

Motorola Mobility LLC

Motorola Mobility LLC, 222 W. Merchandise Mart Plaza, Chicago, Illinois 60654, United

States

Tel: 847-687-6928

Declaration - MIF for HAC RF Interference Evaluation

To whom it may concern:

This device, with FCC ID: **IHDT56WK4**, Hearing Aid Compatibility Requirement is going to be certified under ANSI C63.19 2011 version per Part 20.19.

For Radio Frequency Interference, Speag's Audio Interference Analyzer (AIA) or other indirect or direct measurement was not used to determine the M rating.

The M rating was determined by measuring the maximum steady state average E-field values in dB (V/m) or average antenna input power as documented in HAC test report exhibit, and adding the MIF value in dB. The MIF values below for the worst-case operation mode for all air interfaces are pre-determined values provided by Speag.


UID	Communication System Name	MIF(dB)
10021	GSM-FDD(TDMA,GMSK)	3.63
10011	UMTS-FDD(WCDMA)	-27.23
10100	LTE-FDD(SC-FDMA,100%RB,20MHz,QPSK)	-23.48
10101	LTE-FDD(SC-FDMA,100%RB,20MHz,16-QAM)	-17.86
10102	LTE-FDD(SC-FDMA,100%RB,20MHz,64-QAM)	-17.05
10108	LTE-FDD(SC-FDMA,100%RB,10MHz,QPSK)	-21.57
10109	LTE-FDD(SC-FDMA,100%RB,10MHz,16-QAM)	-16.87
10112	LTE-FDD(SC-FDMA,100%RB,10MHz,64-QAM)	-16.34
10110	LTE-FDD(SC-FDMA,100%RB,5MHz,QPSK)	-23.39
10111	LTE-FDD(SC-FDMA,100%RB,5MHz,16-QAM)	-16.35
10113	LTE-FDD(SC-FDMA,100%RB,5MHz,64-QAM)	-15.98

10139	LTE-FDD(SC-FDMA,100%RB,15MHz,QPSK)	-18.25
10140	LTE-FDD(SC-FDMA,100%RB,15MHz,16-QAM)	-19.37
10141	LTE-FDD(SC-FDMA,100%RB,15MHz,64-QAM)	-19.44
10142	LTE-FDD(SC-FDMA,100%RB,3MHz,QPSK)	-22.36
10143	LTE-FDD(SC-FDMA,100%RB,3MHz,16-QAM)	-14.75
10144	LTE-FDD(SC-FDMA,100%RB,3MHz,64-QAM)	-15.02
10145	LTE-FDD(SC-FDMA,100%RB,1.4MHz,QPSK)	-17.39
10146	LTE-FDD(SC-FDMA,100%RB,1.4MHz,16-QAM)	-13.60
10147	LTE-FDD(SC-FDMA,100%RB,1.4MHz,64-QAM)	-13.90
10148	LTE-FDD(SC-FDMA,50%RB,20MHz,QPSK)	-18.28
10149	LTE-FDD(SC-FDMA,50%RB,20MHz,16-QAM)	-16.87
10150	LTE-FDD(SC-FDMA,50%RB,20MHz,64-QAM)	-16.33
10154	LTE-FDD(SC-FDMA,50%RB,10MHz,QPSK)	-23.42
10155	LTE-FDD(SC-FDMA,50%RB,10MHz,16-QAM)	-16.36
10158	LTE-FDD(SC-FDMA,50%RB,10MHz,64-QAM)	-15.99
10156	LTE-FDD(SC-FDMA,50%RB,5MHz,QPSK)	-21.71
10157	LTE-FDD(SC-FDMA,50%RB,5MHz,16-QAM)	-15.78
10159	LTE-FDD(SC-FDMA,50%RB,5MHz,64-QAM)	-14.49
10160	LTE-FDD(SC-FDMA,50%RB,15MHz,QPSK)	-17.95
10161	LTE-FDD(SC-FDMA,50%RB,15MHz,16-QAM)	-17.54
10162	LTE-FDD(SC-FDMA,50%RB,15MHz,64-QAM)	-17.63
10163	LTE-FDD(SC-FDMA,50%RB,3MHz,QPSK)	-19.99
10164	LTE-FDD(SC-FDMA,50%RB,3MHz,16-QAM)	-14.41
10300	LTE-FDD(SC-FDMA,50%RB,3MHz,64-QAM)	-13.14
10166	LTE-FDD(SC-FDMA,50%RB,1.4MHz,QPSK)	-18.1
10167	LTE-FDD(SC-FDMA,50%RB,1.4MHz,16-QAM)	-12.15
10168	LTE-FDD(SC-FDMA,50%RB,1.4MHz,64-QAM)	-12.10

10169	LTE-FDD(SC-FDMA,1RB,20MHz,QPSK)	-15.63
10170	LTE-FDD(SC-FDMA,1RB,20MHz,16-QAM)	-9.76
10171	LTE-FDD(SC-FDMA,1RB,20MHz,64-QAM)	-9.93
10175	LTE-FDD(SC-FDMA,1RB,10MHz,QPSK)	-15.63
10176	LTE-FDD(SC-FDMA,1RB,10MHz,16-QAM)	-9.76
10179	LTE-FDD(SC-FDMA,1RB,10MHz,64-QAM)	-9.93
10177	LTE-FDD(SC-FDMA,1RB,5MHz,QPSK)	-15.63
10178	LTE-FDD(SC-FDMA,1RB,5MHz,16-QAM)	-9.76
10180	LTE-FDD(SC-FDMA,1RB,5MHz,64-QAM)	-9.93
10181	LTE-FDD(SC-FDMA,1RB,15MHz,QPSK)	-15.63
10182	LTE-FDD(SC-FDMA,1RB,15MHz,16-QAM)	-9.76
10183	LTE-FDD(SC-FDMA,1RB,15MHz,64-QAM)	-9.93
10184	LTE-FDD(SC-FDMA,1RB,3MHz,QPSK)	-15.62
10185	LTE-FDD(SC-FDMA,1RB,3MHz,16-QAM)	-9.76
10186	LTE-FDD(SC-FDMA,1RB,3MHz,64-QAM)	-9.93
10187	LTE-FDD(SC-FDMA,1RB,1.4MHz,QPSK)	-15.62
10188	LTE-FDD(SC-FDMA,1RB,1.4MHz,16-QAM)	-9.76
10189	LTE-FDD(SC-FDMA,1RB,1.4MHz,64-QAM)	-9.93

We are confirming that the Speag simulation provided represents all the air interface modes applicable for a HAC rating for this handset.

Sincerely,

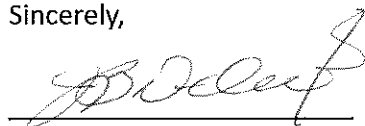

Jeff Narducci

narducci@motorola.com