



	Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>1(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

## **Annex A: Probe sensitivity and reference signal measurement plots**

Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>	FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>
-------------------------------------	---	---------------------------------------	--

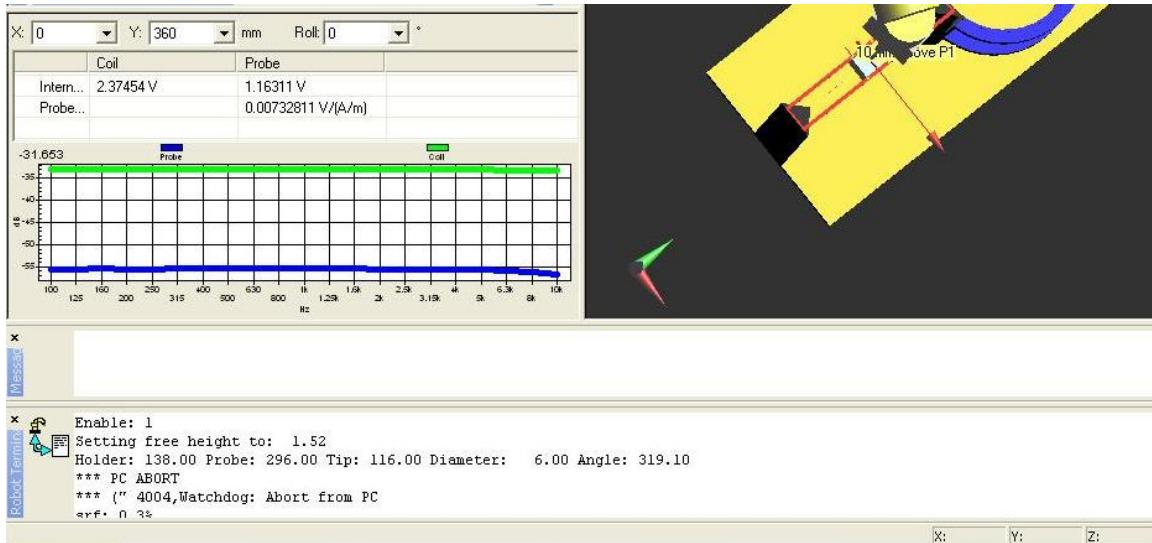


**Figure A1: Probe calibration data for coil and probe**

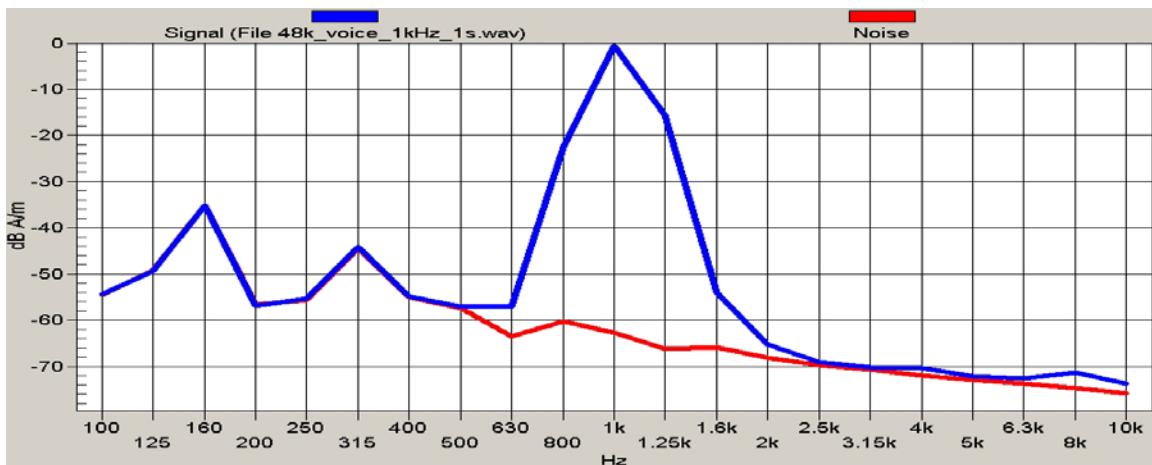

**Figure A2: Reference voice 1 kHz signal and noise**

<b>RIM Testing Services™</b>	Document Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model <b>RDM71UW/REN71UW</b>	Page <b>3(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

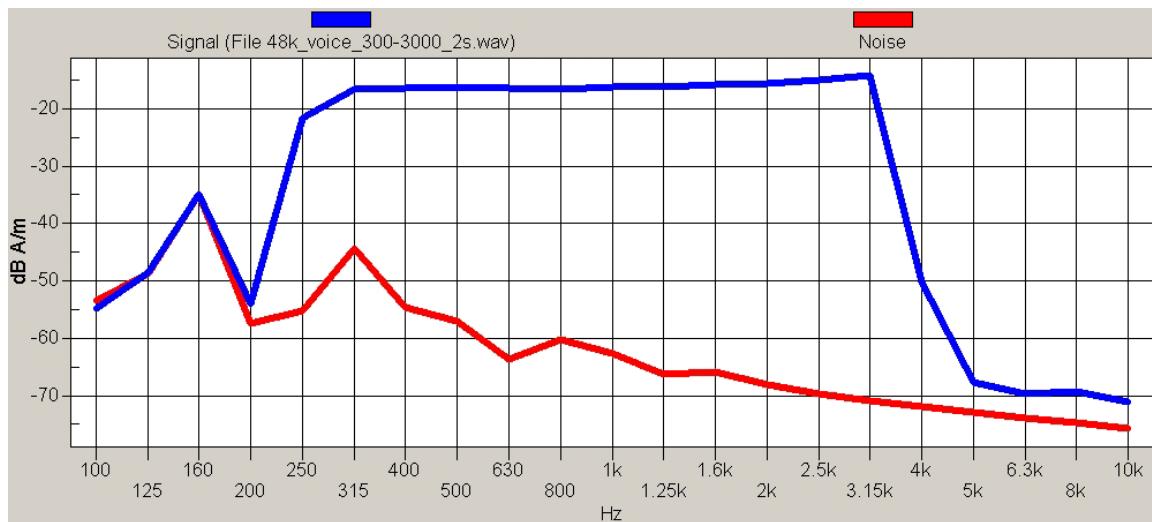

**Figure A3: Reference voice simulated signal and noise**

	<p>Document  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>	<p>Page  <b>4(173)</b></p>
<p>Author Data  <b>Andrew Becker</b></p>	<p>Dates of Test  <b>Mar. 09-10, May 27, July 12, 2011</b></p>	<p>Report No  <b>RTS-3640-1103-10B</b></p>

**Annex B: TMFS system validation and ambient data/plots**

 <p>Document  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			Page <b>5(173)</b>
<p>Author Data  <b>Andrew Becker</b></p>	<p>Dates of Test  <b>Mar. 09-10, May 27, July 12, 2011</b></p>	<p>Report No  <b>RTS-3640-1103-10B</b></p>	<p>FCC ID  <b>L6ARDM70UW</b>  <b>L6AREN70UW</b></p>

Date/Time: 3/9/2011 10:27:03 AM, Date/Time: 3/9/2011 10:27:38 AM

Test Laboratory: RIM Testing Services

HAC T-Coil TMFS\_validation

**DUT: TMFS; Type: TMFS-1**

Communication System: CW; Frequency: 835 MHz; Communication System

PAR: 0 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 1$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
  - Modulation Compensation:
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/Background Noise/z (axial) noise/ABM [HAC-2007] Noise Spectrum(x,y,z,f) (1x1x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Off

Output Gain: 0

Measure Window Start: 2000ms

Measure Window Length: 5000ms

Device Reference Point: 0, 0, -6.3 mm

	Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>6(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

**Cursor:**

ABM = -48.99 dB A/m

Location: 0, 0, 13 mm

**T-Coil scan/Background Noise/x (longitudinal) noise/ABM  
[HAC-2007] Noise Spectrum(x,y,z,f) (1x1x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Off

Output Gain: 0

Measure Window Start: 2000ms

Measure Window Length: 5000ms

Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

ABM = -49.02 dB A/m

Location: 0, 0, 13 mm

**T-Coil scan/Background Noise/y (transversal) noise/ABM  
[HAC-2007] Noise Spectrum(x,y,z,f) (1x1x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Off

Output Gain: 0

Measure Window Start: 2000ms

Measure Window Length: 5000ms

Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

ABM = -49.00 dB A/m

Location: 0, 0, 13 mm

**T-Coil scan/TMFS Validation/z (axial) 8 x 8 step 2/ABM  
[HAC-2007] Interpolated Signal(x,y,z) (41x41x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: 1 kHz Sine

Output Gain: 35.05

Measure Window Start: 0ms

Measure Window Length: 1000ms

BWC applied: -0.01 dB

Device Reference Point: 0, 0, -6.3 mm

 <p>Document  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			Page <b>7(173)</b>
<p>Author Data  <b>Andrew Becker</b></p>	<p>Dates of Test  <b>Mar. 09-10, May 27, July 12, 2011</b></p>	<p>Report No  <b>RTS-3640-1103-10B</b></p>	<p>FCC ID  <b>L6ARDM70UW</b>  <b>L6AREN70UW</b></p>

**Cursor:**

ABM1 = -20.63 dB A/m  
 BWC Factor = -0.01 dB  
 Location: -0.4, 0.8, 3.7 mm

**T-Coil scan/TMFS Validation/x (longitudinal) 52 x 16 step  
 4/ABM [HAC-2007] Interpolated Signal(x,y,z) (131x41x1):**

Measurement grid: dx=10mm, dy=10mm  
 Signal Type: 1 kHz Sine  
 Output Gain: 35.05  
 Measure Window Start: 0ms  
 Measure Window Length: 1000ms  
 BWC applied: -0.01 dB  
 Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

ABM1 = -26.02 dB A/m  
 BWC Factor = -0.01 dB  
 Location: -20.4, -0.4, 3.7 mm

**T-Coil scan/TMFS Validation/y (transversal) 16 x 52 step  
 4/ABM [HAC-2007] Interpolated Signal(x,y,z) (41x131x1):**

Measurement grid: dx=10mm, dy=10mm  
 Signal Type: 1 kHz Sine  
 Output Gain: 35.05  
 Measure Window Start: 0ms  
 Measure Window Length: 1000ms  
 BWC applied: -0.01 dB  
 Device Reference Point: 0, 0, -6.3 mm


**Cursor:**

ABM1 = -26.30 dB A/m  
 BWC Factor = -0.01 dB  
 Location: -0.8, -17.2, 3.7 mm



**T-Coil scan/TMFS Validation/z (axial) at center 100%  
 gain/ABM [HAC-2007] Freq Resp(x,y,z,f) (1x1x1):**

Measurement grid: dx=10mm, dy=10mm  
 Signal Type: Audio File (.wav) 48k\_multisine\_50\_10k\_10s.wav  
 Output Gain: 87.2  
 Measure Window Start: 2000ms  
 Measure Window Length: 5000ms  
 BWC applied: 13.14 dB  
 Device Reference Point: 0, 0, -6.3 mm



 <b>RIM Testing Services™</b>	Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>8(173)</b>
<b>Author Data</b>	<b>Dates of Test</b>	<b>Report No</b>
<b>Andrew Becker</b>	<b>Mar. 09-10, May 27, July 12, 2011</b>	<b>RTS-3640-1103-10B</b>
		<b>FCC ID</b>
		<b>L6ARDM70UW</b>
		<b>L6AREN70UW</b>

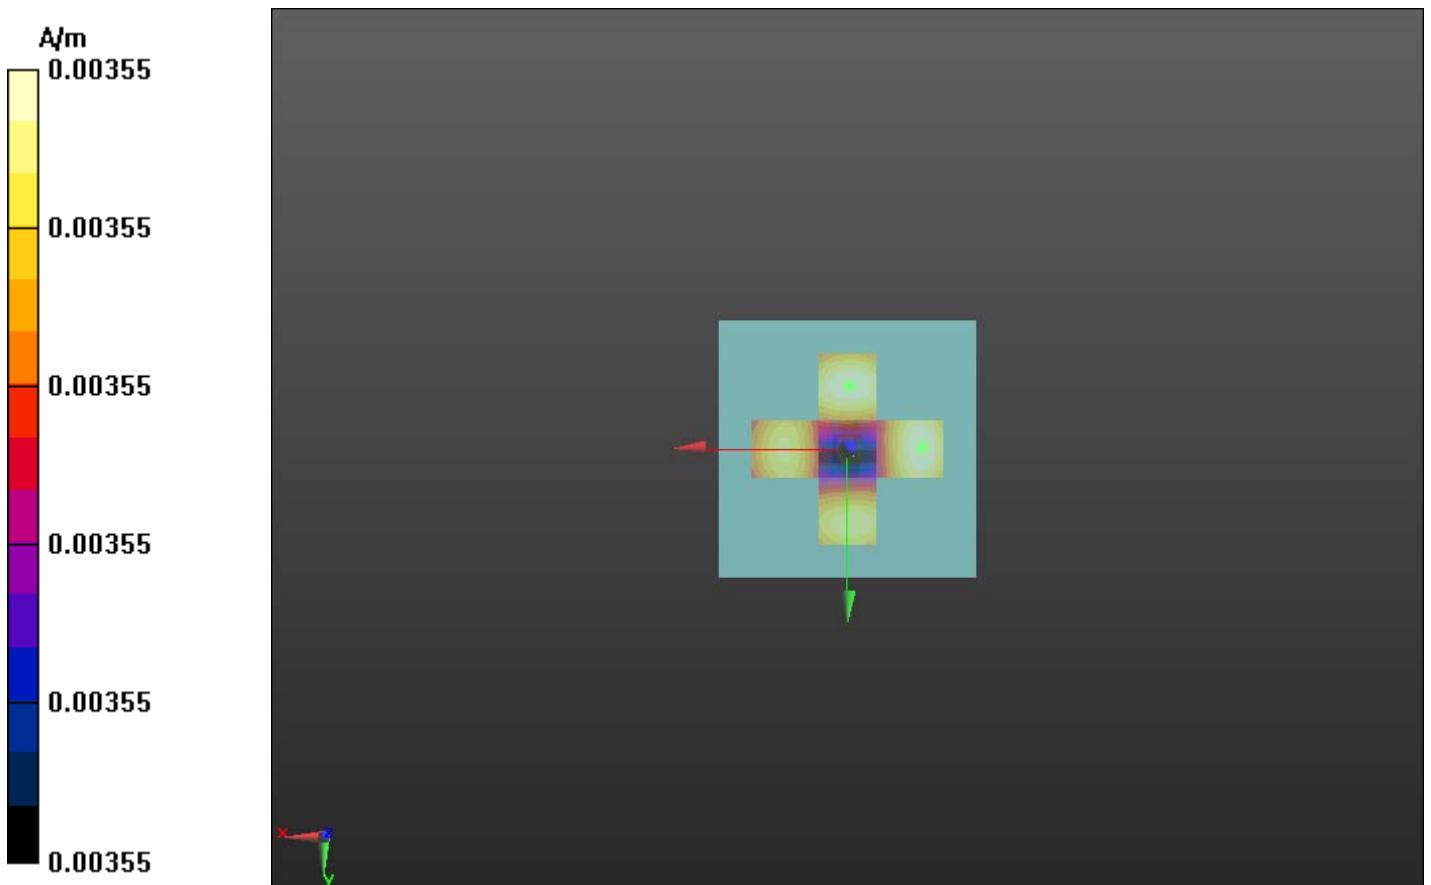

Document Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW	Page 9(173)
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b> Report No <b>RTS-3640-1103-10B</b> FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

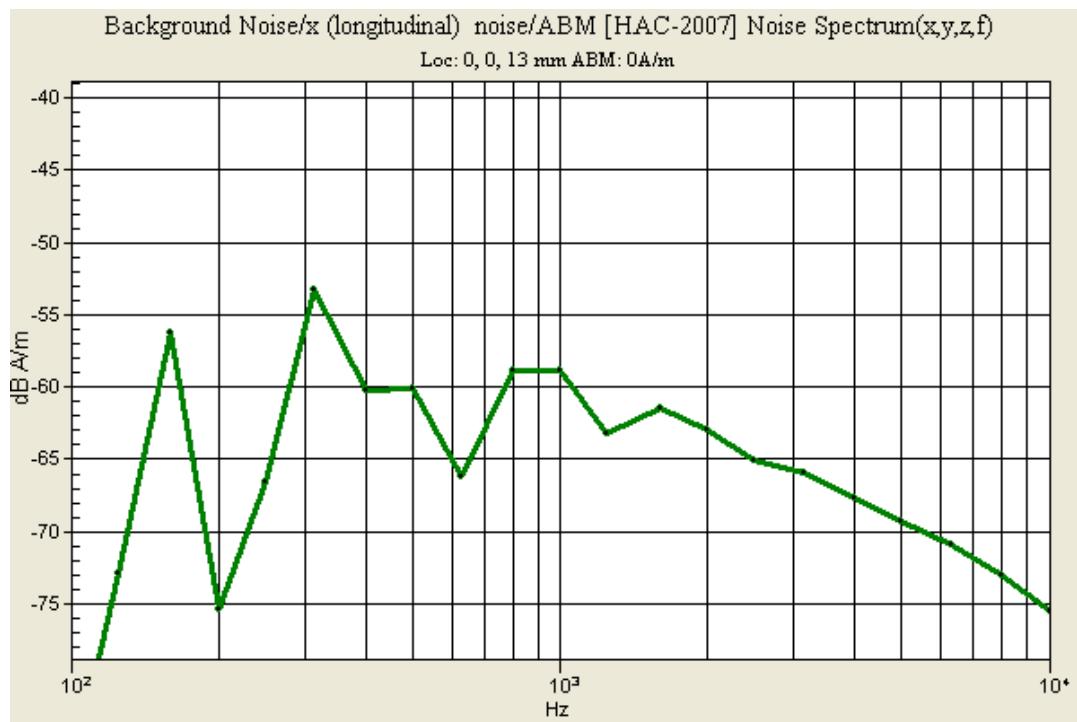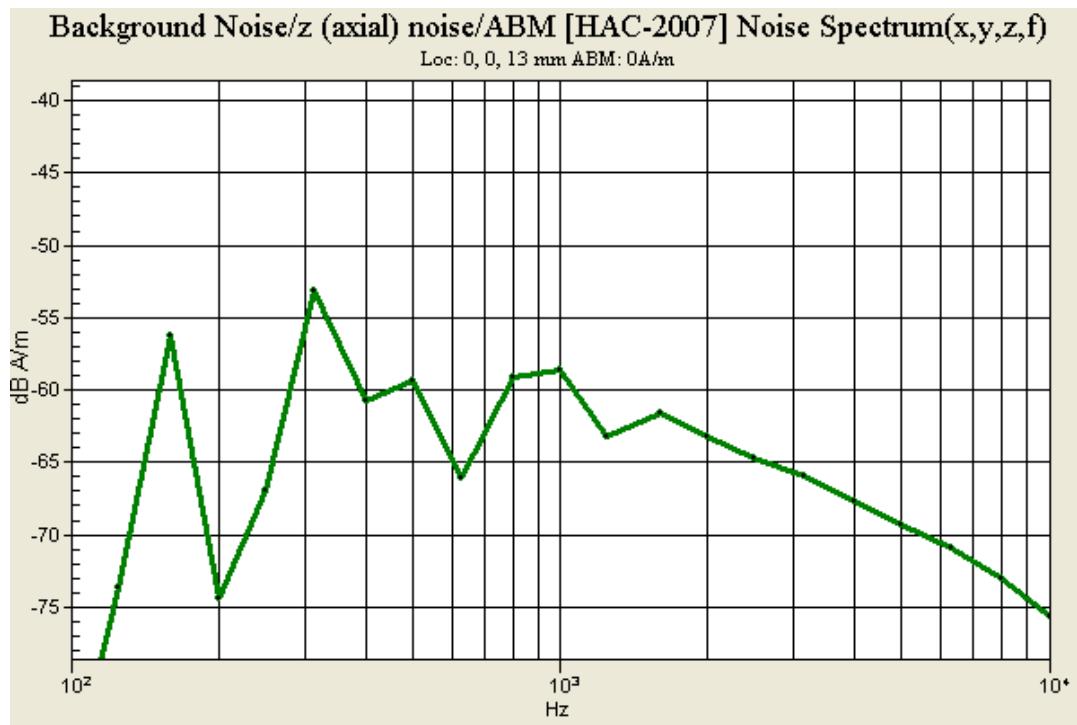

Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>	FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>
-------------------------------------	---	---------------------------------------	--

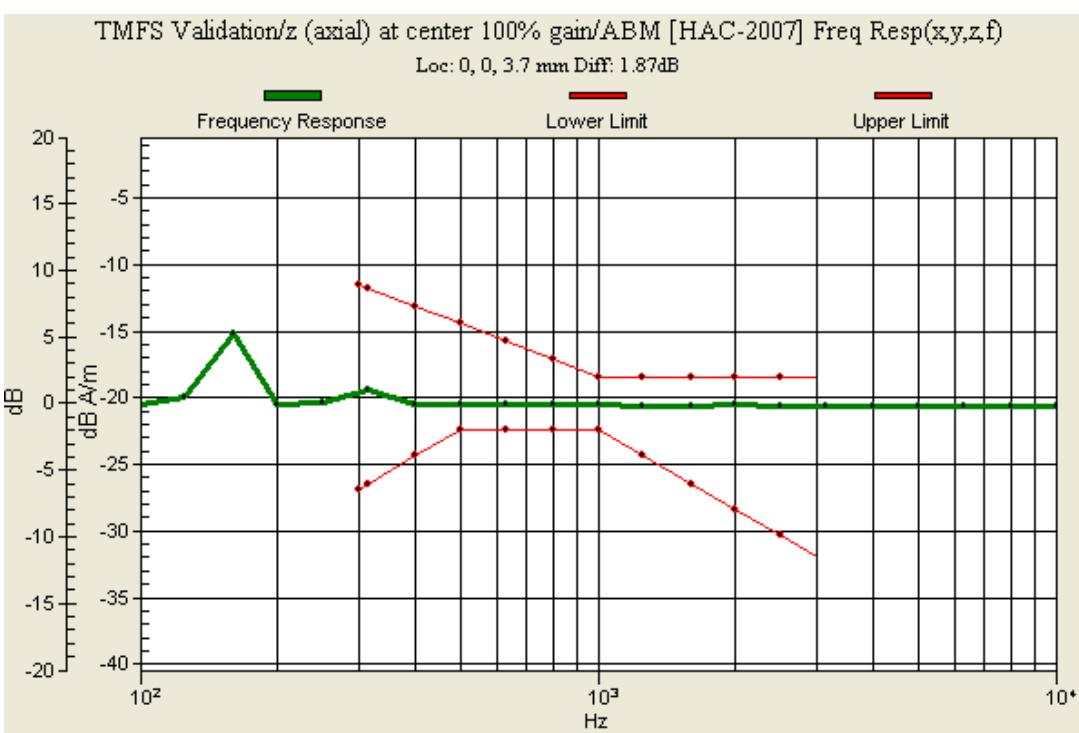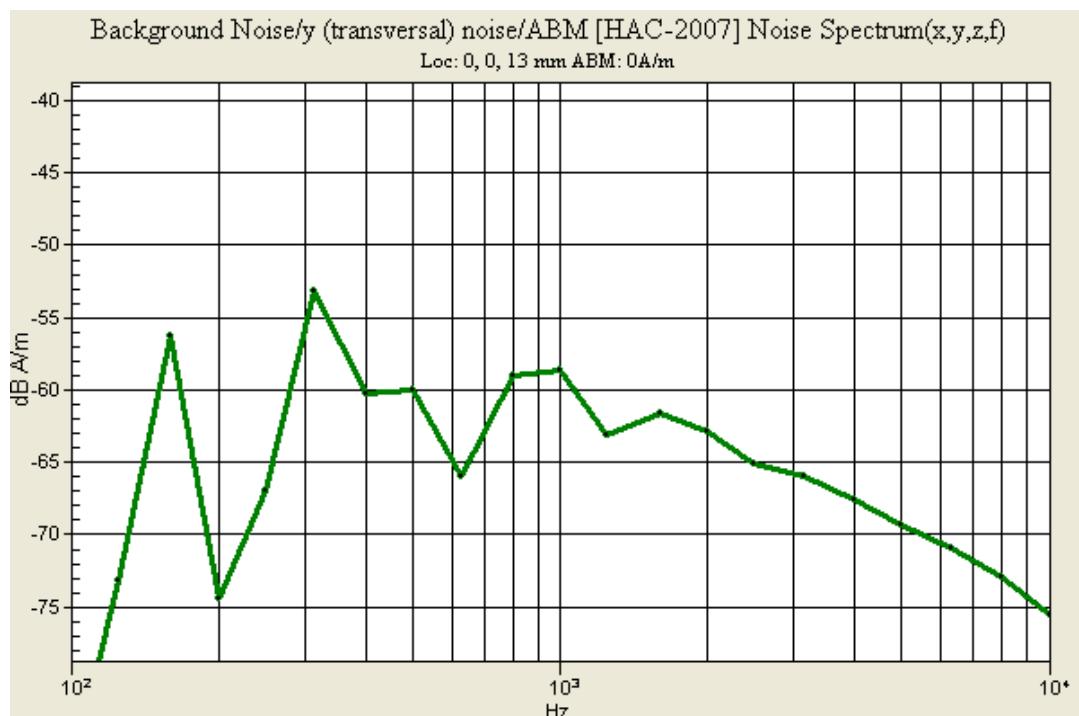

	Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>11(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

Date/Time: 5/27/2011 9:29:30 AM

Test Laboratory: RIM Testing Services

HAC T-Coil TMFS\_validation\_ambient noise

**DUT: TMFS; Type: TMFS-1**

Communication System: CW; Frequency: 835 MHz; Communication System

PAR: 0 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 4/7/2011
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE3 Sn472; Calibrated: 3/7/2011
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/Background Noise/z noise in AMCC (no signal should appear)/ABM [HAC-2007] Noise(x,y,z) (1x1x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Off

Output Gain: 0

Measure Window Start: 2000ms

Measure Window Length: 5000ms

Device Reference Point: 0, 0, -6.3 mm

 <p>Document  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			Page <b>12(173)</b>
<b>Author Data</b> <b>Andrew Becker</b>	<b>Dates of Test</b> <b>Mar. 09-10, May 27, July 12, 2011</b>	<b>Report No</b> <b>RTS-3640-1103-10B</b>	<b>FCC ID</b> <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

**Cursor:**

ABM2 = -50.68 dB A/m  
 Location: 0, 360, -262 mm

**T-Coil scan/Background Noise/z (axial) noise/ABM [HAC-2007]**

**Noise(x,y,z) (1x1x1):**

Measurement grid: dx=10mm, dy=10mm  
 Signal Type: Off  
 Output Gain: 0  
 Measure Window Start: 2000ms  
 Measure Window Length: 5000ms  
 Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

ABM2 = -50.69 dB A/m  
 Location: 0, 0, 13 mm

**T-Coil scan/Background Noise/x (longitudinal) noise/ABM [HAC-2007] Noise(x,y,z) (1x1x1):**

Measurement grid: dx=10mm, dy=10mm  
 Signal Type: Off  
 Output Gain: 0  
 Measure Window Start: 2000ms  
 Measure Window Length: 5000ms  
 Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

ABM2 = -50.66 dB A/m  
 Location: 0, 0, 13 mm

**T-Coil scan/Background Noise/y (transversal) noise/ABM [HAC-2007] Noise(x,y,z) (1x1x1):**

Measurement grid: dx=10mm, dy=10mm  
 Signal Type: Off  
 Output Gain: 0  
 Measure Window Start: 2000ms  
 Measure Window Length: 5000ms  
 Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

ABM2 = -50.63 dB A/m  
 Location: 0, 0, 13 mm

 <p>Document  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			Page <b>13(173)</b>
<p>Author Data  <b>Andrew Becker</b></p>	<p>Dates of Test  <b>Mar. 09-10, May 27, July 12, 2011</b></p>	<p>Report No  <b>RTS-3640-1103-10B</b></p>	<p>FCC ID  <b>L6ARDM70UW</b>  <b>L6AREN70UW</b></p>

**T-Coil scan/TMFS Validation/z (axial) 8 x 8 step 2/ABM  
 [HAC-2007] Signal(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm  
 Signal Type: 1 kHz Sine  
 Output Gain: 35.05  
 Measure Window Start: 0ms  
 Measure Window Length: 1000ms  
 BWC applied: -0.0062 dB  
 Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

ABM1 comp = -20.69 dB A/m  
 BWC Factor = -0.0062 dB  
 Location: 0, 2, 3.7 mm

**T-Coil scan/TMFS Validation/x (longitudinal) 52 x 16 step 4/ABM [HAC-2007] Signal(x,y,z) (14x5x1):**

Measurement grid: dx=10mm, dy=10mm  
 Signal Type: 1 kHz Sine  
 Output Gain: 35.05  
 Measure Window Start: 0ms  
 Measure Window Length: 1000ms  
 BWC applied: -0.0062 dB  
 Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

ABM1 comp = -26.15 dB A/m  
 BWC Factor = -0.0062 dB  
 Location: -18, 0, 3.7 mm

**T-Coil scan/TMFS Validation/y (transversal) 16 x 52 step 4/ABM [HAC-2007] Signal(x,y,z) (5x14x1):**

Measurement grid: dx=10mm, dy=10mm  
 Signal Type: 1 kHz Sine  
 Output Gain: 35.05  
 Measure Window Start: 0ms  
 Measure Window Length: 1000ms  
 BWC applied: -0.0062 dB  
 Device Reference Point: 0, 0, -6.3 mm

Author Data  
**Andrew Becker**

Dates of Test

**Mar. 09-10, May 27, July 12, 2011**

Report No

**RTS-3640-1103-10B**

FCC ID

**L6ARDM70UW**
**L6AREN70UW**
**Cursor:**

ABM1 comp = -26.19 dB A/m

BWC Factor = -0.0062 dB

Location: 0, -18, 3.7 mm

**T-Coil scan/TMFS Validation/z (axial) at center 100% gain/ABM [HAC-2007] Freq Resp(x,y,z,f) (1x1x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_multisine\_50\_10k\_10s.wav

Output Gain: 87.2

Measure Window Start: 2000ms

Measure Window Length: 5000ms

BWC applied: 13.14 dB


Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

Diff = 1.91 dB


BWC Factor = 13.14 dB

Location: 0, 0, 3.7 mm

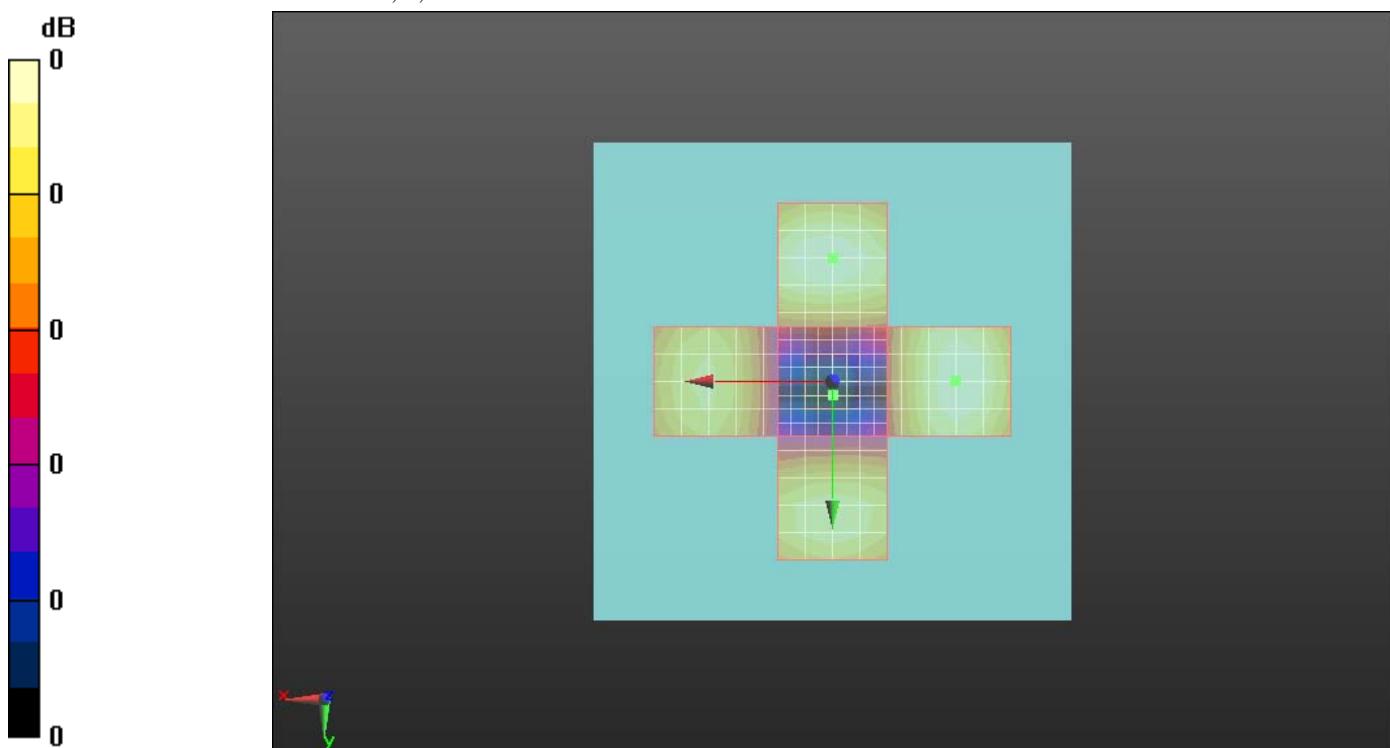

Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>	FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>
-------------------------------------	---	---------------------------------------	--



**Background Noise/z (axial) noise/ABM [HAC-2007] Noise Spectrum(x,y,z,f)**  
Loc: 0, 0, 13 mm ABM: 0A/m

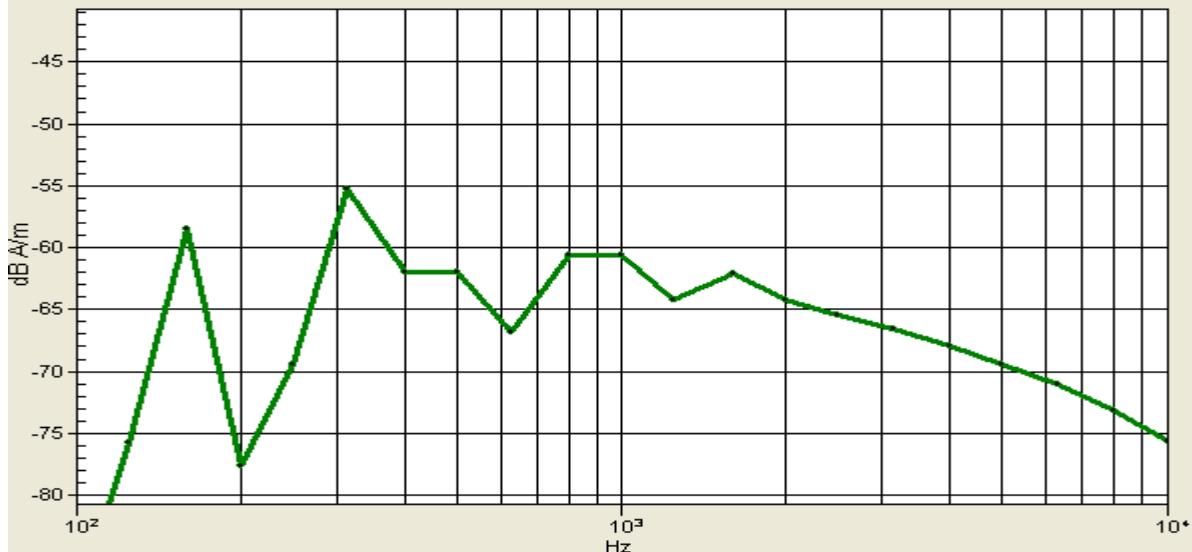

**Background Noise/x (longitudinal) noise/ABM [HAC-2007] Noise Spectrum(x,y,z,f)**  
Loc: 0, 0, 13 mm ABM: 0A/m



Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>	FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>
-------------------------------------	---	---------------------------------------	--

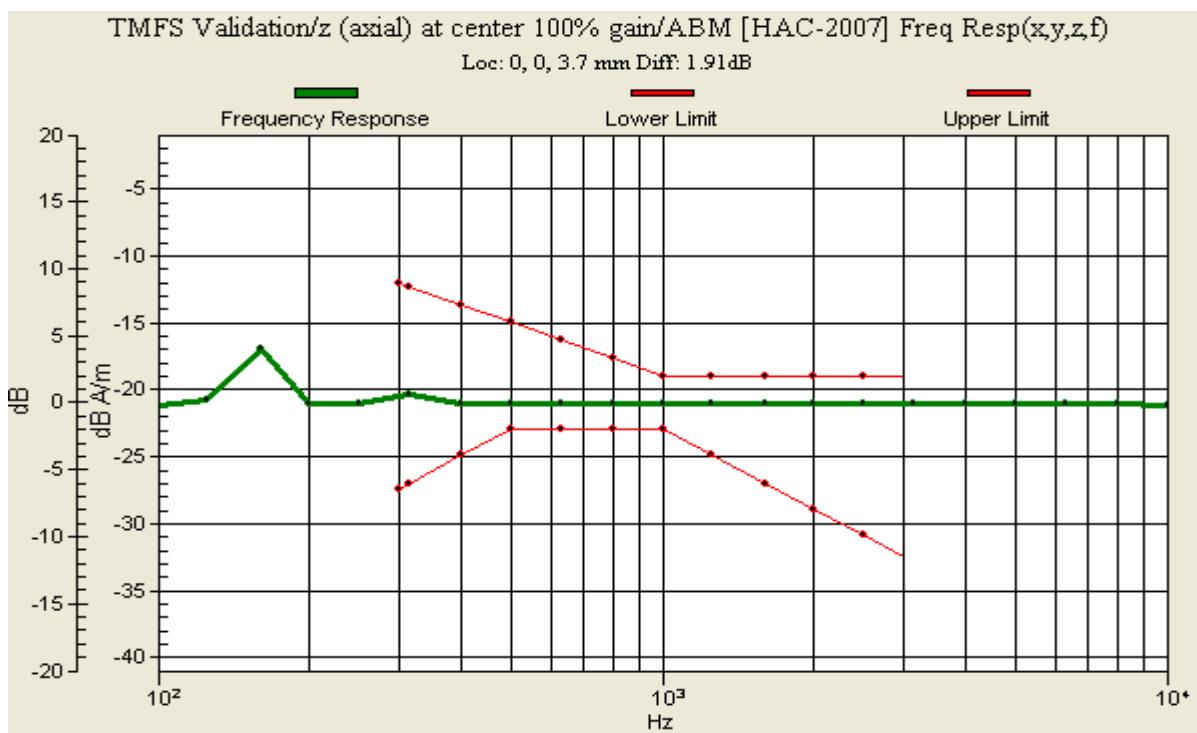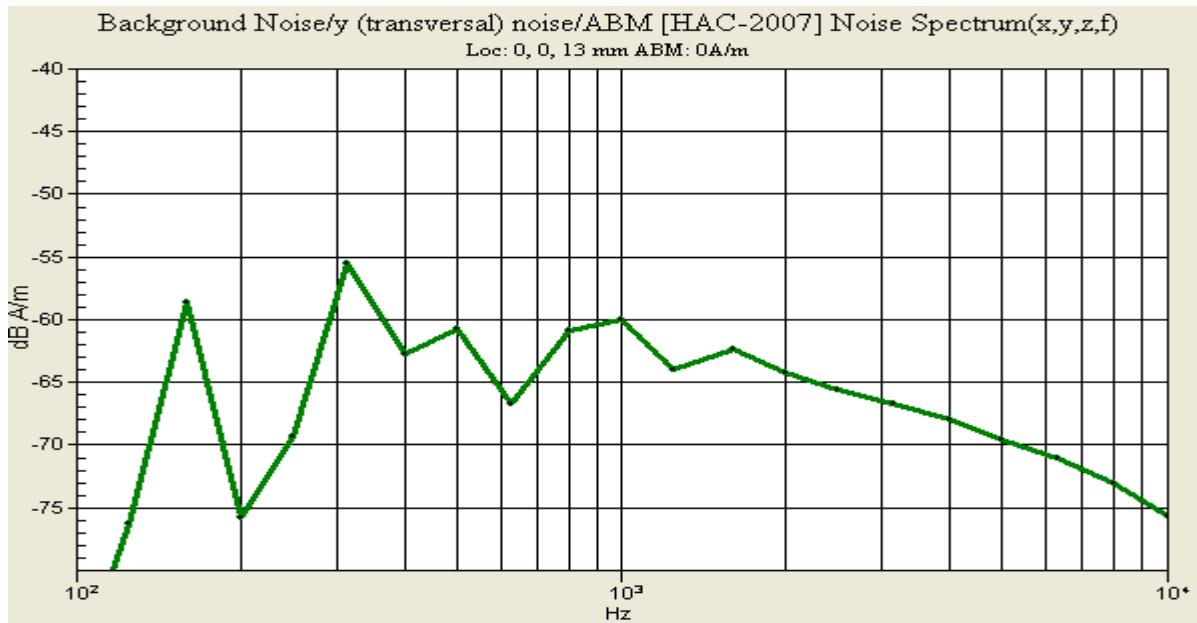

	<b>Document Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	<b>Page 17(173)</b>	
<b>Author Data</b> <b>Andrew Becker</b>	<b>Dates of Test</b> <b>Mar. 09-10, May 27, July 12, 2011</b>	<b>Report No</b> <b>RTS-3640-1103-10B</b>	<b>FCC ID</b> <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

### **Annex C: Audio Band Magnetic measurement data and plots**

 <p><b>Document</b>  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			<b>Page</b> <b>18(173)</b>
<b>Author Data</b> <b>Andrew Becker</b>	<b>Dates of Test</b> <b>Mar. 09-10, May 27, July 12, 2011</b>	<b>Report No</b> <b>RTS-3640-1103-10B</b>	<b>FCC ID</b> <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

Date/Time: 3/9/2011 2:14:49 PM

**Test Laboratory: RIM Testing Services**

**HAC T-Coil\_GSM850\_Slide\_Closed\_axial**

**DUT: BlackBerry; Type: Sample**

**Communication System: GSM 850; Communication System Band: Exported from older format (data unavailable - please correct).; Frequency: 824.2 MHz, Frequency: 836.8 MHz, Frequency: 848.8 MHz; Communication System PAR: 9.191 dB**

**Medium parameters used:  $\sigma = 0 \text{ mho/m}$ ,  $\epsilon_r = 1$ ;  $\rho = 0 \text{ kg/m}^3$**

**Phantom section: TCoil Section**

**Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)**

**DASY5 Configuration:**

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/z (axial) 5.0mm 50 x 50/ABM [HAC-2007] SNR(x,y,z) (11x11x1):**

**Measurement grid: dx=10mm, dy=10mm**

**Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav**

**Output Gain: 35.28**

**Measure Window Start: 300ms**

 <p>Document  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			Page <b>19(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>	FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**T-Coil scan/General Scans 2/z (axial) wideband at best S/N  
 2/ABM [HAC-2007] Freq Resp(x,y,z,f) (1x1x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_300-3000\_2s.wav

Output Gain: 69.12

Measure Window Start: 2000ms

Measure Window Length: 4000ms

BWC applied: 10.78 dB

Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

Diff = 2.00 dB

BWC Factor = 10.78 dB

Location: -5, -15, 3.7 mm

**T-Coil scan/General Scans 2 2/z (axial) 2mm 8 x 8/ABM  
 [HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

ABM1/ABM2 = 48.71 dB

ABM1 comp = 7.06 dB A/m

BWC Factor = 0.14 dB

Location: -5, -17, 4.4 mm

**T-Coil scan/General Scans 2/z (axial) 2mm 8 x 8/ABM [HAC-2007]  
 SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

 <p>Document  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			Page <b>20(173)</b>
<p>Author Data  <b>Andrew Becker</b></p>	<p>Dates of Test  <b>Mar. 09-10, May 27, July 12, 2011</b></p>	<p>Report No  <b>RTS-3640-1103-10B</b></p>	<p>FCC ID  <b>L6ARDM70UW</b>  <b>L6AREN70UW</b></p>

**Cursor:**

ABM1/ABM2 = 48.92 dB  
 ABM1 comp = 7.08 dB A/m  
 BWC Factor = 0.14 dB  
 Location: -5, -17, 4.4 mm

**T-Coil scan/General Scans 2 2/z (axial) wideband at best S/N 2/ABM [HAC-2007] Freq Resp(x,y,z,f) (1x1x1):**

Measurement grid: dx=10mm, dy=10mm  
 Signal Type: Audio File (.wav) 48k\_voice\_300-3000\_2s.wav  
 Output Gain: 69.12  
 Measure Window Start: 2000ms  
 Measure Window Length: 4000ms  
 BWC applied: 10.78 dB  
 Device Reference Point: 0, 0, -6.3 mm

**T-Coil scan/General Scans 2 2/z (axial) 2mm 8 x 8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm  
 Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav  
 Output Gain: 35.28  
 Measure Window Start: 300ms  
 Measure Window Length: 1000ms  
 BWC applied: 0.14 dB  
 Device Reference Point: 0, 0, -6.3 mm



**Cursor:**

ABM1/ABM2 = 48.69 dB  
 ABM1 comp = 7.16 dB A/m  
 BWC Factor = 0.14 dB  
 Location: -5, -17, 4.4 mm



**T-Coil scan/General Scans 2 2/z (axial) wideband at best S/N 2/ABM [HAC-2007] Freq Resp(x,y,z,f) (1x1x1):**

Measurement grid: dx=10mm, dy=10mm  
 Signal Type: Audio File (.wav) 48k\_voice\_300-3000\_2s.wav  
 Output Gain: 69.12  
 Measure Window Start: 2000ms  
 Measure Window Length: 4000ms  
 BWC applied: 10.78 dB  
 Device Reference Point: 0, 0, -6.3 mm

Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>	FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>
-------------------------------------	---	---------------------------------------	--

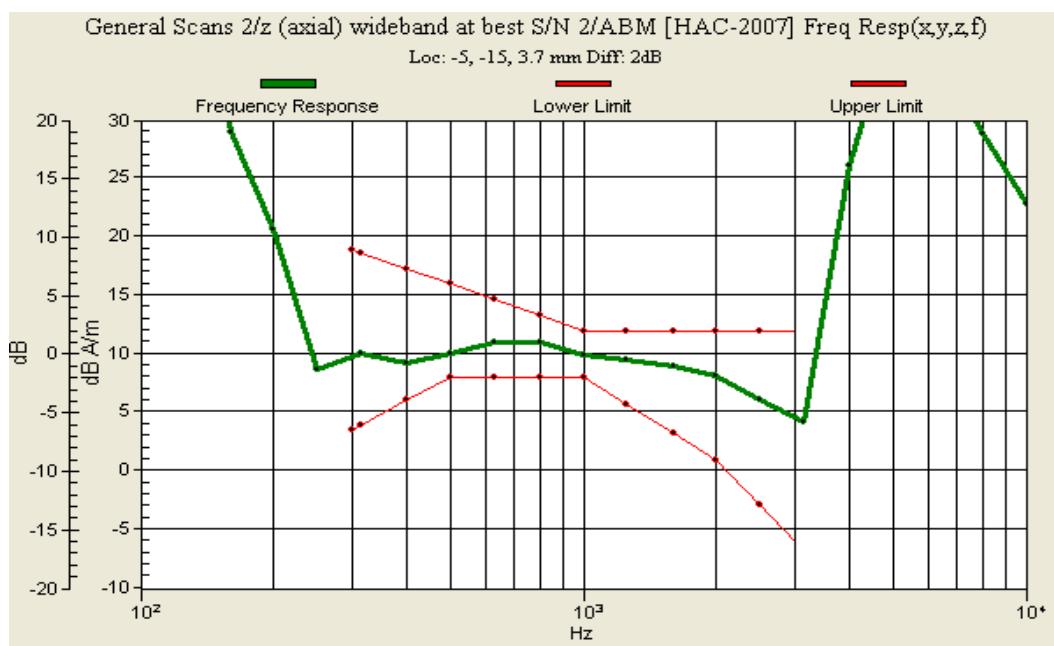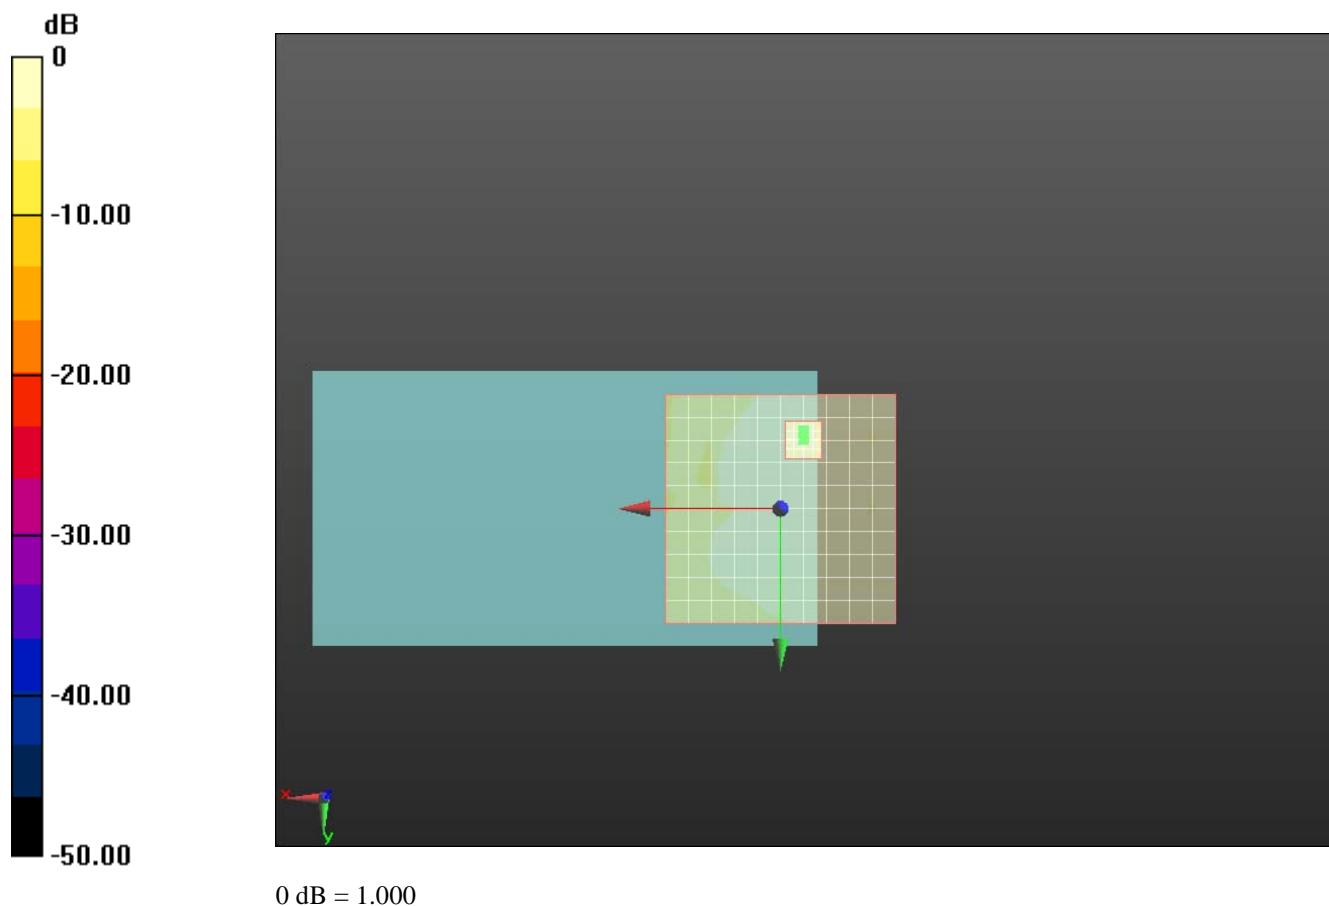

Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>	FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>
-------------------------------------	---	---------------------------------------	--

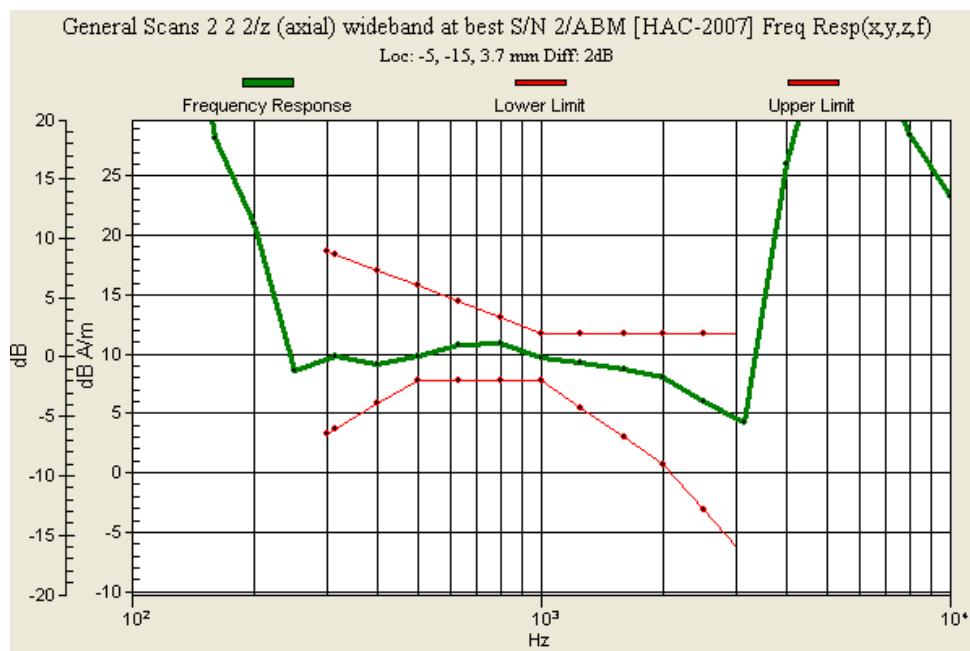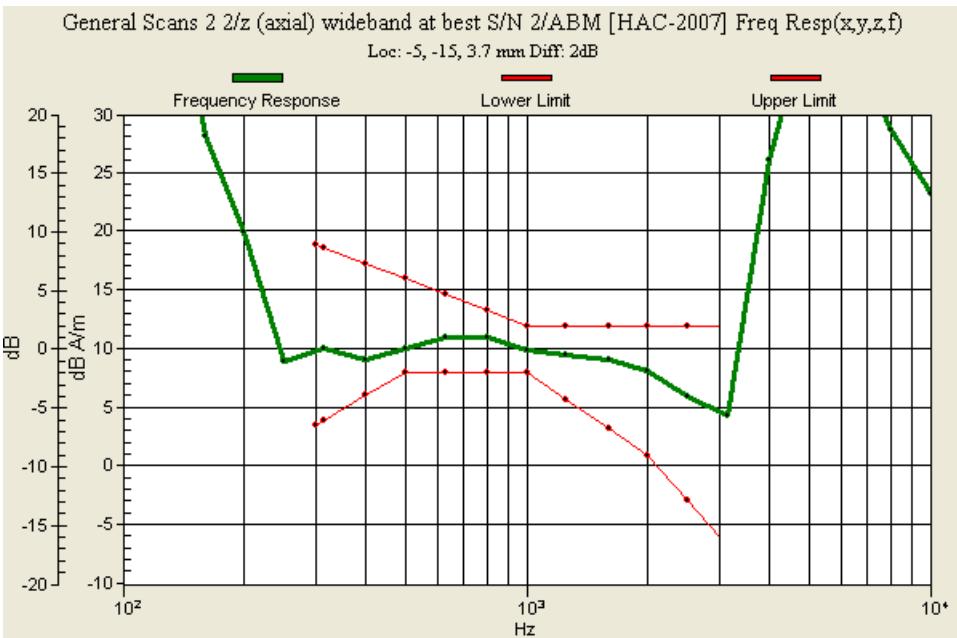

	Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>23(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

Date/Time: 3/9/2011 2:31:23 PM

Test Laboratory: RIM Testing Services

HAC T-Coil\_GSM850\_Slide\_Closed\_radial L

**DUT: BlackBerry; Type: Sample**

Communication System: GSM 850; Communication System Band: Exported from older format (data unavailable - please correct).; Frequency: 824.2 MHz, Frequency: 836.8 MHz, , Frequency: 848.8 MHz; Communication System PAR: 9.191 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/x (longitudinal) 5.0mm 50 x 50/ABM**

**[HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

 <p>Document  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			Page <b>24(173)</b>
<p>Author Data  <b>Andrew Becker</b></p>	<p>Dates of Test  <b>Mar. 09-10, May 27, July 12, 2011</b></p>	<p>Report No  <b>RTS-3640-1103-10B</b></p>	<p>FCC ID  <b>L6ARDM70UW</b>  <b>L6AREN70UW</b></p>

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**T-Coil scan/General Scans 2 2/x (longitudinal) 2mm 8 x 8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

ABM1/ABM2 = 22.57 dB

ABM1 comp = 8.02 dB A/m

BWC Factor = 0.14 dB

Location: -13, -8, 4.4 mm

**T-Coil scan/General Scans 2/x (longitudinal) 2mm 8 x 8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

ABM1/ABM2 = 22.59 dB

ABM1 comp = 7.05 dB A/m

BWC Factor = 0.14 dB

Location: -15, -8, 4.4 mm

**T-Coil scan/General Scans 2 2/x (longitudinal) 2mm 8 x 8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

Author Data  
**Andrew Becker**

Dates of Test


**Mar. 09-10, May 27, July  
12, 2011**

Report No

**RTS-3640-1103-10B**

FCC ID

**L6ARDM70UW  
L6AREN70UW**
**Cursor:**

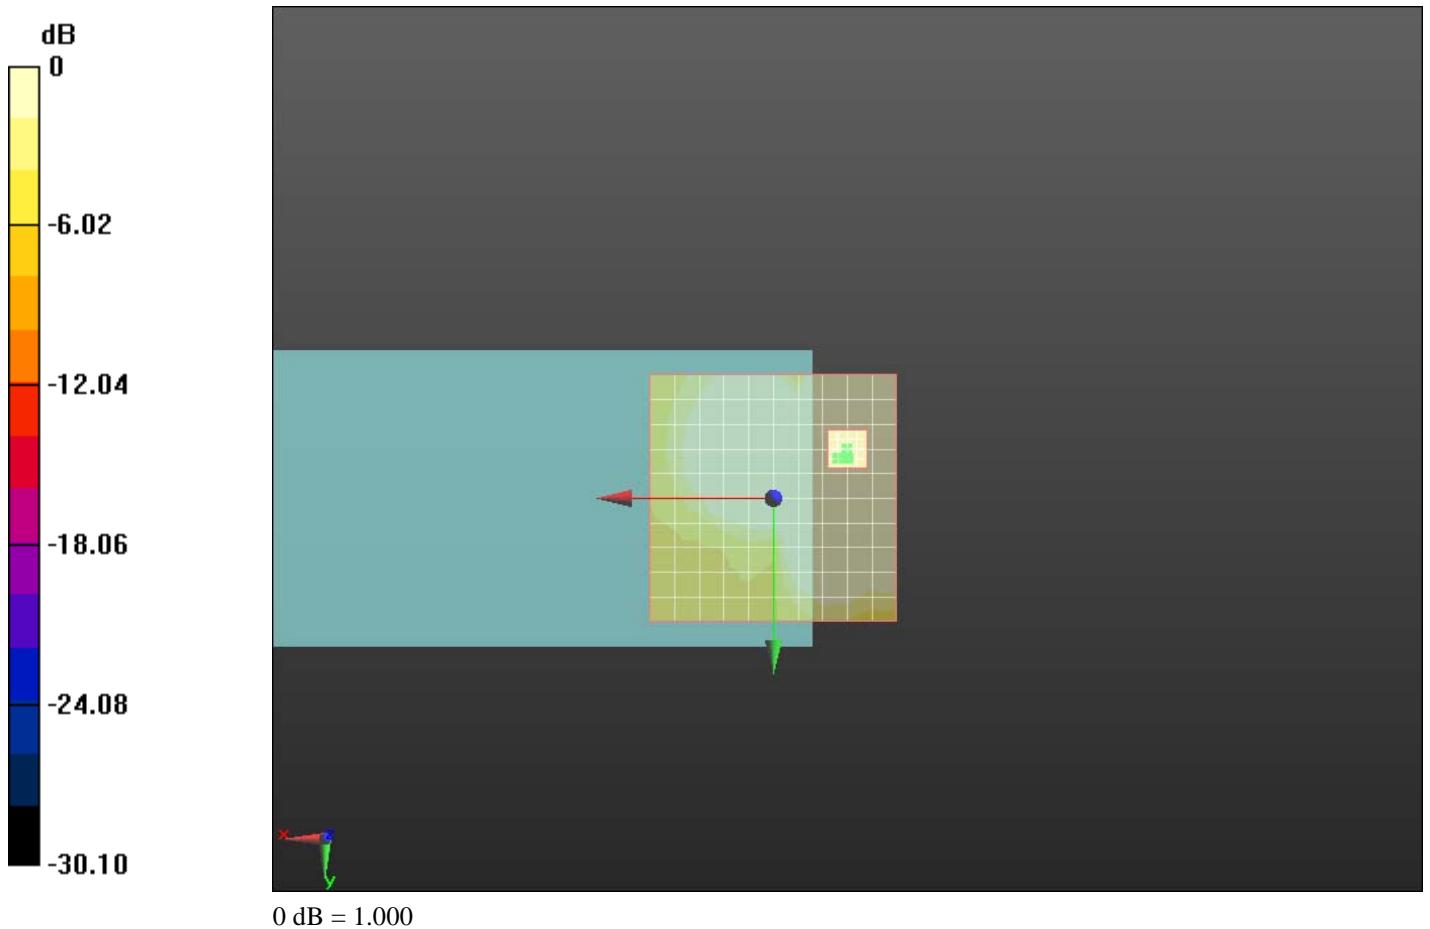 ABM1/ABM2 = 22.56 dB  
 ABM1 comp = 6.88 dB A/m  
 BWC Factor = 0.14 dB  
 Location: -15, -8, 4.4 mm


	Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>26(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

Date/Time: 3/9/2011 2:48:39 PM

Test Laboratory: RIM Testing Services

HAC T-Coil\_GSM850\_Slide\_Closed\_radial T

**DUT: BlackBerry; Type: Sample**

Communication System: GSM 850; Communication System Band: Exported from older format (data unavailable - please correct).; Frequency: 824.2 MHz, Frequency: 836.8 MHz Frequency: 848.8 MHz; Communication System PAR: 9.191 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/y (transversal) 5.0mm 50 x 50/ABM**

**[HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

 <p>Document  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			Page <b>27(173)</b>
<p>Author Data  <b>Andrew Becker</b></p>	<p>Dates of Test  <b>Mar. 09-10, May 27, July 12, 2011</b></p>	<p>Report No  <b>RTS-3640-1103-10B</b></p>	<p>FCC ID  <b>L6ARDM70UW</b>  <b>L6AREN70UW</b></p>

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**T-Coil scan/General Scans 2 2/y (transversal) 2mm 8 x 8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

ABM1/ABM2 = 24.36 dB

ABM1 comp = 7.03 dB A/m

BWC Factor = 0.14 dB

Location: -7, -17, 4.4 mm

**T-Coil scan/General Scans 2/y (transversal) 2mm 8 x 8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

ABM1/ABM2 = 24.42 dB

ABM1 comp = 7.20 dB A/m

BWC Factor = 0.14 dB

Location: -7, -17, 4.4 mm

Author Data  
**Andrew Becker**

Dates of Test

**Mar. 09-10, May 27, July 12, 2011**

Report No

**RTS-3640-1103-10B**

FCC ID

**L6ARDM70UW  
L6AREN70UW**

### T-Coil scan/General Scans 2 2 2/y (transversal) 2mm 8 x 8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm


**Cursor:**

ABM1/ABM2 = 24.36 dB

ABM1 comp = 7.45 dB A/m

BWC Factor = 0.14 dB

Location: -7, -15, 4.4 mm

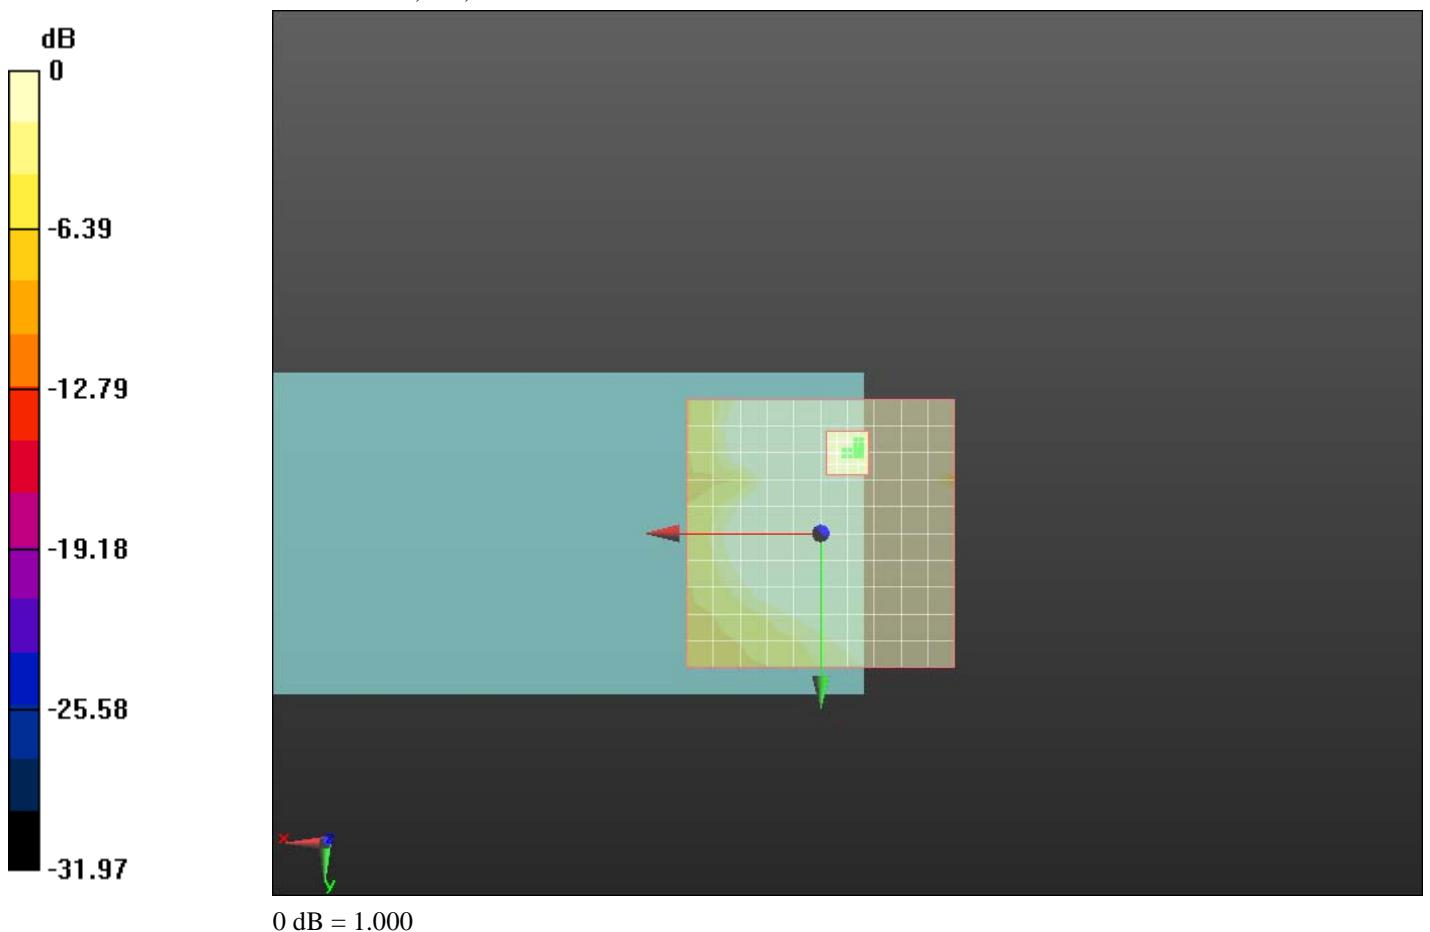

	Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>29(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

Date/Time: 3/9/2011 3:40:00 PM, Date/Time: 3/9/2011 3:57:41 PM, Date/Time:  
3/9/2011 4:36:17 PM

Test Laboratory: RIM Testing Services

HAC T-Coil\_GSM850\_Slide\_Open\_mid\_chan\_Axial

**DUT: BlackBerry Slider Open; Type: Sample**

Communication System: GSM 850; Communication System Band: Exported from older format (data unavailable - please correct).; Frequency: 836.8

MHz;Communication System PAR: 9.191 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/z (axial) 5.0mm 50 x 50/ABM [HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

 <p>Document  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			Page <b>30(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>	FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**T-Coil scan/General Scans 2/z (axial) 2mm 8 x 8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

ABM1/ABM2 = 46.17 dB

ABM1 comp = 17.11 dB A/m

BWC Factor = 0.14 dB

Location: -5, -10, 4.4 mm

**T-Coil scan/General Scans 2/z (axial) wideband at best S/N 2/ABM [HAC-2007] Freq Resp(x,y,z,f) (1x1x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_300-3000\_2s.wav

Output Gain: 69.12

Measure Window Start: 2000ms

Measure Window Length: 4000ms

BWC applied: 10.78 dB


Device Reference Point: 0, 0, -6.3 mm

**Cursor:**


Diff = 1.97 dB

BWC Factor = 10.78 dB

Location: -5, -10, 3.7 mm

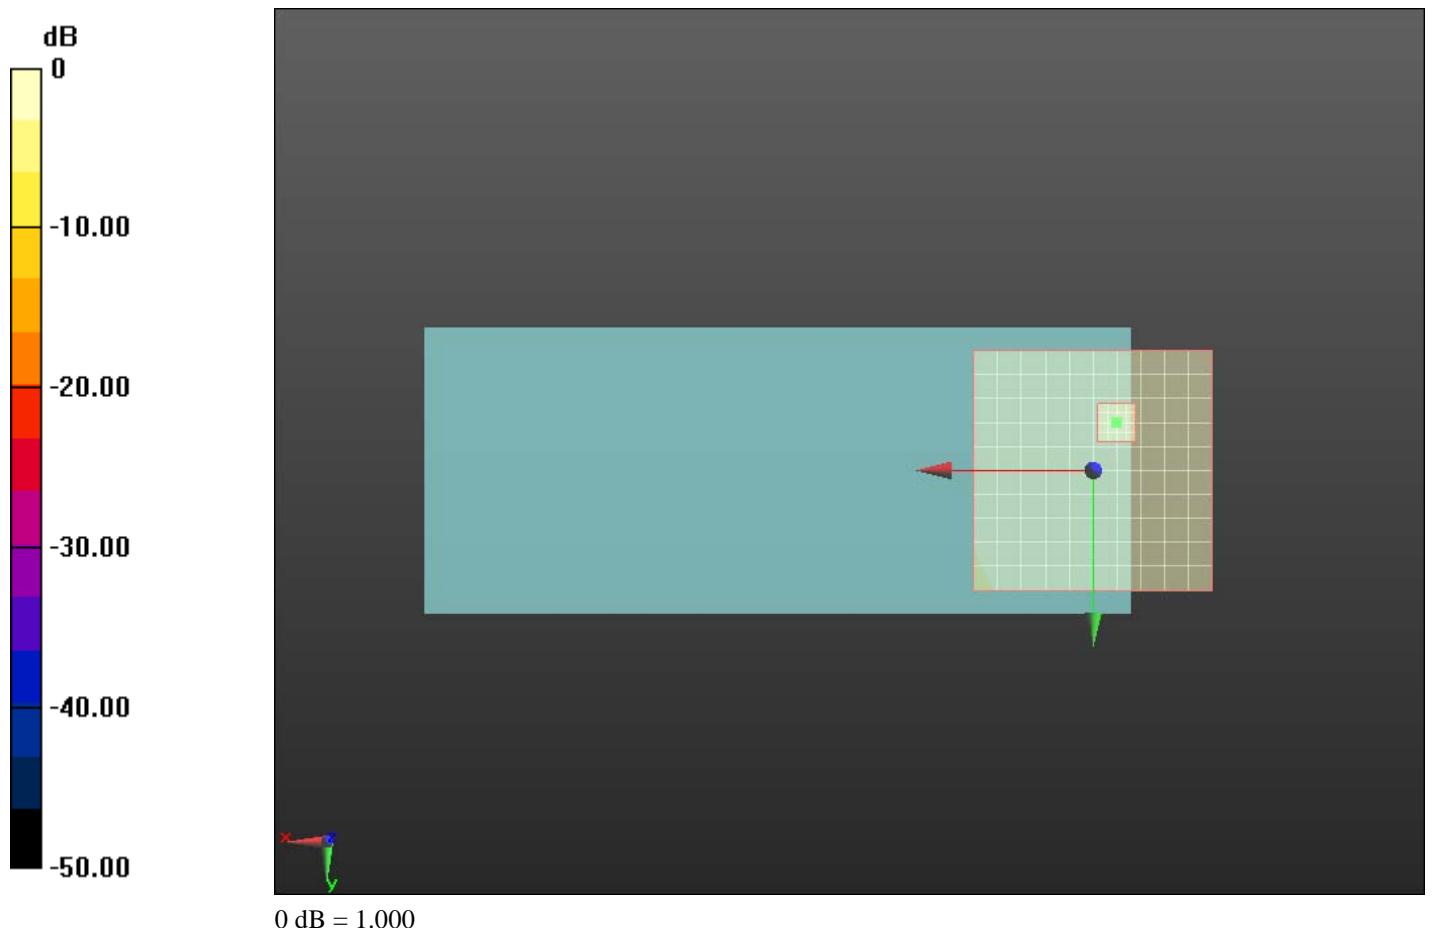

Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>	FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>
-------------------------------------	---	---------------------------------------	--

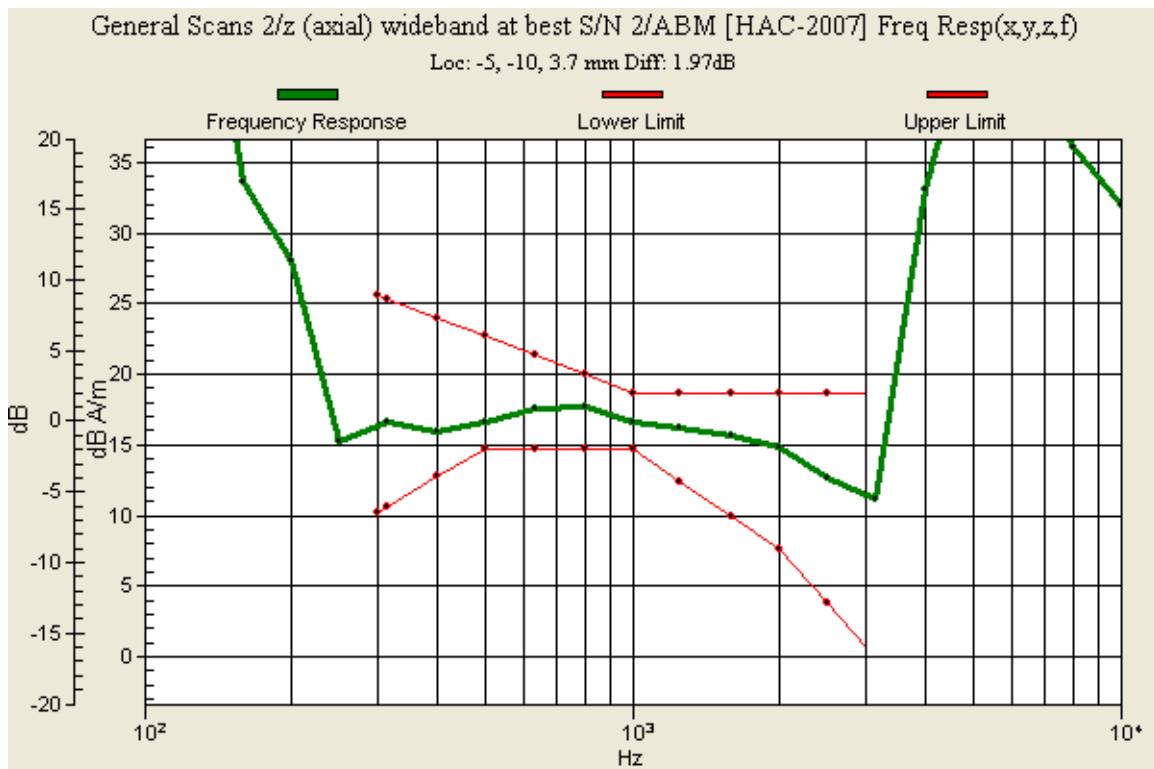

	Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>33(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

Date/Time: 3/9/2011 4:00:46 PM, Date/Time: 3/9/2011 4:14:37 PM

Test Laboratory: RIM Testing Services

HAC T-Coil\_GSM850\_Slide\_Open\_mid\_chan\_Radial\_L

**DUT: BlackBerry Slider Open; Type: Sample**

Communication System: GSM 850; Communication System Band: Exported from older format (data unavailable - please correct).; Frequency: 836.8 MHz; Communication System PAR: 9.191 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/x (longitudinal) 5.0mm 50 x 50/ABM**

**[HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

	Document Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW	Page 34(173)
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

### **T-Coil scan/General Scans 2/x (longitudinal) 2mm 8 x 8/ABM**

#### **[HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm


#### **Cursor:**

ABM1/ABM2 = 41.19 dB

ABM1 comp = 8.50 dB A/m

BWC Factor = 0.14 dB

Location: -12, -8, 4.4 mm

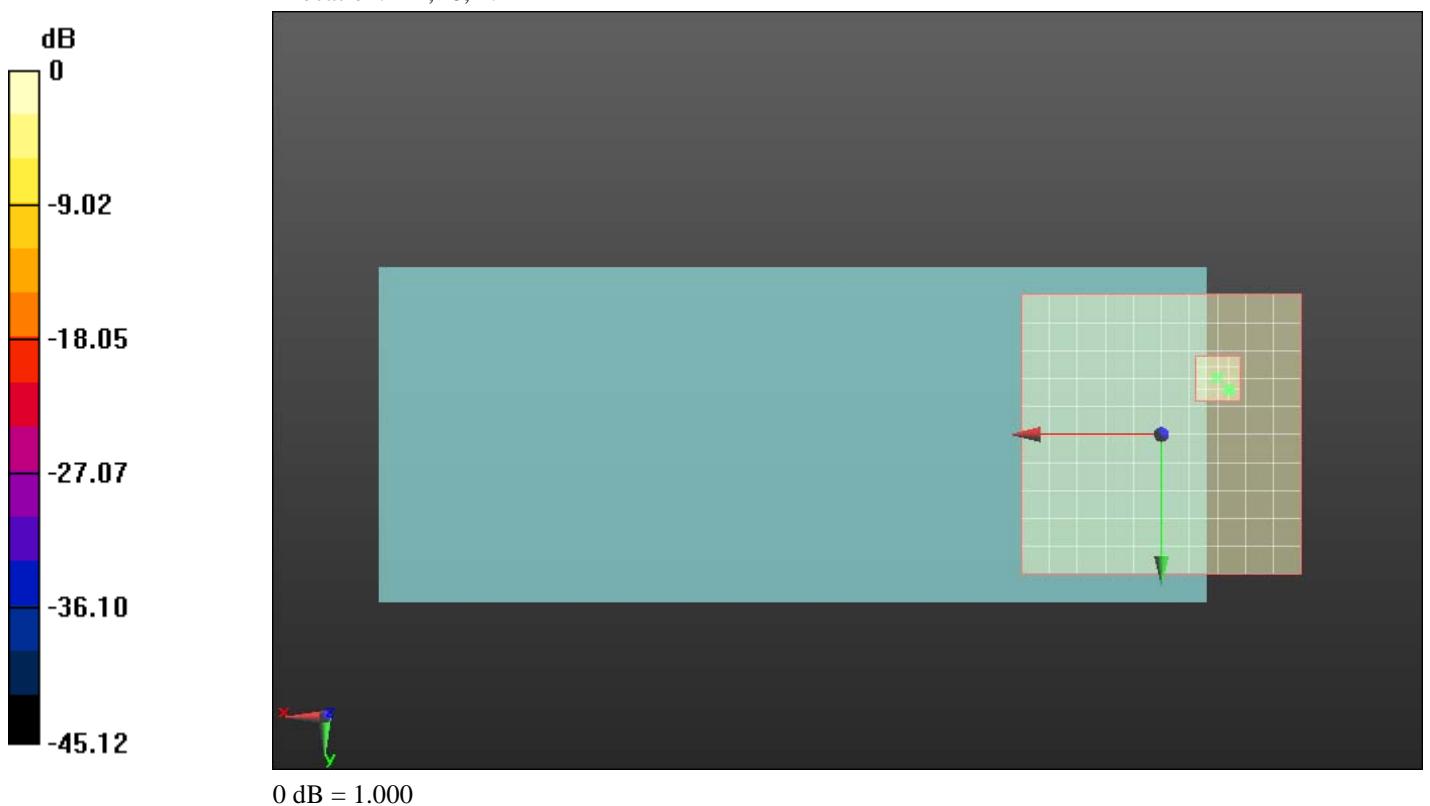

Date/Time: 3/9/2011 4:18:01 PM, Date/Time: 3/9/2011 4:32:51 PM

 <p><b>Document</b>  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			<b>Page</b> <b>35(173)</b>
<b>Author Data</b> <b>Andrew Becker</b>	<b>Dates of Test</b> <b>Mar. 09-10, May 27, July 12, 2011</b>	<b>Report No</b> <b>RTS-3640-1103-10B</b>	<b>FCC ID</b> <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

**Test Laboratory: RIM Testing Services**

**HAC T-Coil\_GSM850\_Slide\_Open\_mid\_chan\_Radial\_T**

**DUT: BlackBerry Slider Open; Type**

**Communication System: GSM 850; Communication System Band: Exported from older format (data unavailable - please correct).; Frequency: 836.8 MHz; Communication System PAR: 9.191 dB**

**Medium parameters used:  $\sigma = 0 \text{ mho/m}$ ,  $\epsilon_r = 1$ ;  $\rho = 0 \text{ kg/m}^3$**

**Phantom section: TCoil Section**

**Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)**

**DASY5 Configuration:**

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/y (transversal) 5.0mm 50 x 50/ABM**

**[HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid:  $dx=10\text{mm}$ ,  $dy=10\text{mm}$

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

Document Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW	Page 36(173)
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b> Report No <b>RTS-3640-1103-10B</b> FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

## **T-Coil scan/General Scans 2/y (transversal) 2mm 8 x 8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm


### **Cursor:**

ABM1/ABM2 = 36.59 dB

ABM1 comp = 9.44 dB A/m

BWC Factor = 0.14 dB

Location: -5, 0, 4.4 mm

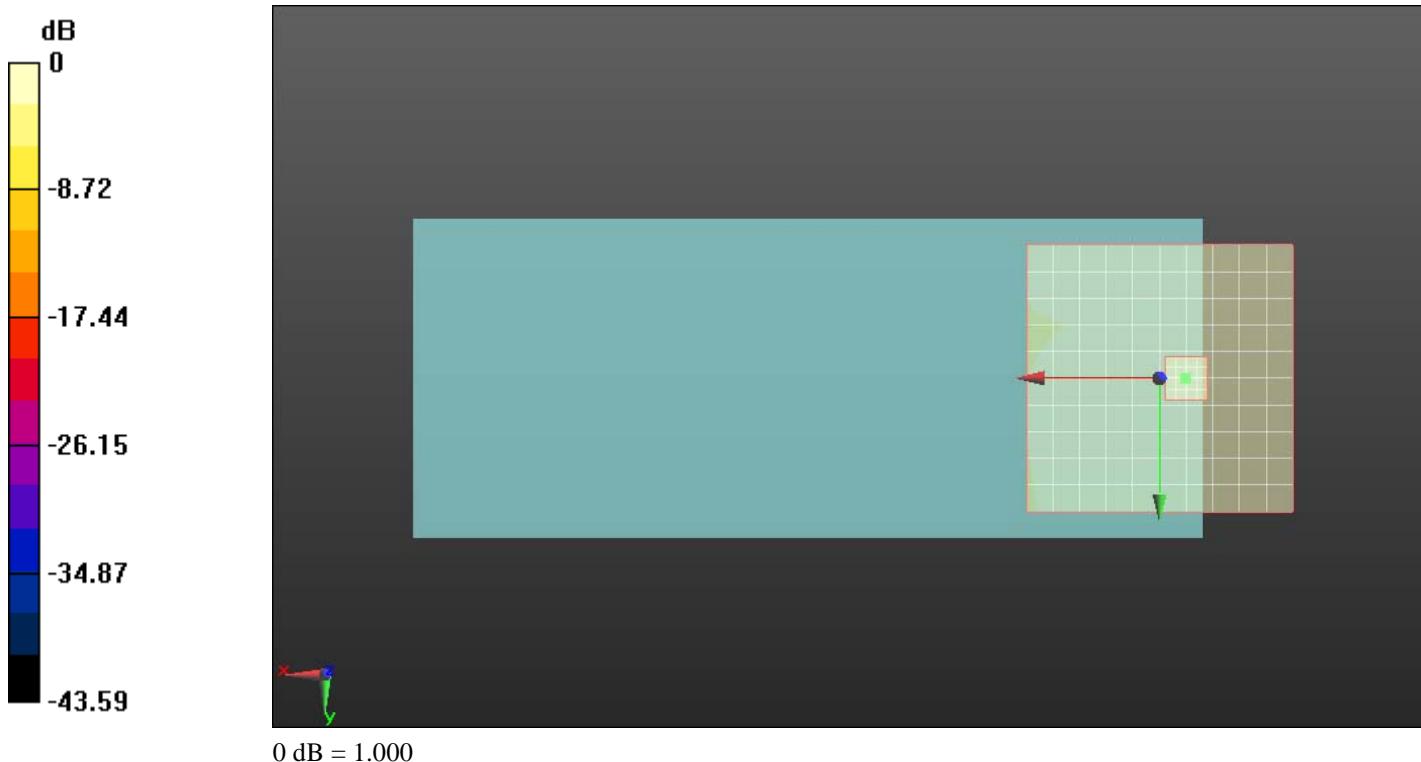

 <p>Document  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			Page <b>37(173)</b>
<p>Author Data  <b>Andrew Becker</b></p>	<p>Dates of Test  <b>Mar. 09-10, May 27, July 12, 2011</b></p>	<p>Report No  <b>RTS-3640-1103-10B</b></p>	<p>FCC ID  <b>L6ARDM70UW</b>  <b>L6AREN70UW</b></p>

Date/Time: 3/9/2011 4:52:14 PM, Date/Time: 3/9/2011 5:05:43 PM, Date/Time:  
3/9/2011 5:43:06 PM

Test Laboratory: RIM Testing Services

HAC T-Coil\_GSM1900\_Slide\_Closed\_low\_chan\_Axial

**DUT: BlackBerry; Type: Sample**

Communication System: GSM 1900; Communication System Band: Exported from older format (data unavailable - please correct).; Frequency: 1850.2

MHz;Communication System PAR: 9.191 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/z (axial) 5.0mm 50 x 50/ABM [HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

 <p>Document  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			Page <b>38(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>	FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**T-Coil scan/General Scans 2/z (axial) 2mm 8 x 8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

ABM1/ABM2 = 37.91 dB

ABM1 comp = 16.15 dB A/m

BWC Factor = 0.14 dB

Location: -7, -8, 4.4 mm

**T-Coil scan/General Scans 2/z (axial) wideband at best S/N 2/ABM [HAC-2007] Freq Resp(x,y,z,f) (1x1x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_300-3000\_2s.wav

Output Gain: 69.12

Measure Window Start: 2000ms

Measure Window Length: 4000ms


BWC applied: 10.78 dB

Device Reference Point: 0, 0, -6.3 mm


Diff = 2.00 dB

BWC Factor = 10.78 dB

Location: -5, -10, 3.7 mm

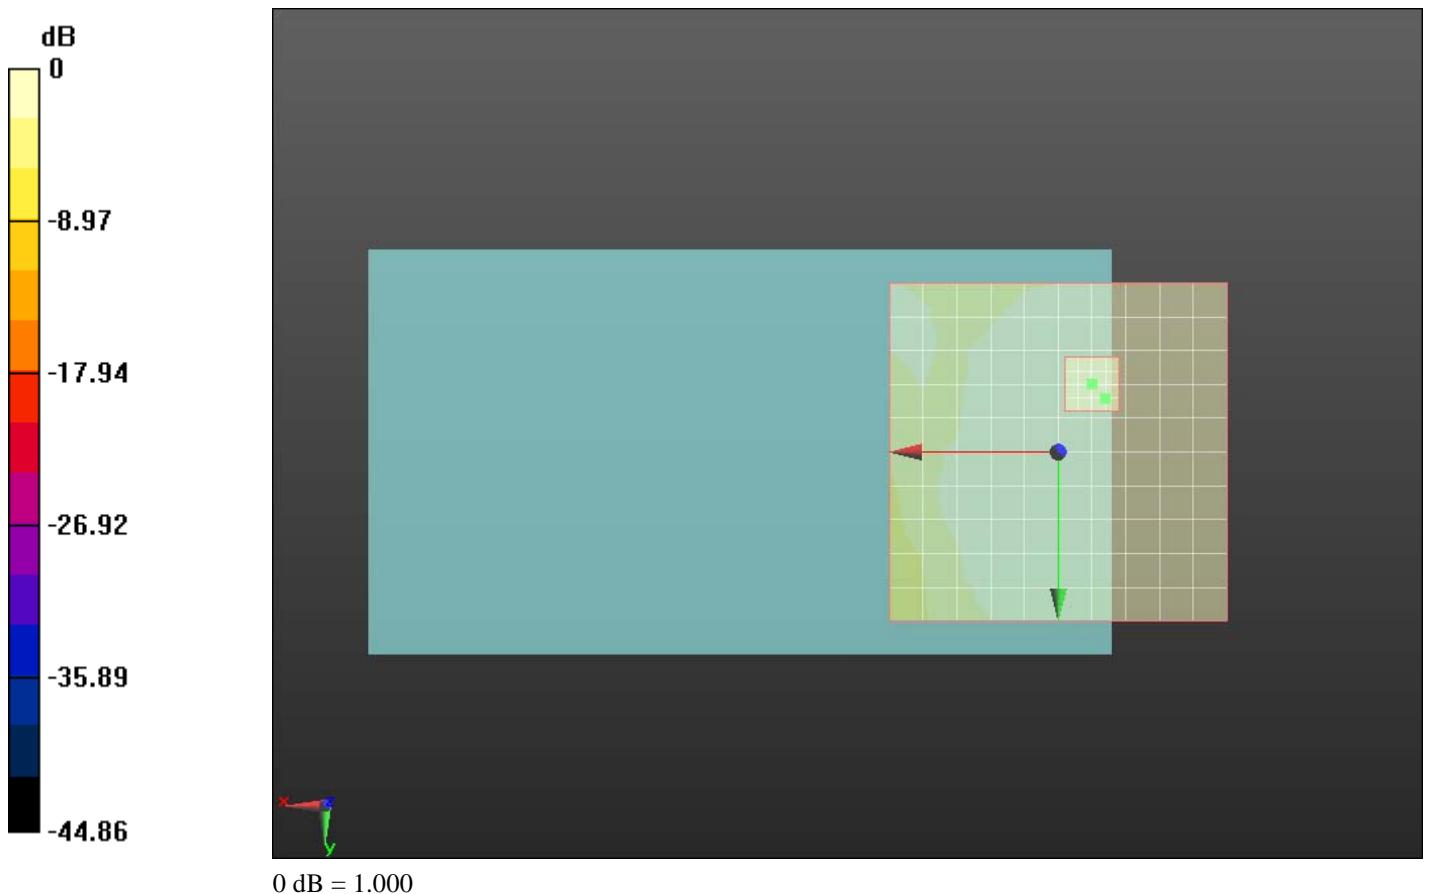

Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>	FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>
-------------------------------------	---	---------------------------------------	--

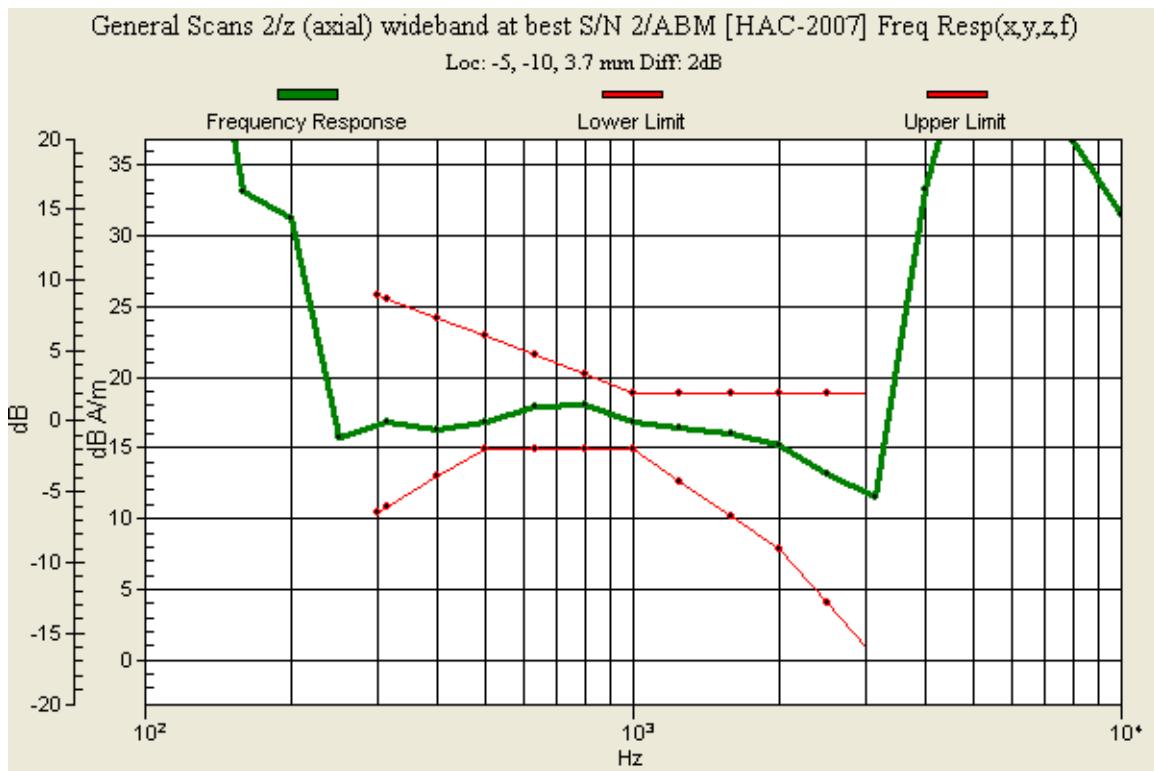

	Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>41(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

Date/Time: 3/9/2011 5:08:48 PM, Date/Time: 3/9/2011 5:22:44 PM

Test Laboratory: RIM Testing Services

HAC T-Coil\_GSM1900\_Slide\_Closed\_low\_chan\_Radial\_L

**DUT: BlackBerry; Type: Sample**

Communication System: GSM 1900; Communication System Band: Exported from older format (data unavailable - please correct).; Frequency: 1850.2 MHz; Communication System PAR: 9.191 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/x (longitudinal) 5.0mm 50 x 50/ABM**

**[HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

	Document Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW	Page 42(173)
	Author Data <b>Andrew Becker</b> Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b> FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

### **T-Coil scan/General Scans 2/x (longitudinal) 2mm 8 x 8/ABM**

#### **[HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm


#### **Cursor:**

ABM1/ABM2 = 31.72 dB

ABM1 comp = 7.39 dB A/m

BWC Factor = 0.14 dB

Location: -15, -10, 4.4 mm

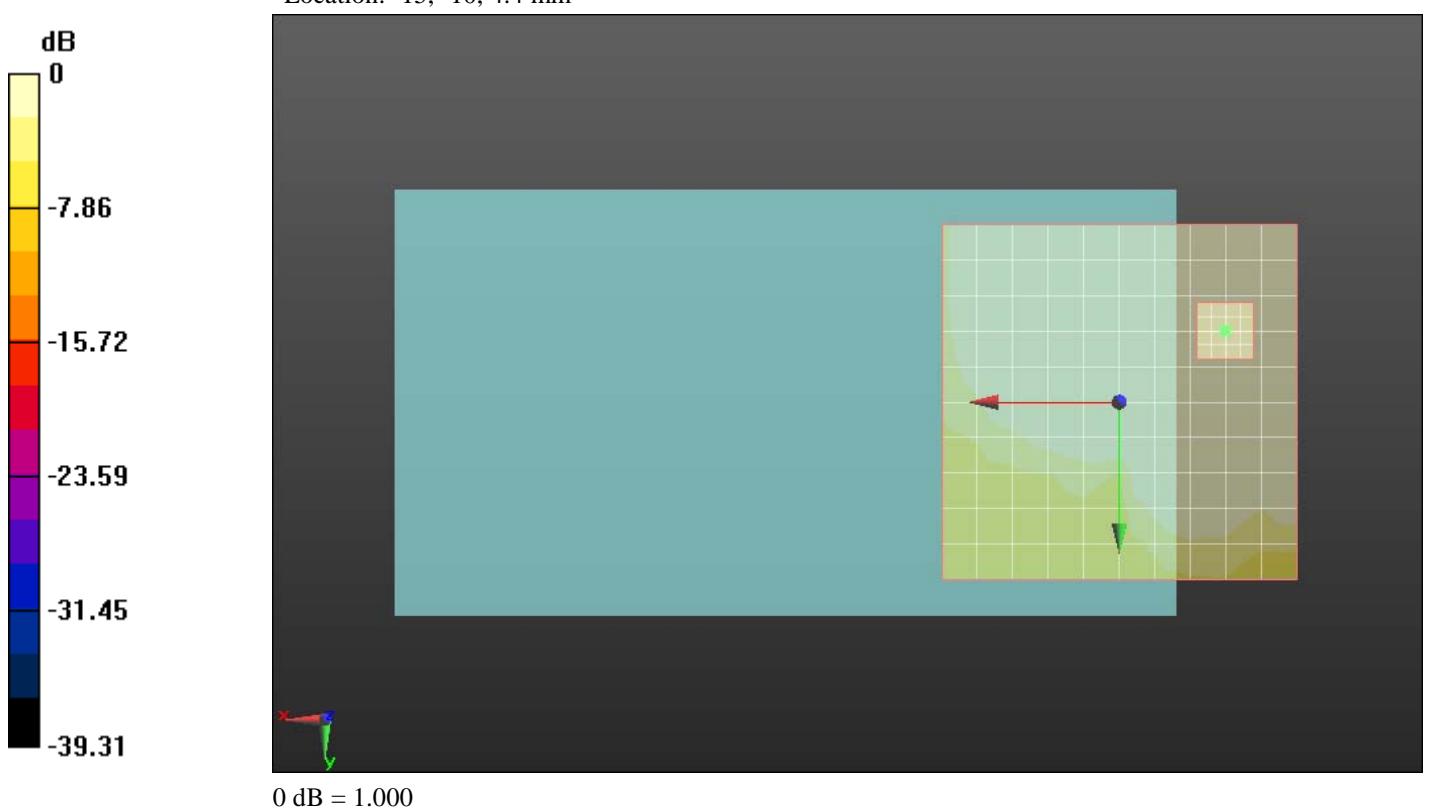

 <p>Document  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			Page <b>43(173)</b>
<p>Author Data  <b>Andrew Becker</b></p>	<p>Dates of Test  <b>Mar. 09-10, May 27, July 12, 2011</b></p>	<p>Report No  <b>RTS-3640-1103-10B</b></p>	<p>FCC ID  <b>L6ARDM70UW</b>  <b>L6AREN70UW</b></p>

Date/Time: 3/9/2011 5:26:10 PM, Date/Time: 3/9/2011 5:39:39 PM

Test Laboratory: RIM Testing Services

HAC T-Coil\_GSM1900\_Slide\_Closed\_low\_chan\_Radial\_T

**DUT: BlackBerry; Type: Sample**

Communication System: GSM 1900; Communication System Band: Exported from older format (data unavailable - please correct).; Frequency: 1850.2 MHz; Communication System PAR: 9.191 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/y (transversal) 5.0mm 50 x 50/ABM**

**[HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

Document Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW	Page 44(173)
Author Data Andrew Becker	Dates of Test Mar. 09-10, May 27, July 12, 2011 Report No RTS-3640-1103-10B FCC ID L6ARDM70UW L6AREN70UW

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**T-Coil scan/General Scans 2/y (transversal) 2mm 8 x 8/ABM  
[HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm


**Cursor:**

ABM1/ABM2 = 28.26 dB

ABM1 comp = 7.52 dB A/m

BWC Factor = 0.14 dB

Location: -7, -17, 4.4 mm

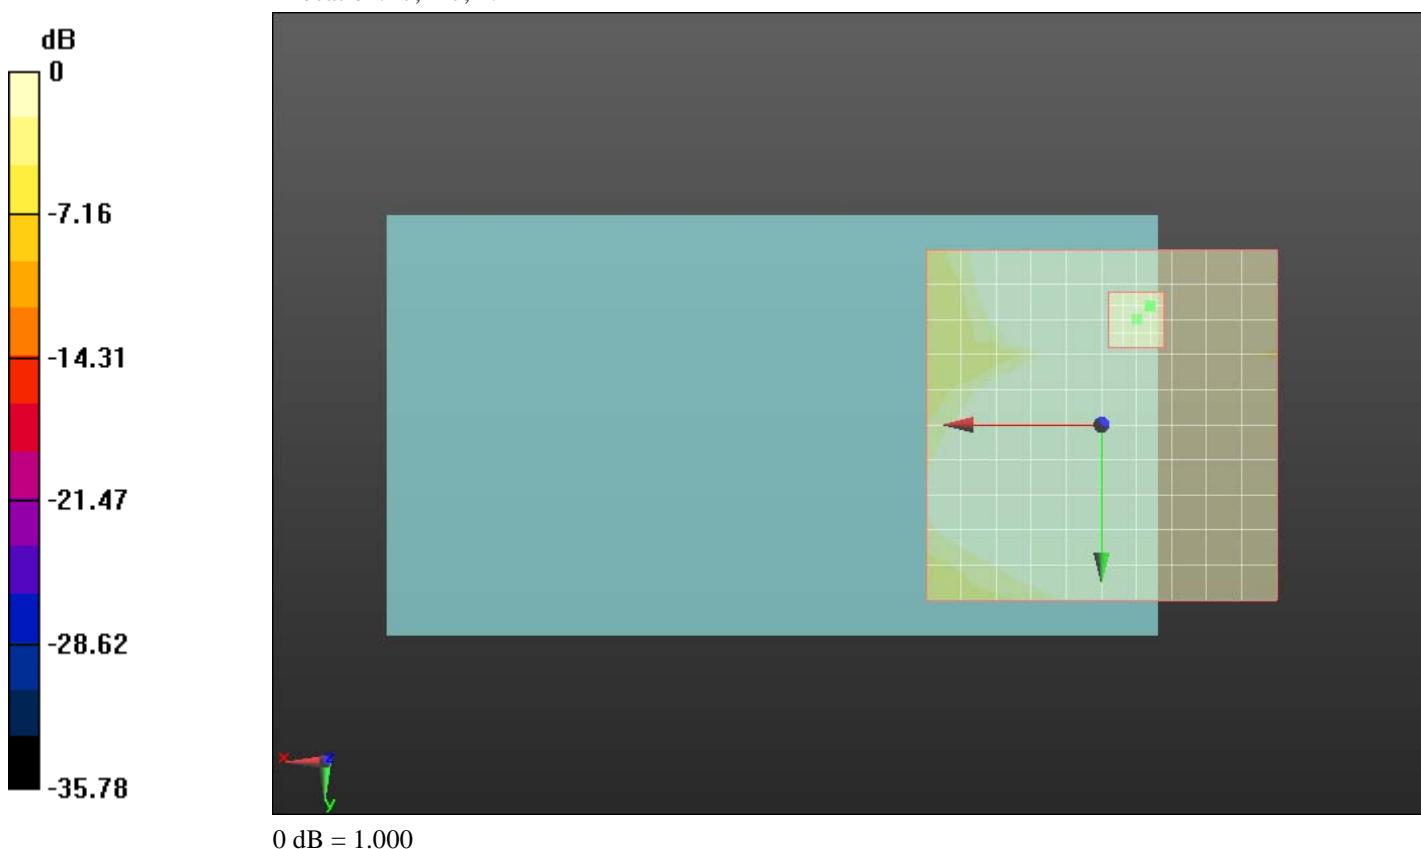

 <p>Document  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			Page <b>45(173)</b>
<p>Author Data  <b>Andrew Becker</b></p>	<p>Dates of Test  <b>Mar. 09-10, May 27, July 12, 2011</b></p>	<p>Report No  <b>RTS-3640-1103-10B</b></p>	<p>FCC ID  <b>L6ARDM70UW</b>  <b>L6AREN70UW</b></p>

Date/Time: 3/9/2011 4:52:14 PM, Date/Time: 3/9/2011 5:45:37 PM, Date/Time:  
 3/9/2011 5:55:42 PM

Test Laboratory: RIM Testing Services

HAC T-Coil\_GSM1900\_Slide\_Closed\_mid\_chan\_Axial

**DUT: BlackBerry; Type: Sample**

Communication System: GSM 1900; Communication System Band: Exported from older format (data unavailable - please correct).; Frequency: 1850.2 MHz, Frequency: 1880 MHz; Communication System PAR: 9.191 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/z (axial) 5.0mm 50 x 50/ABM [HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

	Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>46(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

### **T-Coil scan/General Scans 2 2/z (axial) 2mm 8 x 8/ABM**

#### **[HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

#### **Cursor:**

ABM1/ABM2 = 37.90 dB

ABM1 comp = 15.95 dB A/m

BWC Factor = 0.14 dB

Location: -7, -8, 4.4 mm

### **T-Coil scan/General Scans 2 2/z (axial) wideband at best S/N**

#### **2/ABM [HAC-2007] Freq Resp(x,y,z,f) (1x1x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_300-3000\_2s.wav

Output Gain: 69.12

Measure Window Start: 2000ms

Measure Window Length: 4000ms

BWC applied: 10.78 dB

Device Reference Point: 0, 0, -6.3 mm

#### **Cursor:**

Diff = 1.93 dB

BWC Factor = 10.78 dB


Location: -5, -10, 3.7 mm

Author Data  
**Andrew Becker**


Dates of Test  
**Mar. 09-10, May 27, July  
12, 2011**

Report No  
**RTS-3640-1103-10B**

FCC ID  
**L6ARDM70UW  
L6AREN70UW**

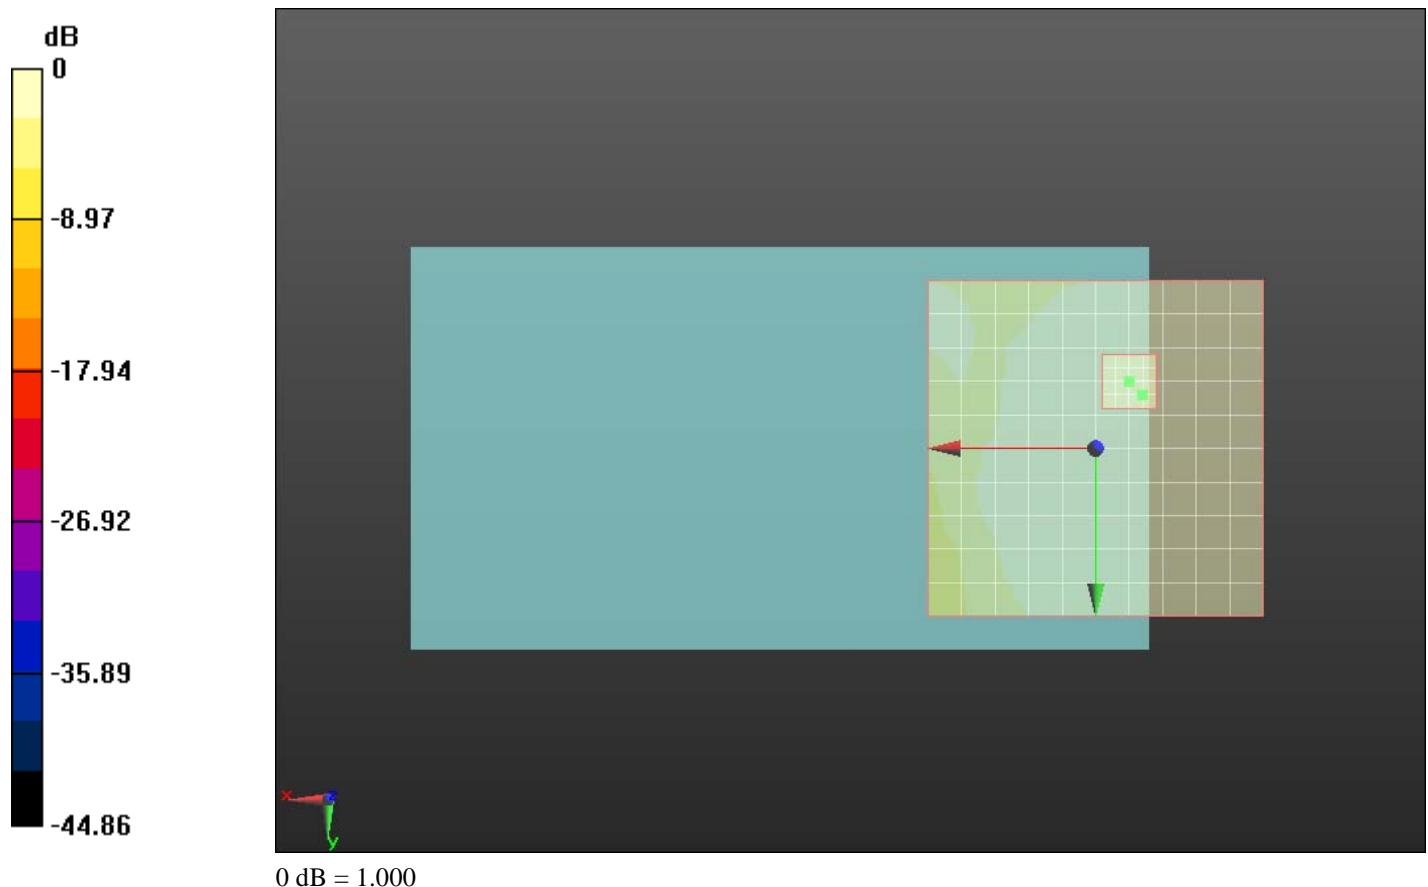

Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>	FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>
-------------------------------------	---	---------------------------------------	--

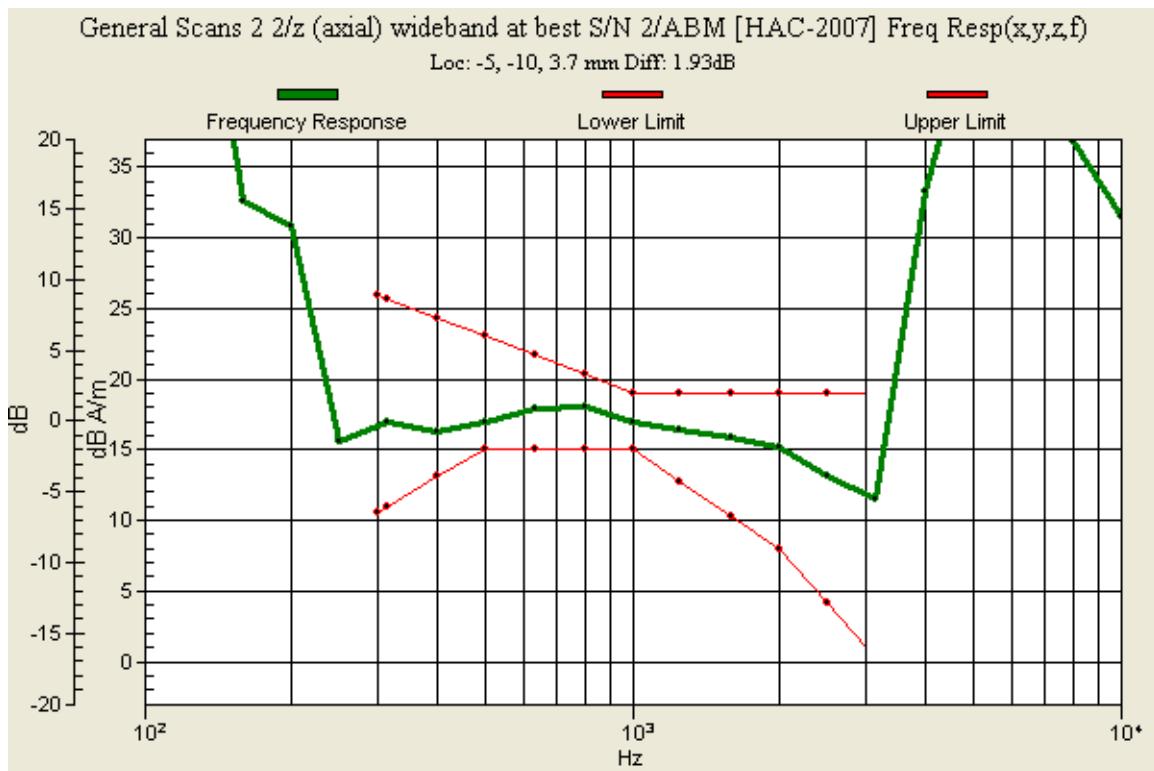

	Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>49(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

Date/Time: 3/9/2011 5:08:48 PM, Date/Time: 3/9/2011 5:48:46 PM

Test Laboratory: RIM Testing Services

HAC T-Coil\_GSM1900\_Slide\_Closed\_mid\_chan\_Radial\_L

**DUT: BlackBerry; Type: Sample**

Communication System: GSM 1900; Communication System Band: Exported from older format (data unavailable - please correct).; Frequency: 1850.2 MHz, Frequency: 1880 MHz; Communication System PAR: 9.191 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/x (longitudinal) 5.0mm 50 x 50/ABM**

**[HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

<b>RIM Testing Services™</b>	Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>50(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**T-Coil scan/General Scans 2 2/x (longitudinal) 2mm 8 x 8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm


**Cursor:**

ABM1/ABM2 = 32.05 dB

ABM1 comp = 5.73 dB A/m

BWC Factor = 0.14 dB

Location: -17, -12, 4.4 mm

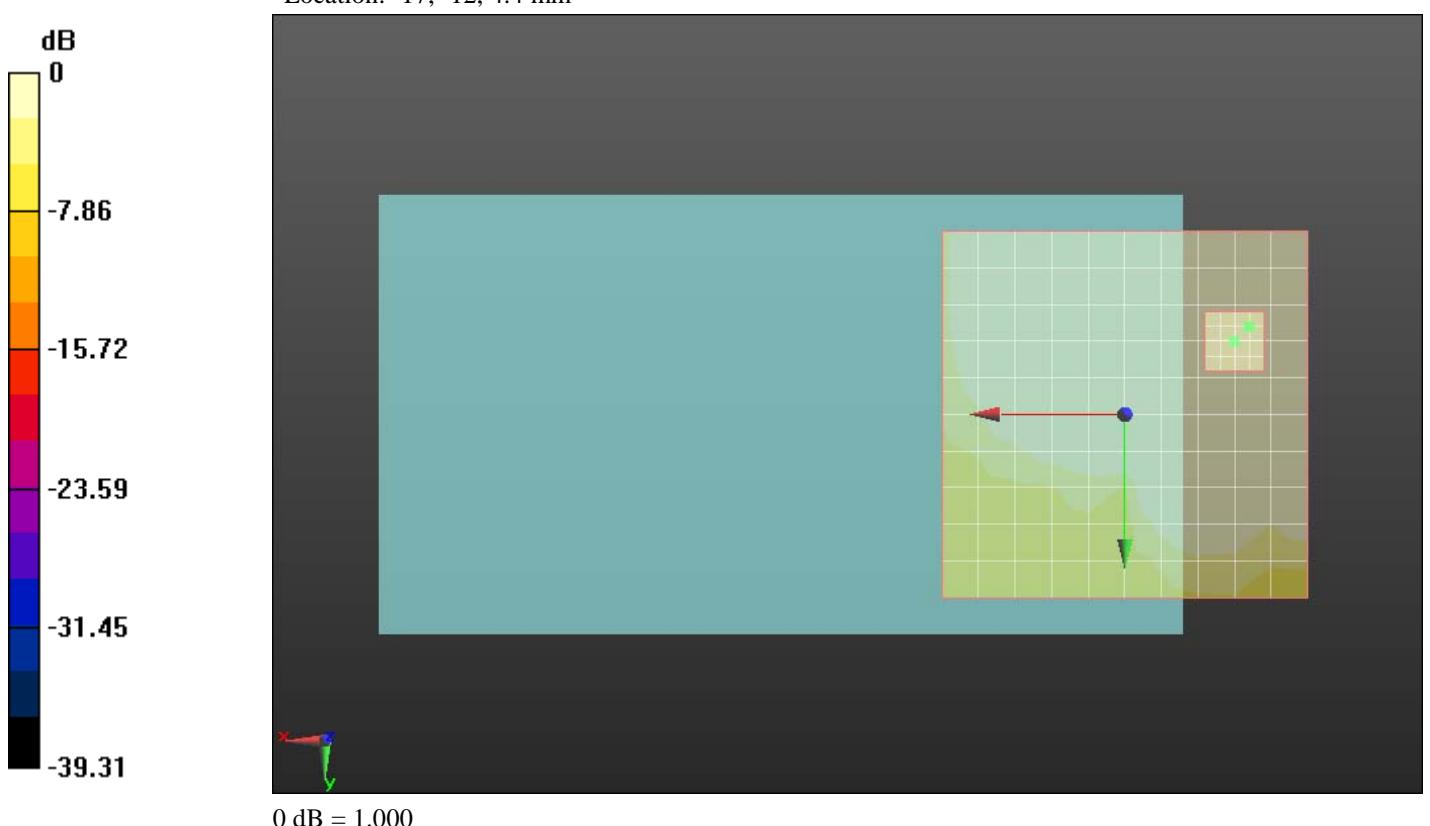

	Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>51(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

Date/Time: 3/9/2011 5:26:10 PM, Date/Time: 3/9/2011 5:52:15 PM

Test Laboratory: RIM Testing Services

HAC T-Coil\_GSM1900\_Slide\_Closed\_mid\_chan\_Radial\_T

**DUT: BlackBerry; Type: Sample**

Communication System: GSM 1900; Communication System Band: Exported from older format (data unavailable - please correct).; Frequency: 1850.2 MHz, Frequency: 1880 MHz; Communication System PAR: 9.191 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/y (transversal) 5.0mm 50 x 50/ABM**

**[HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

<b>RIM Testing Services™</b>	Document Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW	Page 52(173)
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**T-Coil scan/General Scans 2 2/y (transversal) 2mm 8 x 8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm


**Cursor:**

ABM1/ABM2 = 28.39 dB

ABM1 comp = 6.74 dB A/m

BWC Factor = 0.14 dB

Location: -7, -19, 4.4 mm

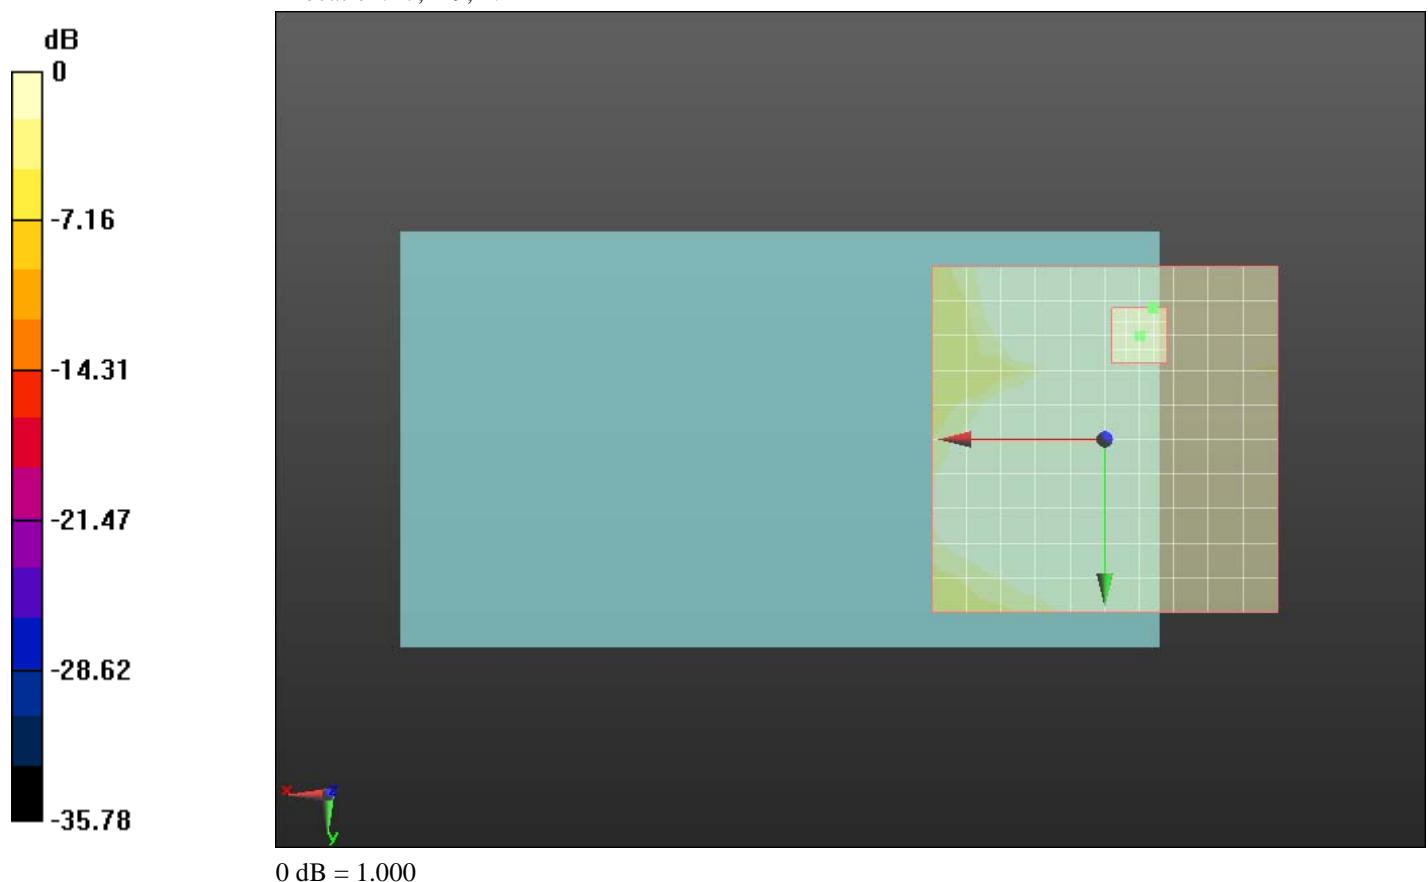

	Document Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW	Page 53(173)	
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>	FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

Date/Time: 3/9/2011 4:52:14 PM, Date/Time: 3/9/2011 5:59:12 PM, Date/Time:  
3/9/2011 6:09:18 PM

Test Laboratory: RIM Testing Services

HAC T-Coil\_GSM1900\_Slide\_Closed\_high\_chan\_Axial

**DUT: BlackBerry; Type: Sample**

Communication System: GSM 1900; Communication System Band: Exported from older format (data unavailable - please correct).; Frequency: 1850.2 MHz, Frequency: 1909.8 MHz; Communication System PAR: 9.191 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/z (axial) 5.0mm 50 x 50/ABM [HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

	Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>54(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**T-Coil scan/General Scans 2 2 2/z (axial) 2mm 8 x 8/ABM**

**[HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

ABM1/ABM2 = 38.19 dB

ABM1 comp = 16.11 dB A/m

BWC Factor = 0.14 dB

Location: -7, -8, 4.4 mm

**T-Coil scan/General Scans 2 2 2/z (axial) wideband at best**

**S/N 2/ABM [HAC-2007] Freq Resp(x,y,z,f) (1x1x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_300-3000\_2s.wav

Output Gain: 69.12

Measure Window Start: 2000ms

Measure Window Length: 4000ms

BWC applied: 10.78 dB


Device Reference Point: 0, 0, -6.3 mm

**Cursor:**


Diff = 1.85 dB

BWC Factor = 10.78 dB

Location: -5, -10, 3.7 mm

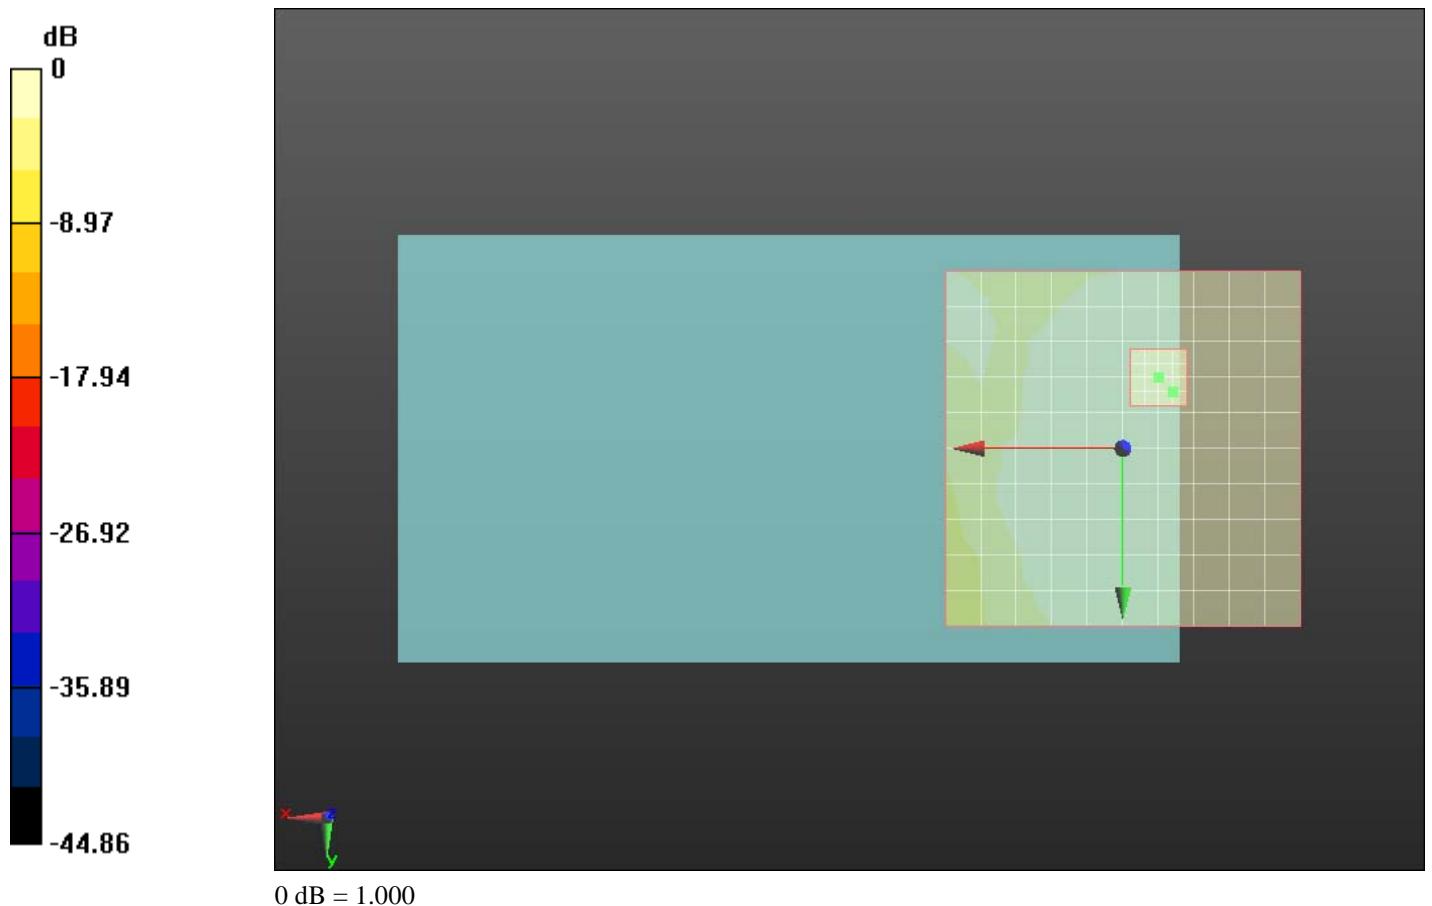

Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>	FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>
-------------------------------------	---	---------------------------------------	--

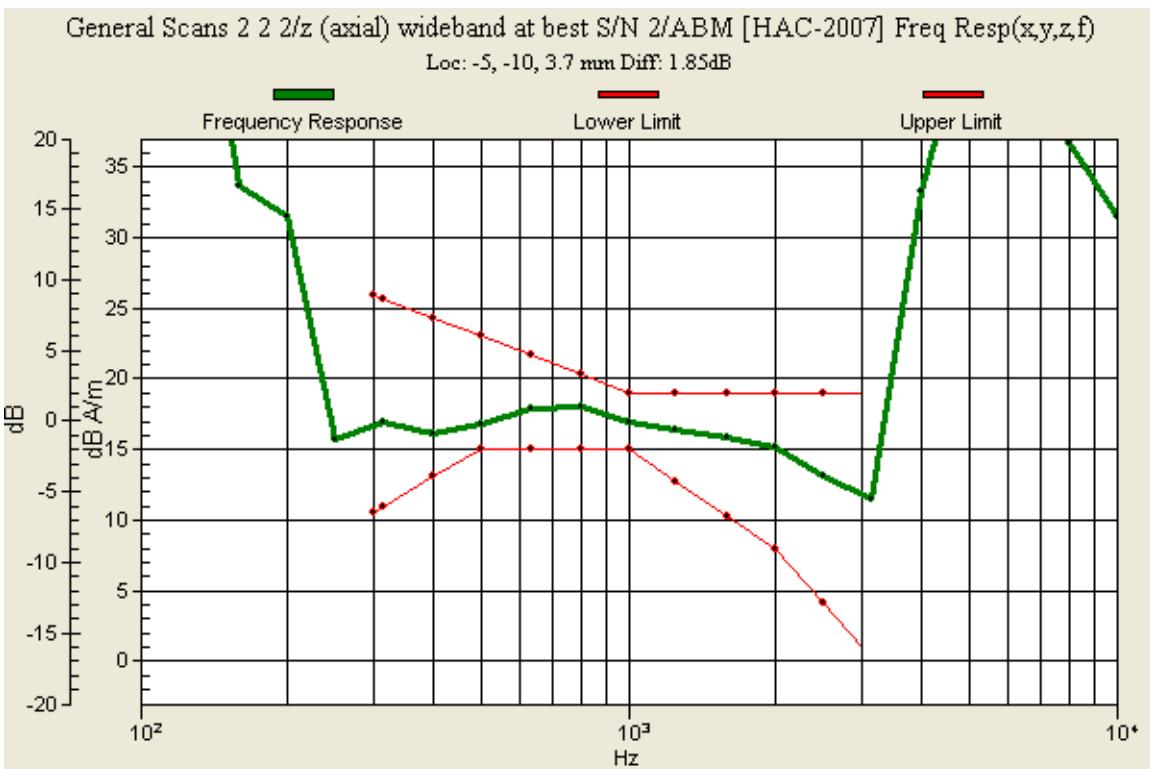

 <p><b>Document</b>  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			<b>Page</b> <b>57(173)</b>
<b>Author Data</b> <b>Andrew Becker</b>	<b>Dates of Test</b> <b>Mar. 09-10, May 27, July 12, 2011</b>	<b>Report No</b> <b>RTS-3640-1103-10B</b>	<b>FCC ID</b> <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

Date/Time: 3/9/2011 5:08:48 PM, Date/Time: 3/9/2011 6:02:21 PM

Test Laboratory: RIM Testing Services

HAC T-Coil\_GSM1900\_Slide\_Closed\_high\_chan\_Radial\_L

**DUT: BlackBerry; Type: Sample**

Communication System: GSM 1900; Communication System Band: Exported from older format (data unavailable - please correct).; Frequency: 1850.2 MHz, Frequency: 1909.8 MHz; Communication System PAR: 9.191 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/x (longitudinal) 5.0mm 50 x 50/ABM**

**[HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

<b>RIM Testing Services™</b>	Document Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW	Page 58(173)
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**T-Coil scan/General Scans 2 2 2/x (longitudinal) 2mm 8 x 8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm


**Cursor:**

ABM1/ABM2 = 32.00 dB

ABM1 comp = 6.95 dB A/m

BWC Factor = 0.14 dB

Location: -15, -12, 4.4 mm

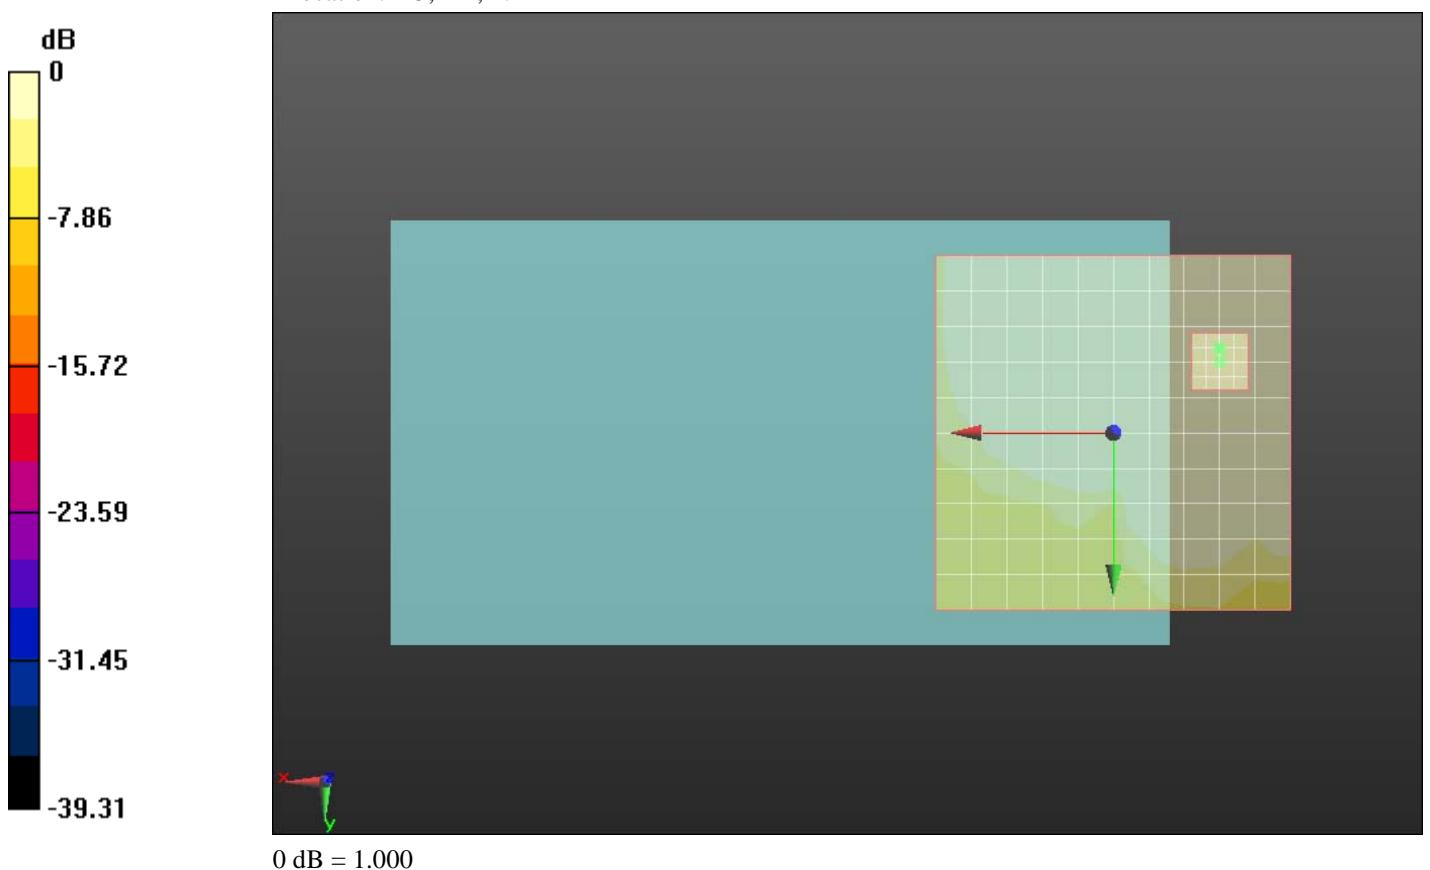

 <p>Document  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			Page <b>59(173)</b>
<p>Author Data  <b>Andrew Becker</b></p>	<p>Dates of Test  <b>Mar. 09-10, May 27, July 12, 2011</b></p>	<p>Report No  <b>RTS-3640-1103-10B</b></p>	<p>FCC ID  <b>L6ARDM70UW</b>  <b>L6AREN70UW</b></p>

Date/Time: 3/9/2011 5:26:10 PM, Date/Time: 3/9/2011 6:05:51 PM

Test Laboratory: RIM Testing Services

HAC T-Coil\_GSM1900\_Slide\_Closed\_high\_chan\_Radial\_T

**DUT: BlackBerry; Type: Sample**

Communication System: GSM 1900; Communication System Band: Exported from older format (data unavailable - please correct).; Frequency: 1850.2 MHz, Frequency: 1909.8 MHz; Communication System PAR: 9.191 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/y (transversal) 5.0mm 50 x 50/ABM**

**[HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>	FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>
-------------------------------------	---	---------------------------------------	--

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**T-Coil scan/General Scans 2 2 2/y (transversal) 2mm 8 x 8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm


**Cursor:**

ABM1/ABM2 = 28.52 dB

ABM1 comp = 7.38 dB A/m

BWC Factor = 0.14 dB

Location: -7, -17, 4.4 mm

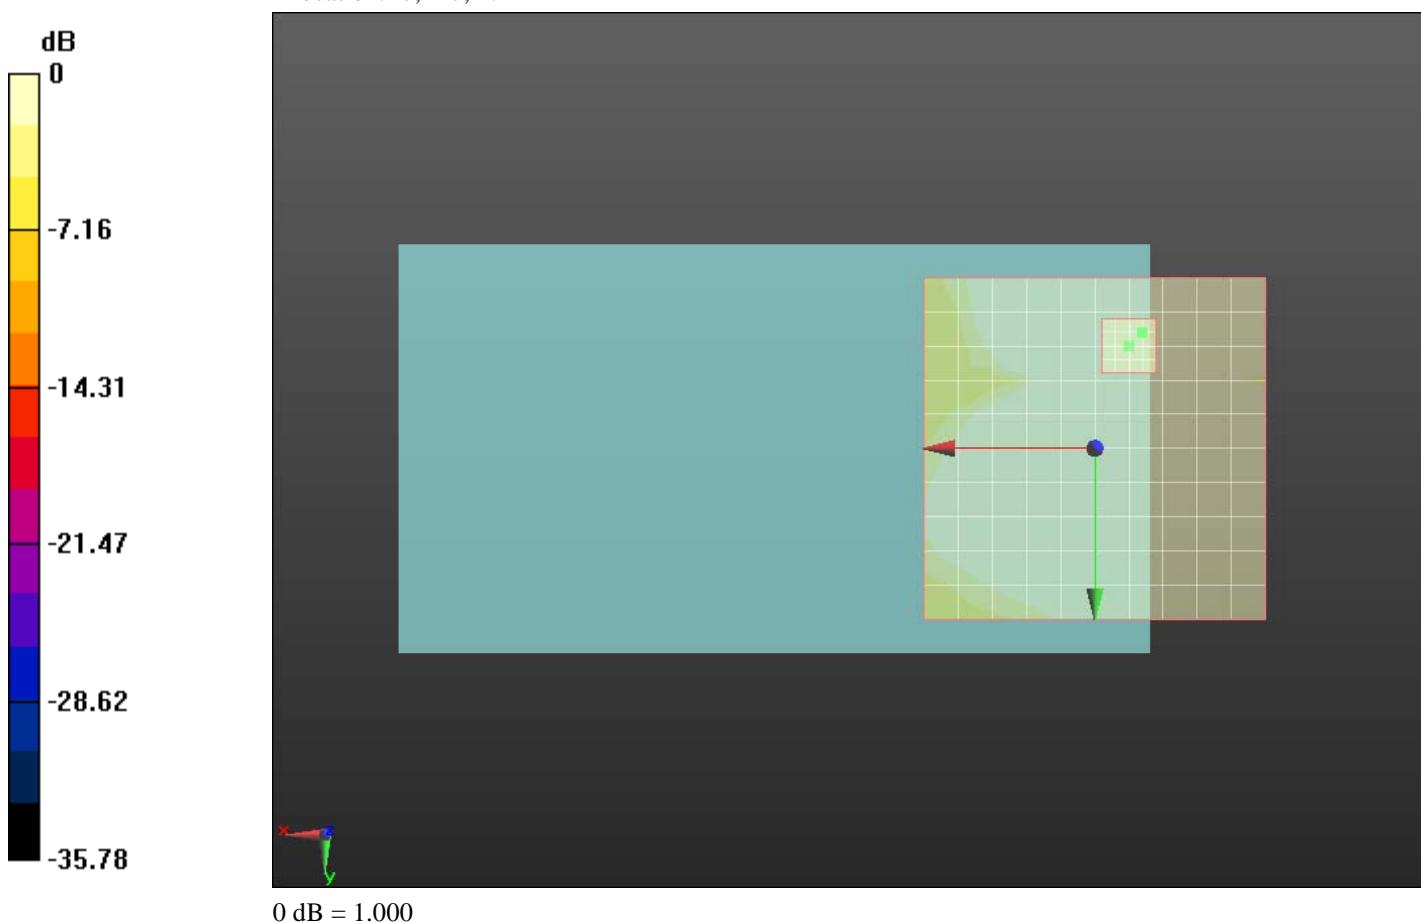

	Document Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW	Page 61(173)	
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>	FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

Date/Time: 3/9/2011 6:13:39 PM, Date/Time: 3/9/2011 6:27:08 PM, Date/Time:  
3/9/2011 7:04:27 PM

Test Laboratory: RIM Testing Services

HAC T-Coil\_GSM1900\_Slide\_Open\_mid\_chan\_Axial

**DUT: BlackBerry; Type: Sample**

Communication System: GSM 1900; Communication System Band: Exported from older format (data unavailable - please correct).; Frequency: 1880 MHz; Communication System PAR: 9.191 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/z (axial) 5.0mm 50 x 50/ABM [HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

 <p>Document  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			Page <b>62(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>	FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**T-Coil scan/General Scans 2/z (axial) 2mm 8 x 8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

ABM1/ABM2 = 49.48 dB

ABM1 comp = 18.04 dB A/m

BWC Factor = 0.14 dB

Location: -5, -8, 4.4 mm

**T-Coil scan/General Scans 2/z (axial) wideband at best S/N 2/ABM [HAC-2007] Freq Resp(x,y,z,f) (1x1x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_300-3000\_2s.wav

Output Gain: 69.12

Measure Window Start: 2000ms

Measure Window Length: 4000ms

BWC applied: 10.78 dB


Device Reference Point: 0, 0, -6.3 mm

**Cursor:**


Diff = 1.92 dB

BWC Factor = 10.78 dB

Location: -5, -10, 3.7 mm

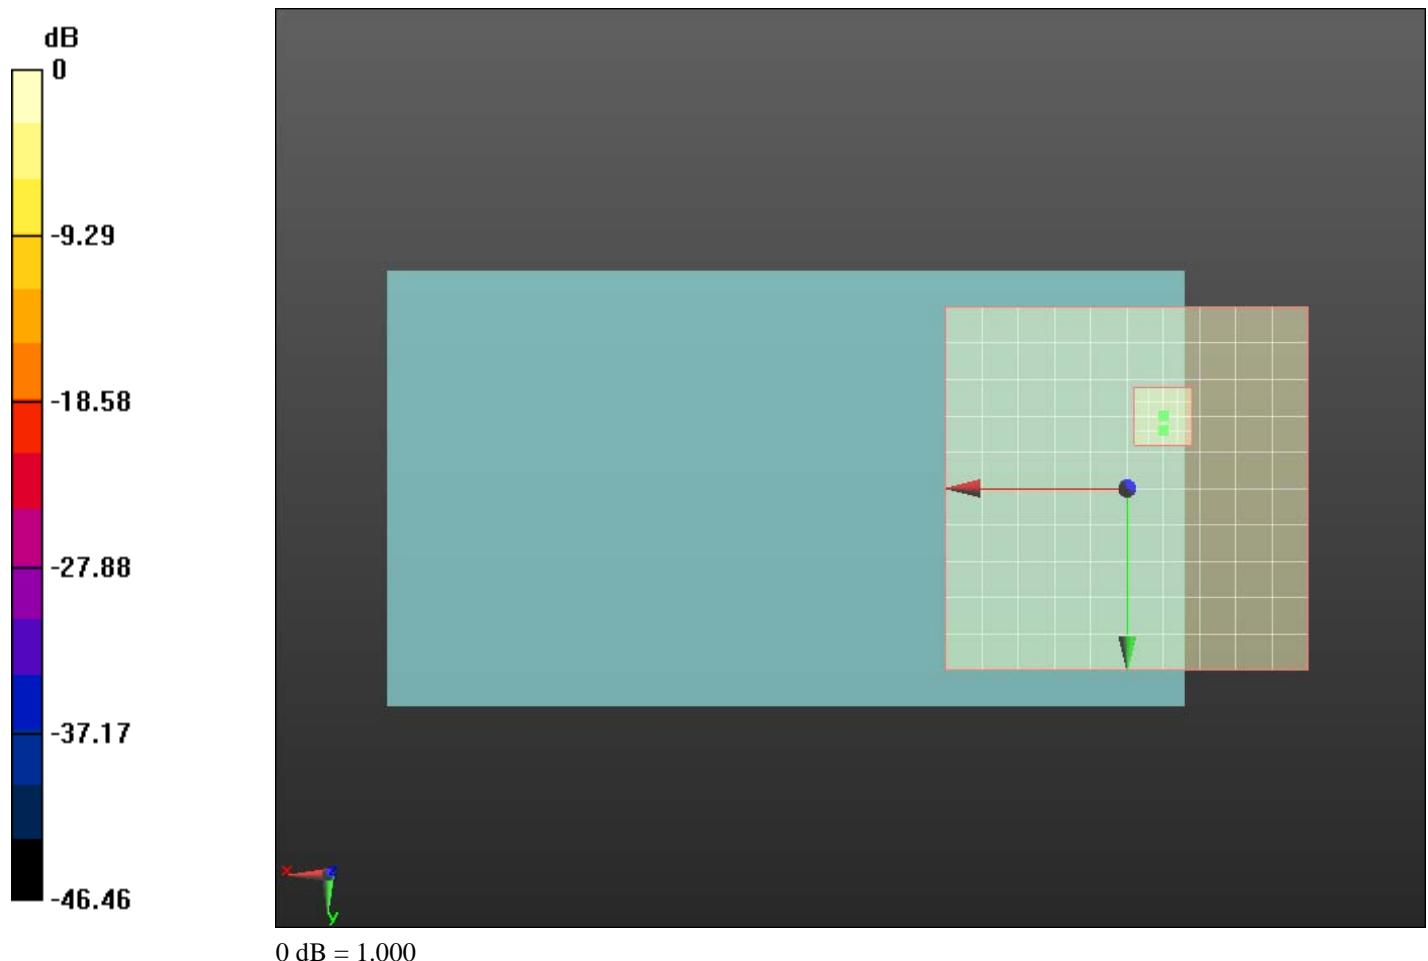Author Data  
**Andrew Becker**Dates of Test  
**Mar. 09-10, May 27, July  
12, 2011**Report No  
**RTS-3640-1103-10B**FCC ID  
**L6ARDM70UW  
L6AREN70UW**

Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>	FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>
-------------------------------------	---	---------------------------------------	--

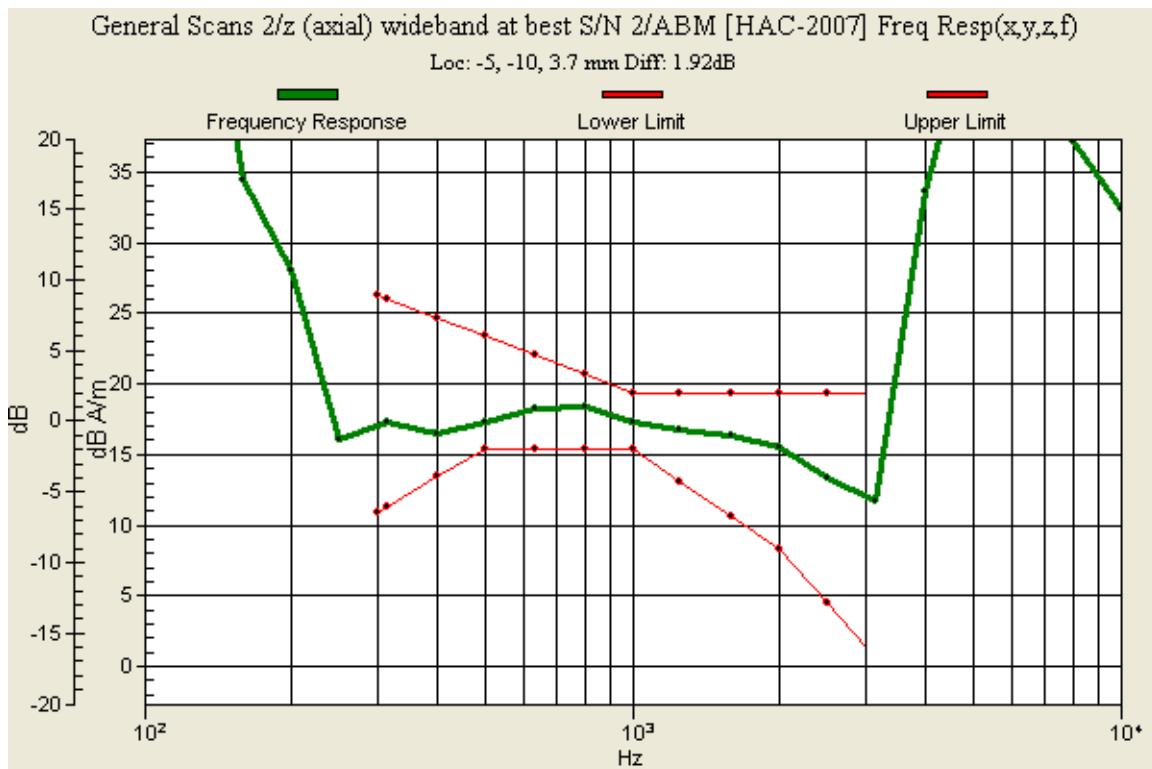

	Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>65(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

Date/Time: 3/9/2011 6:30:14 PM, Date/Time: 3/9/2011 6:44:07 PM

Test Laboratory: RIM Testing Services

HAC T-Coil\_GSM1900\_Slide\_Open\_mid\_chan\_Radial\_L

**DUT: BlackBerry; Type: Sample**

Communication System: GSM 1900; Communication System Band: Exported from older format (data unavailable - please correct).; Frequency: 1880 MHz; Communication System PAR: 9.191 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/x (longitudinal) 5.0mm 50 x 50/ABM**

**[HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

<b>RIM Testing Services™</b>	Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>66(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

### **T-Coil scan/General Scans 2/x (longitudinal) 2mm 8 x 8/ABM**

#### **[HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm


#### **Cursor:**

ABM1/ABM2 = 50.32 dB

ABM1 comp = 7.53 dB A/m

BWC Factor = 0.14 dB

Location: -12, -14, 4.4 mm

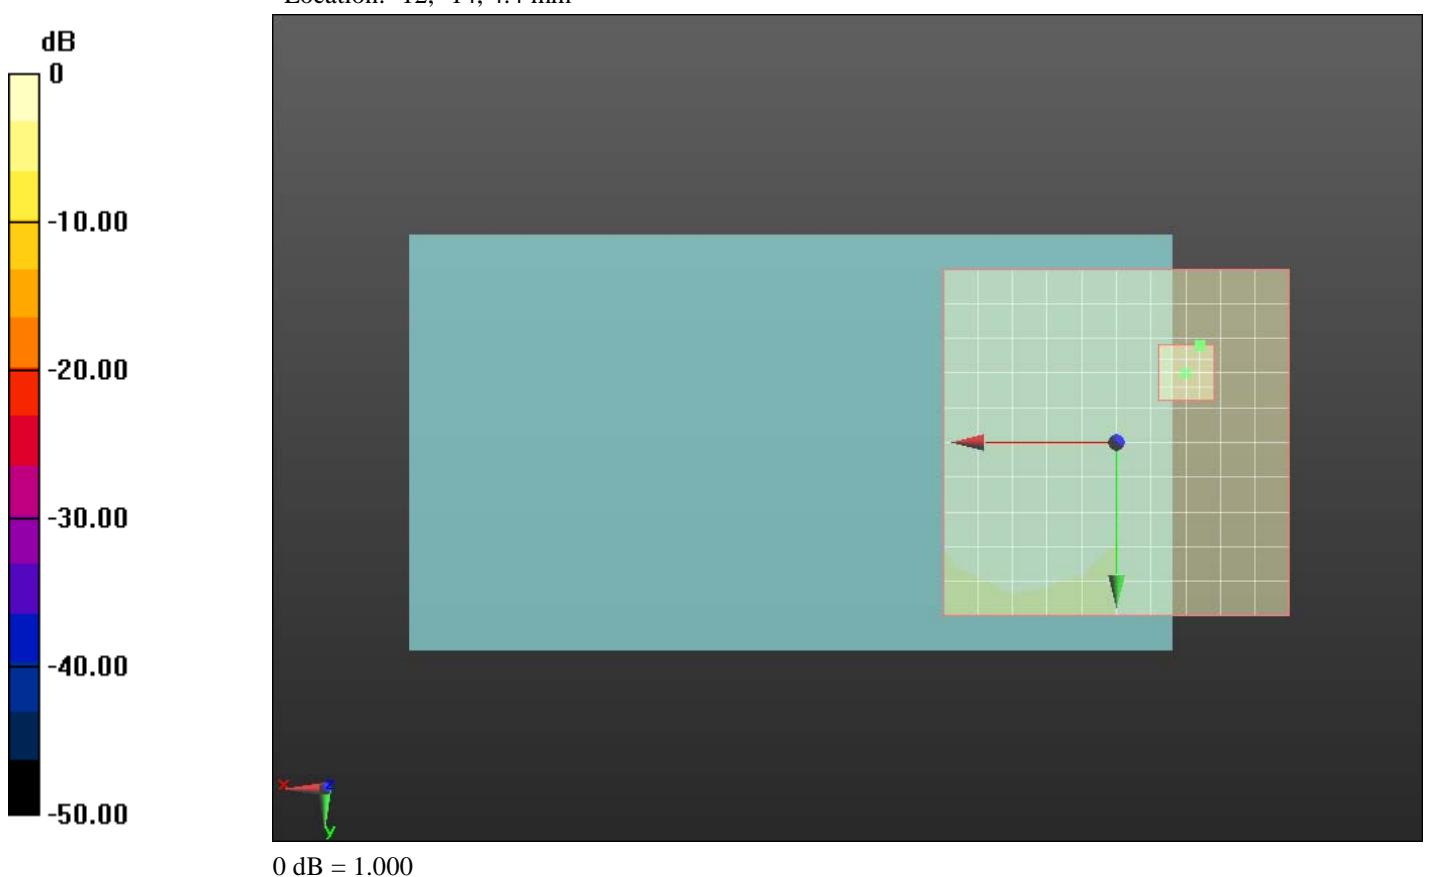

 <p><b>Document</b>  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			<b>Page</b> <b>67(173)</b>
<b>Author Data</b> <b>Andrew Becker</b>	<b>Dates of Test</b> <b>Mar. 09-10, May 27, July 12, 2011</b>	<b>Report No</b> <b>RTS-3640-1103-10B</b>	<b>FCC ID</b> <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

Date/Time: 3/9/2011 6:47:31 PM, Date/Time: 3/9/2011 7:01:00 PM

Test Laboratory: RIM Testing Services

HAC T-Coil\_GSM1900\_Slide\_Open\_mid\_chan\_Radial\_T

**DUT: BlackBerry; Type: Sample**

Communication System: GSM 1900; Communication System Band: Exported from older format (data unavailable - please correct).; Frequency: 1880 MHz; Communication System PAR: 9.191 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/y (transversal) 5.0mm 50 x 50/ABM**

**[HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

<b>RIM Testing Services™</b>	Document Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW	Page 68(173)
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**T-Coil scan/General Scans 2/y (transversal) 2mm 8 x 8/ABM  
[HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm


**Cursor:**

ABM1/ABM2 = 42.05 dB

ABM1 comp = 8.55 dB A/m

BWC Factor = 0.14 dB

Location: -5, -17, 4.4 mm

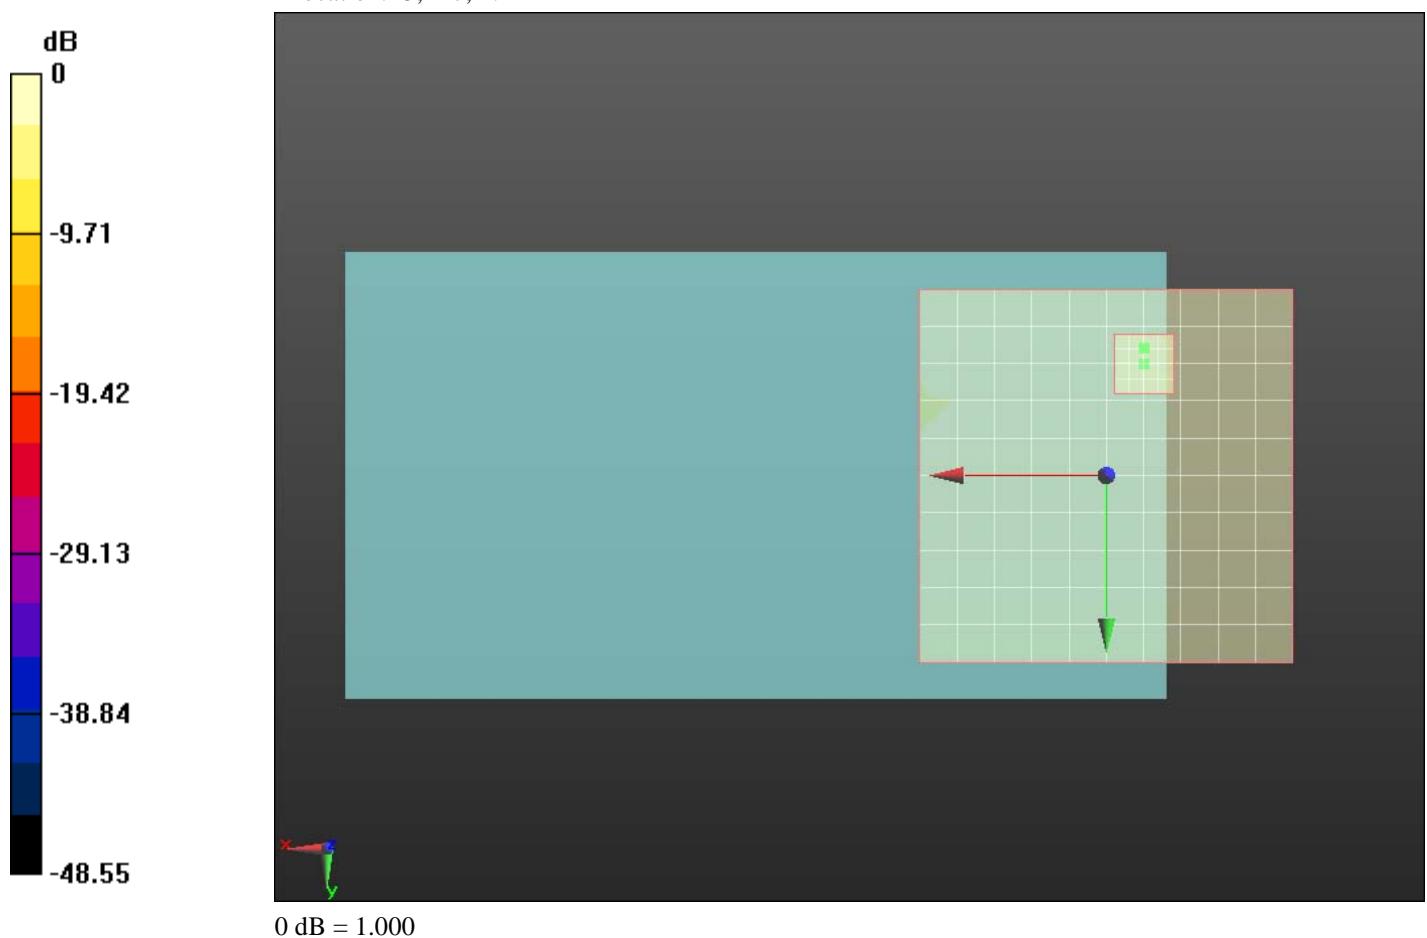

 <p>Document  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			Page <b>69(173)</b>
<p>Author Data  <b>Andrew Becker</b></p>	<p>Dates of Test  <b>Mar. 09-10, May 27, July 12, 2011</b></p>	<p>Report No  <b>RTS-3640-1103-10B</b></p>	<p>FCC ID  <b>L6ARDM70UW</b>  <b>L6AREN70UW</b></p>

Date/Time: 3/9/2011 7:37:07 PM, Date/Time: 3/9/2011 8:29:27 PM, Date/Time:  
 3/9/2011 8:39:42 PM

Test Laboratory: RIM Testing Services

HAC T-Coil\_UMTS\_band\_V\_Slide\_Closed\_low\_chan\_Axial

**DUT: BlackBerry; Type: Sample**

Communication System: WCDMA FDD V; Communication System Band:

Exported from older format (data unavailable - please correct).; Frequency:

836.4 MHz, Frequency: 826.4 MHz; Communication System PAR: 3.4 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/z (axial) 5.0mm 50 x 50/ABM [HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

	Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>70(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

### **T-Coil scan/General Scans 2 2/z (axial) 2mm 8 x 8/ABM**

#### **[HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

#### **Cursor:**

ABM1/ABM2 = 54.85 dB

ABM1 comp = 16.91 dB A/m

BWC Factor = 0.14 dB

Location: -5, -8, 4.4 mm

### **T-Coil scan/General Scans 2 2/z (axial) wideband at best S/N**

#### **2/ABM [HAC-2007] Freq Resp(x,y,z,f) (1x1x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_300-3000\_2s.wav

Output Gain: 69.12

Measure Window Start: 2000ms

Measure Window Length: 4000ms


BWC applied: 10.78 dB

Device Reference Point: 0, 0, -6.3 mm


Diff = 2.00 dB

BWC Factor = 10.78 dB

Location: -5, -10, 3.7 mm

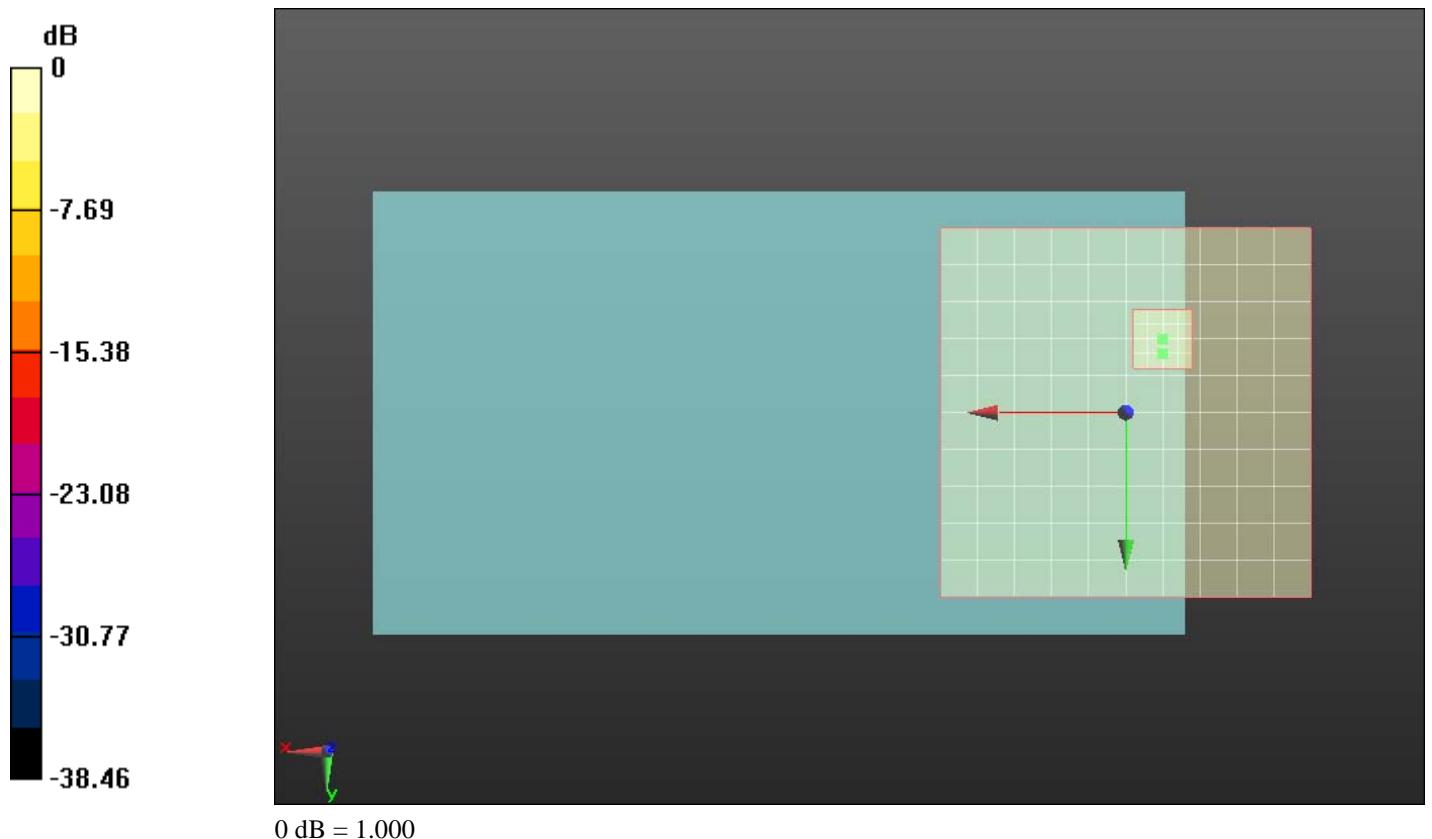

Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>	FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>
-------------------------------------	---	---------------------------------------	--

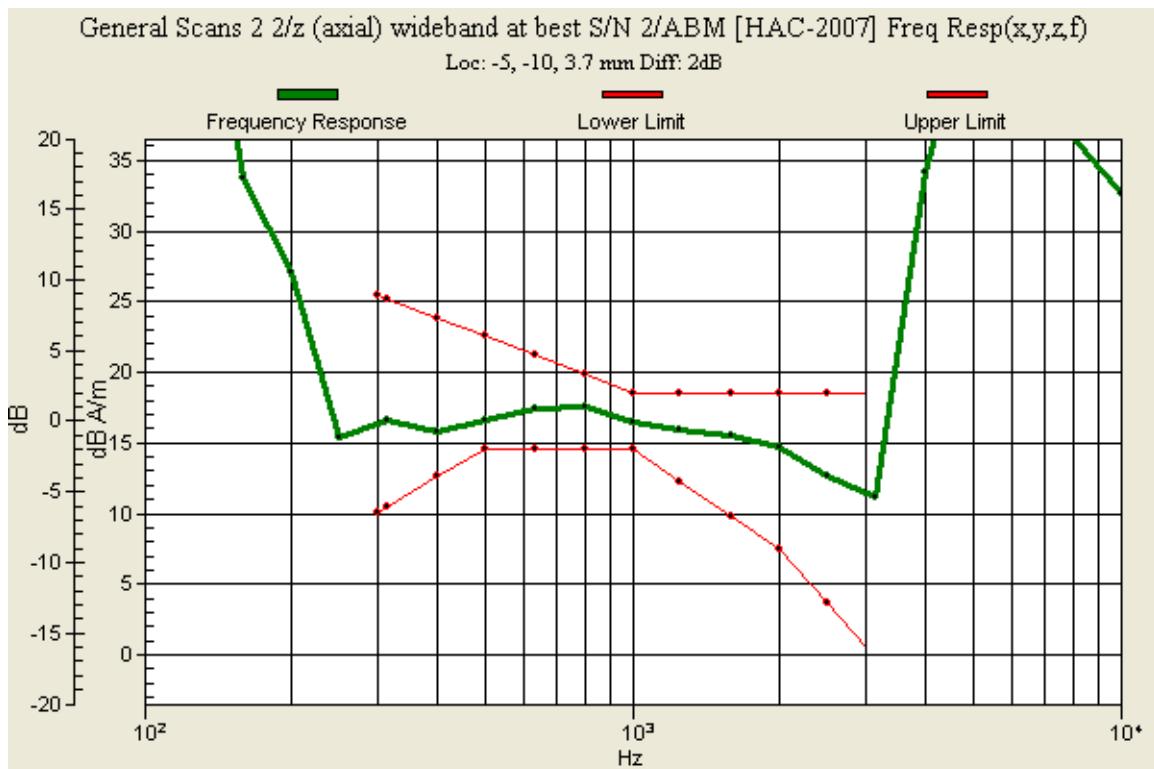

 <p><b>Document</b>  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			<b>Page</b> <b>73(173)</b>
<b>Author Data</b> <b>Andrew Becker</b>	<b>Dates of Test</b> <b>Mar. 09-10, May 27, July 12, 2011</b>	<b>Report No</b> <b>RTS-3640-1103-10B</b>	<b>FCC ID</b> <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

Date/Time: 3/9/2011 7:53:41 PM, Date/Time: 3/9/2011 8:32:40 PM

Test Laboratory: RIM Testing Services

HAC T-Coil\_UMTS\_band\_V\_Slide\_Closed\_low\_chan\_Radial\_L

**DUT: BlackBerry; Type: Sample**

Communication System: WCDMA FDD V; Communication System Band:

Exported from older format (data unavailable - please correct).; Frequency:

836.4 MHz, Frequency: 826.4 MHz; Communication System PAR: 3.4 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

**DASY5 Configuration:**

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/x (longitudinal) 5.0mm 50 x 50/ABM**

**[HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

Author Data  
**Andrew Becker**

Dates of Test

**Mar. 09-10, May 27, July 12, 2011**

Report No

**RTS-3640-1103-10B**

FCC ID

**L6ARDM70UW  
L6AREN70UW**

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**T-Coil scan/General Scans 2 2/x (longitudinal) 2mm 8 x 8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm


**Cursor:**

ABM1/ABM2 = 52.48 dB

ABM1 comp = 8.03 dB A/m

BWC Factor = 0.14 dB

Location: -12, -10, 4.4 mm

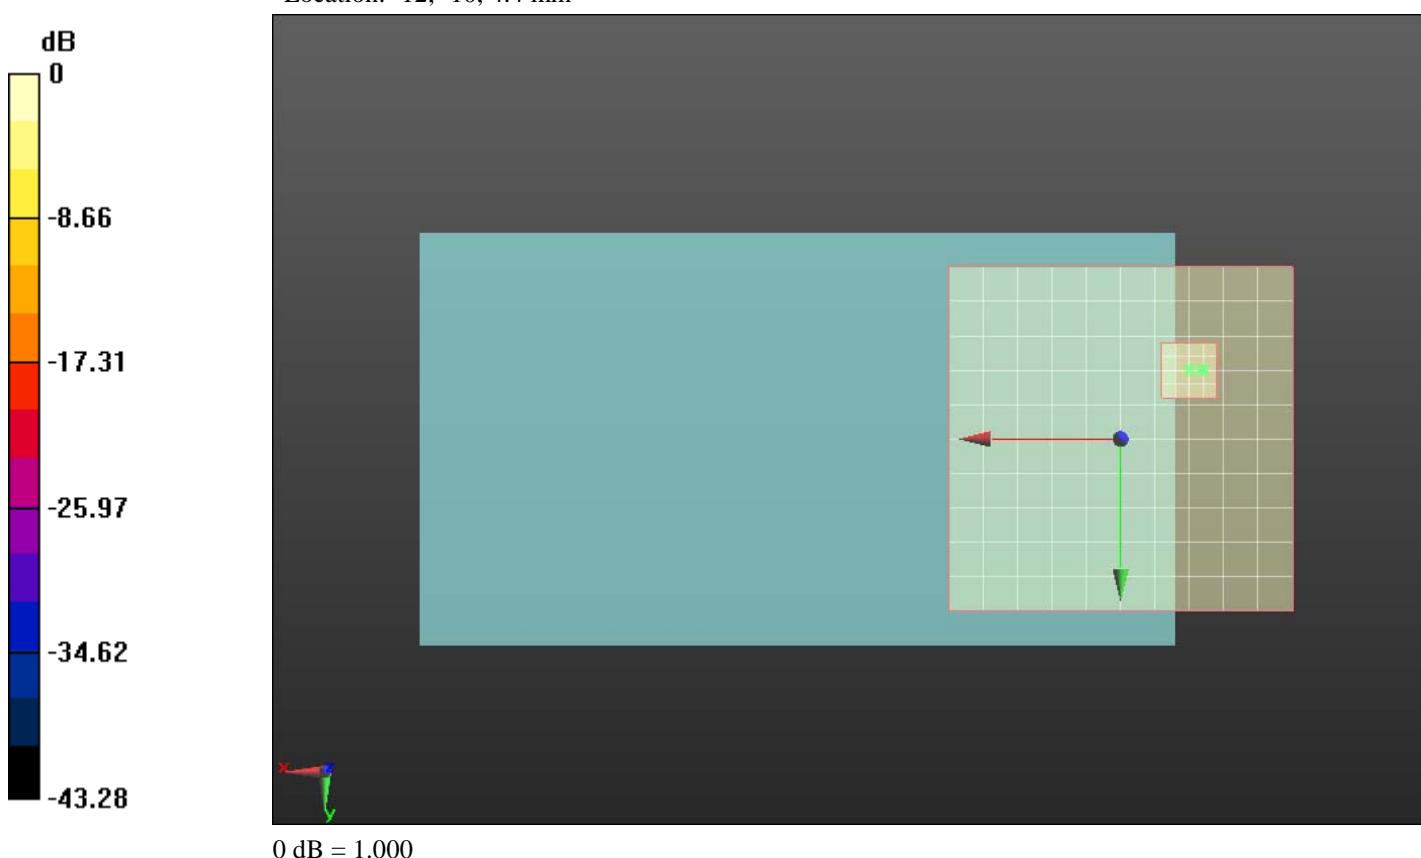

 <p>Document  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			Page <b>75(173)</b>
<p>Author Data  <b>Andrew Becker</b></p>	<p>Dates of Test  <b>Mar. 09-10, May 27, July 12, 2011</b></p>	<p>Report No  <b>RTS-3640-1103-10B</b></p>	<p>FCC ID  <b>L6ARDM70UW</b>  <b>L6AREN70UW</b></p>

Date/Time: 3/9/2011 8:10:01 PM, Date/Time: 3/9/2011 8:36:12 PM

Test Laboratory: RIM Testing Services

HAC T-Coil\_UMTS\_band\_V\_Slide\_Closed\_low\_chan\_Radial\_T

**DUT: BlackBerry; Type: Sample**

Communication System: WCDMA FDD V; Communication System Band:

Exported from older format (data unavailable - please correct).; Frequency:

836.4 MHz, Frequency: 826.4 MHz; Communication System PAR: 3.4 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/y (transversal) 5.0mm 50 x 50/ABM**

**[HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

Author Data  
**Andrew Becker**

Dates of Test

**Mar. 09-10, May 27, July 12, 2011**

Report No

**RTS-3640-1103-10B**

FCC ID

**L6ARDM70UW  
L6AREN70UW**

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**T-Coil scan/General Scans 2 2/y (transversal) 2mm 8 x 8/ABM**
**[HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm


**Cursor:**

ABM1/ABM2 = 52.63 dB

ABM1 comp = 9.06 dB A/m

BWC Factor = 0.14 dB

Location: -5, -2, 4.4 mm

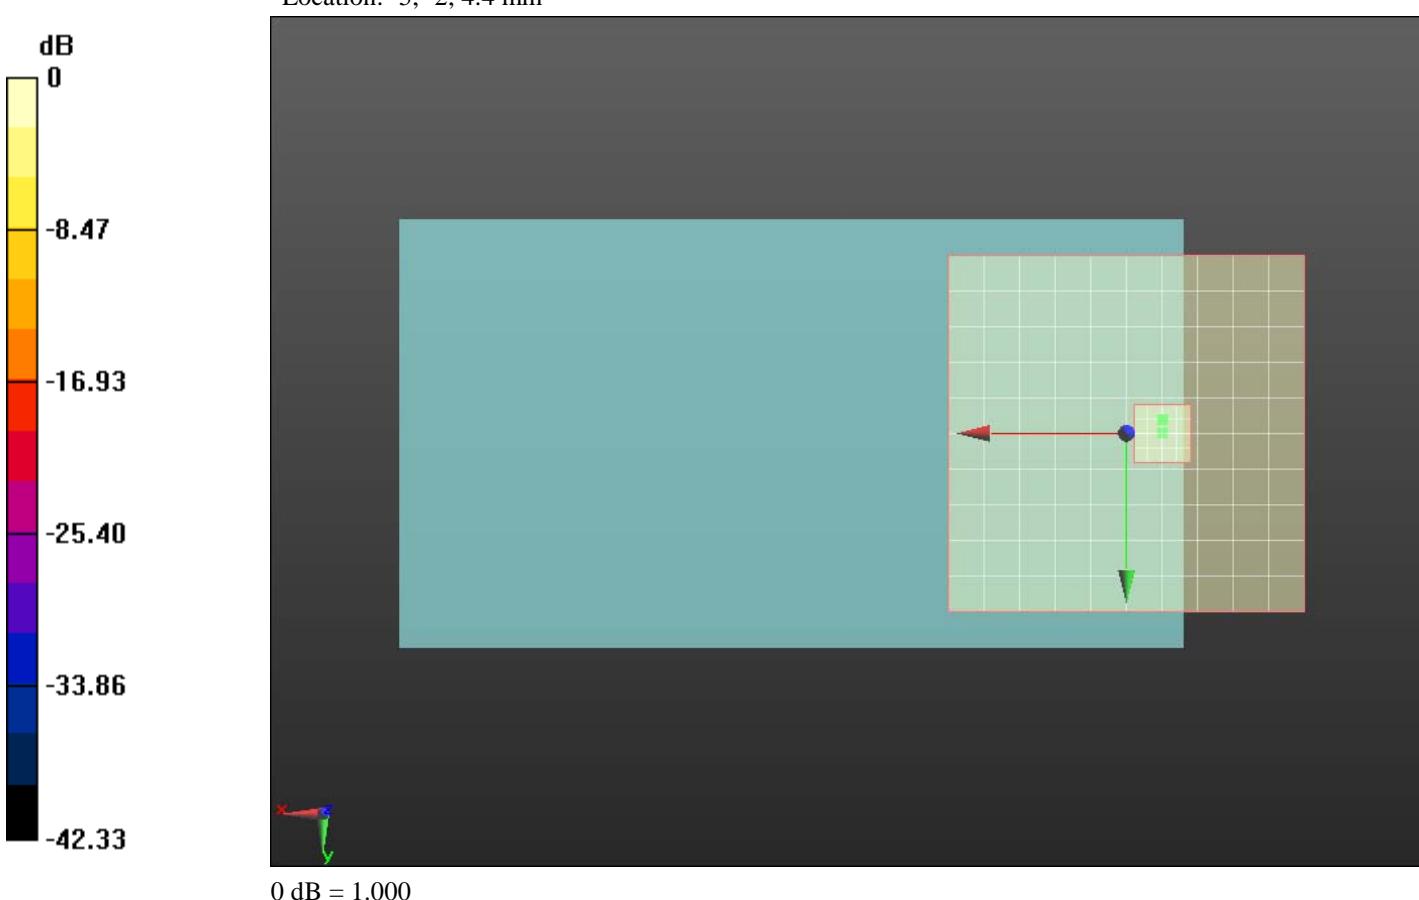

 <p><b>Document</b>  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			<b>Page</b> <b>77(173)</b>
<b>Author Data</b> <b>Andrew Becker</b>	<b>Dates of Test</b> <b>Mar. 09-10, May 27, July 12, 2011</b>	<b>Report No</b> <b>RTS-3640-1103-10B</b>	<b>FCC ID</b> <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

Date/Time: 3/9/2011 7:37:07 PM, Date/Time: 3/9/2011 7:50:35 PM, Date/Time:  
3/9/2011 8:26:54 PM

**Test Laboratory:** RIM Testing Services

HAC T-Coil\_UMTS\_band\_V\_Slide\_Closed\_mid\_chan\_Axial

**DUT:** BlackBerry; **Type:** Sample

Communication System: WCDMA FDD V; Communication System Band:

Exported from older format (data unavailable - please correct).; Frequency:

836.4 MHz; Communication System PAR: 3.4 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

**DASY5 Configuration:**

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/z (axial) 5.0mm 50 x 50/ABM [HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

 <p>Document  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			Page <b>78(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>	FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**T-Coil scan/General Scans 2/z (axial) 2mm 8 x 8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

ABM1/ABM2 = 54.76 dB

ABM1 comp = 15.91 dB A/m

BWC Factor = 0.14 dB

Location: -3, -6, 4.4 mm

**T-Coil scan/General Scans 2/z (axial) wideband at best S/N 2/ABM [HAC-2007] Freq Resp(x,y,z,f) (1x1x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_300-3000\_2s.wav

Output Gain: 69.12

Measure Window Start: 2000ms

Measure Window Length: 4000ms

BWC applied: 10.79 dB

Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

Diff = 1.86 dB

BWC Factor = 10.79 dB



Location: -5, -10, 3.7 mm

Author Data  
**Andrew Becker**

Dates of Test  
**Mar. 09-10, May 27, July 12, 2011**

Report No  
**RTS-3640-1103-10B**

FCC ID  
**L6ARDM70UW**  
**L6AREN70UW**

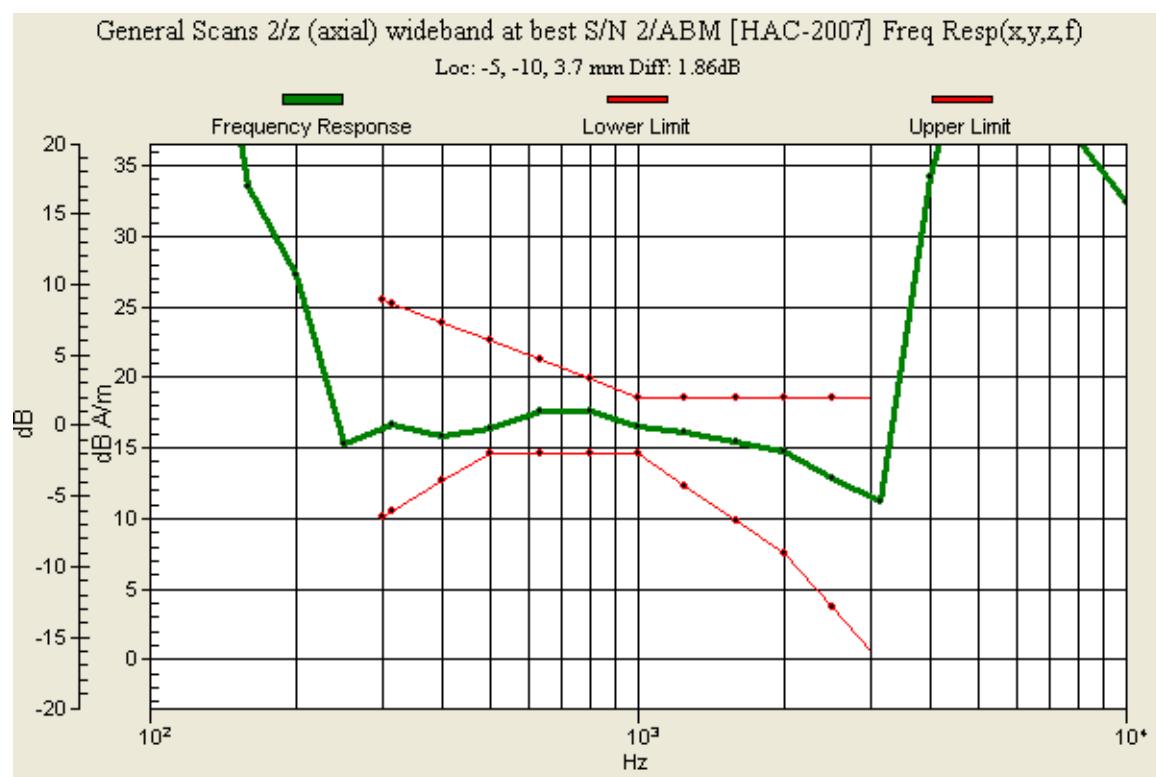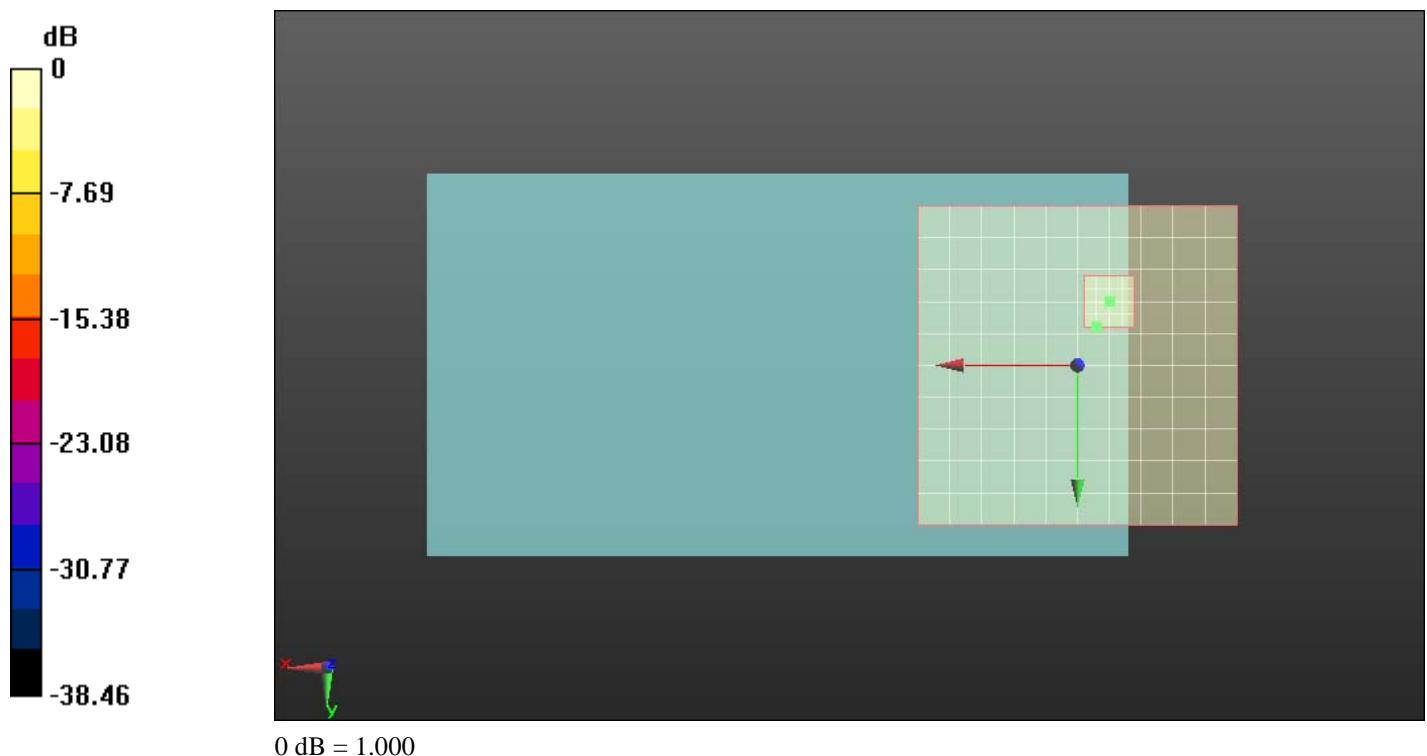

	Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>80(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

Date/Time: 3/9/2011 7:53:41 PM, Date/Time: 3/9/2011 8:07:33 PM

Test Laboratory: RIM Testing Services

HAC T-Coil\_UMTS\_band\_V\_Slide\_Closed\_mid\_chan\_Radial\_L

**DUT: BlackBerry; Type: Sample**

Communication System: WCDMA FDD V; Communication System Band:

Exported from older format (data unavailable - please correct).; Frequency:

836.4 MHz; Communication System PAR: 3.4 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/x (longitudinal) 5.0mm 50 x 50/ABM**

**[HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

	Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>81(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

Location: -10, -10, 3.7 mm

### **T-Coil scan/General Scans 2/x (longitudinal) 2mm 8 x 8/ABM**

#### **[HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm


#### **Cursor:**

ABM1/ABM2 = 52.80 dB

ABM1 comp = 8.20 dB A/m

BWC Factor = 0.14 dB

Location: -12, -10, 4.4 mm

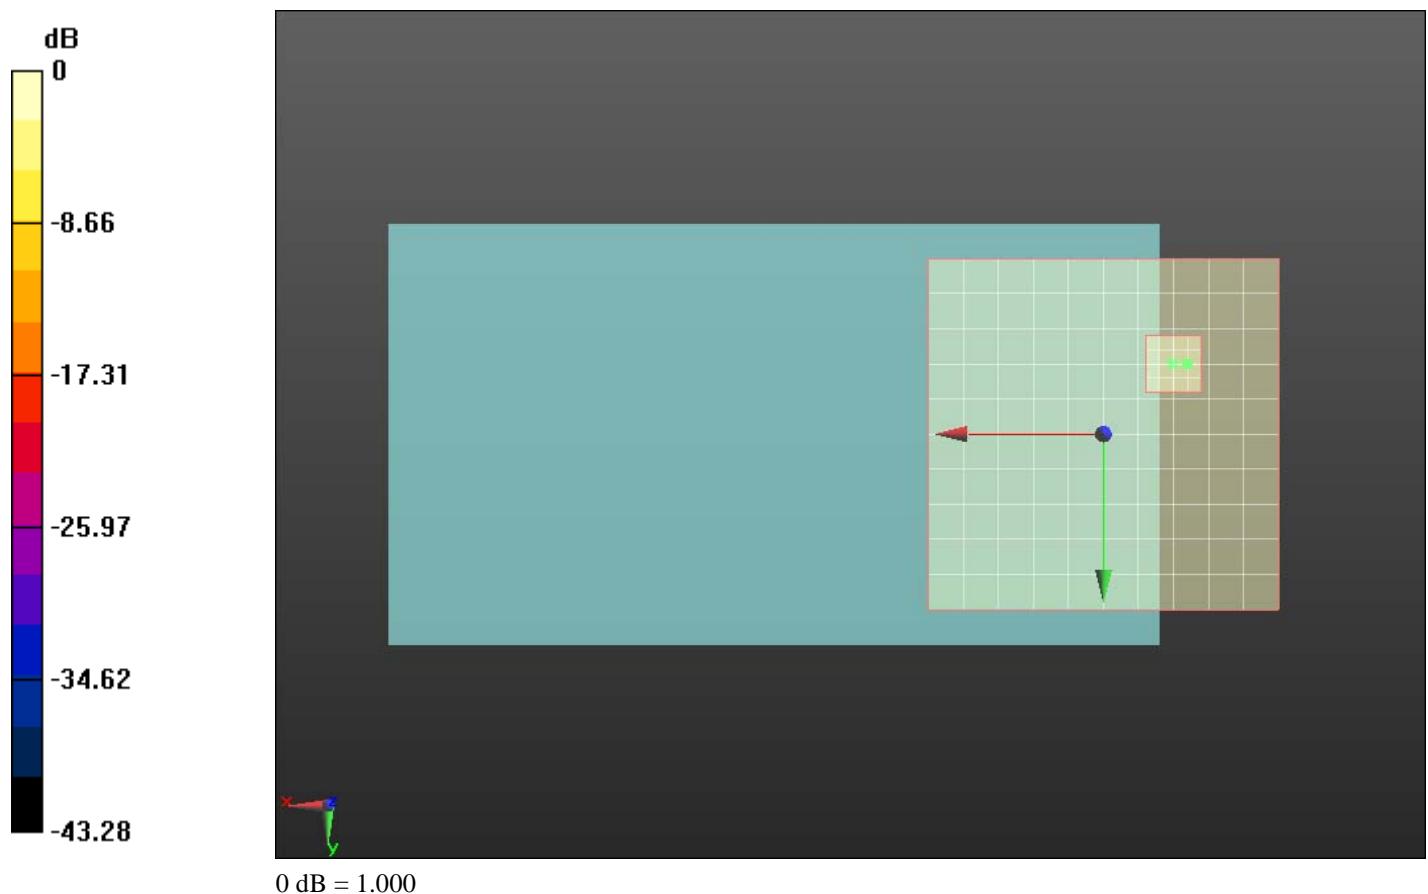Author Data  
**Andrew Becker**Dates of Test  
**Mar. 09-10, May 27, July  
12, 2011**Report No  
**RTS-3640-1103-10B**FCC ID  
**L6ARDM70UW  
L6AREN70UW**

	Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>83(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

Date/Time: 3/9/2011 8:10:01 PM, Date/Time: 3/9/2011 8:23:27 PM

Test Laboratory: RIM Testing Services

HAC T-Coil\_UMTS\_band\_V\_Slide\_Closed\_mid\_chan\_Radial\_T

**DUT: BlackBerry; Type: Sample**

Communication System: WCDMA FDD V; Communication System Band:

Exported from older format (data unavailable - please correct).; Frequency:

836.4 MHz; Communication System PAR: 3.4 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/y (transversal) 5.0mm 50 x 50/ABM**

**[HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**T-Coil scan/General Scans 2/y (transversal) 2mm 8 x 8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm


**Cursor:**

ABM1/ABM2 = 52.75 dB

ABM1 comp = 9.20 dB A/m

BWC Factor = 0.14 dB

Location: -3, 0, 4.4 mm

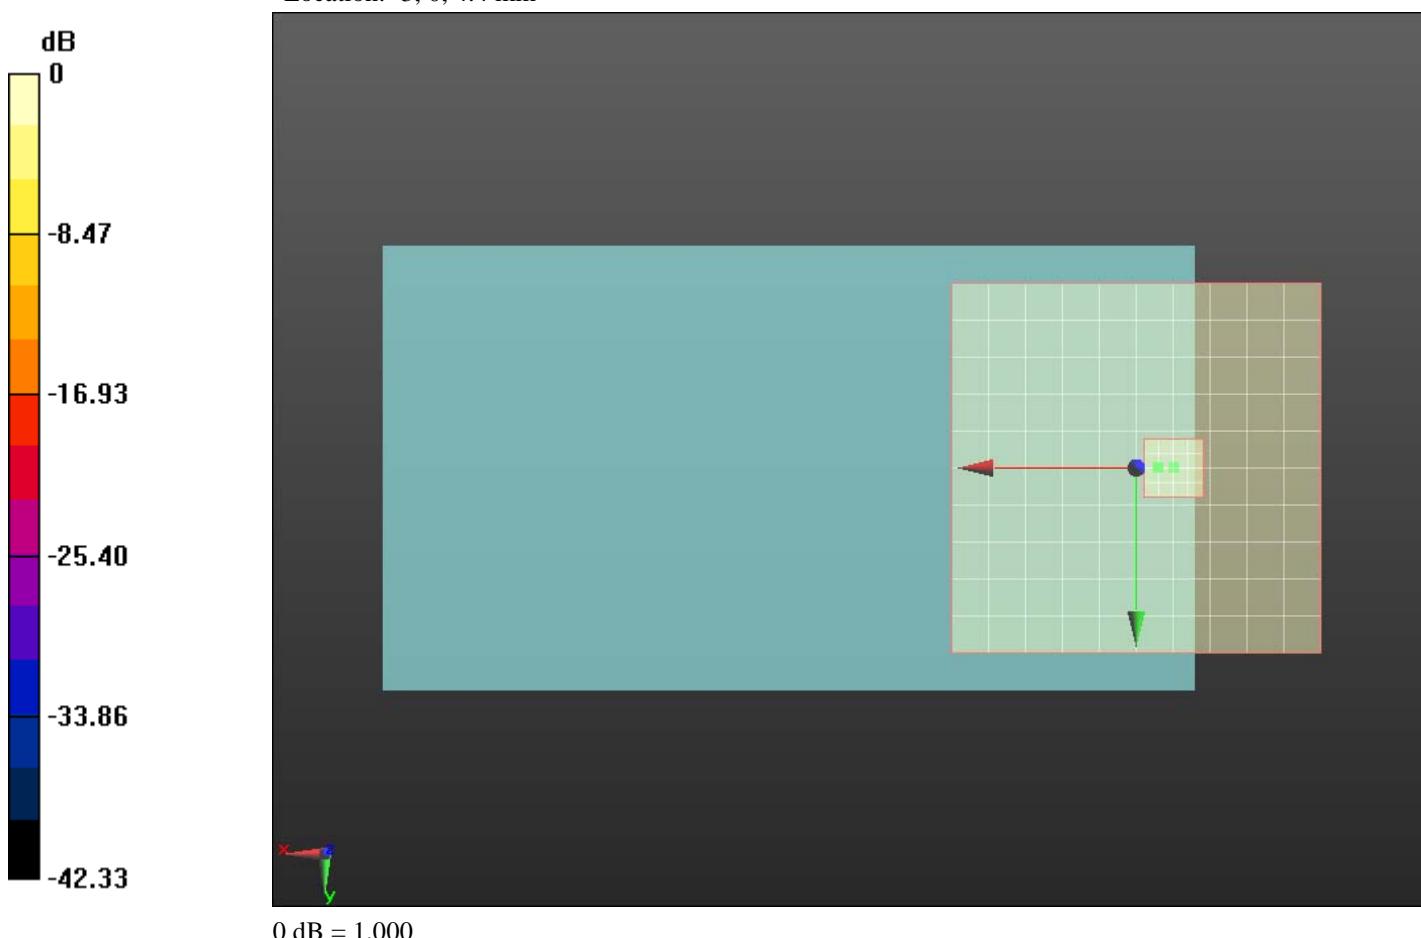

	Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>85(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

Date/Time: 3/9/2011 7:37:07 PM, Date/Time: 3/9/2011 8:41:58 PM, Date/Time:  
3/9/2011 8:52:03 PM

Test Laboratory: RIM Testing Services

HAC T-Coil\_UMTS\_band\_V\_Slide\_Closed\_high\_chan\_Axial

**DUT: BlackBerry; Type: Sample**

Communication System: WCDMA FDD V; Communication System Band:

Exported from older format (data unavailable - please correct).; Frequency:

836.4 MHz, Frequency: 846.6 MHz; Communication System PAR: 3.4 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/z (axial) 5.0mm 50 x 50/ABM [HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

	Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>86(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**T-Coil scan/General Scans 2 2 2/z (axial) 2mm 8 x 8/ABM**

**[HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

ABM1/ABM2 = 54.81 dB

ABM1 comp = 15.61 dB A/m

BWC Factor = 0.14 dB

Location: -7, -10, 4.4 mm

**T-Coil scan/General Scans 2 2 2/z (axial) wideband at best**

**S/N 2/ABM [HAC-2007] Freq Resp(x,y,z,f) (1x1x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_300-3000\_2s.wav

Output Gain: 69.12

Measure Window Start: 2000ms

Measure Window Length: 4000ms


BWC applied: 10.78 dB

Device Reference Point: 0, 0, -6.3 mm


Diff = 1.89 dB

BWC Factor = 10.78 dB

Location: -5, -10, 3.7 mm

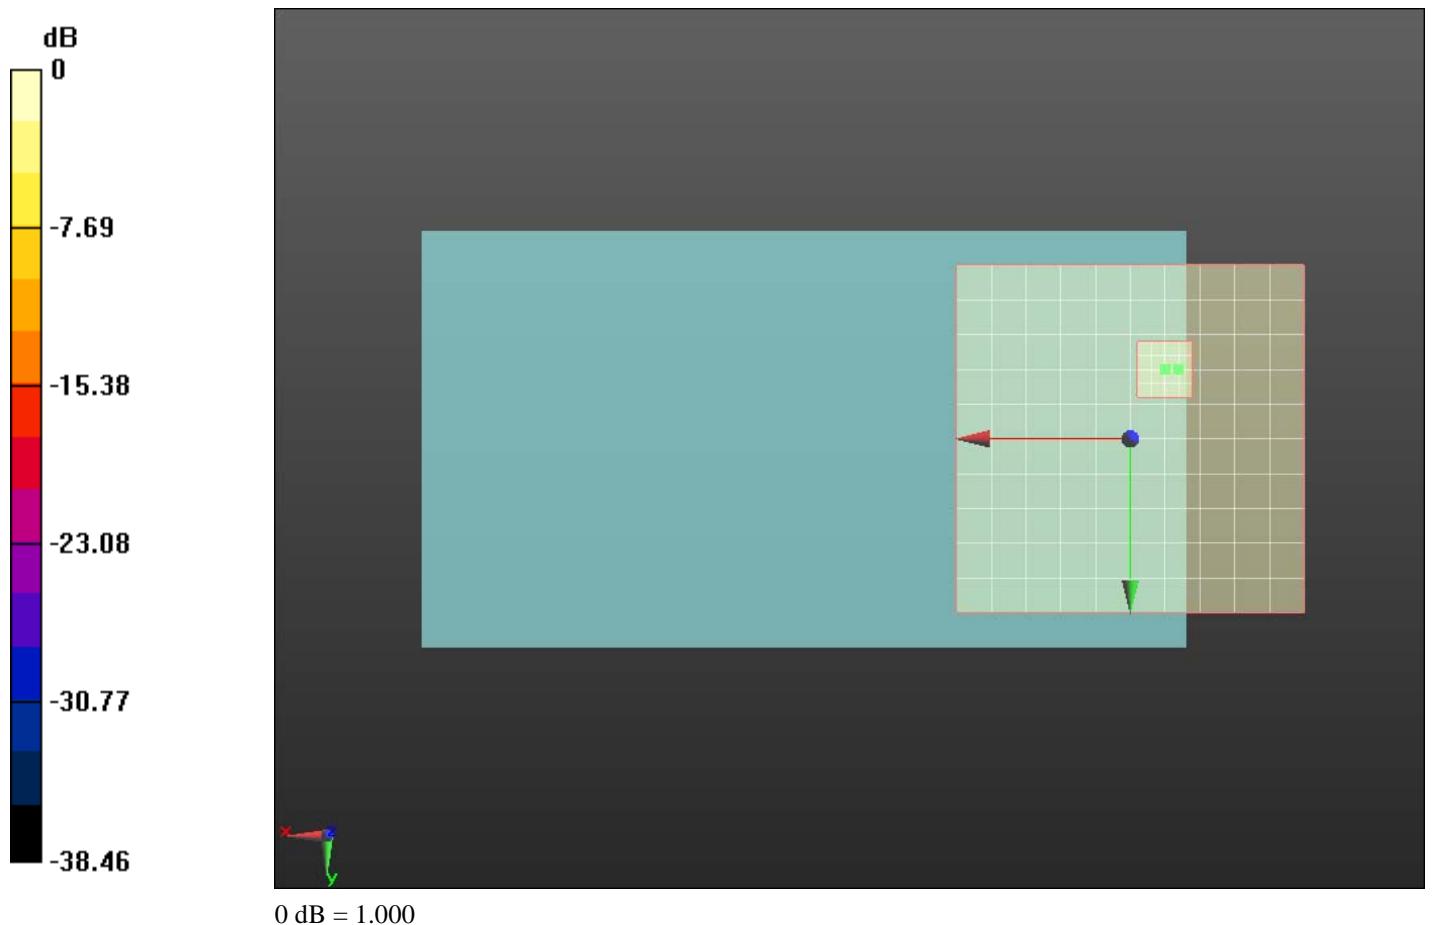

Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>	FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>
-------------------------------------	---	---------------------------------------	--

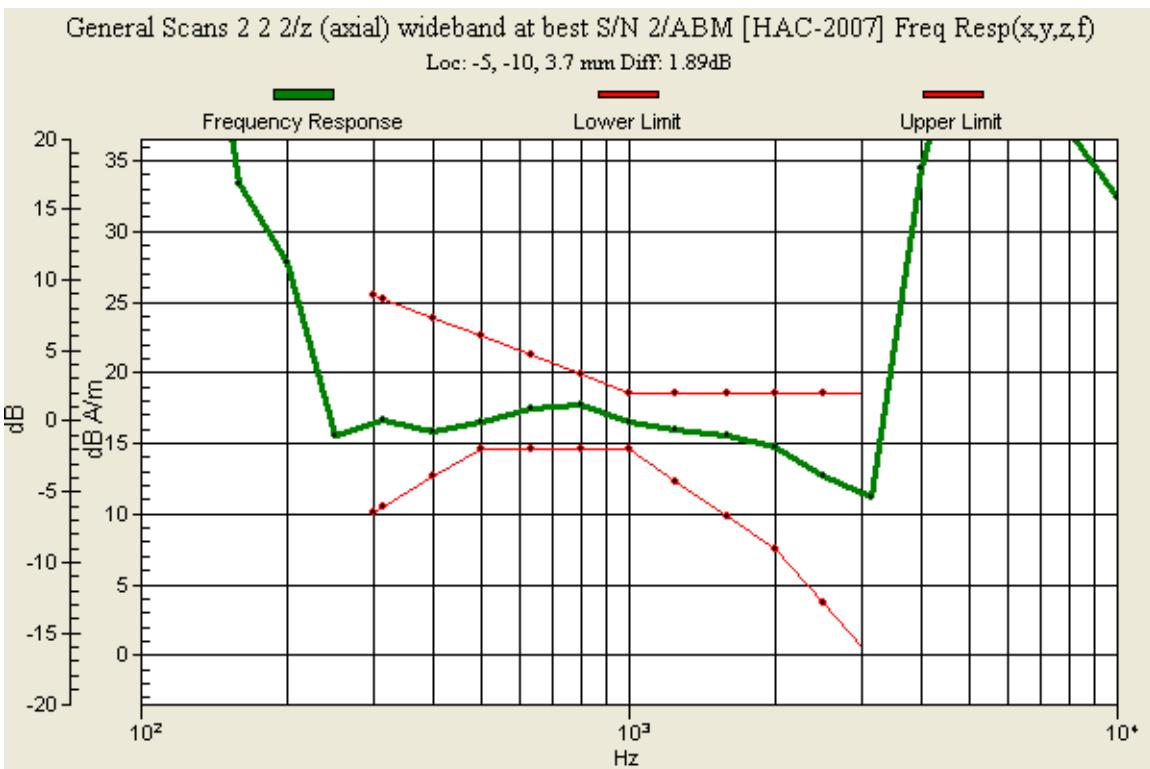

	Document Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW	Page 89(173)	
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>	FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

Date/Time: 3/9/2011 7:53:41 PM, Date/Time: 3/9/2011 8:45:08 PM

Test Laboratory: RIM Testing Services

HAC T-Coil\_UMTS\_band\_V\_Slide\_Closed\_high\_chan\_Radial\_L

**DUT: BlackBerry; Type: Sample**

Communication System: WCDMA FDD V; Communication System Band:

Exported from older format (data unavailable - please correct).; Frequency:

836.4 MHz, Frequency: 846.6 MHz; Communication System PAR: 3.4 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/x (longitudinal) 5.0mm 50 x 50/ABM**

**[HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

<b>RIM Testing Services™</b>	Document Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW	Page 90(173)
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**T-Coil scan/General Scans 2 2 2/x (longitudinal) 2mm 8 x 8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm


**Cursor:**

ABM1/ABM2 = 52.41 dB

ABM1 comp = 7.78 dB A/m

BWC Factor = 0.14 dB

Location: -12, -8, 4.4 mm

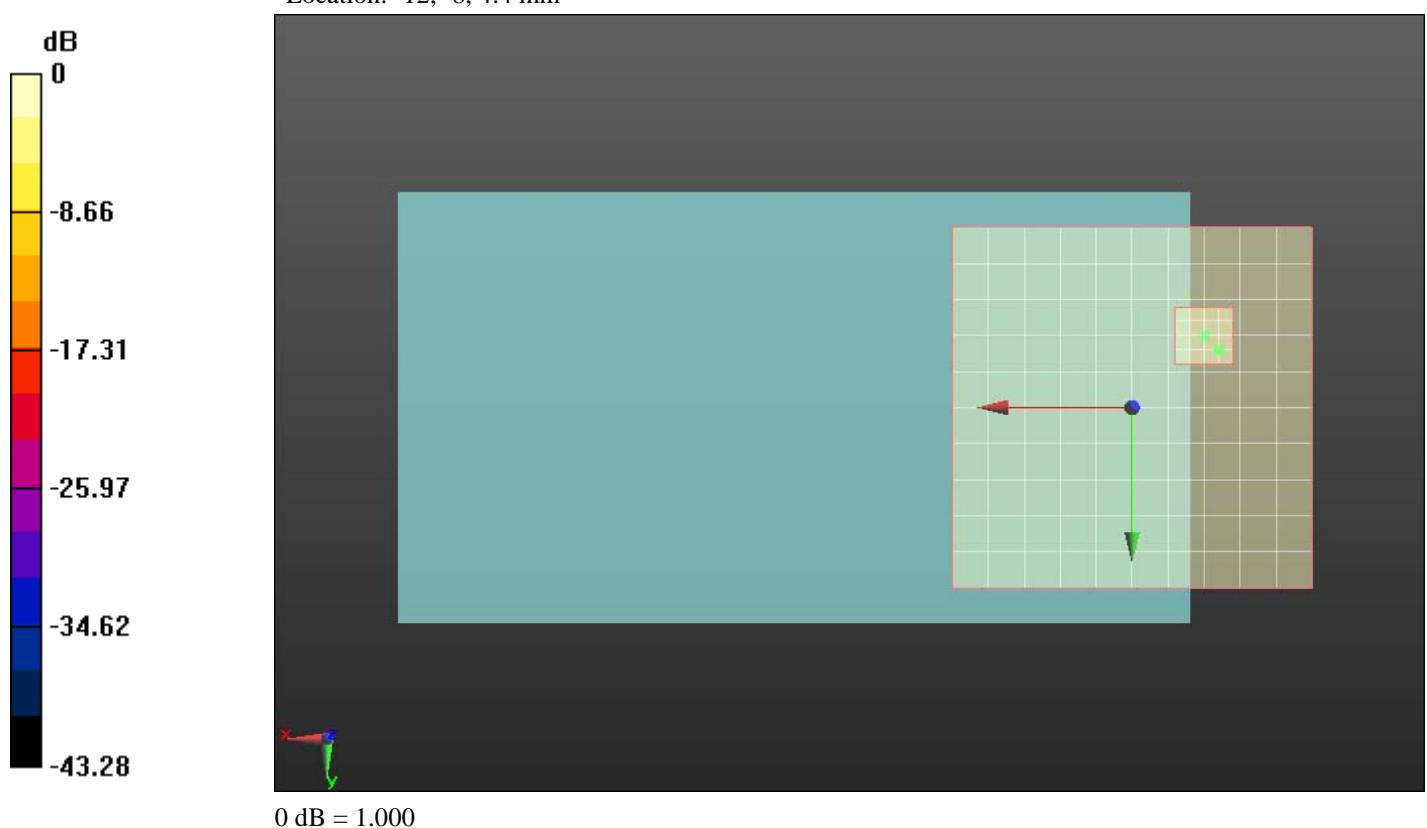

	Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>91(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

Date/Time: 3/9/2011 8:10:01 PM, Date/Time: 3/9/2011 8:48:36 PM

Test Laboratory: RIM Testing Services

HAC T-Coil\_UMTS\_band\_V\_Slide\_Closed\_high\_chan\_Radial\_T

**DUT: BlackBerry; Type: Sample**

Communication System: WCDMA FDD V; Communication System Band:

Exported from older format (data unavailable - please correct).; Frequency:

836.4 MHz, Frequency: 846.6 MHz; Communication System PAR: 3.4 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/y (transversal) 5.0mm 50 x 50/ABM**

**[HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

<b>RIM Testing Services™</b>	Document Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW	Page 92(173)
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**T-Coil scan/General Scans 2 2 2/y (transversal) 2mm 8 x 8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm


**Cursor:**

ABM1/ABM2 = 52.44 dB

ABM1 comp = 8.26 dB A/m

BWC Factor = 0.14 dB

Location: -7, 0, 4.4 mm

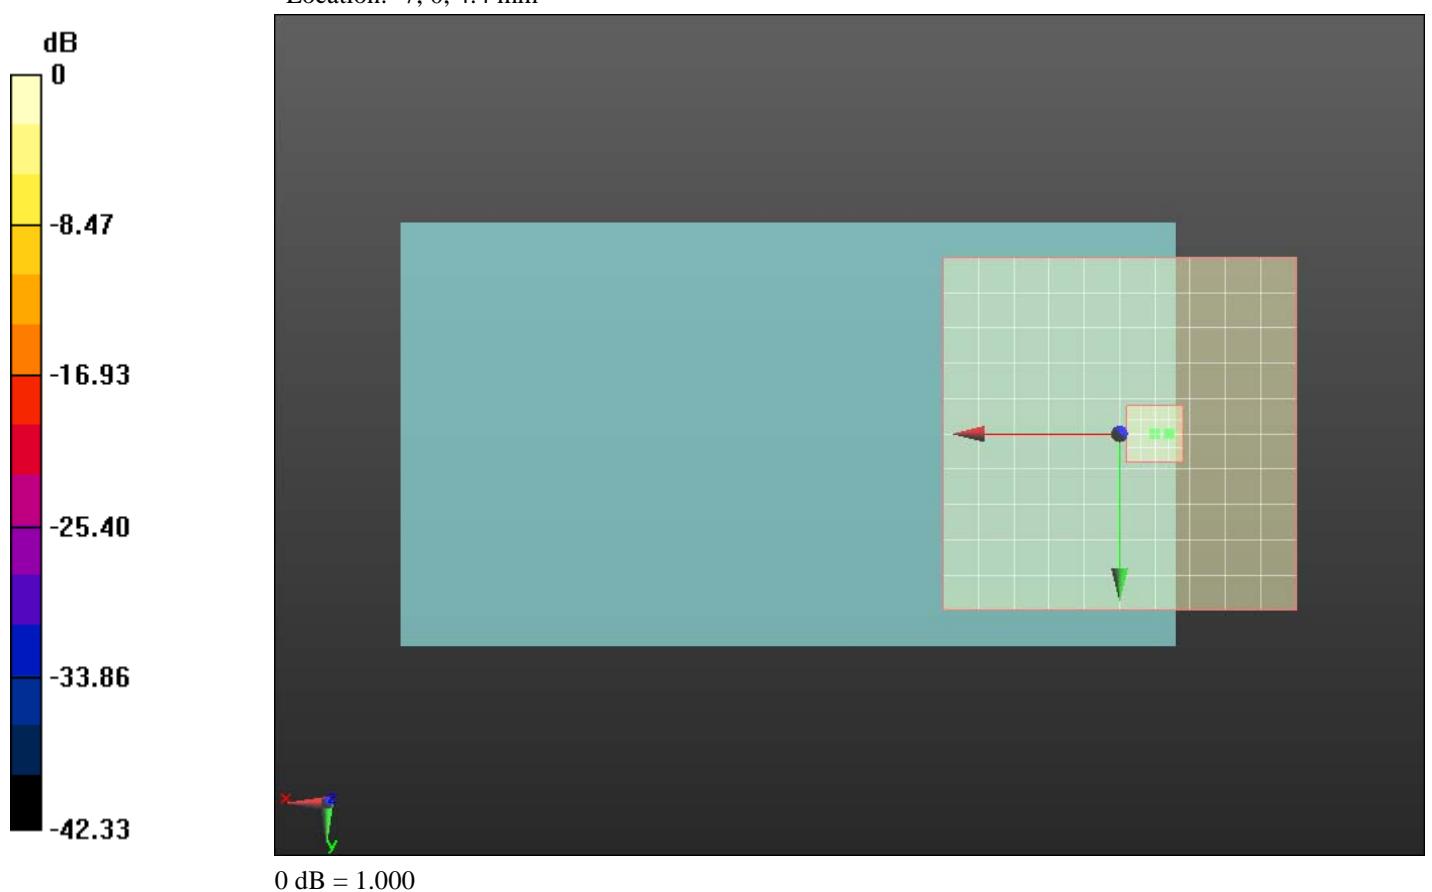

 <p>Document  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			Page <b>93(173)</b>
<p>Author Data  <b>Andrew Becker</b></p>	<p>Dates of Test  <b>Mar. 09-10, May 27, July 12, 2011</b></p>	<p>Report No  <b>RTS-3640-1103-10B</b></p>	<p>FCC ID  <b>L6ARDM70UW</b>  <b>L6AREN70UW</b></p>

Date/Time: 3/9/2011 9:30:42 PM, Date/Time: 3/9/2011 9:44:11 PM, Date/Time:  
 3/9/2011 10:21:30 PM

Test Laboratory: RIM Testing Services

HAC T-Coil\_UMTS\_band\_V\_Slide\_Open\_mid\_chan\_Axial

**DUT: BlackBerry; Type: Sample;**

Communication System: WCDMA FDD V; Communication System Band:

Exported from older format (data unavailable - please correct).; Frequency:

836.4 MHz; Communication System PAR: 3.4 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/z (axial) 5.0mm 50 x 50/ABM [HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

	Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>94(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**T-Coil scan/General Scans 2/z (axial) 2mm 8 x 8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

ABM1/ABM2 = 55.11 dB

ABM1 comp = 17.43 dB A/m

BWC Factor = 0.14 dB

Location: -2, -10, 4.4 mm

**T-Coil scan/General Scans 2/z (axial) wideband at best S/N 2/ABM [HAC-2007] Freq Resp(x,y,z,f) (1x1x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_300-3000\_2s.wav

Output Gain: 69.12

Measure Window Start: 2000ms

Measure Window Length: 4000ms

BWC applied: 10.78 dB

Device Reference Point: 0, 0, -6.3 mm

Diff = 2.00 dB

BWC Factor = 10.78 dB


Location: 0, -10, 3.7 mm

Author Data  
**Andrew Becker**


Dates of Test  
**Mar. 09-10, May 27, July  
12, 2011**

Report No  
**RTS-3640-1103-10B**

FCC ID  
**L6ARDM70UW  
L6AREN70UW**

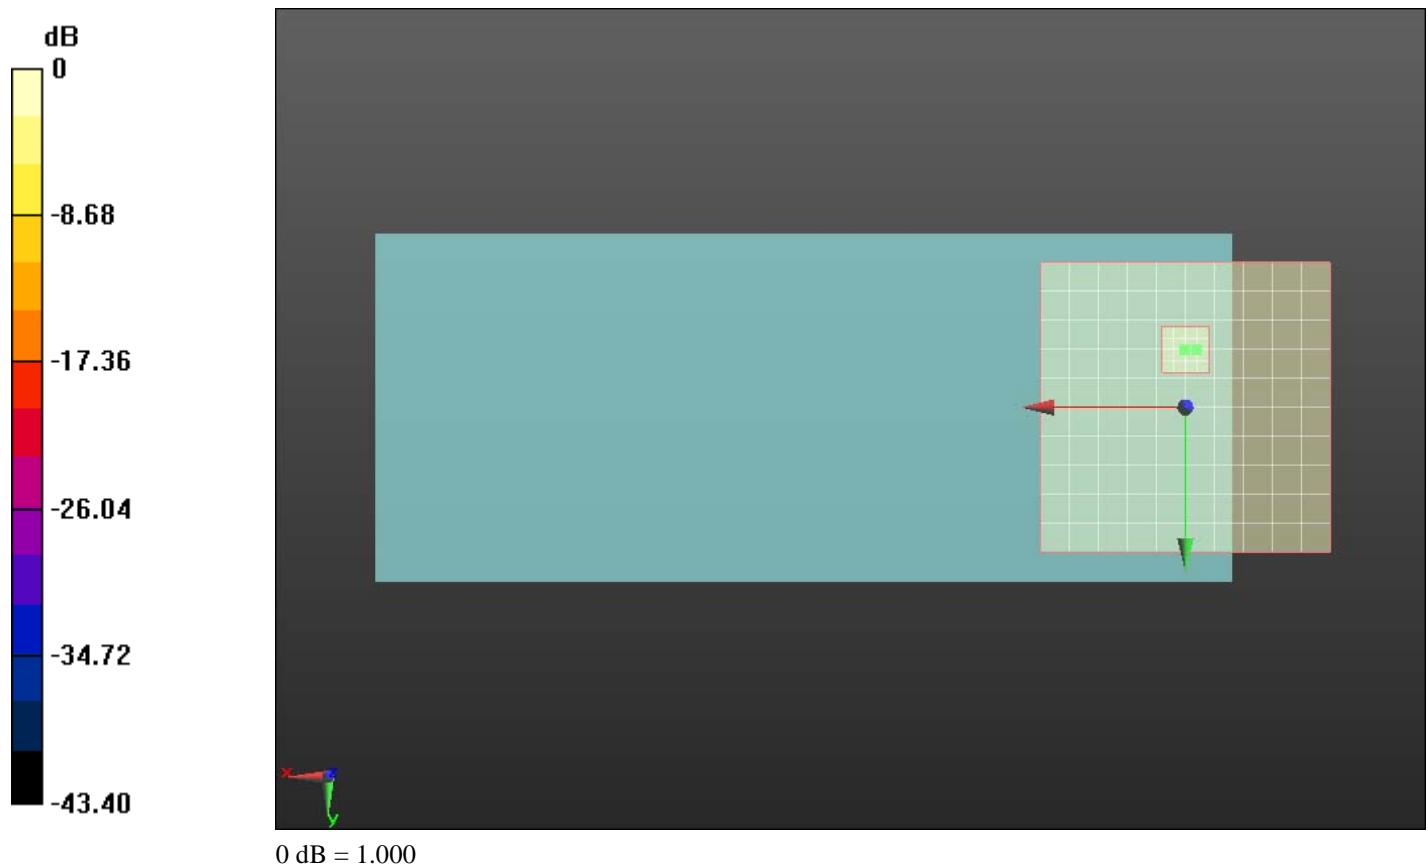

Document Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW	Page 96(173)
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b> Report No <b>RTS-3640-1103-10B</b> FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

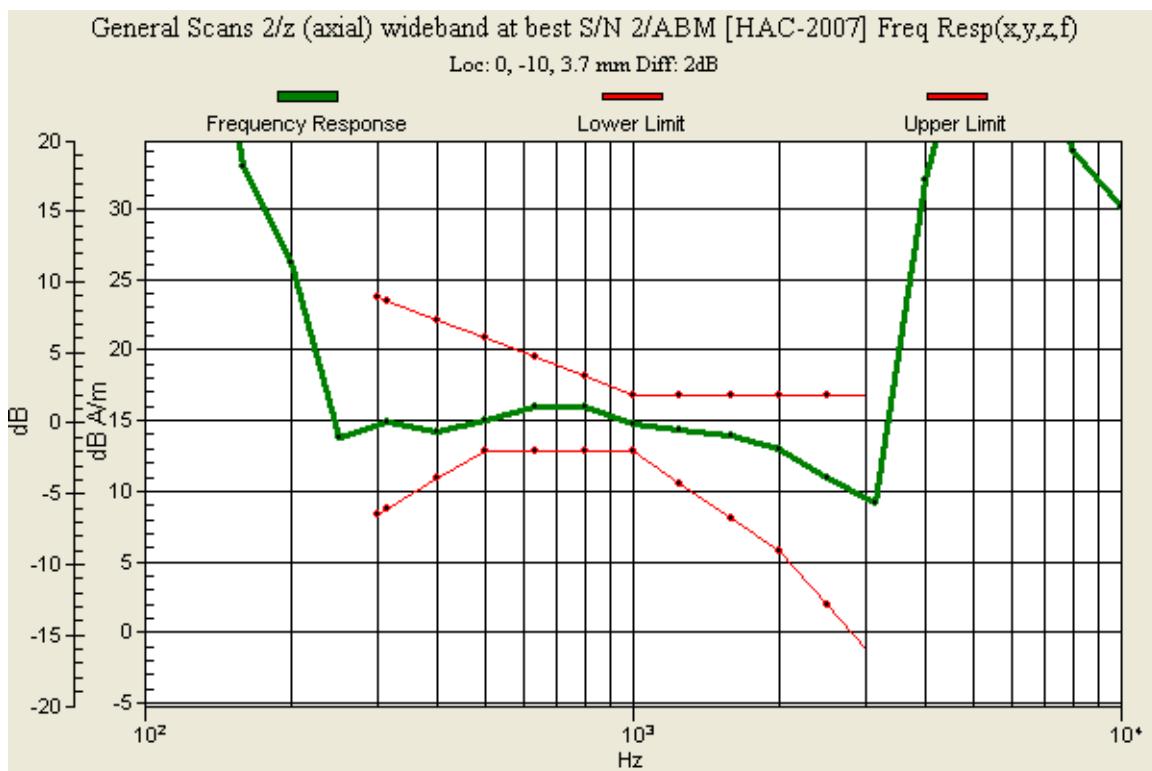

 <p><b>Document</b>  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			<b>Page</b> <b>97(173)</b>
<b>Author Data</b> <b>Andrew Becker</b>	<b>Dates of Test</b> <b>Mar. 09-10, May 27, July 12, 2011</b>	<b>Report No</b> <b>RTS-3640-1103-10B</b>	<b>FCC ID</b> <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

Date/Time: 3/9/2011 9:47:16 PM, Date/Time: 3/9/2011 10:01:09 PM

Test Laboratory: RIM Testing Services

HAC T-Coil\_UMTS\_band\_V\_Slide\_Open\_mid\_chan\_Radial\_L

**DUT: BlackBerry; Type: Sample**

Communication System: WCDMA FDD V; Communication System Band:

Exported from older format (data unavailable - please correct).; Frequency:

836.4 MHz; Communication System PAR: 3.4 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/x (longitudinal) 5.0mm 50 x 50/ABM**

**[HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

<b>RIM Testing Services™</b>	Document Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW	Page 98(173)
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

### **T-Coil scan/General Scans 2/x (longitudinal) 2mm 8 x 8/ABM**

#### **[HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm


#### **Cursor:**

ABM1/ABM2 = 53.67 dB

ABM1 comp = 8.76 dB A/m

BWC Factor = 0.14 dB

Location: -12, -10, 4.4 mm

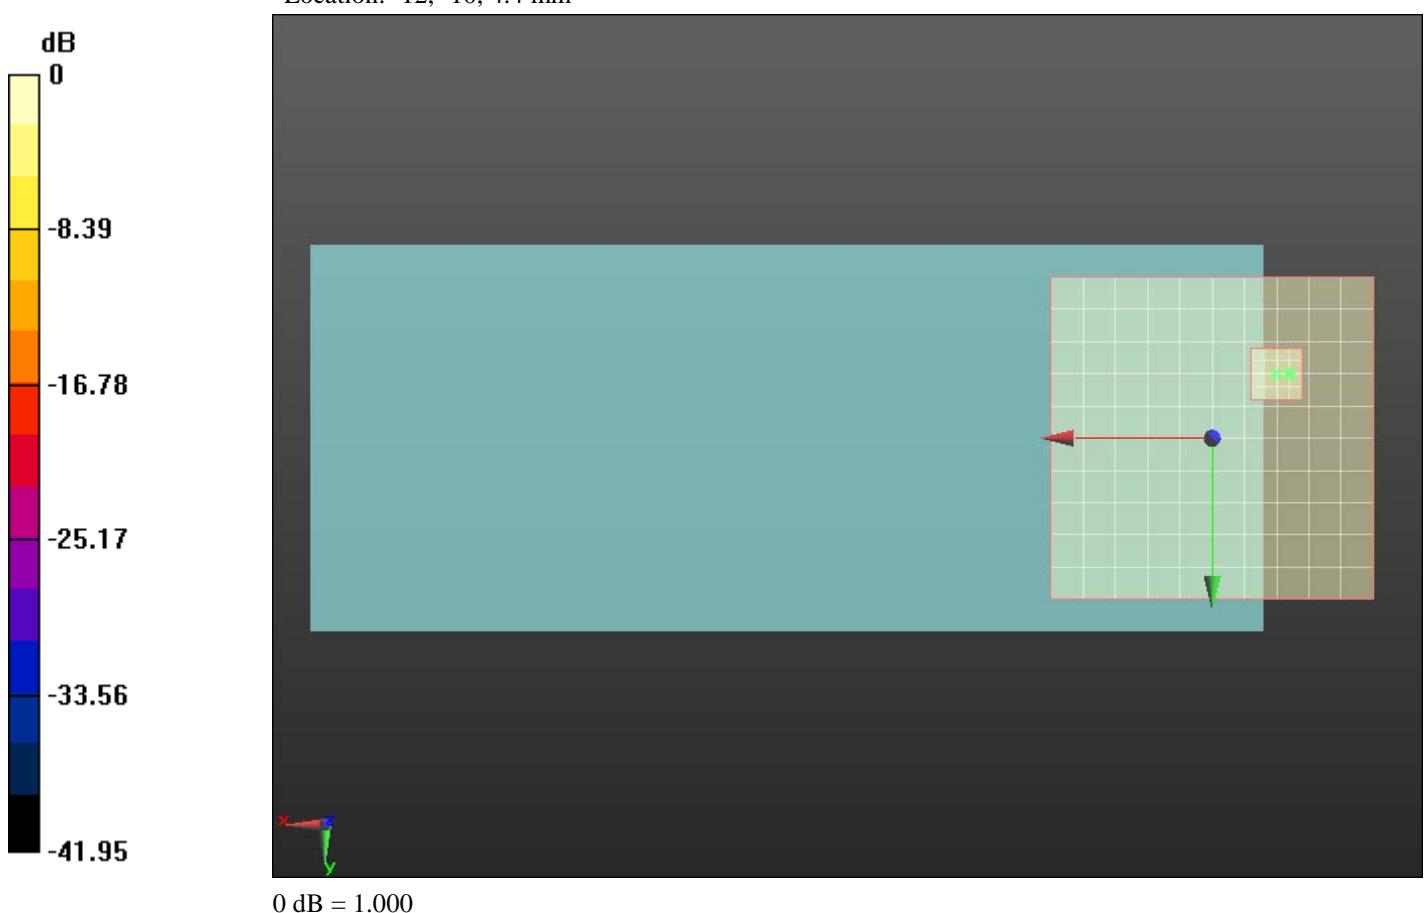

 <p>Document  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			Page <b>99(173)</b>
<p>Author Data  <b>Andrew Becker</b></p>	<p>Dates of Test  <b>Mar. 09-10, May 27, July 12, 2011</b></p>	<p>Report No  <b>RTS-3640-1103-10B</b></p>	<p>FCC ID  <b>L6ARDM70UW</b>  <b>L6AREN70UW</b></p>

Date/Time: 3/9/2011 10:04:33 PM, Date/Time: 3/9/2011 10:18:03 PM

Test Laboratory: RIM Testing Services

HAC T-Coil\_UMTS\_band\_V\_Slide\_Open\_mid\_chan\_Radial\_T

**DUT: BlackBerry; Type: Sample;**

Communication System: WCDMA FDD V; Communication System Band:

Exported from older format (data unavailable - please correct).; Frequency:

836.4 MHz; Communication System PAR: 3.4 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/y (transversal) 5.0mm 50 x 50/ABM**

**[HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

Author Data  
 Andrew Becker

 Dates of Test  
 Mar. 09-10, May 27, July  
 12, 2011

 Report No  
 RTS-3640-1103-10B

 FCC ID  
 L6ARDM70UW  
 L6AREN70UW

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**T-Coil scan/General Scans 2/y (transversal) 2mm 8 x 8/ABM**  
**[HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm


**Cursor:**

ABM1/ABM2 = 53.25 dB

ABM1 comp = 9.22 dB A/m

BWC Factor = 0.14 dB

Location: -3, -2, 4.4 mm

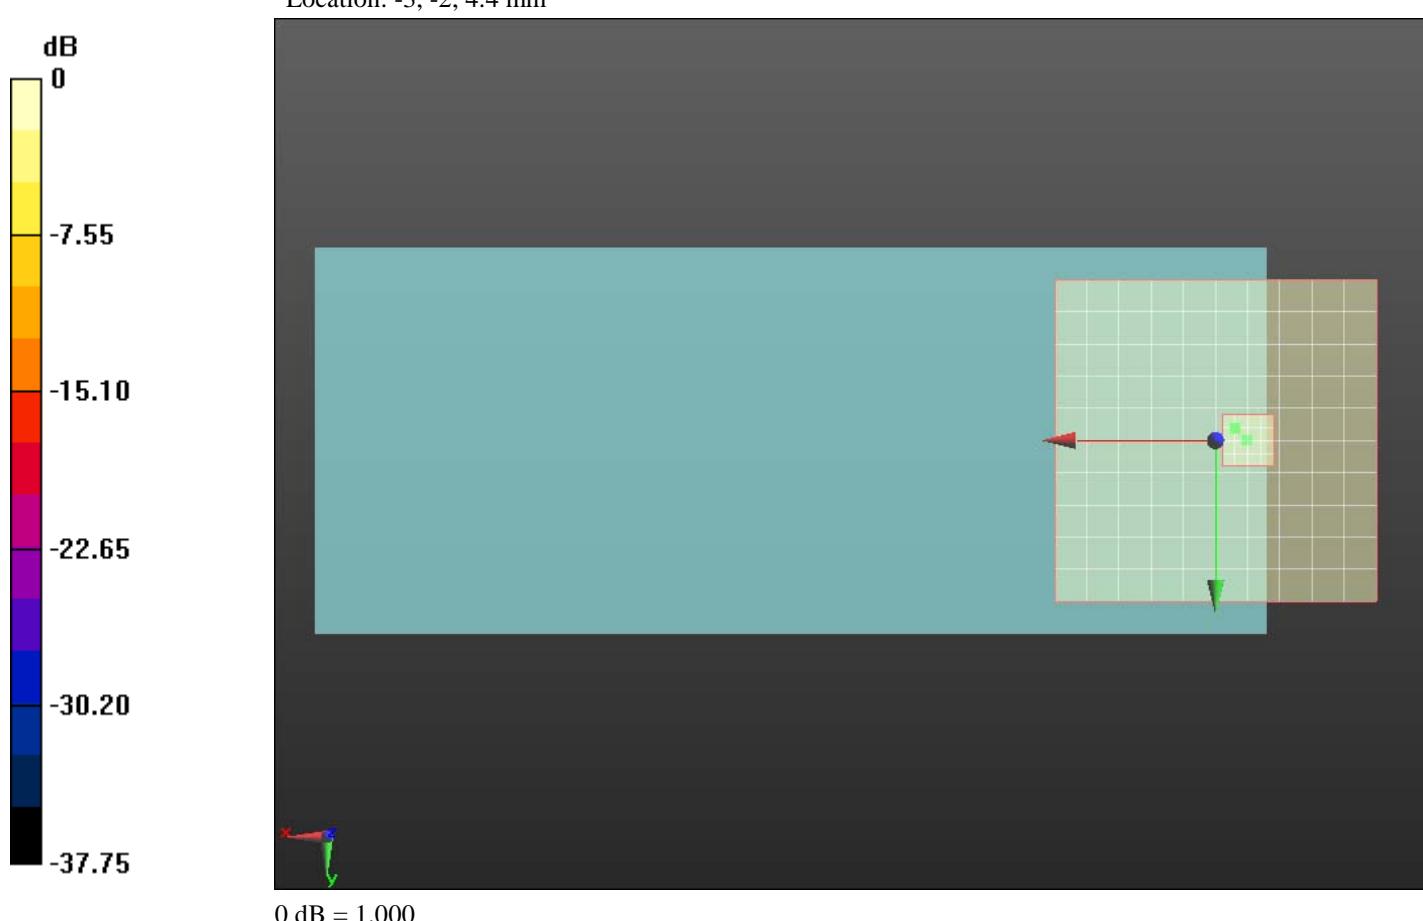

 <p>Document  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			Page <b>101(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>	FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

Date/Time: 3/9/2011 11:34:11 PM, Date/Time: 3/9/2011 11:47:39 PM,

Date/Time: 3/10/2011 12:38:35 AM

Test Laboratory: RIM Testing Services

HAC T-Coil\_UMTS\_band\_II\_Slide\_Closed\_low\_chan\_Axial

**DUT: BlackBerry; Type: Sample**

Communication System: WCDMA FDD II; Communication System Band:

Exported from older format (data unavailable - please correct).; Frequency:

1852.4 MHz; Communication System PAR: 3.4 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/z (axial) 5.0mm 50 x 50/ABM [HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

	Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>102(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**T-Coil scan/General Scans 2/z (axial) 2mm 8 x 8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

ABM1/ABM2 = 54.86 dB

ABM1 comp = 16.39 dB A/m

BWC Factor = 0.14 dB

Location: -3, -6, 4.4 mm

**T-Coil scan/General Scans 2/z (axial) wideband at best S/N 2/ABM [HAC-2007] Freq Resp(x,y,z,f) (1x1x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_300-3000\_2s.wav

Output Gain: 69.12

Measure Window Start: 2000ms

Measure Window Length: 4000ms

BWC applied: 10.78 dB


Device Reference Point: 0, 0, -6.3 mm

**Cursor:**


Diff = 1.87 dB

BWC Factor = 10.78 dB

Location: -5, -10, 3.7 mm

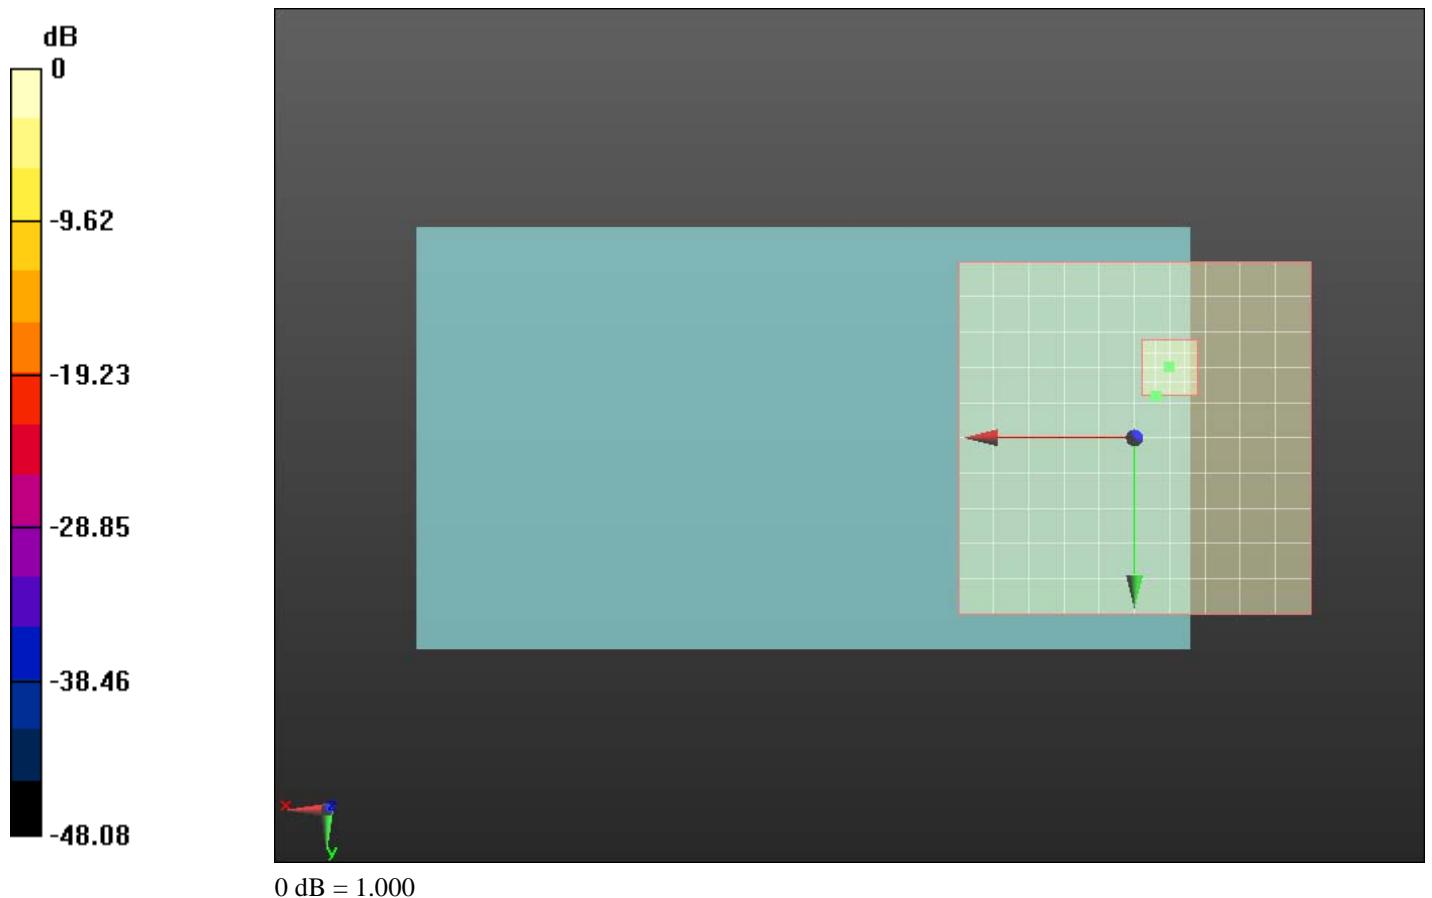

Document Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW	Page 104(173)
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b> Report No <b>RTS-3640-1103-10B</b> FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

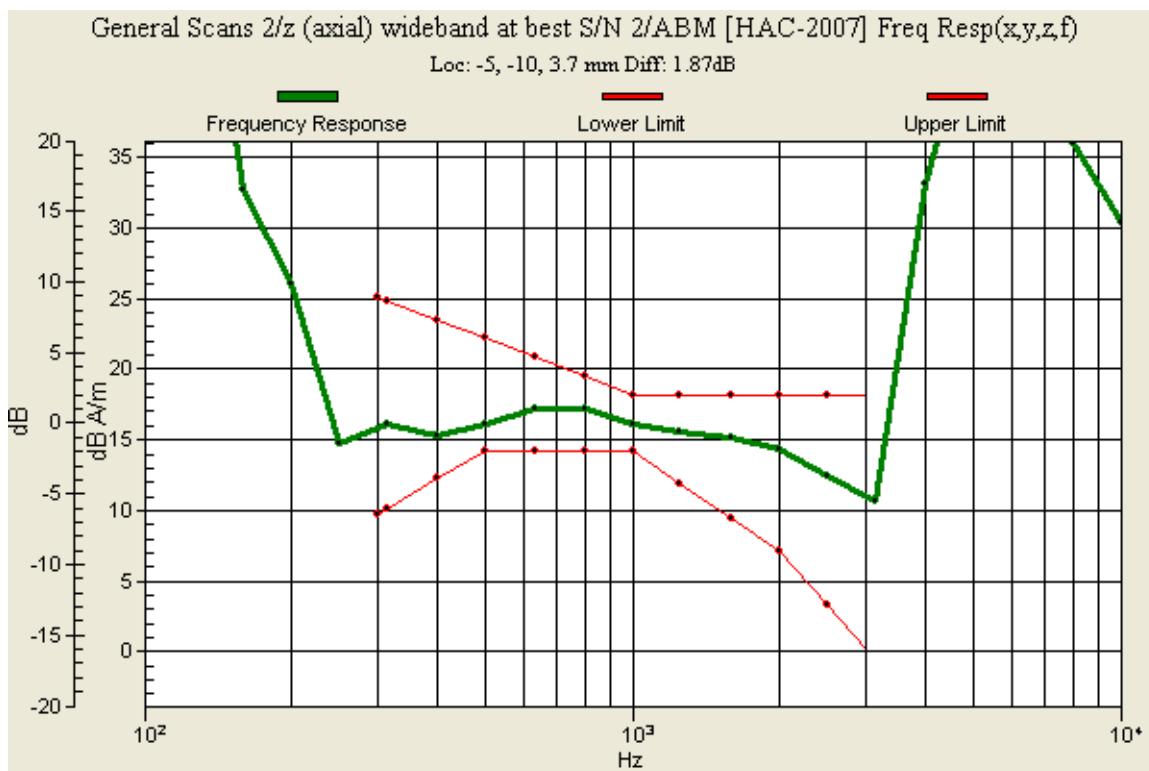

	Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>105(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

Date/Time: 3/9/2011 11:50:45 PM, Date/Time: 3/10/2011 12:04:37 AM

Test Laboratory: RIM Testing Services

HAC T-Coil\_UMTS\_band\_II\_Slide\_Closed\_low\_chan\_Radial\_L

**DUT: BlackBerry; Type: Sample**

Communication System: WCDMA FDD II; Communication System Band:

Exported from older format (data unavailable - please correct).; Frequency:

1852.4 MHz; Communication System PAR: 3.4 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/x (longitudinal) 5.0mm 50 x 50/ABM**

**[HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>	FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>
-------------------------------------	---	---------------------------------------	--

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**T-Coil scan/General Scans 2/x (longitudinal) 2mm 8 x 8/ABM**

**[HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm


**Cursor:**

ABM1/ABM2 = 52.56 dB

ABM1 comp = 7.47 dB A/m

BWC Factor = 0.14 dB

Location: -14, -8, 4.4 mm

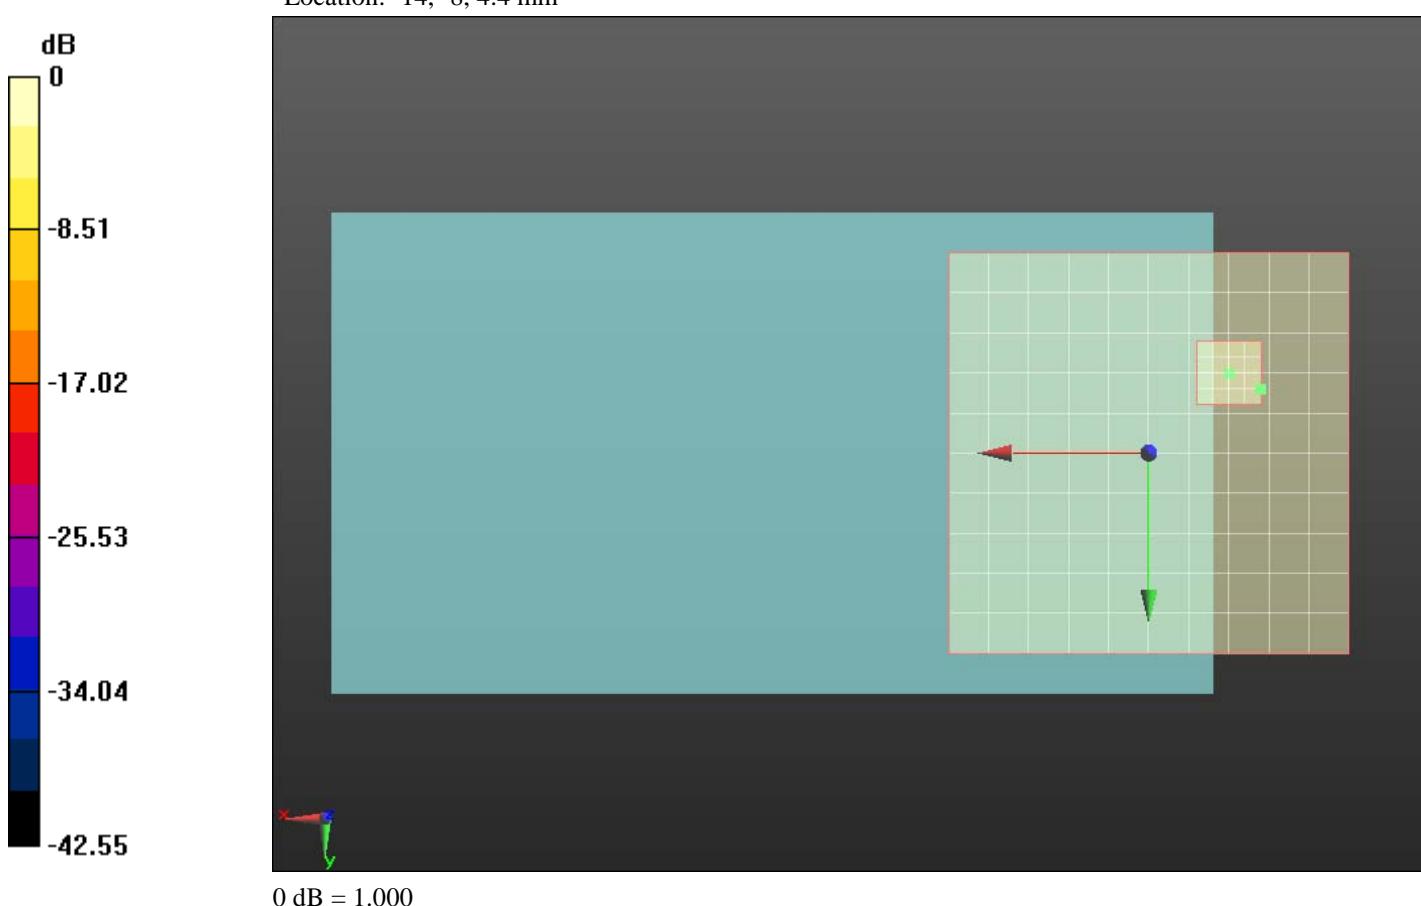

	Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>107(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

Date/Time: 3/10/2011 12:08:02 AM, Date/Time: 3/10/2011 12:35:08 AM

Test Laboratory: RIM Testing Services

HAC T-Coil\_UMTS\_band\_II\_Slide\_Closed\_low\_chan\_Radial\_T

**DUT: BlackBerry; Type: Sample**

Communication System: WCDMA FDD II; Communication System Band:

Exported from older format (data unavailable - please correct).; Frequency:

1852.4 MHz; Communication System PAR: 3.4 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/y (transversal) 5.0mm 50 x 50/ABM**

**[HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

<b>RIM Testing Services™</b>	Document Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW	Page <b>108(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**T-Coil scan/General Scans 2/y (transversal) 2mm 8 x 8/ABM  
[HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm


**Cursor:**

ABM1/ABM2 = 52.47 dB

ABM1 comp = 7.20 dB A/m

BWC Factor = 0.14 dB

Location: -5, -17, 4.4 mm

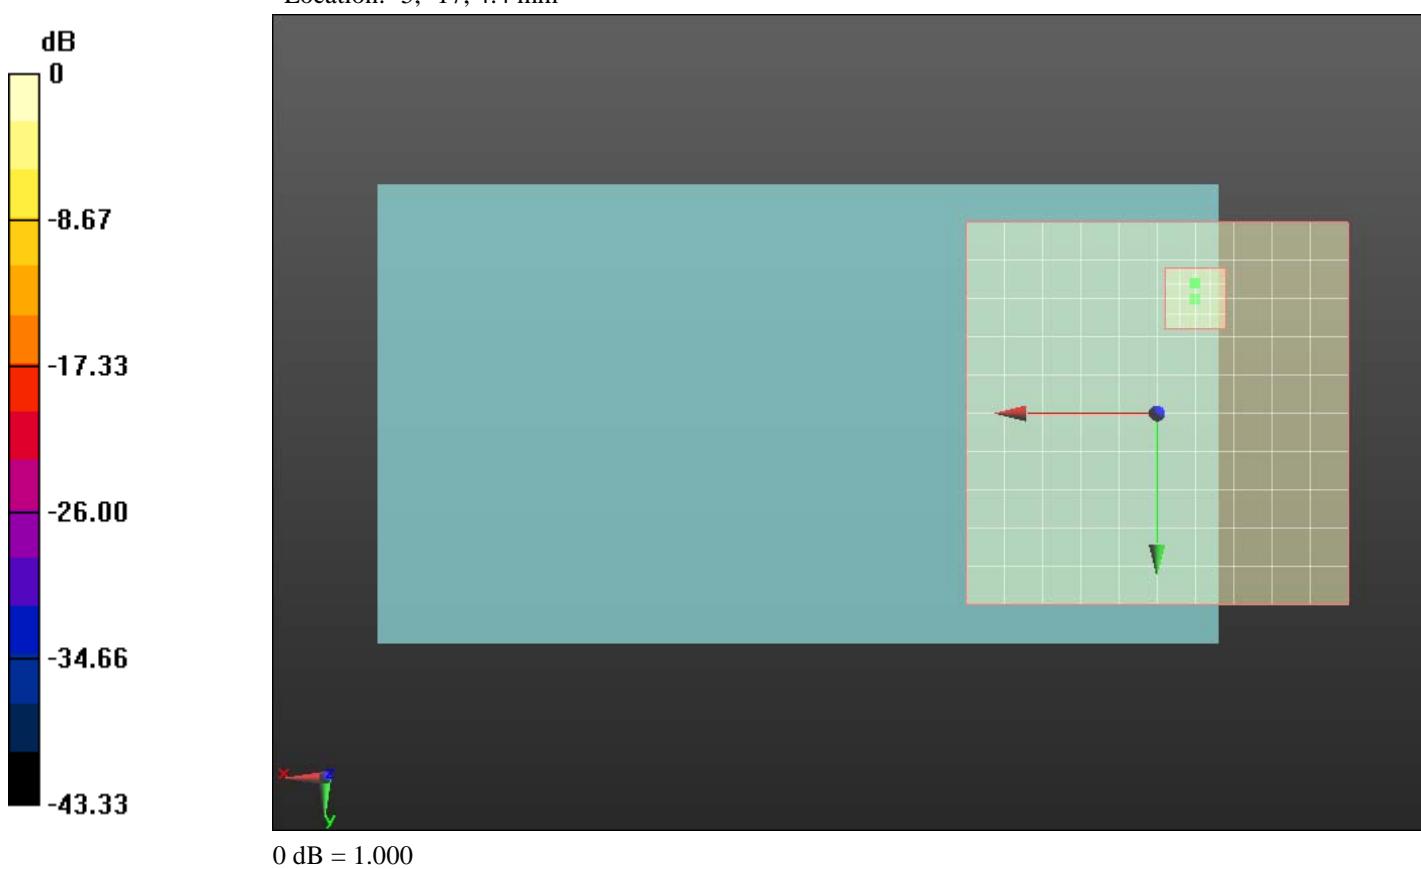

 <p>Document  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			Page <b>109(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>	FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

Date/Time: 3/9/2011 11:34:11 PM, Date/Time: 3/10/2011 12:40:51 AM,

Date/Time: 3/10/2011 12:50:55 AM

Test Laboratory: RIM Testing Services

HAC T-Coil\_UMTS\_band\_II\_Slide\_Closed\_mid\_chan\_Axial

**DUT: BlackBerry; Type: Sample**

Communication System: WCDMA FDD II; Communication System Band:

Exported from older format (data unavailable - please correct).; Frequency:

1852.4 MHz, Frequency: 1880 MHz; Communication System PAR: 3.4 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/z (axial) 5.0mm 50 x 50/ABM [HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

	Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>110(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

### **T-Coil scan/General Scans 2 2/z (axial) 2mm 8 x 8/ABM**

#### **[HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

#### **Cursor:**

ABM1/ABM2 = 54.75 dB

ABM1 comp = 16.82 dB A/m

BWC Factor = 0.14 dB

Location: -3, -10, 4.4 mm

### **T-Coil scan/General Scans 2 2/z (axial) wideband at best S/N**

#### **2/ABM [HAC-2007] Freq Resp(x,y,z,f) (1x1x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_300-3000\_2s.wav

Output Gain: 69.12

Measure Window Start: 2000ms

Measure Window Length: 4000ms

BWC applied: 10.78 dB

Device Reference Point: 0, 0, -6.3 mm

Diff = 2.00 dB

BWC Factor = 10.78 dB


Location: -5, -10, 3.7 mm

Author Data  
**Andrew Becker**


Dates of Test  
**Mar. 09-10, May 27, July  
12, 2011**

Report No  
**RTS-3640-1103-10B**

FCC ID  
**L6ARDM70UW  
L6AREN70UW**

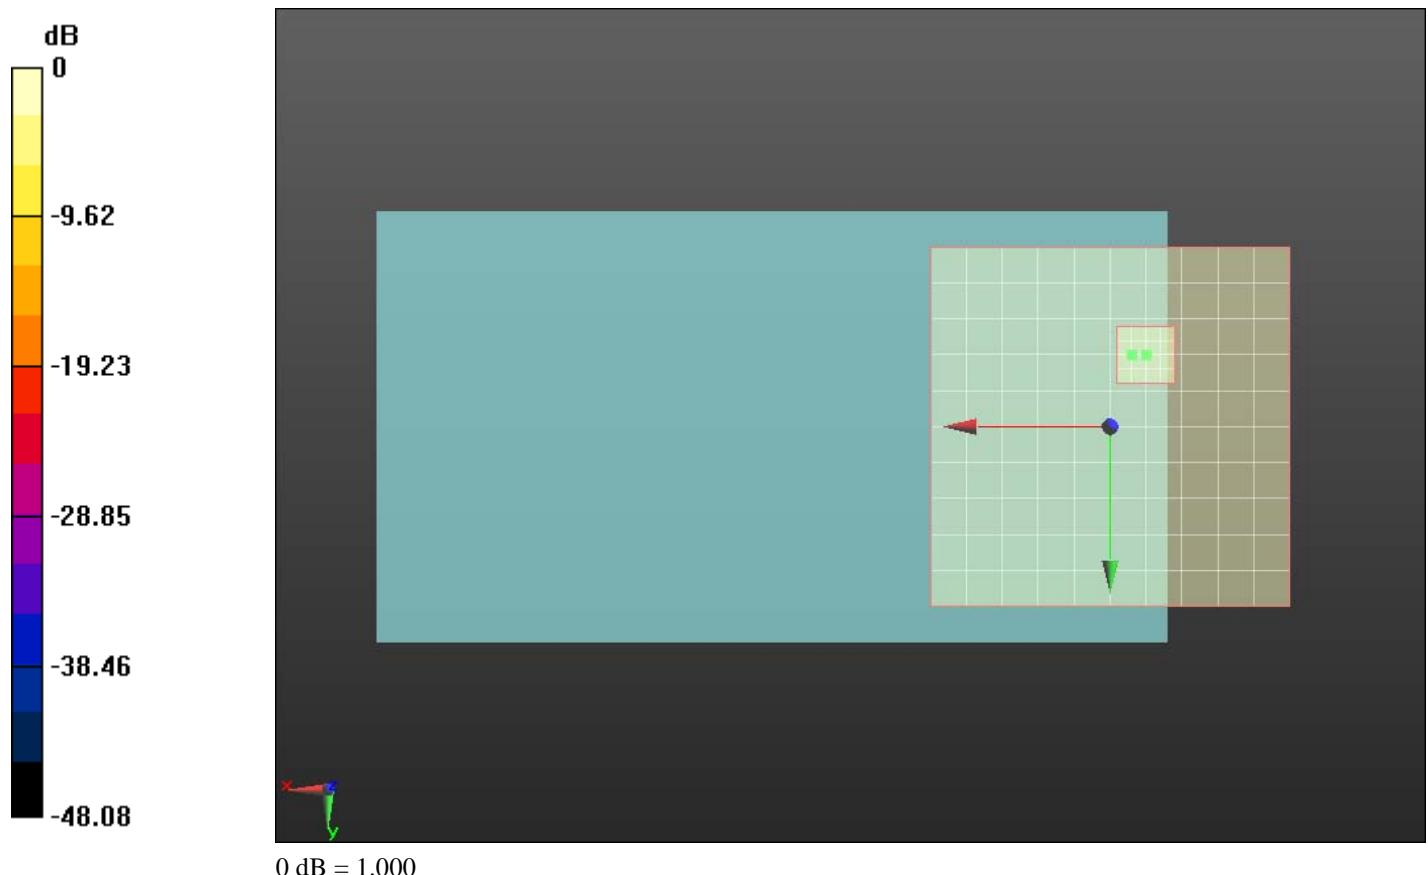

Document Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW	Page 112(173)
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b> Report No <b>RTS-3640-1103-10B</b> FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

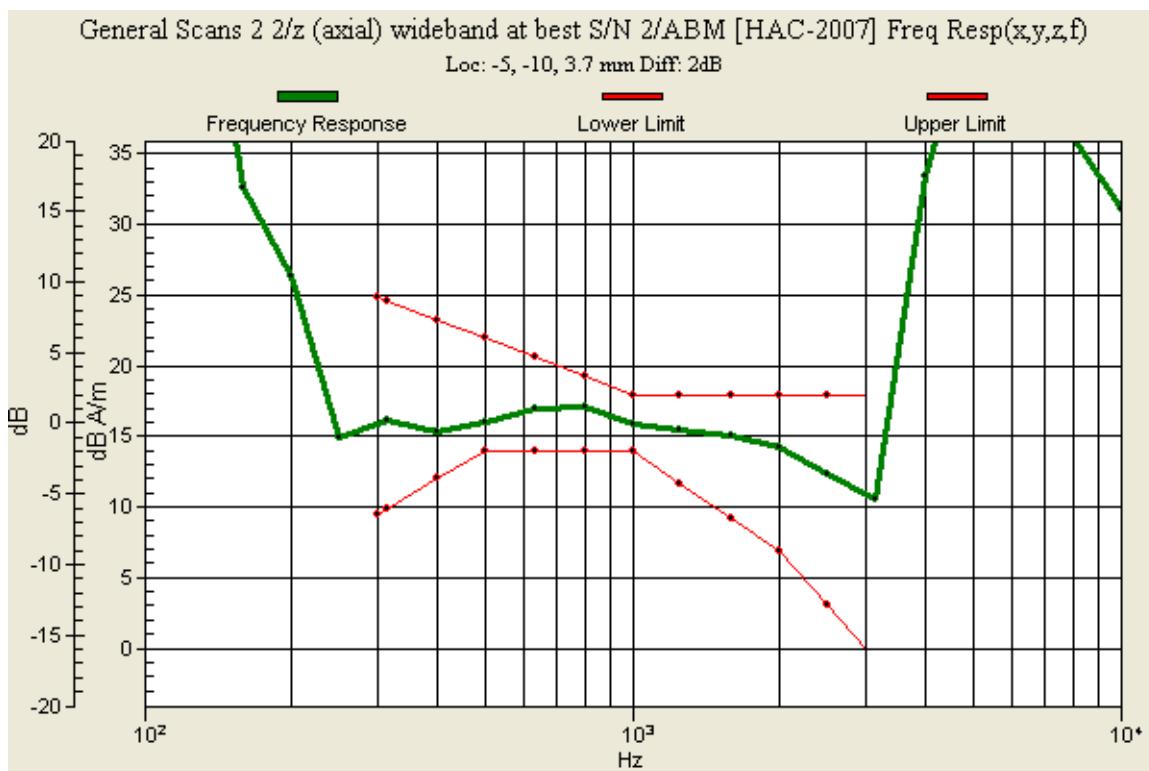

 <p><b>Document</b>  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			<b>Page</b> <b>113(173)</b>
<b>Author Data</b> <b>Andrew Becker</b>	<b>Dates of Test</b> <b>Mar. 09-10, May 27, July 12, 2011</b>	<b>Report No</b> <b>RTS-3640-1103-10B</b>	<b>FCC ID</b> <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

Date/Time: 3/9/2011 11:50:45 PM, Date/Time: 3/10/2011 12:44:00 AM

Test Laboratory: RIM Testing Services

HAC T-Coil\_UMTS\_band\_II\_Slide\_Closed\_mid\_chan\_Radial\_L

**DUT: BlackBerry; Type: Sample**

Communication System: WCDMA FDD II; Communication System Band:

Exported from older format (data unavailable - please correct).; Frequency:

1852.4 MHz, Frequency: 1880 MHz; Communication System PAR: 3.4 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/x (longitudinal) 5.0mm 50 x 50/ABM**

**[HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

## **T-Coil scan/General Scans 2 2/x (longitudinal) 2mm 8 x 8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms


Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

### **Cursor:**

ABM1/ABM2 = 52.53 dB  
 ABM1 comp = 7.59 dB A/m  
 BWC Factor = 0.14 dB  
 Location: -12, -10, 4.4 mm

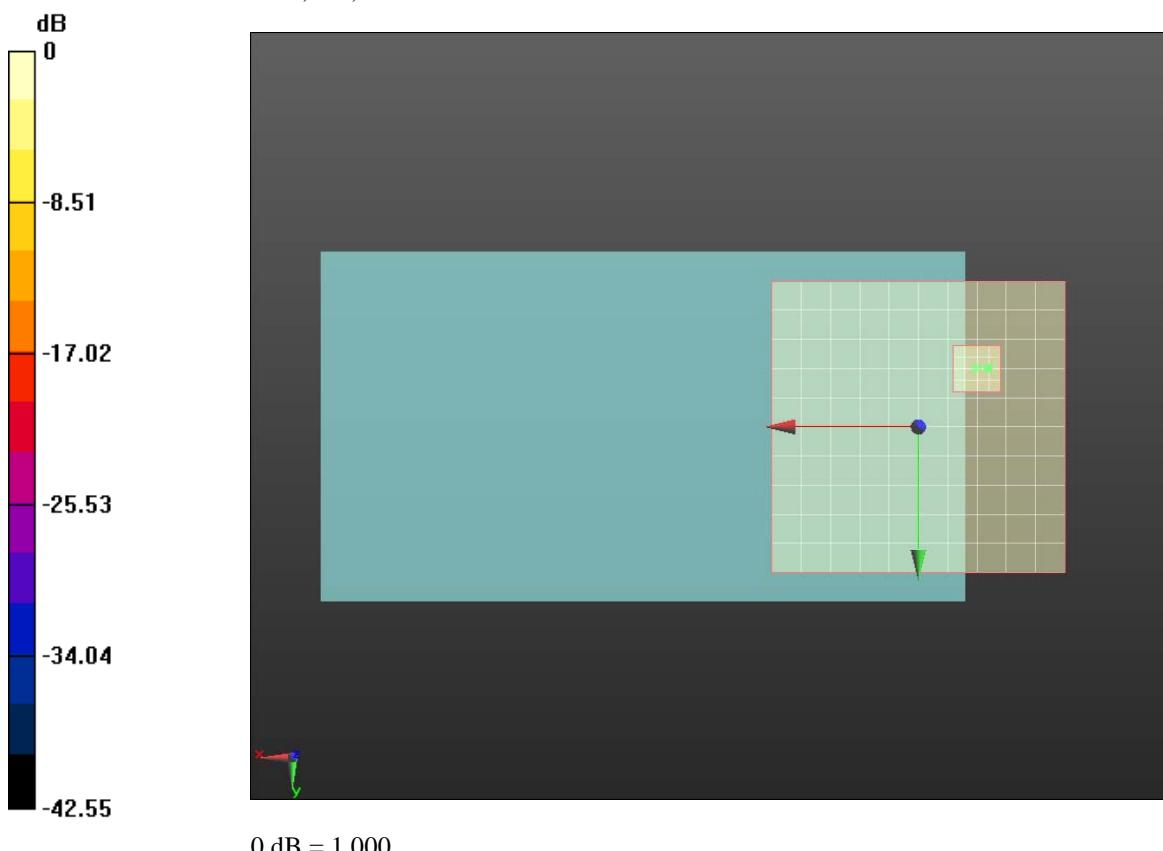

	Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>115(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

Date/Time: 3/10/2011 12:08:02 AM, Date/Time: 3/10/2011 12:47:28 AM

Test Laboratory: RIM Testing Services

HAC T-Coil\_UMTS\_band\_II\_Slide\_Closed\_mid\_chan\_Radial\_T

**DUT: BlackBerry; Type: Sample**

Communication System: WCDMA FDD II; Communication System Band:

Exported from older format (data unavailable - please correct).; Frequency:

1852.4 MHz, Frequency: 1880 MHz; Communication System PAR: 3.4 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/y (transversal) 5.0mm 50 x 50/ABM**

**[HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Document Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW	Page 116(173)
Author Data Andrew Becker	Dates of Test Mar. 09-10, May 27, July 12, 2011 Report No RTS-3640-1103-10B FCC ID L6ARDM70UW L6AREN70UW

## T-Coil scan/General Scans 2 2/y (transversal) 2mm 8 x 8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms


Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

### Cursor:

ABM1/ABM2 = 52.11 dB  
ABM1 comp = 7.34 dB A/m  
BWC Factor = 0.14 dB  
Location: -3, -15, 4.4 mm

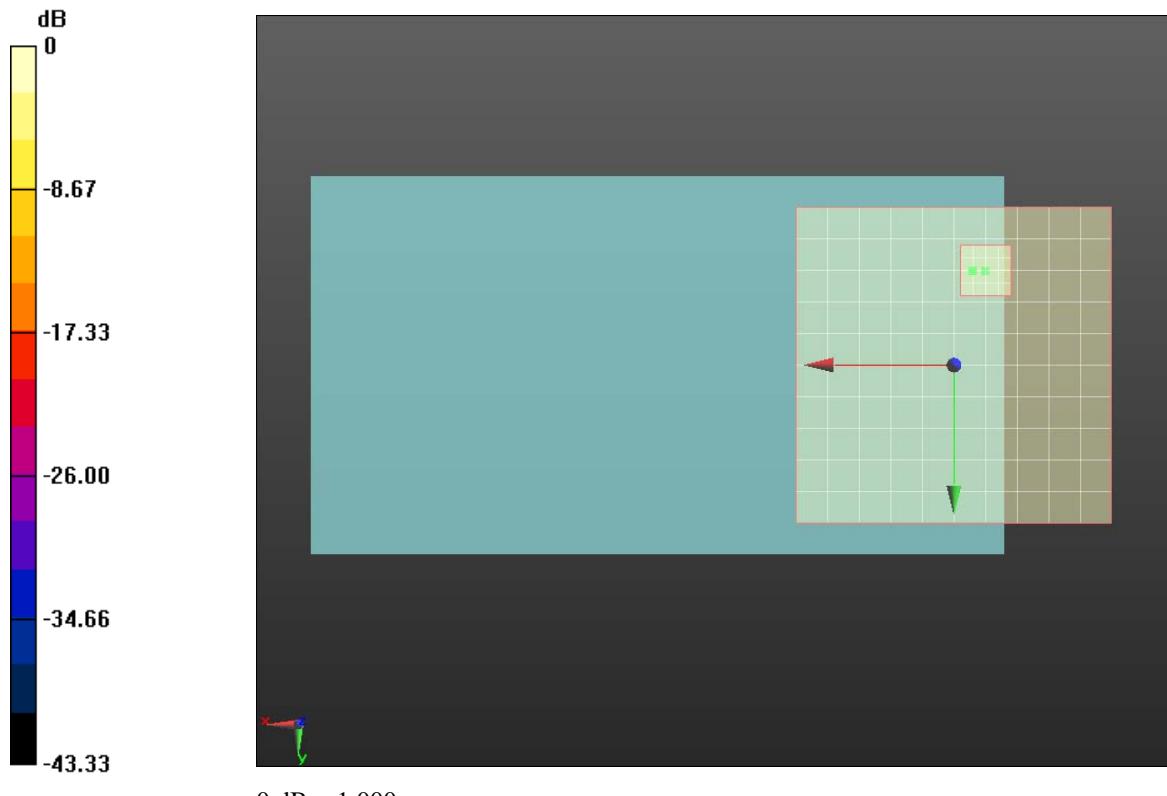

	Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>117(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

Date/Time: 3/9/2011 11:34:11 PM, Date/Time: 3/10/2011 12:53:09 AM,

Date/Time: 3/10/2011 1:03:16 AM

Test Laboratory: RIM Testing Services

HAC T-Coil\_UMTS\_band\_II\_Slide\_Closed\_high\_chan\_Axial

**DUT: BlackBerry; Type: Sample**

Communication System: WCDMA FDD II; Communication System Band:

Exported from older format (data unavailable - please correct).; Frequency:

1852.4 MHz, Frequency: 1907.6 MHz; Communication System PAR: 3.4 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/z (axial) 5.0mm 50 x 50/ABM [HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

	<b>Document Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	<b>Page 118(173)</b>
<b>Author Data</b> <b>Andrew Becker</b>	<b>Dates of Test</b> <b>Mar. 09-10, May 27, July 12, 2011</b>	<b>Report No</b> <b>RTS-3640-1103-10B</b>

BWC applied: 0.14 dB

**T-Coil scan/General Scans 2 2 2/z (axial) 2mm 8 x 8/ABM**

**[HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

ABM1/ABM2 = 54.78 dB

ABM1 comp = 16.67 dB A/m

BWC Factor = 0.14 dB

Location: -3, -10, 4.4 mm

**T-Coil scan/General Scans 2 2 2/z (axial) wideband at best**

**S/N 2/ABM [HAC-2007] Freq Resp(x,y,z,f) (1x1x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_300-3000\_2s.wav

Output Gain: 69.12

Measure Window Start: 2000ms

Measure Window Length: 4000ms

BWC applied: 10.78 dB


Device Reference Point: 0, 0, -6.3 mm


**Cursor:**

Diff = 2.00 dB

BWC Factor = 10.78 dB

Location: -5, -10, 3.7 mm

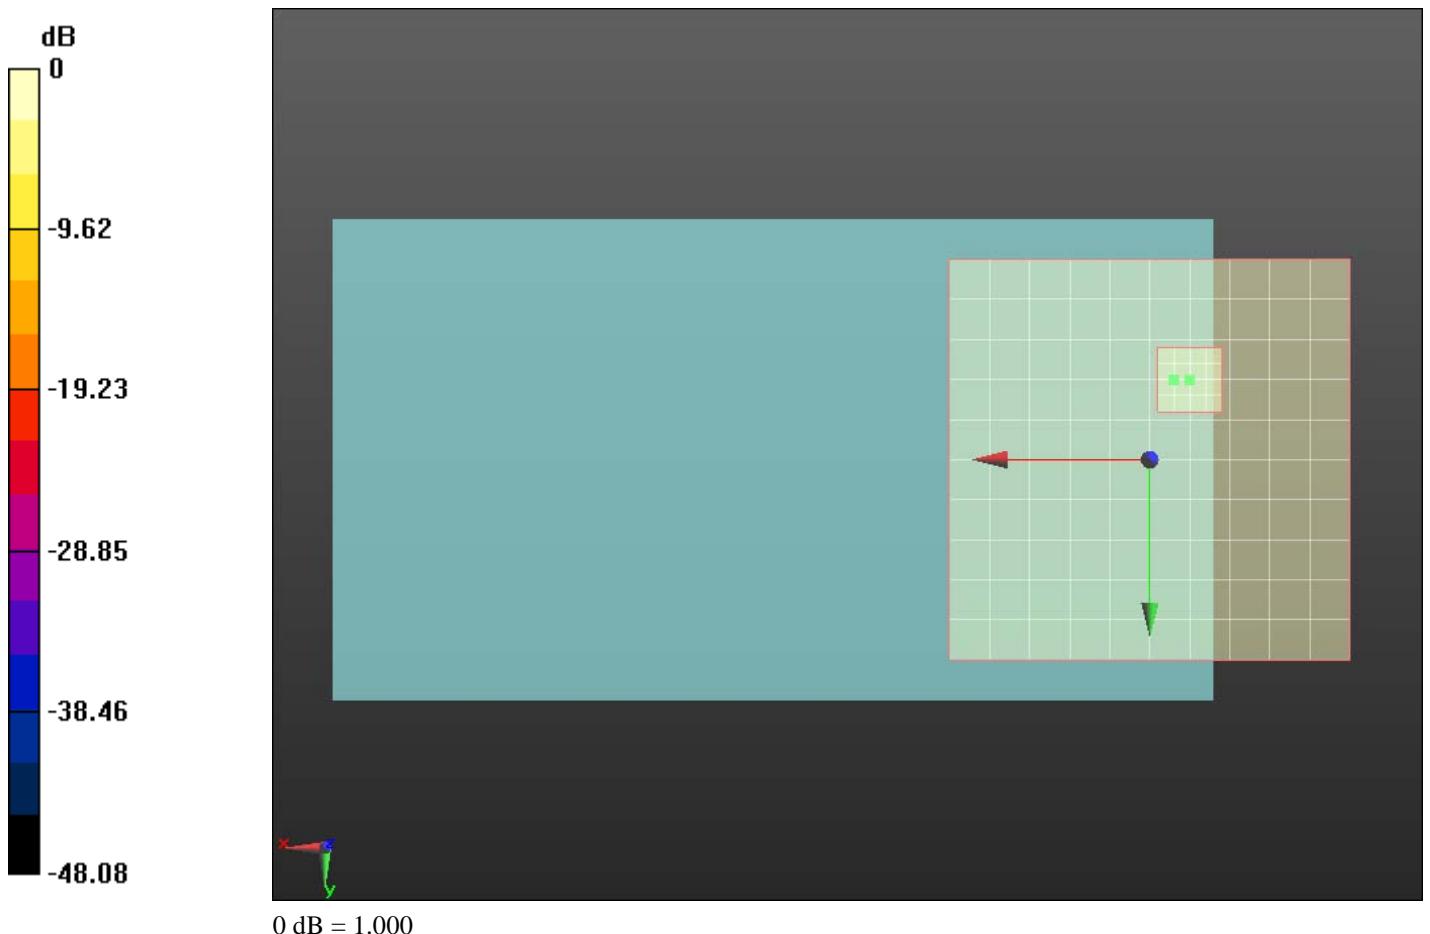Author Data  
**Andrew Becker**Dates of Test  
**Mar. 09-10, May 27, July  
12, 2011**Report No  
**RTS-3640-1103-10B**FCC ID  
**L6ARDM70UW  
L6AREN70UW**

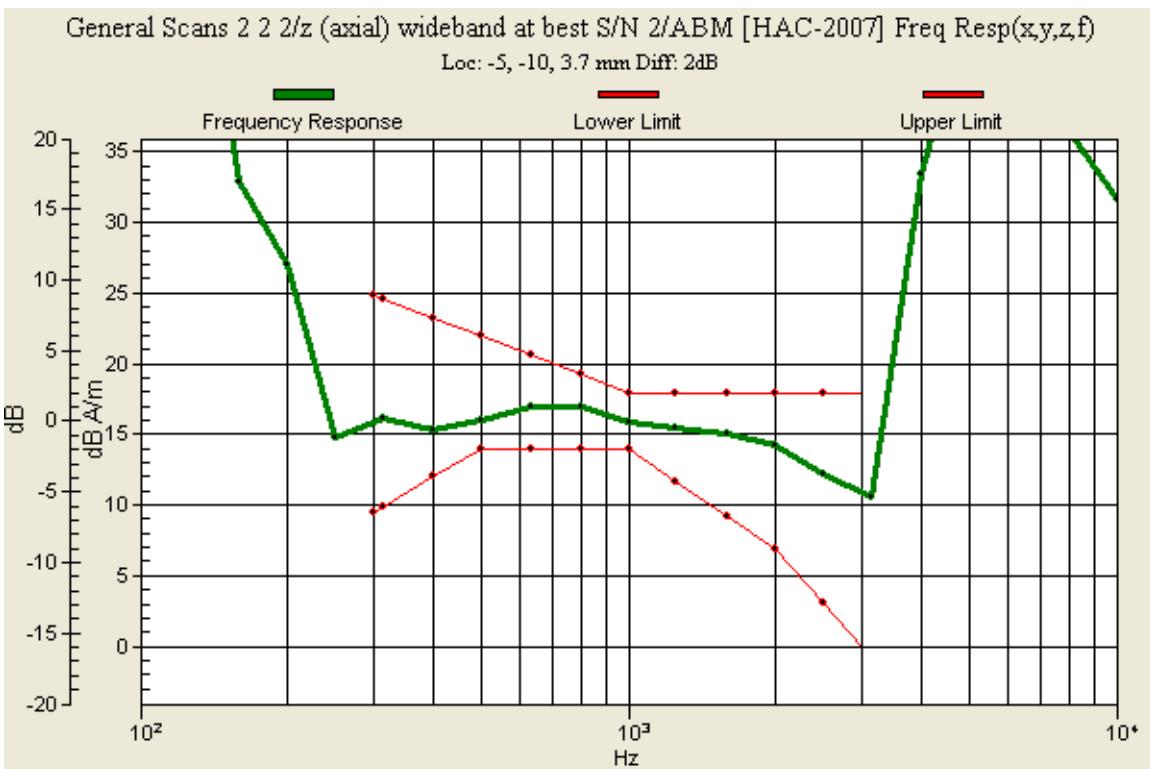

 <p><b>Document</b>  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			<b>Page</b> <b>121(173)</b>
<b>Author Data</b> <b>Andrew Becker</b>	<b>Dates of Test</b> <b>Mar. 09-10, May 27, July 12, 2011</b>	<b>Report No</b> <b>RTS-3640-1103-10B</b>	<b>FCC ID</b> <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

Date/Time: 3/9/2011 11:50:45 PM, Date/Time: 3/10/2011 12:56:18 AM

Test Laboratory: RIM Testing Services

HAC T-Coil\_UMTS\_band\_II\_Slide\_Closed\_high\_chan\_Radial\_L

**DUT: BlackBerry; Type: Sample**

Communication System: WCDMA FDD II; Communication System Band:

Exported from older format (data unavailable - please correct).; Frequency:

1852.4 MHz, Frequency: 1907.6 MHz; Communication System PAR: 3.4 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/x (longitudinal) 5.0mm 50 x 50/ABM**

**[HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

Document Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW	Page 122(173)
Author Data Andrew Becker	Dates of Test Mar. 09-10, May 27, July 12, 2011 Report No RTS-3640-1103-10B FCC ID L6ARDM70UW L6AREN70UW

BWC applied: 0.14 dB

**T-Coil scan/General Scans 2 2 2/x (longitudinal) 2mm 8 x 8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm


**Cursor:**

ABM1/ABM2 = 52.52 dB

ABM1 comp = 7.61 dB A/m

BWC Factor = 0.14 dB

Location: -12, -10, 4.4 mm

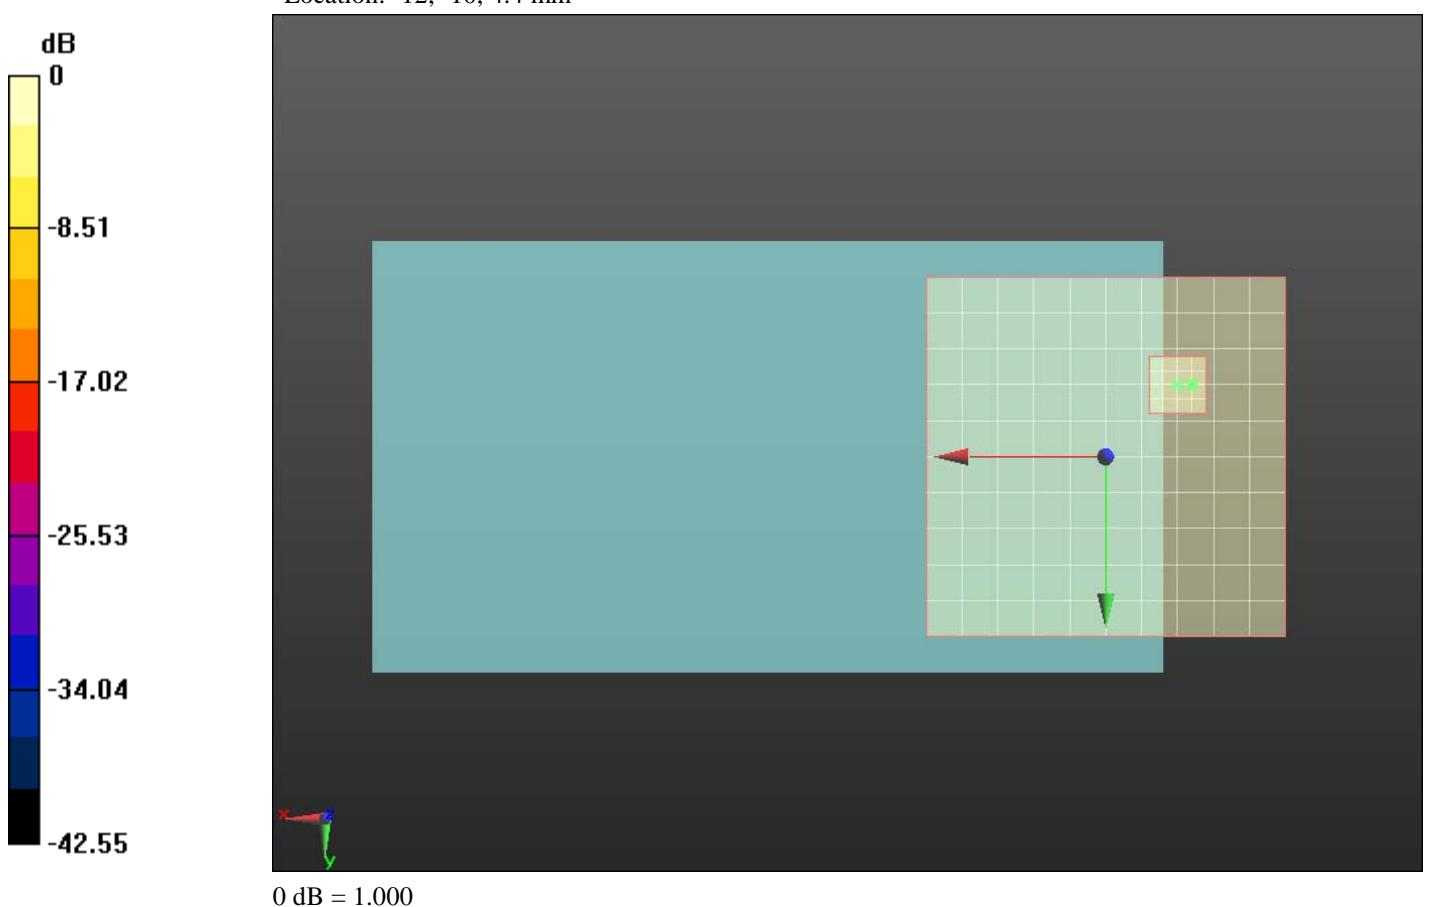

 <p><b>Document</b>  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			<b>Page</b> <b>123(173)</b>
<b>Author Data</b> <b>Andrew Becker</b>	<b>Dates of Test</b> <b>Mar. 09-10, May 27, July 12, 2011</b>	<b>Report No</b> <b>RTS-3640-1103-10B</b>	<b>FCC ID</b> <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

Date/Time: 3/10/2011 12:08:02 AM, Date/Time: 3/10/2011 12:59:46 AM

Test Laboratory: RIM Testing Services

HAC T-Coil\_UMTS\_band\_II\_Slide\_Closed\_high\_chan\_Radial\_T

**DUT: BlackBerry; Type: Sample;**

Communication System: WCDMA FDD II; Communication System Band:

Exported from older format (data unavailable - please correct).; Frequency:

1852.4 MHz, Frequency: 1907.6 MHz; Communication System PAR: 3.4 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/y (transversal) 5.0mm 50 x 50/ABM**

**[HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

## T-Coil scan/General Scans 2 2 2/y (transversal) 2mm 8 x 8/ABM

### [HAC-2007] SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms


Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

#### Cursor:

ABM1/ABM2 = 52.19 dB  
ABM1 comp = 7.30 dB A/m  
BWC Factor = 0.14 dB  
Location: -3, -17, 4.4 mm

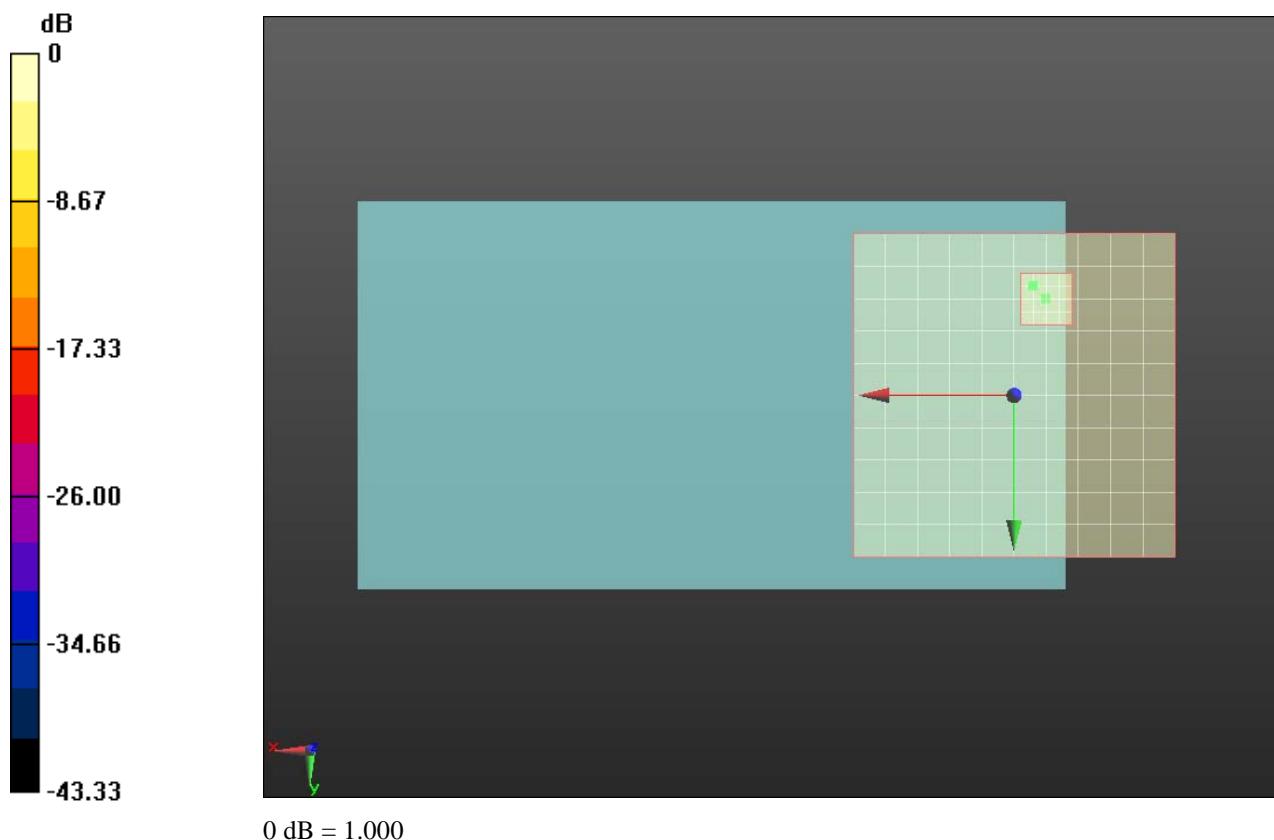

	Document Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW	Page 125(173)
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

Date/Time: 3/9/2011 10:26:27 PM, Date/Time: 3/9/2011 10:39:54 PM,

Date/Time: 3/9/2011 11:29:38 PM

Test Laboratory: RIM Testing Services

HAC T-Coil\_UMTS\_band\_II\_Slide\_Open\_mid\_chan\_Axial

**DUT: BlackBerry; Type: Sample**

Communication System: WCDMA FDD II; Communication System Band:

Exported from older format (data unavailable - please correct).; Frequency: 1880 MHz; Communication System PAR: 3.4 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/z (axial) 5.0mm 50 x 50/ABM [HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

 <p>Document  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			Page <b>126(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>	FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

BWC applied: 0.14 dB

**T-Coil scan/General Scans 2/z (axial) 2mm 8 x 8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

ABM1/ABM2 = 55.22 dB

ABM1 comp = 16.70 dB A/m

BWC Factor = 0.14 dB

Location: -1, -10, 4.4 mm

**T-Coil scan/General Scans 2/z (axial) wideband at best S/N 2/ABM [HAC-2007] Freq Resp(x,y,z,f) (1x1x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_300-3000\_2s.wav

Output Gain: 69.12

Measure Window Start: 2000ms

Measure Window Length: 4000ms

BWC applied: 10.79 dB

Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

Diff = 2.00 dB

BWC Factor = 10.79 dB


Location: -5, -10, 3.7 mm

Author Data  
**Andrew Becker**


Dates of Test  
**Mar. 09-10, May 27, July  
12, 2011**

Report No  
**RTS-3640-1103-10B**

FCC ID  
**L6ARDM70UW  
L6AREN70UW**

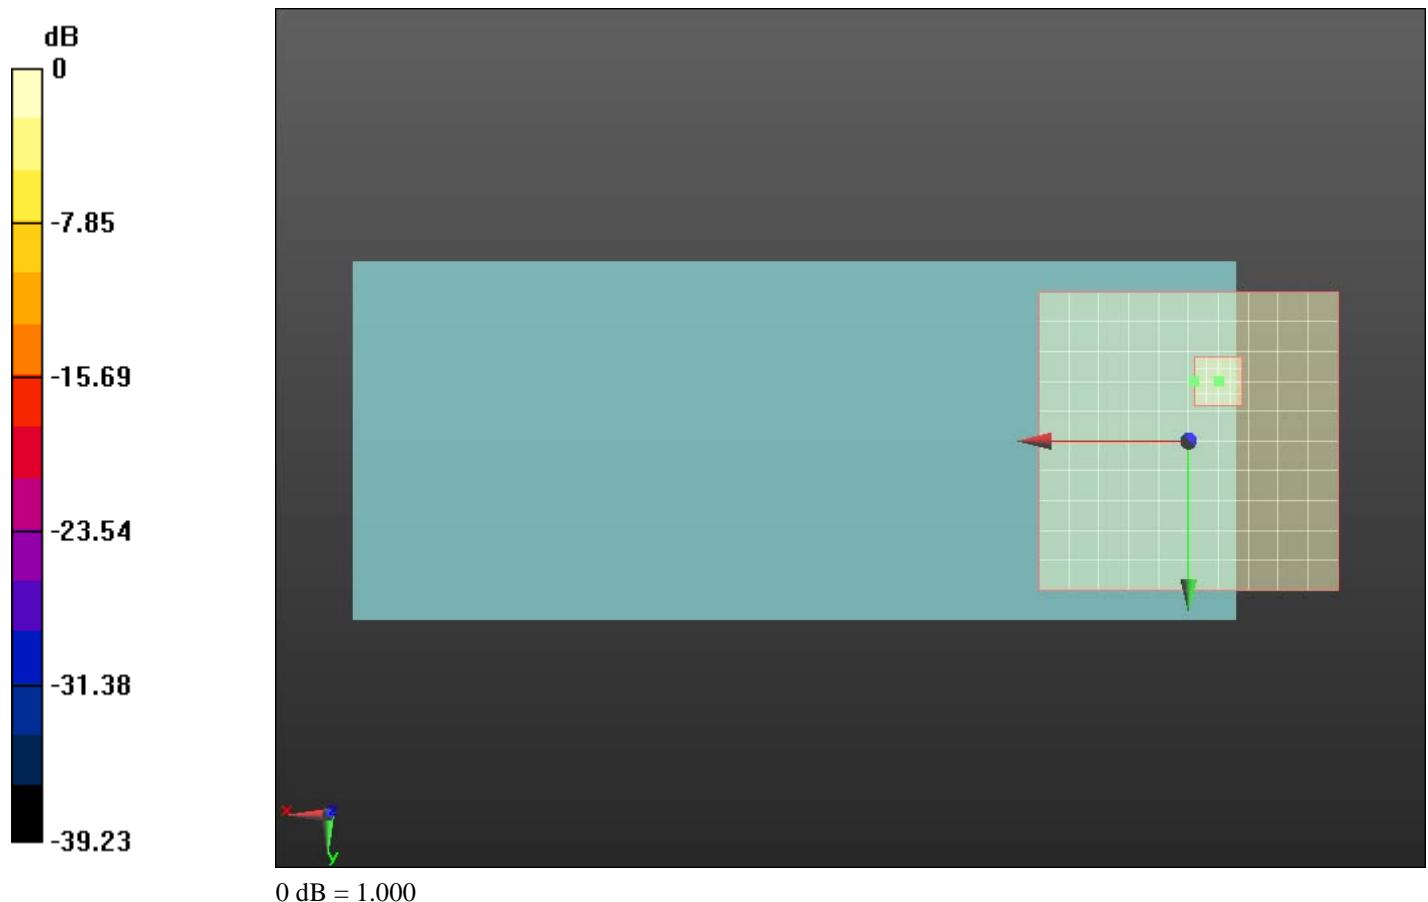

Document Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW	Page 128(173)
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b> Report No <b>RTS-3640-1103-10B</b> FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

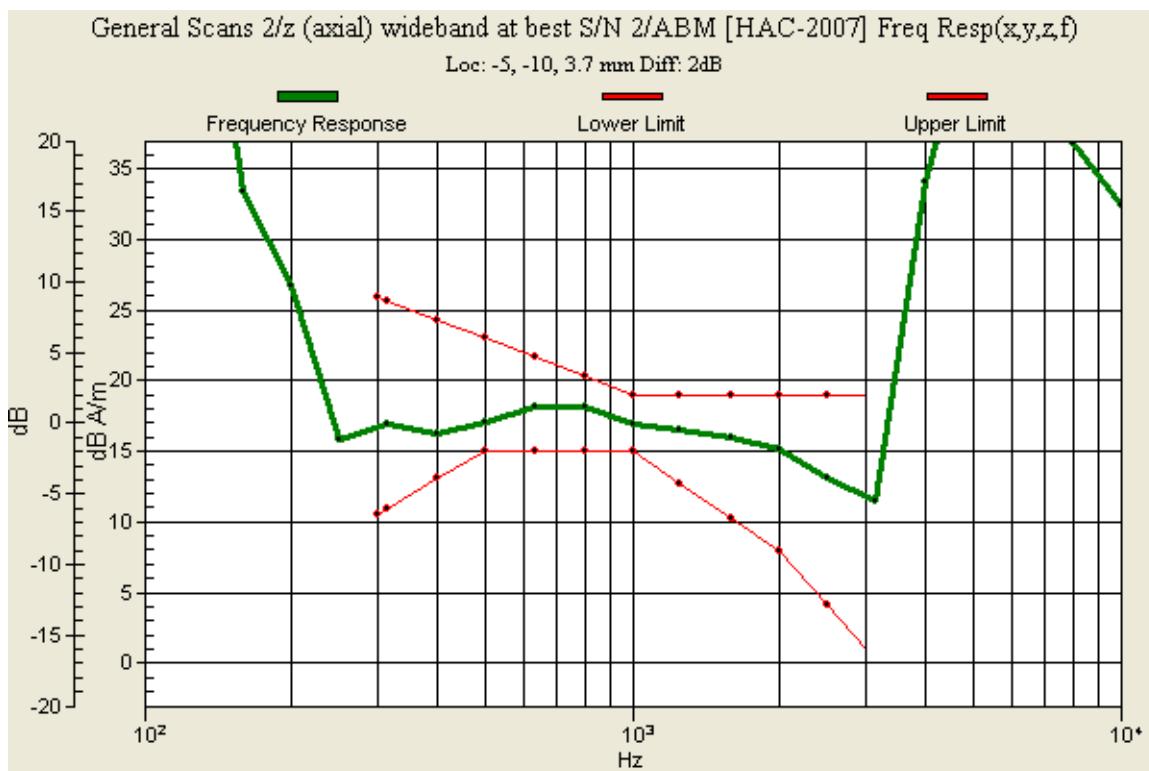

	Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>129(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

Date/Time: 3/9/2011 10:42:59 PM, Date/Time: 3/9/2011 11:09:16 PM

Test Laboratory: RIM Testing Services

HAC T-Coil\_UMTS\_band\_II\_Slide\_Open\_mid\_chan\_Radial\_L

**DUT: BlackBerry; Type: Sample**

Communication System: WCDMA FDD II; Communication System Band:

Exported from older format (data unavailable - please correct).; Frequency: 1880 MHz; Communication System PAR: 3.4 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/x (longitudinal) 5.0mm 50 x 50/ABM**

**[HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

Author Data  
**Andrew Becker**

Dates of Test

**Mar. 09-10, May 27, July 12, 2011**

Report No

**RTS-3640-1103-10B**

FCC ID

**L6ARDM70UW**  
**L6AREN70UW**

BWC applied: 0.14 dB

**T-Coil scan/General Scans 2/x (longitudinal) 2mm 8 x 8/ABM**
**[HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm


**Cursor:**

ABM1/ABM2 = 53.48 dB

ABM1 comp = 8.12 dB A/m

BWC Factor = 0.14 dB

Location: -14, -10, 4.4 mm

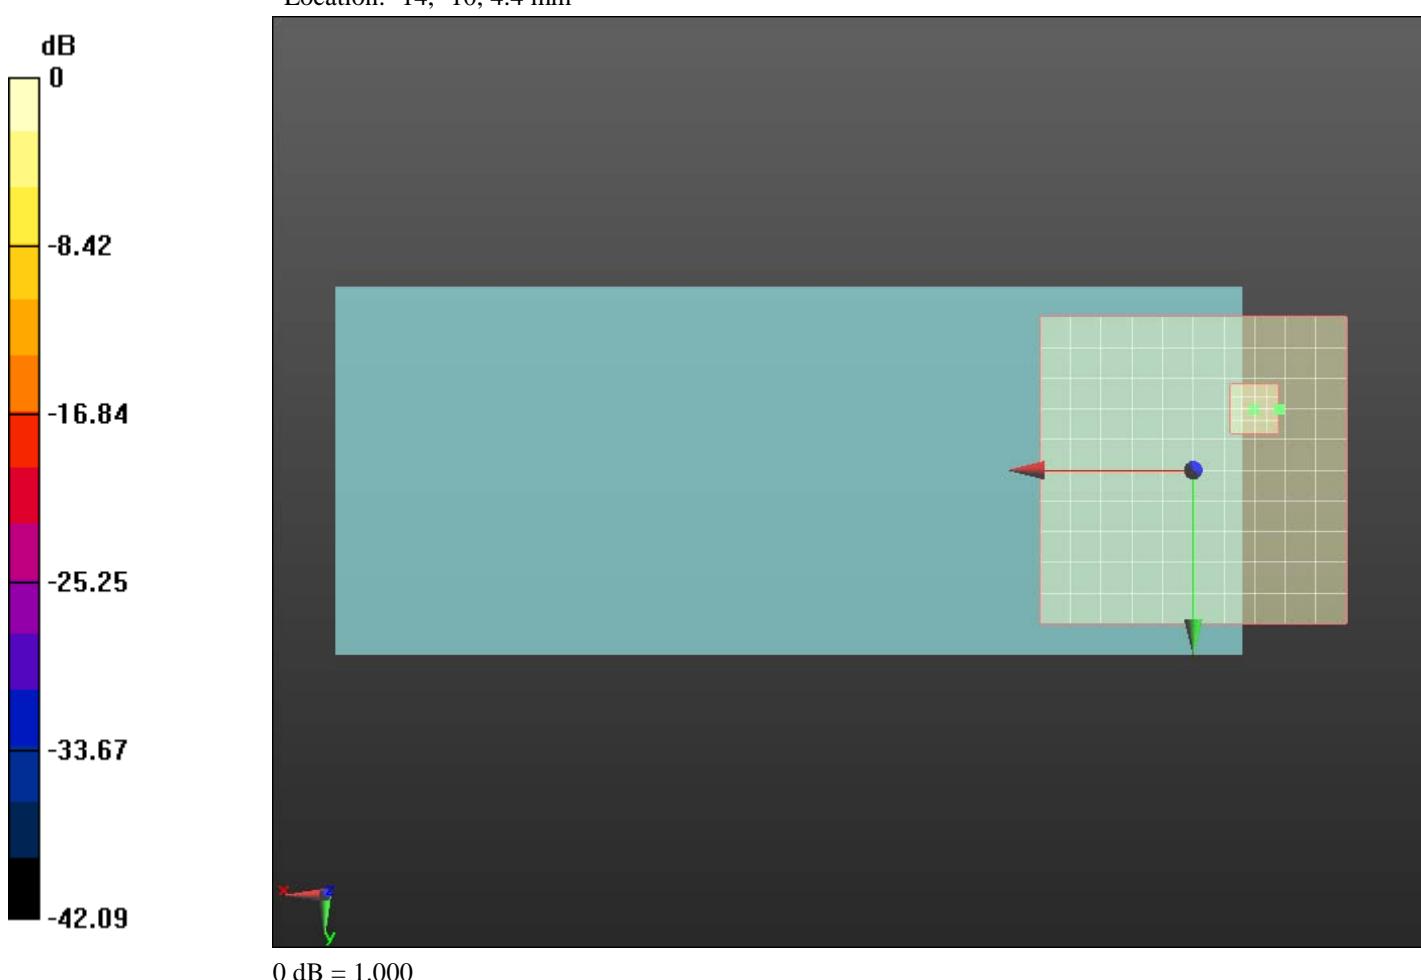

 <p><b>Document</b>  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			<b>Page</b> <b>131(173)</b>
<b>Author Data</b> <b>Andrew Becker</b>	<b>Dates of Test</b> <b>Mar. 09-10, May 27, July 12, 2011</b>	<b>Report No</b> <b>RTS-3640-1103-10B</b>	<b>FCC ID</b> <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

Date/Time: 3/9/2011 11:12:40 PM, Date/Time: 3/9/2011 11:26:12 PM

Test Laboratory: RIM Testing Services

HAC T-Coil\_UMTS\_band\_II\_Slide\_Open\_mid\_chan\_Radia\_T

**DUT: BlackBerry; Type: Sample**

Communication System: WCDMA FDD II; Communication System Band:

Exported from older format (data unavailable - please correct).; Frequency: 1880 MHz; Communication System PAR: 3.4 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 6/8/2010
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE4 Sn881; Calibrated: 4/19/2010
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/y (transversal) 5.0mm 50 x 50/ABM**

**[HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

Document Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW	Page 132(173)
Author Data Andrew Becker	Dates of Test Mar. 09-10, May 27, July 12, 2011 Report No RTS-3640-1103-10B FCC ID L6ARDM70UW L6AREN70UW

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**T-Coil scan/General Scans 2/y (transversal) 2mm 8 x 8/ABM  
[HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm


**Cursor:**

ABM1/ABM2 = 53.29 dB

ABM1 comp = 8.51 dB A/m

BWC Factor = 0.14 dB

Location: -3, -15, 4.4 mm

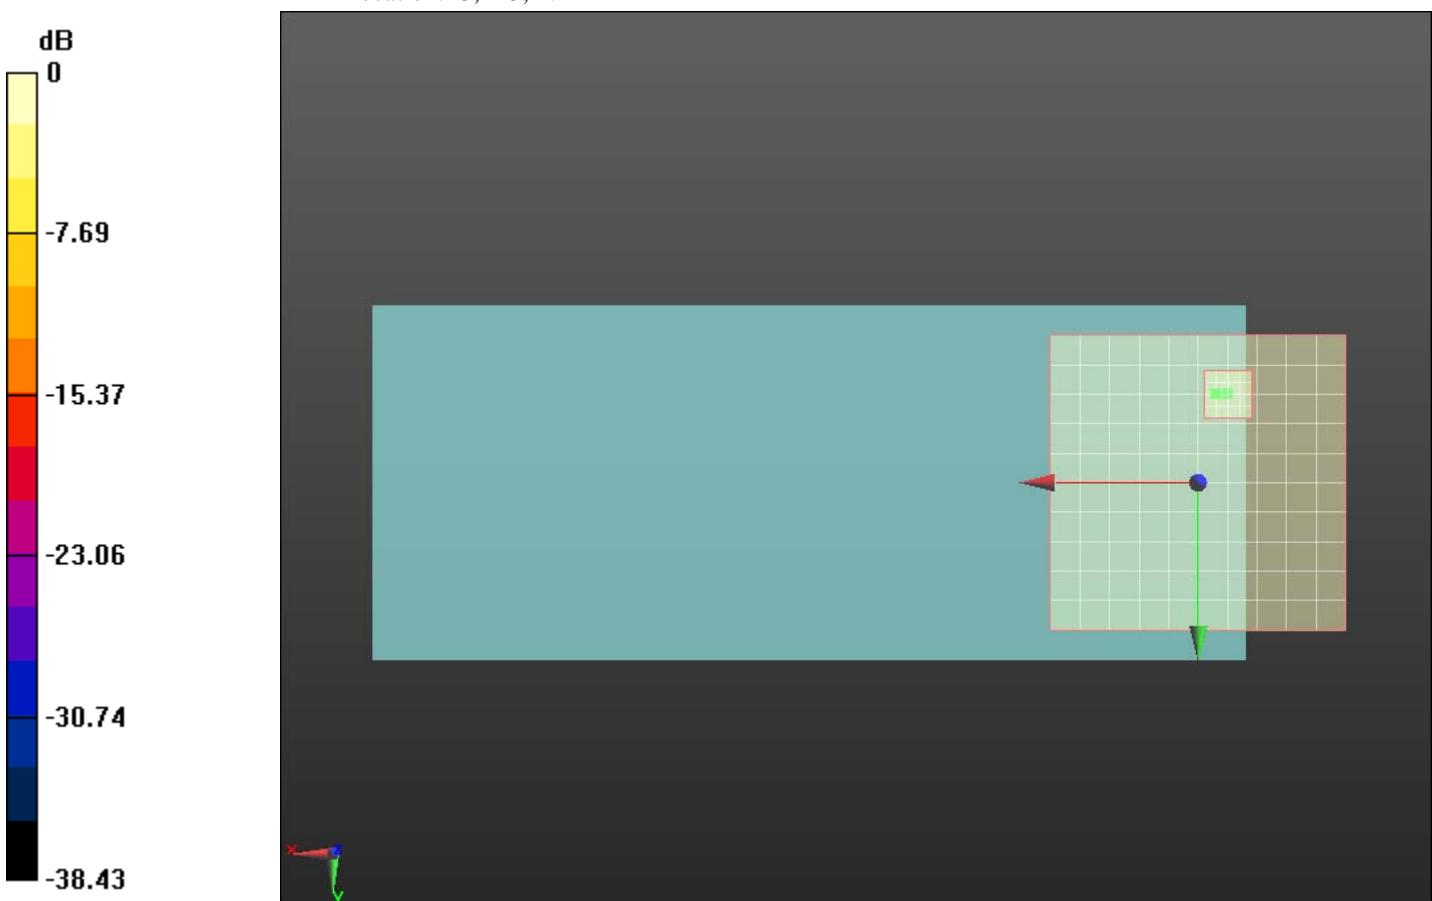

	Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>133(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

0 dB = 1.000

Date/Time: 7/12/2011 8:55:39 PM, Date/Time: 7/12/2011 9:09:16 PM, Date/Time: 7/12/2011 9:46:36 PM, Date/Time: 7/12/2011 9:49:57 PM, Date/Time: 7/12/2011 10:00:06 PM, Date/Time: 7/12/2011 10:12:50 PM, Date/Time: 7/12/2011 10:22:41 PM

Test Laboratory: RIM Testing Services

HAC T-Coil\_UMTS\_band\_IV

**DUT: BlackBerry; Type: Sample**

Communication System: WCDMA FDD IV; Communication System Band: Exported from older format (data unavailable - please correct).; Frequency: 1712.4 MHz, Frequency: 1732.6 MHz, Frequency: 1752.6 MHz; Communication System PAR: 0 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 4/7/2011
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE3 Sn472; Calibrated: 3/7/2011
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/z (axial) 5.0mm 50 x 50/ABM [HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

 <p><b>Document</b>  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			<b>Page</b> <b>134(173)</b>
<b>Author Data</b> <b>Andrew Becker</b>	<b>Dates of Test</b> <b>Mar. 09-10, May 27, July 12, 2011</b>	<b>Report No</b> <b>RTS-3640-1103-10B</b>	<b>FCC ID</b> <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**T-Coil scan/General Scans 2/z (axial) 2mm 8 x 8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

ABM1/ABM2 = 56.15 dB

ABM1 comp = 16.61 dB A/m

BWC Factor = 0.14 dB

Location: -2, -12, 4.4 mm

**T-Coil scan/General Scans 2/z (axial) wideband at best S/N 2/ABM [HAC-2007]**

**Freq Resp(x,y,z,f) (1x1x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_300-3000\_2s.wav

Output Gain: 69.12

Measure Window Start: 2000ms

Measure Window Length: 4000ms

BWC applied: 10.79 dB

Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

Diff = 1.80 dB

BWC Factor = 10.79 dB

Location: 0, -10, 3.7 mm

**T-Coil scan/General Scans 2 2/z (axial) 2mm 8 x 8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

 <p>Document  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			Page <b>135(173)</b>
<b>Author Data</b> <b>Andrew Becker</b>	<b>Dates of Test</b> <b>Mar. 09-10, May 27, July 12, 2011</b>	<b>Report No</b> <b>RTS-3640-1103-10B</b>	<b>FCC ID</b> <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

ABM1/ABM2 = 56.37 dB  
 ABM1 comp = 16.31 dB A/m  
 BWC Factor = 0.14 dB  
 Location: -2, -6, 4.4 mm

### **T-Coil scan/General Scans 2 2/z (axial) wideband at best S/N 2/ABM [HAC-2007]**

#### **Freq Resp(x,y,z,f) (1x1x1):**

Measurement grid: dx=10mm, dy=10mm  
 Signal Type: Audio File (.wav) 48k\_voice\_300-3000\_2s.wav  
 Output Gain: 69.12  
 Measure Window Start: 2000ms  
 Measure Window Length: 4000ms  
 BWC applied: 10.79 dB  
 Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

Diff = 1.90 dB  
 BWC Factor = 10.79 dB  
 Location: 0, -10, 3.7 mm

### **T-Coil scan/General Scans 2 2 2/z (axial) 2mm 8 x 8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm  
 Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav  
 Output Gain: 35.28  
 Measure Window Start: 300ms  
 Measure Window Length: 1000ms  
 BWC applied: 0.15 dB  
 Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

ABM1/ABM2 = 56.35 dB  
 ABM1 comp = 16.74 dB A/m  
 BWC Factor = 0.15 dB  
 Location: -2, -6, 4.4 mm


### **T-Coil scan/General Scans 2 2 2/z (axial) wideband at best S/N 2/ABM [HAC-2007]**

#### **Freq Resp(x,y,z,f) (1x1x1):**


Measurement grid: dx=10mm, dy=10mm  
 Signal Type: Audio File (.wav) 48k\_voice\_300-3000\_2s.wav  
 Output Gain: 69.12  
 Measure Window Start: 2000ms  
 Measure Window Length: 4000ms  
 BWC applied: 10.79 dB  
 Device Reference Point: 0, 0, -6.3 mm

**Cursor:**


Diff = 1.92 dB  
 BWC Factor = 10.79 dB  
 Location: 0, -10, 3.7 mm

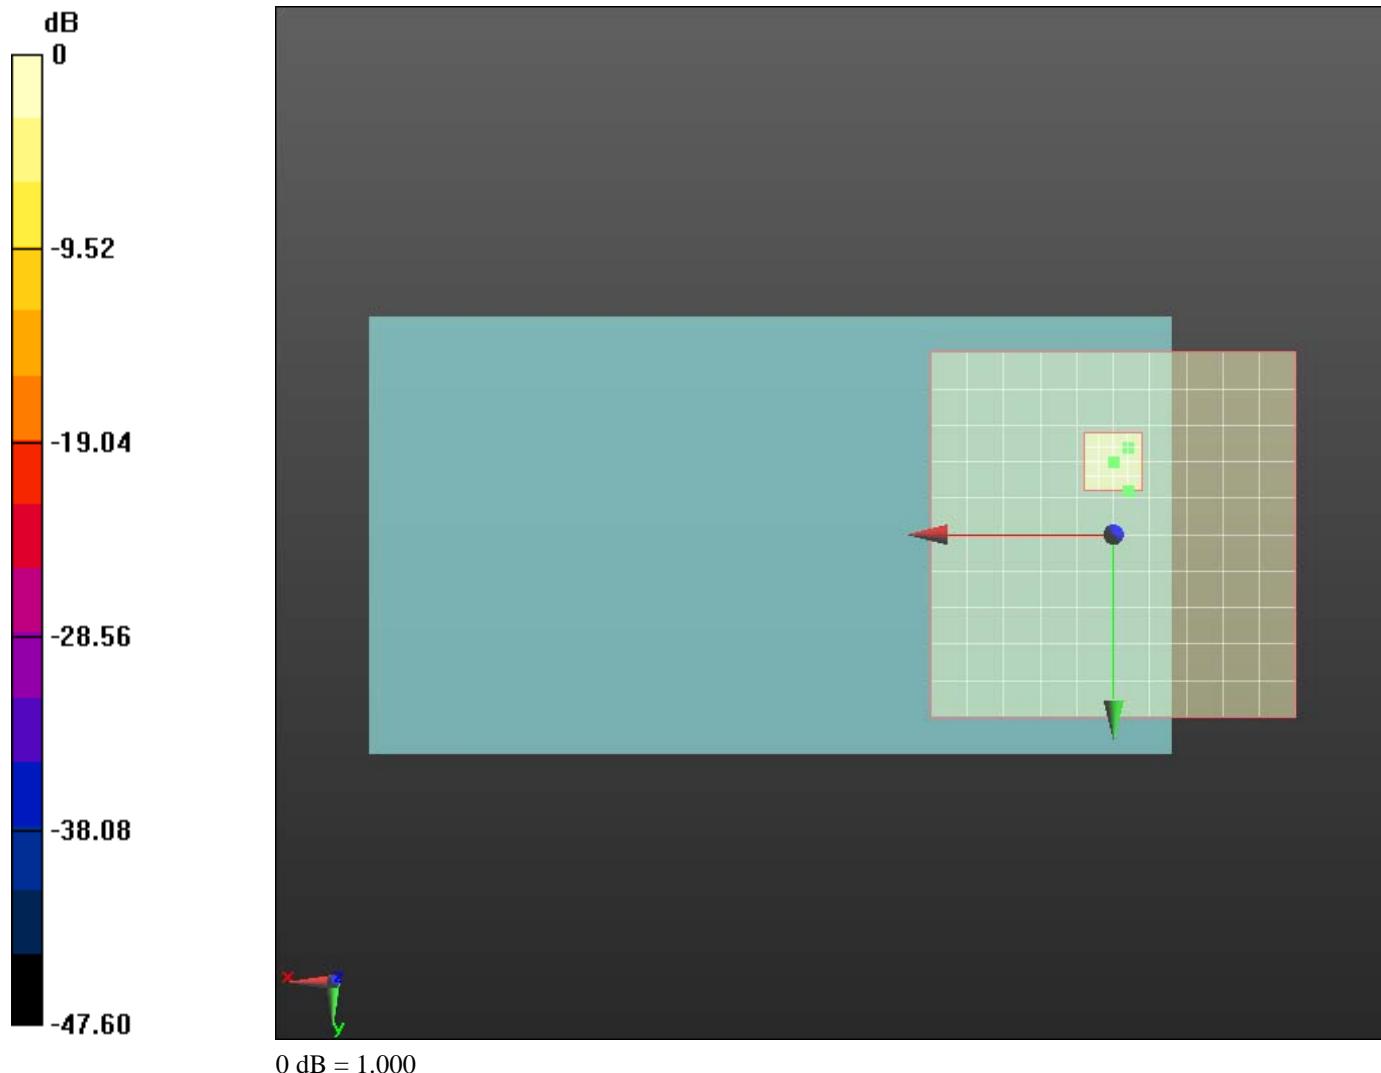


Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>	FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>
-------------------------------------	---	---------------------------------------	--

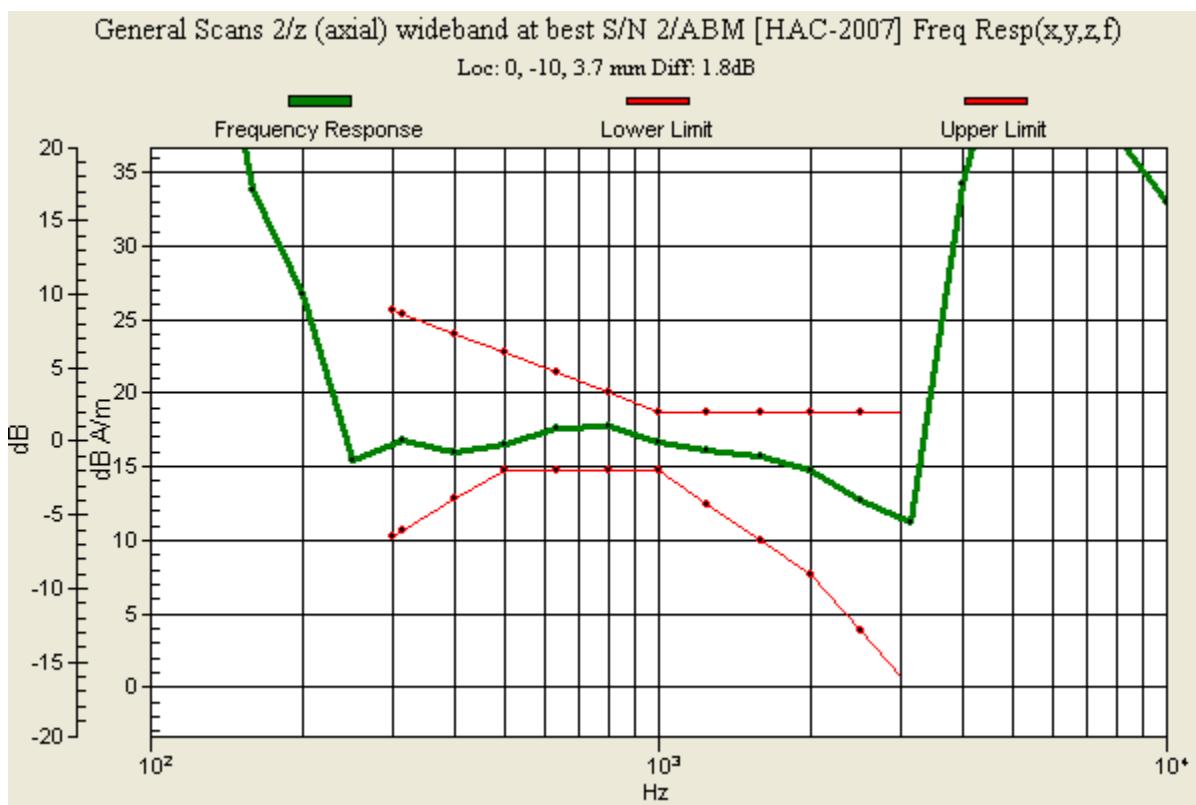

Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>	FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>
-------------------------------------	---	---------------------------------------	--

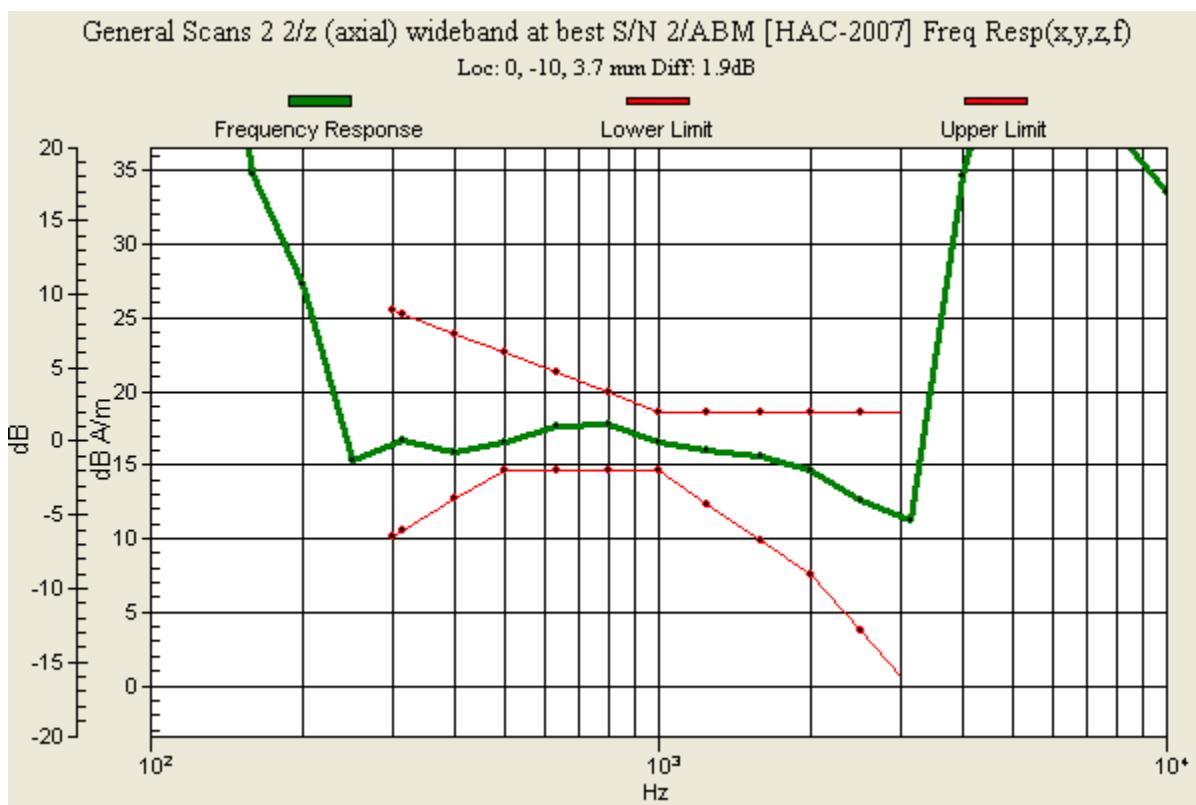

Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>	FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>
-------------------------------------	---	---------------------------------------	--

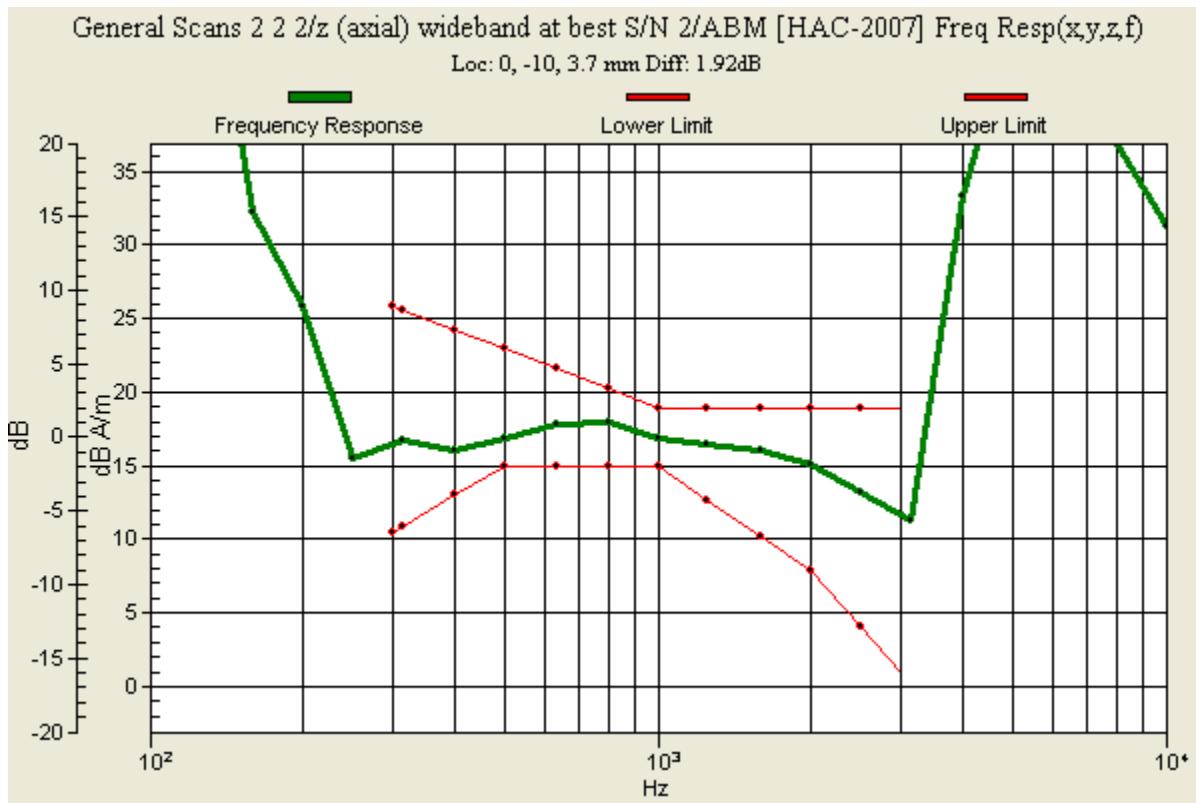

 <p><b>Document</b>  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			<b>Page</b> <b>140(173)</b>
<b>Author Data</b> <b>Andrew Becker</b>	<b>Dates of Test</b> <b>Mar. 09-10, May 27, July 12, 2011</b>	<b>Report No</b> <b>RTS-3640-1103-10B</b>	<b>FCC ID</b> <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

Date/Time: 7/12/2011 9:12:41 PM, Date/Time: 7/12/2011 9:26:33 PM,

Date/Time: 7/12/2011 9:53:25 PM, Date/Time: 7/12/2011 10:16:20 PM

**Test Laboratory:** RIM Testing Services

HAC T-Coil\_UMTS\_band\_IV\_Radial\_L

**DUT:** BlackBerry; **Type:** Sample

Communication System: WCDMA FDD IV; Communication System Band:

Exported from older format (data unavailable - please correct).; Frequency:

1712.4 MHz, Frequency: 1732.6 MHz, Frequency: 1752.6 MHz; Communication System PAR: 0 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

**DASY5 Configuration:**

- Probe: AM1DV3 - 3062; ; Calibrated: 4/7/2011
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE3 Sn472; Calibrated: 3/7/2011
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/x (longitudinal) 5.0mm 50 x 50/ABM**

**[HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

 <p>Document  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			Page <b>141(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>	FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

### **T-Coil scan/General Scans 2/x (longitudinal) 2mm 8 x 8/ABM**

#### **[HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

ABM1/ABM2 = 54.04 dB

ABM1 comp = 7.67 dB A/m

BWC Factor = 0.14 dB

Location: -12, -10, 4.4 mm

### **T-Coil scan/General Scans 2 2/x (longitudinal) 2mm 8 x**

#### **8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

ABM1/ABM2 = 53.74 dB

ABM1 comp = 7.47 dB A/m

BWC Factor = 0.14 dB

Location: -10, -12, 4.4 mm

### **T-Coil scan/General Scans 2 2 2/x (longitudinal) 2mm 8 x**

#### **8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.15 dB

Device Reference Point: 0, 0, -6.3 mm

Author Data  
**Andrew Becker**

Dates of Test


**Mar. 09-10, May 27, July  
12, 2011**

Report No

**RTS-3640-1103-10B**

FCC ID

**L6ARDM70UW  
L6AREN70UW**
**Cursor:**

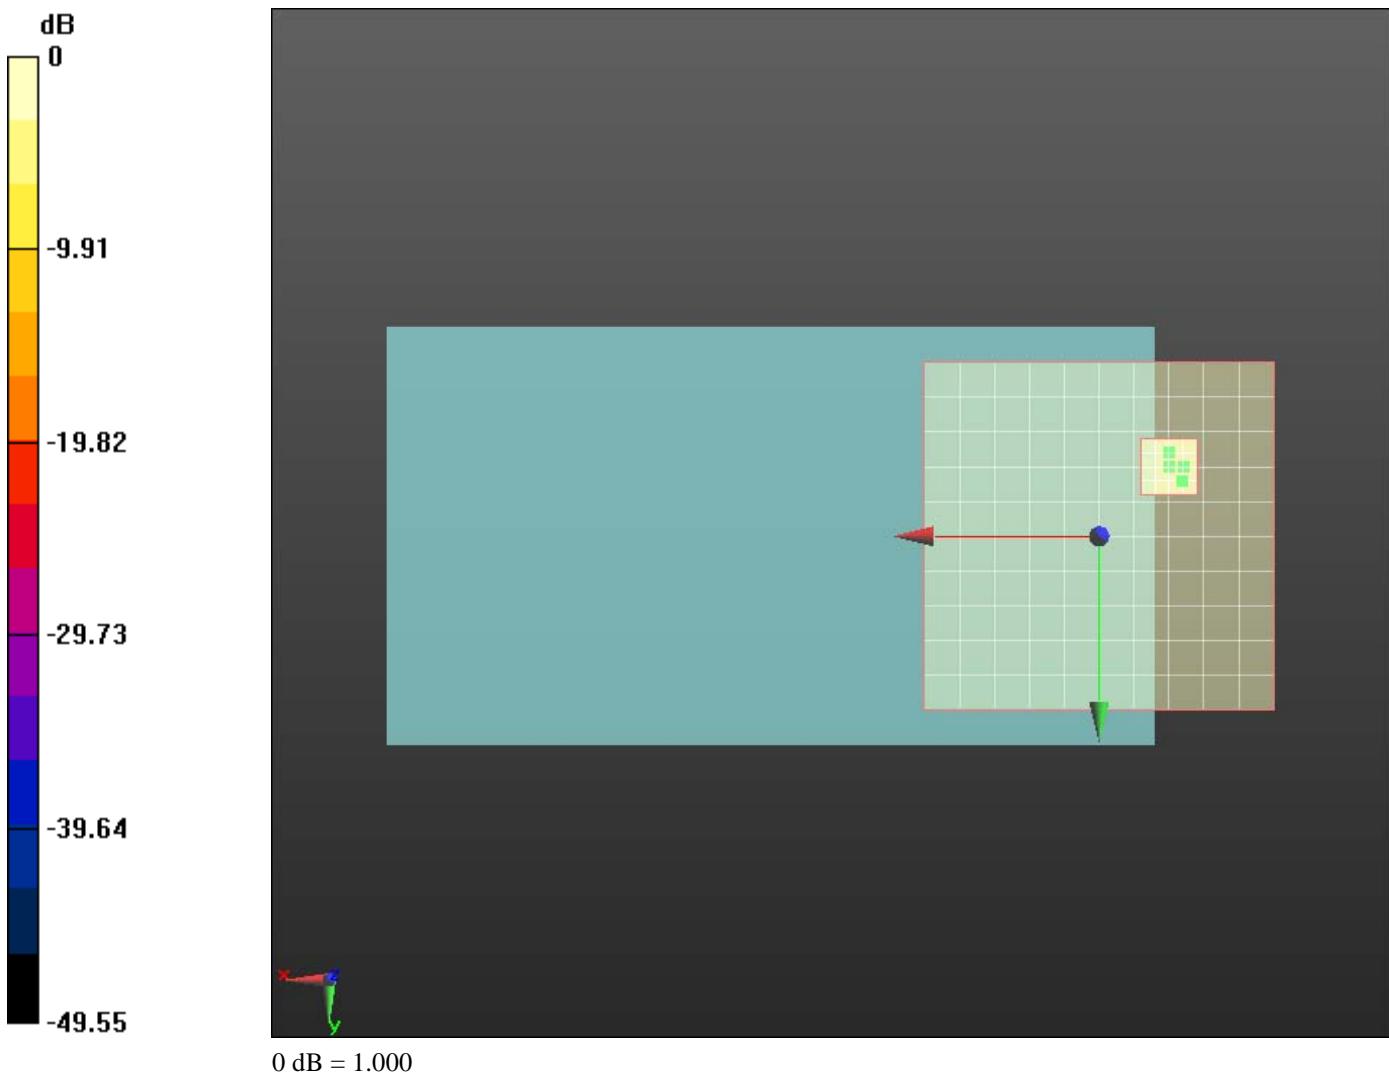 ABM1/ABM2 = 53.52 dB  
 ABM1 comp = 7.83 dB A/m  
 BWC Factor = 0.15 dB  
 Location: -12, -8, 4.4 mm


 <p>Document  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			Page <b>143(173)</b>
<p>Author Data  <b>Andrew Becker</b></p>	<p>Dates of Test  <b>Mar. 09-10, May 27, July 12, 2011</b></p>	<p>Report No  <b>RTS-3640-1103-10B</b></p>	<p>FCC ID  <b>L6ARDM70UW</b>  <b>L6AREN70UW</b></p>

Date/Time: 7/12/2011 9:29:38 PM, Date/Time: 7/12/2011 9:43:08 PM,

Date/Time: 7/12/2011 9:56:37 PM, Date/Time: 7/12/2011 10:19:28 PM

Test Laboratory: RIM Testing Services

HAC T-Coil\_UMTS\_band\_IV\_Radial\_T

**DUT: BlackBerry; Type: Sample**

Communication System: WCDMA FDD IV; Communication System Band:

Exported from older format (data unavailable - please correct).; Frequency:

1712.4 MHz, Frequency: 1732.6 MHz, Frequency: 1752.6 MHz; Communication System PAR: 0 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 4/7/2011
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE3 Sn472; Calibrated: 3/7/2011
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/y (transversal) 5.0mm 50 x 50/ABM**

**[HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

 <p>Document  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			Page <b>144(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>	FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

### **T-Coil scan/General Scans 2/y (transversal) 2mm 8 x 8/ABM**

#### **[HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

ABM1/ABM2 = 54.11 dB

ABM1 comp = 10.06 dB A/m

BWC Factor = 0.14 dB

Location: -2, 0, 4.4 mm

### **T-Coil scan/General Scans 2 2/y (transversal) 2mm 8 x**

#### **8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

ABM1/ABM2 = 54.23 dB

ABM1 comp = 10.18 dB A/m

BWC Factor = 0.14 dB

Location: -2, -2, 4.4 mm

### **T-Coil scan/General Scans 2 2 2/y (transversal) 2mm 8 x**

#### **8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.15 dB

Device Reference Point: 0, 0, -6.3 mm

Author Data  
**Andrew Becker**

Dates of Test


**Mar. 09-10, May 27, July  
12, 2011**

Report No

**RTS-3640-1103-10B**

FCC ID

**L6ARDM70UW  
L6AREN70UW**
**Cursor:**

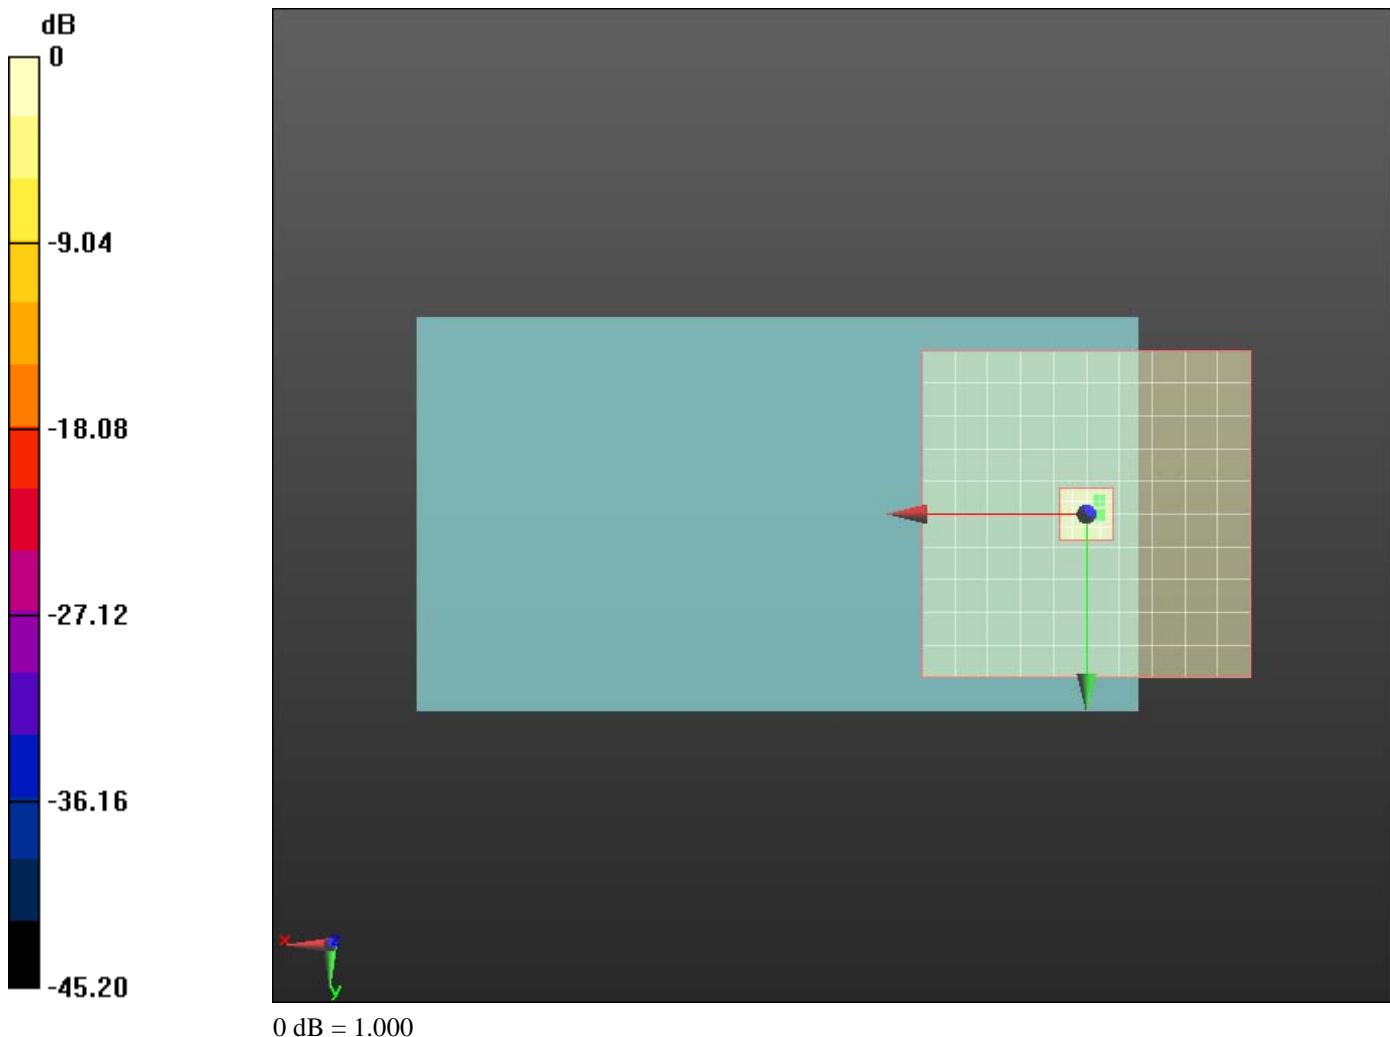 ABM1/ABM2 = 54.10 dB  
 ABM1 comp = 10.38 dB A/m  
 BWC Factor = 0.15 dB  
 Location: -2, 0, 4.4 mm


 <p>Document  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			Page <b>146(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>	FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

Date/Time: 7/12/2011 10:33:45 PM, Date/Time: 7/12/2011 10:47:17 PM,  
 Date/Time: 7/12/2011 11:24:31 PM, Date/Time: 7/12/2011 11:30:01 PM,  
 Date/Time: 7/12/2011 11:39:49 PM, Date/Time: 7/12/2011 11:47:50 PM,  
 Date/Time: 7/12/2011 11:58:06 PM

Test Laboratory: RIM Testing Services

HAC T-Coil\_UMTS\_band\_IV\_Slide\_Open\_Axial

**DUT: BlackBerry; Type: Sample**

Communication System: WCDMA FDD IV; Communication System Band: Exported from older format (data unavailable - please correct).; Frequency: 1712.4 MHz, Frequency: 1732.6 MHz, Frequency: 1752.6 MHz; Communication System PAR: 0 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 4/7/2011
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE3 Sn472; Calibrated: 3/7/2011
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/z (axial) 5.0mm 50 x 50/ABM [HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

	Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>147(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**T-Coil scan/General Scans 2/z (axial) 2mm 8 x 8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

ABM1/ABM2 = 57.03 dB

ABM1 comp = 17.44 dB A/m

BWC Factor = 0.14 dB

Location: 0, -10, 4.4 mm

**T-Coil scan/General Scans 2/z (axial) wideband at best S/N/ABM [HAC-2007] Freq Resp(x,y,z,f) (1x1x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_300-3000\_2s.wav

Output Gain: 69.12

Measure Window Start: 300ms

Measure Window Length: 2000ms

BWC applied: 10.78 dB

Device Reference Point: 0, 0, -6.3 mm

	Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>148(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

**Cursor:**

Diff = 2.00 dB  
 BWC Factor = 10.78 dB  
 Location: 0, -10, 3.7 mm

**T-Coil scan/General Scans 2 2/z (axial) 2mm 8 x 8/ABM  
[HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm  
 Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav  
 Output Gain: 35.28  
 Measure Window Start: 300ms  
 Measure Window Length: 1000ms  
 BWC applied: 0.14 dB  
 Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

ABM1/ABM2 = 56.54 dB  
 ABM1 comp = 16.66 dB A/m  
 BWC Factor = 0.14 dB  
 Location: -2, -6, 4.4 mm

**T-Coil scan/General Scans 2 2/z (axial) wideband at best S/N/ABM [HAC-2007] Freq Resp(x,y,z,f) (1x1x1):**

Measurement grid: dx=10mm, dy=10mm  
 Signal Type: Audio File (.wav) 48k\_voice\_300-3000\_2s.wav  
 Output Gain: 69.12  
 Measure Window Start: 300ms  
 Measure Window Length: 2000ms  
 BWC applied: 10.78 dB  
 Device Reference Point: 0, 0, -6.3 mm

**T-Coil scan/General Scans 2 2/z (axial) 2mm 8 x 8/ABM  
[HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm  
 Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav  
 Output Gain: 35.28  
 Measure Window Start: 300ms  
 Measure Window Length: 1000ms  
 BWC applied: 0.14 dB  
 Device Reference Point: 0, 0, -6.3 mm

	Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>149(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

**Cursor:**


ABM1/ABM2 = 56.67 dB  
 ABM1 comp = 17.58 dB A/m  
 BWC Factor = 0.14 dB  
 Location: -2, -10, 4.4 mm

**T-Coil scan/General Scans 2 2 2/z (axial) wideband at best S/N 2/ABM [HAC-2007] Freq Resp(x,y,z,f) (1x1x1):**


Measurement grid: dx=10mm, dy=10mm  
 Signal Type: Audio File (.wav) 48k\_voice\_300-3000\_2s.wav  
 Output Gain: 69.12  
 Measure Window Start: 2000ms  
 Measure Window Length: 4000ms  
 BWC applied: 10.79 dB  
 Device Reference Point: 0, 0, -6.3 mm


**Cursor:**

Diff = 1.89 dB  
 BWC Factor = 10.79 dB  
 Location: 0, -10, 3.7 mm

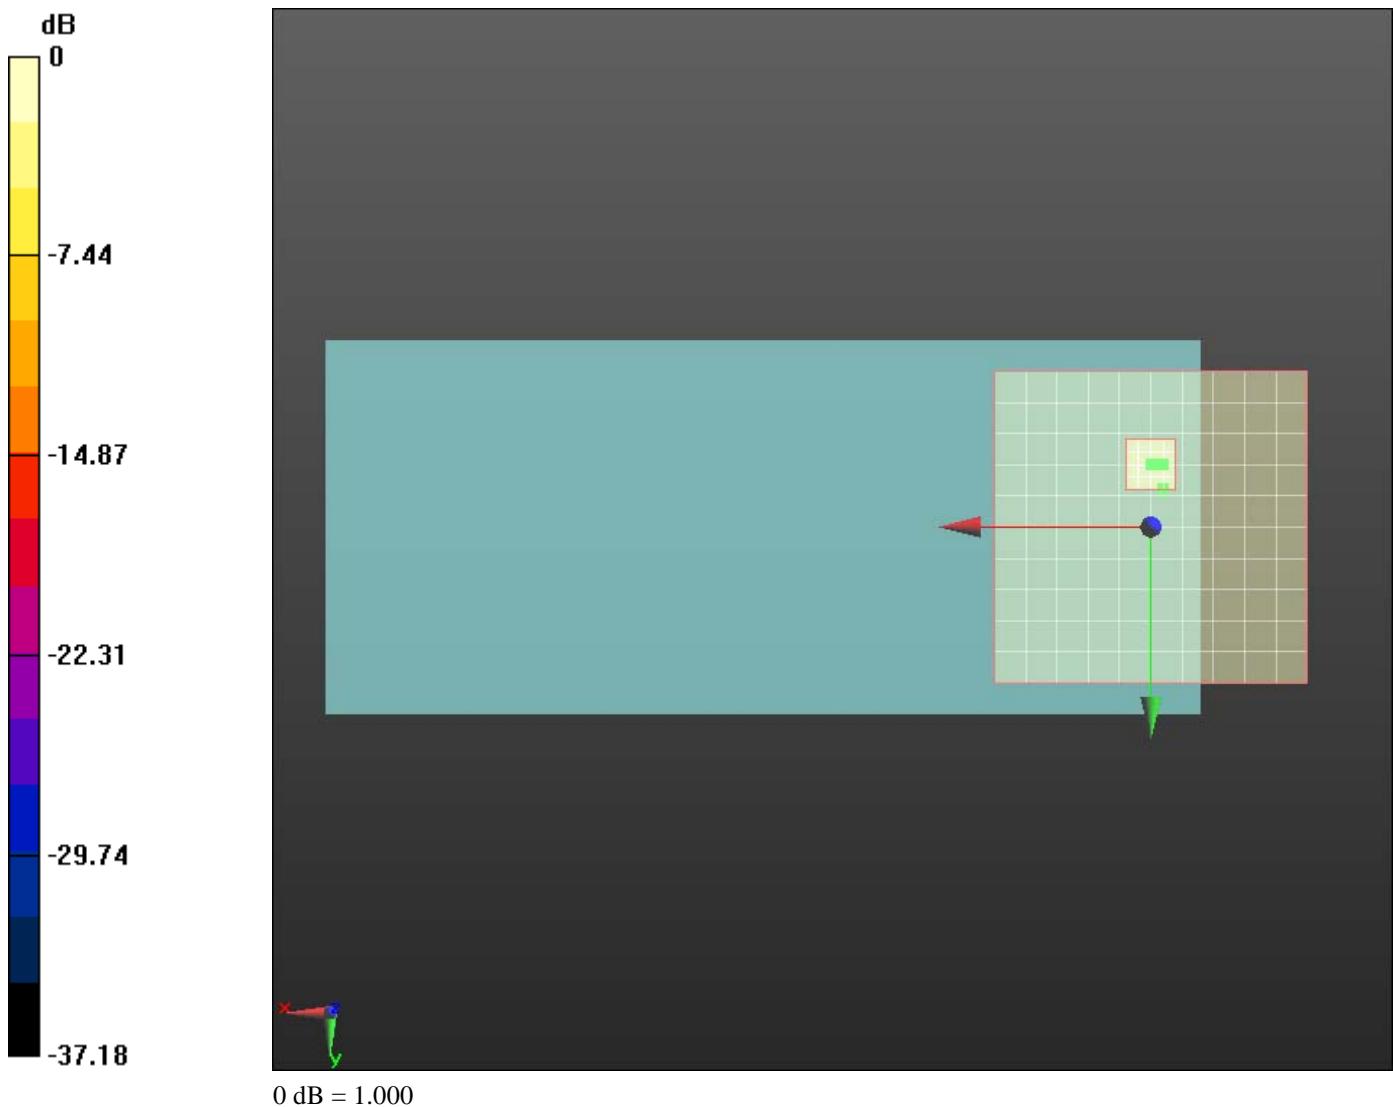
Author Data  
**Andrew Becker**Dates of Test  
**Mar. 09-10, May 27, July  
12, 2011**Report No  
**RTS-3640-1103-10B**FCC ID  
**L6ARDM70UW  
L6AREN70UW**

Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>	FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>
-------------------------------------	---	---------------------------------------	--

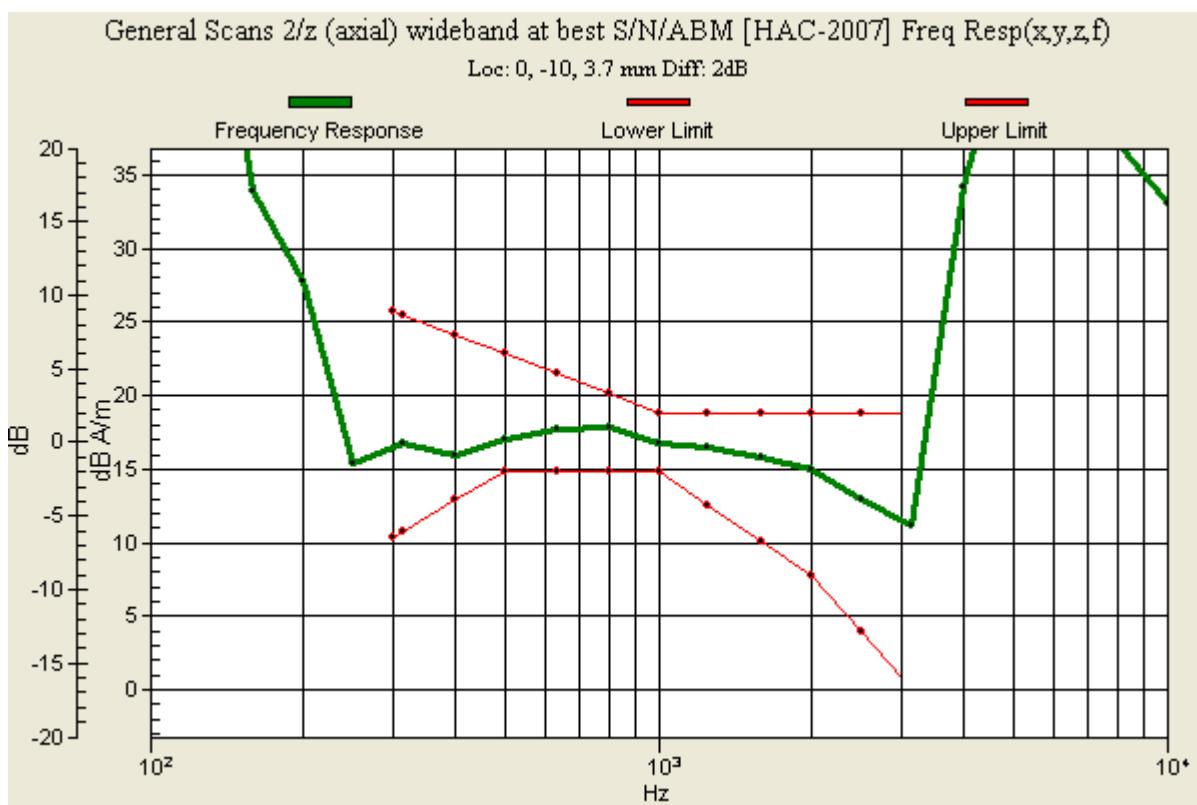

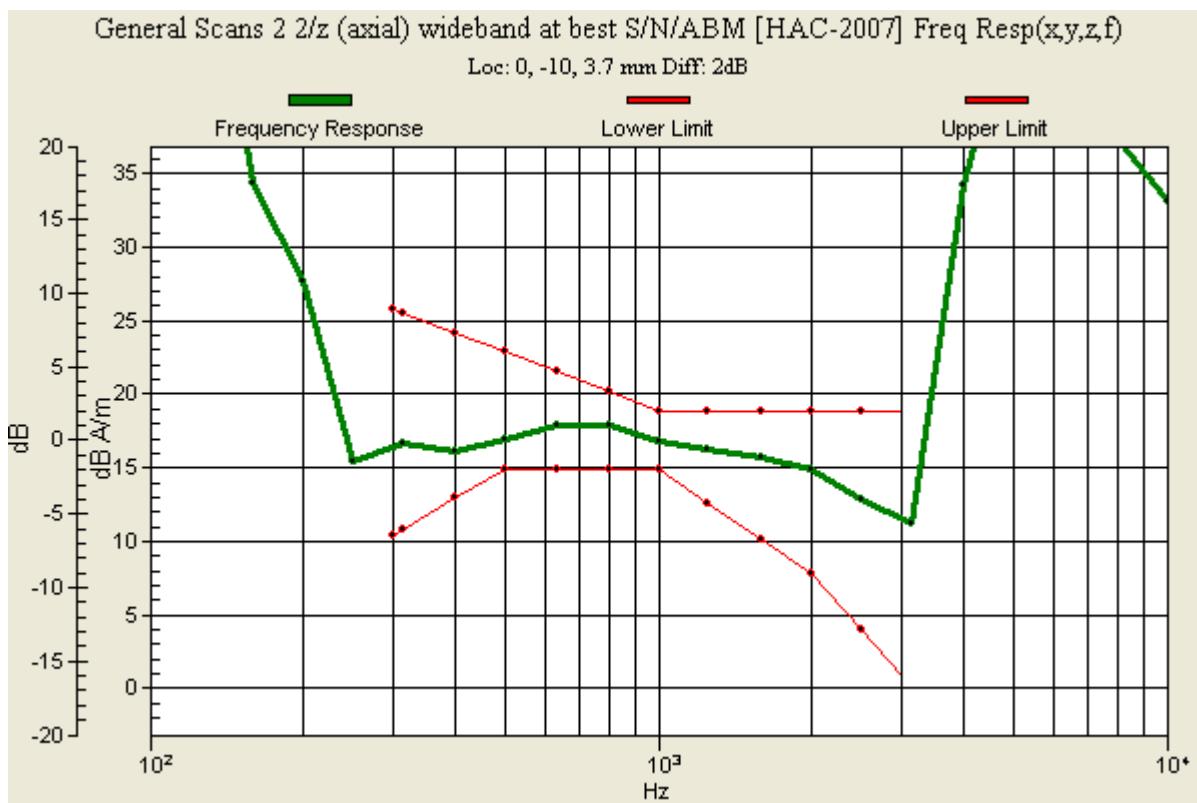

Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>	FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>
-------------------------------------	---	---------------------------------------	--

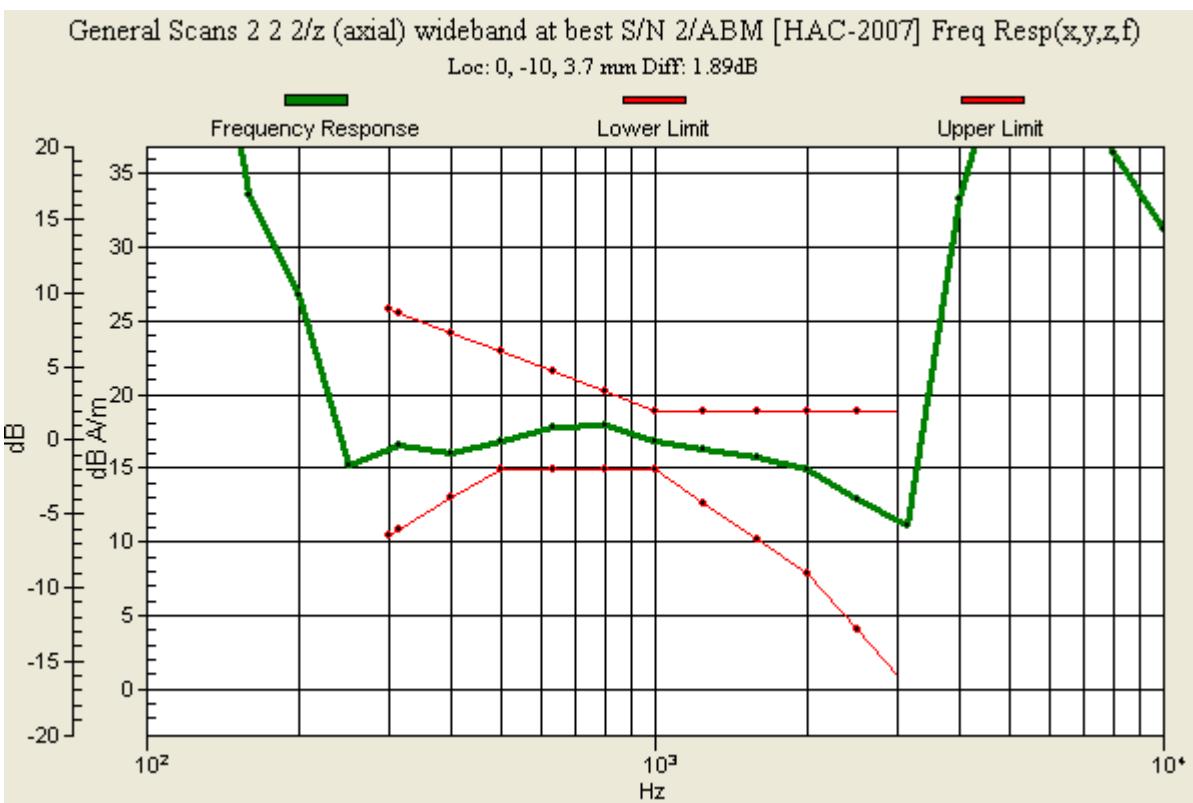

 <p>Document  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			Page <b>154(173)</b>
<p>Author Data  <b>Andrew Becker</b></p>	<p>Dates of Test  <b>Mar. 09-10, May 27, July 12, 2011</b></p>	<p>Report No  <b>RTS-3640-1103-10B</b></p>	<p>FCC ID  <b>L6ARDM70UW</b>  <b>L6AREN70UW</b></p>

Date/Time: 7/12/2011 10:50:44 PM, Date/Time: 7/12/2011 11:04:43 PM,

Date/Time: 7/12/2011 11:33:31 PM, Date/Time: 7/12/2011 11:51:23 PM

Test Laboratory: RIM Testing Services

HAC T-Coil\_UMTS\_band\_IV\_Slide\_Open\_Radial\_L

DUT: BlackBerry; Type: Sample;

Communication System: WCDMA FDD IV; Communication System Band:

Exported from older format (data unavailable - please correct).; Frequency:

1712.4 MHz, Frequency: 1732.6 MHz, Frequency: 1752.6 MHz; Communication System PAR: 0 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 4/7/2011
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE3 Sn472; Calibrated: 3/7/2011
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/x (longitudinal) 5.0mm 50 x 50/ABM**

**[HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

 <p>Document  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			Page <b>155(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>	FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

### **T-Coil scan/General Scans 2/x (longitudinal) 2mm 8 x 8/ABM**

#### **[HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

ABM1/ABM2 = 54.65 dB

ABM1 comp = 8.17 dB A/m

BWC Factor = 0.14 dB

Location: -8, -10, 4.4 mm

### **T-Coil scan/General Scans 2 2/x (longitudinal) 2mm 8 x**

#### **8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

ABM1/ABM2 = 54.63 dB

ABM1 comp = 8.38 dB A/m

BWC Factor = 0.14 dB

Location: -10, -10, 4.4 mm

### **T-Coil scan/General Scans 2 2 2/x (longitudinal) 2mm 8 x**

#### **8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

Author Data  
**Andrew Becker**


Dates of Test  
**Mar. 09-10, May 27, July 12, 2011**

Report No  
**RTS-3640-1103-10B**

FCC ID  
**L6ARDM70UW**  
**L6AREN70UW**

**Cursor:**

ABM1/ABM2 = 54.84 dB  
 ABM1 comp = 8.71 dB A/m  
 BWC Factor = 0.14 dB  
 Location: -10, -8, 4.4 mm

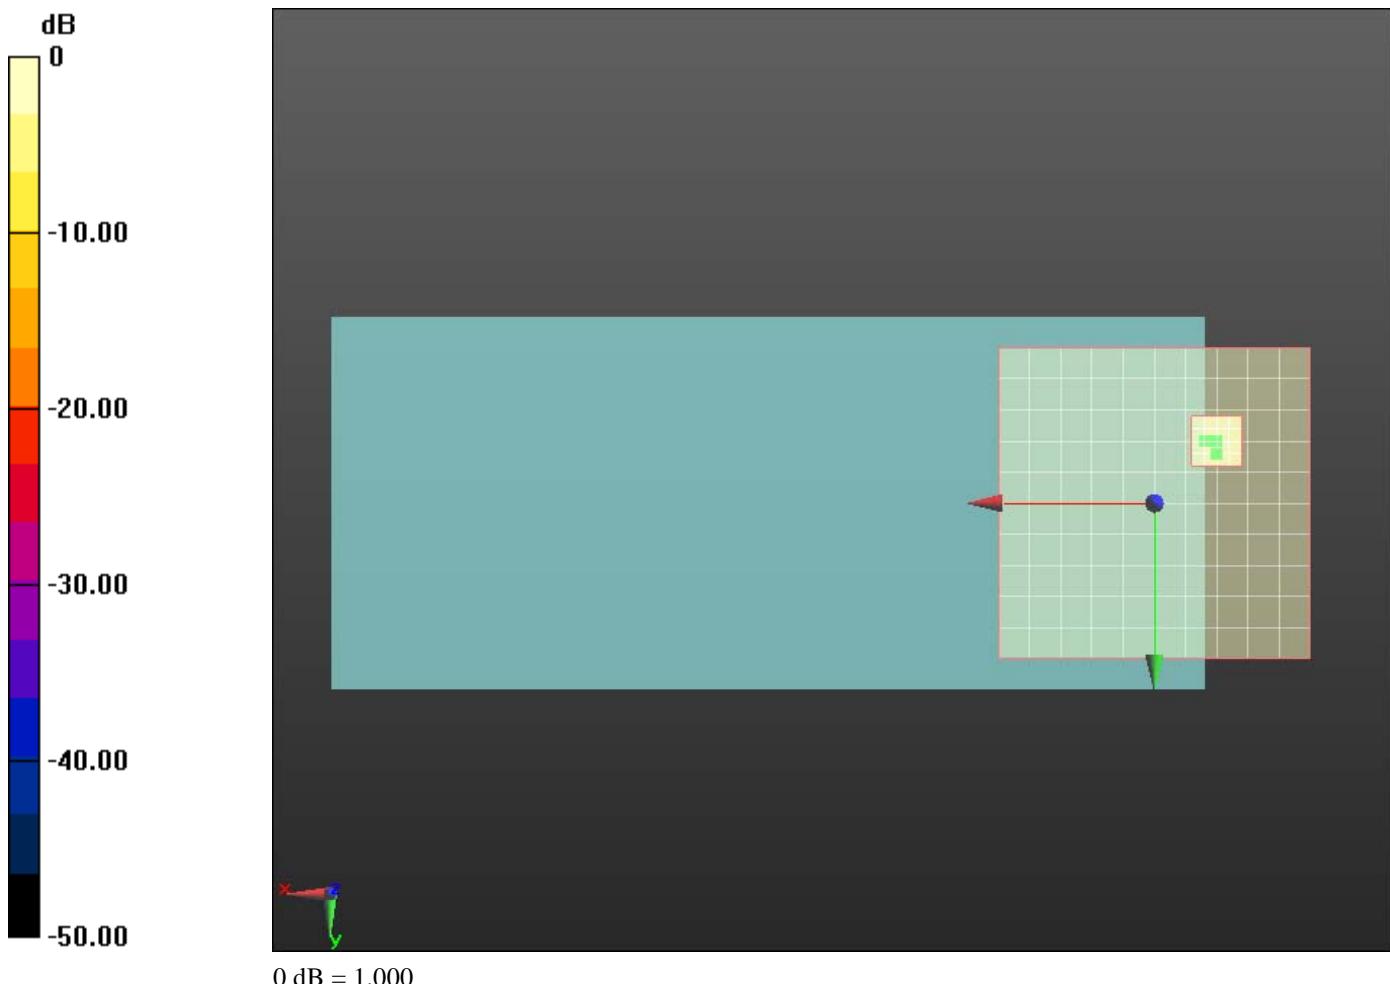

 <p><b>Document</b>  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			<b>Page</b> <b>157(173)</b>
<b>Author Data</b> <b>Andrew Becker</b>	<b>Dates of Test</b> <b>Mar. 09-10, May 27, July 12, 2011</b>	<b>Report No</b> <b>RTS-3640-1103-10B</b>	<b>FCC ID</b> <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

Date/Time: 7/12/2011 11:07:49 PM, Date/Time: 7/12/2011 11:21:23 PM,

Date/Time: 7/12/2011 11:36:40 PM, Date/Time: 7/12/2011 11:54:50 PM

**Test Laboratory:** RIM Testing Services

HAC T-Coil\_UMTS\_band\_IV\_Slide\_Open\_Radial\_T

**DUT:** BlackBerry; **Type:** Sample

Communication System: WCDMA FDD IV; Communication System Band:

Exported from older format (data unavailable - please correct).; Frequency:

1712.4 MHz, Frequency: 1732.6 MHz, Frequency: 1752.6 MHz; Communication System PAR: 0 dB

Medium parameters used:  $\sigma = 0$  mho/m,  $\epsilon_r = 1$ ;  $\rho = 0$  kg/m<sup>3</sup>

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

**DASY5 Configuration:**

- Probe: AM1DV3 - 3062; ; Calibrated: 4/7/2011
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE3 Sn472; Calibrated: 3/7/2011
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

**T-Coil scan/General Scans 2/y (transversal) 5.0mm 50 x 50/ABM**

**[HAC-2007] SNR(x,y,z) (11x11x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

 <p>Document  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			Page <b>158(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>	FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

### **T-Coil scan/General Scans 2/y (transversal) 2mm 8 x 8/ABM**

#### **[HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

ABM1/ABM2 = 54.54 dB

ABM1 comp = 8.41 dB A/m

BWC Factor = 0.14 dB

Location: -1, -15, 4.4 mm

### **T-Coil scan/General Scans 2 2/y (transversal) 2mm 8 x**

#### **8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

**Cursor:**

ABM1/ABM2 = 54.76 dB

ABM1 comp = 8.19 dB A/m

BWC Factor = 0.14 dB

Location: -1, -17, 4.4 mm

### **T-Coil scan/General Scans 2 2 2/y (transversal) 2mm 8 x**

#### **8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k\_voice\_1kHz\_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.14 dB

Device Reference Point: 0, 0, -6.3 mm

Author Data  
**Andrew Becker**


Dates of Test  
**Mar. 09-10, May 27, July 12, 2011**

Report No  
**RTS-3640-1103-10B**

FCC ID  
**L6ARDM70UW**  
**L6AREN70UW**

**Cursor:**

ABM1/ABM2 = 54.71 dB  
 ABM1 comp = 8.70 dB A/m  
 BWC Factor = 0.14 dB  
 Location: -1, -15, 4.4 mm

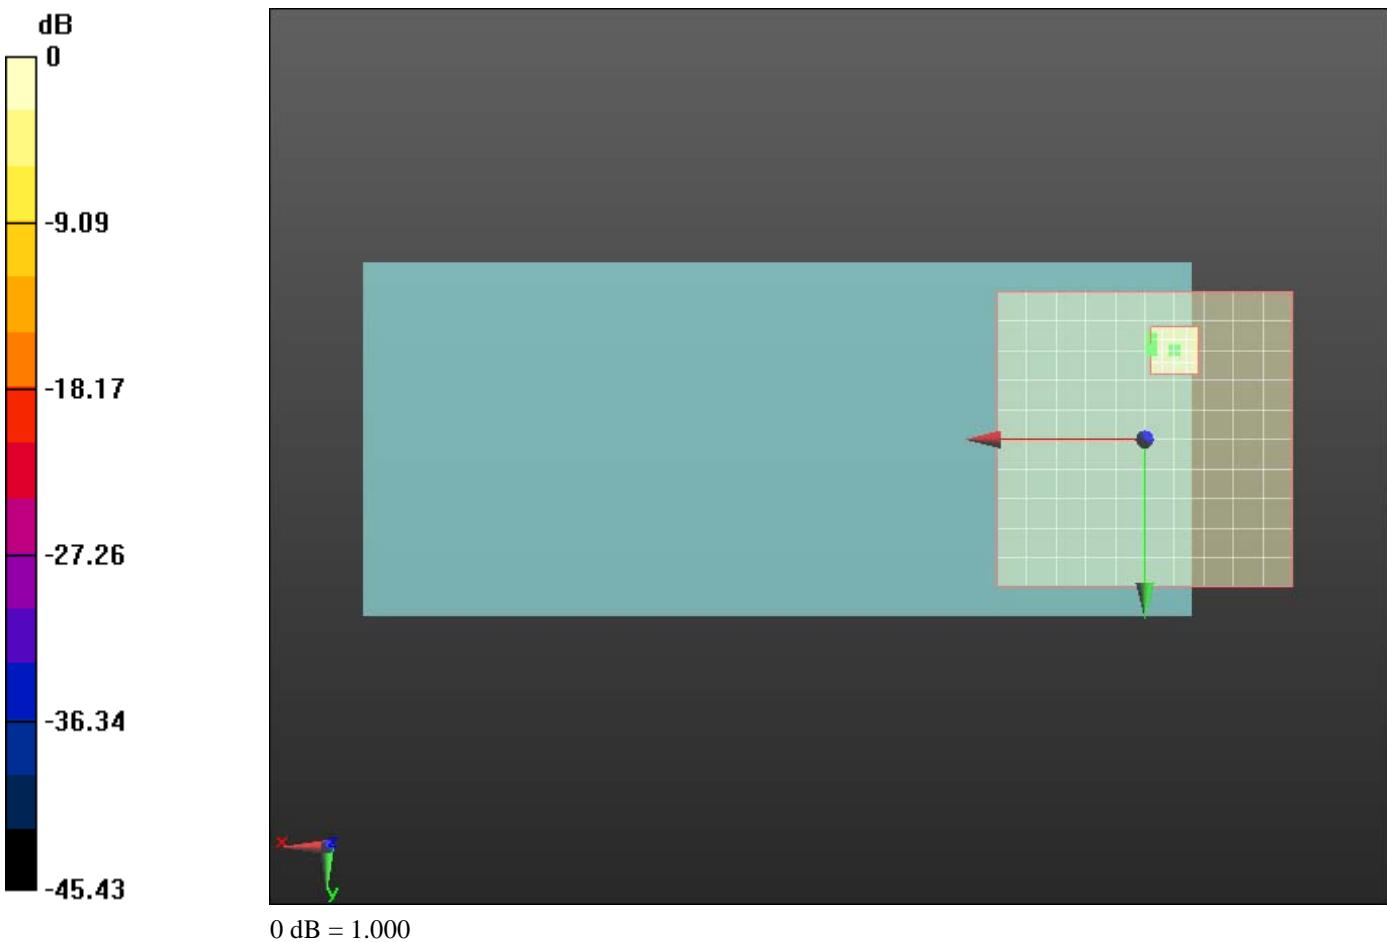

	Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>160(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

**Annex D: Probe/TMFS calibration certificate and equipment specification**



Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>161(173)</b>
---	-------------------------

Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>	FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>
-------------------------------------	---	---------------------------------------	--

**Calibration Laboratory of**  
Schmid & Partner  
Engineering AG  
Zeughausstrasse 43, 8004 Zurich, Switzerland



**S** Schweizerischer Kalibrierdienst  
**C** Service suisse d'étalonnage  
**S** Servizio svizzero di taratura  
**S** Swiss Calibration Service

Accredited by the Swiss Accreditation Service (SAS)

Accreditation No.: **SCS 108**

The Swiss Accreditation Service is one of the signatories to the EA

Multilateral Agreement for the recognition of calibration certificates

Client **RTS (RIM Testing Service)**

Certificate No: **AM1DV3-3062\_Jun10**

## **CALIBRATION CERTIFICATE**

Object **AM1DV3 - SN: 3062**

Calibration procedure(s) **QA CAL-24.v2**  
Calibration procedure for AM1D magnetic field probes and TMFS in the audio range

Calibration date: **June 8, 2010**

This calibration certificate documents the traceability to national standards, which realize the physical units of measurements (SI).  
The measurements and the uncertainties with confidence probability are given on the following pages and are part of the certificate.

All calibrations have been conducted in the closed laboratory facility. environment temperature (22 ± 3)°C and humidity < 70%.

Calibration Equipment used (M&TE critical for calibration)

Primary Standards	ID #	Cal Date (Certificate No.)	Scheduled Calibration
Keithley Multimeter Type 2001	SN: 0810278	1-Oct-09 (No: 9055)	Oct-10
Reference Probe AM1DV3	SN: 3000	17-Aug-09 (No. AM1D-3000_Aug09)	Aug-10
DAE4	SN: 781	22-Jan-10 (No. DAE4-781_Jan10)	Jan-11
Secondary Standards	ID #	Check Date (in house)	Scheduled Check
AMCC	1050	15-Oct-09 (in house check Oct-09)	Oct-10

Calibrated by: Name **Mike Mell** Function **Laboratory Technician** Signature

Approved by: Name **Fin Bomholt** Function **R&D Director** Signature

Issued: June 9, 2010

This calibration certificate shall not be reproduced except in full without written approval of the laboratory.

 <p><b>Document</b>  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			<b>Page</b> <b>162(173)</b>
<b>Author Data</b> <b>Andrew Becker</b>	<b>Dates of Test</b> <b>Mar. 09-10, May 27, July 12, 2011</b>	<b>Report No</b> <b>RTS-3640-1103-10B</b>	<b>FCC ID</b> <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

## References

- [1] ANSI C63.19-2007  
American National Standard for Methods of Measurement of Compatibility between Wireless Communications Devices and Hearing Aids.
- [2] DASY4 manual, Chapter: Hearing Aid Compatibility (HAC) T-Coil Extension

## Description of the AM1D probe

The AM1D Audio Magnetic Field Probe is a fully shielded magnetic field probe for the frequency range from 100 Hz to 20 kHz. The pickup coil is compliant with the dimensional requirements of [1]. The probe includes a symmetric low noise amplifier for the signal available at the shielded 3 pin connector at the side. Power is supplied via the same connector (phantom power supply) and monitored via the LED near the connector. The 7 pin connector at the end of the probe does not carry any signals, but determines the angle of the sensor when mounted on the DAE. The probe supports mechanical detection of the surface. The single sensor in the probe is arranged in a tilt angle allowing measurement of 3 orthogonal field components when rotating the probe by 120° around its axis. It is aligned with the perpendicular component of the field, if the probe axis is tilted nominally 35.3° above the measurement plane, using the connector rotation and sensor angle stated below. The probe is fully RF shielded when operated with the matching signal cable (shielded) and allows measurement of audio magnetic fields in the close vicinity of RF emitting wireless devices according to [1] without additional shielding.

## Handling of the item

The probe is manufactured from stainless steel. In order to maintain the performance and calibration of the probe, it must not be opened. The probe is designed for operation in air and shall not be exposed to humidity or liquids. For proper operation of the surface detection and emergency stop functions in a DASY system, the probe must be operated with the special probe cup provided (larger diameter).

## Methods Applied and Interpretation of Parameters

- *Coordinate System:* The AM1D probe is mounted in the DASY system for operation with a HAC Test Arch phantom with AMCC Helmholtz calibration coil according to [2], with the tip pointing to "southwest" orientation.
- *Functional Test:* The functional test preceding calibration includes test of Noise level  
RF immunity (1kHz AM modulated signal). The shield of the probe cable must be well connected. Frequency response verification from 100 Hz to 10 kHz.
- *Connector Rotation:* The connector at the end of the probe does not carry any signals and is used for fixation to the DAE only. The probe is operated in the center of the AMCC Helmholtz coil using a 1 kHz magnetic field signal. Its angle is determined from the two minima at nominally +120° and -120° rotation, so the sensor in the tip of the probe is aligned to the vertical plane in z-direction, corresponding to the field maximum in the AMCC Helmholtz calibration coil.
- *Sensor Angle:* The sensor tilting in the vertical plane from the ideal vertical direction is determined from the two minima at nominally +120° and -120°. DASY system uses this angle to align the sensor for radial measurements to the x and y axis in the horizontal plane.
- *Sensitivity:* With the probe sensor aligned to the z-field in the AMCC, the output of the probe is compared to the magnetic field in the AMCC at 1 kHz. The field in the AMCC Helmholtz coil is given by the geometry and the current through the coil, which is monitored on the precision shunt resistor of the coil.

	Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>163(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

#### AM1D probe identification and configuration data

Item	<b>AM1DV3 Audio Magnetic 1D Field Probe</b>
Type No	<b>SP AM1 001 BA</b>
Serial No	<b>3062</b>

Overall length	296 mm
Tip diameter	6.0 mm (at the tip)
Sensor offset	3.0 mm (centre of sensor from tip)
Internal Amplifier	20 dB

Manufacturer / Origin	<b>Schmid &amp; Partner Engineering AG, Zürich, Switzerland</b>
Manufacturing date	<b>Oct-2008</b>
Last calibration date	<b>June 16, 2009</b>

#### Calibration data

Connector rotation angle	(in DASY system)	<b>62.6 °</b>	<b>+/- 3.6 ° (k=2)</b>
Sensor angle	(in DASY system)	<b>0.00 °</b>	<b>+/- 0.5 ° (k=2)</b>
Sensitivity at 1 kHz	(in DASY system)	<b>0.00741 V / (A/m)</b>	<b>+/- 2.2 % (k=2)</b>



Document  
Annex A-D to Hearing Aid Compatibility Audio Band Magnetic  
(ABM) T-Coil Test Report for BlackBerry® Smartphone model  
RDM71UW/REN71UW

Page  
164(173)

Author Data Andrew Becker	Dates of Test Mar. 09-10, May 27, July 12, 2011	Report No RTS-3640-1103-10B	FCC ID L6ARDM70UW L6AREN70UW
------------------------------	---	--------------------------------	------------------------------------

Calibration Laboratory of  
Schmid & Partner  
Engineering AG  
Zeughausstrasse 43, 8004 Zurich, Switzerland



S Schweizerischer Kalibrierdienst  
C Service suisse d'étalonnage  
S Servizio svizzero di taratura  
S Swiss Calibration Service

Accredited by the Swiss Accreditation Service (SAS)

The Swiss Accreditation Service is one of the signatories to the EA  
Multilateral Agreement for the recognition of calibration certificates

Client RTS (RIM Testing Services)

Accreditation No.: SCS 108

Certificate No: AM1DV3-3062\_Apr11

## CALIBRATION CERTIFICATE

Object AM1DV3 - SN: 3062

Calibration procedure(s) QA CAL-24.v2  
Calibration procedure for AM1D magnetic field probes and TMFS in the  
audio range

Calibration date: April 7, 2011

This calibration certificate documents the traceability to national standards, which realize the physical units of measurements (SI).  
The measurements and the uncertainties with confidence probability are given on the following pages and are part of the certificate.

All calibrations have been conducted in the closed laboratory facility: environment temperature (22 ± 3)°C and humidity < 70%.

Calibration Equipment used (M&TE critical for calibration)

Primary Standards	ID #	Cal Date (Certificate No.)	Scheduled Calibration
Keithley Multimeter Type 2001	SN: 0810278	28-Sep-10 (No:10376)	Sep-11
Reference Probe AM1DV3	SN: 3000	6-Sep-10 (No: AM1D-3000_Sep10)	Sep-11
DAE4	SN: 781	20-Oct-10 (No: DAE4-781_Oct10)	Oct-11

Secondary Standards	ID #	Check Date (in house)	Scheduled Check
AMCC	1060	15-Oct-09 (in house check Oct-09)	Oct-11

Calibrated by:	Name Claudio Leubier	Function Laboratory Technician	
Approved by:	Pin Bonholt	R&D Director	

Issued: April 8, 2011

This calibration certificate shall not be reproduced except in full without written approval of the laboratory.

 <p>Document  <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b></p>			Page <b>165(173)</b>
<b>Author Data</b> <b>Andrew Becker</b>	<b>Dates of Test</b> <b>Mar. 09-10, May 27, July 12, 2011</b>	<b>Report No</b> <b>RTS-3640-1103-10B</b>	<b>FCC ID</b> <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

## References

- [1] **ANSI C63.19-2007**  
American National Standard for Methods of Measurement of Compatibility between Wireless Communications Devices and Hearing Aids.
- [2] **DASY4 manual, Chapter: Hearing Aid Compatibility (HAC) T-Coil Extension**

## Description of the AM1D probe

The AM1D Audio Magnetic Field Probe is a fully shielded magnetic field probe for the frequency range from 100 Hz to 20 kHz. The pickup coil is compliant with the dimensional requirements of [1]. The probe includes a symmetric low noise amplifier for the signal available at the shielded 3 pin connector at the side. Power is supplied via the same connector (phantom power supply) and monitored via the LED near the connector. The 7 pin connector at the end of the probe does not carry any signals, but determines the angle of the sensor when mounted on the DAE. The probe supports mechanical detection of the surface.

The single sensor in the probe is arranged in a tilt angle allowing measurement of 3 orthogonal field components when rotating the probe by 120° around its axis. It is aligned with the perpendicular component of the field, if the probe axis is tilted nominally 35.3° above the measurement plane, using the connector rotation and sensor angle stated below.

The probe is fully RF shielded when operated with the matching signal cable (shielded) and allows measurement of audio magnetic fields in the close vicinity of RF emitting wireless devices according to [1] without additional shielding.

## Handling of the item

The probe is manufactured from stainless steel. In order to maintain the performance and calibration of the probe, it must not be opened. The probe is designed for operation in air and shall not be exposed to humidity or liquids. For proper operation of the surface detection and emergency stop functions in a DASY system, the probe must be operated with the special probe cup provided (larger diameter).

## Methods Applied and Interpretation of Parameters

- **Coordinate System:** The AM1D probe is mounted in the DASY system for operation with a HAC Test Arch phantom with AMCC Helmholtz calibration coil according to [2], with the tip pointing to "southwest" orientation.
- **Functional Test:** The functional test preceding calibration includes test of Noise level RF immunity (1kHz AM modulated signal). The shield of the probe cable must be well connected. Frequency response verification from 100 Hz to 10 kHz.
- **Connector Rotation:** The connector at the end of the probe does not carry any signals and is used for fixation to the DAE only. The probe is operated in the center of the AMCC Helmholtz coil using a 1 kHz magnetic field signal. Its angle is determined from the two minima at nominally +120° and -120° rotation, so the sensor in the tip of the probe is aligned to the vertical plane in z-direction, corresponding to the field maximum in the AMCC Helmholtz calibration coil.
- **Sensor Angle:** The sensor tilting in the vertical plane from the ideal vertical direction is determined from the two minima at nominally +120° and -120°. DASY system uses this angle to align the sensor for radial measurements to the x and y axis in the horizontal plane.
- **Sensitivity:** With the probe sensor aligned to the z-field in the AMCC, the output of the probe is compared to the magnetic field in the AMCC at 1 kHz. The field in the AMCC Helmholtz coil is given by the geometry and the current through the coil, which is monitored on the precision shunt resistor of the coil.



Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>166(173)</b>
<b>Author Data</b> <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b> Report No <b>RTS-3640-1103-10B</b> FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>

#### AM1D probe identification and configuration data

<b>Item</b>	<b>AM1DV3 Audio Magnetic 1D Field Probe</b>
<b>Type No</b>	<b>SP AM1 001 BA</b>
<b>Serial No</b>	<b>3062</b>

<b>Overall length</b>	<b>296 mm</b>
<b>Tip diameter</b>	<b>6.0 mm (at the tip)</b>
<b>Sensor offset</b>	<b>3.0 mm (centre of sensor from tip)</b>
<b>Internal Amplifier</b>	<b>20 dB</b>

<b>Manufacturer / Origin</b>	<b>Schmid &amp; Partner Engineering AG, Zürich, Switzerland</b>
<b>Manufacturing date</b>	<b>Oct-2008</b>
<b>Last calibration date</b>	<b>June 8, 2010</b>

#### Calibration data

Connector rotation angle (in DASY system) **57.8 °** +/- 3.6 ° (k=2)

Sensor angle (in DASY system) **0.61 °** +/- 0.5 ° (k=2)

Sensitivity at 1 kHz (in DASY system) **0.00742 V / (A/m)** +/- 2.2 % (k=2)



Document

**Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW**

Page  
**167(173)**

Author Data  
**Andrew Becker**

Dates of Test

**Mar. 09-10, May 27, July 12, 2011**

Report No

**RTS-3640-1103-10B**

FCC ID

**L6ARDM70UW  
L6AREN70UW**

**Calibration Laboratory of**  
Schmid & Partner  
Engineering AG  
Zeughausstrasse 43, 8004 Zurich, Switzerland



**S** Schweizerischer Kalibrierdienst  
**C** Service suisse d'étalonnage  
**S** Servizio svizzero di taratura  
**S** Swiss Calibration Service

Accredited by the Swiss Accreditation Service (SAS)  
The Swiss Accreditation Service is one of the signatories to the EA  
Multilateral Agreement for the recognition of calibration certificates

Accreditation No.: **SCS 108**

Client

**RTS (RIM Testing Services)**Certificate No: **TMFS\_1003\_Jan10**

## **CALIBRATION CERTIFICATE**

Object / Identification

**TMFS-1 – SN: 1003**

Calibration procedure(s)

**QA CAL-24.v2****Calibration procedure for AM1D magnetic field probes and TMFS in the audio range**

Calibration date

**January 22, 2010**

Condition of the calibrated item

**In Tolerance**

This calibration certificate documents the traceability to national standards, which realize the physical units of measurements (SI).  
The calibrations have been conducted in the R&D laboratory facility: environment temperature (22 ± 3)°C and humidity < 70%.

Calibration Equipment used (M&amp;TE critical for calibration)

Primary Standards	ID #	Cal Date (Calibrated by, Certificate No.)	Scheduled Calibration
Keithley Multimeter Type 2001	SN: 0810278	1-Oct-09 (No: 9055)	Oct-10
Secondary Standards	ID #	Cal / Check Date	Scheduled Calibration Check
AMCC	1050	15-Oct-09 (in house check Oct-09)	Oct-11
Reference Probe AM1DV2	SN: 1008	21-Jan-10 (No. AM1D-1008_Jan10)	Jan-11
AMMI Audio Measuring Instrument	1062	14-Jul-09 (in house check Jul-09)	Jul-11
Agilent WF Generator 33120A	MY40005266	13-Oct-09 (in house check Oct-09)	Oct-11

Calibrated by:

Name  
**Mike Neill**Function  
**Laboratory Technician**Signature  

Approved by:

**Fin Bomhoff****R&D Director**

Issued: January 25, 2010

This calibration certificate shall not be reproduced except in full without written approval of the laboratory.

	Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>168(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

## References

- [1] ANSI-PC63.19-2007  
American National Standard for Methods of Measurement of Compatibility between Wireless Communications Devices and Hearing Aids.
- [2] DASY4 manual, Chapter 29: Hearing Aid Compatibility (HAC) T-Coil Extension (April 2008)

## Methods Applied and Interpretation of Parameters

- **Coordinate System:** The TMFS is mounted underneath the HAC Test Arch touching equivalently to a wireless device according to [2] 29.2.2.: In "North" orientation, the TMFS signal connector is directed to the north, with x and y axes of TMFS and Test arch coinciding (see fig. 1). The rotational symmetry axis of the TMFS is aligned to the center of the HAC test Arch. For East, South and West configuration, the TMFS has been rotated clockwise in steps of 90°, so the connector looks into the specified direction. The evaluation of the radial direction is referenced to the device orientation (x equivalent to South direction).

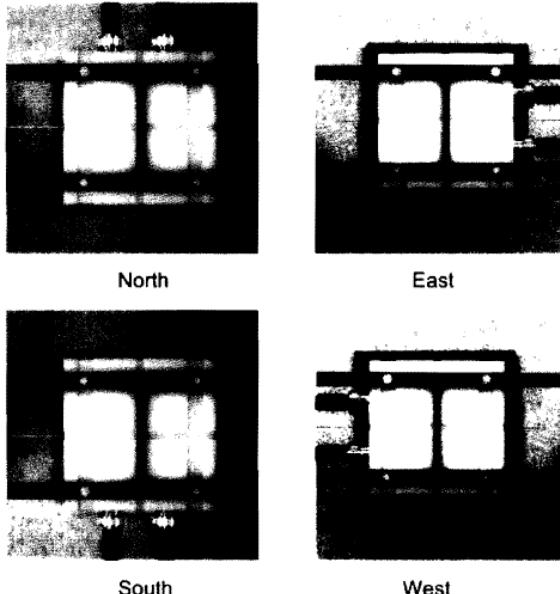


Fig. 1 TMFS scanning measurement configurations

- **Measurement Plane:** In coincidence with standard [1], the measurement plane (probe sensor center) is selected to be at a distance of 10 mm above the the surface of the TMFS touching the frame. The 50 x 50 mm scan area is aligned to the center of the unit. The scanning plane is verified to be parallel to the phantom frame before the measurements using the predefined "Geometry and signal check" procedure according to the predefined procedures described in [2].
- **Measurement Conditions:** Calibration of AM1D probe and AMMI are according to [2]. The 1 kHz sine signal for the level measurement is supplied from an external, independent generator via a BNC cable to TMFS IN and monitored at TMFS OUT with an independent RMS voltmeter or Audio Analyzer. The level is set to 0.5 Vrms and monitored during the scans.
- For the **frequency response**, a higher suppression of the background ambient magnetic field over the full frequency range was achieved by placing the TMFS in a magnetically shielded box. The AM1D probe was fixed without robot positioner near the axial maximum for this measurement. The background noise suppression was typ. 30 dB at 100 Hz (minimum) and 42 dB at 1 kHz. The predefined multisine signal (48k\_multisine\_50-10000\_10s.wav) was used and evaluated in the third-octave bands from 100 Hz to 10000 Hz.

	Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>169(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

### 1 Measurement Conditions

DASY system configuration, as far as not given on page 1.

<b>DASY Version</b>	<b>DASY5</b>	<b>V5.2 B162</b>
<b>DASY PP Version</b>	<b>SEMCAD</b>	<b>V14.0 B59</b>
<b>Phantom</b>	<b>HAC Test Arch</b>	<b>SD HAC P01 BA, #1002</b>
<b>Distance TMFS Top - Probe Centre</b>	<b>10 mm</b>	
<b>Scan resolution</b>	<b>dx, dy = 5 mm</b>	<b>area = 50 x 50 mm</b>
<b>Frequency</b>	<b>for field scans</b>	<b>1 kHz</b>
<b>Signal level to TMFS</b>	<b>for field scans</b>	<b>500 mV RMS</b>
<b>Signal</b>	<b>for frequency response</b>	<b>multisine signal 50-10000 Hz, each third-octave band</b>

Table 1: System configuration

### 2 Axial Maximum Field

Configuration	East	South	West	North	Subset Average	Average
<b>Axial Max</b>	<b>-20.17</b>	<b>-20.17</b>	<b>-20.16</b>	<b>-20.17</b>		<b>-20.17</b>
TMFS Y Axis 1st Max	-25.74	-25.74	-25.70	-25.70		
TMFS Y Axis 2nd Max	-25.92	-25.66	-26.02	-25.7		
<b>Longitudinal Max Avg</b>	<b>-25.83</b>	<b>-25.70</b>	<b>-25.86</b>	<b>-25.70</b>	<b>-25.77</b>	
TMFS X Axis 1st Max	-25.73	-25.71	-25.73	-25.67		
TMFS X Axis 2nd Max	-25.68	-25.91	-25.67	-25.96		
<b>Transversal Max Avg</b>	<b>-25.71</b>	<b>-25.81</b>	<b>-25.70</b>	<b>-25.82</b>	<b>-25.76</b>	
<b>Radial Max</b>						<b>-25.77</b>

Table 2: Axial and radial field maxima measured with probe center at 10mm distance in dB A/m

The maximum was calculated as the average from the values measured in the 4 orientations listed in table 2.

**Axial Maximum -20.17 dB A/m** (+/- 0.33dB, k=2)

### 3 Radial Maximum Field

In addition, the average from the 16 maxima of the radial field listed in table 2 (measured at 10mm) was calculated:

**Radial Maximum -25.77 dB A/m**

<b>RIM Testing Services™</b>	Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>170(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

#### 4 Appendix

##### 4.1 Frequency response

Max. deviation measured, relative to 1 kHz: min. -0.03, max. +0.02 dB

Frequency [Hz]	Response [dB]
100	0.02
125	0.00
160	-0.01
200	0.00
250	0.02
315	-0.01
400	0.00
500	0.00
630	0.00
800	0.00
<b>1000</b>	<b>0.00</b>
1250	-0.01
1600	-0.01
2000	-0.01
2500	-0.01
3150	-0.01
4000	-0.02
5000	-0.02
6300	-0.03
8000	-0.03
10000	-0.03

Table 3: Frequency response

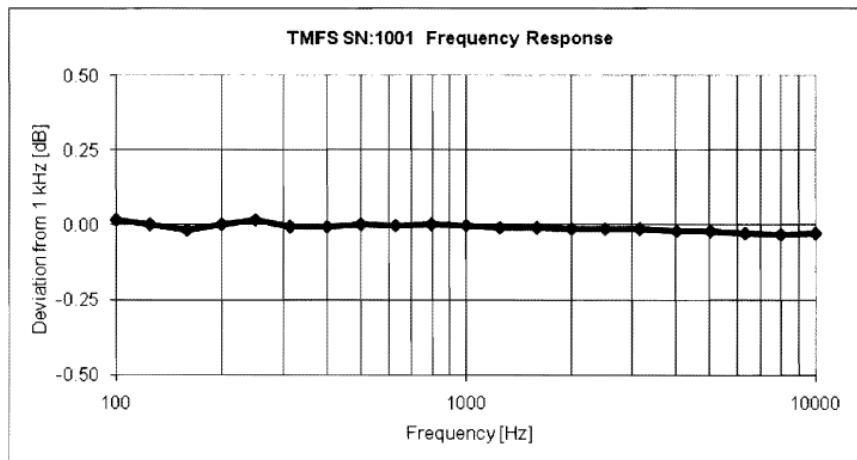


Fig. 2 Frequency response 100 to 10'000 Hz

	Document	Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW	Page
	Author Data	Report No	171(173)
Andrew Becker	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>	

#### 4.2 Field plots

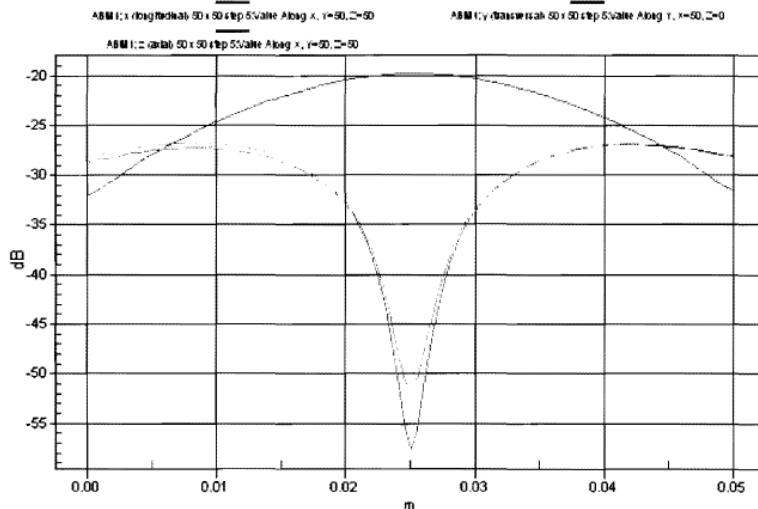


Fig. 3: Typical 2D field plots for x (red), y (green) and z (blue) components

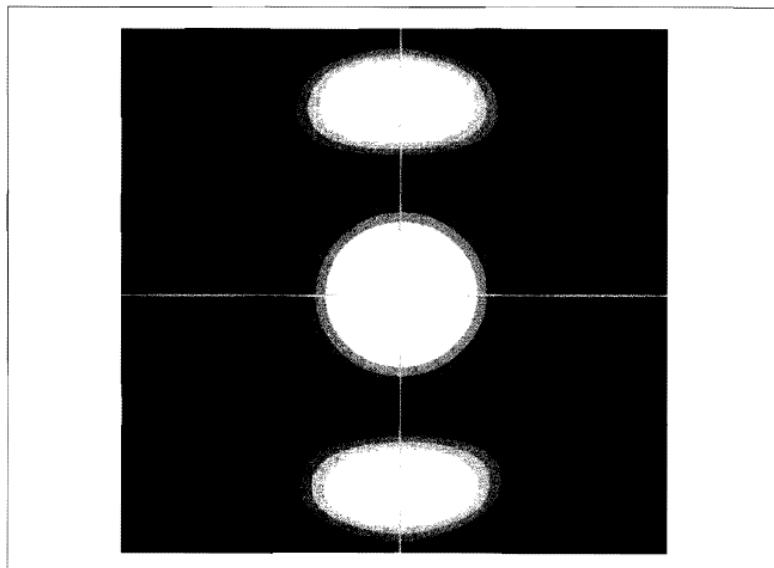


Fig. 4: Superponed field plots of z (axial), x and y radial magnetic field, 50 x 50 mm, individual scaling: white = max. field level, black = -4dB below max. The lines show the position of the 2D field plot of figure 3.



Document

**Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW**

Page  
172(173)

Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>	FCC ID <b>L6ARDM70UW</b> <b>L6AREN70UW</b>
-------------------------------------	---	---------------------------------------	--

**s p e a g**

Schmid & Partner Engineering AG  
Zeughausstrasse 43, 8004 Zurich, Switzerland  
Phone +41 1 245 9700, Fax +41 1 245 9779  
info@speag.com, http://www.speag.com

**Certificate of conformity**

Item	Audio Magnetic Calibration Coil AMCC
Type No	SD HAC P02 A
Series No	1001 ff.
Manufacturer / Origin	Schmid & Partner Engineering AG Zurich, Switzerland

**Description of the item**

The Audio Magnetic Calibration coil (AMCC) is a Helmholtz Coil designed according to standard [1], section D.9 for calibration of the AM1D probe. Two horizontal coils are positioned above a non-metallic base plate and generate a homogeneous magnetic field in the z direction (normal to it).

**Configuration**

The AMCC consists of two parallel coils of 20 turns with radius 143 mm connected in parallel in a distance of 143 mm. With this design, a current of 10 mA produces a field of 1 A/m. The DC input resistance at the input BNC socket is adjusted by a series resistor to a DC resistance of approximately 50 Ohm. The voltage required to produce a field of 1 A/m is consequently approx. 500 mV.

To current through the coil is monitored via a shunt resistor of 10 Ohm +/- 1%. The voltage is available on a BNO socket with 100 mV corresponding to 1 A/m.

**Handling of the item**

The coil shall be positioned in a non-metallic environment to avoid distortion of the magnetic field.

**Tests**

Test	Requirement	Details	Units tested
Number of turns	N = 20 per coil	Resistance measurement	all
Orientation of coils	parallel coils with same direction of windings	Magnetic field variation in the AMCC axis	all
Coil radius	r = 143 mm	mechanical dimension	First article
Coil distance	d = 143 mm distance between coil centers	mechanical dimension	First article
Input resistance	51.7 +/- 2 Ohm	DC resistance at BNC input connector	all
Shunt resistance	R = 10.0 Ohm +/- 1 %	DC resistance at BNO output connector	all
Shunt sensitivity	Hc = 1 A/m per 100 mV according to formula Hc = (U / R) * N / r / (1.25^1.5)	Field measurement compared with Narda ELT400 + BN2300/90.10	First article

**Standards**

[1] ANSI PC63.19-2006 Draft 3.12

**Conformity**

Based on the tests above, we certify that this item is in compliance with the requirements of [1].

Date 22.5.2006

**s p e a g****Stamp / Signature**

Schmid & Partner Engineering AG  
Zeughausstrasse 43, 8004 Zurich, Switzerland  
Phone +41 1 245 9700, Fax +41 1 245 9779  
info@speag.com, http://www.speag.com

	Document <b>Annex A-D to Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDM71UW/REN71UW</b>	Page <b>173(173)</b>
Author Data <b>Andrew Becker</b>	Dates of Test <b>Mar. 09-10, May 27, July 12, 2011</b>	Report No <b>RTS-3640-1103-10B</b>

## Specifications

### Audio Magnetic Field Probe AM1D

The AM1D probe is an active probe with a single sensor according to [1] section D.8. It is fully RF shielded and has a rounded tip of 6 mm diameter incorporating a pickup coil with its center offset 3mm from the tip and the sides.

SPEAG, the manufacturer of the T-Coil system tested the probe frequency response and its dynamic range. The compliance is stated in the Certificate of conformity document 880-SPAM1001A-A. Also the probe frequency has been verified and the response deviation from the ideal differentiator was within +0.05 and - 0.46 dB in the range 100 Hz to 10 kHz on the center frequencies of the third-octave bands. Note that it includes the probe preamplifier and also with the AMMI internal preamplifiers, filters and processing.

#### Dynamic range:

maximum + 21 dB A/m @ 1 kHz

Noise level typically -70 dB A/m @ 1 kHz

ABM2 typically -60 dB A/m

#### Linearity

Within < 0.1 dB from 5 dB  
below limitation to 16 dB above noise level

#### Sensitivity

Typically -24 dBV / A/m @ 1 kHz probe output

### Audio Magnetic Measurement Instrument (AMMI)

sampling rate 48 kHz / 24 bit

dynamic range 85 dB

test signal generation user selectable and predefined (via PC)

calibration auto-calibration / full system calibration using AMCC

with monitor output

dimensions 482 x 65 x 270 mm

### Helmholtz Calibration Coil (AMCC)

dimensions 370 x 370 x 196 mm, according to ANSI-PC63.19

The Audio Magnetic Calibration coil is a Helmholtz Coil designed according to [1], section D.9 for calibration of the AM1D probe. The two horizontal coils generate a homogeneous magnetic field in the z direction.

Shunt sensitivity  $H_c = 1 \text{ A/m per } 100\text{mV}$  according to formula:

$$H_c = (U / R) * N / r / (1.25 ^ 1.5)$$

Number of turns  $N = 20$  per coil

Coil radius  $r = 143 \text{ mm}$

Shunt resistance  $R = 10.00 \text{ Ohm}$