



Intertek Testing Services

ETL SEMKO

Report No.: 9909986

Mode: Charging

Tested By: Hong, Report No.: 9909986


Scan Settings (1 Range)

Frequencies			Receiver Settings					
Start	Stop	Step	IF BW	Detector	M-Time	Atten	Preamp	OpRge
450k	30M	5k	10k	PK	20ms	AUTO	LN OFF	60dB

Final Measurement: x QP

Meas Time: 1 s
Subranges: 16
Acc Margin: 20dB

Transducer No.	Start	Stop	Name
21	9k	30M	EW0698

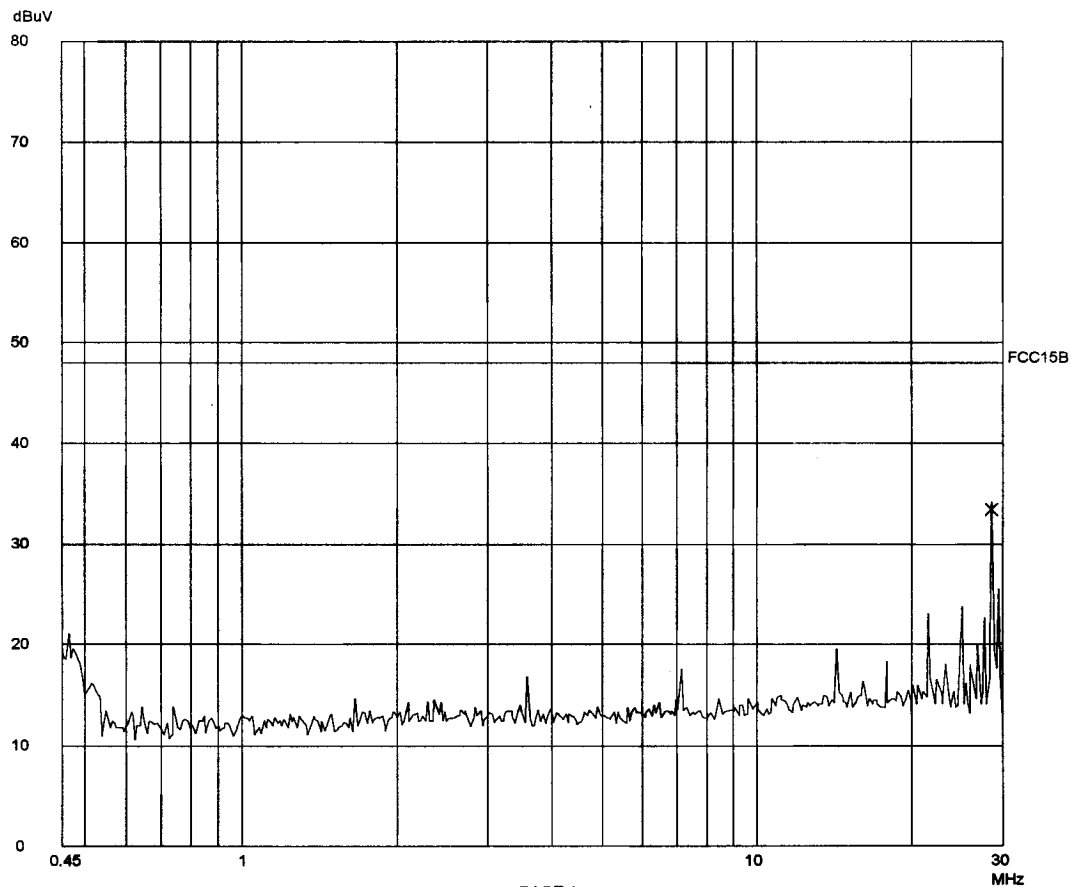



Intertek Testing Services

ETL SEMKO

Report No.: 9909986

Mode: *Charging*

Tested By: Hong, Report No.: 9909986

Scan Settings (1 Range)

|----- Frequencies -----||----- Receiver Settings -----|

Start	Stop	Step	IF BW	Detector	M-Time	Atten	Preamp	OpRge
450k	30M	5k	10k	PK	20ms	AUTO	LN	OFF 60dB

Final Measurement Results:

Frequency QP Level QP Limit

MHz dBuV dBuV

28.63500 33.3 48.0

* limit exceeded



Intertek Testing Services

ETL SEMKO

Report No.: 9909986

Made ! Standby

Tested By: Hong, Report No.: 9909986


Scan Settings (1 Range)

Frequencies			Receiver Settings					
Start	Stop	Step	IF BW	Detector	M-Time	Atten	Preamp	OpRge
450k	30M	5k	10k	PK	20ms	AUTO	LN OFF	60dB

Final Measurement: x QP

Meas Time: 1 s
Subranges: 16
Acc Margin: 20dB

Transducer No.	Start	Stop	Name
21	9k	30M	EW0698

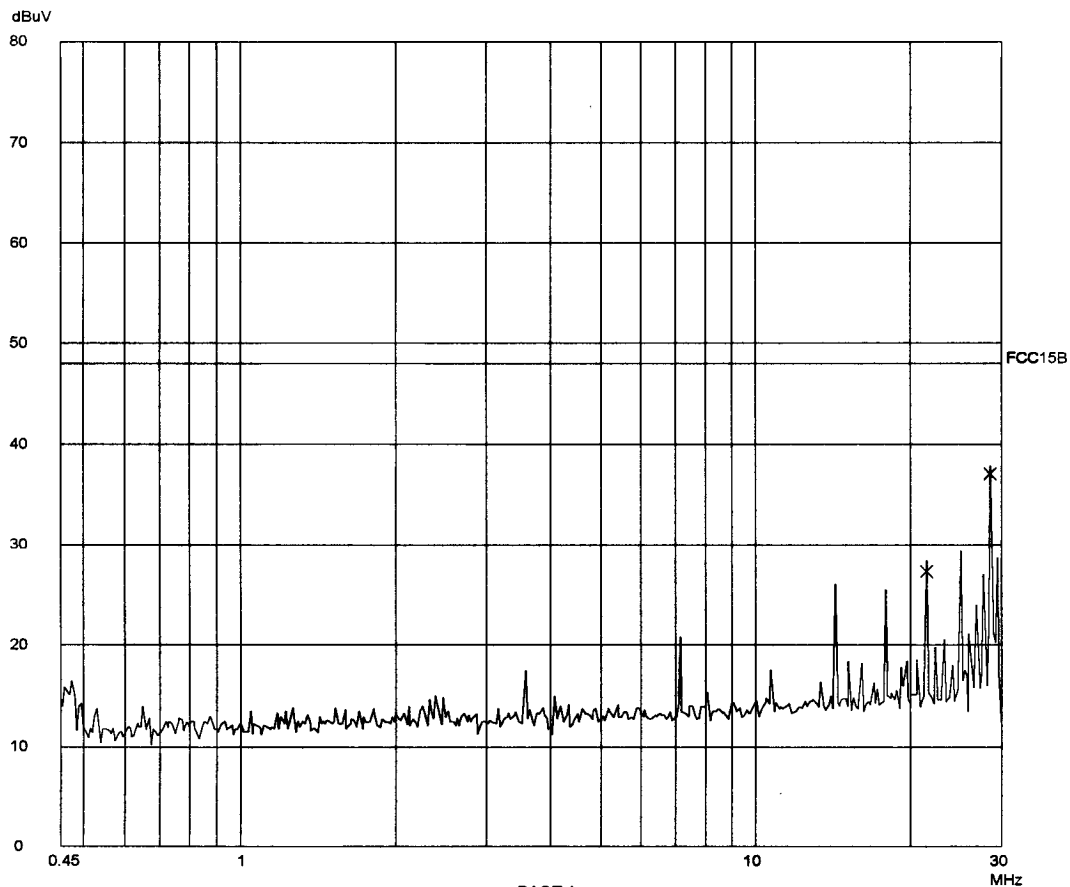



Intertek Testing Services

ETL SEMKO

Report No.: 9909986

Mode: Standby

Tested By: Hong, Report No.: 9909986

Scan Settings (1 Range)

|----- Frequencies -----||----- Receiver Settings -----|

Start	Stop	Step	IF BW	Detector	M-Time	Atten	Preamp	OpRge
450k	30M	5k	10k	PK	20ms	AUTO	LN OFF	60dB

Final Measurement Results:

Frequency QP Level QP Limit

MHz dBuV dBuV

21.47500 27.3 48.0

28.63500 37.0 48.0

* limit exceeded



Intertek Testing Services

ETL SEMKO

Report No.: 9909986

Mode: Transmission

Tested By: Hong, Report No.: 9909986

Scan Settings (1 Range)

Frequencies			Receiver Settings					
Start	Stop	Step	IF BW	Detector	M-Time	Atten	Preamp	OpRge
450k	30M	5k	10k	PK	20ms	AUTO	LN OFF	60dB


Final Measurement: x QP

Meas Time: 1 s

Subranges: 16

Acc Margin: 20dB

Transducer No.	Start	Stop	Name
21	9k	30M	EW0698

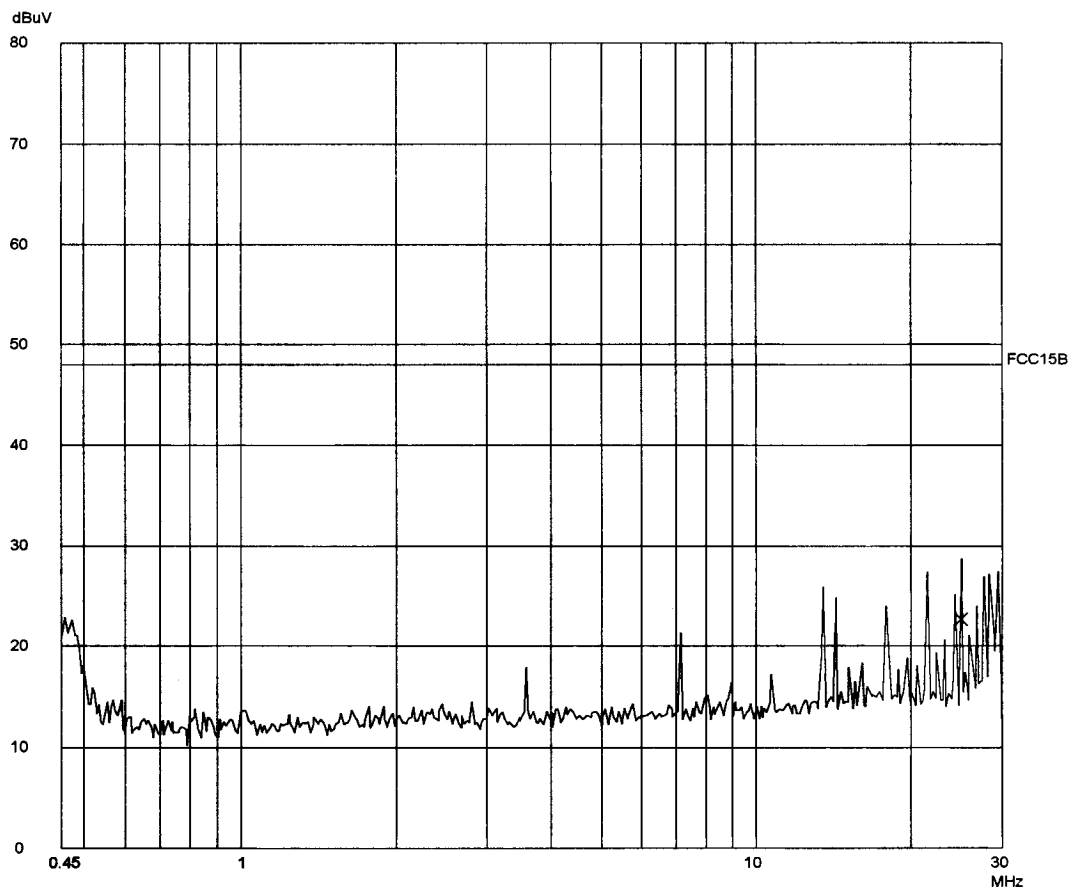



Intertek Testing Services

ETL SEMKO

Report No.: 9909986

Mode: Transmission

Tested By: Hong, Report No.: 9909986

Scan Settings (1 Range)

----- Frequencies -----||----- Receiver Settings -----|

Start	Stop	Step	IF BW	Detector	M-Time	Atten	Preamp	OpRge
-------	------	------	-------	----------	--------	-------	--------	-------

450k	30M	5k	10k	PK	20ms	AUTO	LN	OFF 60dB
------	-----	----	-----	----	------	------	----	----------

Final Measurement Results:

Frequency	QP Level	QP Limit
-----------	----------	----------

MHz	dBuV	dBuV
-----	------	------

25.05500	22.7	48.0
----------	------	------

* limit exceeded