

Report No.: FA220201

Appendix D. Product Photos






TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: Q78-UV857 Page Number : D1 of D1
Report Issued Date : Feb. 03, 2012
Report Version : Rev. 01



Report No.: FA220201


Appendix E. Test Setup Photos

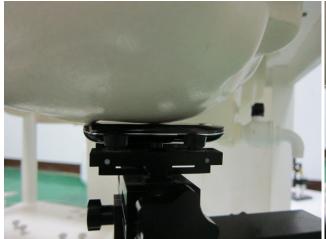



Right Cheek


Right Tilted

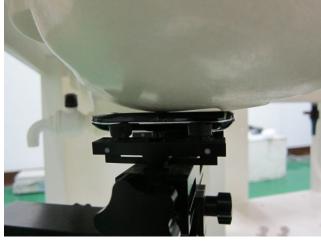



Left Cheek

Left Tilted

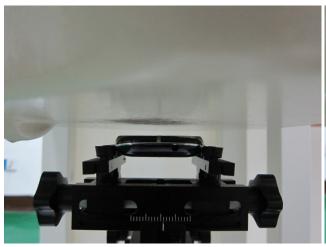






Front of DUT with Earphone to Phantom 1 cm Gap

SPORTON INTERNATIONAL (KUNSHAN) INC

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: Q78-UV857 Page Number : E1 of E2
Report Issued Date : Jan. 31, 2012
Report Version : Rev. 01

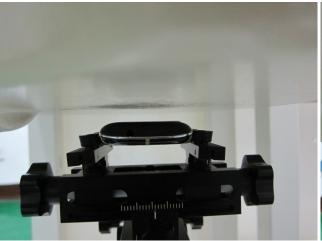

Back of DUT with Phantom 1 cm Gap



Report No.: FA192004


Back of DUT with Earphone to Phantom 1 cm Gap



Left Side of DUT with Phantom 1 cm Gap



Right Side of DUT with Phantom 1 cm Gap

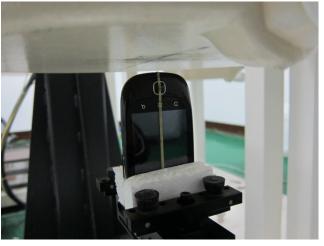

Bottom Side of DUT with Phantom 1 cm Gap

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Q78-UV857 Page Number : E2 of E2
Report Issued Date : Feb. 03, 2012
Report Version : Rev. 01



Appendix F. FCC 3G SAR Measurement Procedures

Conducted Output Power:

The EUT was tested according to the requirements of the FCC 3G procedures and the TS 34.121. The EUT's WCDMA function is Release 6 version supporting HSDPA Category 12. A detailed analysis of the output power for all WCDMA and HSDPA modes is provided in the tables below. According to the FCC 3G procedures, handsets with HSDPA should be tested according to Release 6 HSPA test procedures, and the EUT does not support VOIP function over the HSPA function. Device was tested according to procedure KDB941225 - section Release 6 HSPA Data Devices as documented/evaluated in the following table. Power values for HSPA are less than ½ dB higher than the basic 12.2 kbps RMC configurations in WCDMA or maximum SAR value (1.1 W/kg) in WCDMA mode is less than 75% of SAR limit.

WCDMA SAR Test mode - Conducted Power											
Mode	Setup	Cell band (850)			PCS band (1900)						
		CH4132	CH4182	CH4233	CH9262	CH9400	CH9538				
		826.4	836.4	846.6	1852.4	1880.0	1907.6				
		(MHz)	(MHz)	(MHz)	(MHz)	(MHz)	(MHz)				
WCDMA	AMR	22.73	22.70	22.60	22.39	22.32	22.34				
	RMC 12.2Kbps	22.75	22.68	22.63	22.41	22.36	22.33				
HSDPA	Subtest 1	22.75	22.62	22.58	22.24	22.26	22.06				
	Subtest 2	21.73	21.71	21.59	21.22	21.14	21.00				
	Subtest 3	21.24	21.30	21.08	20.71	20.70	20.55				
	Subtest 4	21.26	21.30	21.10	20.70	20.68	20.53				


 ${\bf SPORTON\ INTERNATIONAL\ (KUNSHAN)\ INC.}$

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: Q78-UV857 Page Number : F1 of F4
Report Issued Date : Feb. 03, 2012
Report Version : Rev. 01

Report No.: FA220201

WCDMA Setup Configuration:

- a. The EUT was connected to Base Station referred to the drawing of Setup Configuration.
- b. The RF path losses were compensated into the measurements.
- c. A call was established between EUT and Base Station with following setting
 - i. Data rates: Varied from RMC 12.2Kbps
 - ii. RMC Test Loop = Loop Mode 1
 - iii. Power Ctrl Mode = All Up bits
- d. The transmitted maximum output power was recorded.

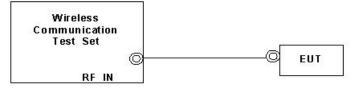

Setup Configuration

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: Q78-UV857 Page Number : F2 of F4
Report Issued Date : Feb. 03, 2012
Report Version : Rev. 01

Report No.: FA220201

HSDPA Setup Configuration:

a. The EUT was connected to Base Station referred to the drawing of Setup Configuration.

Report No.: FA220201

- b. The RF path losses were compensated into the measurements.
- c. A call was established between EUT and Base Station with following setting:
 - i. Set Gain Factors (β_c and β_d) and parameters were set according to each
 - ii. Specific sub-test in the following table, C10.1.4, quoted from the TS 34.121
 - iii. Set RMC12.2Kbps + HSDPA mode.
 - iv. Set Cell Power = -86 dBm
 - v. Set HS-DSCH Configuration Type to FRC (H-set 1, QPSK)
 - vi. Select HSDPA Uplink Parameters
 - vii. Set DeltaACK, DeltaNACK and DeltaCQI = 8
 - viii. Set Ack-Nack Repetition Factor to 3
 - ix. Set CQI Feedback Cycle (k) to 4 ms
 - x. Set CQI Repetition Factor to 2
 - xi. Power Ctrl Mode = All Up bits
- d. The transmitted maximum output power was recorded.

Table C.10.1.4: β values for transmitter characteristics tests with HS-DPCCH

Sub-test	βς	β _d	β _d (SF)	βc/βd	βнs (Note1, Note 2)	CM (dB) (Note 3)	MPR (dB) (Note 3)
1	2/15	15/15	64	2/15	4/15	0.0	0.0
2	12/15 (Note 4)	15/15 (Note 4)	64	12/15 (Note 4)	24/15	1.0	0.0
3	15/15	8/15	64	15/8	30/15	1.5	0.5
4	15/15	4/15	64	15/4	30/15	1.5	0.5

Note 1: Δ_{ACK} , Δ_{NACK} and Δ_{CQI} = 30/15 with β_{hs} = 30/15 * β_c .

Note 2: For the HS-DPCCH power mask requirement test in clause 5.2C, 5.7A, and the Error Vector Magnitude (EVM) with HS-DPCCH test in clause 5.13.1A, and HSDPA EVM with phase discontinuity in clause 5.13.1AA, Δ_{ACK} and Δ_{NACK} = 30/15 with β_{hs} = 30/15 * β_c , and Δ_{CQI} = 24/15 with β_{hs} = 24/15 * β_c .

Note 3: CM = 1 for β_0/β_d =12/15, $\beta_h s/\beta_c$ =24/15. For all other combinations of DPDCH, DPCCH and HSDPCCH the MPR is based on the relative CM difference. This is applicable for only UEs that support HSDPA in release 6 and later releases.

Note 4: For subtest 2 the β_c/β_d ratio of 12/15 for the TFC during the measurement period (TF1, TF0) is achieved by setting the signalled gain factors for the reference TFC (TF1, TF1) to β_c = 11/15 and β_d = 15/15

Setup Configuration

 SPORTON INTERNATIONAL (KUNSHAN) INC.
 Page Number
 : F3 of F4

 TEL: 86-0512-5790-0158
 Report Issued Date
 : Feb. 03, 2012

 FAX: 86-0512-5790-0958
 Report Version
 : Rev. 01

FCC ID: Q78-UV857



FCC SAR Test Report

Reference:

- [1] 941225 D01 SAR test for 3G devices v02, SAR Measurement Procedures for 3G Devices CDMA 2000/Ev-Do/WCDMA/HSDPA/HSPA Oct. 2007 Laboratory Division Office of Engineering and **Technology Federal Communications Commission**
- [2.] TS 34.121 Universal Mobile Telecommunications System (UMTS); Terminal Conformance Specification, Radio Transmission and Reception (FDD)
- [3.] HSUPA Measurement Guide with 8960 V7.5.0 Release 7 (2007-06) Ver.: v.02.18

SPORTON INTERNATIONAL (KUNSHAN) INC.

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: Q78-UV857

Page Number : F4 of F4 Report Issued Date: Feb. 03, 2012

Report No.: FA220201

Report Version : Rev. 01