



849 NW State Road 45
Newberry, FL 32669 USA
Ph: 888.472.2424 or 352.472.5500
Fax: 352.472.2030
Email: info@timcoengr.com
Website: www.timcoengr.com

FCC PART 15.249 TEST REPORT

UNLICENSED INTENTIONAL RADIATOR

Applicant	SAAB TRAINING, LLC	
Address	2602 CHALLENGER TECH PARK SUITE 130	
	ORLANDO FL 32826 USA	
FCC ID	R4APDD915A	
Model Number	PDD	
Product Description	VEST TRANSMITTER	
Date Sample Received	12/7/2010	
Date Tested	12/7/2010	
Tested By	Nam Nguyen	
Approved By	Richard Block	
Report Number	2754UT10TestReport.doc	
Test Results	<input checked="" type="checkbox"/> PASS	<input type="checkbox"/> FAIL

THE ATTACHED REPORT SHALL NOT BE REPRODUCED EXCEPT IN FULL
WITHOUT THE WRITTEN APPROVAL OF TIMCO ENGINEERING, INC.



Certificate # 0955-01



TABLE OF CONTENT

GENERAL REMARKS.....	3
GENERAL INFORMATION.....	4
EMC EQUIPMENT LIST	5
TEST PROCEDURES	6
RADIATION INTERFERENCE.....	7
OCCUPIED BANDWIDTH.....	8
BAND EDGE COMPLIANCE.....	10
Horizontal	12
Vertical.....	13
POWER LINE CONDUCTED INTERFERENCE	14

APPLICANT: SAAB TRAINING, LLC
FCC ID: R4APDD915A
REPORT #: S\SAAB\2754UT10\2754UT10TestReport.doc



GENERAL REMARKS

The attached report shall not be reproduced except in full without the written permission of Timco Engineering Inc.

Summary

The device under test does:

- fulfill the general approval requirements as identified in this test report
- not fulfill the general approval requirements as identified in this test report

Attestations

This equipment has been tested in accordance with the standards identified in this test report. To the best of my knowledge and belief, these tests were performed using the measurement procedures described in this report.

All instrumentation and accessories used to test products for compliance to the indicated standards are calibrated regularly in accordance with ISO 17025 requirements.



Certificate # 0955-01

I attest that the necessary measurements were made, under my supervision, at:

Timco Engineering Inc.
849 NW State Road 45
Newberry, FL 32669



Authorized Signatory Name:

Richard Block
Compliance Engineer

Date: 1/14/2011

APPLICANT: SAAB TRAINING, LLC
FCC ID: R4APDD915A
REPORT #: S\SAAB\2754UT10\2754UT10TestReport.doc



GENERAL INFORMATION

DUT Specification

The test results relate only to the items tested.					
Applicable Standard	Part 15.249				
DUT Description	VEST TRANSMITTER				
FCC ID	R4APDD915A				
Model Number	PDD				
Operating Frequency	TX: 915.00 MHz	RX: Same			
DUT Power Source	<input type="checkbox"/> 110–120Vac/50– 60Hz				
	<input type="checkbox"/> DC Power				
	<input checked="" type="checkbox"/> Battery Operated Exclusively				
Test Item	<input type="checkbox"/> Prototype	<input checked="" type="checkbox"/> Pre-Production	<input type="checkbox"/> Production		
Type of Equipment	<input type="checkbox"/> Fixed	<input type="checkbox"/> Mobile	<input checked="" type="checkbox"/> Portable		
Antenna Connector	FCC Rules require that the antenna connector be unique.				
Test Facility	Timco Engineering Inc. located at 849 NW State Road 45 Newberry, FL 32669 USA.				
Test Conditions	Temperature: 26°C Relative humidity: 50%				
Test Exercise	The DUT was placed in continuous transmit mode of operation.				
Modifications					

Test Supporting Equipment

Supporting Device	Manufacturer	Model / FCC ID	Serial Number
N/A			

APPLICANT: SAAB TRAINING, LLC

FCC ID: R4APDD915A

REPORT #: S\SAAB\2754UT10\2754UT10TestReport.doc



EMC EQUIPMENT LIST

Device	Manufacturer	Model	Serial Number	Cal/Char Date	Due Date
3-Meter Semi-Anechoic Chamber	Panashield	N/A	N/A	Listed 3/10/10	3/10/12
AC Voltmeter	HP	400FL	2213A14499	CAL 3/23/09	3/23/11
Antenna: Dipole Kit	Electro-Metrics	TDA-30/1-4	153	CHAR 6/10/09	6/10/11
Frequency Counter	HP	5385A	3242A07460	CAL 5/26/09	5/26/11
Hygro-Thermometer	Extech	445703	0602	CAL 1/30/09	1/30/11
Modulation Analyzer	HP	8901A	3435A06868	CAL 5/26/09	5/26/11
Digital Multimeter	Fluke	FLUKE-77-3	79510405	CAL 5/18/09	5/18/11
Analyzer Tan Tower Preamplifier	HP	8449B-H02	3008A00372	CAL 11/21/09	11/21/11
Analyzer Tan Tower Quasi-Peak Adapter	HP	85650A	3303A01690	CAL 11/22/09	11/22/11
Analyzer Tan Tower RF Preselector	HP	85685A	3221A01400	CAL 11/21/09	11/21/11
Analyzer Tan Tower Spectrum Analyzer	HP	8566B Opt 462	3138A07786 3144A20661	CAL 11/24/09	11/24/11
Temperature Chamber	Tenney Engineering	TTRC	11717-7	CHAR 4/25/10	4/25/12

APPLICANT: SAAB TRAINING, LLC

FCC ID: R4APDD915A

REPORT #: S\SAAB\2754UT10\2754UT10TestReport.doc



TEST PROCEDURES

Radiation Interference: ANSI C63.4-2003 using a spectrum analyzer, a preselector, a quasi-peak adapter, and an appropriate antenna. The analyzer was calibrated in dB above a microvolt at the output of the antenna. The resolution bandwidth was 100 kHz with an appropriate sweep speed and the video bandwidth was 300 kHz up to 1 GHz and 1 MHz with a video BW of 3 MHz above 1 GHz. When an emission was found, the table was rotated to produce the maximum signal strength. The antenna was placed in both the horizontal and vertical planes and the worse case emissions were reported. The spectrum was searched to at least the tenth (10) harmonic of the fundamental.

Formula Of Conversion Factors: The field strength at 3m was established by adding the meter reading of the spectrum analyzer (which is set to read in units of dBuV) to the antenna correction factor supplied by the antenna manufacturer. The antenna correction factors are stated in terms of dB. The gain of the preselector was accounted for in the spectrum analyzer meter reading.

Example:

Freq (MHz)	Meter Reading	+ ACF	+ CL	= FS
33	20 dBuV	+ 10.36 dB	+ 0.5	= 30.86 dBuV/m @ 3m

Power Line Conducted Interference: The procedure used was ANSI C63.4-2003 using a 50uH LISN. Both lines were observed. The bandwidth of the spectrum analyzer was 10kHz with an appropriate sweep speed. The spectrum was scanned from 0.15 to 30 MHz.

Occupied Bandwidth: A small sample of the transmitter output was fed into the spectrum analyzer and the attached plot was printed. The vertical scale is set to -10 dBm per division.

ANSI C63.4-2003 10.1 Measurement Procedures: The DUT was placed on a table 80 cm high and with dimensions of 1m by 1.5m. The DUT was placed in the center of the table (1.5m side). The table used for radiated measurements is capable of continuous rotation.

When an emission was found, the table was rotated to produce the maximum signal strength. At this point, the antenna was raised and lowered from 1m to 4m. The antenna was placed in both the horizontal and vertical planes. Emissions attenuated more than 20 dB below the permissible value are not reported.



RADIATION INTERFERENCE

Rules Part No.: 15.249, 15.209

Requirements:

Frequency	Limits
Part 15.209	
9 to 490 kHz	2400/F (kHz) μ V/m @ 300 meters
490 to 1705 kHz	24000/F (kHz) μ V/m @ 30 meters
1705 kHz to 30 MHz	29.54 dB μ V/m @ 30 meters
30 – 88	40.0 dB μ V/m @ 3 meters
80 – 216	43.5 dB μ V/m @ 3 meters
216 – 960	46.0 dB μ V/m @ 3 meters
Above 960	54.0 dB μ V/m @ 3 meters
Part 15.249	
Fundamental 902 – 928 MHz	94.0 dB μ V/m @ 3 meters
Fundamental 2.4 – 2.4835 MHz	94.0 dB μ V/m @ 3 meters
Harmonics	54.0 dB μ V/m @ 3 meters

Test Data:

Tuned Frequency MHz	Emission Frequency MHz	Meter Reading dBuV	Ant. Polarity	Coax Loss dB	Correction Factor dB/m	Field Strength dBuV/m	Margin dB
915.0	915.00	53.7	V	1.97	22.60	78.27	15.73
915.0	915.00	62.4	H	1.97	23.35	87.72	6.28
915.0	1,830.00	16.2	V	2.76	30.11	49.07	4.93
915.0	1,830.00	16.3	H	2.76	30.11	49.17	4.83
915.0	2,745.00	8.4	V	3.42	32.55	44.37	9.63
915.0	2,745.00	8.7	H	3.42	32.55	44.67	9.33
915.0	3,660.00	8.0	V	4.19	33.06	45.25	8.75
915.0	3,660.00	8.2	H	4.19	33.06	45.45	8.55
915.0	4,575.00	7.4	V	4.79	34.10	46.29	7.71
915.0	4,575.00	8.0	H	4.79	34.10	46.89	7.11
915.0	5,490.00	5.4	H	5.15	34.69	45.24	8.76
915.0	5,490.00	6.9	V	5.15	34.69	46.74	7.26
915.0	6,405.00	7.0	H	5.42	35.72	48.14	5.86
915.0	6,405.00	9.0	V	5.42	35.72	50.14	3.86
915.0	8,235.00	7.5	H	6.29	36.00	49.79	4.21
915.0	8,235.00	9.1	V	6.29	36.00	51.39	2.61
915.0	9,150.00	8.6	V	6.65	36.39	51.64	2.36

APPLICANT: SAAB TRAINING, LLC

FCC ID: R4APDD915A


REPORT: S\SAAB\2754UT10\2754UT10TestReport.doc

OCCUPIED BANDWIDTH



Rules Part No.: 15.249 (d)

Requirements: The field strength of any emissions appearing outside the bandedges and up to 10 kHz above and below the band edges shall be attenuated at least 50 dB below the level of the carrier or to the general limits of 15.249.

Test Data:

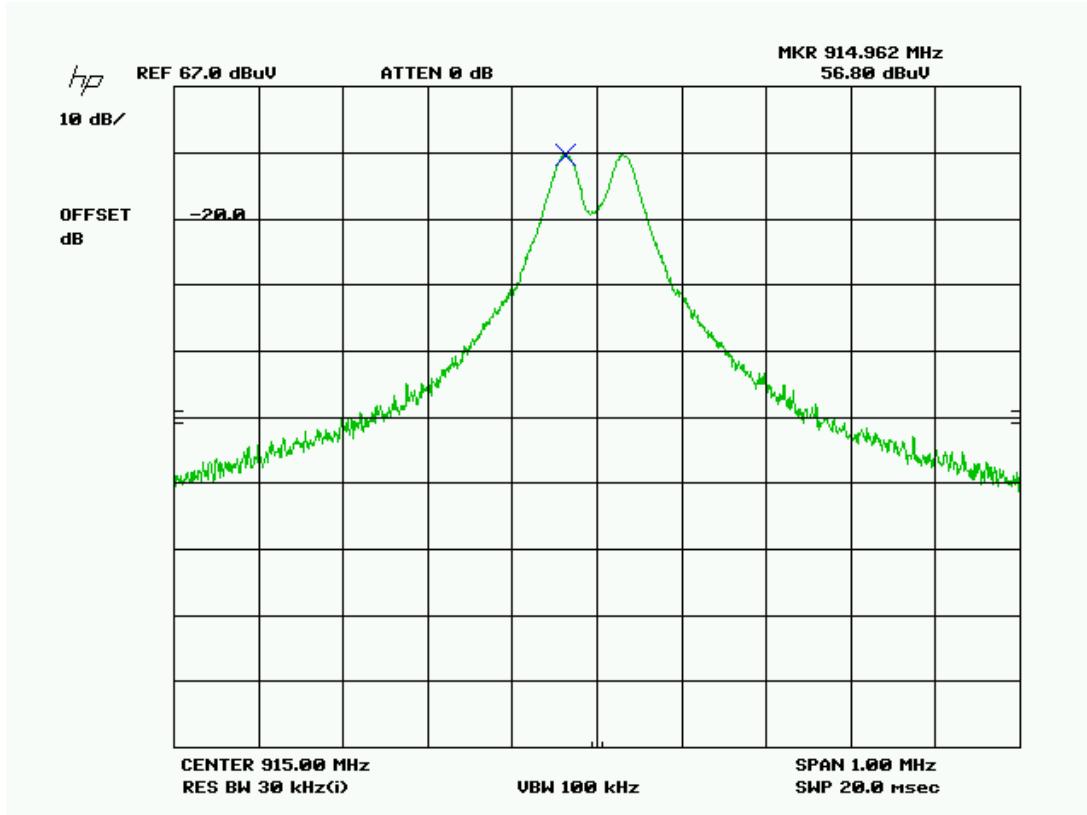

APPLICANT: SAAB TRAINING, LLC
 FCC ID: R4APDD915A
 REPORT: S\SAAB\2754UT10\2754UT10TestReport.doc

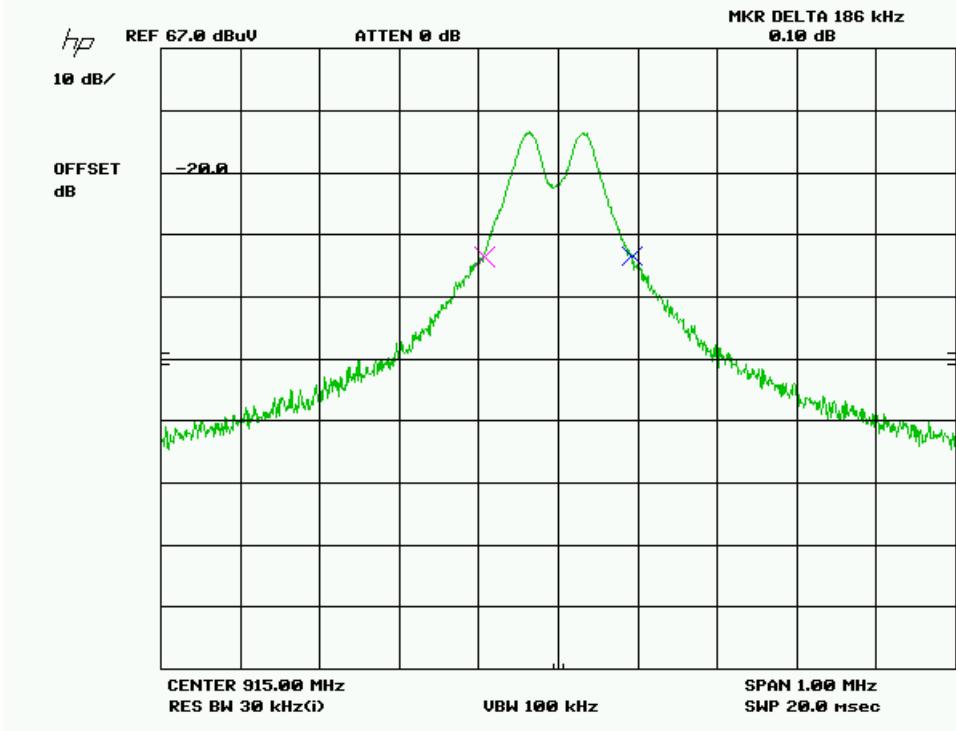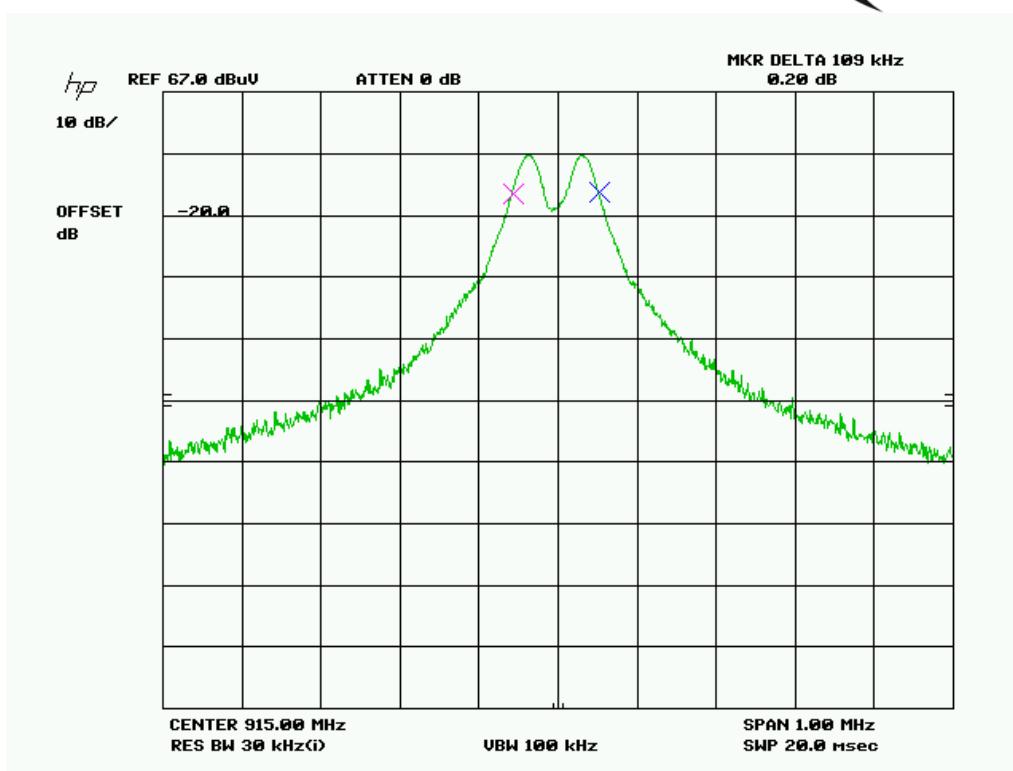

APPLICANT: SAAB TRAINING, LLC

FCC ID: R4APDD915A

REPORT: S\SAAB\2754UT10\2754UT10TestReport.doc

BAND EDGE COMPLIANCE

Rules Part No.: 15.249 (d)


Requirements: 40 dBc or in the case of restricted bands 54 dBuV/m.

Test Data:

Lower bandedge


Peak Plot

Tuned Frequency MHz	Emission Frequency MHz	Meter Reading dBuV	Ant. Polarity V/H	Coax Loss dB	Correction Factor dB/m	Field Strength dBuV/m	dBc
915.0	901.01	4.1	V	1.95	22.69	28.74	49.53
915.0	901.93	4.5	H	1.95	23.32	29.77	57.95

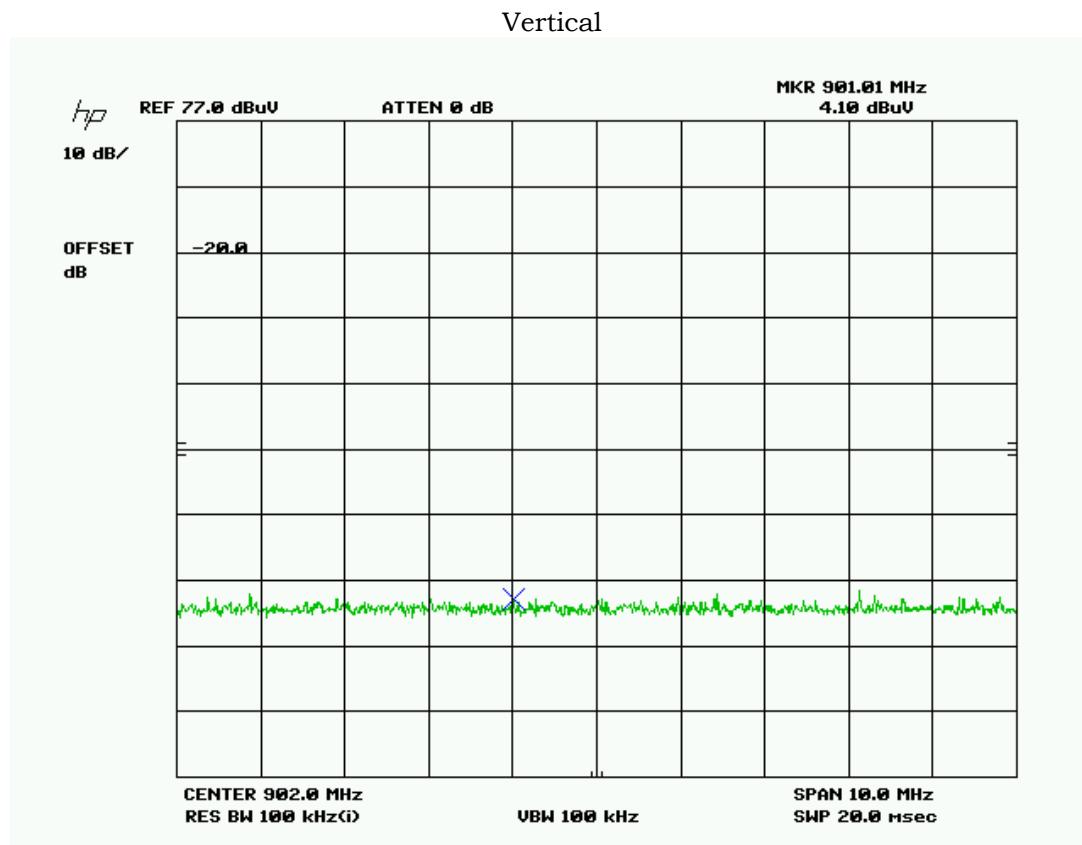

APPLICANT: SAAB TRAINING, LLC
 FCC ID: R4APDD915A
 REPORT: S\SAAB\2754UT10\2754UT10TestReport.doc

Horizontal

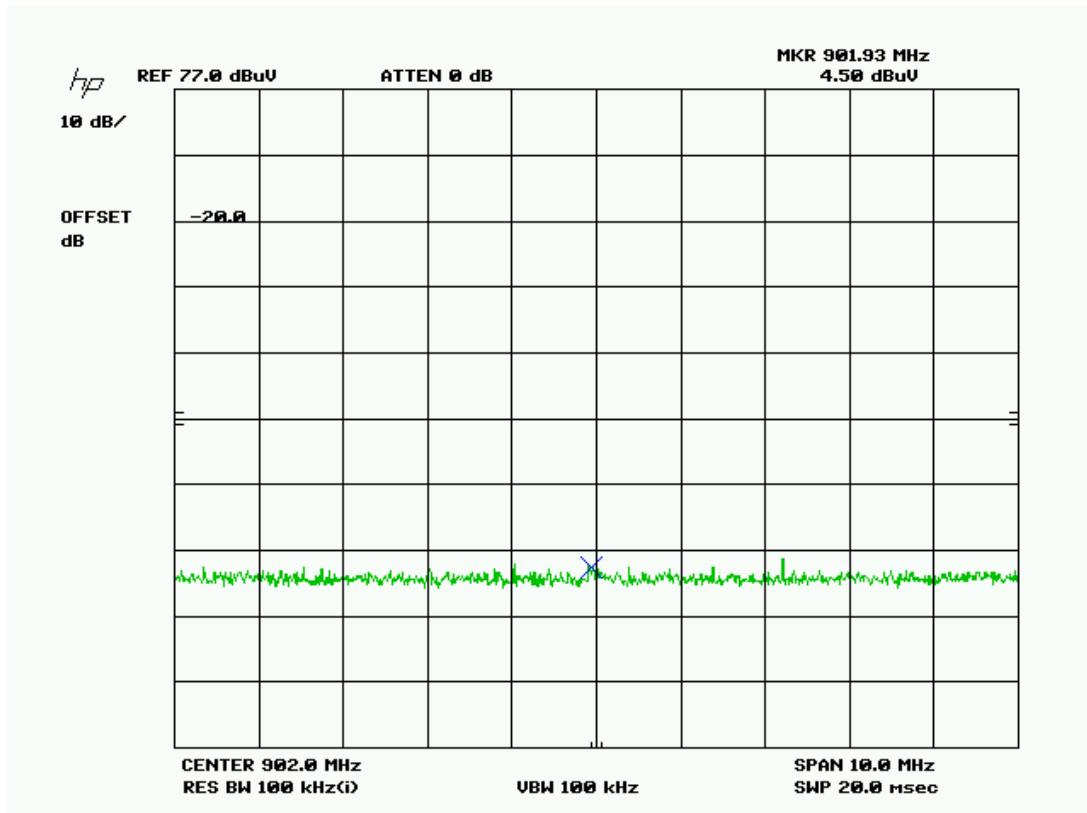


APPLICANT: SAAB TRAINING, LLC
 FCC ID: R4APDD915A
 REPORT: S\SAAB\2754UT10\2754UT10TestReport.doc

Upper bandedge

Peak Plot


Tuned Frequency MHz	Emission Frequency MHz	Meter Reading dBuV	Ant. Polarity V/H	Coax Loss dB	Correction Factor dB/m	Field Strength dBuV/m	dBc
915.0	928.03	4.3	H	1.99	23.46	29.75	57.97
915.0	928.79	4.0	V	1.99	22.69	28.68	49.59

Horizontal

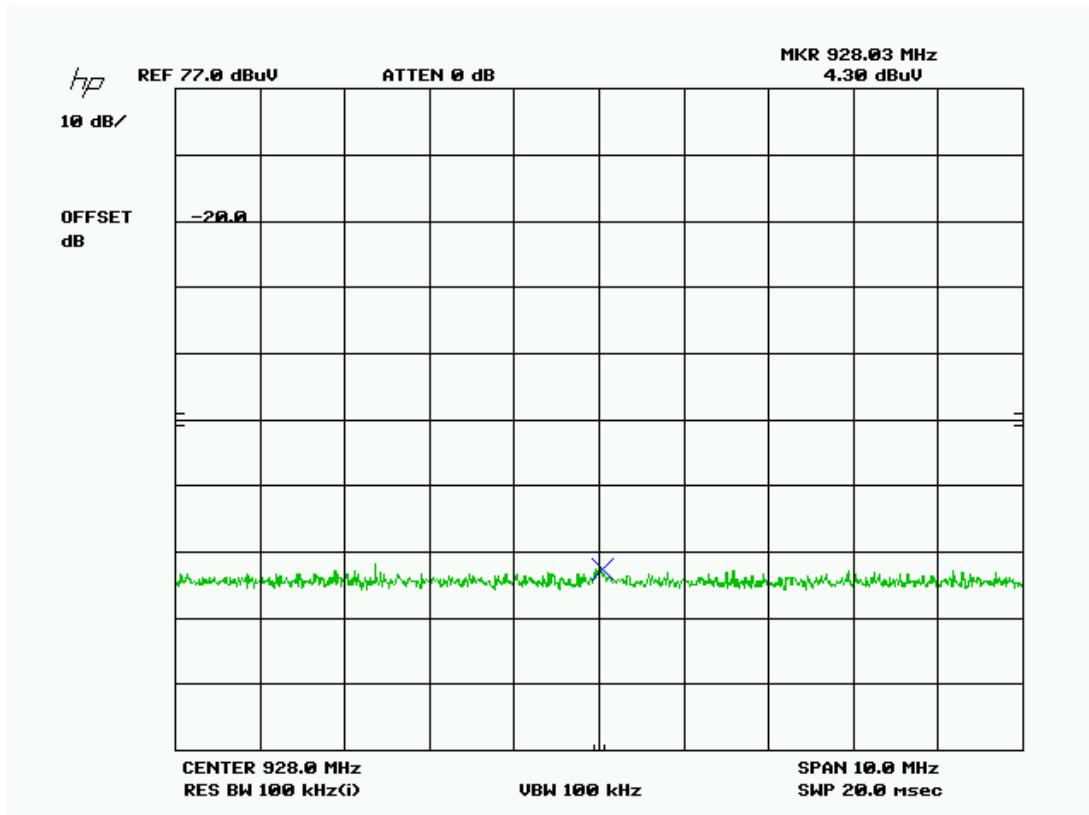

APPLICANT: SAAB TRAINING, LLC
 FCC ID: R4APDD915A
 REPORT: S\SAAB\2754UT10\2754UT10TestReport.doc

Vertical

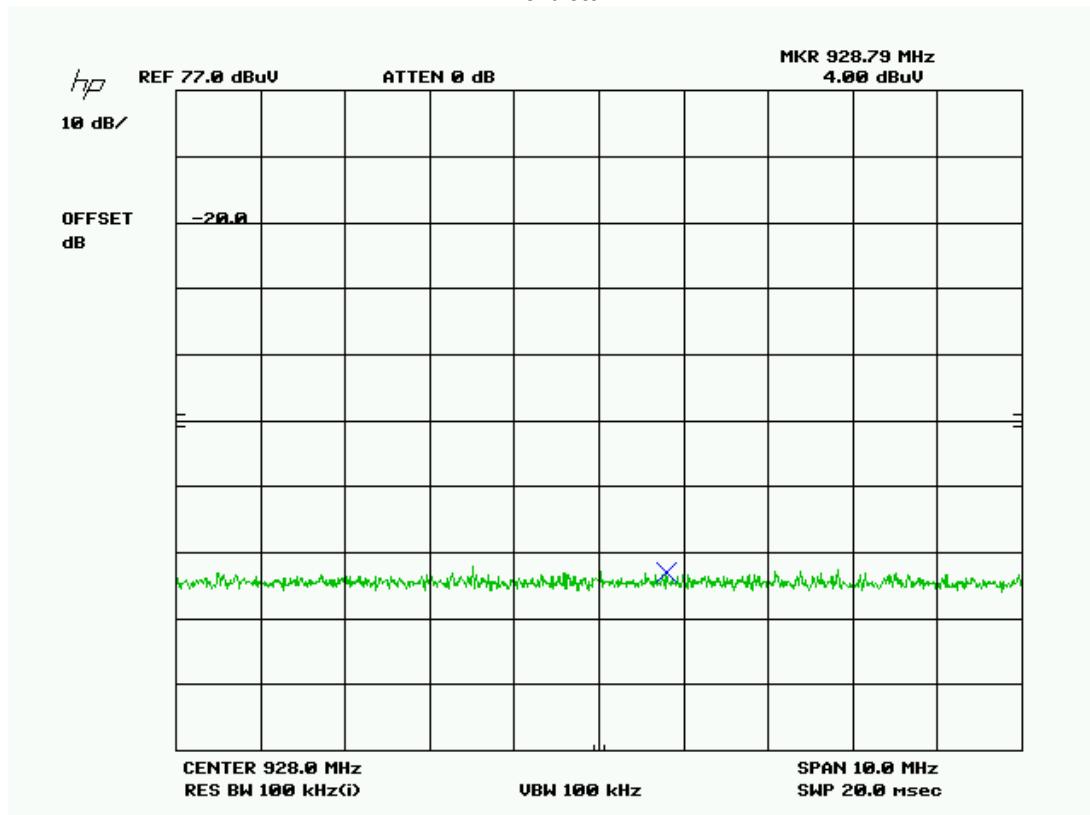

APPLICANT: SAAB TRAINING, LLC
 FCC ID: R4APDD915A
 REPORT: S\SAAB\2754UT10\2754UT10TestReport.doc



POWER LINE CONDUCTED INTERFERENCE

Rules Part No.: 15.207

Requirements:

Frequency (MHz)	Quasi Peak Limits (dBuv)	Average Limits (dBuV)
0.15 – 0.5	66 – 56	56 – 46
0.5 – 5.0	56	46
5.0 – 30	60	50

Test Data: The attached graphs represent the emissions read for power line conducted for this device. Both lines were observed.

N/A
Battery or vehicle powered DUT.

APPLICANT: SAAB TRAINING, LLC
FCC ID: R4APDD915A
REPORT: S\SAAB\2754UT10\2754UT10TestReport.doc

Page 14 of 14
Mdea 9.20.2007