



11AC20SISO-Ant1-5320



11AC20SISO-Ant1-5500



11AC20SISO-Ant1-5580




11AC20SISO-Ant1-5700



11AC20SISO-Ant1-5745



11AC20SISO-Ant1-5785

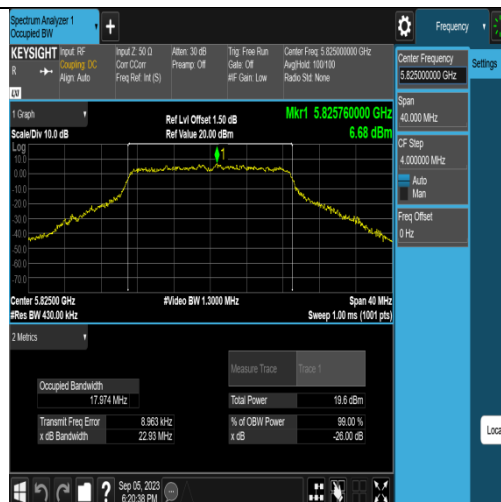

11AC20SISO-Ant1-5825



11AC40SISO-Ant1-5190



11AC40SISO-Ant1-5230



11AC40SISO-Ant1-5270



11AC40SISO-Ant1-5310



11AC40SISO-Ant1-5510



11AC40SISO-Ant1-5550



11AC40SISO-Ant1-5670



11AC40SISO-Ant1-5755




11AC40SISO-Ant1-5795




11AC80SISO-Ant1-5210



11AC80SISO-Ant1-5290

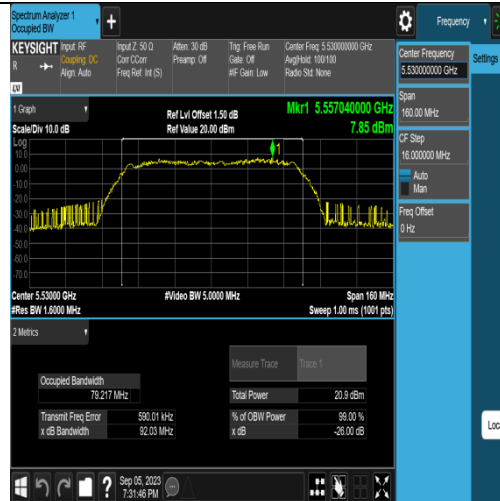

11AC80SISO-Ant1-5530

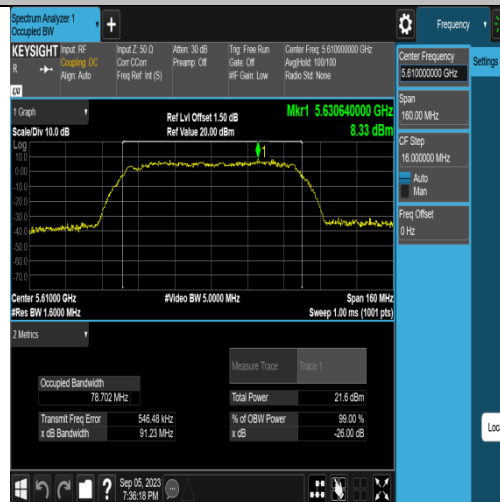

11AC80SISO-Ant1-5610




11AC80SISO-Ant1-5775

Appendix D: 6dB Emission Bandwidth

TestMode	Antenna	Frequency[MHz]	6db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5745	16.320	5736.800	5753.120	0.5	PASS
11A	Ant1	5785	15.600	5777.240	5792.840	0.5	PASS
11A	Ant1	5825	15.080	5817.400	5832.480	0.5	PASS
11N20SISO	Ant1	5745	15.680	5737.400	5753.080	0.5	PASS
11N20SISO	Ant1	5785	17.520	5776.200	5793.720	0.5	PASS
11N20SISO	Ant1	5825	15.120	5817.400	5832.520	0.5	PASS
11N40SISO	Ant1	5755	35.600	5737.480	5773.080	0.5	PASS
11N40SISO	Ant1	5795	35.680	5777.400	5813.080	0.5	PASS
11AC20SISO	Ant1	5745	17.520	5736.200	5753.720	0.5	PASS
11AC20SISO	Ant1	5785	16.800	5776.560	5793.360	0.5	PASS
11AC20SISO	Ant1	5825	12.960	5819.600	5832.560	0.5	PASS
11AC40SISO	Ant1	5755	34.480	5738.600	5773.080	0.5	PASS
11AC40SISO	Ant1	5795	35.440	5777.400	5812.840	0.5	PASS
11AC80SISO	Ant1	5775	75.200	5737.400	5812.600	0.5	PASS

Note: We have evaluated SISO, MIMO mode, shown in the report is the worst data.

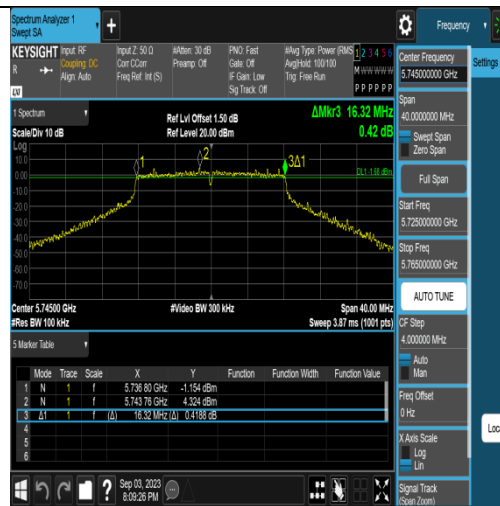

11A-Ant1-5745



11A-Ant1-5785



11A-Ant1-5825



11N20SISO-Ant1-5745



11N20SISO-Ant1-5785



11N20SISO-Ant1-5825



11N40SISO-Ant1-5755



11N40SISO-Ant1-5795



11AC20SISO-Ant1-5745



11AC20SISO-Ant1-5785



11AC20SISO-Ant1-5825



11AC40SISO-Ant1-5755



11AC40SISO-Ant1-5795




11AC80SISO-Ant1-5775

Appendix E: Duty cycle


TestMode	Antenna	Frequency[MHz]	Transmission Duration [ms]	Transmission Period [ms]	Duty Cycle [%]
11A	Ant1	5180	2.06	2.10	98.10
11A	Ant1	5200	2.07	2.11	98.10
11A	Ant1	5240	2.07	2.11	98.10
11A	Ant1	5260	2.07	2.11	98.10
11A	Ant1	5280	2.07	2.11	98.10
11A	Ant1	5320	2.06	2.10	98.10
11A	Ant1	5500	2.07	2.11	98.10
11A	Ant1	5580	2.07	2.10	98.57
11A	Ant1	5700	2.06	2.10	98.10
11A	Ant1	5745	2.06	2.10	98.10
11A	Ant1	5785	2.07	2.10	98.57
11A	Ant1	5825	2.06	2.10	98.10
11N20SISO	Ant1	5180	1.92	1.96	97.96
11N20SISO	Ant1	5200	1.92	1.96	97.96
11N20SISO	Ant1	5240	1.92	1.96	97.96
11N20SISO	Ant1	5260	1.92	1.96	97.96
11N20SISO	Ant1	5280	1.92	1.96	97.96
11N20SISO	Ant1	5320	1.93	1.96	98.47
11N20SISO	Ant1	5500	1.93	1.96	98.47
11N20SISO	Ant1	5580	1.92	1.96	97.96
11N20SISO	Ant1	5700	1.93	1.96	98.47
11N20SISO	Ant1	5745	1.92	1.96	97.96
11N20SISO	Ant1	5785	1.92	1.96	97.96
11N20SISO	Ant1	5825	1.92	1.96	97.96
11N40SISO	Ant1	5190	0.95	0.98	96.94
11N40SISO	Ant1	5230	0.95	0.99	95.96
11N40SISO	Ant1	5270	0.95	0.98	96.94
11N40SISO	Ant1	5310	0.95	0.98	96.94
11N40SISO	Ant1	5510	0.94	0.98	95.92
11N40SISO	Ant1	5550	0.95	0.98	96.94
11N40SISO	Ant1	5670	0.95	0.98	96.94
11N40SISO	Ant1	5755	0.95	0.99	95.96
11N40SISO	Ant1	5795	0.95	0.99	95.96
11AC20SISO	Ant1	5180	1.93	1.96	98.47
11AC20SISO	Ant1	5200	1.92	1.96	97.96
11AC20SISO	Ant1	5240	1.92	1.96	97.96
11AC20SISO	Ant1	5260	1.93	1.96	98.47
11AC20SISO	Ant1	5280	1.93	1.96	98.47
11AC20SISO	Ant1	5320	1.93	1.96	98.47
11AC20SISO	Ant1	5500	1.93	1.96	98.47
11AC20SISO	Ant1	5580	1.92	1.96	97.96
11AC20SISO	Ant1	5700	1.92	1.96	97.96
11AC20SISO	Ant1	5745	1.93	1.96	98.47
11AC20SISO	Ant1	5785	1.93	1.96	98.47
11AC20SISO	Ant1	5825	1.93	1.96	98.47
11AC40SISO	Ant1	5190	0.95	0.99	95.96
11AC40SISO	Ant1	5230	0.94	0.98	95.92

11AC40SISO	Ant1	5270	0.95	0.98	96.94
11AC40SISO	Ant1	5310	0.95	0.99	95.96
11AC40SISO	Ant1	5510	0.94	0.98	95.92
11AC40SISO	Ant1	5550	0.95	0.99	95.96
11AC40SISO	Ant1	5670	0.95	0.98	96.94
11AC40SISO	Ant1	5755	0.95	0.98	96.94
11AC40SISO	Ant1	5795	0.95	0.98	96.94
11AC80SISO	Ant1	5210	0.47	0.50	94.00
11AC80SISO	Ant1	5290	0.46	0.50	92.00
11AC80SISO	Ant1	5530	0.46	0.50	92.00
11AC80SISO	Ant1	5610	0.47	0.50	94.00
11AC80SISO	Ant1	5775	0.47	0.50	94.00


Note: We have evaluated SISO, MIMO mode, shown in the report is the worst data.

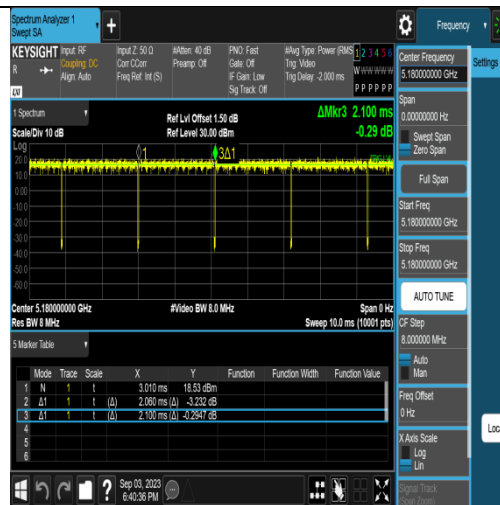


NTNV-11A-Ant1-5180

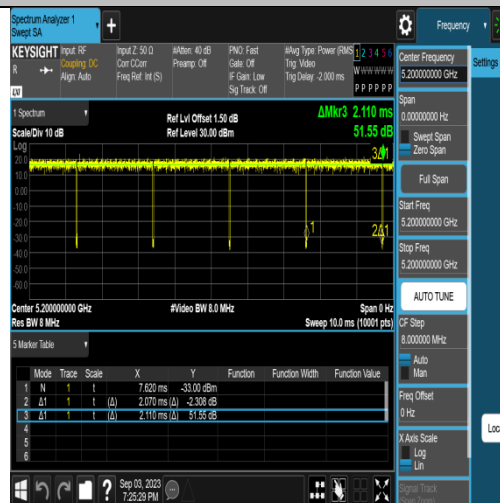


NTNV-11A-Ant1-5200

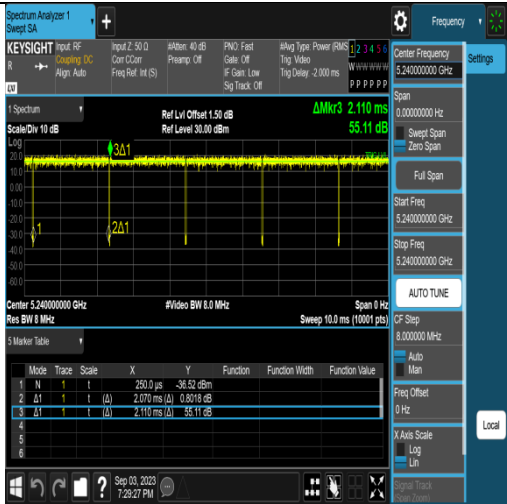


NTNV-11A-Ant1-5240

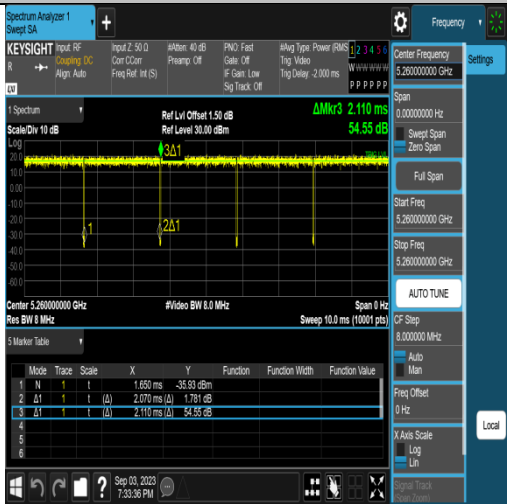


NTNV-11A-Ant1-5260

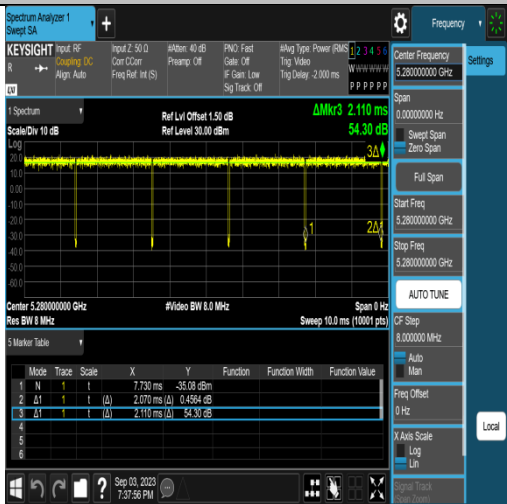


NTNV-11A-Ant1-5280

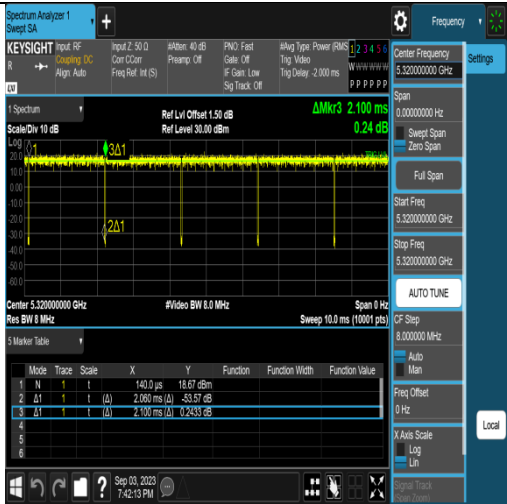


NTNV-11A-Ant1-5320

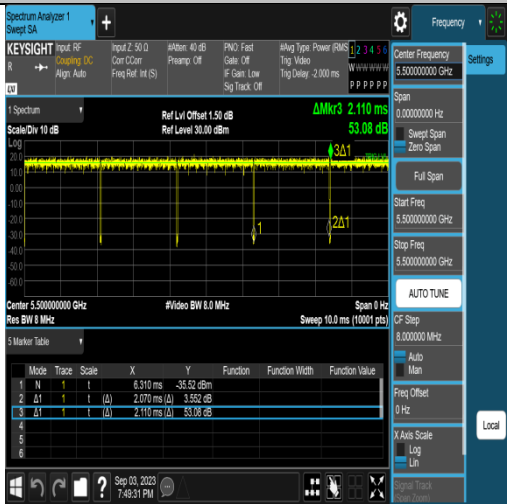


NTNV-11A-Ant1-5500

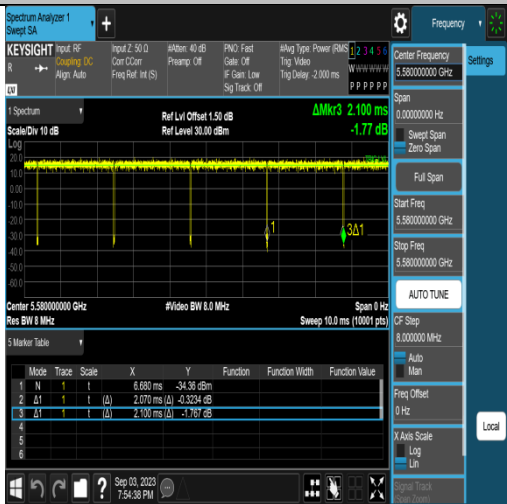


NTNV-11A-Ant1-5580

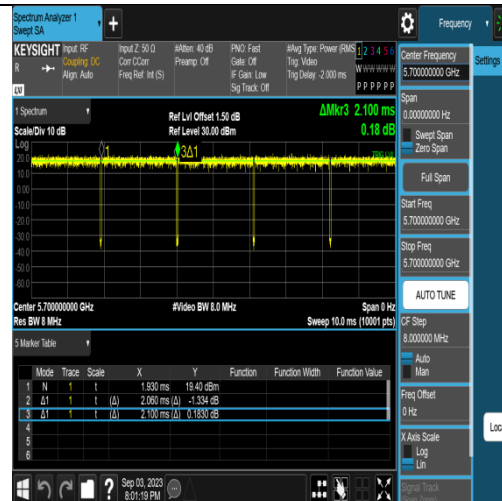


NTNV-11A-Ant1-5700

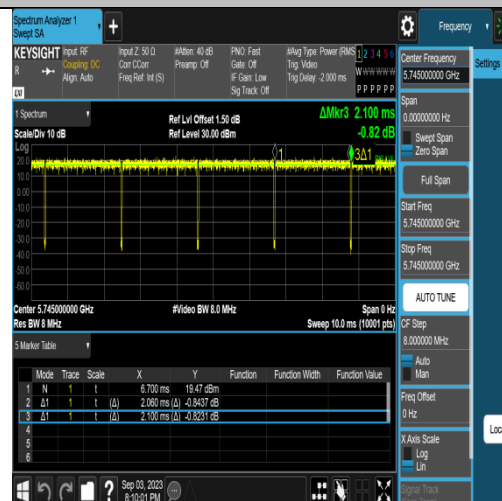

NTNV-11A-Ant1-5745

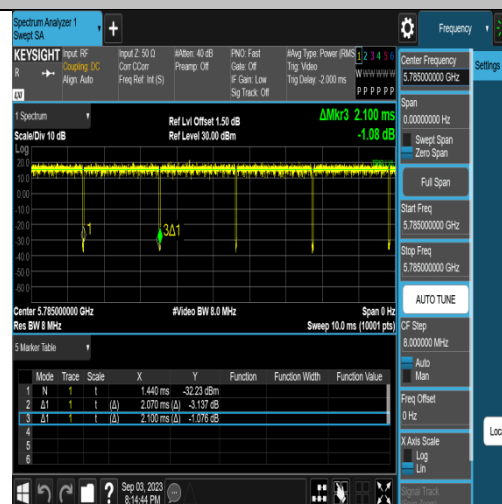

NTNV-11A-Ant1-5785

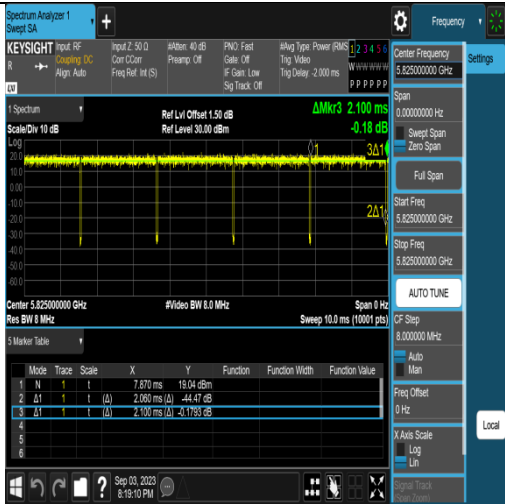

NTNV-11A-Ant1-5825



NTNV-11N20SISO-Ant1-5180




NTNV-11N20SISO-Ant1-5200



NTVN-11N20SISO-Ant1-5240




NTVN-11N20SISO-Ant1-5260

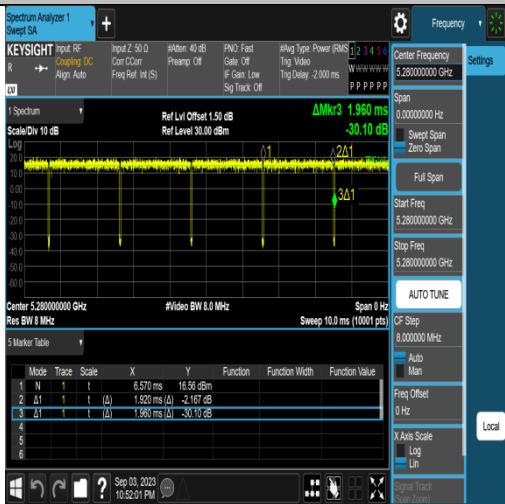

NTVN-11N20SISO-Ant1-5280



NTVN-11N20SISO-Ant1-5320

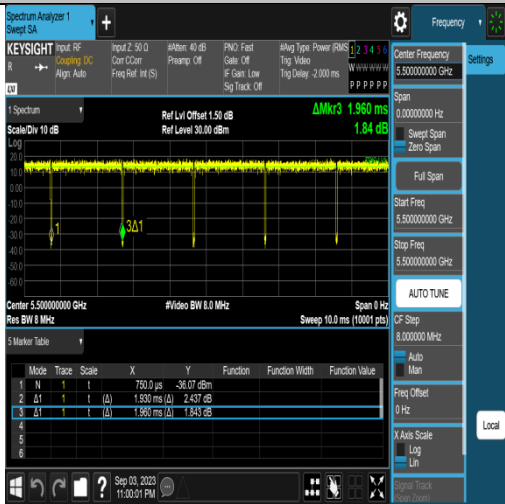


NTVN-11N20SISO-Ant1-5500



NTVN-11N20SISO-Ant1-5580




NTVN-11N20SISO-Ant1-5700

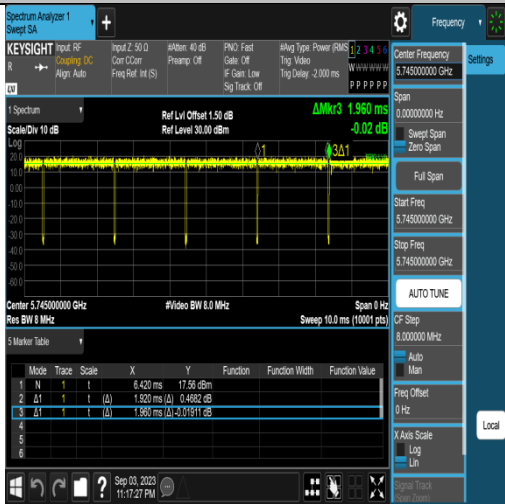


NTVN-11N20SISO-Ant1-5745




NTVN-11N20SISO-Ant1-5785

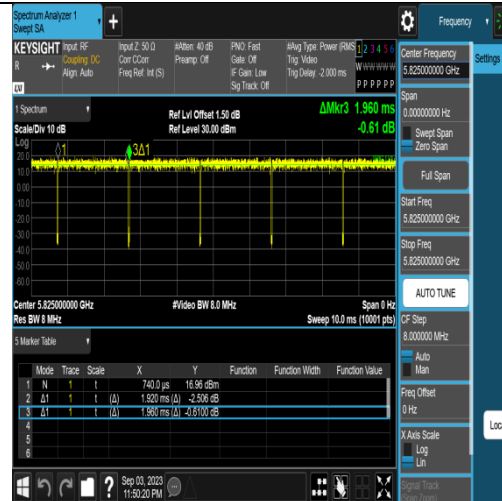


NTVN-11N20SISO-Ant1-5825

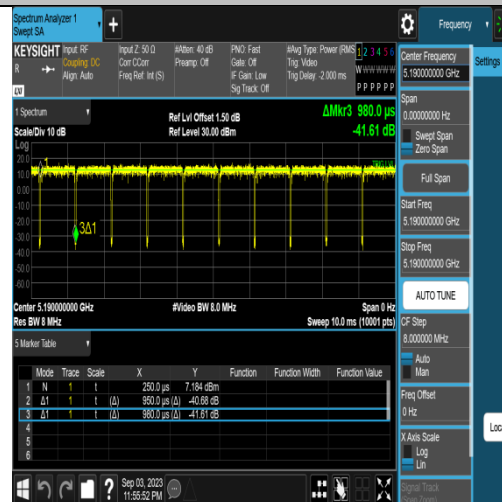


NTVN-11N40SISO-Ant1-5190

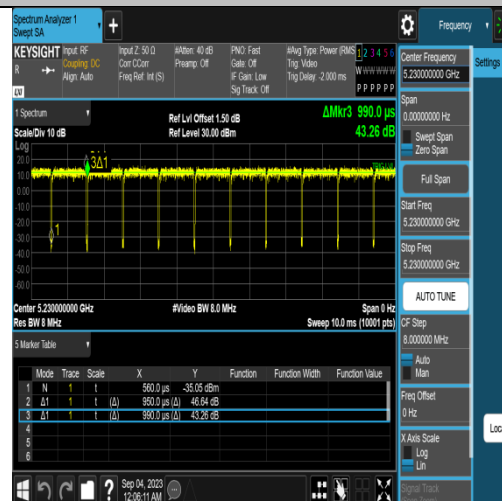


NTVN-11N40SISO-Ant1-5230

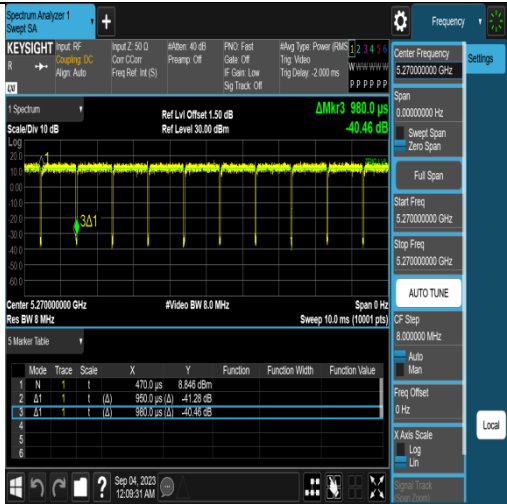

NTVN-11N40SISO-Ant1-5270

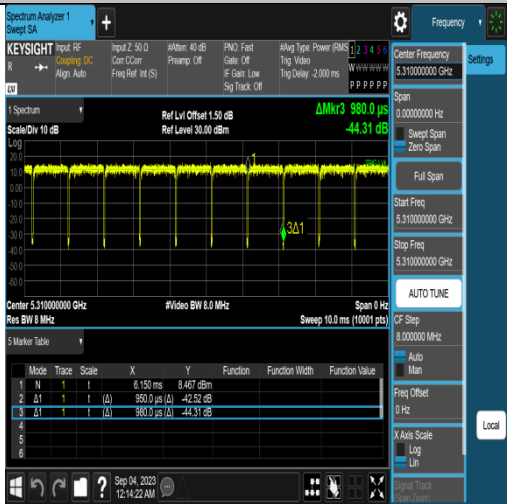

NTVN-11N40SISO-Ant1-5310

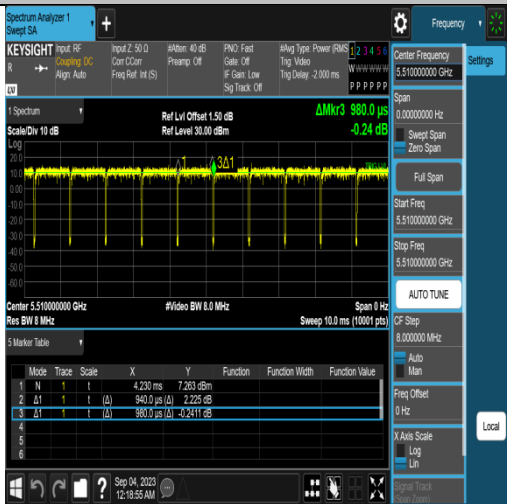

NTVN-11N40SISO-Ant1-5510