






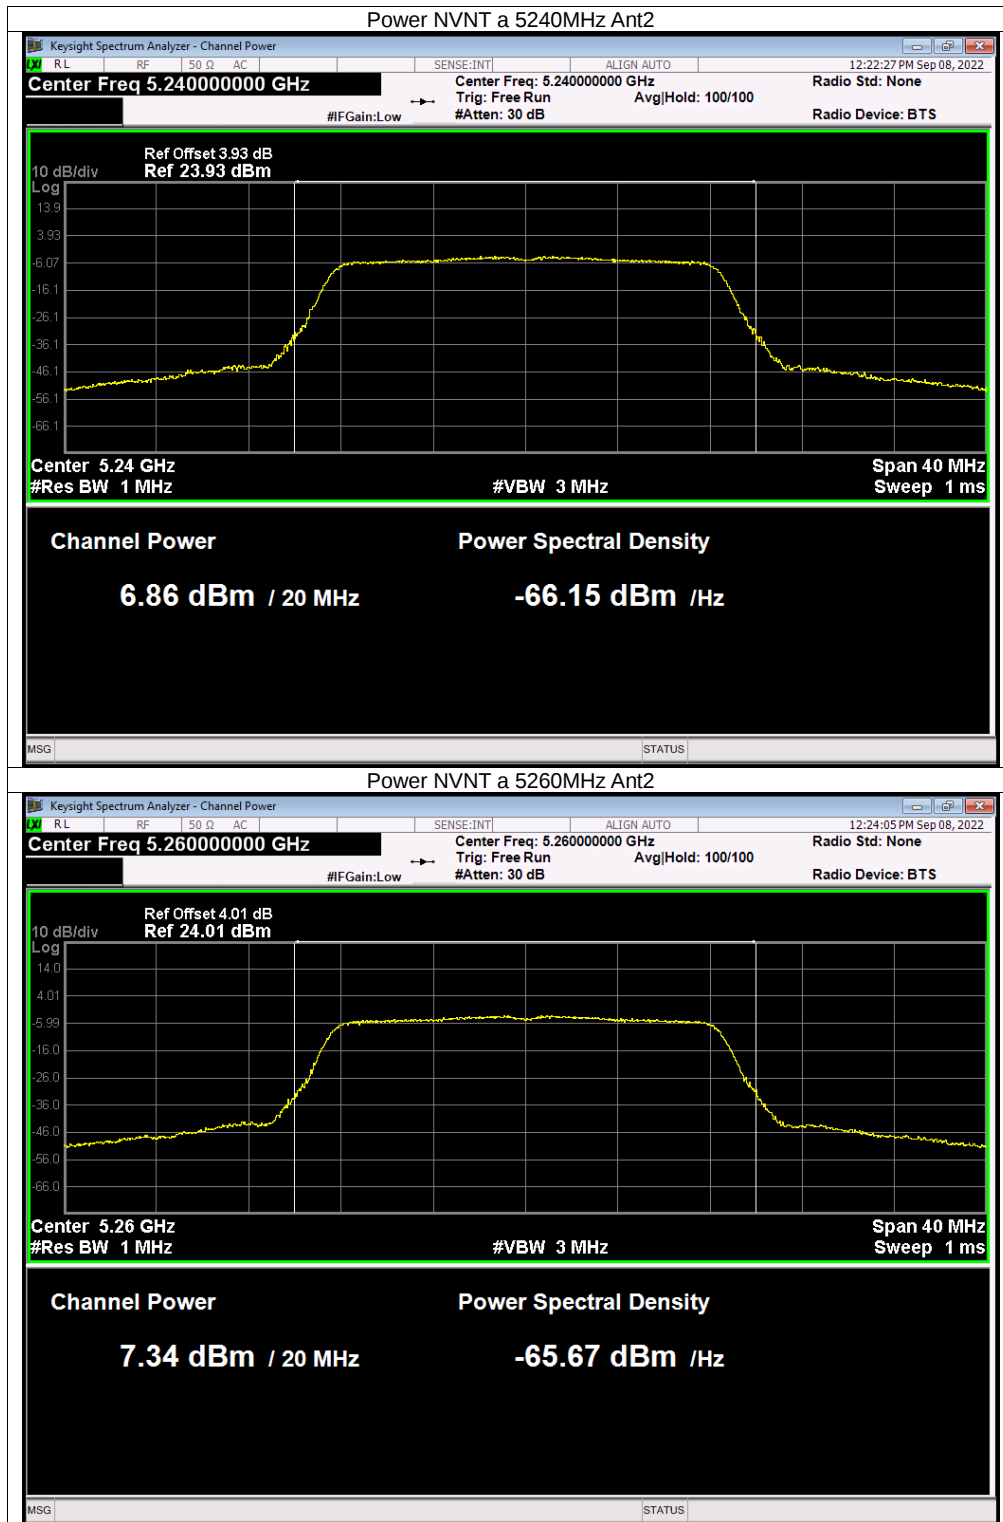


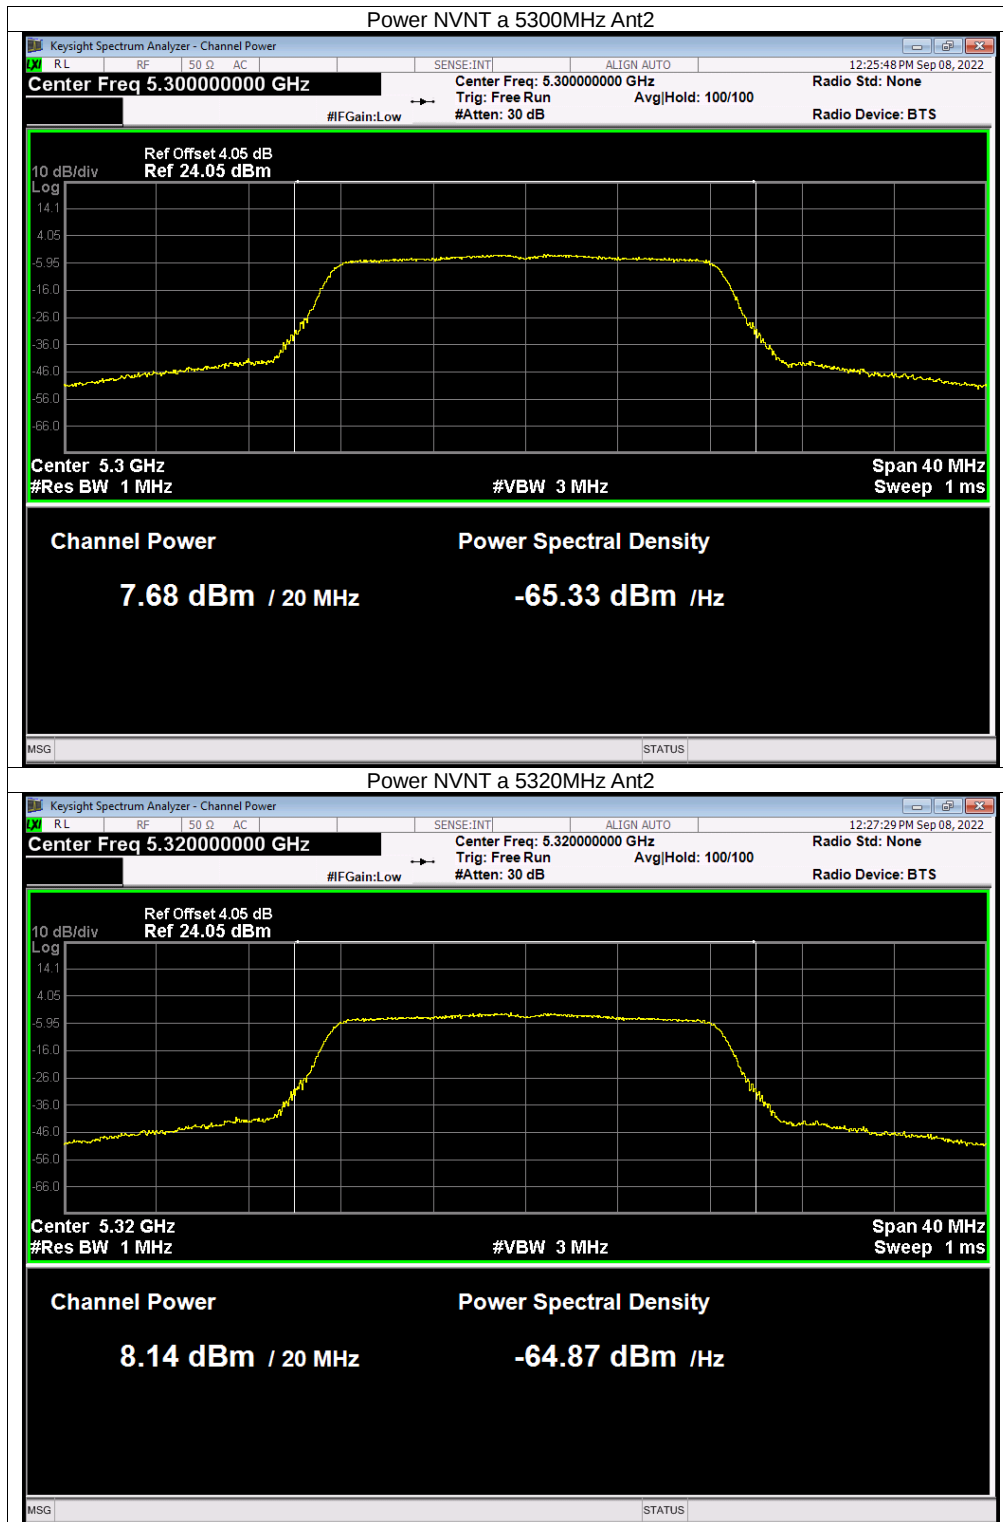


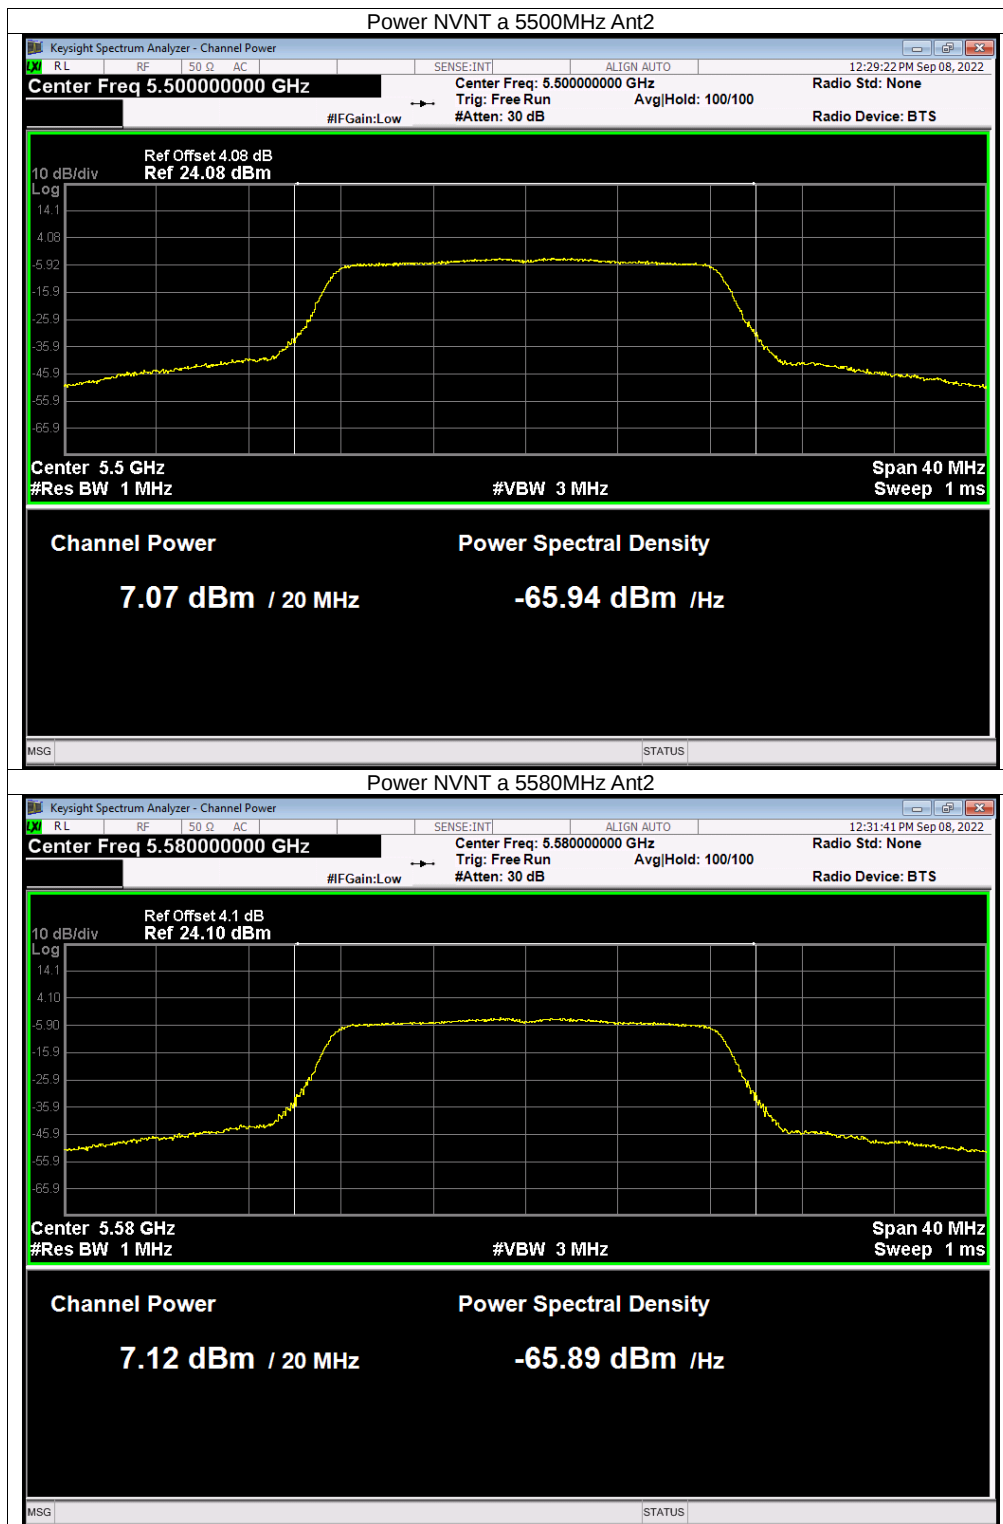


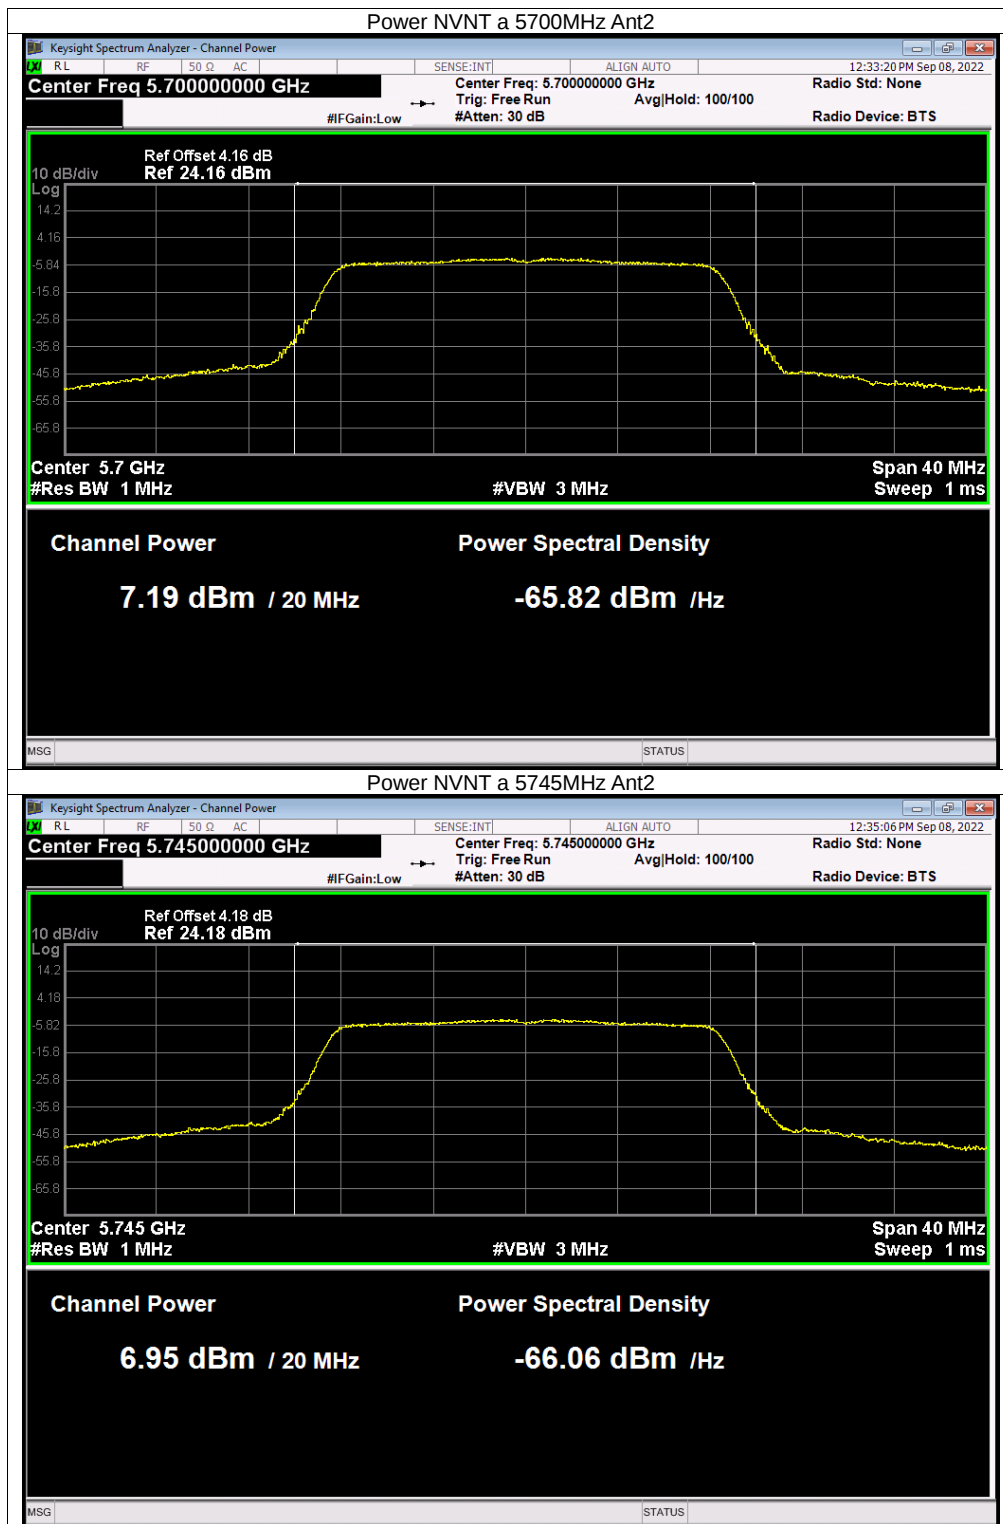


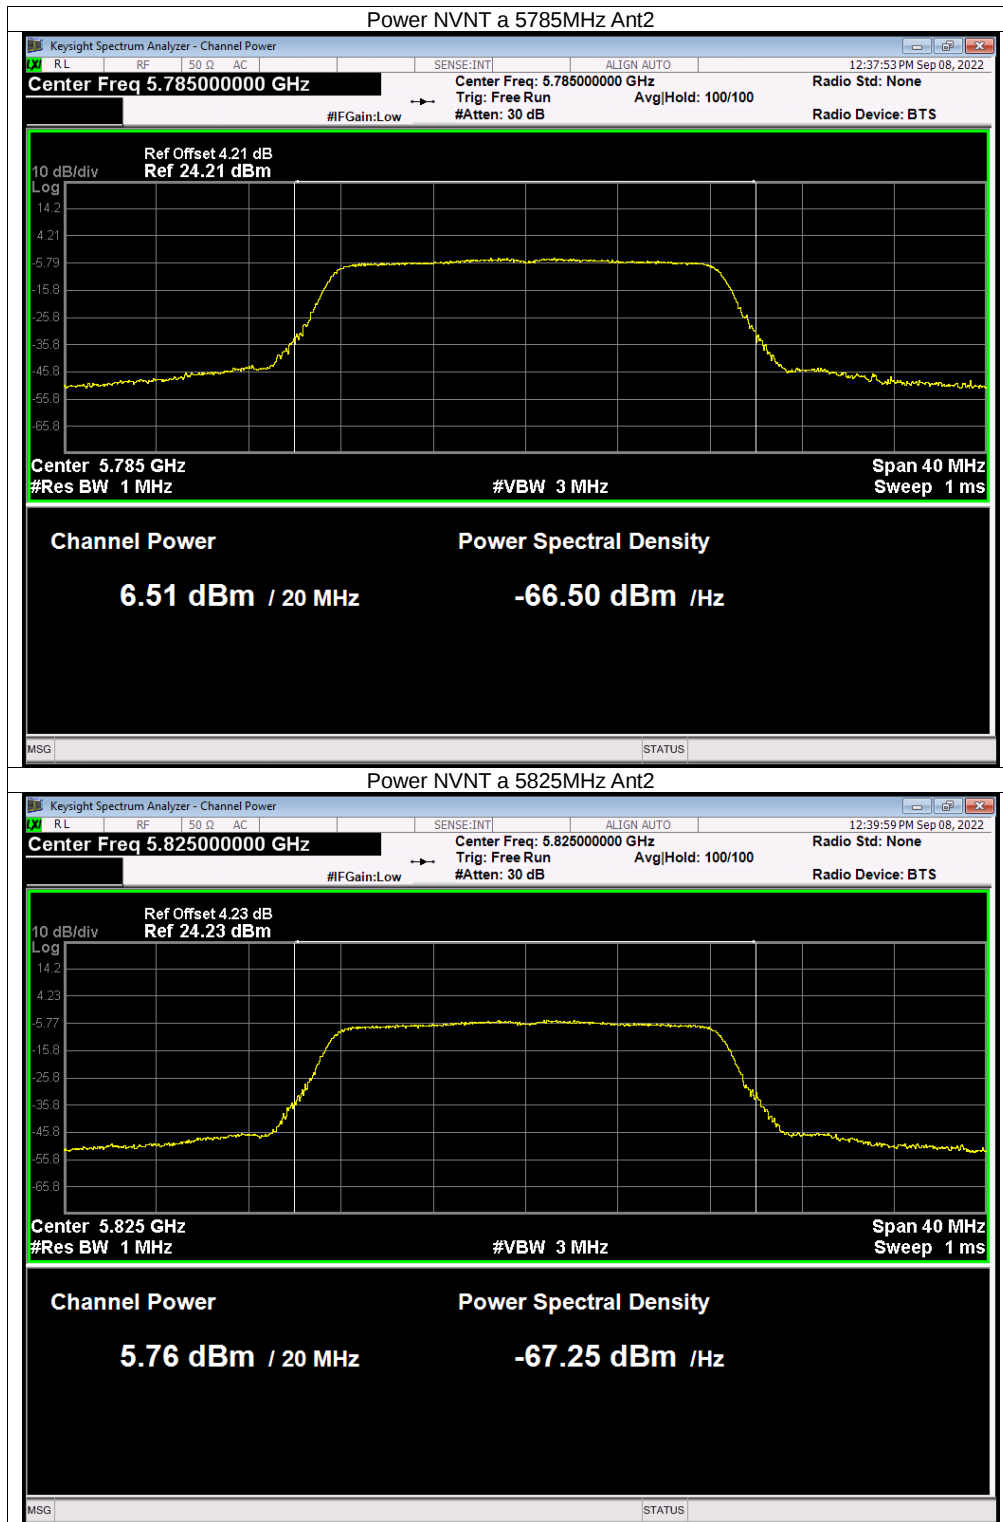


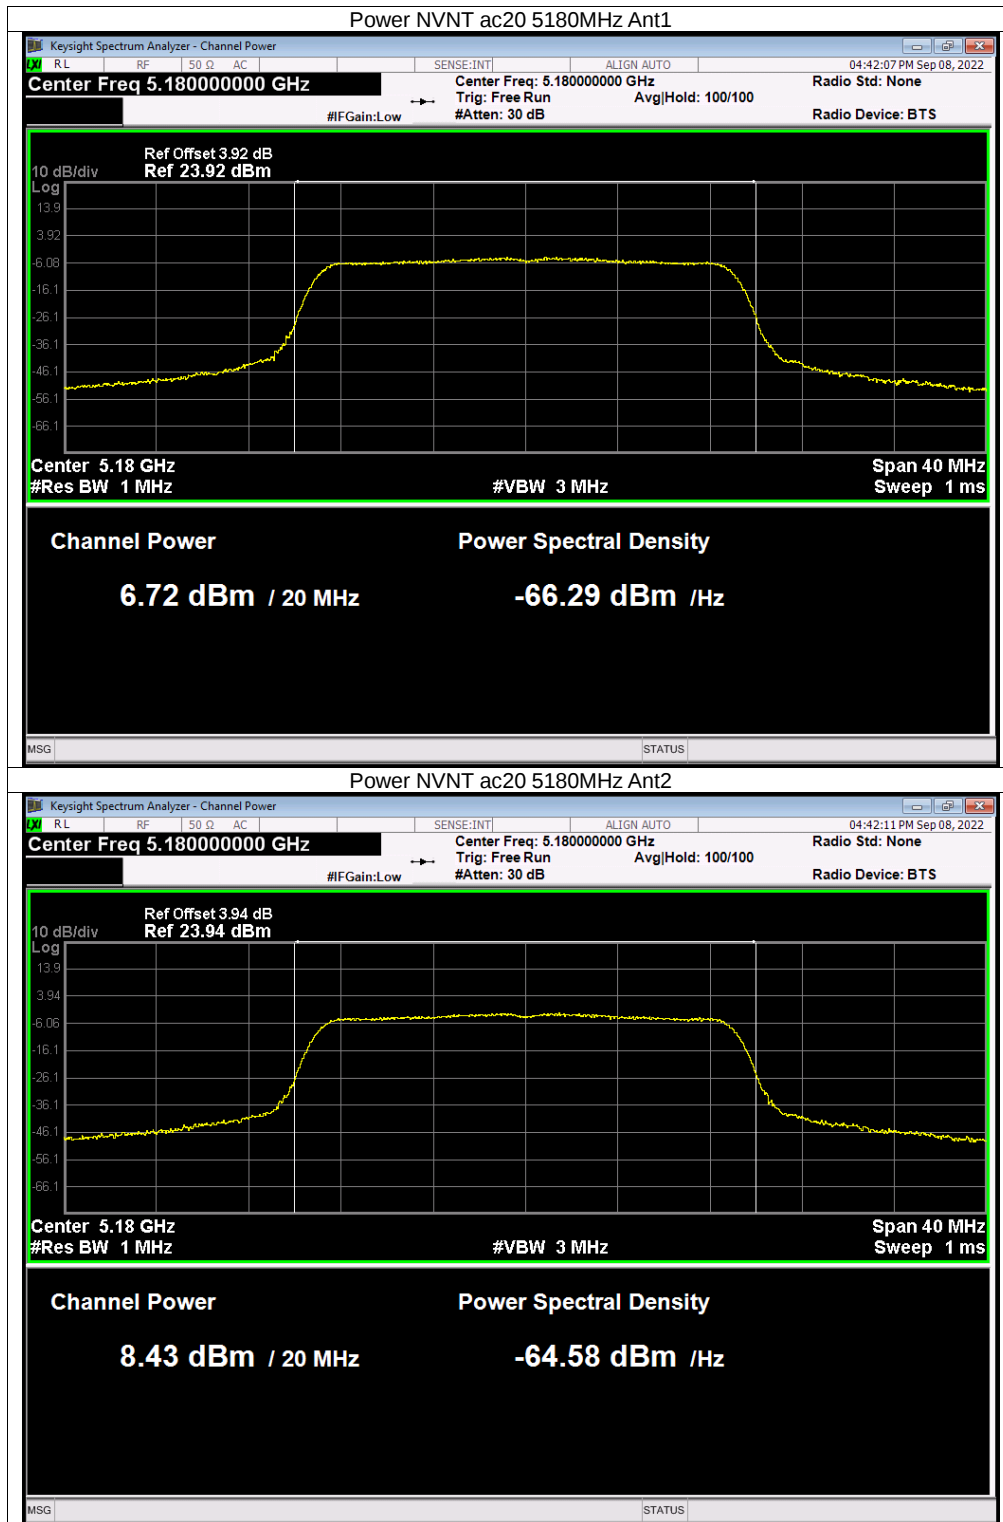


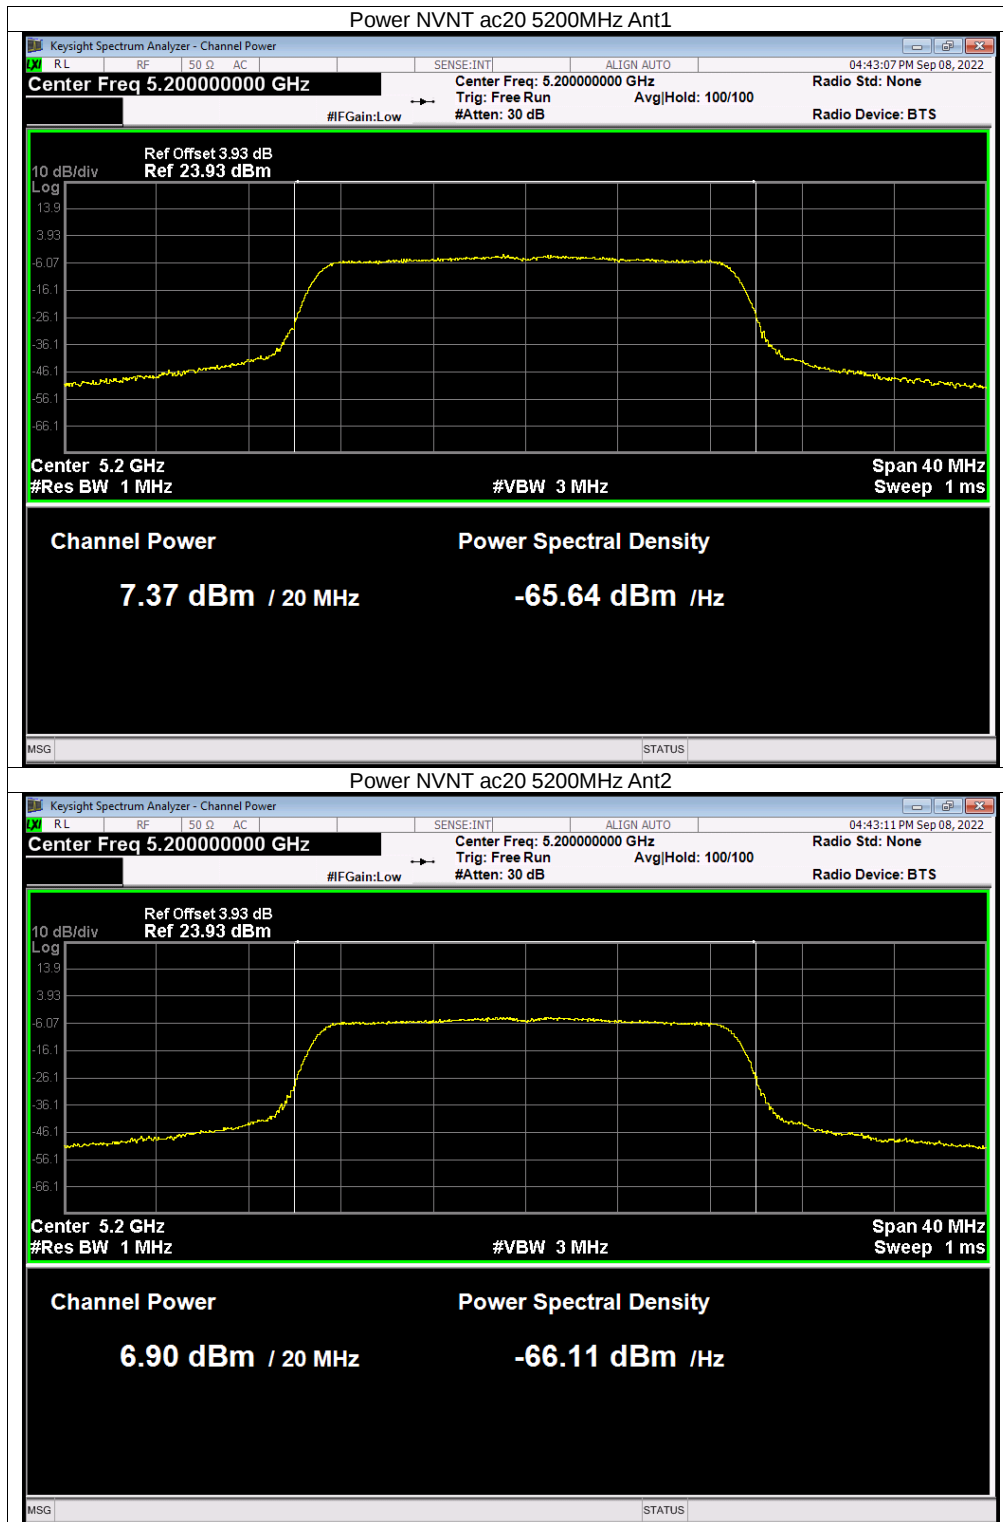

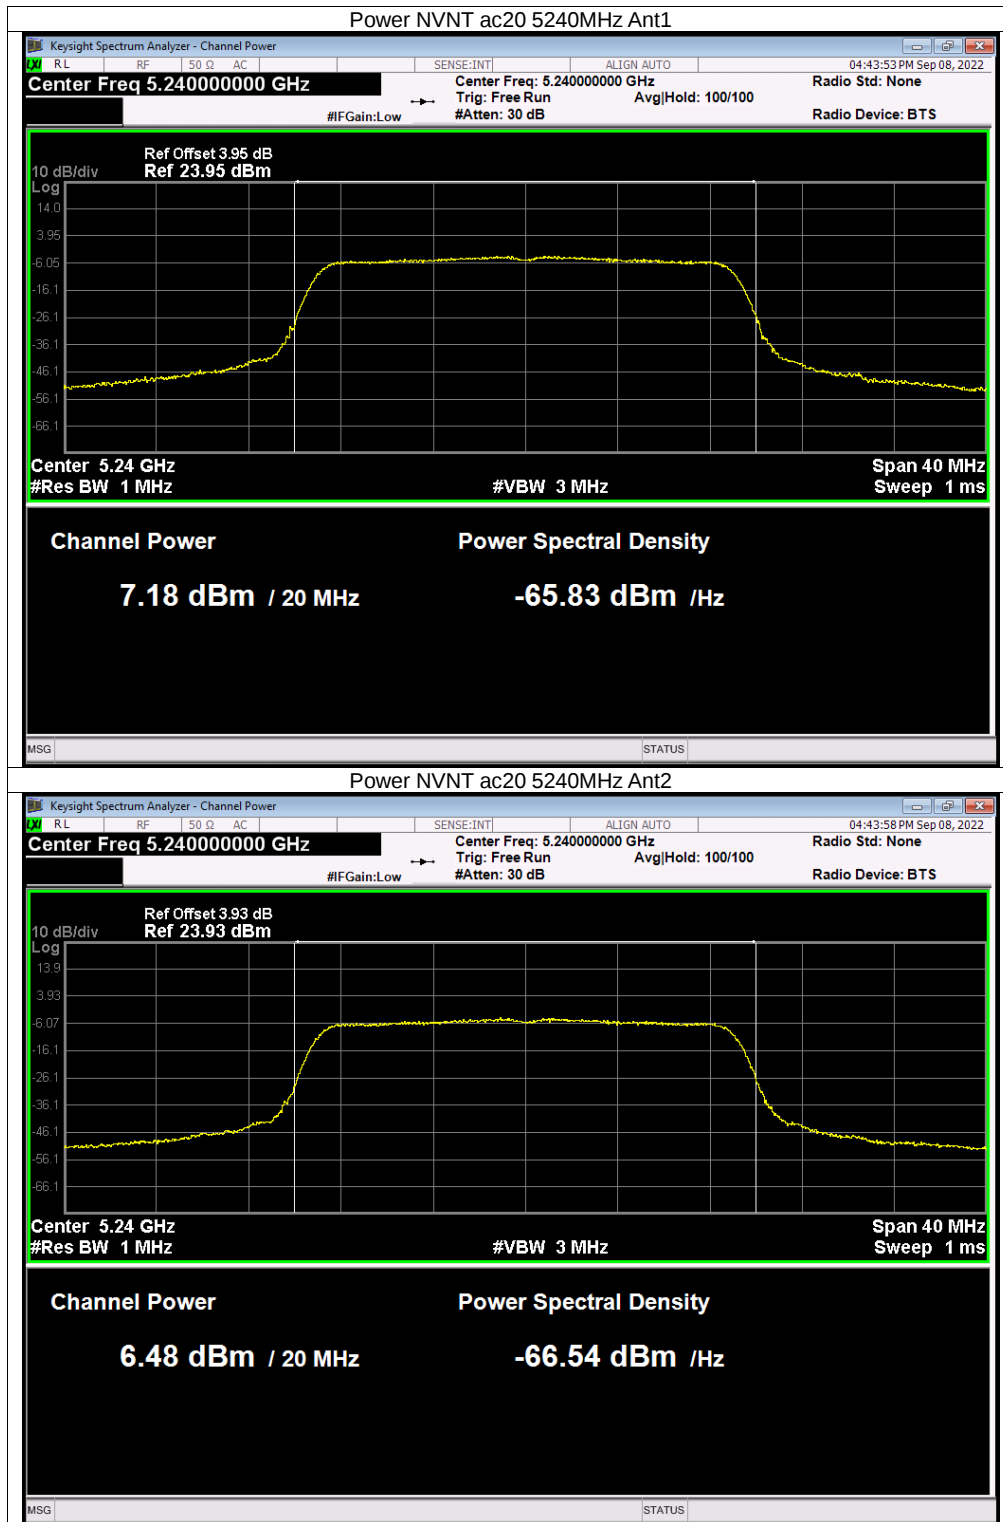


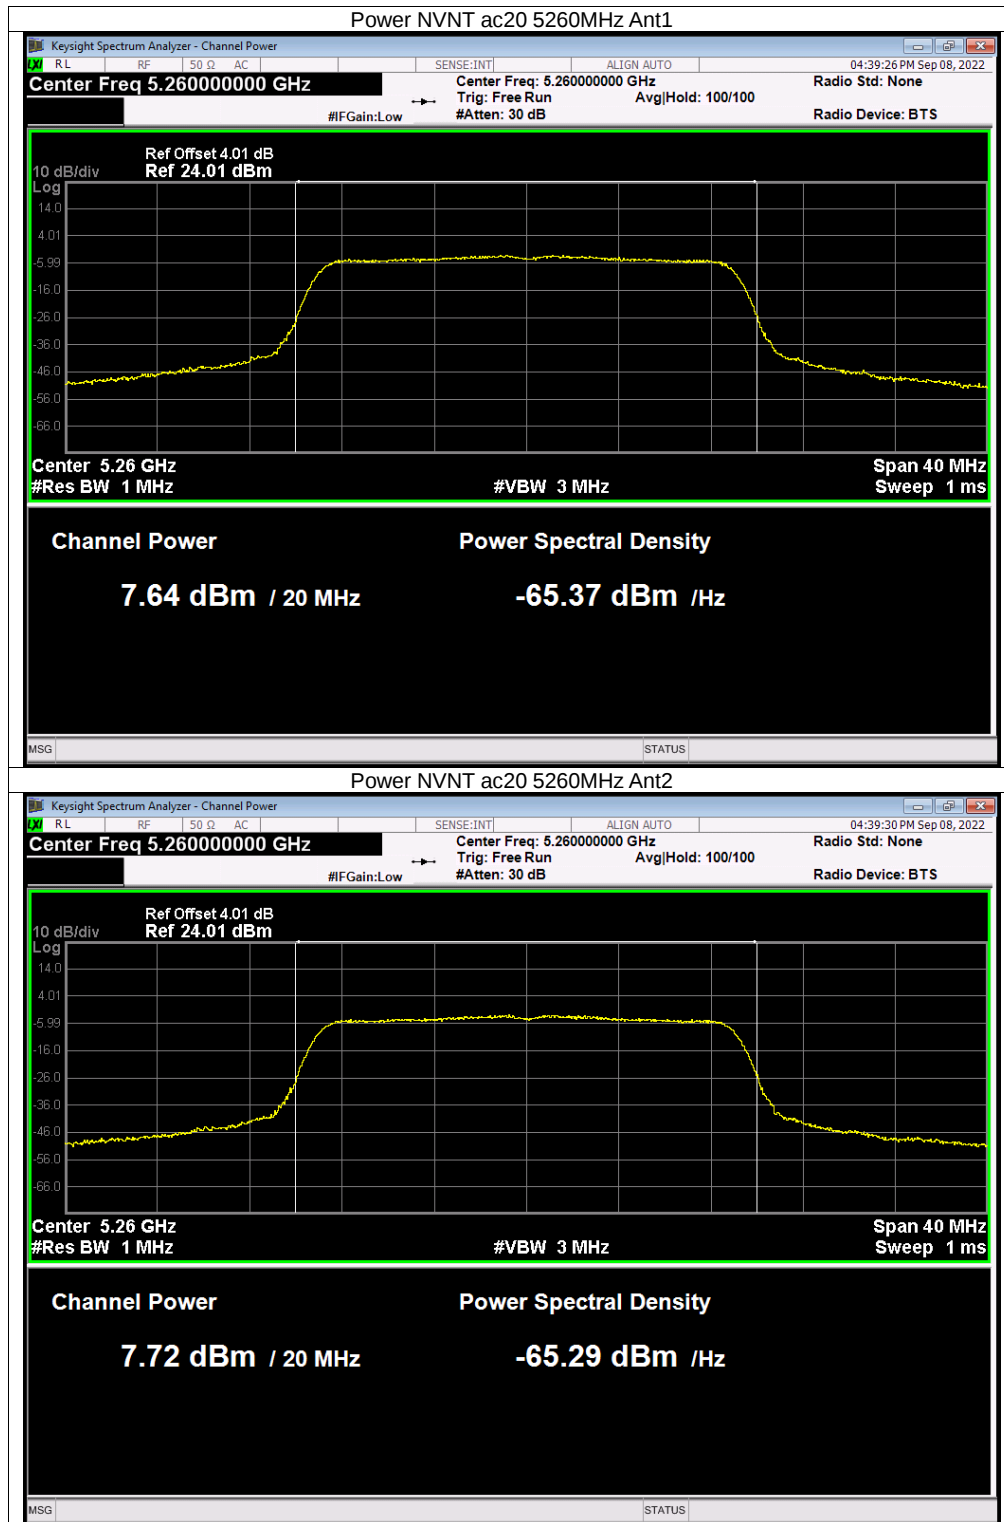


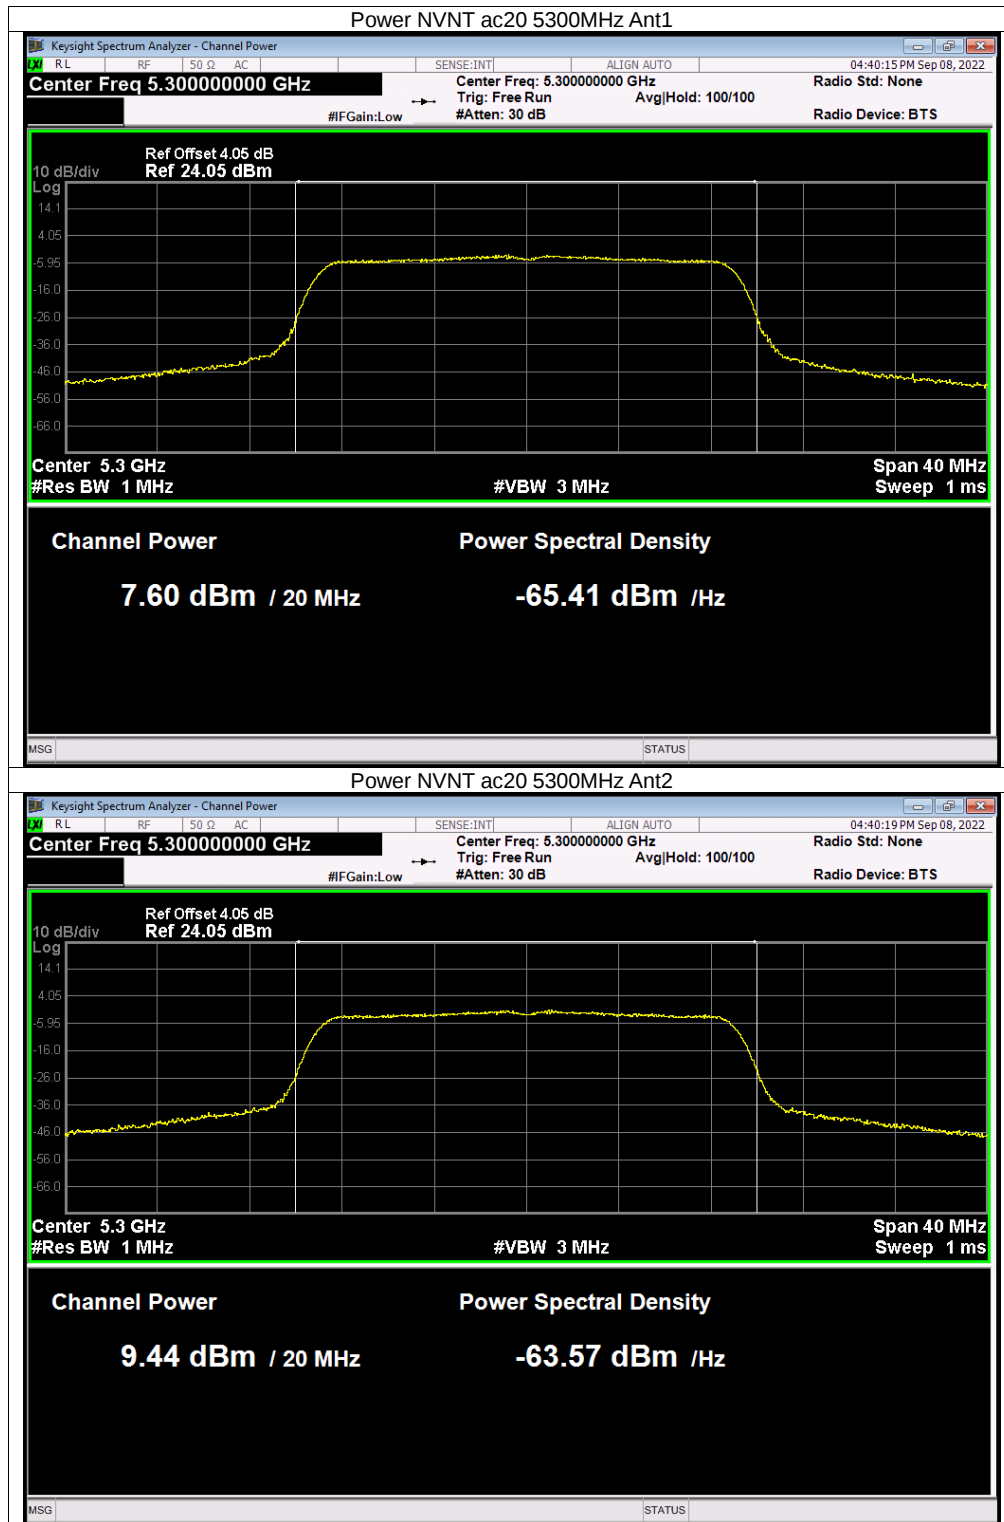


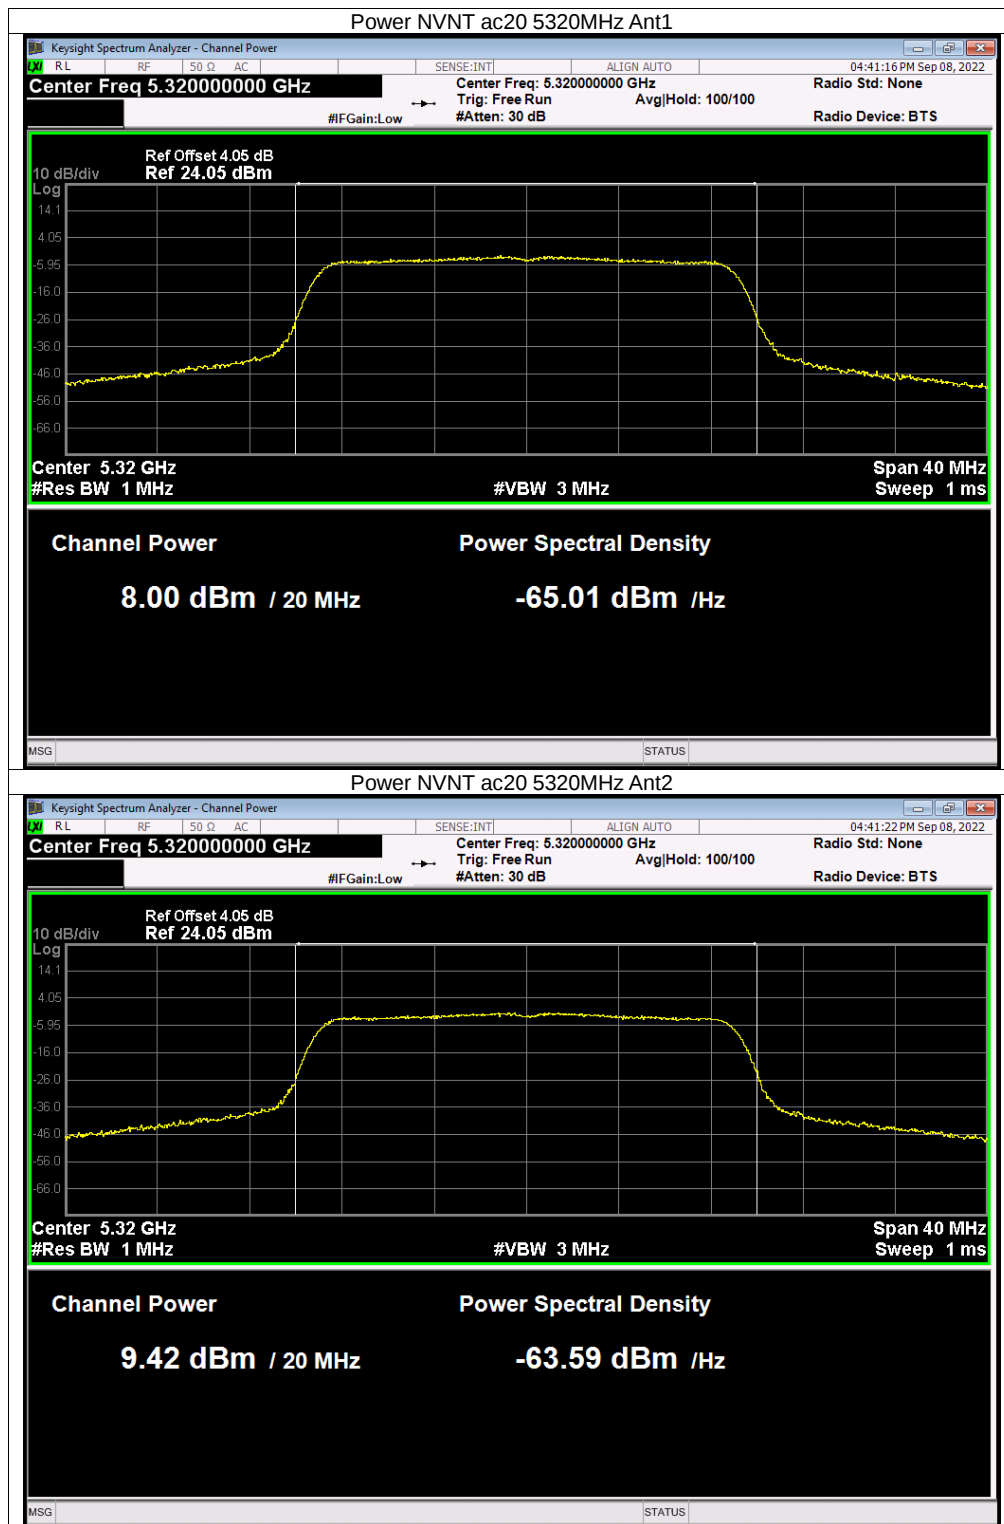




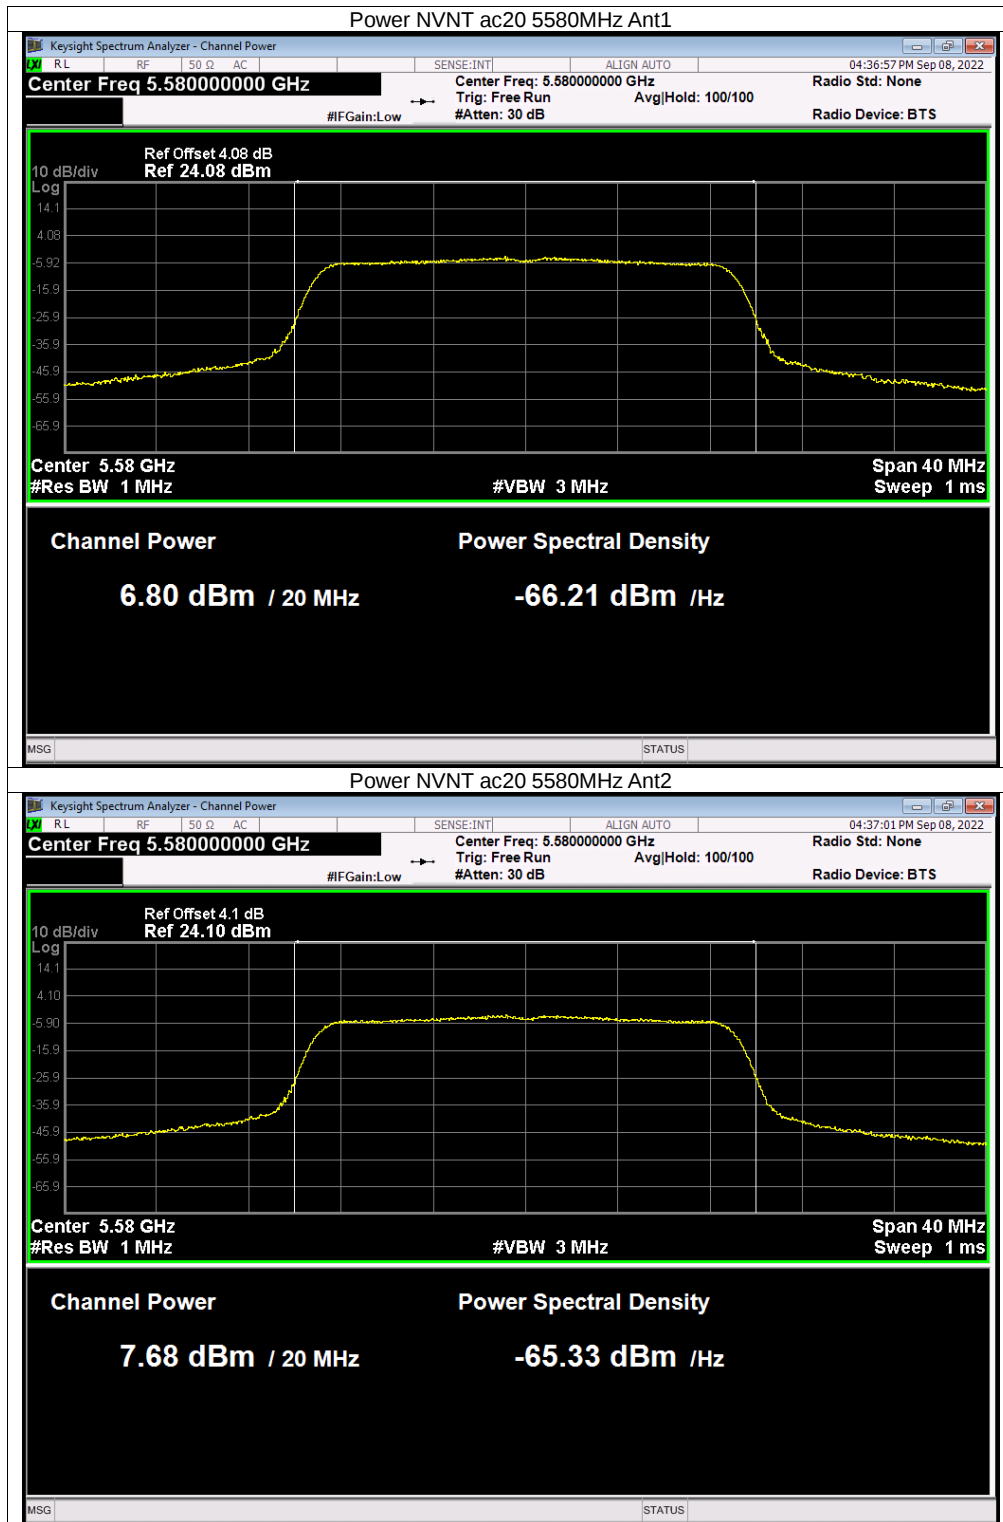


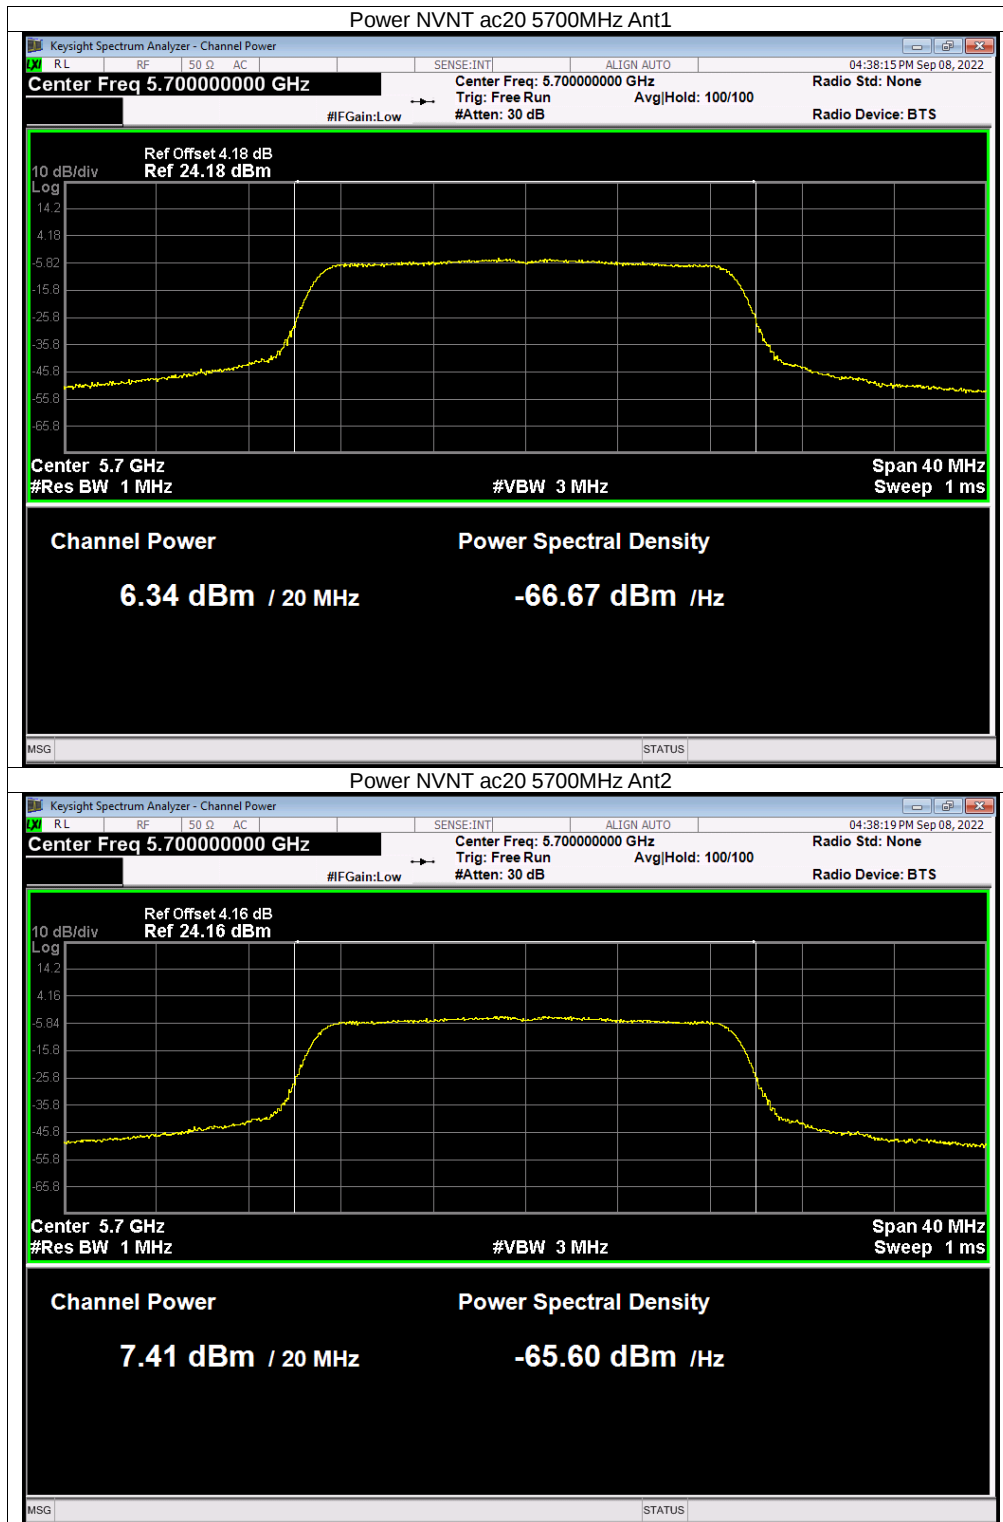


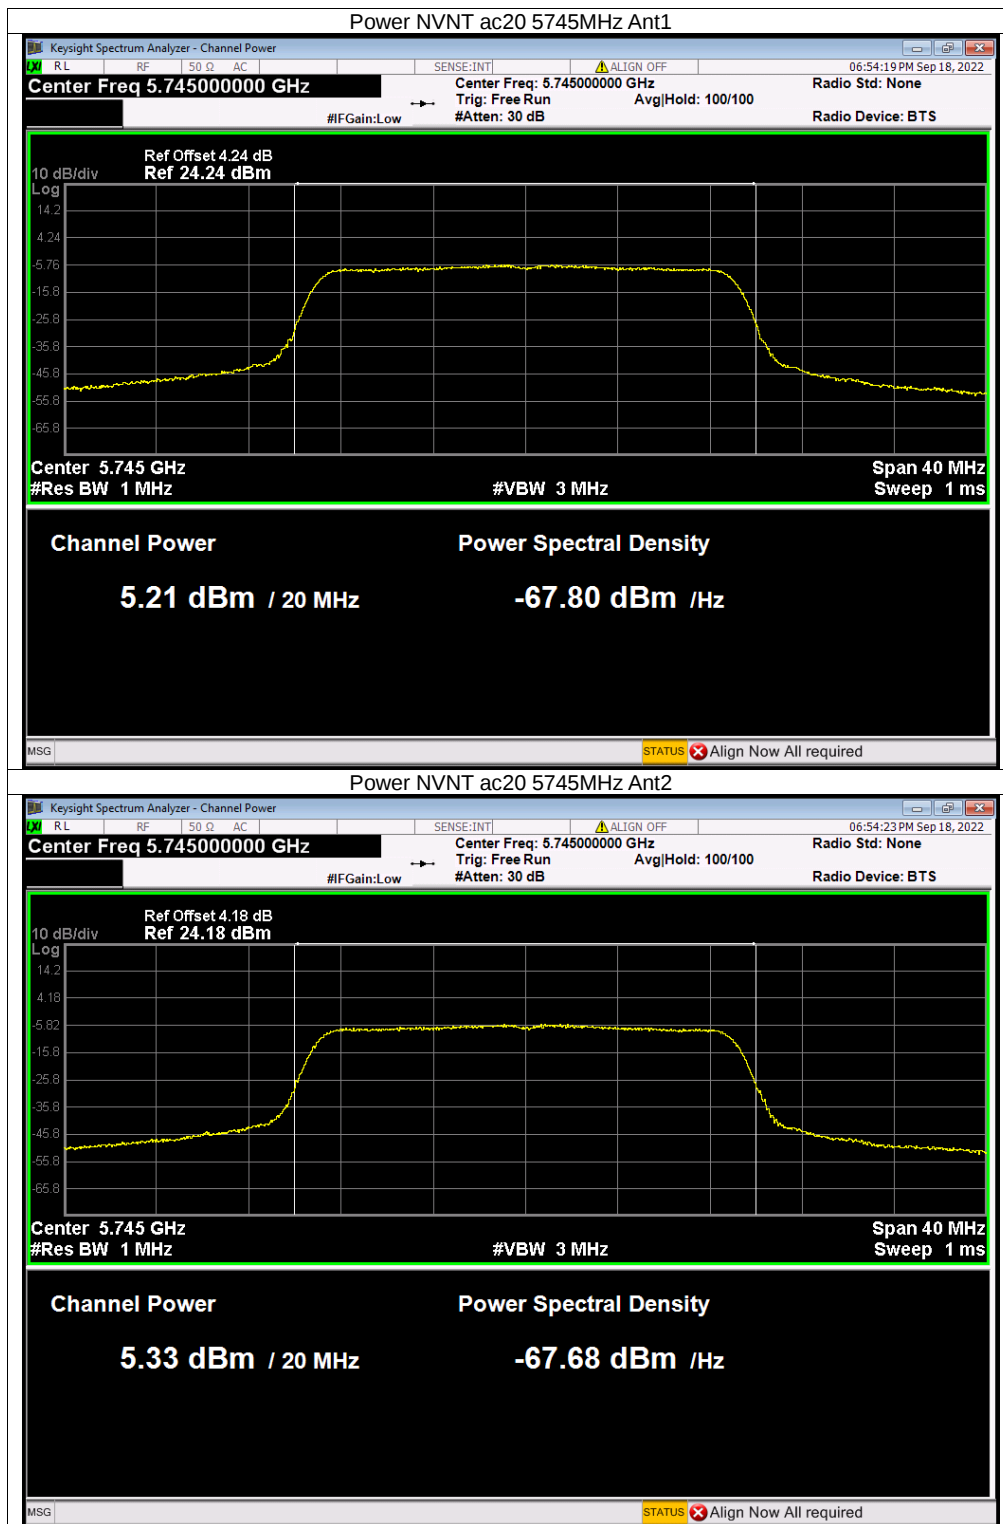




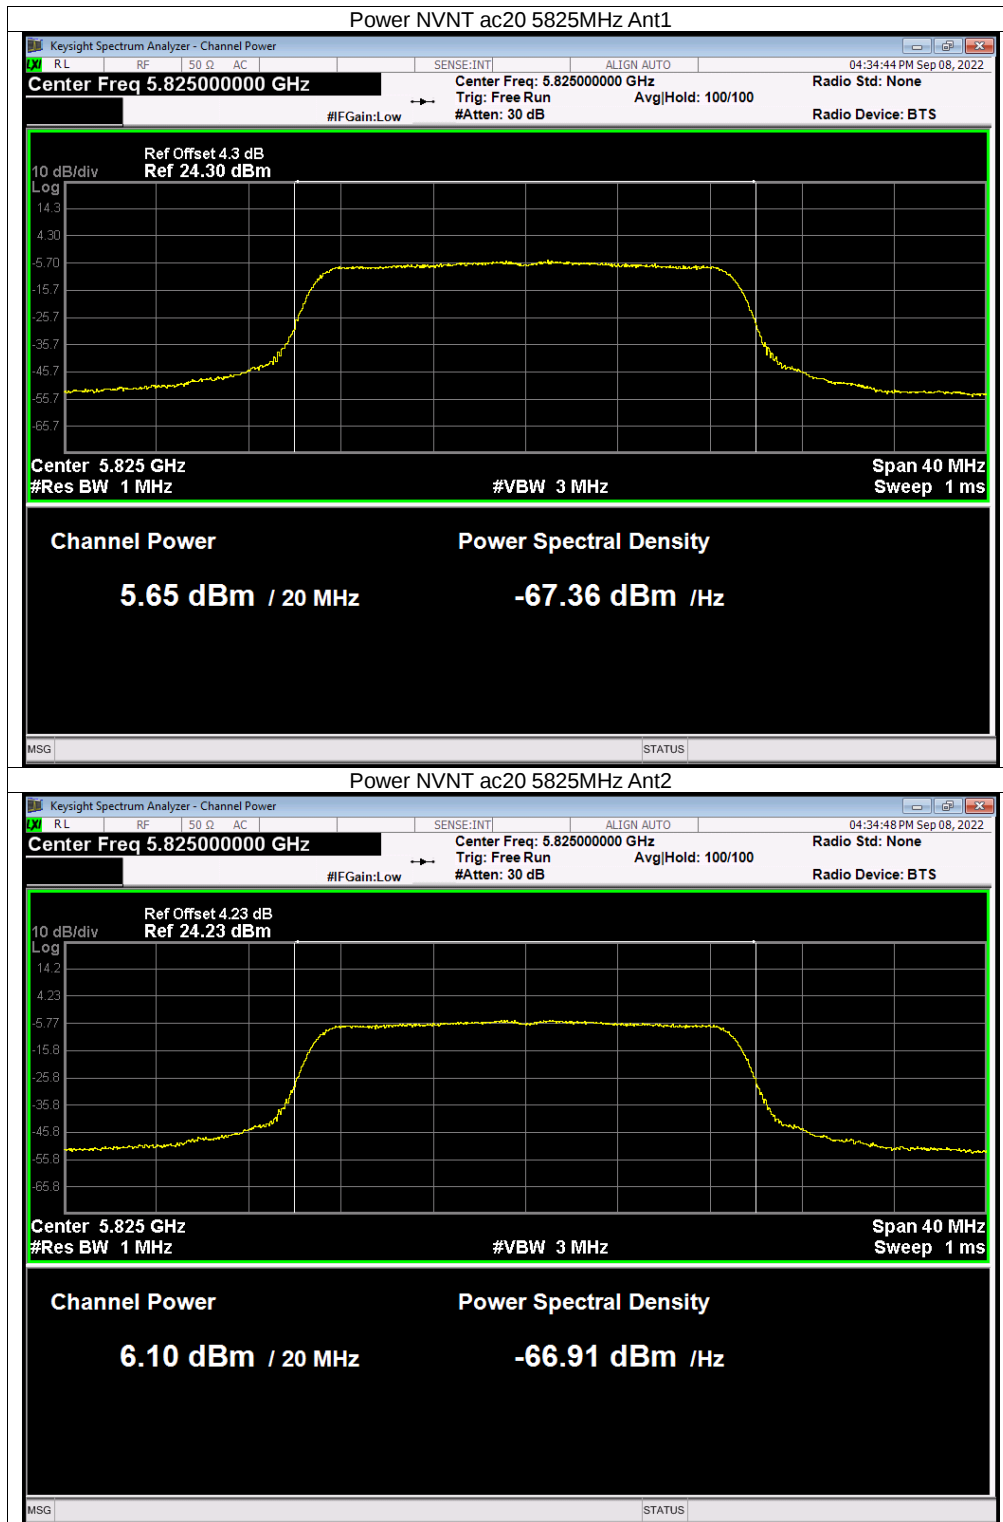


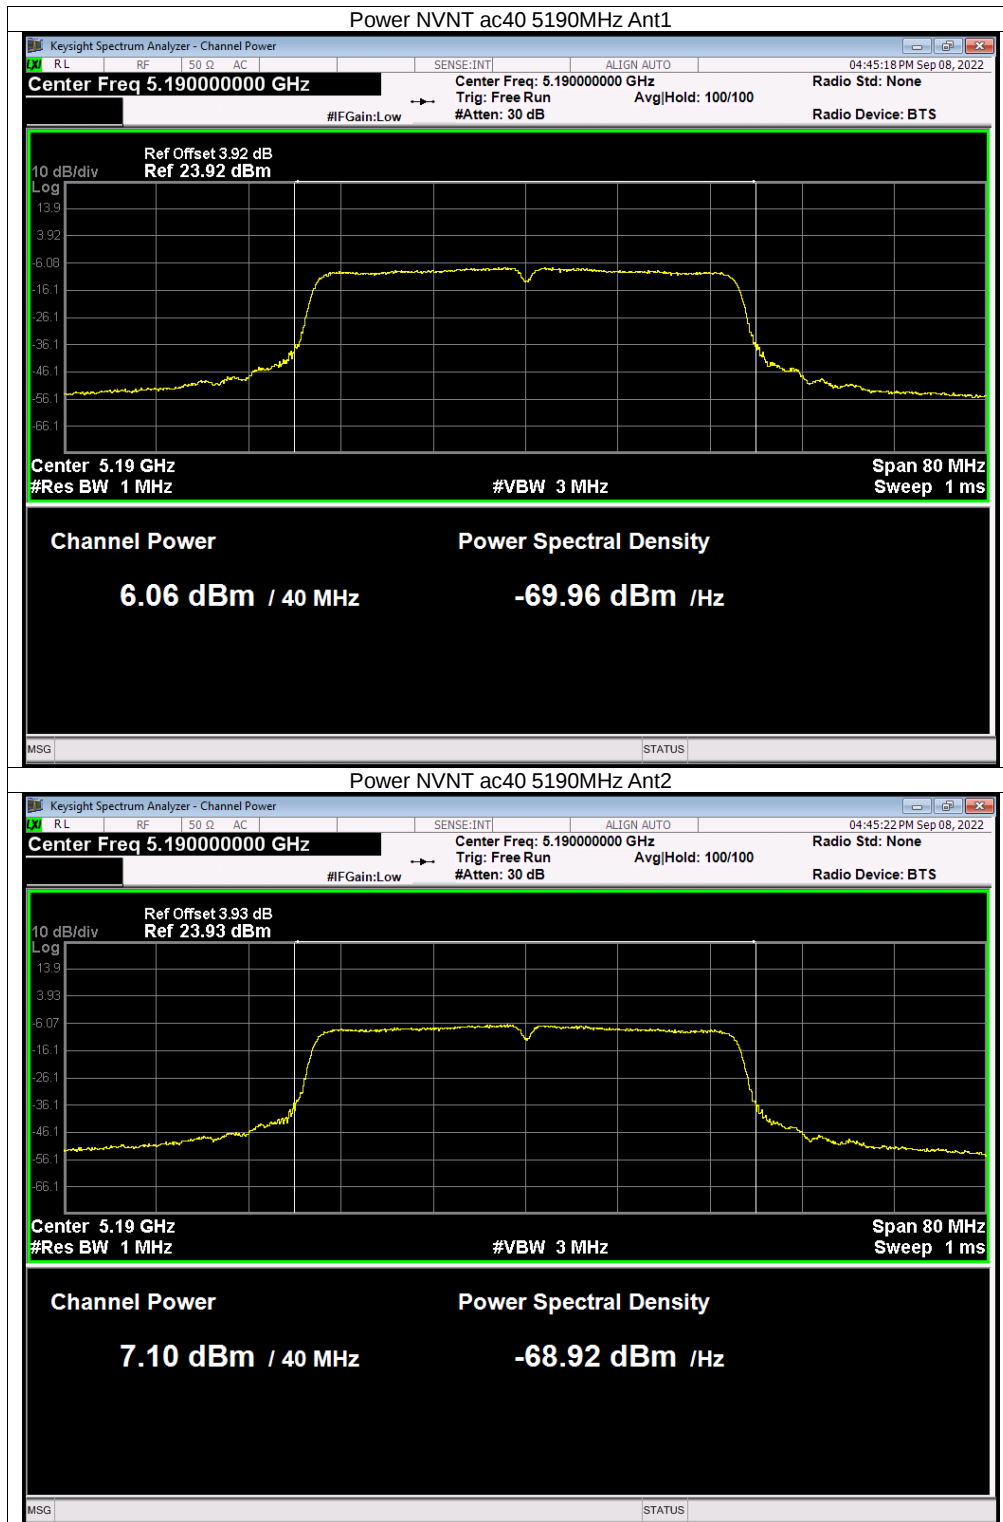


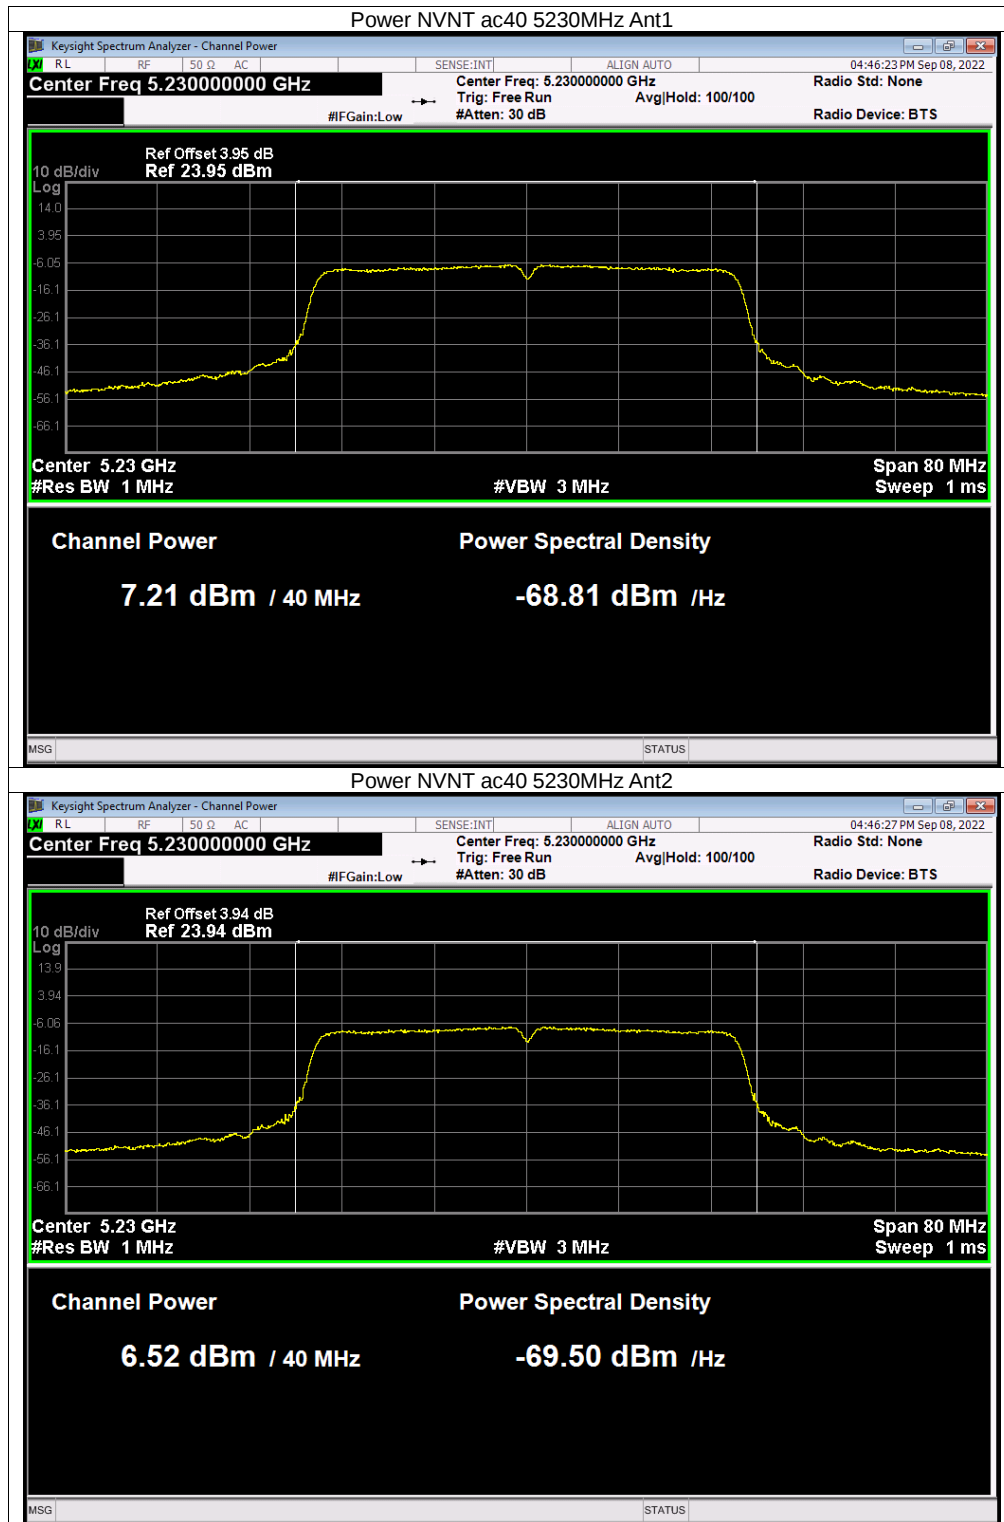





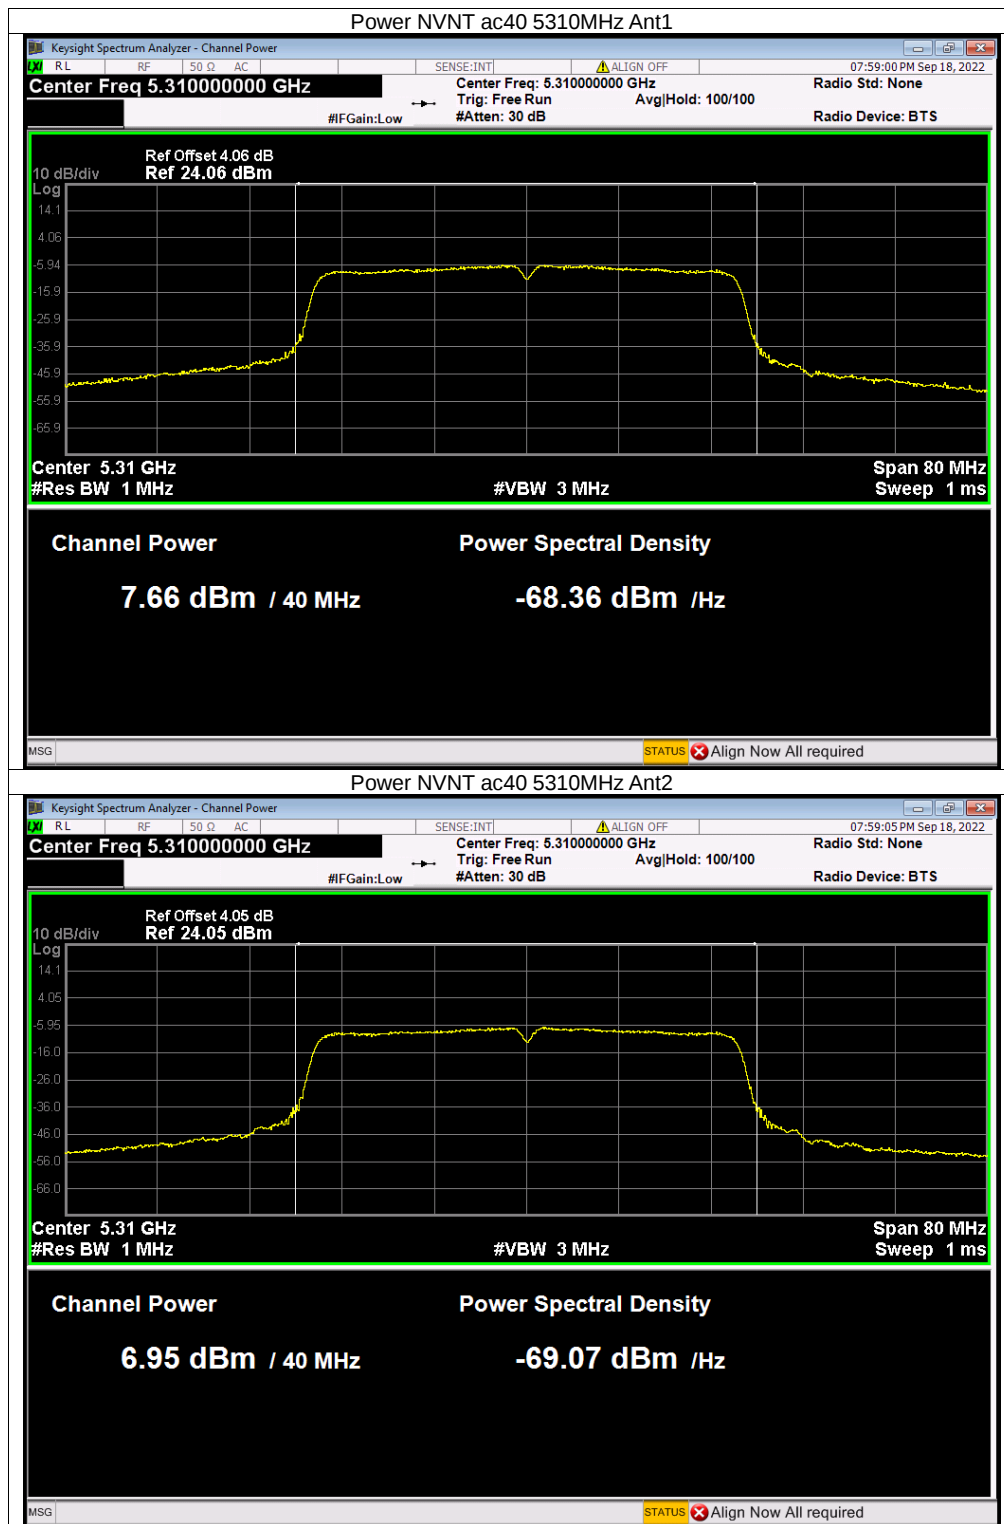

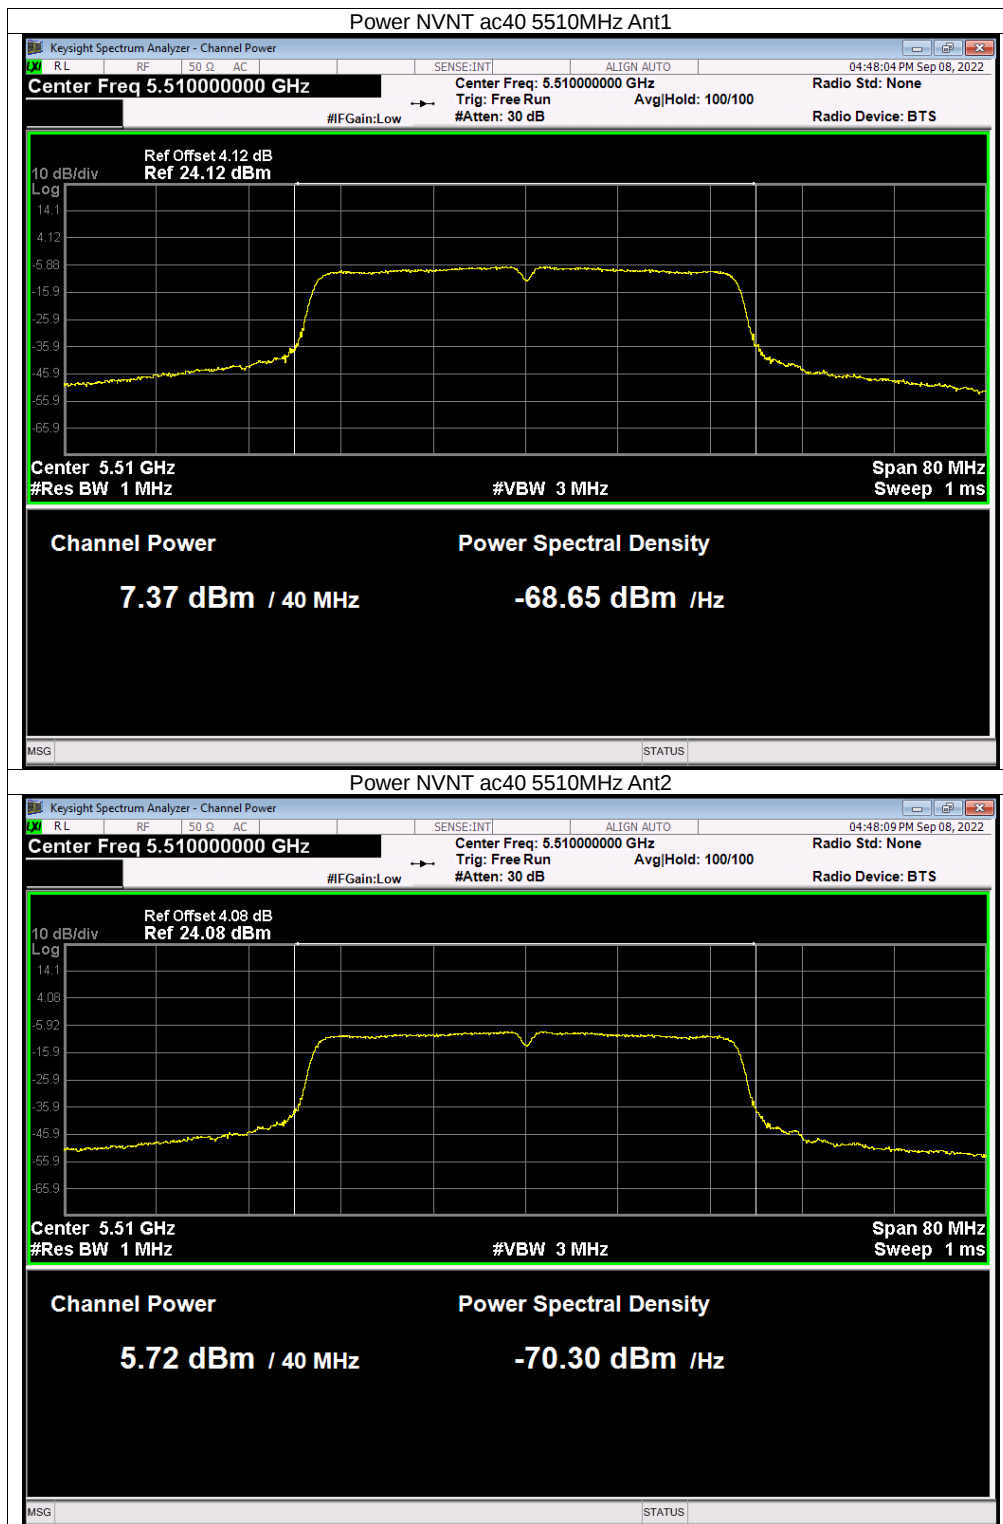


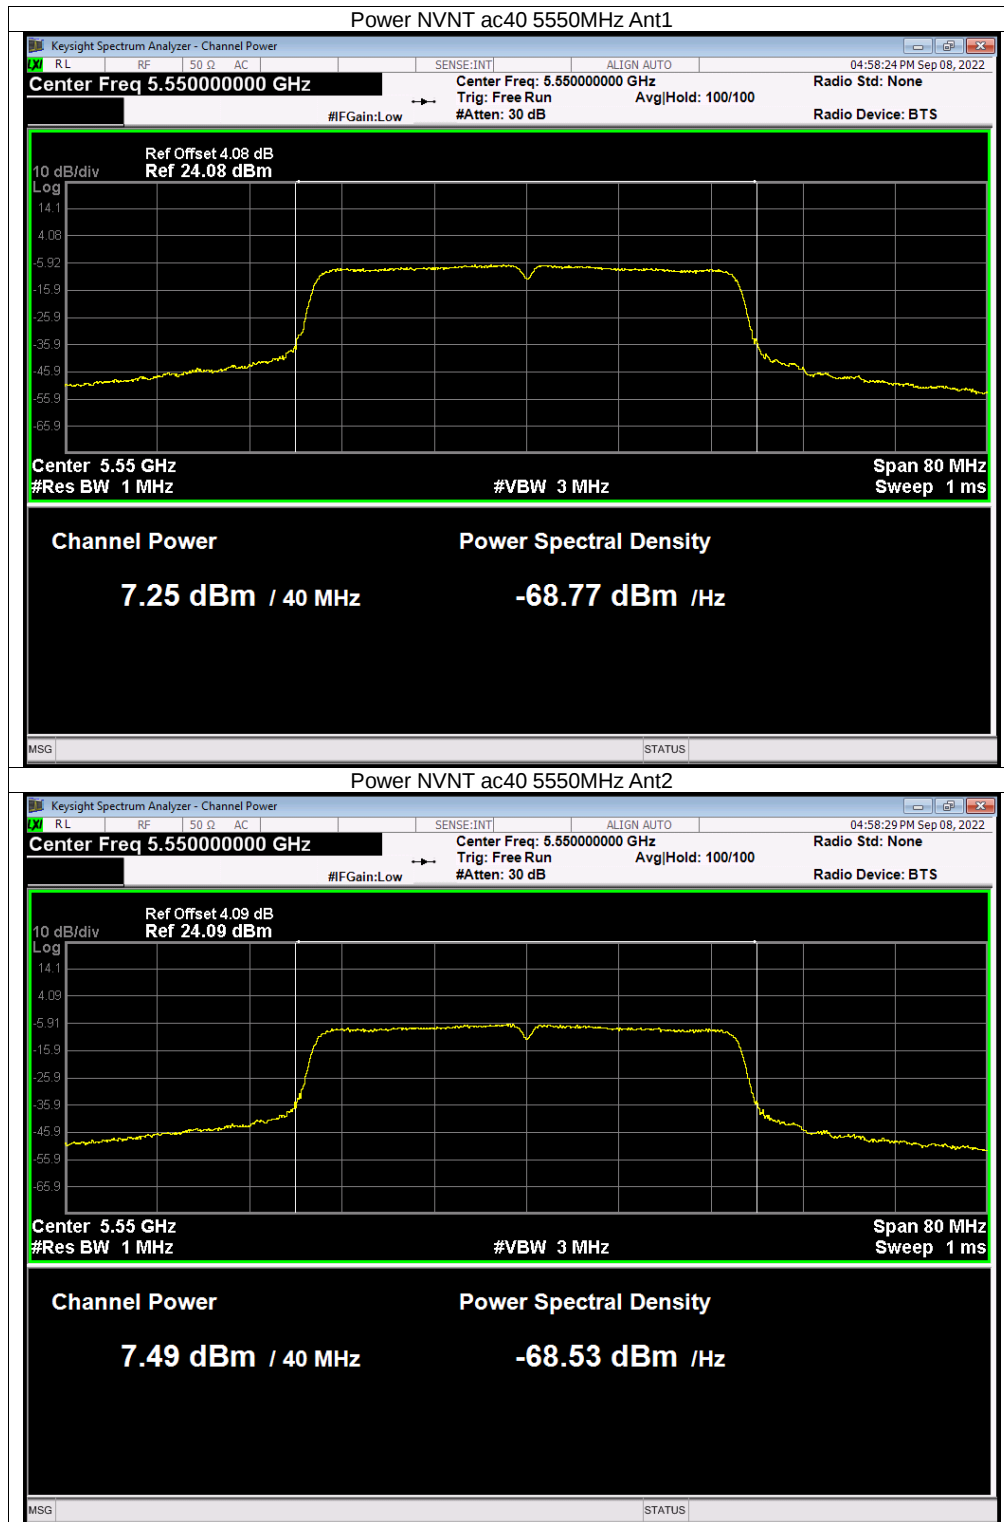


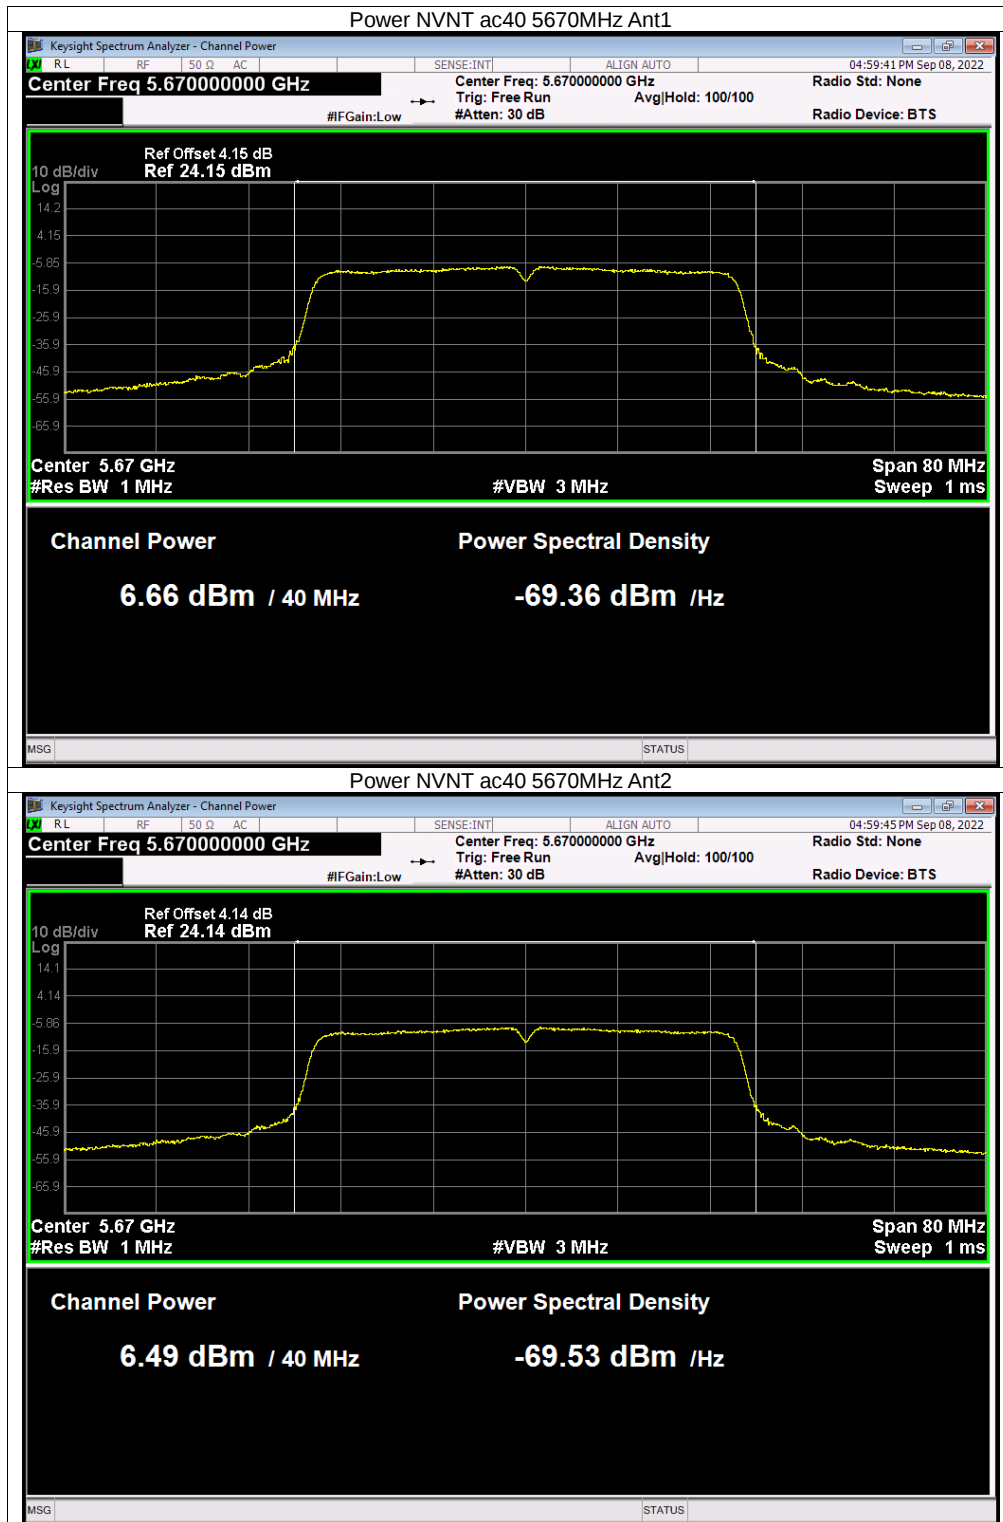


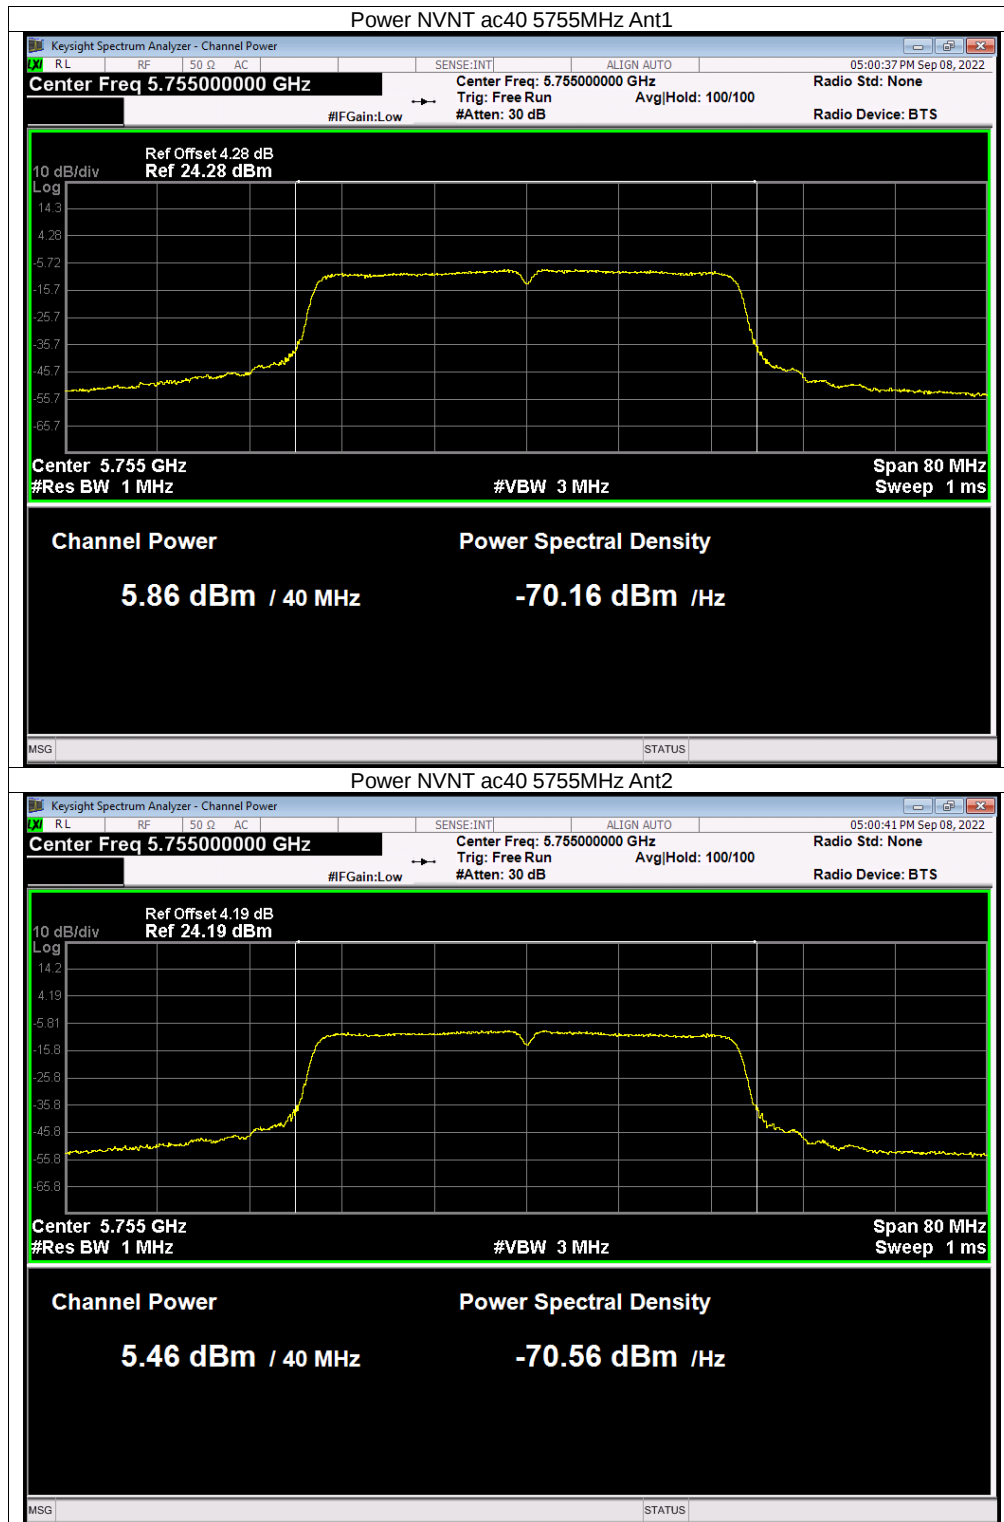





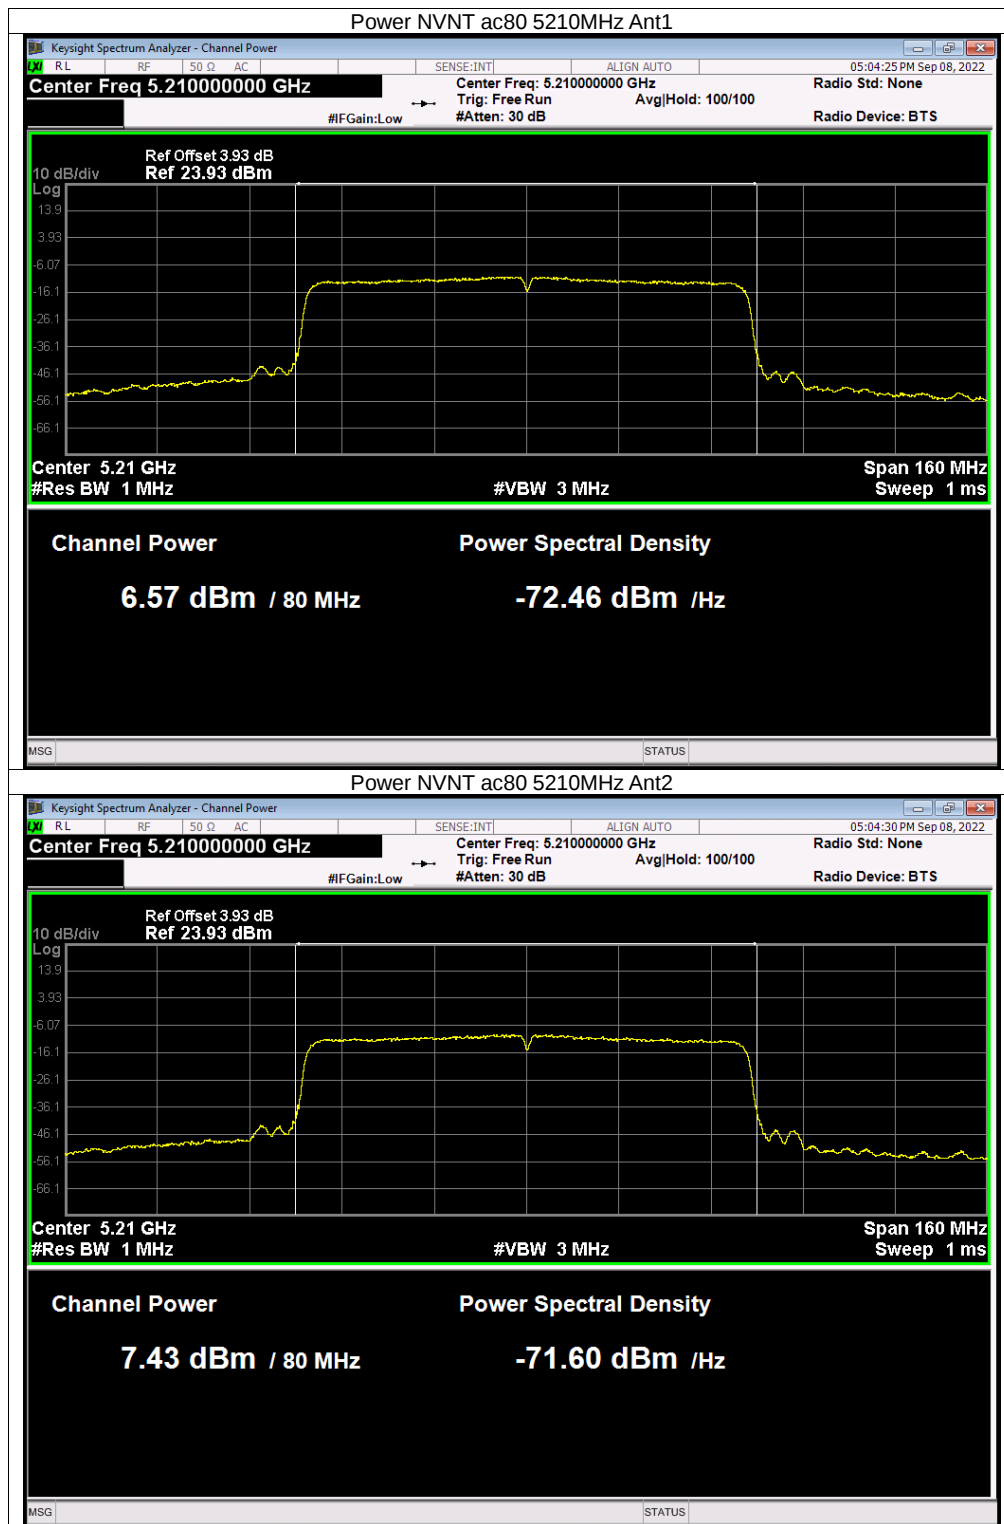


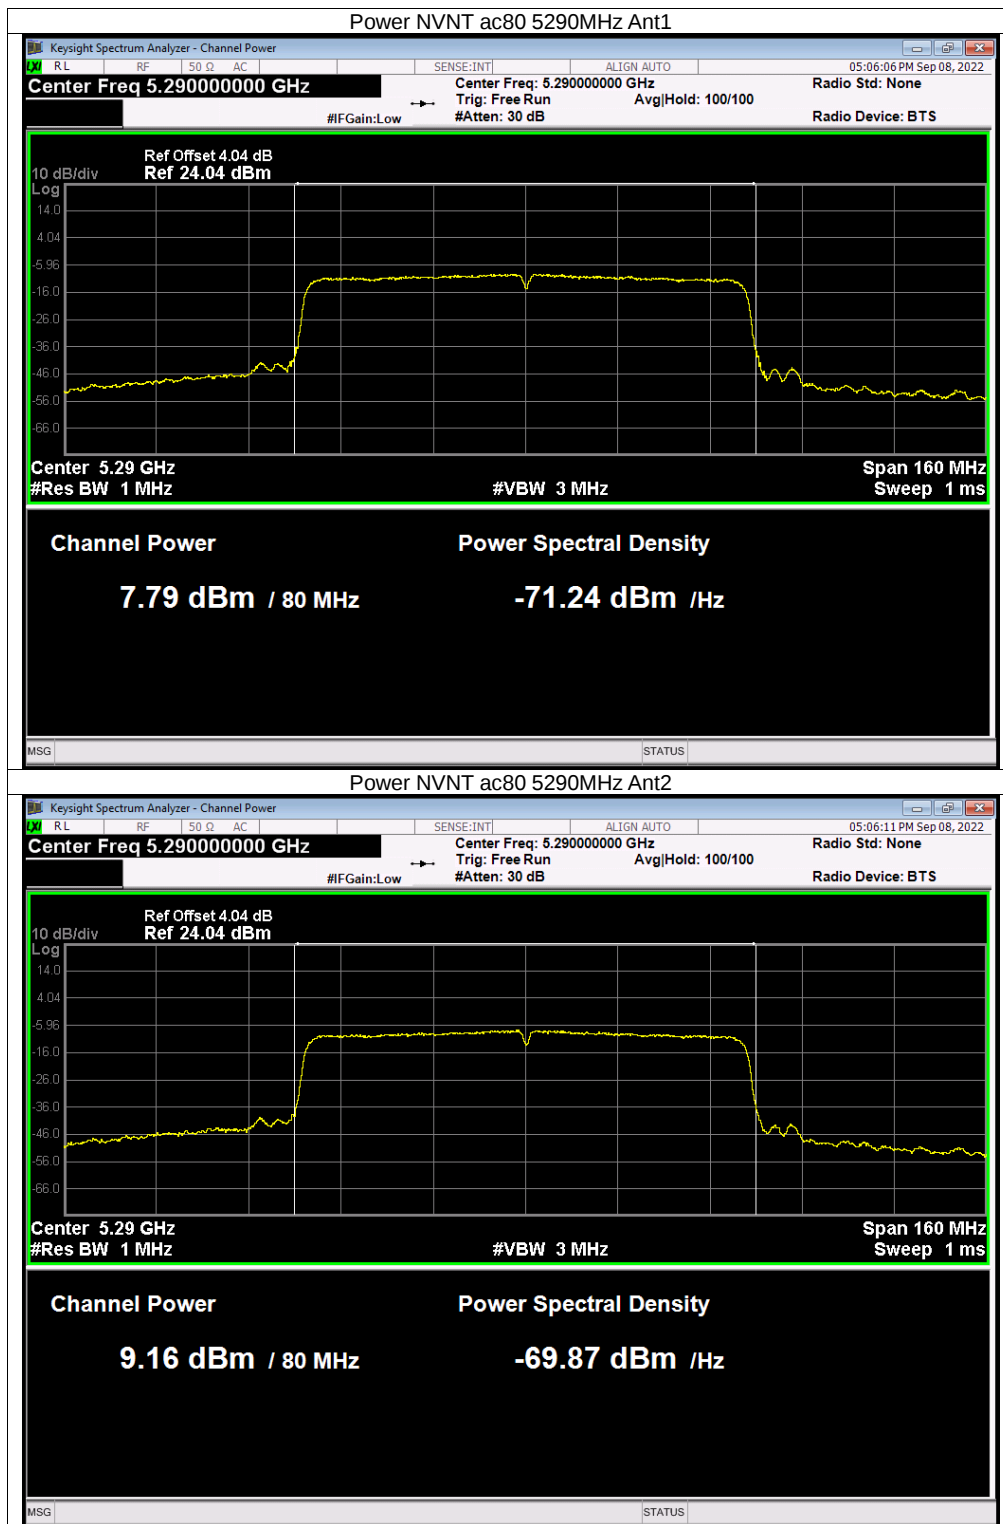

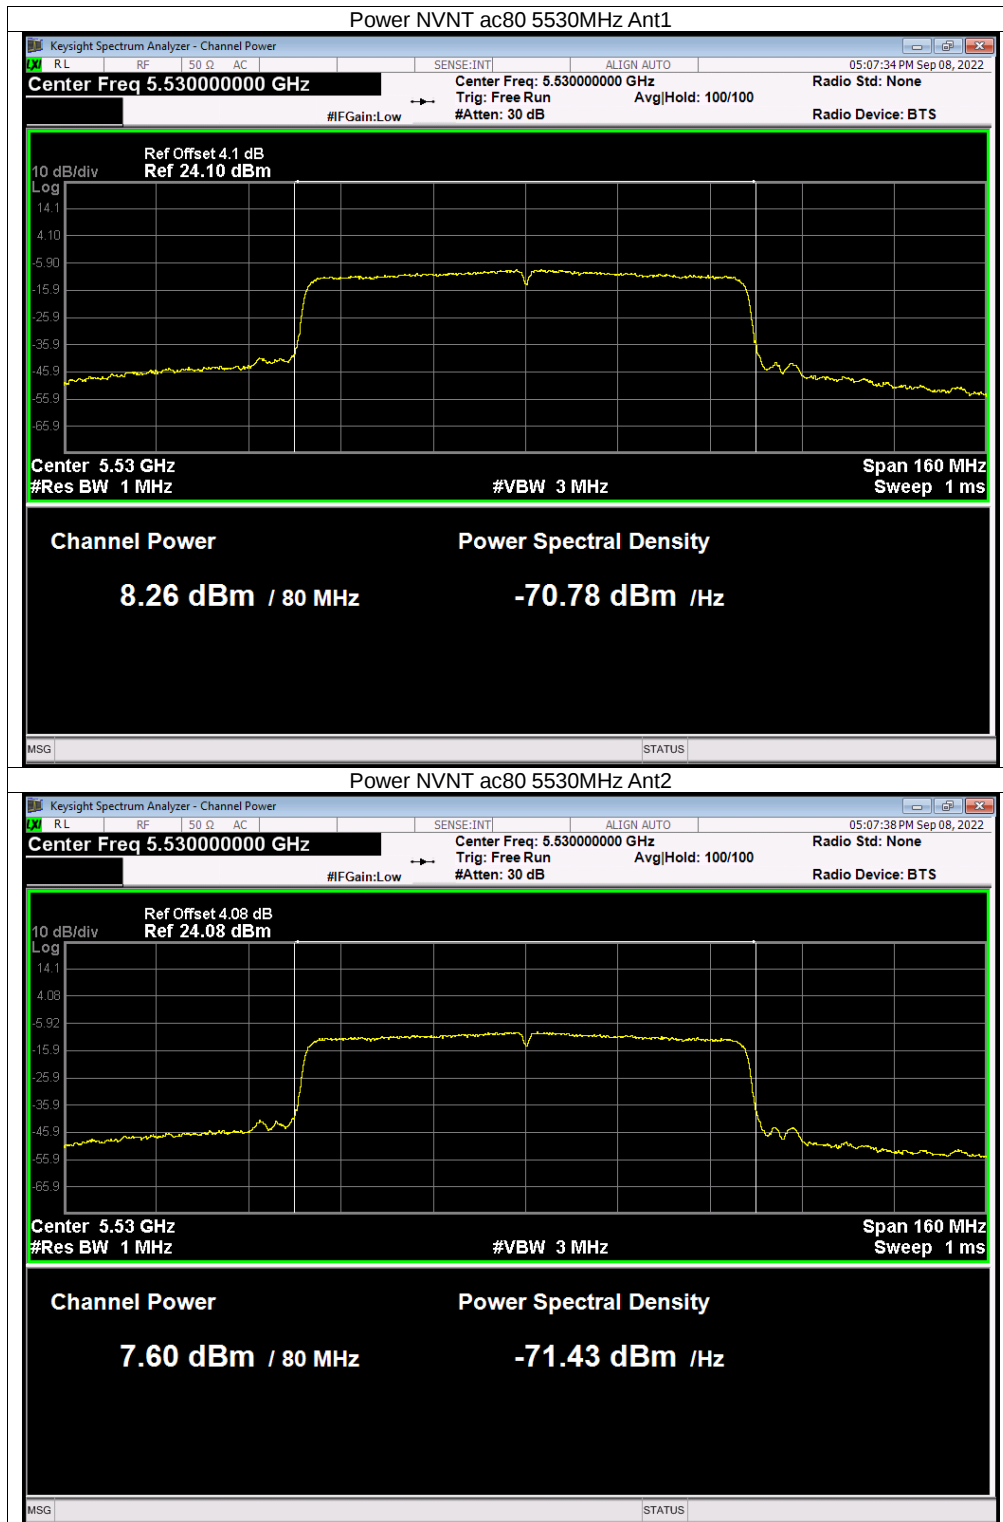


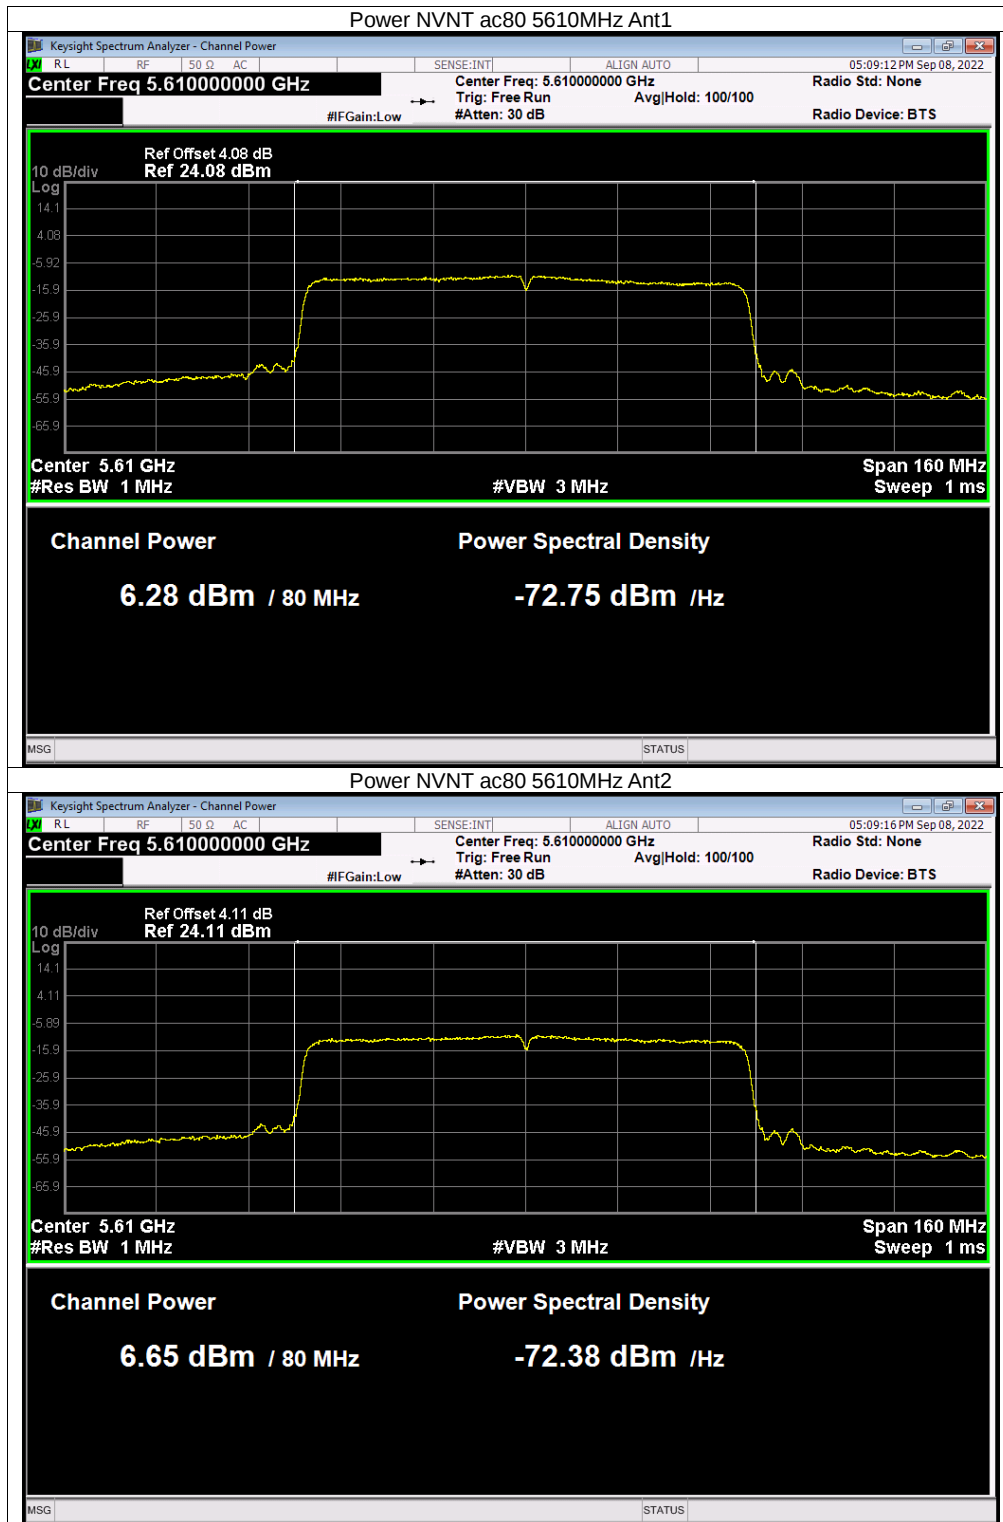


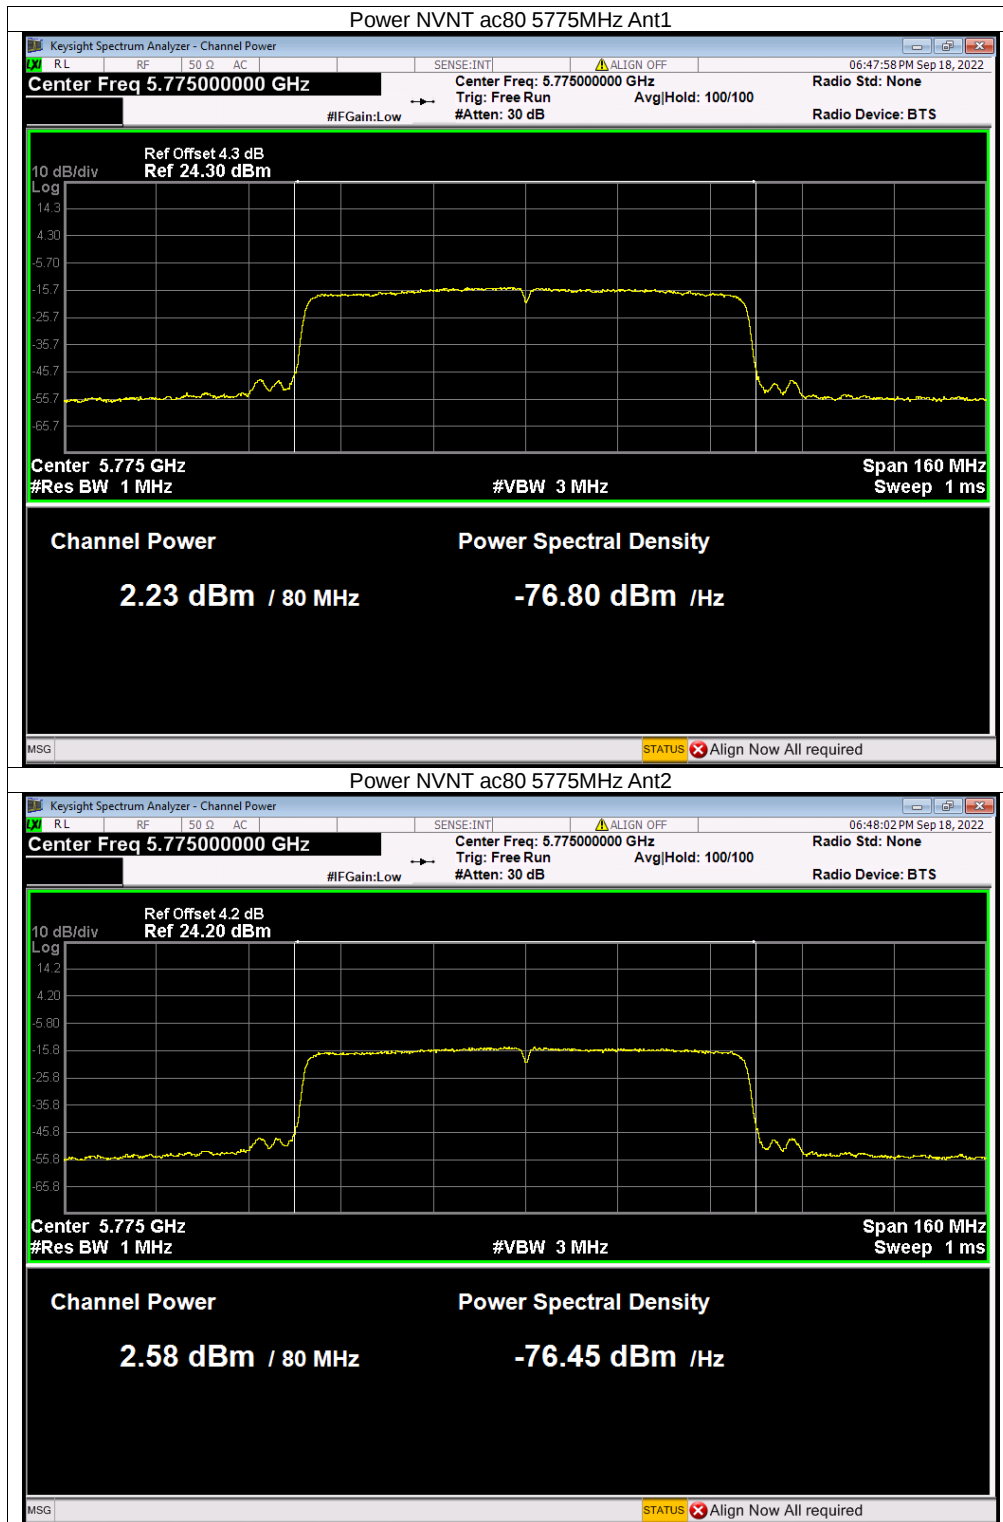


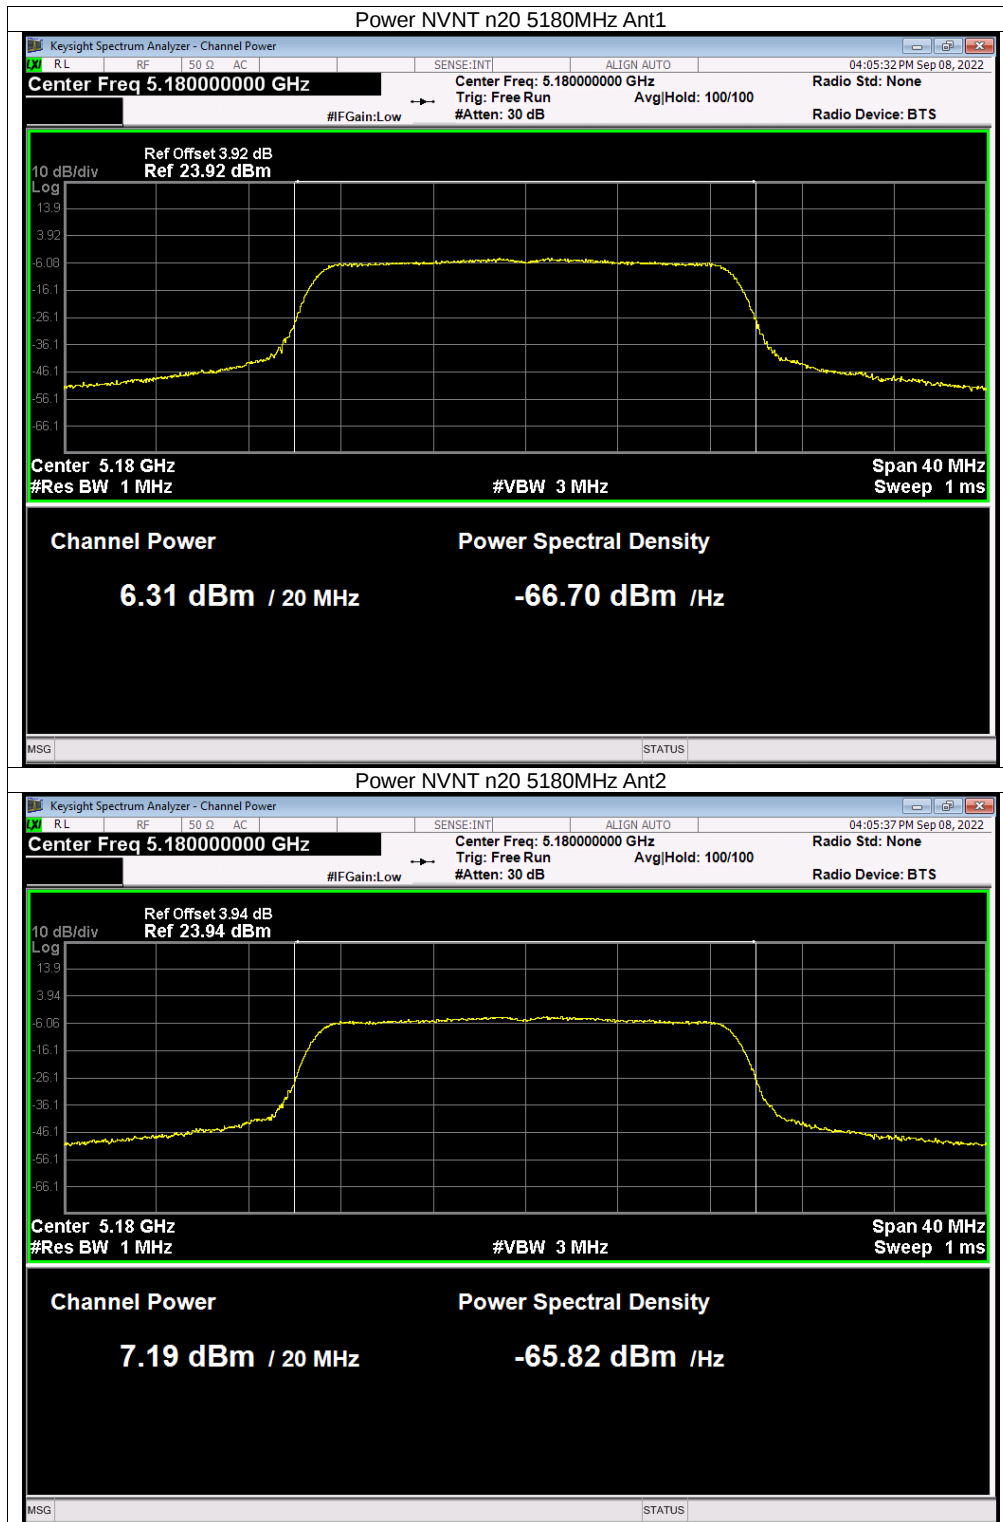





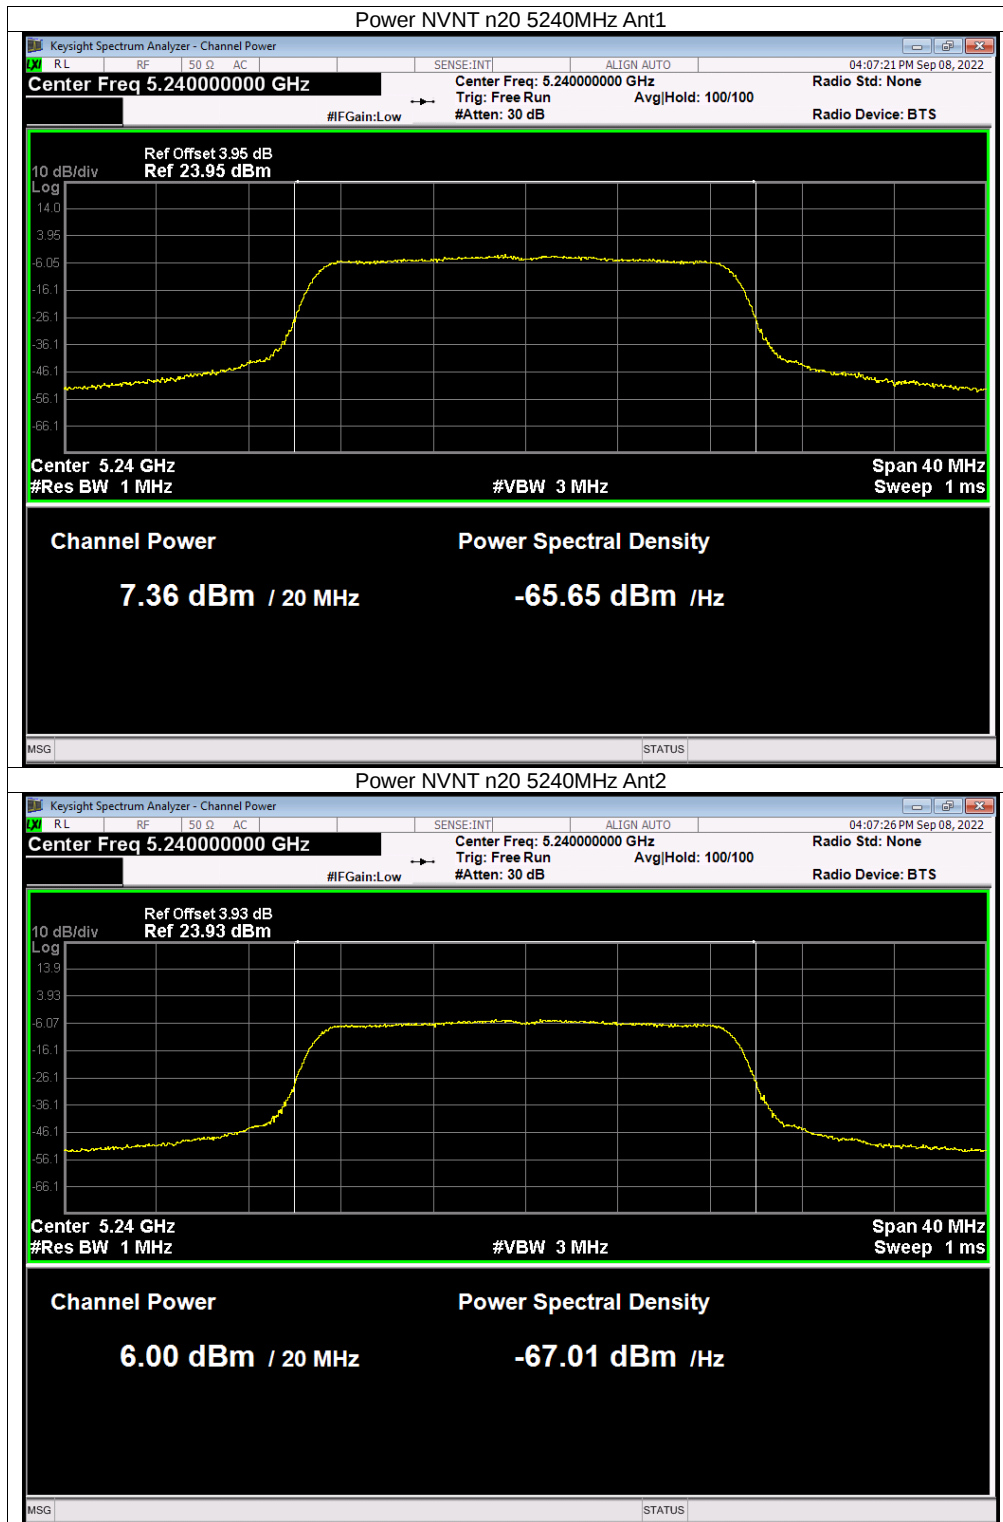

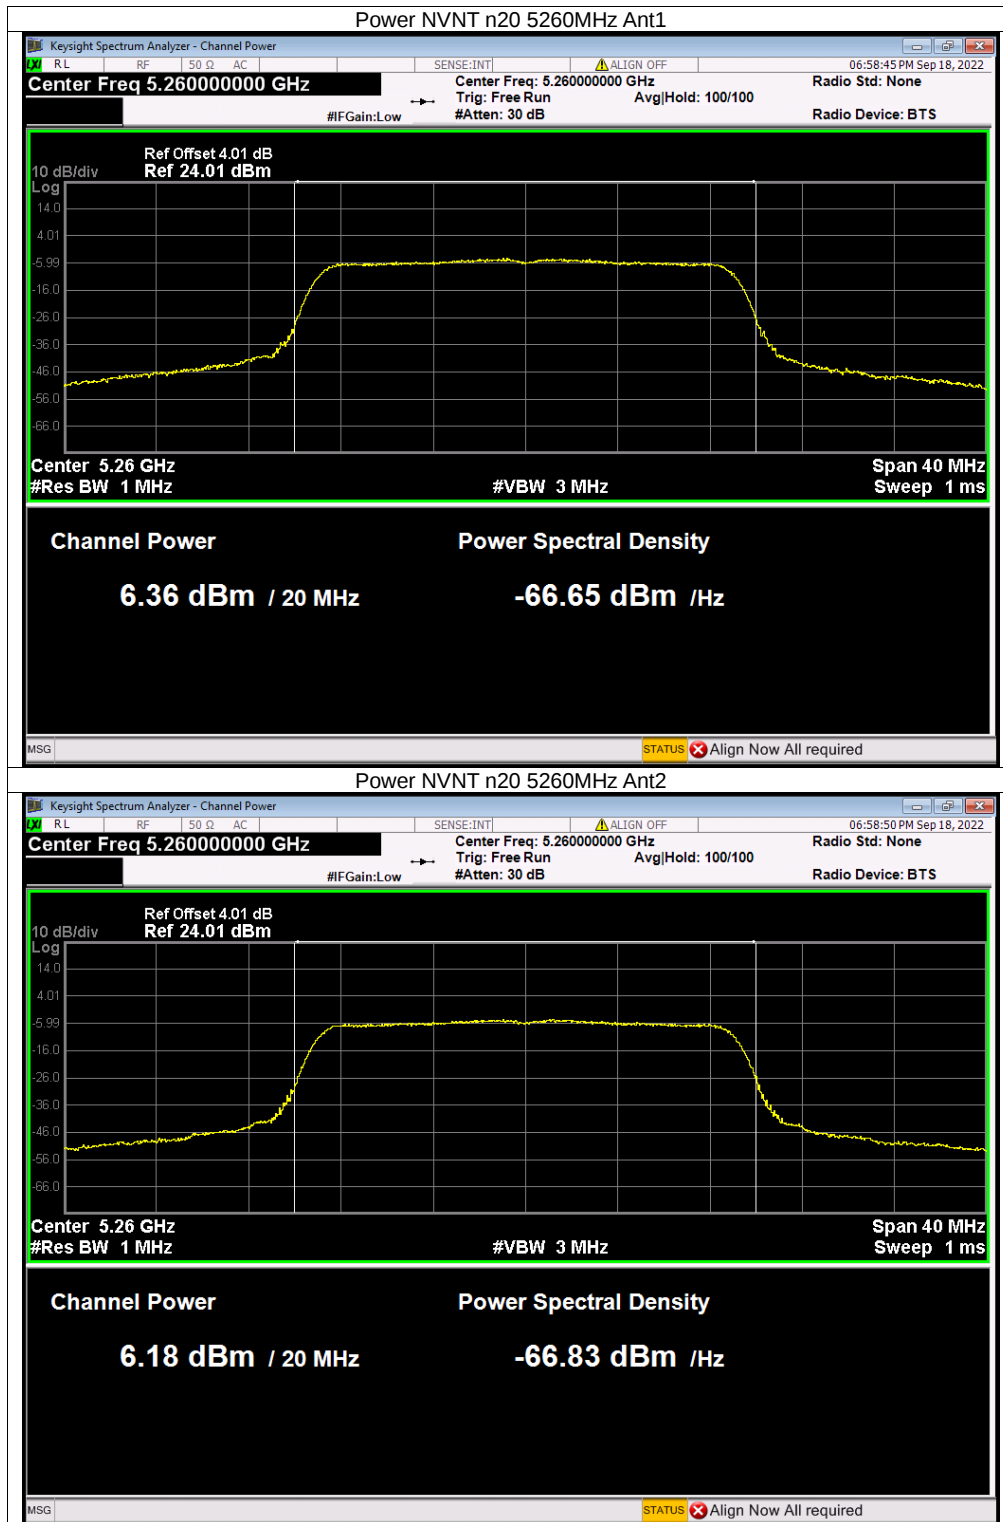


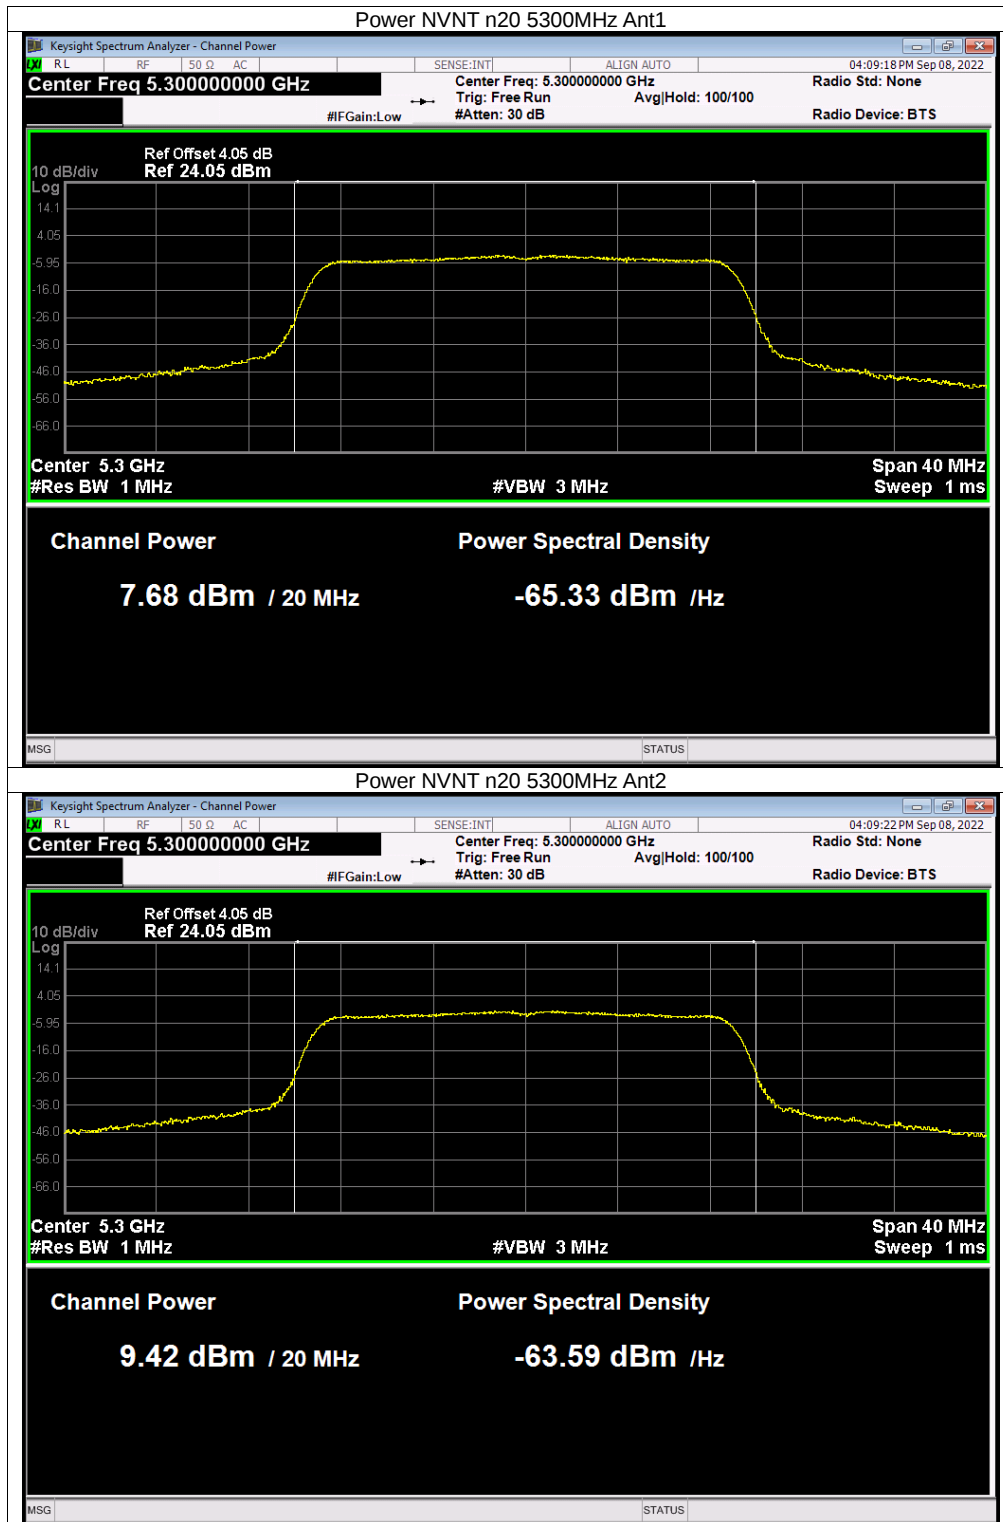

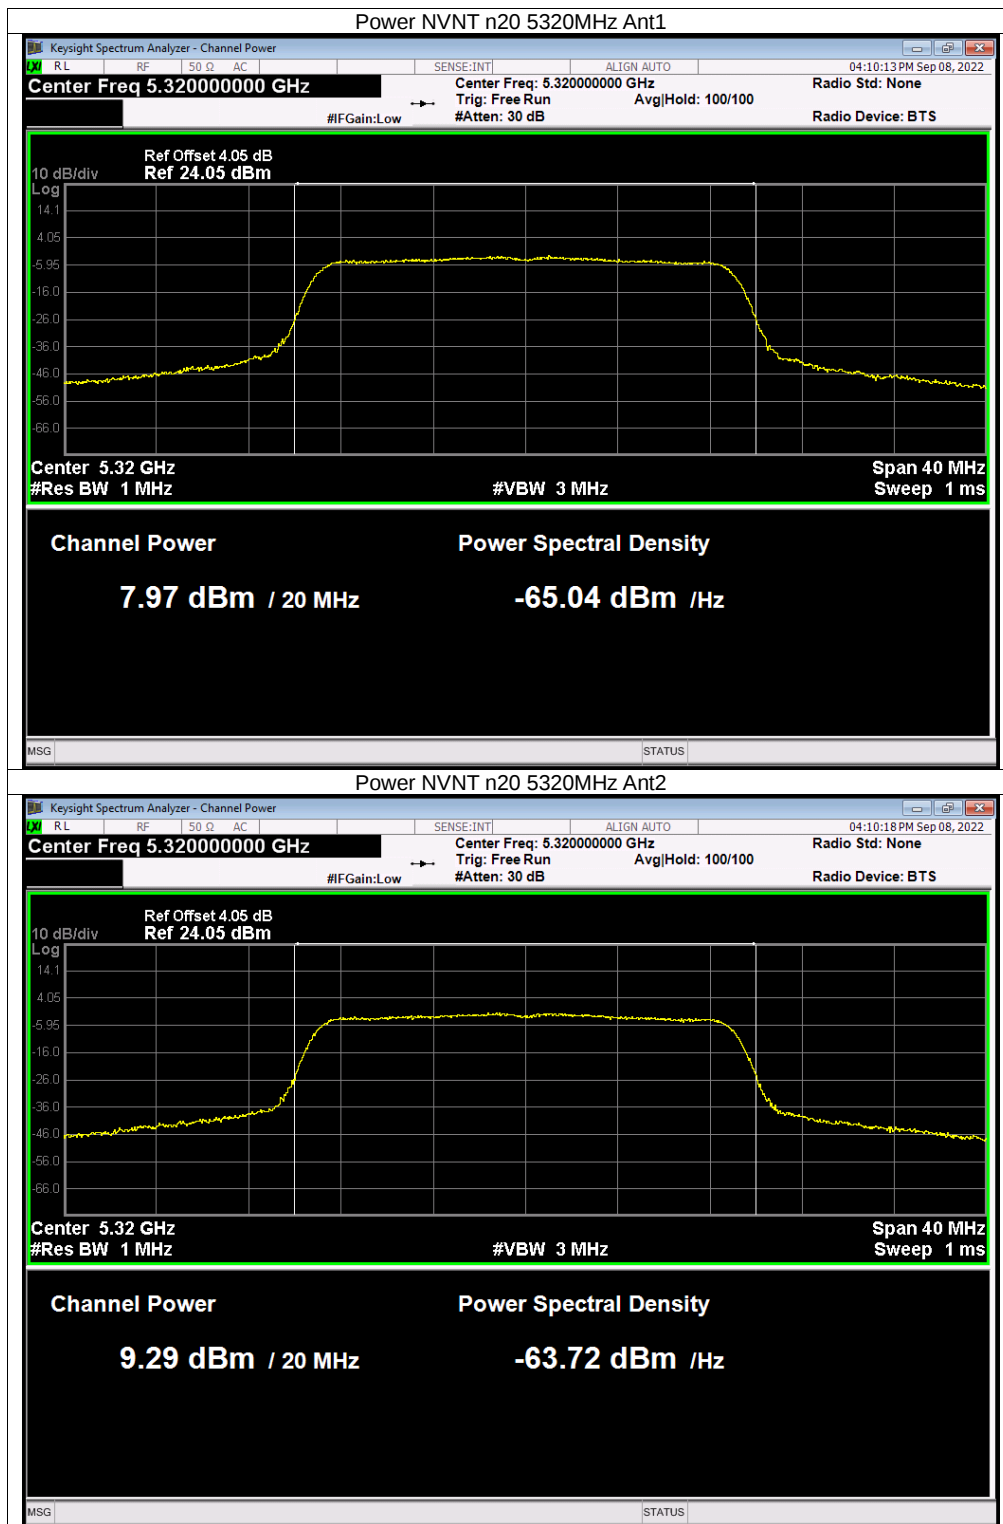


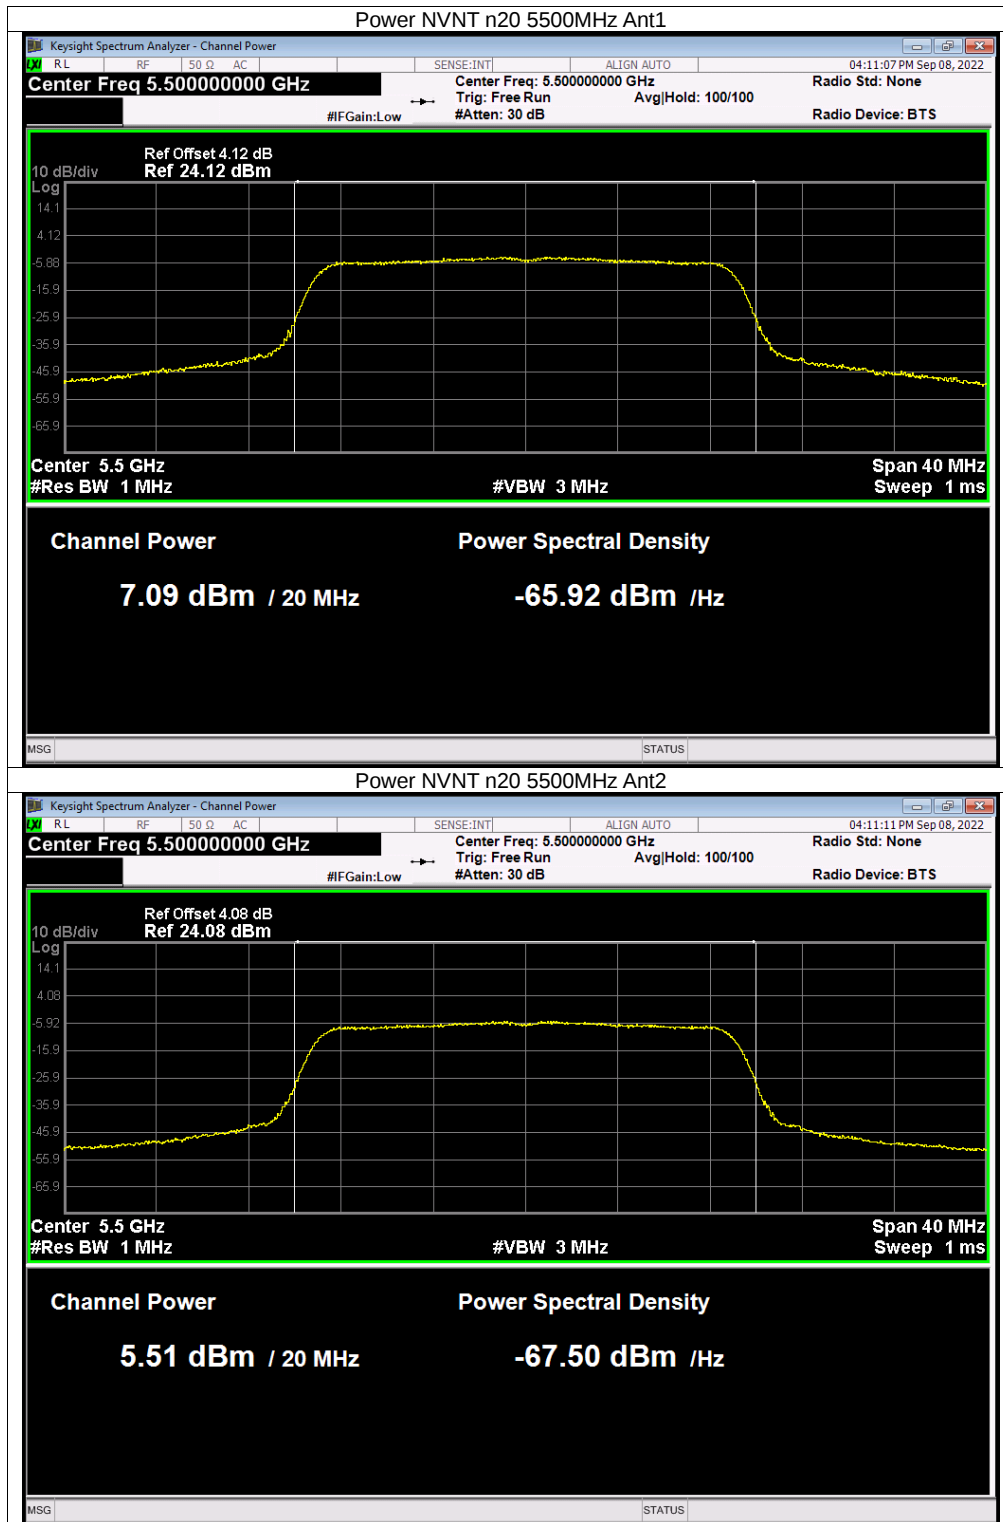





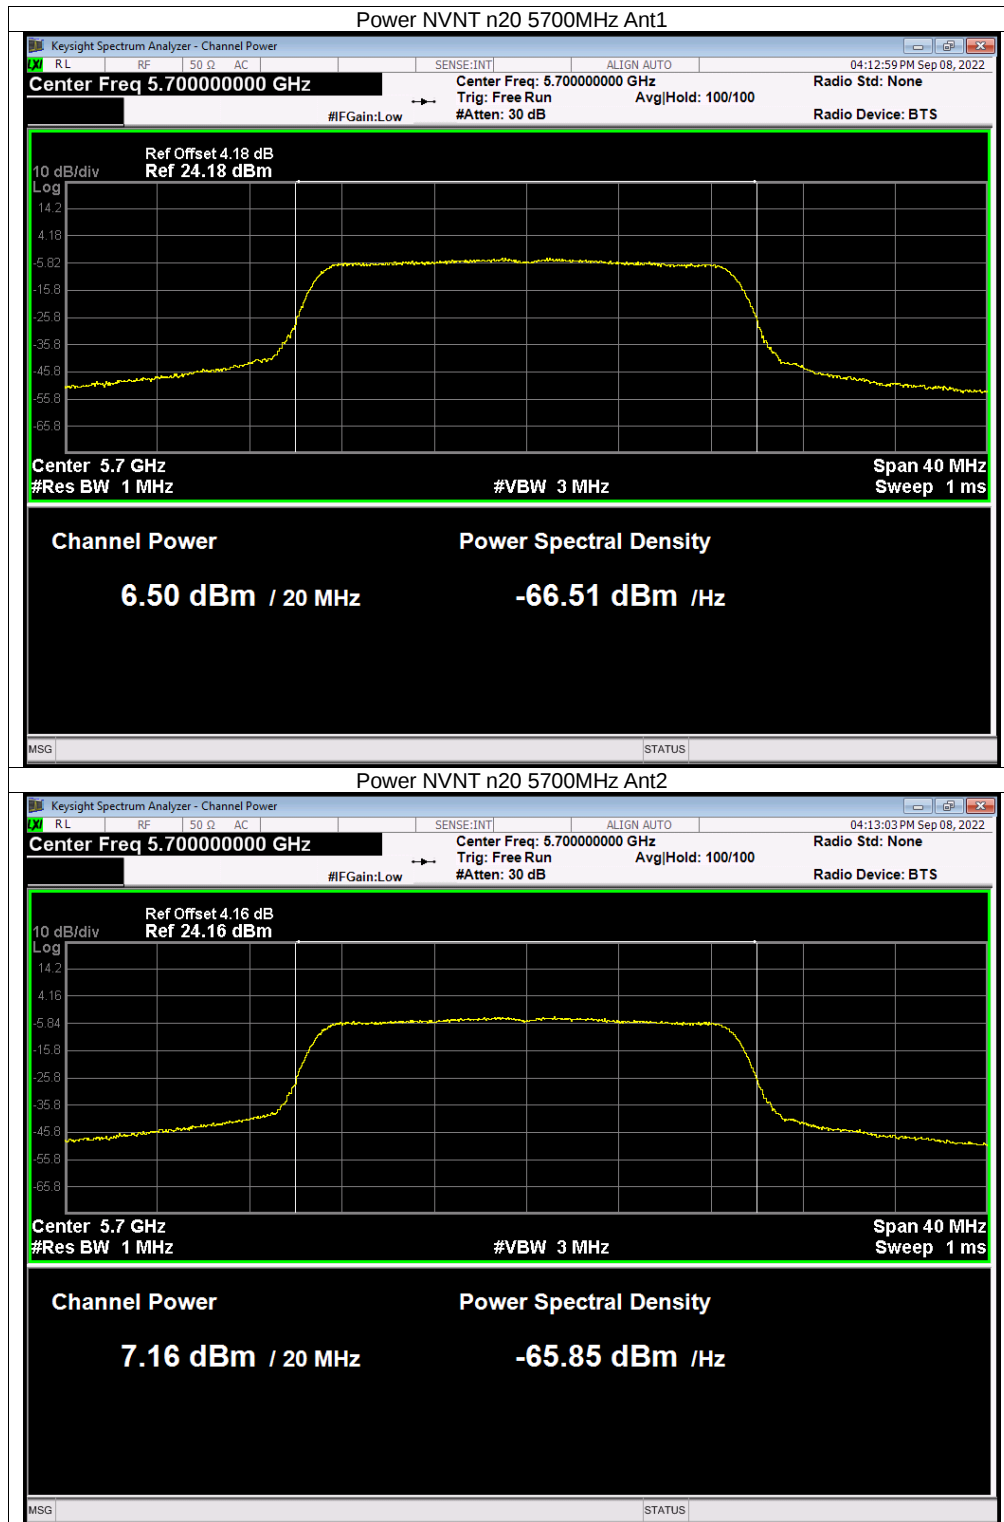





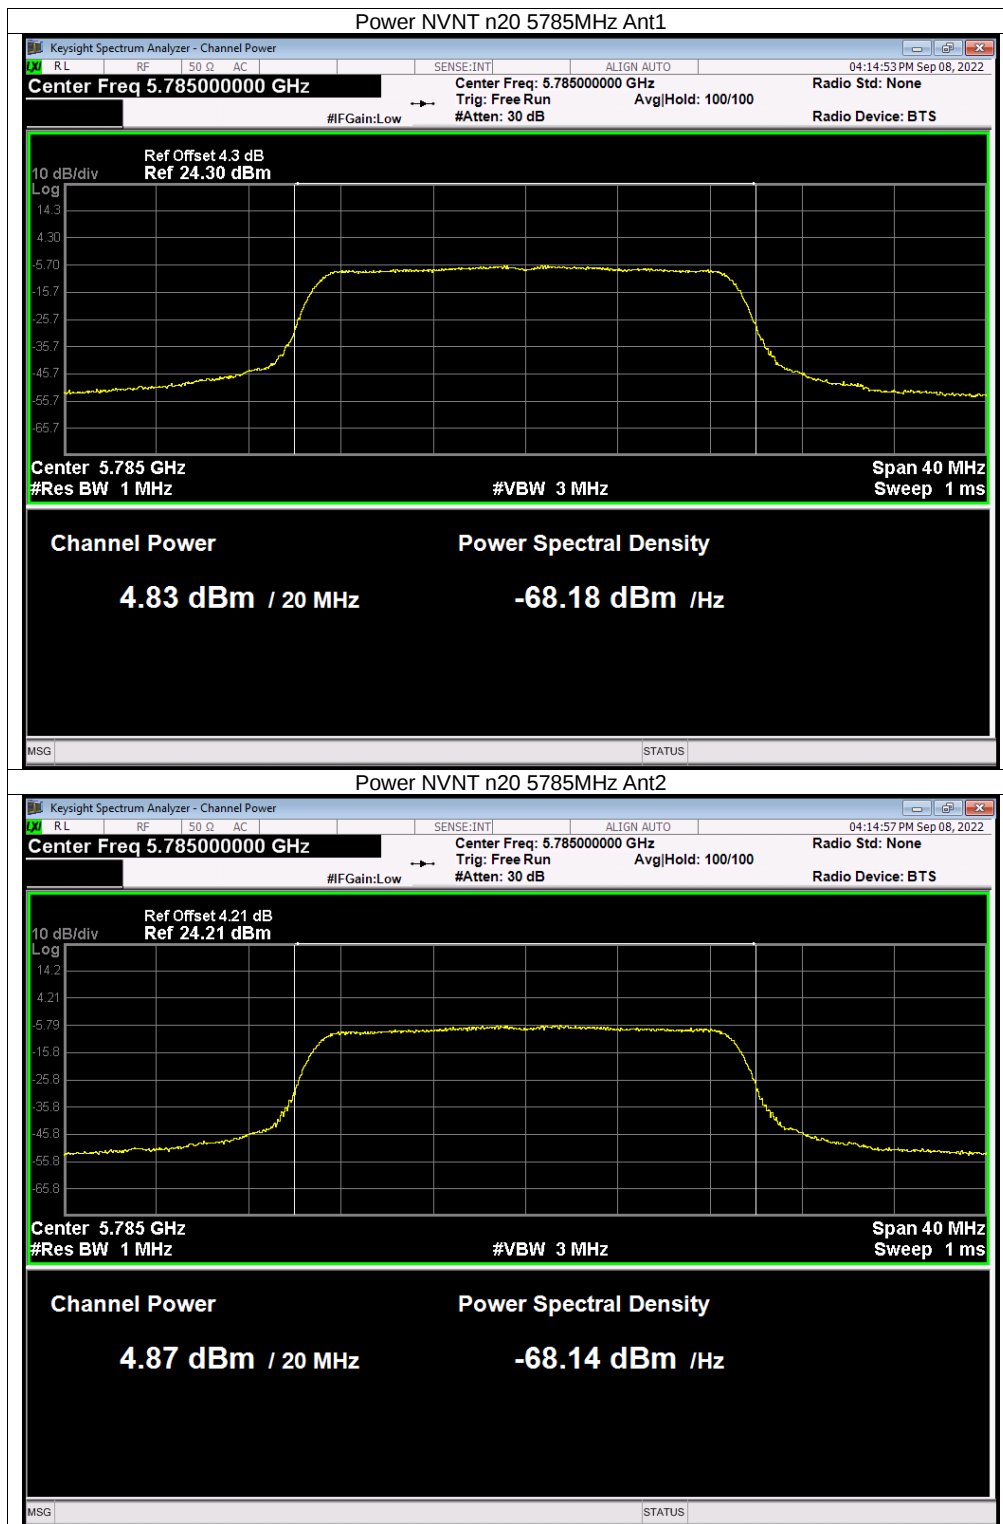


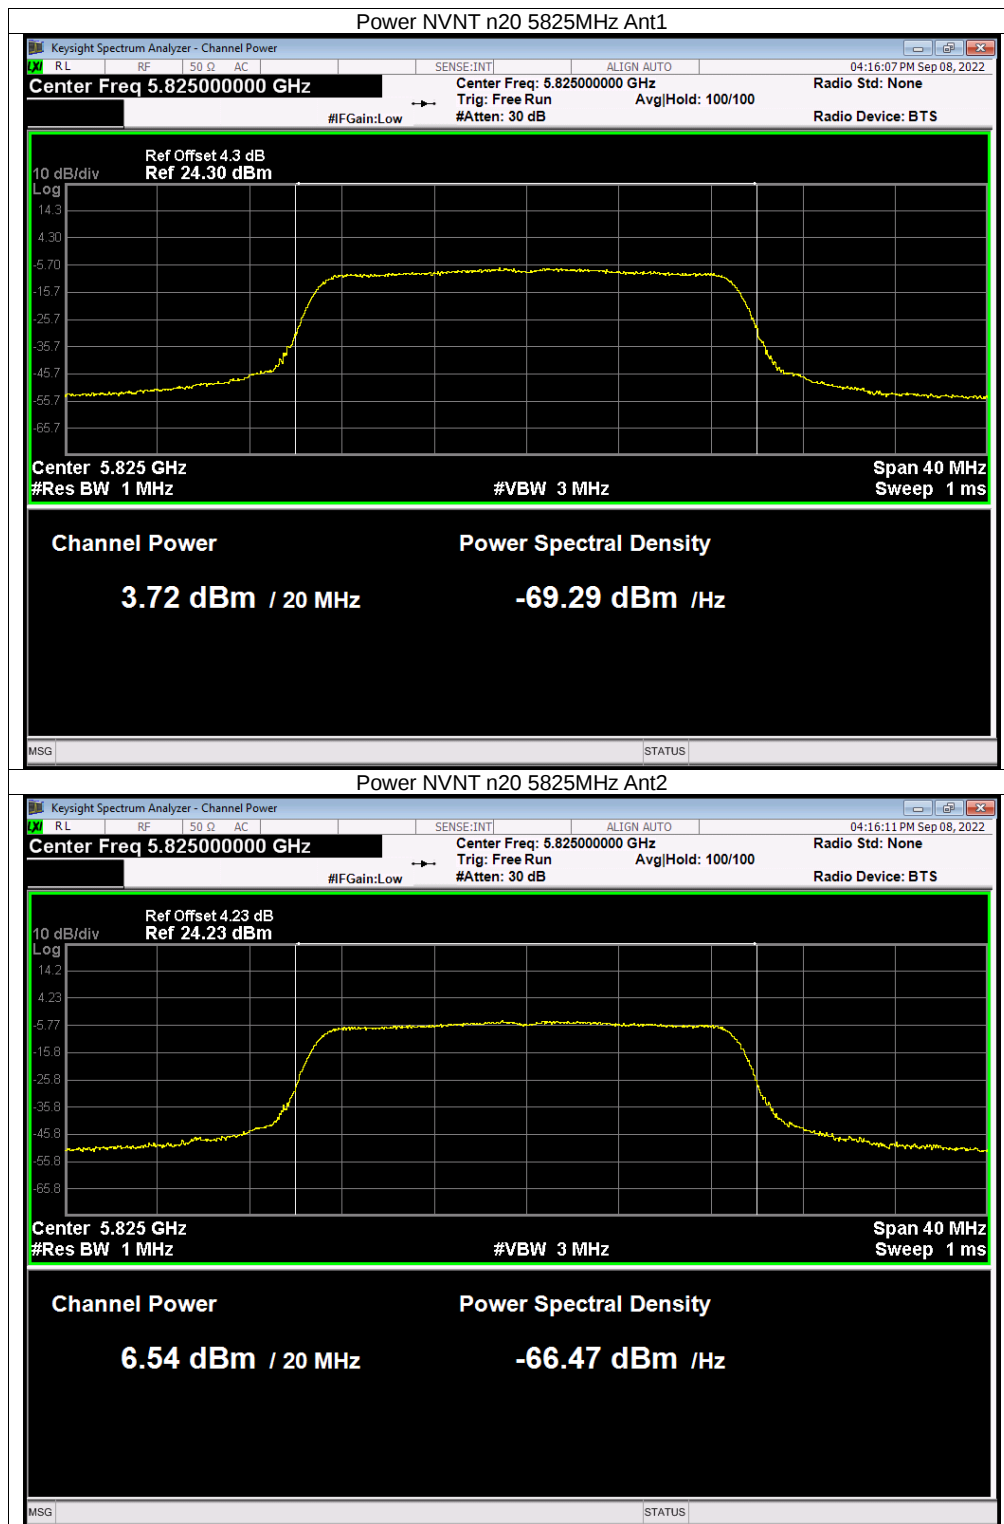

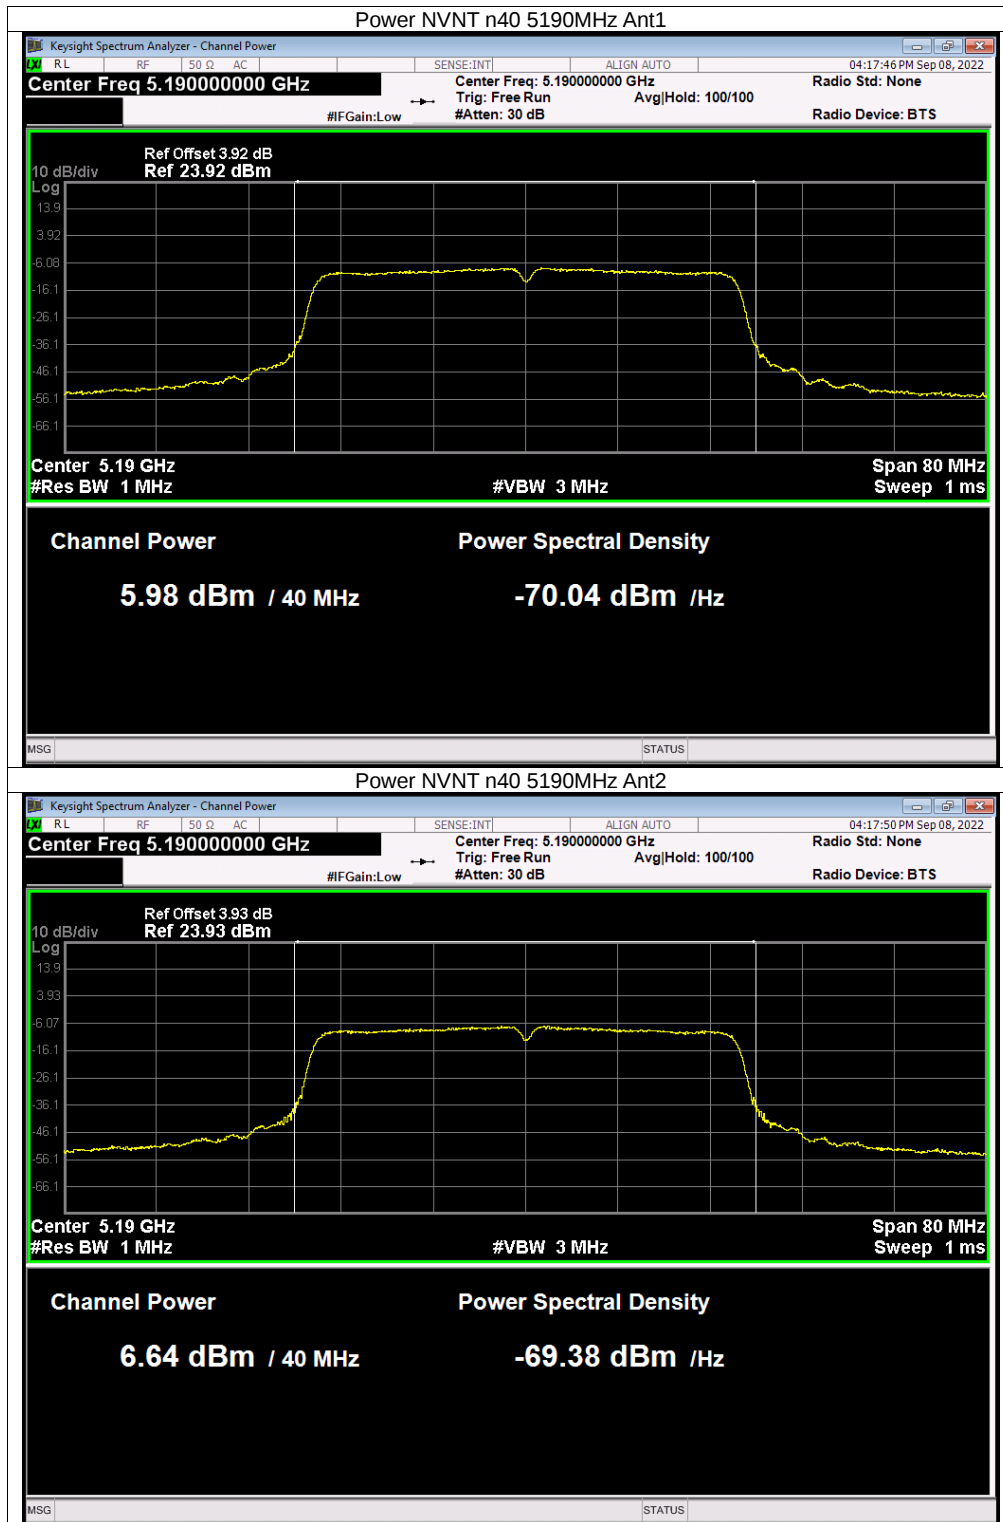


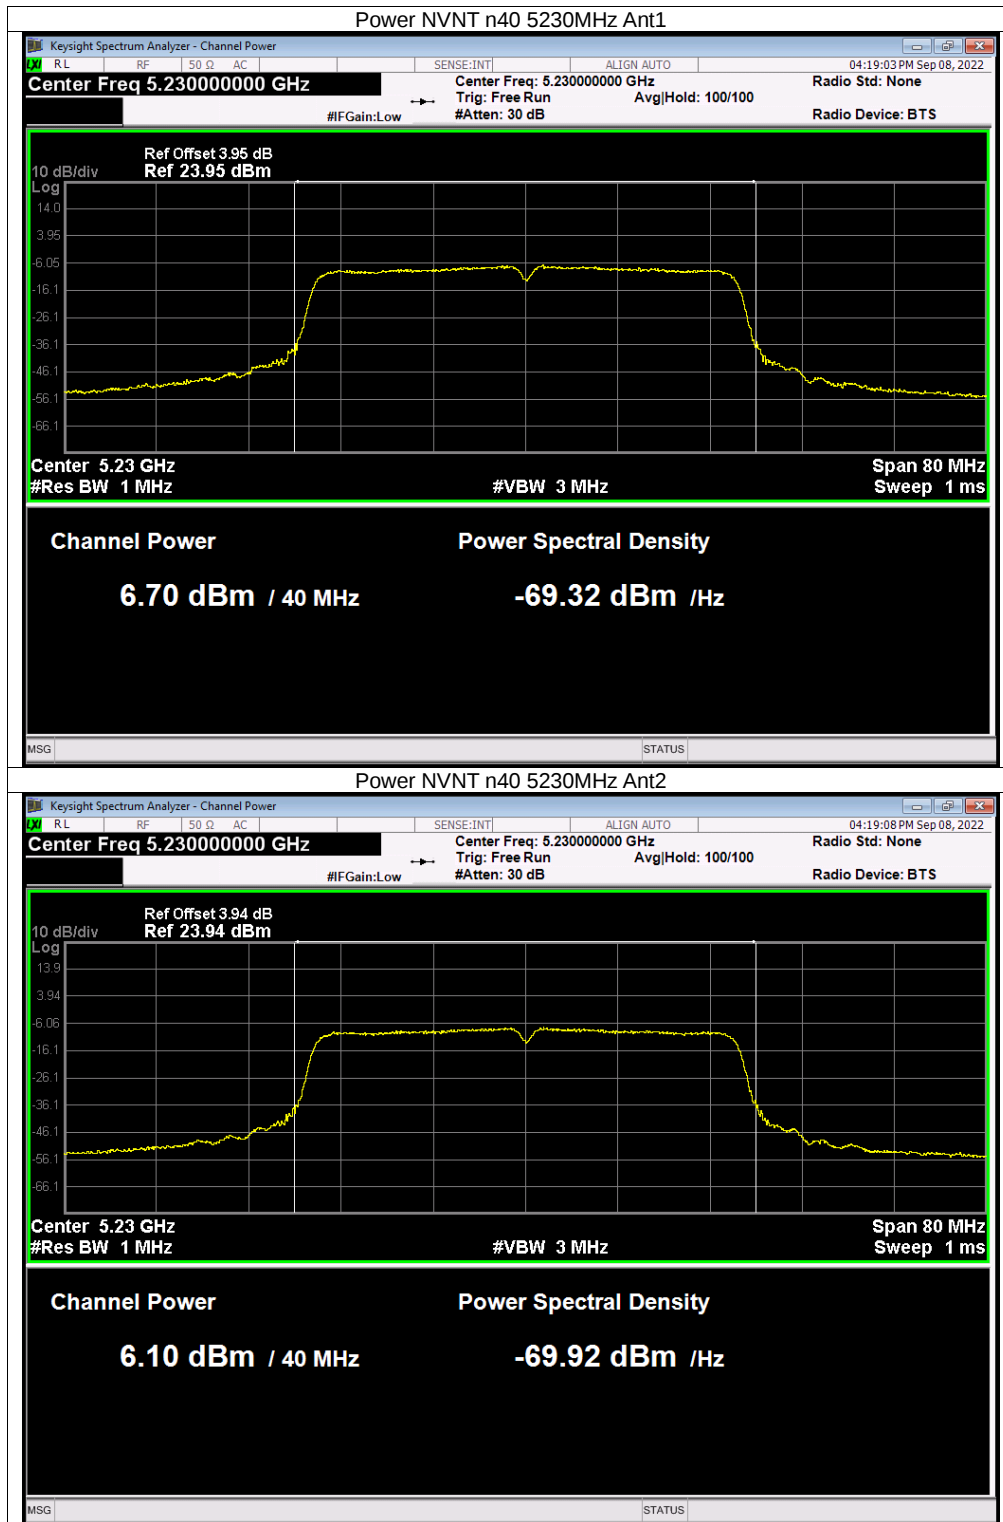


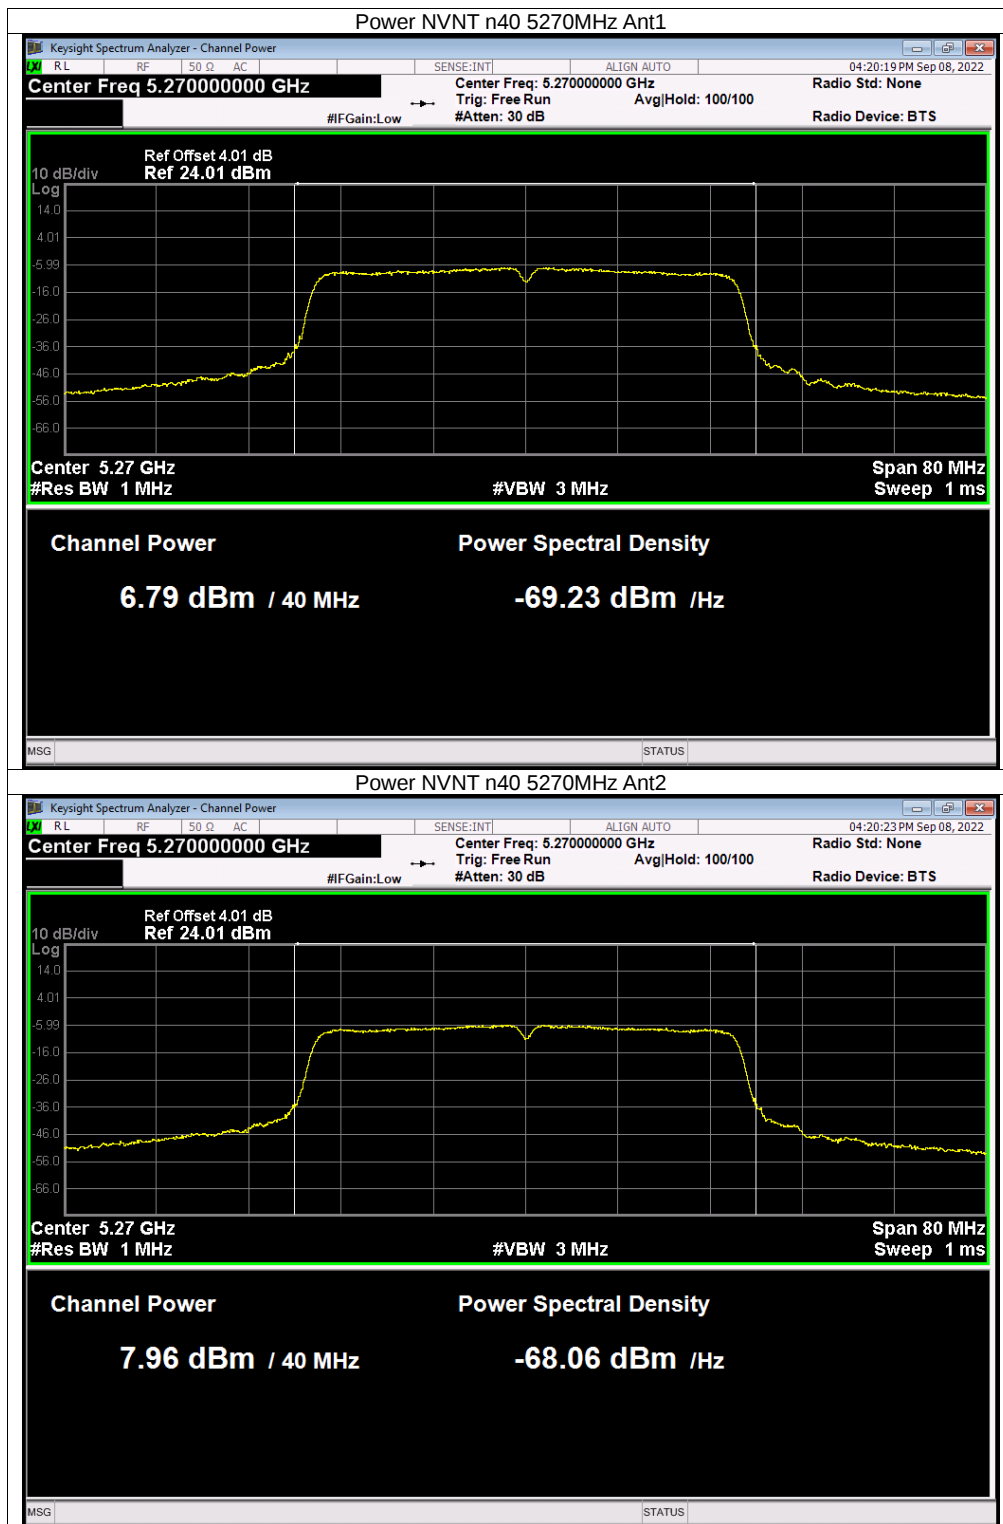

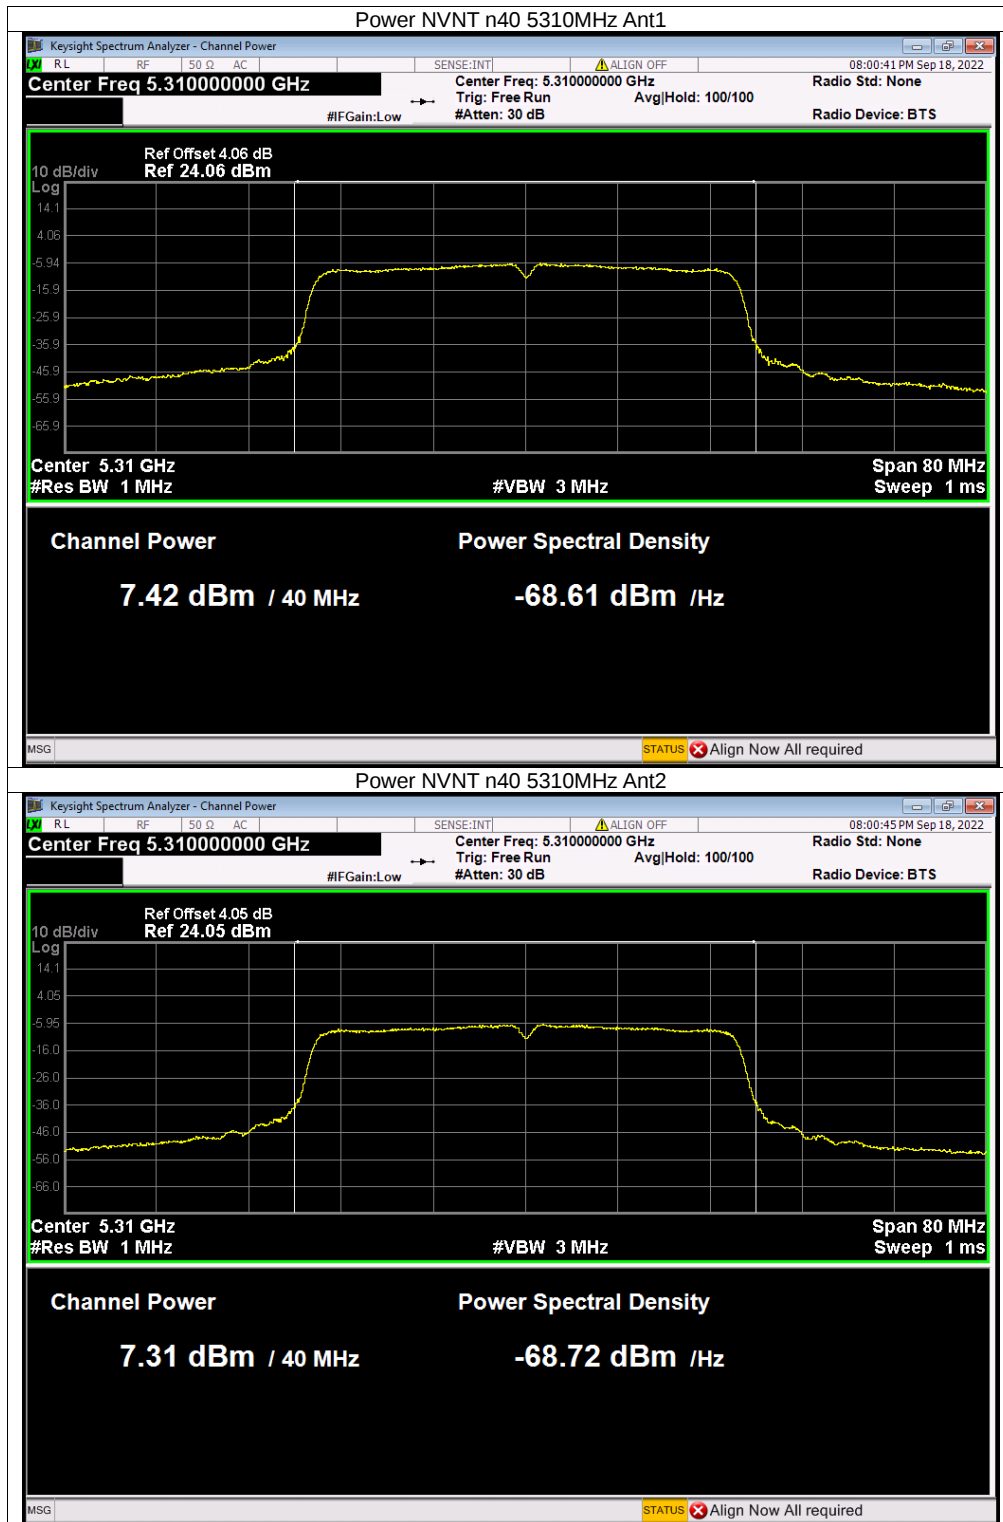




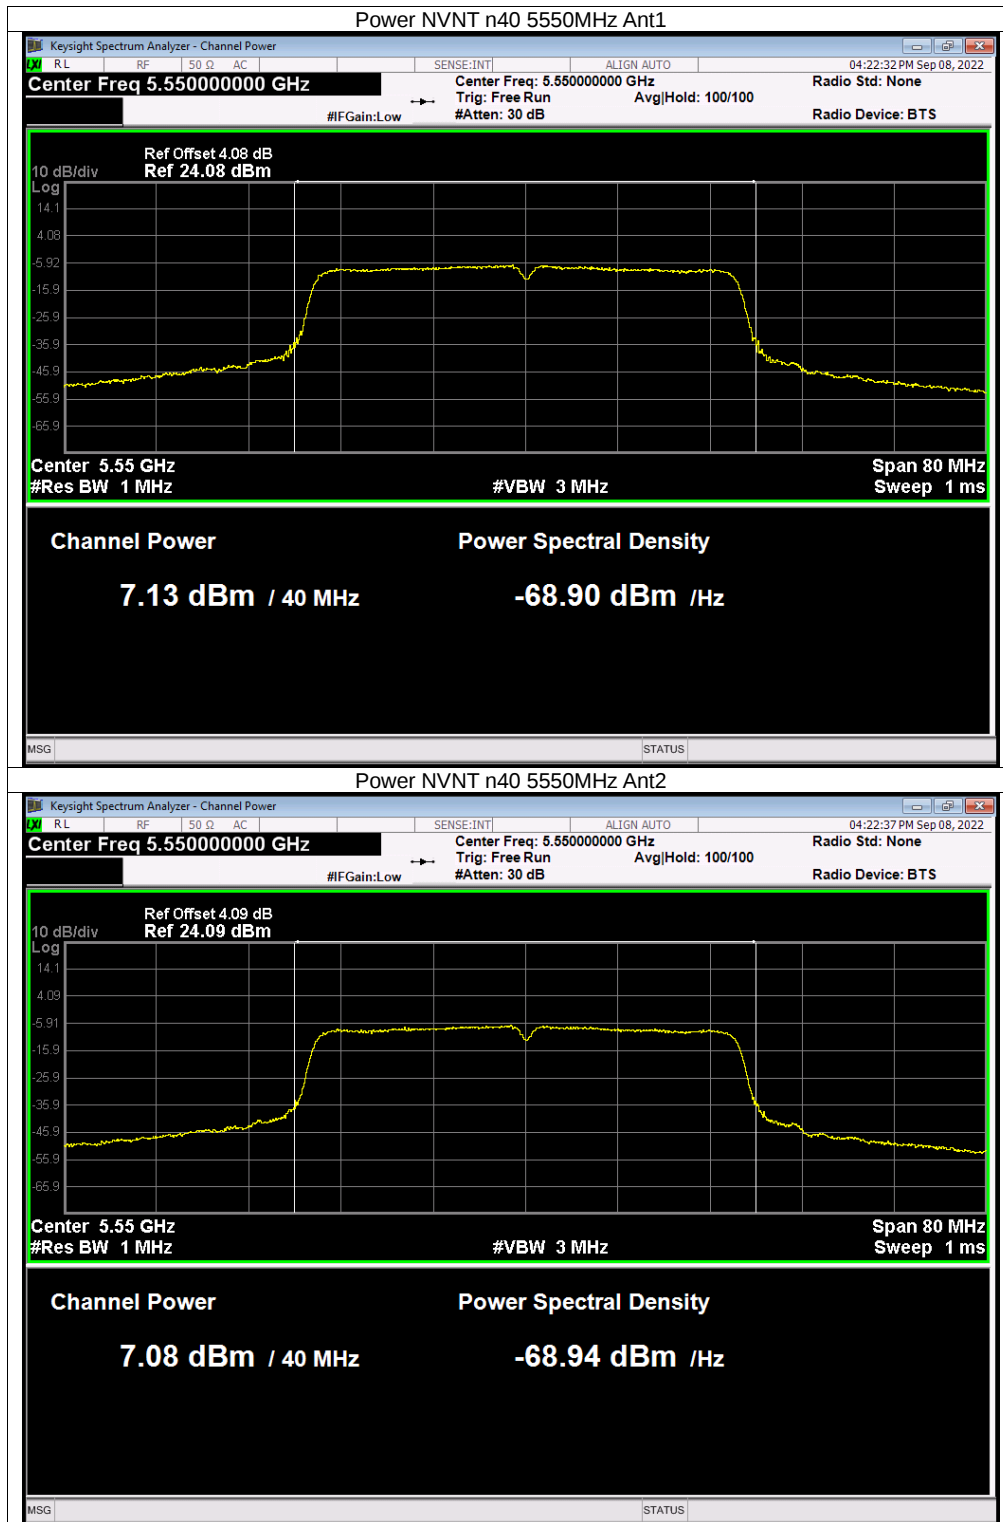

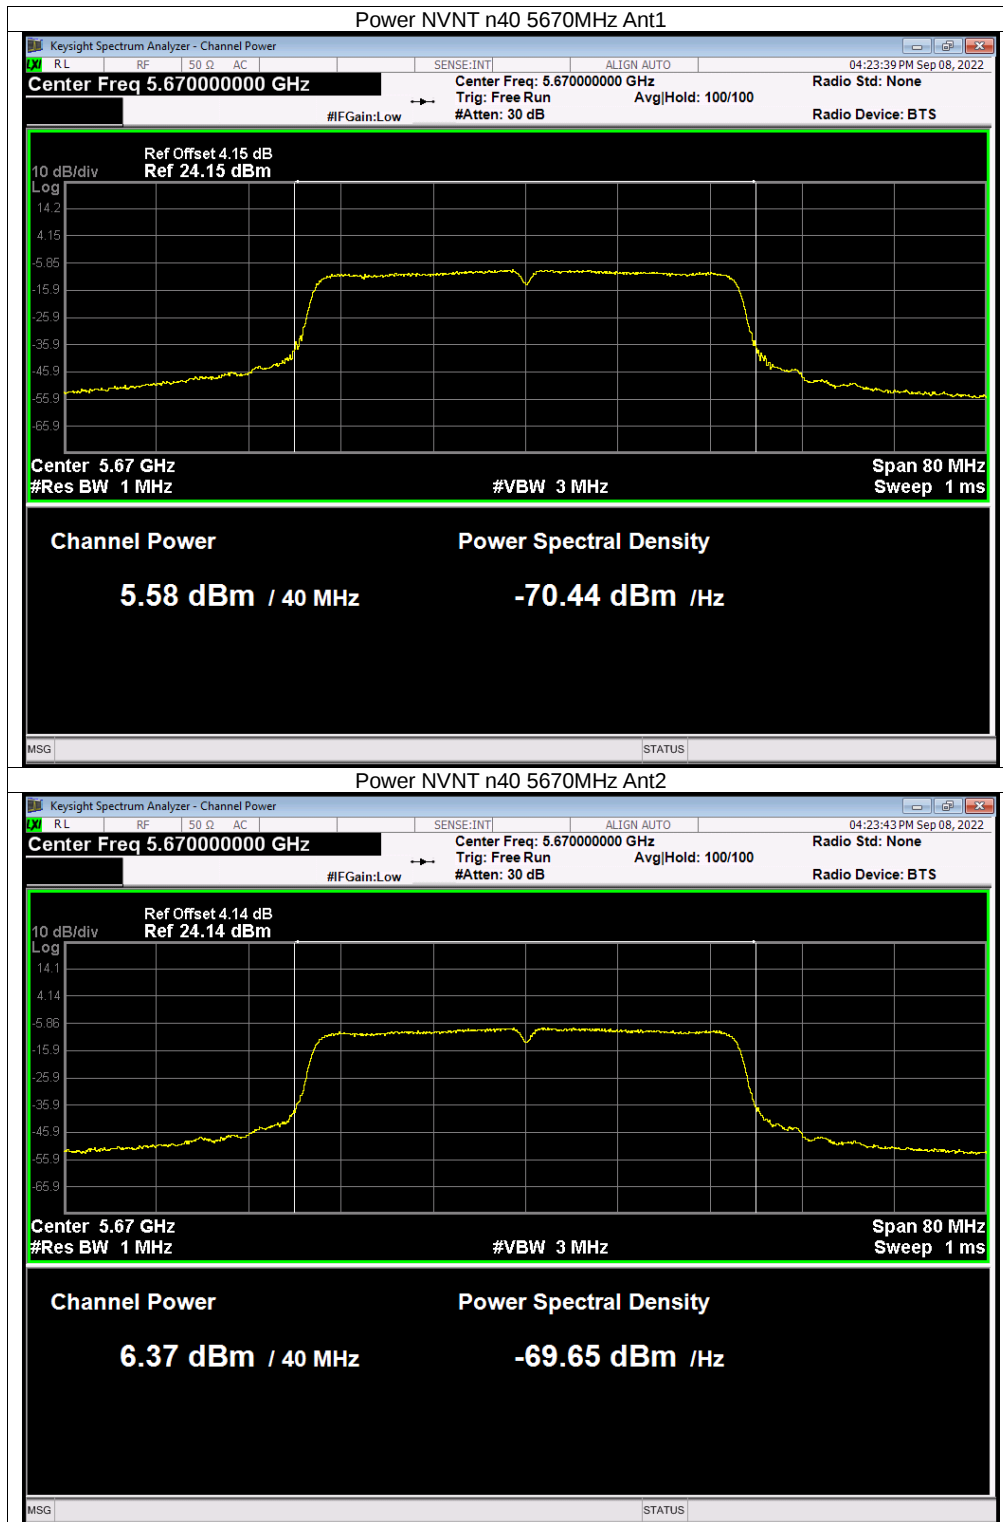



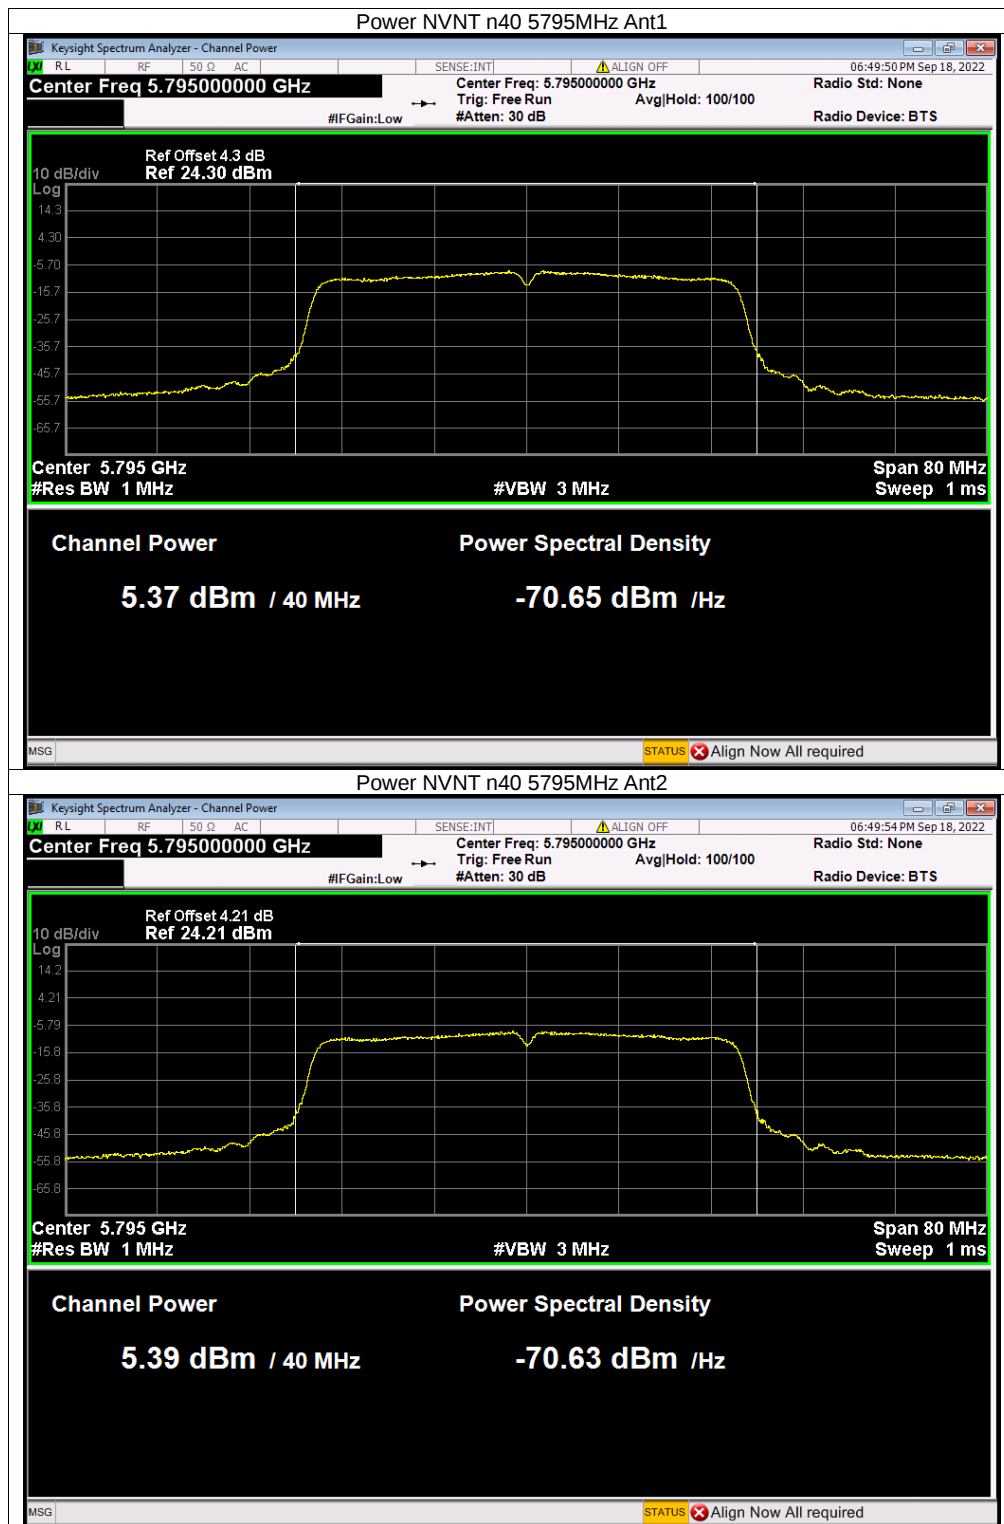



MAXIMUM POWER SPECTRAL DENSITY LEVEL

Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm)	Duty Factor (dB)	Total PSD (dBm)	Limit (dBm)	Verdict
NVNT	a	5180	Ant1	-5.64	0	-5.64	11	Pass
NVNT	a	5200	Ant1	-6.59	0	-6.59	11	Pass
NVNT	a	5240	Ant1	-5.31	0	-5.31	11	Pass
NVNT	a	5260	Ant1	-4.92	0	-4.92	11	Pass
NVNT	a	5300	Ant1	-4.85	0	-4.85	11	Pass
NVNT	a	5320	Ant1	-4.6	0	-4.6	11	Pass
NVNT	a	5500	Ant1	-4.78	0	-4.78	11	Pass
NVNT	a	5580	Ant1	-4.77	0	-4.77	11	Pass
NVNT	a	5700	Ant1	-4.81	0	-4.81	11	Pass
NVNT	a	5745	Ant1	-8.65	0	-8.65	30	Pass
NVNT	a	5785	Ant1	-8.22	0	-8.22	30	Pass
NVNT	a	5825	Ant1	-8.43	0	-8.43	30	Pass
NVNT	a	5180	Ant2	-5.33	0	-5.33	11	Pass
NVNT	a	5200	Ant2	-5.06	0	-5.06	11	Pass
NVNT	a	5240	Ant2	-5.1	0	-5.1	11	Pass
NVNT	a	5260	Ant2	-4.76	0	-4.76	11	Pass
NVNT	a	5300	Ant2	-4.44	0	-4.44	11	Pass
NVNT	a	5320	Ant2	-3.58	0	-3.58	11	Pass
NVNT	a	5500	Ant2	-4.71	0	-4.71	11	Pass
NVNT	a	5580	Ant2	-4.62	0	-4.62	11	Pass
NVNT	a	5700	Ant2	-4.47	0	-4.47	11	Pass
NVNT	a	5745	Ant2	-7.71	0	-7.71	30	Pass
NVNT	a	5785	Ant2	-7.84	0	-7.84	30	Pass
NVNT	a	5825	Ant2	-8.82	0	-8.82	30	Pass
NVNT	ac20	5180	Ant1	-5.59	0	-5.59	11	Pass
NVNT	ac20	5180	Ant2	-3.87	0	-3.87	11	Pass
NVNT	ac20	5180	Sum	-1.64	0	-1.64	8.99	Pass
NVNT	ac20	5200	Ant1	-5.04	0	-5.04	11	Pass
NVNT	ac20	5200	Ant2	-5.38	0	-5.38	11	Pass
NVNT	ac20	5200	Sum	-2.2	0	-2.2	8.99	Pass
NVNT	ac20	5240	Ant1	-4.95	0	-4.95	11	Pass
NVNT	ac20	5240	Ant2	-5.55	0	-5.55	11	Pass
NVNT	ac20	5240	Sum	-2.23	0	-2.23	8.99	Pass
NVNT	ac20	5260	Ant1	-4.45	0	-4.45	11	Pass
NVNT	ac20	5260	Ant2	-4.13	0	-4.13	11	Pass
NVNT	ac20	5260	Sum	-1.28	0	-1.28	8.99	Pass
NVNT	ac20	5300	Ant1	-4.99	0	-4.99	11	Pass
NVNT	ac20	5300	Ant2	-2.98	0	-2.98	11	Pass
NVNT	ac20	5300	Sum	-0.86	0	-0.86	8.99	Pass
NVNT	ac20	5320	Ant1	-4.34	0	-4.34	11	Pass
NVNT	ac20	5320	Ant2	-2.51	0	-2.51	11	Pass
NVNT	ac20	5320	Sum	-0.32	0	-0.32	8.99	Pass
NVNT	ac20	5500	Ant1	-4.6	0	-4.6	11	Pass
NVNT	ac20	5500	Ant2	-7.21	0	-7.21	11	Pass
NVNT	ac20	5500	Sum	-2.7	0	-2.7	8.99	Pass
NVNT	ac20	5580	Ant1	-5.06	0	-5.06	11	Pass
NVNT	ac20	5580	Ant2	-4.73	0	-4.73	11	Pass
NVNT	ac20	5580	Sum	-1.88	0	-1.88	8.99	Pass
NVNT	ac20	5700	Ant1	-6.03	0	-6.03	11	Pass
NVNT	ac20	5700	Ant2	-4.92	0	-4.92	11	Pass
NVNT	ac20	5700	Sum	-2.43	0	-2.43	8.99	Pass
NVNT	ac20	5745	Ant1	-9.42	0	-9.42	30	Pass
NVNT	ac20	5745	Ant2	-9.75	0	-9.75	30	Pass
NVNT	ac20	5745	Sum	-6.57	0	-6.57	27.99	Pass
NVNT	ac20	5785	Ant1	-9.56	0	-9.56	30	Pass
NVNT	ac20	5785	Ant2	-10.85	0	-10.85	30	Pass
NVNT	ac20	5785	Sum	-7.15	0	-7.15	27.99	Pass
NVNT	ac20	5825	Ant1	-9.22	0	-9.22	30	Pass
NVNT	ac20	5825	Ant2	-8.8	0	-8.8	30	Pass
NVNT	ac20	5825	Sum	-5.99	0	-5.99	27.99	Pass
NVNT	ac40	5190	Ant1	-8.94	0	-8.94	11	Pass
NVNT	ac40	5190	Ant2	-8.07	0	-8.07	11	Pass
NVNT	ac40	5190	Sum	-5.47	0	-5.47	8.99	Pass
NVNT	ac40	5230	Ant1	-8.08	0	-8.08	11	Pass
NVNT	ac40	5230	Ant2	-8.89	0	-8.89	11	Pass
NVNT	ac40	5230	Sum	-5.46	0	-5.46	8.99	Pass
NVNT	ac40	5270	Ant1	-7.92	0	-7.92	11	Pass
NVNT	ac40	5270	Ant2	-7.04	0	-7.04	11	Pass
NVNT	ac40	5270	Sum	-4.45	0	-4.45	8.99	Pass
NVNT	ac40	5310	Ant1	-7.2	0	-7.2	11	Pass
NVNT	ac40	5310	Ant2	-8.29	0	-8.29	11	Pass



NVNT	ac40	5310	Sum	-4.7	0	-4.7	8.99	Pass
NVNT	ac40	5510	Ant1	-7.77	0	-7.77	11	Pass
NVNT	ac40	5510	Ant2	-9.63	0	-9.63	11	Pass
NVNT	ac40	5510	Sum	-5.59	0	-5.59	8.99	Pass
NVNT	ac40	5550	Ant1	-8.06	0	-8.06	11	Pass
NVNT	ac40	5550	Ant2	-7.9	0	-7.9	11	Pass
NVNT	ac40	5550	Sum	-4.97	0	-4.97	8.99	Pass
NVNT	ac40	5670	Ant1	-8.71	0	-8.71	11	Pass
NVNT	ac40	5670	Ant2	-9.01	0	-9.01	11	Pass
NVNT	ac40	5670	Sum	-5.85	0	-5.85	8.99	Pass
NVNT	ac40	5755	Ant1	-12.02	0	-12.02	30	Pass
NVNT	ac40	5755	Ant2	-12.67	0	-12.67	30	Pass
NVNT	ac40	5755	Sum	-9.32	0	-9.32	27.99	Pass
NVNT	ac40	5795	Ant1	-13.22	0	-13.22	30	Pass
NVNT	ac40	5795	Ant2	-12.71	0	-12.71	30	Pass
NVNT	ac40	5795	Sum	-9.95	0	-9.95	27.99	Pass
NVNT	ac80	5210	Ant1	-11.32	0	-11.32	11	Pass
NVNT	ac80	5210	Ant2	-11.15	0	-11.15	11	Pass
NVNT	ac80	5210	Sum	-8.22	0	-8.22	8.99	Pass
NVNT	ac80	5290	Ant1	-10.92	0	-10.92	11	Pass
NVNT	ac80	5290	Ant2	-9.35	0	-9.35	11	Pass
NVNT	ac80	5290	Sum	-7.05	0	-7.05	8.99	Pass
NVNT	ac80	5530	Ant1	-10.05	0	-10.05	11	Pass
NVNT	ac80	5530	Ant2	-11.02	0	-11.02	11	Pass
NVNT	ac80	5530	Sum	-7.5	0	-7.5	8.99	Pass
NVNT	ac80	5610	Ant1	-12.34	0	-12.34	11	Pass
NVNT	ac80	5610	Ant2	-12.22	0	-12.22	11	Pass
NVNT	ac80	5610	Sum	-9.27	0	-9.27	8.99	Pass
NVNT	ac80	5775	Ant1	-16.2	0	-16.2	30	Pass
NVNT	ac80	5775	Ant2	-16.14	0	-16.14	30	Pass
NVNT	ac80	5775	Sum	-13.16	0	-13.16	27.99	Pass
NVNT	n20	5180	Ant1	-6.21	0	-6.21	11	Pass
NVNT	n20	5180	Ant2	-5.2	0	-5.2	11	Pass
NVNT	n20	5180	Sum	-2.67	0	-2.67	8.99	Pass
NVNT	n20	5200	Ant1	-5.74	0	-5.74	11	Pass
NVNT	n20	5200	Ant2	-5.45	0	-5.45	11	Pass
NVNT	n20	5200	Sum	-2.58	0	-2.58	8.99	Pass
NVNT	n20	5240	Ant1	-4.55	0	-4.55	11	Pass
NVNT	n20	5240	Ant2	-6.38	0	-6.38	11	Pass
NVNT	n20	5240	Sum	-2.36	0	-2.36	8.99	Pass
NVNT	n20	5260	Ant1	-5.51	0	-5.51	11	Pass
NVNT	n20	5260	Ant2	-6.22	0	-6.22	11	Pass
NVNT	n20	5260	Sum	-2.84	0	-2.84	8.99	Pass
NVNT	n20	5300	Ant1	-4.52	0	-4.52	11	Pass
NVNT	n20	5300	Ant2	-2.99	0	-2.99	11	Pass
NVNT	n20	5300	Sum	-0.68	0	-0.68	8.99	Pass
NVNT	n20	5320	Ant1	-4.31	0	-4.31	11	Pass
NVNT	n20	5320	Ant2	-2.85	0	-2.85	11	Pass
NVNT	n20	5320	Sum	-0.51	0	-0.51	8.99	Pass
NVNT	n20	5500	Ant1	-5.22	0	-5.22	11	Pass
NVNT	n20	5500	Ant2	-6.93	0	-6.93	11	Pass
NVNT	n20	5500	Sum	-2.98	0	-2.98	8.99	Pass
NVNT	n20	5580	Ant1	-5.65	0	-5.65	11	Pass
NVNT	n20	5580	Ant2	-4.88	0	-4.88	11	Pass
NVNT	n20	5580	Sum	-2.24	0	-2.24	8.99	Pass
NVNT	n20	5700	Ant1	-5.97	0	-5.97	11	Pass
NVNT	n20	5700	Ant2	-4.91	0	-4.91	11	Pass
NVNT	n20	5700	Sum	-2.4	0	-2.4	8.99	Pass
NVNT	n20	5745	Ant1	-9.15	0	-9.15	30	Pass
NVNT	n20	5745	Ant2	-8.95	0	-8.95	30	Pass
NVNT	n20	5745	Sum	-6.04	0	-6.04	27.99	Pass
NVNT	n20	5785	Ant1	-10.52	0	-10.52	30	Pass
NVNT	n20	5785	Ant2	-10.1	0	-10.1	30	Pass
NVNT	n20	5785	Sum	-7.29	0	-7.29	27.99	Pass
NVNT	n20	5825	Ant1	-11.18	0	-11.18	30	Pass
NVNT	n20	5825	Ant2	-8.55	0	-8.55	30	Pass
NVNT	n20	5825	Sum	-6.66	0	-6.66	27.99	Pass
NVNT	n40	5190	Ant1	-8.87	0	-8.87	11	Pass



NVNT	n40	5190	Ant2	-8.59	0	-8.59	11	Pass
NVNT	n40	5190	Sum	-5.72	0	-5.72	8.99	Pass
NVNT	n40	5230	Ant1	-8.4	0	-8.4	11	Pass
NVNT	n40	5230	Ant2	-8.99	0	-8.99	11	Pass
NVNT	n40	5230	Sum	-5.67	0	-5.67	8.99	Pass
NVNT	n40	5270	Ant1	-8.62	0	-8.62	11	Pass
NVNT	n40	5270	Ant2	-7.35	0	-7.35	11	Pass
NVNT	n40	5270	Sum	-4.93	0	-4.93	8.99	Pass
NVNT	n40	5310	Ant1	-7.2	0	-7.2	11	Pass
NVNT	n40	5310	Ant2	-7.88	0	-7.88	11	Pass
NVNT	n40	5310	Sum	-4.52	0	-4.52	8.99	Pass
NVNT	n40	5510	Ant1	-7.93	0	-7.93	11	Pass
NVNT	n40	5510	Ant2	-9.73	0	-9.73	11	Pass
NVNT	n40	5510	Sum	-5.73	0	-5.73	8.99	Pass
NVNT	n40	5550	Ant1	-8.09	0	-8.09	11	Pass
NVNT	n40	5550	Ant2	-8.26	0	-8.26	11	Pass
NVNT	n40	5550	Sum	-5.16	0	-5.16	8.99	Pass
NVNT	n40	5670	Ant1	-10.05	0	-10.05	11	Pass
NVNT	n40	5670	Ant2	-8.91	0	-8.91	11	Pass
NVNT	n40	5670	Sum	-6.43	0	-6.43	8.99	Pass
NVNT	n40	5755	Ant1	-13.27	0	-13.27	30	Pass
NVNT	n40	5755	Ant2	-11.96	0	-11.96	30	Pass
NVNT	n40	5755	Sum	-9.56	0	-9.56	27.99	Pass
NVNT	n40	5795	Ant1	-11.78	0	-11.78	30	Pass
NVNT	n40	5795	Ant2	-11.98	0	-11.98	30	Pass
NVNT	n40	5795	Sum	-8.87	0	-8.87	27.99	Pass

