





Restrict Band NVNT be20 5320MHz Ant1 Peak

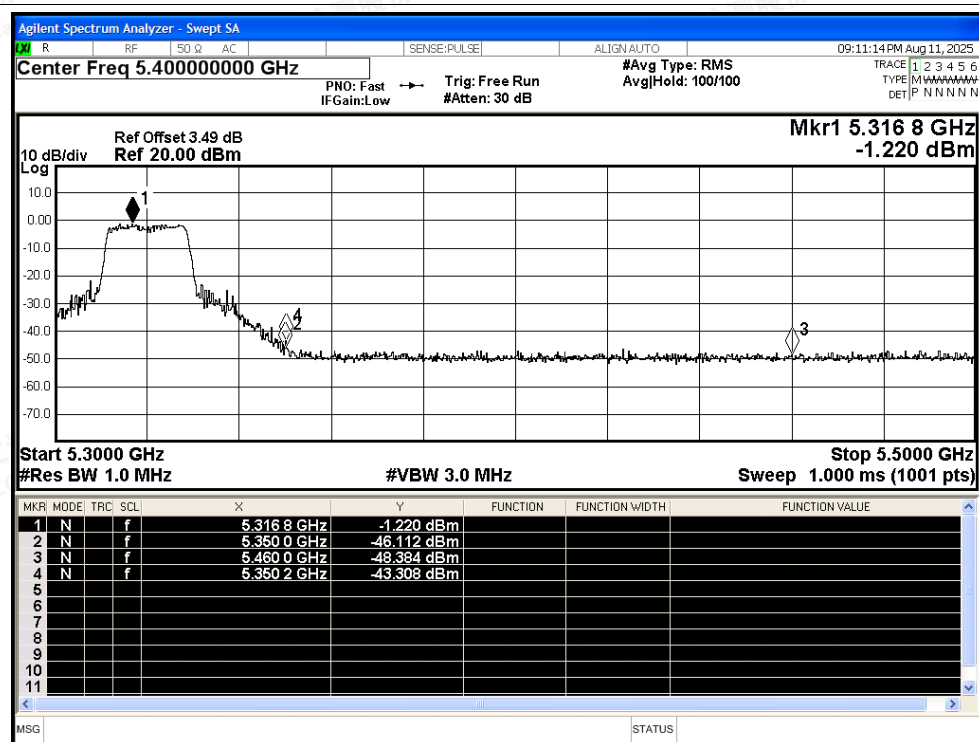

Restrict Band NVNT be20 5320MHz Ant1 Average

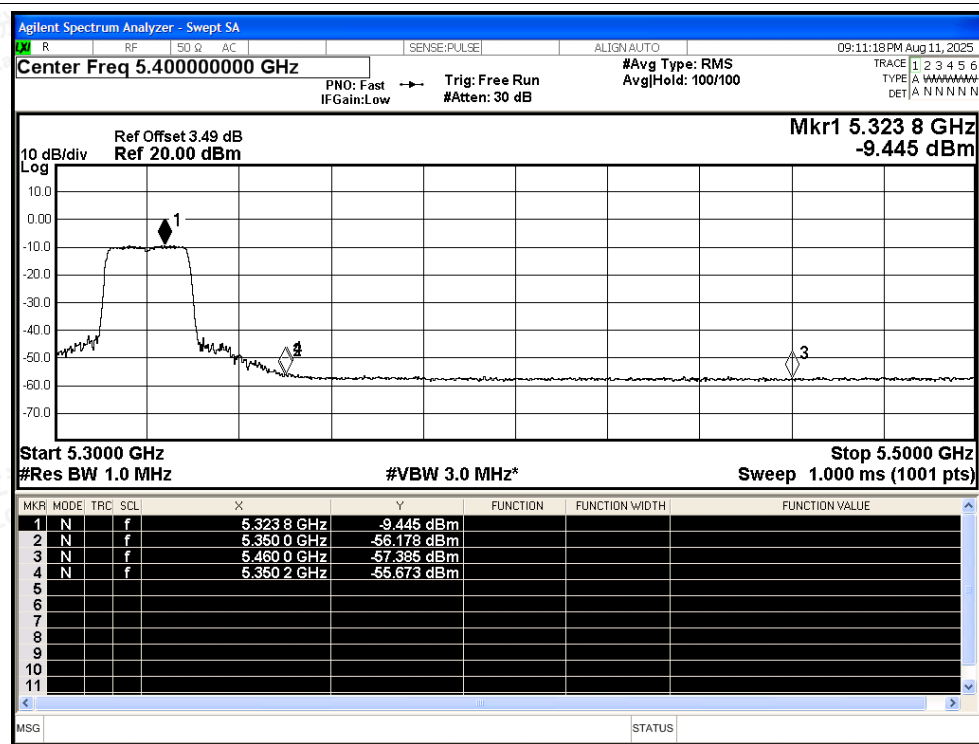

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be40 5270MHz Ant1 Peak

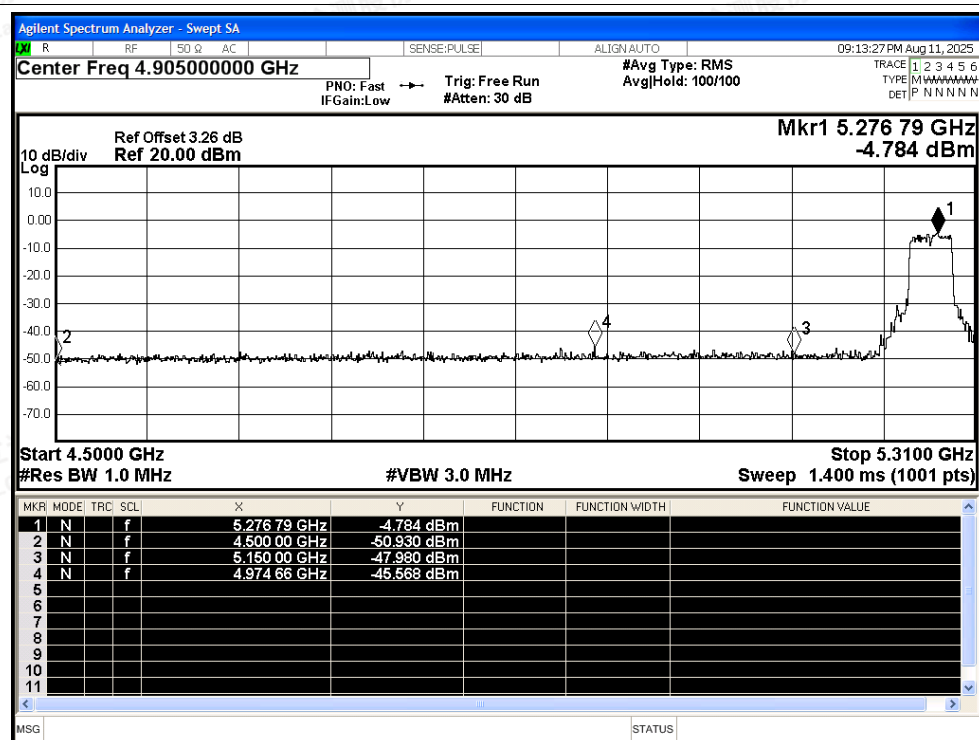

Restrict Band NVNT be40 5270MHz Ant1 Average

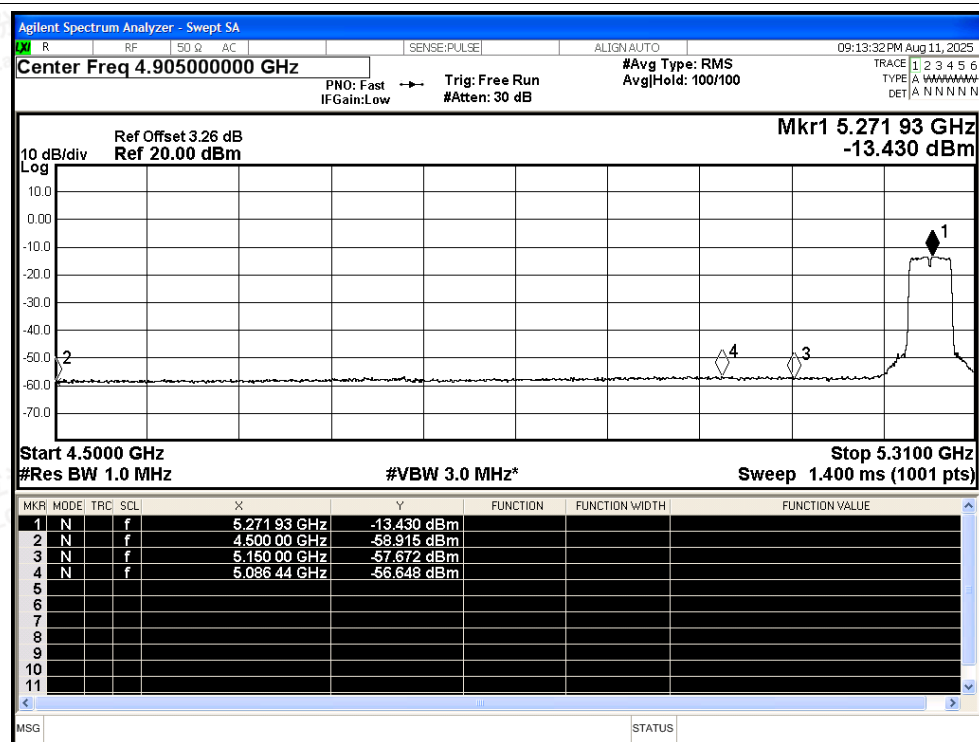

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be40 5310MHz Ant1 Peak

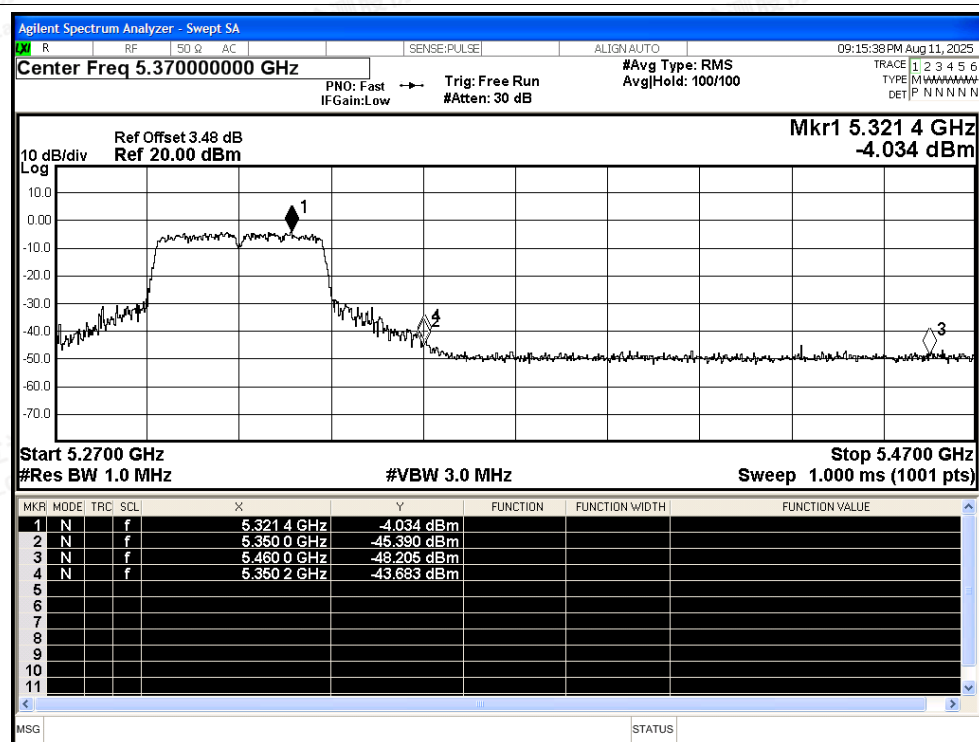

Restrict Band NVNT be40 5310MHz Ant1 Average

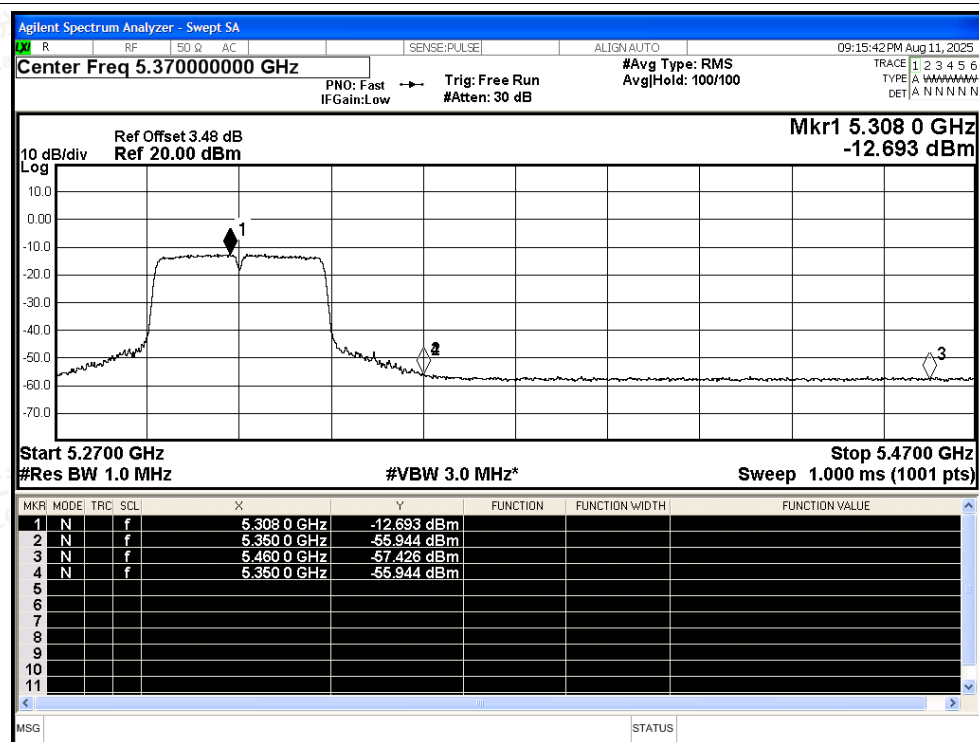

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be80 5290MHz Ant1 Peak

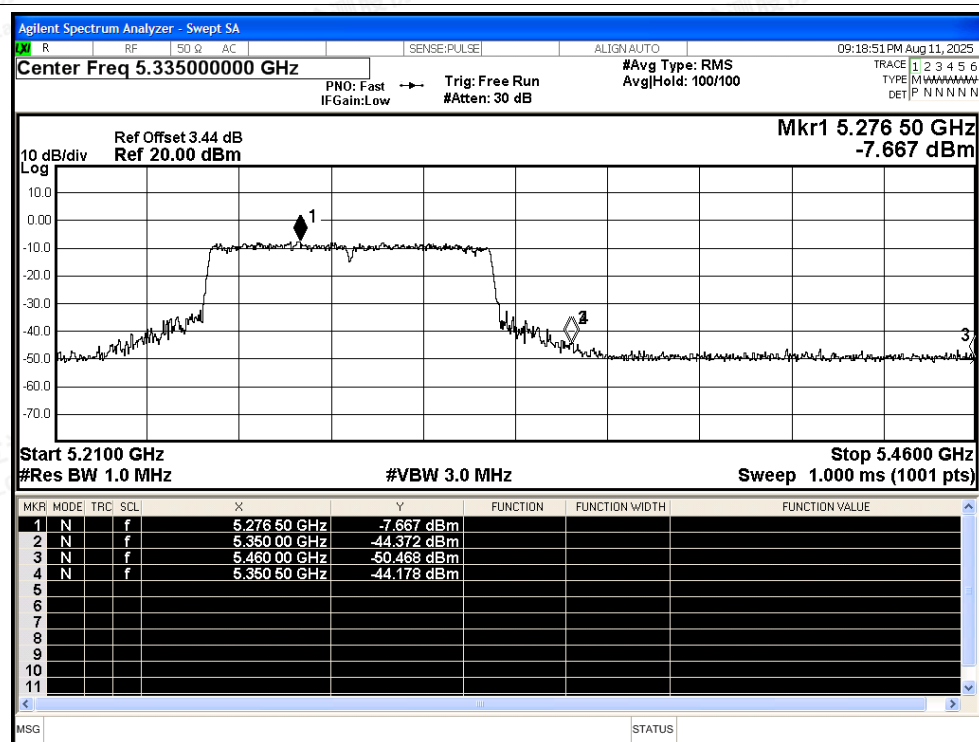

Restrict Band NVNT be80 5290MHz Ant1 Average

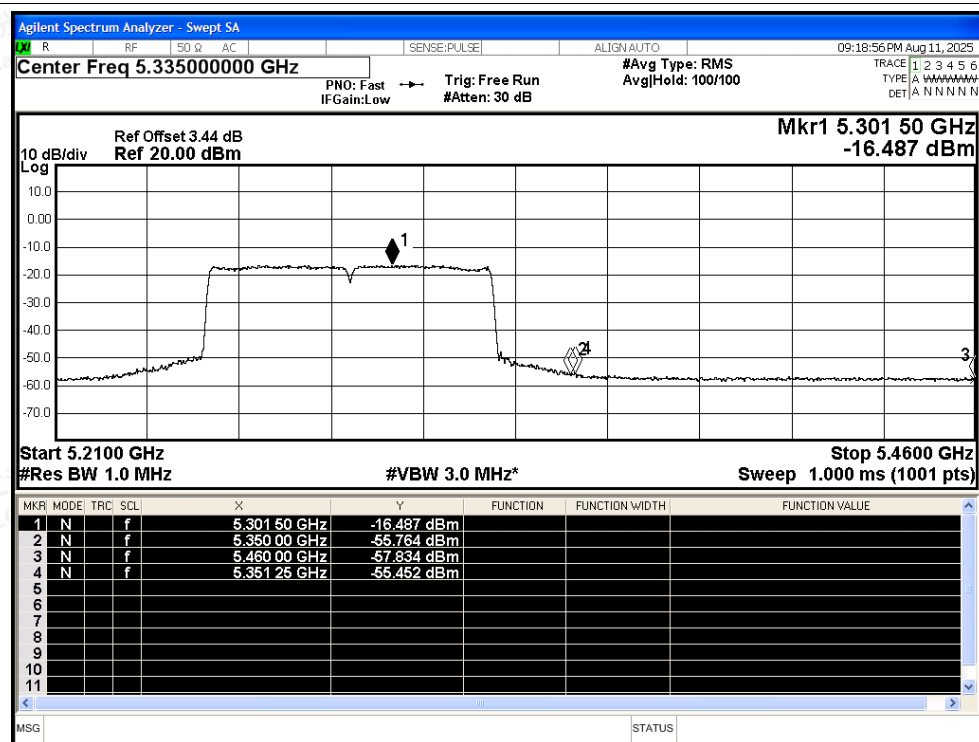

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be80 5290MHz Ant1 Peak

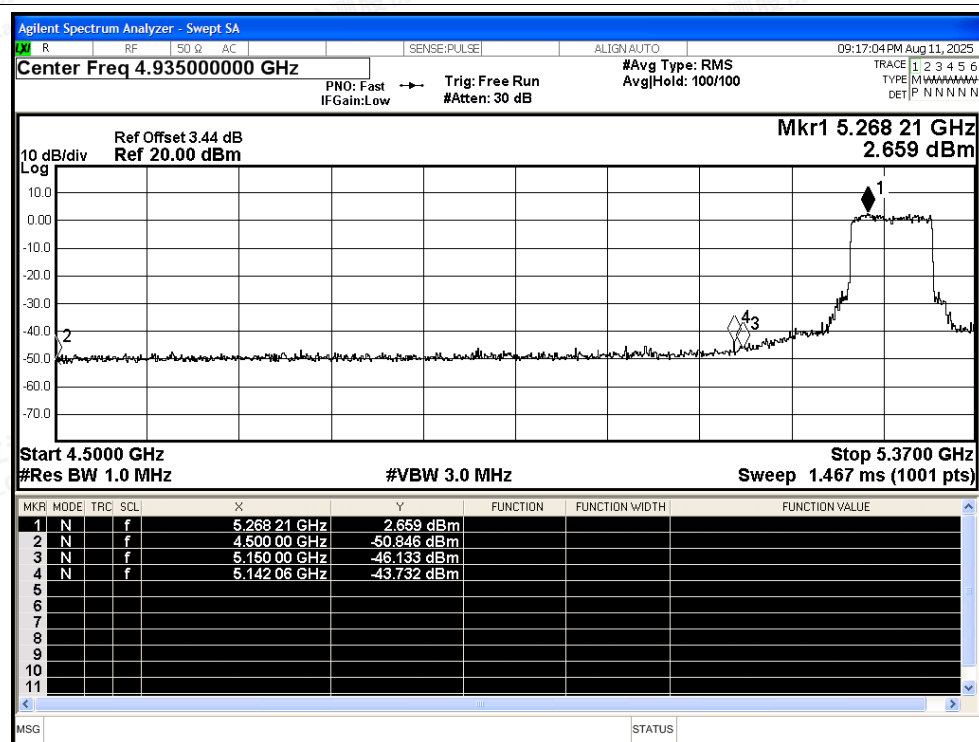

Restrict Band NVNT be80 5290MHz Ant1 Average

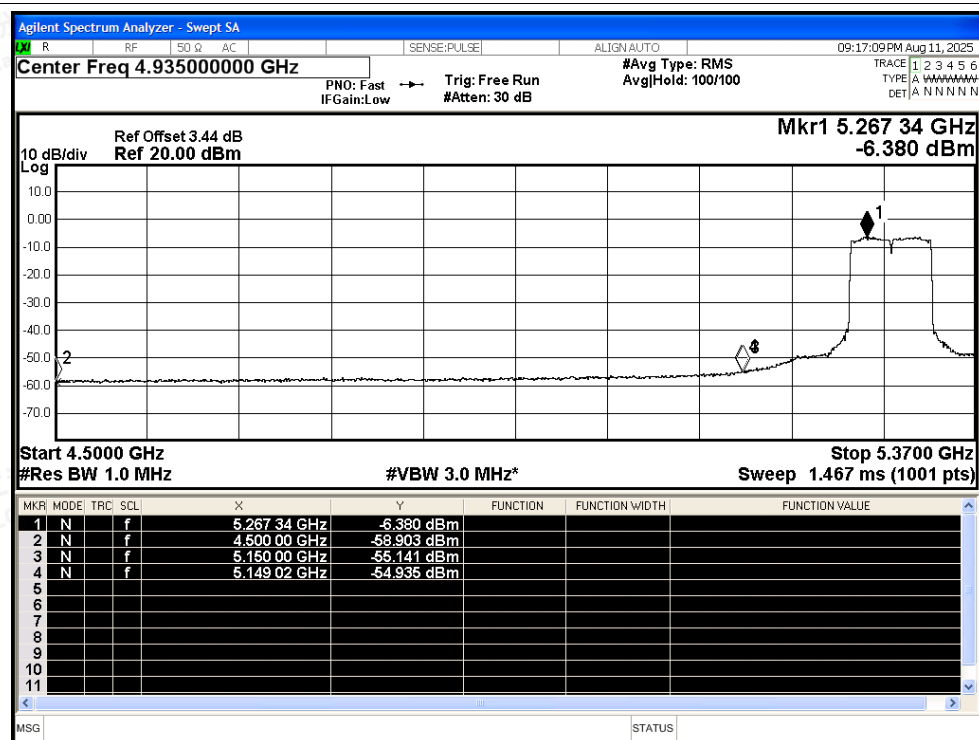

Restrict Band NVNT ac160 5250MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

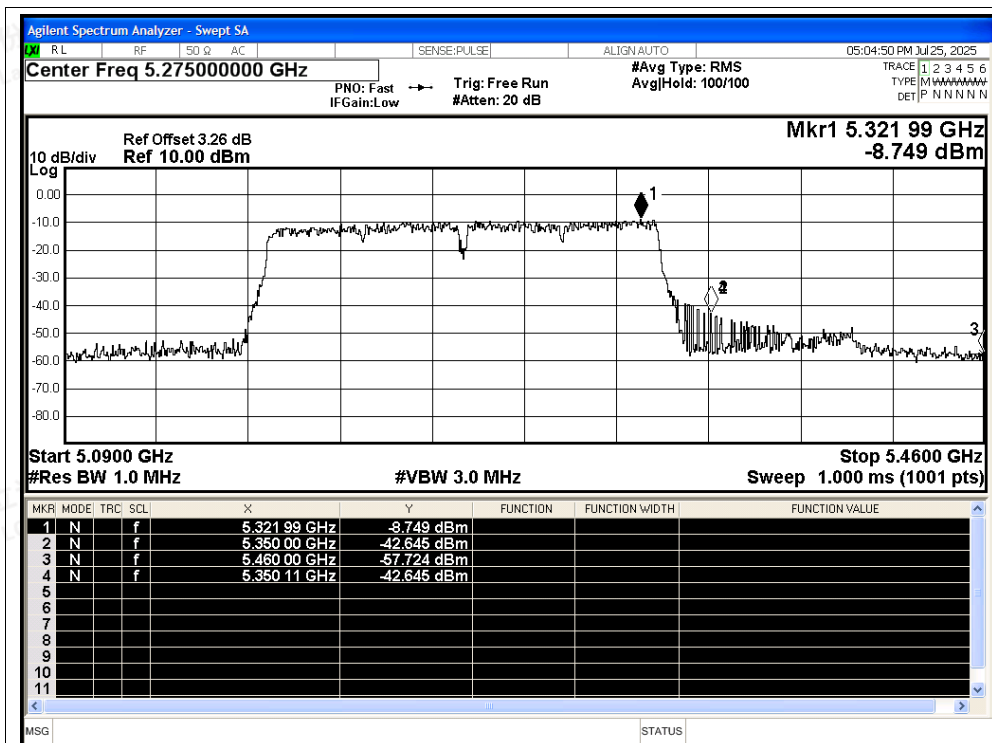

Restrict Band NVNT ac160 5250MHz Ant1 Average

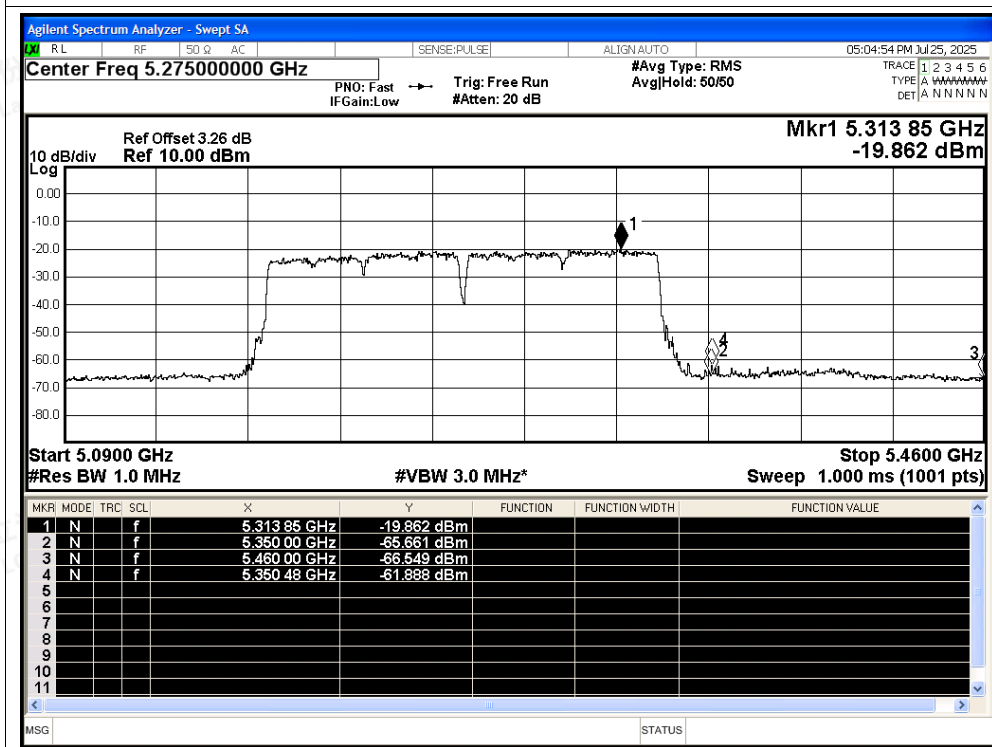

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac160 5250MHz Ant1 Peak

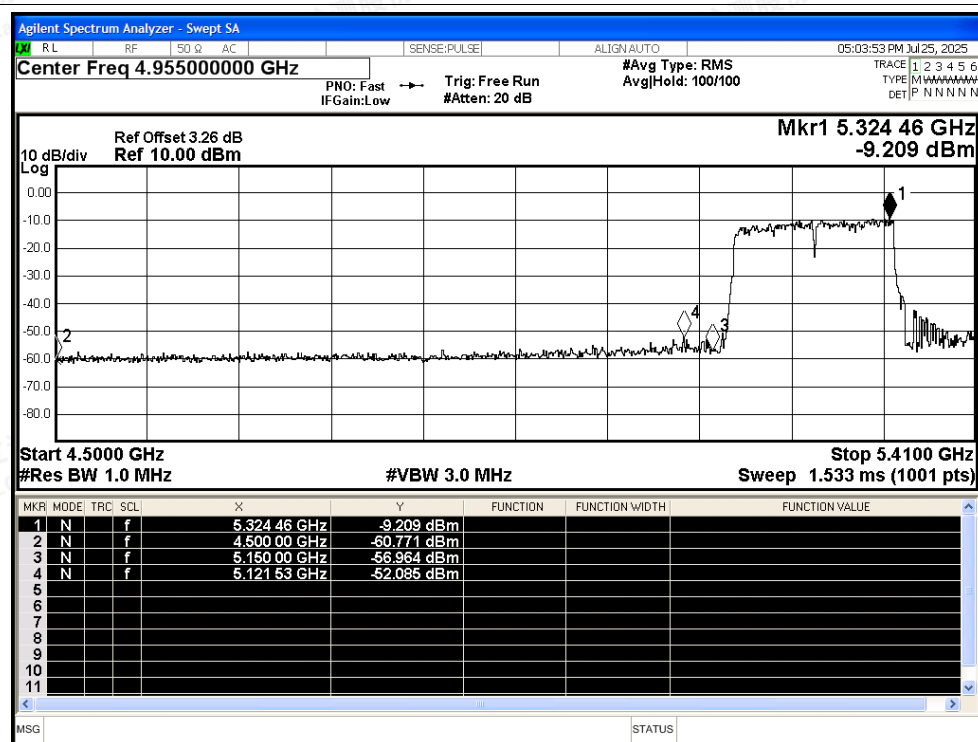

Restrict Band NVNT ac160 5250MHz Ant1 Average

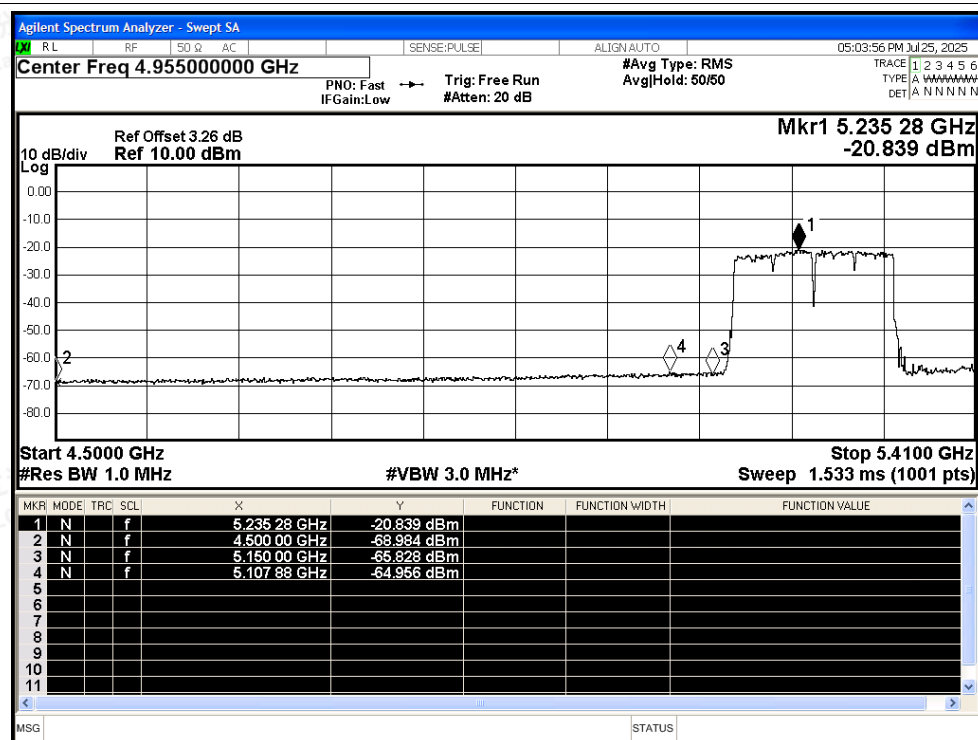

Restrict Band NVNT ax160 5250MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

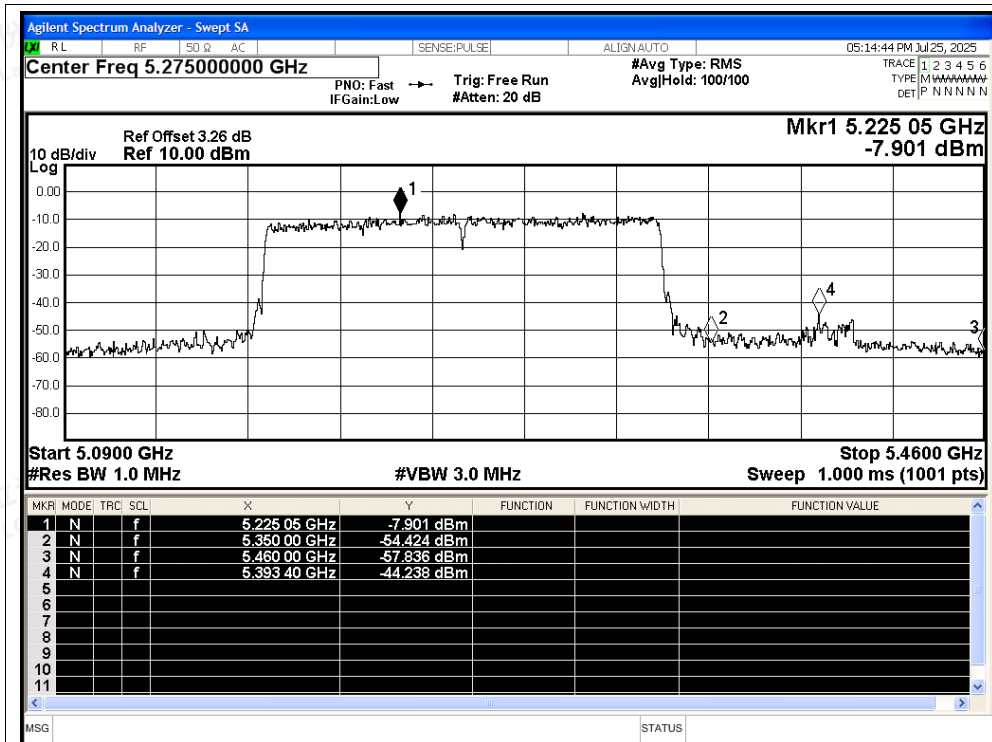

Restrict Band NVNT ax160 5250MHz Ant1 Average

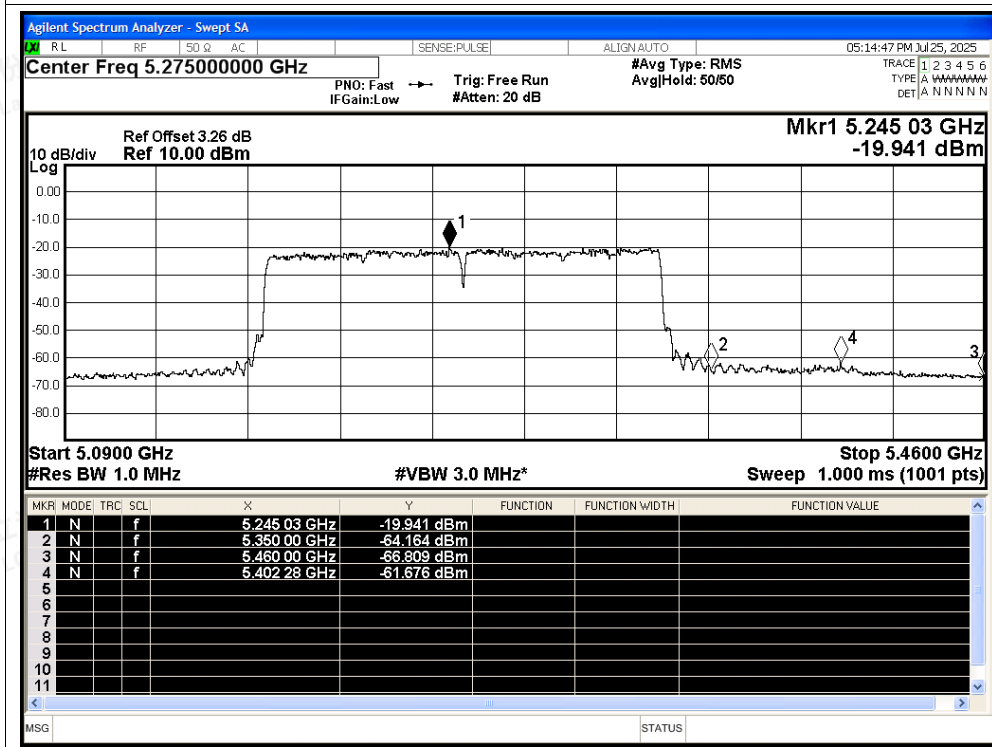

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax160 5250MHz Ant1 Peak

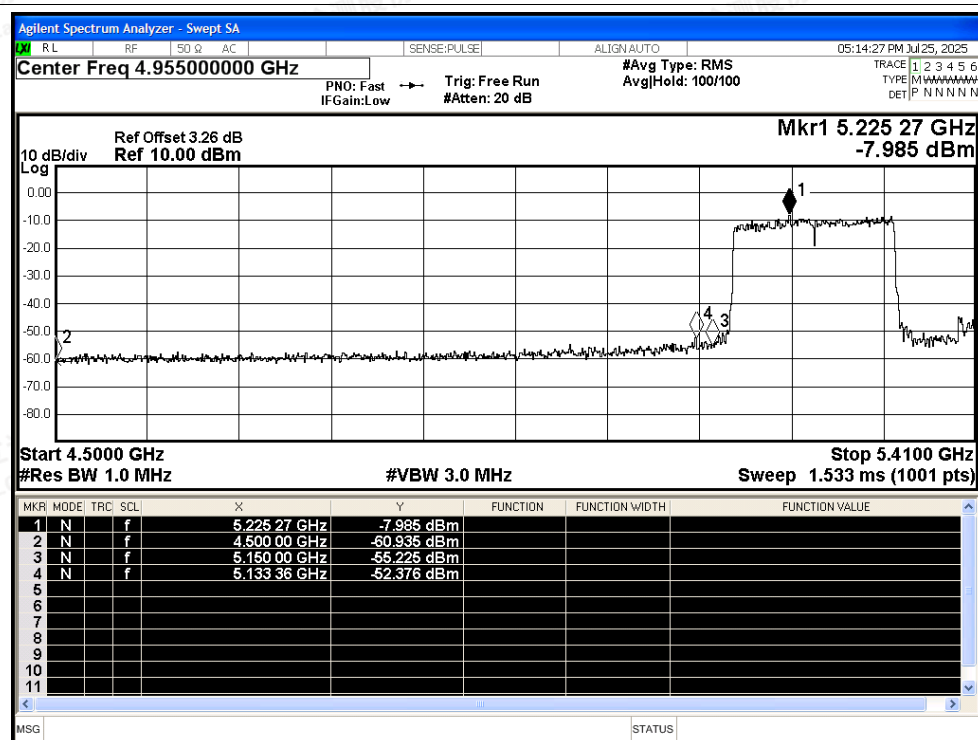

Restrict Band NVNT ax160 5250MHz Ant1 Average

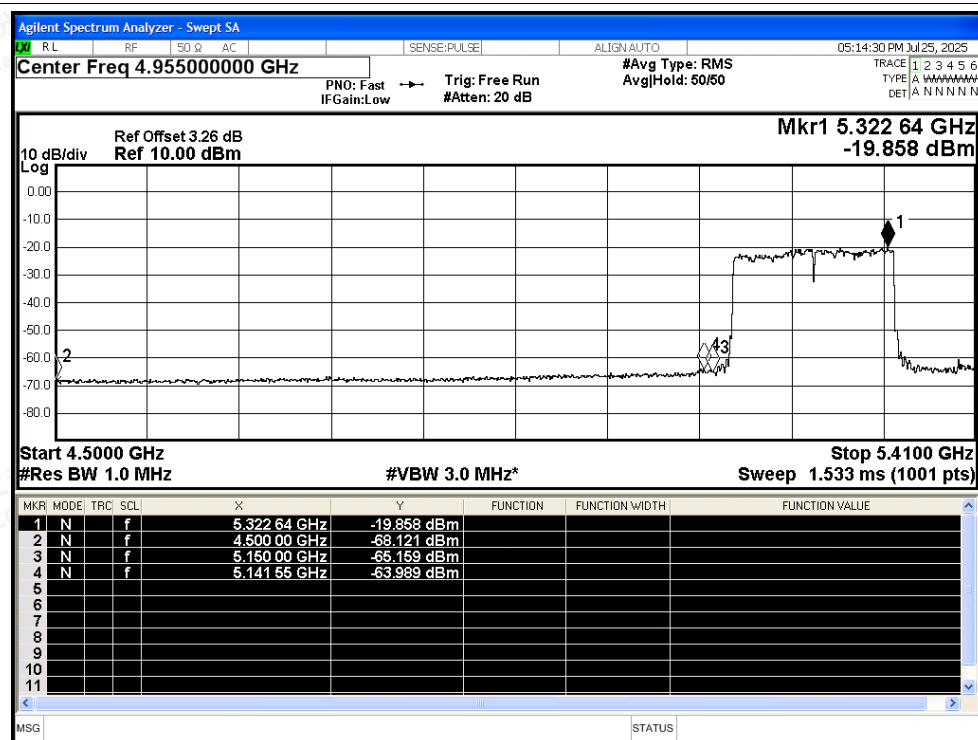

Restrict Band NVNT be160 5250MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

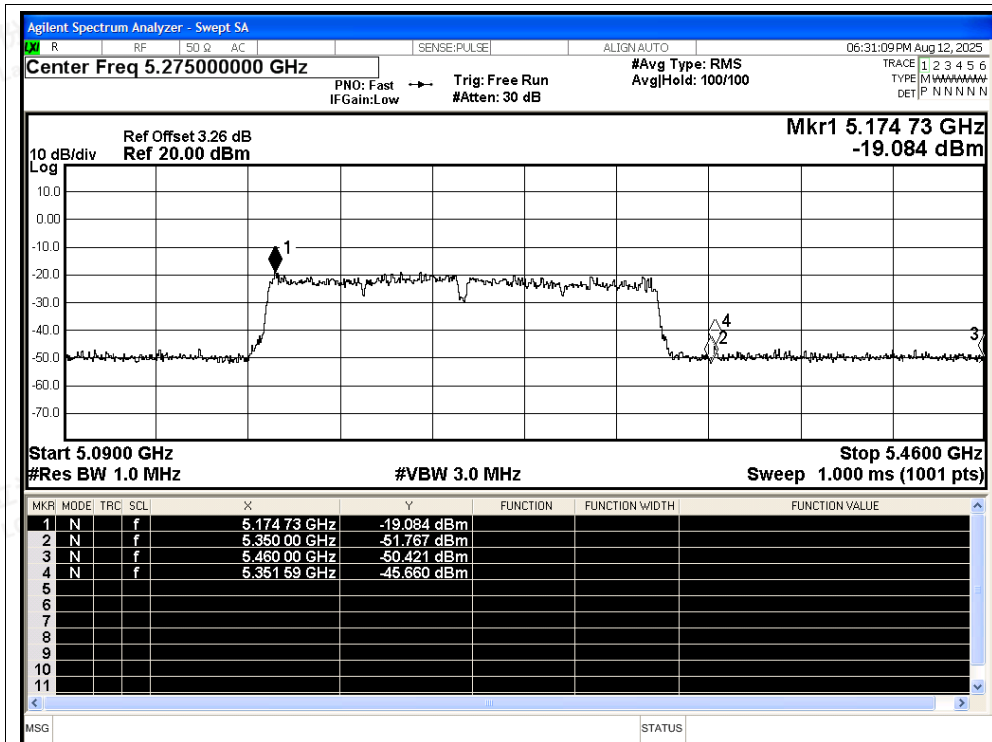

Restrict Band NVNT be160 5250MHz Ant1 Average

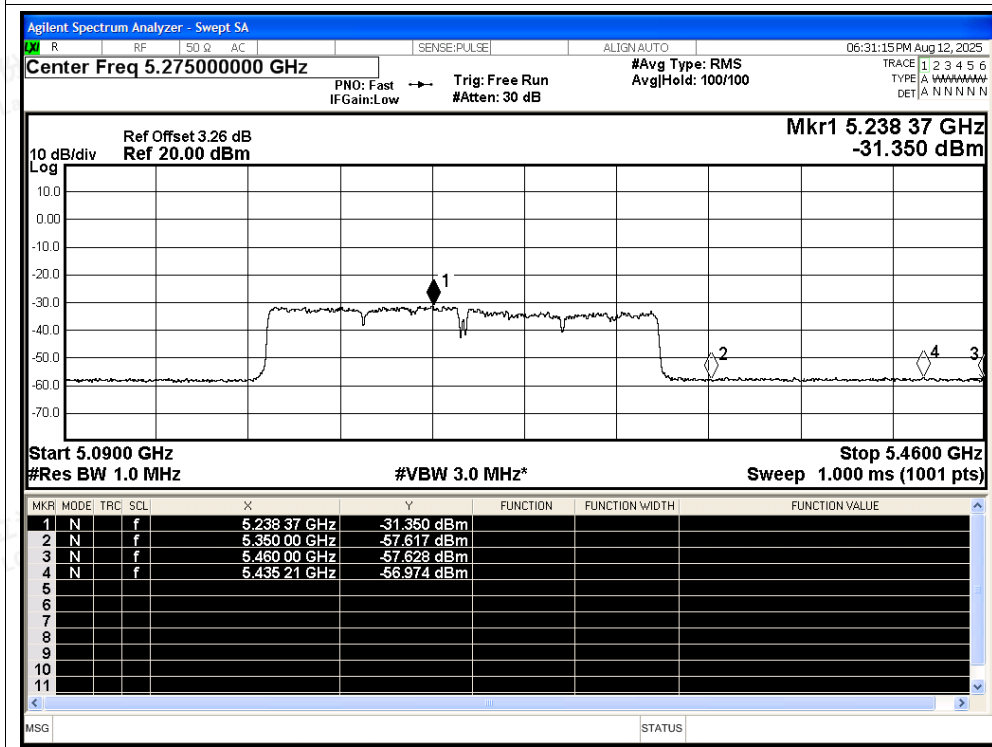

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be160 5250MHz Ant1 Peak

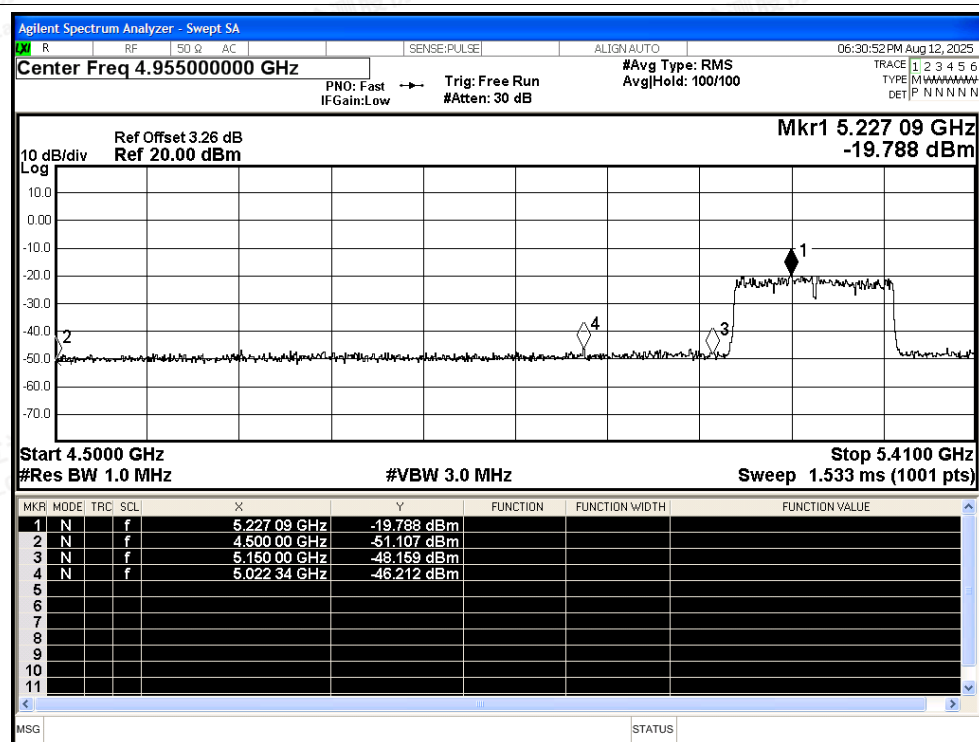

Restrict Band NVNT be160 5250MHz Ant1 Average

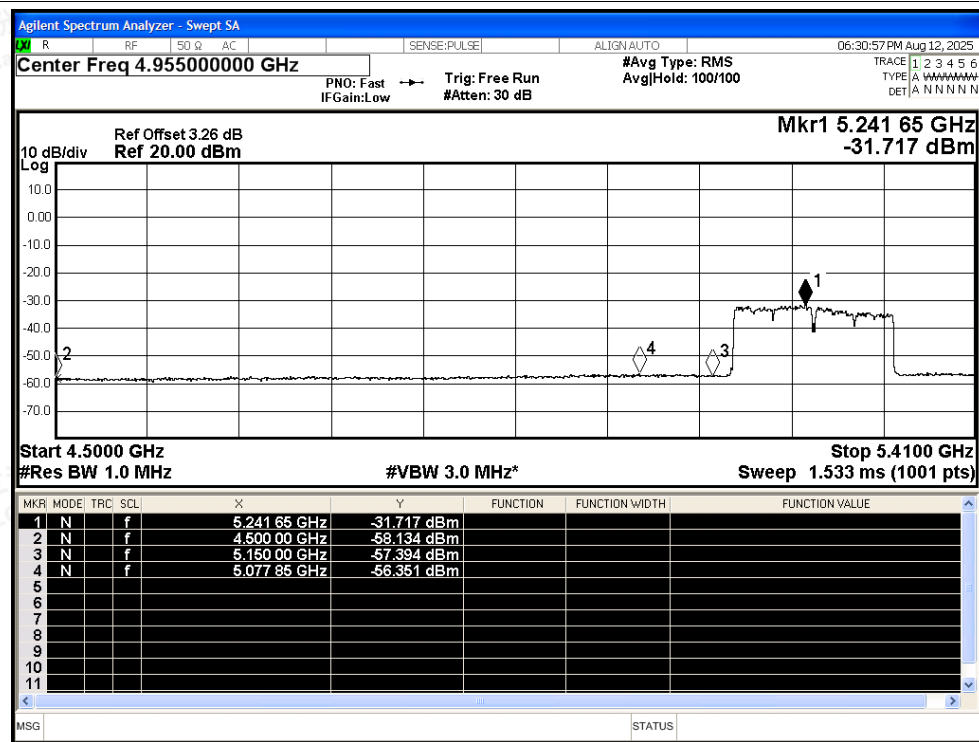

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5260	Ant2	4500	-50.62	3.67	-	48.28	Peak	68.2	Pass
NVNT	a	5260	Ant2	4500	-59.09	3.67	0.24	40.05	Average	54	Pass
NVNT	a	5260	Ant2	4968.78	-46.14	3.67	-	52.76	Peak	68.2	Pass
NVNT	a	5260	Ant2	5058.48	-56.68	3.67	0.24	42.46	Average	54	Pass
NVNT	a	5260	Ant2	5150	-49.3	3.67	-	49.60	Peak	68.2	Pass
NVNT	a	5260	Ant2	5150	-57.45	3.67	0.24	41.69	Average	54	Pass
NVNT	a	5320	Ant2	5350	-46.88	3.67	-	52.02	Peak	68.2	Pass
NVNT	a	5320	Ant2	5350	-56.41	3.67	0.24	42.73	Average	54	Pass
NVNT	a	5320	Ant2	5350.4	-44.24	3.67	-	54.66	Peak	68.2	Pass
NVNT	a	5320	Ant2	5351	-56.26	3.67	0.24	42.88	Average	54	Pass
NVNT	a	5320	Ant2	5460	-49.79	3.67	-	49.11	Peak	68.2	Pass
NVNT	a	5320	Ant2	5460	-57.95	3.67	0.24	41.19	Average	54	Pass
NVNT	n20	5260	Ant2	4500	-51.46	3.67	-	47.44	Peak	68.2	Pass
NVNT	n20	5260	Ant2	4500	-58.51	3.67	0.12	40.51	Average	54	Pass
NVNT	n20	5260	Ant2	5140.38	-46.47	3.67	-	52.43	Peak	68.2	Pass
NVNT	n20	5260	Ant2	5113.86	-56.34	3.67	0.12	42.68	Average	54	Pass
NVNT	n20	5260	Ant2	5150	-47.28	3.67	-	51.62	Peak	68.2	Pass
NVNT	n20	5260	Ant2	5150	-56.97	3.67	0.12	42.05	Average	54	Pass
NVNT	n20	5320	Ant2	5350	-43.87	3.67	-	55.03	Peak	68.2	Pass
NVNT	n20	5320	Ant2	5350	-55.56	3.67	0.12	43.46	Average	54	Pass
NVNT	n20	5320	Ant2	5351.2	-43.37	3.67	-	55.53	Peak	68.2	Pass
NVNT	n20	5320	Ant2	5352.2	-55.29	3.67	0.12	43.73	Average	54	Pass
NVNT	n20	5320	Ant2	5460	-47.22	3.67	-	51.68	Peak	68.2	Pass
NVNT	n20	5320	Ant2	5460	-57.3	3.67	0.12	41.72	Average	54	Pass
NVNT	n40	5270	Ant2	4500	-48.06	3.67	-	50.84	Peak	68.2	Pass
NVNT	n40	5270	Ant2	4500	-58.21	3.67	0.24	40.93	Average	54	Pass
NVNT	n40	5270	Ant2	5121.27	-46.41	3.67	-	52.49	Peak	68.2	Pass
NVNT	n40	5270	Ant2	4806.99	-56.51	3.67	0.24	42.63	Average	54	Pass
NVNT	n40	5270	Ant2	5150	-49.07	3.67	-	49.83	Peak	68.2	Pass
NVNT	n40	5270	Ant2	5150	-57.19	3.67	0.24	41.95	Average	54	Pass
NVNT	n40	5310	Ant2	5350	-47.32	3.67	-	51.58	Peak	68.2	Pass
NVNT	n40	5310	Ant2	5350	-55.31	3.67	0.24	43.83	Average	54	Pass
NVNT	n40	5310	Ant2	5351.4	-42.24	3.67	-	56.66	Peak	68.2	Pass
NVNT	n40	5310	Ant2	5350.2	-55.15	3.67	0.24	43.99	Average	54	Pass
NVNT	n40	5310	Ant2	5460	-49.17	3.67	-	49.73	Peak	68.2	Pass
NVNT	n40	5310	Ant2	5460	-57.69	3.67	0.24	41.45	Average	54	Pass
NVNT	ac20	5260	Ant2	4500	-50.2	3.67	-	48.70	Peak	68.2	Pass
NVNT	ac20	5260	Ant2	4500	-58.88	3.67	0.12	40.14	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5260	Ant2	4798.74	-46.58	3.67	-	52.32	Peak	68.2	Pass
NVNT	ac20	5260	Ant2	5053.02	-56.47	3.67	0.12	42.55	Average	54	Pass
NVNT	ac20	5260	Ant2	5150	-48.14	3.67	-	50.76	Peak	68.2	Pass
NVNT	ac20	5260	Ant2	5150	-57.45	3.67	0.12	41.57	Average	54	Pass
NVNT	ac20	5320	Ant2	5350	-44.14	3.67	-	54.76	Peak	68.2	Pass
NVNT	ac20	5320	Ant2	5350	-55.38	3.67	0.12	43.64	Average	54	Pass
NVNT	ac20	5320	Ant2	5350	-44.14	3.67	-	54.76	Peak	68.2	Pass
NVNT	ac20	5320	Ant2	5350.2	-55.01	3.67	0.12	44.01	Average	54	Pass
NVNT	ac20	5320	Ant2	5460	-50.67	3.67	-	48.23	Peak	68.2	Pass
NVNT	ac20	5320	Ant2	5460	-58.36	3.67	0.12	40.66	Average	54	Pass
NVNT	ac40	5270	Ant2	4500	-49.51	3.67	-	49.39	Peak	68.2	Pass
NVNT	ac40	5270	Ant2	4500	-58.89	3.67	0.24	40.25	Average	54	Pass
NVNT	ac40	5270	Ant2	5025.69	-45.73	3.67	-	53.17	Peak	68.2	Pass
NVNT	ac40	5270	Ant2	5071.86	-56.48	3.67	0.24	42.66	Average	54	Pass
NVNT	ac40	5270	Ant2	5150	-49.15	3.67	-	49.75	Peak	68.2	Pass
NVNT	ac40	5270	Ant2	5150	-56.99	3.67	0.24	42.15	Average	54	Pass
NVNT	ac40	5310	Ant2	5350	-45.55	3.67	-	53.35	Peak	68.2	Pass
NVNT	ac40	5310	Ant2	5350	-55.86	3.67	0.23	43.27	Average	54	Pass
NVNT	ac40	5310	Ant2	5350.8	-42.4	3.67	-	56.50	Peak	68.2	Pass
NVNT	ac40	5310	Ant2	5351.2	-55.62	3.67	0.23	43.51	Average	54	Pass
NVNT	ac40	5310	Ant2	5460	-49.91	3.67	-	48.99	Peak	68.2	Pass
NVNT	ac40	5310	Ant2	5460	-57.66	3.67	0.23	41.47	Average	54	Pass
NVNT	ac80	5290	Ant2	4500	-49.04	3.67	-	49.86	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	4500	-58.52	3.67	0.47	40.85	Average	54	Pass
NVNT	ac80	5290	Ant2	5149.02	-46.5	3.67	-	52.40	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5145.54	-55.08	3.67	0.47	44.29	Average	54	Pass
NVNT	ac80	5290	Ant2	5150	-48.49	3.67	-	50.41	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5150	-55.87	3.67	0.47	43.50	Average	54	Pass
NVNT	ac80	5290	Ant2	5350	-39.78	3.67	-	59.12	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5350	-49.92	3.67	0.47	49.45	Average	54	Pass
NVNT	ac80	5290	Ant2	5353.25	-38.97	3.67	-	59.93	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5355	-49.29	3.67	0.47	50.08	Average	54	Pass
NVNT	ac80	5290	Ant2	5460	-48.92	3.67	-	49.98	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5460	-57.27	3.67	0.47	42.10	Average	54	Pass
NVNT	ax20	5260	Ant2	4500	-49.5	3.67	-	49.40	Peak	68.2	Pass
NVNT	ax20	5260	Ant2	4500	-58.31	3.67	0.12	40.71	Average	54	Pass
NVNT	ax20	5260	Ant2	5046.78	-46.03	3.67	-	52.87	Peak	68.2	Pass
NVNT	ax20	5260	Ant2	5067.84	-56.48	3.67	0.12	42.54	Average	54	Pass
NVNT	ax20	5260	Ant2	5150	-48.65	3.67	-	50.25	Peak	68.2	Pass
NVNT	ax20	5260	Ant2	5150	-56.97	3.67	0.12	42.05	Average	54	Pass
NVNT	ax20	5320	Ant2	5350	-43.26	3.67	-	55.64	Peak	68.2	Pass
NVNT	ax20	5320	Ant2	5350	-55.92	3.67	0.12	43.10	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5320	Ant2	5460	-50.37	3.67	-	48.53	Peak	68.2	Pass
NVNT	ax20	5320	Ant2	5460	-57.41	3.67	0.12	41.61	Average	54	Pass
NVNT	ax20	5320	Ant2	5460	-50.37	3.67	-	48.53	Peak	68.2	Pass
NVNT	ax20	5320	Ant2	5460	-57.41	3.67	0.12	41.61	Average	54	Pass
NVNT	ax40	5270	Ant2	4500	-50.18	3.67	-	48.72	Peak	68.2	Pass
NVNT	ax40	5270	Ant2	4500	-58.73	3.67	0.23	40.40	Average	54	Pass
NVNT	ax40	5270	Ant2	5053.23	-46.26	3.67	-	52.64	Peak	68.2	Pass
NVNT	ax40	5270	Ant2	4772.16	-56.69	3.67	0.23	42.44	Average	54	Pass
NVNT	ax40	5270	Ant2	5150	-48.76	3.67	-	50.14	Peak	68.2	Pass
NVNT	ax40	5270	Ant2	5150	-56.99	3.67	0.23	42.14	Average	54	Pass
NVNT	ax40	5310	Ant2	5350	-45.34	3.67	-	53.56	Peak	68.2	Pass
NVNT	ax40	5310	Ant2	5350	-55.87	3.67	0.24	43.27	Average	54	Pass
NVNT	ax40	5310	Ant2	5351.6	-40.5	3.67	-	58.40	Peak	68.2	Pass
NVNT	ax40	5310	Ant2	5350.8	-55.25	3.67	0.24	43.89	Average	54	Pass
NVNT	ax40	5310	Ant2	5460	-49.72	3.67	-	49.18	Peak	68.2	Pass
NVNT	ax40	5310	Ant2	5460	-58.07	3.67	0.24	41.07	Average	54	Pass
NVNT	ax80	5290	Ant2	5350	-45.63	3.67	-	53.27	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5350	-55.37	3.67	0.47	44.00	Average	54	Pass
NVNT	ax80	5290	Ant2	5351.75	-44.66	3.67	-	54.24	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5350	-55.37	3.67	0.47	44.00	Average	54	Pass
NVNT	ax80	5290	Ant2	5460	-49.92	3.67	-	48.98	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5460	-57.18	3.67	0.47	42.19	Average	54	Pass
NVNT	ax80	5290	Ant2	4500	-49.38	3.67	-	49.52	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	4500	-58.14	3.67	0.47	41.23	Average	54	Pass
NVNT	ax80	5290	Ant2	5137.71	-46.12	3.67	-	52.78	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5149.02	-55.03	3.67	0.47	44.34	Average	54	Pass
NVNT	ax80	5290	Ant2	5150	-48.14	3.67	-	50.76	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5150	-55.44	3.67	0.47	43.93	Average	54	Pass
NVNT	be20	5260	Ant2	4500	-50.63	3.67	-	48.27	Peak	68.2	Pass
NVNT	be20	5260	Ant2	4500	-58.13	3.67	0.12	40.89	Average	54	Pass
NVNT	be20	5260	Ant2	4982.04	-45.66	3.67	-	53.24	Peak	68.2	Pass
NVNT	be20	5260	Ant2	5063.16	-56.52	3.67	0.12	42.50	Average	54	Pass
NVNT	be20	5260	Ant2	5150	-48.56	3.67	-	50.34	Peak	68.2	Pass
NVNT	be20	5260	Ant2	5150	-57.37	3.67	0.12	41.65	Average	54	Pass
NVNT	be20	5320	Ant2	5350	-43.15	3.67	-	55.75	Peak	68.2	Pass
NVNT	be20	5320	Ant2	5350	-56.71	3.67	0.12	42.31	Average	54	Pass
NVNT	be20	5320	Ant2	5351.8	-41.81	3.67	-	57.09	Peak	68.2	Pass
NVNT	be20	5320	Ant2	5350.2	-55.53	3.67	0.12	43.49	Average	54	Pass
NVNT	be20	5320	Ant2	5460	-49.22	3.67	-	49.68	Peak	68.2	Pass
NVNT	be20	5320	Ant2	5460	-57.86	3.67	0.12	41.16	Average	54	Pass
NVNT	be40	5270	Ant2	4500	-50.15	3.67	-	48.75	Peak	68.2	Pass
NVNT	be40	5270	Ant2	4500	-58.52	3.67	0.24	40.62	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	be40	5270	Ant2	5053.23	-46.08	3.67	-	52.82	Peak	68.2	Pass
NVNT	be40	5270	Ant2	5121.27	-56.49	3.67	0.24	42.65	Average	54	Pass
NVNT	be40	5270	Ant2	5150	-47.99	3.67	-	50.91	Peak	68.2	Pass
NVNT	be40	5270	Ant2	5150	-57	3.67	0.24	42.14	Average	54	Pass
NVNT	be40	5310	Ant2	5350	-44.1	3.67	-	54.80	Peak	68.2	Pass
NVNT	be40	5310	Ant2	5350	-55.59	3.67	0.24	43.55	Average	54	Pass
NVNT	be40	5310	Ant2	5350	-44.1	3.67	-	54.80	Peak	68.2	Pass
NVNT	be40	5310	Ant2	5350.4	-55.48	3.67	0.24	43.66	Average	54	Pass
NVNT	be40	5310	Ant2	5460	-49.63	3.67	-	49.27	Peak	68.2	Pass
NVNT	be40	5310	Ant2	5460	-58.22	3.67	0.24	40.92	Average	54	Pass
NVNT	be80	5290	Ant2	5350	-44.5	3.67	-	54.40	Peak	68.2	Pass
NVNT	be80	5290	Ant2	5350	-56.26	3.67	0.47	43.11	Average	54	Pass
NVNT	be80	5290	Ant2	5352	-42.98	3.67	-	55.92	Peak	68.2	Pass
NVNT	be80	5290	Ant2	5350.25	-55.93	3.67	0.47	43.44	Average	54	Pass
NVNT	be80	5290	Ant2	5460	-48.42	3.67	-	50.48	Peak	68.2	Pass
NVNT	be80	5290	Ant2	5460	-58.15	3.67	0.47	41.22	Average	54	Pass
NVNT	be80	5290	Ant2	4500	-50.72	3.67	-	48.18	Peak	68.2	Pass
NVNT	be80	5290	Ant2	4500	-58.76	3.67	0.47	40.61	Average	54	Pass
NVNT	be80	5290	Ant2	5115.09	-45.34	3.67	-	53.56	Peak	68.2	Pass
NVNT	be80	5290	Ant2	5147.28	-54.71	3.67	0.47	44.66	Average	54	Pass
NVNT	be80	5290	Ant2	5150	-46.49	3.67	-	52.41	Peak	68.2	Pass
NVNT	be80	5290	Ant2	5150	-55.06	3.67	0.47	44.31	Average	54	Pass
NVNT	ac160	5250	Ant2	5350	-54.66	3.67	-	44.24	Peak	68.2	Pass
NVNT	ac160	5250	Ant2	5350	-63.9	3.67	3.99	38.99	Average	54	Pass
NVNT	ac160	5250	Ant2	5353.07	-42.81	3.67	-	56.09	Peak	68.2	Pass
NVNT	ac160	5250	Ant2	5353.44	-60.94	3.67	3.99	41.95	Average	54	Pass
NVNT	ac160	5250	Ant2	5460	-58.89	3.67	-	40.01	Peak	68.2	Pass
NVNT	ac160	5250	Ant2	5460	-67.38	3.67	3.99	35.51	Average	54	Pass
NVNT	ac160	5250	Ant2	4500	-60.22	3.67	-	38.68	Peak	68.2	Pass
NVNT	ac160	5250	Ant2	4500	-68.57	3.67	3.99	34.32	Average	54	Pass
NVNT	ac160	5250	Ant2	5143.37	-50.24	3.67	-	48.66	Peak	68.2	Pass
NVNT	ac160	5250	Ant2	5142.46	-63.87	3.67	3.99	39.02	Average	54	Pass
NVNT	ac160	5250	Ant2	5150	-56.26	3.67	-	42.64	Peak	68.2	Pass
NVNT	ac160	5250	Ant2	5150	-66.26	3.67	3.99	36.63	Average	54	Pass
NVNT	ax160	5250	Ant2	5350	-51.53	3.67	-	47.37	Peak	68.2	Pass
NVNT	ax160	5250	Ant2	5350	-63.93	3.67	3.98	38.95	Average	54	Pass
NVNT	ax160	5250	Ant2	5406.72	-43.98	3.67	-	54.92	Peak	68.2	Pass
NVNT	ax160	5250	Ant2	5352.7	-61.72	3.67	3.98	41.16	Average	54	Pass
NVNT	ax160	5250	Ant2	5460	-59.17	3.67	-	39.73	Peak	68.2	Pass
NVNT	ax160	5250	Ant2	5460	-66.72	3.67	3.98	36.16	Average	54	Pass
NVNT	ax160	5250	Ant2	4500	-61.48	3.67	-	37.42	Peak	68.2	Pass
NVNT	ax160	5250	Ant2	4500	-68.5	3.67	3.98	34.38	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




NVNT	ax160	5250	Ant2	5132.45	-50.69	3.67	-	48.21	Peak	68.2	Pass
NVNT	ax160	5250	Ant2	5143.37	-63.05	3.67	3.98	39.83	Average	54	Pass
NVNT	ax160	5250	Ant2	5150	-55.59	3.67	-	43.31	Peak	68.2	Pass
NVNT	ax160	5250	Ant2	5150	-65.03	3.67	3.98	37.85	Average	54	Pass
NVNT	be160	5250	Ant2	5350	-48.55	3.67	-	50.35	Peak	68.2	Pass
NVNT	be160	5250	Ant2	5350	-57.18	3.67	3.77	45.49	Average	54	Pass
NVNT	be160	5250	Ant2	5354.92	-41.72	3.67	-	57.18	Peak	68.2	Pass
NVNT	be160	5250	Ant2	5374.9	-56.33	3.67	3.77	46.34	Average	54	Pass
NVNT	be160	5250	Ant2	5460	-48.83	3.67	-	50.07	Peak	68.2	Pass
NVNT	be160	5250	Ant2	5460	-57.63	3.67	3.77	45.04	Average	54	Pass
NVNT	be160	5250	Ant2	4500	-48.62	3.67	-	50.28	Peak	68.2	Pass
NVNT	be160	5250	Ant2	4500	-59.09	3.67	3.77	43.58	Average	54	Pass
NVNT	be160	5250	Ant2	5143.37	-46.02	3.67	-	52.88	Peak	68.2	Pass
NVNT	be160	5250	Ant2	5085.13	-56.26	3.67	3.77	46.41	Average	54	Pass
NVNT	be160	5250	Ant2	5150	-48.07	3.67	-	50.83	Peak	68.2	Pass
NVNT	be160	5250	Ant2	5150	-57.36	3.67	3.77	45.31	Average	54	Pass






Test Graphs

Restrict Band NVNT a 5260MHz Ant2 Peak

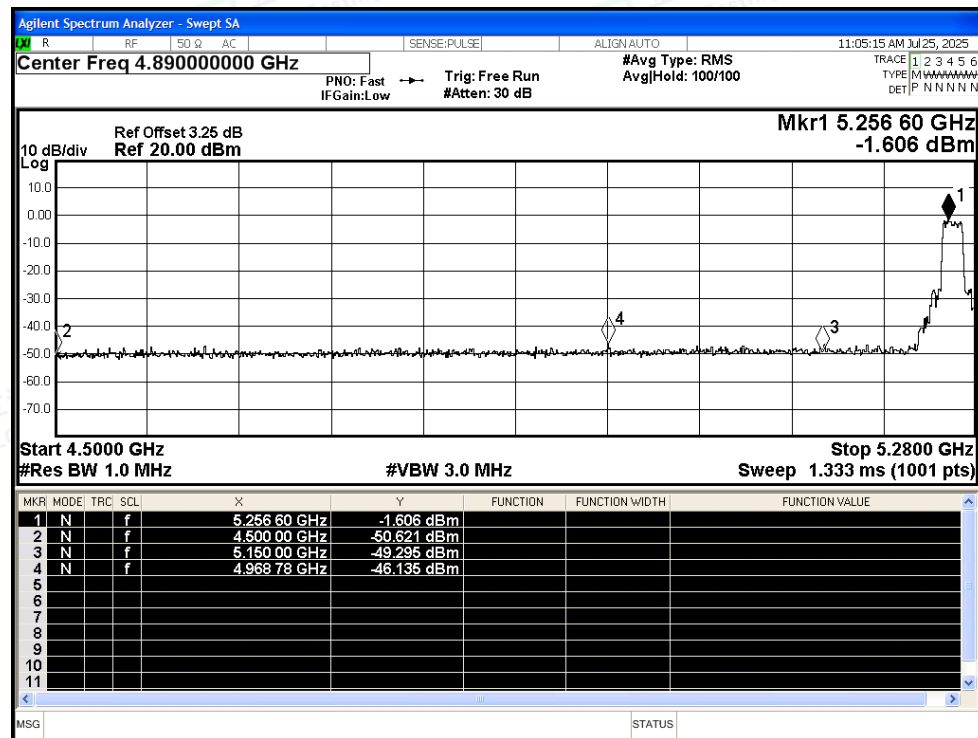

Restrict Band NVNT a 5260MHz Ant2 Average

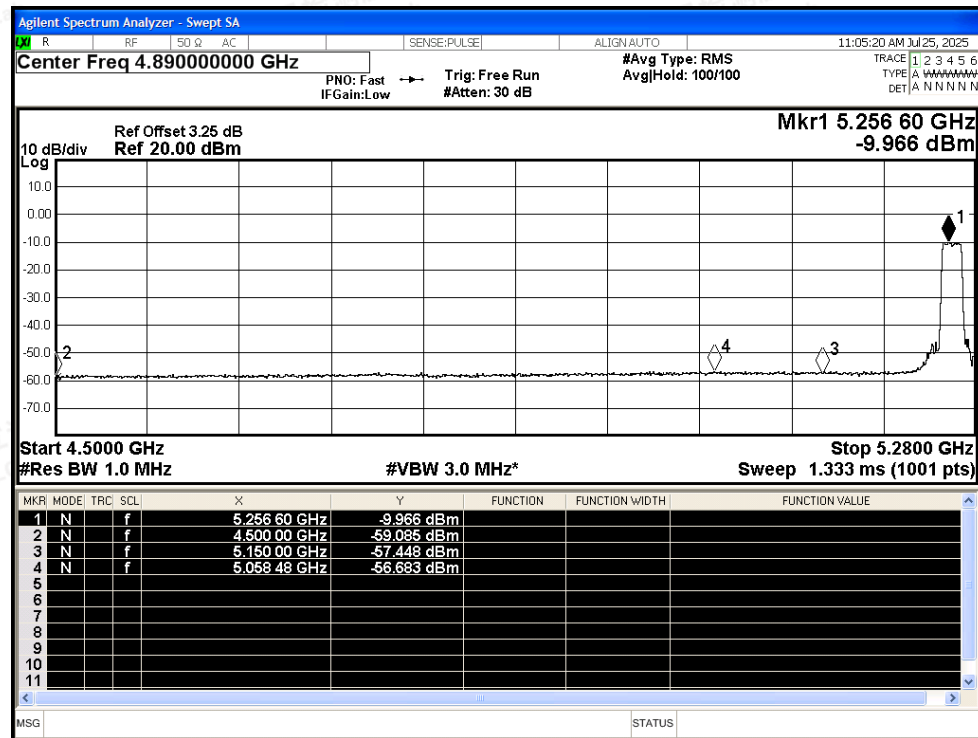

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5320MHz Ant2 Peak

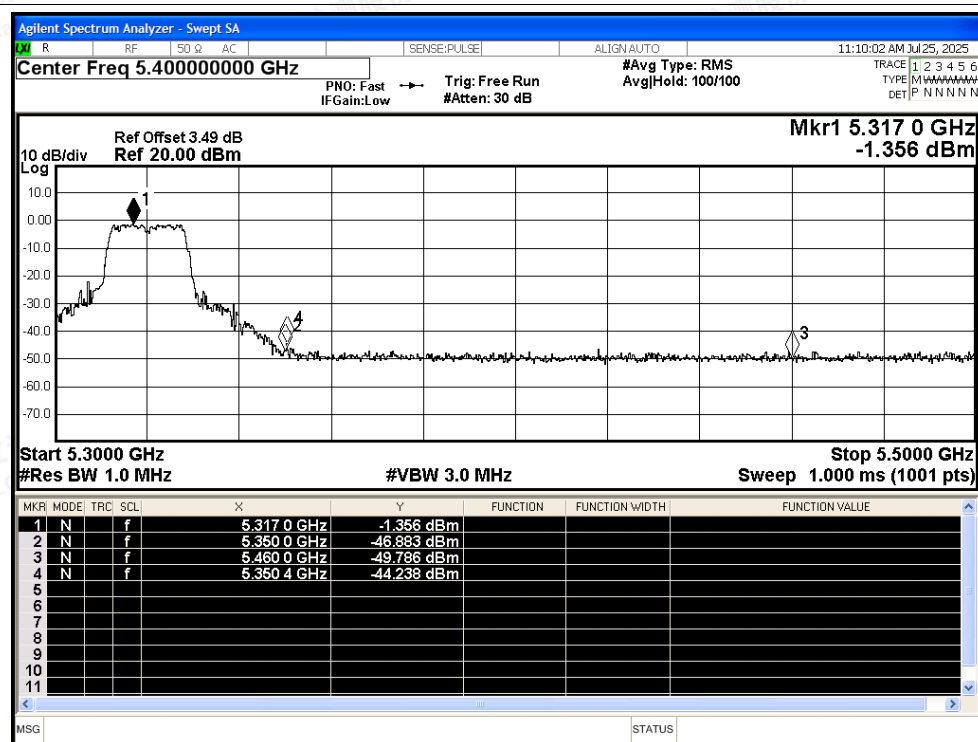

Restrict Band NVNT a 5320MHz Ant2 Average

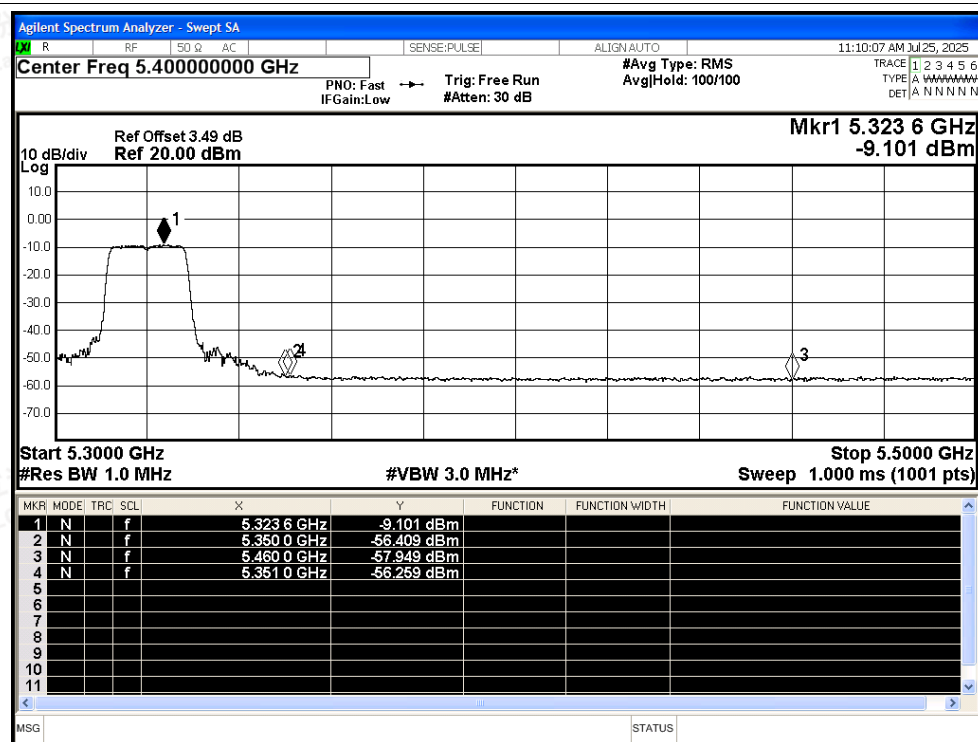

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5260MHz Ant2 Peak

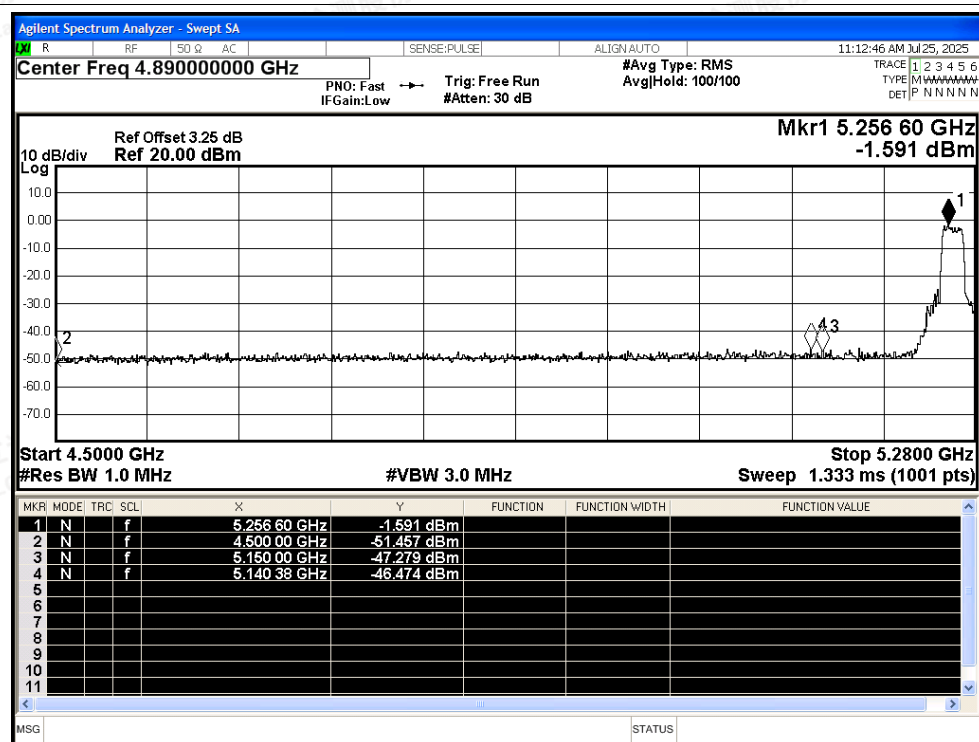

Restrict Band NVNT n20 5260MHz Ant2 Average

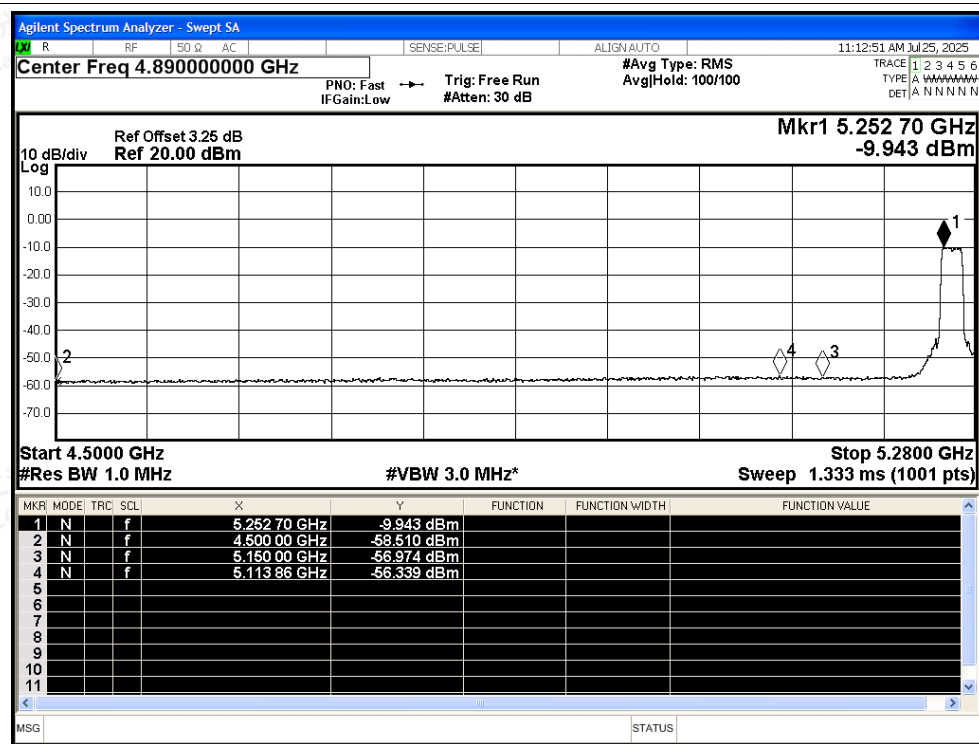

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5320MHz Ant2 Peak

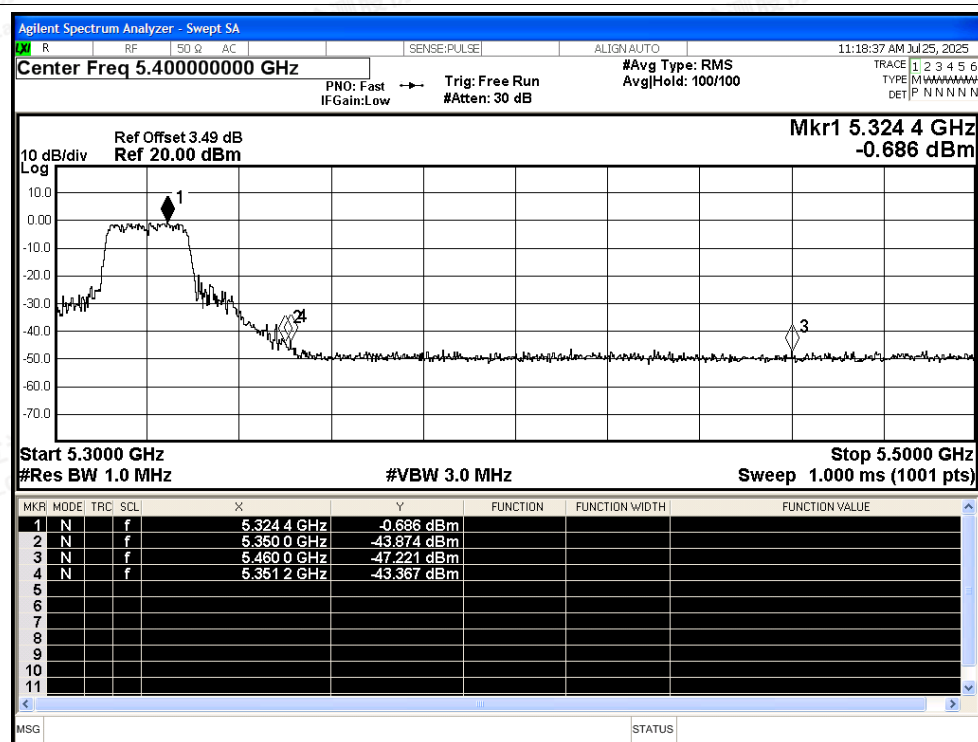

Restrict Band NVNT n20 5320MHz Ant2 Average

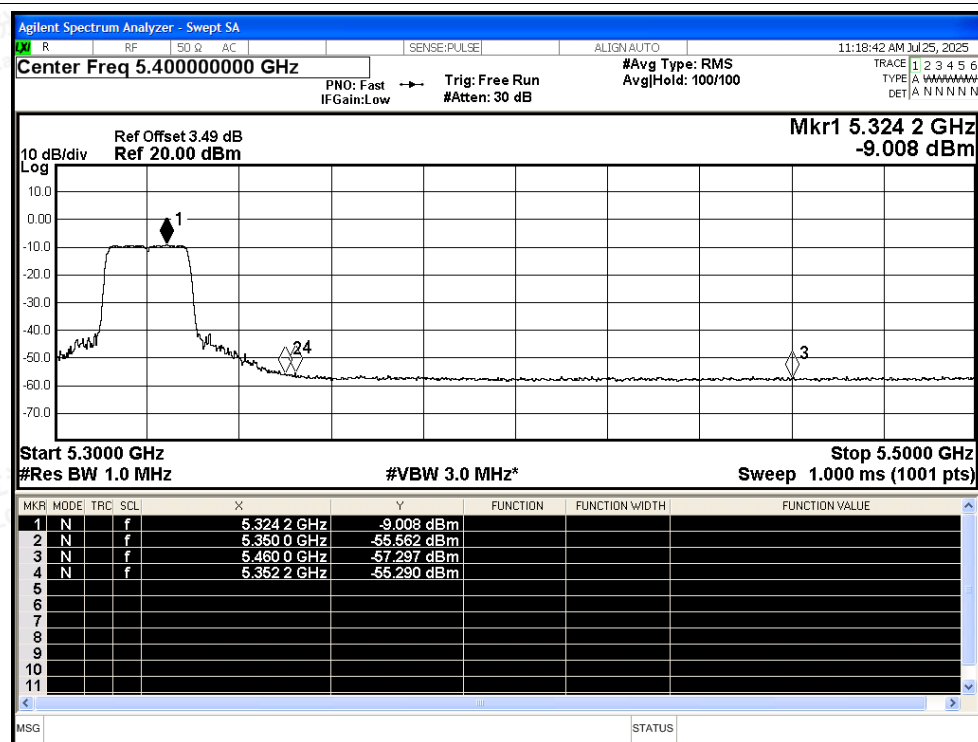

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5270MHz Ant2 Peak

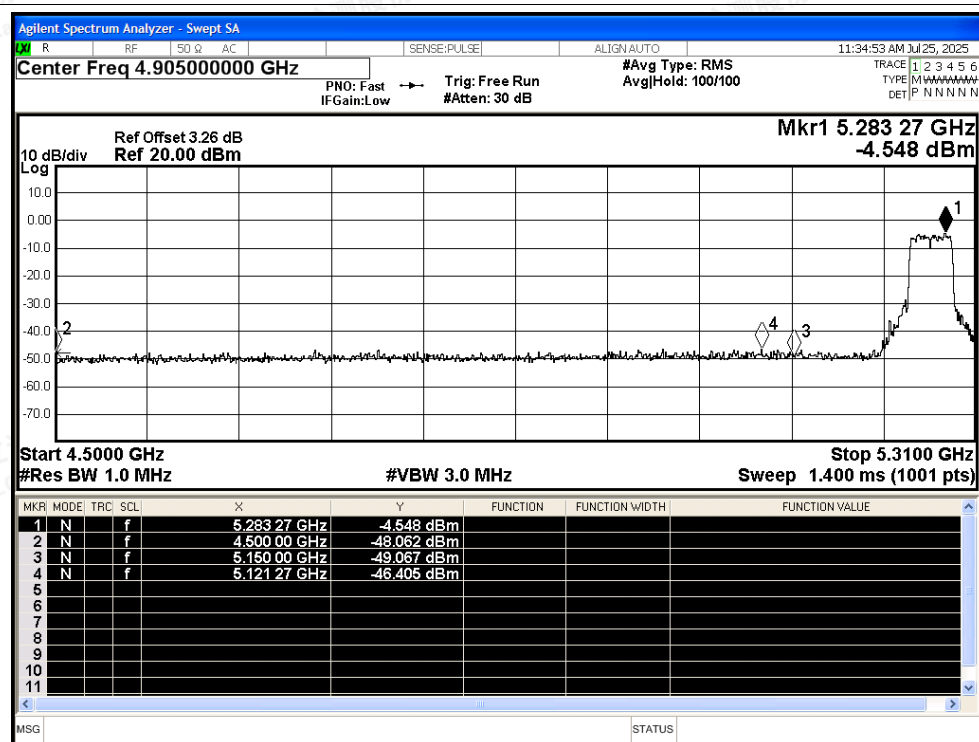

Restrict Band NVNT n40 5270MHz Ant2 Average

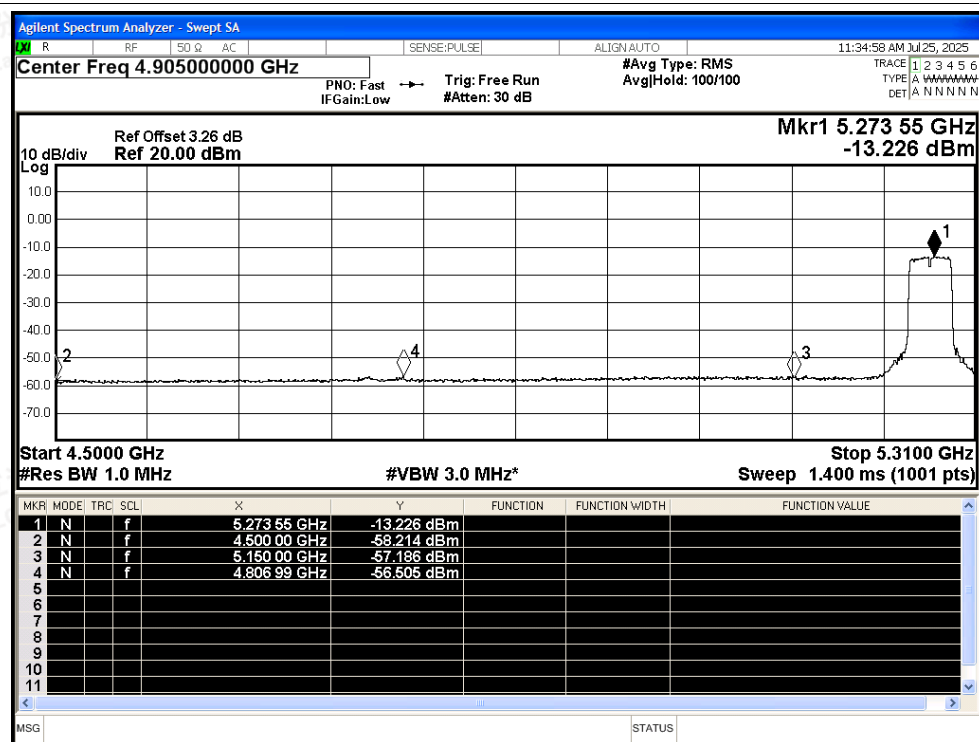

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5310MHz Ant2 Peak

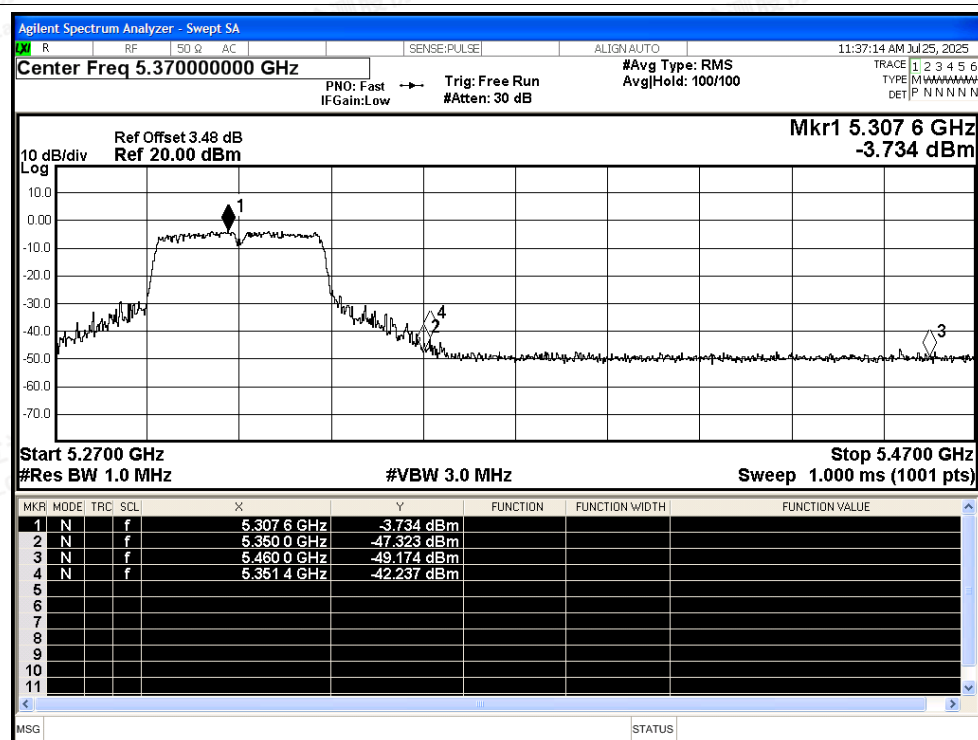

Restrict Band NVNT n40 5310MHz Ant2 Average

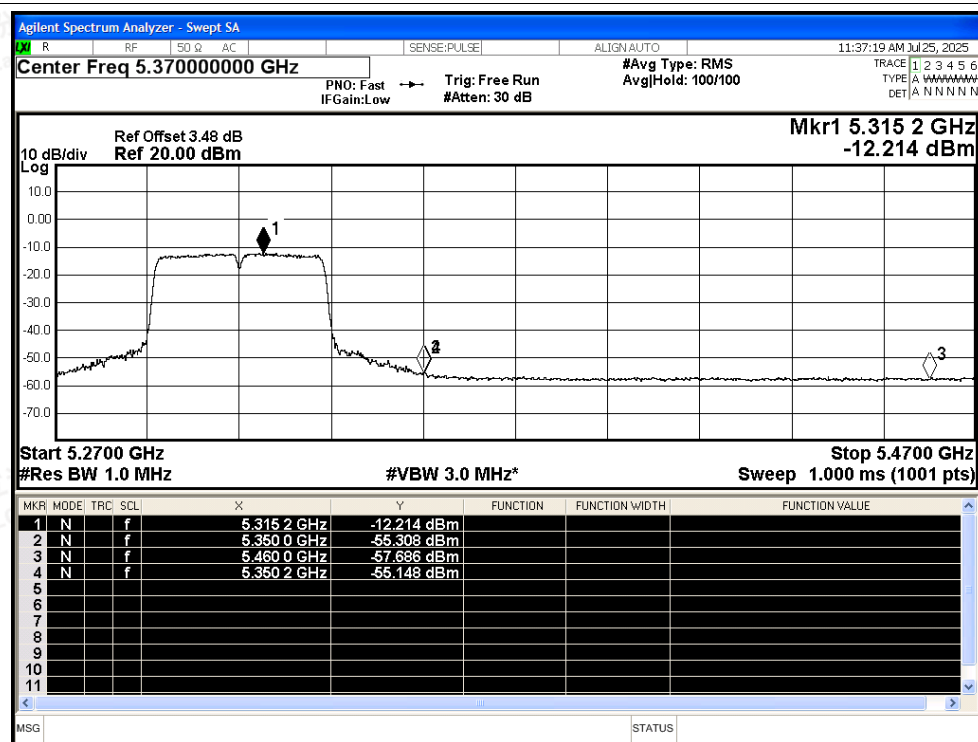

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5260MHz Ant2 Peak

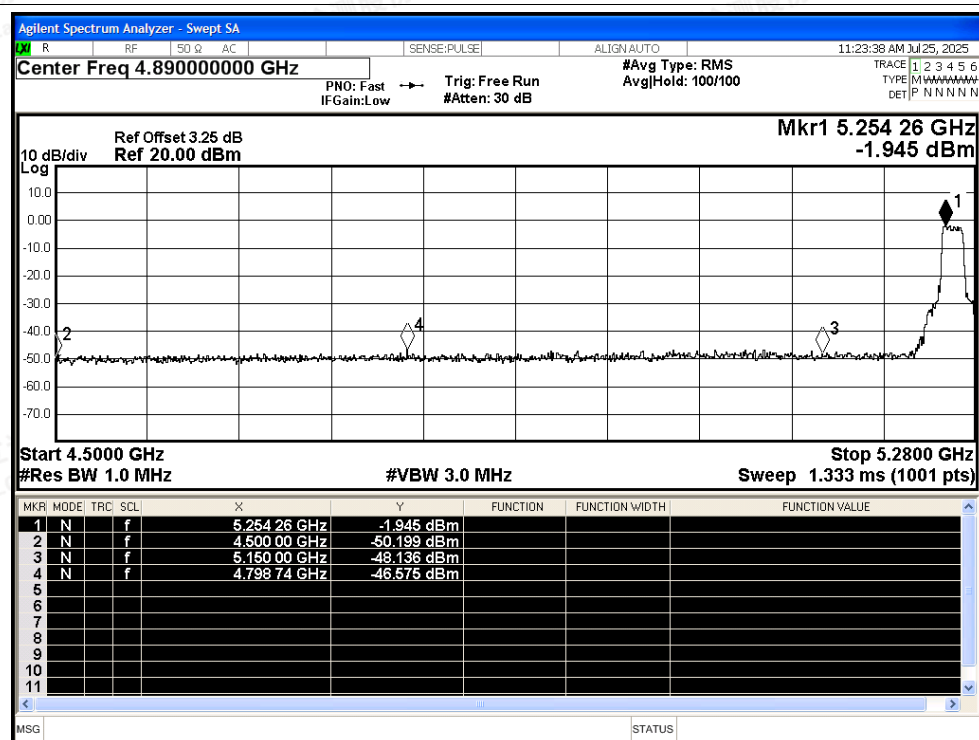

Restrict Band NVNT ac20 5260MHz Ant2 Average

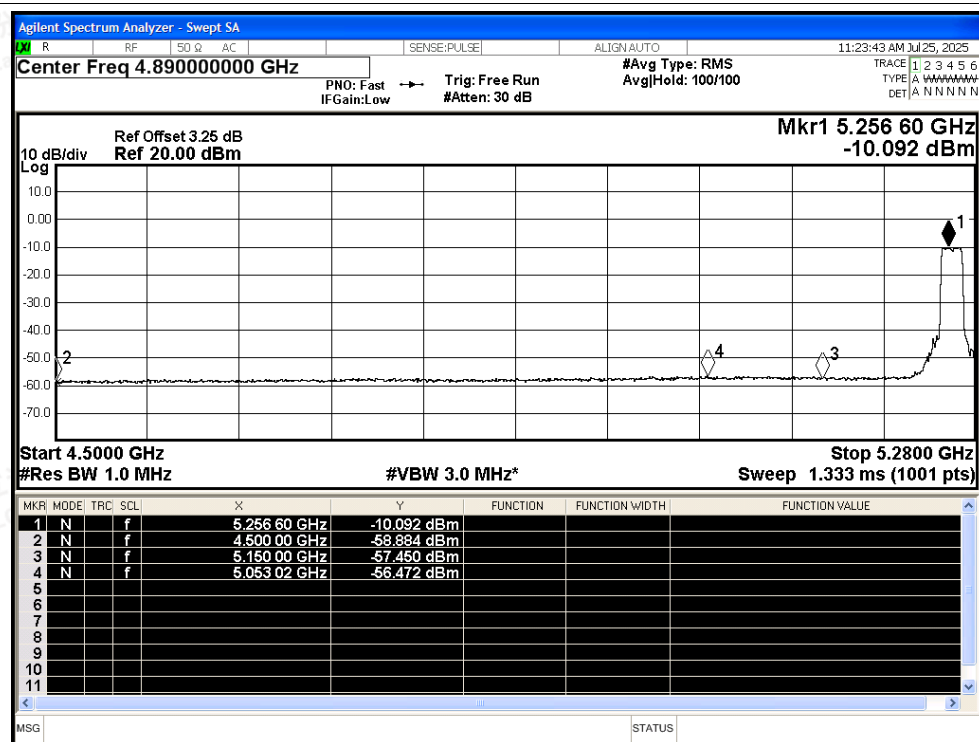

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5320MHz Ant2 Peak

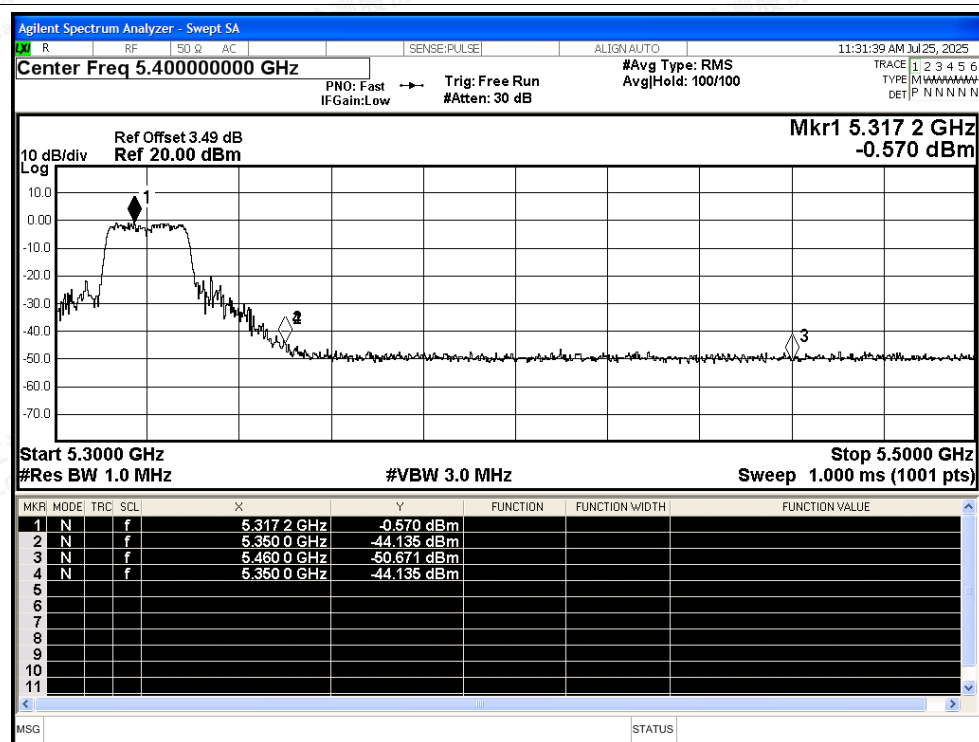

Restrict Band NVNT ac20 5320MHz Ant2 Average

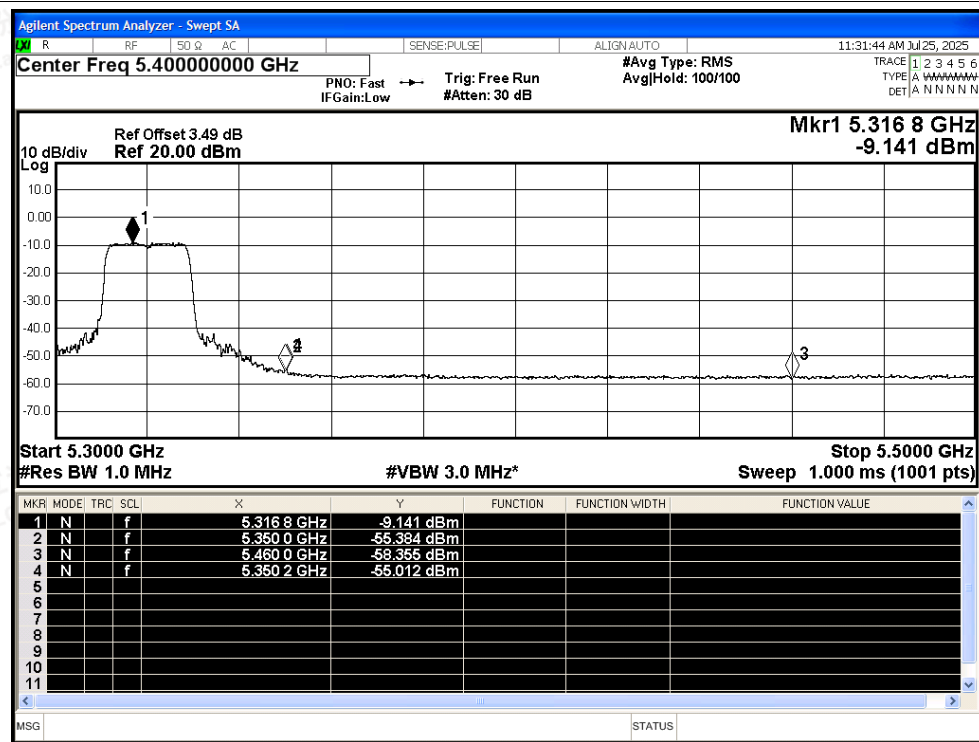

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5270MHz Ant2 Peak

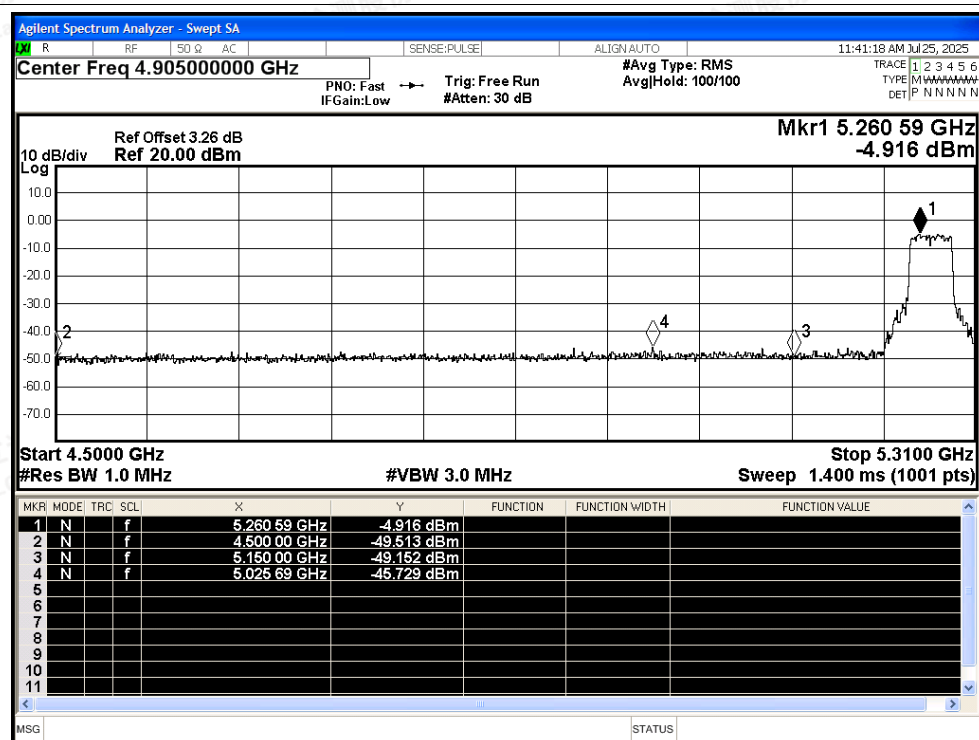

Restrict Band NVNT ac40 5270MHz Ant2 Average

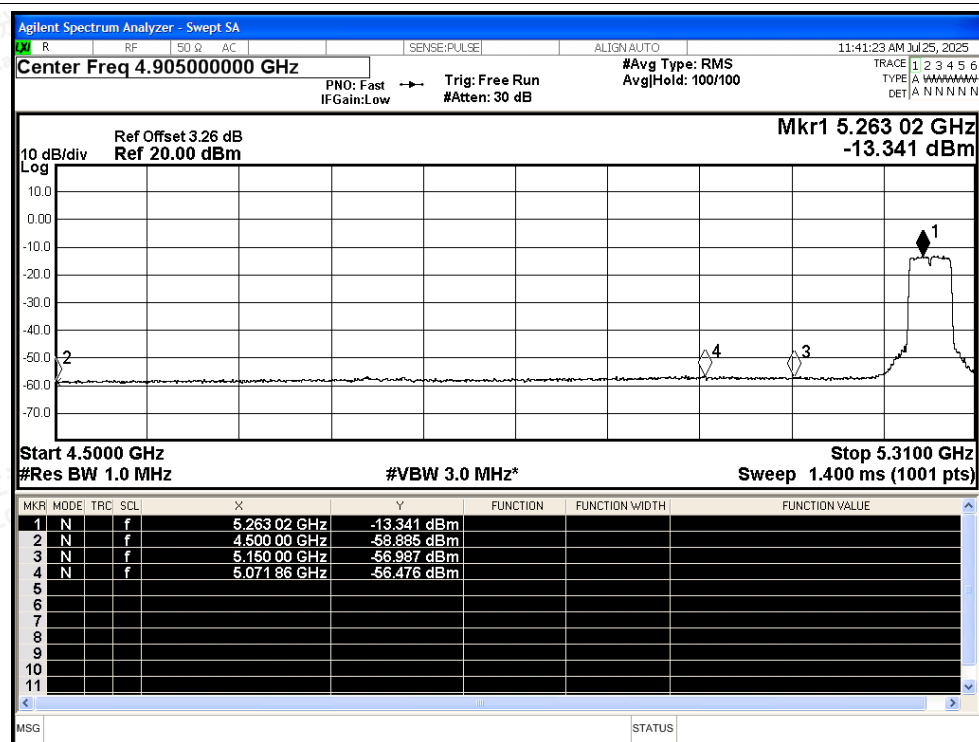

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5310MHz Ant2 Peak

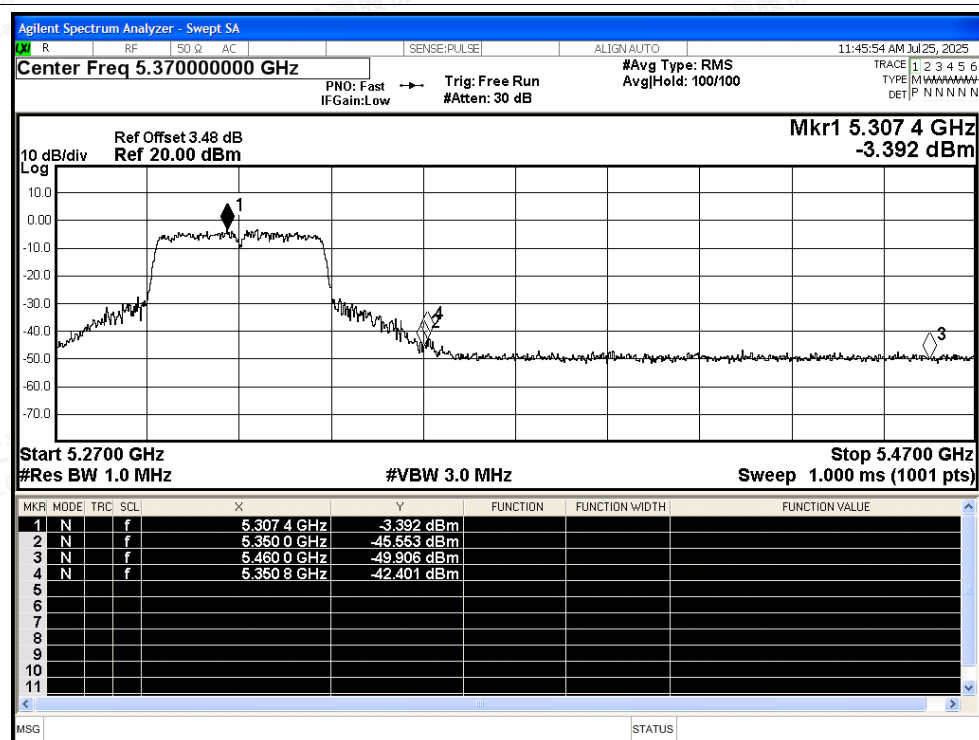

Restrict Band NVNT ac40 5310MHz Ant2 Average

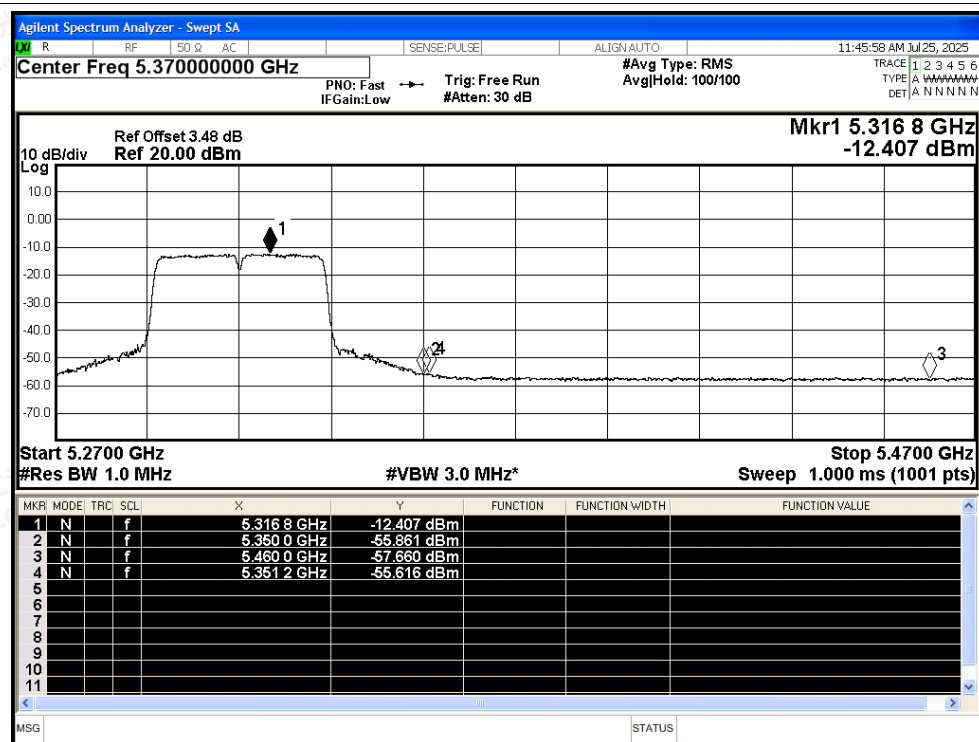

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5290MHz Ant2 Peak

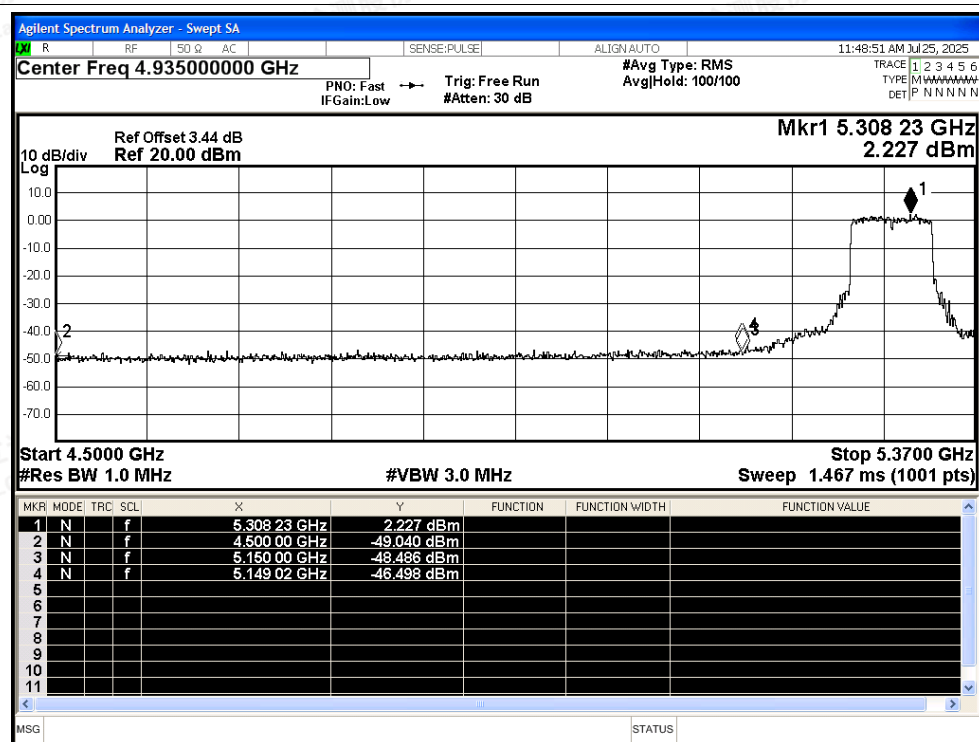

Restrict Band NVNT ac80 5290MHz Ant2 Average

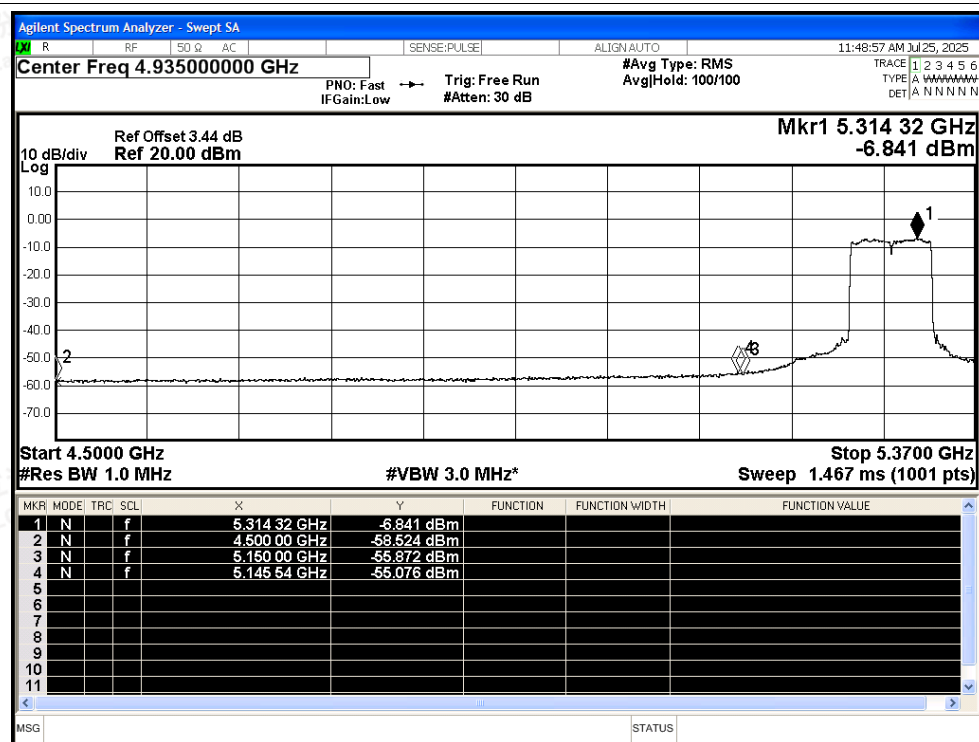

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5290MHz Ant2 Peak

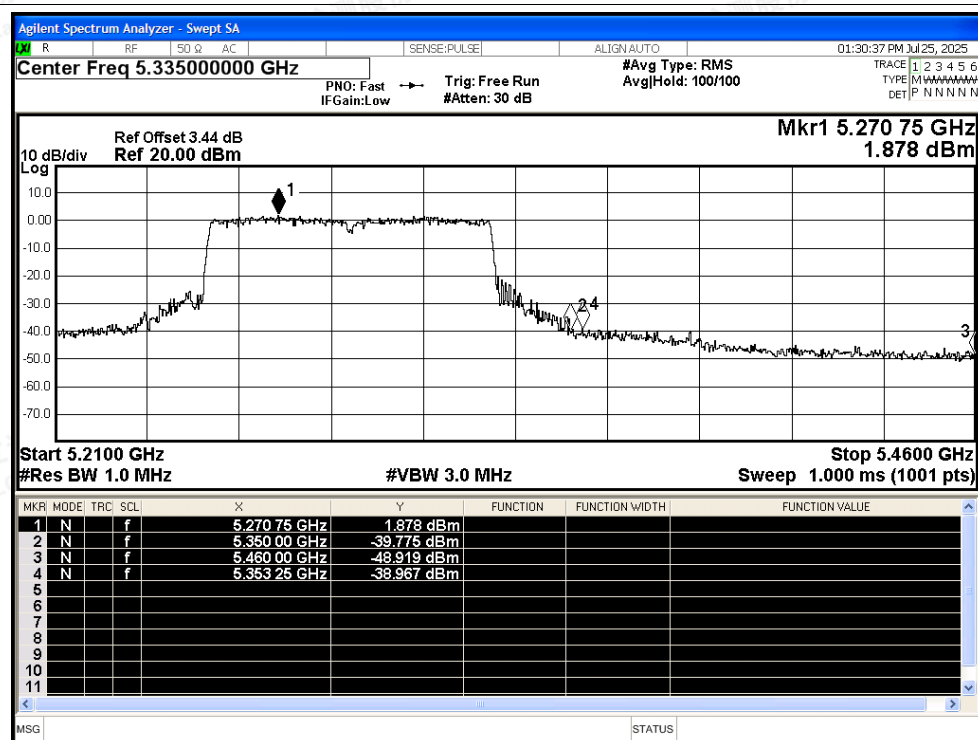

Restrict Band NVNT ac80 5290MHz Ant2 Average

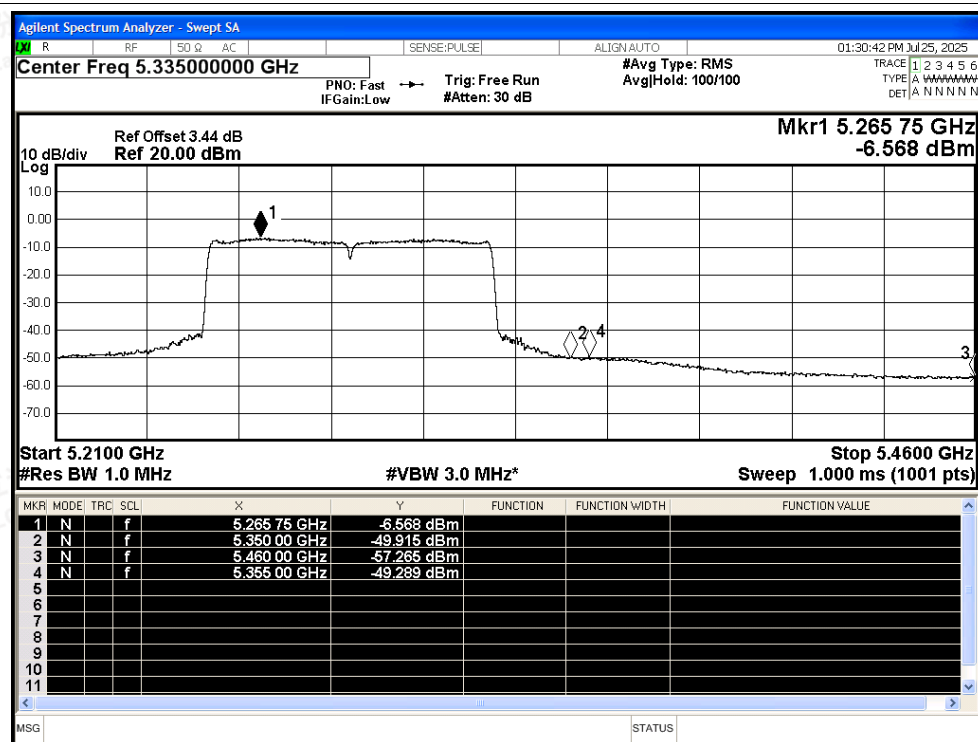

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5260MHz Ant2 Peak

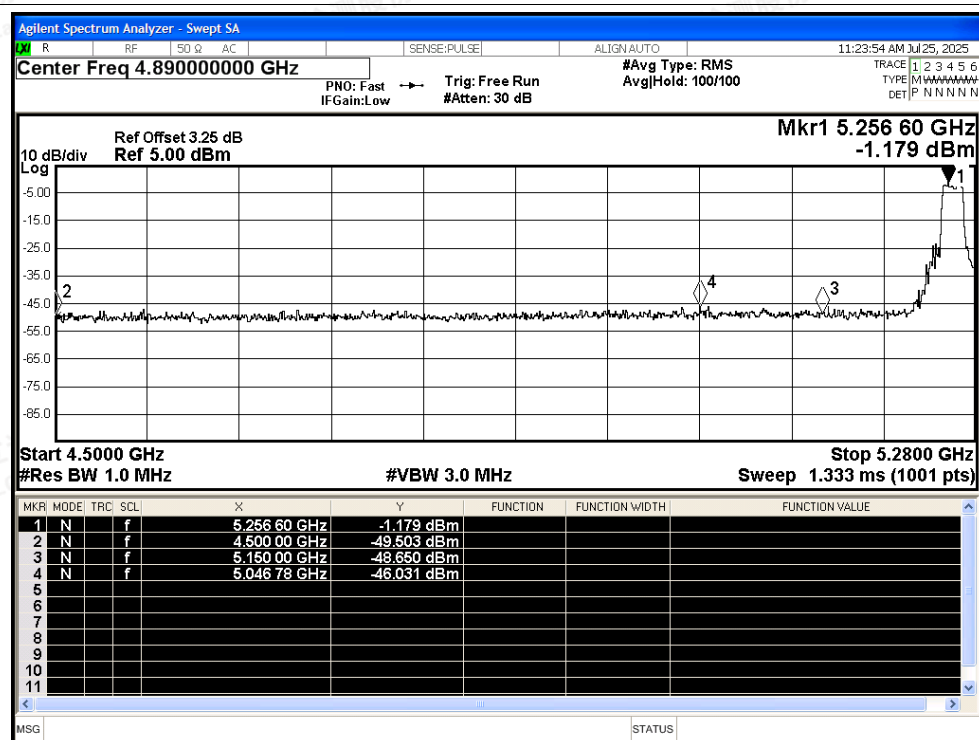

Restrict Band NVNT ax20 5260MHz Ant2 Average

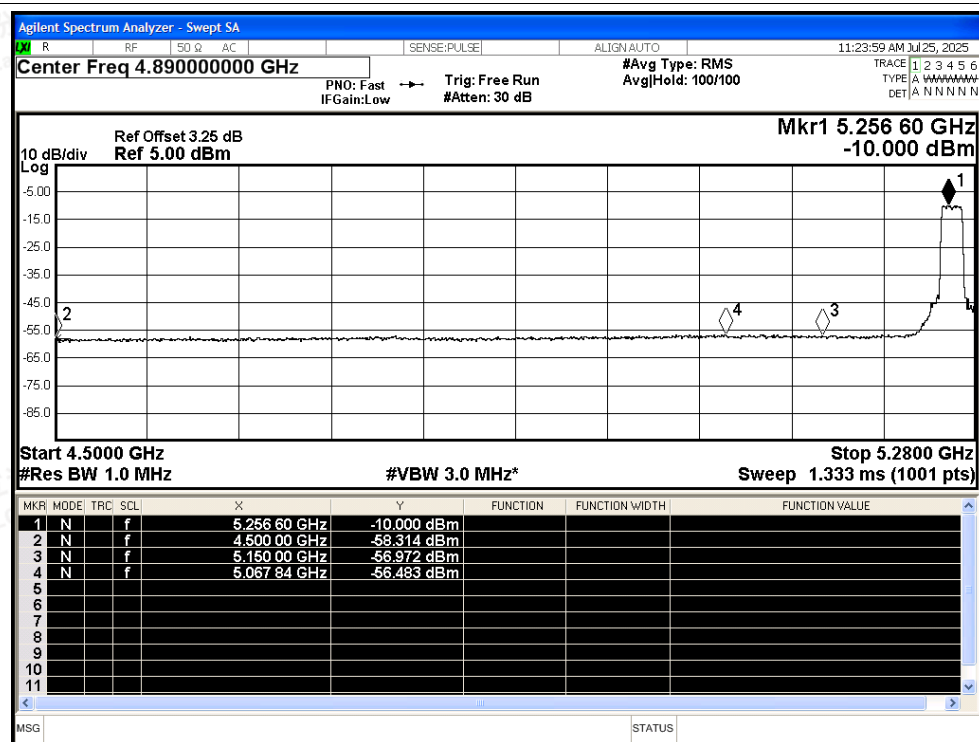

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5320MHz Ant2 Peak

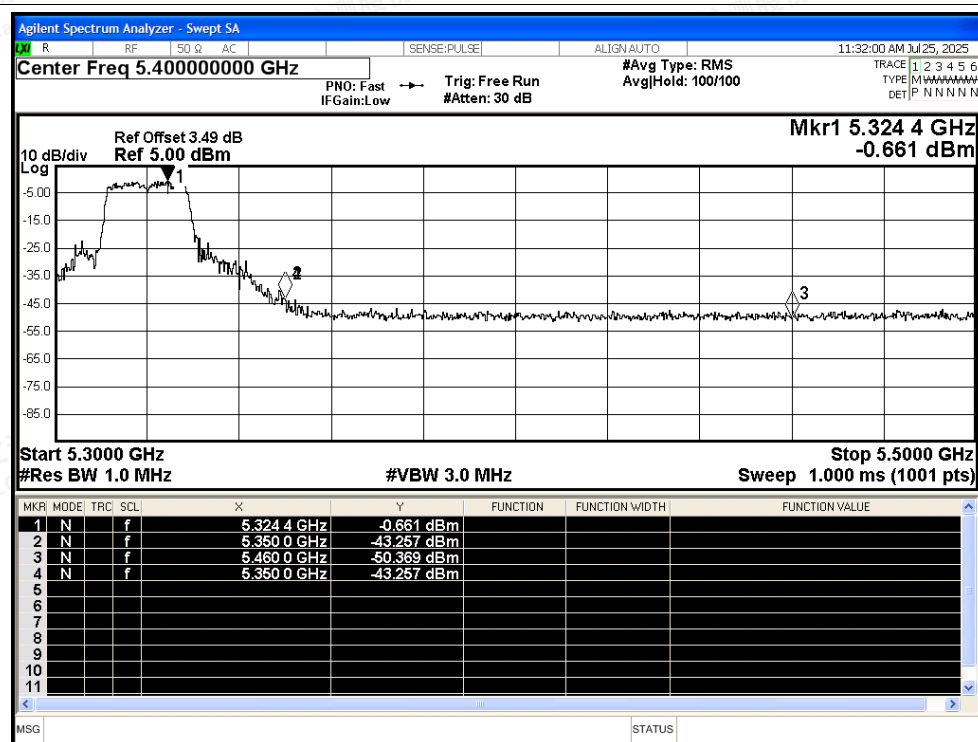

Restrict Band NVNT ax20 5320MHz Ant2 Average

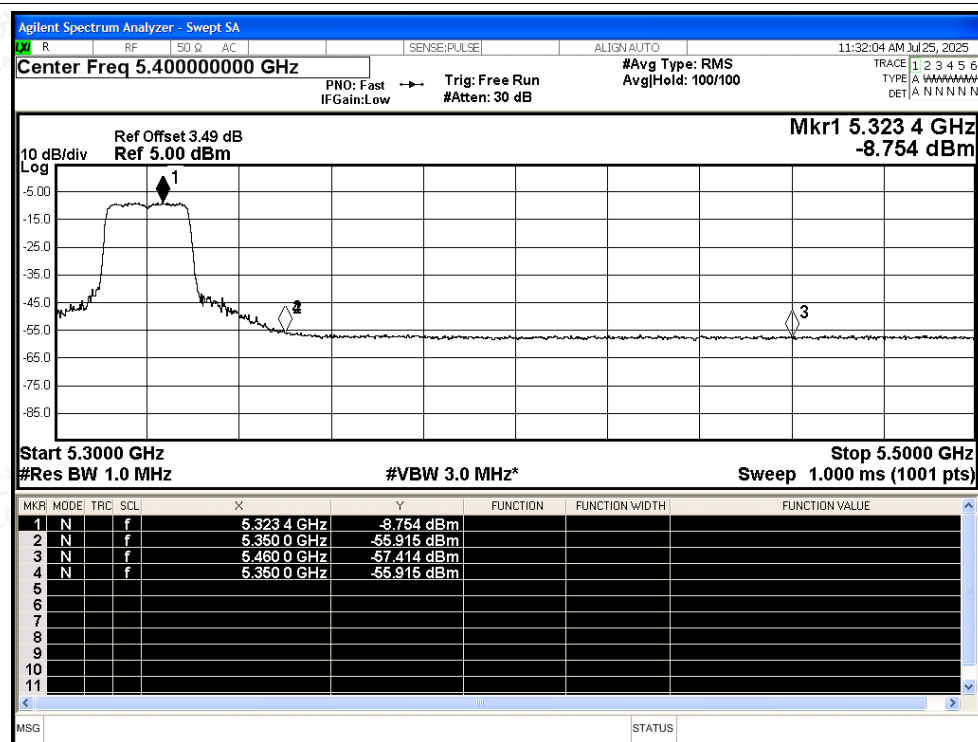

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5270MHz Ant2 Peak

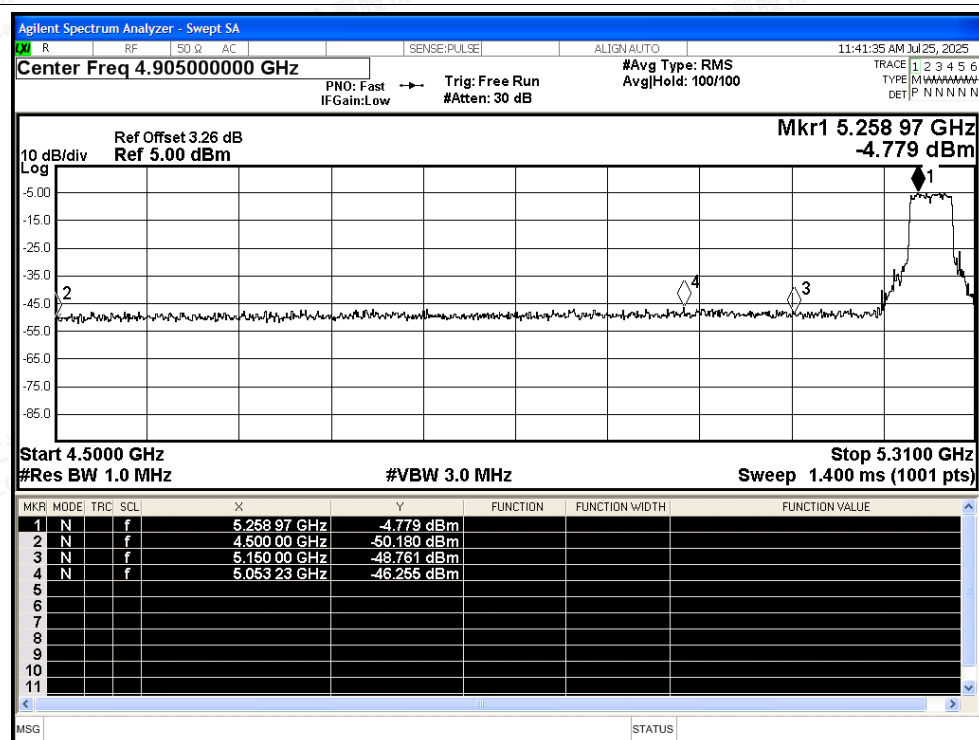

Restrict Band NVNT ax40 5270MHz Ant2 Average

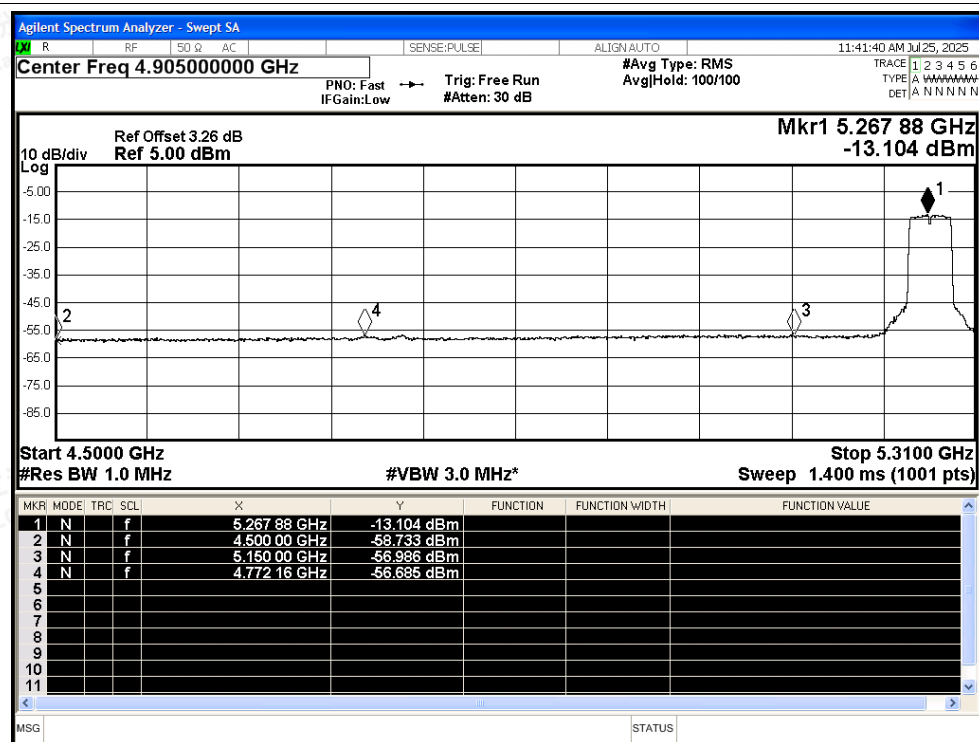

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5310MHz Ant2 Peak

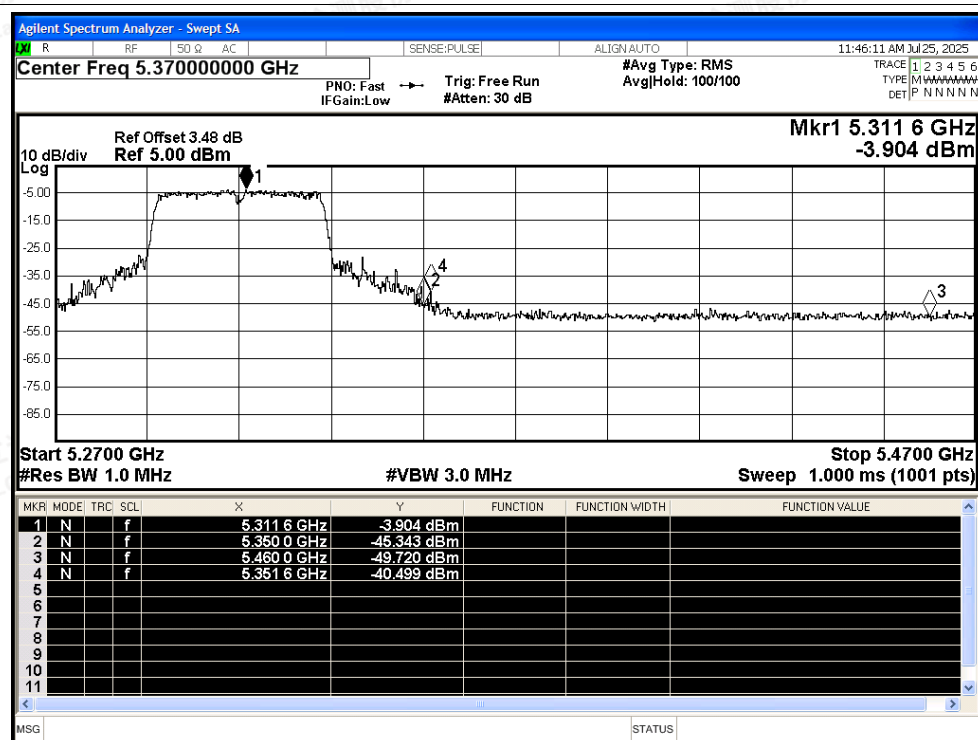

Restrict Band NVNT ax40 5310MHz Ant2 Average

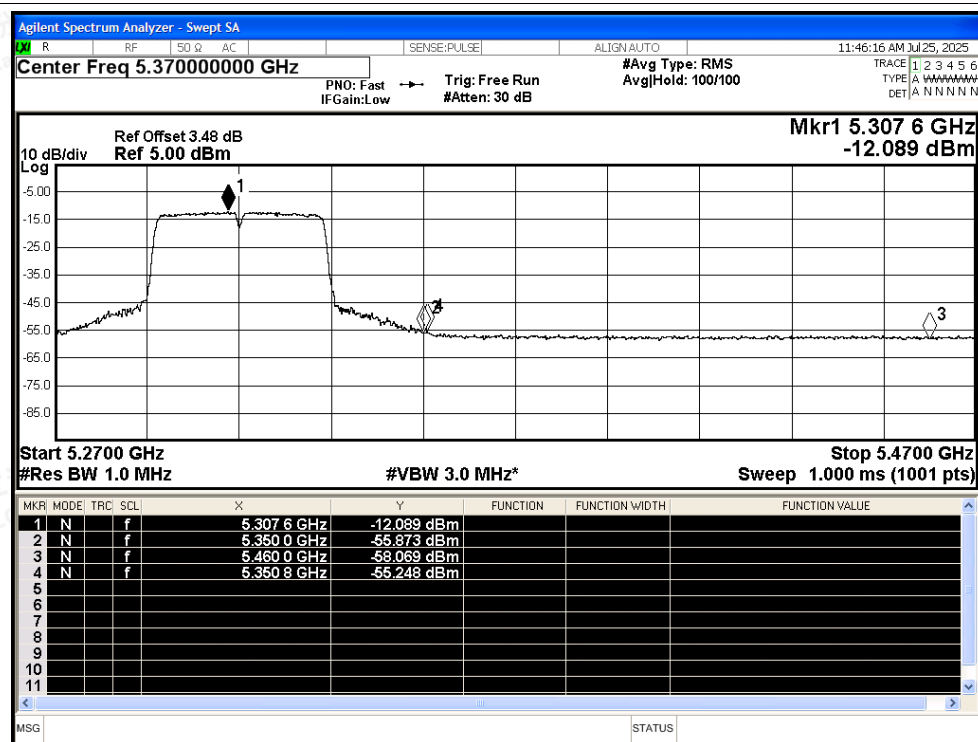

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5290MHz Ant2 Peak

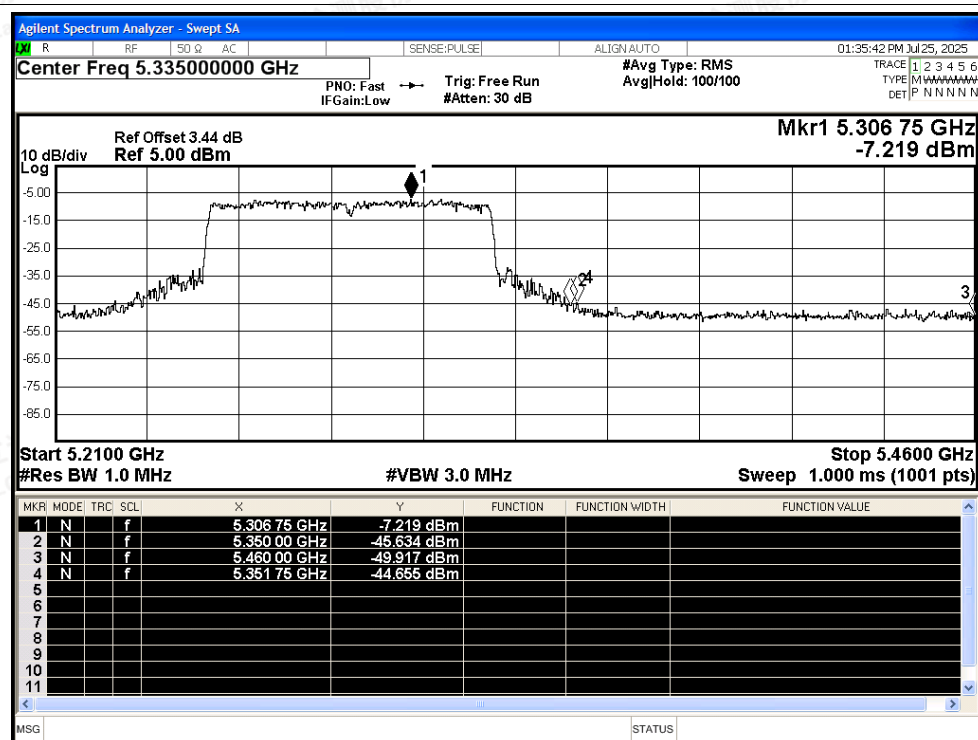

Restrict Band NVNT ax80 5290MHz Ant2 Average

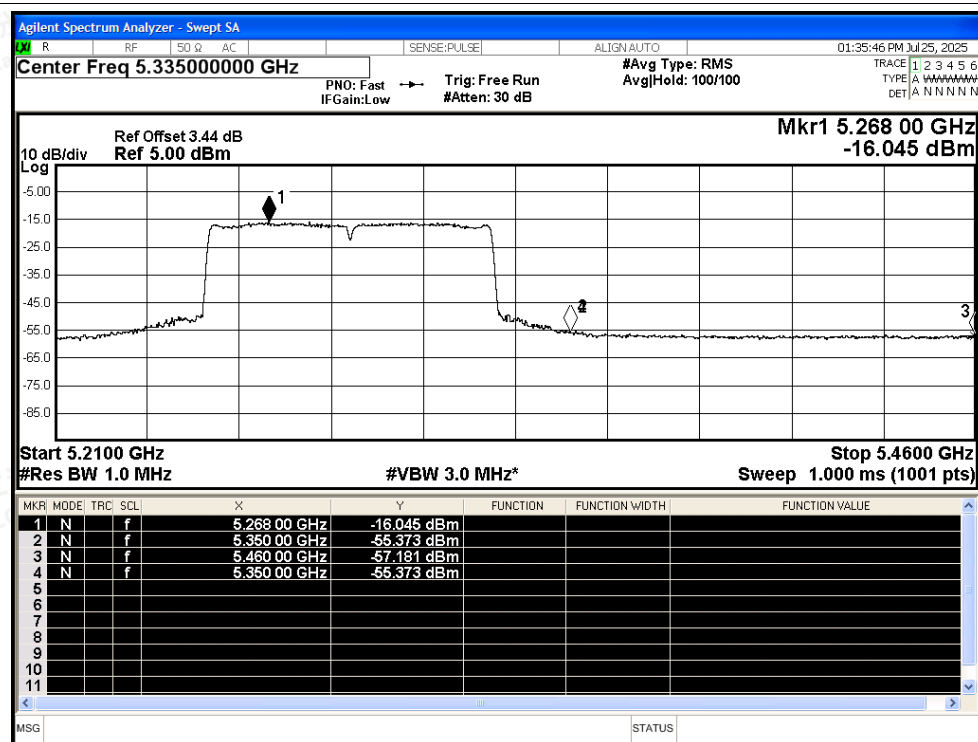

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5290MHz Ant2 Peak

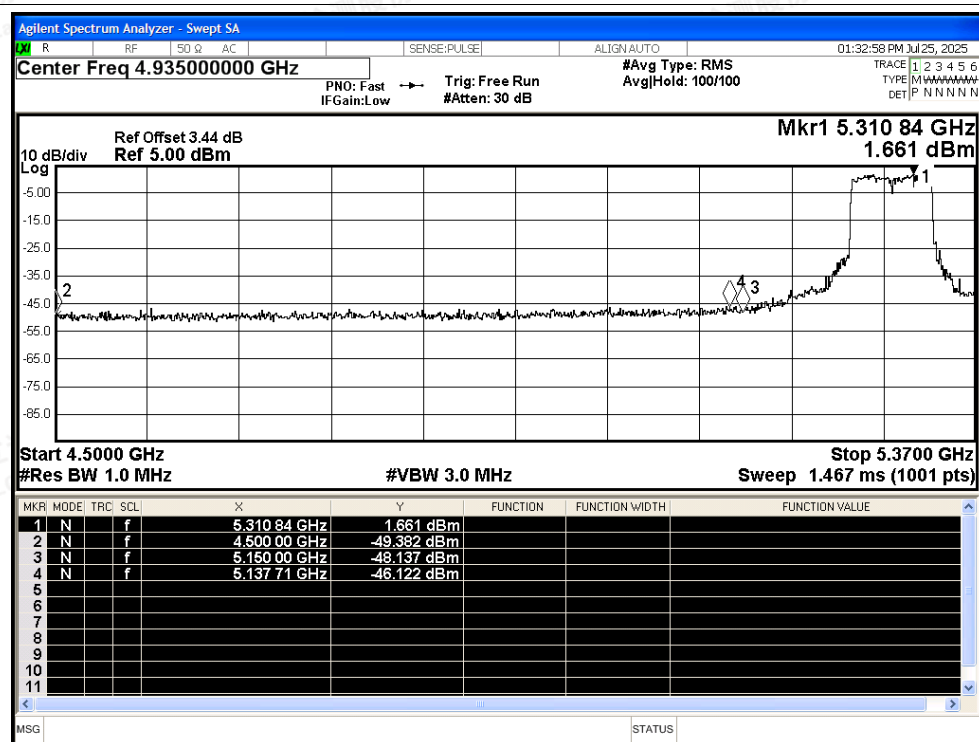

Restrict Band NVNT ax80 5290MHz Ant2 Average

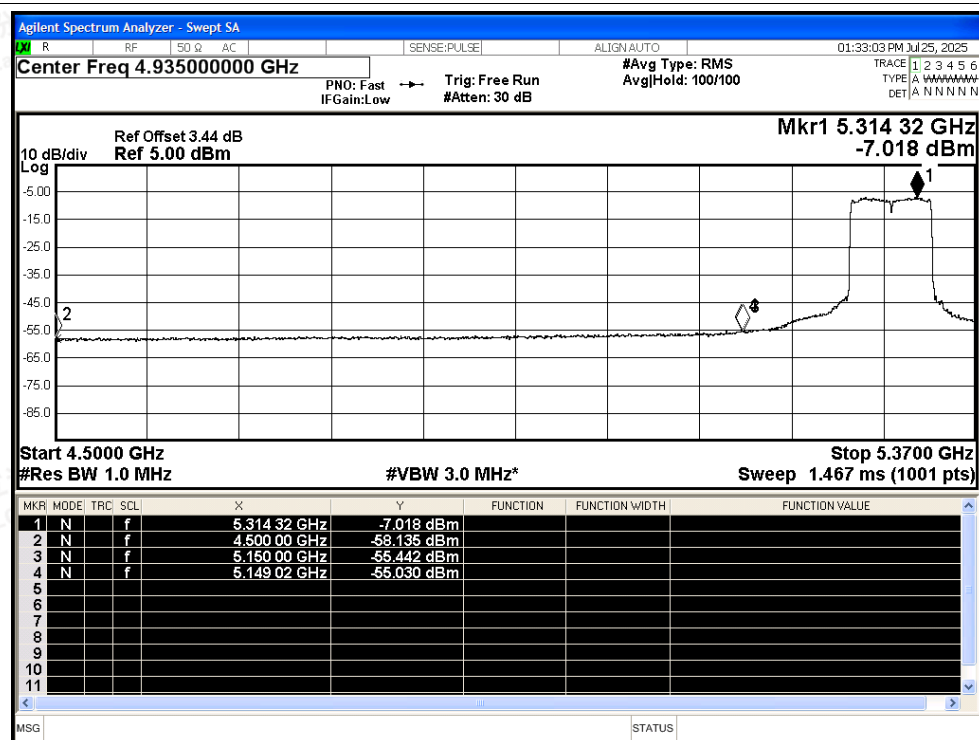

Restrict Band NVNT be20 5260MHz Ant2 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

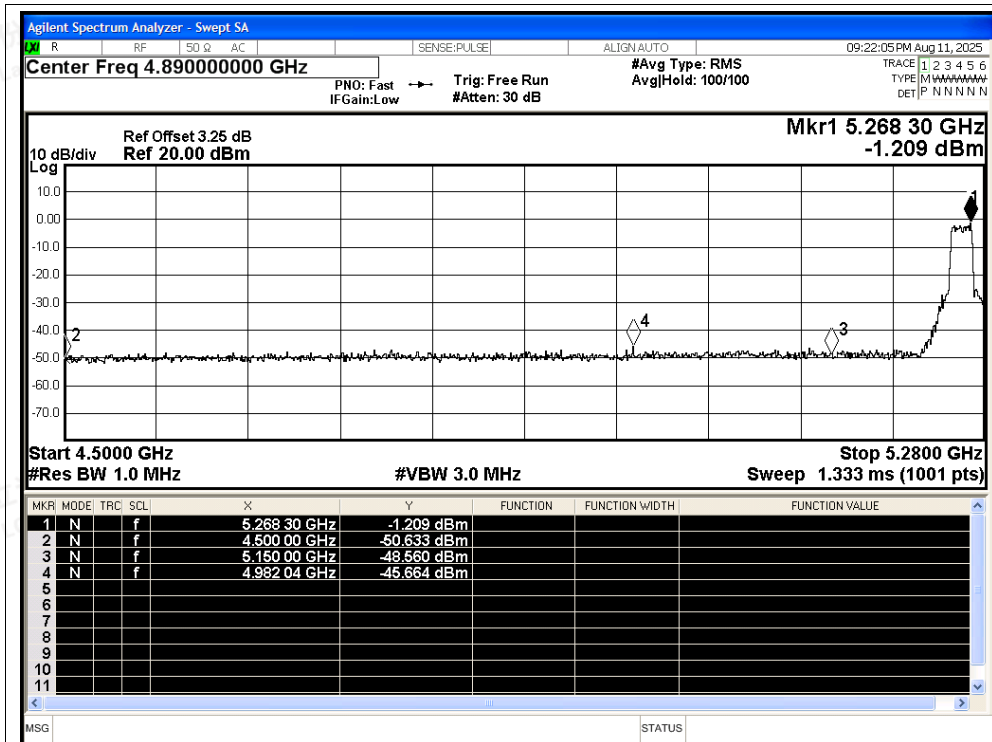

Restrict Band NVNT be20 5260MHz Ant2 Average

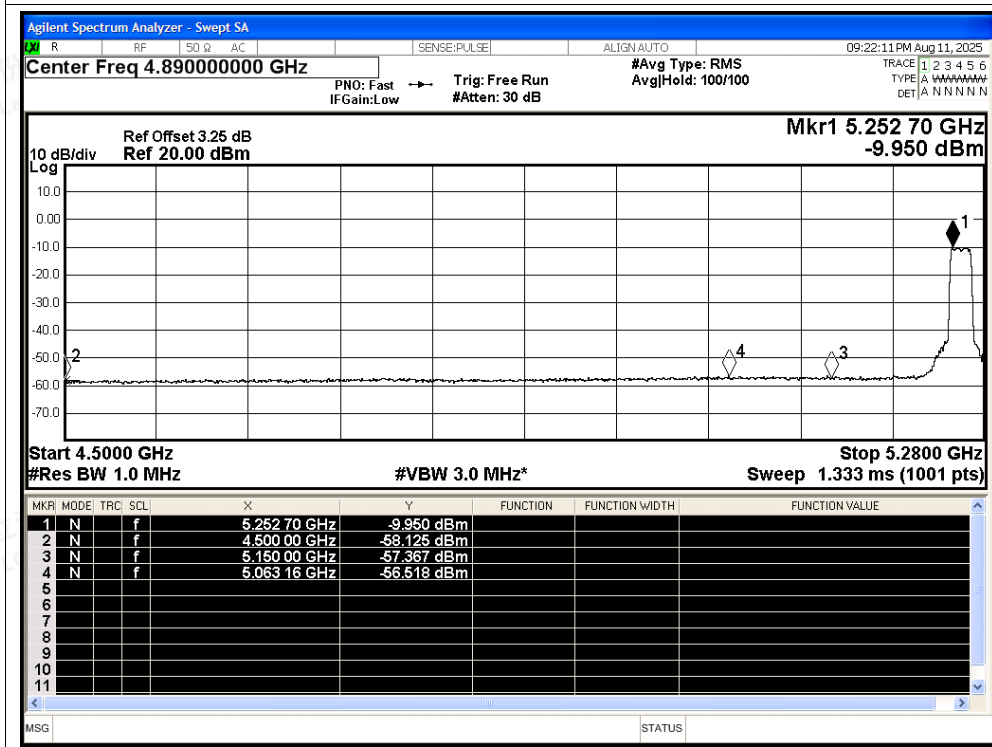

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be20 5320MHz Ant2 Peak

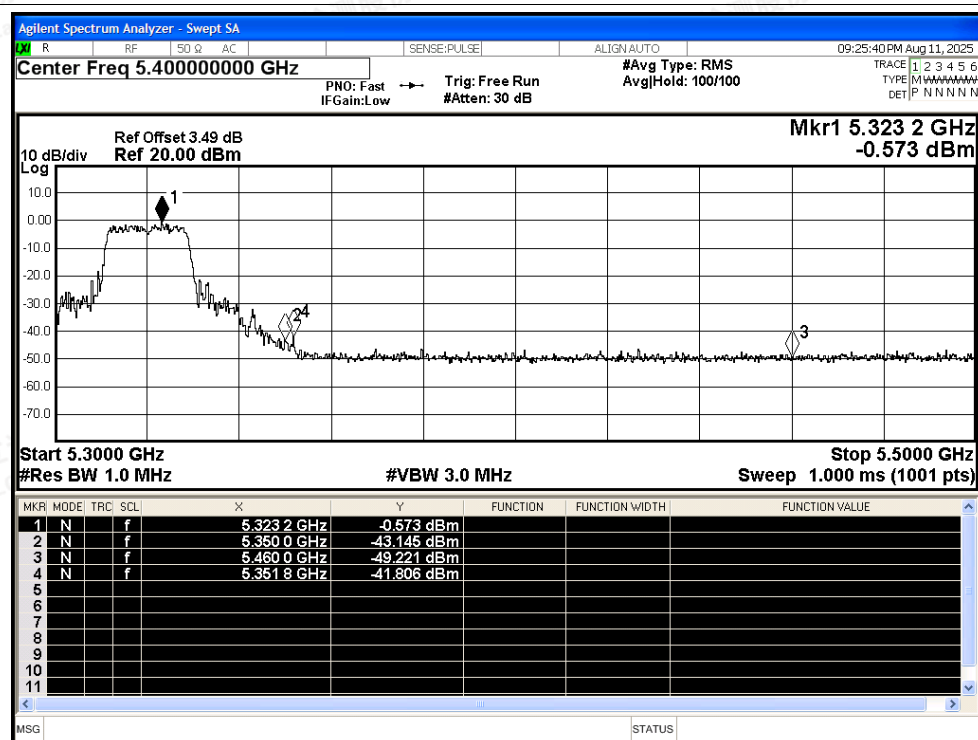

Restrict Band NVNT be20 5320MHz Ant2 Average

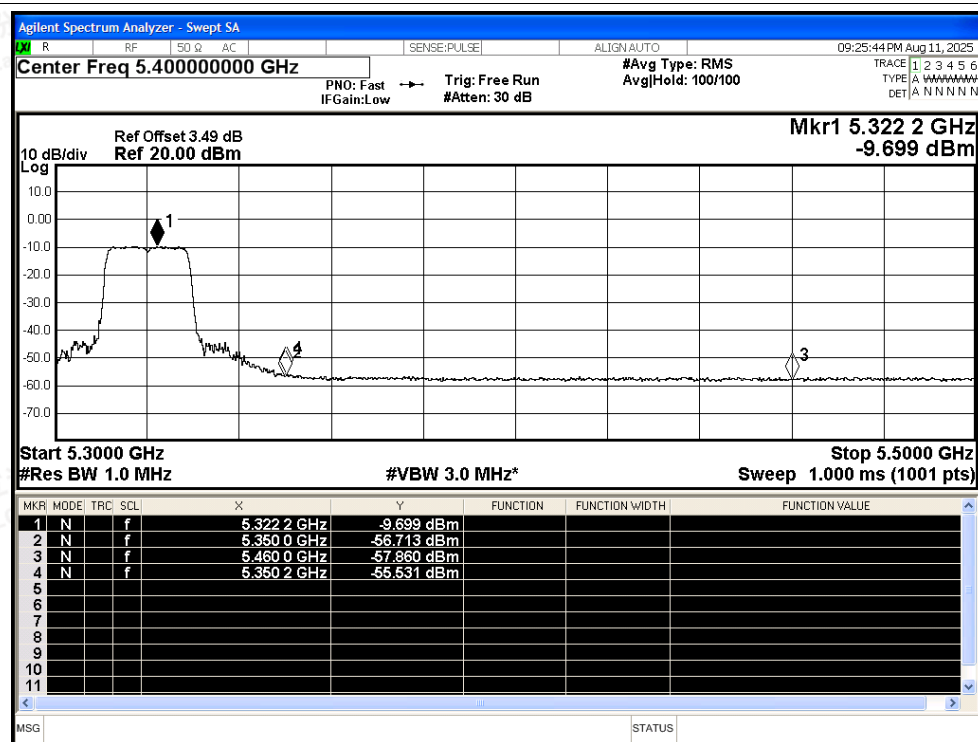

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be40 5270MHz Ant2 Peak

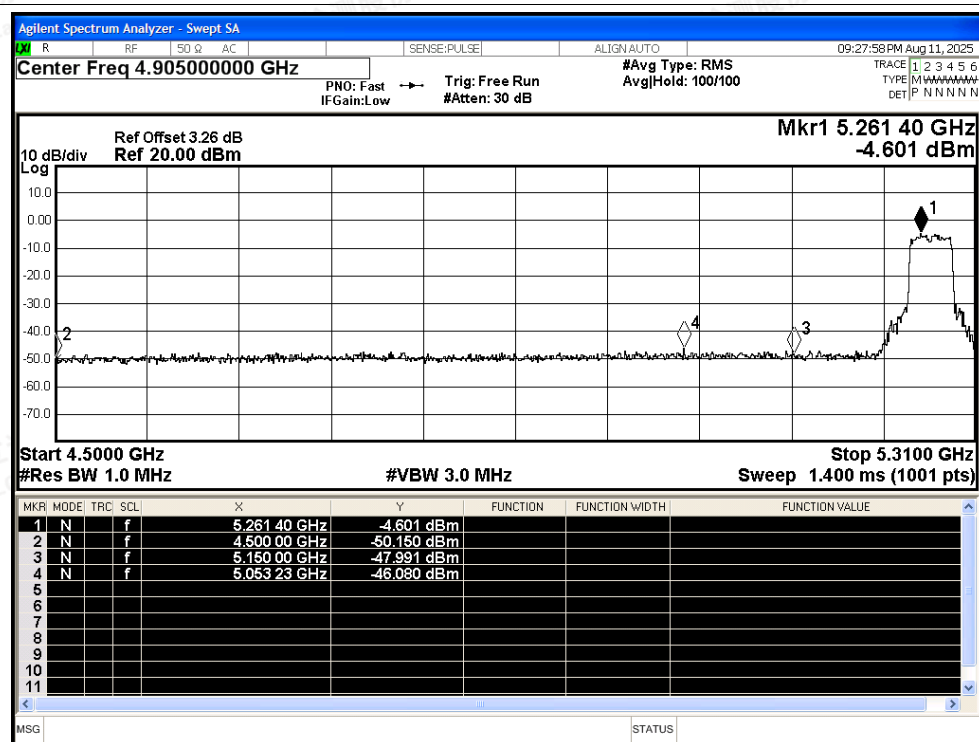

Restrict Band NVNT be40 5270MHz Ant2 Average

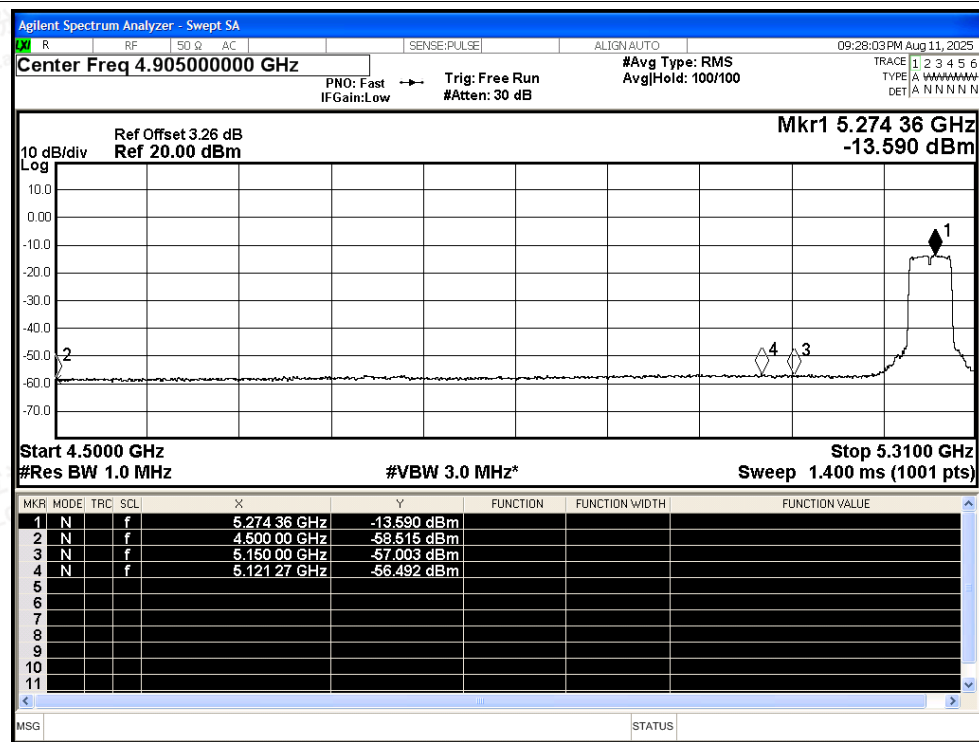

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be40 5310MHz Ant2 Peak

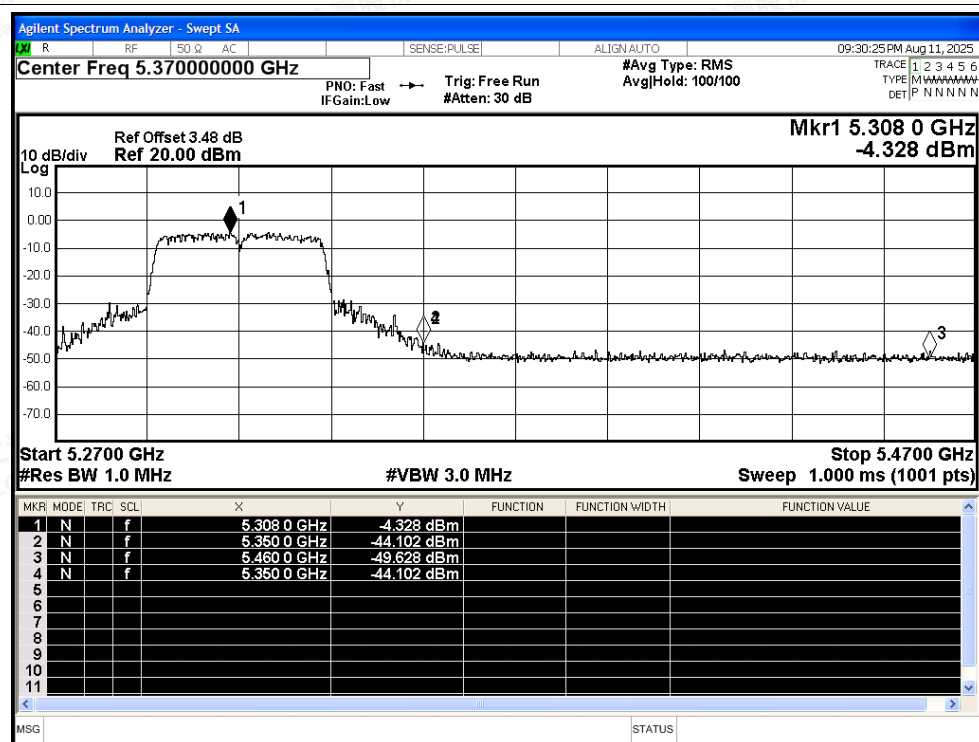

Restrict Band NVNT be40 5310MHz Ant2 Average

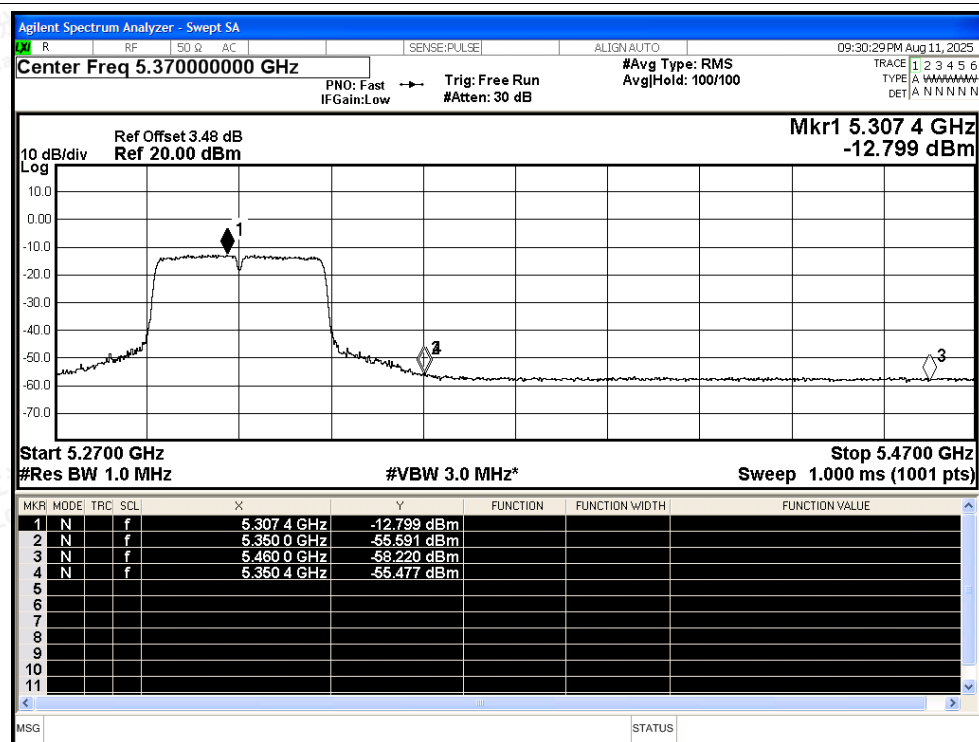

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be80 5290MHz Ant2 Peak

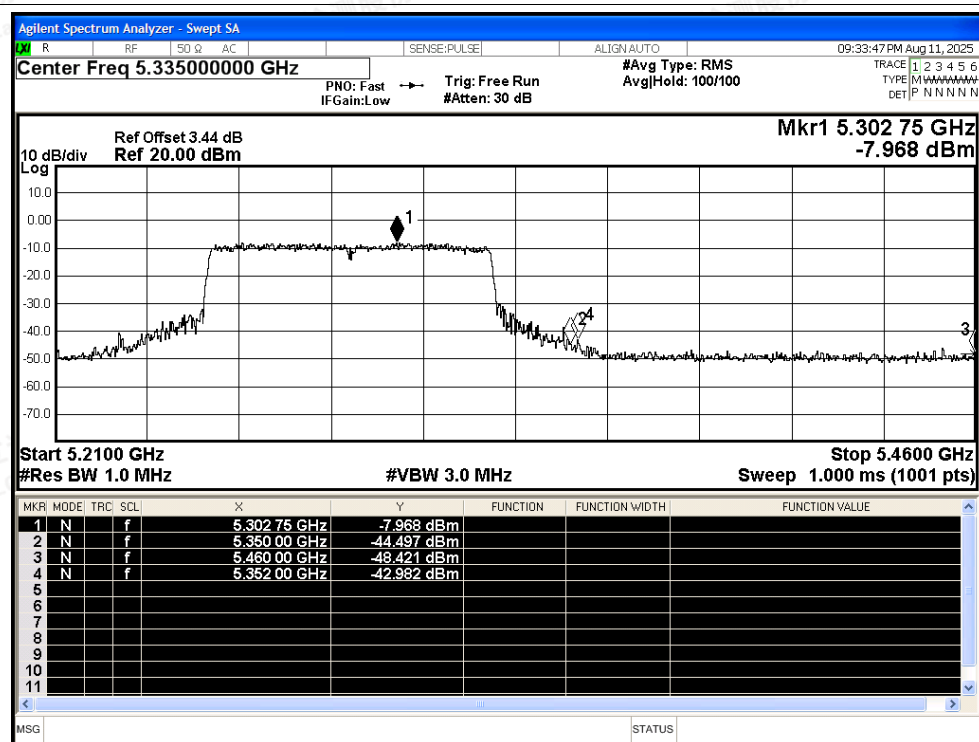

Restrict Band NVNT be80 5290MHz Ant2 Average

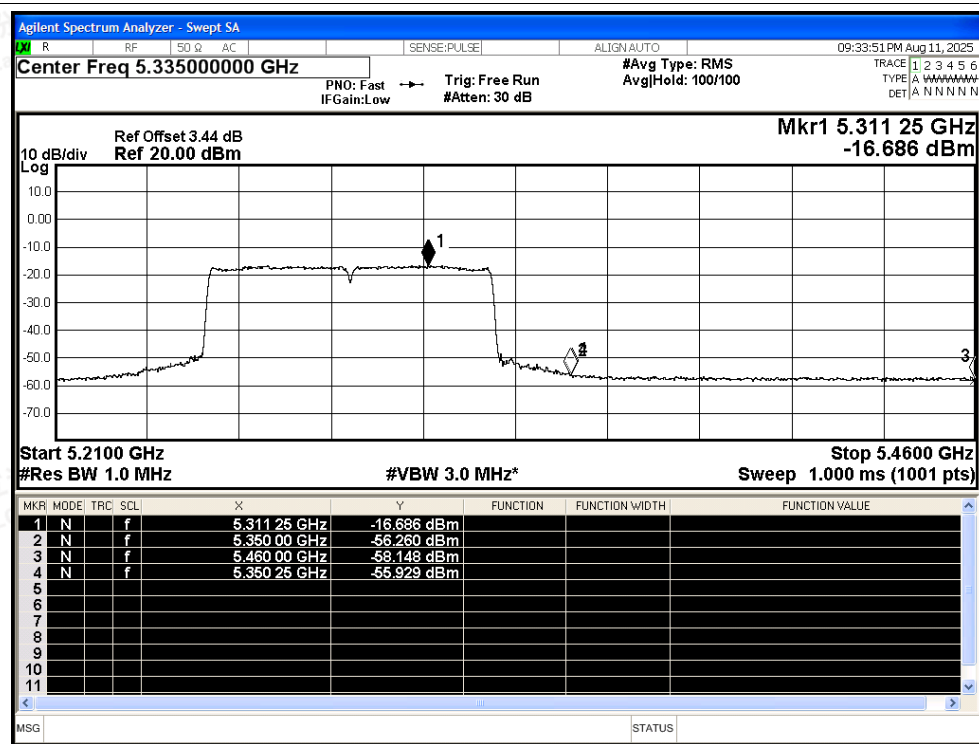

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be80 5290MHz Ant2 Peak

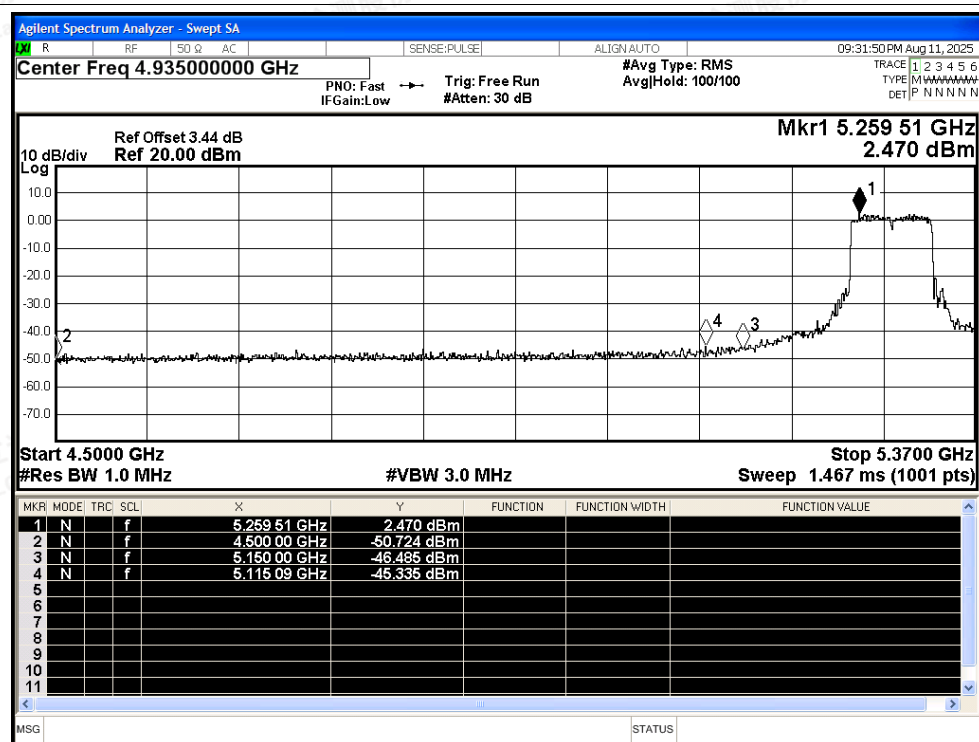

Restrict Band NVNT be80 5290MHz Ant2 Average

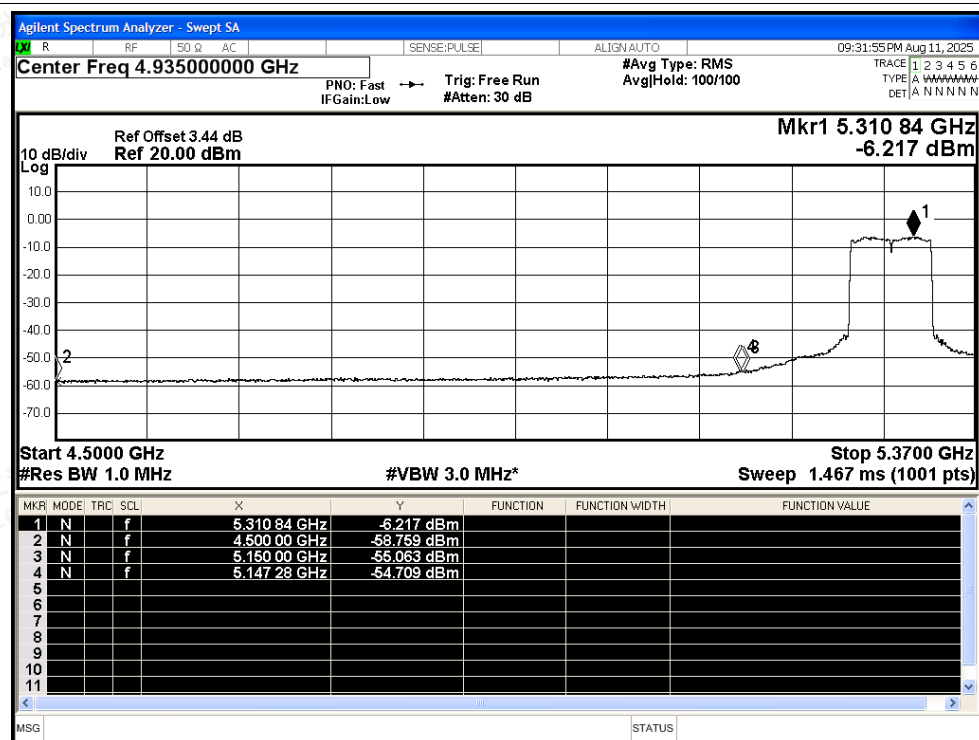

Restrict Band NVNT ac160 5250MHz Ant2 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

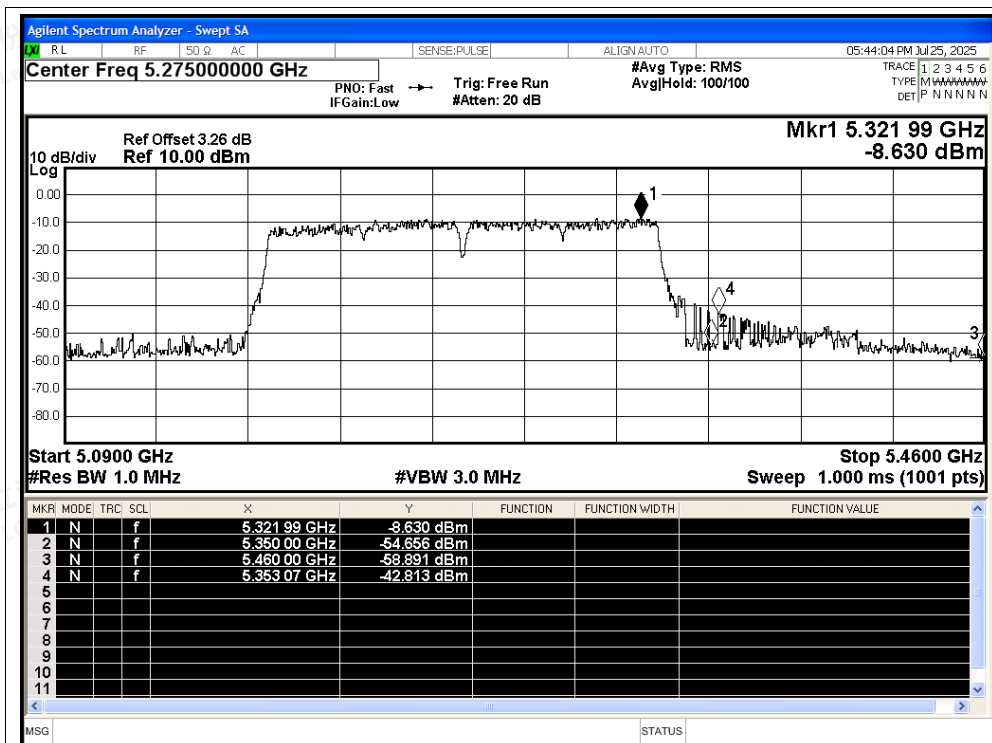

Restrict Band NVNT ac160 5250MHz Ant2 Average

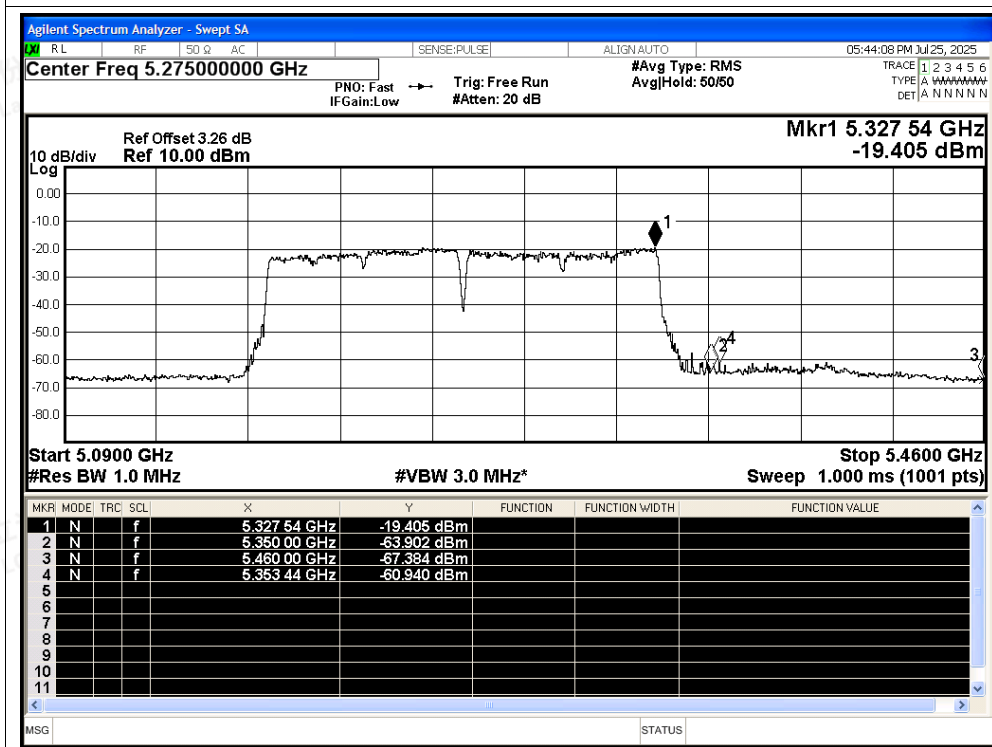

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac160 5250MHz Ant2 Peak

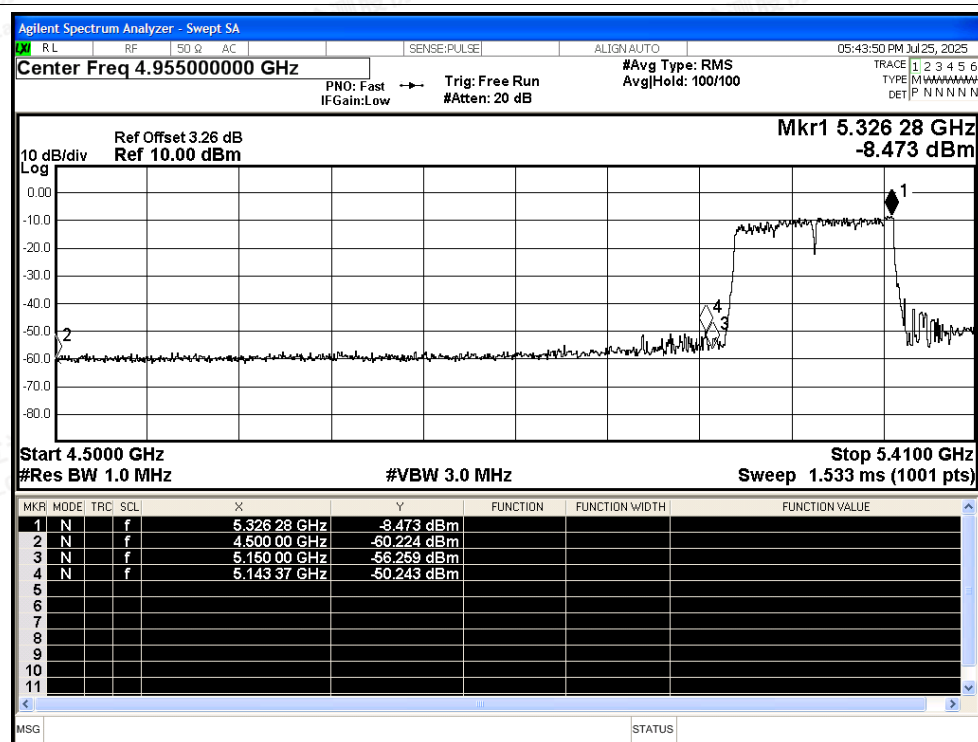

Restrict Band NVNT ac160 5250MHz Ant2 Average

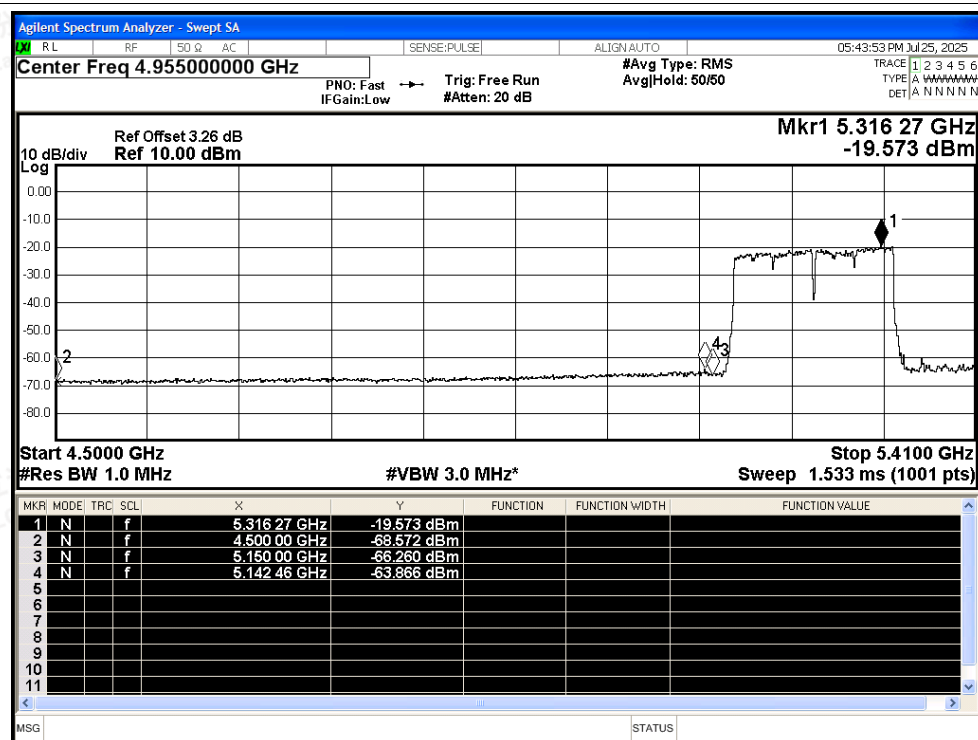

Restrict Band NVNT ax160 5250MHz Ant2 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

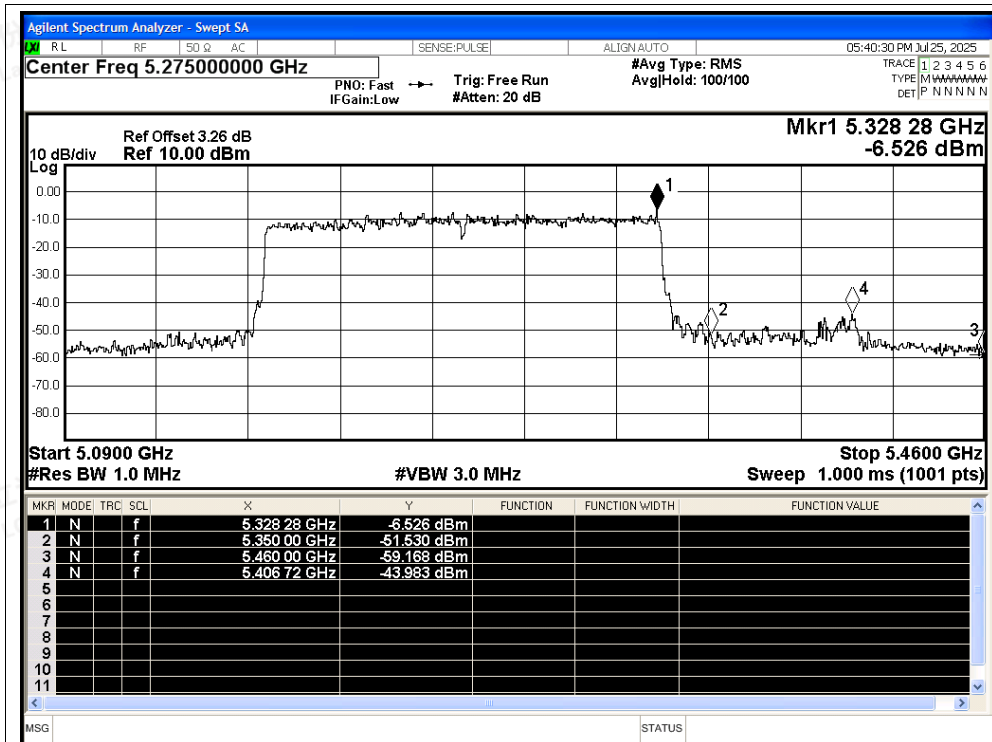

Restrict Band NVNT ax160 5250MHz Ant2 Average

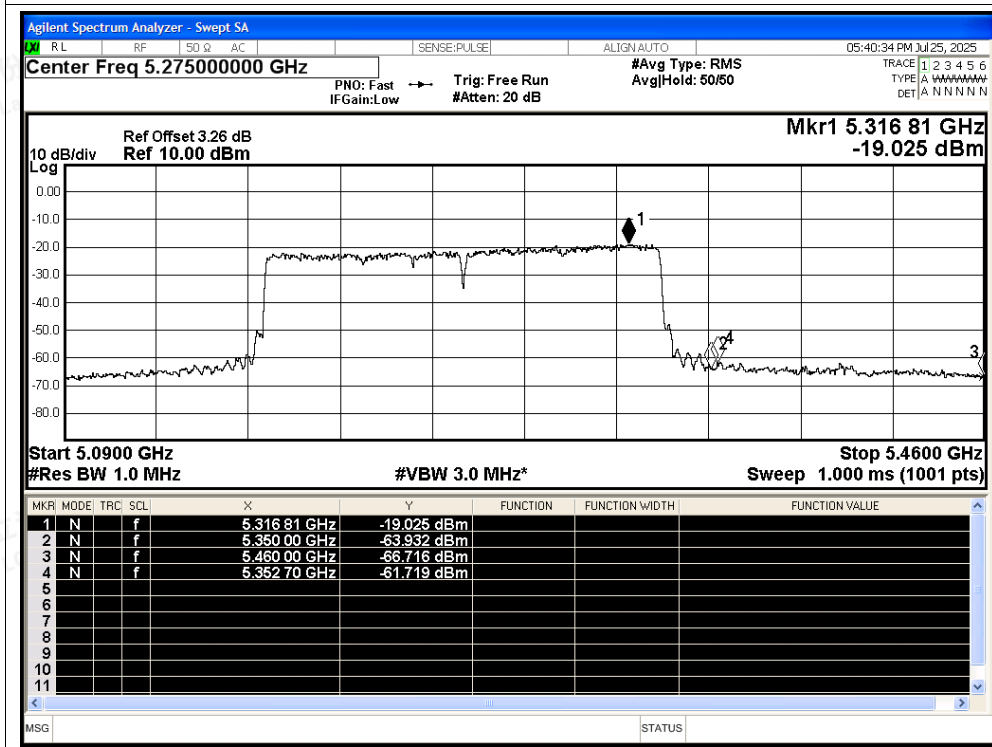

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax160 5250MHz Ant2 Peak

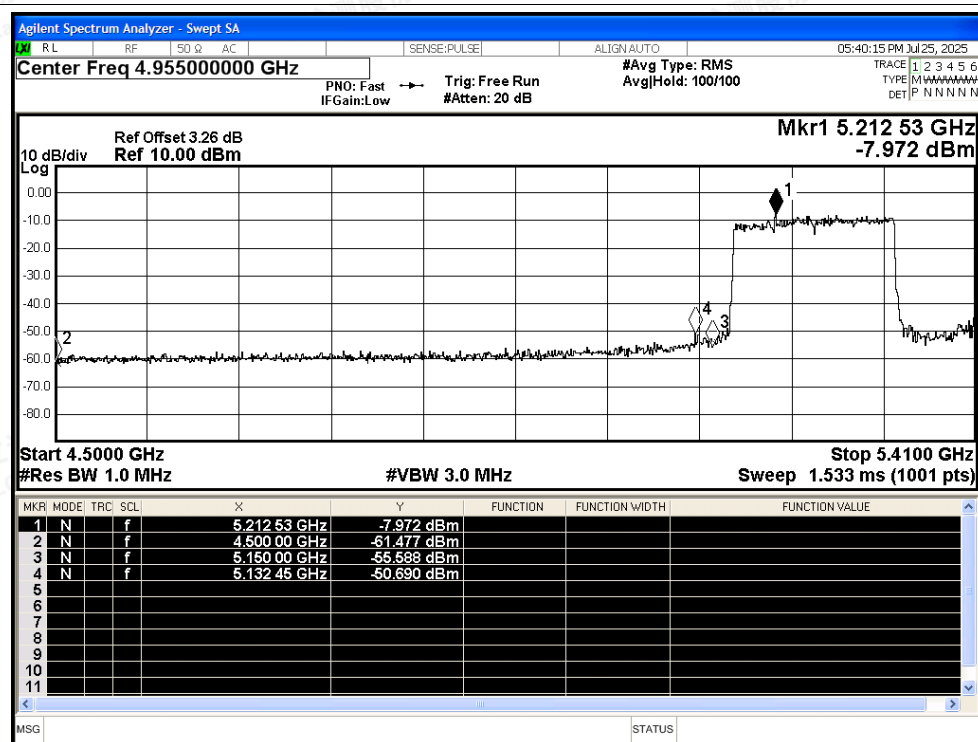

Restrict Band NVNT ax160 5250MHz Ant2 Average

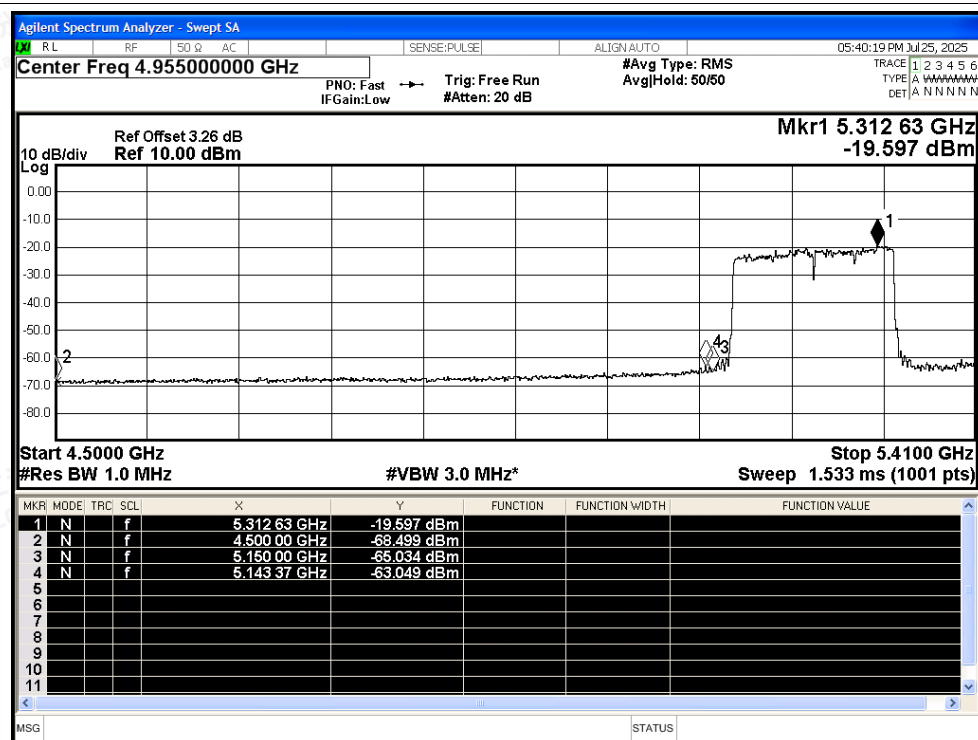

Restrict Band NVNT be160 5250MHz Ant2 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

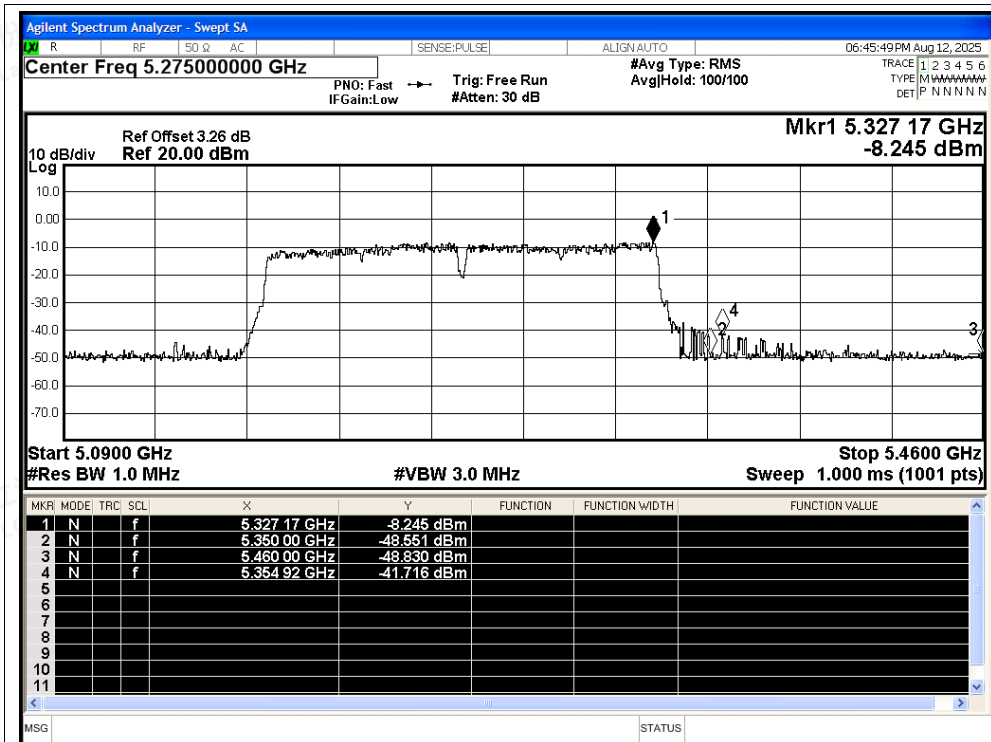

Restrict Band NVNT be160 5250MHz Ant2 Average

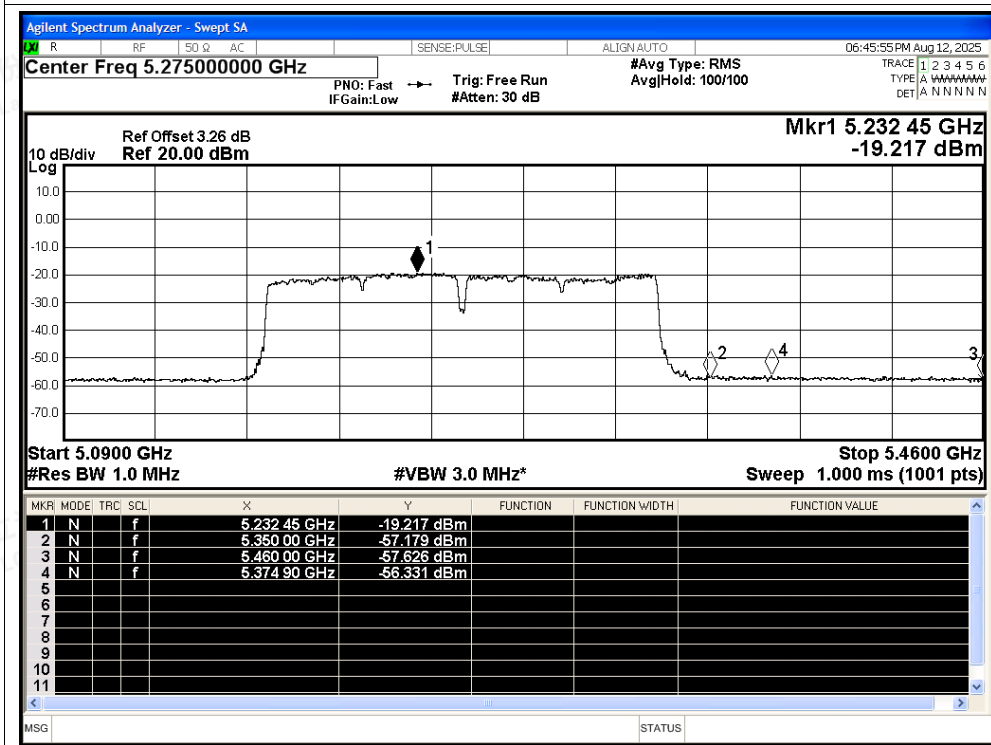

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be160 5250MHz Ant2 Peak

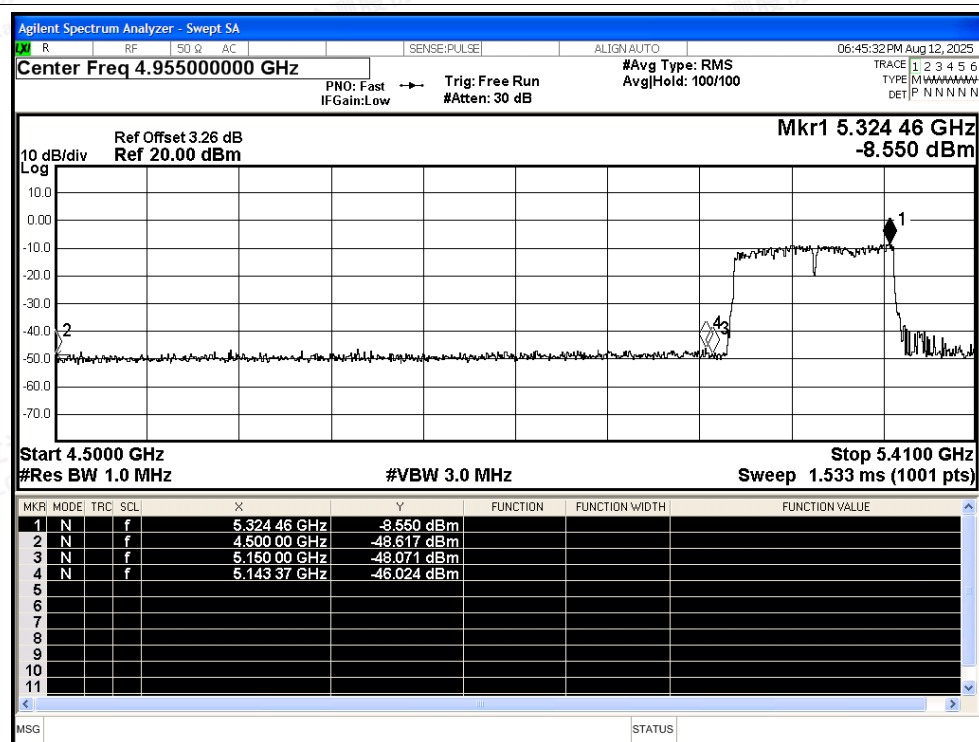

Restrict Band NVNT be160 5250MHz Ant2 Average

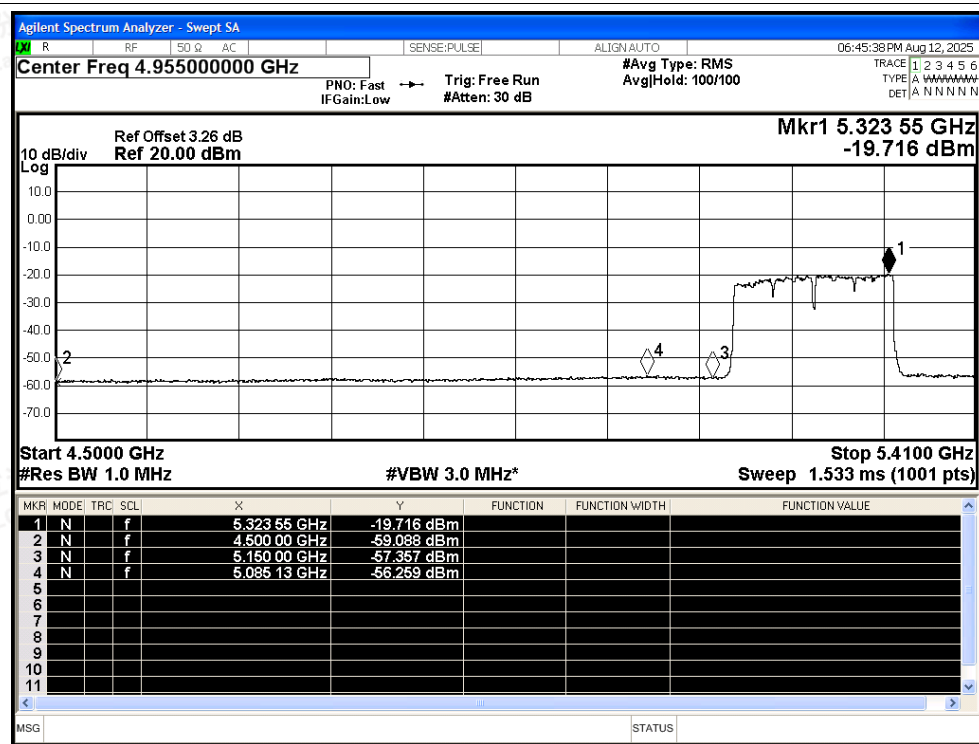

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5260	Ant3	4500	-52.01	3.77	-	46.99	Peak	68.2	Pass
NVNT	a	5260	Ant3	4500	-58.91	3.77	0.24	40.33	Average	54	Pass
NVNT	a	5260	Ant3	5049.9	-46.24	3.77	-	52.76	Peak	68.2	Pass
NVNT	a	5260	Ant3	5063.16	-56.61	3.77	0.24	42.63	Average	54	Pass
NVNT	a	5260	Ant3	5150	-49.24	3.77	-	49.76	Peak	68.2	Pass
NVNT	a	5260	Ant3	5150	-57.07	3.77	0.24	42.17	Average	54	Pass
NVNT	a	5320	Ant3	5350	-47.64	3.77	-	51.36	Peak	68.2	Pass
NVNT	a	5320	Ant3	5350	-56.62	3.77	0.24	42.62	Average	54	Pass
NVNT	a	5320	Ant3	5351	-44.31	3.77	-	54.69	Peak	68.2	Pass
NVNT	a	5320	Ant3	5350.8	-56.24	3.77	0.24	43.00	Average	54	Pass
NVNT	a	5320	Ant3	5460	-50.26	3.77	-	48.74	Peak	68.2	Pass
NVNT	a	5320	Ant3	5460	-58.18	3.77	0.24	41.06	Average	54	Pass
NVNT	n20	5260	Ant3	4500	-50.85	3.77	-	48.15	Peak	68.2	Pass
NVNT	n20	5260	Ant3	4500	-58.62	3.77	0.12	40.50	Average	54	Pass
NVNT	n20	5260	Ant3	5027.28	-45.53	3.77	-	53.47	Peak	68.2	Pass
NVNT	n20	5260	Ant3	5147.4	-56.59	3.77	0.12	42.53	Average	54	Pass
NVNT	n20	5260	Ant3	5150	-49.3	3.77	-	49.70	Peak	68.2	Pass
NVNT	n20	5260	Ant3	5150	-56.86	3.77	0.12	42.26	Average	54	Pass
NVNT	n20	5320	Ant3	5350	-46	3.77	-	53.00	Peak	68.2	Pass
NVNT	n20	5320	Ant3	5350	-56.01	3.77	0.12	43.11	Average	54	Pass
NVNT	n20	5320	Ant3	5351.2	-44.41	3.77	-	54.59	Peak	68.2	Pass
NVNT	n20	5320	Ant3	5350.8	-55.29	3.77	0.12	43.83	Average	54	Pass
NVNT	n20	5320	Ant3	5460	-50.35	3.77	-	48.65	Peak	68.2	Pass
NVNT	n20	5320	Ant3	5460	-57.73	3.77	0.12	41.39	Average	54	Pass
NVNT	n40	5270	Ant3	4500	-50.88	3.77	-	48.12	Peak	68.2	Pass
NVNT	n40	5270	Ant3	4500	-58.61	3.77	0.24	40.63	Average	54	Pass
NVNT	n40	5270	Ant3	5079.15	-44.89	3.77	-	54.11	Peak	68.2	Pass
NVNT	n40	5270	Ant3	5092.11	-56.3	3.77	0.24	42.94	Average	54	Pass
NVNT	n40	5270	Ant3	5150	-49.92	3.77	-	49.08	Peak	68.2	Pass
NVNT	n40	5270	Ant3	5150	-57.59	3.77	0.24	41.65	Average	54	Pass
NVNT	n40	5310	Ant3	5350	-41.85	3.77	-	57.15	Peak	68.2	Pass
NVNT	n40	5310	Ant3	5350	-55.82	3.77	0.24	43.42	Average	54	Pass
NVNT	n40	5310	Ant3	5350	-41.85	3.77	-	57.15	Peak	68.2	Pass
NVNT	n40	5310	Ant3	5350.2	-55.59	3.77	0.24	43.65	Average	54	Pass
NVNT	n40	5310	Ant3	5460	-49.85	3.77	-	49.15	Peak	68.2	Pass
NVNT	n40	5310	Ant3	5460	-58.05	3.77	0.24	41.19	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5260	Ant3	4500	-50.51	3.77	-	48.49	Peak	68.2	Pass
NVNT	ac20	5260	Ant3	4500	-58.77	3.77	0.12	40.35	Average	54	Pass
NVNT	ac20	5260	Ant3	4840.86	-45.91	3.77	-	53.09	Peak	68.2	Pass
NVNT	ac20	5260	Ant3	5124.78	-56.58	3.77	0.12	42.54	Average	54	Pass
NVNT	ac20	5260	Ant3	5150	-48.09	3.77	-	50.91	Peak	68.2	Pass
NVNT	ac20	5260	Ant3	5150	-56.81	3.77	0.12	42.31	Average	54	Pass
NVNT	ac20	5320	Ant3	5350	-43.94	3.77	-	55.06	Peak	68.2	Pass
NVNT	ac20	5320	Ant3	5350	-55.62	3.77	0.12	43.50	Average	54	Pass
NVNT	ac20	5320	Ant3	5350	-43.94	3.77	-	55.06	Peak	68.2	Pass
NVNT	ac20	5320	Ant3	5352.2	-55.25	3.77	0.12	43.87	Average	54	Pass
NVNT	ac20	5320	Ant3	5460	-50.38	3.77	-	48.62	Peak	68.2	Pass
NVNT	ac20	5320	Ant3	5460	-57.24	3.77	0.12	41.88	Average	54	Pass
NVNT	ac40	5270	Ant3	4500	-49.57	3.77	-	49.43	Peak	68.2	Pass
NVNT	ac40	5270	Ant3	4500	-58.27	3.77	0.23	40.96	Average	54	Pass
NVNT	ac40	5270	Ant3	4946.31	-46.16	3.77	-	52.84	Peak	68.2	Pass
NVNT	ac40	5270	Ant3	5051.61	-56.58	3.77	0.23	42.65	Average	54	Pass
NVNT	ac40	5270	Ant3	5150	-49.28	3.77	-	49.72	Peak	68.2	Pass
NVNT	ac40	5270	Ant3	5150	-57.45	3.77	0.23	41.78	Average	54	Pass
NVNT	ac40	5310	Ant3	5350	-45.22	3.77	-	53.78	Peak	68.2	Pass
NVNT	ac40	5310	Ant3	5350	-55.79	3.77	0.24	43.45	Average	54	Pass
NVNT	ac40	5310	Ant3	5350.4	-39.41	3.77	-	59.59	Peak	68.2	Pass
NVNT	ac40	5310	Ant3	5350.4	-55.06	3.77	0.24	44.18	Average	54	Pass
NVNT	ac40	5310	Ant3	5460	-50.21	3.77	-	48.79	Peak	68.2	Pass
NVNT	ac40	5310	Ant3	5460	-57.96	3.77	0.24	41.28	Average	54	Pass
NVNT	ac80	5290	Ant3	4500	-50.92	3.77	-	48.08	Peak	68.2	Pass
NVNT	ac80	5290	Ant3	4500	-58.61	3.77	0.47	40.86	Average	54	Pass
NVNT	ac80	5290	Ant3	5119.44	-44.72	3.77	-	54.28	Peak	68.2	Pass
NVNT	ac80	5290	Ant3	5149.02	-55.65	3.77	0.47	43.82	Average	54	Pass
NVNT	ac80	5290	Ant3	5150	-47.22	3.77	-	51.78	Peak	68.2	Pass
NVNT	ac80	5290	Ant3	5150	-55.7	3.77	0.47	43.77	Average	54	Pass
NVNT	ac80	5290	Ant3	4500	-50.92	3.77	-	48.08	Peak	68.2	Pass
NVNT	ac80	5290	Ant3	4500	-58.61	3.77	0.47	40.86	Average	54	Pass
NVNT	ac80	5290	Ant3	5119.44	-44.72	3.77	-	54.28	Peak	68.2	Pass
NVNT	ac80	5290	Ant3	5149.02	-55.65	3.77	0.47	43.82	Average	54	Pass
NVNT	ac80	5290	Ant3	5150	-47.22	3.77	-	51.78	Peak	68.2	Pass
NVNT	ac80	5290	Ant3	5150	-55.7	3.77	0.47	43.77	Average	54	Pass
NVNT	ax20	5260	Ant3	4500	-49.28	3.77	-	49.72	Peak	68.2	Pass
NVNT	ax20	5260	Ant3	4500	-58.59	3.77	0.12	40.53	Average	54	Pass
NVNT	ax20	5260	Ant3	5144.28	-46.3	3.77	-	52.70	Peak	68.2	Pass
NVNT	ax20	5260	Ant3	5056.14	-56.41	3.77	0.12	42.71	Average	54	Pass
NVNT	ax20	5260	Ant3	5150	-49.65	3.77	-	49.35	Peak	68.2	Pass
NVNT	ax20	5260	Ant3	5150	-56.94	3.77	0.12	42.18	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5320	Ant3	5350	-46.07	3.77	-	52.93	Peak	68.2	Pass
NVNT	ax20	5320	Ant3	5350	-55.58	3.77	0.12	43.54	Average	54	Pass
NVNT	ax20	5320	Ant3	5350.2	-43.25	3.77	-	55.75	Peak	68.2	Pass
NVNT	ax20	5320	Ant3	5350.8	-55.07	3.77	0.12	44.05	Average	54	Pass
NVNT	ax20	5320	Ant3	5460	-49.44	3.77	-	49.56	Peak	68.2	Pass
NVNT	ax20	5320	Ant3	5460	-57.84	3.77	0.12	41.28	Average	54	Pass
NVNT	ax40	5270	Ant3	4500	-49.98	3.77	-	49.02	Peak	68.2	Pass
NVNT	ax40	5270	Ant3	4500	-58.29	3.77	0.24	40.95	Average	54	Pass
NVNT	ax40	5270	Ant3	4922.82	-45.76	3.77	-	53.24	Peak	68.2	Pass
NVNT	ax40	5270	Ant3	5115.6	-56.57	3.77	0.24	42.67	Average	54	Pass
NVNT	ax40	5270	Ant3	5150	-49.43	3.77	-	49.57	Peak	68.2	Pass
NVNT	ax40	5270	Ant3	5150	-57.33	3.77	0.24	41.91	Average	54	Pass
NVNT	ax40	5310	Ant3	5350	-44.65	3.77	-	54.35	Peak	68.2	Pass
NVNT	ax40	5310	Ant3	5350	-55.72	3.77	0.24	43.52	Average	54	Pass
NVNT	ax40	5310	Ant3	5350.2	-43.61	3.77	-	55.39	Peak	68.2	Pass
NVNT	ax40	5310	Ant3	5350.6	-55.27	3.77	0.24	43.97	Average	54	Pass
NVNT	ax40	5310	Ant3	5460	-49.73	3.77	-	49.27	Peak	68.2	Pass
NVNT	ax40	5310	Ant3	5460	-57.58	3.77	0.24	41.66	Average	54	Pass
NVNT	ax80	5290	Ant3	5350	-45.16	3.77	-	53.84	Peak	68.2	Pass
NVNT	ax80	5290	Ant3	5350	-56.01	3.77	0.47	43.46	Average	54	Pass
NVNT	ax80	5290	Ant3	5350.5	-44.48	3.77	-	54.52	Peak	68.2	Pass
NVNT	ax80	5290	Ant3	5350.75	-55.66	3.77	0.47	43.81	Average	54	Pass
NVNT	ax80	5290	Ant3	5460	-49.78	3.77	-	49.22	Peak	68.2	Pass
NVNT	ax80	5290	Ant3	5460	-58.18	3.77	0.47	41.29	Average	54	Pass
NVNT	ax80	5290	Ant3	4500	-50.53	3.77	-	48.47	Peak	68.2	Pass
NVNT	ax80	5290	Ant3	4500	-58.6	3.77	0.47	40.87	Average	54	Pass
NVNT	ax80	5290	Ant3	5136.84	-44.81	3.77	-	54.19	Peak	68.2	Pass
NVNT	ax80	5290	Ant3	5149.02	-55.54	3.77	0.47	43.93	Average	54	Pass
NVNT	ax80	5290	Ant3	5150	-47.47	3.77	-	51.53	Peak	68.2	Pass
NVNT	ax80	5290	Ant3	5150	-55.79	3.77	0.47	43.68	Average	54	Pass
NVNT	be20	5260	Ant3	4500	-50.3	3.77	-	48.70	Peak	68.2	Pass
NVNT	be20	5260	Ant3	4500	-58.87	3.77	0.12	40.25	Average	54	Pass
NVNT	be20	5260	Ant3	5093.58	-46.33	3.77	-	52.67	Peak	68.2	Pass
NVNT	be20	5260	Ant3	5048.34	-56.58	3.77	0.12	42.54	Average	54	Pass
NVNT	be20	5260	Ant3	5150	-46.43	3.77	-	52.57	Peak	68.2	Pass
NVNT	be20	5260	Ant3	5150	-57.52	3.77	0.12	41.60	Average	54	Pass
NVNT	be20	5320	Ant3	5350	-48.71	3.77	-	50.29	Peak	68.2	Pass
NVNT	be20	5320	Ant3	5350	-55.29	3.77	0.12	43.83	Average	54	Pass
NVNT	be20	5320	Ant3	5350.4	-44.11	3.77	-	54.89	Peak	68.2	Pass
NVNT	be20	5320	Ant3	5350	-55.29	3.77	0.12	43.83	Average	54	Pass
NVNT	be20	5320	Ant3	5460	-49.09	3.77	-	49.91	Peak	68.2	Pass
NVNT	be20	5320	Ant3	5460	-57.57	3.77	0.12	41.55	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	be40	5270	Ant3	4500	-51.11	3.77	-	47.89	Peak	68.2	Pass
NVNT	be40	5270	Ant3	4500	-58.7	3.77	0.24	40.54	Average	54	Pass
NVNT	be40	5270	Ant3	5071.05	-46.39	3.77	-	52.61	Peak	68.2	Pass
NVNT	be40	5270	Ant3	5148	-56.65	3.77	0.24	42.59	Average	54	Pass
NVNT	be40	5270	Ant3	5150	-49.22	3.77	-	49.78	Peak	68.2	Pass
NVNT	be40	5270	Ant3	5150	-57.62	3.77	0.24	41.62	Average	54	Pass
NVNT	be40	5310	Ant3	5350	-43.62	3.77	-	55.38	Peak	68.2	Pass
NVNT	be40	5310	Ant3	5350	-55.82	3.77	0.24	43.42	Average	54	Pass
NVNT	be40	5310	Ant3	5460	-50.03	3.77	-	48.97	Peak	68.2	Pass
NVNT	be40	5310	Ant3	5460	-57.9	3.77	0.24	41.34	Average	54	Pass
NVNT	be40	5310	Ant3	5460	-50.03	3.77	-	48.97	Peak	68.2	Pass
NVNT	be40	5310	Ant3	5460	-57.9	3.77	0.24	41.34	Average	54	Pass
NVNT	be80	5290	Ant3	5350	-48.58	3.77	-	50.42	Peak	68.2	Pass
NVNT	be80	5290	Ant3	5350	-55.34	3.77	0.47	44.13	Average	54	Pass
NVNT	be80	5290	Ant3	5356.25	-44.66	3.77	-	54.34	Peak	68.2	Pass
NVNT	be80	5290	Ant3	5350	-55.34	3.77	0.47	44.13	Average	54	Pass
NVNT	be80	5290	Ant3	5460	-49.24	3.77	-	49.76	Peak	68.2	Pass
NVNT	be80	5290	Ant3	5460	-57.84	3.77	0.47	41.63	Average	54	Pass
NVNT	be80	5290	Ant3	4500	-50.08	3.77	-	48.92	Peak	68.2	Pass
NVNT	be80	5290	Ant3	4500	-58.79	3.77	0.47	40.68	Average	54	Pass
NVNT	be80	5290	Ant3	5095.08	-45.22	3.77	-	53.78	Peak	68.2	Pass
NVNT	be80	5290	Ant3	5149.02	-55.04	3.77	0.47	44.43	Average	54	Pass
NVNT	be80	5290	Ant3	5150	-46.7	3.77	-	52.30	Peak	68.2	Pass
NVNT	be80	5290	Ant3	5150	-55.08	3.77	0.47	44.39	Average	54	Pass
NVNT	ac160	5250	Ant3	5350	-47.58	3.77	-	51.42	Peak	68.2	Pass
NVNT	ac160	5250	Ant3	5350	-62.79	3.77	3.77	39.98	Average	54	Pass
NVNT	ac160	5250	Ant3	5350.48	-42.18	3.77	-	56.82	Peak	68.2	Pass
NVNT	ac160	5250	Ant3	5407.83	-60.23	3.77	3.77	42.54	Average	54	Pass
NVNT	ac160	5250	Ant3	5460	-57.25	3.77	-	41.75	Peak	68.2	Pass
NVNT	ac160	5250	Ant3	5460	-66.76	3.77	3.77	36.01	Average	54	Pass
NVNT	ac160	5250	Ant3	4500	-60.01	3.77	-	38.99	Peak	68.2	Pass
NVNT	ac160	5250	Ant3	4500	-68.55	3.77	3.77	34.22	Average	54	Pass
NVNT	ac160	5250	Ant3	5132.45	-51.77	3.77	-	47.23	Peak	68.2	Pass
NVNT	ac160	5250	Ant3	5137	-64.91	3.77	3.77	37.86	Average	54	Pass
NVNT	ac160	5250	Ant3	5150	-55.86	3.77	-	43.14	Peak	68.2	Pass
NVNT	ac160	5250	Ant3	5150	-66.12	3.77	3.77	36.65	Average	54	Pass
NVNT	ax160	5250	Ant3	5350	-49.79	3.77	-	49.21	Peak	68.2	Pass
NVNT	ax160	5250	Ant3	5350	-60.69	3.77	3.52	41.83	Average	54	Pass
NVNT	ax160	5250	Ant3	5392.29	-41.01	3.77	-	57.99	Peak	68.2	Pass
NVNT	ax160	5250	Ant3	5406.35	-56.87	3.77	3.52	45.65	Average	54	Pass
NVNT	ax160	5250	Ant3	5460	-54.82	3.77	-	44.18	Peak	68.2	Pass
NVNT	ax160	5250	Ant3	5460	-66.17	3.77	3.52	36.35	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax160	5250	Ant3	4500	-60.67	3.77	-	38.33	Peak	68.2	Pass
NVNT	ax160	5250	Ant3	4500	-68.88	3.77	3.52	33.64	Average	54	Pass
NVNT	ax160	5250	Ant3	5126.08	-48.5	3.77	-	50.50	Peak	68.2	Pass
NVNT	ax160	5250	Ant3	5134.27	-62.78	3.77	3.52	39.74	Average	54	Pass
NVNT	ax160	5250	Ant3	5150	-53.79	3.77	-	45.21	Peak	68.2	Pass
NVNT	ax160	5250	Ant3	5150	-63.81	3.77	3.52	38.71	Average	54	Pass
NVNT	be160	5250	Ant3	5350	-37.64	3.77	-	61.36	Peak	68.2	Pass
NVNT	be160	5250	Ant3	5350	-57.39	3.77	3.77	45.38	Average	54	Pass
NVNT	be160	5250	Ant3	5350.11	-37.64	3.77	-	61.36	Peak	68.2	Pass
NVNT	be160	5250	Ant3	5397.1	-55.7	3.77	3.77	47.07	Average	54	Pass
NVNT	be160	5250	Ant3	5460	-49.36	3.77	-	49.64	Peak	68.2	Pass
NVNT	be160	5250	Ant3	5460	-57.65	3.77	3.77	45.12	Average	54	Pass
NVNT	be160	5250	Ant3	4500	-50.01	3.77	-	48.99	Peak	68.2	Pass
NVNT	be160	5250	Ant3	4500	-59.23	3.77	3.77	43.54	Average	54	Pass
NVNT	be160	5250	Ant3	5134.27	-41.51	3.77	-	57.49	Peak	68.2	Pass
NVNT	be160	5250	Ant3	5143.37	-55.74	3.77	3.77	47.03	Average	54	Pass
NVNT	be160	5250	Ant3	5150	-44.85	3.77	-	54.15	Peak	68.2	Pass
NVNT	be160	5250	Ant3	5150	-57.04	3.77	3.77	45.73	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5260MHz Ant3 Peak

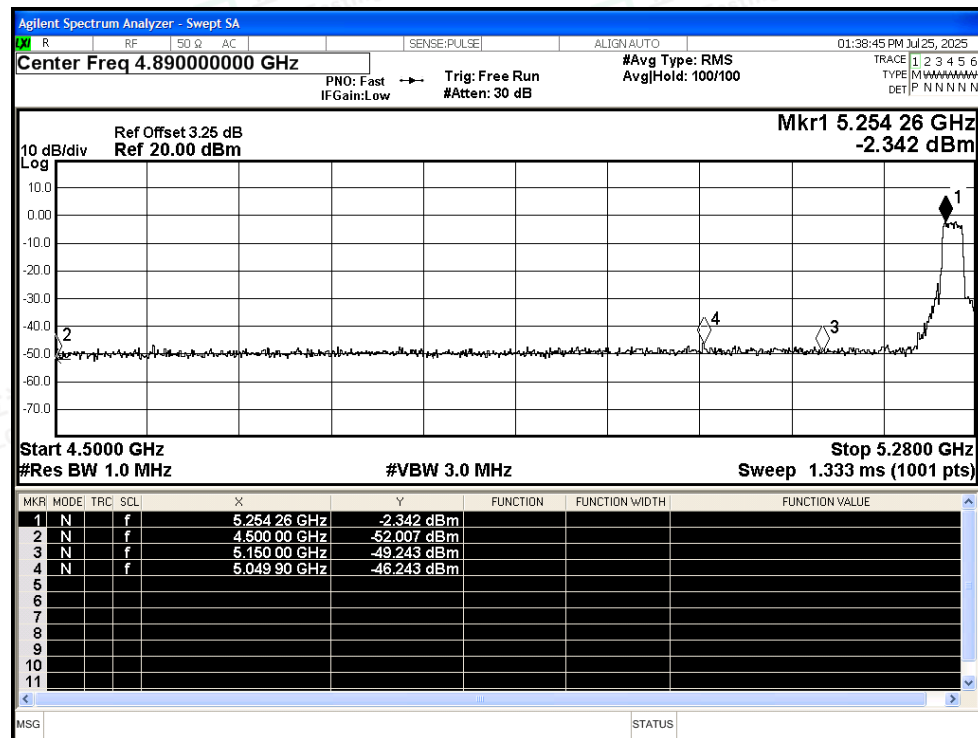

Restrict Band NVNT a 5260MHz Ant3 Average

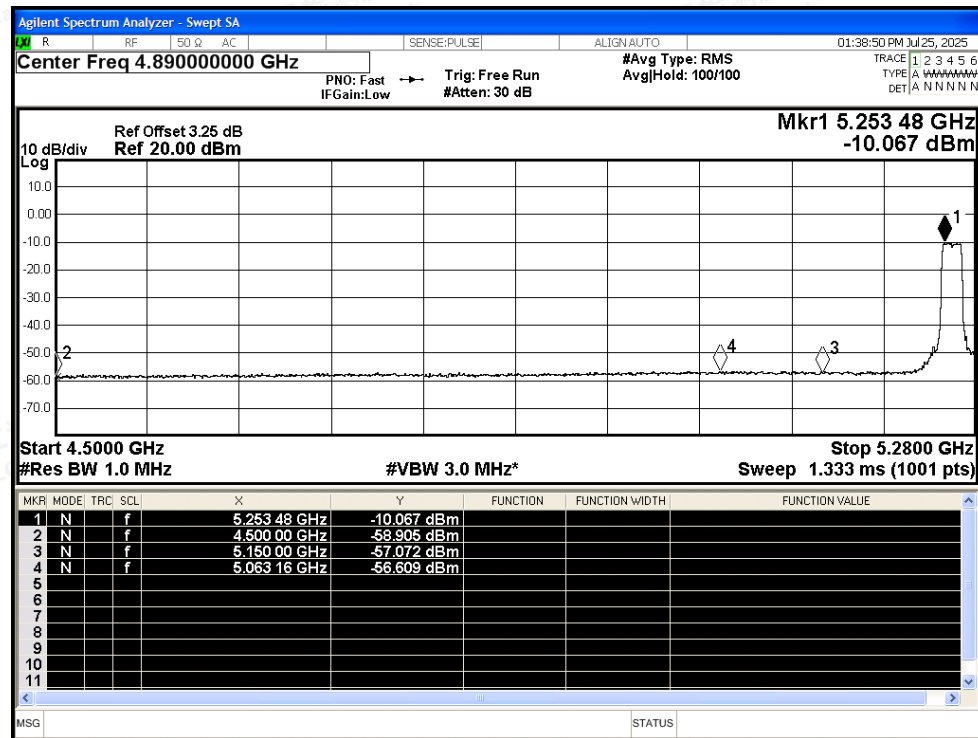

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5320MHz Ant3 Peak

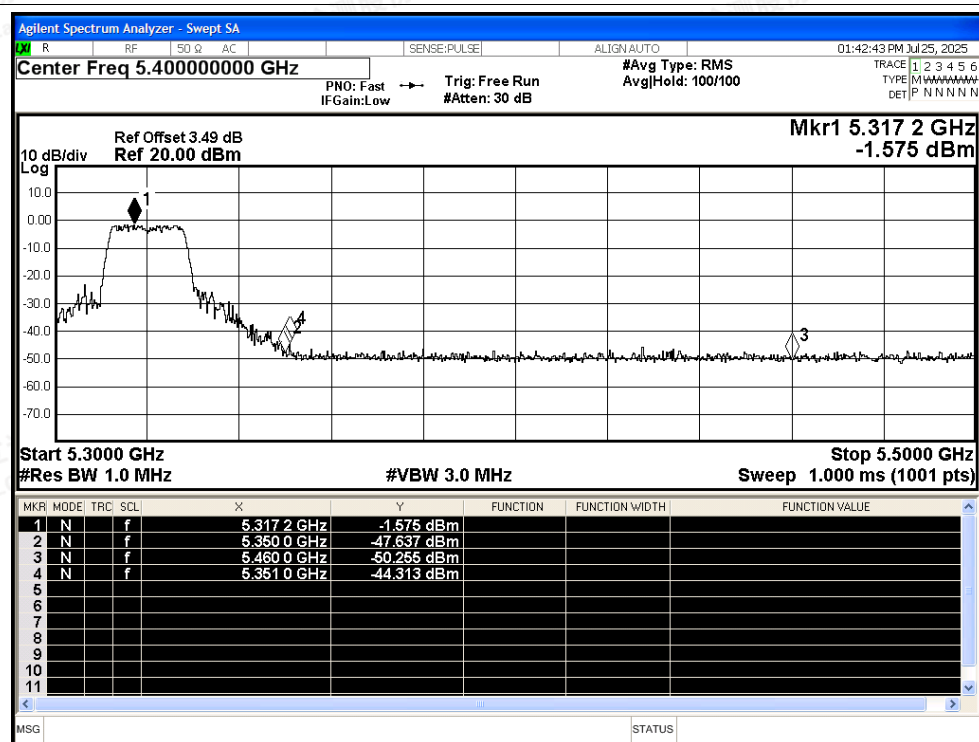

Restrict Band NVNT a 5320MHz Ant3 Average

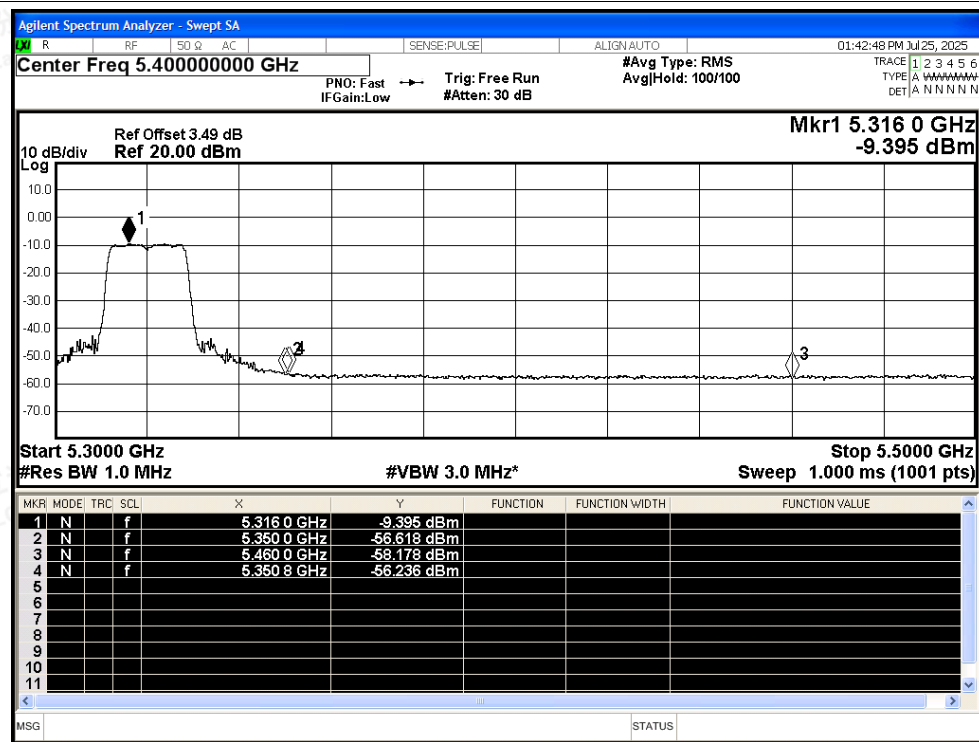

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5260MHz Ant3 Peak

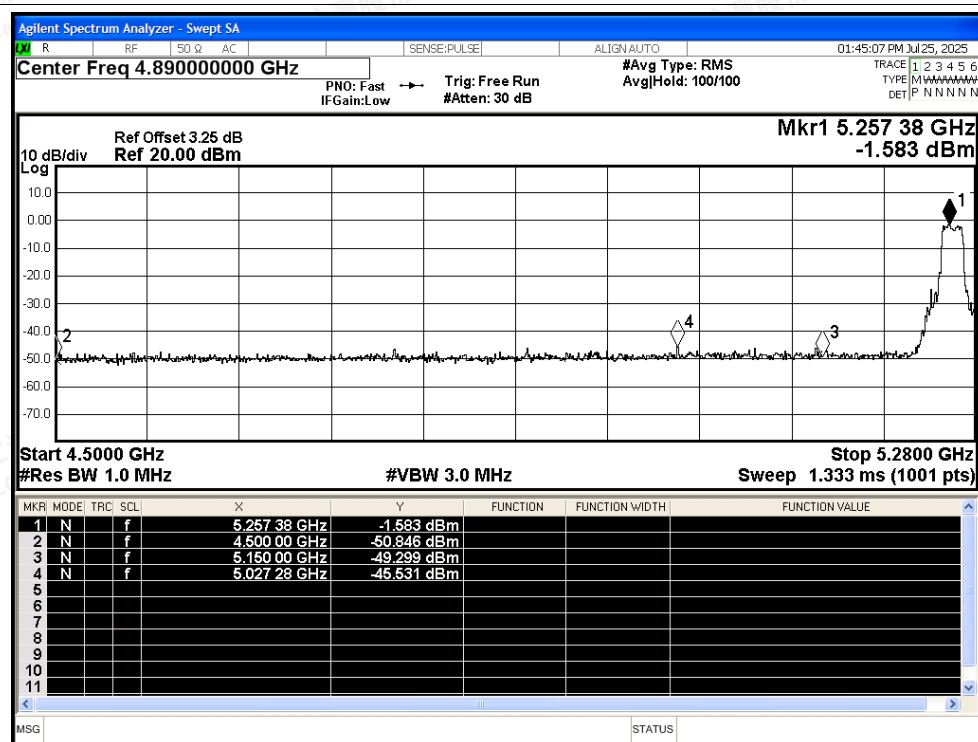

Restrict Band NVNT n20 5260MHz Ant3 Average

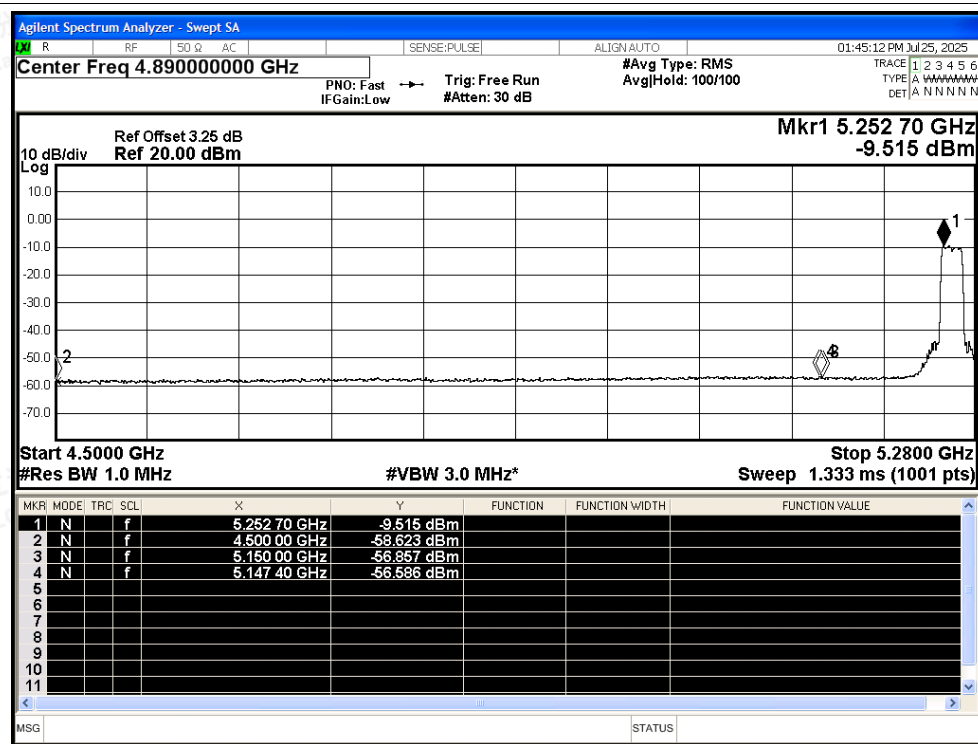

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5320MHz Ant3 Peak

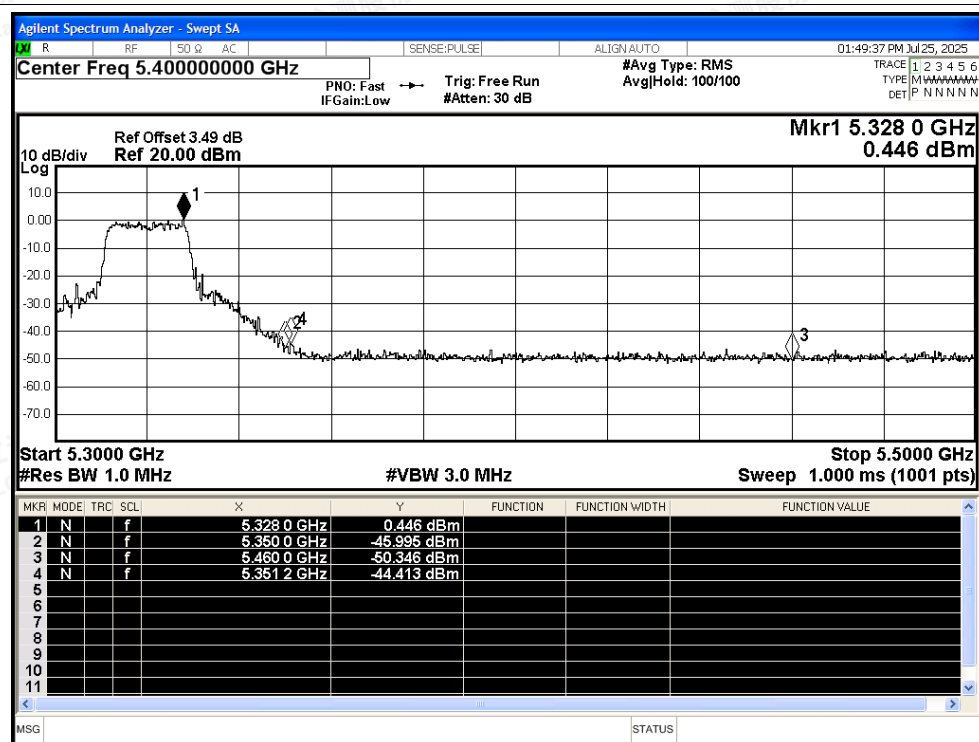

Restrict Band NVNT n20 5320MHz Ant3 Average

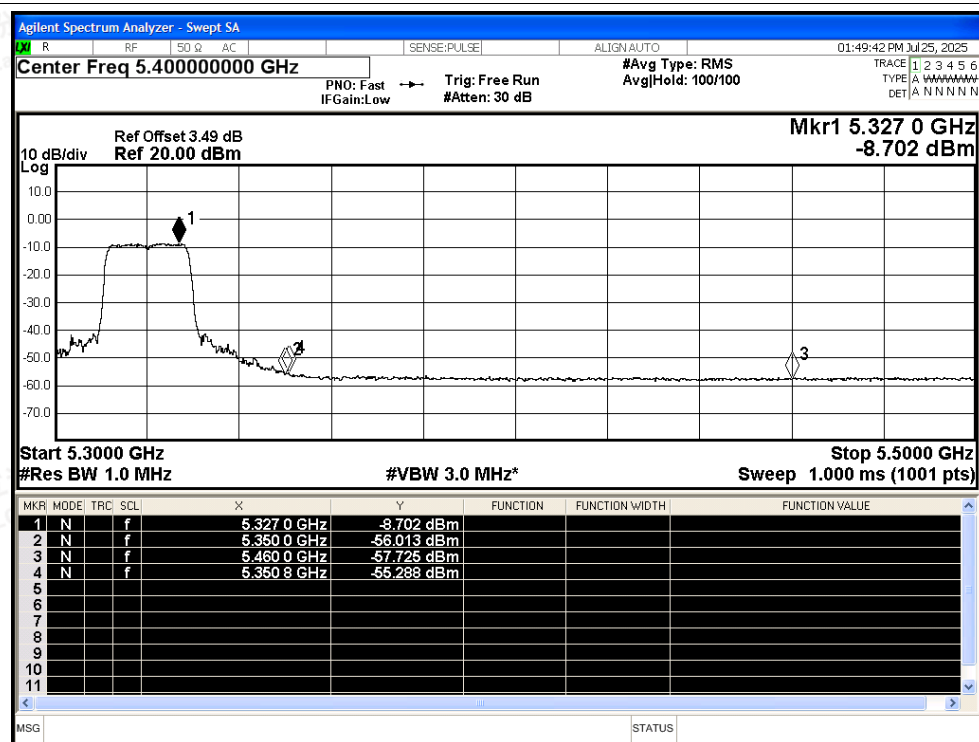

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5270MHz Ant3 Peak

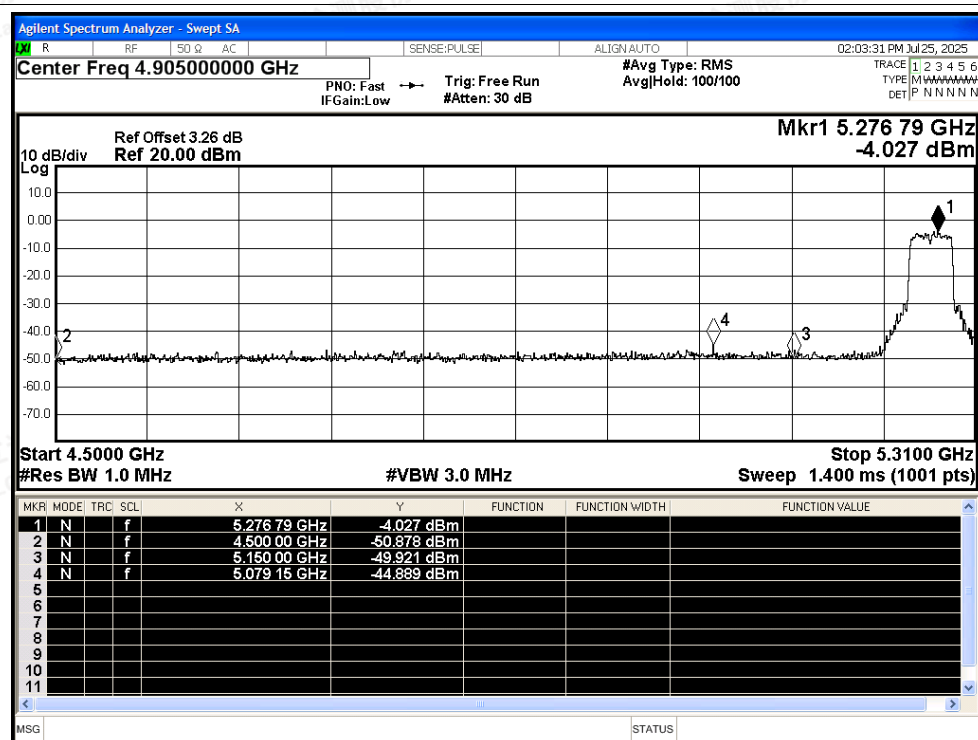

Restrict Band NVNT n40 5270MHz Ant3 Average

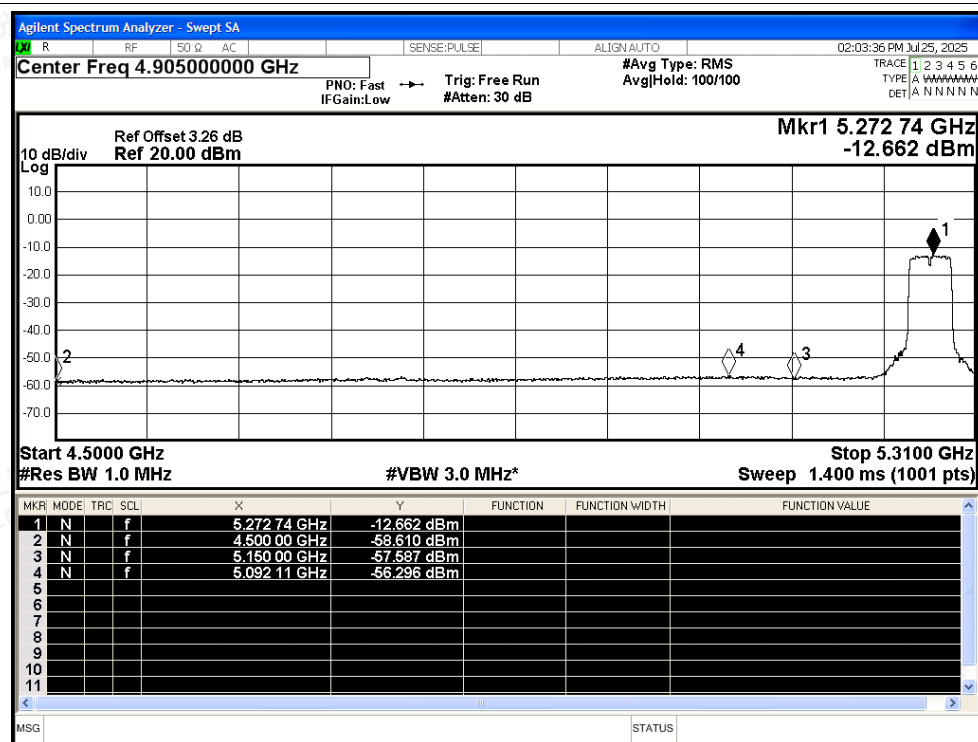

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5310MHz Ant3 Peak

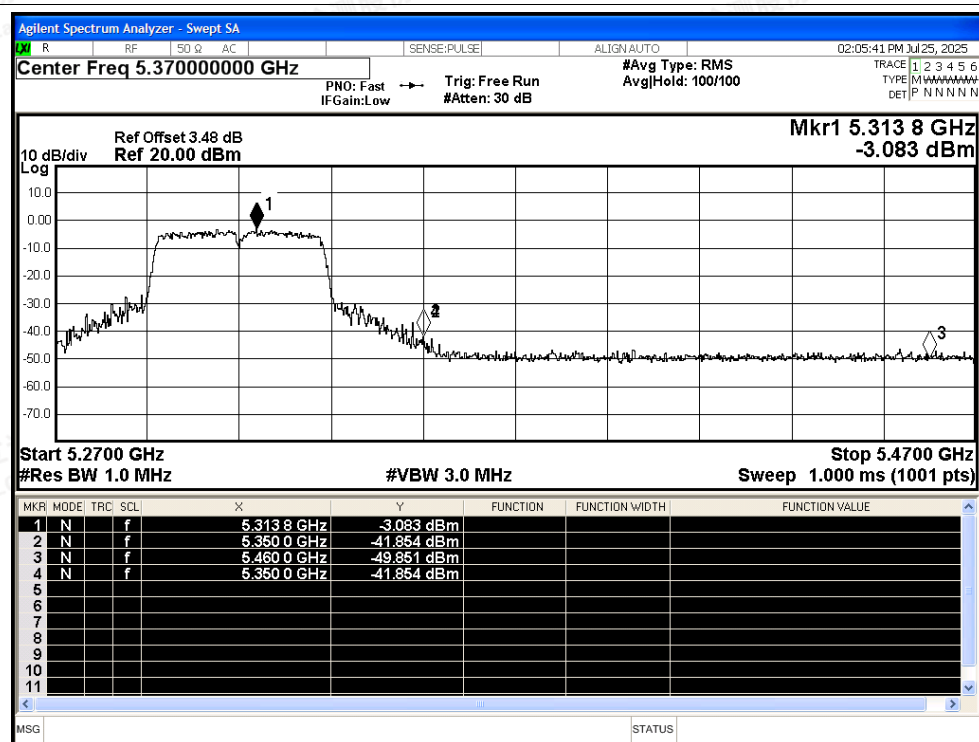

Restrict Band NVNT n40 5310MHz Ant3 Average

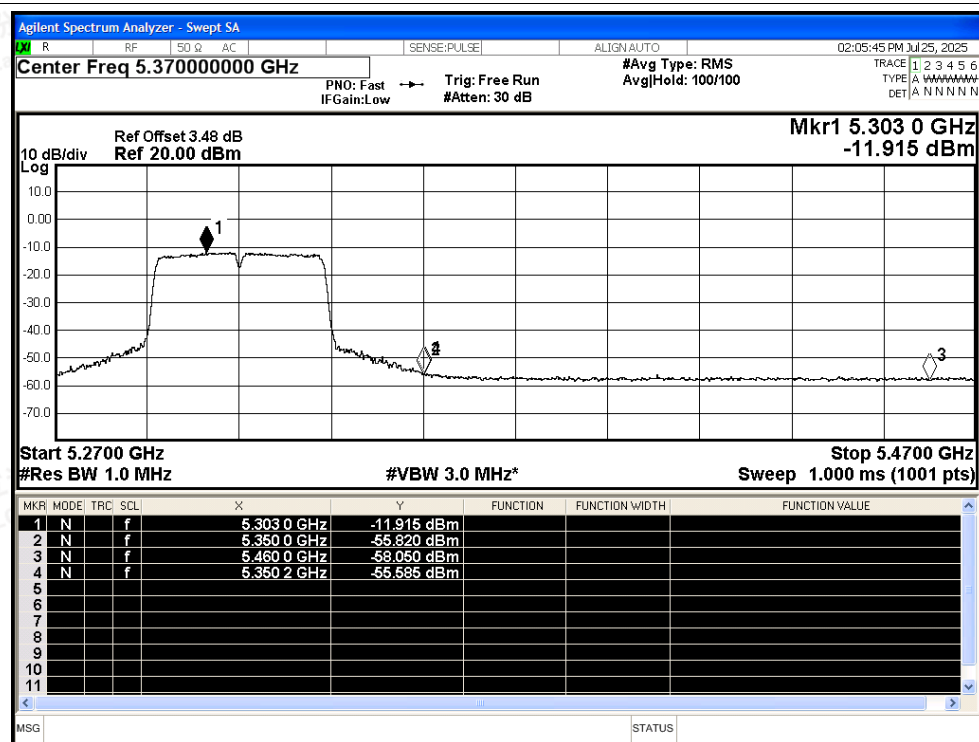

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5260MHz Ant3 Peak

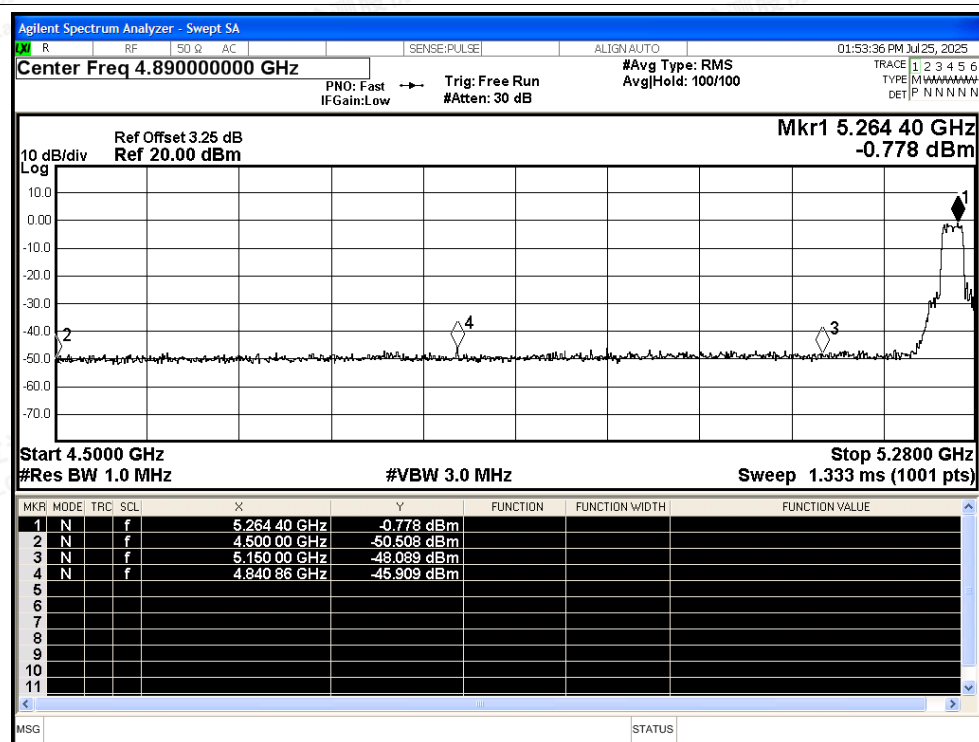

Restrict Band NVNT ac20 5260MHz Ant3 Average

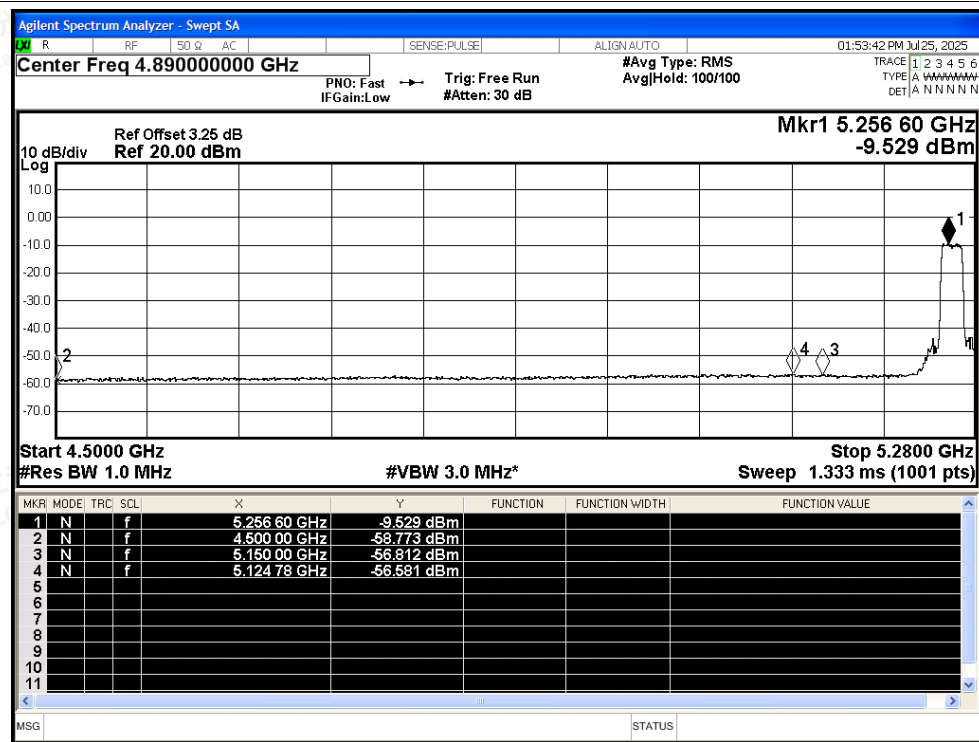

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5320MHz Ant3 Peak

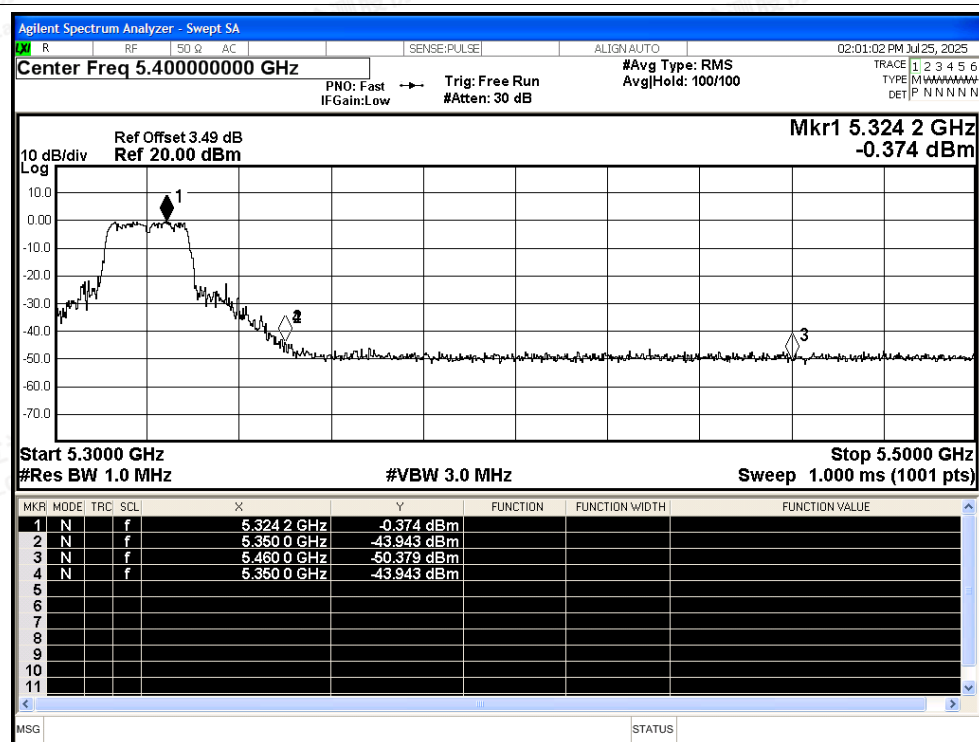

Restrict Band NVNT ac20 5320MHz Ant3 Average

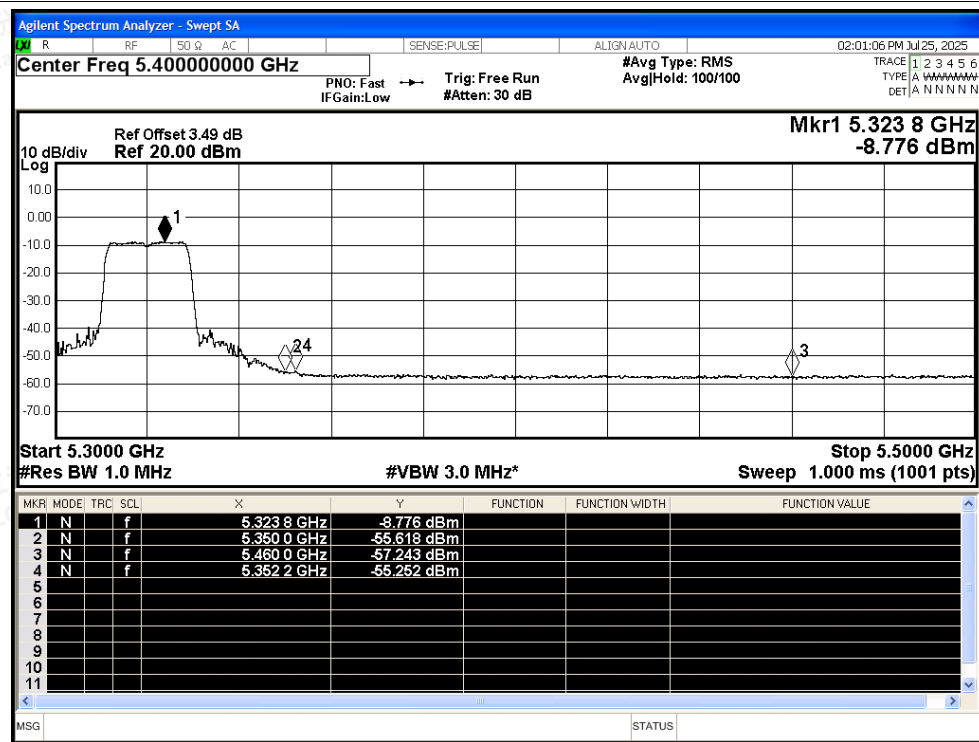

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5270MHz Ant3 Peak

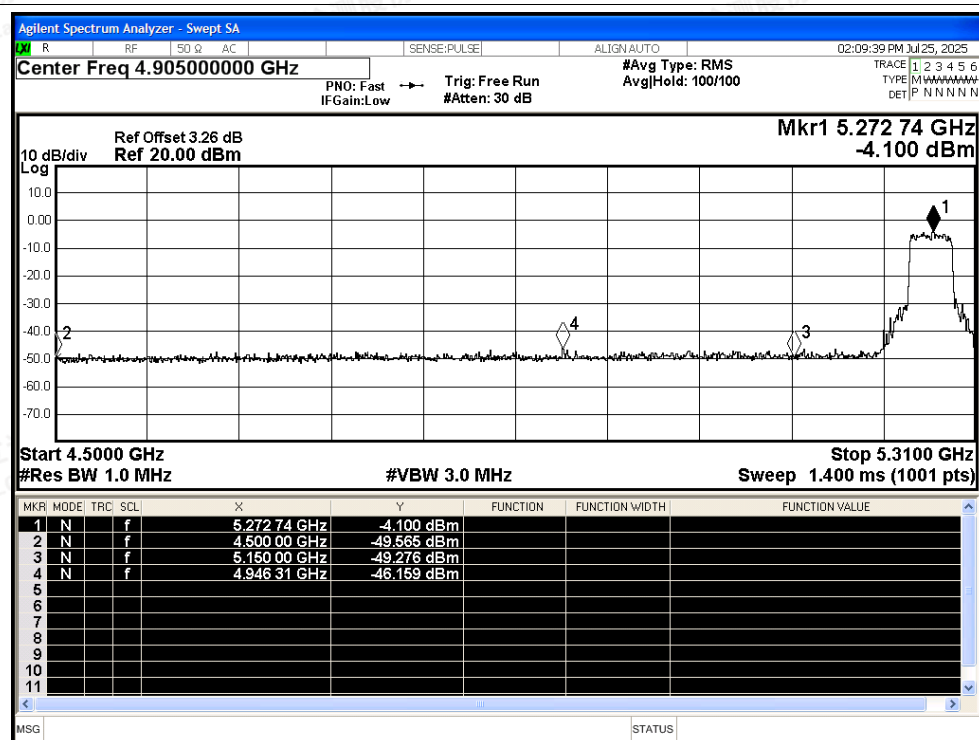

Restrict Band NVNT ac40 5270MHz Ant3 Average

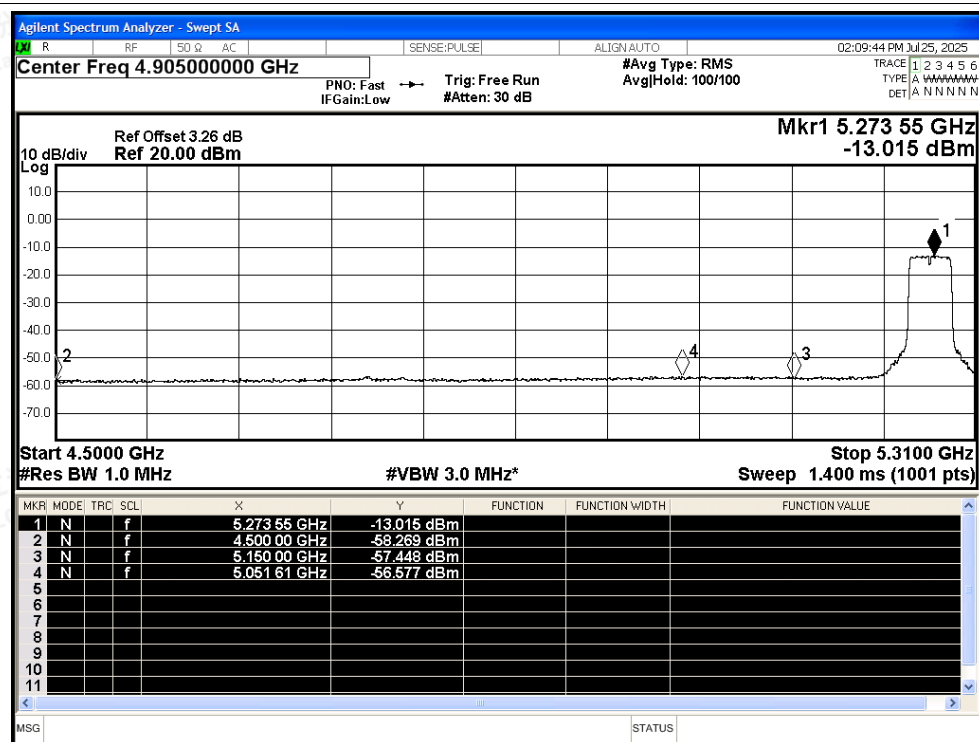

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5310MHz Ant3 Peak

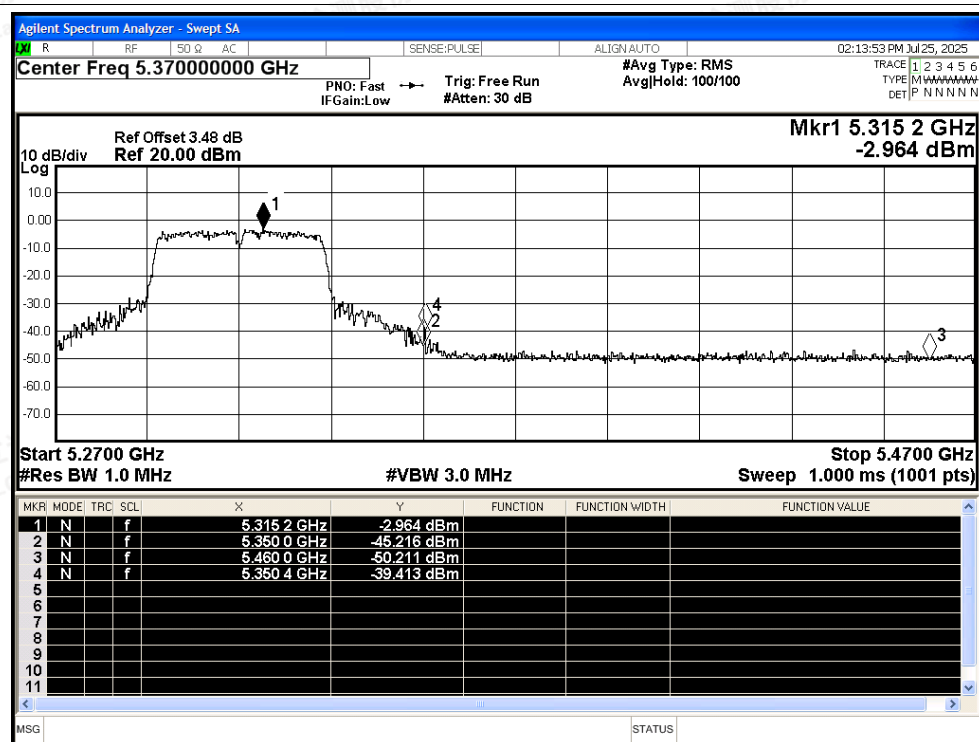

Restrict Band NVNT ac40 5310MHz Ant3 Average

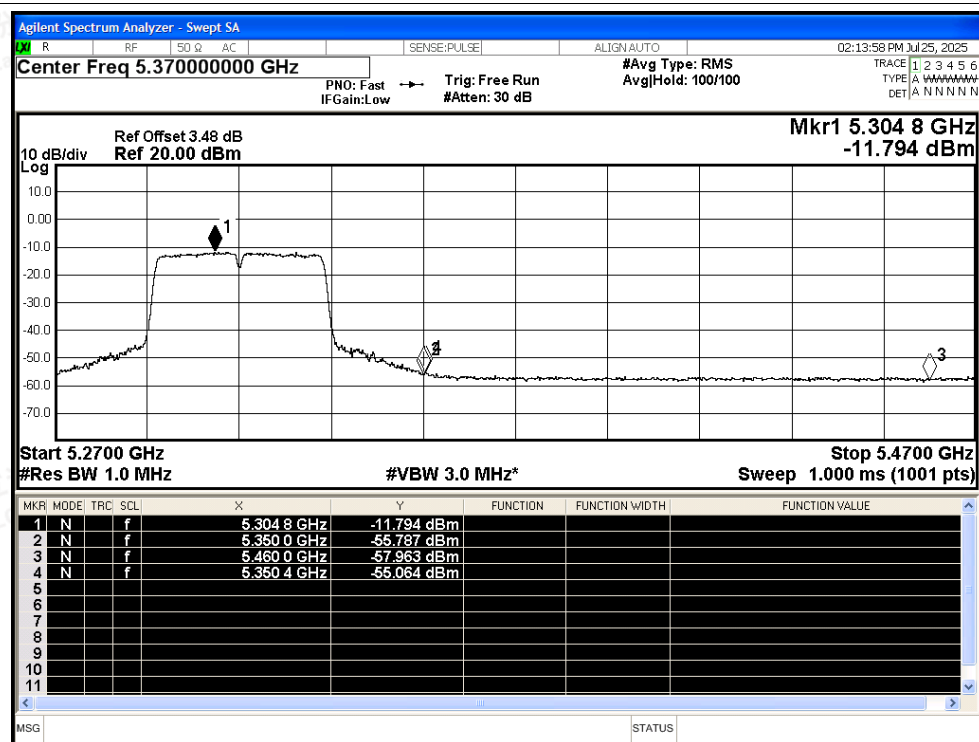

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5290MHz Ant3 Peak

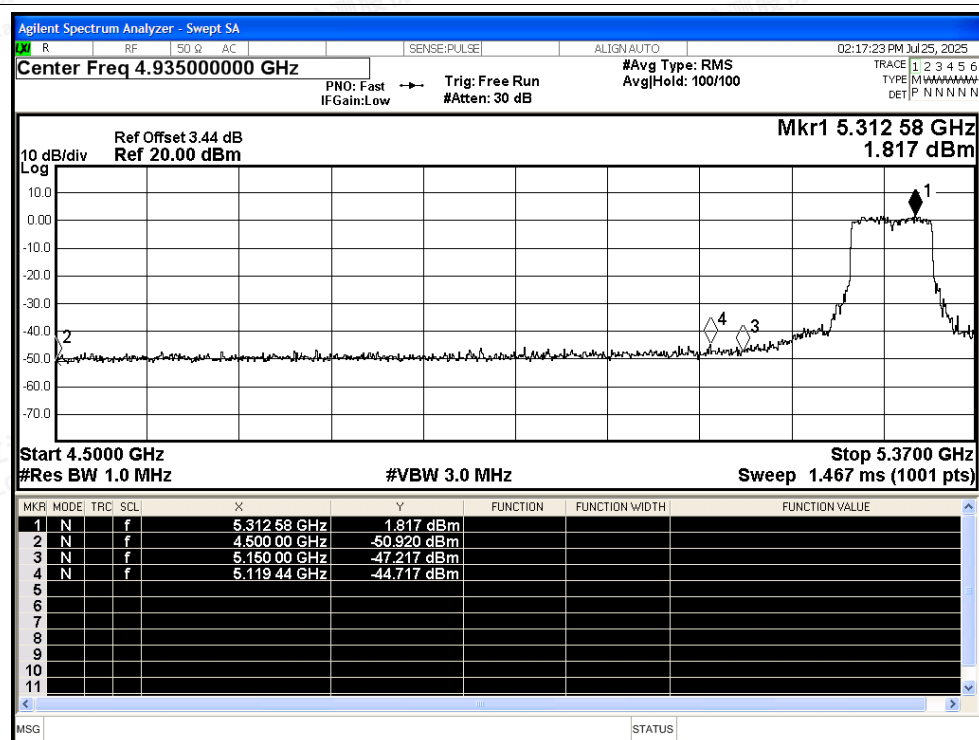

Restrict Band NVNT ac80 5290MHz Ant3 Average

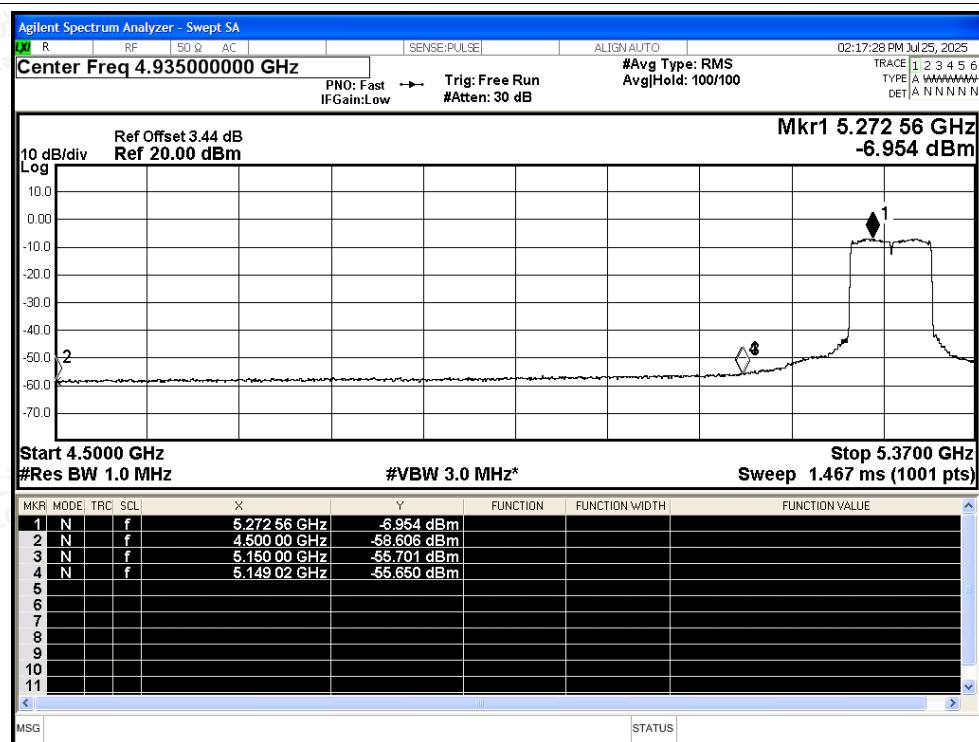

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5260MHz Ant3 Peak

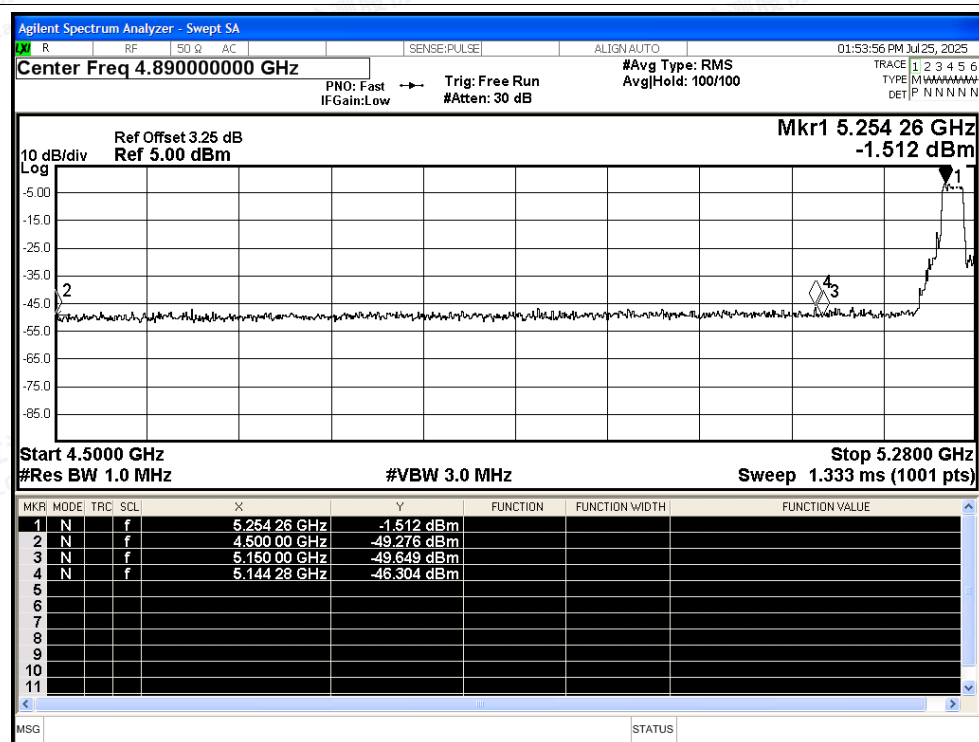

Restrict Band NVNT ax20 5260MHz Ant3 Average

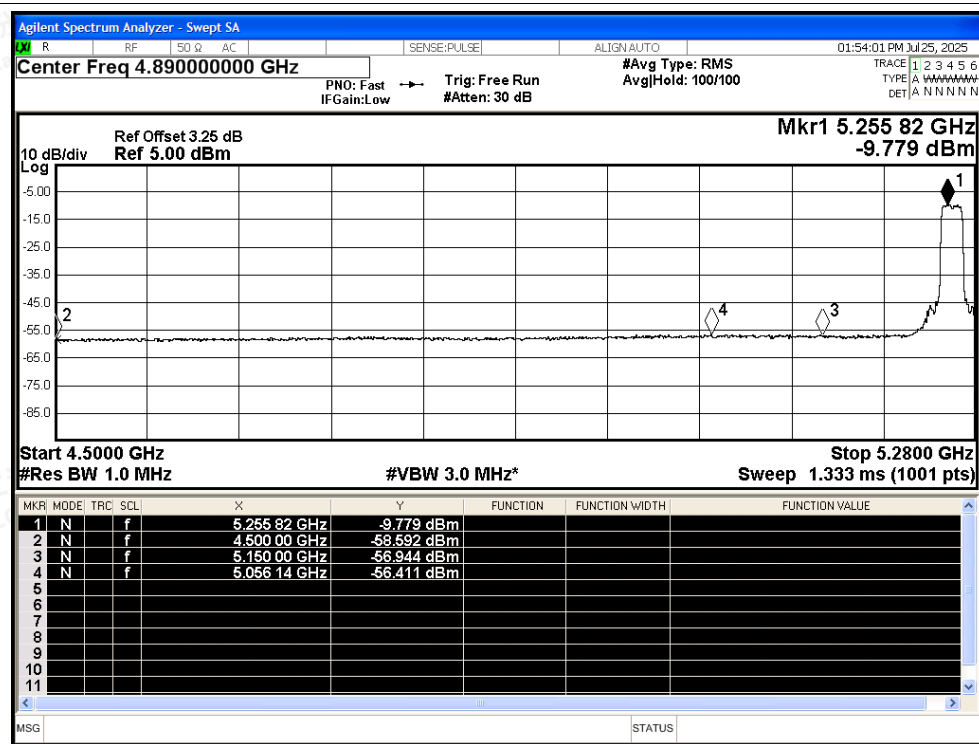

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5320MHz Ant3 Peak

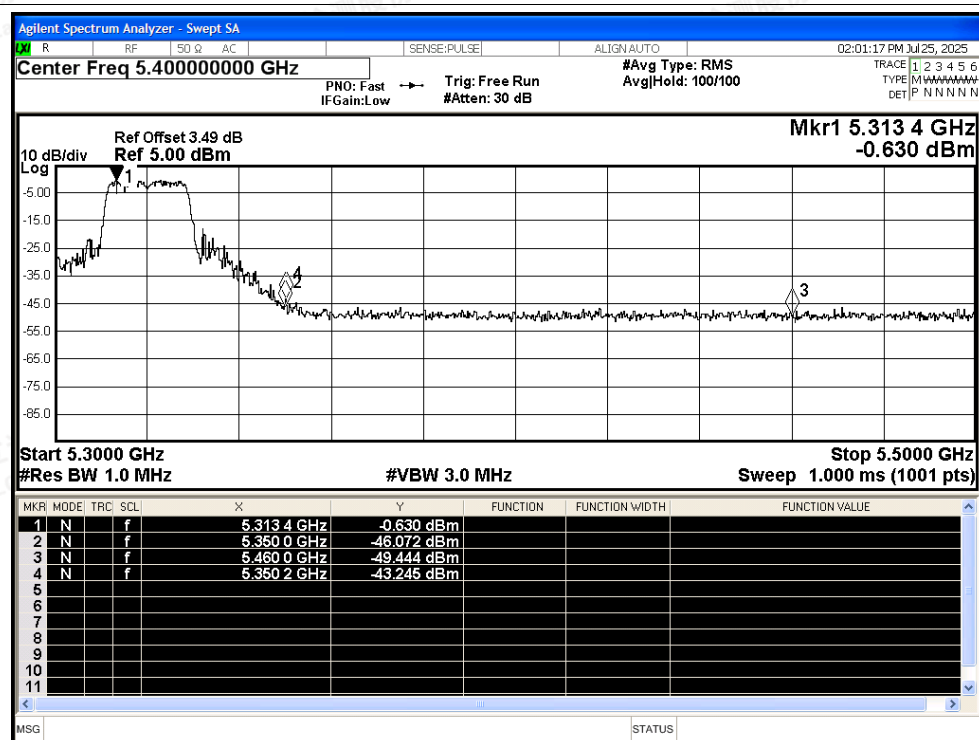

Restrict Band NVNT ax20 5320MHz Ant3 Average

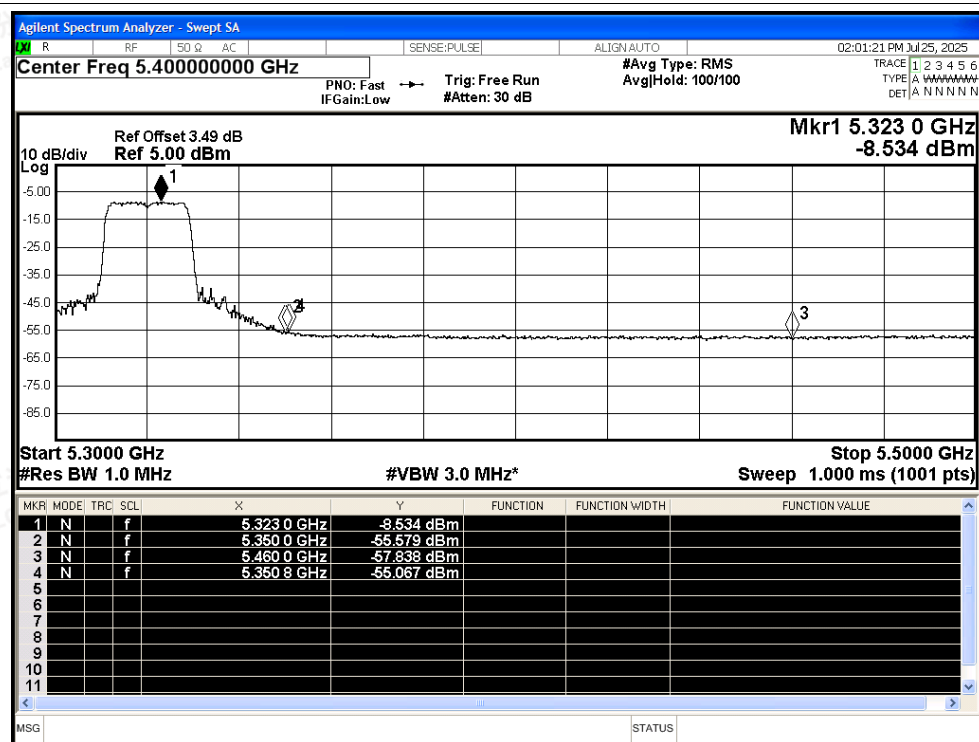

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5270MHz Ant3 Peak

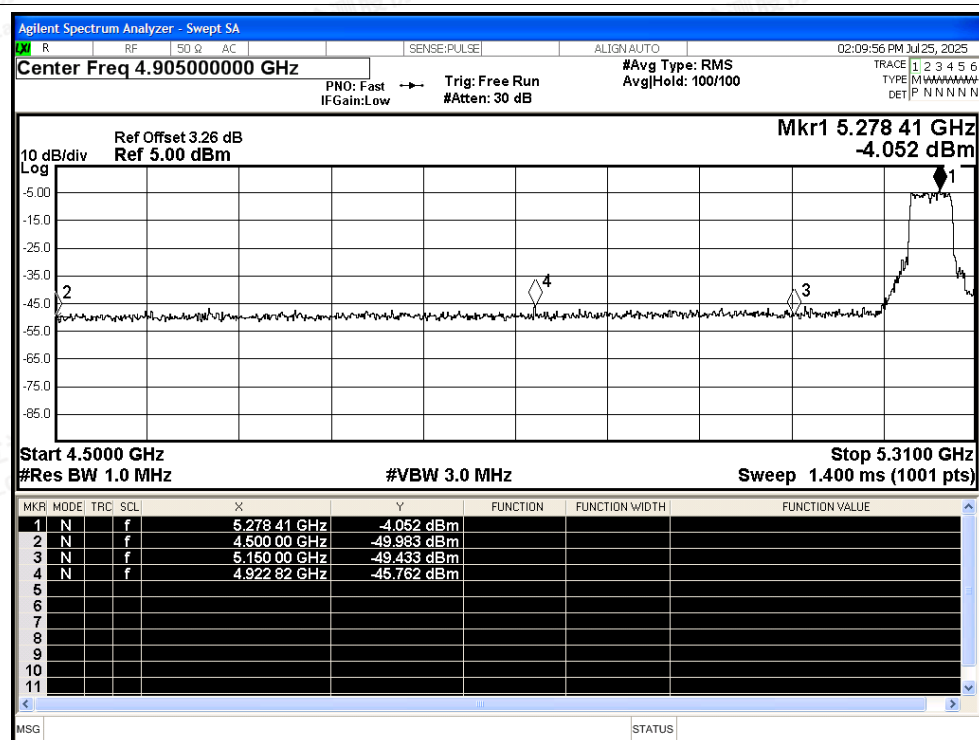

Restrict Band NVNT ax40 5270MHz Ant3 Average

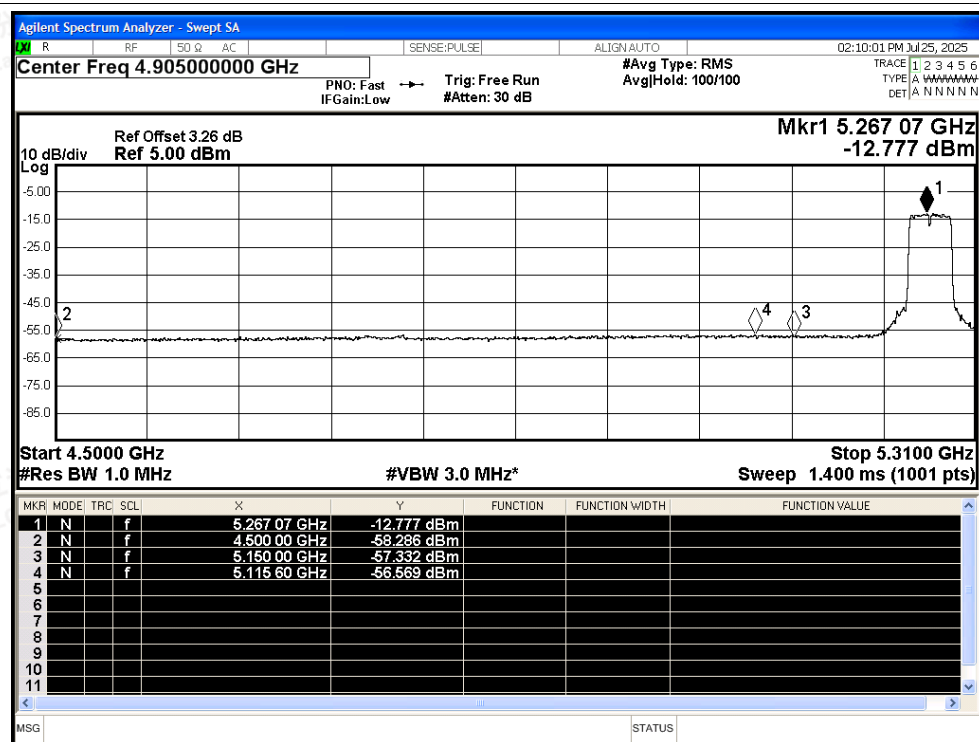

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5310MHz Ant3 Peak

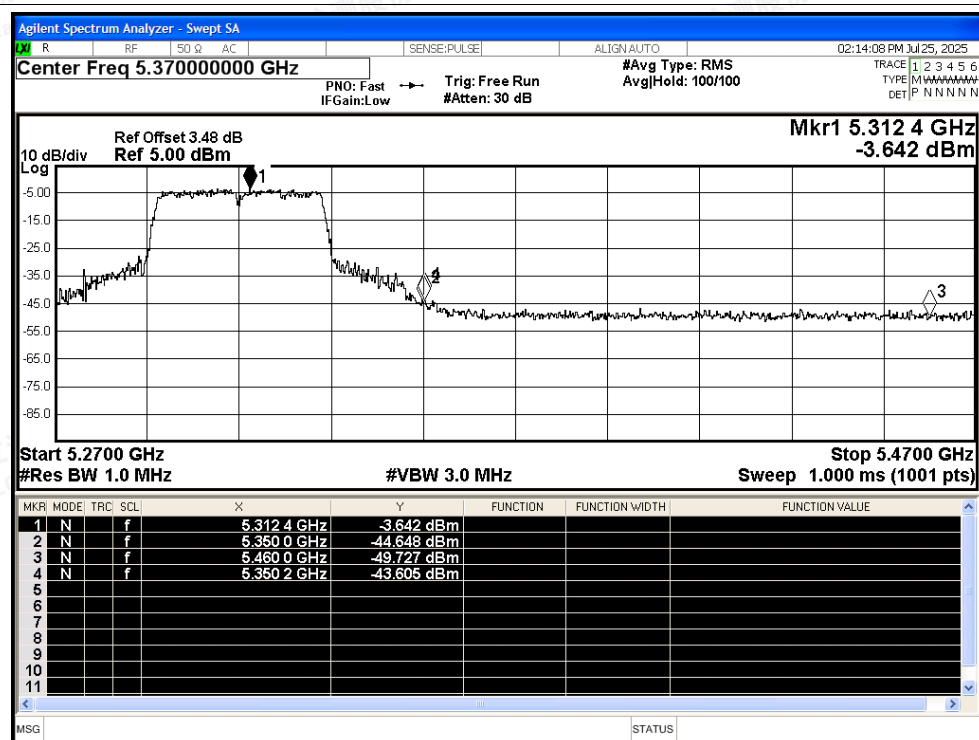

Restrict Band NVNT ax40 5310MHz Ant3 Average

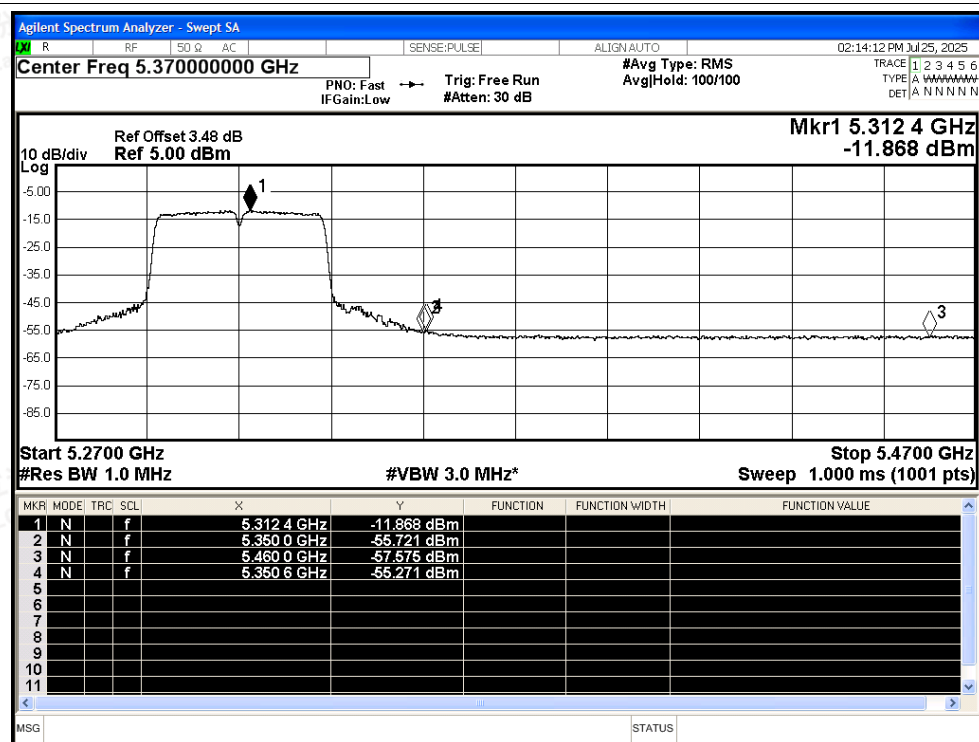

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5290MHz Ant3 Peak

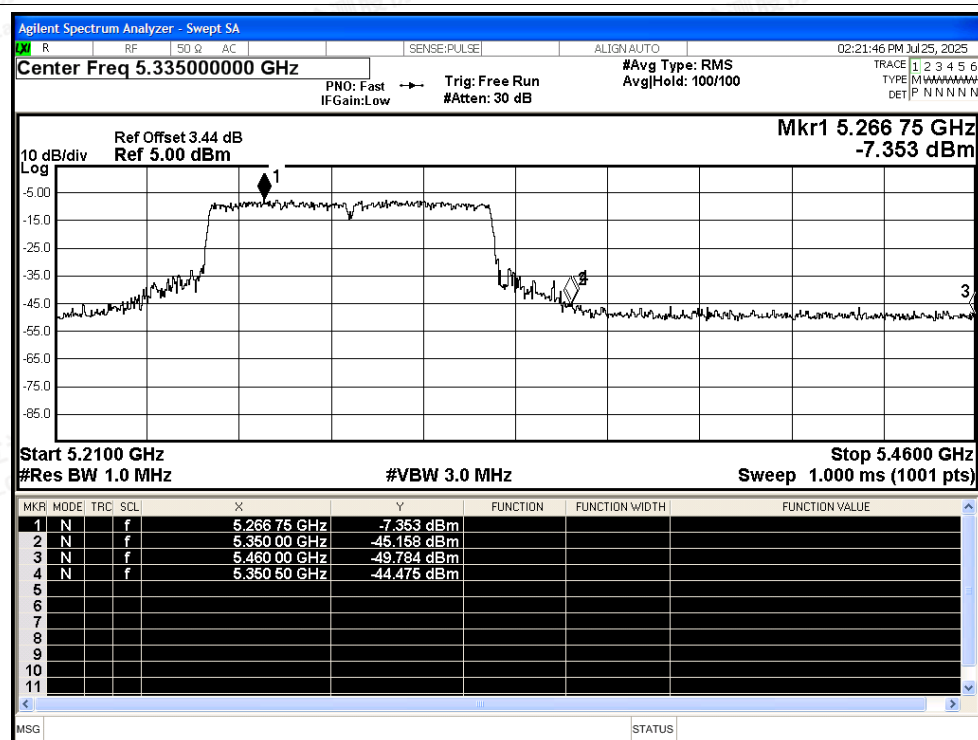

Restrict Band NVNT ax80 5290MHz Ant3 Average

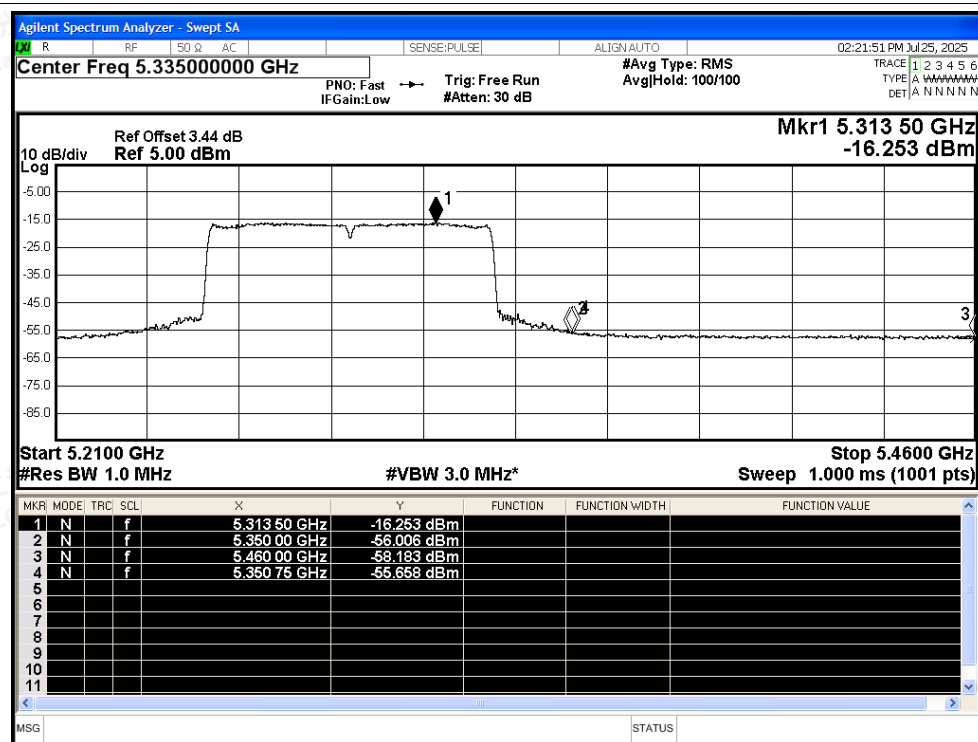

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5290MHz Ant3 Peak

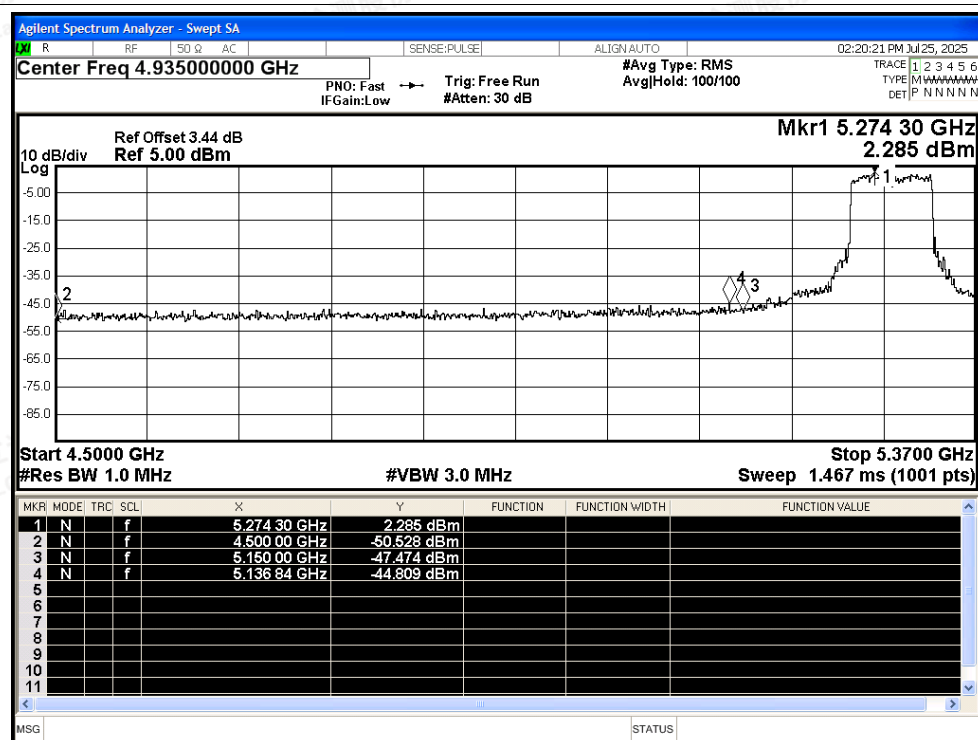

Restrict Band NVNT ax80 5290MHz Ant3 Average

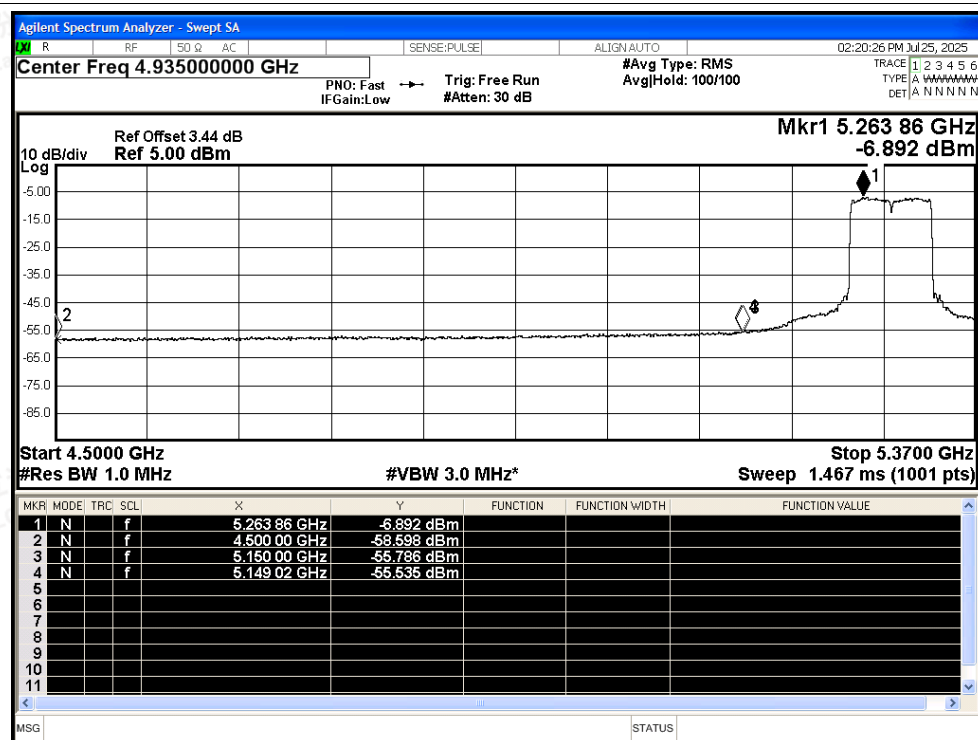

Restrict Band NVNT be20 5260MHz Ant3 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

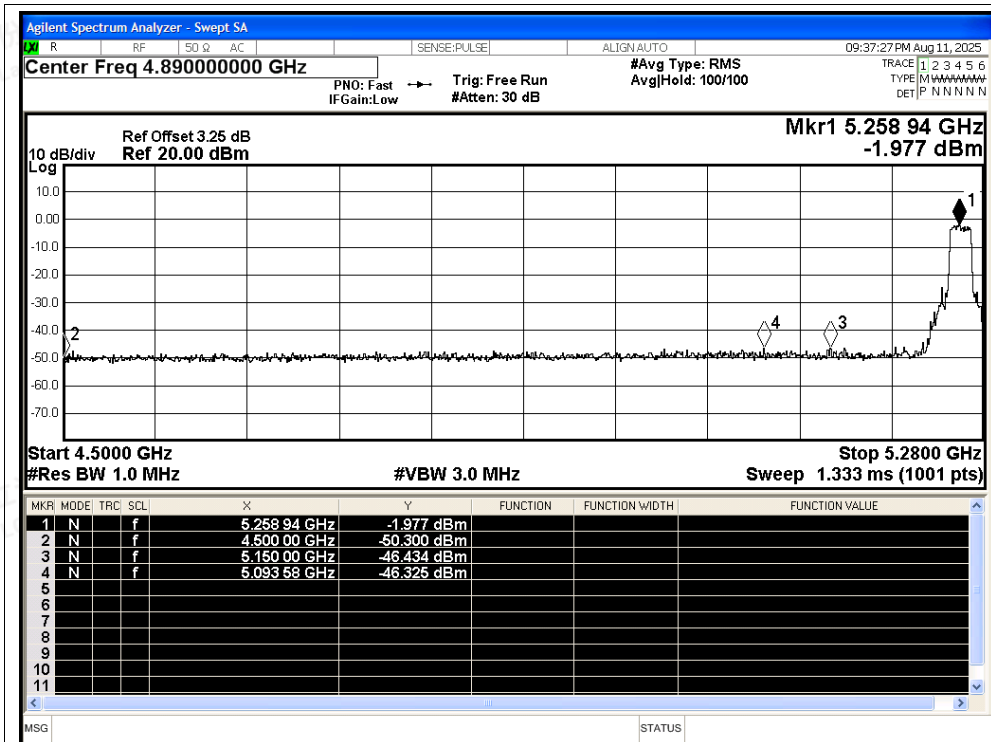

Restrict Band NVNT be20 5260MHz Ant3 Average

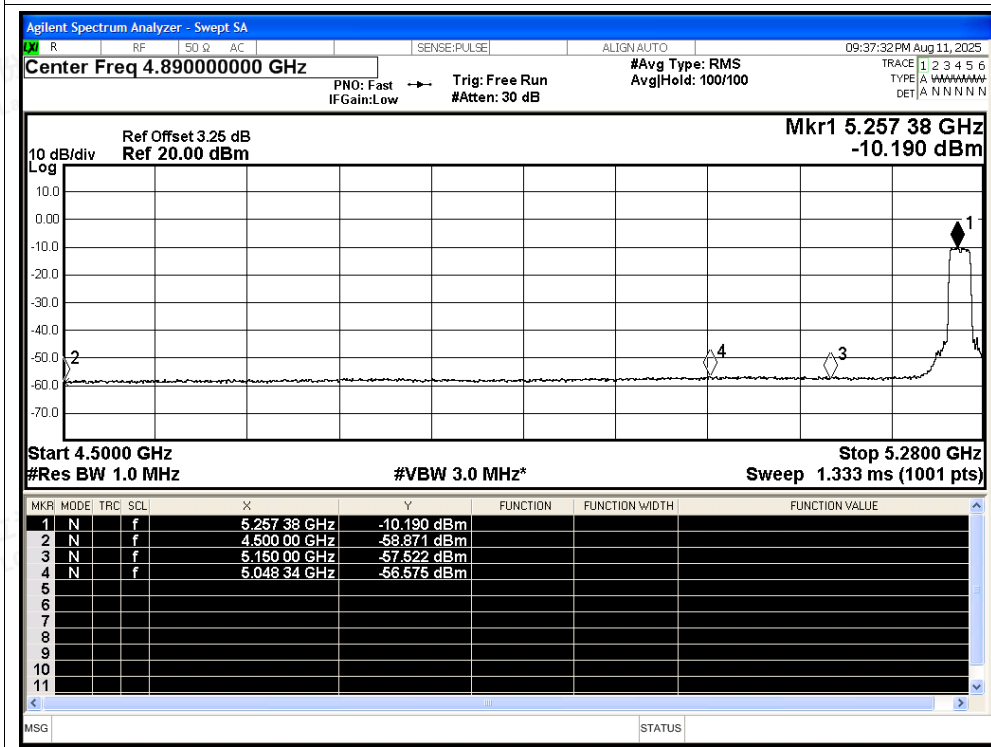

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be20 5320MHz Ant3 Peak

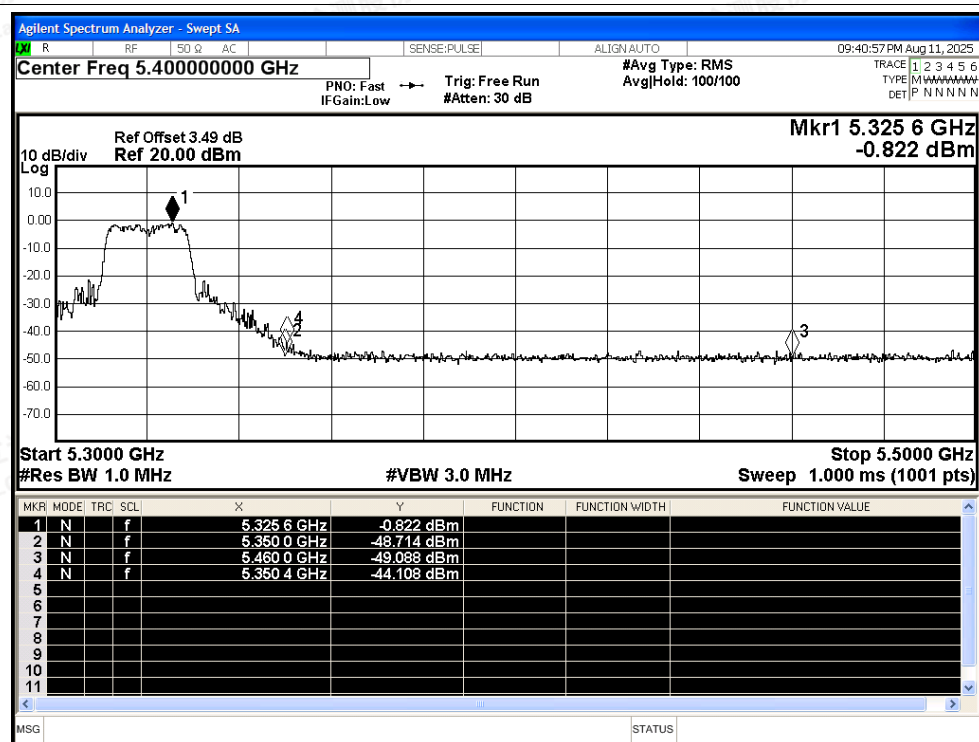

Restrict Band NVNT be20 5320MHz Ant3 Average

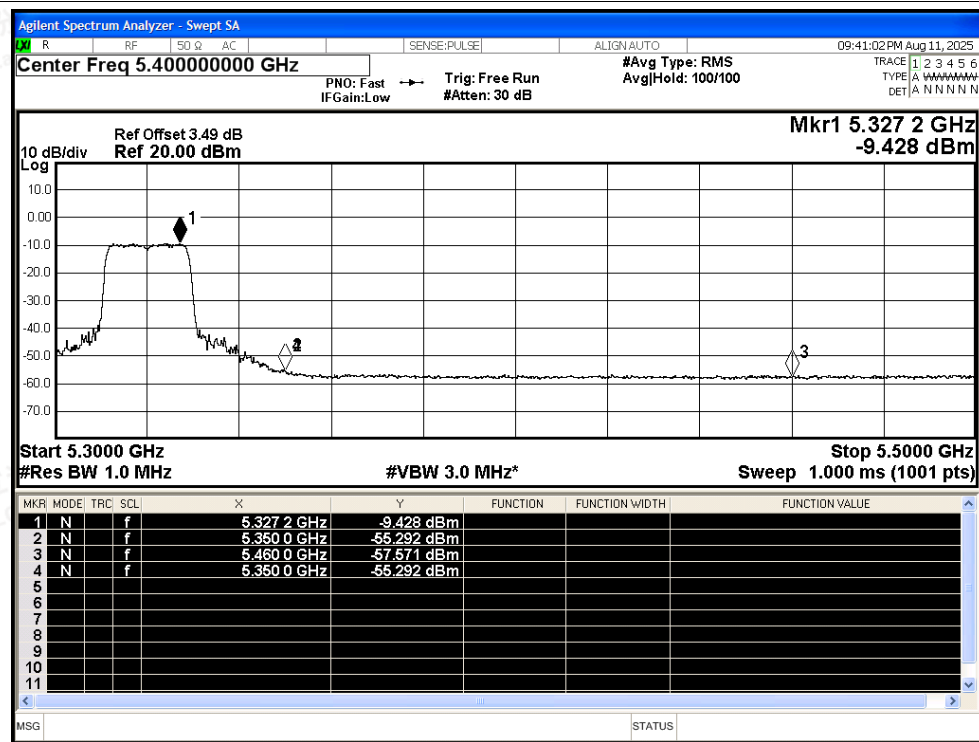

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be40 5270MHz Ant3 Peak

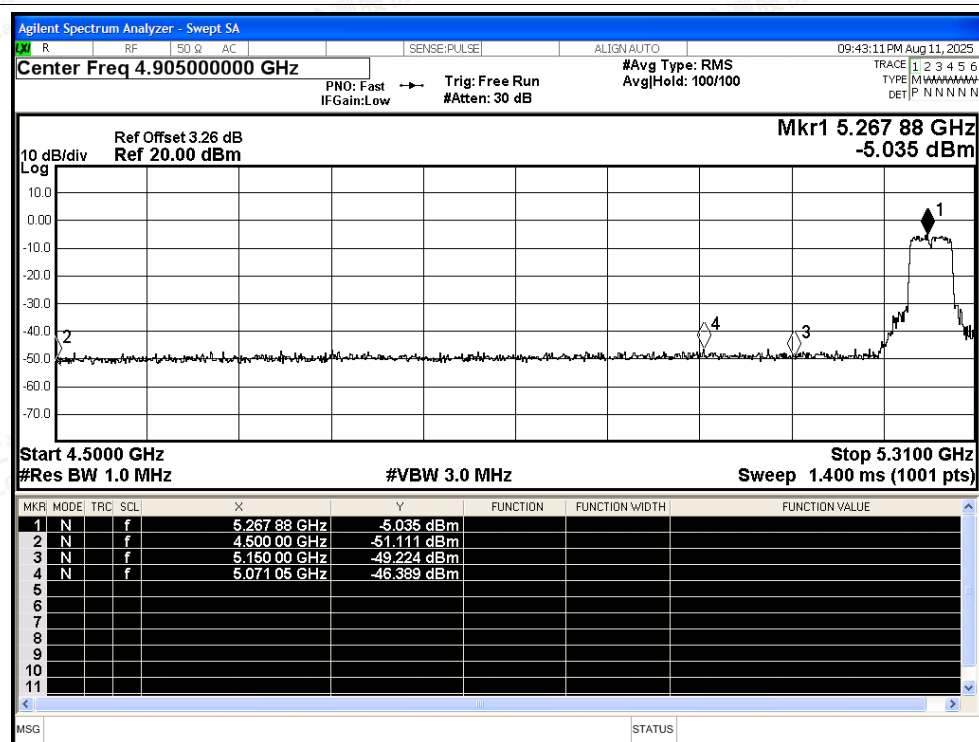

Restrict Band NVNT be40 5270MHz Ant3 Average

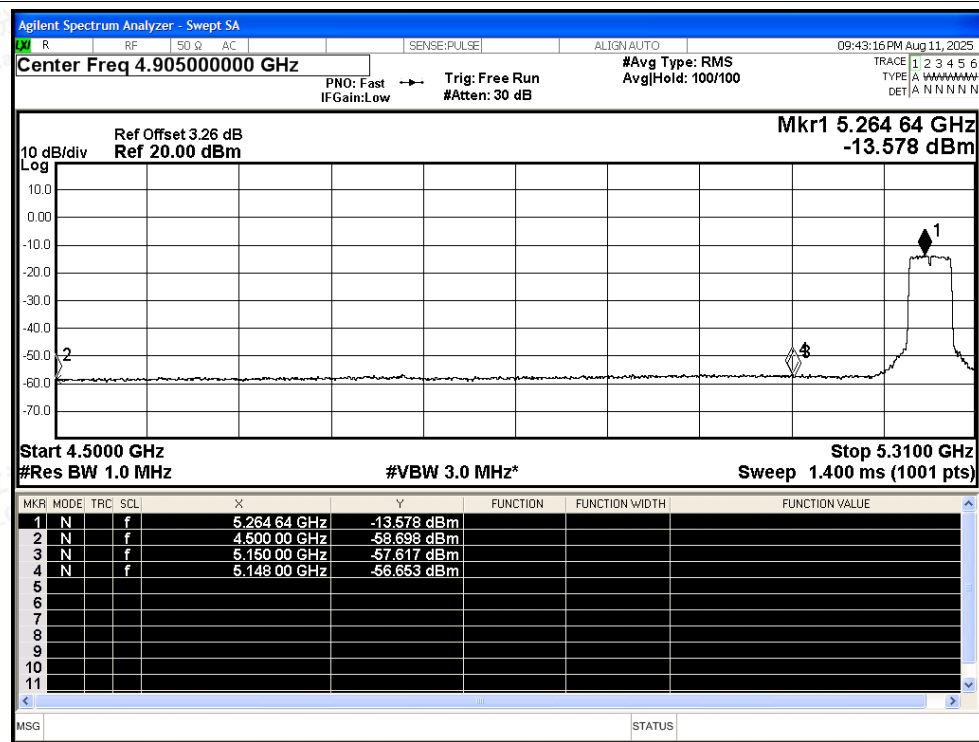

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be40 5310MHz Ant3 Peak

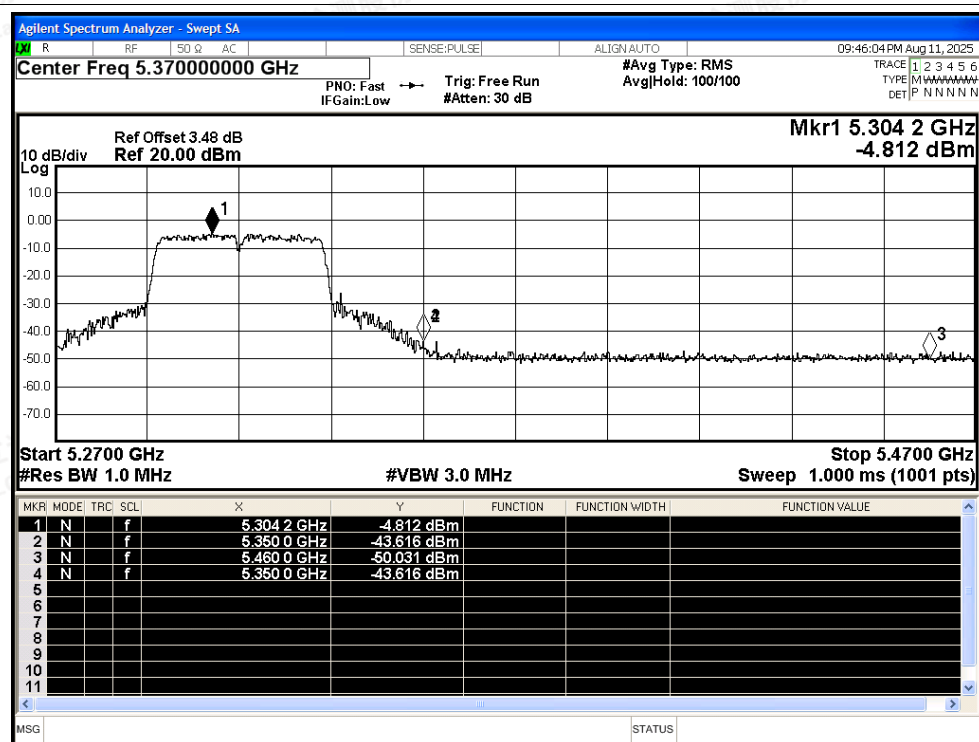

Restrict Band NVNT be40 5310MHz Ant3 Average

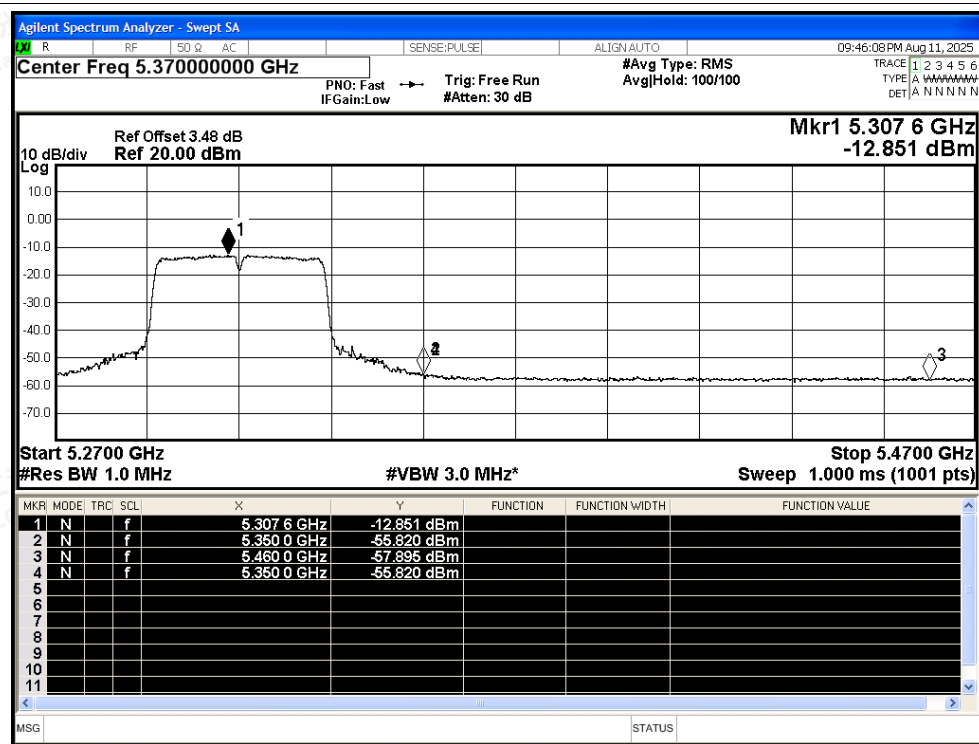

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be80 5290MHz Ant3 Peak

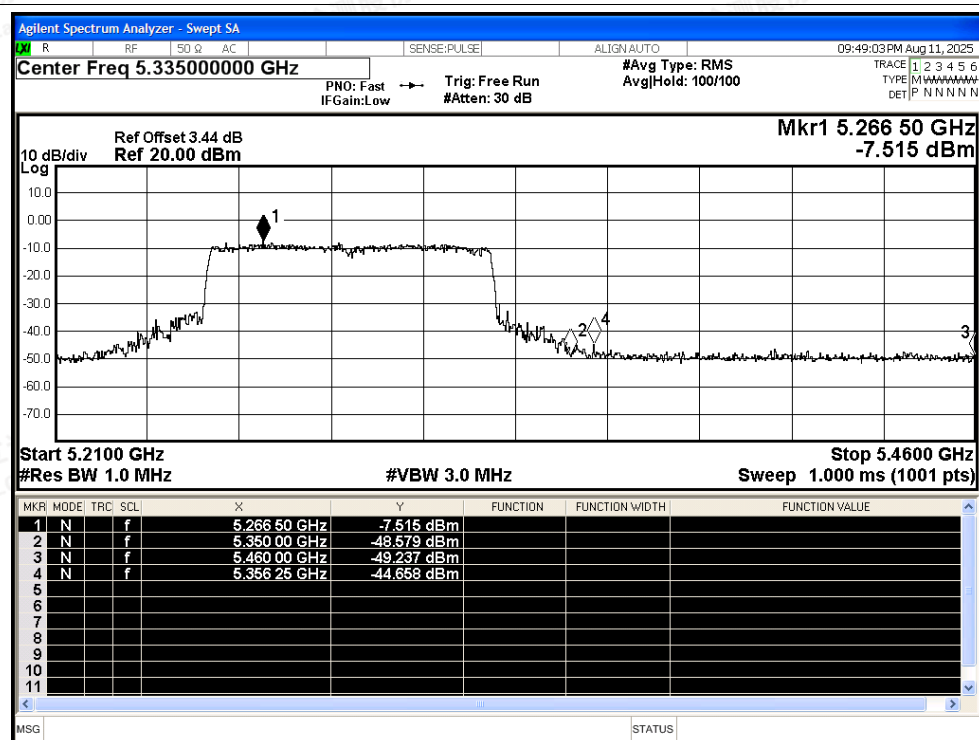

Restrict Band NVNT be80 5290MHz Ant3 Average

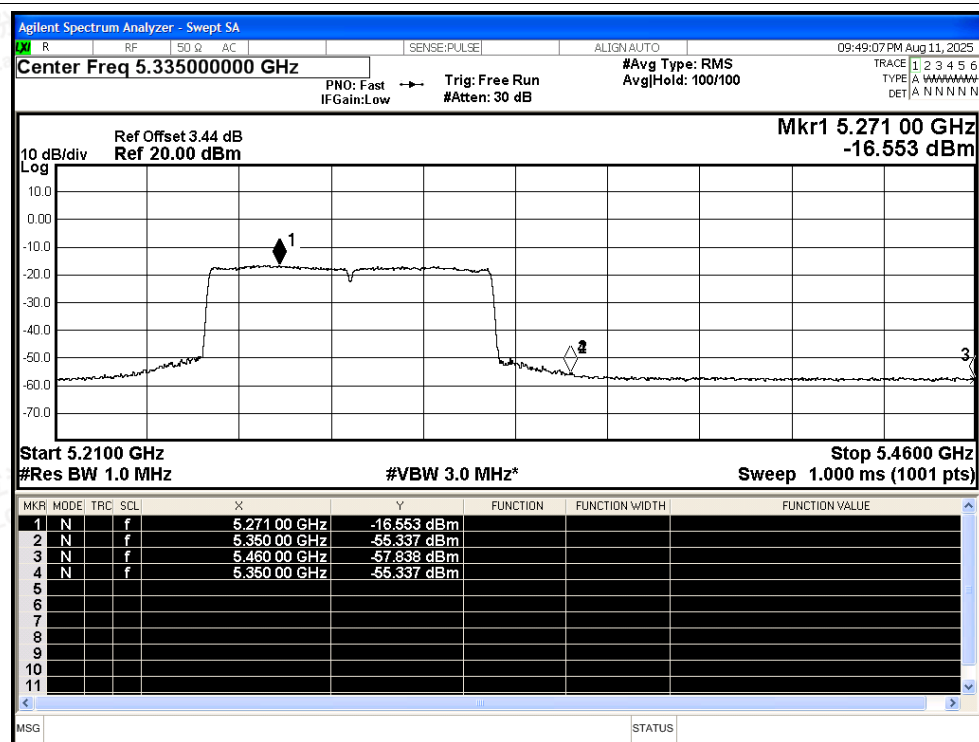

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be80 5290MHz Ant3 Peak

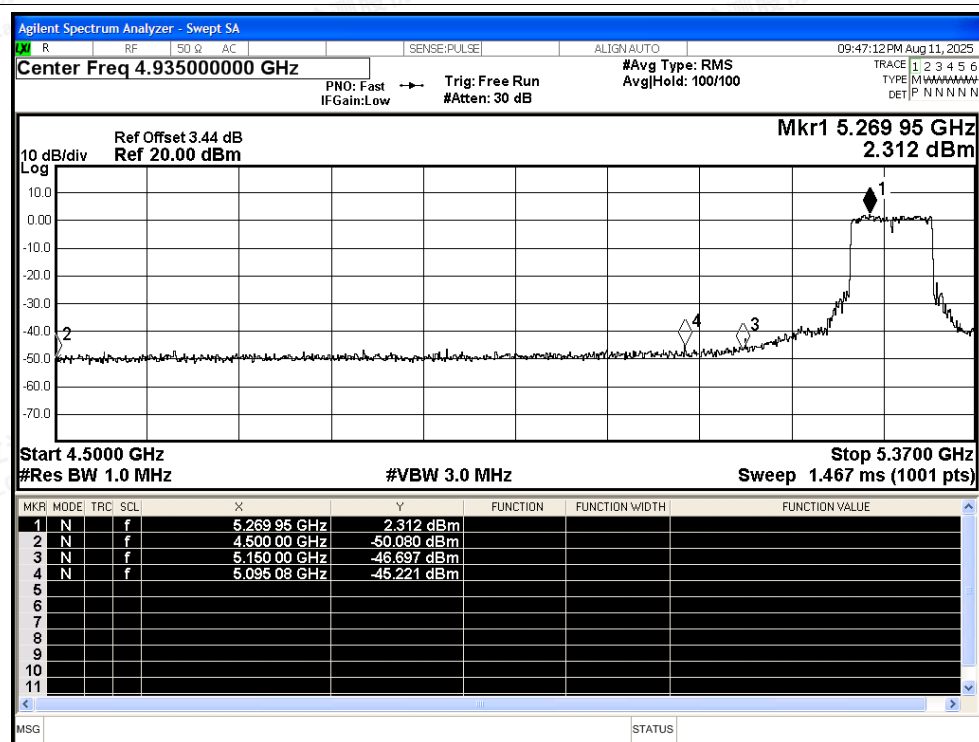

Restrict Band NVNT be80 5290MHz Ant3 Average

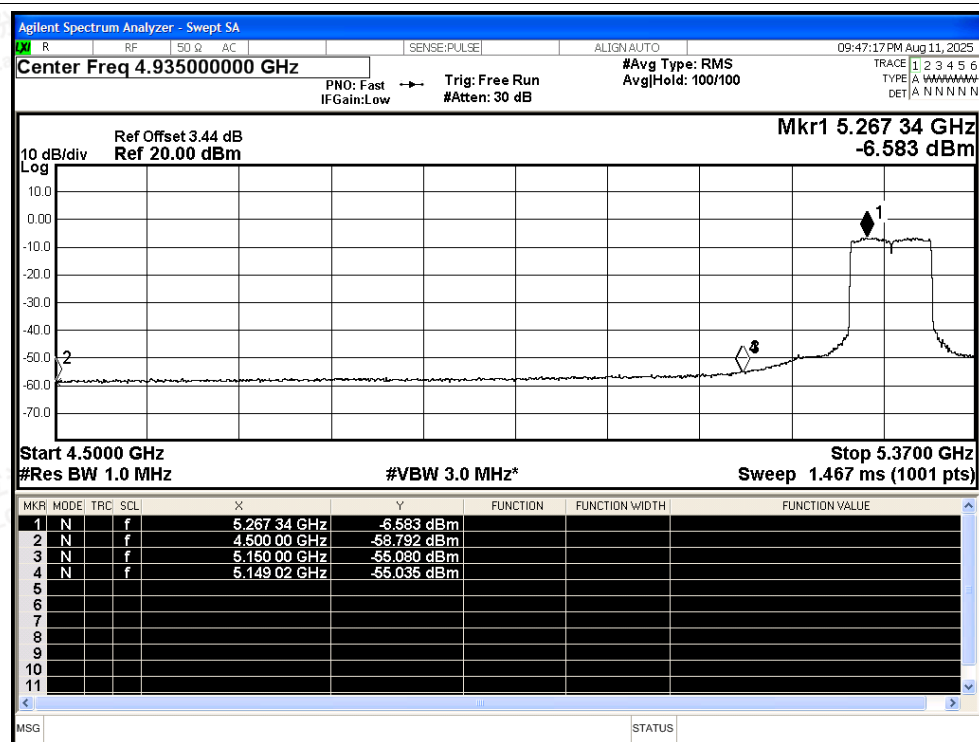

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac160 5250MHz Ant3 Peak

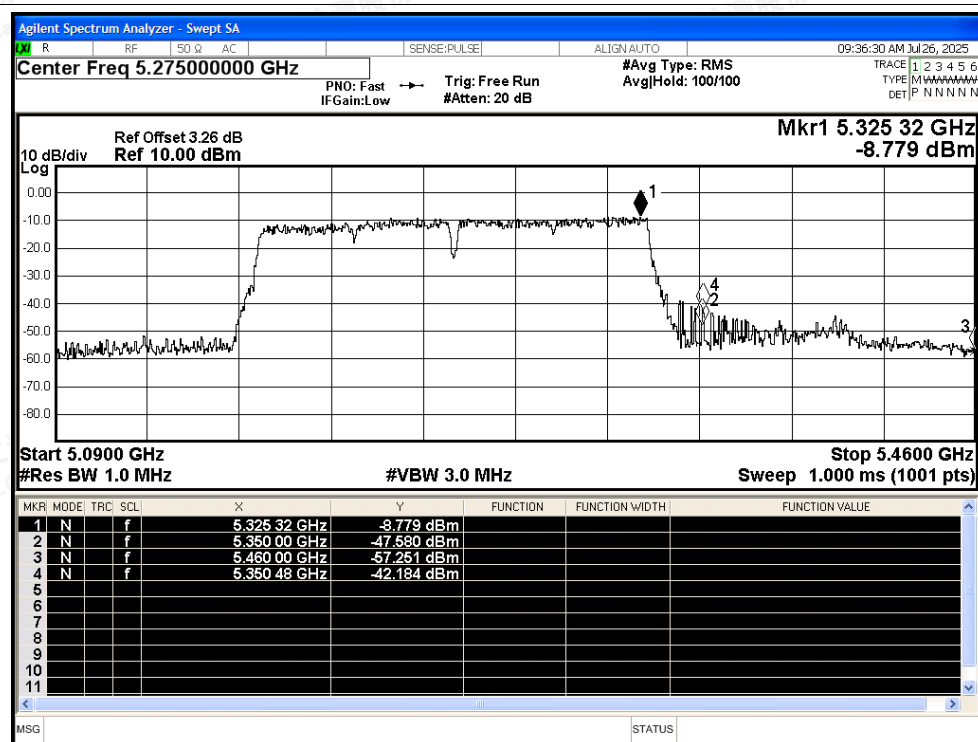

Restrict Band NVNT ac160 5250MHz Ant3 Average

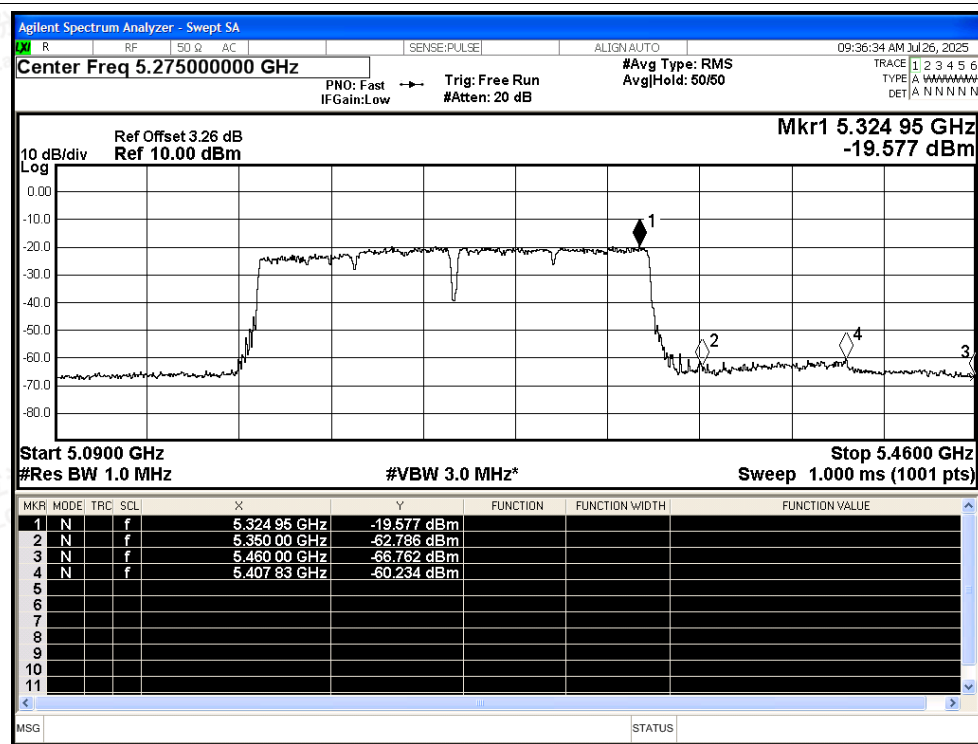

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac160 5250MHz Ant3 Peak

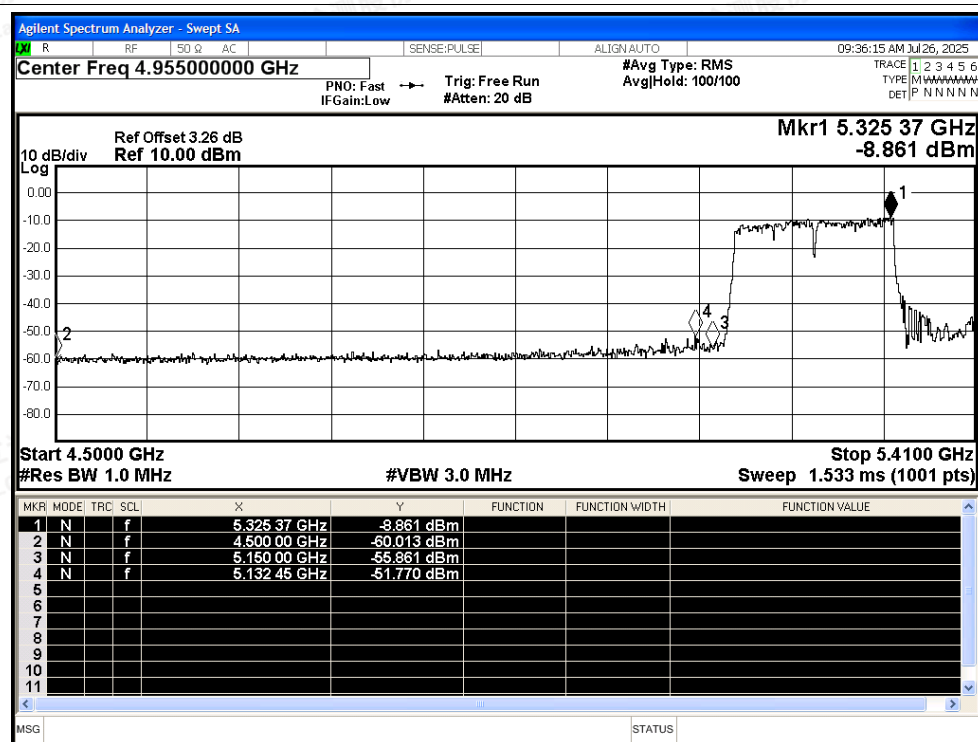

Restrict Band NVNT ac160 5250MHz Ant3 Average

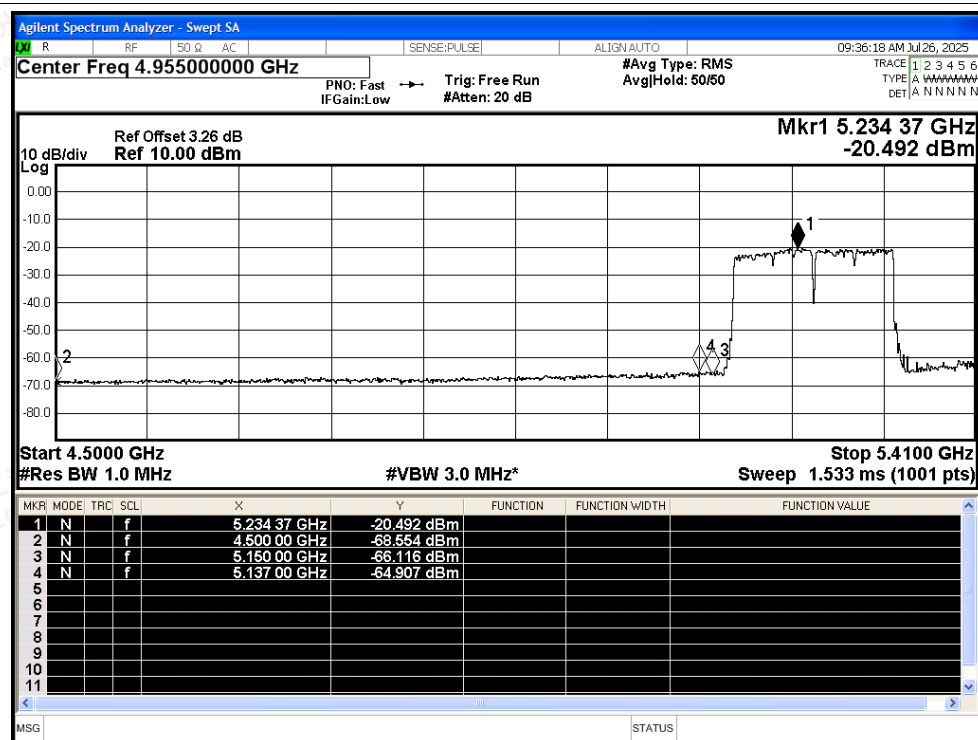

Restrict Band NVNT ax160 5250MHz Ant3 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

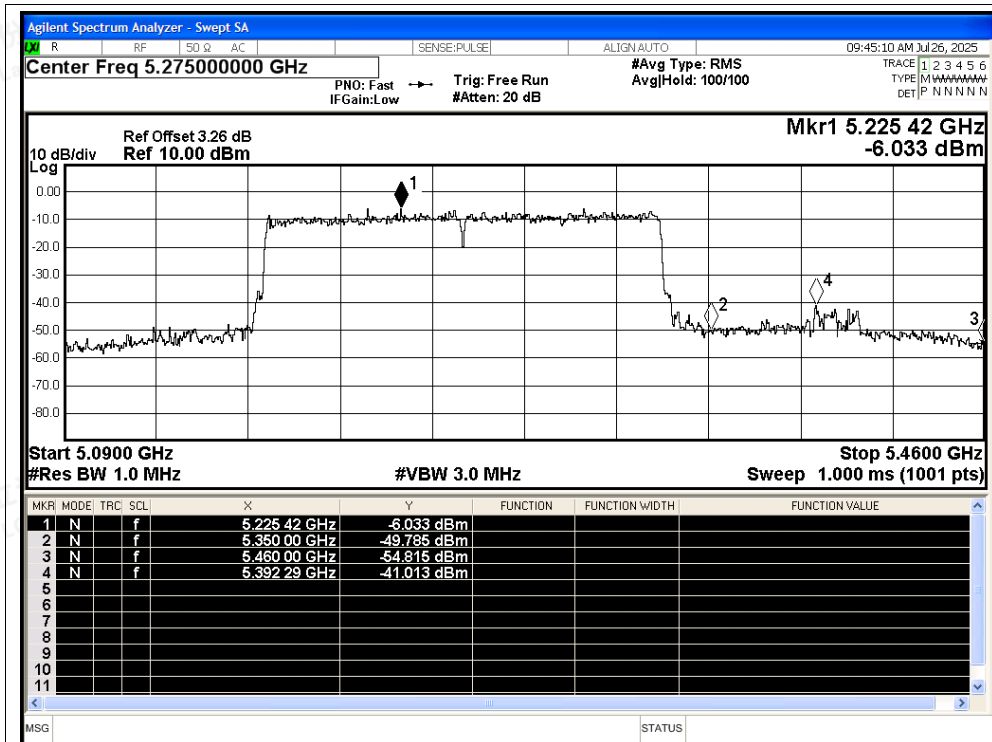

Restrict Band NVNT ax160 5250MHz Ant3 Average

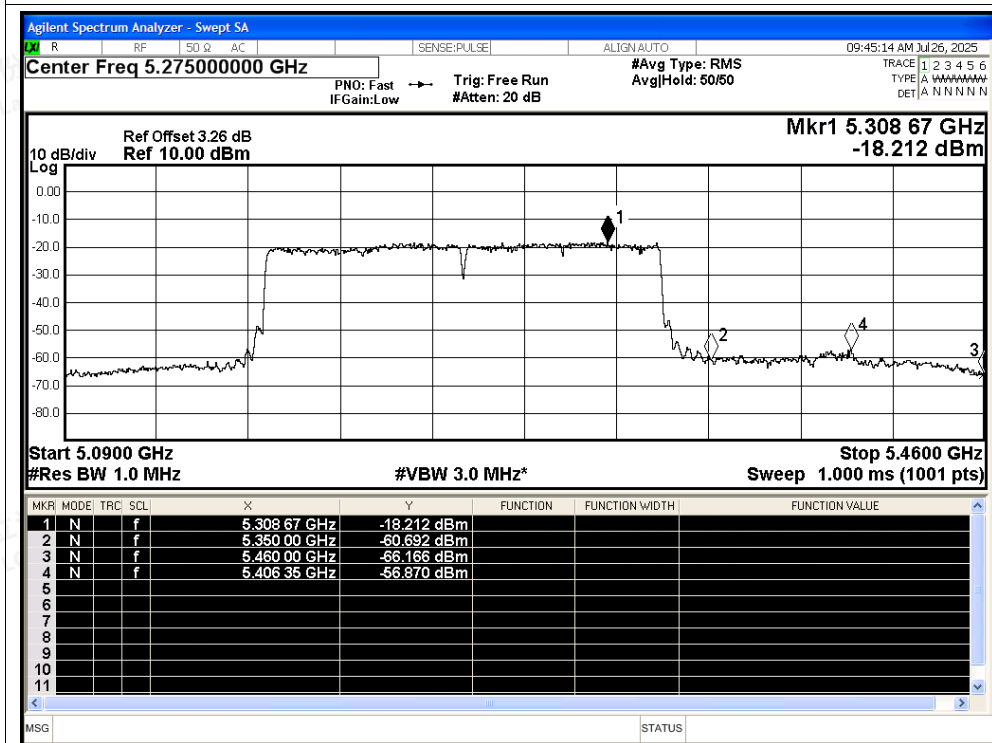

Restrict Band NVNT ax160 5250MHz Ant3 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

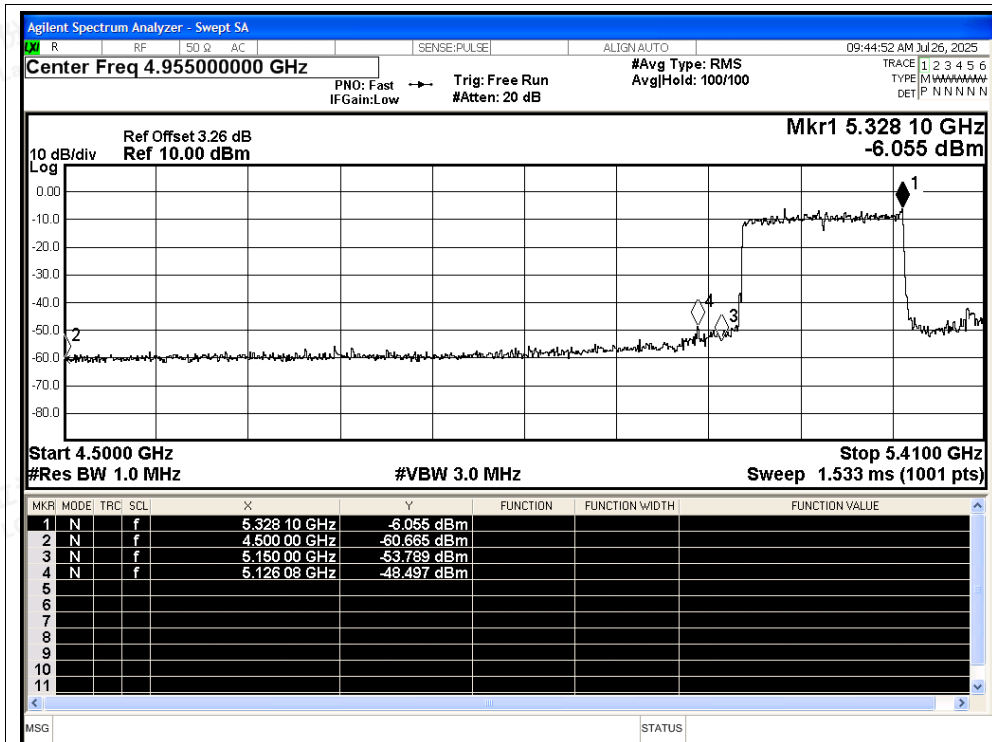

Restrict Band NVNT ax160 5250MHz Ant3 Average

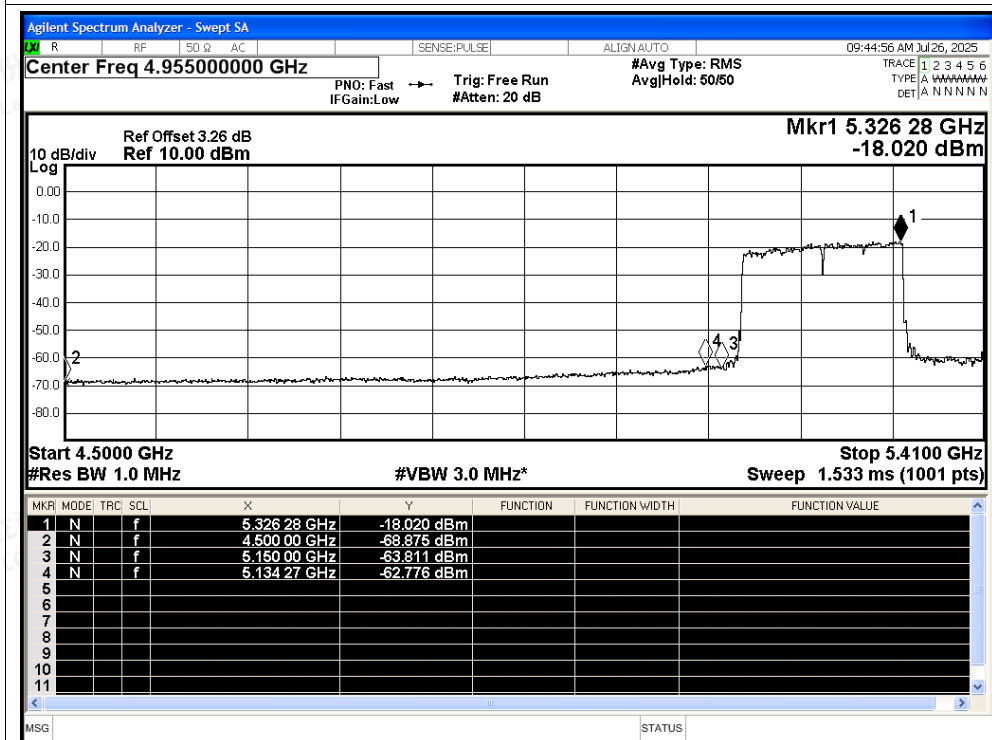

Restrict Band NVNT be160 5250MHz Ant3 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

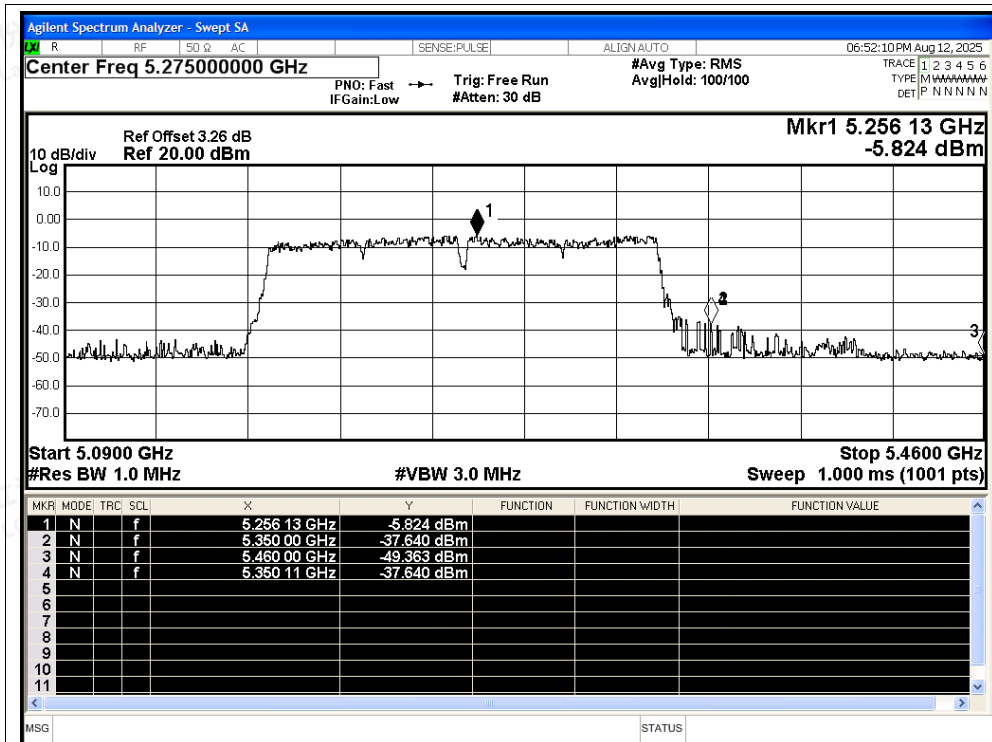

Restrict Band NVNT be160 5250MHz Ant3 Average

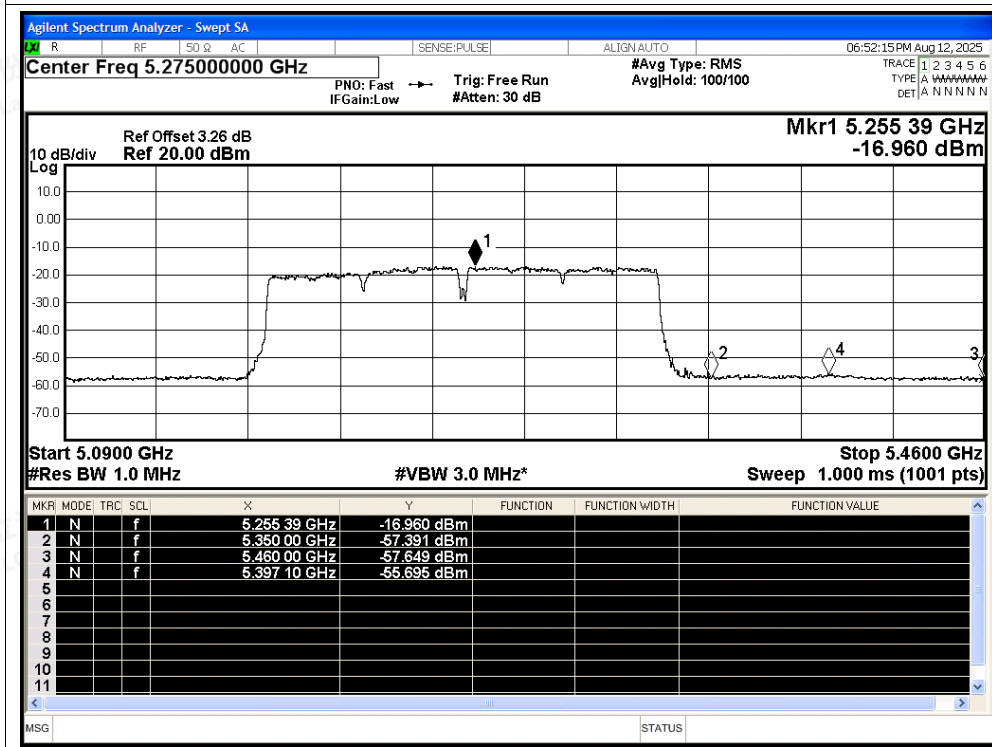

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity