






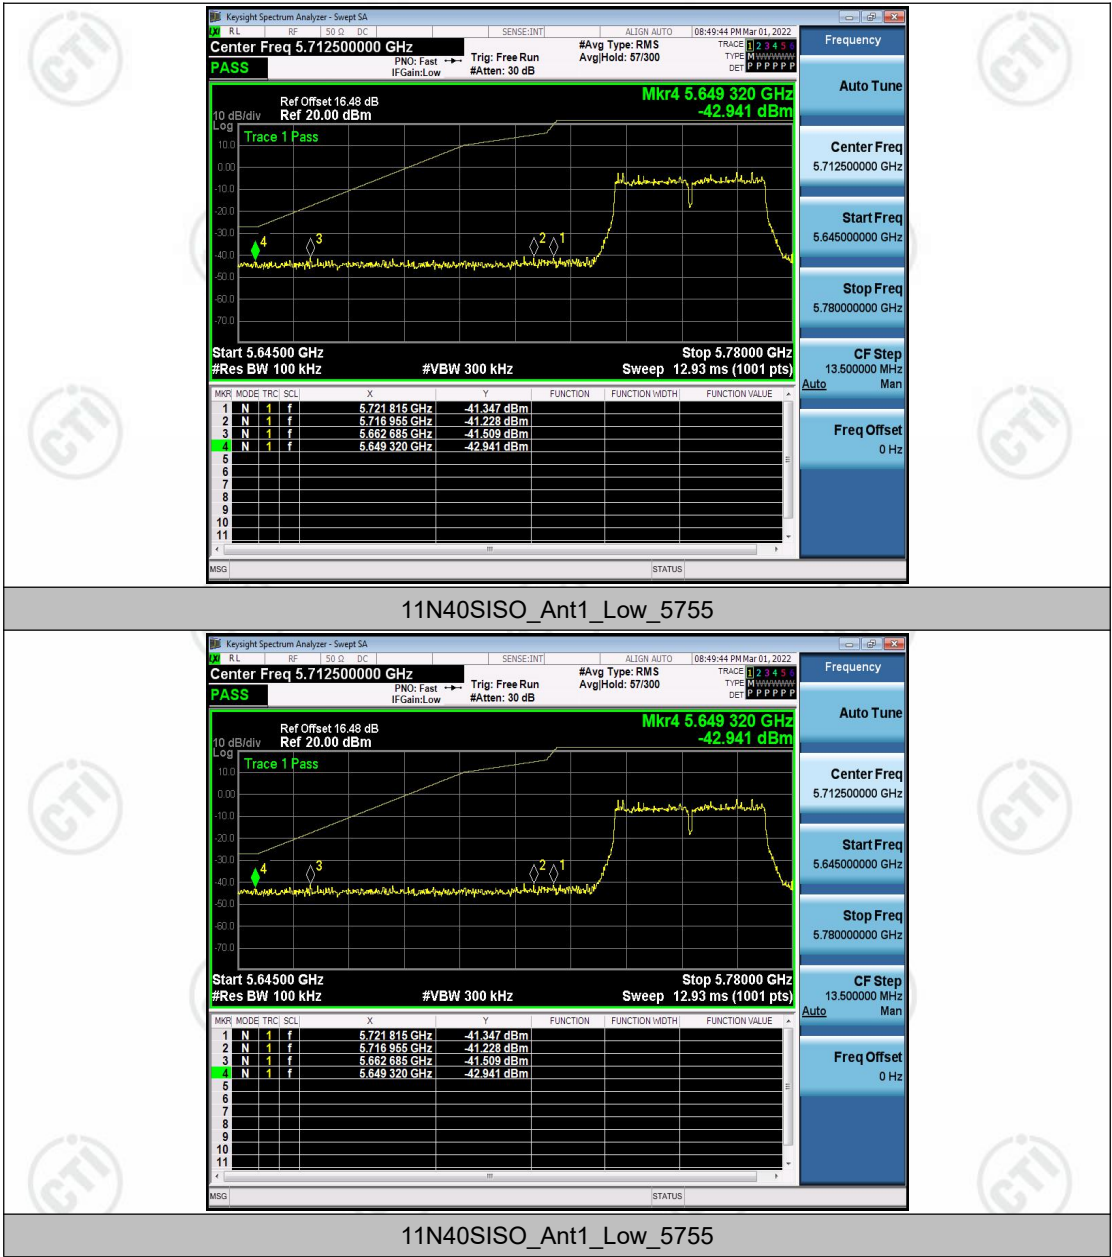


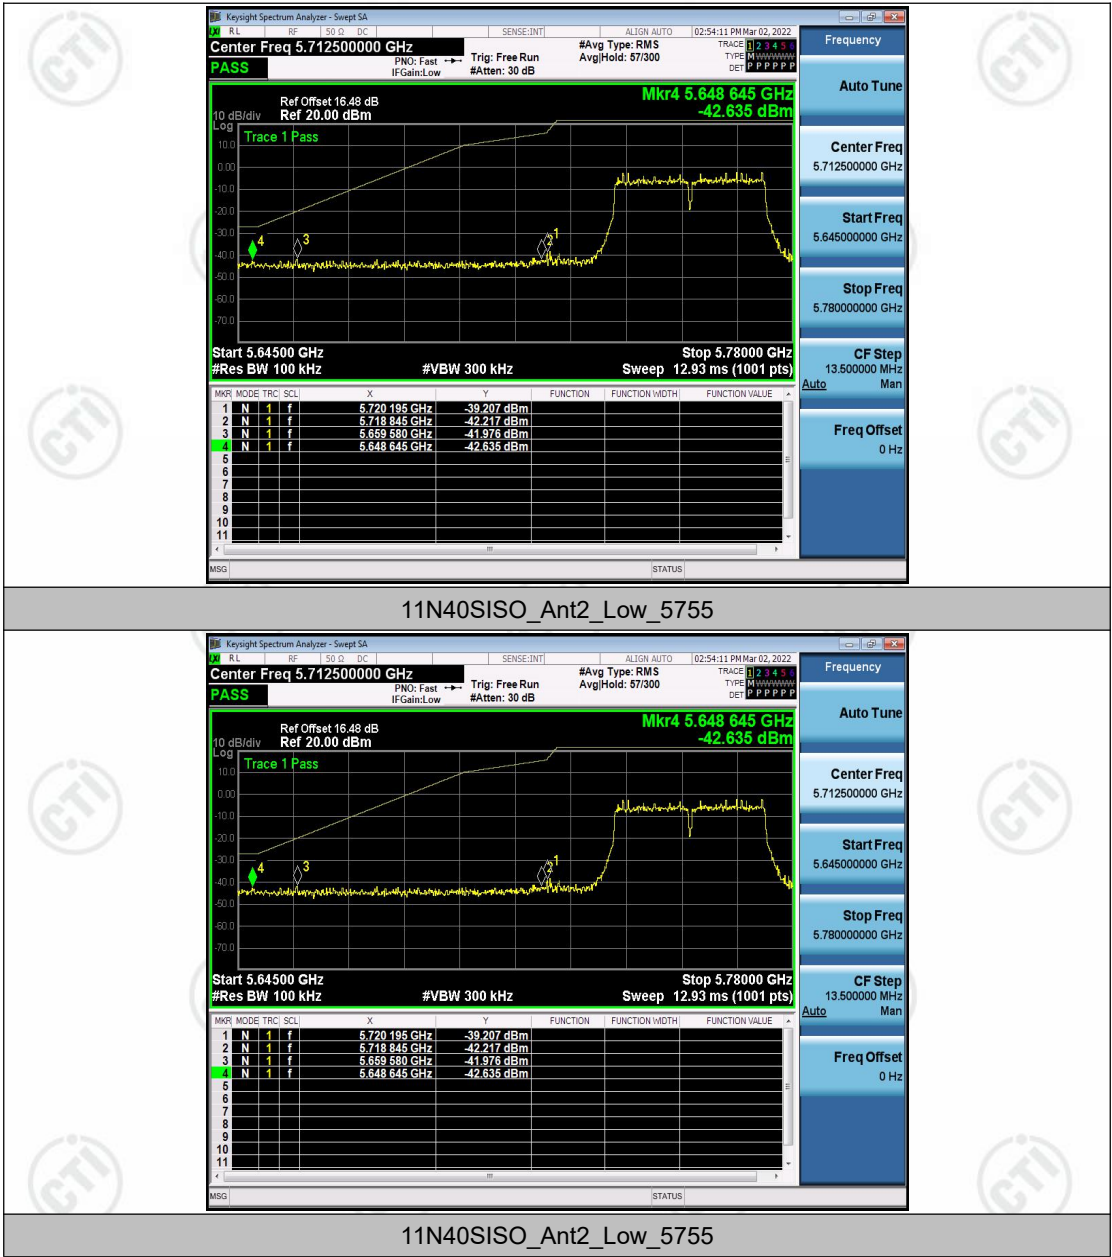


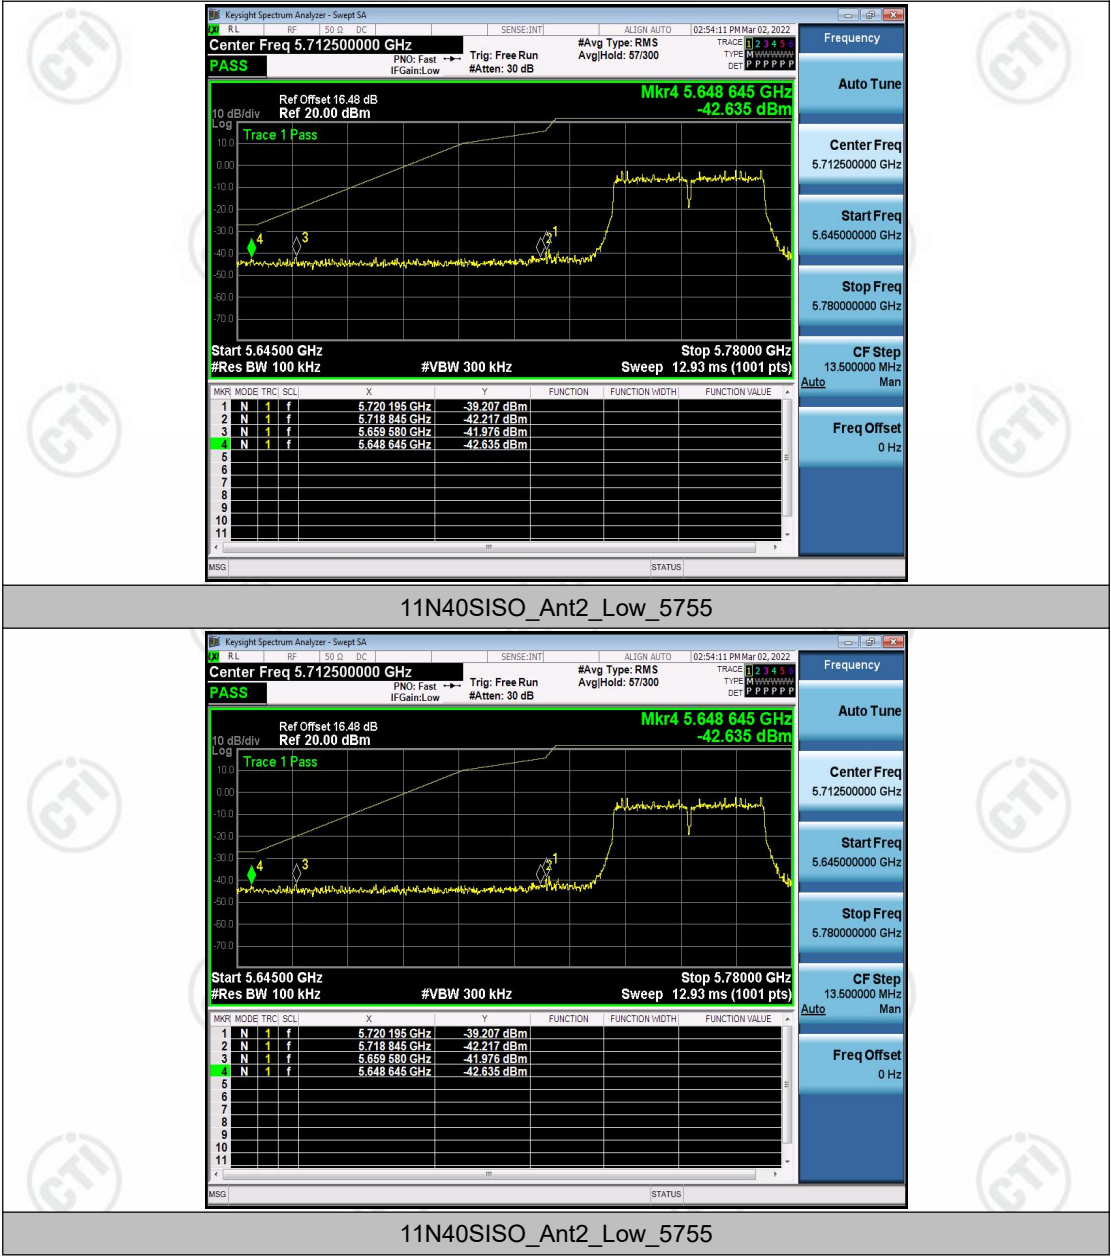


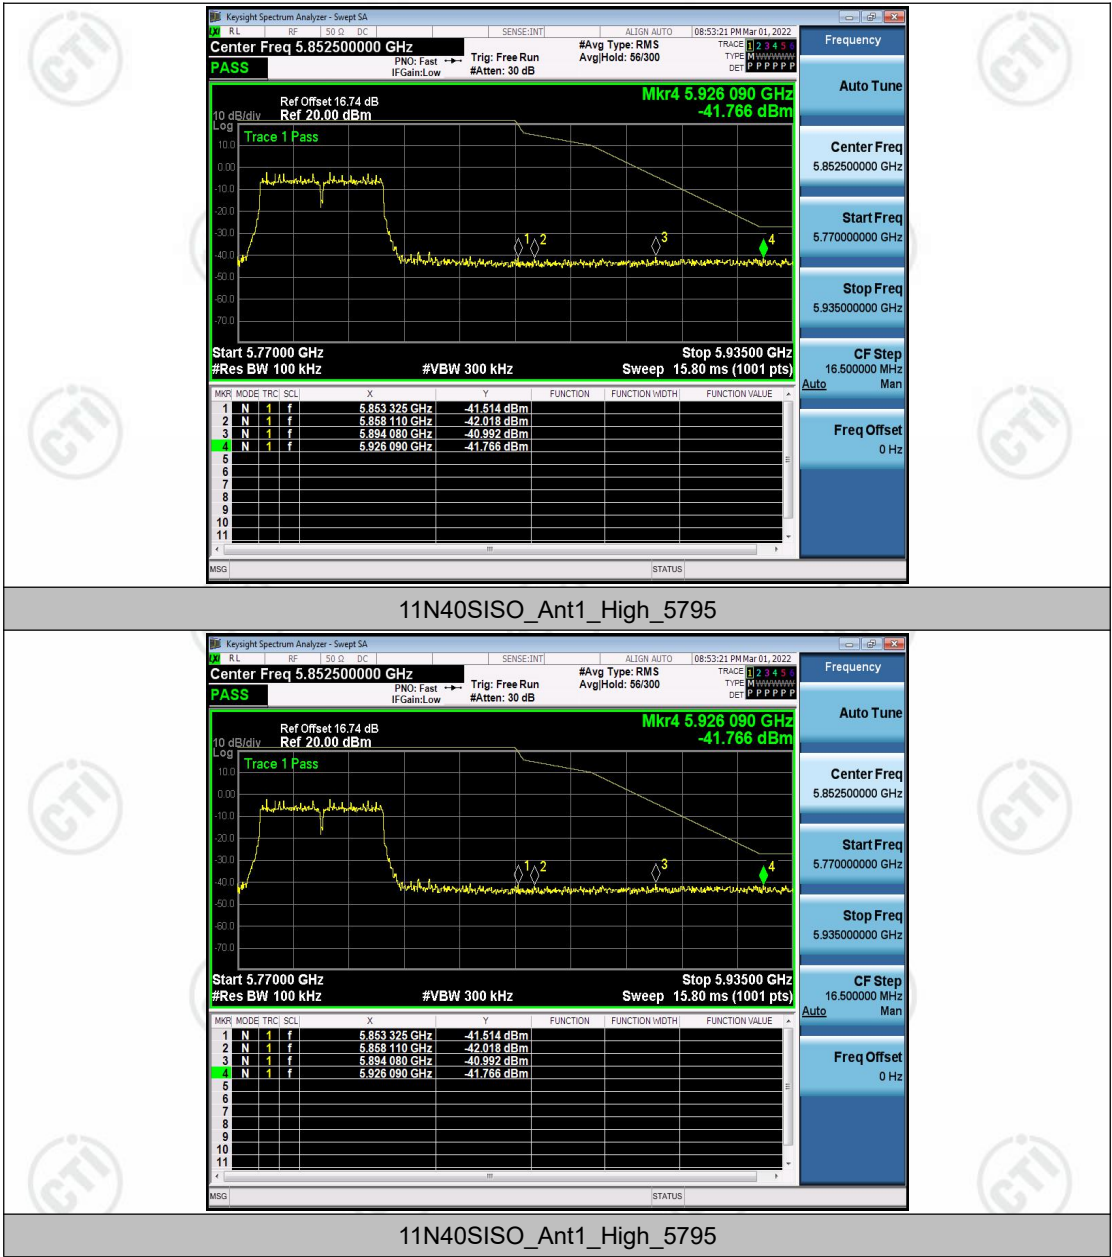


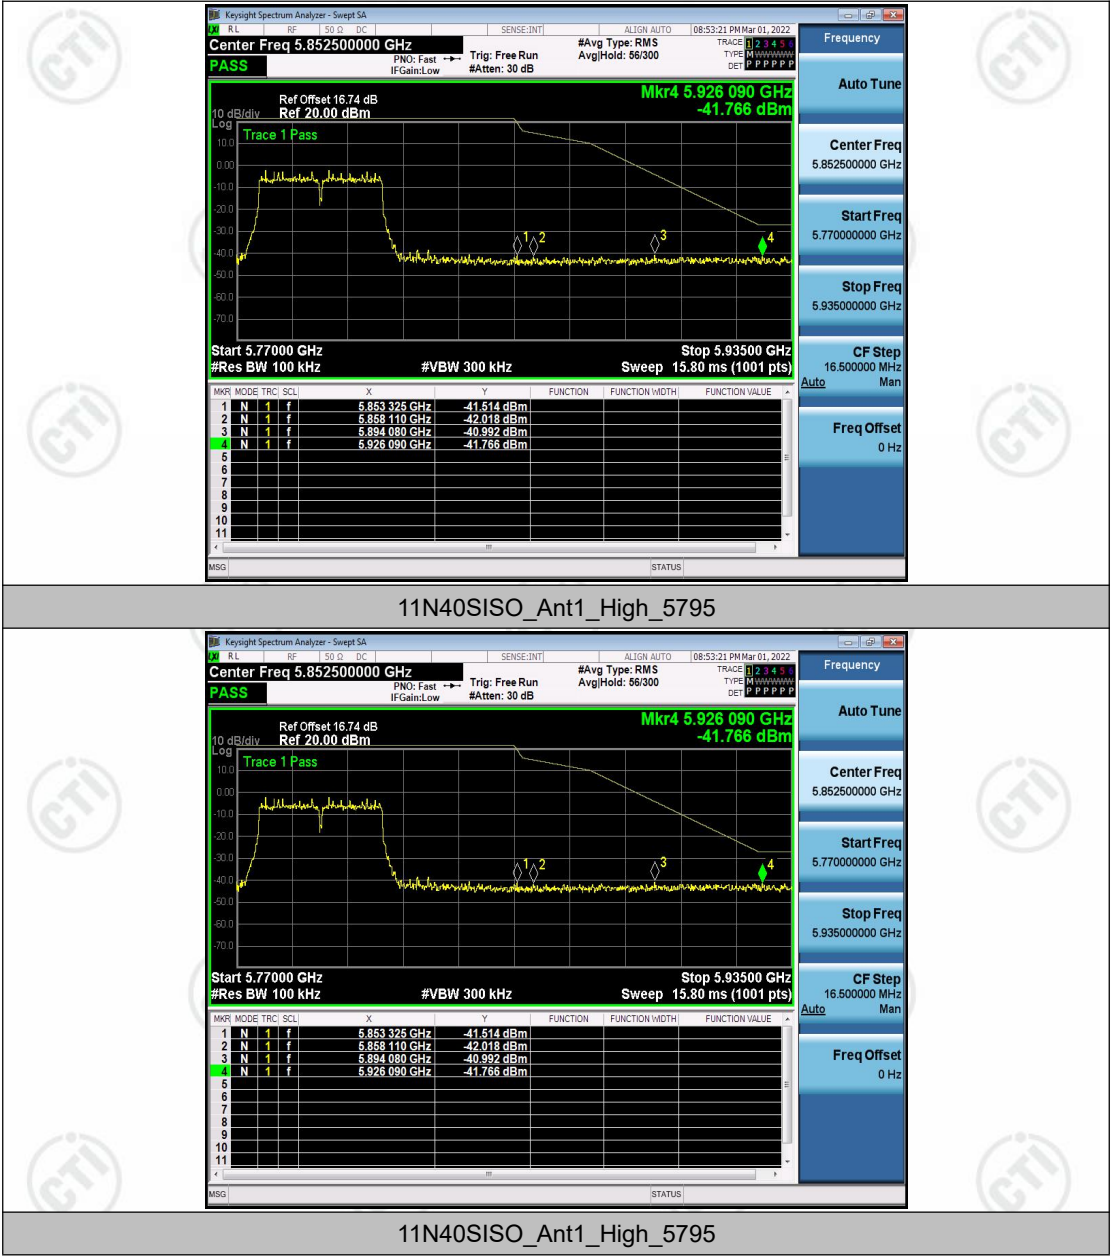


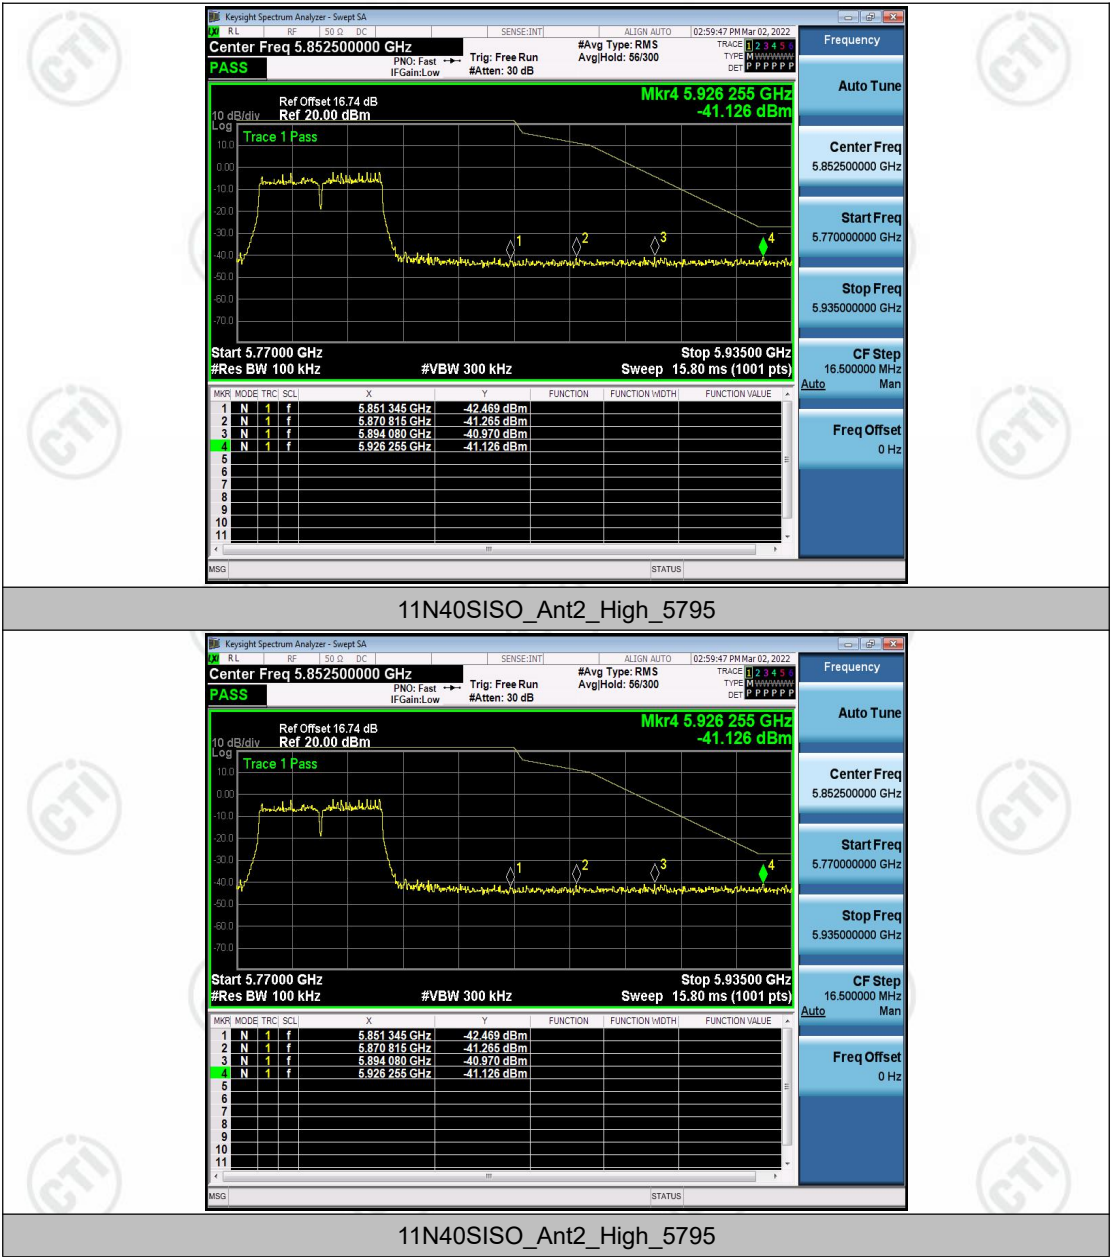


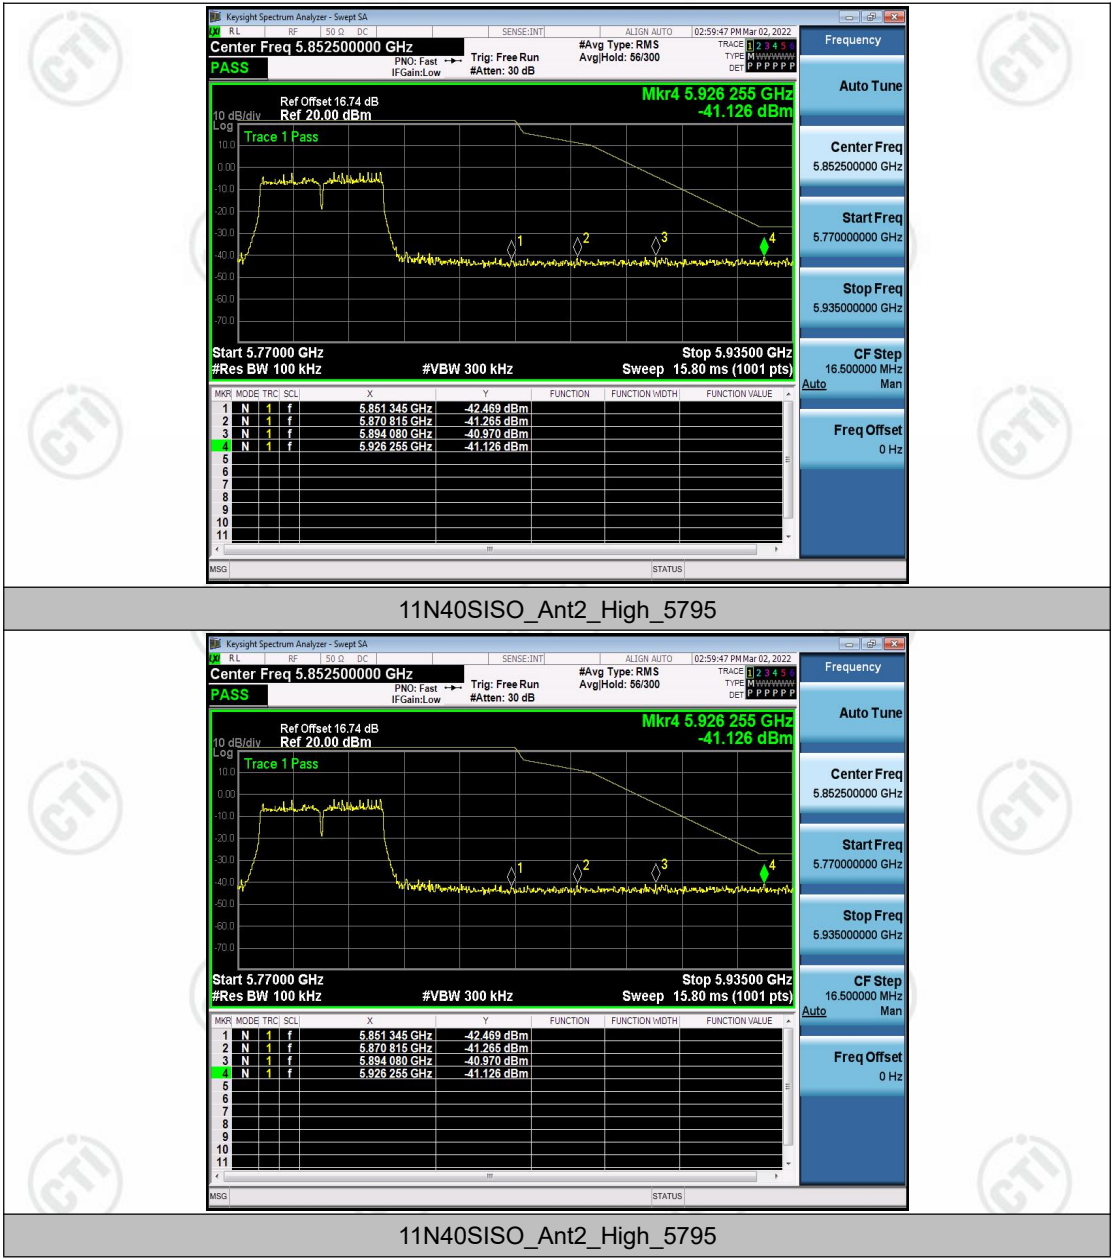


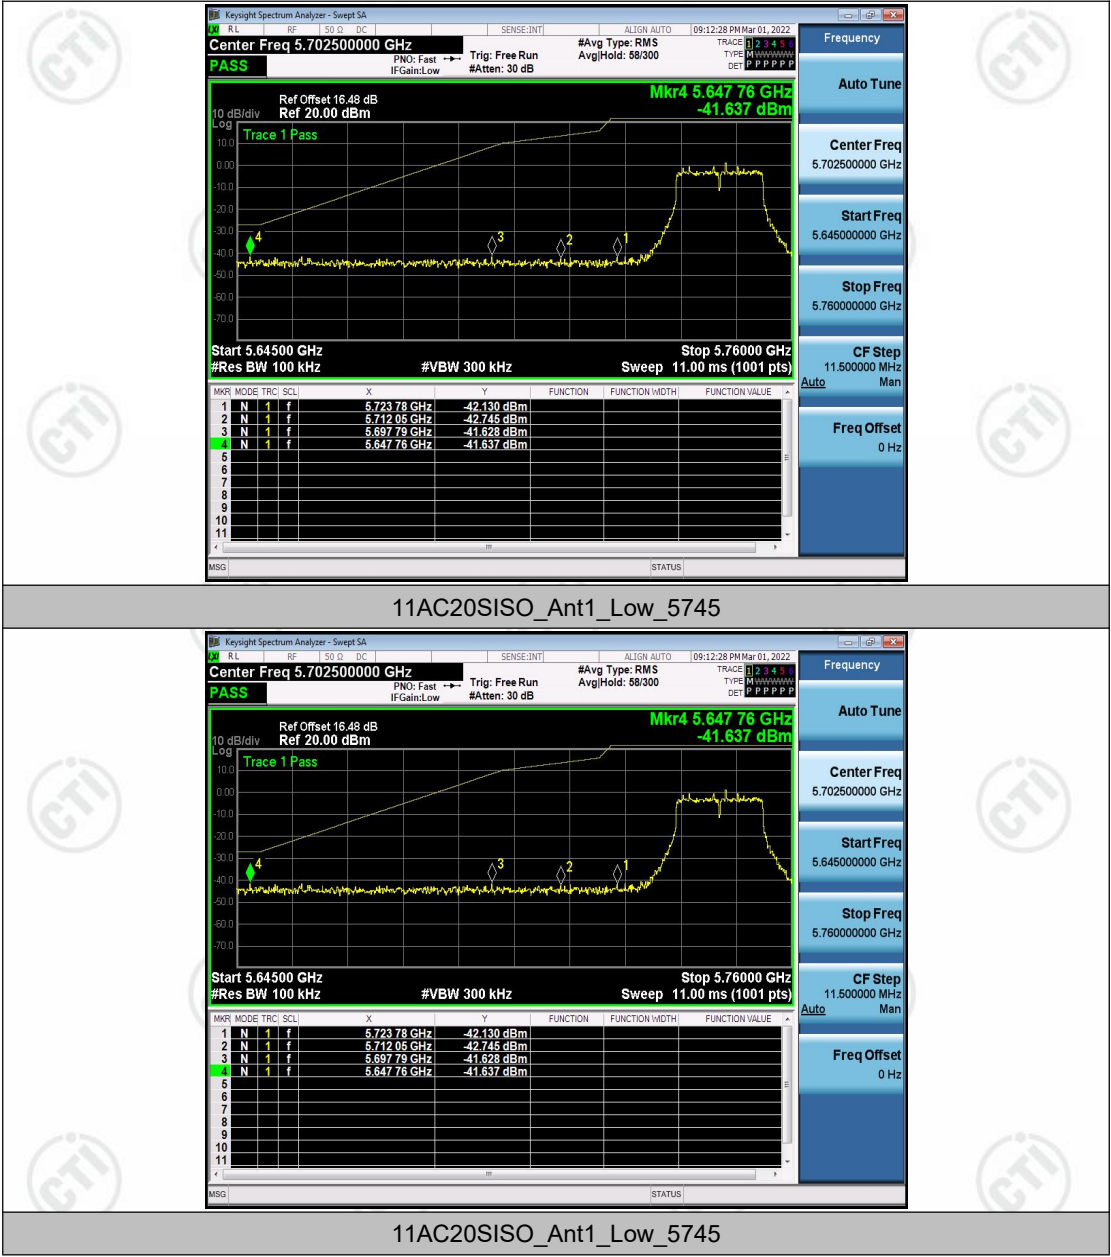


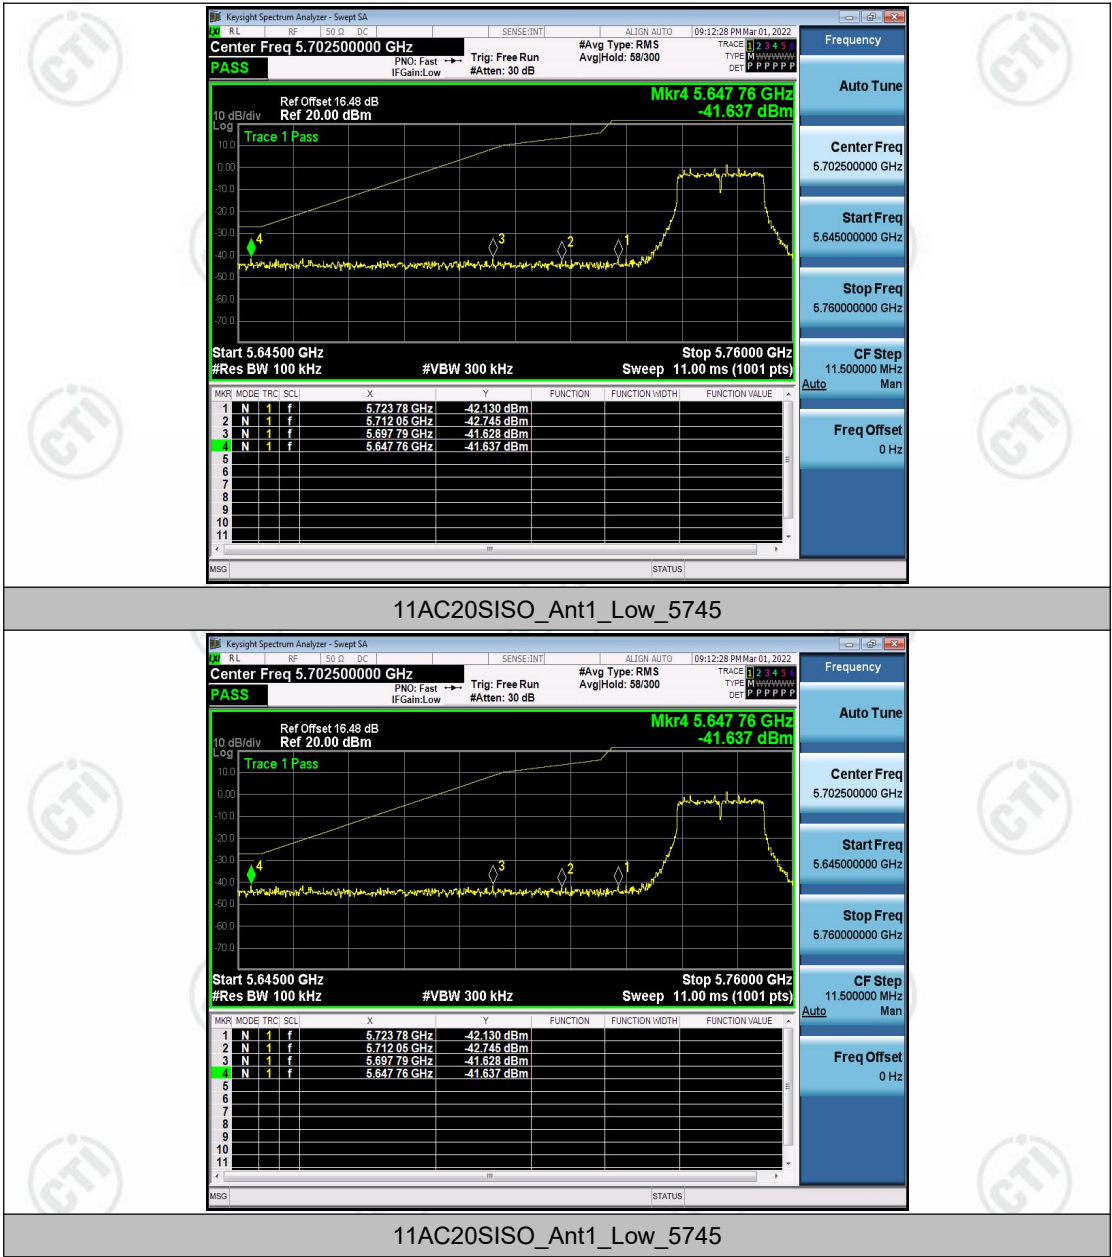


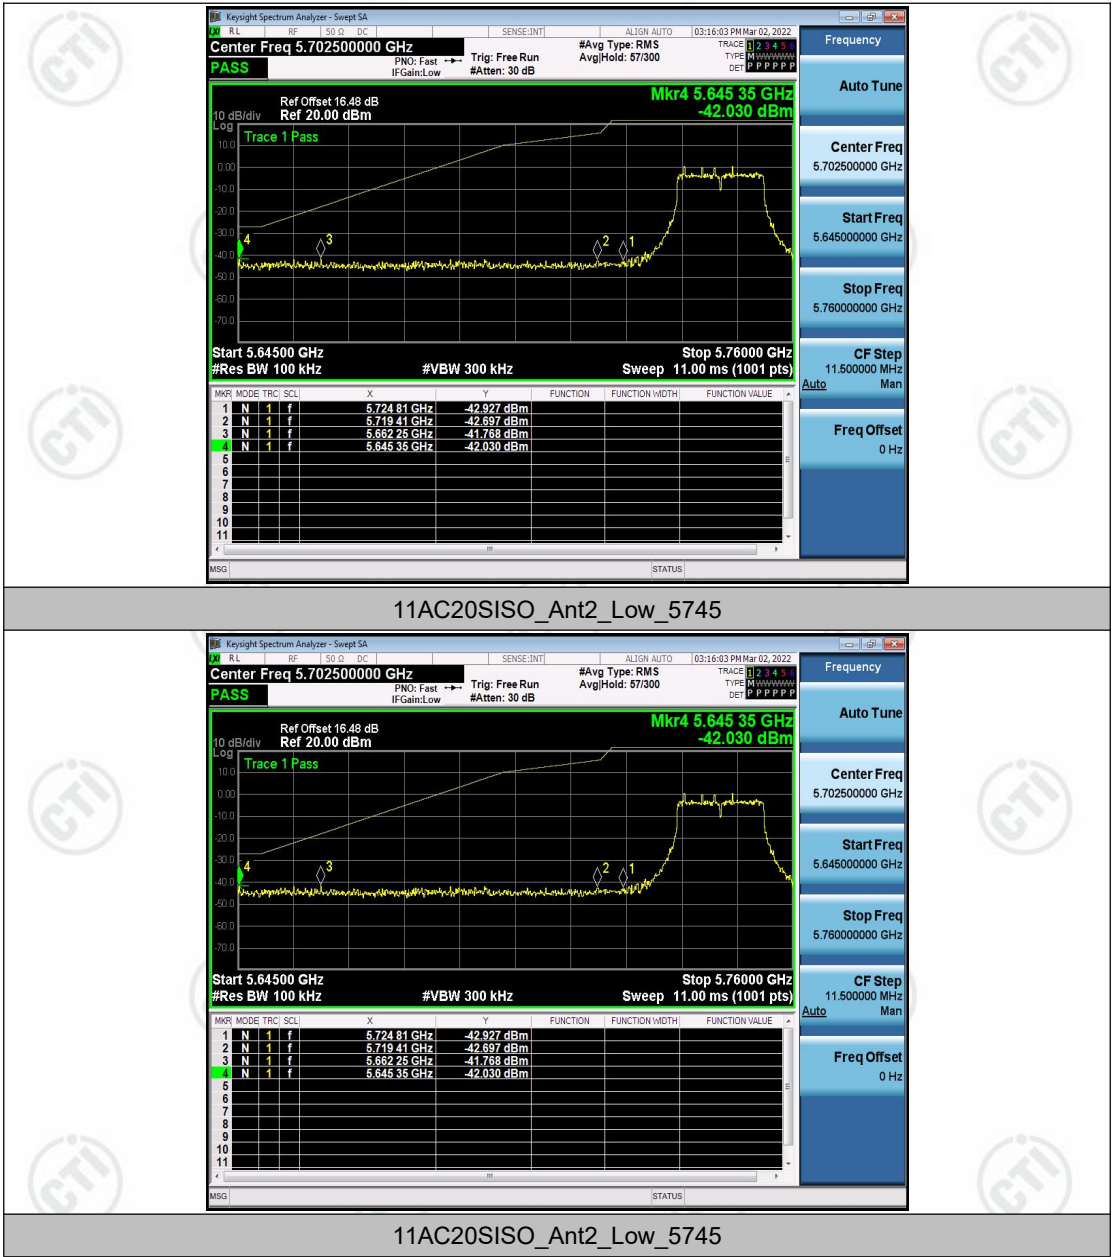


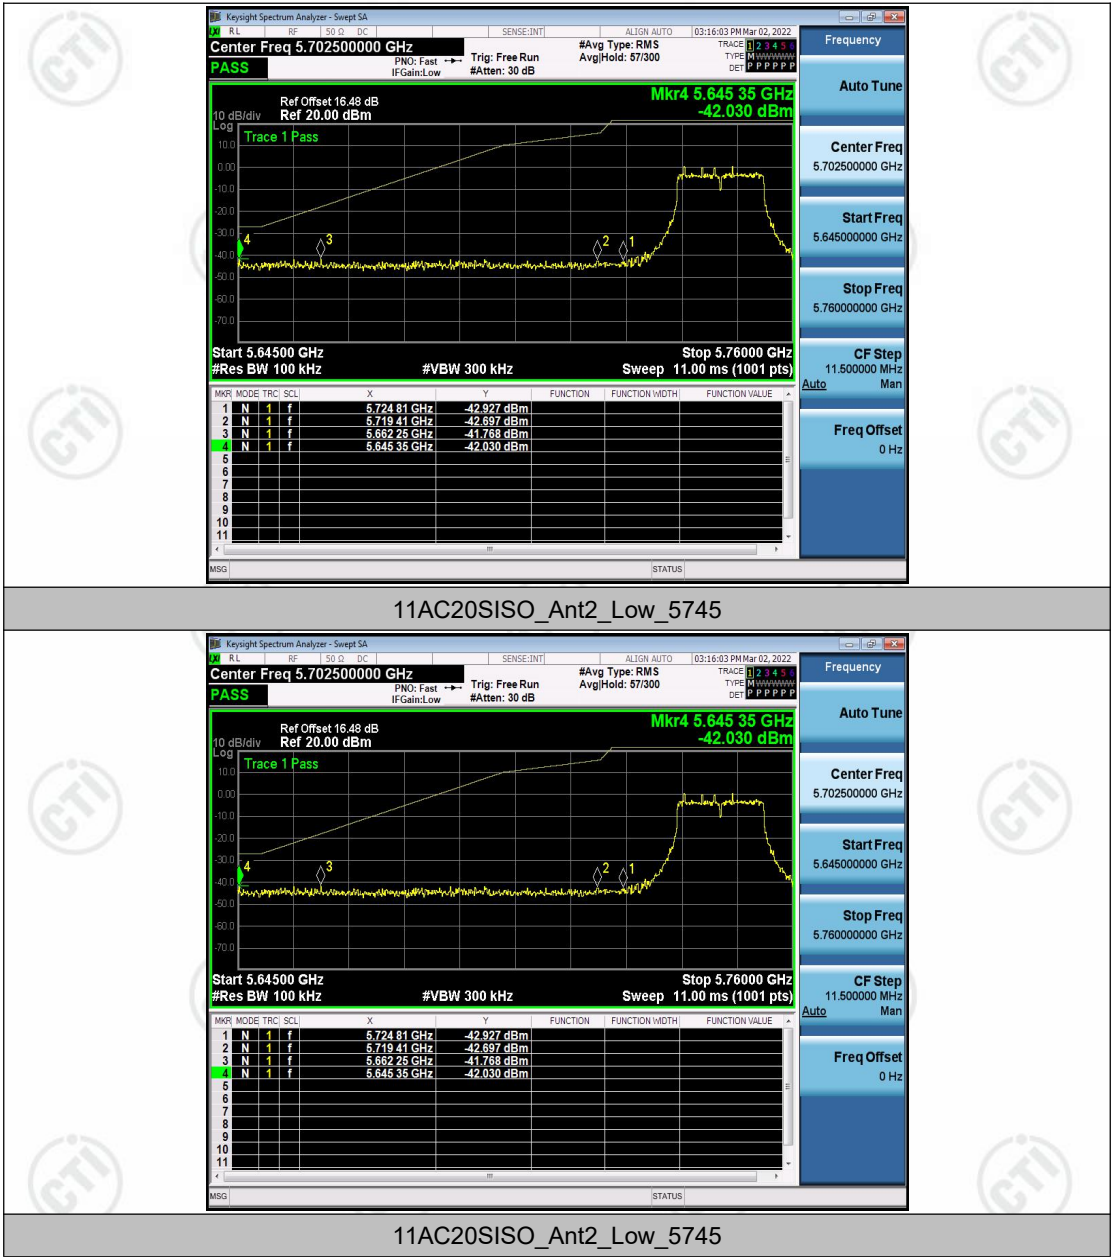


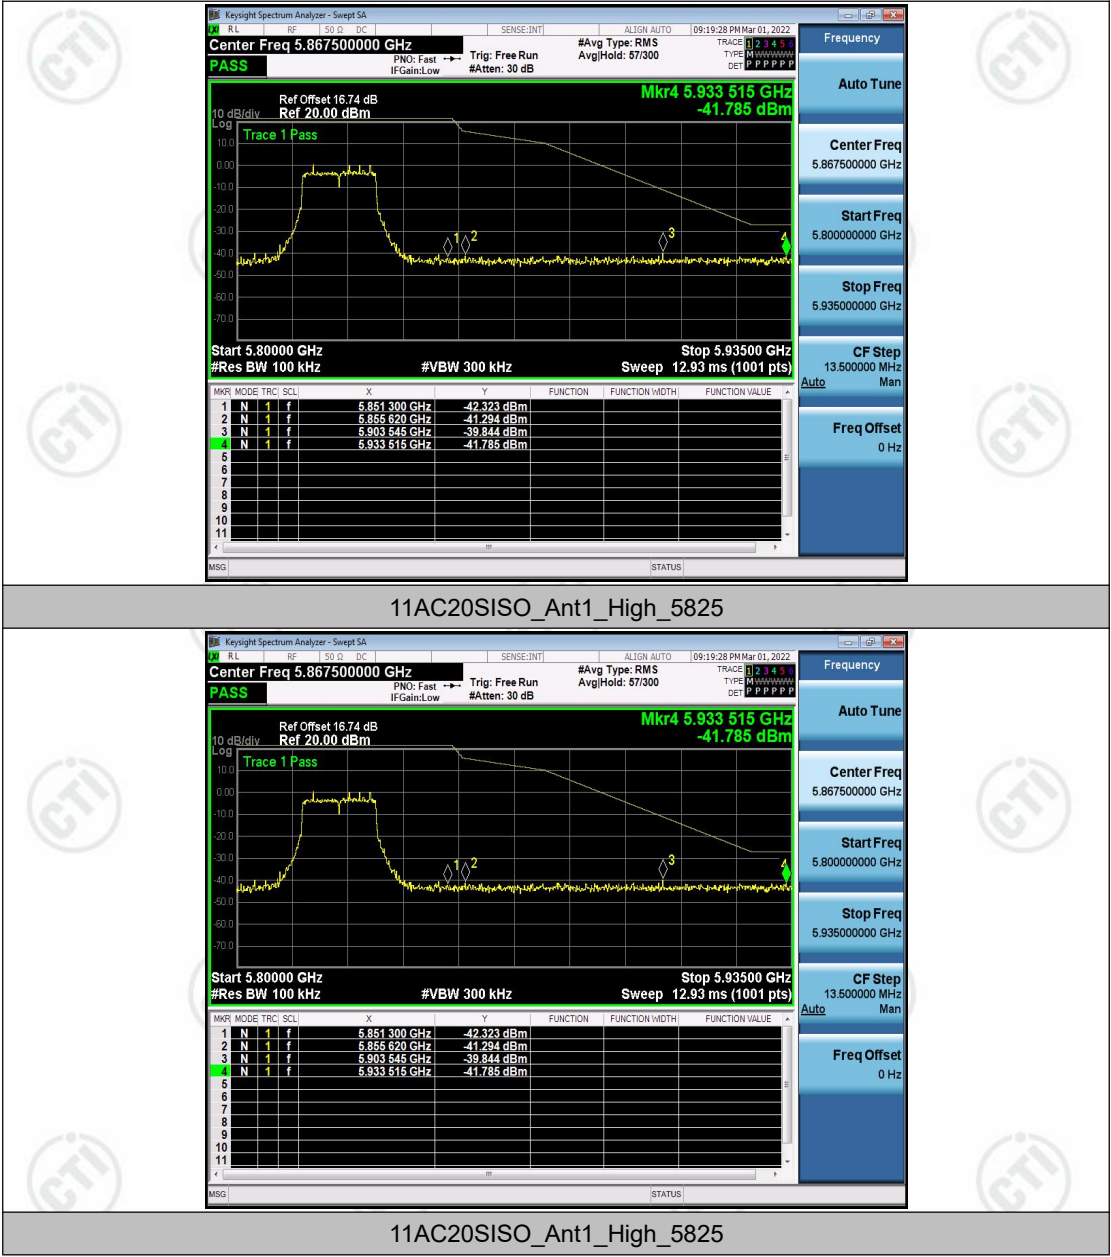


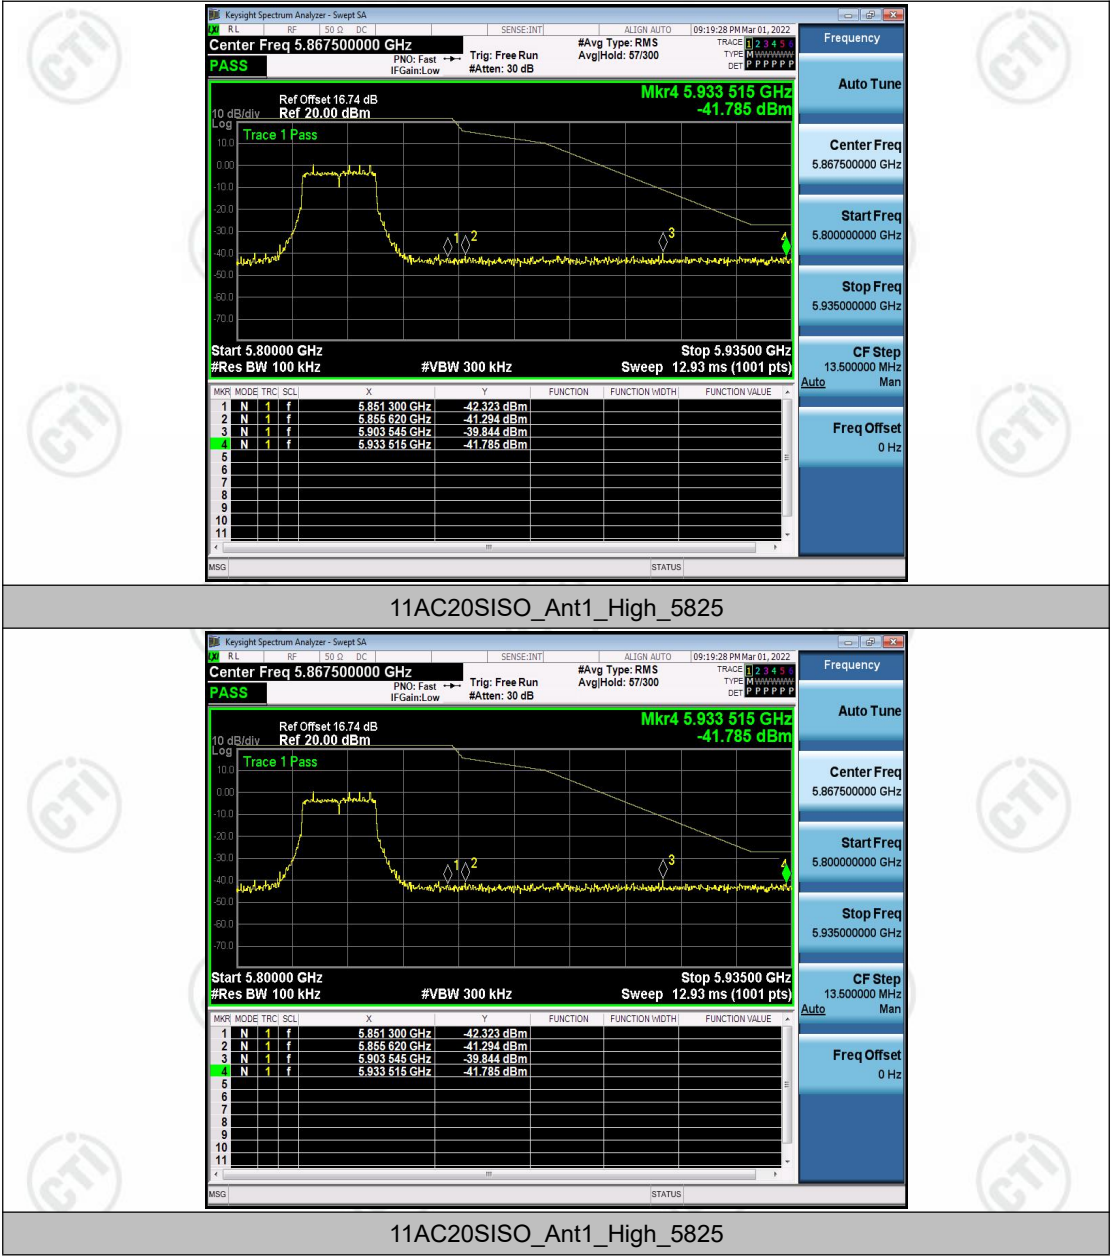


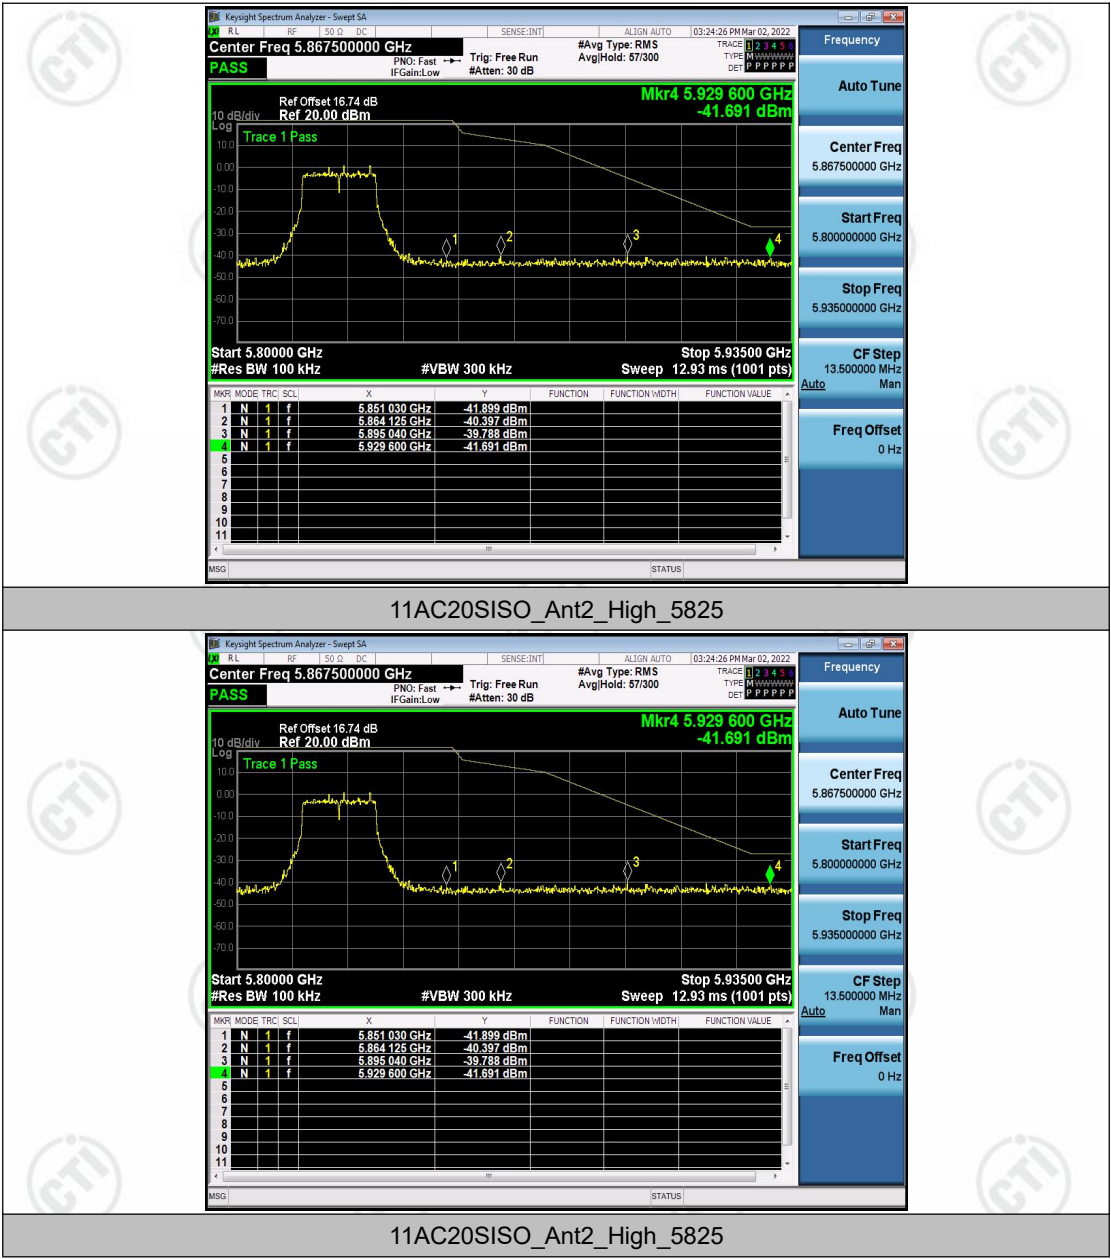


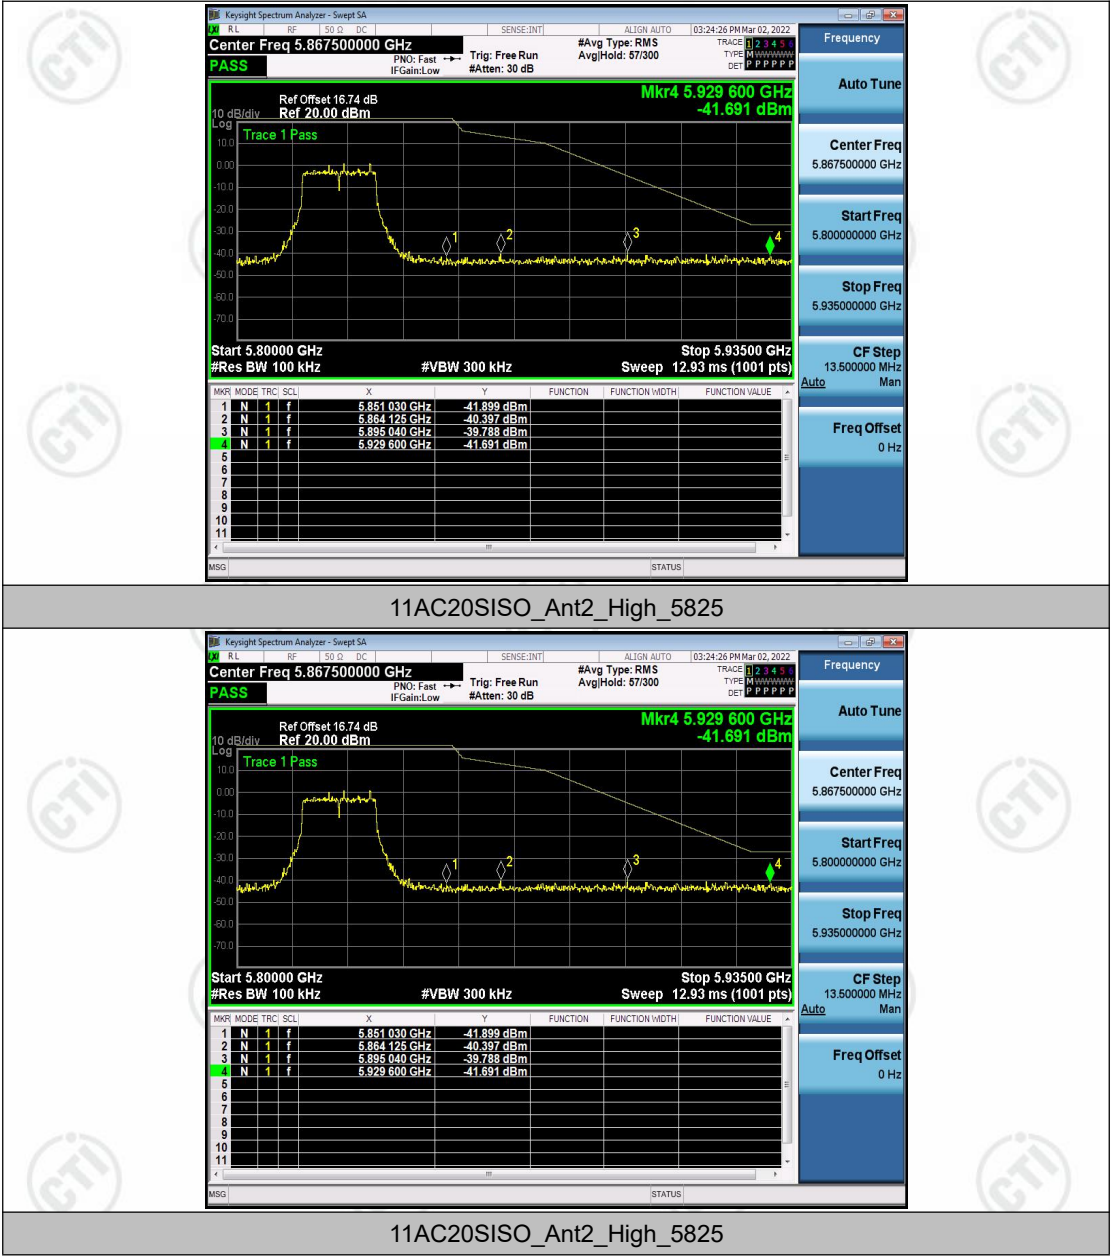


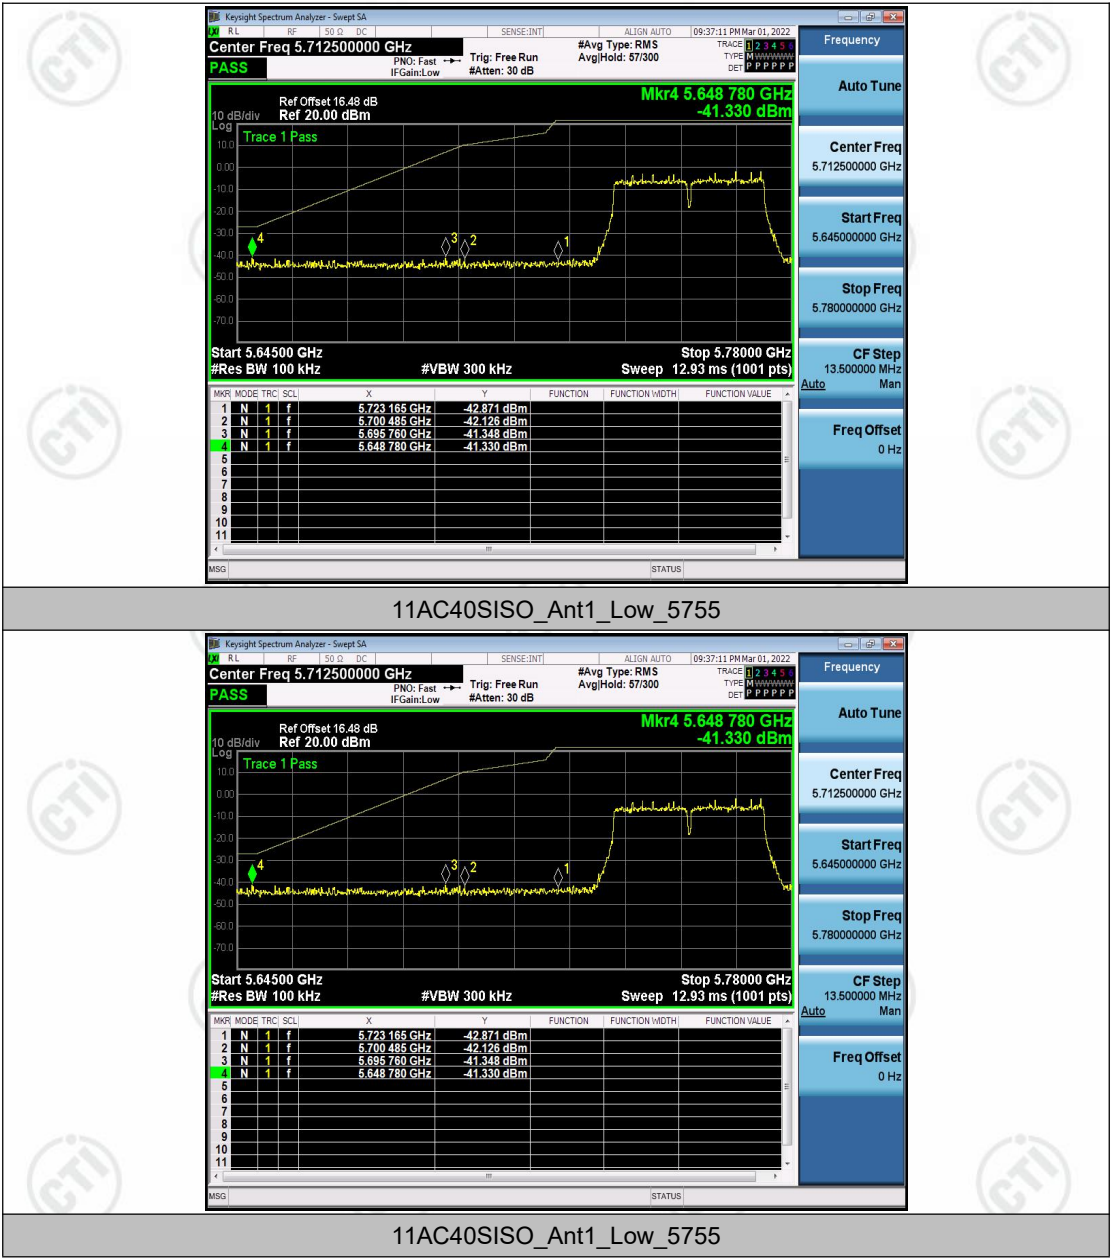


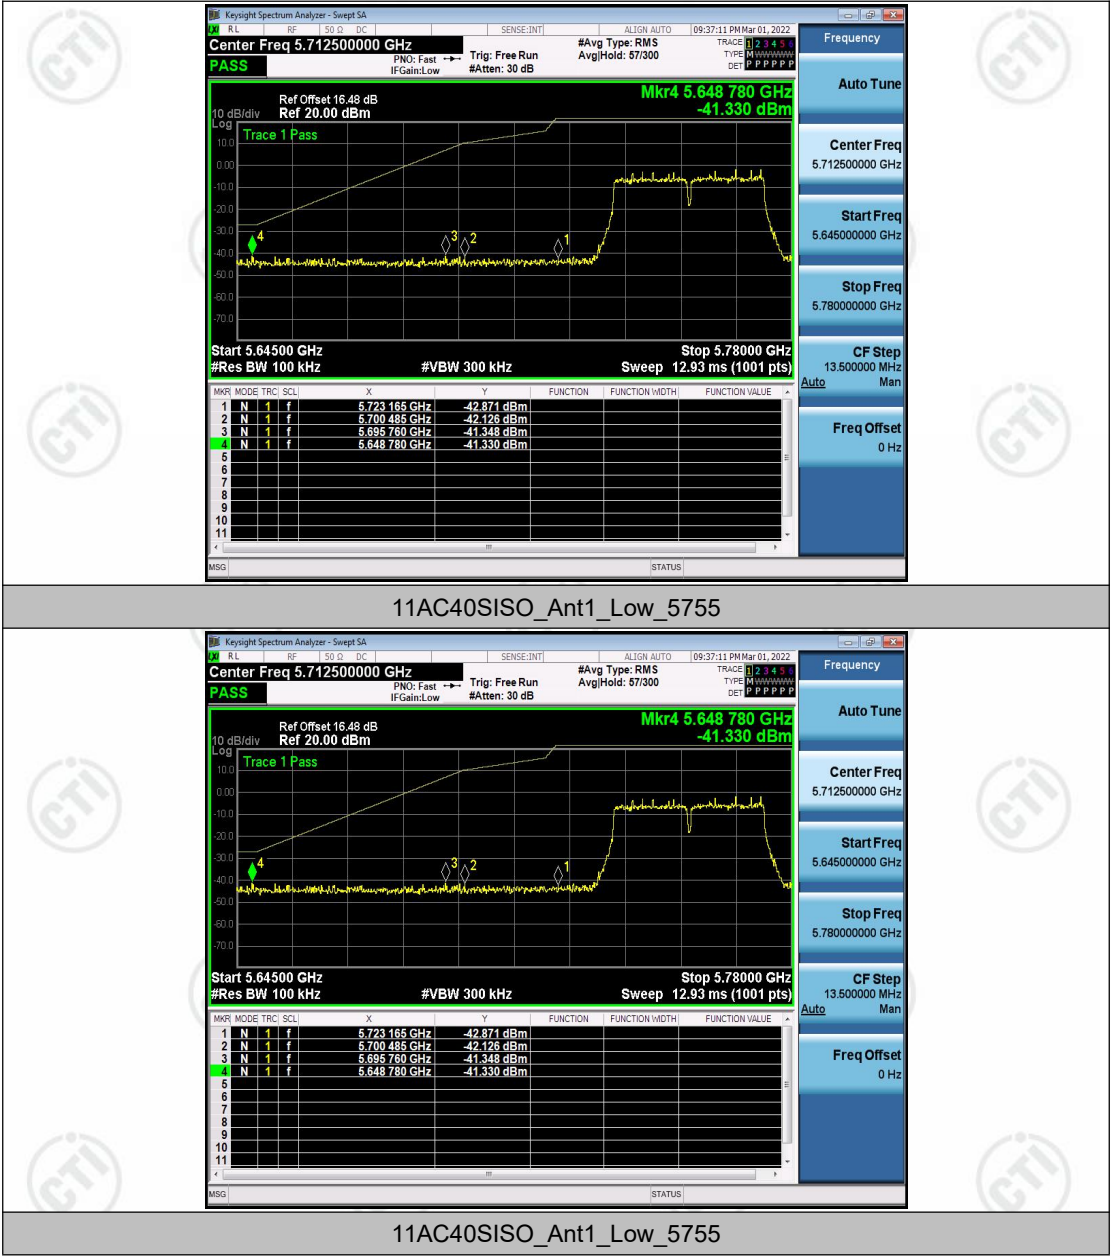


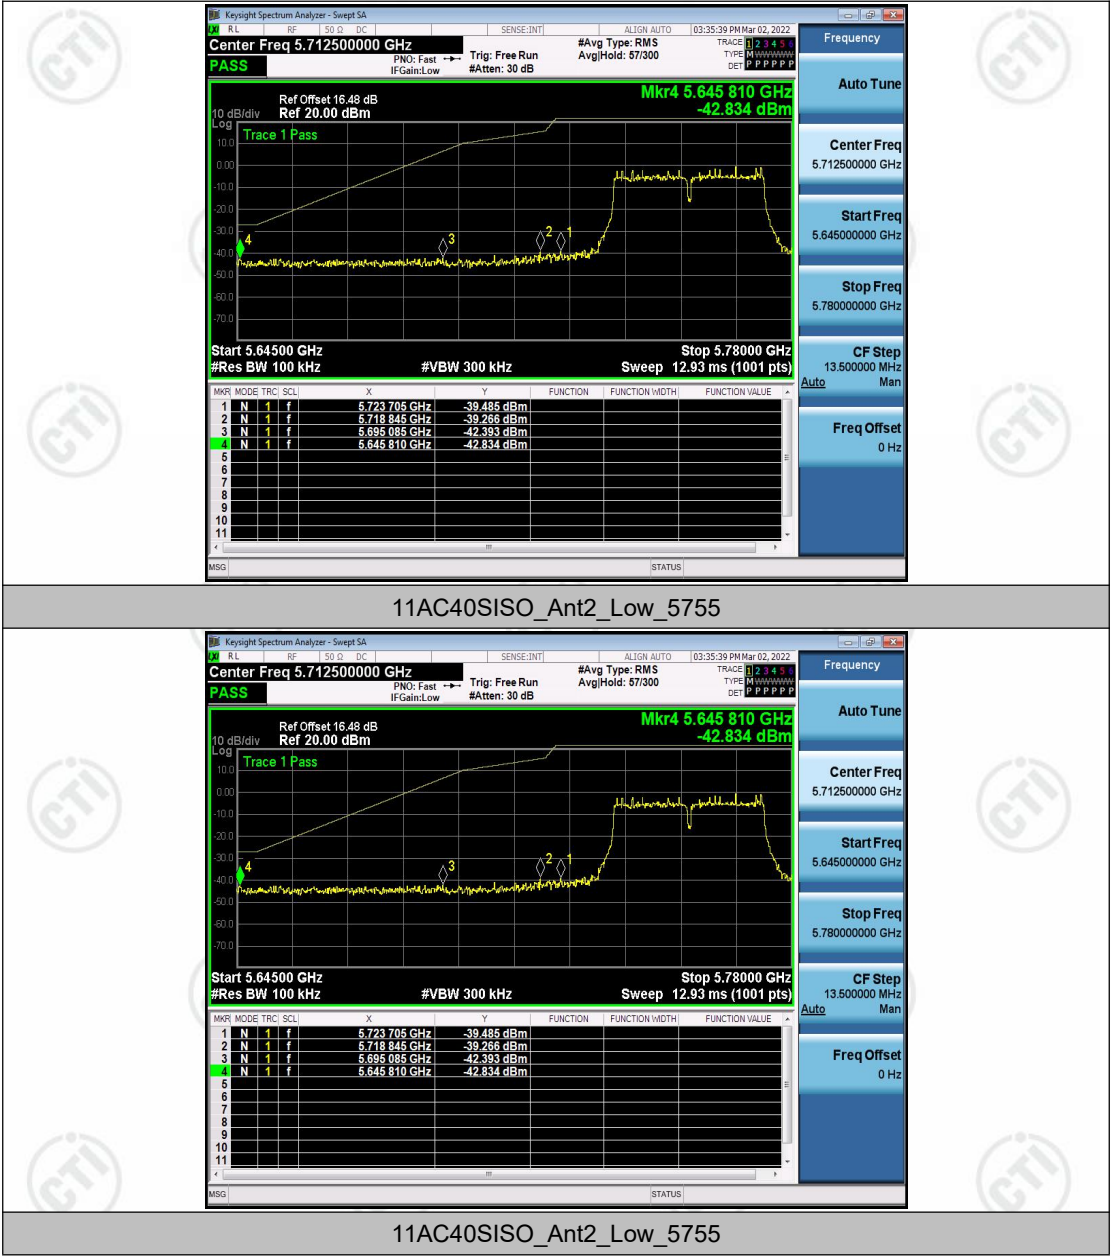


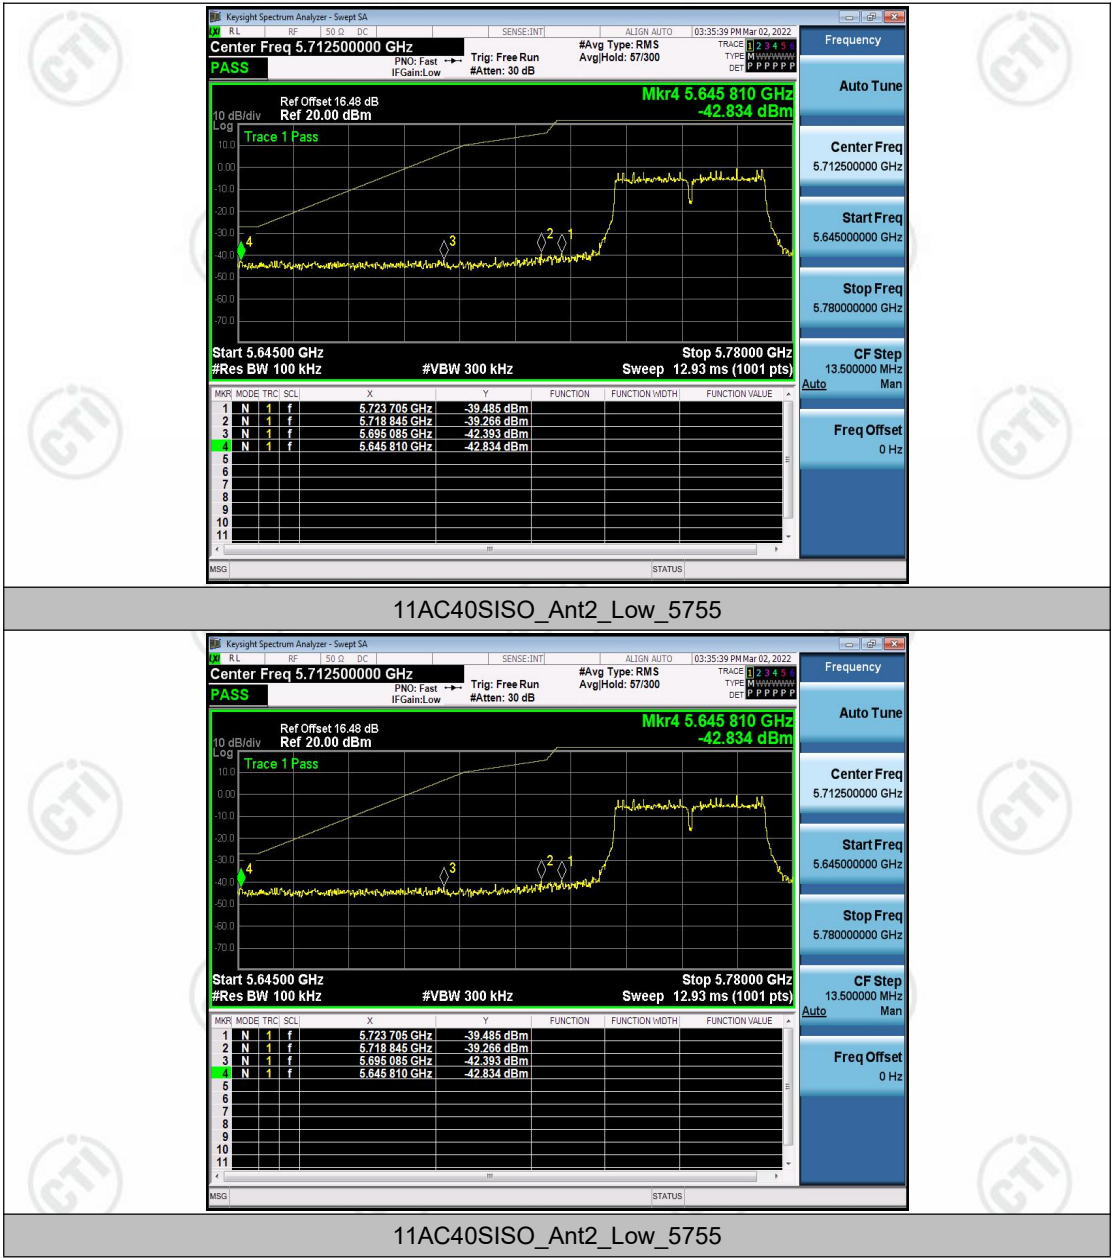


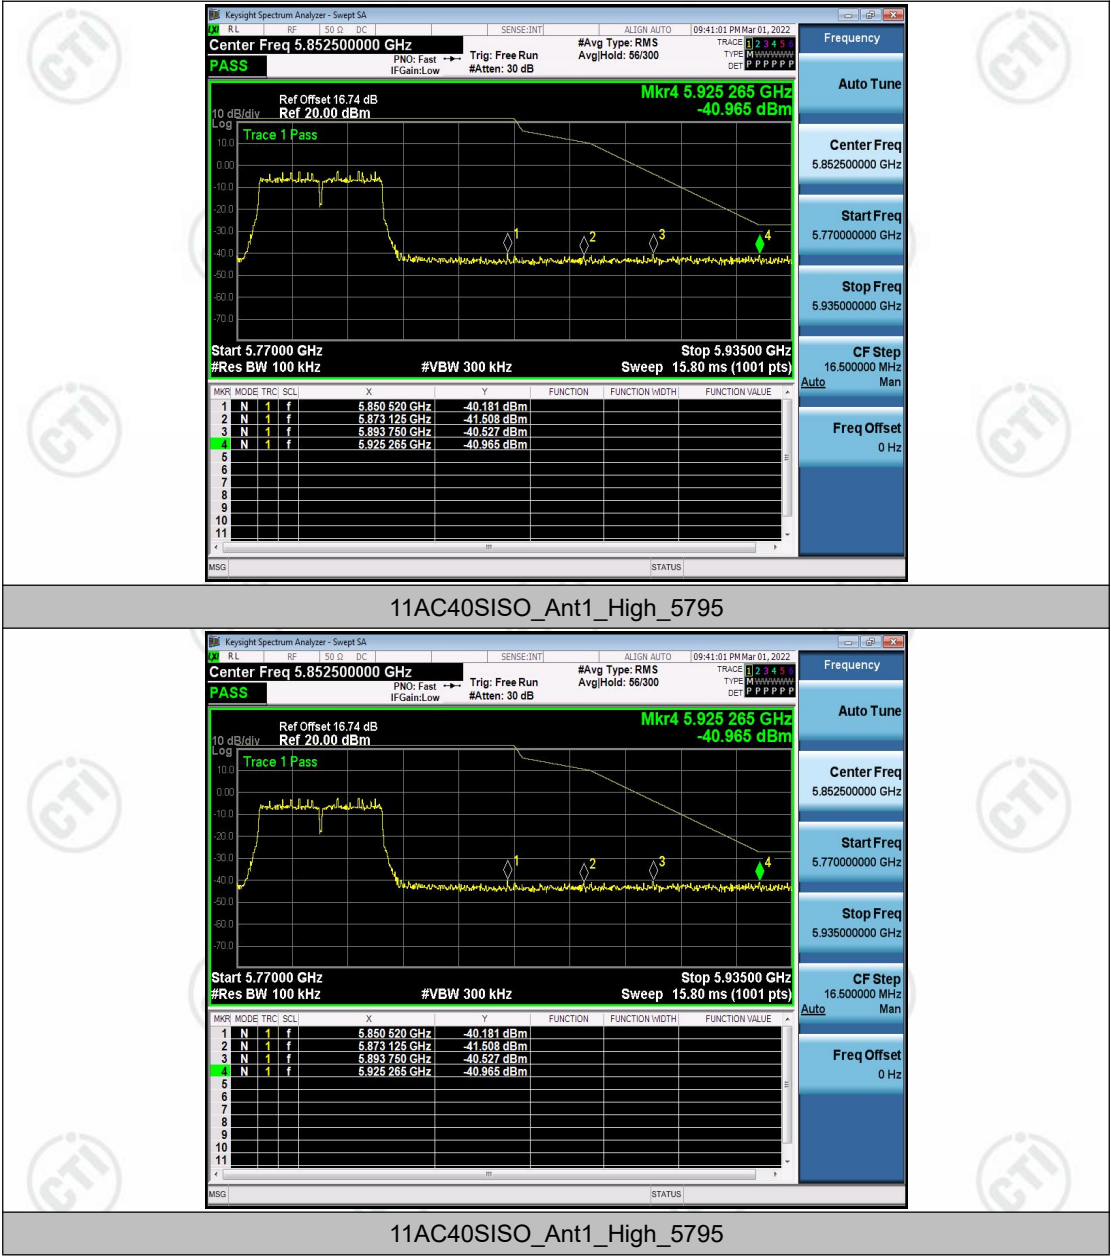


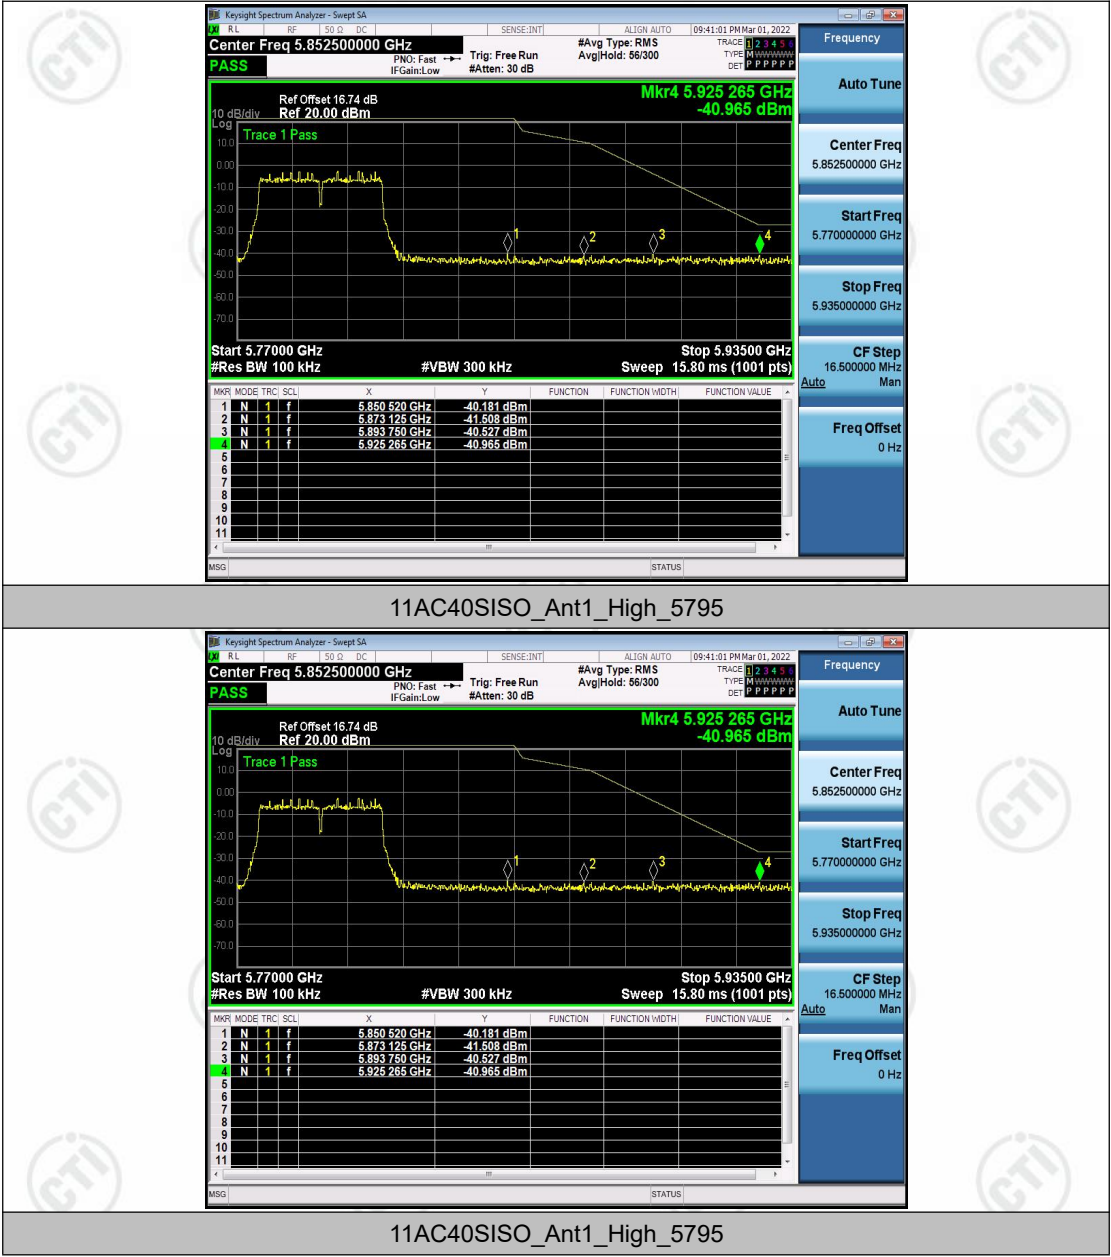


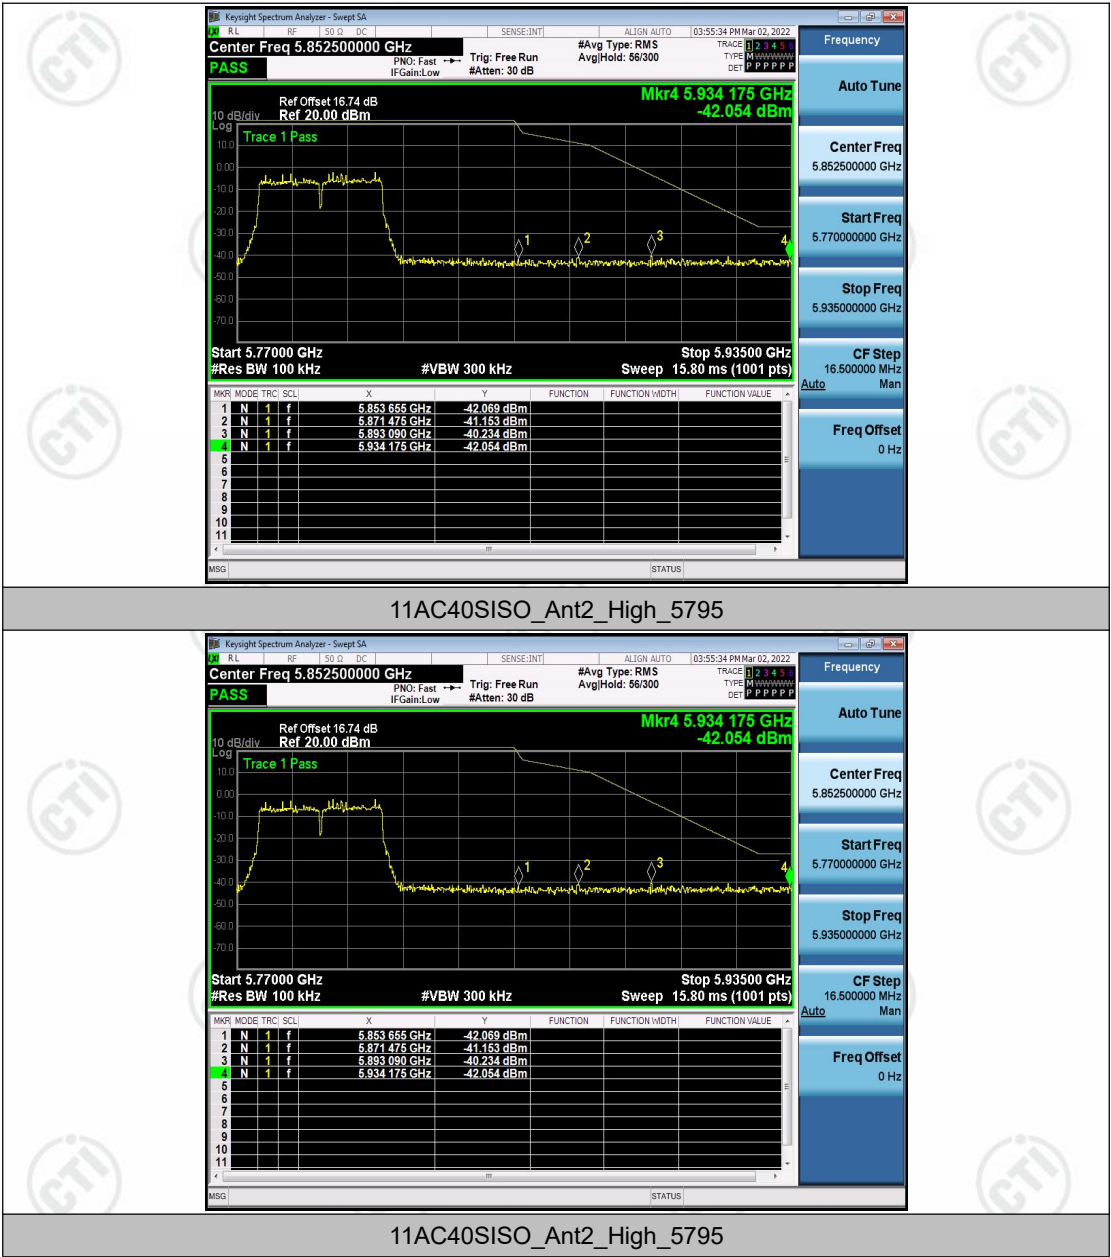


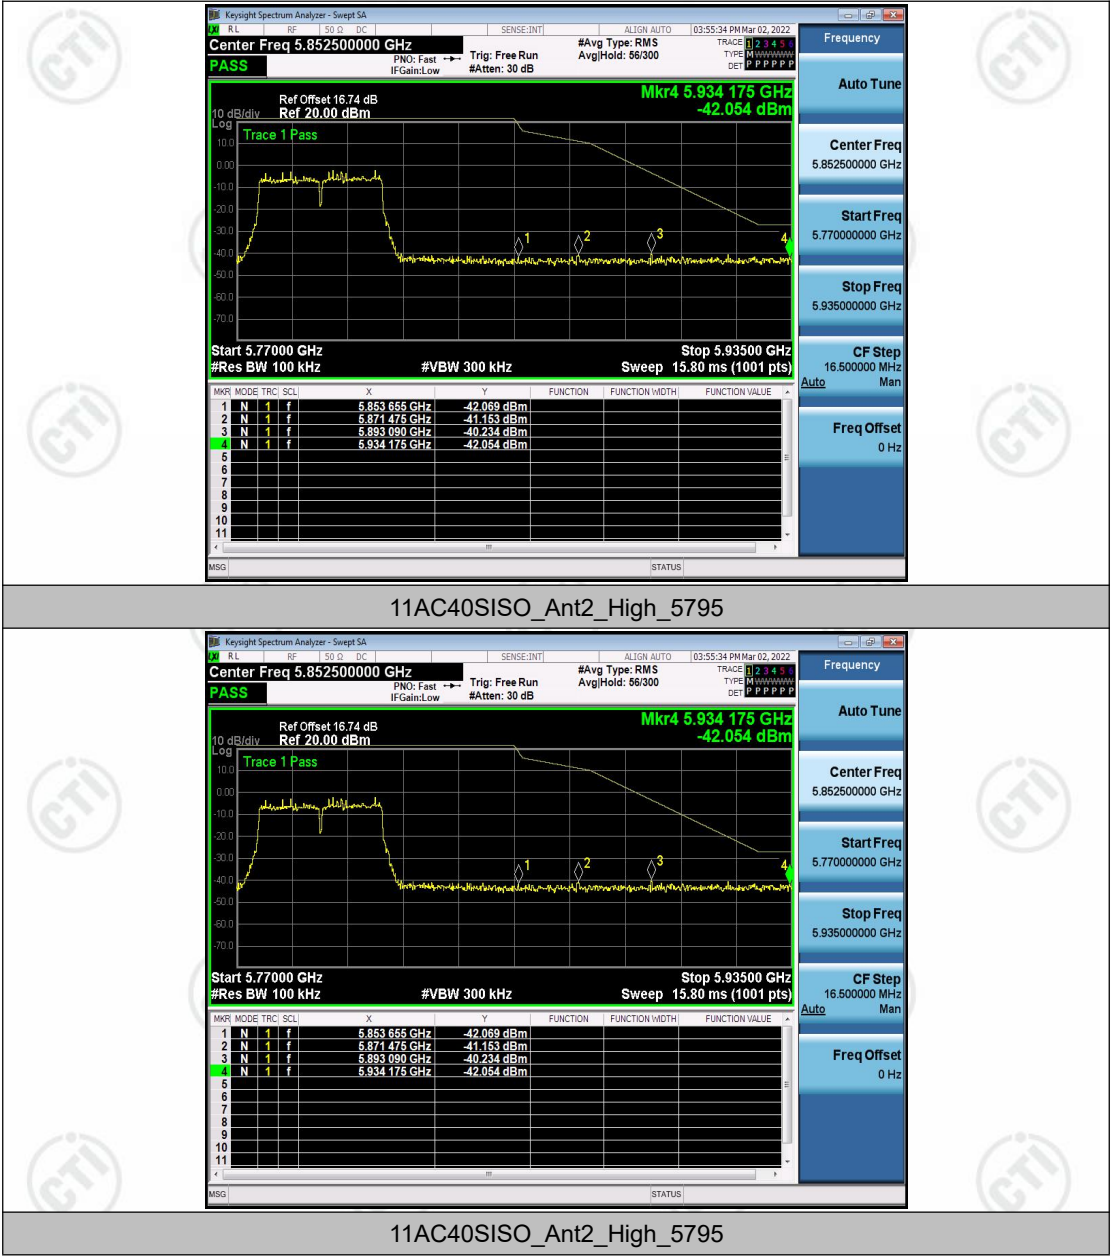


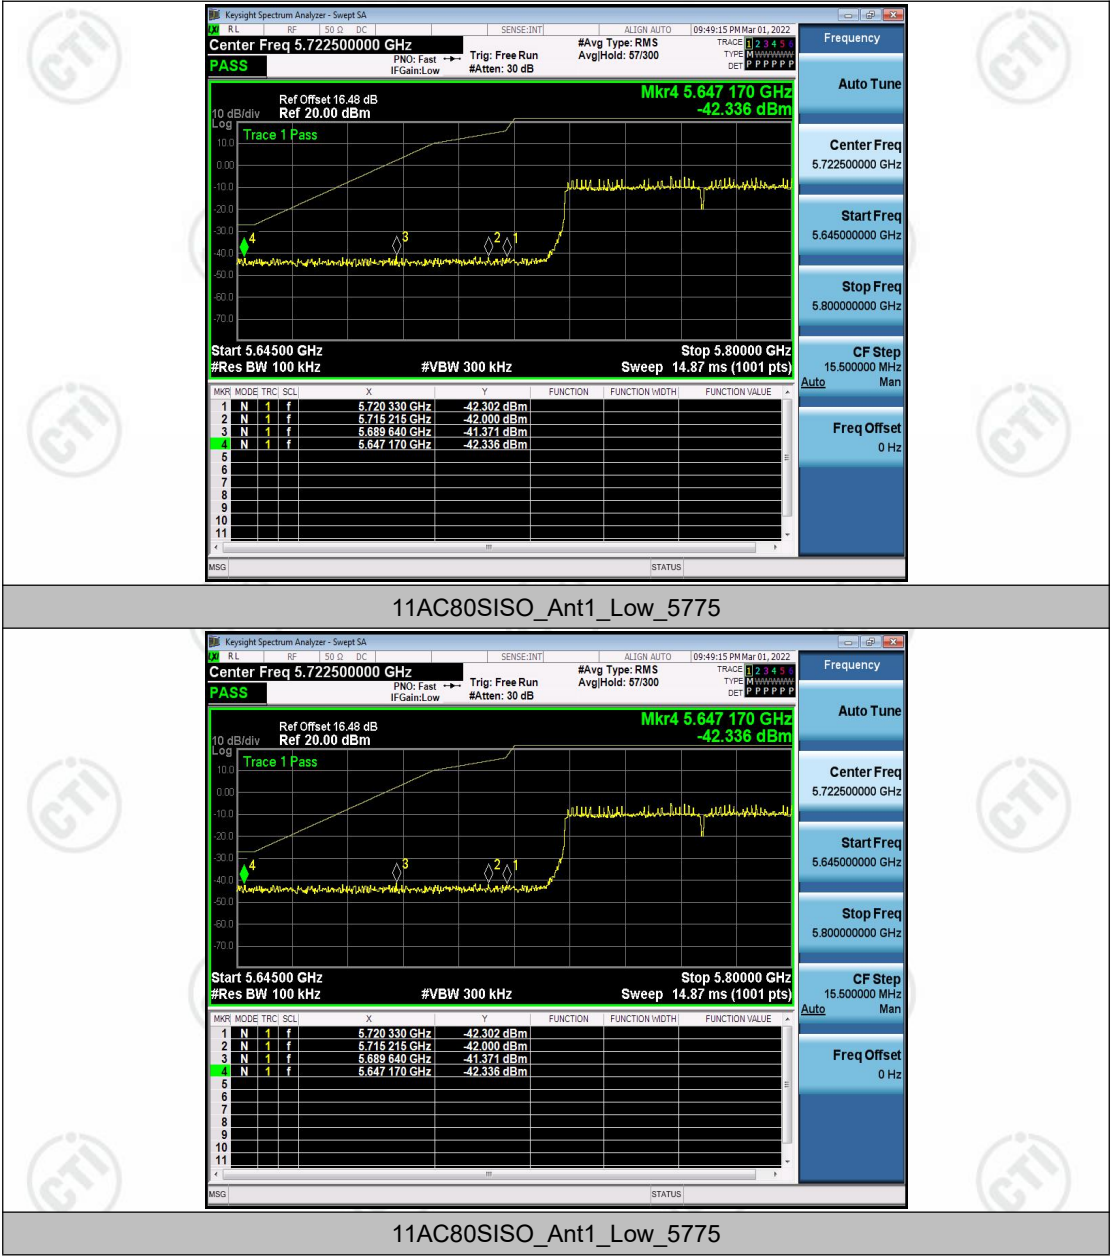

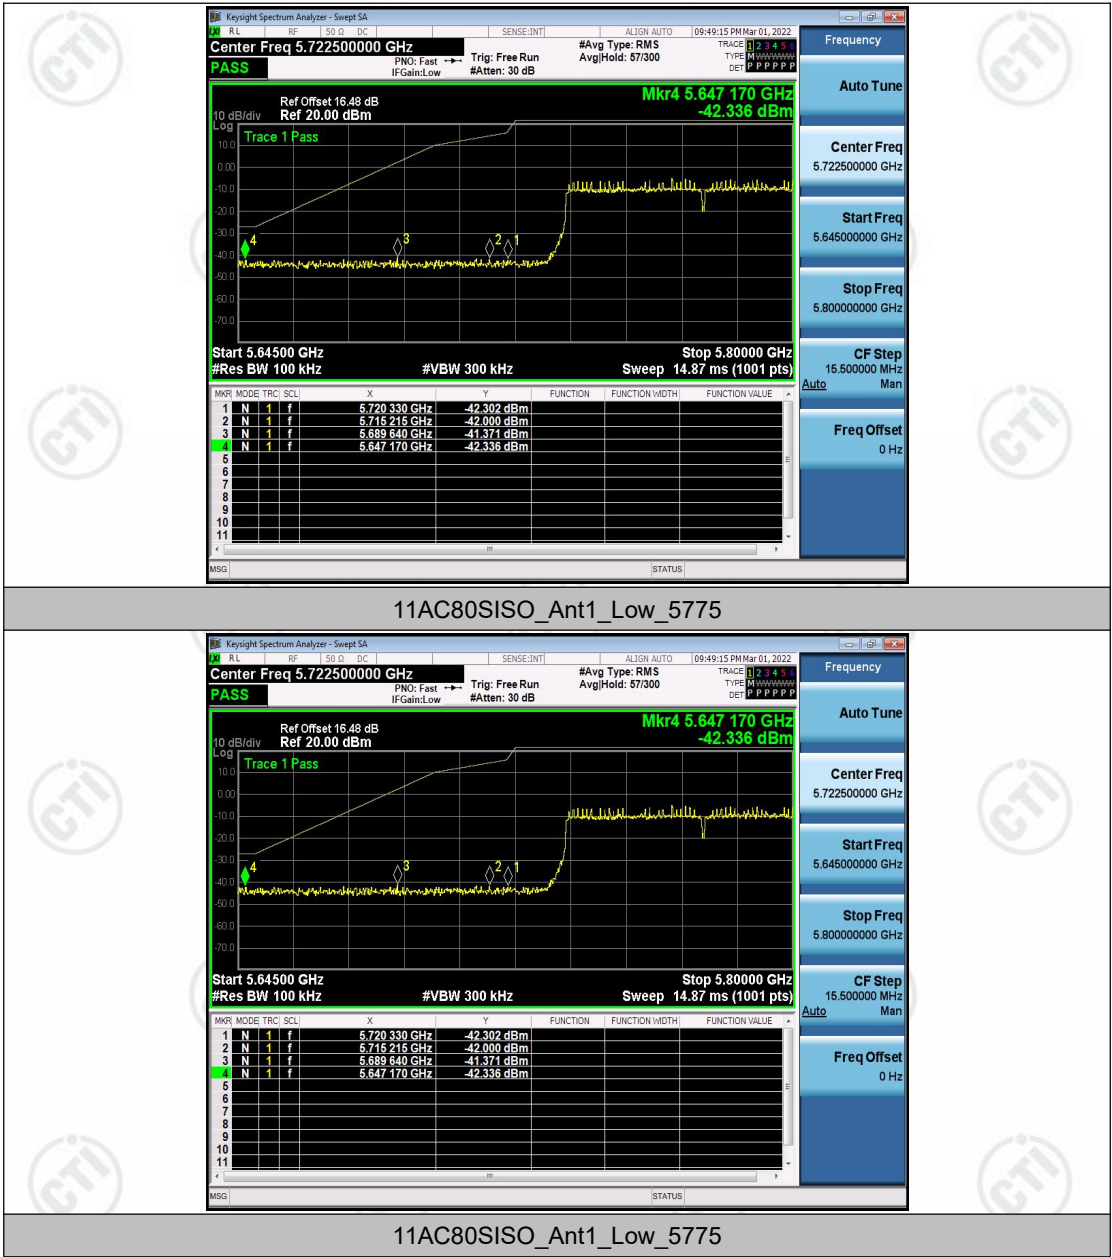

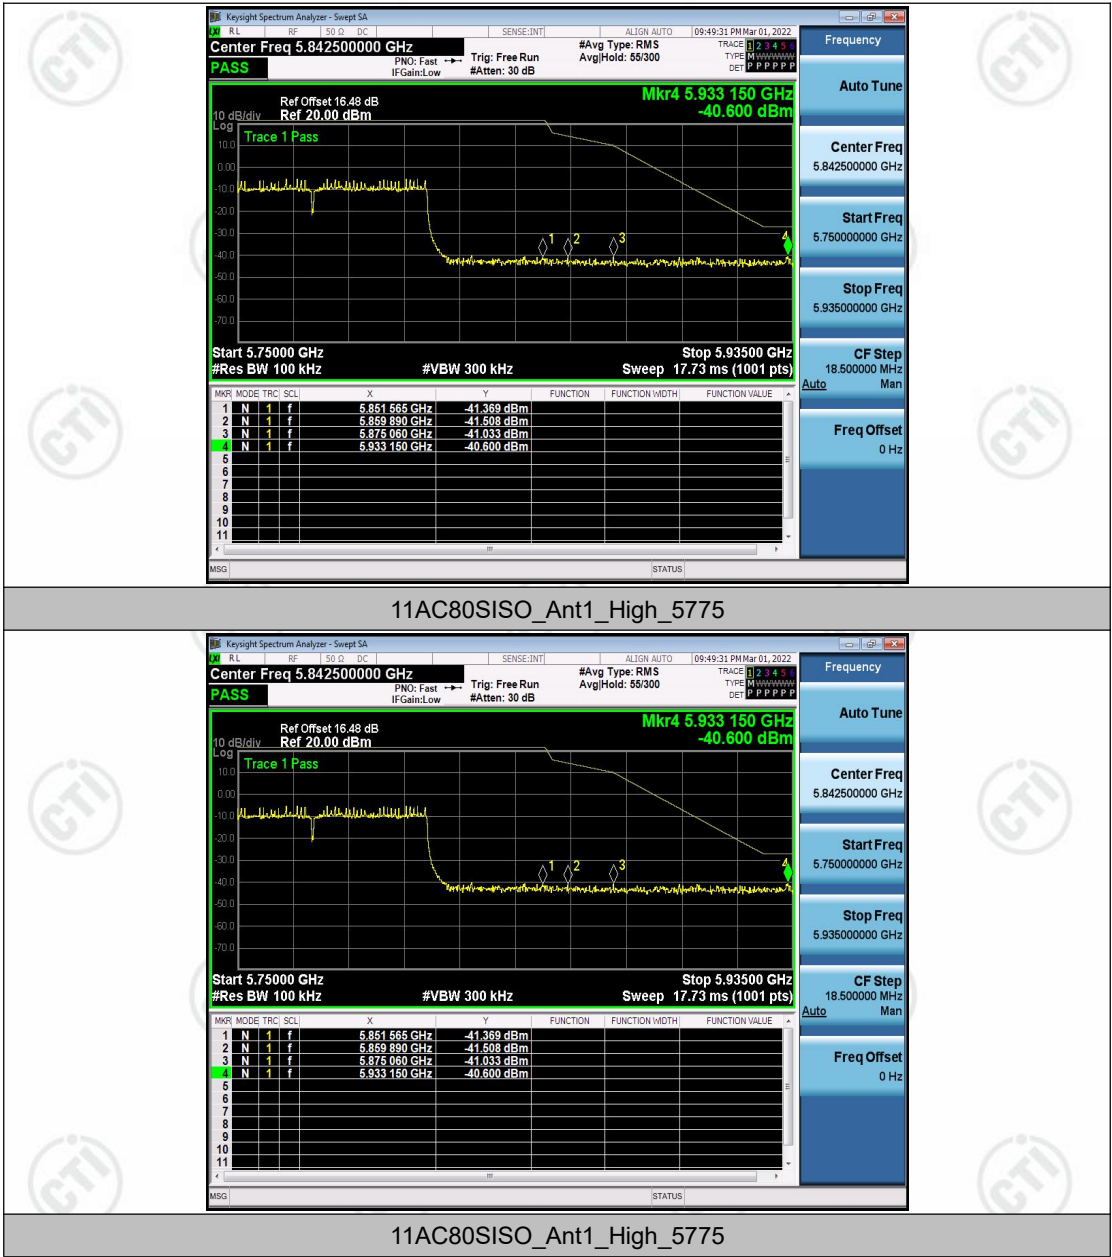

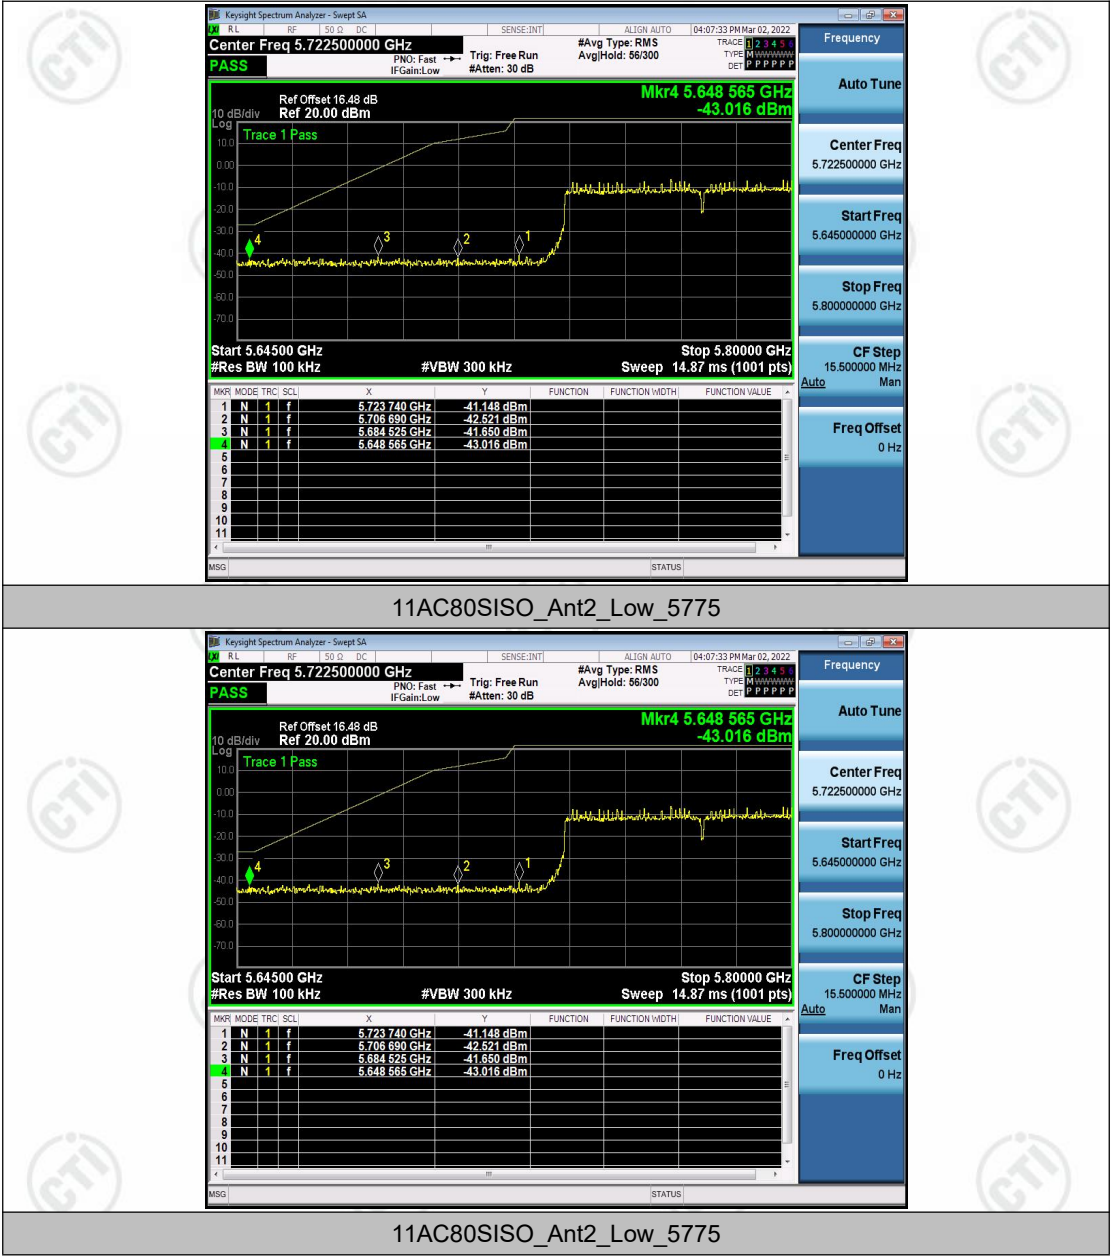

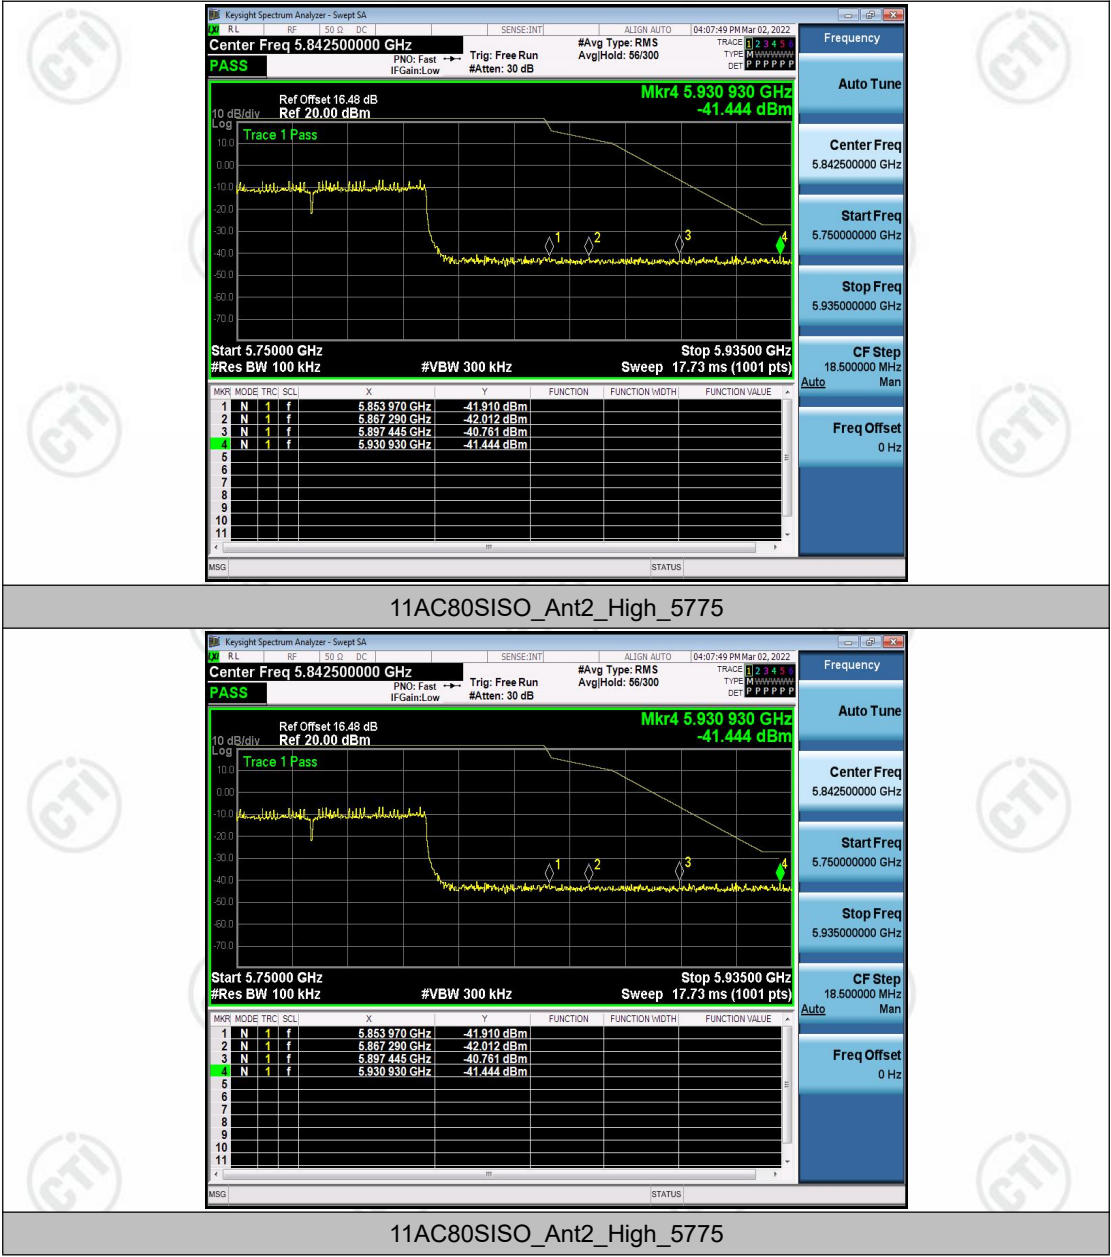

Appendix F: Conducted Spurious Emission

Test Result

TestMode	Antenna	Channel	FreqRange [MHz]	Max. Fre [MHz]	Max. Level [dBm]	Limit [dBm]	Verdict
11A	Ant1	5180	30~5140	30~5140	-33.536	<=-27	PASS
			5360~40000	5360~40000	-32.66	<=-27	PASS
	Ant2	5180	30~5140	30~5140	-31.776	<=-27	PASS
			5360~40000	5360~40000	-34.01	<=-27	PASS
	Ant1	5200	30~5140	30~5140	-34.888	<=-27	PASS
			5360~40000	5360~40000	-34.032	<=-27	PASS
	Ant2	5200	30~5140	30~5140	-30.846	<=-27	PASS
			5360~40000	5360~40000	-33.951	<=-27	PASS
	Ant1	5240	30~5140	30~5140	-35.84	<=-27	PASS
			5360~40000	5360~40000	-33.991	<=-27	PASS
	Ant2	5240	30~5140	30~5140	-31.78	<=-27	PASS
			5360~40000	5360~40000	-33.496	<=-27	PASS
	Ant1	5745	30~5650	30~5650	-35.993	<=-27	PASS
			5925~40000	5925~40000	-32.848	<=-27	PASS
	Ant2	5745	30~5650	30~5650	-29.772	<=-27	PASS
			5925~40000	5925~40000	-33.089	<=-27	PASS
	Ant1	5785	30~5650	30~5650	-34.45	<=-27	PASS
			5925~40000	5925~40000	-32.513	<=-27	PASS
	Ant2	5785	30~5650	30~5650	-28.779	<=-27	PASS
			5925~40000	5925~40000	-32.113	<=-27	PASS
	Ant1	5825	30~5650	30~5650	-33.744	<=-27	PASS
			5925~40000	5925~40000	-32.28	<=-27	PASS
	Ant2	5825	30~5650	30~5650	-29.306	<=-27	PASS
			5925~40000	5925~40000	-32.723	<=-27	PASS
11N20SI SO	Ant1	5180	30~5140	30~5140	-33.719	<=-27	PASS
			5360~40000	5360~40000	-33.655	<=-27	PASS
	Ant2	5180	30~5140	30~5140	-29.739	<=-27	PASS
			5360~40000	5360~40000	-33.812	<=-27	PASS
	Ant1	5200	30~5140	30~5140	-34.258	<=-27	PASS
			5360~40000	5360~40000	-33.799	<=-27	PASS
	Ant2	5200	30~5140	30~5140	-30.543	<=-27	PASS
			5360~40000	5360~40000	-33.402	<=-27	PASS
	Ant1	5240	30~5140	30~5140	-34.368	<=-27	PASS
			5360~40000	5360~40000	-33.854	<=-27	PASS

	Ant2	5240	30~5140	30~5140	-31.374	<=-27	PASS
			5360~40000	5360~40000	-33.879	<=-27	PASS
	Ant1	5745	30~5650	30~5650	-32.642	<=-27	PASS
			5925~40000	5925~40000	-32.395	<=-27	PASS
	Ant2	5745	30~5650	30~5650	-31.086	<=-27	PASS
			5925~40000	5925~40000	-33.538	<=-27	PASS
	Ant1	5785	30~5650	30~5650	-32.445	<=-27	PASS
			5925~40000	5925~40000	-32.497	<=-27	PASS
	Ant2	5785	30~5650	30~5650	-31.513	<=-27	PASS
			5925~40000	5925~40000	-33.068	<=-27	PASS
	Ant1	5825	30~5650	30~5650	-32.92	<=-27	PASS
			5925~40000	5925~40000	-33.273	<=-27	PASS
	Ant2	5825	30~5650	30~5650	-31.796	<=-27	PASS
			5925~40000	5925~40000	-33.471	<=-27	PASS
11N40SI SO	Ant1	5190	30~5140	30~5140	-34.097	<=-27	PASS
			5360~40000	5360~40000	-32.244	<=-27	PASS
	Ant2	5190	30~5140	30~5140	-32.101	<=-27	PASS
			5360~40000	5360~40000	-32.416	<=-27	PASS
	Ant1	5230	30~5140	30~5140	-33.105	<=-27	PASS
			5360~40000	5360~40000	-33.557	<=-27	PASS
	Ant2	5230	30~5140	30~5140	-32.074	<=-27	PASS
			5360~40000	5360~40000	-33.683	<=-27	PASS
	Ant1	5755	30~5650	30~5650	-31.304	<=-27	PASS
			5925~40000	5925~40000	-32.73	<=-27	PASS
	Ant2	5755	30~5650	30~5650	-31.446	<=-27	PASS
			5925~40000	5925~40000	-33.265	<=-27	PASS
	Ant1	5795	30~5650	30~5650	-32.136	<=-27	PASS
			5925~40000	5925~40000	-32.293	<=-27	PASS
	Ant2	5795	30~5650	30~5650	-30.656	<=-27	PASS
			5925~40000	5925~40000	-32.822	<=-27	PASS
11AC20S ISO	Ant1	5180	30~5140	30~5140	-30.582	<=-27	PASS
			5360~40000	5360~40000	-34.016	<=-27	PASS
	Ant2	5180	30~5140	30~5140	-32.617	<=-27	PASS
			5360~40000	5360~40000	-33.571	<=-27	PASS
	Ant1	5200	30~5140	30~5140	-34.167	<=-27	PASS
			5360~40000	5360~40000	-33.565	<=-27	PASS
	Ant2	5200	30~5140	30~5140	-31.065	<=-27	PASS
			5360~40000	5360~40000	-32.31	<=-27	PASS
	Ant1	5240	30~5140	30~5140	-34.891	<=-27	PASS
			5360~40000	5360~40000	-33.478	<=-27	PASS

	Ant2	5240	30~5140	30~5140	-31.228	<=-27	PASS
			5360~40000	5360~40000	-32.547	<=-27	PASS
	Ant1	5745	30~5650	30~5650	-32.668	<=-27	PASS
			5925~40000	5925~40000	-32.755	<=-27	PASS
	Ant2	5745	30~5650	30~5650	-31.338	<=-27	PASS
			5925~40000	5925~40000	-32.911	<=-27	PASS
	Ant1	5785	30~5650	30~5650	-33.613	<=-27	PASS
			5925~40000	5925~40000	-32.862	<=-27	PASS
	Ant2	5785	30~5650	30~5650	-30.763	<=-27	PASS
			5925~40000	5925~40000	-32.401	<=-27	PASS
	Ant1	5825	30~5650	30~5650	-32.784	<=-27	PASS
			5925~40000	5925~40000	-31.381	<=-27	PASS
	Ant2	5825	30~5650	30~5650	-30.603	<=-27	PASS
			5925~40000	5925~40000	-33.168	<=-27	PASS
11AC40S ISO	Ant1	5190	30~5140	30~5140	-33.486	<=-27	PASS
			5360~40000	5360~40000	-33.448	<=-27	PASS
	Ant2	5190	30~5140	30~5140	-31.075	<=-27	PASS
			5360~40000	5360~40000	-34.166	<=-27	PASS
	Ant1	5230	30~5140	30~5140	-34.504	<=-27	PASS
			5360~40000	5360~40000	-33.899	<=-27	PASS
	Ant2	5230	30~5140	30~5140	-31.757	<=-27	PASS
			5360~40000	5360~40000	-34.242	<=-27	PASS
	Ant1	5755	30~5650	30~5650	-33.048	<=-27	PASS
			5925~40000	5925~40000	-32.579	<=-27	PASS
	Ant2	5755	30~5650	30~5650	-30.528	<=-27	PASS
			5925~40000	5925~40000	-31.795	<=-27	PASS
11AC80S ISO	Ant1	5210	30~5140	30~5140	-34.354	<=-27	PASS
			5360~40000	5360~40000	-33.088	<=-27	PASS
	Ant2	5210	30~5140	30~5140	-31.377	<=-27	PASS
			5360~40000	5360~40000	-33.581	<=-27	PASS
	Ant1	5775	30~5650	30~5650	-32.764	<=-27	PASS
			5925~40000	5925~40000	-32.48	<=-27	PASS
	Ant2	5775	30~5650	30~5650	-30.033	<=-27	PASS
			5925~40000	5925~40000	-32.394	<=-27	PASS

Test Graphs

