




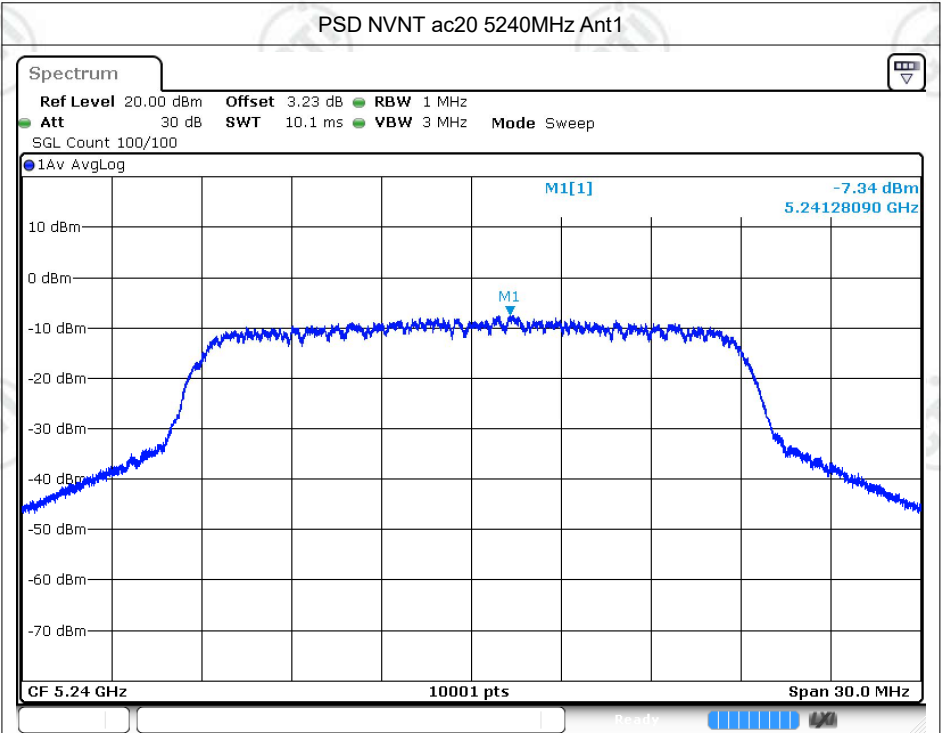


Date: 19.MAY.2025 12:51:50

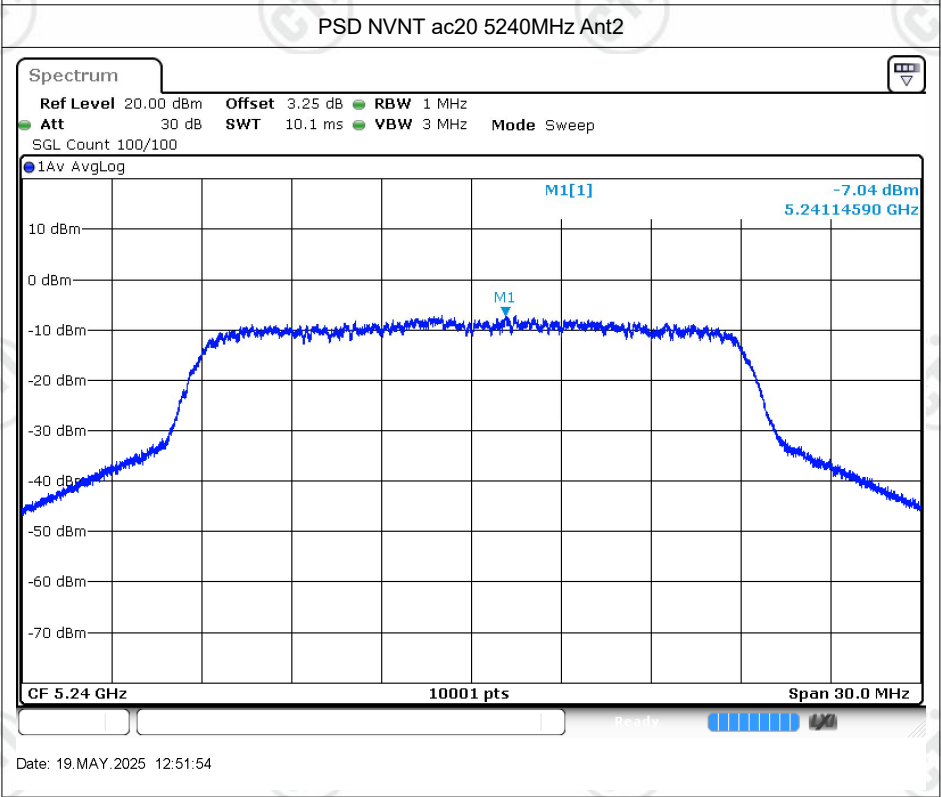


Date: 19.MAY.2025 12:51:54

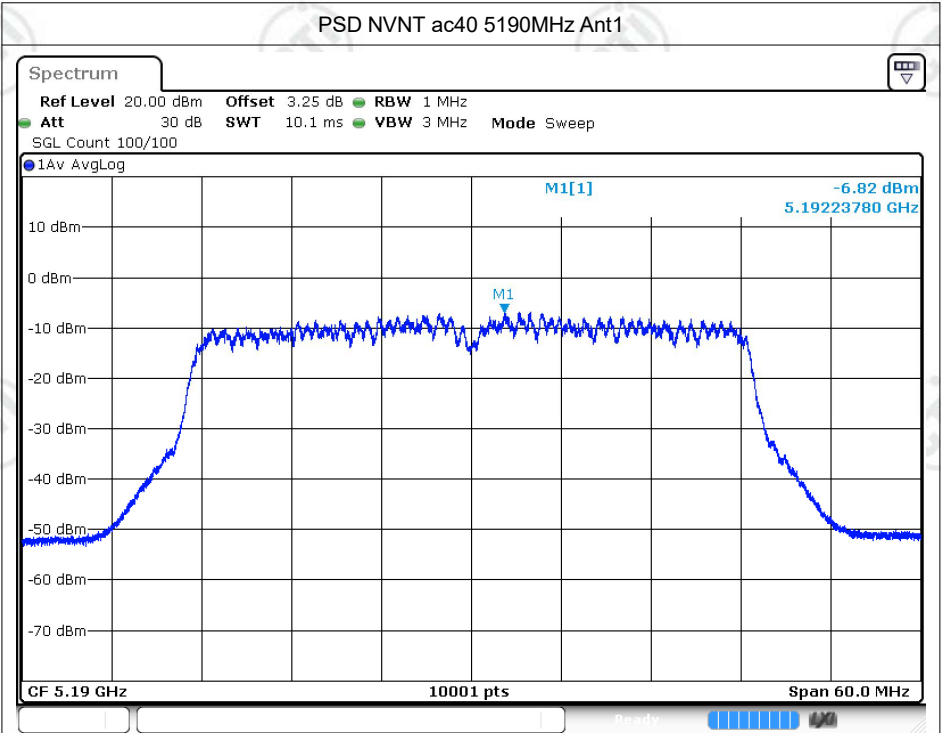


Date: 19.MAY.2025 11:11:28

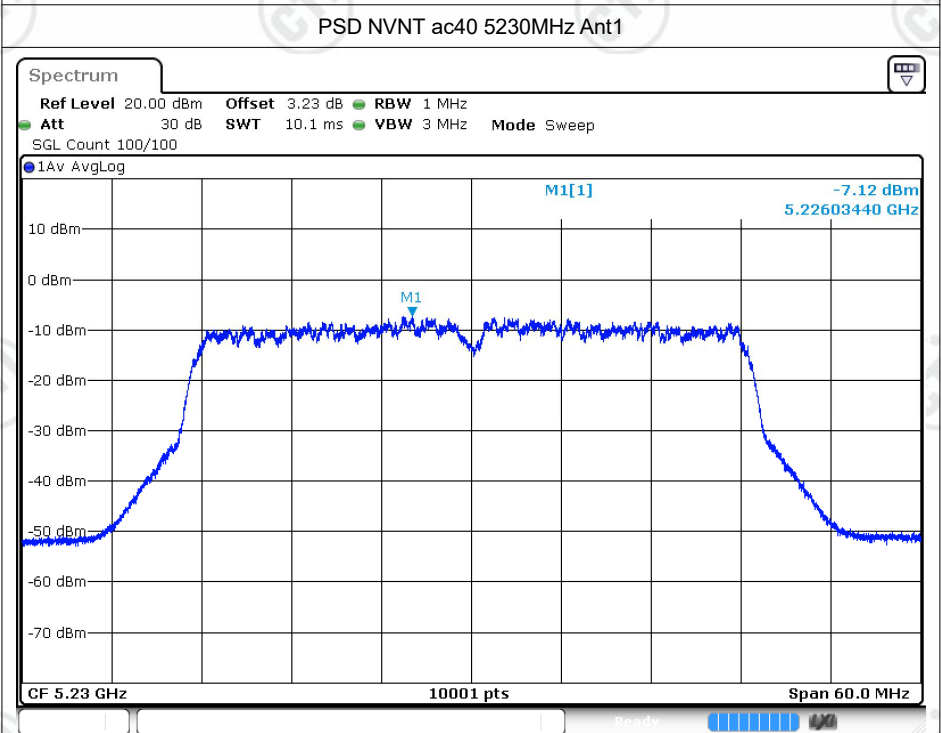


Date: 19.MAY.2025 11:13:10

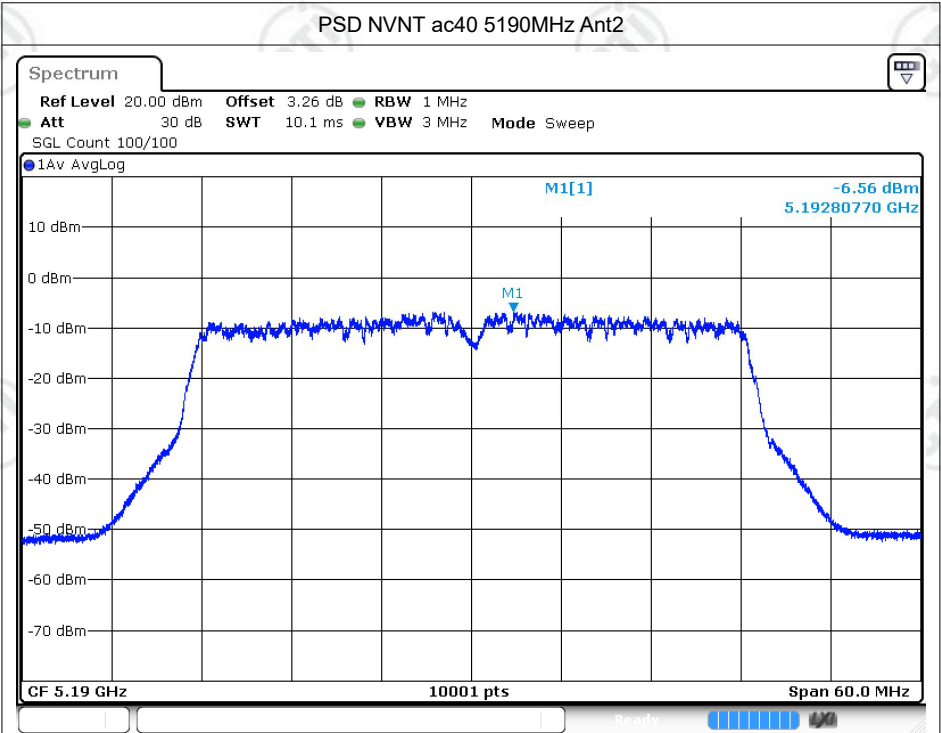


Date: 19.MAY.2025 12:40:38

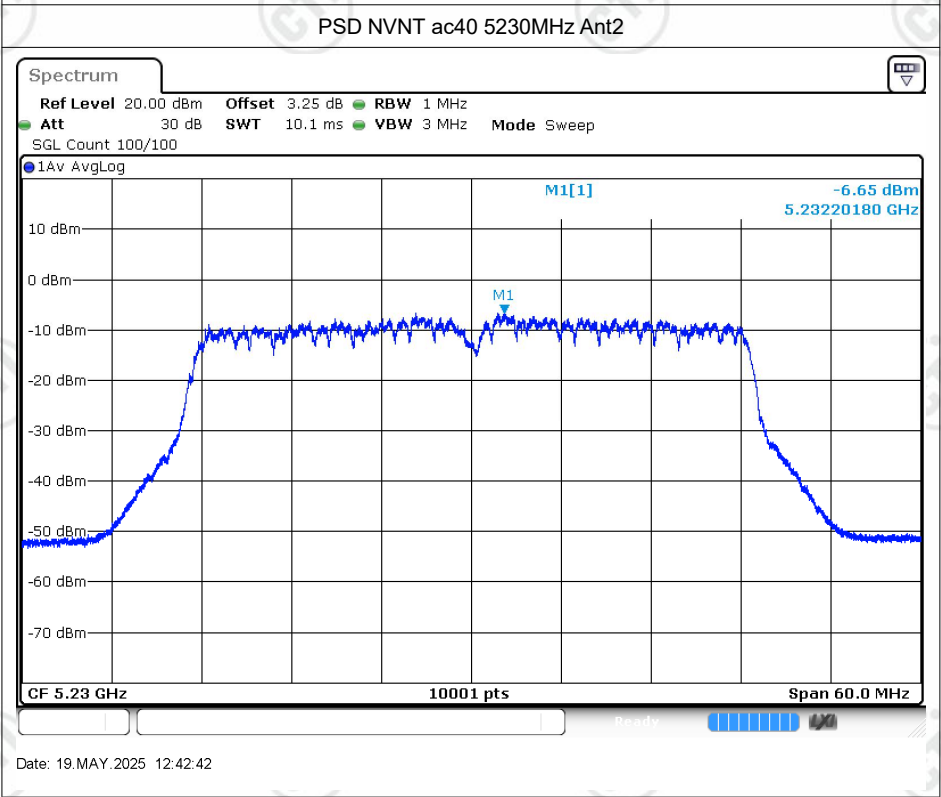


Date: 19.MAY.2025 12:42:42

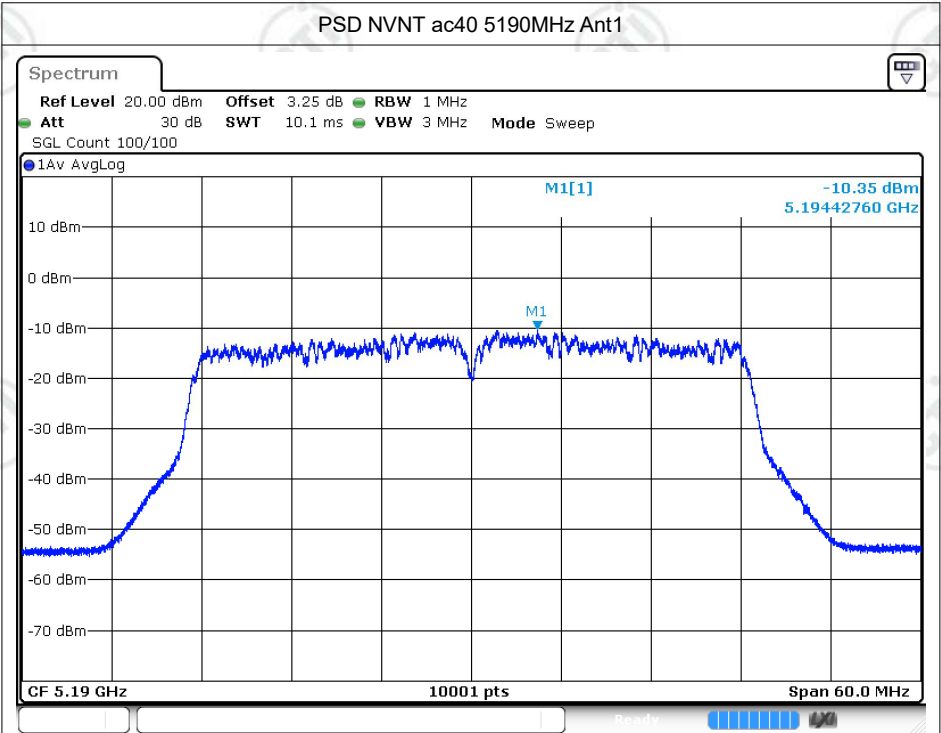


Date: 19.MAY.2025 12:53:50

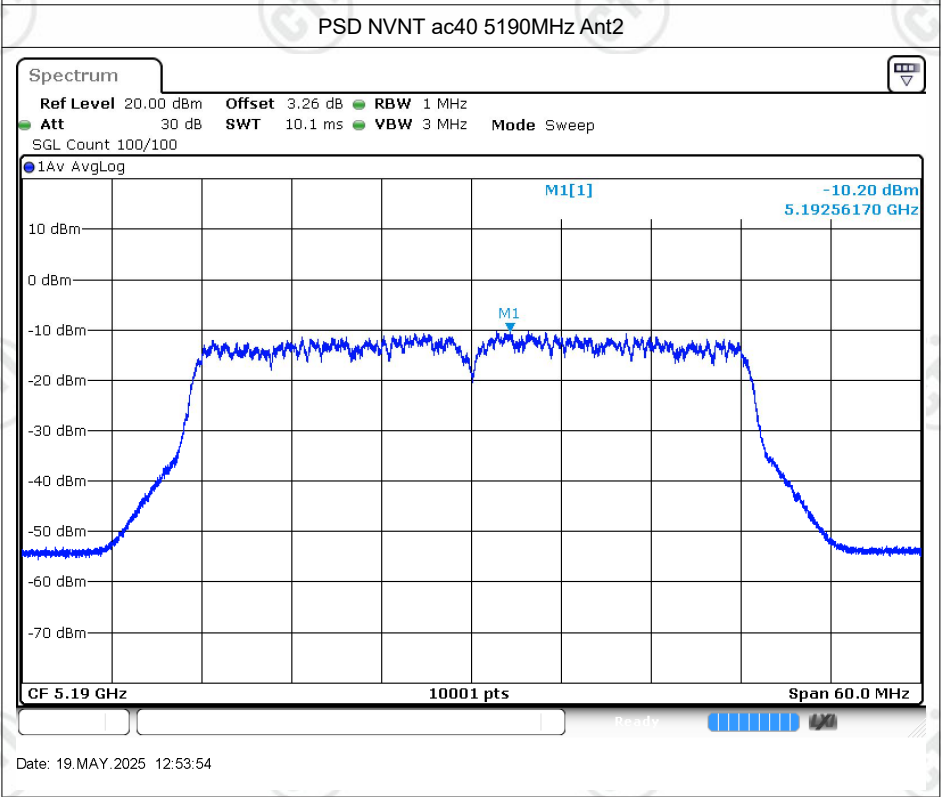


Date: 19.MAY.2025 12:53:54

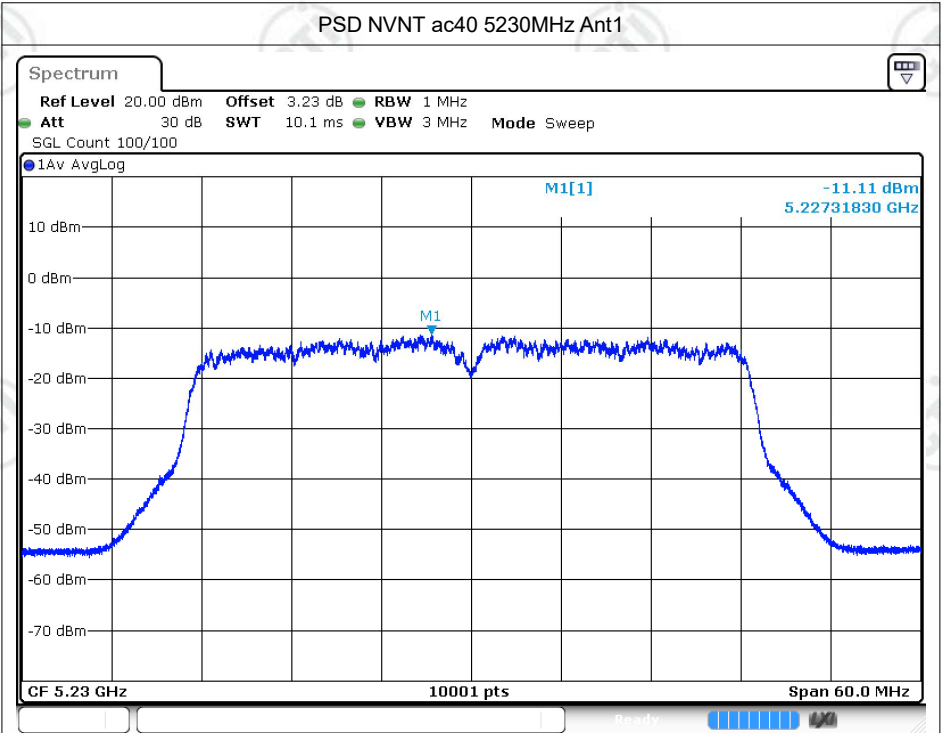


Date: 19.MAY.2025 12:53:25

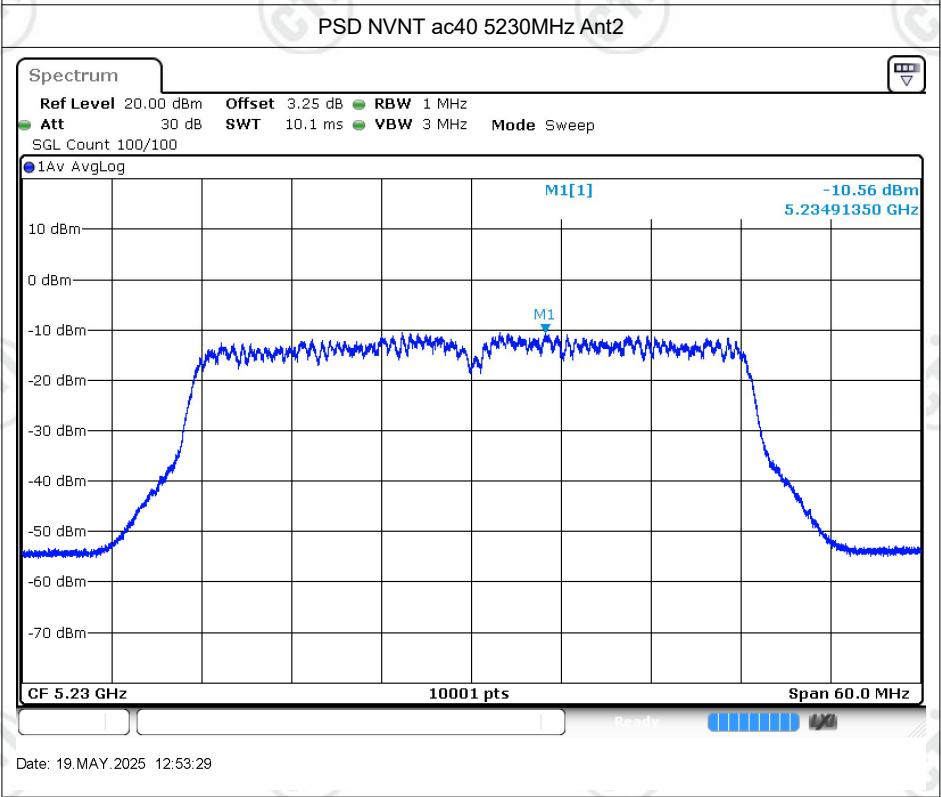


Date: 19.MAY.2025 12:53:29

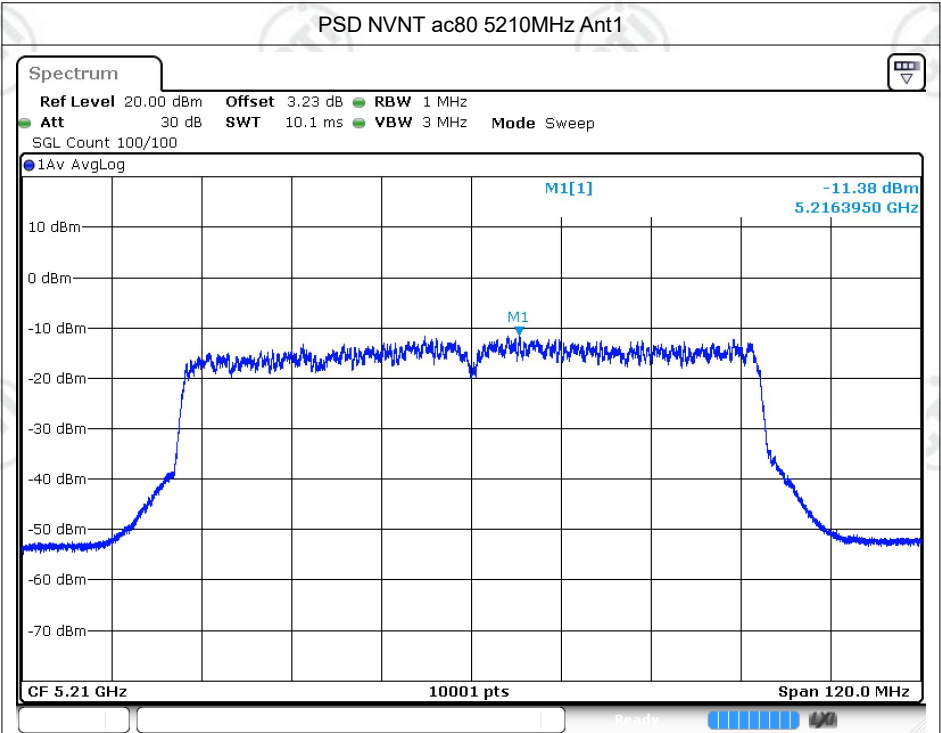


Date: 19.MAY.2025 11:15:19

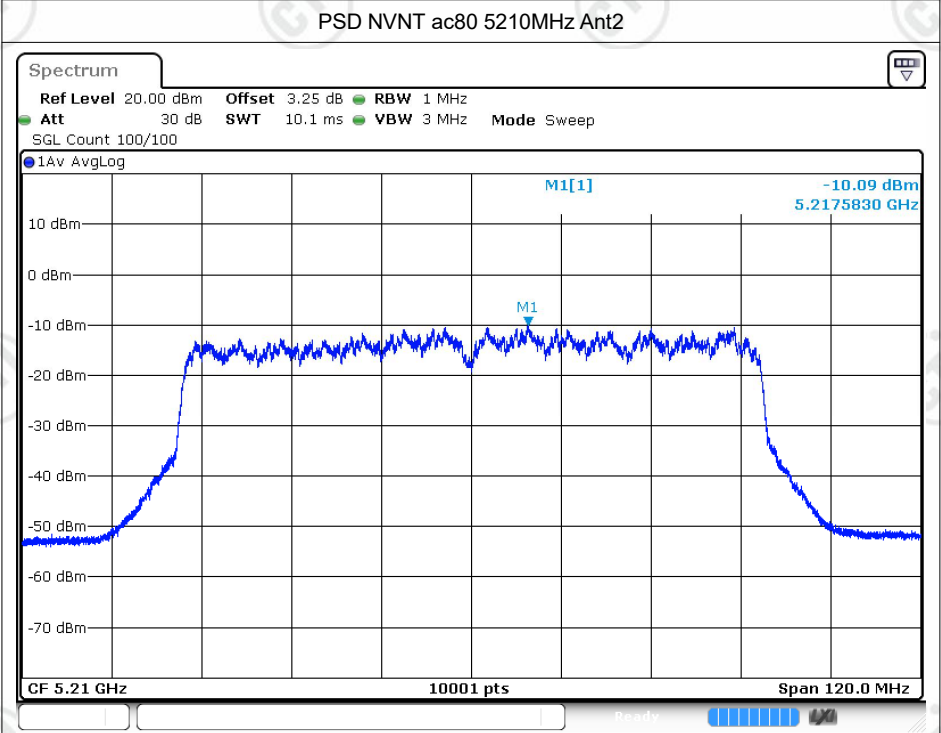

Date: 19.MAY.2025 12:44:26

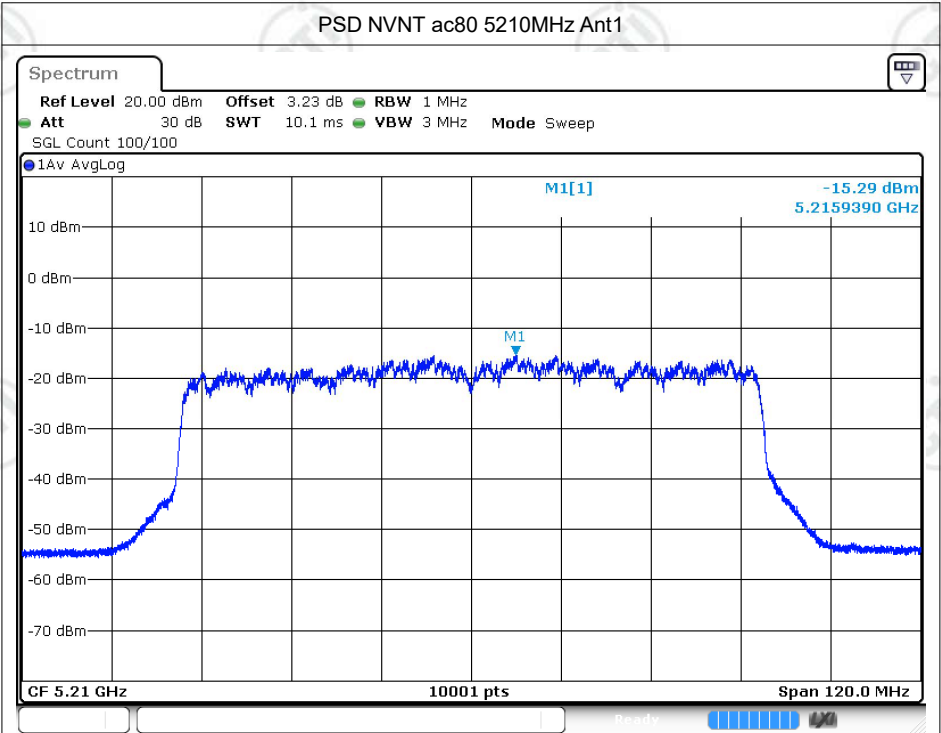

Date: 19.MAY.2025 12:54:22

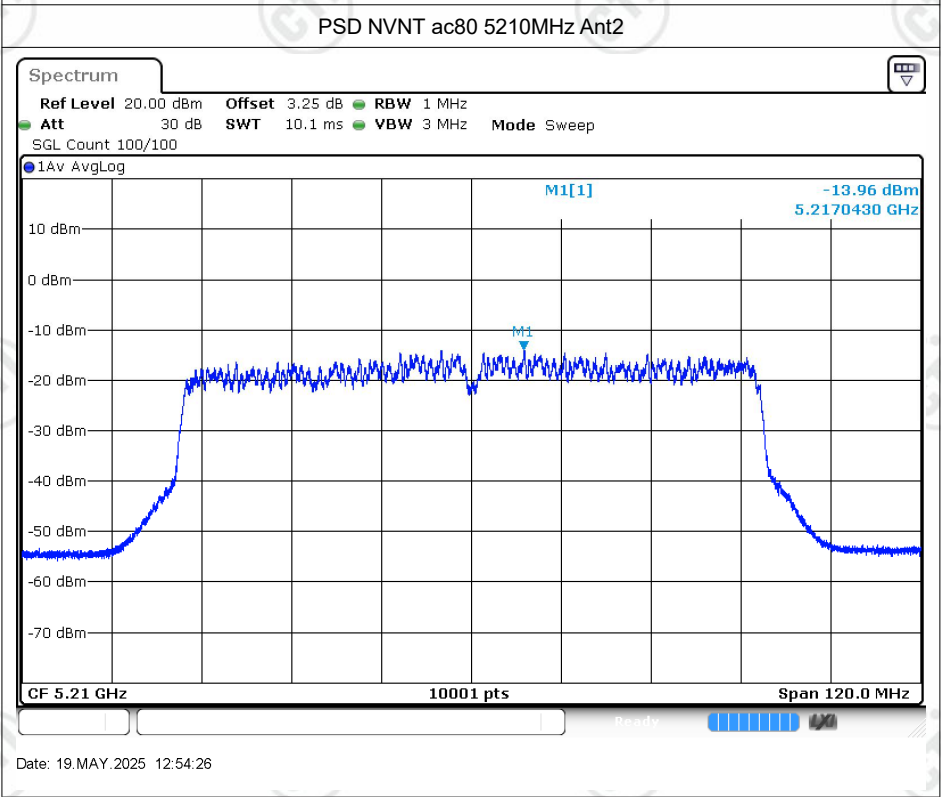

Date: 19.MAY.2025 12:54:26

Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
20C 102V	a	5180	Ant1	5180	0	0	25	Pass
20C 120V	a	5180	Ant1	5180.02	20000	3.86	25	Pass
20C 138V	a	5180	Ant1	5180	0	0	25	Pass
-20C 120V	a	5180	Ant1	5180.02	20000	3.86	25	Pass
-10C 120V	a	5180	Ant1	5180.02	20000	3.86	25	Pass
0C 120V	a	5180	Ant1	5180.02	20000	3.86	25	Pass
10C 120V	a	5180	Ant1	5180.02	20000	3.86	25	Pass
30C 120V	a	5180	Ant1	5180.02	20000	3.86	25	Pass
40C 120V	a	5180	Ant1	5180	0	0	25	Pass
50C 120V	a	5180	Ant1	5180.02	20000	3.86	25	Pass
20C 102V	a	5240	Ant1	5240	0	0	25	Pass
20C 120V	a	5240	Ant1	5240.04	40000	7.63	25	Pass
20C 138V	a	5240	Ant1	5240	0	0	25	Pass
-20C 120V	a	5240	Ant1	5240.02	20000	3.82	25	Pass
-10C 120V	a	5240	Ant1	5240	0	0	25	Pass
0C 120V	a	5240	Ant1	5240	0	0	25	Pass
10C 120V	a	5240	Ant1	5240	0	0	25	Pass
30C 120V	a	5240	Ant1	5240	0	0	25	Pass
40C 120V	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
50C 120V	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
20C 102V	a	5180	Ant2	5180.02	20000	3.86	25	Pass
20C 120V	a	5180	Ant2	5180.02	20000	3.86	25	Pass
20C 138V	a	5180	Ant2	5180.02	20000	3.86	25	Pass
-20C 120V	a	5180	Ant2	5180	0	0	25	Pass
-10C 120V	a	5180	Ant2	5180.02	20000	3.86	25	Pass
0C 120V	a	5180	Ant2	5180.02	20000	3.86	25	Pass
10C 120V	a	5180	Ant2	5180	0	0	25	Pass
30C 120V	a	5180	Ant2	5180.02	20000	3.86	25	Pass
40C 120V	a	5180	Ant2	5180	0	0	25	Pass
50C 120V	a	5180	Ant2	5180.02	20000	3.86	25	Pass
20C 102V	a	5240	Ant2	5240.02	20000	3.82	25	Pass
20C 120V	a	5240	Ant2	5240.02	20000	3.82	25	Pass
20C 138V	a	5240	Ant2	5240	0	0	25	Pass
-20C 120V	a	5240	Ant2	5240	0	0	25	Pass
-10C 120V	a	5240	Ant2	5240.02	20000	3.82	25	Pass
0C 120V	a	5240	Ant2	5240	0	0	25	Pass
10C 120V	a	5240	Ant2	5240.02	20000	3.82	25	Pass


30C 120V	a	5240	Ant2	5240	0	0	25	Pass
40C 120V	a	5240	Ant2	5239.98	-20000	-3.82	25	Pass
50C 120V	a	5240	Ant2	5240	0	0	25	Pass
20C 102V	n20	5180	Ant1	5180	0	0	25	Pass
20C 120V	n20	5180	Ant1	5180.02	20000	3.86	25	Pass
20C 138V	n20	5180	Ant1	5180.02	20000	3.86	25	Pass
-20C 120V	n20	5180	Ant1	5180.02	20000	3.86	25	Pass
-10C 120V	n20	5180	Ant1	5180.02	20000	3.86	25	Pass
0C 120V	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
10C 120V	n20	5180	Ant1	5180.02	20000	3.86	25	Pass
30C 120V	n20	5180	Ant1	5180	0	0	25	Pass
40C 120V	n20	5180	Ant1	5180.02	20000	3.86	25	Pass
50C 120V	n20	5180	Ant1	5180	0	0	25	Pass
20C 102V	n20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
20C 120V	n20	5240	Ant1	5240	0	0	25	Pass
20C 138V	n20	5240	Ant1	5240.02	20000	3.82	25	Pass
-20C 120V	n20	5240	Ant1	5240	0	0	25	Pass
-10C 120V	n20	5240	Ant1	5240	0	0	25	Pass
0C 120V	n20	5240	Ant1	5240.04	40000	7.63	25	Pass
10C 120V	n20	5240	Ant1	5240	0	0	25	Pass
30C 120V	n20	5240	Ant1	5240	0	0	25	Pass
40C 120V	n20	5240	Ant1	5240.02	20000	3.82	25	Pass
50C 120V	n20	5240	Ant1	5240	0	0	25	Pass
20C 102V	n20	5180	Ant2	5180.02	20000	3.86	25	Pass
20C 120V	n20	5180	Ant2	5180.02	20000	3.86	25	Pass
20C 138V	n20	5180	Ant2	5180	0	0	25	Pass
-20C 120V	n20	5180	Ant2	5180.02	20000	3.86	25	Pass
-10C 120V	n20	5180	Ant2	5180	0	0	25	Pass
0C 120V	n20	5180	Ant2	5180	0	0	25	Pass
10C 120V	n20	5180	Ant2	5180.02	20000	3.86	25	Pass
30C 120V	n20	5180	Ant2	5180.02	20000	3.86	25	Pass
40C 120V	n20	5180	Ant2	5180	0	0	25	Pass
50C 120V	n20	5180	Ant2	5180	0	0	25	Pass
20C 102V	n20	5240	Ant2	5240.02	20000	3.82	25	Pass
20C 120V	n20	5240	Ant2	5240	0	0	25	Pass
20C 138V	n20	5240	Ant2	5240	0	0	25	Pass
-20C 120V	n20	5240	Ant2	5240	0	0	25	Pass
-10C 120V	n20	5240	Ant2	5240.02	20000	3.82	25	Pass
0C 120V	n20	5240	Ant2	5240	0	0	25	Pass
10C 120V	n20	5240	Ant2	5240	0	0	25	Pass
30C 120V	n20	5240	Ant2	5239.98	-20000	-3.82	25	Pass


40C 120V	n20	5240	Ant2	5240.04	40000	7.63	25	Pass
50C 120V	n20	5240	Ant2	5240.04	40000	7.63	25	Pass
20C 102V	n40	5190	Ant1	5190	0	0	25	Pass
20C 120V	n40	5190	Ant1	5190	0	0	25	Pass
20C 138V	n40	5190	Ant1	5190.04	40000	7.71	25	Pass
-20C 120V	n40	5190	Ant1	5190	0	0	25	Pass
-10C 120V	n40	5190	Ant1	5190	0	0	25	Pass
0C 120V	n40	5190	Ant1	5190.04	40000	7.71	25	Pass
10C 120V	n40	5190	Ant1	5190.04	40000	7.71	25	Pass
30C 120V	n40	5190	Ant1	5190.04	40000	7.71	25	Pass
40C 120V	n40	5190	Ant1	5190.04	40000	7.71	25	Pass
50C 120V	n40	5190	Ant1	5190.04	40000	7.71	25	Pass
20C 102V	n40	5230	Ant1	5230.04	40000	7.65	25	Pass
20C 120V	n40	5230	Ant1	5230	0	0	25	Pass
20C 138V	n40	5230	Ant1	5230.04	40000	7.65	25	Pass
-20C 120V	n40	5230	Ant1	5230.04	40000	7.65	25	Pass
-10C 120V	n40	5230	Ant1	5230.04	40000	7.65	25	Pass
0C 120V	n40	5230	Ant1	5230	0	0	25	Pass
10C 120V	n40	5230	Ant1	5230	0	0	25	Pass
30C 120V	n40	5230	Ant1	5230	0	0	25	Pass
40C 120V	n40	5230	Ant1	5230	0	0	25	Pass
50C 120V	n40	5230	Ant1	5230	0	0	25	Pass
20C 102V	n40	5190	Ant2	5190	0	0	25	Pass
20C 120V	n40	5190	Ant2	5190.04	40000	7.71	25	Pass
20C 138V	n40	5190	Ant2	5190.04	40000	7.71	25	Pass
-20C 120V	n40	5190	Ant2	5190.04	40000	7.71	25	Pass
-10C 120V	n40	5190	Ant2	5190	0	0	25	Pass
0C 120V	n40	5190	Ant2	5190.04	40000	7.71	25	Pass
10C 120V	n40	5190	Ant2	5190	0	0	25	Pass
30C 120V	n40	5190	Ant2	5190	0	0	25	Pass
40C 120V	n40	5190	Ant2	5189.96	-40000	-7.71	25	Pass
50C 120V	n40	5190	Ant2	5190	0	0	25	Pass
20C 102V	n40	5230	Ant2	5230.04	40000	7.65	25	Pass
20C 120V	n40	5230	Ant2	5230	0	0	25	Pass
20C 138V	n40	5230	Ant2	5230.04	40000	7.65	25	Pass
-20C 120V	n40	5230	Ant2	5230.04	40000	7.65	25	Pass
-10C 120V	n40	5230	Ant2	5230	0	0	25	Pass
0C 120V	n40	5230	Ant2	5230.04	40000	7.65	25	Pass
10C 120V	n40	5230	Ant2	5230.04	40000	7.65	25	Pass
30C 120V	n40	5230	Ant2	5230	0	0	25	Pass
40C 120V	n40	5230	Ant2	5230	0	0	25	Pass

50C 120V	n40	5230	Ant2	5230.04	40000	7.65	25	Pass
20C 102V	ac20	5180	Ant1	5180.02	20000	3.86	25	Pass
20C 120V	ac20	5180	Ant1	5180.02	20000	3.86	25	Pass
20C 138V	ac20	5180	Ant1	5180.02	20000	3.86	25	Pass
-20C 120V	ac20	5180	Ant1	5180	0	0	25	Pass
-10C 120V	ac20	5180	Ant1	5180.02	20000	3.86	25	Pass
0C 120V	ac20	5180	Ant1	5180	0	0	25	Pass
10C 120V	ac20	5180	Ant1	5180	0	0	25	Pass
30C 120V	ac20	5180	Ant1	5180.02	20000	3.86	25	Pass
40C 120V	ac20	5180	Ant1	5180	0	0	25	Pass
50C 120V	ac20	5180	Ant1	5180	0	0	25	Pass
20C 102V	ac20	5240	Ant1	5240	0	0	25	Pass
20C 120V	ac20	5240	Ant1	5240.02	20000	3.82	25	Pass
20C 138V	ac20	5240	Ant1	5240	0	0	25	Pass
-20C 120V	ac20	5240	Ant1	5240.04	40000	7.63	25	Pass
-10C 120V	ac20	5240	Ant1	5240.02	20000	3.82	25	Pass
0C 120V	ac20	5240	Ant1	5240	0	0	25	Pass
10C 120V	ac20	5240	Ant1	5240	0	0	25	Pass
30C 120V	ac20	5240	Ant1	5240	0	0	25	Pass
40C 120V	ac20	5240	Ant1	5240.02	20000	3.82	25	Pass
50C 120V	ac20	5240	Ant1	5240	0	0	25	Pass
20C 102V	ac20	5180	Ant2	5179.98	-20000	-3.86	25	Pass
20C 120V	ac20	5180	Ant2	5180.02	20000	3.86	25	Pass
20C 138V	ac20	5180	Ant2	5180	0	0	25	Pass
-20C 120V	ac20	5180	Ant2	5180.02	20000	3.86	25	Pass
-10C 120V	ac20	5180	Ant2	5180	0	0	25	Pass
0C 120V	ac20	5180	Ant2	5180	0	0	25	Pass
10C 120V	ac20	5180	Ant2	5180	0	0	25	Pass
30C 120V	ac20	5180	Ant2	5180.02	20000	3.86	25	Pass
40C 120V	ac20	5180	Ant2	5180	0	0	25	Pass
50C 120V	ac20	5180	Ant2	5180	0	0	25	Pass
20C 102V	ac20	5240	Ant2	5240.02	20000	3.82	25	Pass
20C 120V	ac20	5240	Ant2	5240	0	0	25	Pass
20C 138V	ac20	5240	Ant2	5240.04	40000	7.63	25	Pass
-20C 120V	ac20	5240	Ant2	5240.02	20000	3.82	25	Pass
-10C 120V	ac20	5240	Ant2	5240.02	20000	3.82	25	Pass
0C 120V	ac20	5240	Ant2	5240	0	0	25	Pass
10C 120V	ac20	5240	Ant2	5240	0	0	25	Pass
30C 120V	ac20	5240	Ant2	5240.02	20000	3.82	25	Pass
40C 120V	ac20	5240	Ant2	5240	0	0	25	Pass
50C 120V	ac20	5240	Ant2	5240.02	20000	3.82	25	Pass


20C 102V	ac40	5190	Ant1	5190.04	40000	7.71	25	Pass
20C 120V	ac40	5190	Ant1	5190	0	0	25	Pass
20C 138V	ac40	5190	Ant1	5190	0	0	25	Pass
-20C 120V	ac40	5190	Ant1	5190	0	0	25	Pass
-10C 120V	ac40	5190	Ant1	5190.04	40000	7.71	25	Pass
0C 120V	ac40	5190	Ant1	5190	0	0	25	Pass
10C 120V	ac40	5190	Ant1	5190.04	40000	7.71	25	Pass
30C 120V	ac40	5190	Ant1	5190	0	0	25	Pass
40C 120V	ac40	5190	Ant1	5190	0	0	25	Pass
50C 120V	ac40	5190	Ant1	5190	0	0	25	Pass
20C 102V	ac40	5230	Ant1	5230.04	40000	7.65	25	Pass
20C 120V	ac40	5230	Ant1	5230.04	40000	7.65	25	Pass
20C 138V	ac40	5230	Ant1	5230	0	0	25	Pass
-20C 120V	ac40	5230	Ant1	5230	0	0	25	Pass
-10C 120V	ac40	5230	Ant1	5230	0	0	25	Pass
0C 120V	ac40	5230	Ant1	5230.04	40000	7.65	25	Pass
10C 120V	ac40	5230	Ant1	5230	0	0	25	Pass
30C 120V	ac40	5230	Ant1	5230.04	40000	7.65	25	Pass
40C 120V	ac40	5230	Ant1	5230.04	40000	7.65	25	Pass
50C 120V	ac40	5230	Ant1	5230	0	0	25	Pass
20C 102V	ac40	5190	Ant2	5189.96	-40000	-7.71	25	Pass
20C 120V	ac40	5190	Ant2	5190	0	0	25	Pass
20C 138V	ac40	5190	Ant2	5190	0	0	25	Pass
-20C 120V	ac40	5190	Ant2	5190.04	40000	7.71	25	Pass
-10C 120V	ac40	5190	Ant2	5190.04	40000	7.71	25	Pass
0C 120V	ac40	5190	Ant2	5190	0	0	25	Pass
10C 120V	ac40	5190	Ant2	5190.04	40000	7.71	25	Pass
30C 120V	ac40	5190	Ant2	5190.04	40000	7.71	25	Pass
40C 120V	ac40	5190	Ant2	5190	0	0	25	Pass
50C 120V	ac40	5190	Ant2	5190.04	40000	7.71	25	Pass
20C 102V	ac40	5230	Ant2	5230.04	40000	7.65	25	Pass
20C 120V	ac40	5230	Ant2	5230	0	0	25	Pass
20C 138V	ac40	5230	Ant2	5230	0	0	25	Pass
-20C 120V	ac40	5230	Ant2	5230	0	0	25	Pass
-10C 120V	ac40	5230	Ant2	5230	0	0	25	Pass
0C 120V	ac40	5230	Ant2	5230.04	40000	7.65	25	Pass
10C 120V	ac40	5230	Ant2	5230	0	0	25	Pass
30C 120V	ac40	5230	Ant2	5230	0	0	25	Pass
40C 120V	ac40	5230	Ant2	5230	0	0	25	Pass
50C 120V	ac40	5230	Ant2	5230.04	40000	7.65	25	Pass
20C 102V	ac80	5210	Ant1	5210	0	0	25	Pass

20C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
20C 138V	ac80	5210	Ant1	5210	0	0	25	Pass
-20C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
-10C 120V	ac80	5210	Ant1	5210.08	80000	15.36	25	Pass
0C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
10C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
30C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
40C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
50C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
20C 102V	ac80	5210	Ant2	5210	0	0	25	Pass
20C 120V	ac80	5210	Ant2	5210.08	80000	15.36	25	Pass
20C 138V	ac80	5210	Ant2	5210	0	0	25	Pass
-20C 120V	ac80	5210	Ant2	5210	0	0	25	Pass
-10C 120V	ac80	5210	Ant2	5210	0	0	25	Pass
0C 120V	ac80	5210	Ant2	5210	0	0	25	Pass
10C 120V	ac80	5210	Ant2	5210	0	0	25	Pass
30C 120V	ac80	5210	Ant2	5210	0	0	25	Pass
40C 120V	ac80	5210	Ant2	5210	0	0	25	Pass
50C 120V	ac80	5210	Ant2	5210	0	0	25	Pass

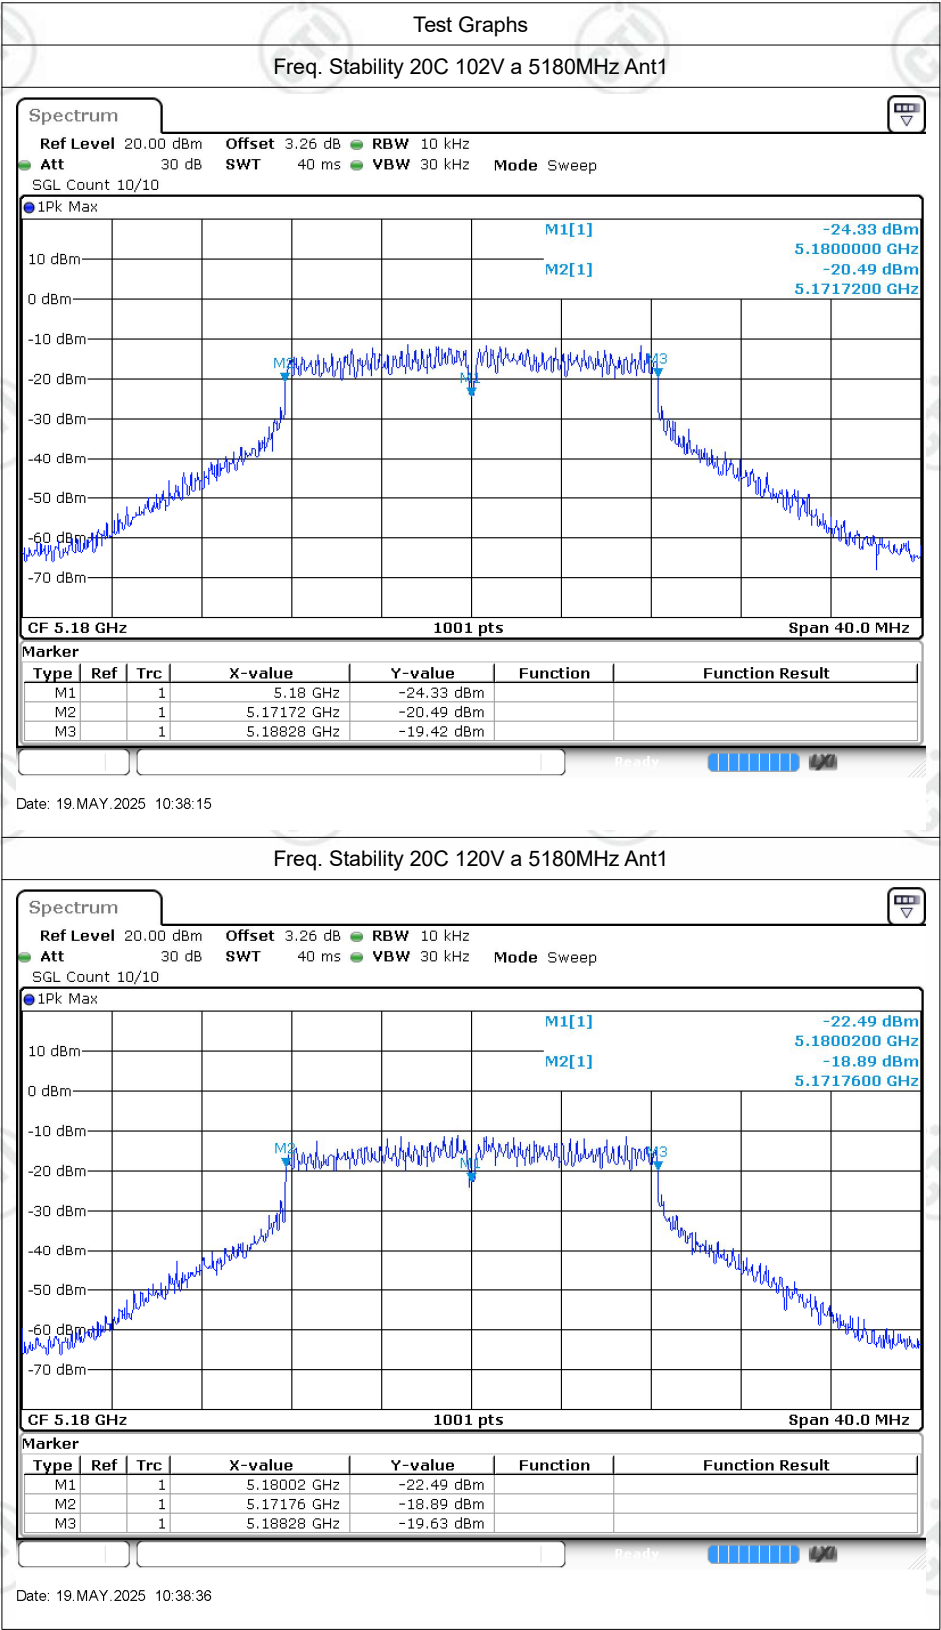


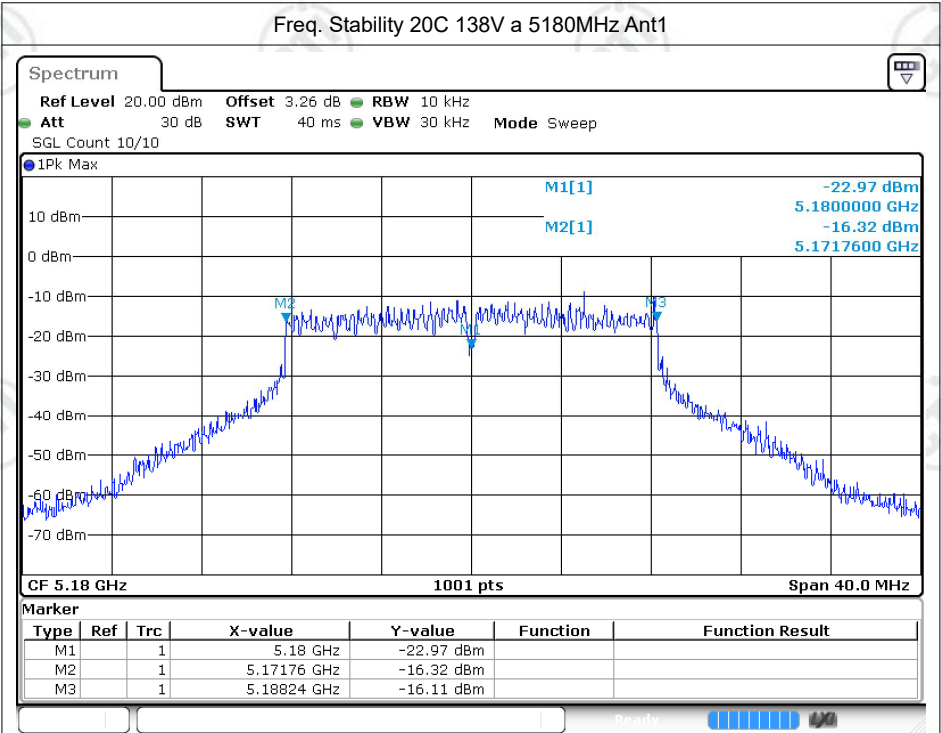


Date: 19.MAY.2025 10:38:21

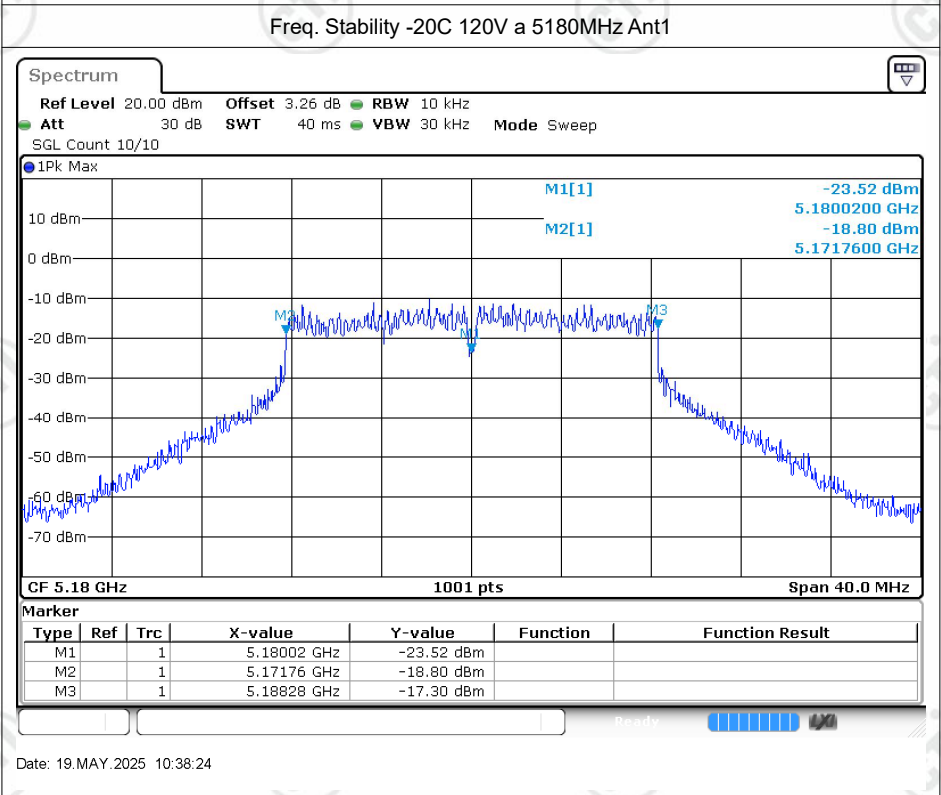


Date: 19.MAY.2025 10:38:24

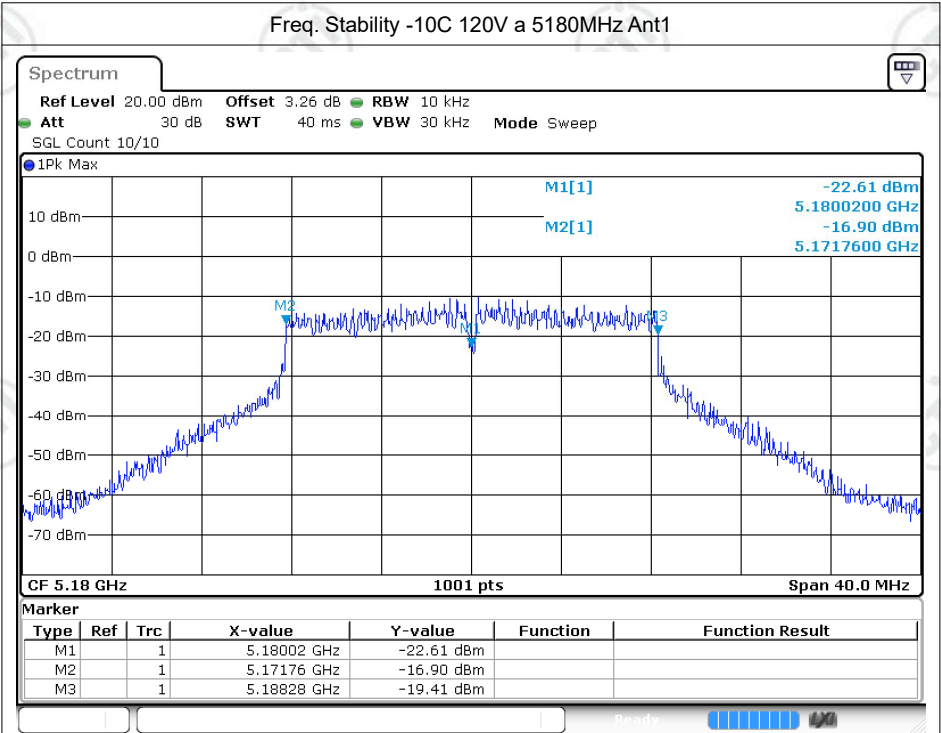


Date: 19.MAY.2025 10:38:27

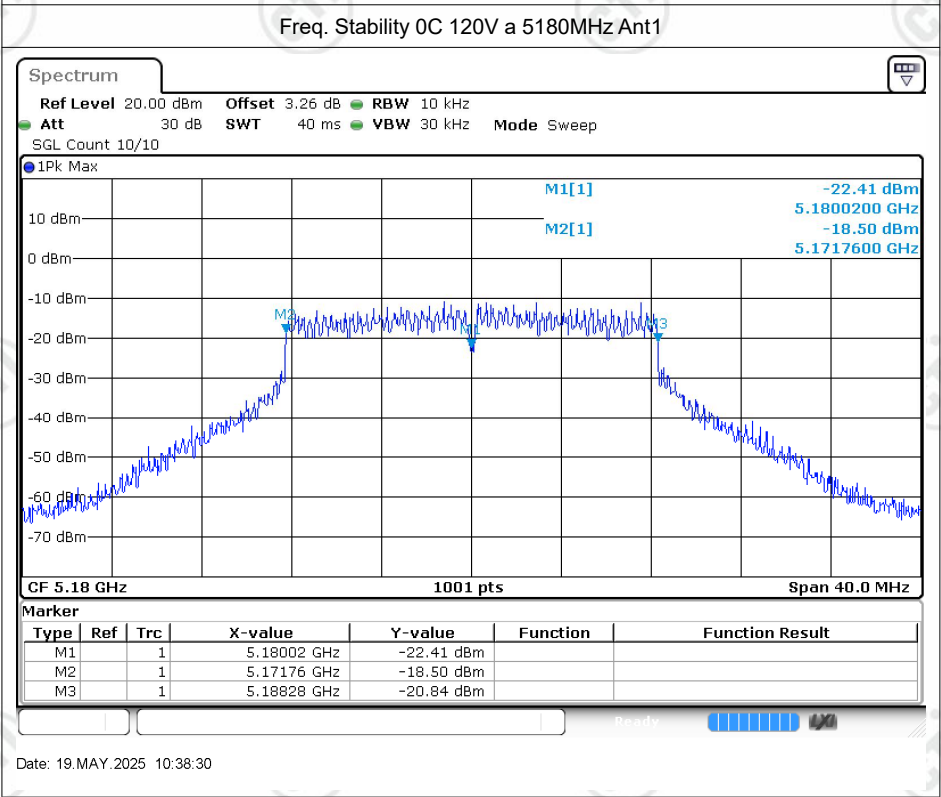

Date: 19.MAY.2025 10:38:30

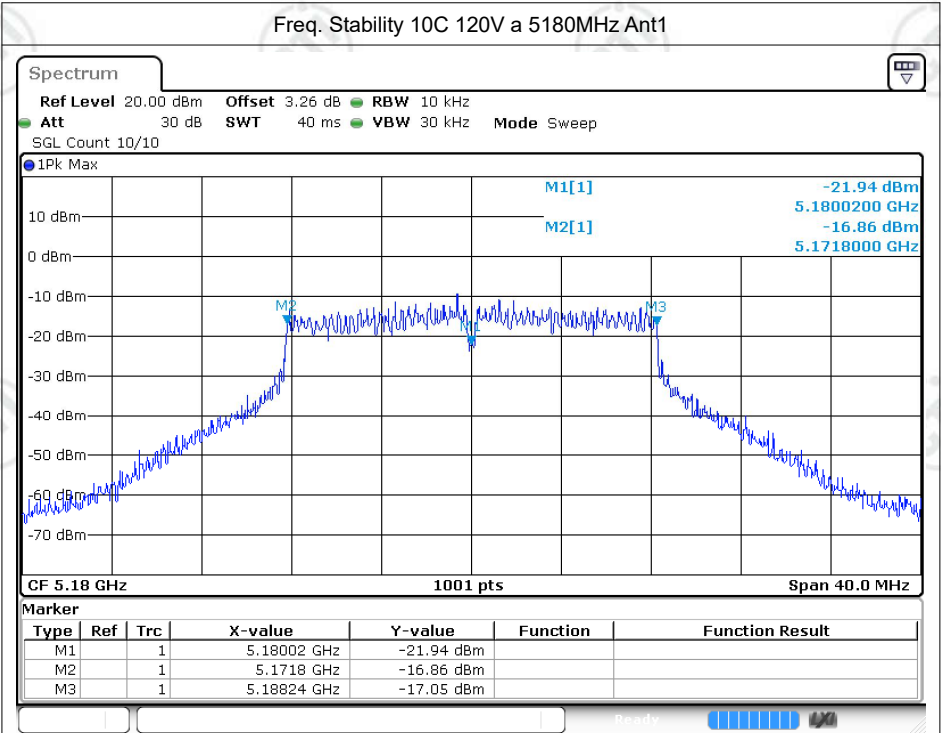

Date: 19.MAY.2025 10:38:33

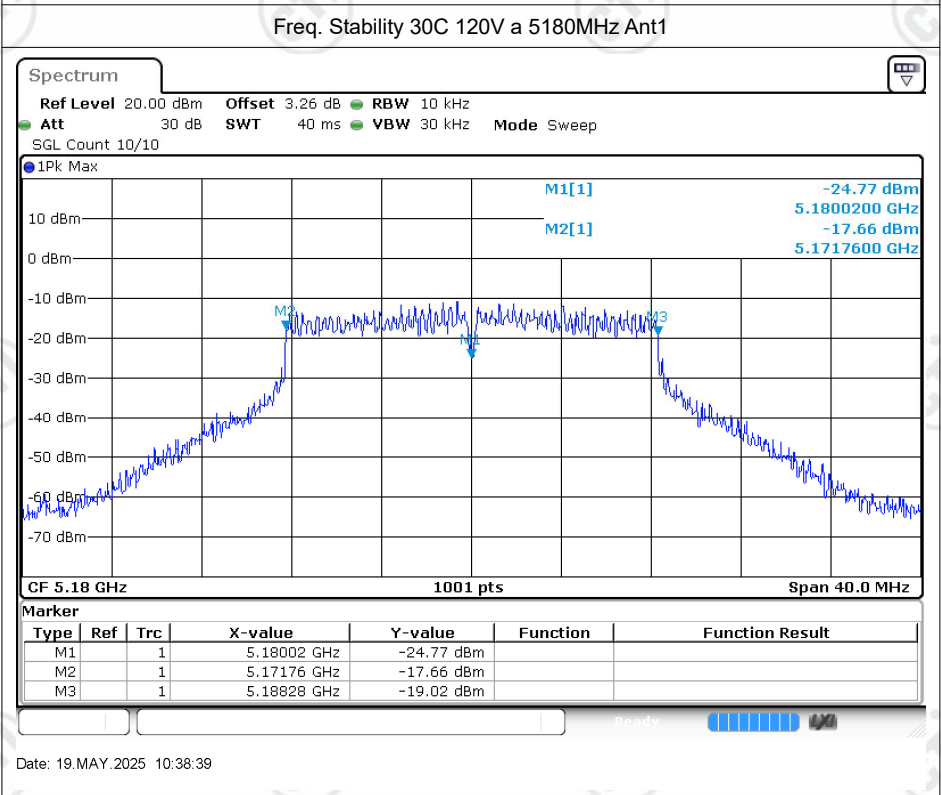

Date: 19.MAY.2025 10:38:39