


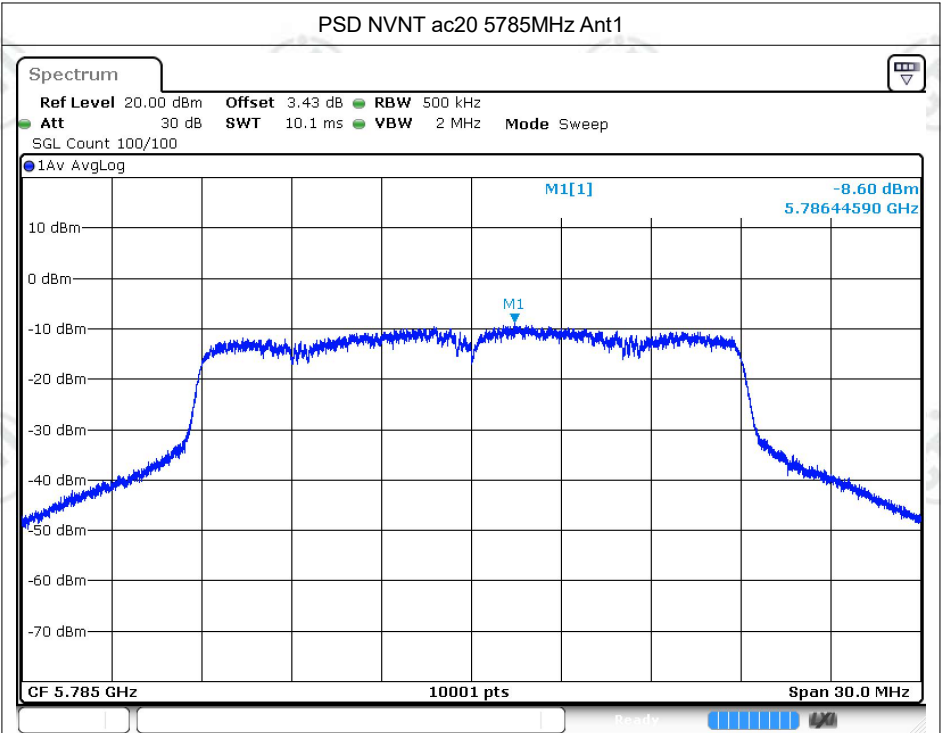


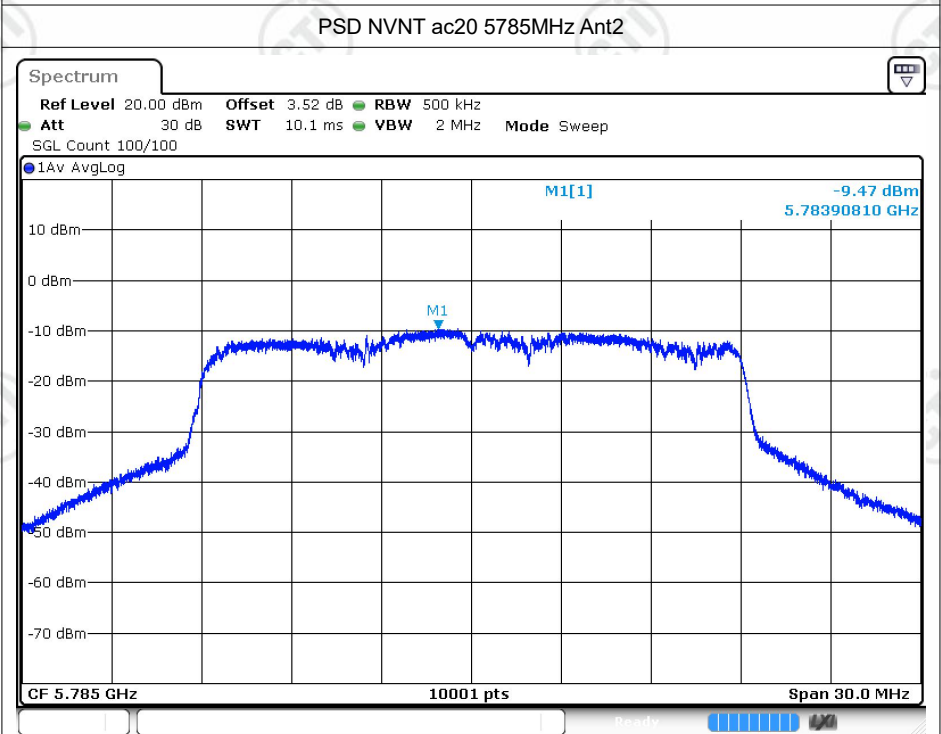


Date: 19.MAY.2025 14:03:59

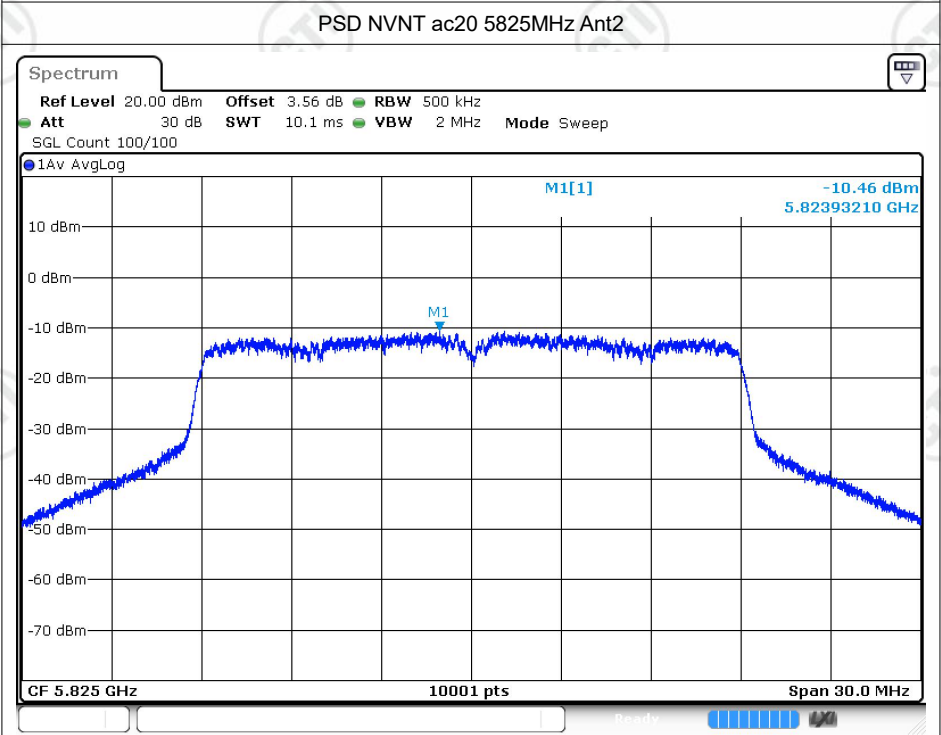


Date: 19.MAY.2025 14:04:03

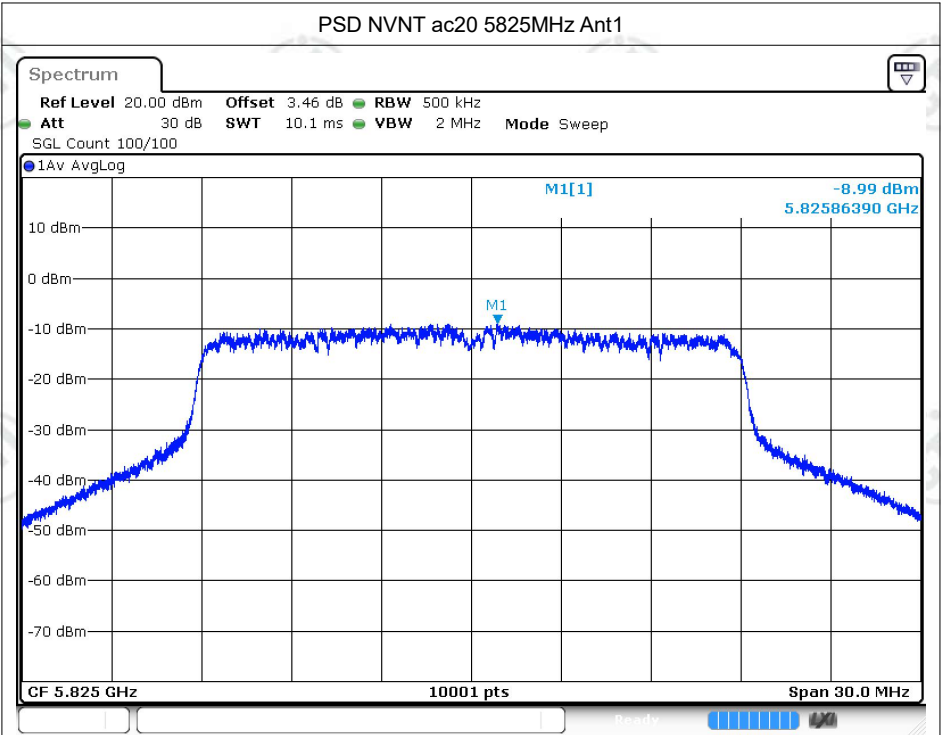


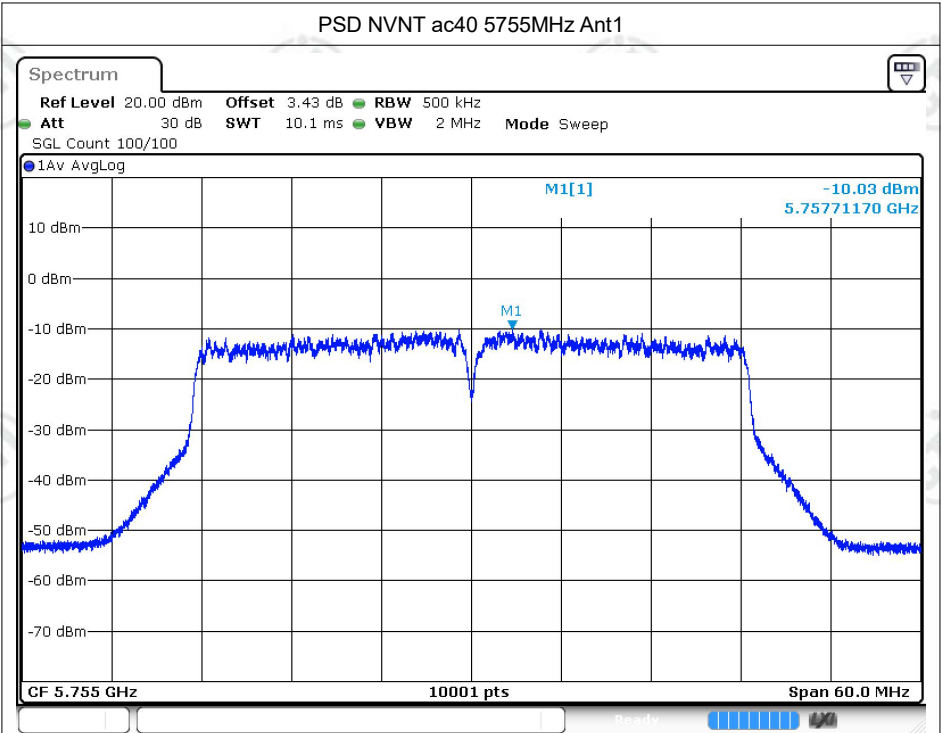


Date: 19.MAY.2025 13:23:39

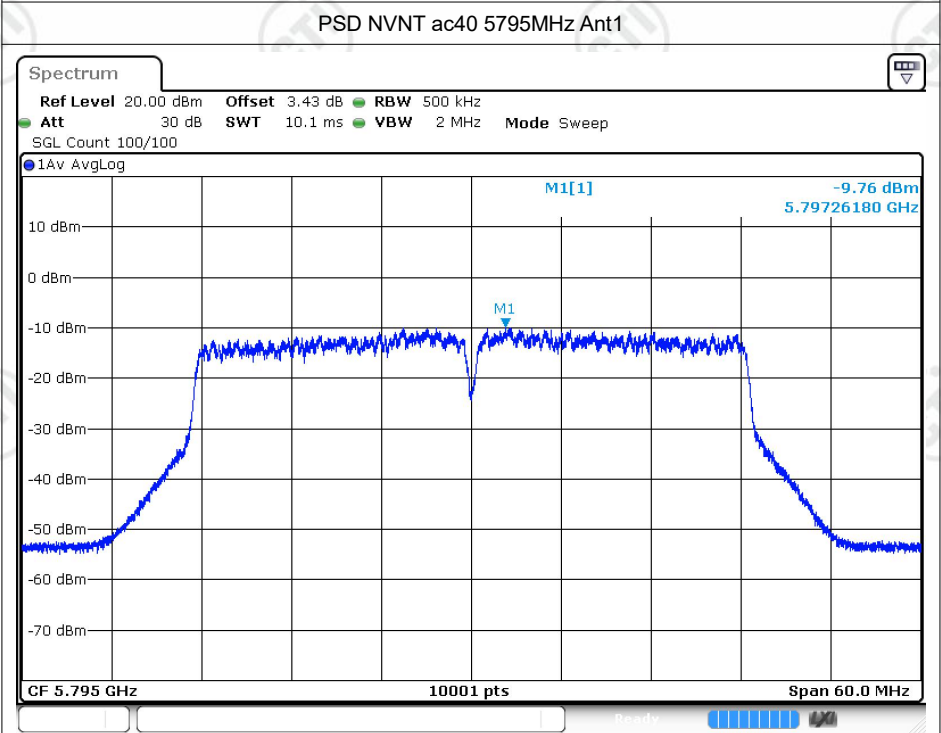


Date: 19.MAY.2025 13:25:25

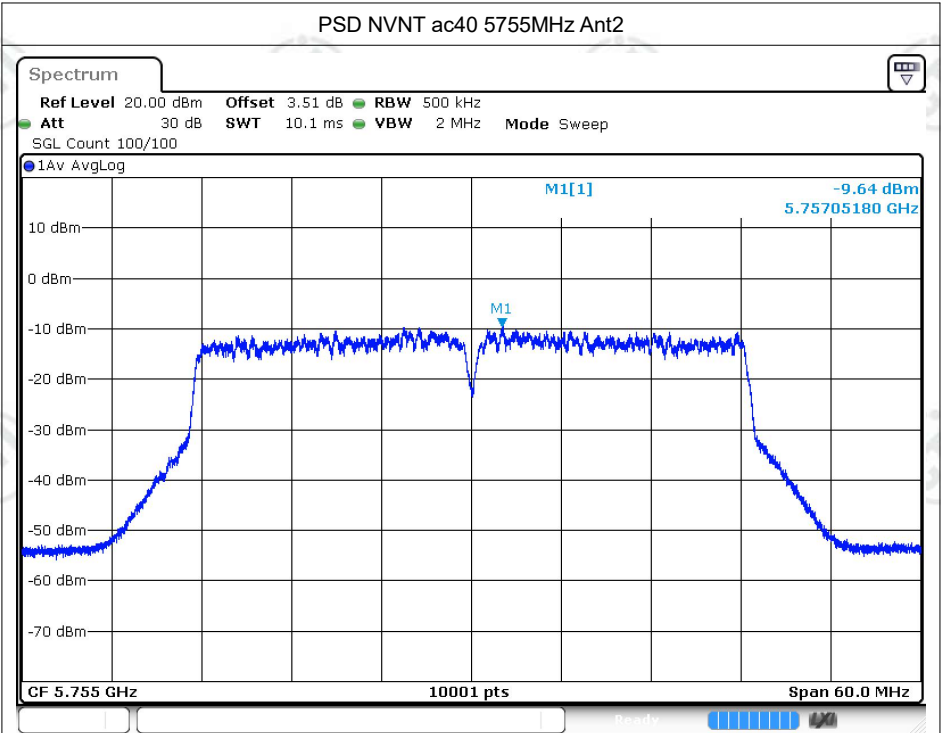


Date: 19.MAY.2025 13:53:01

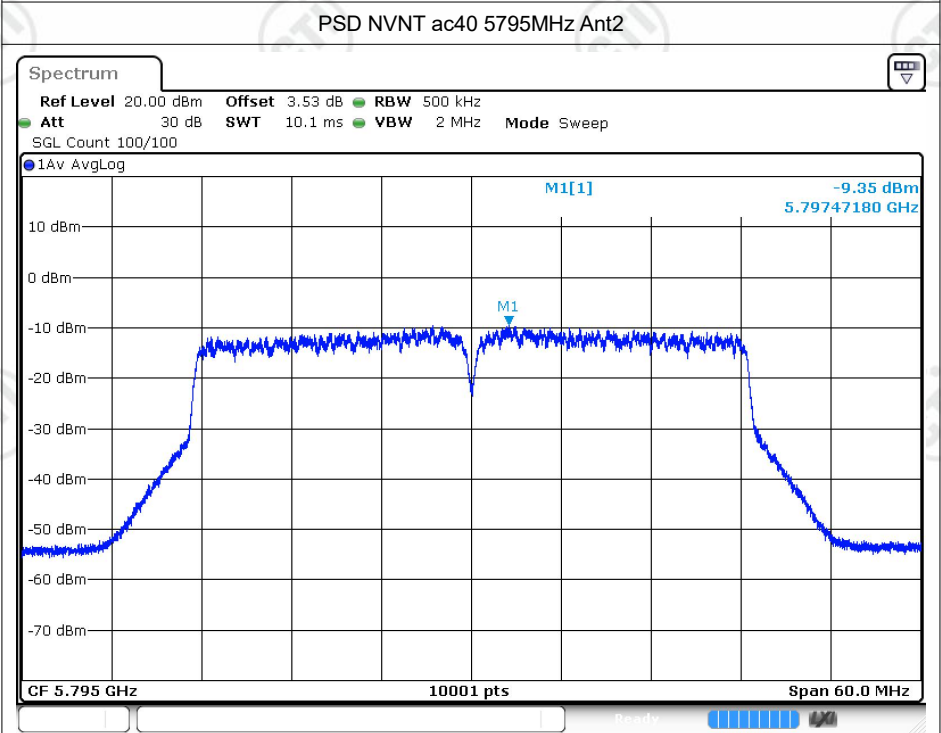


Date: 19.MAY.2025 13:54:35

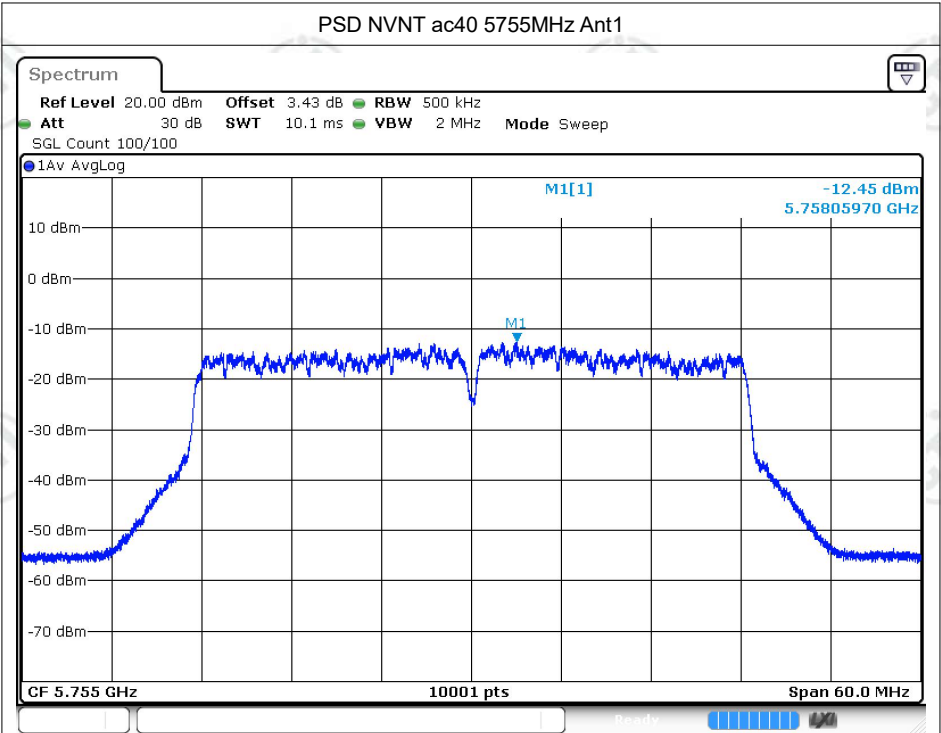


Date: 19.MAY.2025 14:05:36

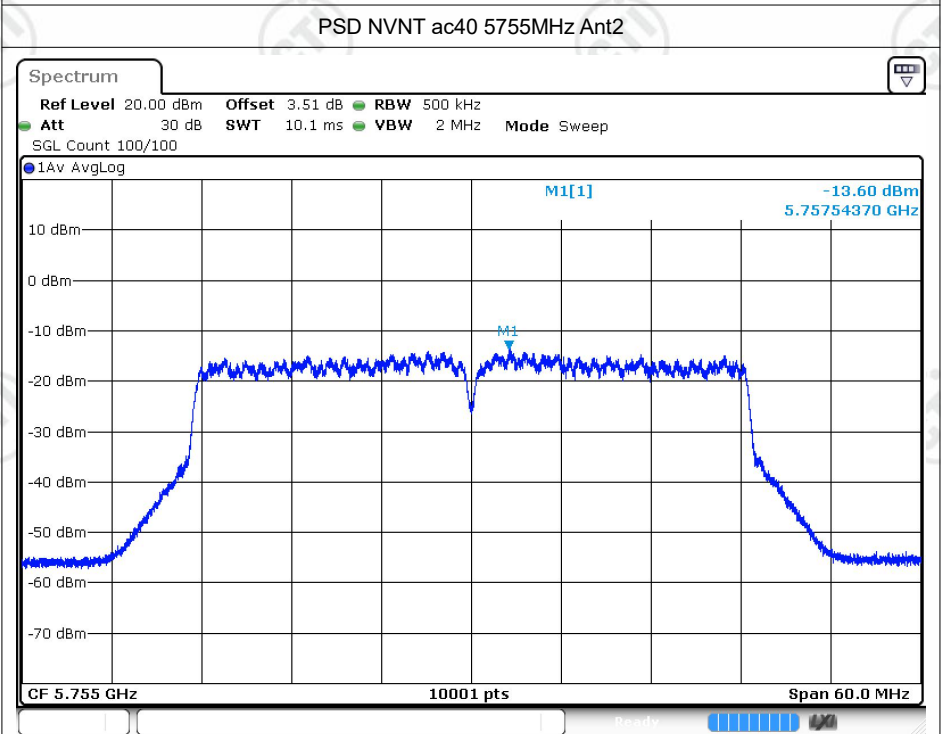


Date: 19.MAY.2025 14:05:39

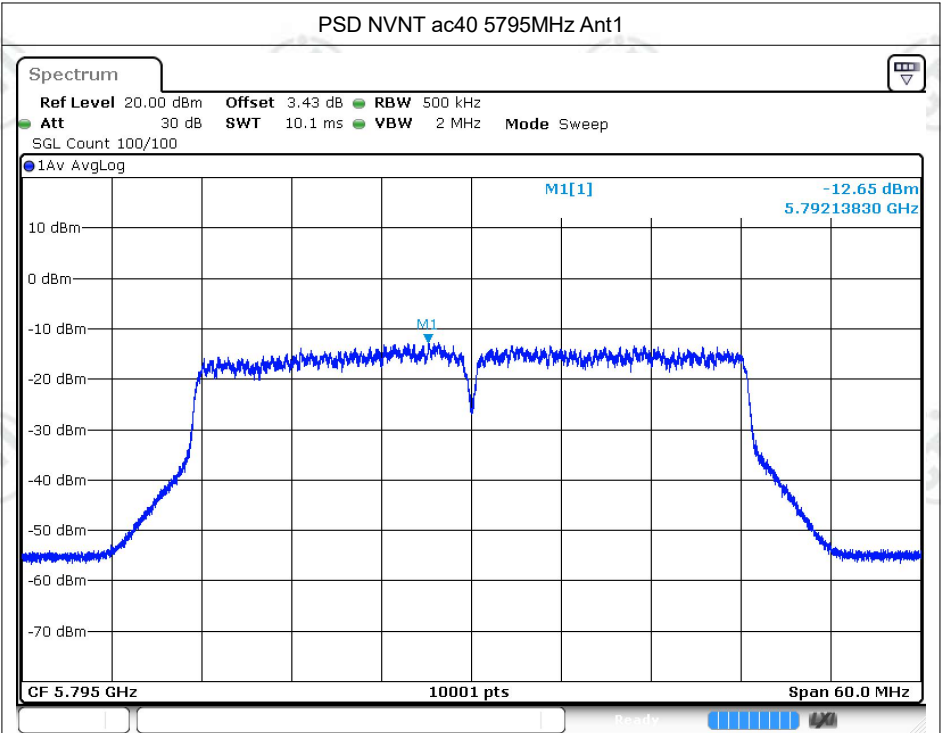


Date: 19.MAY.2025 14:06:24

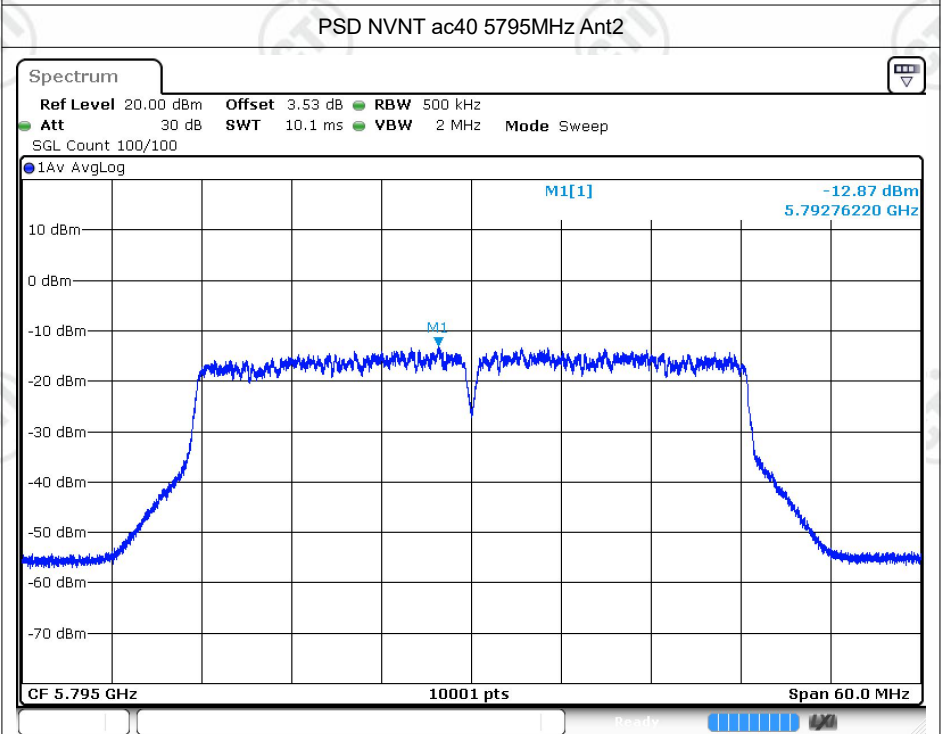


Date: 19.MAY.2025 14:06:27

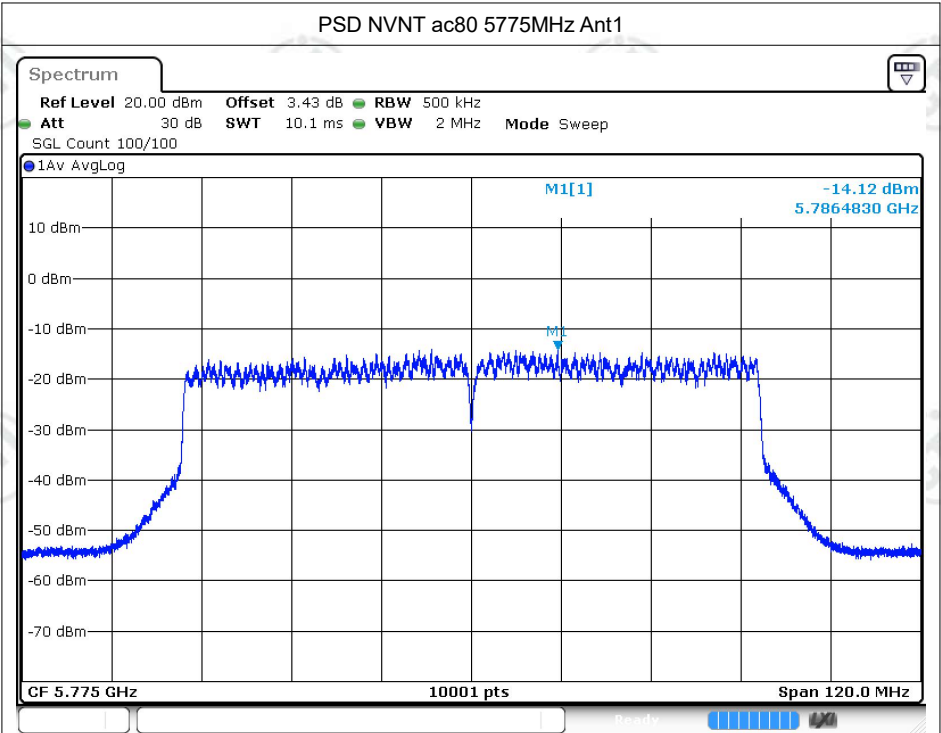


Date: 19.MAY.2025 13:28:03

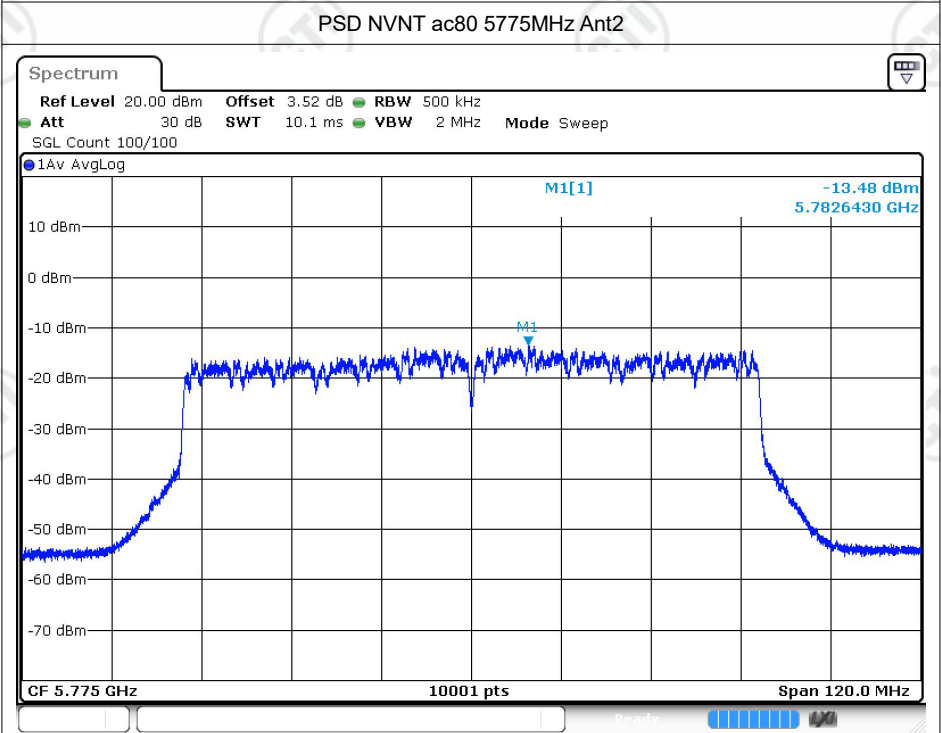

Date: 19.MAY.2025 13:56:25

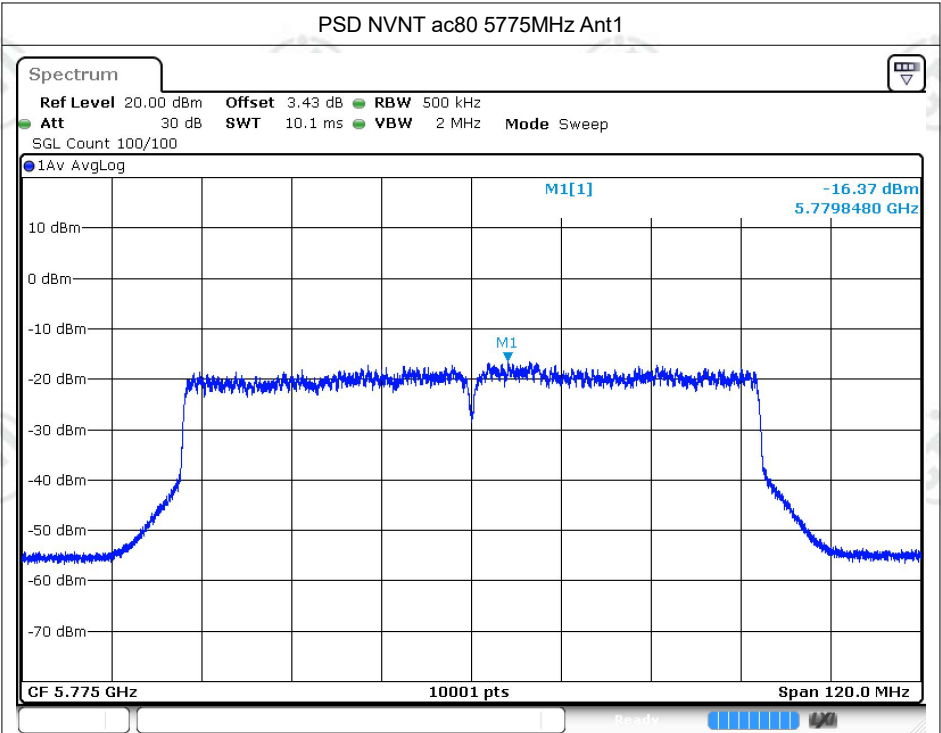

Date: 19.MAY.2025 14:07:55

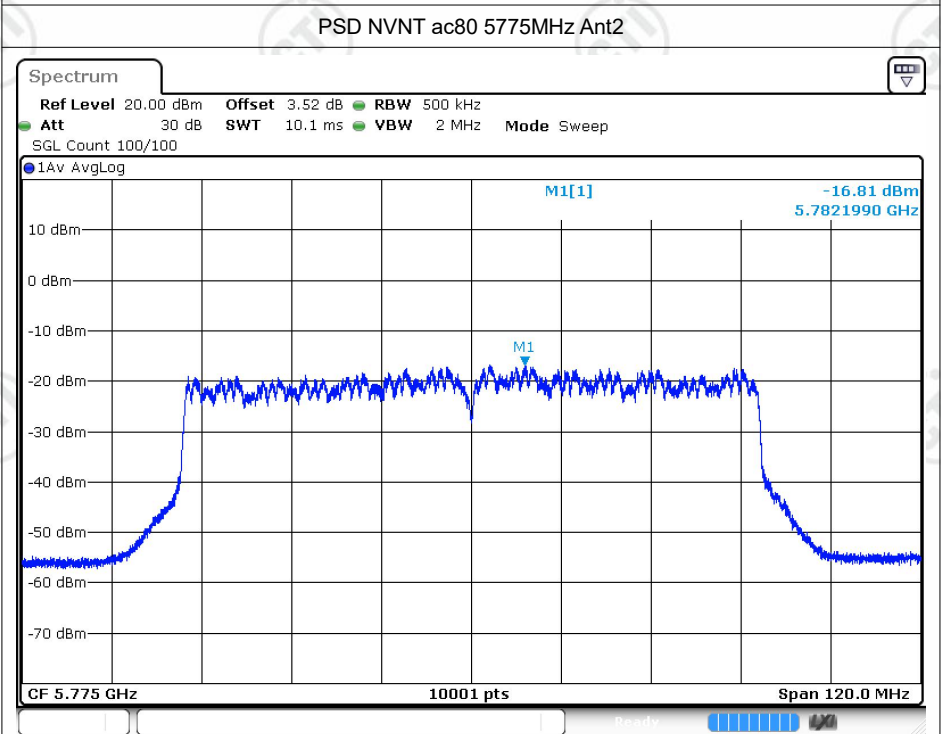

Date: 19.MAY.2025 14:07:58

Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
20C 102V	a	5745	Ant1	5745	0	0	25	Pass
20C 120V	a	5745	Ant1	5745	0	0	25	Pass
20C 138V	a	5745	Ant1	5745	0	0	25	Pass
-20C 120V	a	5745	Ant1	5744.98	-20000	-3.48	25	Pass
-10C 120V	a	5745	Ant1	5744.98	-20000	-3.48	25	Pass
0C 120V	a	5745	Ant1	5745	0	0	25	Pass
10C 120V	a	5745	Ant1	5745	0	0	25	Pass
30C 120V	a	5745	Ant1	5745	0	0	25	Pass
40C 120V	a	5745	Ant1	5745.02	20000	3.48	25	Pass
50C 120V	a	5745	Ant1	5745.02	20000	3.48	25	Pass
20C 102V	a	5825	Ant1	5824.98	-20000	-3.43	25	Pass
20C 120V	a	5825	Ant1	5825.02	20000	3.43	25	Pass
20C 138V	a	5825	Ant1	5824.98	-20000	-3.43	25	Pass
-20C 120V	a	5825	Ant1	5825	0	0	25	Pass
-10C 120V	a	5825	Ant1	5824.98	-20000	-3.43	25	Pass
0C 120V	a	5825	Ant1	5825.02	20000	3.43	25	Pass
10C 120V	a	5825	Ant1	5825	0	0	25	Pass
30C 120V	a	5825	Ant1	5825.02	20000	3.43	25	Pass
40C 120V	a	5825	Ant1	5825	0	0	25	Pass
50C 120V	a	5825	Ant1	5825	0	0	25	Pass
20C 102V	a	5745	Ant2	5745	0	0	25	Pass
20C 120V	a	5745	Ant2	5744.98	-20000	-3.48	25	Pass
20C 138V	a	5745	Ant2	5744.98	-20000	-3.48	25	Pass
-20C 120V	a	5745	Ant2	5745	0	0	25	Pass
-10C 120V	a	5745	Ant2	5745.02	20000	3.48	25	Pass
0C 120V	a	5745	Ant2	5745	0	0	25	Pass
10C 120V	a	5745	Ant2	5745	0	0	25	Pass
30C 120V	a	5745	Ant2	5745	0	0	25	Pass
40C 120V	a	5745	Ant2	5745	0	0	25	Pass
50C 120V	a	5745	Ant2	5745.02	20000	3.48	25	Pass
20C 102V	a	5825	Ant2	5825.02	20000	3.43	25	Pass
20C 120V	a	5825	Ant2	5824.98	-20000	-3.43	25	Pass
20C 138V	a	5825	Ant2	5825.02	20000	3.43	25	Pass
-20C 120V	a	5825	Ant2	5824.98	-20000	-3.43	25	Pass
-10C 120V	a	5825	Ant2	5825	0	0	25	Pass
0C 120V	a	5825	Ant2	5825	0	0	25	Pass
10C 120V	a	5825	Ant2	5825.02	20000	3.43	25	Pass

30C 120V	a	5825	Ant2	5825	0	0	25	Pass
40C 120V	a	5825	Ant2	5825	0	0	25	Pass
50C 120V	a	5825	Ant2	5825.02	20000	3.43	25	Pass
20C 102V	n20	5745	Ant1	5745	0	0	25	Pass
20C 120V	n20	5745	Ant1	5745	0	0	25	Pass
20C 138V	n20	5745	Ant1	5745.02	20000	3.48	25	Pass
-20C 120V	n20	5745	Ant1	5745	0	0	25	Pass
-10C 120V	n20	5745	Ant1	5745	0	0	25	Pass
0C 120V	n20	5745	Ant1	5745	0	0	25	Pass
10C 120V	n20	5745	Ant1	5745.02	20000	3.48	25	Pass
30C 120V	n20	5745	Ant1	5745	0	0	25	Pass
40C 120V	n20	5745	Ant1	5745	0	0	25	Pass
50C 120V	n20	5745	Ant1	5745.02	20000	3.48	25	Pass
20C 102V	n20	5825	Ant1	5825	0	0	25	Pass
20C 120V	n20	5825	Ant1	5825	0	0	25	Pass
20C 138V	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
-20C 120V	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
-10C 120V	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
0C 120V	n20	5825	Ant1	5825	0	0	25	Pass
10C 120V	n20	5825	Ant1	5825	0	0	25	Pass
30C 120V	n20	5825	Ant1	5825.02	20000	3.43	25	Pass
40C 120V	n20	5825	Ant1	5825	0	0	25	Pass
50C 120V	n20	5825	Ant1	5825	0	0	25	Pass
20C 102V	n20	5745	Ant2	5745.02	20000	3.48	25	Pass
20C 120V	n20	5745	Ant2	5745.02	20000	3.48	25	Pass
20C 138V	n20	5745	Ant2	5745.02	20000	3.48	25	Pass
-20C 120V	n20	5745	Ant2	5745	0	0	25	Pass
-10C 120V	n20	5745	Ant2	5745.02	20000	3.48	25	Pass
0C 120V	n20	5745	Ant2	5744.98	-20000	-3.48	25	Pass
10C 120V	n20	5745	Ant2	5745.04	40000	6.96	25	Pass
30C 120V	n20	5745	Ant2	5745	0	0	25	Pass
40C 120V	n20	5745	Ant2	5745	0	0	25	Pass
50C 120V	n20	5745	Ant2	5745	0	0	25	Pass
20C 102V	n20	5825	Ant2	5825	0	0	25	Pass
20C 120V	n20	5825	Ant2	5825.02	20000	3.43	25	Pass
20C 138V	n20	5825	Ant2	5825	0	0	25	Pass
-20C 120V	n20	5825	Ant2	5825	0	0	25	Pass
-10C 120V	n20	5825	Ant2	5825.02	20000	3.43	25	Pass
0C 120V	n20	5825	Ant2	5825.02	20000	3.43	25	Pass
10C 120V	n20	5825	Ant2	5825	0	0	25	Pass
30C 120V	n20	5825	Ant2	5825.02	20000	3.43	25	Pass
40C 120V	n20	5825	Ant2	5824.98	-20000	-3.43	25	Pass

50C 120V	n20	5825	Ant2	5825.02	20000	3.43	25	Pass
20C 102V	n40	5755	Ant1	5755	0	0	25	Pass
20C 120V	n40	5755	Ant1	5755	0	0	25	Pass
20C 138V	n40	5755	Ant1	5755	0	0	25	Pass
-20C 120V	n40	5755	Ant1	5755	0	0	25	Pass
-10C 120V	n40	5755	Ant1	5755.04	40000	6.95	25	Pass
0C 120V	n40	5755	Ant1	5755.04	40000	6.95	25	Pass
10C 120V	n40	5755	Ant1	5755	0	0	25	Pass
30C 120V	n40	5755	Ant1	5755	0	0	25	Pass
40C 120V	n40	5755	Ant1	5755	0	0	25	Pass
50C 120V	n40	5755	Ant1	5755	0	0	25	Pass
20C 102V	n40	5795	Ant1	5795.04	40000	6.9	25	Pass
20C 120V	n40	5795	Ant1	5795	0	0	25	Pass
20C 138V	n40	5795	Ant1	5795	0	0	25	Pass
-20C 120V	n40	5795	Ant1	5795	0	0	25	Pass
-10C 120V	n40	5795	Ant1	5795	0	0	25	Pass
0C 120V	n40	5795	Ant1	5795.04	40000	6.9	25	Pass
10C 120V	n40	5795	Ant1	5795	0	0	25	Pass
30C 120V	n40	5795	Ant1	5795	0	0	25	Pass
40C 120V	n40	5795	Ant1	5795.04	40000	6.9	25	Pass
50C 120V	n40	5795	Ant1	5795.04	40000	6.9	25	Pass
20C 102V	n40	5755	Ant2	5755.04	40000	6.95	25	Pass
20C 120V	n40	5755	Ant2	5755	0	0	25	Pass
20C 138V	n40	5755	Ant2	5755	0	0	25	Pass
-20C 120V	n40	5755	Ant2	5755	0	0	25	Pass
-10C 120V	n40	5755	Ant2	5755.04	40000	6.95	25	Pass
0C 120V	n40	5755	Ant2	5755.04	40000	6.95	25	Pass
10C 120V	n40	5755	Ant2	5754.96	-40000	-6.95	25	Pass
30C 120V	n40	5755	Ant2	5755	0	0	25	Pass
40C 120V	n40	5755	Ant2	5755.04	40000	6.95	25	Pass
50C 120V	n40	5755	Ant2	5755	0	0	25	Pass
20C 102V	n40	5795	Ant2	5795	0	0	25	Pass
20C 120V	n40	5795	Ant2	5795.04	40000	6.9	25	Pass
20C 138V	n40	5795	Ant2	5795.04	40000	6.9	25	Pass
-20C 120V	n40	5795	Ant2	5795	0	0	25	Pass
-10C 120V	n40	5795	Ant2	5795	0	0	25	Pass
0C 120V	n40	5795	Ant2	5795.04	40000	6.9	25	Pass
10C 120V	n40	5795	Ant2	5795	0	0	25	Pass
30C 120V	n40	5795	Ant2	5795	0	0	25	Pass
40C 120V	n40	5795	Ant2	5795	0	0	25	Pass
50C 120V	n40	5795	Ant2	5795	0	0	25	Pass
20C 102V	ac20	5745	Ant1	5745.02	20000	3.48	25	Pass

20C 120V	ac20	5745	Ant1	5745	0	0	25	Pass
20C 138V	ac20	5745	Ant1	5745.04	40000	6.96	25	Pass
-20C 120V	ac20	5745	Ant1	5745	0	0	25	Pass
-10C 120V	ac20	5745	Ant1	5745.02	20000	3.48	25	Pass
0C 120V	ac20	5745	Ant1	5745.02	20000	3.48	25	Pass
10C 120V	ac20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
30C 120V	ac20	5745	Ant1	5745.02	20000	3.48	25	Pass
40C 120V	ac20	5745	Ant1	5745	0	0	25	Pass
50C 120V	ac20	5745	Ant1	5745	0	0	25	Pass
20C 102V	ac20	5825	Ant1	5825.02	20000	3.43	25	Pass
20C 120V	ac20	5825	Ant1	5825	0	0	25	Pass
20C 138V	ac20	5825	Ant1	5825.02	20000	3.43	25	Pass
-20C 120V	ac20	5825	Ant1	5825.02	20000	3.43	25	Pass
-10C 120V	ac20	5825	Ant1	5825.04	40000	6.87	25	Pass
0C 120V	ac20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
10C 120V	ac20	5825	Ant1	5825.02	20000	3.43	25	Pass
30C 120V	ac20	5825	Ant1	5825.02	20000	3.43	25	Pass
40C 120V	ac20	5825	Ant1	5825	0	0	25	Pass
50C 120V	ac20	5825	Ant1	5825	0	0	25	Pass
20C 102V	ac20	5745	Ant2	5745	0	0	25	Pass
20C 120V	ac20	5745	Ant2	5745.02	20000	3.48	25	Pass
20C 138V	ac20	5745	Ant2	5745.02	20000	3.48	25	Pass
-20C 120V	ac20	5745	Ant2	5745	0	0	25	Pass
-10C 120V	ac20	5745	Ant2	5745.02	20000	3.48	25	Pass
0C 120V	ac20	5745	Ant2	5745	0	0	25	Pass
10C 120V	ac20	5745	Ant2	5744.98	-20000	-3.48	25	Pass
30C 120V	ac20	5745	Ant2	5745	0	0	25	Pass
40C 120V	ac20	5745	Ant2	5745.02	20000	3.48	25	Pass
50C 120V	ac20	5745	Ant2	5745	0	0	25	Pass
20C 102V	ac20	5825	Ant2	5825.04	40000	6.87	25	Pass
20C 120V	ac20	5825	Ant2	5825.02	20000	3.43	25	Pass
20C 138V	ac20	5825	Ant2	5825	0	0	25	Pass
-20C 120V	ac20	5825	Ant2	5825.02	20000	3.43	25	Pass
-10C 120V	ac20	5825	Ant2	5825.02	20000	3.43	25	Pass
0C 120V	ac20	5825	Ant2	5825.02	20000	3.43	25	Pass
10C 120V	ac20	5825	Ant2	5825	0	0	25	Pass
30C 120V	ac20	5825	Ant2	5825	0	0	25	Pass
40C 120V	ac20	5825	Ant2	5824.98	-20000	-3.43	25	Pass
50C 120V	ac20	5825	Ant2	5825.02	20000	3.43	25	Pass
20C 102V	ac40	5755	Ant1	5755	0	0	25	Pass
20C 120V	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
20C 138V	ac40	5755	Ant1	5755	0	0	25	Pass

-20C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
-10C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
0C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
10C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
30C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
40C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
50C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
20C 102V	ac40	5795	Ant1	5795.04	40000	6.9	25	Pass
20C 120V	ac40	5795	Ant1	5795.04	40000	6.9	25	Pass
20C 138V	ac40	5795	Ant1	5795	0	0	25	Pass
-20C 120V	ac40	5795	Ant1	5795.04	40000	6.9	25	Pass
-10C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
0C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
10C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
30C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
40C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
50C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
20C 102V	ac40	5755	Ant2	5755	0	0	25	Pass
20C 120V	ac40	5755	Ant2	5755	0	0	25	Pass
20C 138V	ac40	5755	Ant2	5755	0	0	25	Pass
-20C 120V	ac40	5755	Ant2	5755.04	40000	6.95	25	Pass
-10C 120V	ac40	5755	Ant2	5755	0	0	25	Pass
0C 120V	ac40	5755	Ant2	5755	0	0	25	Pass
10C 120V	ac40	5755	Ant2	5755.04	40000	6.95	25	Pass
30C 120V	ac40	5755	Ant2	5755.04	40000	6.95	25	Pass
40C 120V	ac40	5755	Ant2	5755	0	0	25	Pass
50C 120V	ac40	5755	Ant2	5755.04	40000	6.95	25	Pass
20C 102V	ac40	5795	Ant2	5795.04	40000	6.9	25	Pass
20C 120V	ac40	5795	Ant2	5795.04	40000	6.9	25	Pass
20C 138V	ac40	5795	Ant2	5795.04	40000	6.9	25	Pass
-20C 120V	ac40	5795	Ant2	5795.04	40000	6.9	25	Pass
-10C 120V	ac40	5795	Ant2	5795	0	0	25	Pass
0C 120V	ac40	5795	Ant2	5795.04	40000	6.9	25	Pass
10C 120V	ac40	5795	Ant2	5795.04	40000	6.9	25	Pass
30C 120V	ac40	5795	Ant2	5794.96	-40000	-6.9	25	Pass
40C 120V	ac40	5795	Ant2	5795.04	40000	6.9	25	Pass
50C 120V	ac40	5795	Ant2	5795.04	40000	6.9	25	Pass
20C 102V	ac80	5775	Ant1	5775	0	0	25	Pass
20C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
20C 138V	ac80	5775	Ant1	5775	0	0	25	Pass
-20C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
-10C 120V	ac80	5775	Ant1	5775	0	0	25	Pass

0C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
10C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
30C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
40C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
50C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
20C 102V	ac80	5775	Ant2	5775	0	0	25	Pass
20C 120V	ac80	5775	Ant2	5775	0	0	25	Pass
20C 138V	ac80	5775	Ant2	5775	0	0	25	Pass
-20C 120V	ac80	5775	Ant2	5775	0	0	25	Pass
-10C 120V	ac80	5775	Ant2	5775	0	0	25	Pass
0C 120V	ac80	5775	Ant2	5775	0	0	25	Pass
10C 120V	ac80	5775	Ant2	5775	0	0	25	Pass
30C 120V	ac80	5775	Ant2	5775	0	0	25	Pass
40C 120V	ac80	5775	Ant2	5775	0	0	25	Pass
50C 120V	ac80	5775	Ant2	5775	0	0	25	Pass