



Plot on Configuration QPSK, 10M / 5480 MHz / Average / Port 1 / 6GHz~9GHz

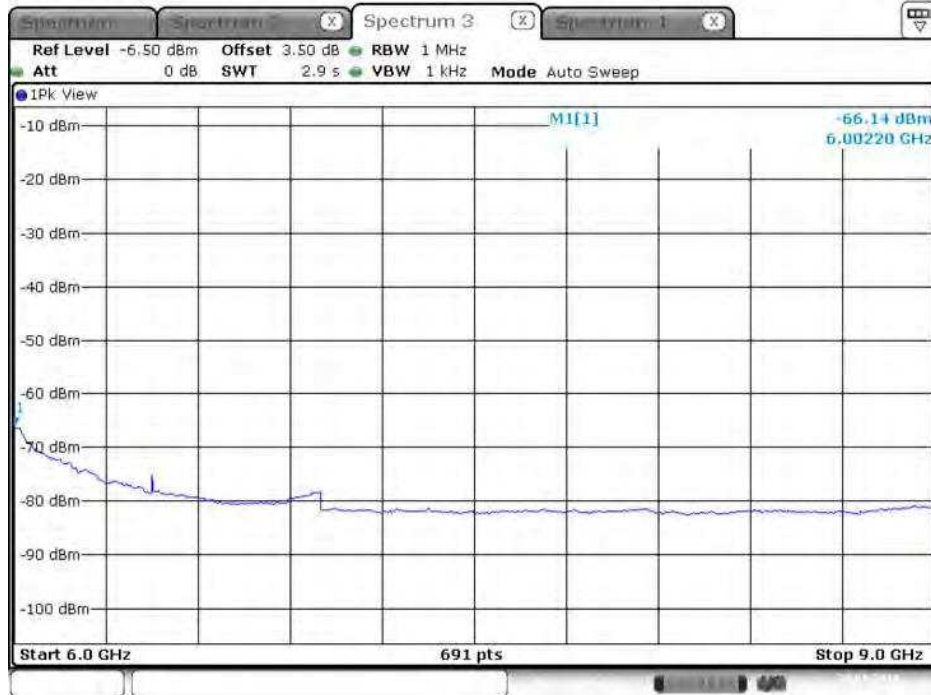


Date: 24.JAN.2018 02:34:02

Plot on Configuration QPSK, 10M / 5480 MHz / Average / Port 2 / 1 6GHz~9GHz

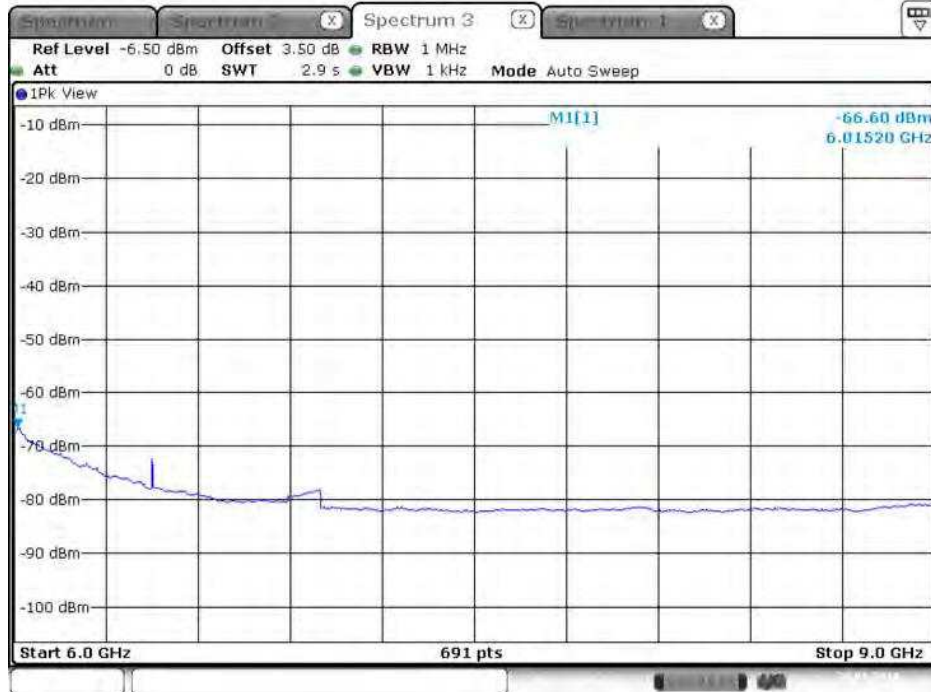


Date: 24.JAN.2018 02:35:14

Plot on Configuration QPSK, 10M / 5480 MHz / Peak / Port 1 / 6GHz~9GHz

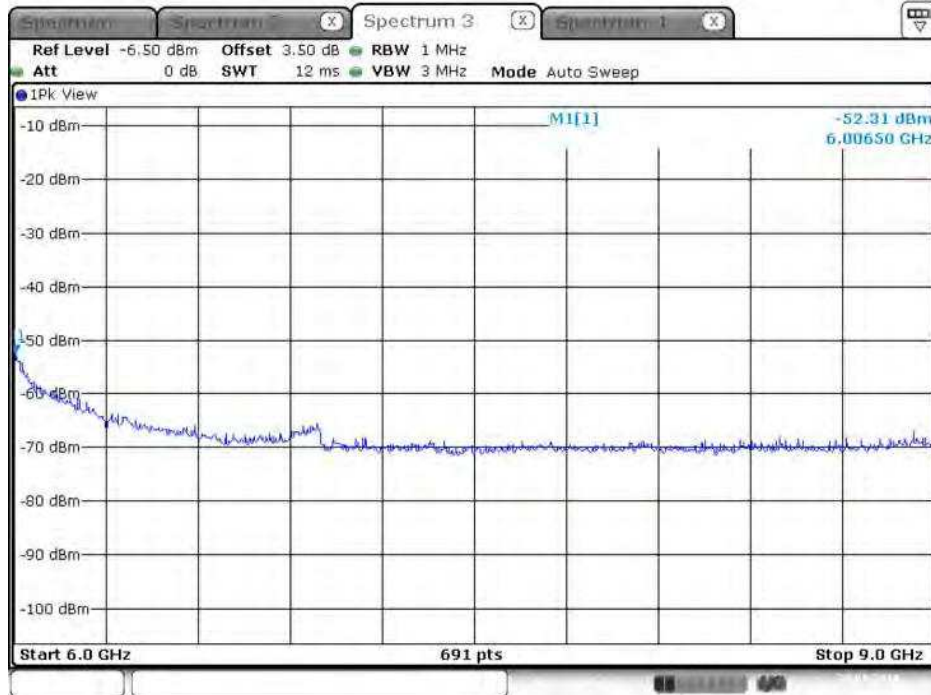


Date: 24.JAN.2018 02:34.17

Plot on Configuration QPSK, 10M / 5480 MHz / Peak / Port 2 / 6GHz~9GHz

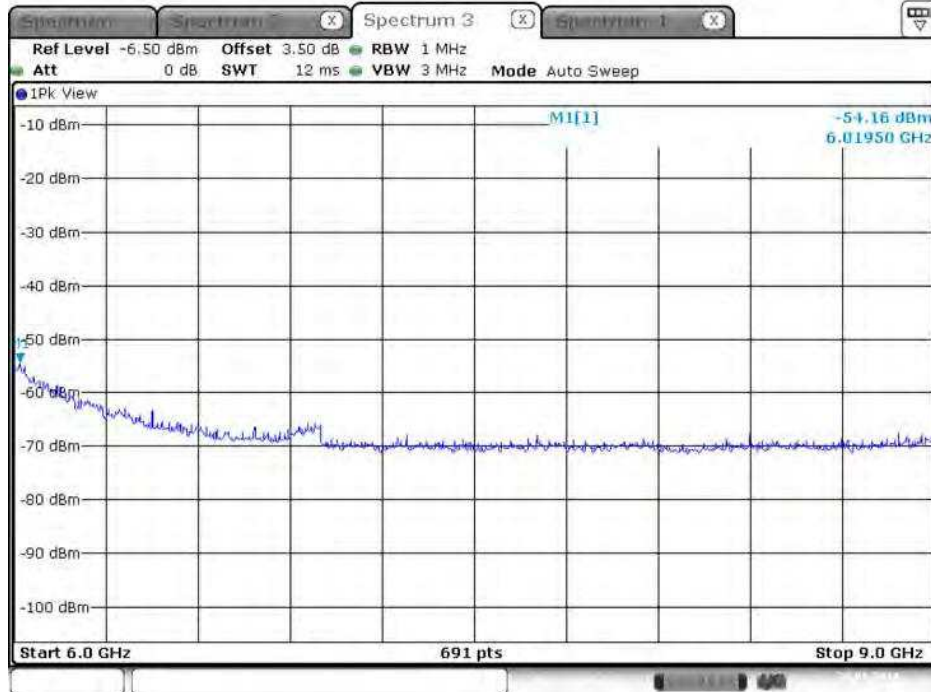


Date: 24.JAN.2018 02:35.01

Plot on Configuration QPSK, 10M / 5575 MHz / Average / Port 1 / 6GHz~9GHz

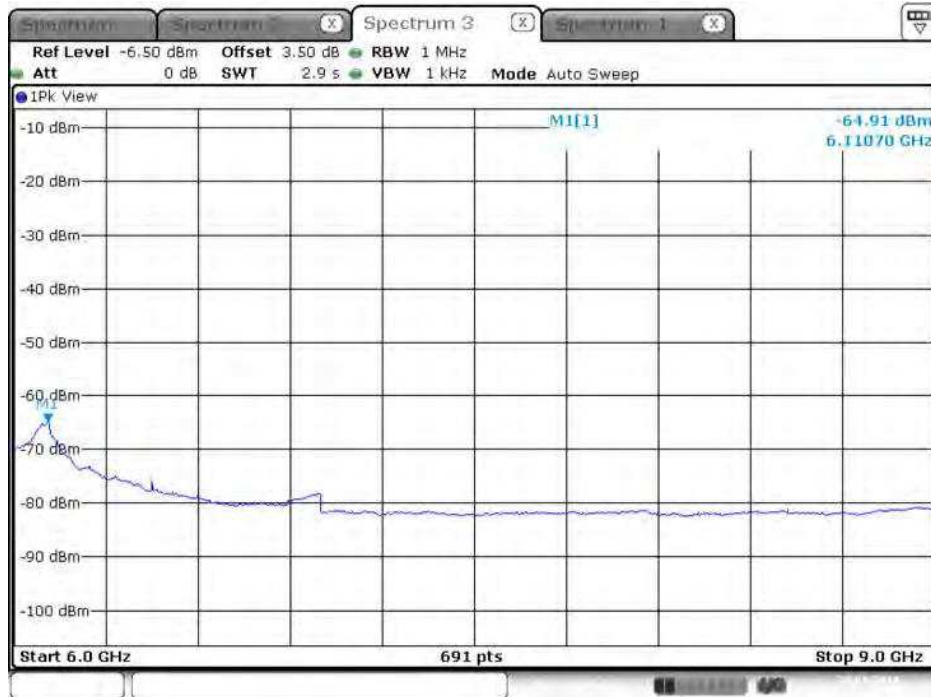


Date: 24.JAN.2018 02:27:05

Plot on Configuration QPSK, 10M / 5575 MHz / Average / Port 2 / 6GHz~9GHz

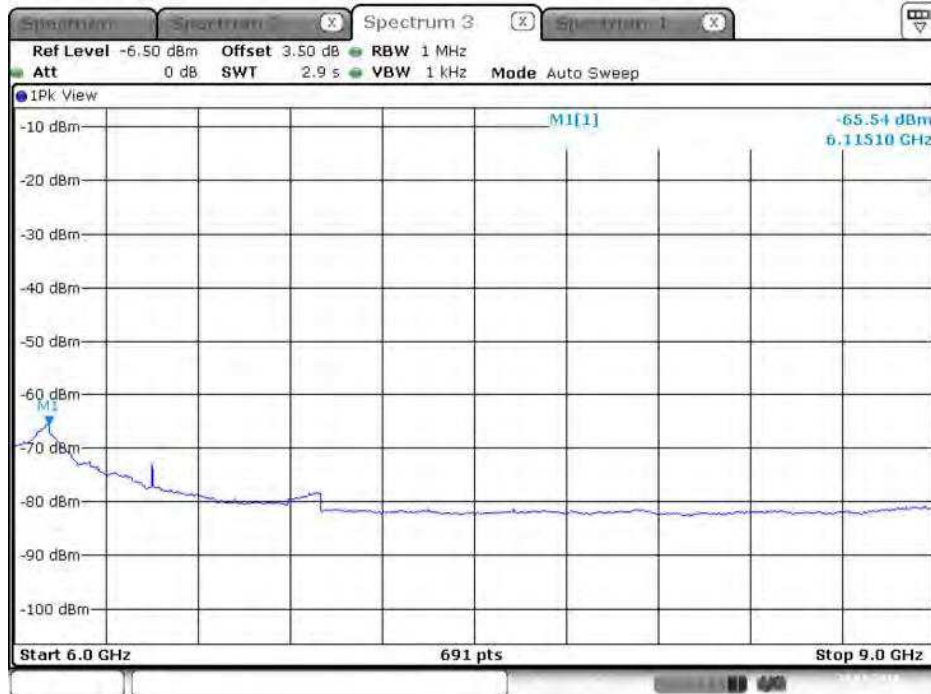


Date: 24.JAN.2018 02:22:34

Plot on Configuration QPSK, 10M / 5575 MHz / Peak / Port 1 / 6GHz~9GHz

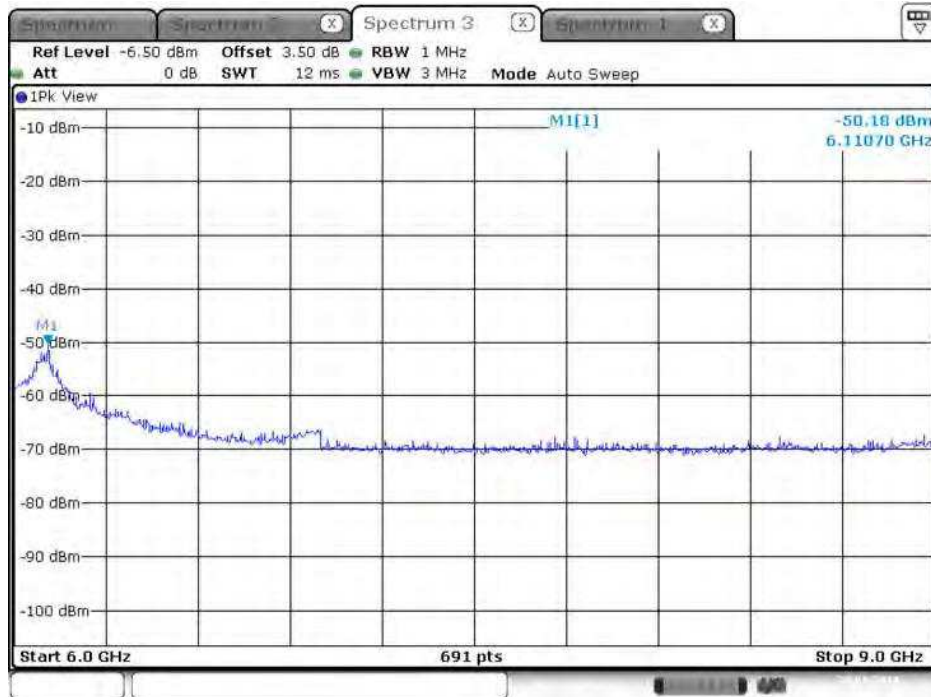


Date: 24.JAN.2018 02:26:52

Plot on Configuration QPSK, 10M / 5575 MHz / Peak / Port 2 / 6GHz~9GHz

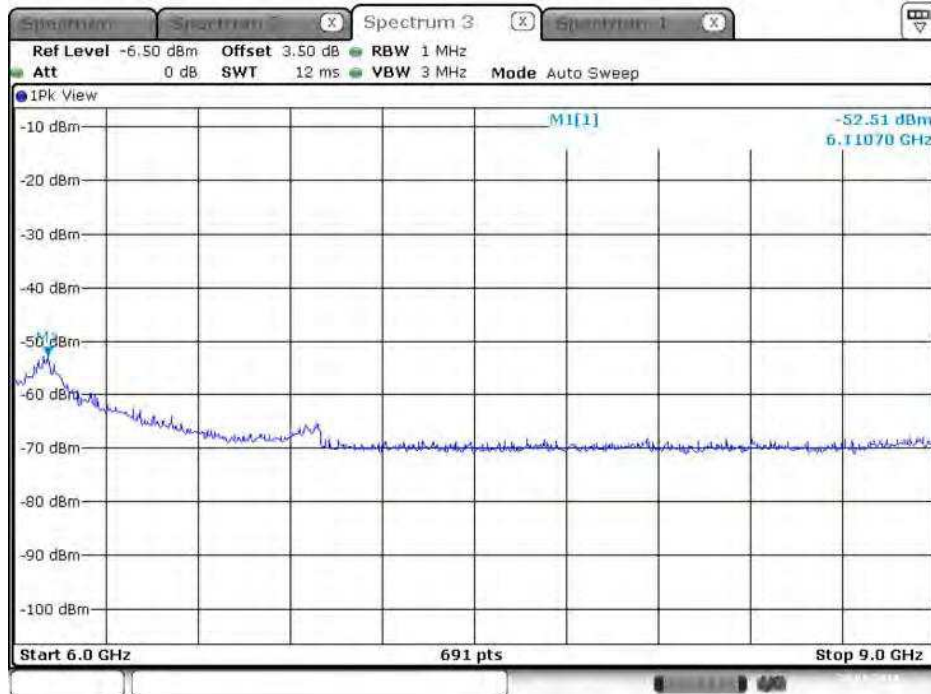


Date: 24.JAN.2018 02:22:57

Plot on Configuration QPSK, 10M / 5715 MHz / Average / Port 1 / 6GHz~9GHz

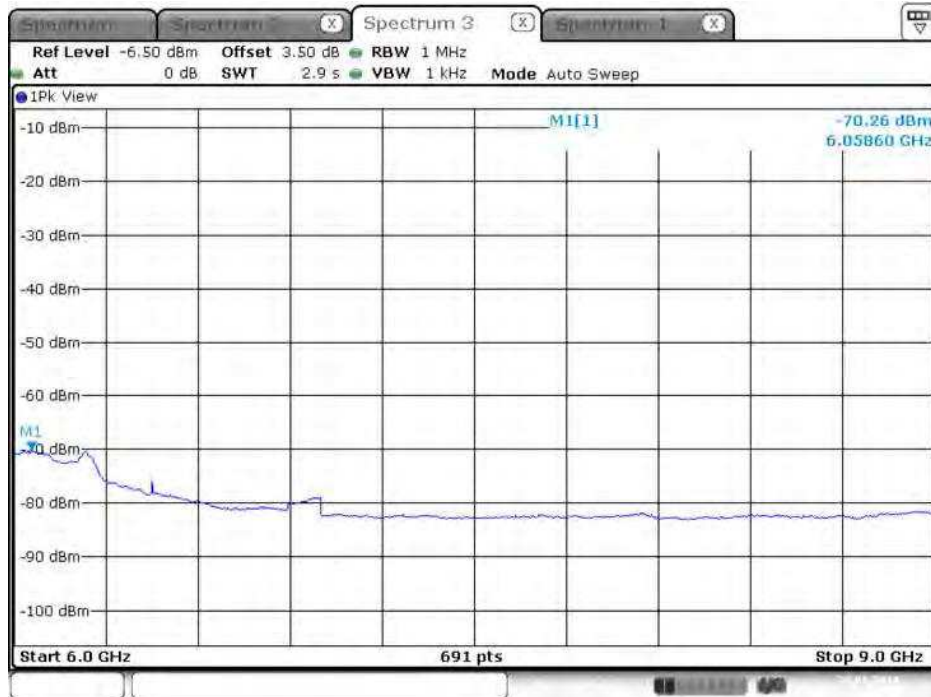


Date: 24.JAN.2018 10:28:25

Plot on Configuration QPSK, 10M / 5715 MHz / Average / Port 2 / 6GHz~9GHz

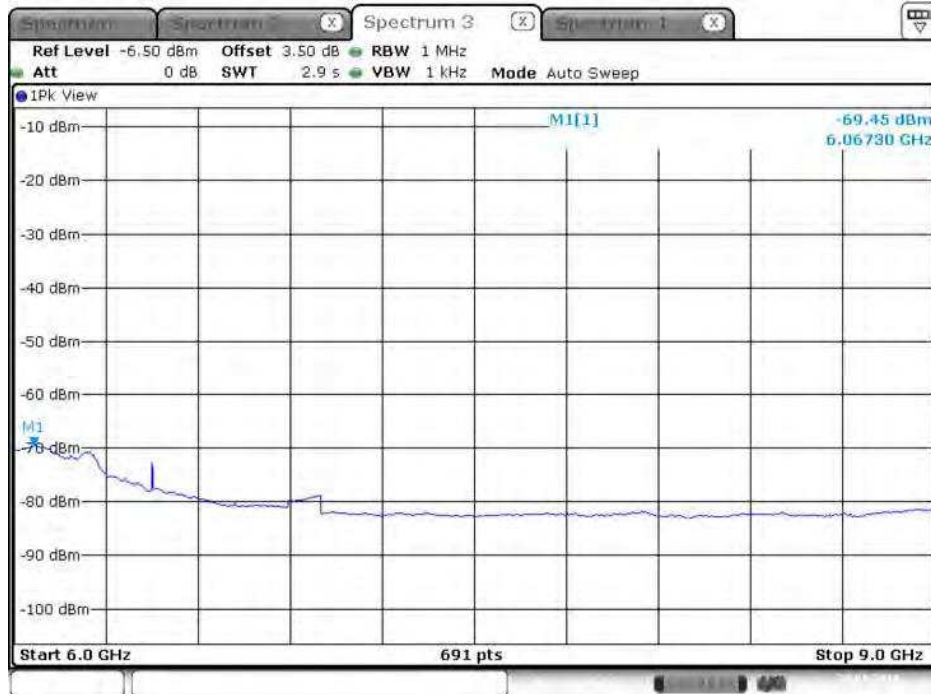


Date: 24.JAN.2018 10:46:59

Plot on Configuration QPSK, 10M / 5715 MHz / Peak / Port 1 / 6GHz~9GHz

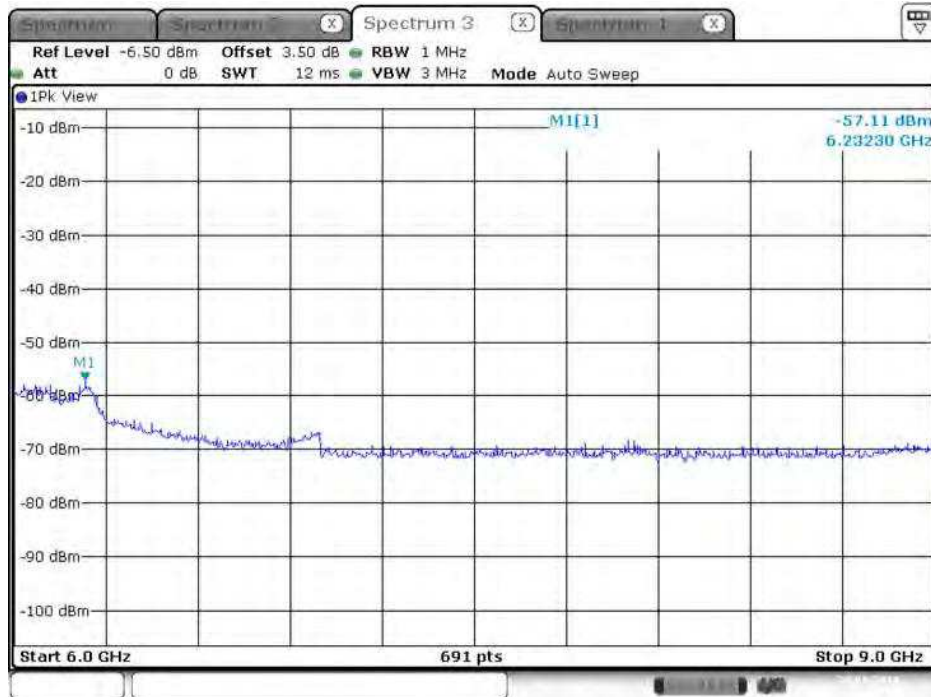

Date: 24.JAN.2018 10:29:30

Plot on Configuration QPSK, 10M / 5715 MHz / Peak / Port 2 / 6GHz~9GHz

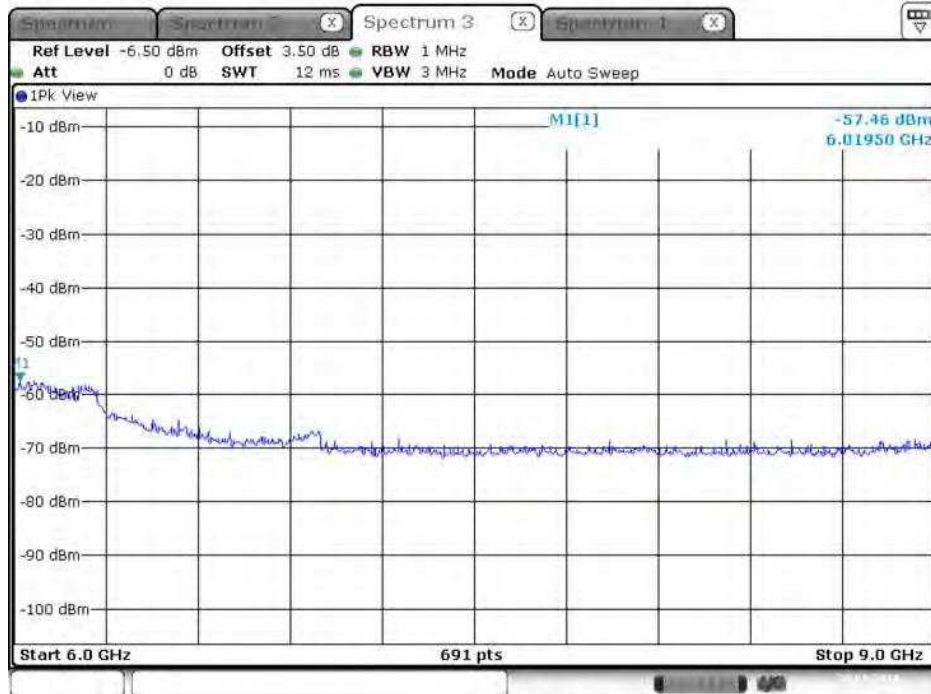


Date: 24.JAN.2018 10:48:21

Plot on Configuration QPSK, 10M / 5725 MHz (Straddle Channel) / Average / Port 1 / 6GHz~9GHz




Date: 24.JAN.2018 02:08:17

Plot on Configuration QPSK, 10M / 5725 MHz (Straddle Channel) / Average / Port 2 / 6GHz~9GHz

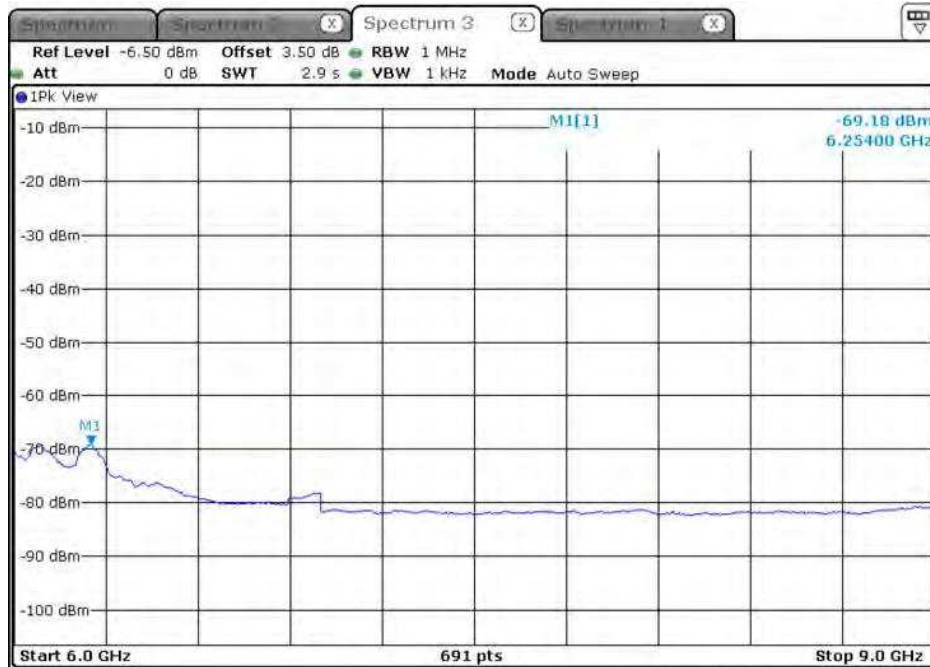


Date: 24.JAN.2018 01:54:07

Plot on Configuration QPSK, 10M / 5725 MHz (Straddle Channel) / Peak / Port 1 / 6GHz~9GHz

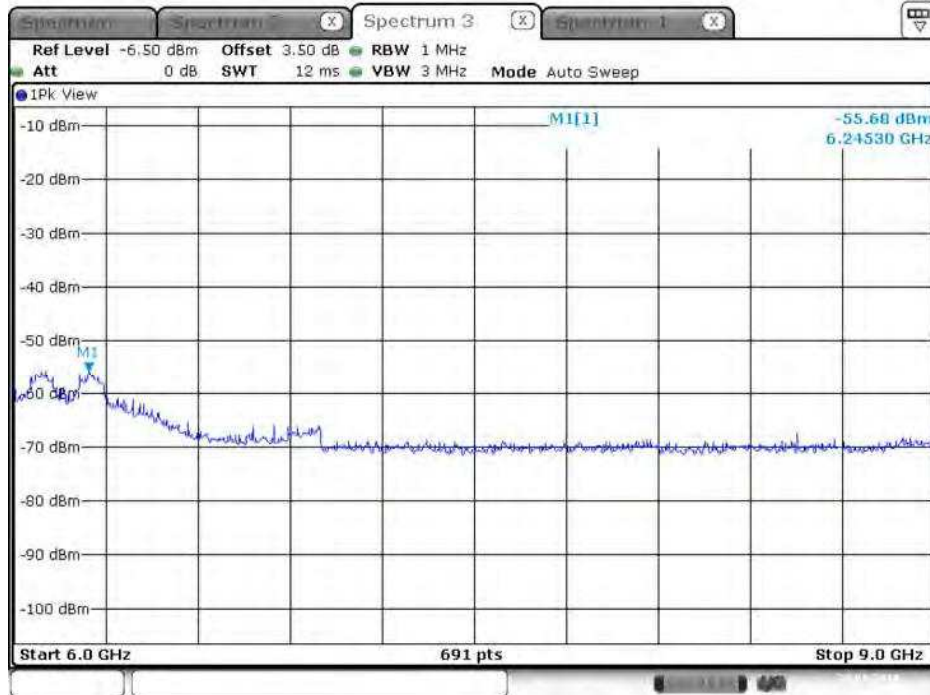


Date: 24.JAN.2018 02:07:55

Plot on Configuration QPSK, 10M / 5725 MHz (Straddle Channel) / Peak / Port 2 / 6GHz~9GHz

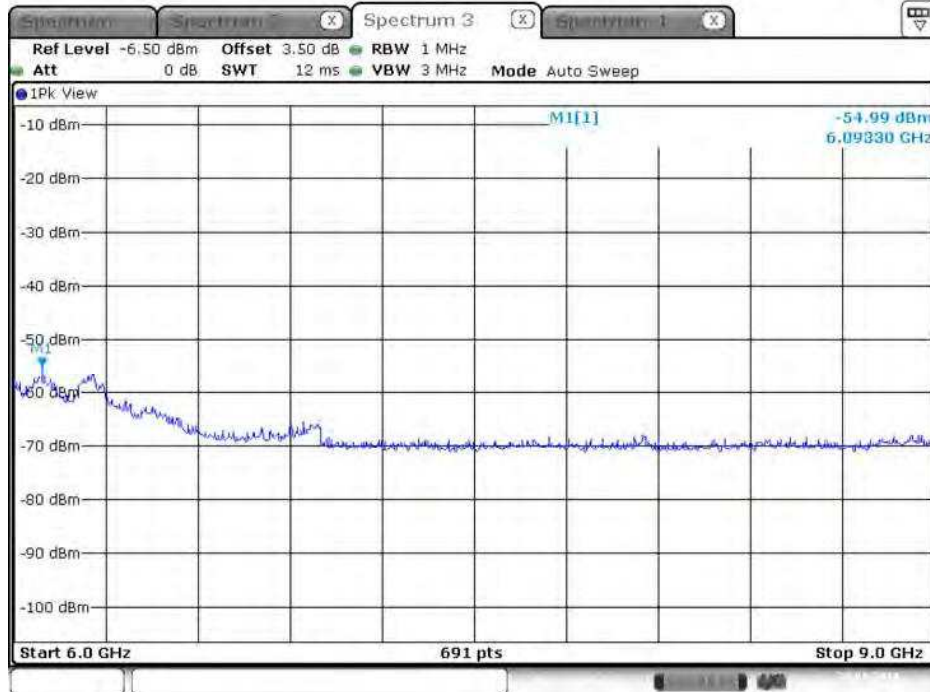

Date: 24.JAN.2018 01:54:31

Plot on Configuration QPSK, 40M / 5495 MHz / Average / Port 1 / 6GHz~9GHz

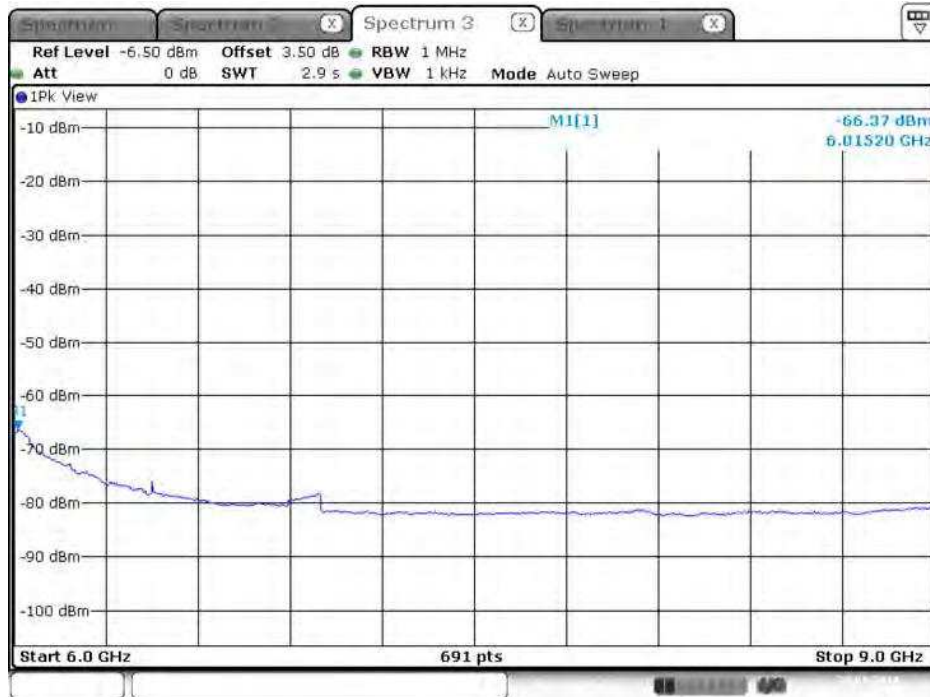


Date: 24.JAN.2018 03:10:33

Plot on Configuration QPSK, 40M / 5495 MHz / Average / Port 2 / 6GHz~9GHz




Date: 24.JAN.2018 03:06:08

Plot on Configuration QPSK, 40M / 5495 MHz / Peak / Port 1 / 6GHz~9GHz

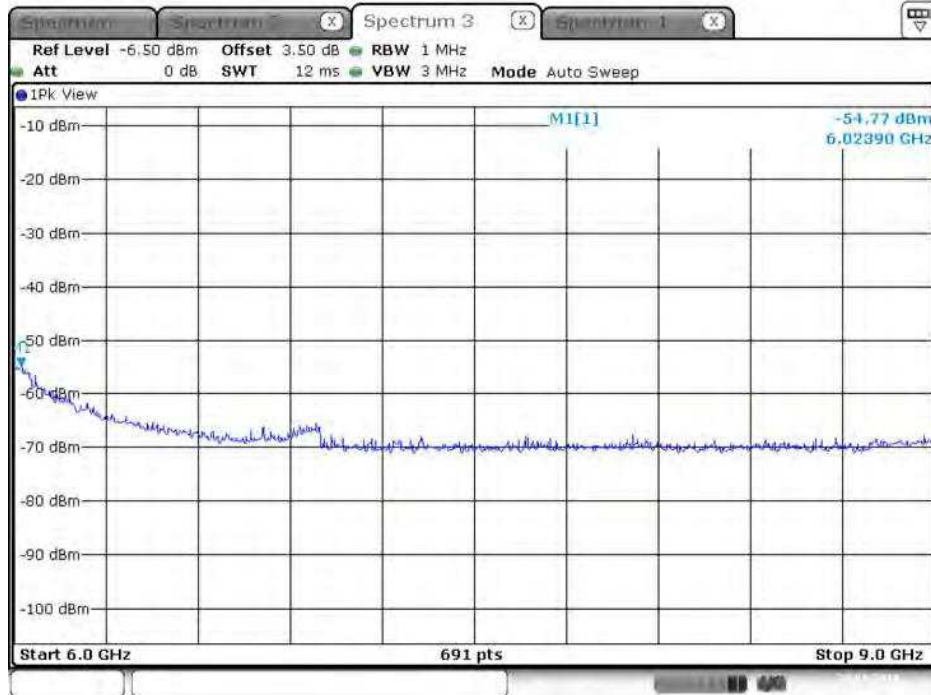

Date: 24.JAN.2018 03:10:17

Plot on Configuration QPSK, 40M / 5495 MHz / Peak / Port 2 / 6GHz~9GHz

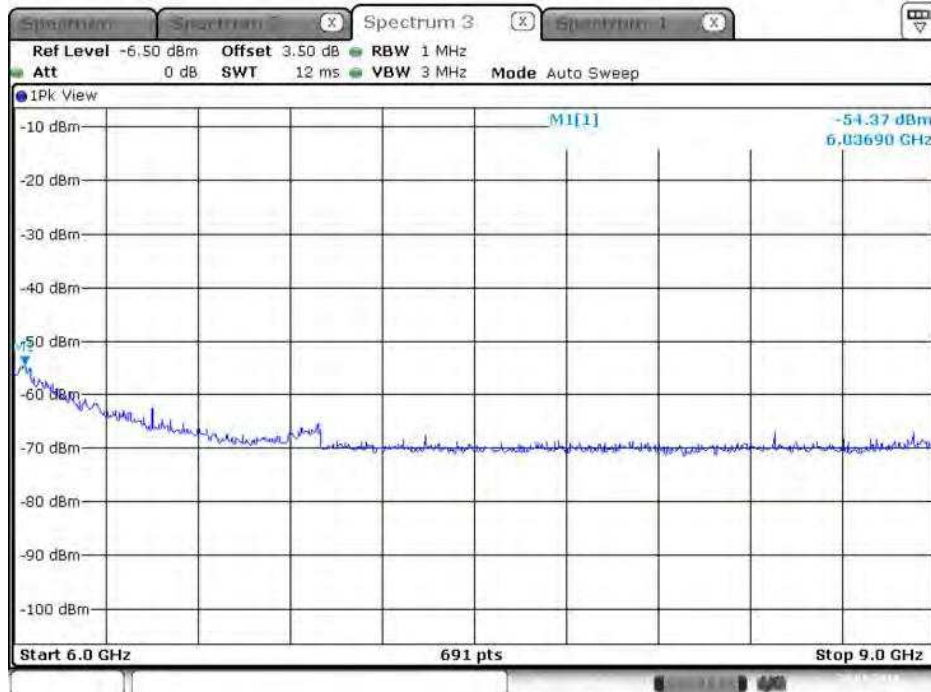

Date: 24.JAN.2018 03:06:28

Plot on Configuration QPSK, 40M / 5550 MHz / Average / Port 1 / 6GHz~9GHz




Date: 24.JAN.2018 03:28:10

Plot on Configuration QPSK, 40M / 5550 MHz / Average / Port 2 / 6GHz~9GHz




Date: 24.JAN.2018 03:35:16

Plot on Configuration QPSK, 40M / 5550 MHz / Peak / Port 1 / 6GHz~9GHz

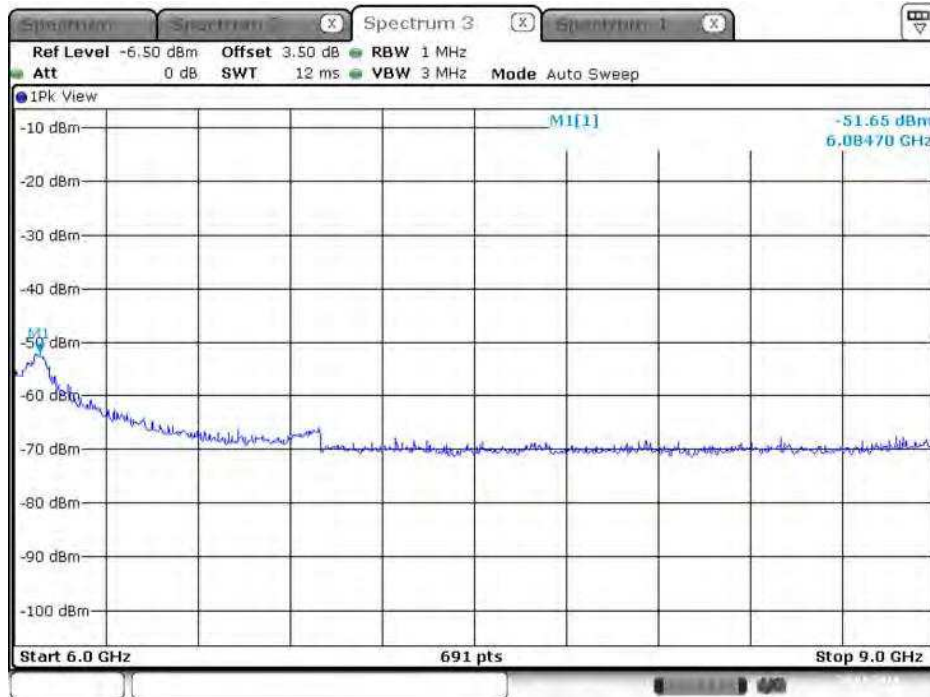


Date: 24.JAN.2018 03:28:46

Plot on Configuration QPSK, 40M / 5550 MHz / Peak / Port 2 / 6GHz~9GHz

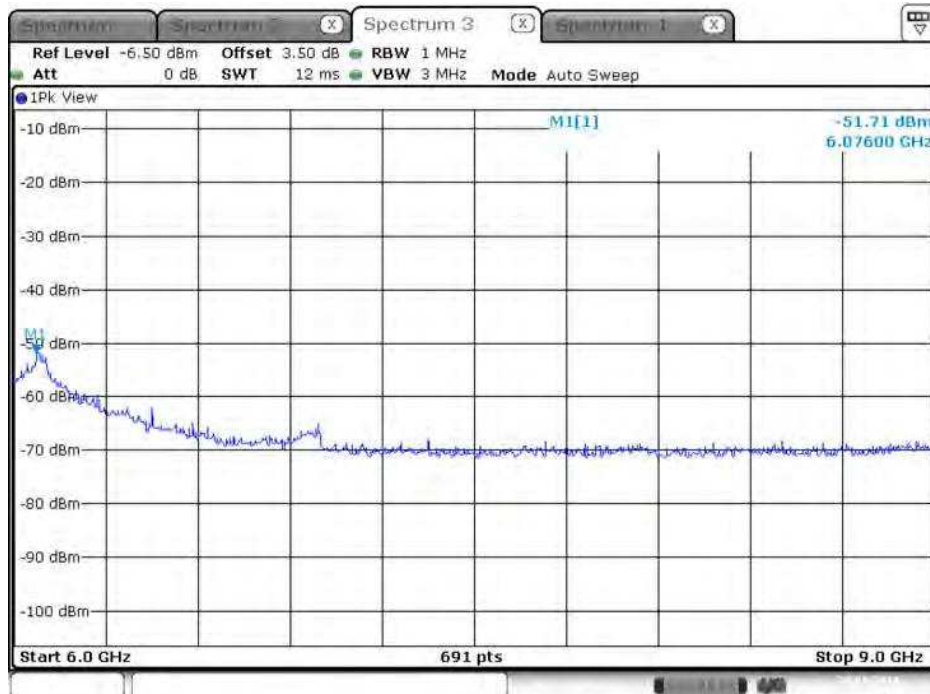


Date: 24.JAN.2018 03:35:01

Plot on Configuration QPSK, 40M / 5700 MHz / Average / Port 1 / 6GHz~9GHz

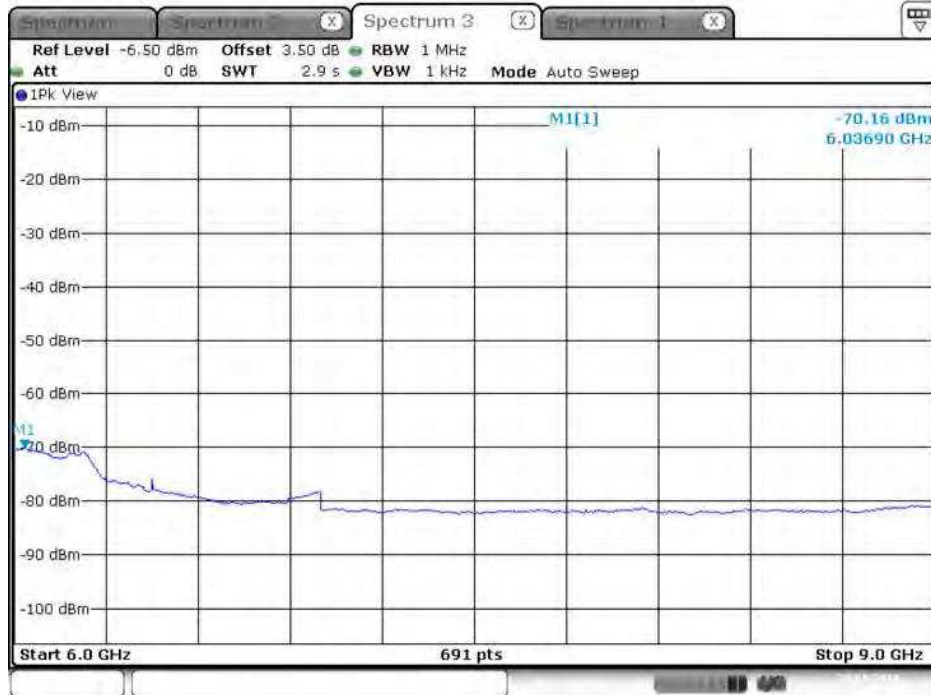


Date: 24.JAN.2018 03:55:18

Plot on Configuration QPSK, 40M / 5700 MHz / Average / Port 2 / 6GHz~9GHz

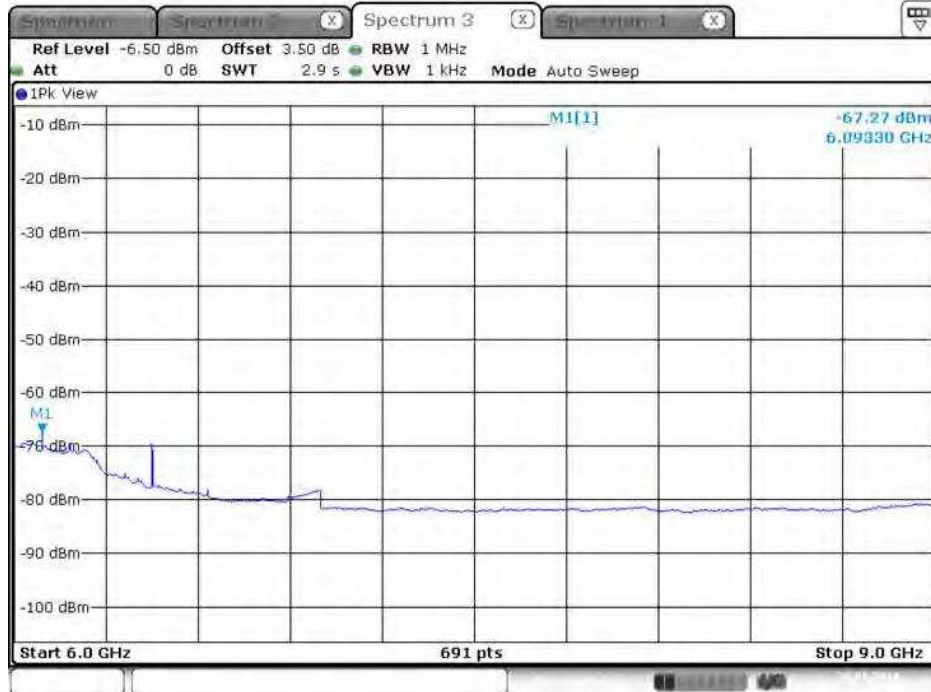


Date: 24.JAN.2018 03:49:54

Plot on Configuration QPSK, 40M / 5700 MHz / Peak / Port 1 / 6GHz~9GHz

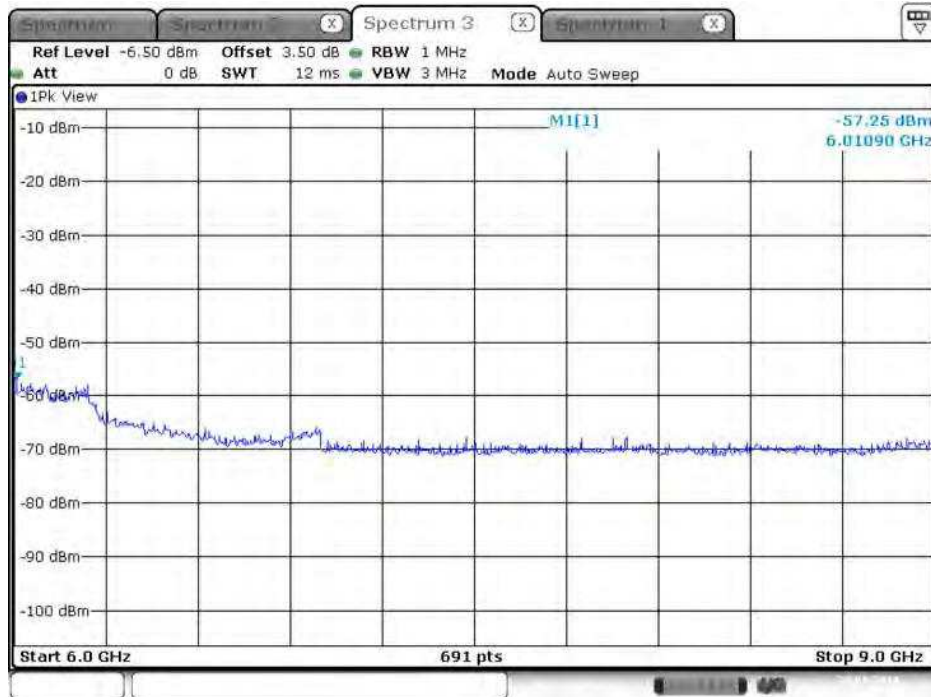

Date: 24.JAN.2018 03:55:02

Plot on Configuration QPSK, 40M / 5700 MHz / Peak / Port 2 / 6GHz~9GHz

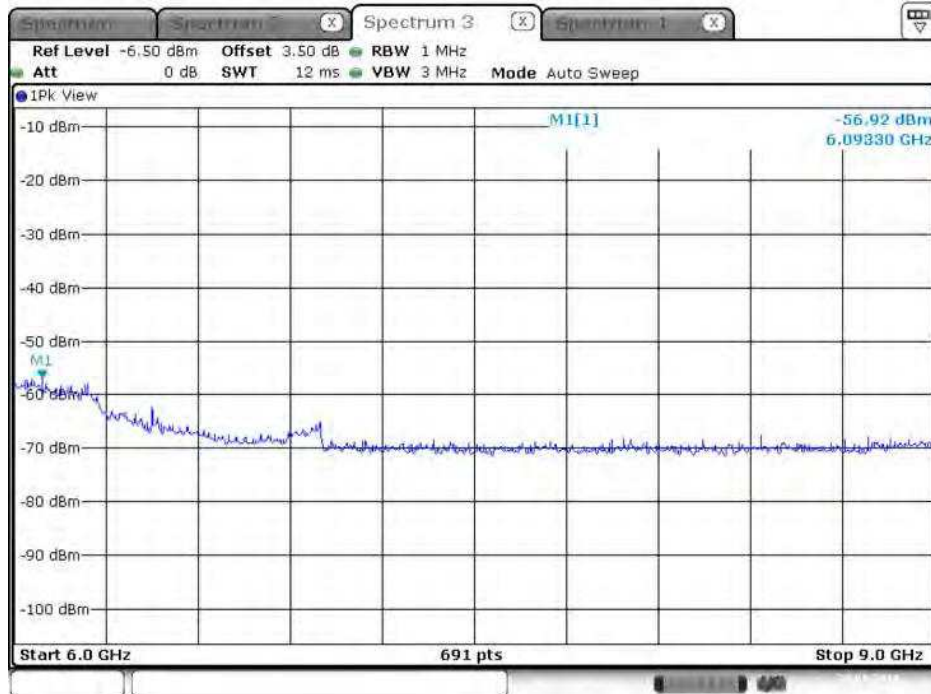


Date: 24.JAN.2018 03:50:10

Plot on Configuration QPSK, 40M / 5720 MHz (Straddle Channel) / Average / Port 1 / 6GHz~9GHz




Date: 24.JAN.2018 01:39:04

Plot on Configuration QPSK, 40M / 5720 MHz (Straddle Channel) / Average / Port 2 / 6GHz~9GHz

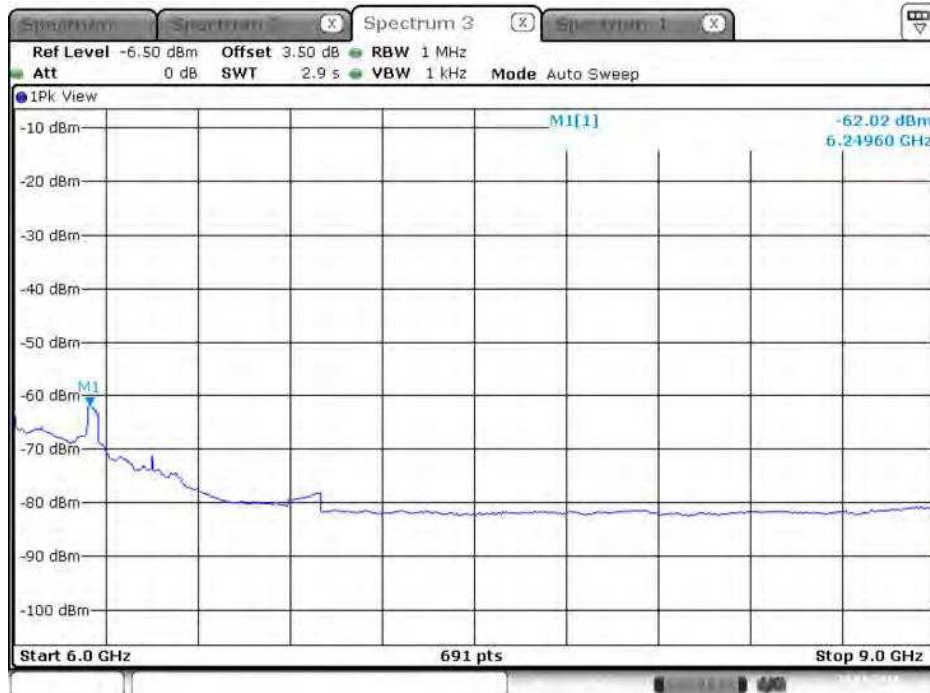


Date: 24.JAN.2018 01:49:31

Plot on Configuration QPSK, 40M / 5720 MHz (Straddle Channel) / Peak / Port 1 / 6GHz~9GHz

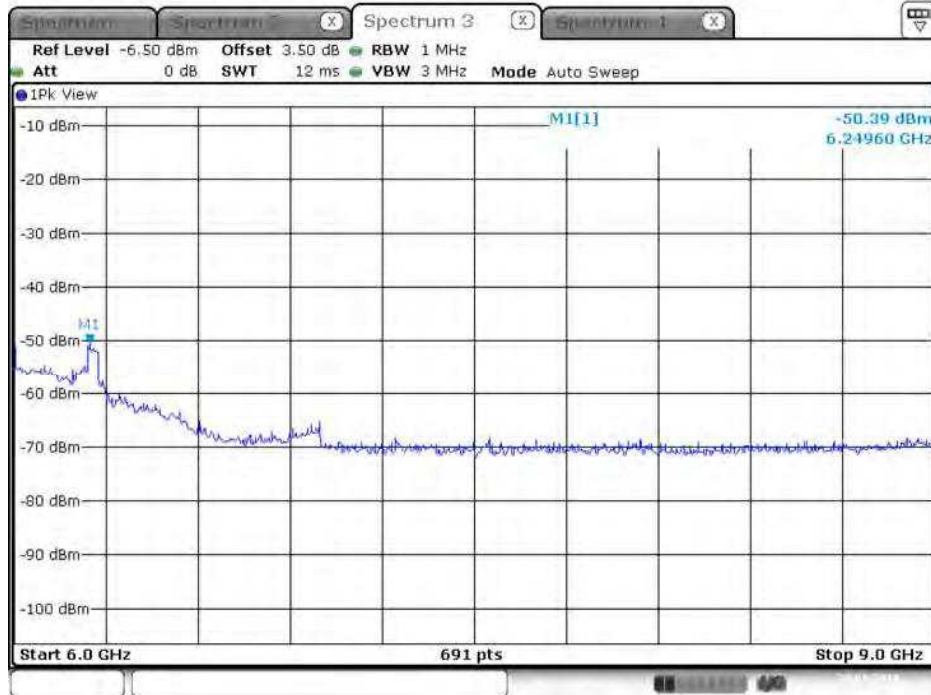


Date: 24.JAN.2018 01:39:17

Plot on Configuration QPSK, 40M / 5720 MHz (Straddle Channel) / Peak / Port 2 / 6GHz~9GHz

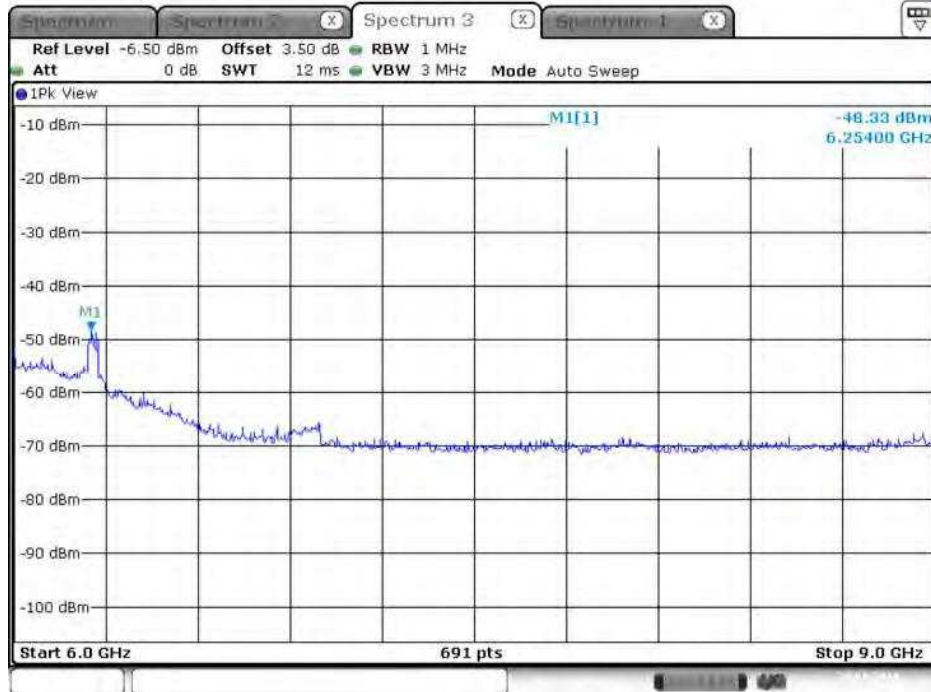


Date: 24.JAN.2018 01:49:16


Plot on Configuration QPSK, 10M / 5480 MHz / Average / Port 1 / 9GHz~18GHz

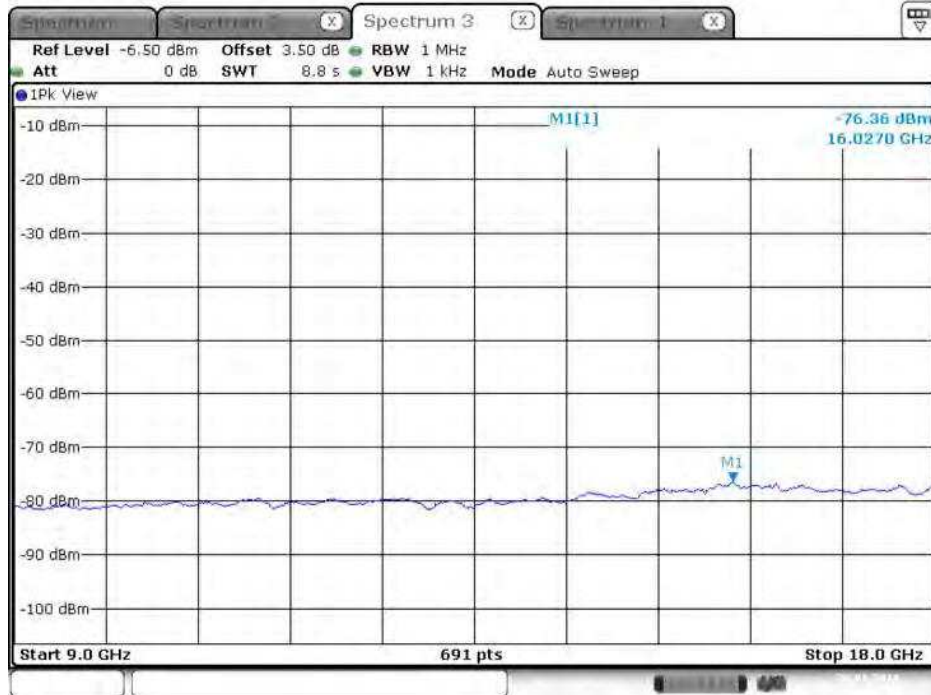

Plot on Configuration QPSK, 10M / 5480 MHz / Average / Port 2 / 9GHz~18GHz

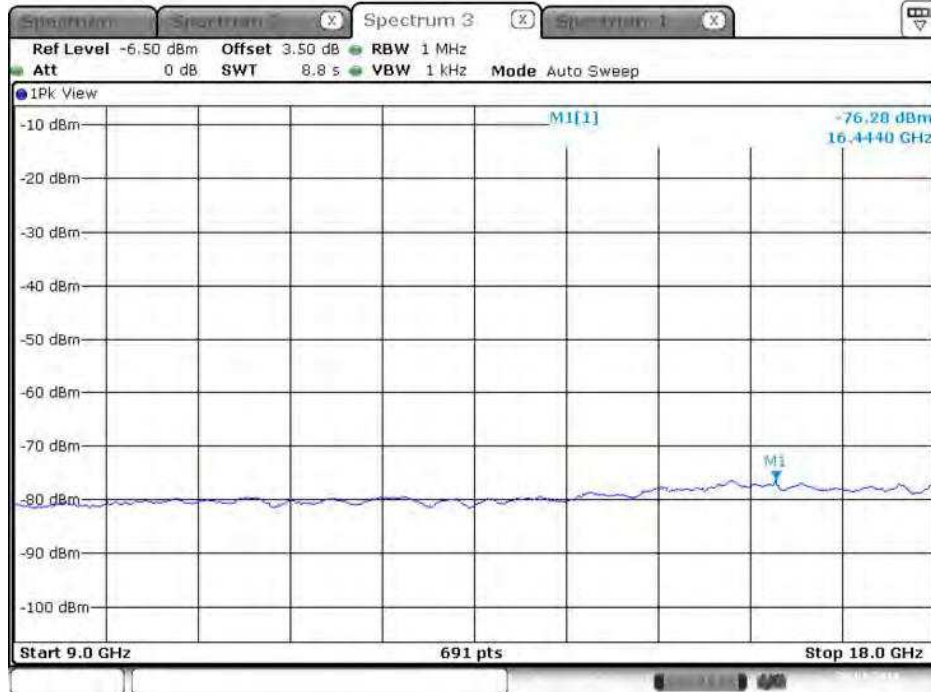


Plot on Configuration QPSK, 10M / 5480 MHz / Peak / Port 1 / 9GHz~18GHz

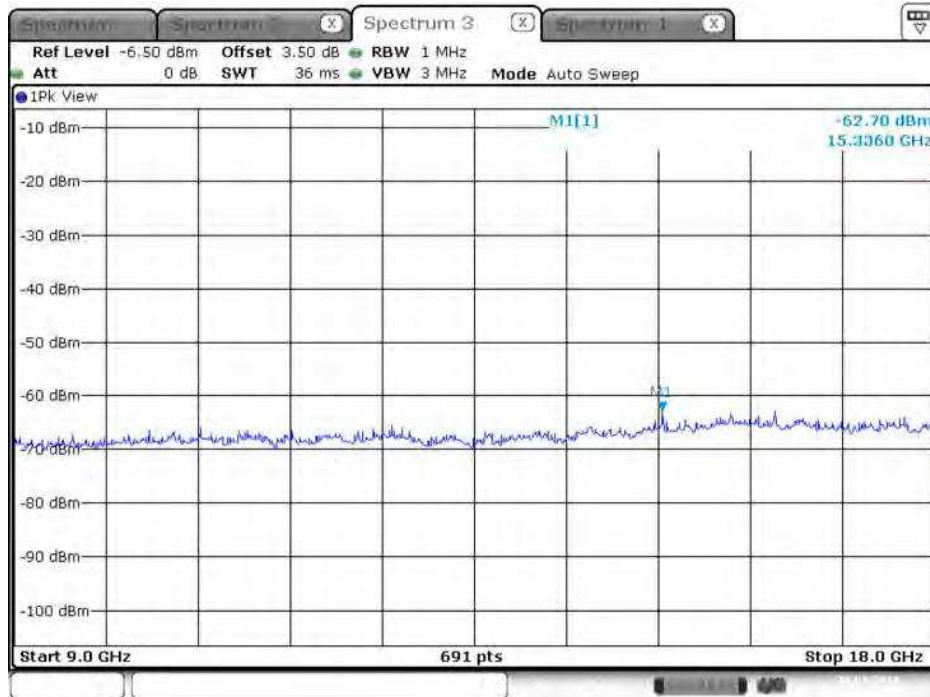


Date: 24.JAN.2018 04:03:56

Plot on Configuration QPSK, 10M / 5480 MHz / Peak / Port 2 / 9GHz~18GHz

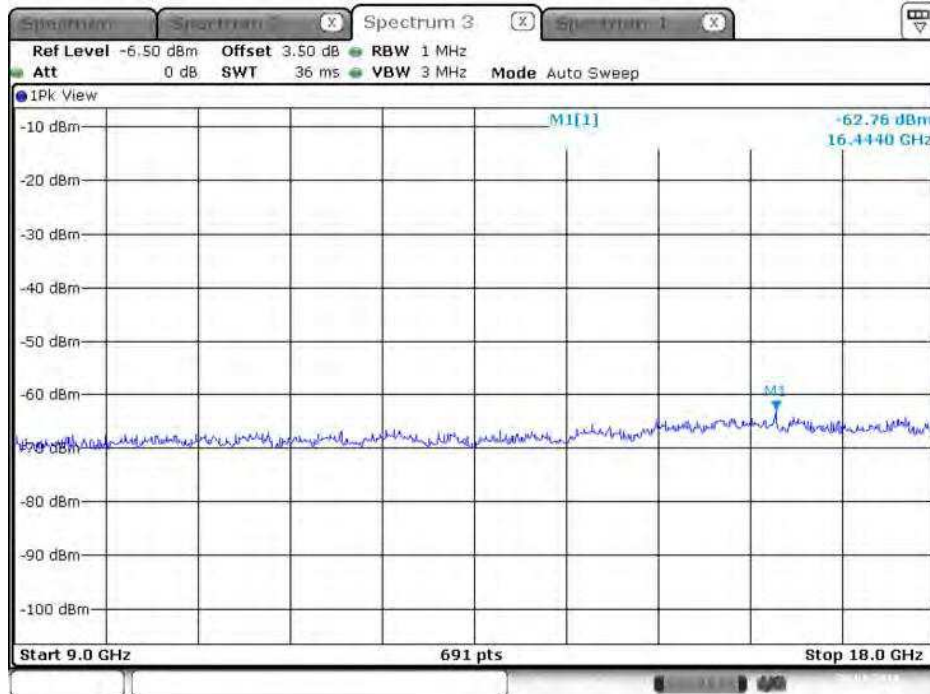


Date: 24.JAN.2018 04:07:24

Plot on Configuration QPSK, 10M / 5575 MHz / Average / Port 1 / 9GHz~18GHz

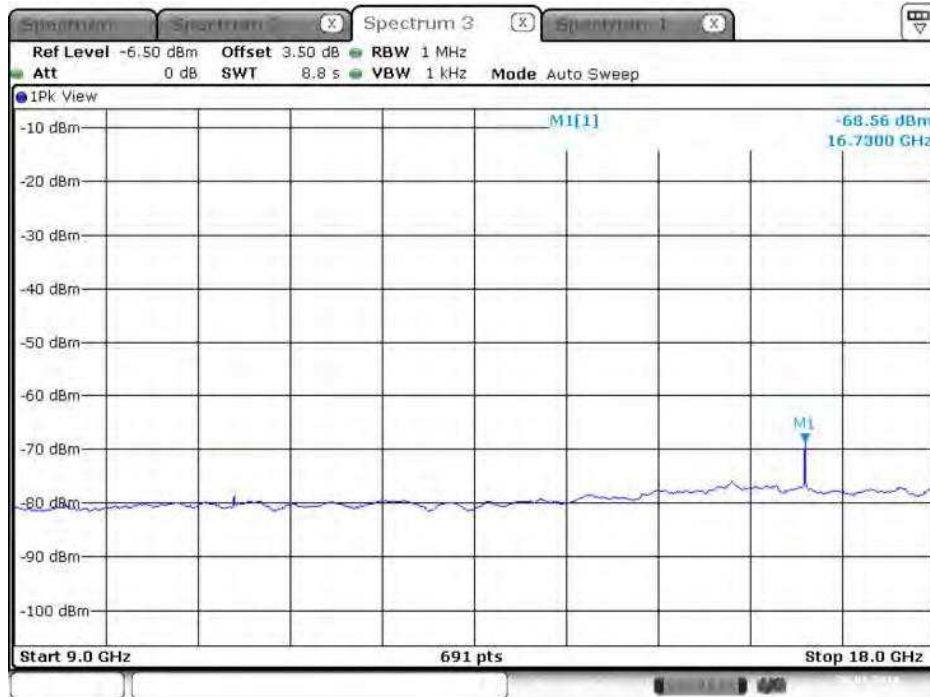


Date: 24 JAN 2018 04:10:54

Plot on Configuration QPSK, 10M / 5575 MHz / Average / Port 2 / 9GHz~18GHz

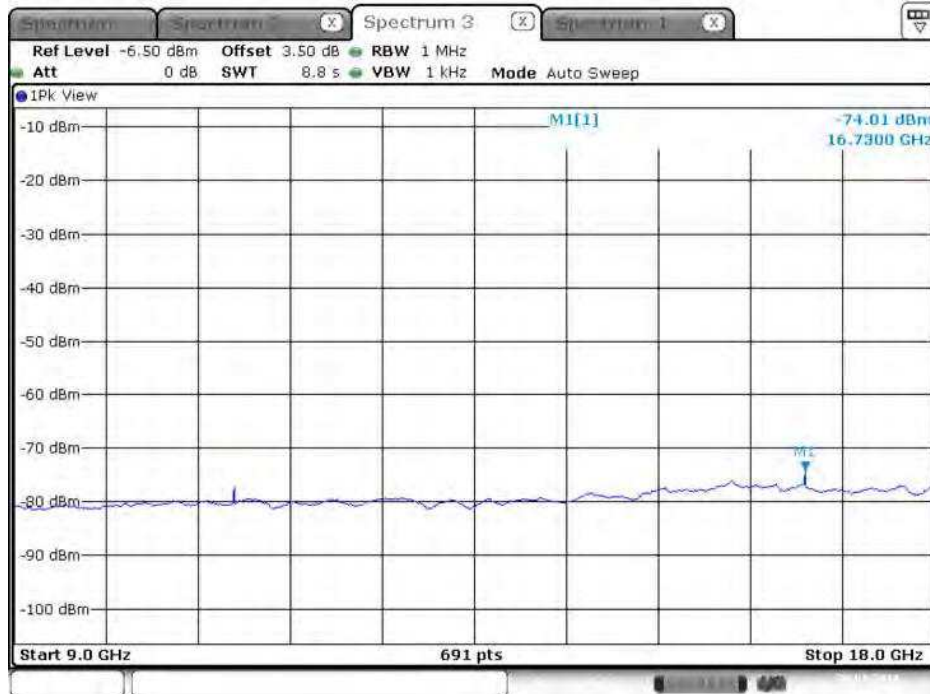


Date: 24 JAN 2018 04:09:39


Plot on Configuration QPSK, 10M / 5575 MHz / Peak / Port 1 / 9GHz~18GHz

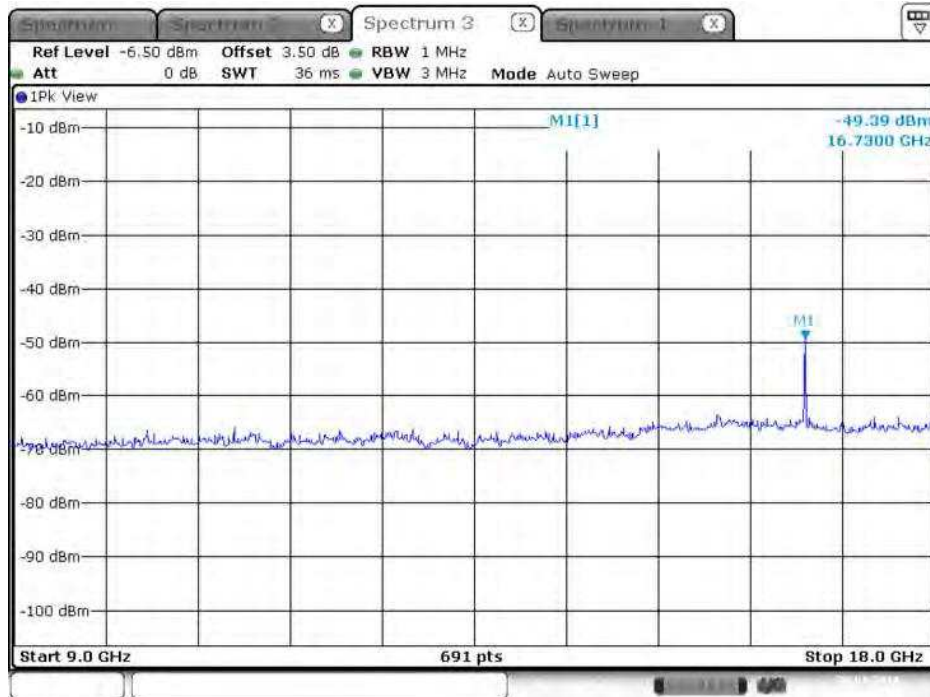

Plot on Configuration QPSK, 10M / 5575 MHz / Peak / Port 2 / 9GHz~18GHz

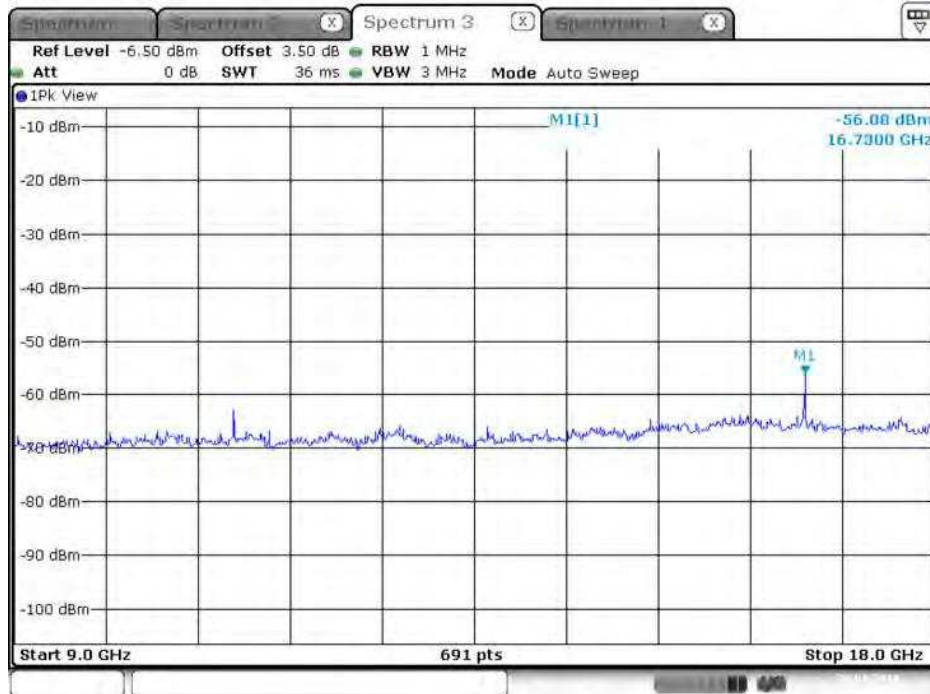


Plot on Configuration QPSK, 10M / 5715 MHz / Average / Port 1 / 9GHz~18GHz

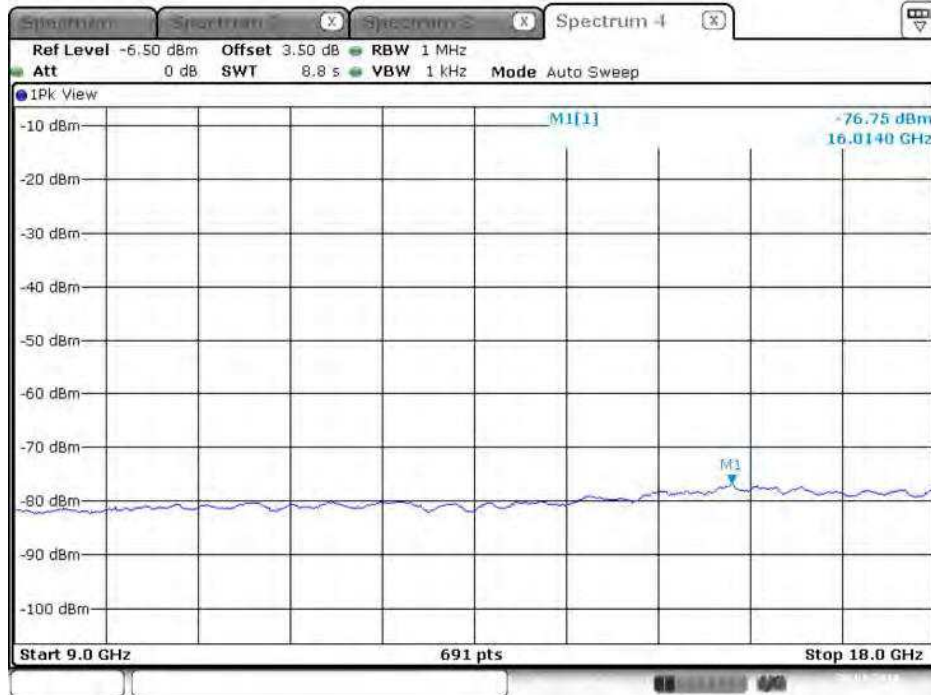


Date: 24.JAN.2018 10:32:40

Plot on Configuration QPSK, 10M / 5715 MHz / Average / Port 2 / 9GHz~18GHz

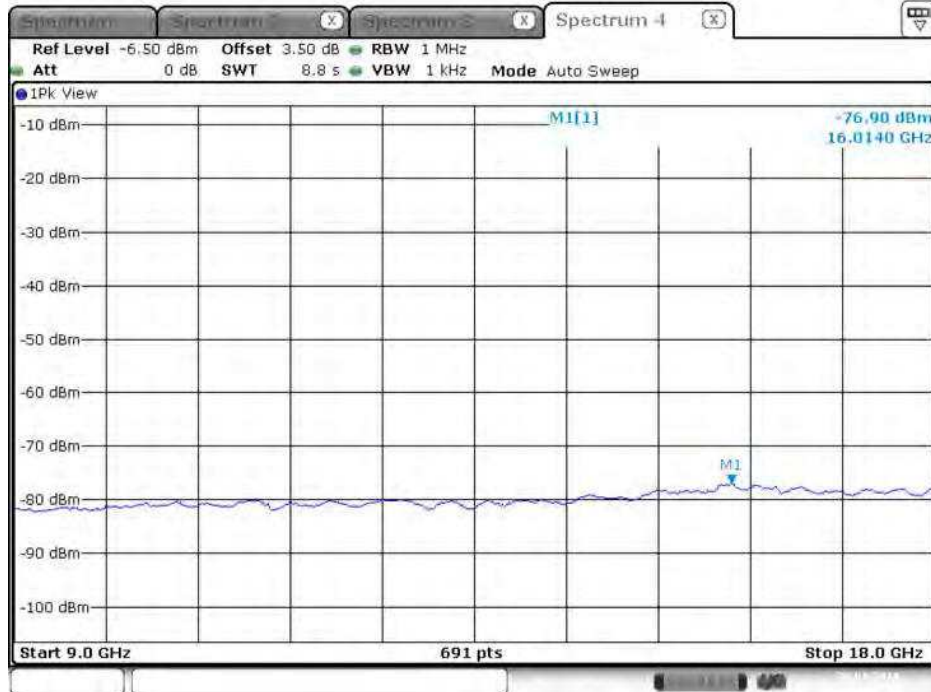


Date: 24.JAN.2018 10:41:38

Plot on Configuration QPSK, 10M / 5715 MHz / Peak / Port 1 / 9GHz~18GHz

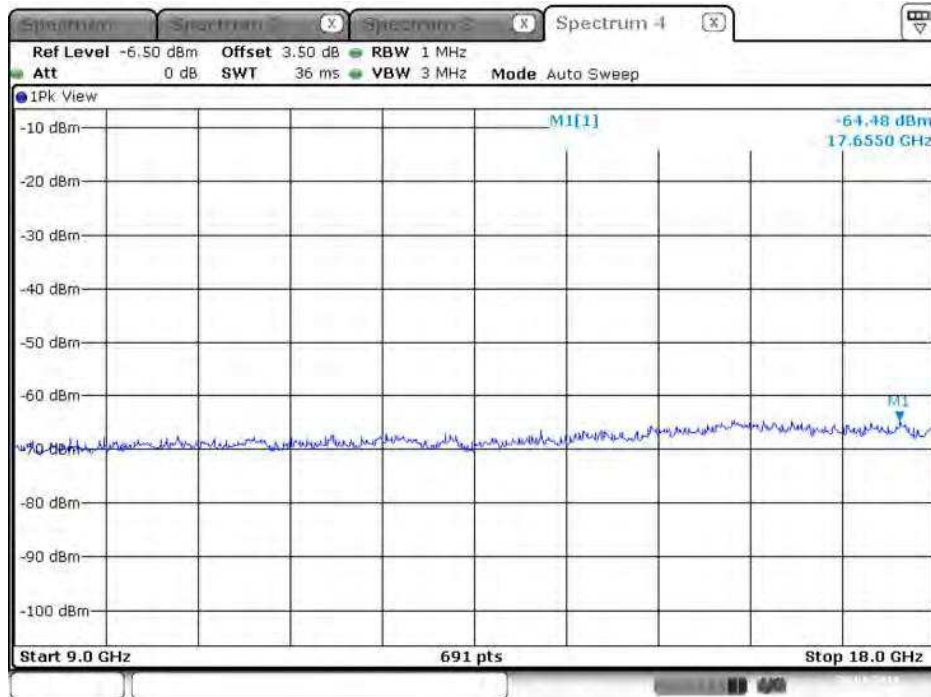


Date: 24.JAN.2018 10:34:05

Plot on Configuration QPSK, 10M / 5715 MHz / Peak / Port 2 / 9GHz~18GHz

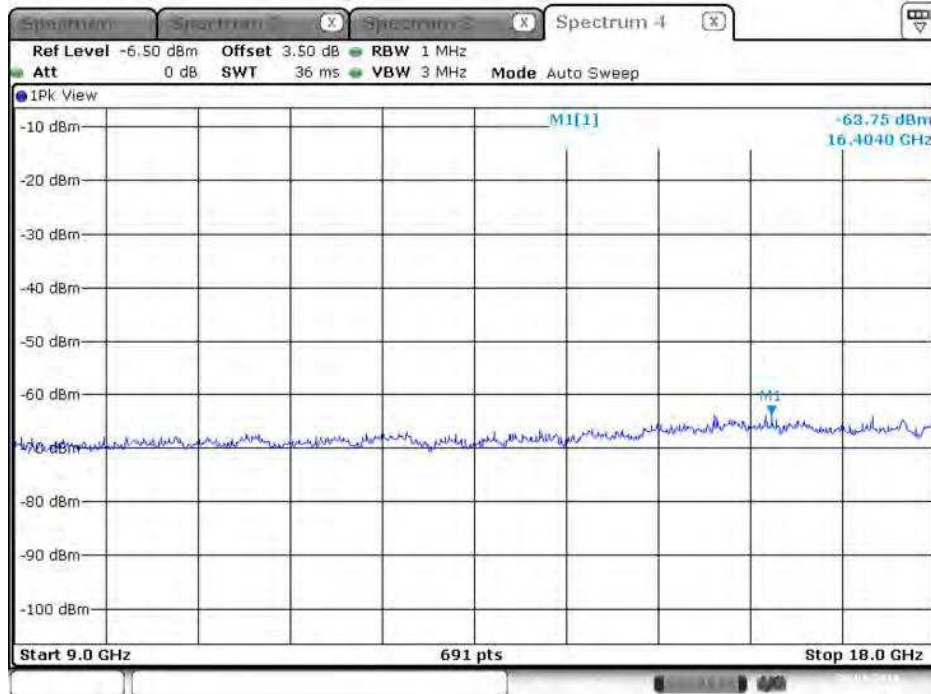


Date: 24.JAN.2018 10:43:10

Plot on Configuration QPSK, 10M / 5725 MHz (Straddle Channel) / Average / Port 1 / 9GHz~18GHz

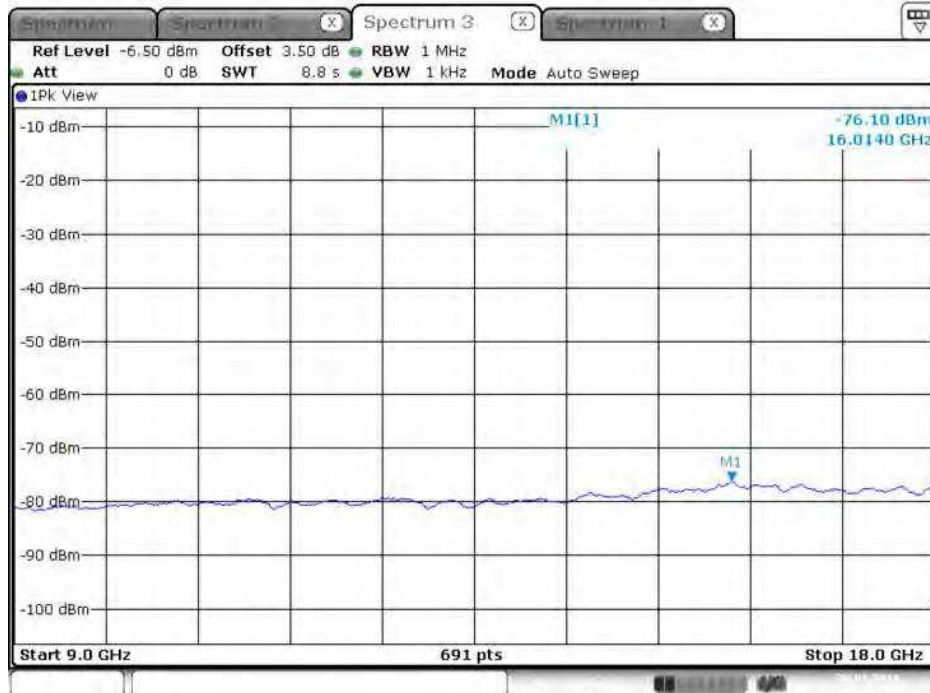


Date: 24.JAN.2018 04:33:02

Plot on Configuration QPSK, 10M / 5725 MHz (Straddle Channel) / Average / Port 2 / 9GHz~18GHz

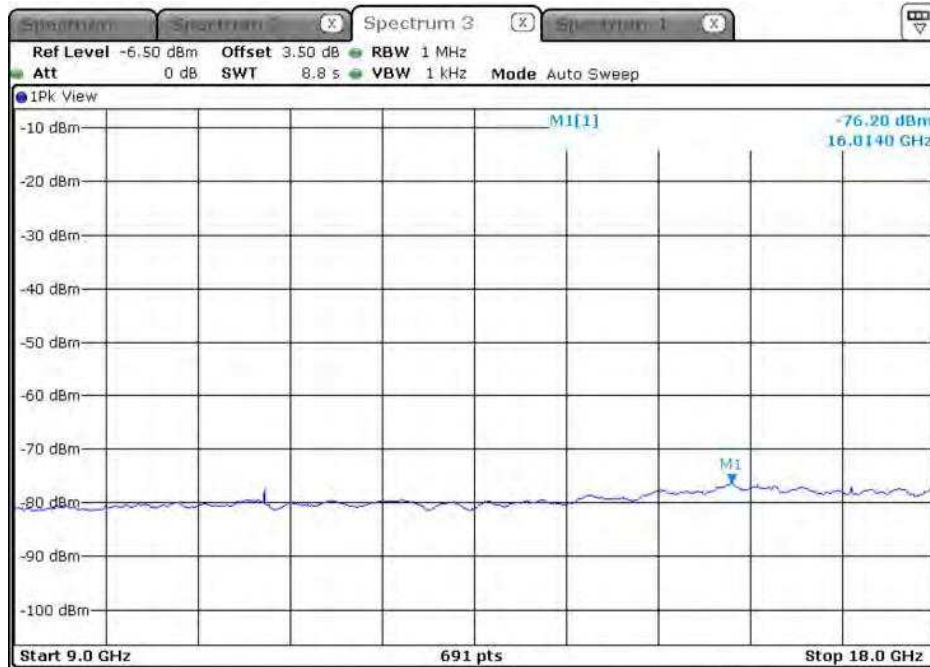


Date: 24.JAN.2018 04:33:40

Plot on Configuration QPSK, 10M / 5725 MHz (Straddle Channel) / Peak / Port 1 / 9GHz~18GHz

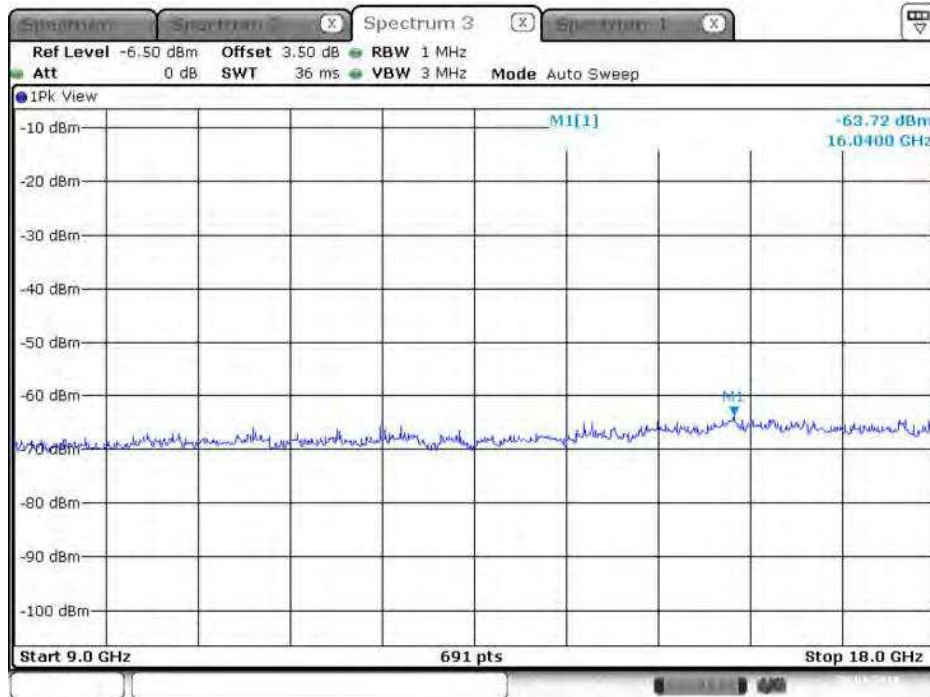


Date: 24.JAN.2018 04:32:37

Plot on Configuration QPSK, 10M / 5725 MHz (Straddle Channel) / Peak / Port 2 / 9GHz~18GHz

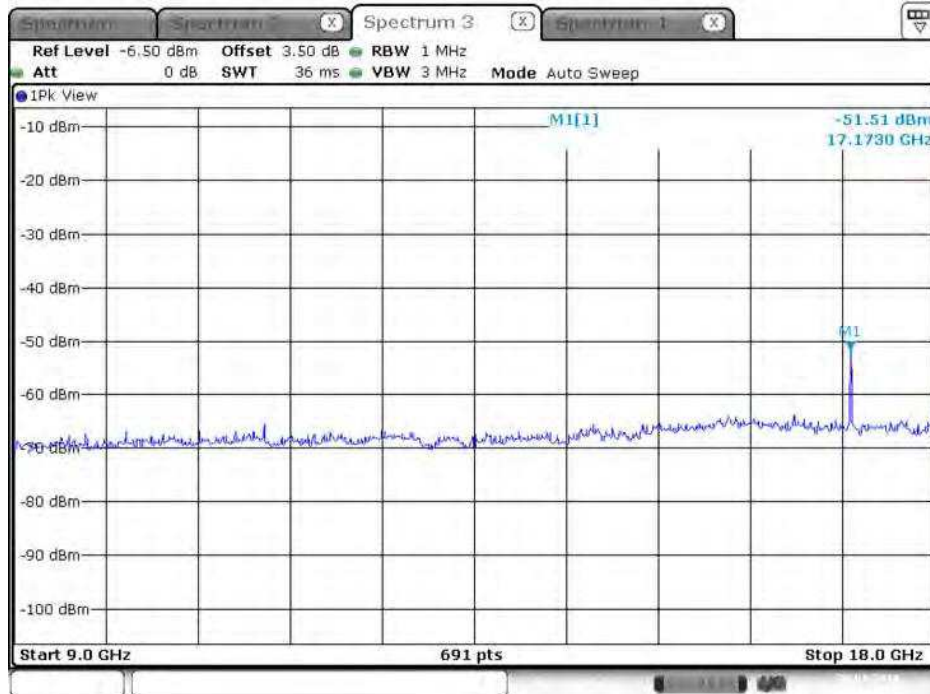


Date: 24.JAN.2018 04:33:53


Plot on Configuration QPSK, 40M / 5495 MHz / Average / Port 1 / 9GHz~18GHz

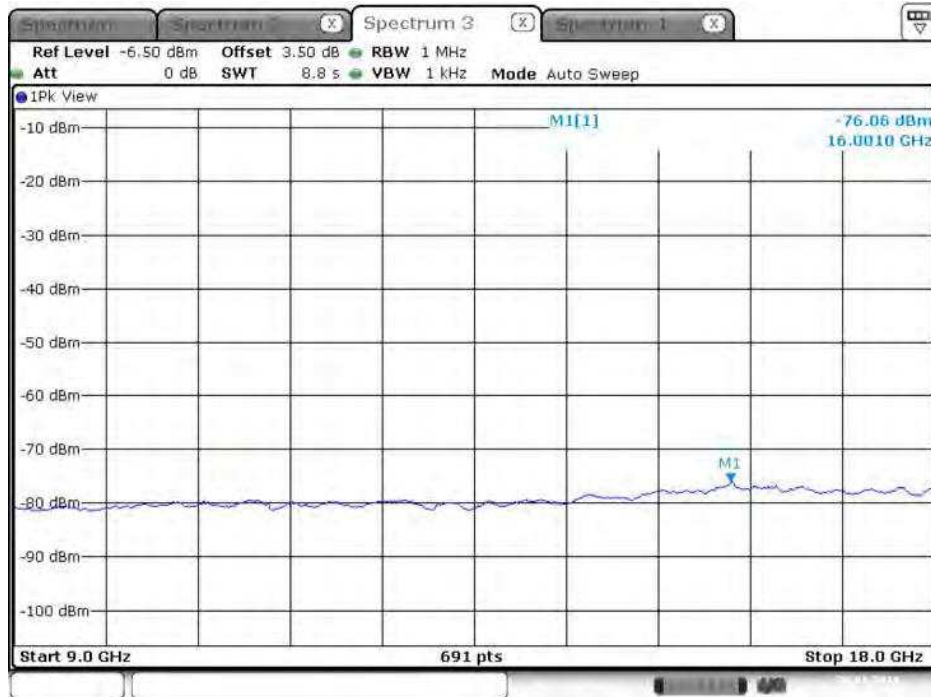

Plot on Configuration QPSK, 40M / 5495 MHz / Average / Port 2 / 9GHz~18GHz

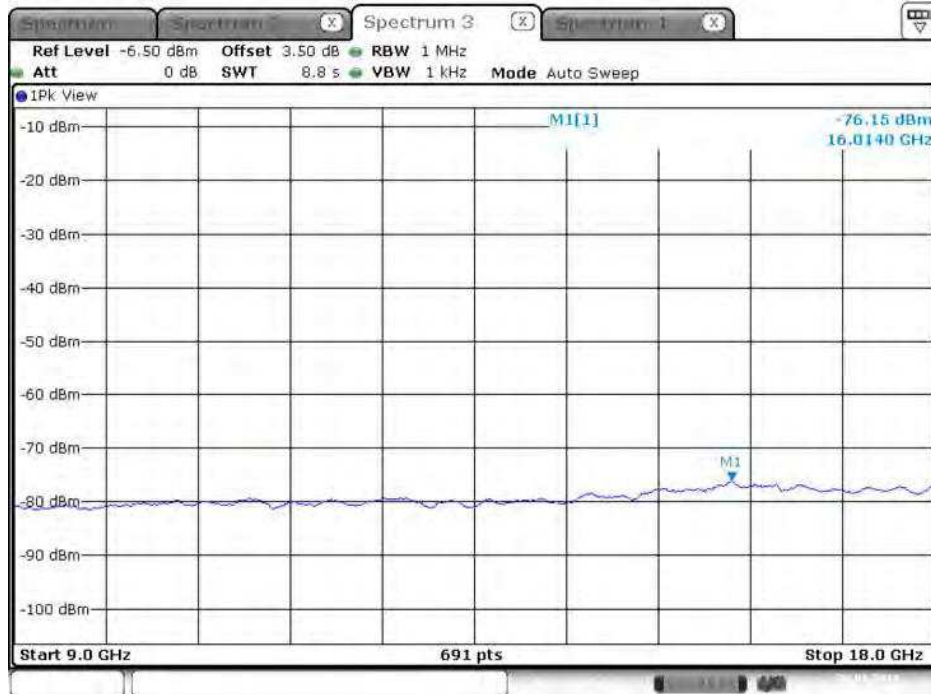


Plot on Configuration QPSK, 40M / 5495 MHz / Peak / Port 1 / 9GHz~18GHz

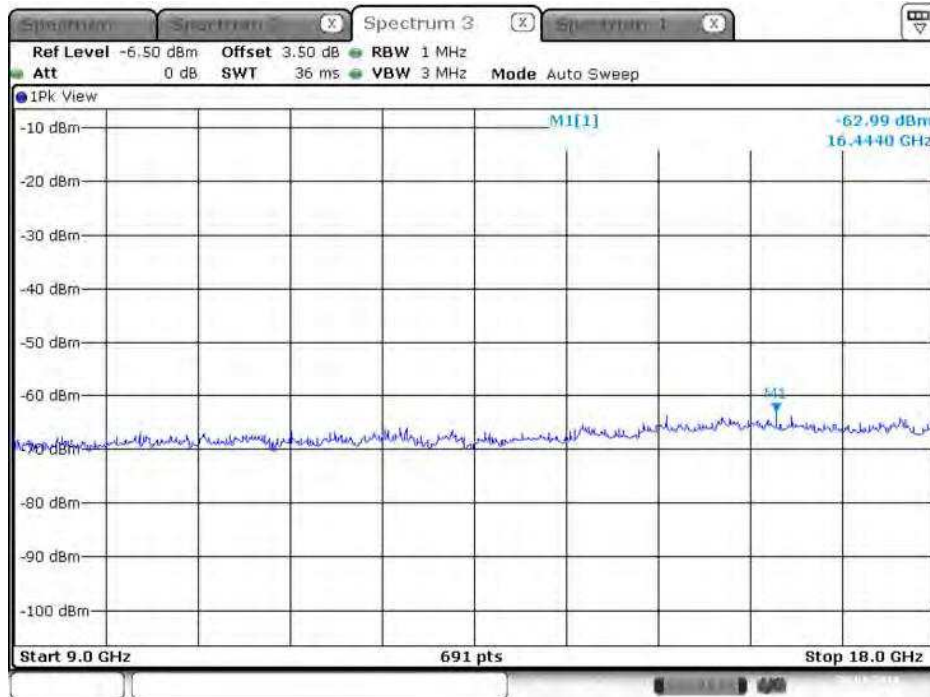


Date: 24.JAN.2018 04:15:40

Plot on Configuration QPSK, 40M / 5495 MHz / Peak / Port 2 / 9GHz~18GHz

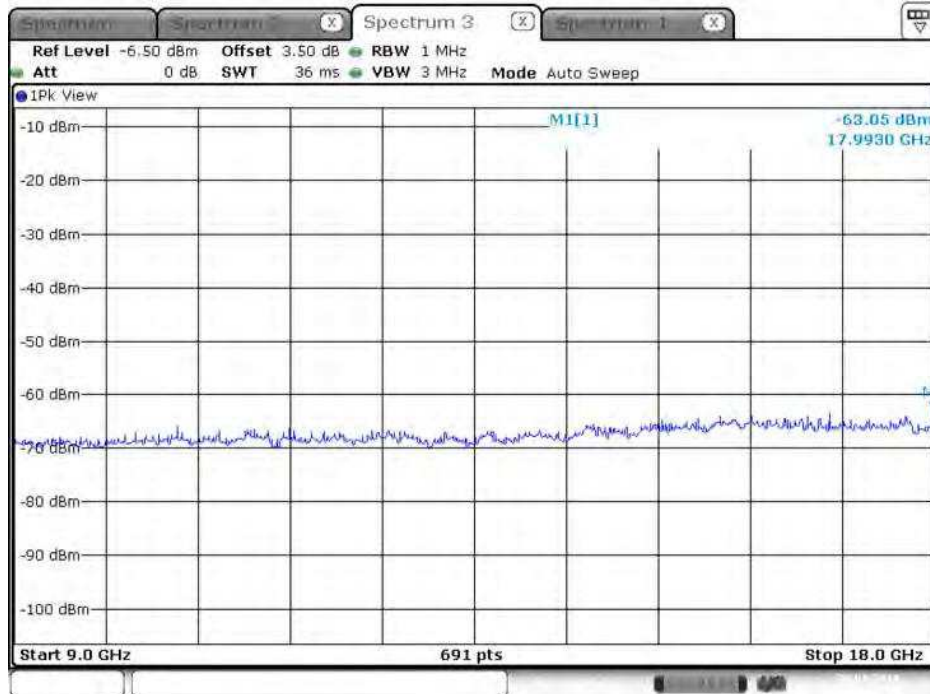


Date: 24.JAN.2018 04:18:19


Plot on Configuration QPSK, 40M / 5550 MHz / Average / Port 1 / 9GHz~18GHz

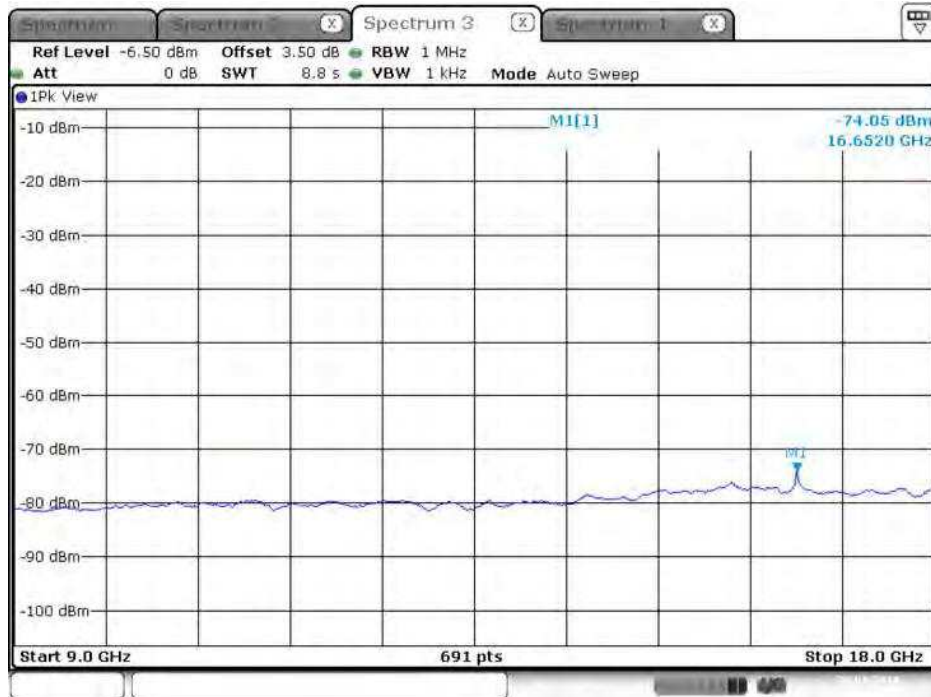

Plot on Configuration QPSK, 40M / 5550 MHz / Average / Port 2 / 9GHz~18GHz

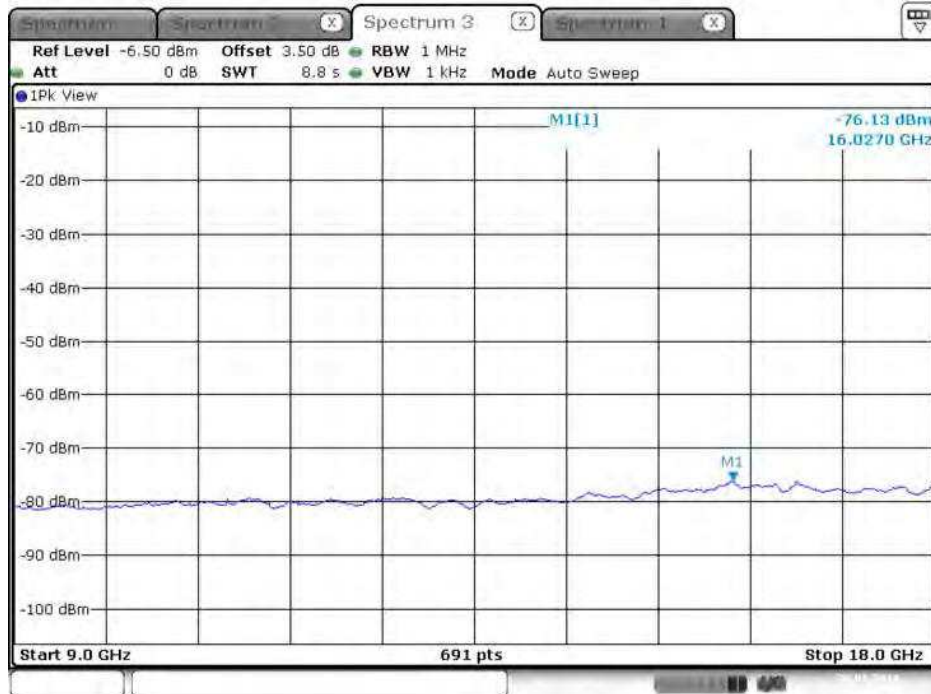


Plot on Configuration QPSK, 40M / 5550 MHz / Peak / Port 1 / 9GHz~18GHz

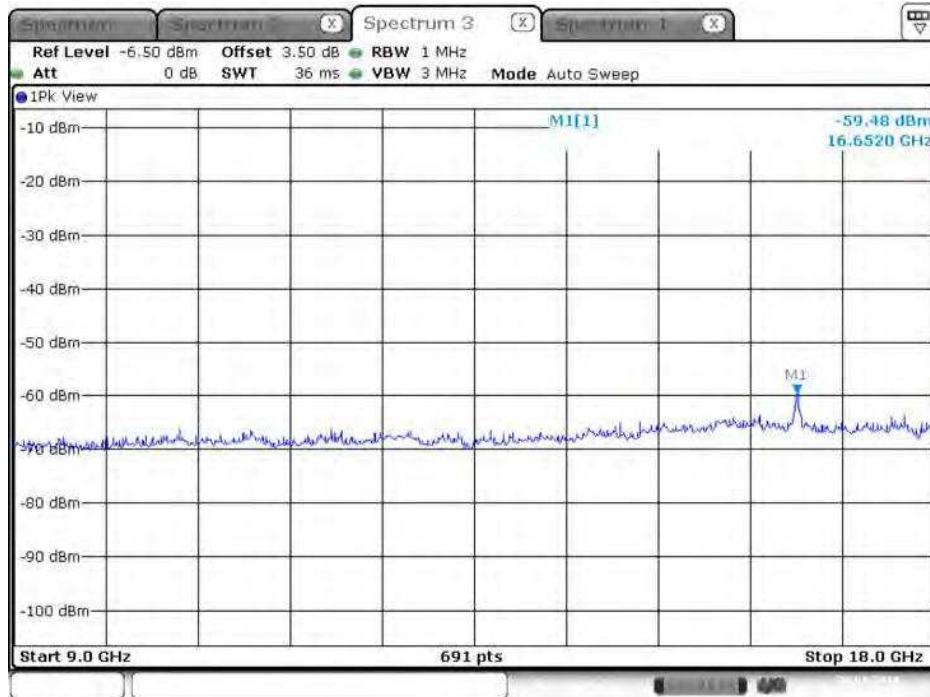


Date: 24.JAN.2018 04:22:14

Plot on Configuration QPSK, 40M / 5550 MHz / Peak / Port 2 / 9GHz~18GHz

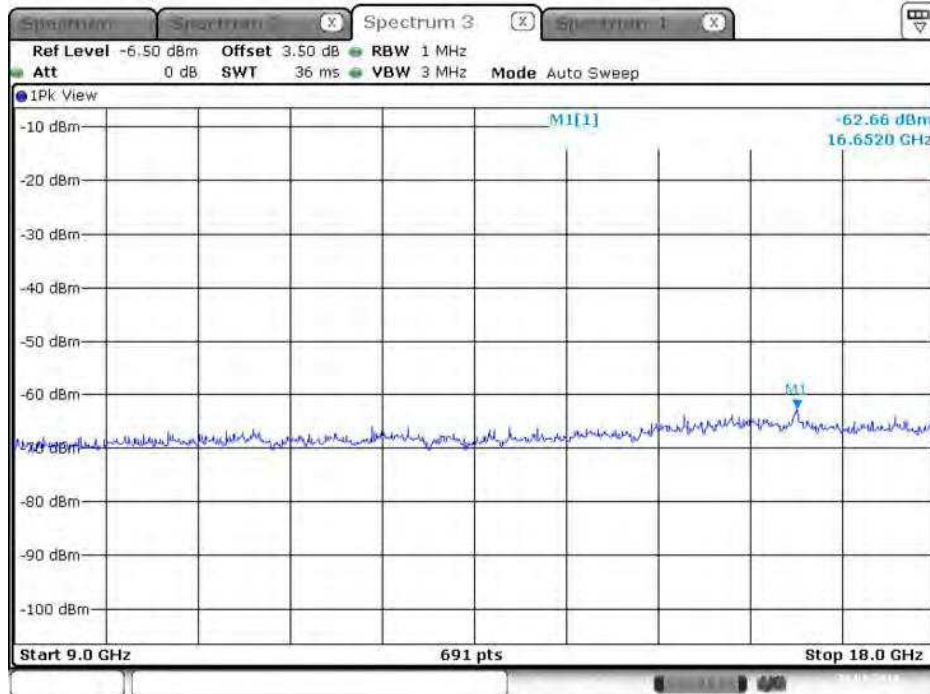


Date: 24.JAN.2018 04:20:06

Plot on Configuration QPSK, 40M / 5700 MHz / Average / Port 1 / 9GHz~18GHz

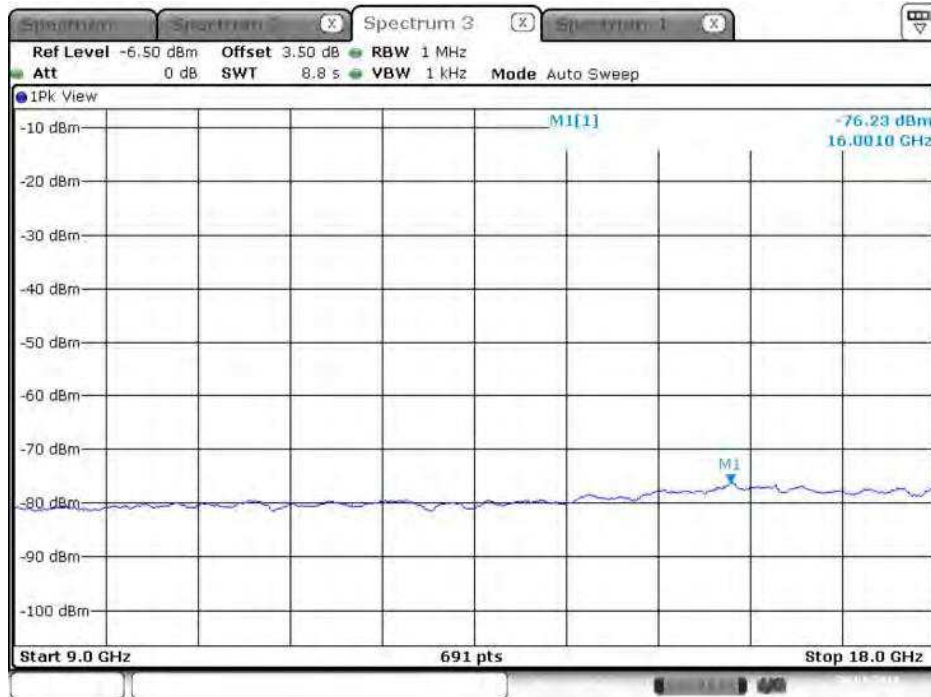


Date: 24.JAN.2018 04:23:42

Plot on Configuration QPSK, 40M / 5700 MHz / Average / Port 2 / 9GHz~18GHz

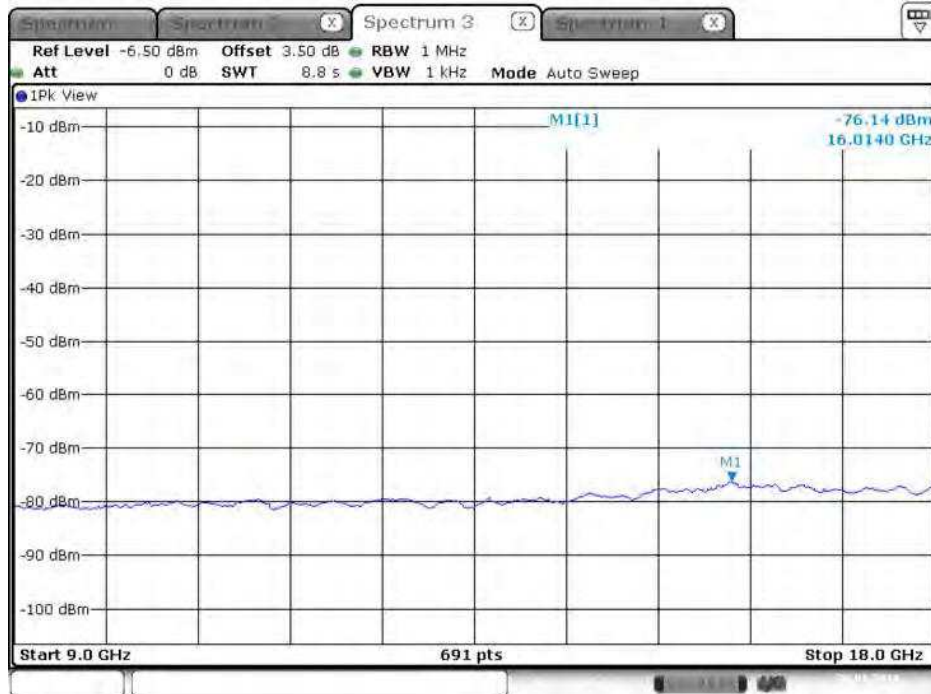


Date: 24.JAN.2018 04:25:58

Plot on Configuration QPSK, 40M / 5700 MHz / Peak / Port 1 / 9GHz~18GHz

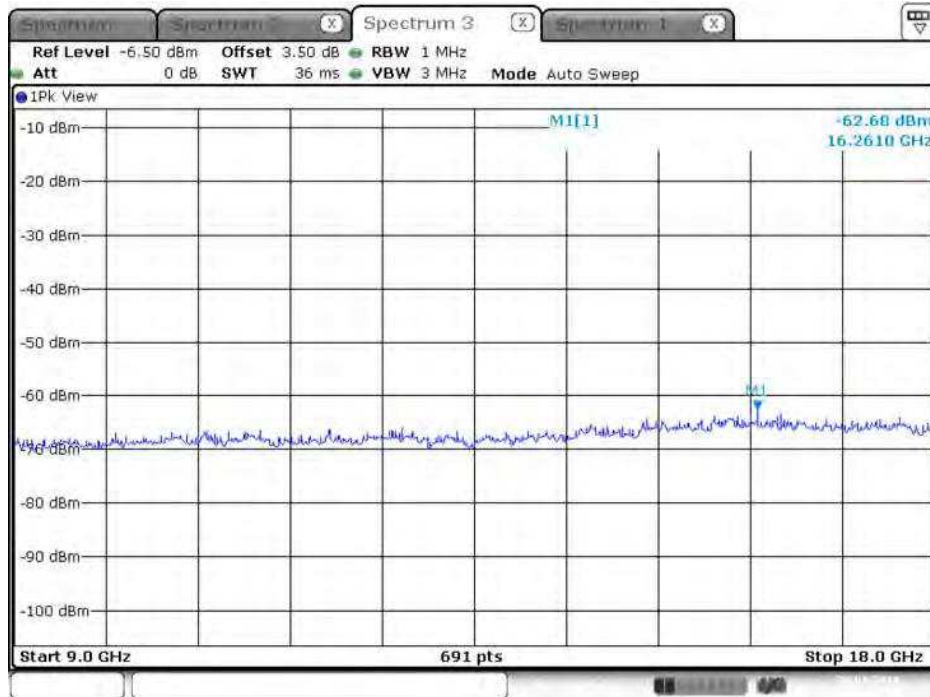


Date: 24.JAN.2018 04:23:22

Plot on Configuration QPSK, 40M / 5700 MHz / Peak / Port 2 / 9GHz~18GHz

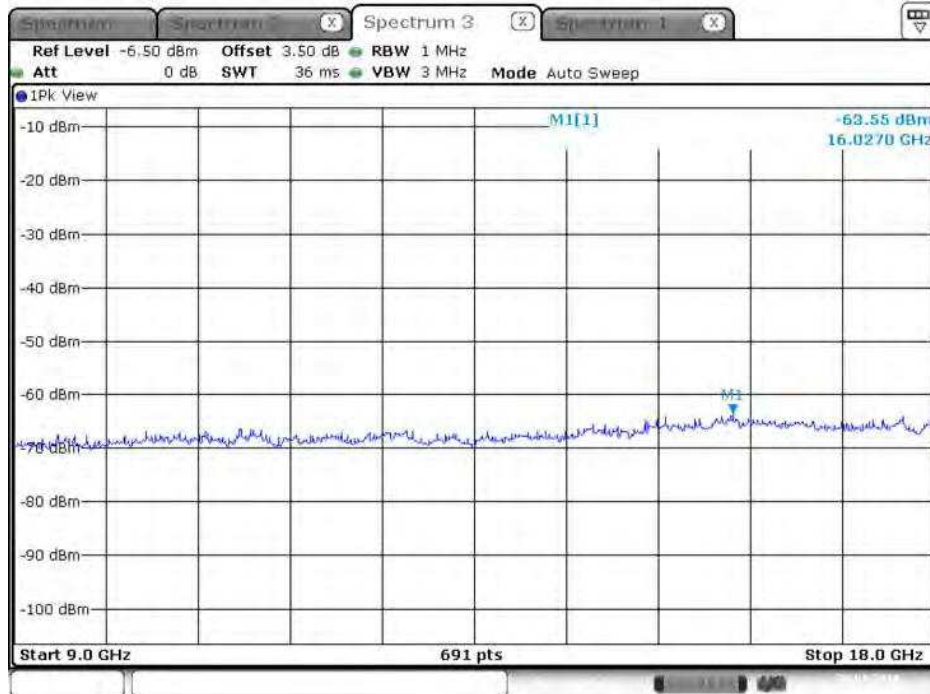


Date: 24.JAN.2018 04:26:17


Plot on Configuration QPSK, 40M / 5720 MHz (Straddle Channel) / Average / Port 1 / 9GHz~18GHz

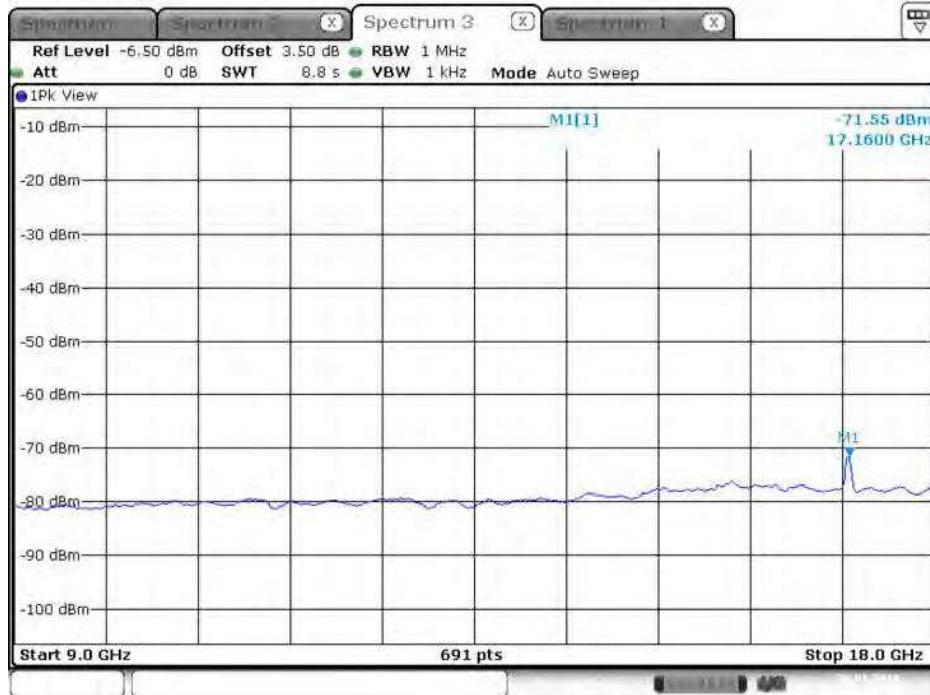

Plot on Configuration QPSK, 40M / 5720 MHz (Straddle Channel) / Average / Port 2 / 9GHz~18GHz

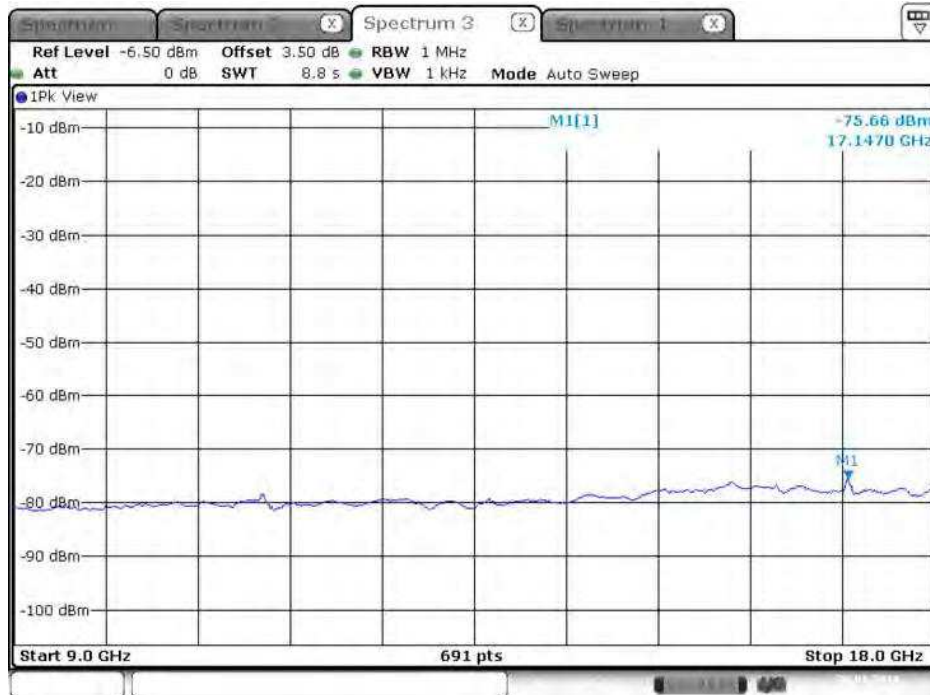


Plot on Configuration QPSK, 40M / 5720 MHz (Straddle Channel) / Peak / Port 1 / 9GHz~18GHz

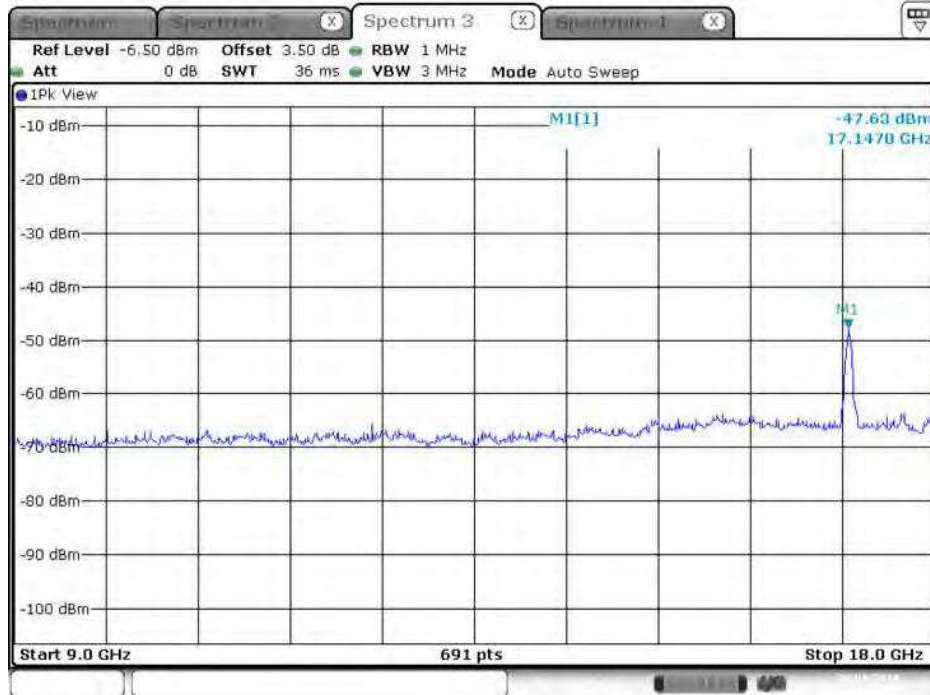


Date: 24.JAN.2018 04:29:24

Plot on Configuration QPSK, 40M / 5720 MHz (Straddle Channel) / Peak / Port 2 / 9GHz~18GHz

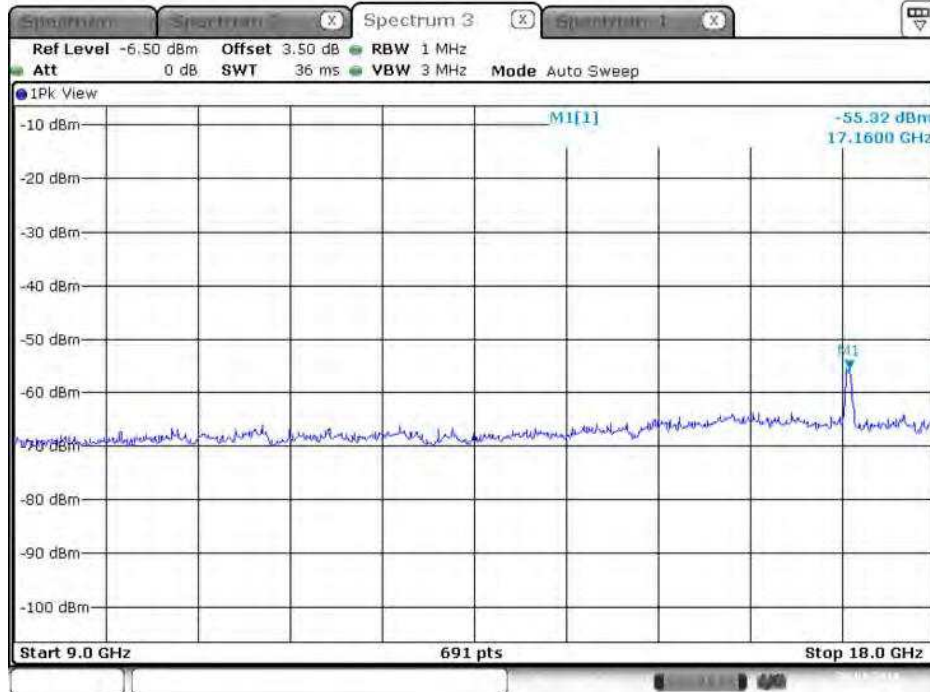


Date: 24.JAN.2018 04:27:53

Plot on Configuration QPSK, 10M / 5480 MHz / Average / Port 1 / 18GHz~40GHz

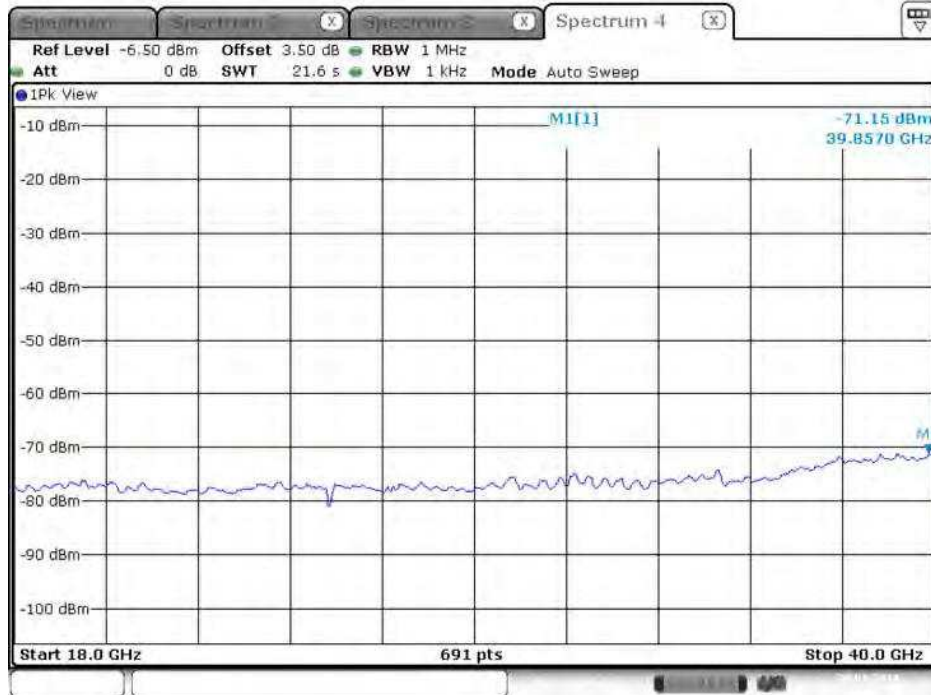


Date: 24.JAN.2018 04:04:48

Plot on Configuration QPSK, 10M / 5480 MHz / Average / Port 2 / 18GHz~40GHz

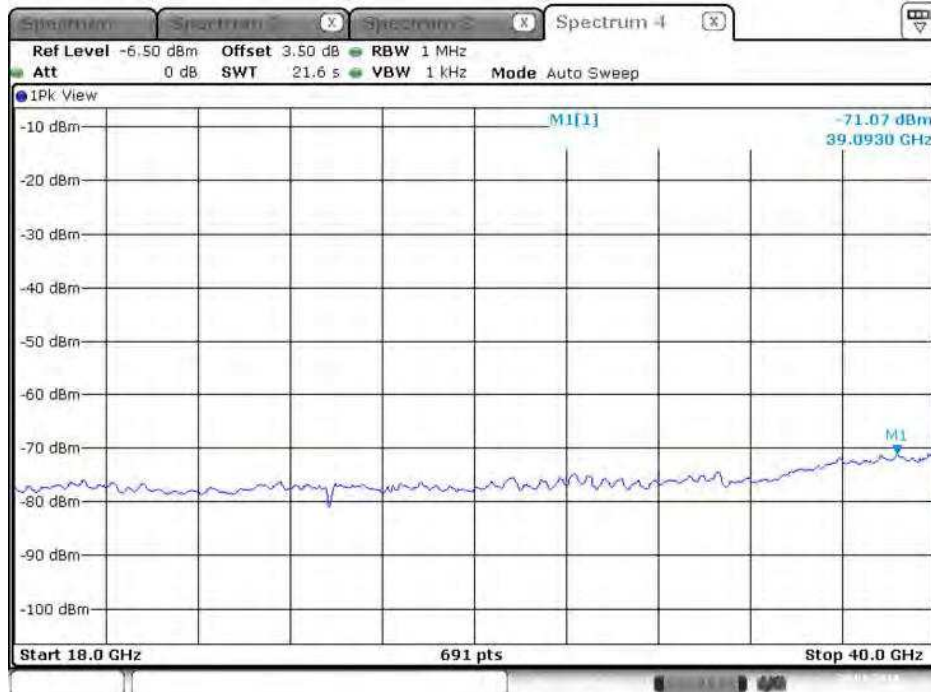


Date: 24.JAN.2018 04:07:11

Plot on Configuration QPSK, 10M / 5480 MHz / Peak / Port 1 / 18GHz~40GHz

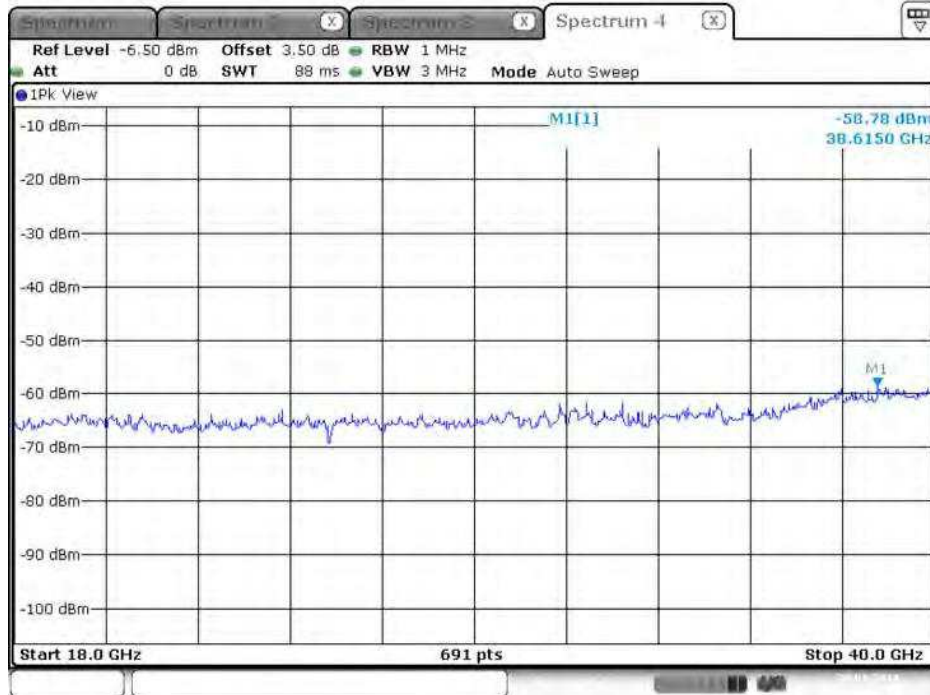


Date: 24.JAN.2018 04:05:04

Plot on Configuration QPSK, 10M / 5480 MHz / Peak / Port 2 / 18GHz~40GHz

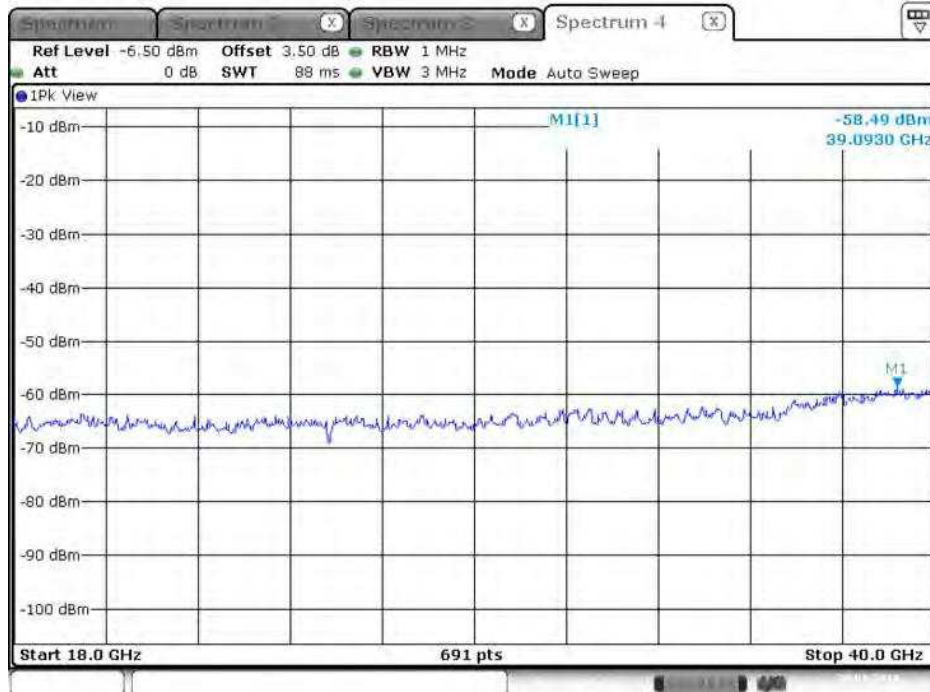


Date: 24.JAN.2018 04:06:16

Plot on Configuration QPSK, 10M / 5575 MHz / Average / Port 1 / 18GHz~40GHz

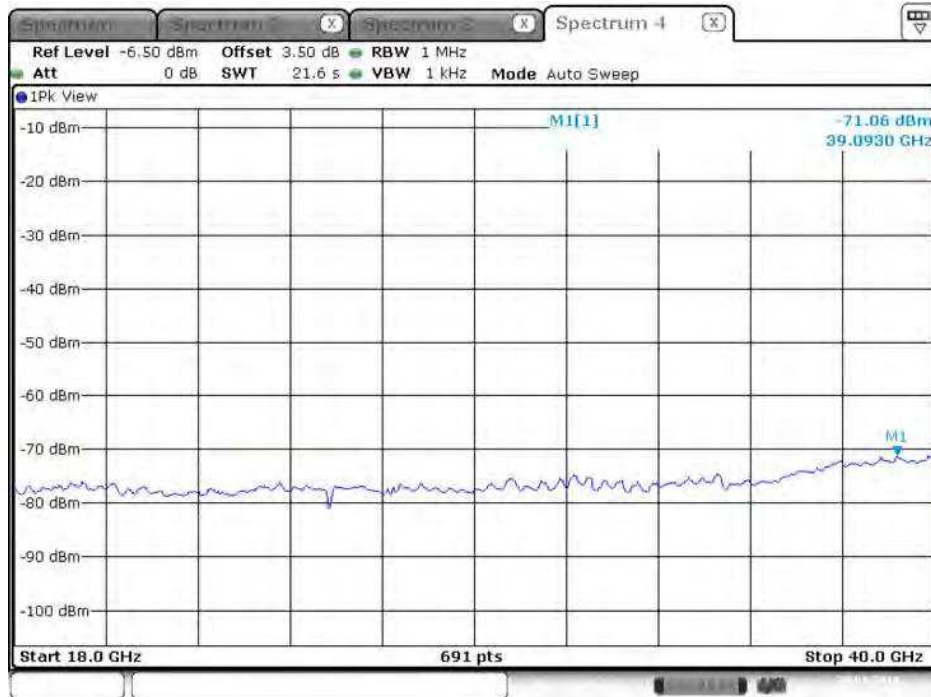


Date: 24.JAN.2018 04:11:52

Plot on Configuration QPSK, 10M / 5575 MHz / Average / Port 2 / 18GHz~40GHz

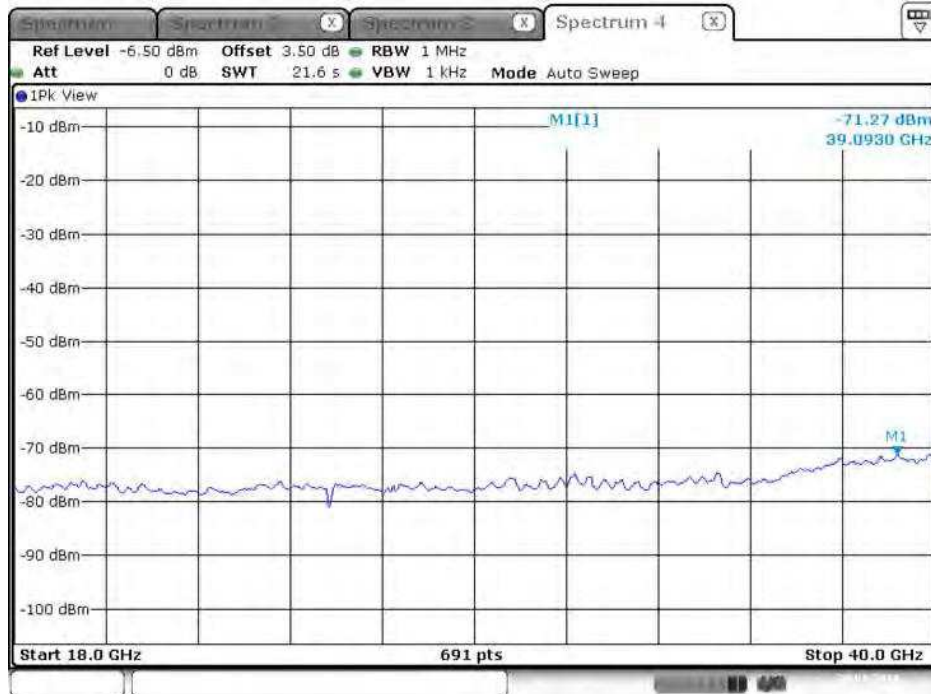


Date: 24.JAN.2018 04:08:58

Plot on Configuration QPSK, 10M / 5575 MHz / Peak / Port 1 / 18GHz~40GHz

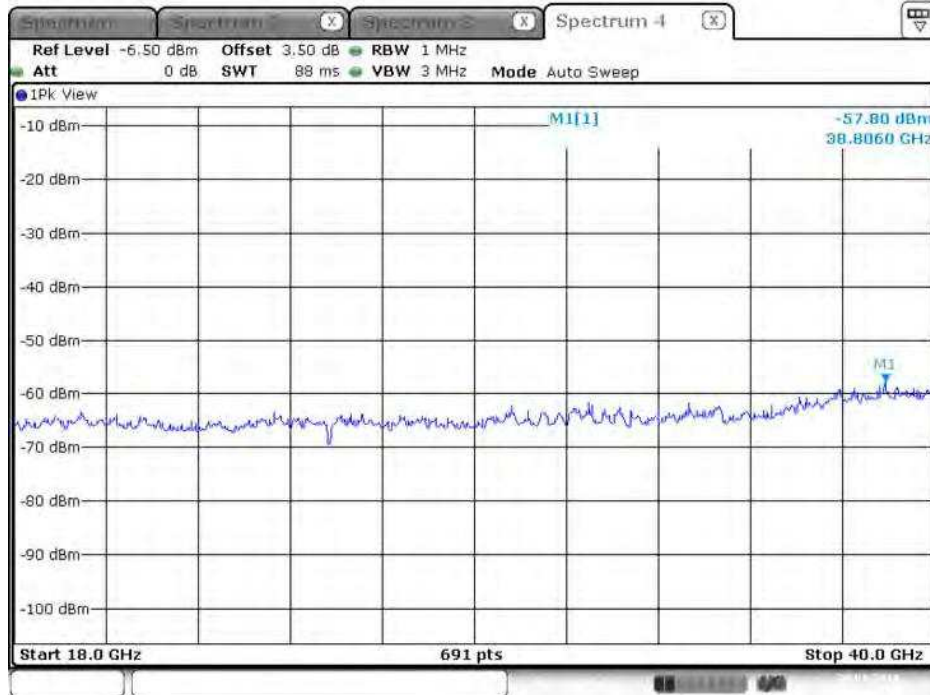


Date: 24.JAN.2018 04:11:17

Plot on Configuration QPSK, 10M / 5575 MHz / Peak / Port 2 / 18GHz~40GHz

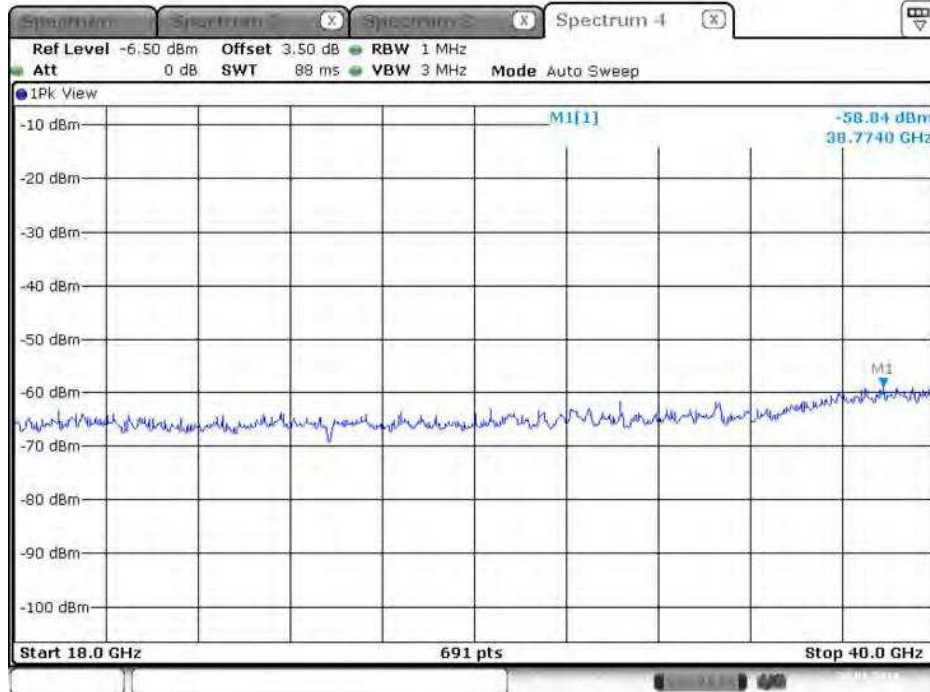


Date: 24.JAN.2018 04:09:10

Plot on Configuration QPSK, 10M / 5715 MHz / Average / Port 1 / 18GHz~40GHz

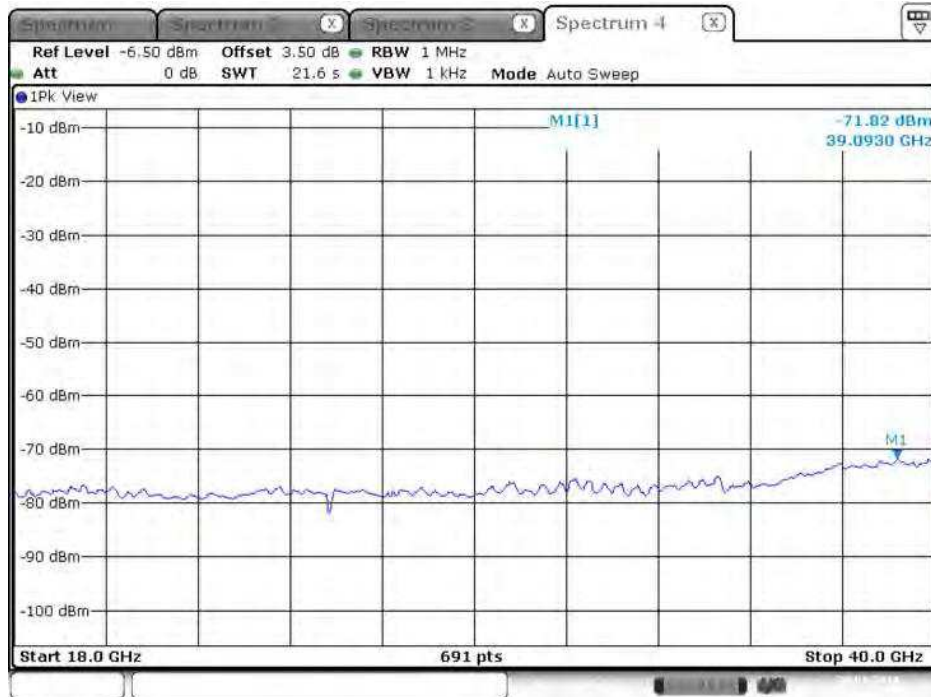


Date: 24.JAN.2018 10:35:56

Plot on Configuration QPSK, 10M / 5715 MHz / Average / Port 2 / 18GHz~40GHz

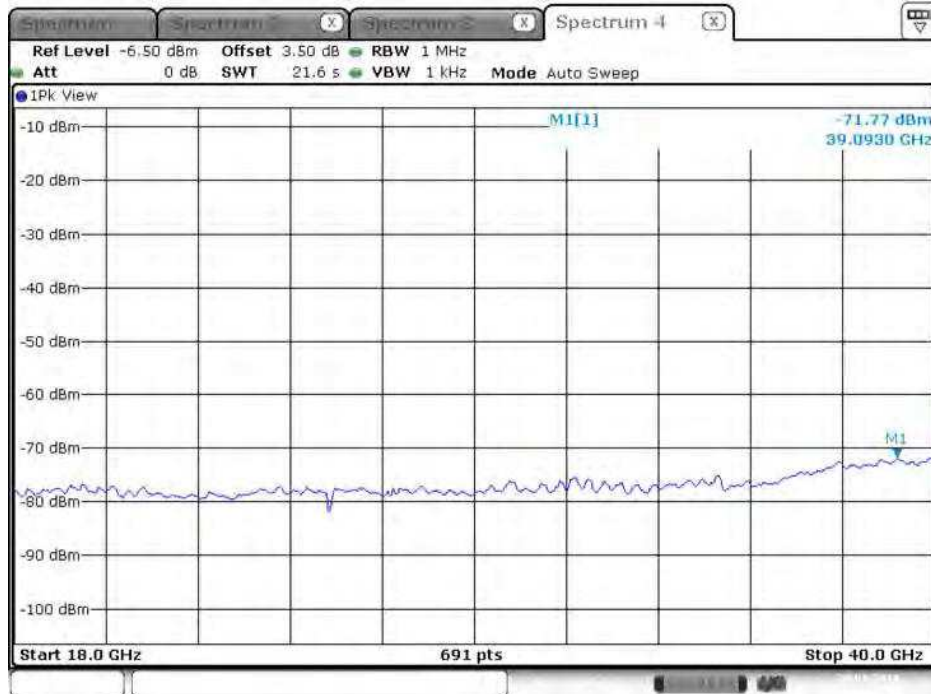


Date: 24.JAN.2018 10:38:19

Plot on Configuration QPSK, 10M / 5715 MHz / Peak / Port 1 / 18GHz~40GHz

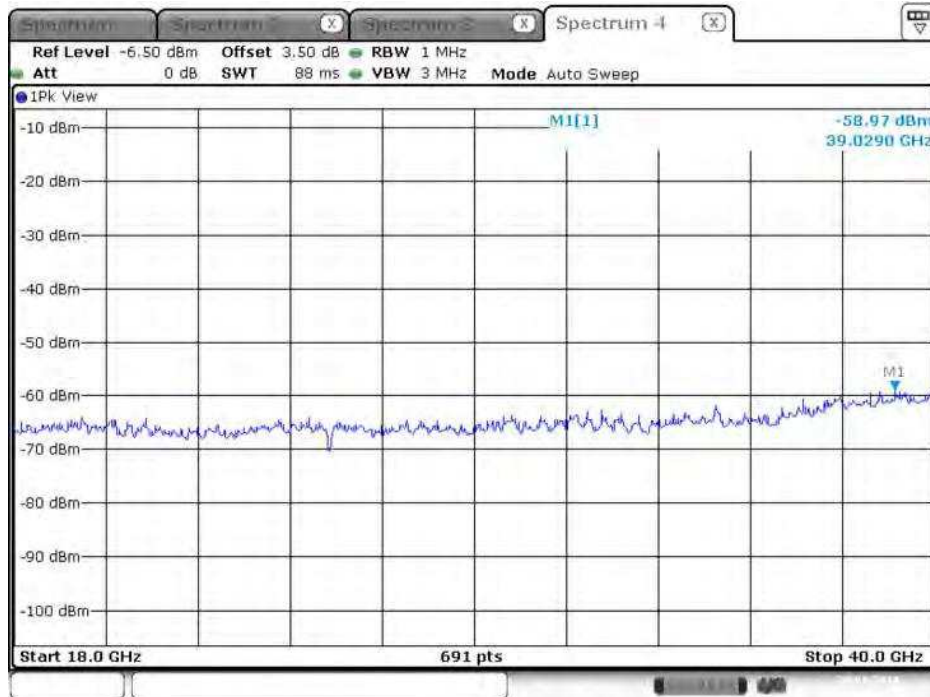


Date: 24.JAN.2018 10:36:47

Plot on Configuration QPSK, 10M / 5715 MHz / Peak / Port 2 / 18GHz~40GHz

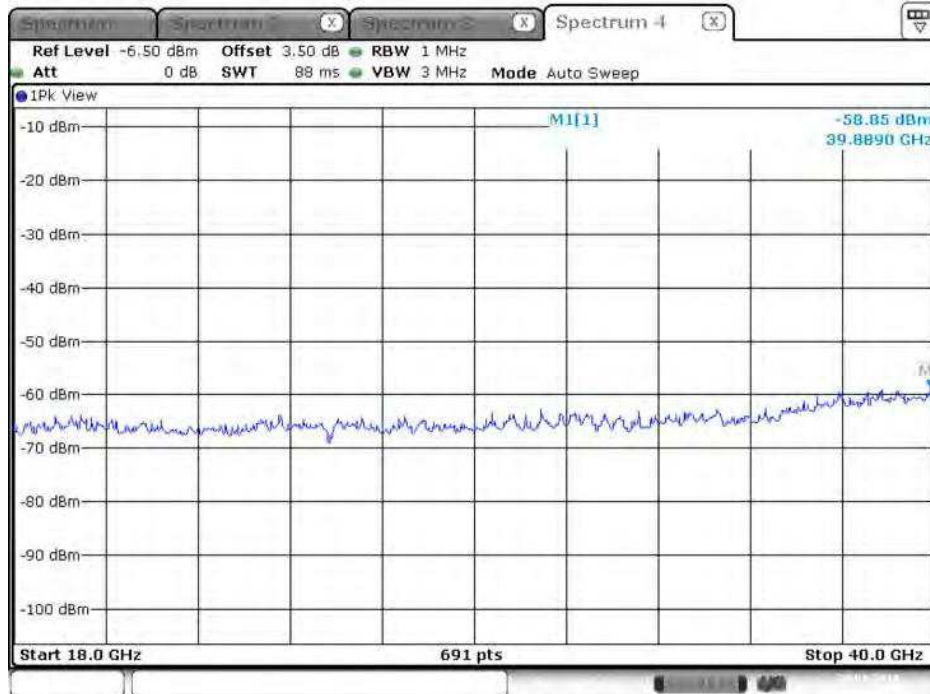


Date: 24.JAN.2018 10:39:15

Plot on Configuration QPSK, 10M / 5725 MHz (Straddle Channel) / Average / Port 1 / 18GHz~40GHz

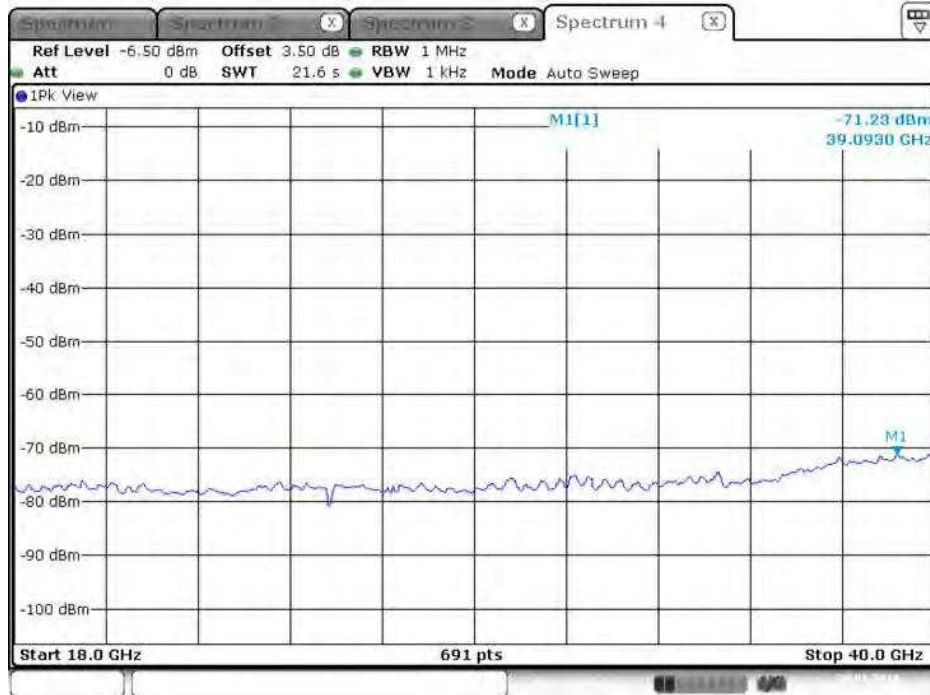


Date: 24.JAN.2018 04:32:13

Plot on Configuration QPSK, 10M / 5725 MHz (Straddle Channel) / Average / Port 2 / 18GHz~40GHz

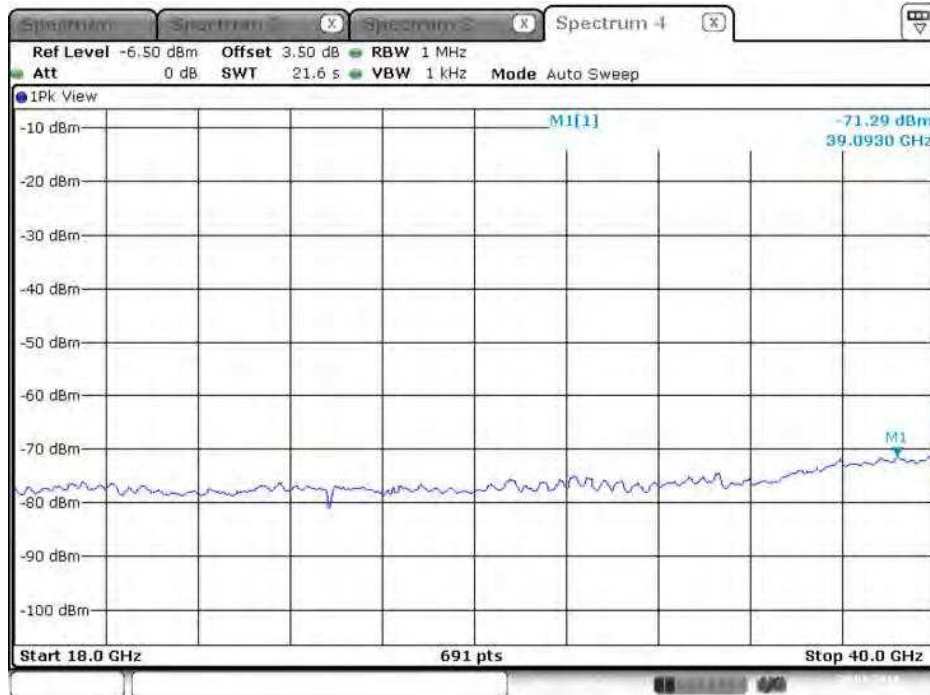


Date: 24.JAN.2018 04:34:35

Plot on Configuration QPSK, 10M / 5725 MHz (Straddle Channel) / Peak / Port 1 / 18GHz~40GHz

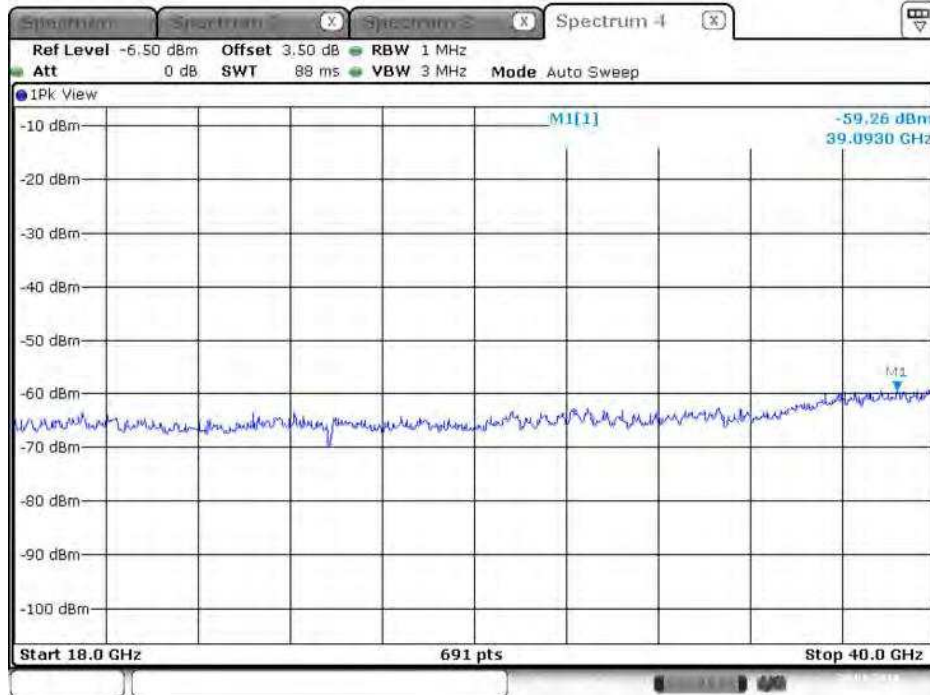


Date: 24.JAN.2018 04:32:24

Plot on Configuration QPSK, 10M / 5725 MHz (Straddle Channel) / Peak / Port 2 / 18GHz~40GHz

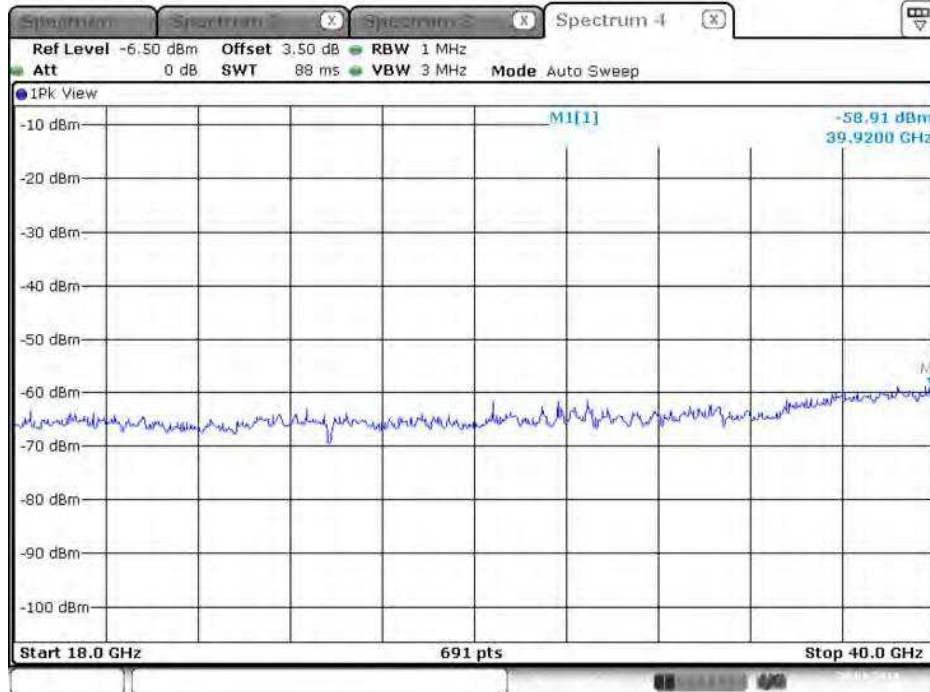


Date: 24.JAN.2018 04:34:04


Plot on Configuration QPSK, 40M / 5495 MHz / Average / Port 1 / 18GHz~40GHz

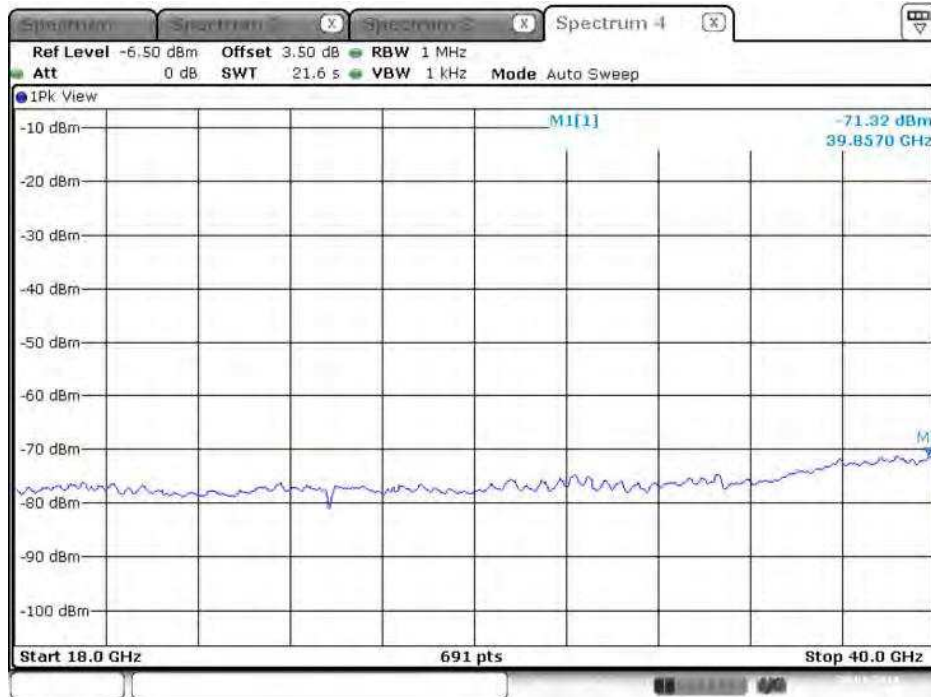

Plot on Configuration QPSK, 40M / 5495 MHz / Average / Port 2 / 18GHz~40GHz

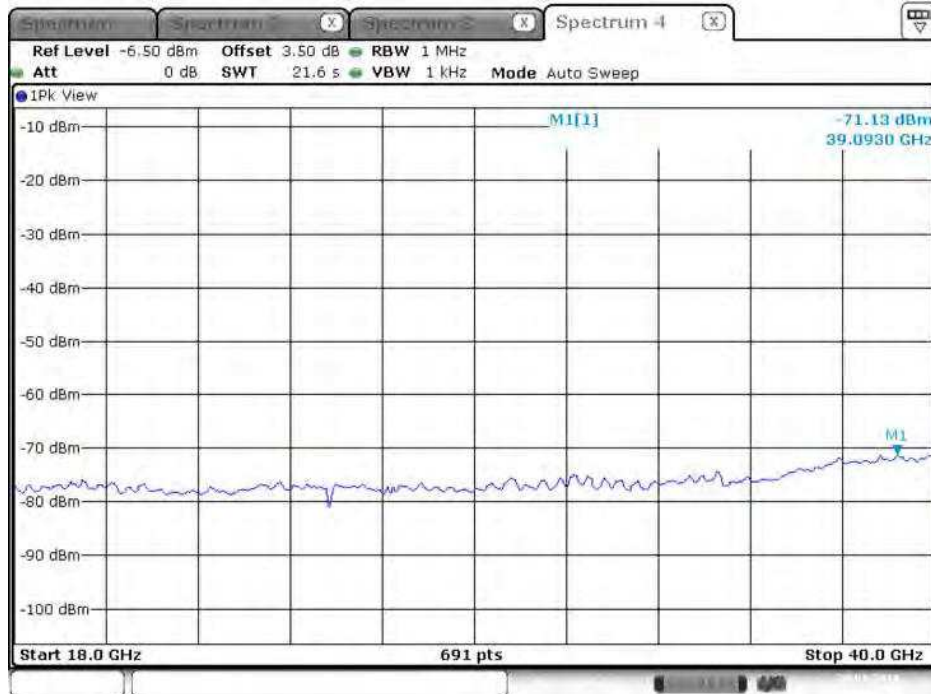


Plot on Configuration QPSK, 40M / 5495 MHz / Peak / Port 1 / 18GHz~40GHz

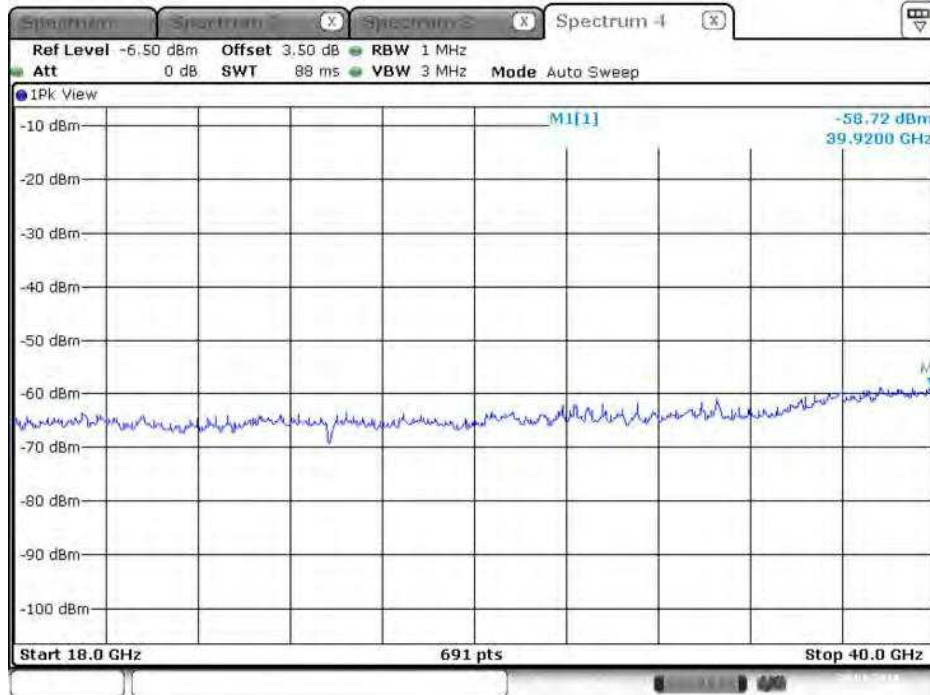


Date: 24.JAN.2018 04:15:25

Plot on Configuration QPSK, 40M / 5495 MHz / Peak / Port 2 / 18GHz~40GHz

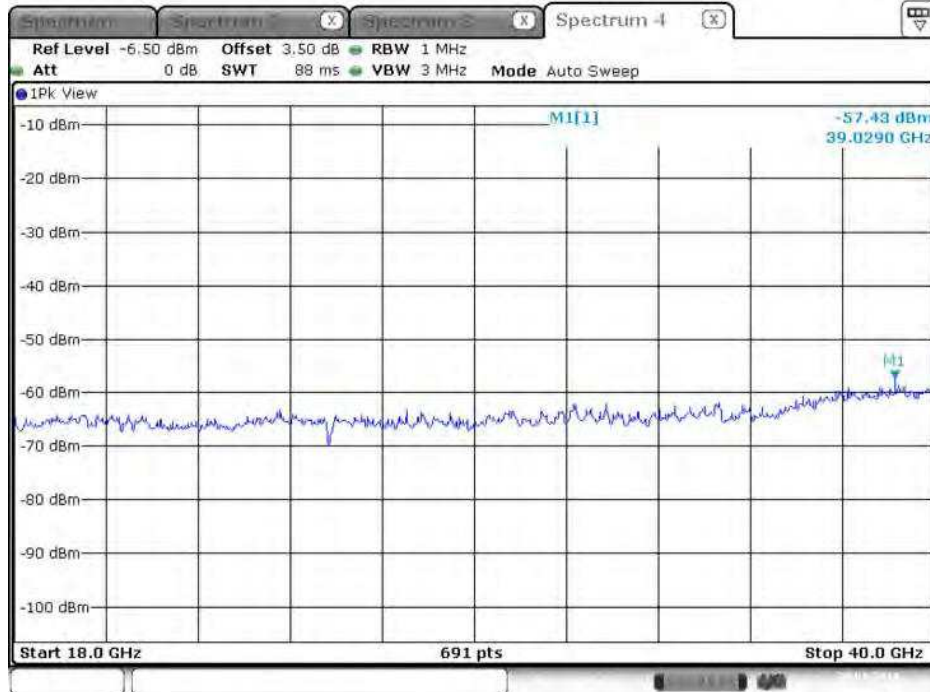


Date: 24.JAN.2018 04:17:34

Plot on Configuration QPSK, 40M / 5550 MHz / Average / Port 1 / 18GHz~40GHz

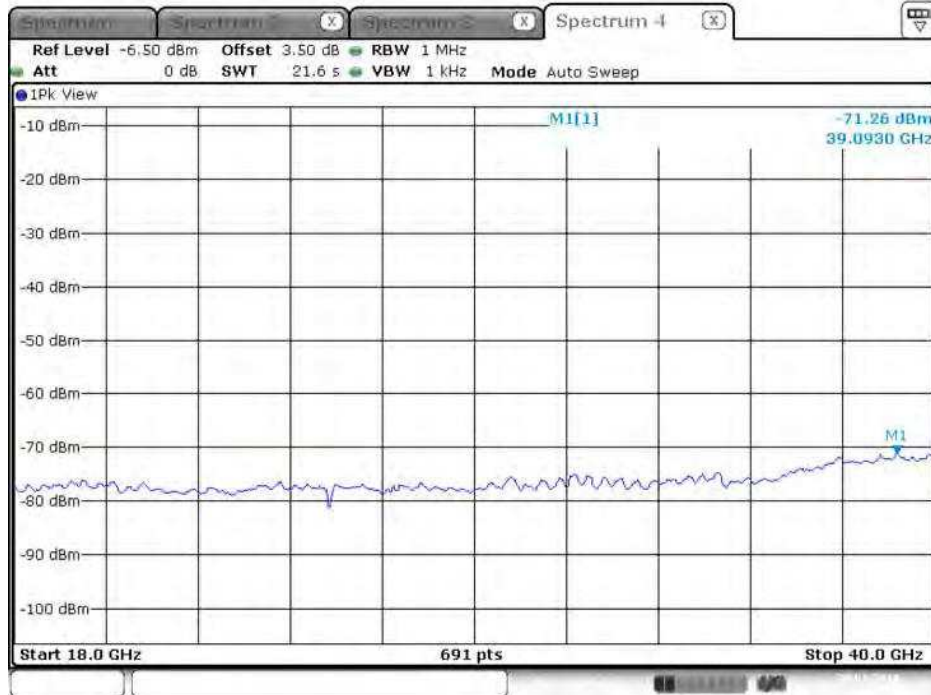

Date: 24.JAN.2018 04:21:24

Plot on Configuration QPSK, 40M / 5550 MHz / Average / Port 2 / 18GHz~40GHz

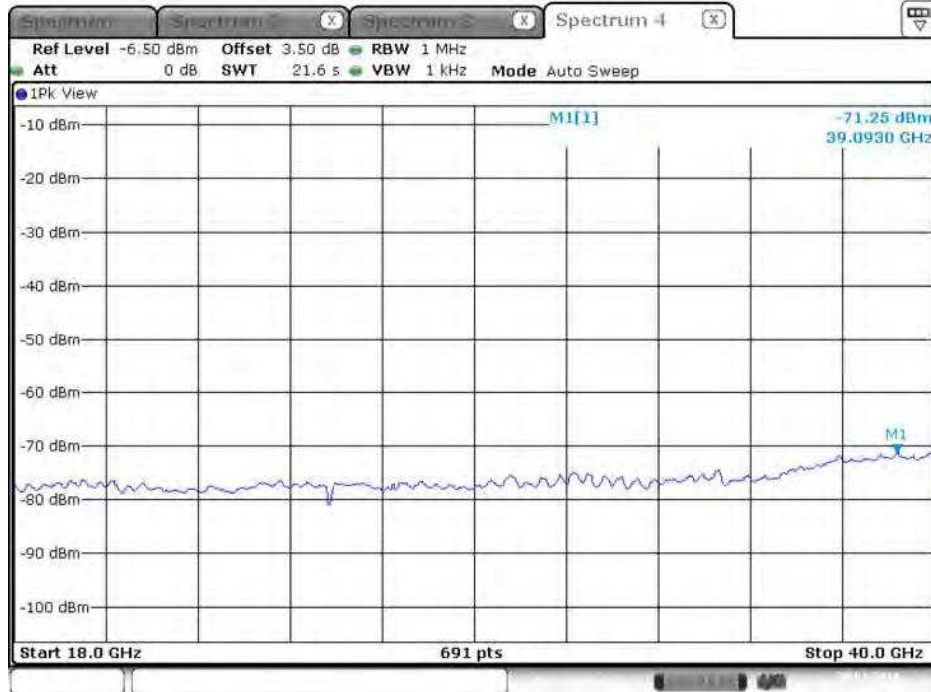


Date: 24.JAN.2018 04:19:39



Plot on Configuration QPSK, 40M / 5550 MHz / Peak / Port 2 / 18GHz~40GHz




Plot on Configuration QPSK, 40M / 5700 MHz / Average / Port 1 / 18GHz~40GHz

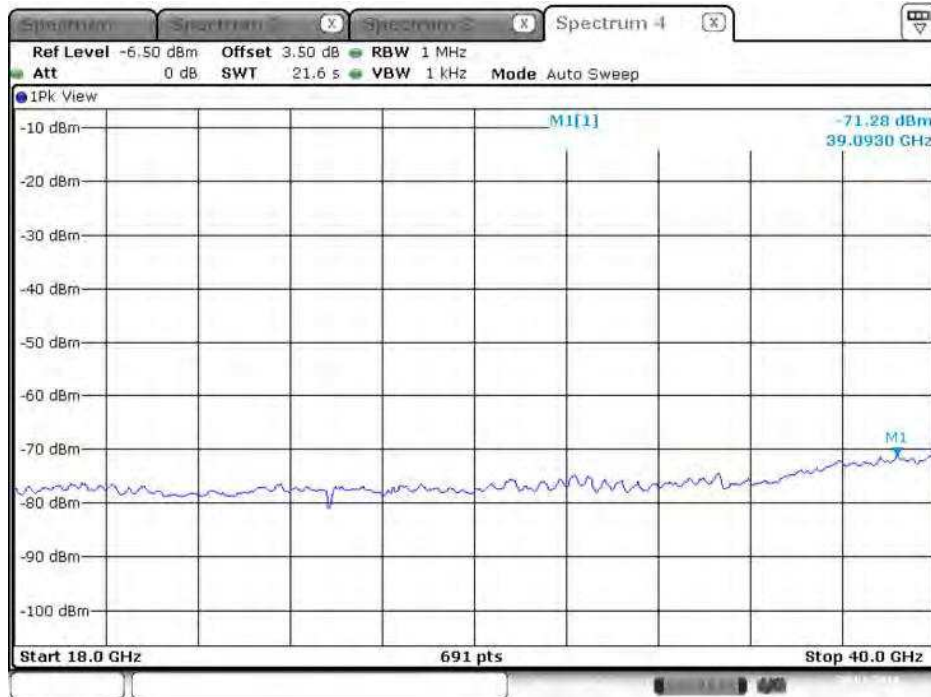


Date: 24.JAN.2018 04:24:27

Plot on Configuration QPSK, 40M / 5700 MHz / Average / Port 2 / 18GHz~40GHz

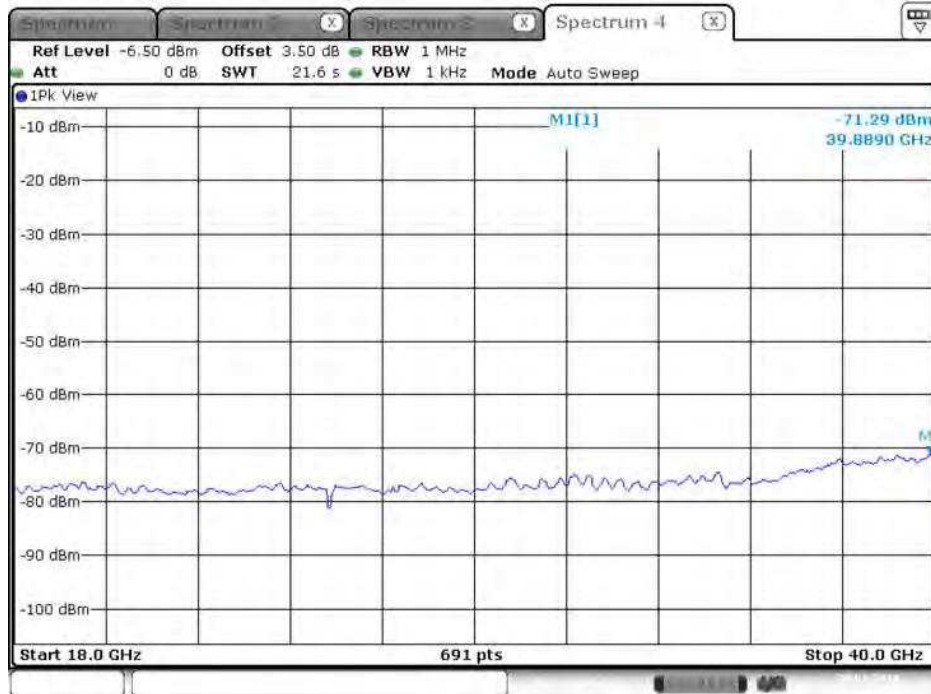


Date: 24.JAN.2018 04:25:17

Plot on Configuration QPSK, 40M / 5700 MHz / Peak / Port 1 / 18GHz~40GHz

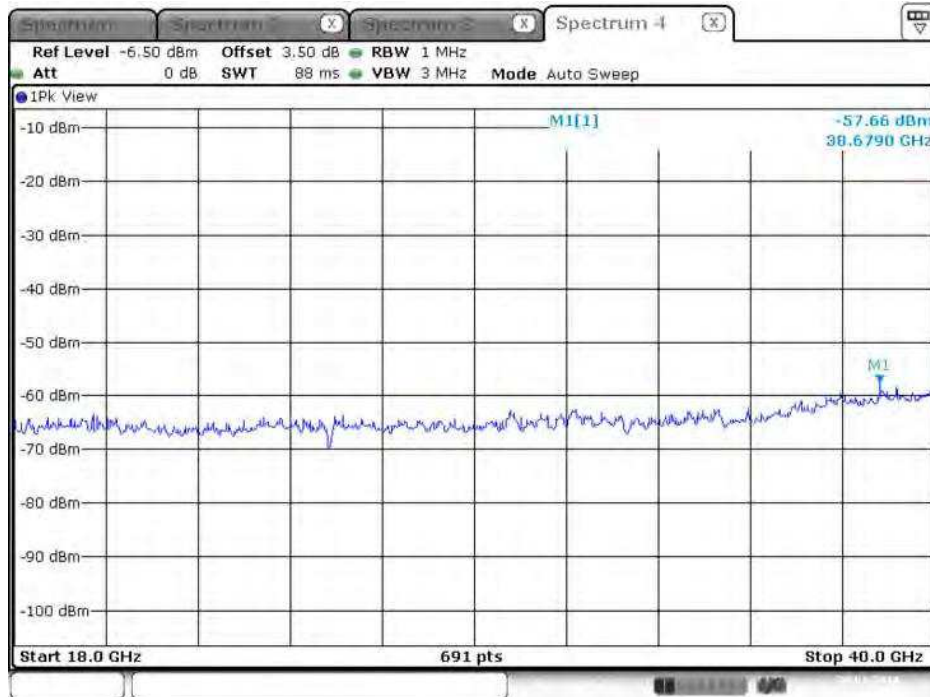


Date: 24.JAN.2018 04:23:54

Plot on Configuration QPSK, 40M / 5700 MHz / Peak / Port 2 / 18GHz~40GHz

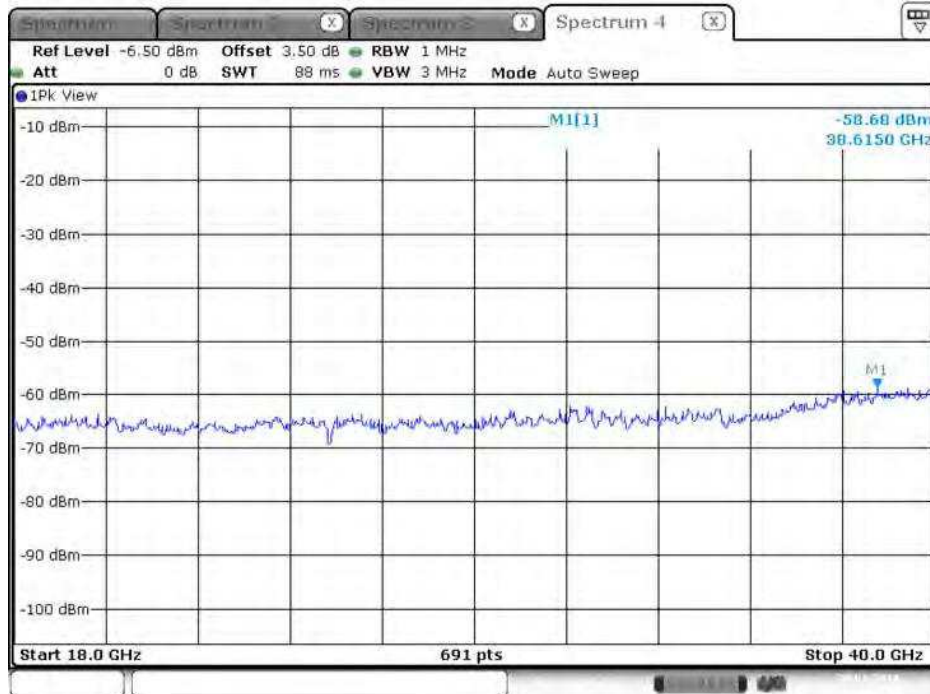


Date: 24.JAN.2018 04:25:33

Plot on Configuration QPSK, 40M / 5720 MHz (Straddle Channel) / Average / Port 1 / 18GHz~40GHz

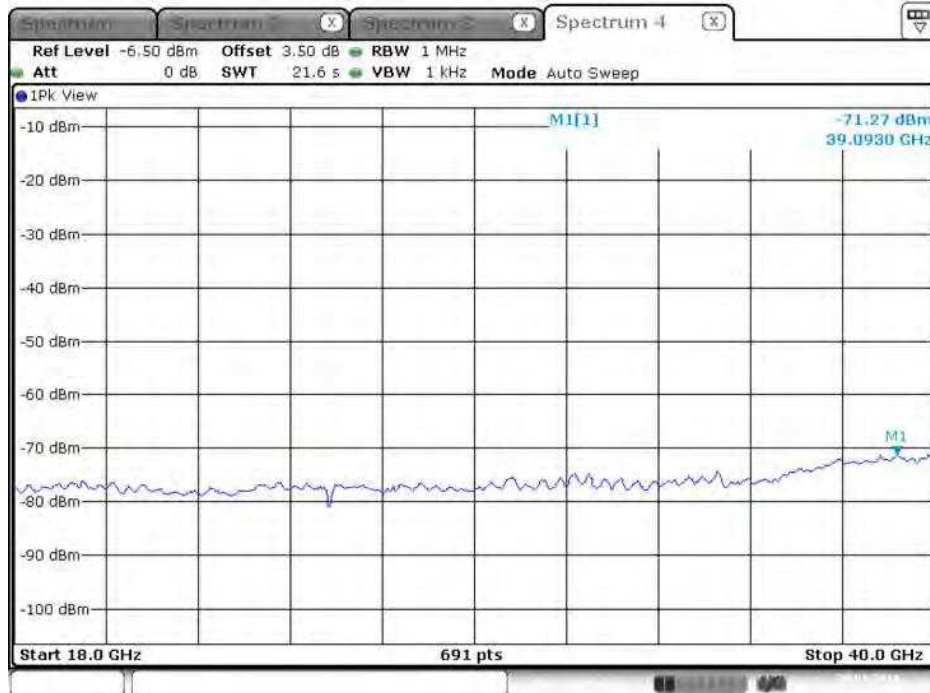


Date: 24.JAN.2018 04:30:08

Plot on Configuration QPSK, 40M / 5720 MHz (Straddle Channel) / Average / Port 2 / 18GHz~40GHz

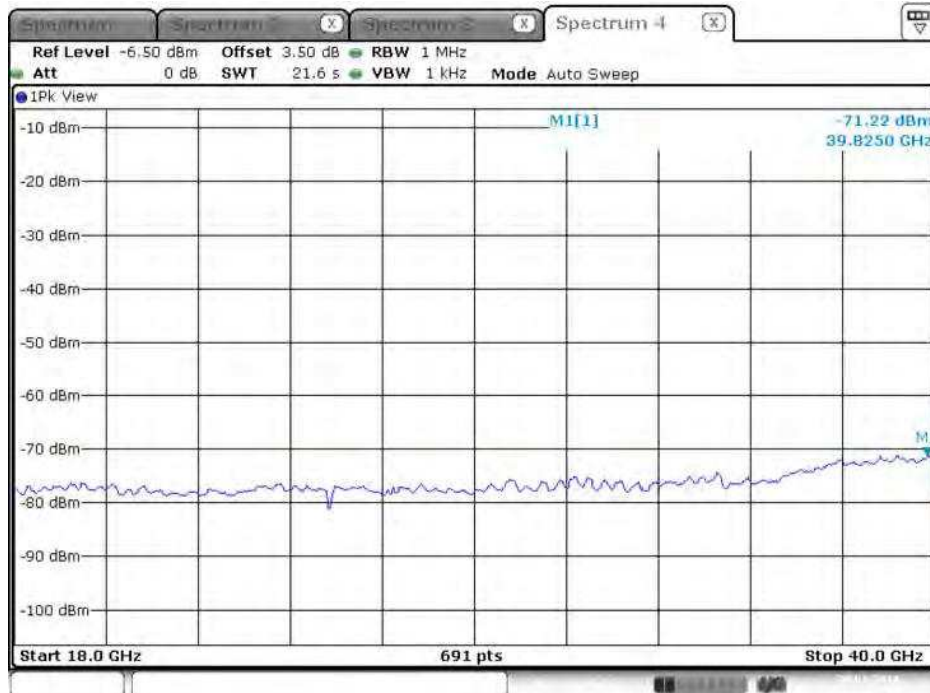


Date: 24.JAN.2018 04:27:20

Plot on Configuration QPSK, 40M / 5720 MHz (Straddle Channel) / Peak / Port 1 / 18GHz~40GHz

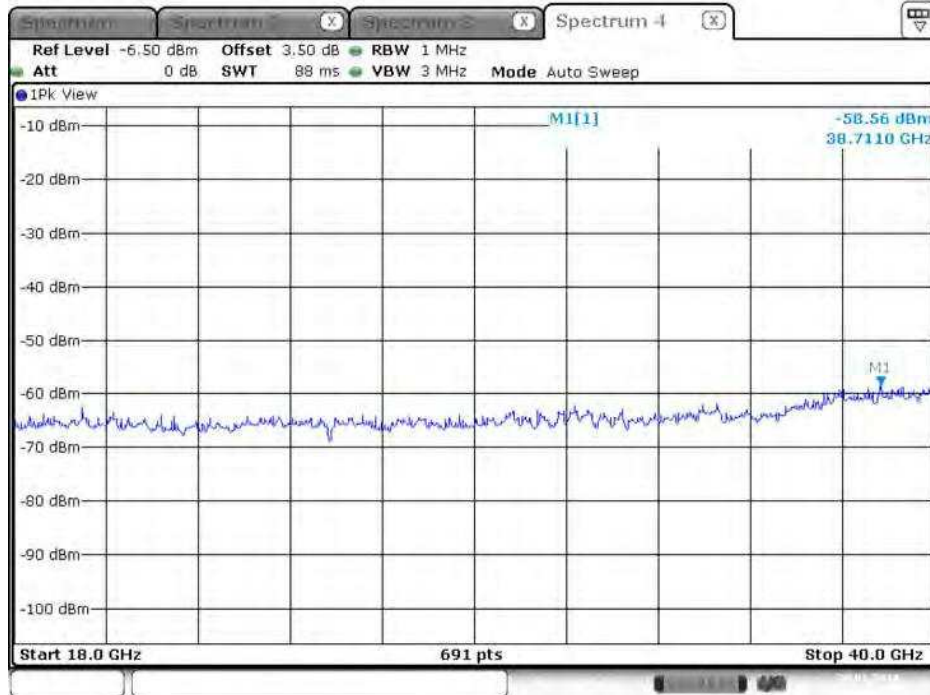

Date: 24.JAN.2018 04:29:37


Plot on Configuration QPSK, 40M / 5720 MHz (Straddle Channel) / Peak / Port 2 / 18GHz~40GHz

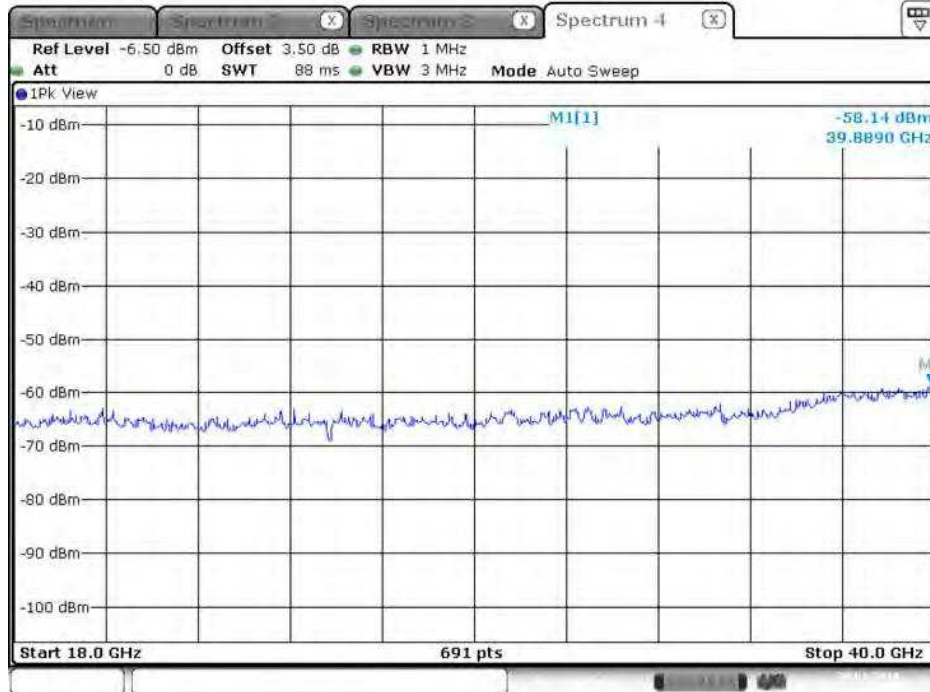

Date: 24.JAN.2018 04:27:35


For Antenna 2:

Plot on Configuration QPSK, 10M / 5255 MHz / Average / Port 1 / 1GHz~3GHz

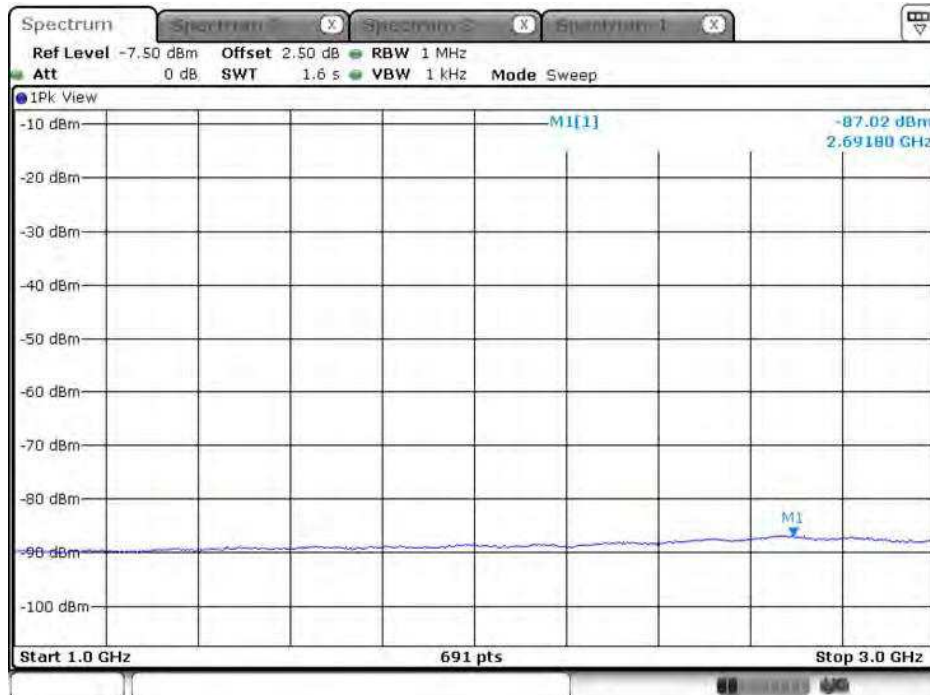


Date: 9.FEB.2018 19:06:40

Plot on Configuration QPSK, 10M / 5255 MHz / Average / Port 2 / 1GHz~3GHz

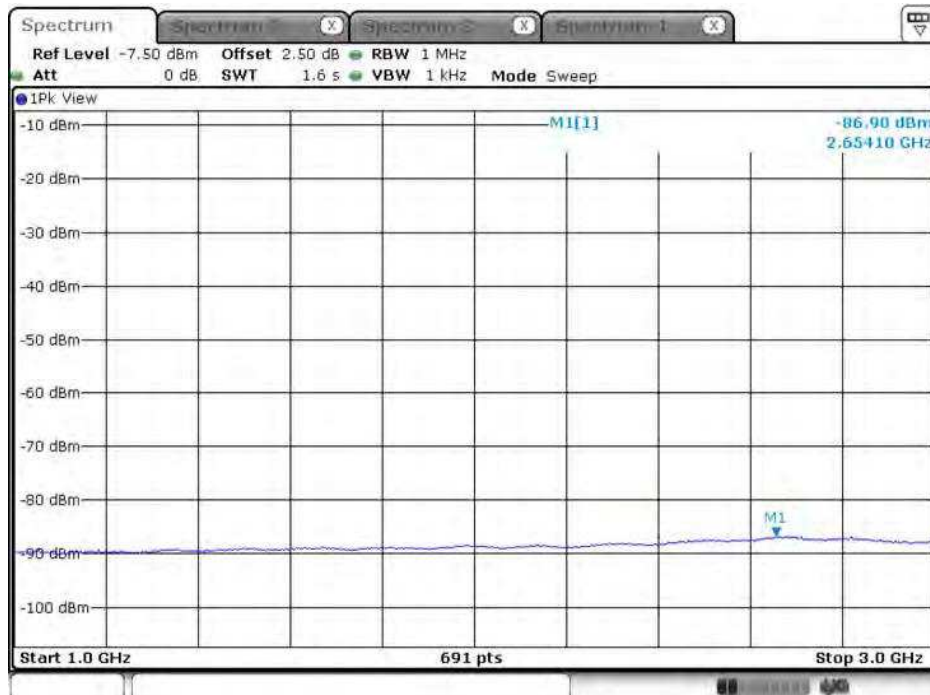


Date: 9.FEB.2018 19:27:00

Plot on Configuration QPSK, 10M / 5255 MHz / Peak / Port 1 / 1GHz~3GHz

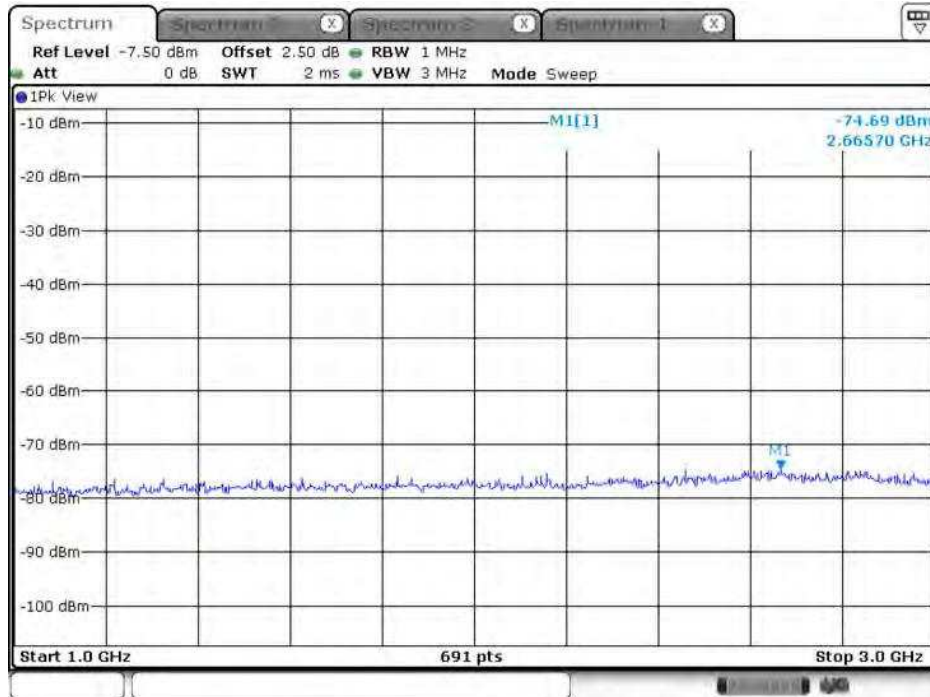

Date: 9.FEB.2018 19:07:57

Plot on Configuration QPSK, 10M / 5255 MHz / Peak / Port 2 / 1GHz~3GHz

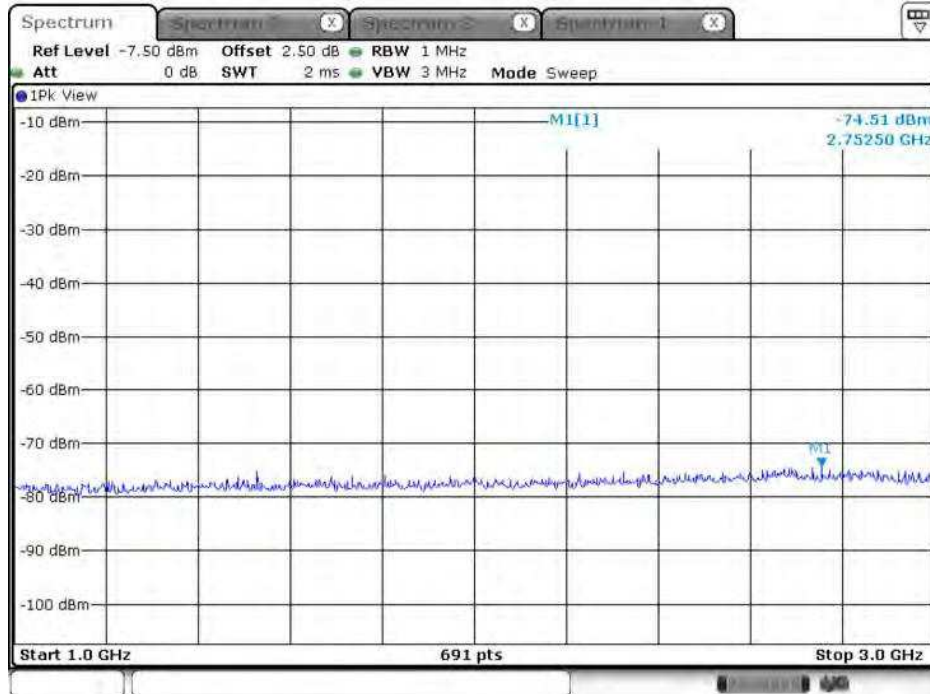

Date: 9.FEB.2018 19:27:45