



NVNT	ac20	5500	Ant1	5469.6	-44.11	3	-	54.12	Peak	68.2	Pass
NVNT	ac20	5500	Ant1	5469	-56.1	3	0.12	42.25	Average	54	Pass
NVNT	ac20	5500	Ant1	5470	-47.23	3	-	51.00	Peak	68.2	Pass
NVNT	ac20	5500	Ant1	5470	-56.59	3	0.12	41.76	Average	54	Pass
NVNT	ac20	5700	Ant1	5725	-42.92	3	-	55.31	Peak	68.2	Pass
NVNT	ac20	5700	Ant1	5725	-53.85	3	0.12	44.50	Average	54	Pass
NVNT	ac20	5700	Ant1	5727	-40.14	3	-	58.09	Peak	68.2	Pass
NVNT	ac20	5700	Ant1	5726	-53.58	3	0.12	44.77	Average	54	Pass
NVNT	ac20	5700	Ant1	5735	-49.42	3	-	48.81	Peak	68.2	Pass
NVNT	ac20	5700	Ant1	5735	-57.8	3	0.12	40.55	Average	54	Pass
NVNT	ac40	5510	Ant1	5460	-49.68	3	-	48.55	Peak	68.2	Pass
NVNT	ac40	5510	Ant1	5460	-57.84	3	0.23	40.62	Average	54	Pass
NVNT	ac40	5510	Ant1	5469.6	-44.9	3	-	53.33	Peak	68.2	Pass
NVNT	ac40	5510	Ant1	5469.6	-54.68	3	0.23	43.78	Average	54	Pass
NVNT	ac40	5510	Ant1	5470	-46.01	3	-	52.22	Peak	68.2	Pass
NVNT	ac40	5510	Ant1	5470	-55.9	3	0.23	42.56	Average	54	Pass
NVNT	ac40	5670	Ant1	5725	-49.53	3	-	48.70	Peak	68.2	Pass
NVNT	ac40	5670	Ant1	5725	-58.17	3	0.24	40.30	Average	54	Pass
NVNT	ac40	5670	Ant1	5730.6	-48.13	3	-	50.10	Peak	68.2	Pass
NVNT	ac40	5670	Ant1	5725.2	-57.55	3	0.24	40.92	Average	54	Pass
NVNT	ac40	5670	Ant1	5735	-50.12	3	-	48.11	Peak	68.2	Pass
NVNT	ac40	5670	Ant1	5735	-58.36	3	0.24	40.11	Average	54	Pass
NVNT	ac80	5530	Ant1	5460	-49.45	3	-	48.78	Peak	68.2	Pass
NVNT	ac80	5530	Ant1	5460	-57.12	3	0.25	41.36	Average	54	Pass
NVNT	ac80	5530	Ant1	5467.4	-41.88	3	-	56.35	Peak	68.2	Pass
NVNT	ac80	5530	Ant1	5470	-55.45	3	0.25	43.03	Average	54	Pass
NVNT	ac80	5530	Ant1	5470	-44.46	3	-	53.77	Peak	68.2	Pass
NVNT	ac80	5530	Ant1	5470	-55.45	3	0.25	43.03	Average	54	Pass
NVNT	ac80	5610	Ant1	5725	-50.47	3	-	47.76	Peak	68.2	Pass
NVNT	ac80	5610	Ant1	5725	-58.15	3	0.25	40.33	Average	54	Pass
NVNT	ac80	5610	Ant1	5725.16	-48.54	3	-	49.69	Peak	68.2	Pass
NVNT	ac80	5610	Ant1	5729.875	-57.24	3	0.25	41.24	Average	54	Pass
NVNT	ac80	5610	Ant1	5735	-50.41	3	-	47.82	Peak	68.2	Pass
NVNT	ac80	5610	Ant1	5735	-57.8	3	0.25	40.68	Average	54	Pass
NVNT	ax20	5500	Ant1	5460	-49.5	3	-	48.73	Peak	68.2	Pass
NVNT	ax20	5500	Ant1	5460	-57.92	3	0.12	40.43	Average	54	Pass
NVNT	ax20	5500	Ant1	5468.6	-44.42	3	-	53.81	Peak	68.2	Pass
NVNT	ax20	5500	Ant1	5469.6	-56.27	3	0.12	42.08	Average	54	Pass
NVNT	ax20	5500	Ant1	5470	-46.82	3	-	51.41	Peak	68.2	Pass
NVNT	ax20	5500	Ant1	5470	-56.98	3	0.12	41.37	Average	54	Pass
NVNT	ax20	5700	Ant1	5725	-39.47	3	-	58.76	Peak	68.2	Pass
NVNT	ax20	5700	Ant1	5725	-55.13	3	0.12	43.22	Average	54	Pass
NVNT	ax20	5700	Ant1	5726	-38.67	3	-	59.56	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




NVNT	ax20	5700	Ant1	5725.8	-53.78	3	0.12	44.57	Average	54	Pass
NVNT	ax20	5700	Ant1	5735	-50.31	3	-	47.92	Peak	68.2	Pass
NVNT	ax20	5700	Ant1	5735	-57.52	3	0.12	40.83	Average	54	Pass
NVNT	ax40	5510	Ant1	5460	-49.51	3	-	48.72	Peak	68.2	Pass
NVNT	ax40	5510	Ant1	5460	-58.12	3	0.24	40.35	Average	54	Pass
NVNT	ax40	5510	Ant1	5468.4	-42.07	3	-	56.16	Peak	68.2	Pass
NVNT	ax40	5510	Ant1	5469.6	-55.67	3	0.24	42.80	Average	54	Pass
NVNT	ax40	5510	Ant1	5470	-44.41	3	-	53.82	Peak	68.2	Pass
NVNT	ax40	5510	Ant1	5470	-56.6	3	0.24	41.87	Average	54	Pass
NVNT	ax40	5670	Ant1	5725	-48.71	3	-	49.52	Peak	68.2	Pass
NVNT	ax40	5670	Ant1	5725	-58.11	3	0.24	40.36	Average	54	Pass
NVNT	ax40	5670	Ant1	5726.2	-47.8	3	-	50.43	Peak	68.2	Pass
NVNT	ax40	5670	Ant1	5725.6	-57.57	3	0.24	40.90	Average	54	Pass
NVNT	ax40	5670	Ant1	5735	-50.65	3	-	47.58	Peak	68.2	Pass
NVNT	ax40	5670	Ant1	5735	-58.56	3	0.24	39.91	Average	54	Pass
NVNT	ax80	5530	Ant1	5460	-49.58	3	-	48.65	Peak	68.2	Pass
NVNT	ax80	5530	Ant1	5460	-56.66	3	0.25	41.82	Average	54	Pass
NVNT	ax80	5530	Ant1	5468.8	-41.98	3	-	56.25	Peak	68.2	Pass
NVNT	ax80	5530	Ant1	5469.4	-55.24	3	0.25	43.24	Average	54	Pass
NVNT	ax80	5530	Ant1	5470	-45.41	3	-	52.82	Peak	68.2	Pass
NVNT	ax80	5530	Ant1	5470	-55.27	3	0.25	43.21	Average	54	Pass
NVNT	ax80	5610	Ant1	5725	-49.55	3	-	48.68	Peak	68.2	Pass
NVNT	ax80	5610	Ant1	5725	-58.02	3	0.25	40.46	Average	54	Pass
NVNT	ax80	5610	Ant1	5725.57	-47.67	3	-	50.56	Peak	68.2	Pass
NVNT	ax80	5610	Ant1	5727.005	-57.52	3	0.25	40.96	Average	54	Pass
NVNT	ax80	5610	Ant1	5735	-49.46	3	-	48.77	Peak	68.2	Pass
NVNT	ax80	5610	Ant1	5735	-58.23	3	0.25	40.25	Average	54	Pass






Test Graphs

Restrict Band NVNT a 5500MHz Ant1 Peak

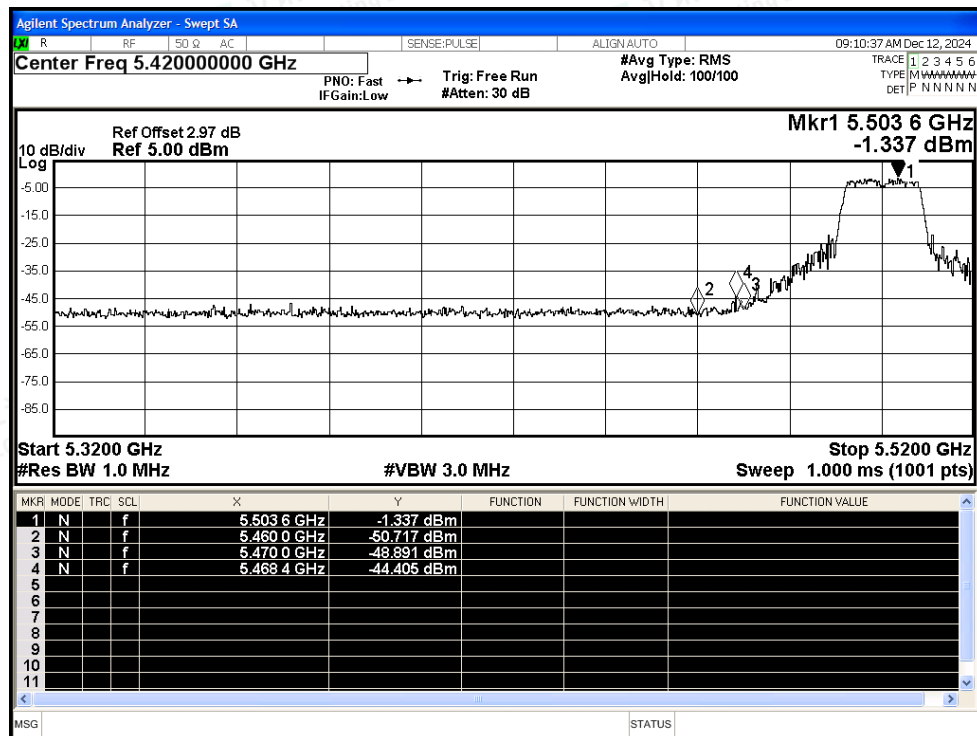

Restrict Band NVNT a 5500MHz Ant1 Average

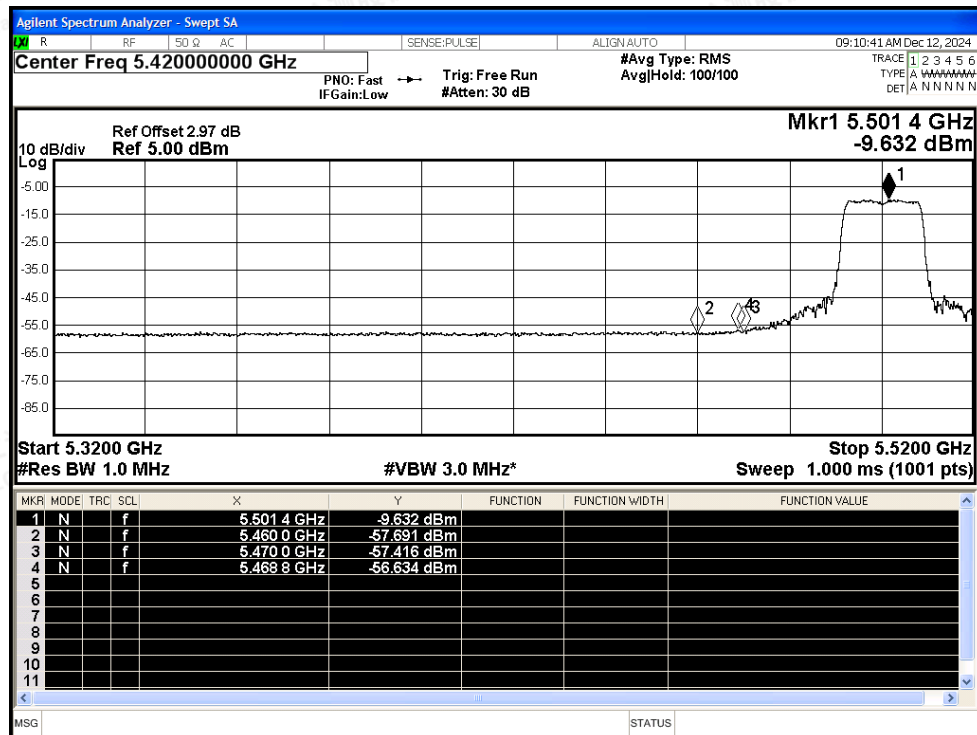

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5700MHz Ant1 Peak

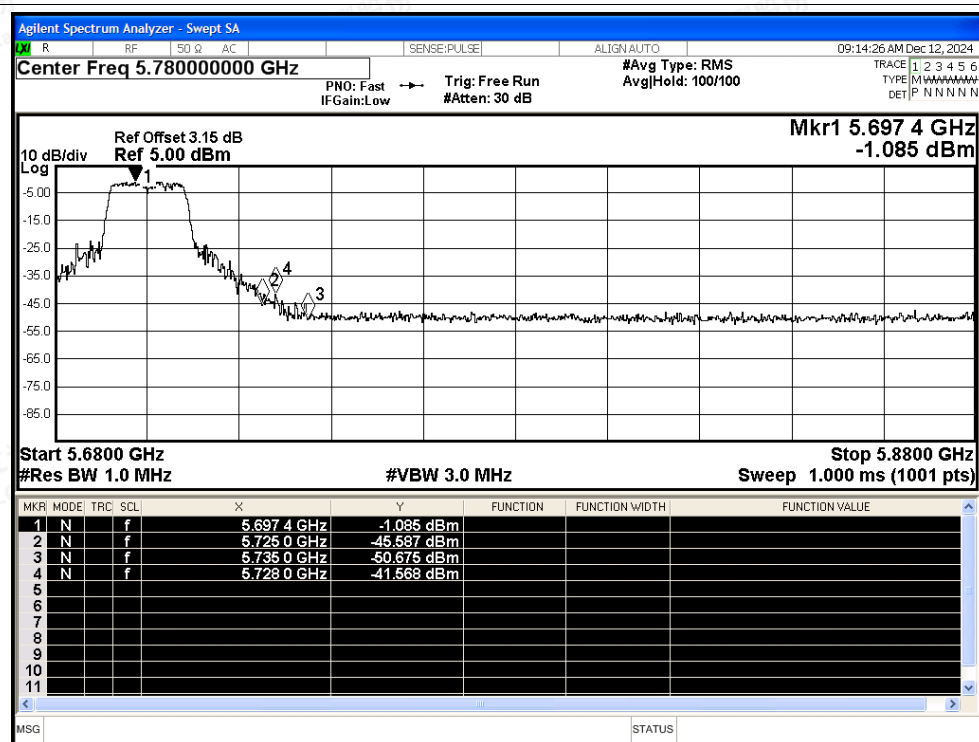

Restrict Band NVNT a 5700MHz Ant1 Average

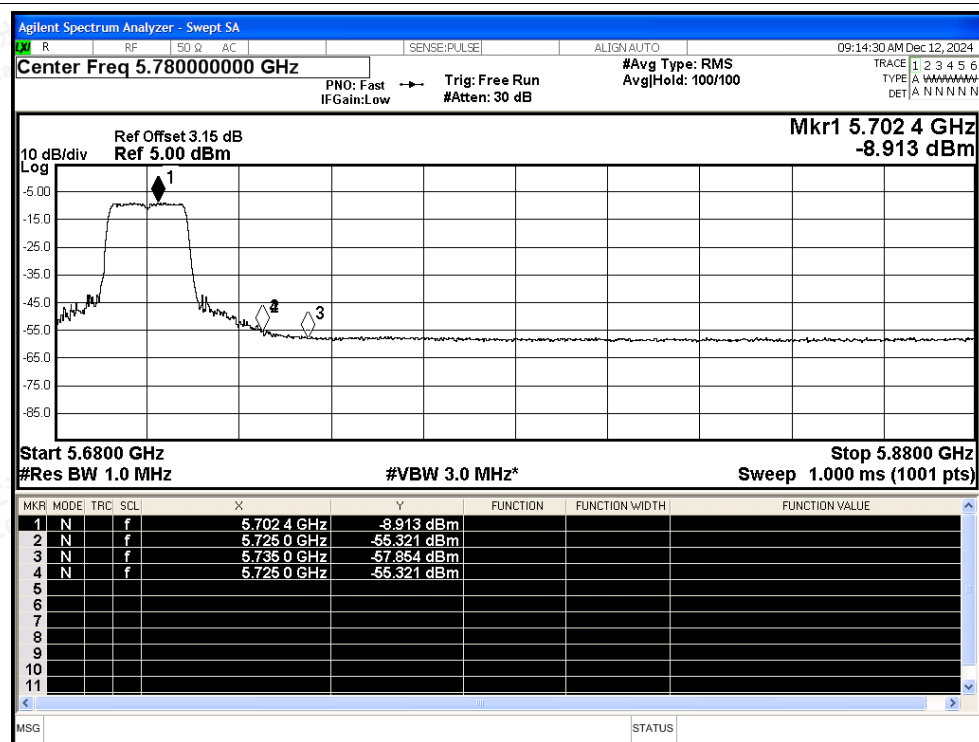

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5500MHz Ant1 Peak

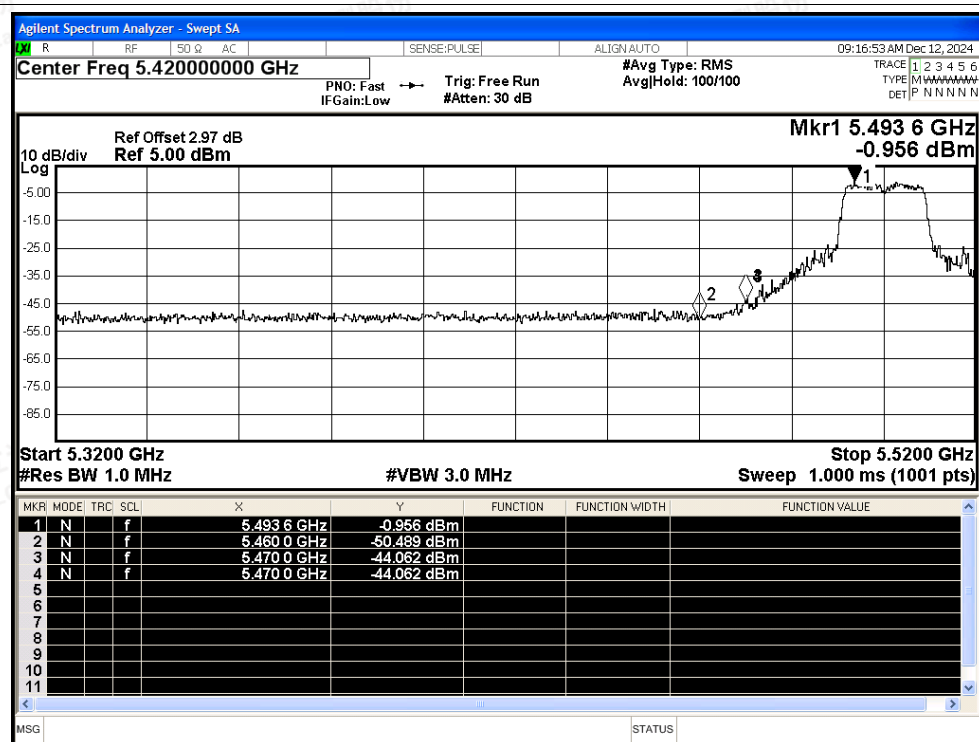

Restrict Band NVNT n20 5500MHz Ant1 Average

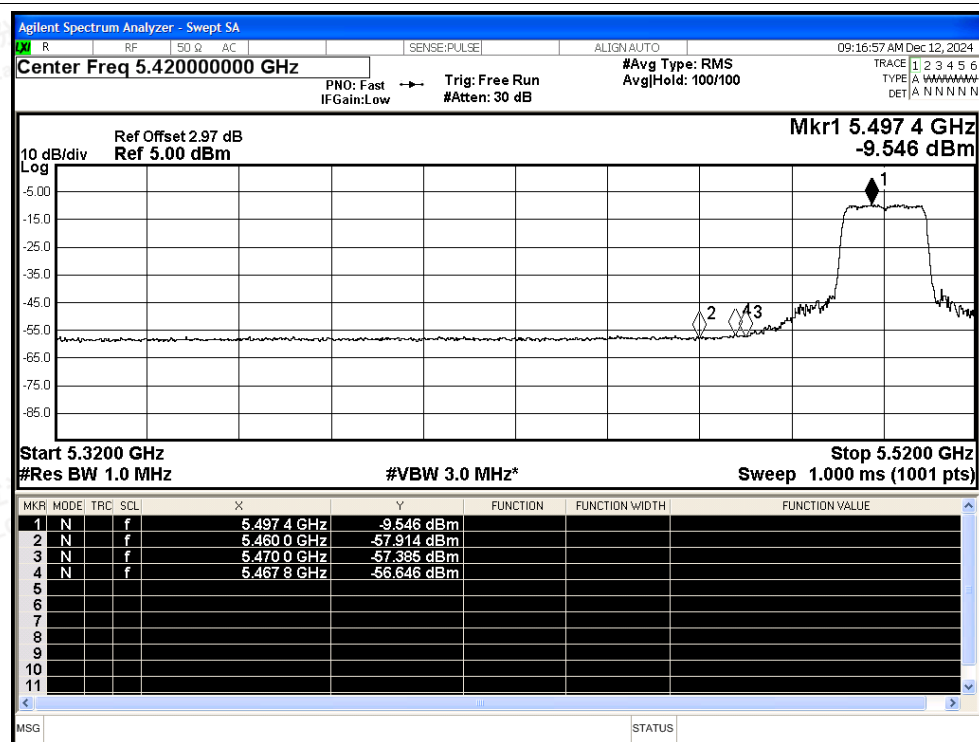

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5700MHz Ant1 Peak

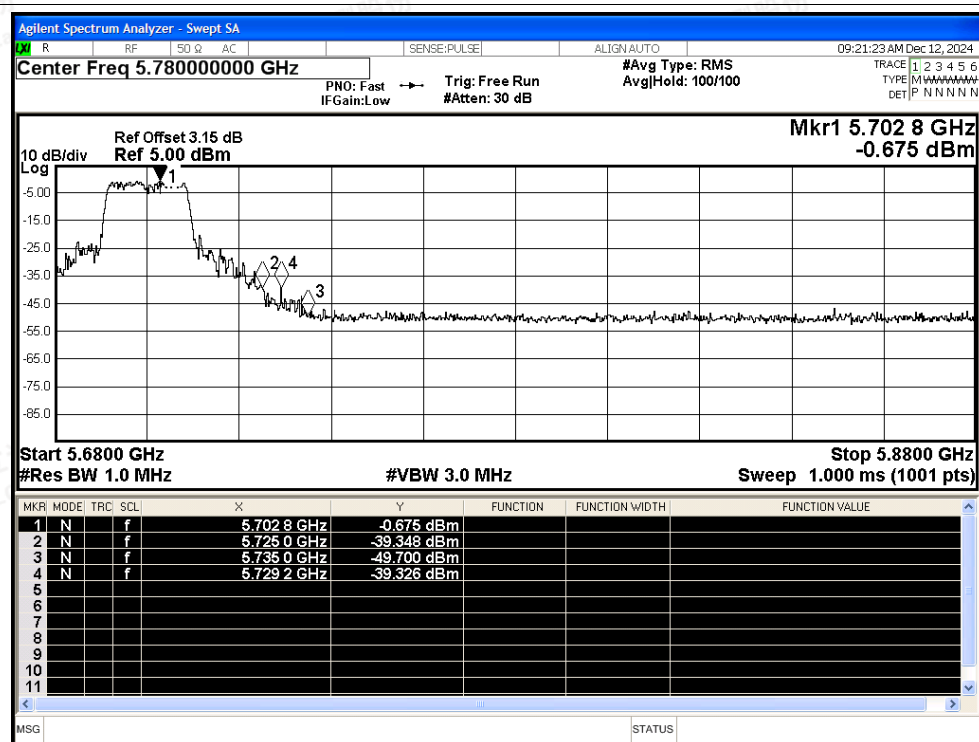

Restrict Band NVNT n20 5700MHz Ant1 Average

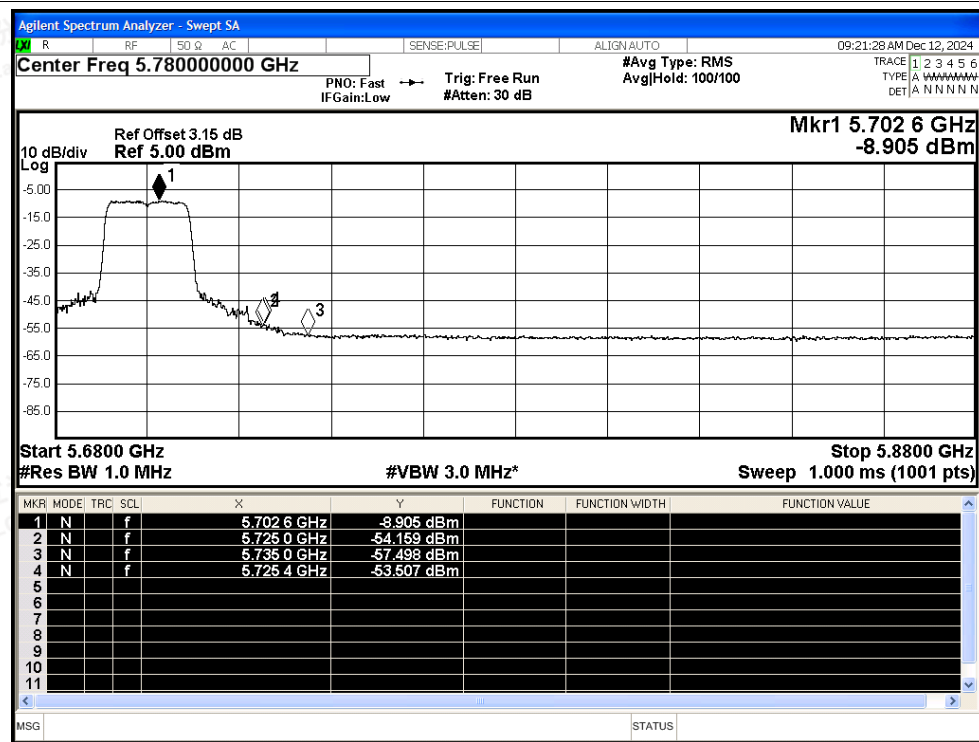

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5510MHz Ant1 Peak

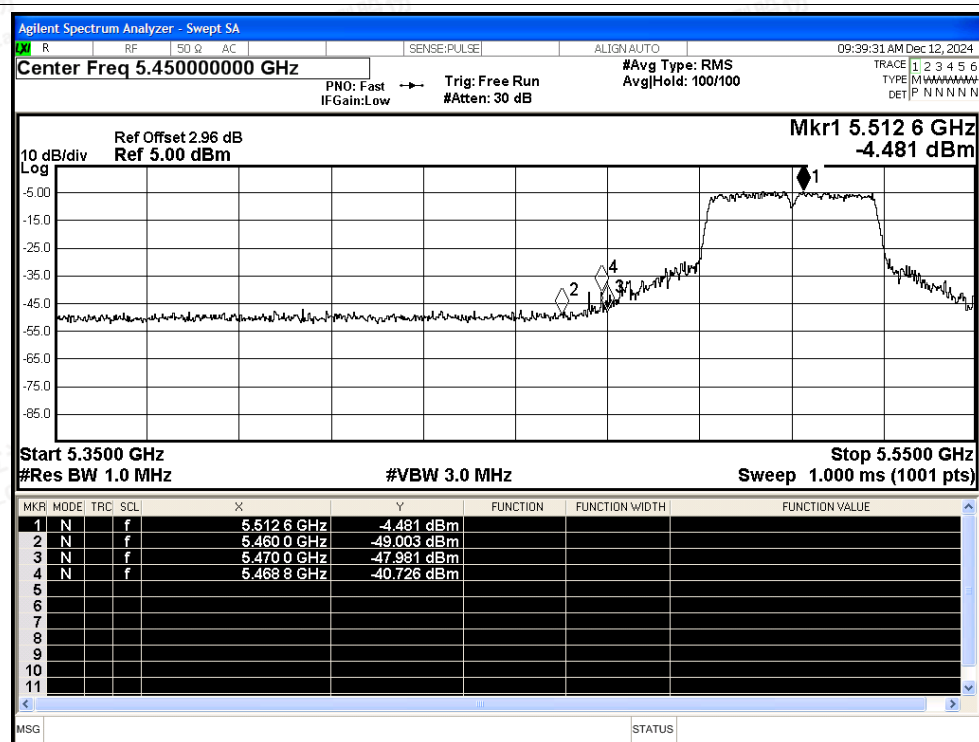

Restrict Band NVNT n40 5510MHz Ant1 Average

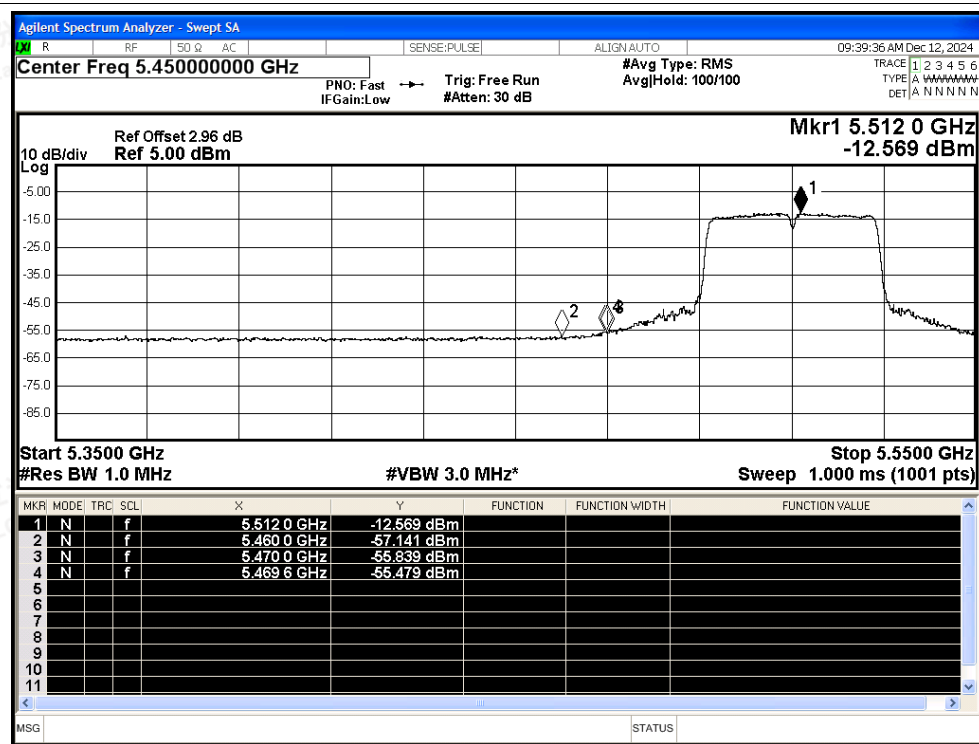

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5670MHz Ant1 Peak

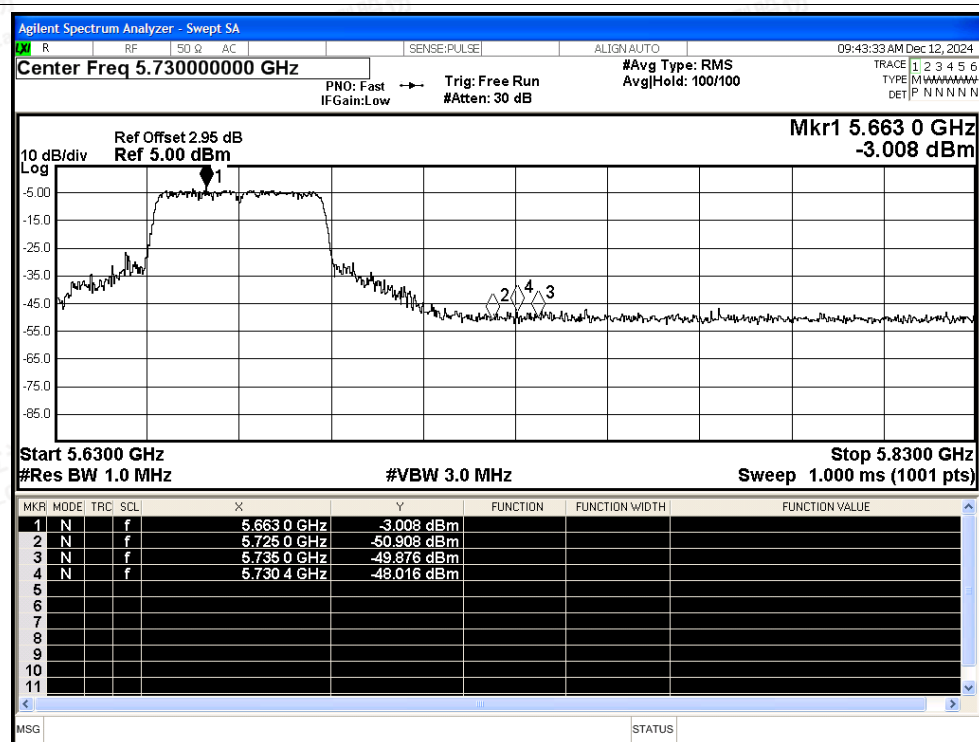

Restrict Band NVNT n40 5670MHz Ant1 Average

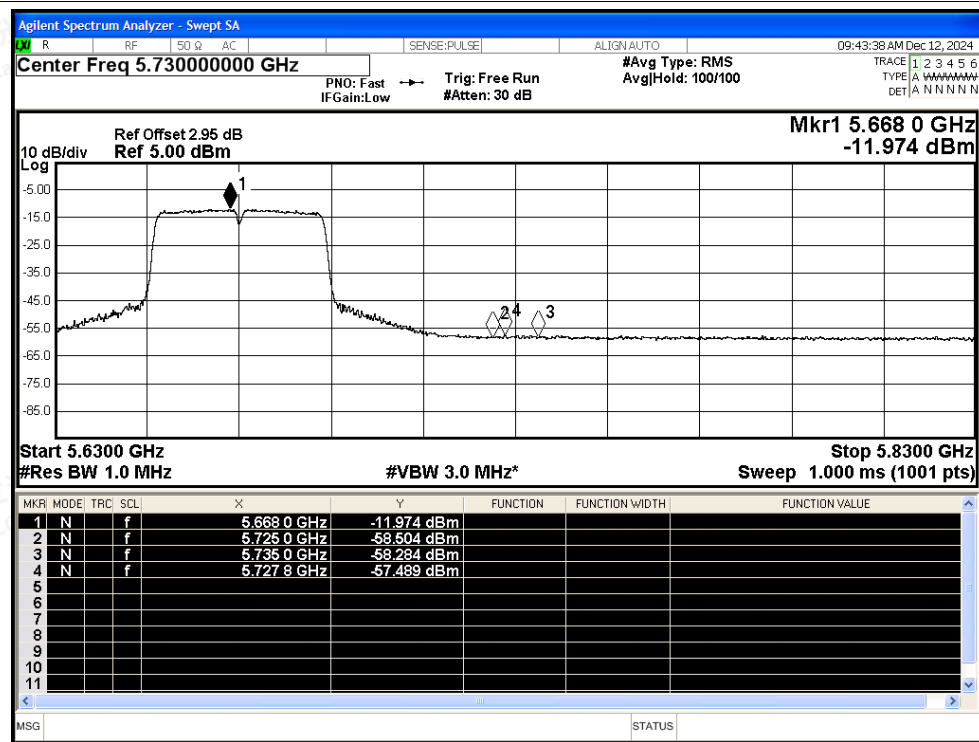

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5500MHz Ant1 Peak

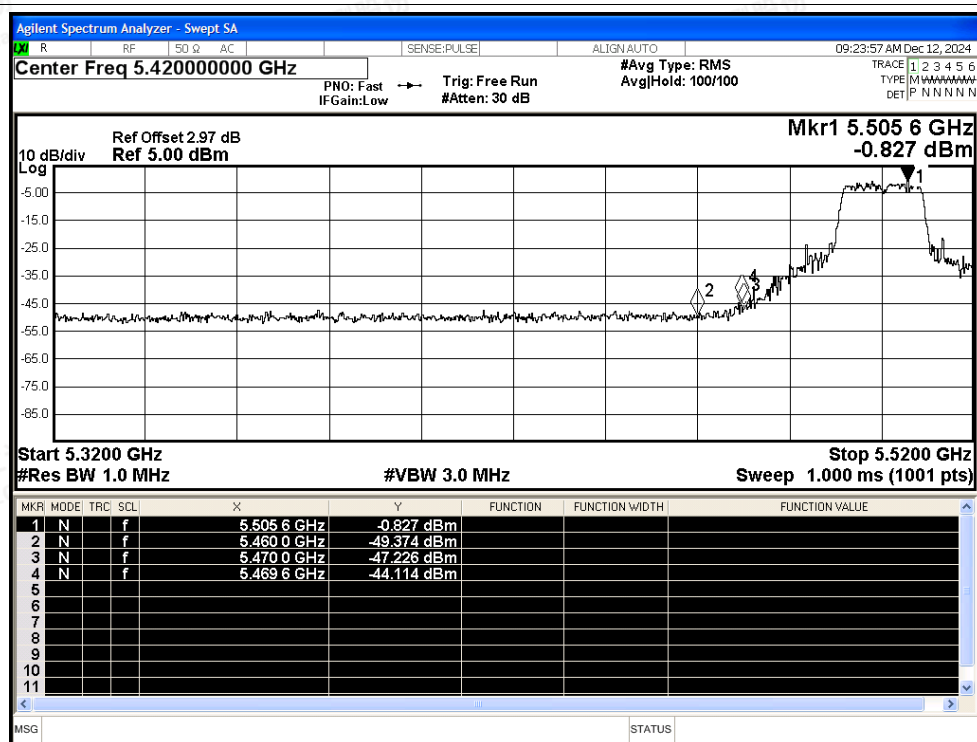

Restrict Band NVNT ac20 5500MHz Ant1 Average

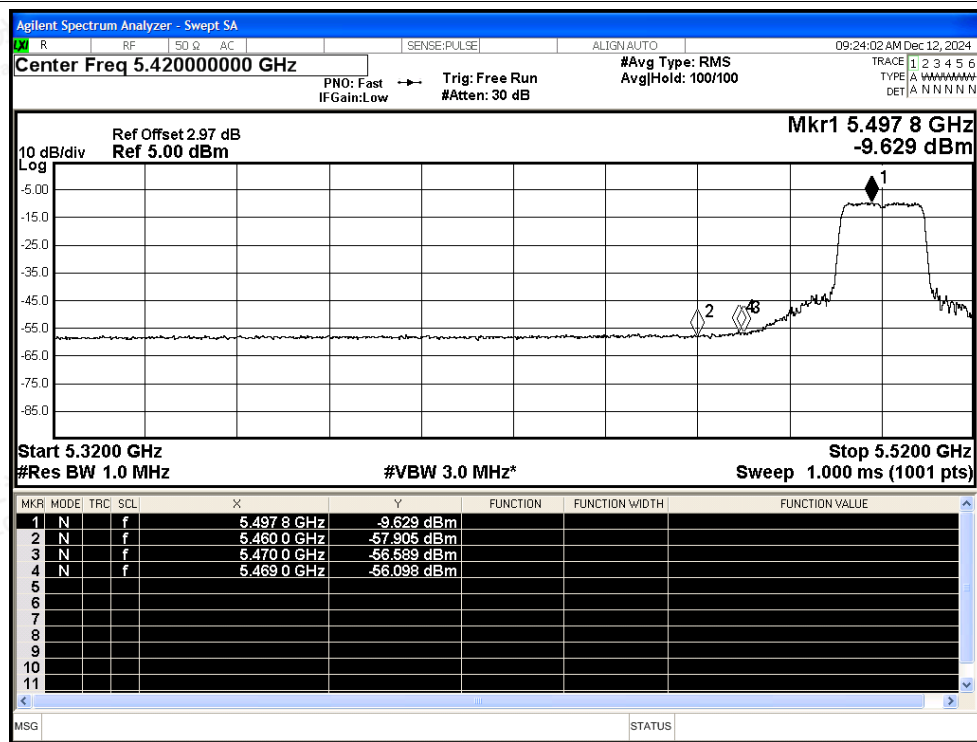

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5700MHz Ant1 Peak

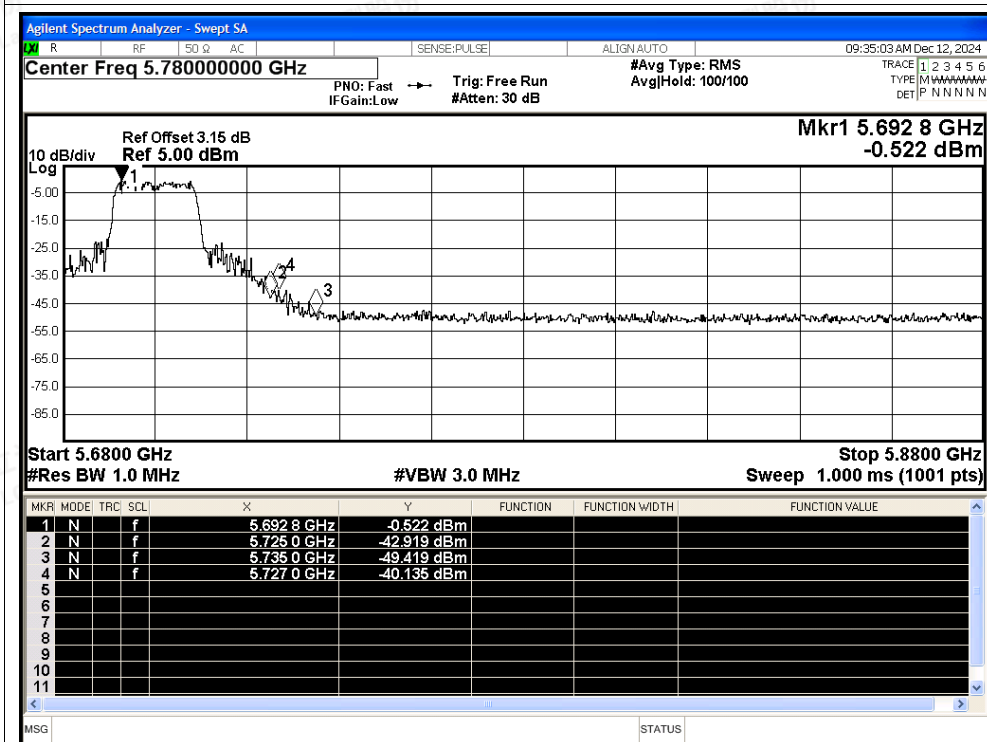

Restrict Band NVNT ac20 5700MHz Ant1 Average

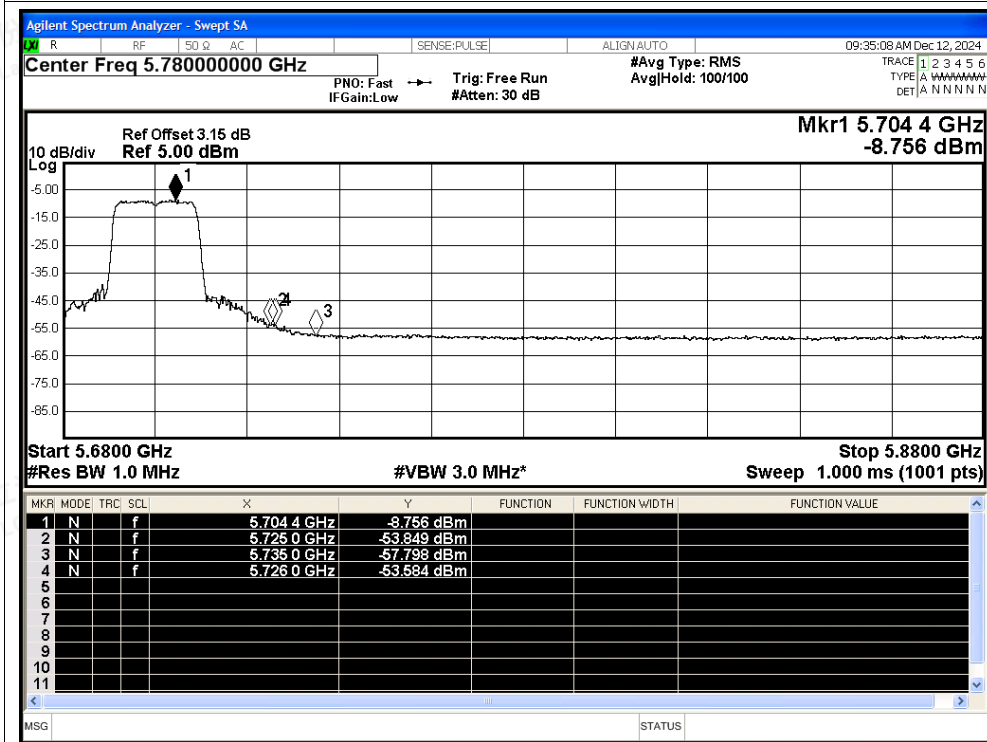

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5510MHz Ant1 Peak

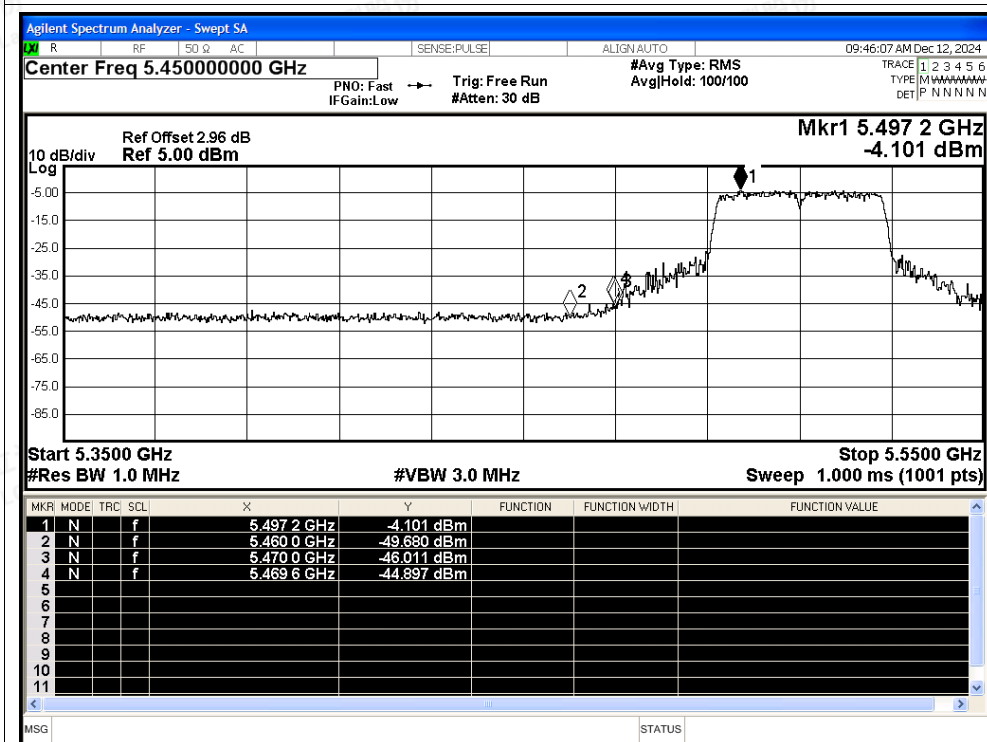

Restrict Band NVNT ac40 5510MHz Ant1 Average

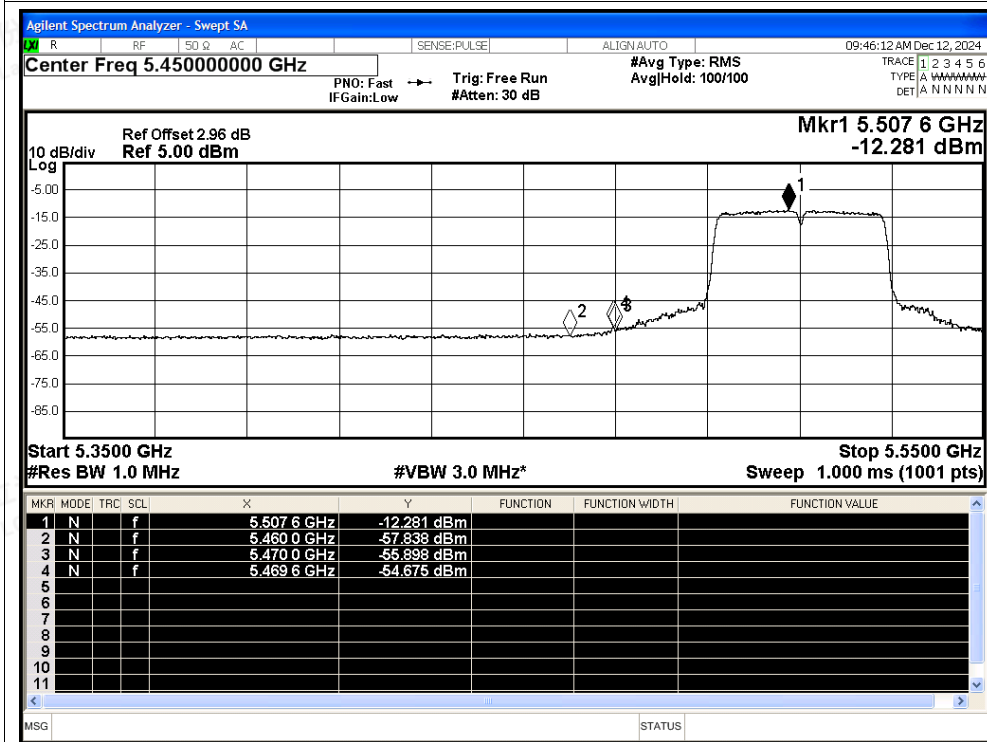

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5670MHz Ant1 Peak

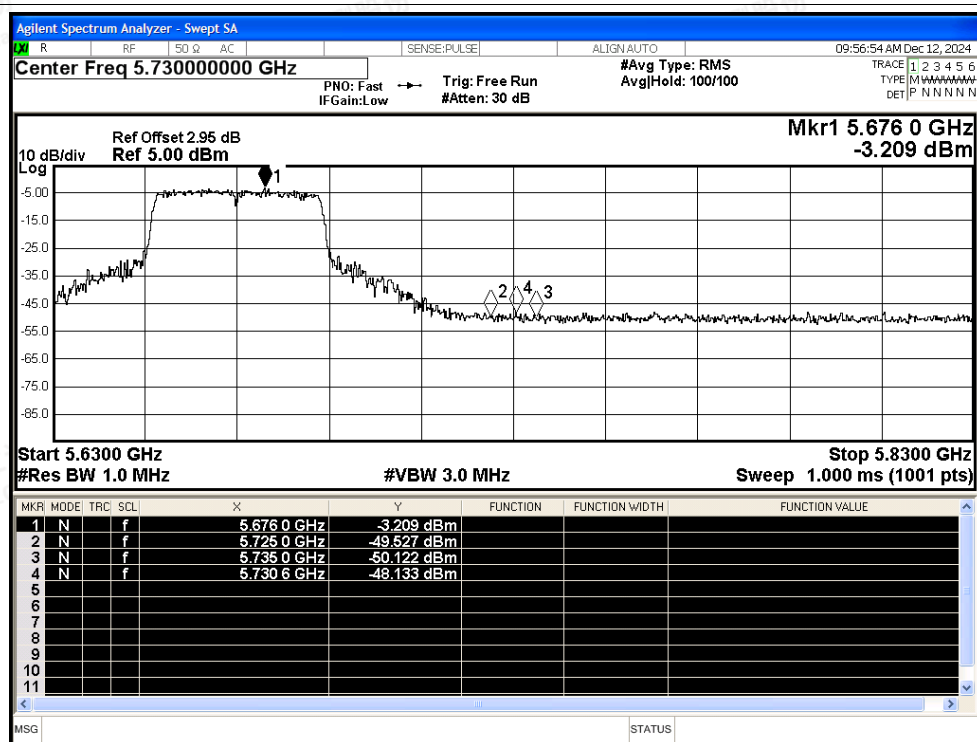

Restrict Band NVNT ac40 5670MHz Ant1 Average

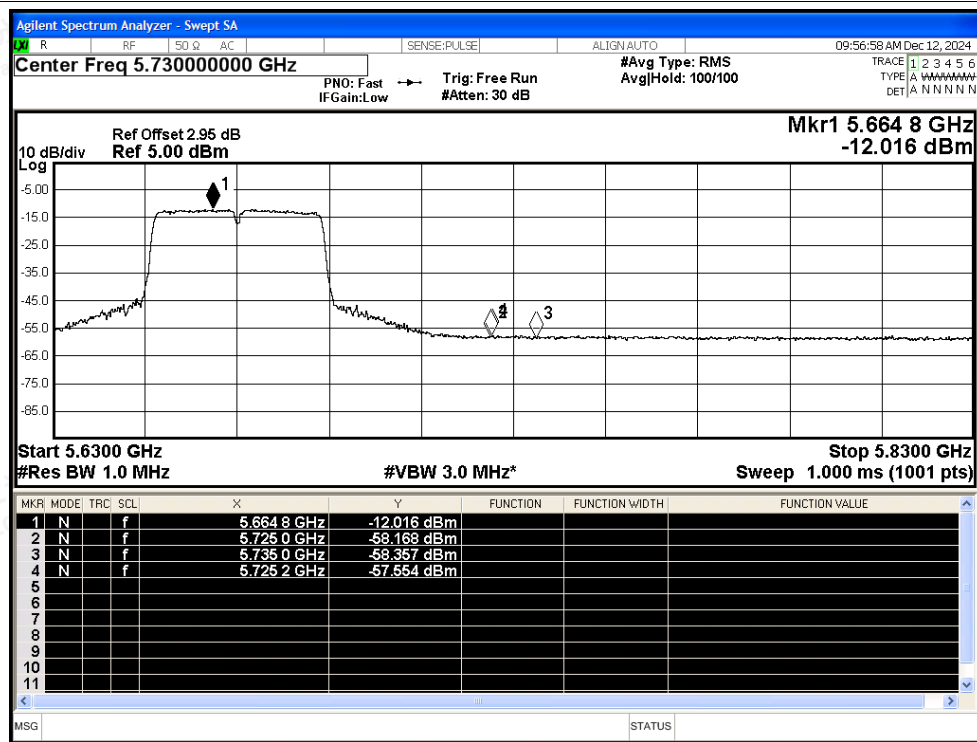

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5530MHz Ant1 Peak

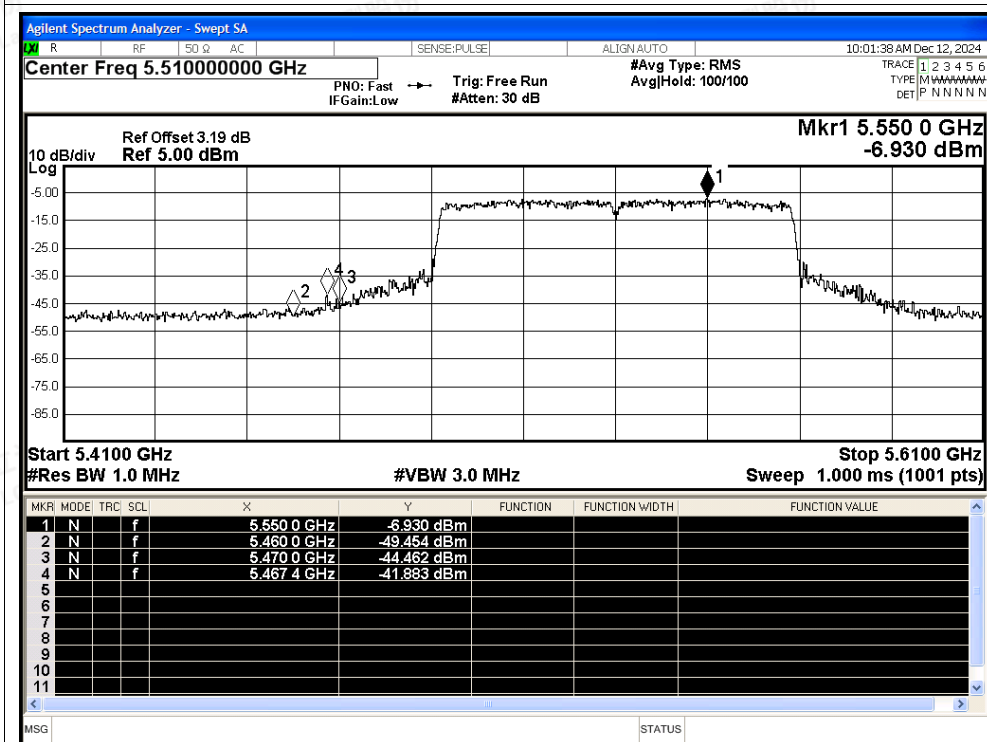

Restrict Band NVNT ac80 5530MHz Ant1 Average

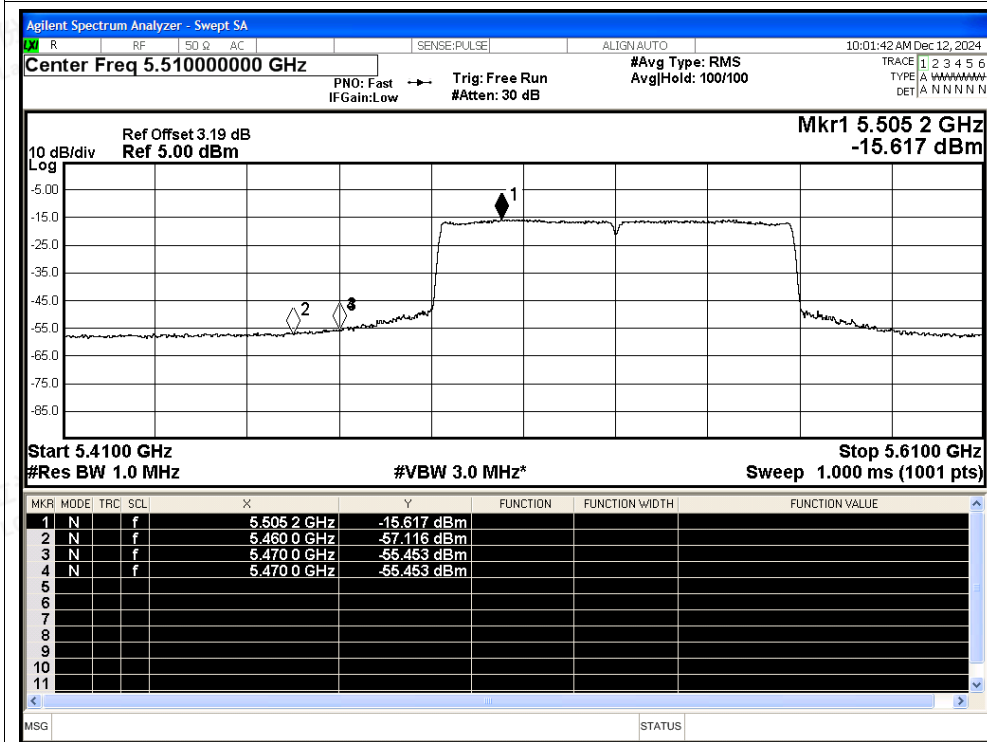

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5610MHz Ant1 Peak

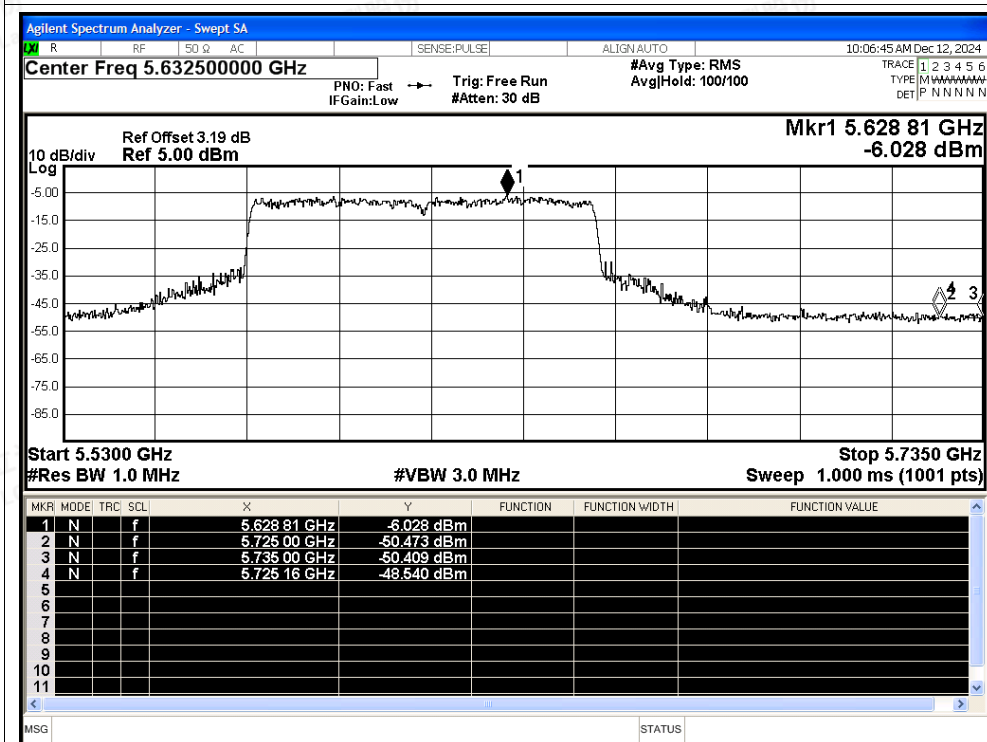

Restrict Band NVNT ac80 5610MHz Ant1 Average

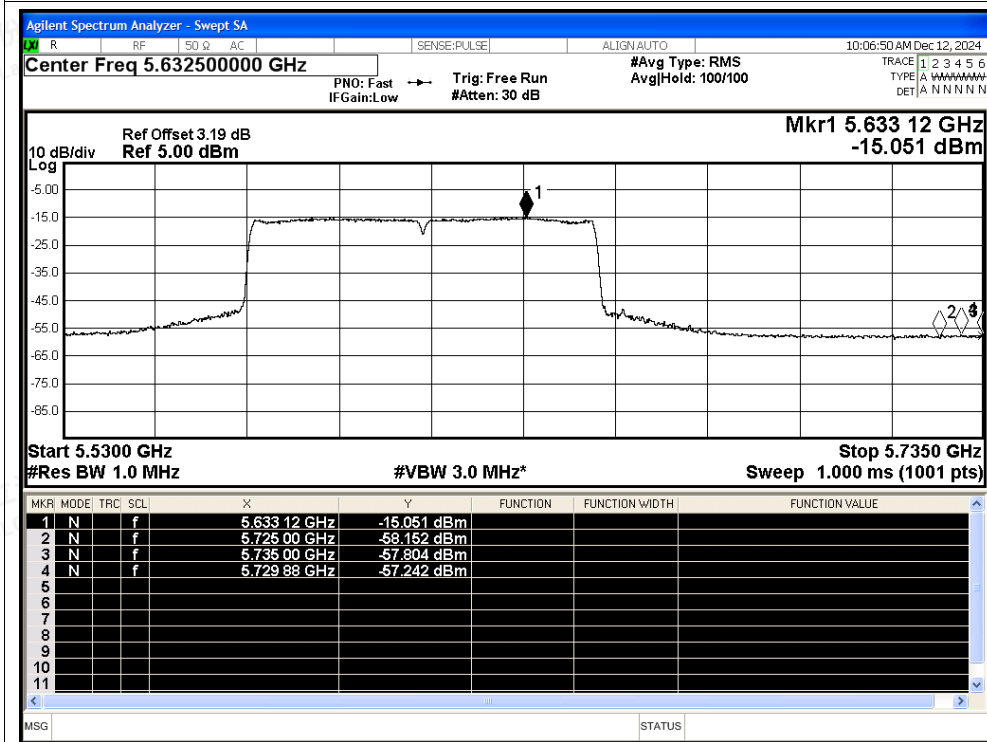

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5500MHz Ant1 Peak

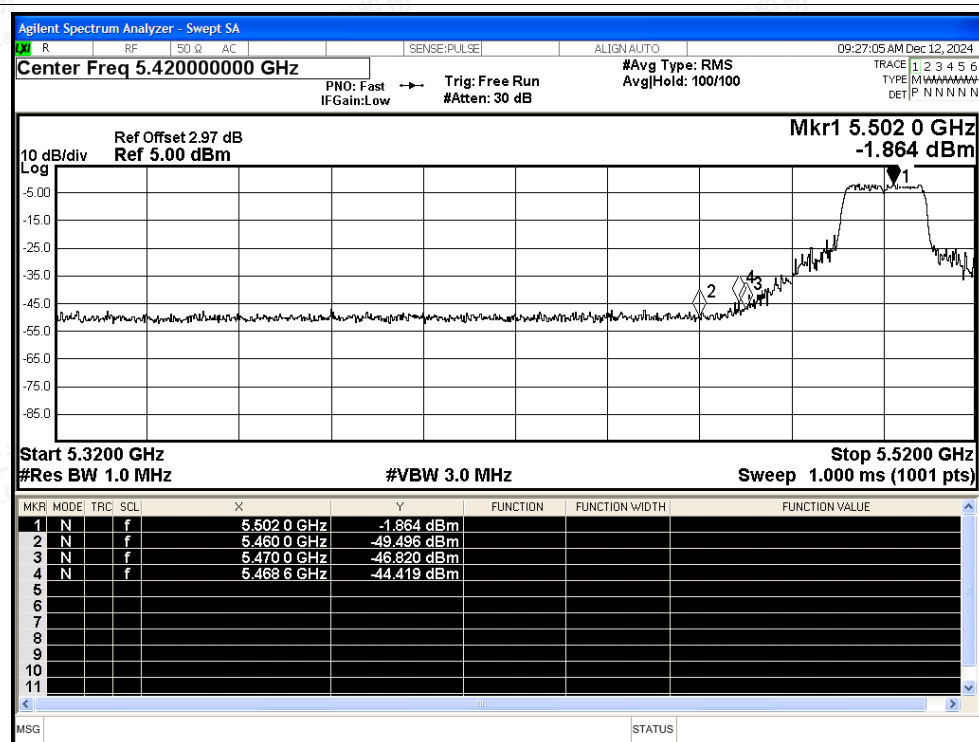

Restrict Band NVNT ax20 5500MHz Ant1 Average

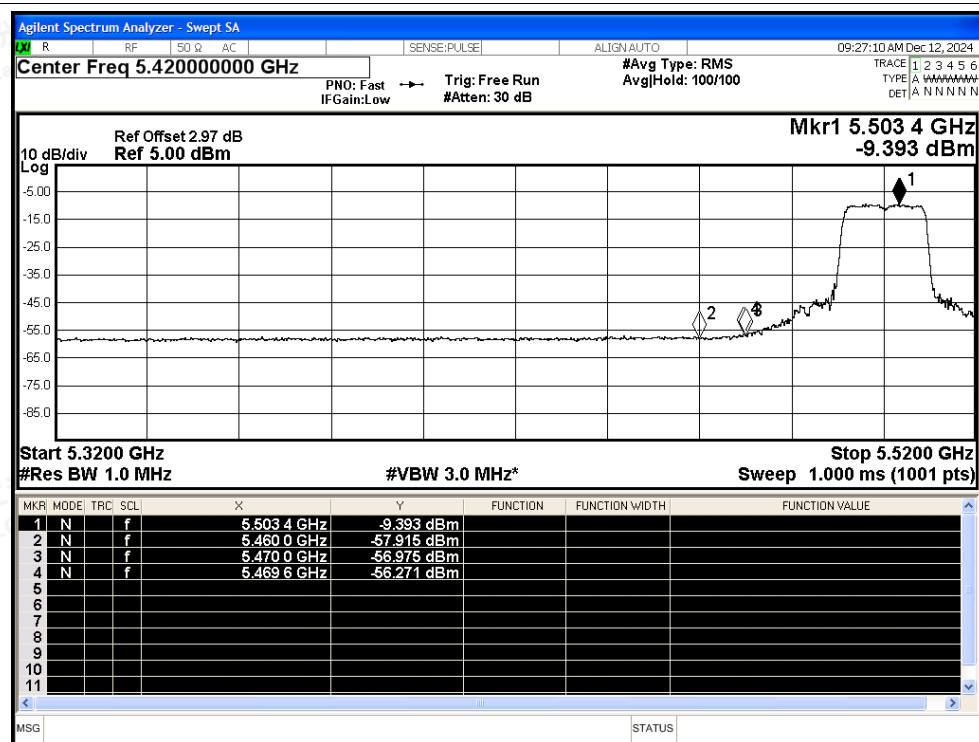

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5700MHz Ant1 Peak

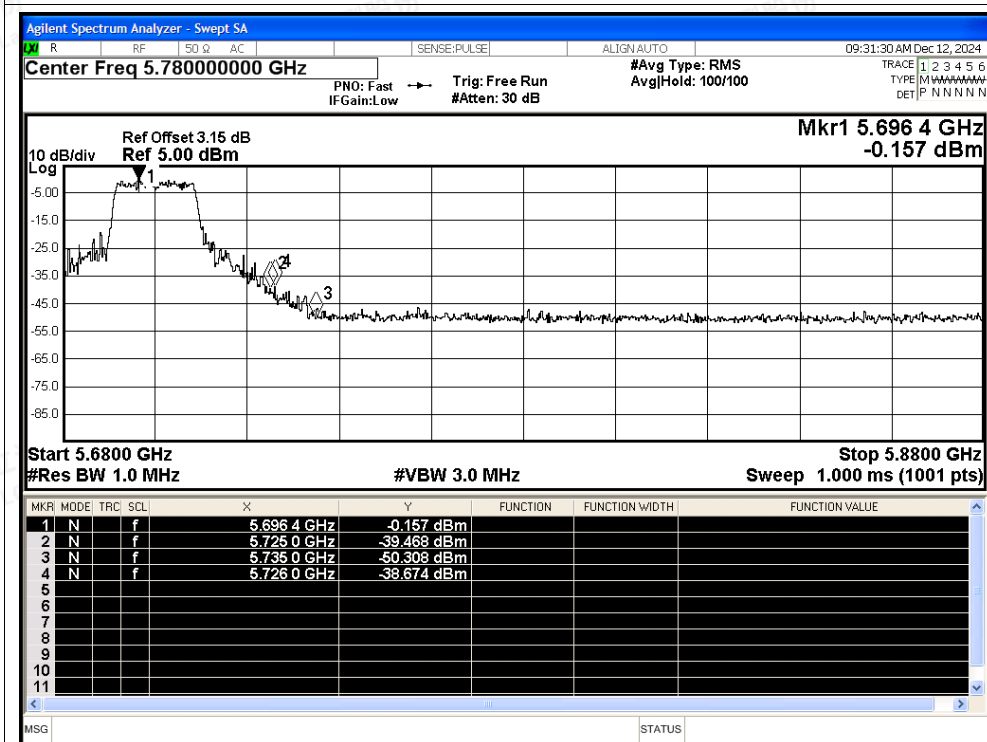

Restrict Band NVNT ax20 5700MHz Ant1 Average

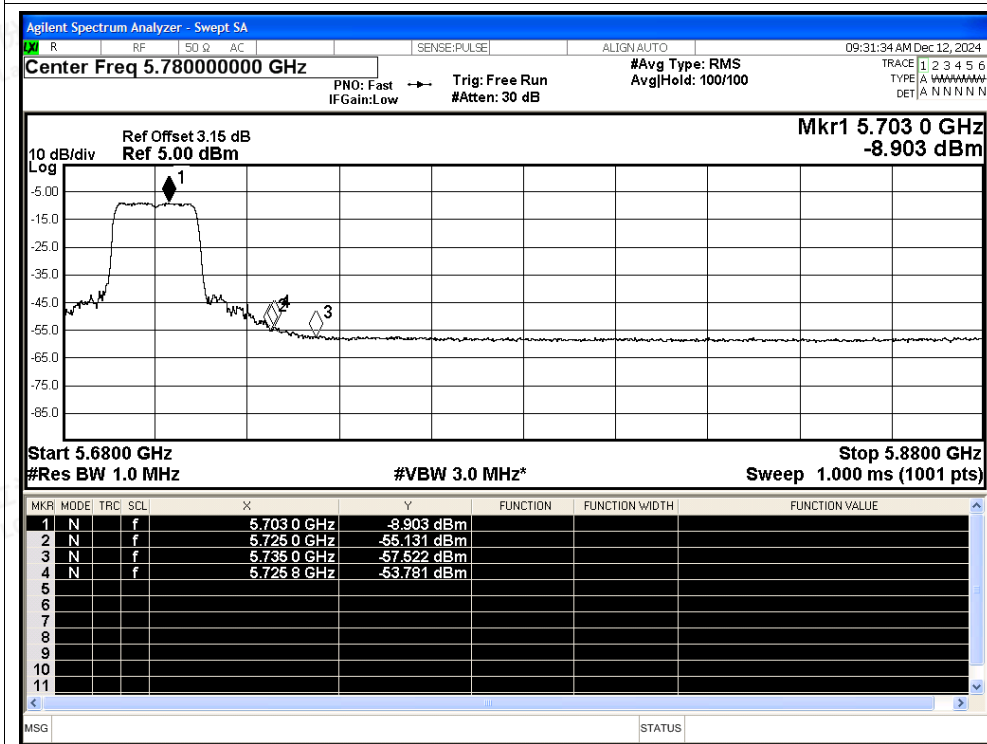

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5510MHz Ant1 Peak

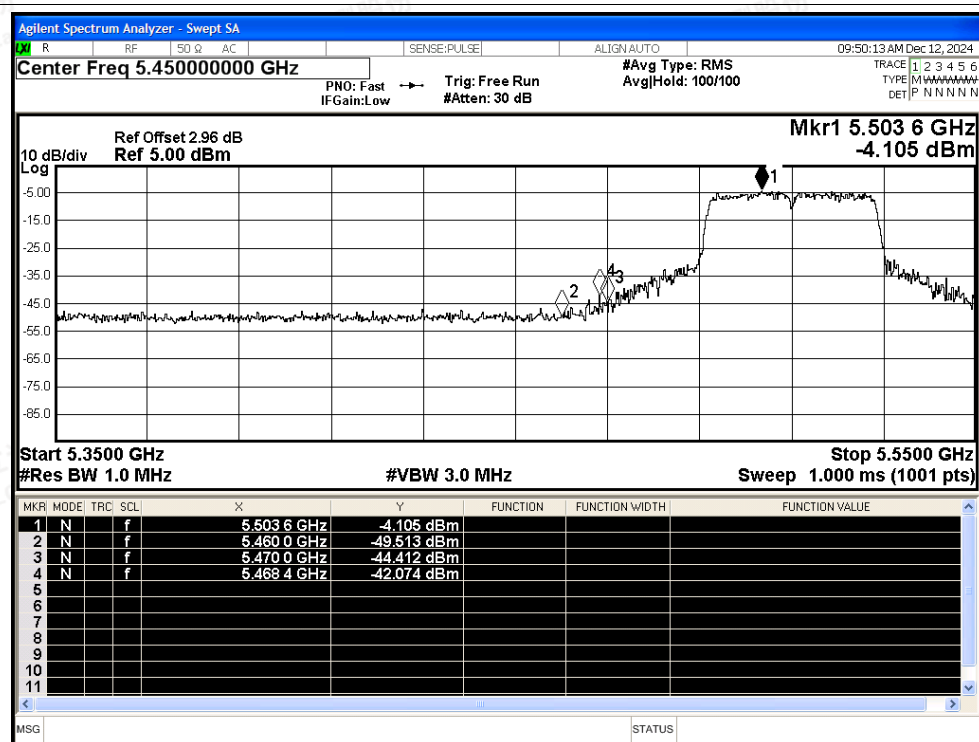

Restrict Band NVNT ax40 5510MHz Ant1 Average

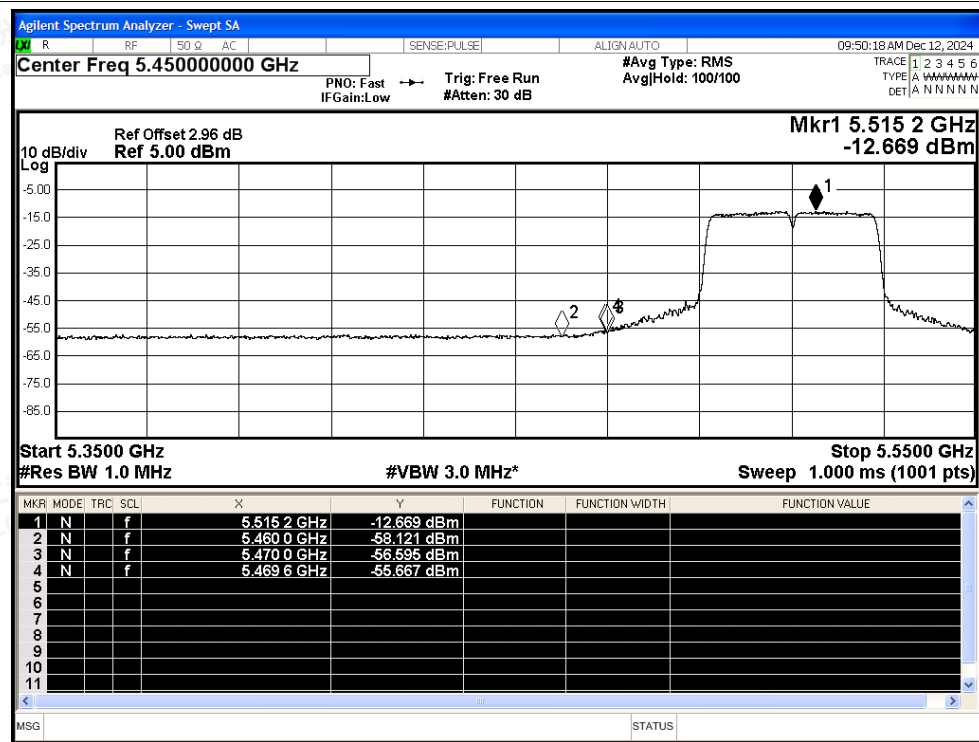

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5670MHz Ant1 Peak

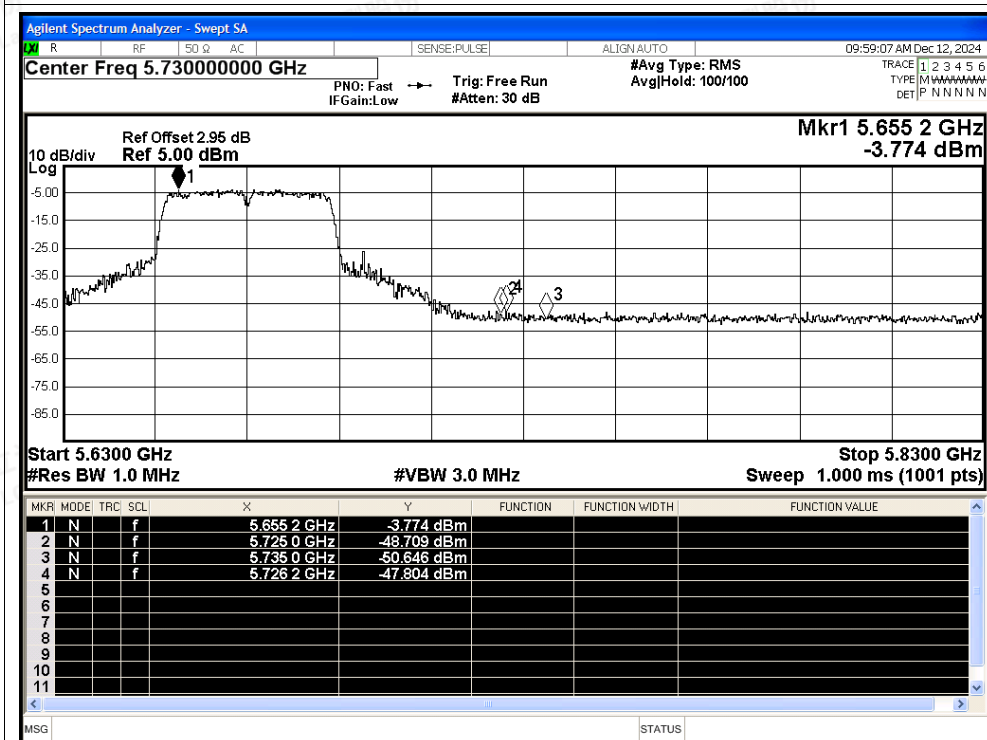

Restrict Band NVNT ax40 5670MHz Ant1 Average

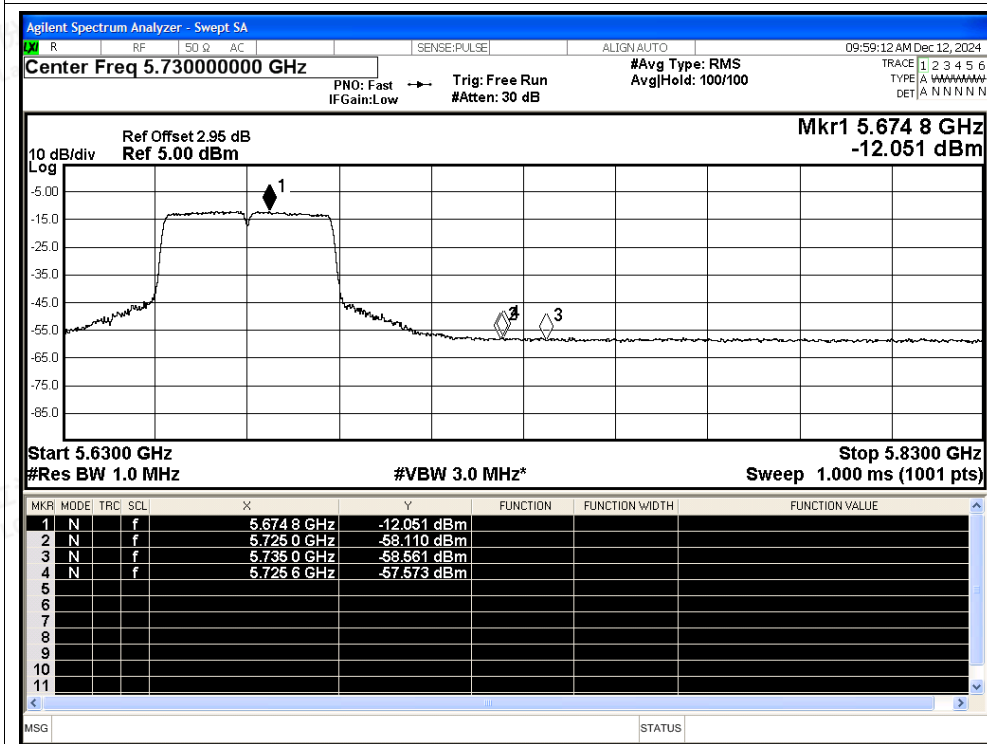

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5530MHz Ant1 Peak

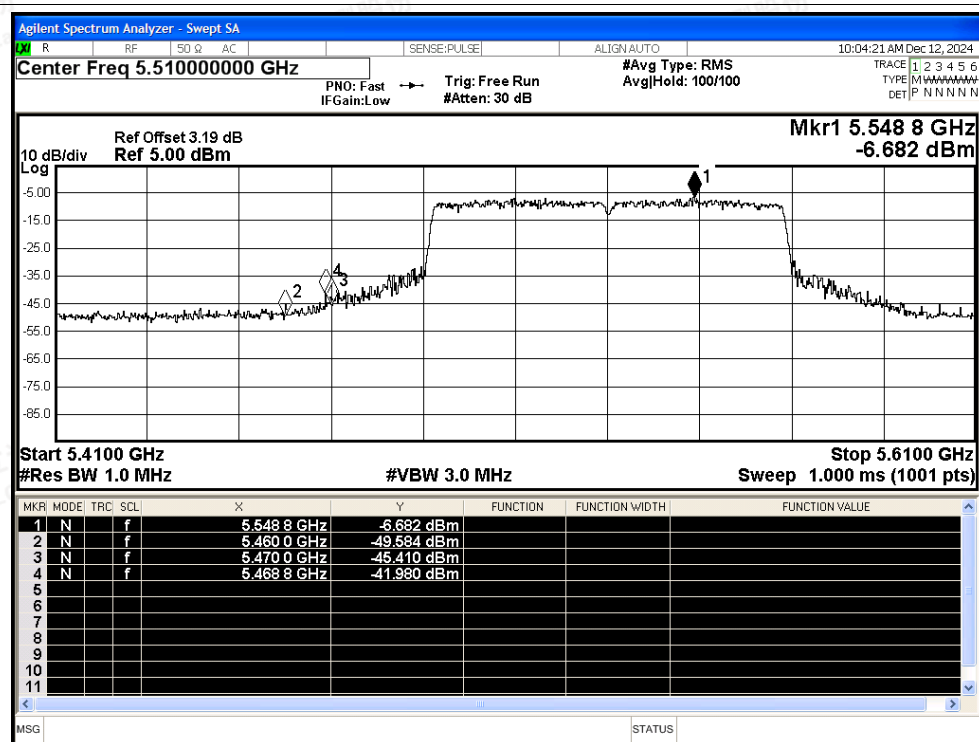

Restrict Band NVNT ax80 5530MHz Ant1 Average

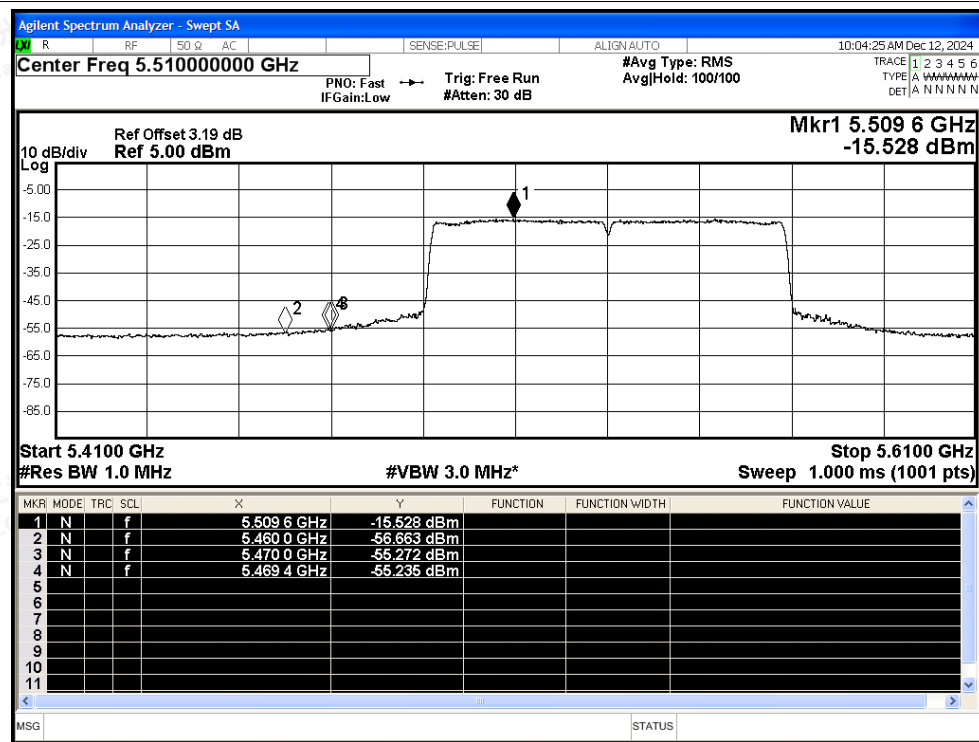

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5610MHz Ant1 Peak

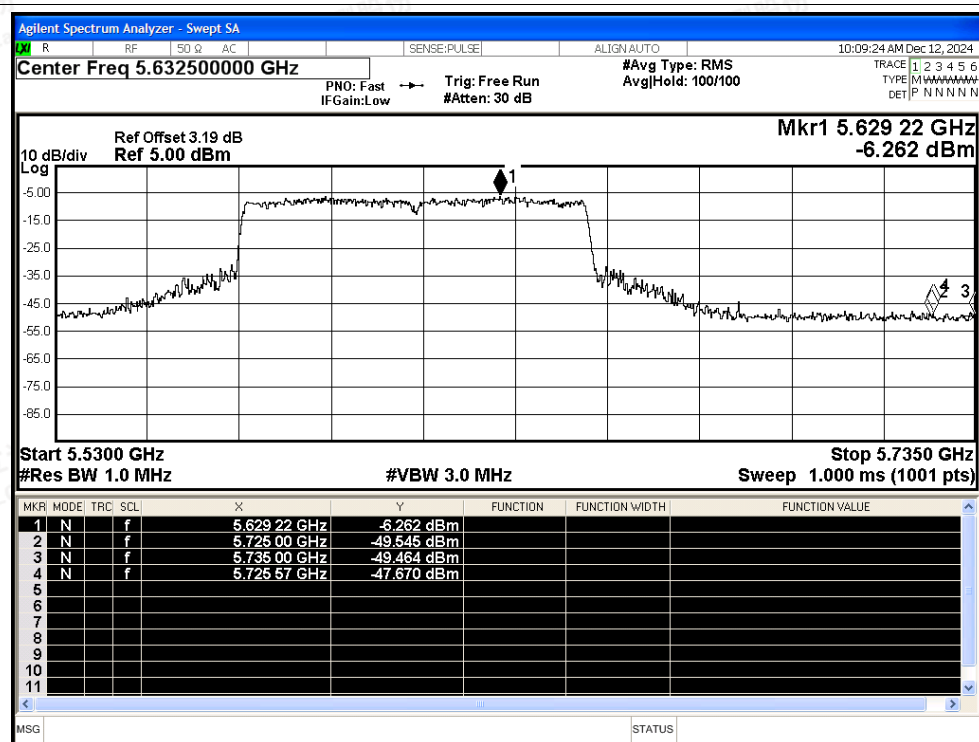

Restrict Band NVNT ax80 5610MHz Ant1 Average

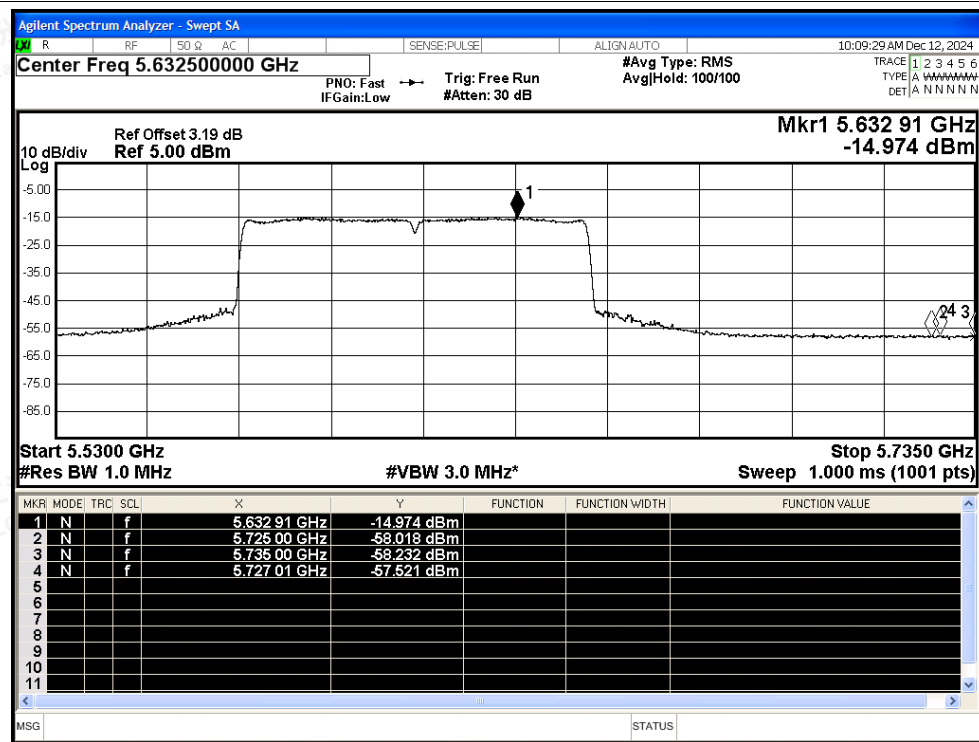

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5500	Ant2	5460	-51.07	3	-	47.16	Peak	68.2	Pass
NVNT	a	5500	Ant2	5460	-58.12	3	0.24	40.35	Average	54	Pass
NVNT	a	5500	Ant2	5469.4	-42.92	3	-	55.31	Peak	68.2	Pass
NVNT	a	5500	Ant2	5464.8	-56.69	3	0.24	41.78	Average	54	Pass
NVNT	a	5500	Ant2	5470	-47.53	3	-	50.70	Peak	68.2	Pass
NVNT	a	5500	Ant2	5470	-56.93	3	0.24	41.54	Average	54	Pass
NVNT	a	5700	Ant2	5725	-44.32	3	-	53.91	Peak	68.2	Pass
NVNT	a	5700	Ant2	5725	-55.36	3	0.24	43.11	Average	54	Pass
NVNT	a	5700	Ant2	5726.6	-40.49	3	-	57.74	Peak	68.2	Pass
NVNT	a	5700	Ant2	5725	-55.36	3	0.24	43.11	Average	54	Pass
NVNT	a	5700	Ant2	5735	-49.46	3	-	48.77	Peak	68.2	Pass
NVNT	a	5700	Ant2	5735	-57.52	3	0.24	40.95	Average	54	Pass
NVNT	n20	5500	Ant2	5460	-48.98	3	-	49.25	Peak	68.2	Pass
NVNT	n20	5500	Ant2	5460	-57.62	3	0.12	40.73	Average	54	Pass
NVNT	n20	5500	Ant2	5470	-43.44	3	-	54.79	Peak	68.2	Pass
NVNT	n20	5500	Ant2	5468.4	-56.38	3	0.12	41.97	Average	54	Pass
NVNT	n20	5500	Ant2	5470	-43.44	3	-	54.79	Peak	68.2	Pass
NVNT	n20	5500	Ant2	5470	-56.73	3	0.12	41.62	Average	54	Pass
NVNT	n20	5700	Ant2	5725	-43.08	3	-	55.15	Peak	68.2	Pass
NVNT	n20	5700	Ant2	5725	-53.31	3	0.12	45.04	Average	54	Pass
NVNT	n20	5700	Ant2	5726.8	-38.62	3	-	59.61	Peak	68.2	Pass
NVNT	n20	5700	Ant2	5725	-53.31	3	0.12	45.04	Average	54	Pass
NVNT	n20	5700	Ant2	5735	-48.66	3	-	49.57	Peak	68.2	Pass
NVNT	n20	5700	Ant2	5735	-57.17	3	0.12	41.18	Average	54	Pass
NVNT	n40	5510	Ant2	5460	-49.48	3	-	48.75	Peak	68.2	Pass
NVNT	n40	5510	Ant2	5460	-57.91	3	0.23	40.55	Average	54	Pass
NVNT	n40	5510	Ant2	5469.2	-40.24	3	-	57.99	Peak	68.2	Pass
NVNT	n40	5510	Ant2	5469.6	-54.77	3	0.23	43.69	Average	54	Pass
NVNT	n40	5510	Ant2	5470	-41.91	3	-	56.32	Peak	68.2	Pass
NVNT	n40	5510	Ant2	5470	-55.69	3	0.23	42.77	Average	54	Pass
NVNT	n40	5670	Ant2	5725	-49.8	3	-	48.43	Peak	68.2	Pass
NVNT	n40	5670	Ant2	5725	-57.62	3	0.24	40.85	Average	54	Pass
NVNT	n40	5670	Ant2	5733.4	-48.68	3	-	49.55	Peak	68.2	Pass
NVNT	n40	5670	Ant2	5725	-57.62	3	0.24	40.85	Average	54	Pass
NVNT	n40	5670	Ant2	5735	-50.37	3	-	47.86	Peak	68.2	Pass
NVNT	n40	5670	Ant2	5735	-58.44	3	0.24	40.03	Average	54	Pass
NVNT	ac20	5500	Ant2	5460	-48.81	3	-	49.42	Peak	68.2	Pass
NVNT	ac20	5500	Ant2	5460	-57.63	3	0.12	40.72	Average	54	Pass
NVNT	ac20	5500	Ant2	5470	-44.04	3	-	54.19	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5500	Ant2	5469	-56.2	3	0.12	42.15	Average	54	Pass
NVNT	ac20	5500	Ant2	5470	-44.04	3	-	54.19	Peak	68.2	Pass
NVNT	ac20	5500	Ant2	5470	-56.84	3	0.12	41.51	Average	54	Pass
NVNT	ac20	5700	Ant2	5725	-39.05	3	-	59.18	Peak	68.2	Pass
NVNT	ac20	5700	Ant2	5725	-53.88	3	0.12	44.47	Average	54	Pass
NVNT	ac20	5700	Ant2	5725.2	-35.54	3	-	62.69	Peak	68.2	Pass
NVNT	ac20	5700	Ant2	5725.6	-52.67	3	0.12	45.68	Average	54	Pass
NVNT	ac20	5700	Ant2	5735	-50.56	3	-	47.67	Peak	68.2	Pass
NVNT	ac20	5700	Ant2	5735	-57.1	3	0.12	41.25	Average	54	Pass
NVNT	ac40	5510	Ant2	5460	-50.07	3	-	48.16	Peak	68.2	Pass
NVNT	ac40	5510	Ant2	5460	-57.92	3	0.24	40.55	Average	54	Pass
NVNT	ac40	5510	Ant2	5466	-42.64	3	-	55.59	Peak	68.2	Pass
NVNT	ac40	5510	Ant2	5469.8	-55.86	3	0.24	42.61	Average	54	Pass
NVNT	ac40	5510	Ant2	5470	-47.59	3	-	50.64	Peak	68.2	Pass
NVNT	ac40	5510	Ant2	5470	-55.86	3	0.24	42.61	Average	54	Pass
NVNT	ac40	5670	Ant2	5725	-48.9	3	-	49.33	Peak	68.2	Pass
NVNT	ac40	5670	Ant2	5725	-58.24	3	0.24	40.23	Average	54	Pass
NVNT	ac40	5670	Ant2	5734.4	-47.13	3	-	51.10	Peak	68.2	Pass
NVNT	ac40	5670	Ant2	5732.2	-57.4	3	0.24	41.07	Average	54	Pass
NVNT	ac40	5670	Ant2	5735	-50.3	3	-	47.93	Peak	68.2	Pass
NVNT	ac40	5670	Ant2	5735	-58.39	3	0.24	40.08	Average	54	Pass
NVNT	ac80	5530	Ant2	5460	-47.55	3	-	50.68	Peak	68.2	Pass
NVNT	ac80	5530	Ant2	5460	-56.77	3	0.25	41.71	Average	54	Pass
NVNT	ac80	5530	Ant2	5469.4	-42.19	3	-	56.04	Peak	68.2	Pass
NVNT	ac80	5530	Ant2	5470	-55.01	3	0.25	43.47	Average	54	Pass
NVNT	ac80	5530	Ant2	5470	-45.36	3	-	52.87	Peak	68.2	Pass
NVNT	ac80	5530	Ant2	5470	-55.01	3	0.25	43.47	Average	54	Pass
NVNT	ac80	5610	Ant2	5725	-48.8	3	-	49.43	Peak	68.2	Pass
NVNT	ac80	5610	Ant2	5725	-57.48	3	0.25	41.00	Average	54	Pass
NVNT	ac80	5610	Ant2	5728.235	-47.99	3	-	50.24	Peak	68.2	Pass
NVNT	ac80	5610	Ant2	5727.825	-57.29	3	0.25	41.19	Average	54	Pass
NVNT	ac80	5610	Ant2	5735	-50.42	3	-	47.81	Peak	68.2	Pass
NVNT	ac80	5610	Ant2	5735	-57.7	3	0.25	40.78	Average	54	Pass
NVNT	ax20	5500	Ant2	5460	-49.5	3	-	48.73	Peak	68.2	Pass
NVNT	ax20	5500	Ant2	5460	-57.52	3	0.12	40.83	Average	54	Pass
NVNT	ax20	5500	Ant2	5466.4	-43.67	3	-	54.56	Peak	68.2	Pass
NVNT	ax20	5500	Ant2	5468.4	-56.48	3	0.12	41.87	Average	54	Pass
NVNT	ax20	5500	Ant2	5470	-47.68	3	-	50.55	Peak	68.2	Pass
NVNT	ax20	5500	Ant2	5470	-56.54	3	0.12	41.81	Average	54	Pass
NVNT	ax20	5700	Ant2	5725	-41.31	3	-	56.92	Peak	68.2	Pass
NVNT	ax20	5700	Ant2	5725	-53.06	3	0.12	45.29	Average	54	Pass
NVNT	ax20	5700	Ant2	5725.2	-40.23	3	-	58.00	Peak	68.2	Pass
NVNT	ax20	5700	Ant2	5725	-53.06	3	0.12	45.29	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5700	Ant2	5735	-49.23	3	-	49.00	Peak	68.2	Pass
NVNT	ax20	5700	Ant2	5735	-57.2	3	0.12	41.15	Average	54	Pass
NVNT	ax40	5510	Ant2	5460	-48.61	3	-	49.62	Peak	68.2	Pass
NVNT	ax40	5510	Ant2	5460	-57.67	3	0.24	40.80	Average	54	Pass
NVNT	ax40	5510	Ant2	5469.4	-44.47	3	-	53.76	Peak	68.2	Pass
NVNT	ax40	5510	Ant2	5469.6	-55.12	3	0.24	43.35	Average	54	Pass
NVNT	ax40	5510	Ant2	5470	-44.93	3	-	53.30	Peak	68.2	Pass
NVNT	ax40	5510	Ant2	5470	-56.29	3	0.24	42.18	Average	54	Pass
NVNT	ax40	5670	Ant2	5725	-50.65	3	-	47.58	Peak	68.2	Pass
NVNT	ax40	5670	Ant2	5725	-57.73	3	0.24	40.74	Average	54	Pass
NVNT	ax40	5670	Ant2	5733.6	-48.09	3	-	50.14	Peak	68.2	Pass
NVNT	ax40	5670	Ant2	5734.8	-57.61	3	0.24	40.86	Average	54	Pass
NVNT	ax40	5670	Ant2	5735	-51.03	3	-	47.20	Peak	68.2	Pass
NVNT	ax40	5670	Ant2	5735	-58	3	0.24	40.47	Average	54	Pass
NVNT	ax80	5530	Ant2	5460	-47.01	3	-	51.22	Peak	68.2	Pass
NVNT	ax80	5530	Ant2	5460	-57.12	3	0.25	41.36	Average	54	Pass
NVNT	ax80	5530	Ant2	5469	-43.17	3	-	55.06	Peak	68.2	Pass
NVNT	ax80	5530	Ant2	5469	-55.4	3	0.25	43.08	Average	54	Pass
NVNT	ax80	5530	Ant2	5470	-44.85	3	-	53.38	Peak	68.2	Pass
NVNT	ax80	5530	Ant2	5470	-55.76	3	0.25	42.72	Average	54	Pass
NVNT	ax80	5610	Ant2	5725	-49.71	3	-	48.52	Peak	68.2	Pass
NVNT	ax80	5610	Ant2	5725	-57.9	3	0.25	40.58	Average	54	Pass
NVNT	ax80	5610	Ant2	5733.77	-47.05	3	-	51.18	Peak	68.2	Pass
NVNT	ax80	5610	Ant2	5727.825	-57.18	3	0.25	41.30	Average	54	Pass
NVNT	ax80	5610	Ant2	5735	-50.55	3	-	47.68	Peak	68.2	Pass
NVNT	ax80	5610	Ant2	5735	-57.4	3	0.25	41.08	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5500MHz Ant2 Peak

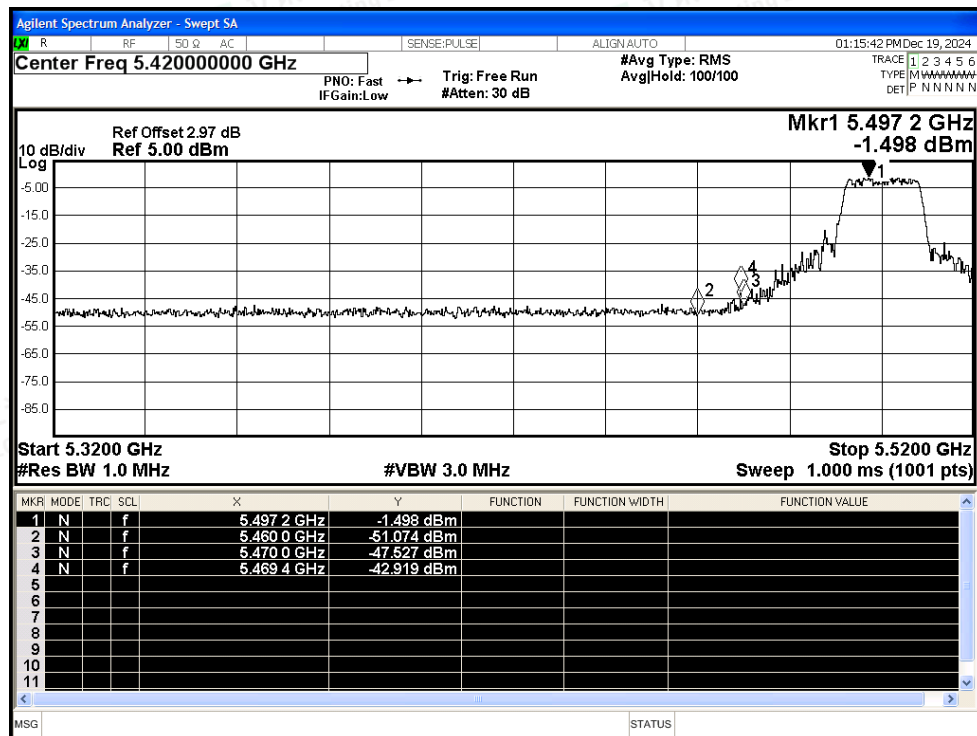

Restrict Band NVNT a 5500MHz Ant2 Average

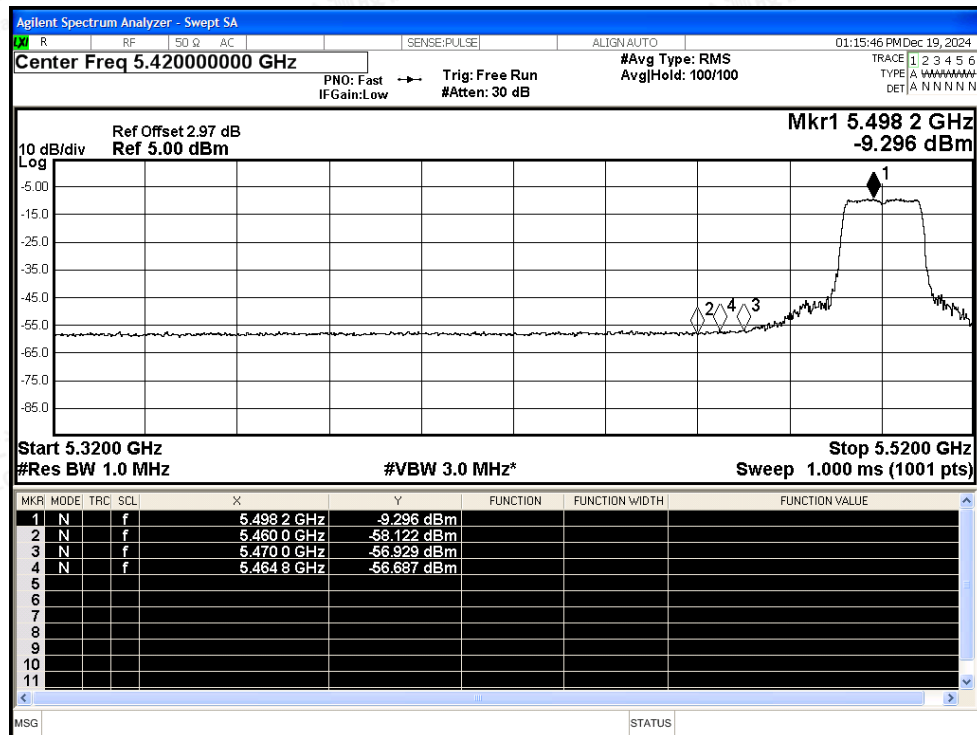

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5700MHz Ant2 Peak

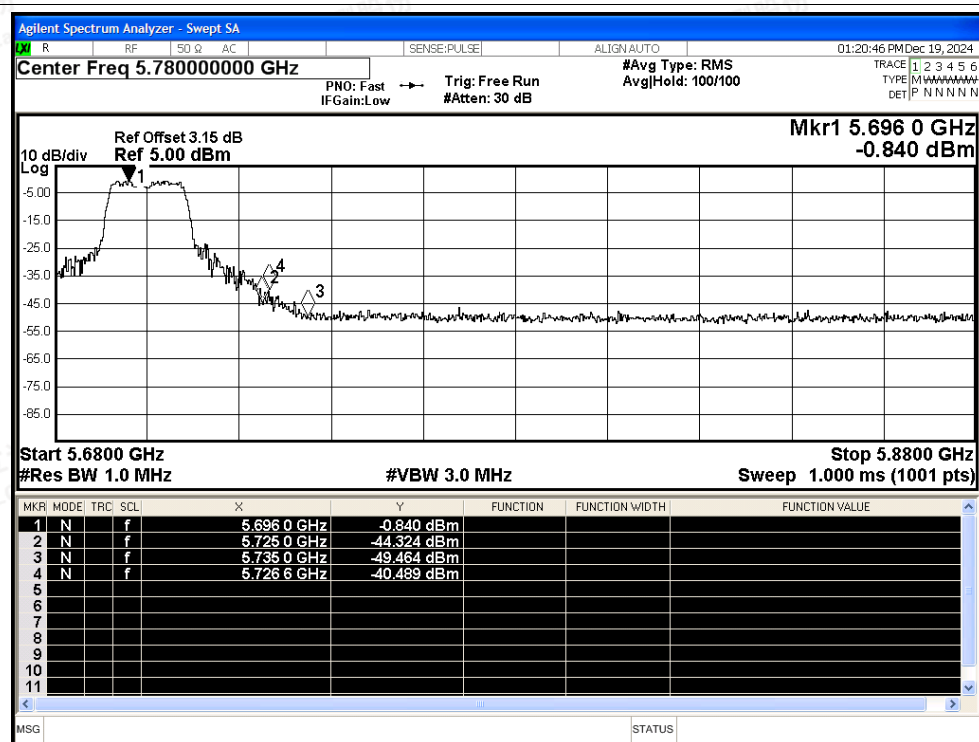

Restrict Band NVNT a 5700MHz Ant2 Average

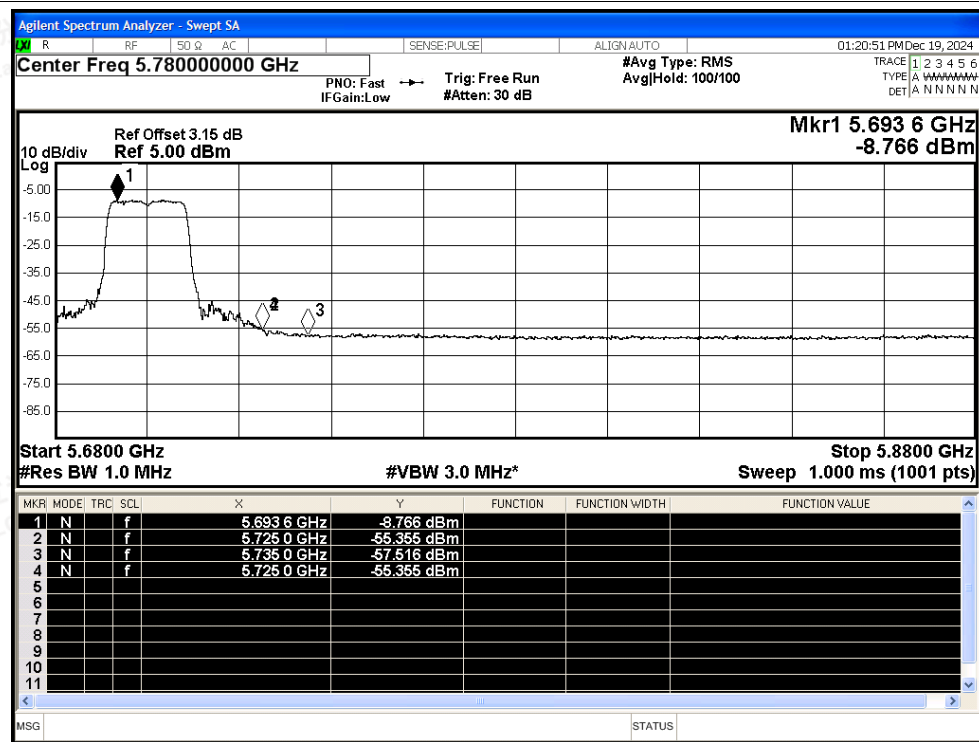

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5500MHz Ant2 Peak

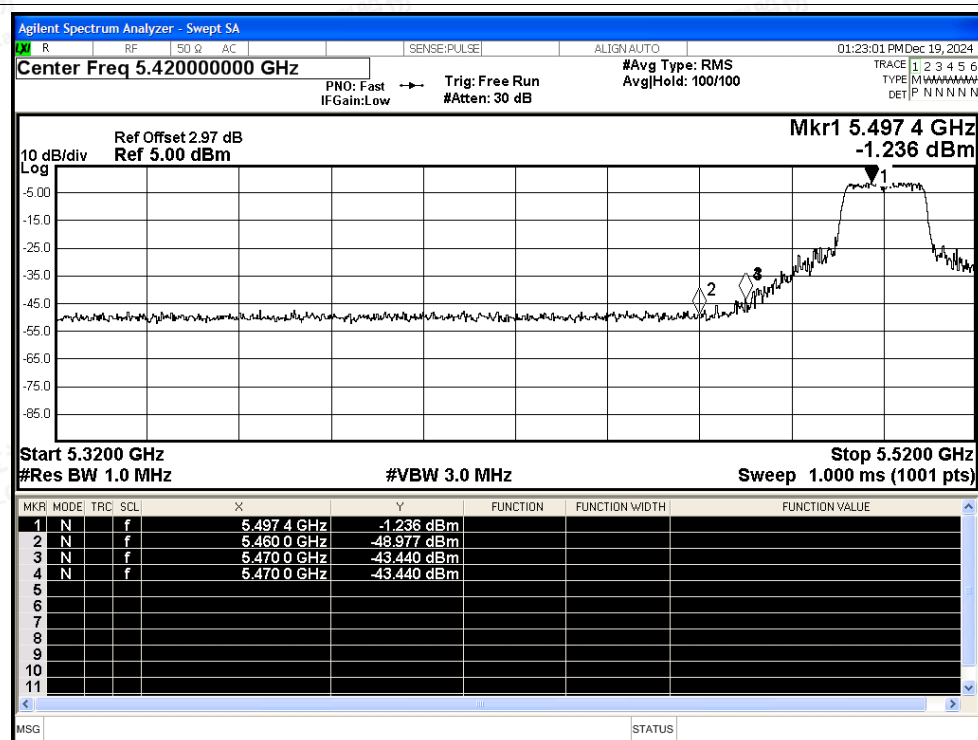

Restrict Band NVNT n20 5500MHz Ant2 Average

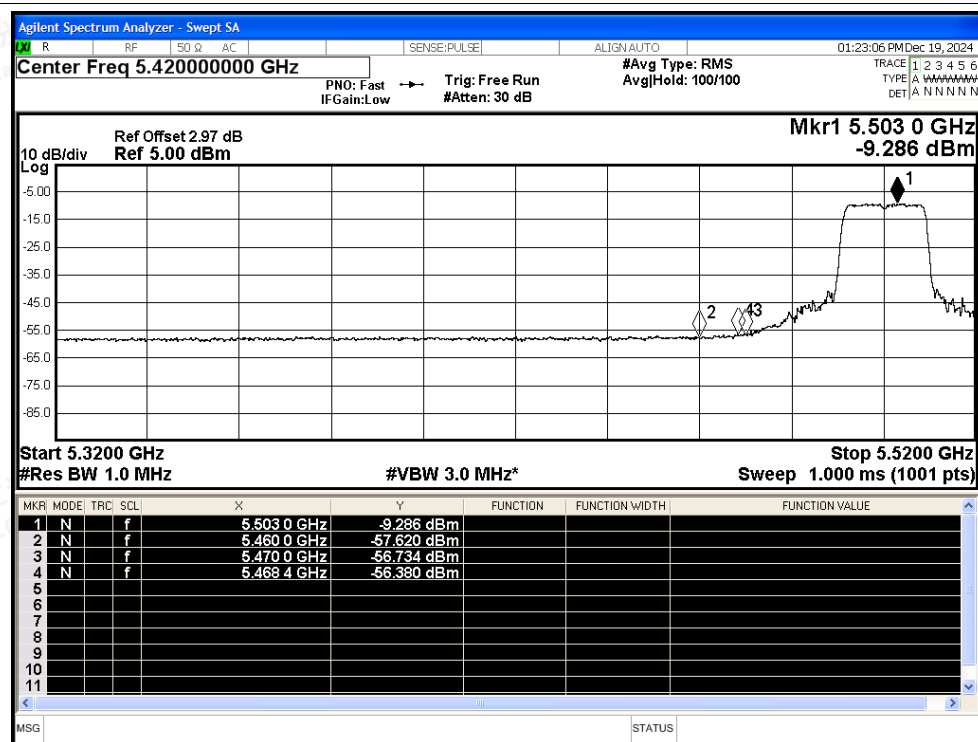

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5700MHz Ant2 Peak

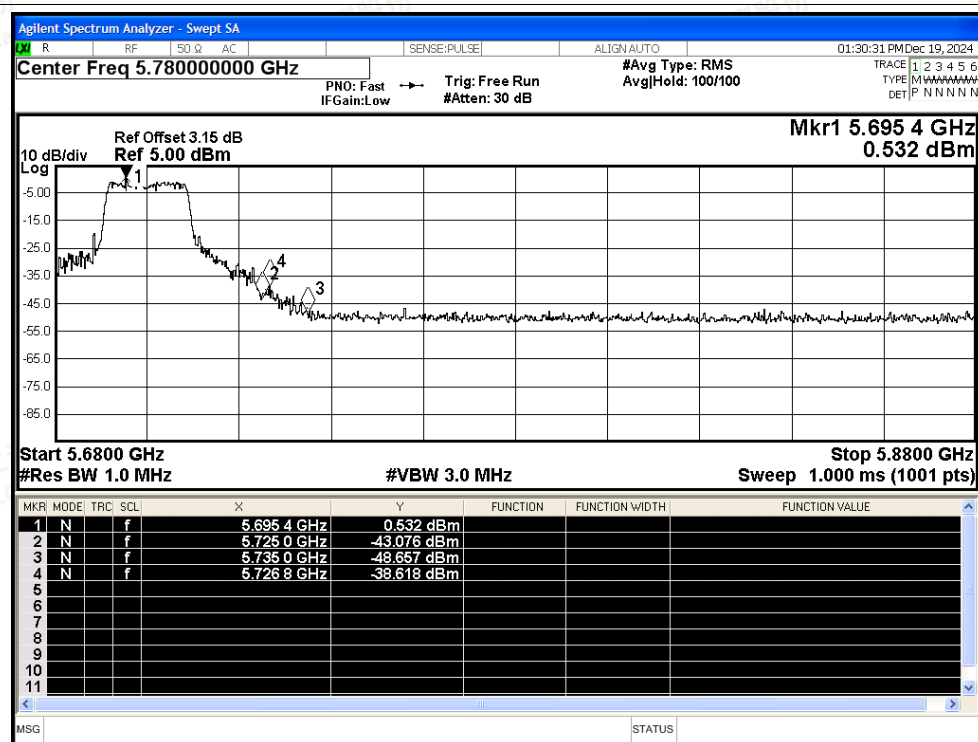

Restrict Band NVNT n20 5700MHz Ant2 Average

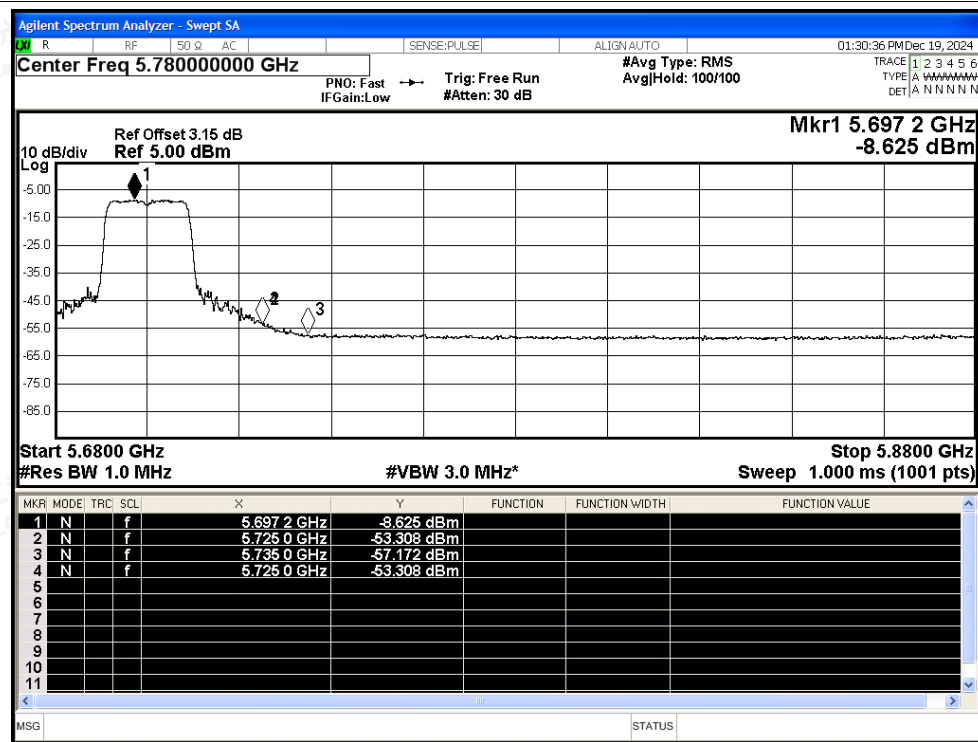

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5510MHz Ant2 Peak

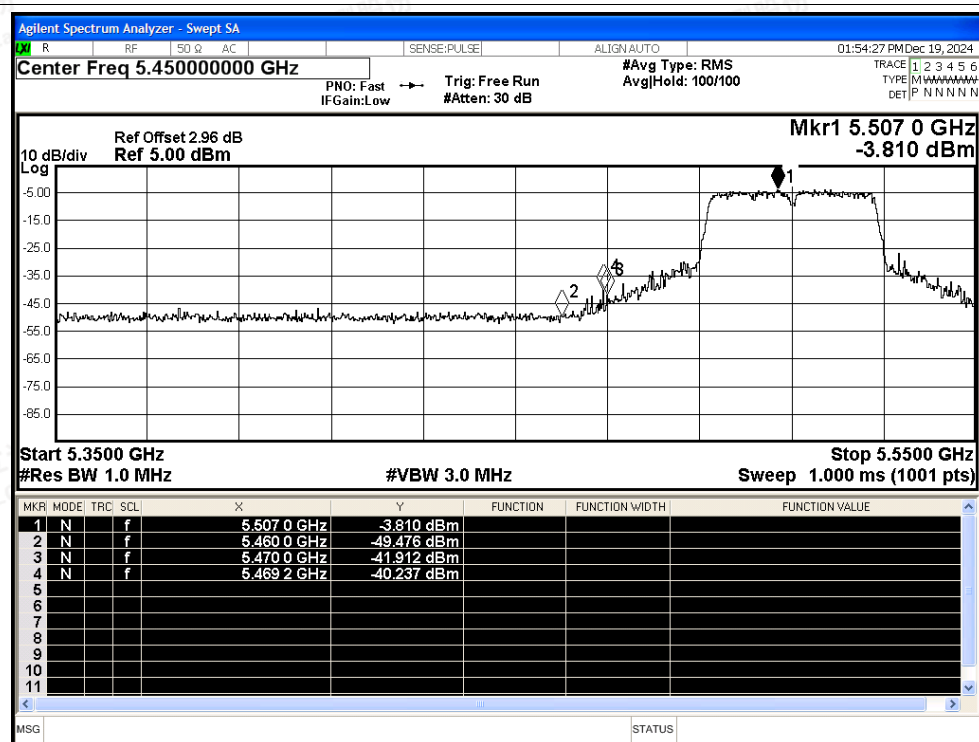

Restrict Band NVNT n40 5510MHz Ant2 Average

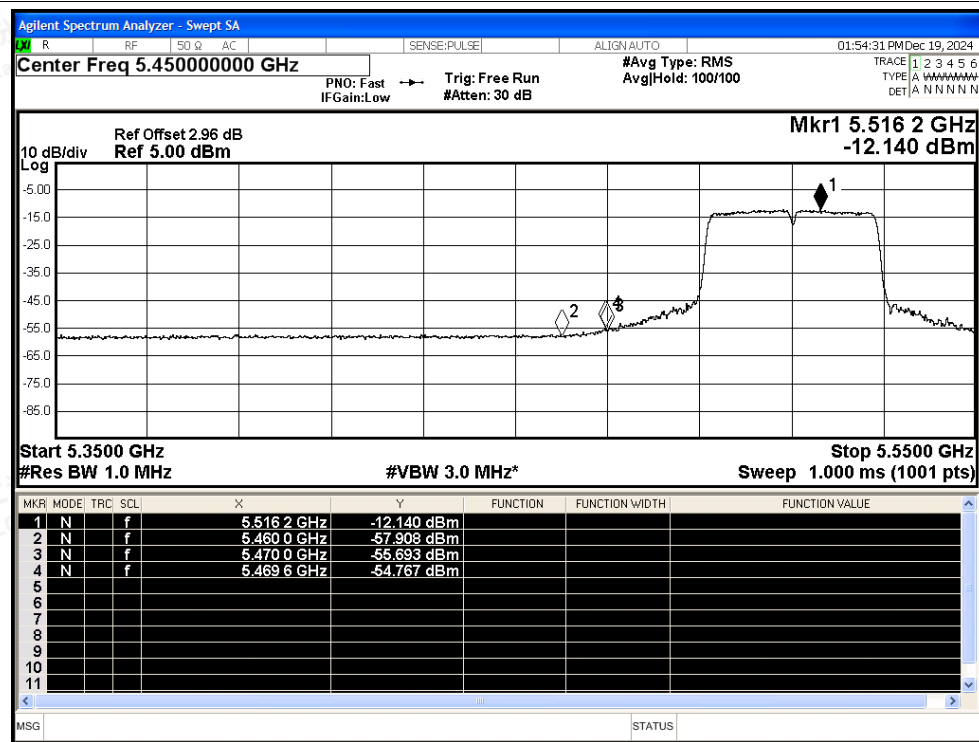

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5670MHz Ant2 Peak

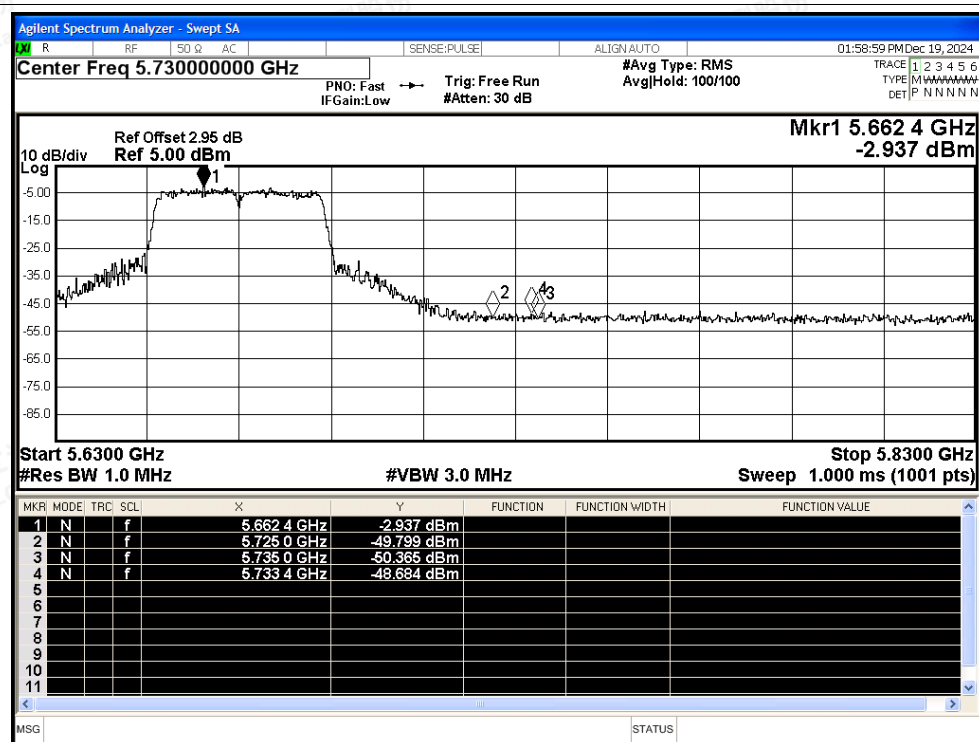

Restrict Band NVNT n40 5670MHz Ant2 Average

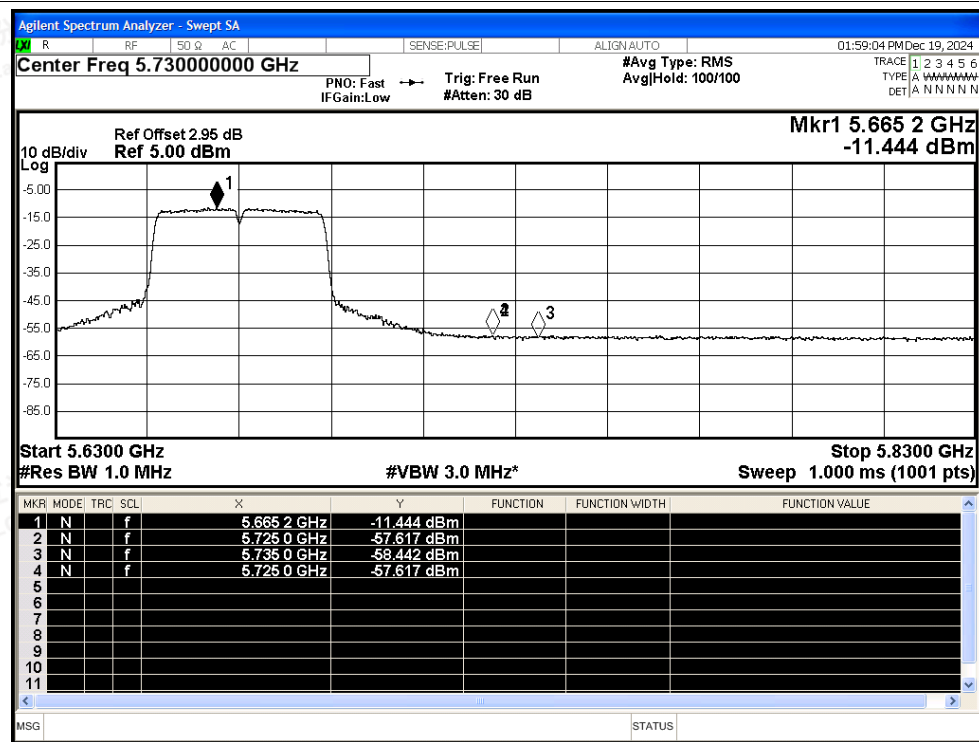

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5500MHz Ant2 Peak

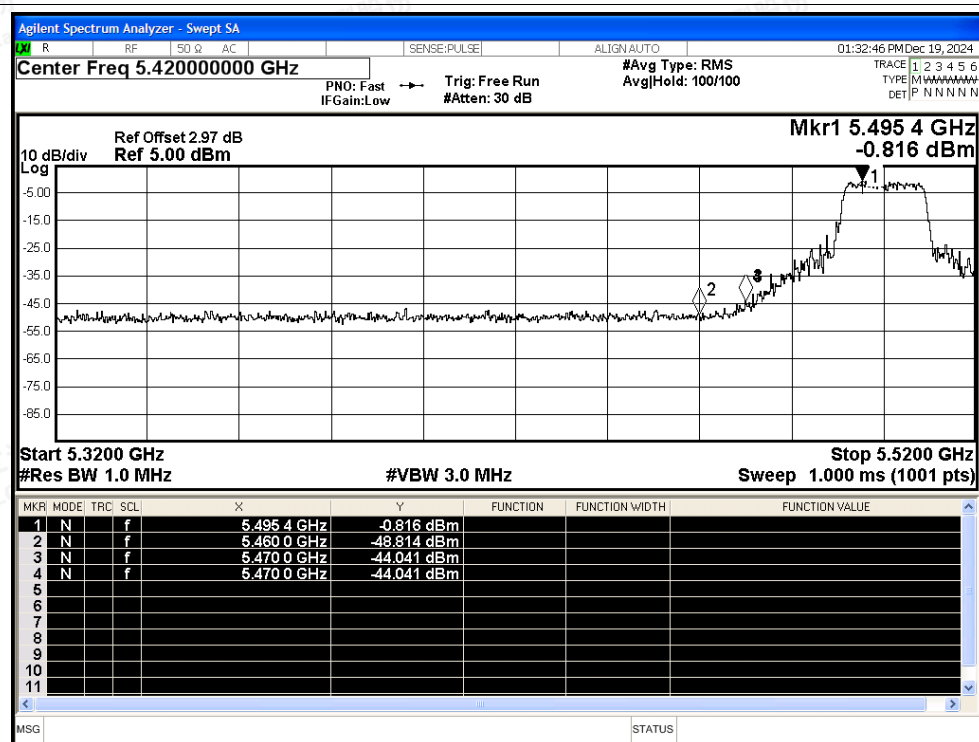

Restrict Band NVNT ac20 5500MHz Ant2 Average

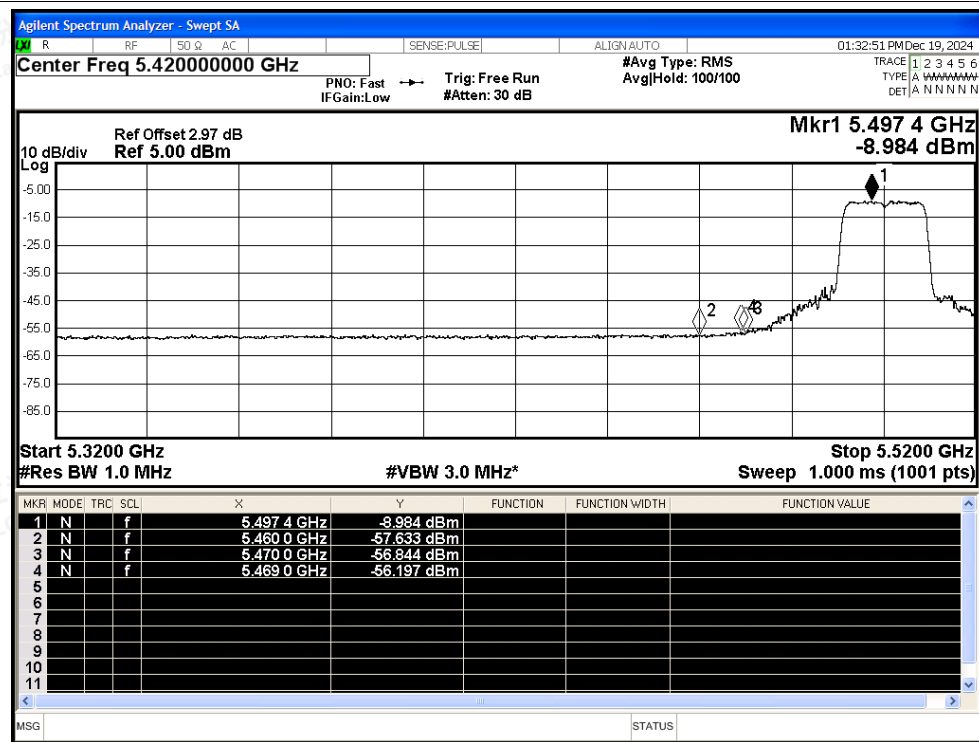

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5700MHz Ant2 Peak

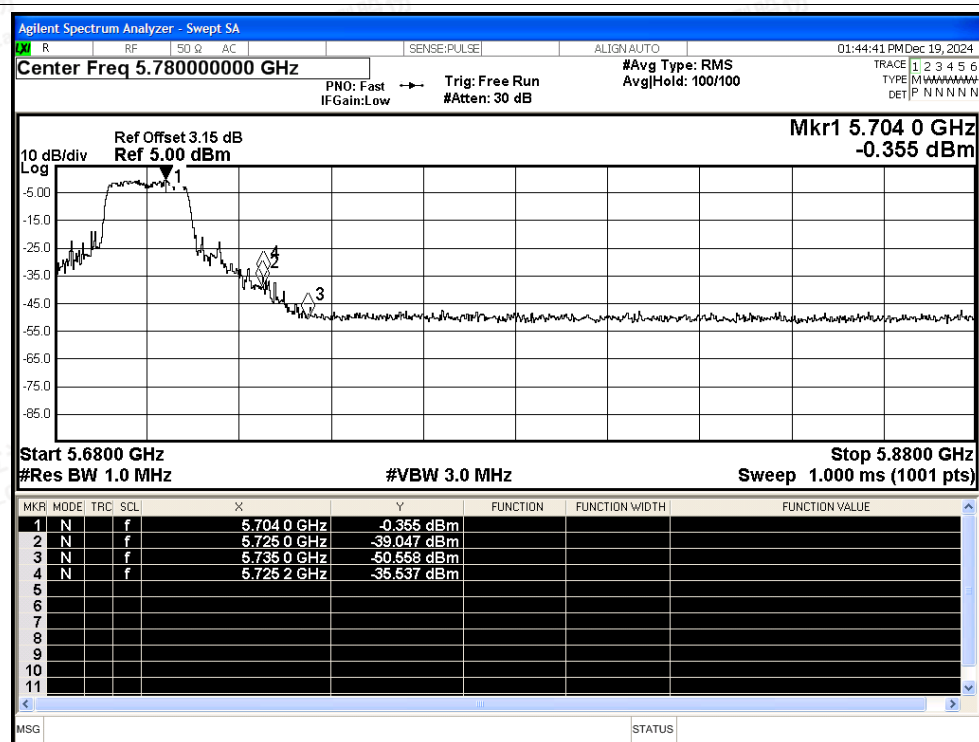

Restrict Band NVNT ac20 5700MHz Ant2 Average

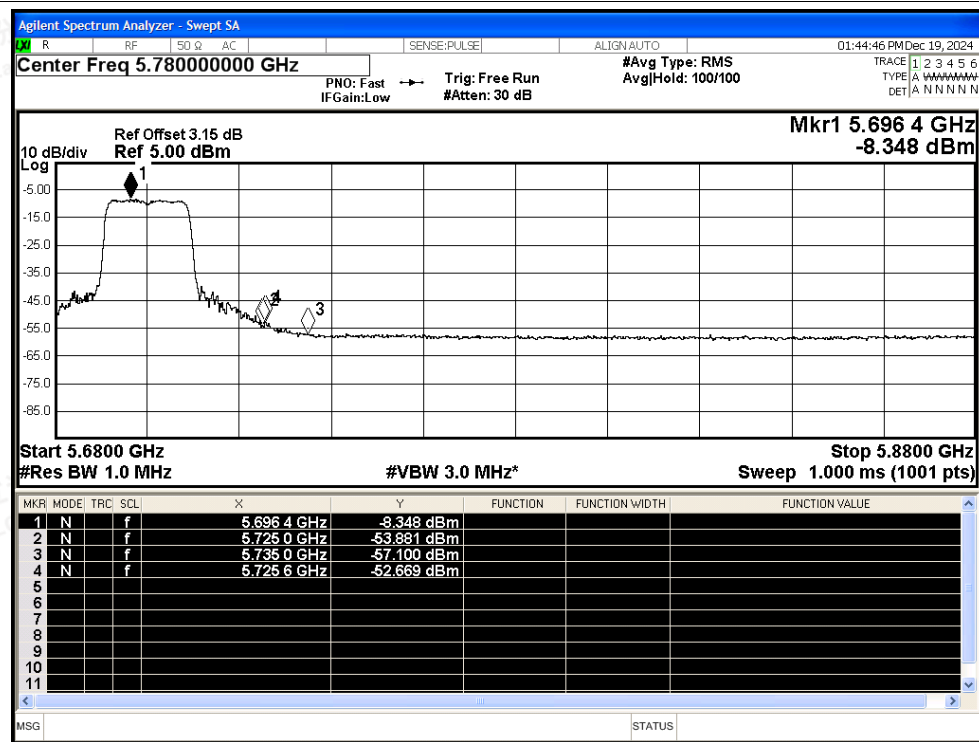

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5510MHz Ant2 Peak

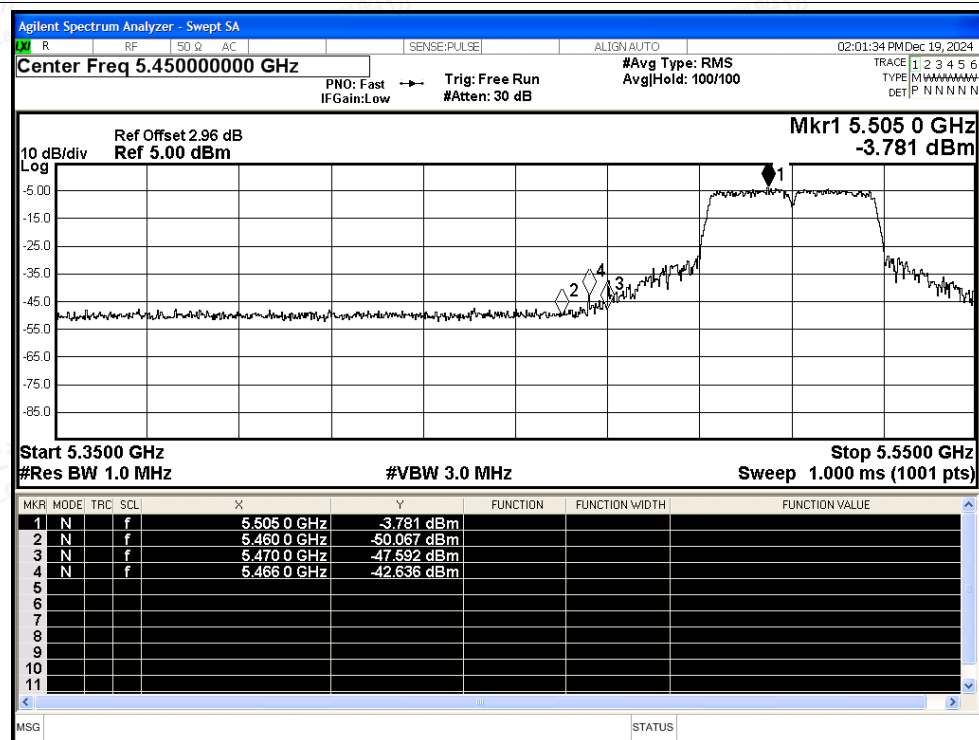

Restrict Band NVNT ac40 5510MHz Ant2 Average

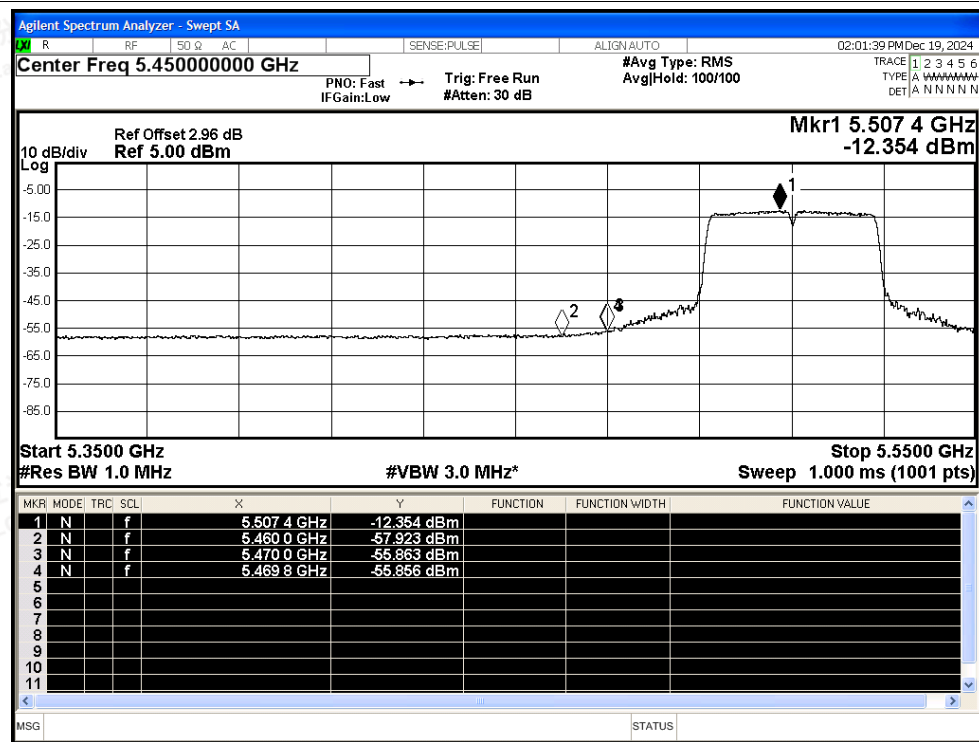

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5670MHz Ant2 Peak

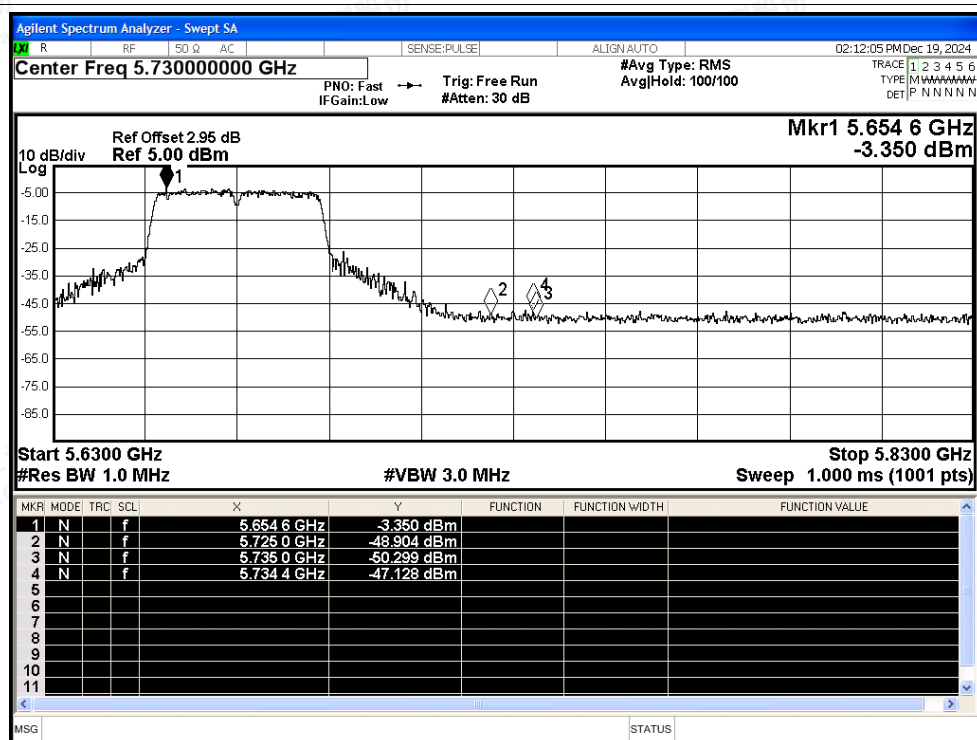

Restrict Band NVNT ac40 5670MHz Ant2 Average

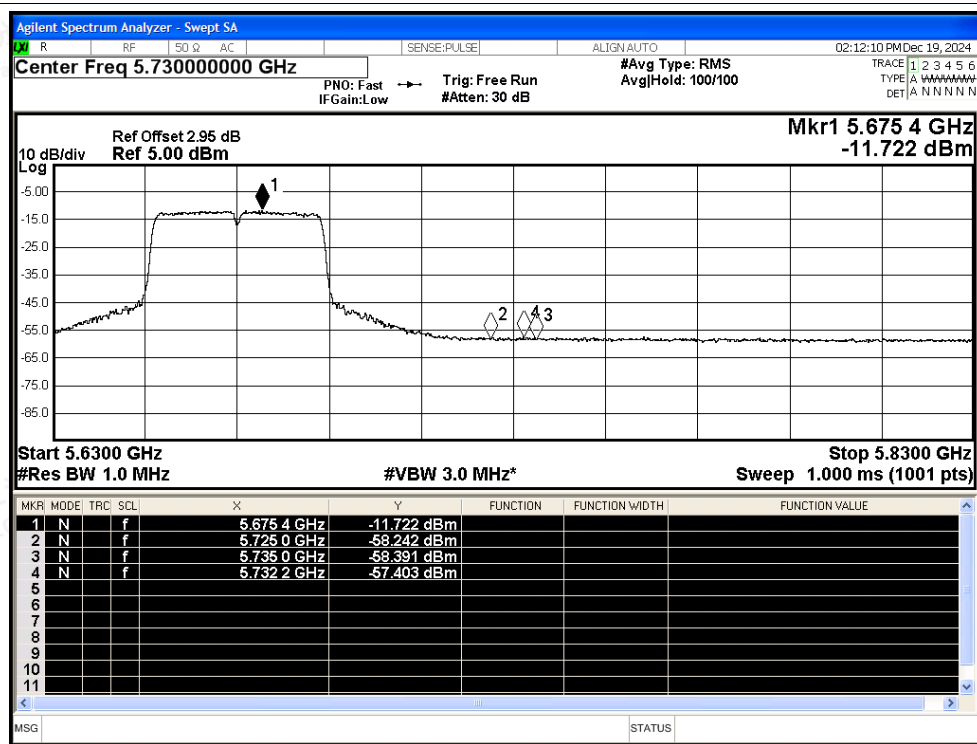

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5530MHz Ant2 Peak

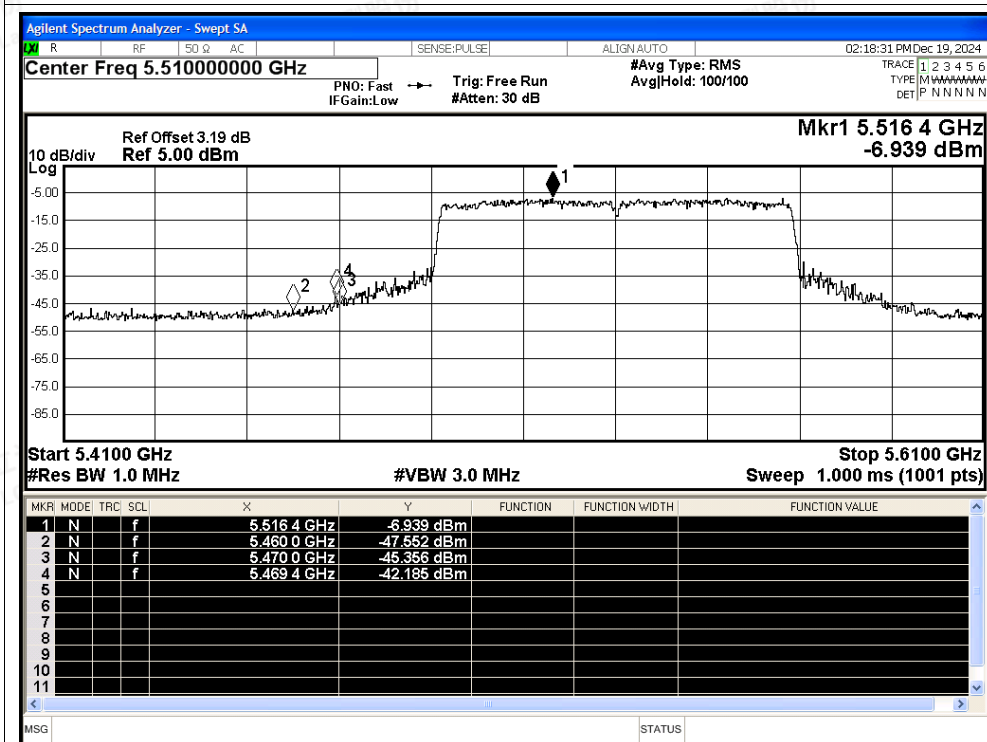

Restrict Band NVNT ac80 5530MHz Ant2 Average

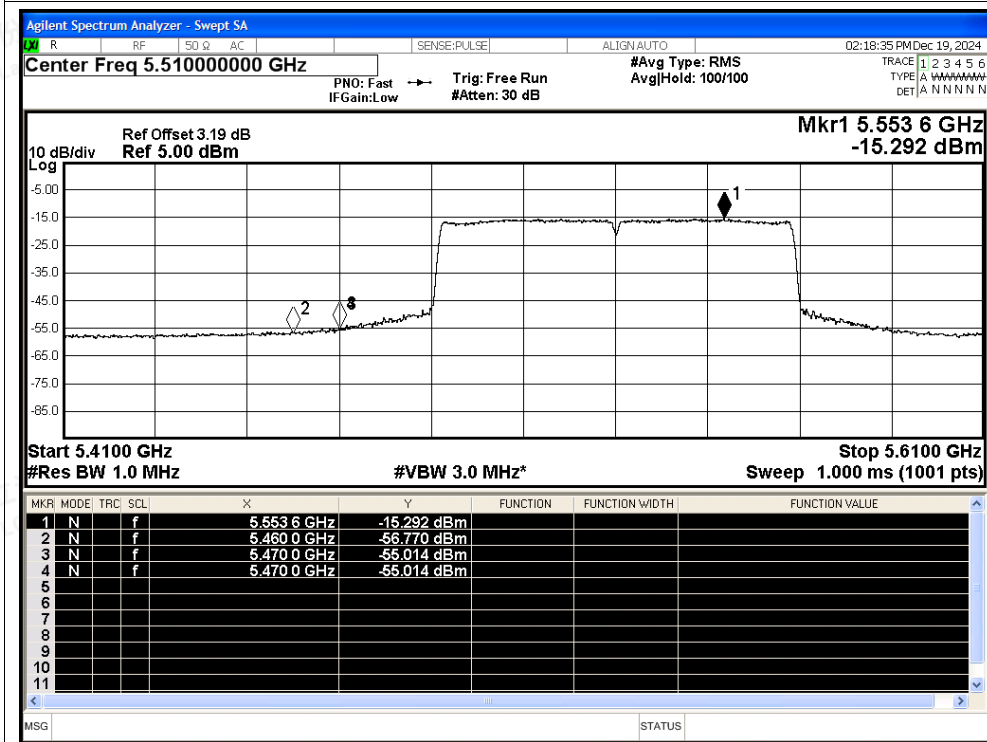

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5610MHz Ant2 Peak

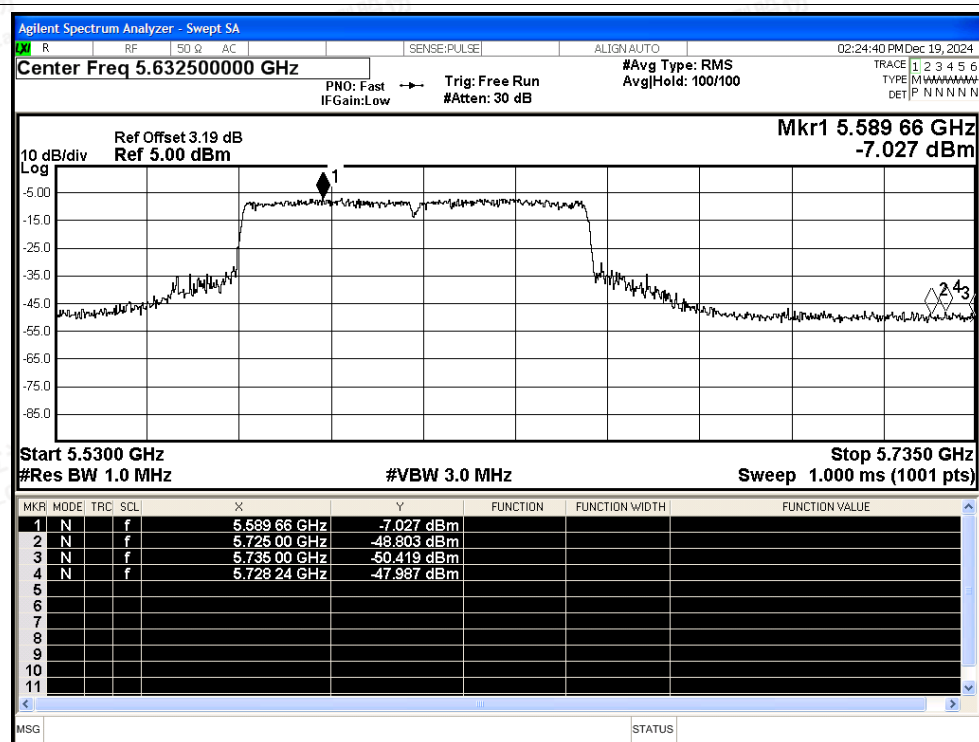

Restrict Band NVNT ac80 5610MHz Ant2 Average

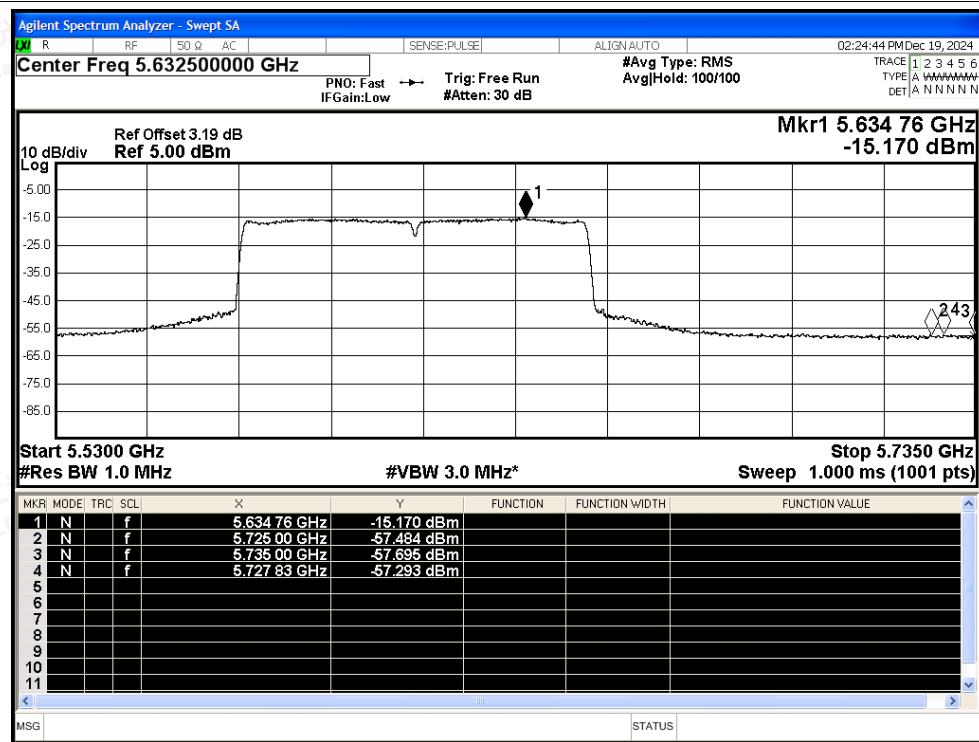

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5500MHz Ant2 Peak

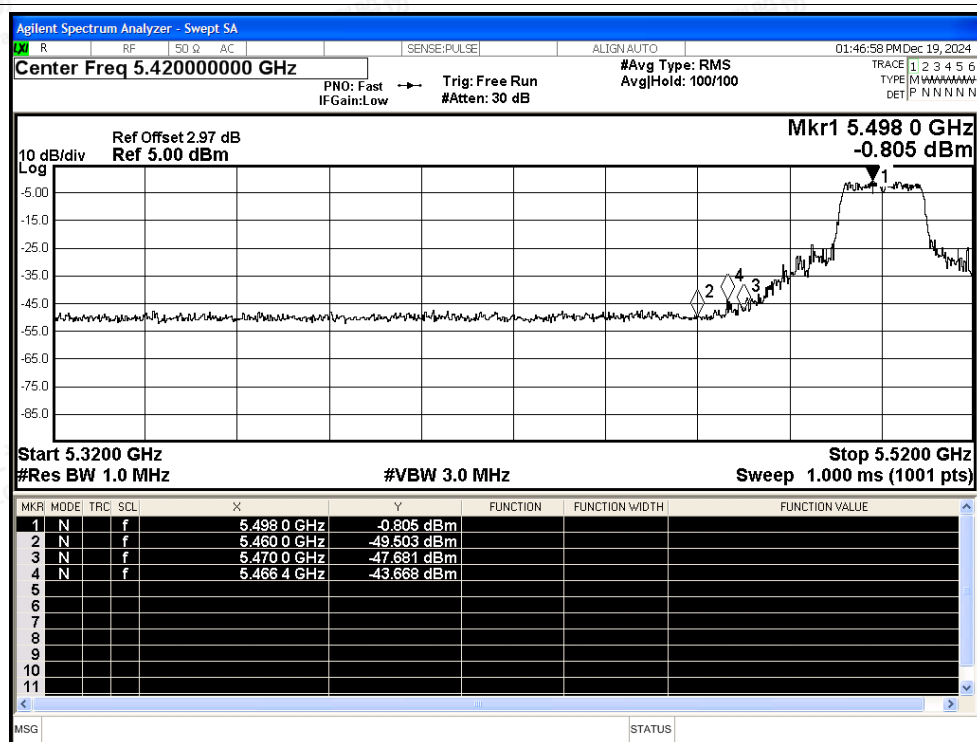

Restrict Band NVNT ax20 5500MHz Ant2 Average

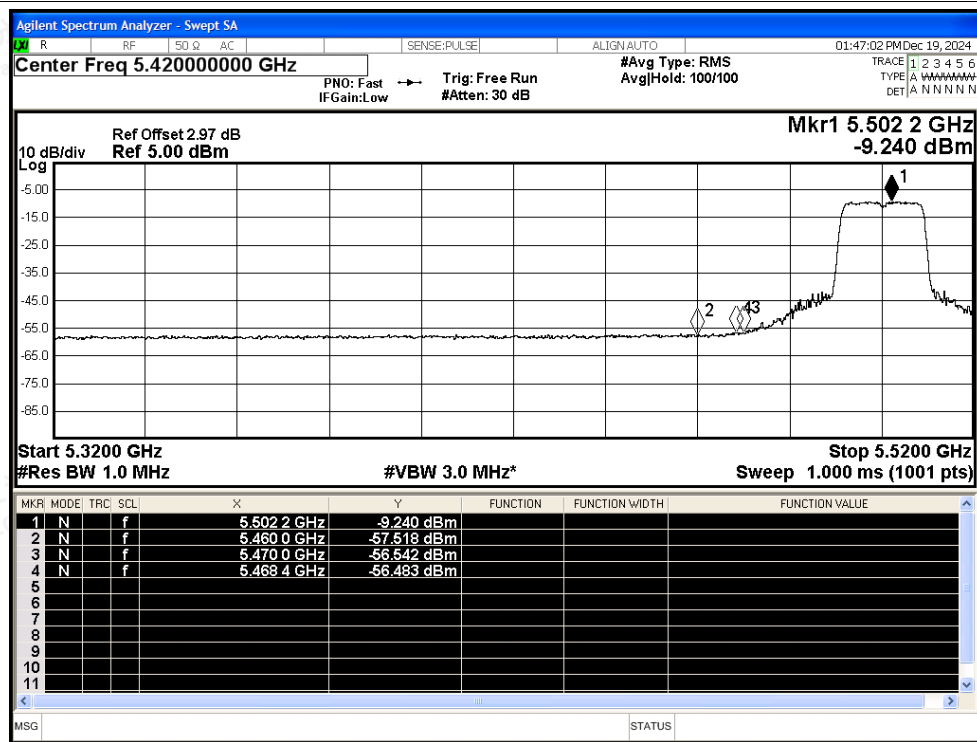

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5700MHz Ant2 Peak

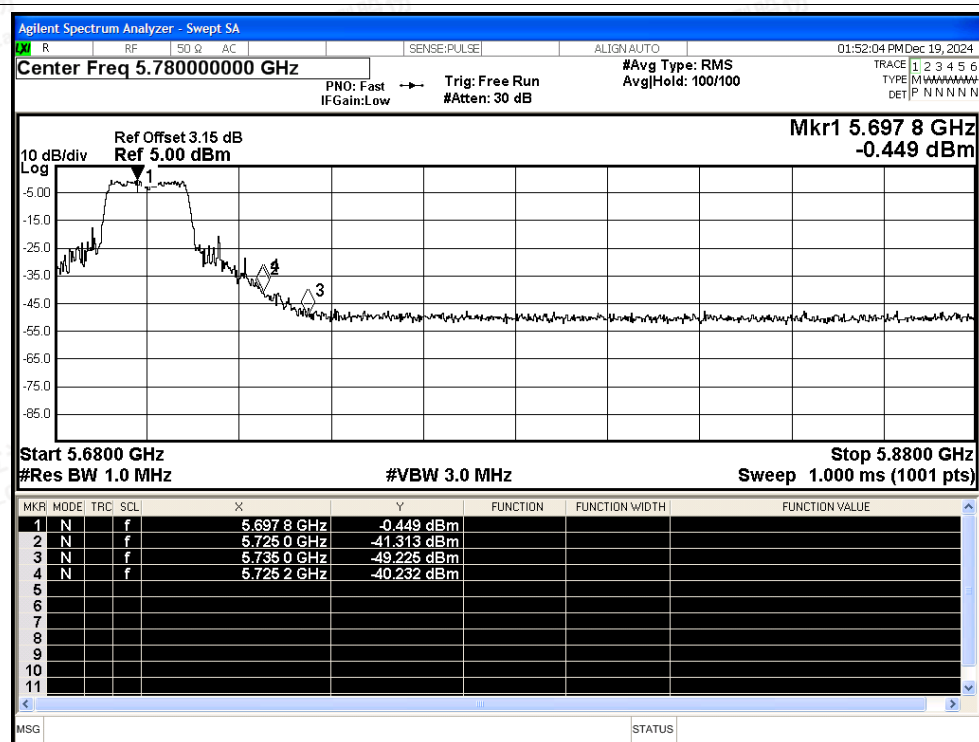

Restrict Band NVNT ax20 5700MHz Ant2 Average

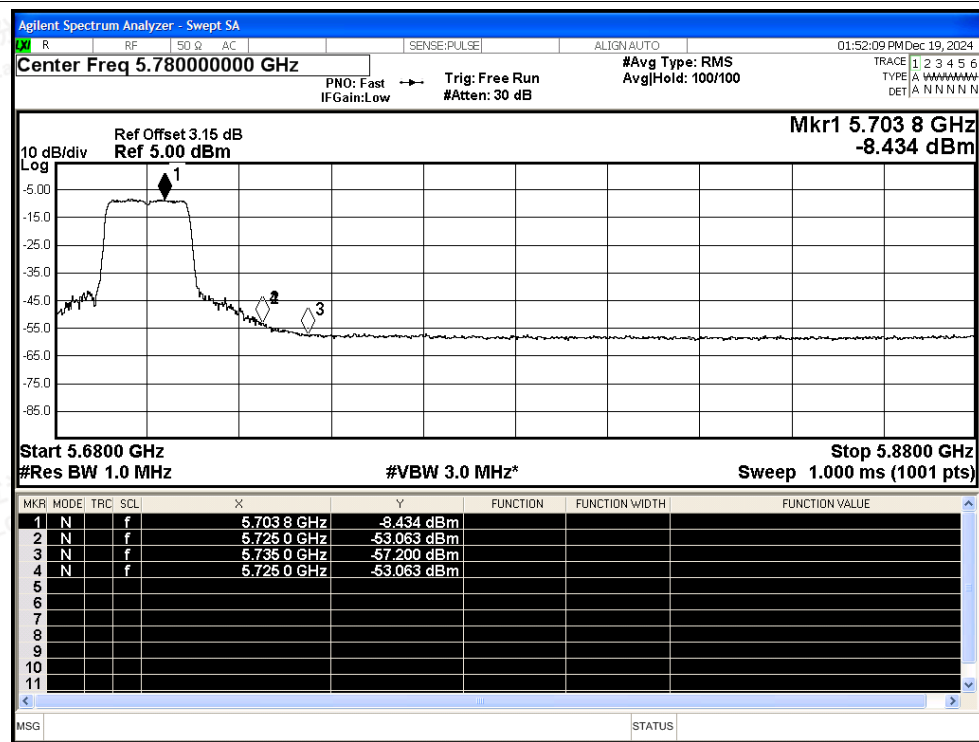

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5510MHz Ant2 Peak

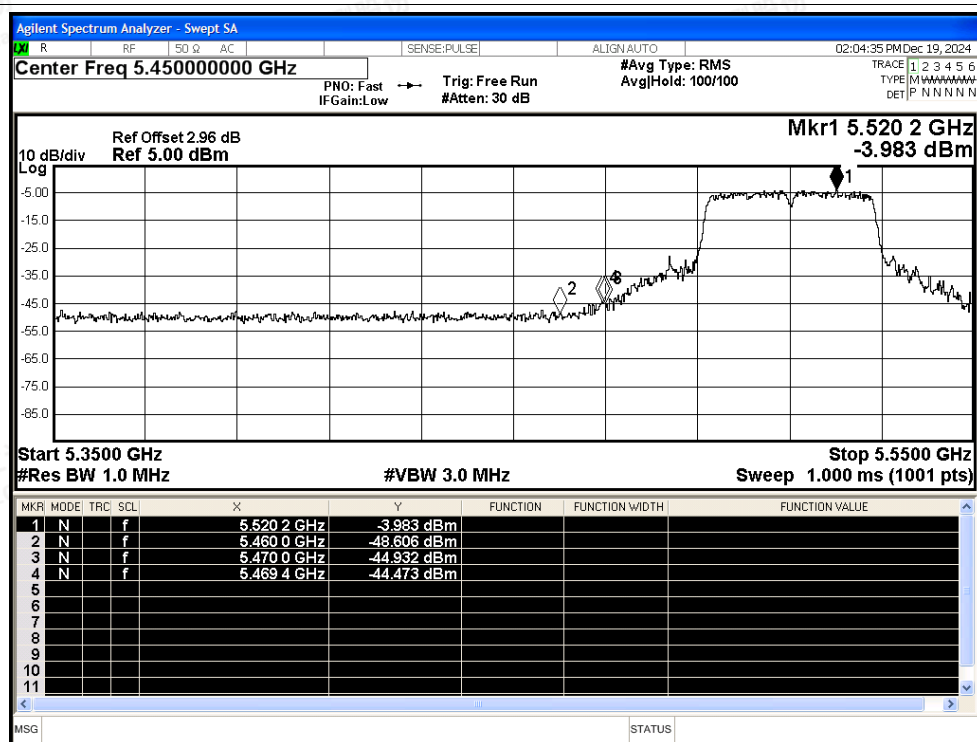

Restrict Band NVNT ax40 5510MHz Ant2 Average

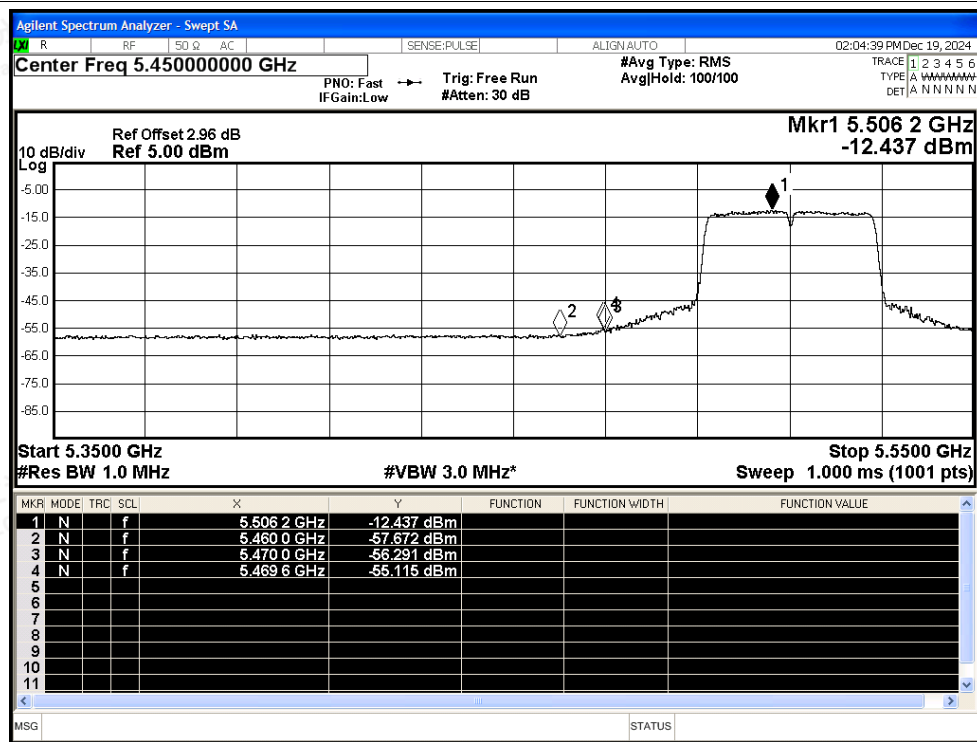

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5670MHz Ant2 Peak

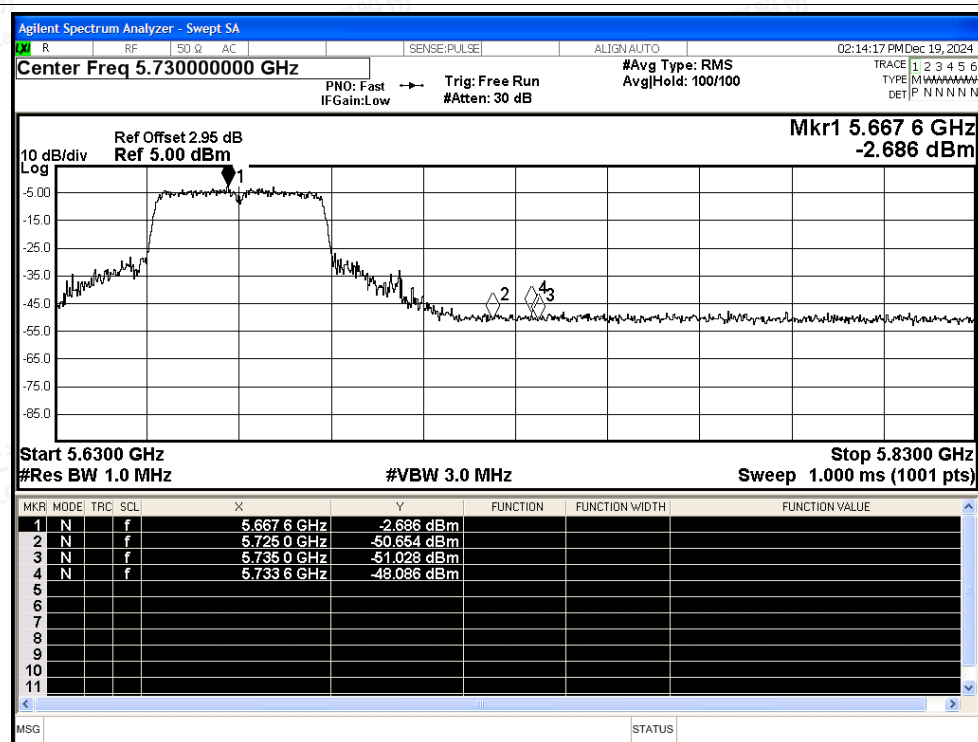

Restrict Band NVNT ax40 5670MHz Ant2 Average

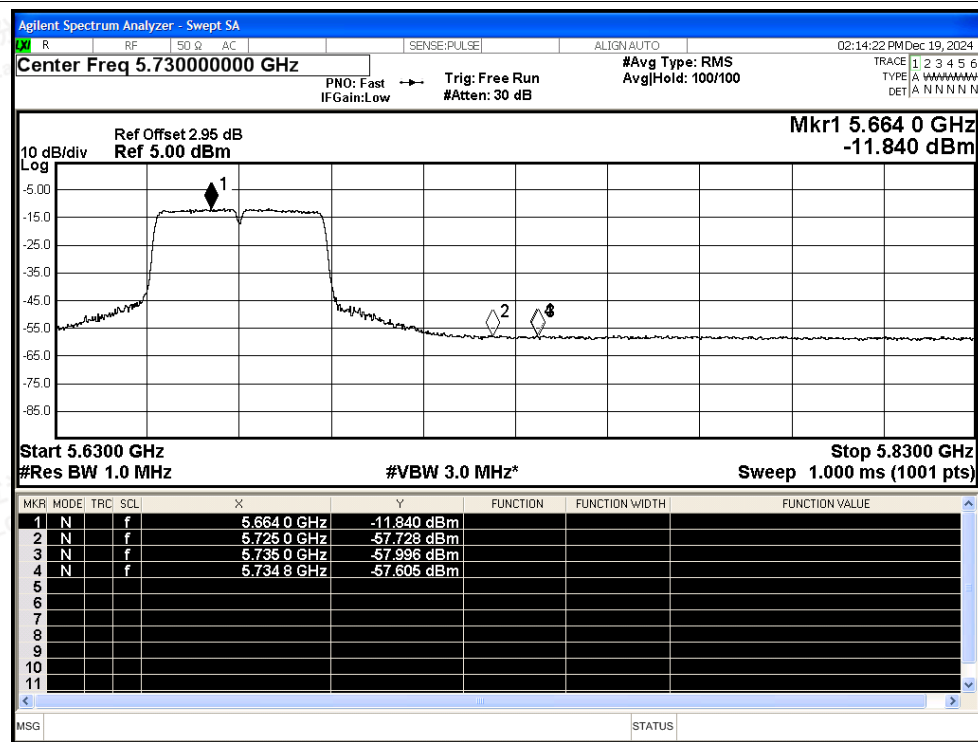

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5530MHz Ant2 Peak

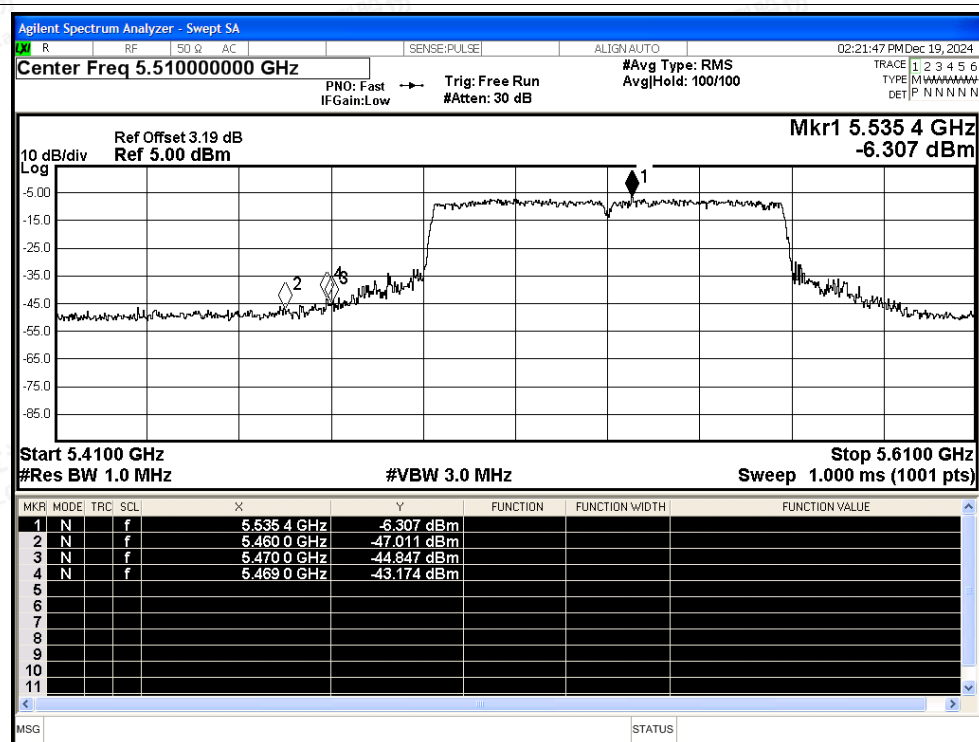

Restrict Band NVNT ax80 5530MHz Ant2 Average

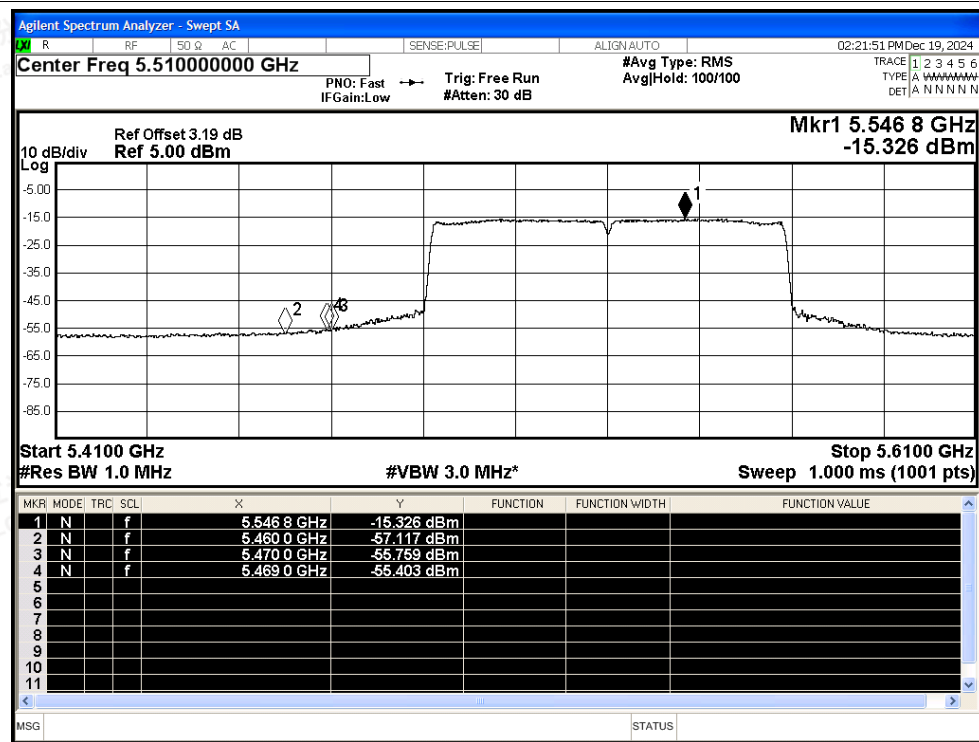

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5610MHz Ant2 Peak

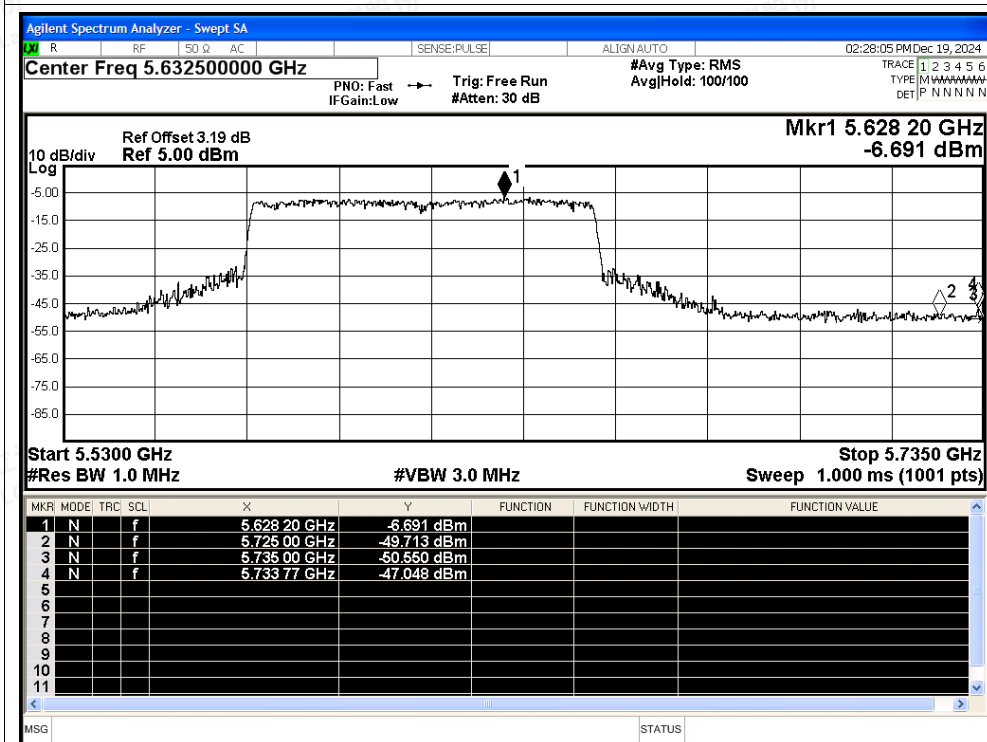

Restrict Band NVNT ax80 5610MHz Ant2 Average

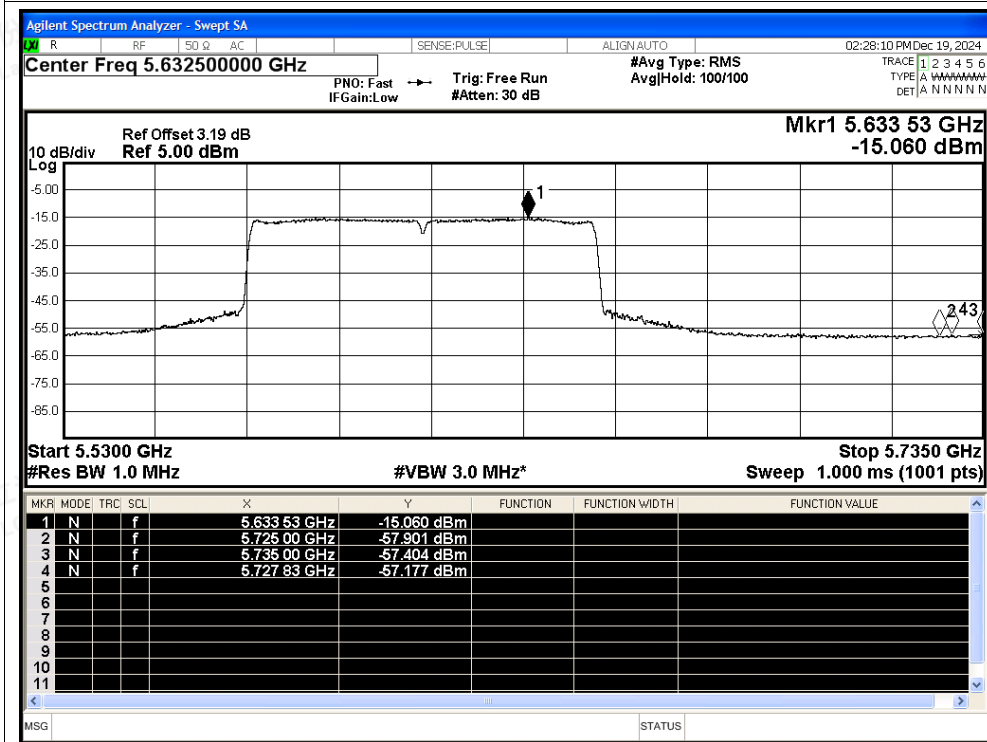

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	Spur Freq (MHz)	ANT1 Power (dBm)	ANT2 Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5500	5460	-50.49	-48.98	6.01	54.58	Peak	68.2	Pass
NVNT	n20	5500	5460	-57.91	-57.62	6.01	46.49	Average	54	Pass
NVNT	n20	5500	5470	-44.06	-43.44	6.01	60.51	Peak	68.2	Pass
NVNT	n20	5500	5467.8	-56.65	-56.38	6.01	47.73	Average	54	Pass
NVNT	n20	5500	5470	-44.06	-43.44	6.01	60.51	Peak	68.2	Pass
NVNT	n20	5500	5470	-57.39	-56.73	6.01	47.20	Average	54	Pass
NVNT	n20	5700	5725	-39.35	-43.08	6.01	63.42	Peak	68.2	Pass
NVNT	n20	5700	5725	-54.16	-53.31	6.01	50.53	Average	54	Pass
NVNT	n20	5700	5729.2	-39.33	-38.62	6.01	65.29	Peak	68.2	Pass
NVNT	n20	5700	5725.4	-53.51	-53.31	6.01	50.84	Average	54	Pass
NVNT	n20	5700	5735	-49.7	-48.66	6.01	55.10	Peak	68.2	Pass
NVNT	n20	5700	5735	-57.5	-57.17	6.01	46.92	Average	54	Pass
NVNT	n40	5510	5460	-49	-49.48	6.01	55.01	Peak	68.2	Pass
NVNT	n40	5510	5460	-57.14	-57.91	6.01	46.74	Average	54	Pass
NVNT	n40	5510	5468.8	-40.73	-40.24	6.01	63.77	Peak	68.2	Pass
NVNT	n40	5510	5469.6	-55.48	-54.77	6.01	49.14	Average	54	Pass
NVNT	n40	5510	5470	-47.98	-41.91	6.01	60.29	Peak	68.2	Pass
NVNT	n40	5510	5470	-55.84	-55.69	6.01	48.48	Average	54	Pass
NVNT	n40	5670	5725	-50.91	-49.8	6.01	53.93	Peak	68.2	Pass
NVNT	n40	5670	5725	-58.5	-57.62	6.01	46.21	Average	54	Pass
NVNT	n40	5670	5730.4	-48.02	-48.68	6.01	55.91	Peak	68.2	Pass
NVNT	n40	5670	5727.8	-57.49	-57.62	6.01	46.69	Average	54	Pass
NVNT	n40	5670	5735	-49.88	-50.37	6.01	54.13	Peak	68.2	Pass
NVNT	n40	5670	5735	-58.28	-58.44	6.01	45.89	Average	54	Pass
NVNT	ac20	5500	5460	-49.37	-48.81	6.01	55.17	Peak	68.2	Pass
NVNT	ac20	5500	5460	-57.91	-57.63	6.01	46.48	Average	54	Pass
NVNT	ac20	5500	5469.6	-44.11	-44.04	6.01	60.17	Peak	68.2	Pass
NVNT	ac20	5500	5469	-56.1	-56.2	6.01	48.10	Average	54	Pass
NVNT	ac20	5500	5470	-47.23	-44.04	6.01	58.90	Peak	68.2	Pass
NVNT	ac20	5500	5470	-56.59	-56.84	6.01	47.53	Average	54	Pass
NVNT	ac20	5700	5725	-42.92	-39.05	6.01	63.68	Peak	68.2	Pass
NVNT	ac20	5700	5725	-53.85	-53.88	6.01	50.38	Average	54	Pass
NVNT	ac20	5700	5727	-40.14	-35.54	6.01	66.99	Peak	68.2	Pass
NVNT	ac20	5700	5726	-53.58	-52.67	6.01	51.15	Average	54	Pass
NVNT	ac20	5700	5735	-49.42	-50.56	6.01	54.30	Peak	68.2	Pass
NVNT	ac20	5700	5735	-57.8	-57.1	6.01	46.81	Average	54	Pass
NVNT	ac40	5510	5460	-49.68	-50.07	6.01	54.38	Peak	68.2	Pass
NVNT	ac40	5510	5460	-57.84	-57.92	6.01	46.37	Average	54	Pass
NVNT	ac40	5510	5469.6	-44.9	-42.64	6.01	60.62	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5510	5469.6	-54.68	-55.86	6.01	49.02	Average	54	Pass
NVNT	ac40	5510	5470	-46.01	-47.59	6.01	57.52	Peak	68.2	Pass
NVNT	ac40	5510	5470	-55.9	-55.86	6.01	48.37	Average	54	Pass
NVNT	ac40	5670	5725	-49.53	-48.9	6.01	55.04	Peak	68.2	Pass
NVNT	ac40	5670	5725	-58.17	-58.24	6.01	46.04	Average	54	Pass
NVNT	ac40	5670	5730.6	-48.13	-47.13	6.01	56.65	Peak	68.2	Pass
NVNT	ac40	5670	5725.2	-57.55	-57.4	6.01	46.77	Average	54	Pass
NVNT	ac40	5670	5735	-50.12	-50.3	6.01	54.04	Peak	68.2	Pass
NVNT	ac40	5670	5735	-58.36	-58.39	6.01	45.87	Average	54	Pass
NVNT	ac80	5530	5460	-49.45	-47.55	6.01	55.85	Peak	68.2	Pass
NVNT	ac80	5530	5460	-57.12	-56.77	6.01	47.31	Average	54	Pass
NVNT	ac80	5530	5467.4	-41.88	-42.19	6.01	62.22	Peak	68.2	Pass
NVNT	ac80	5530	5470	-55.45	-55.01	6.01	49.02	Average	54	Pass
NVNT	ac80	5530	5470	-44.46	-45.36	6.01	59.36	Peak	68.2	Pass
NVNT	ac80	5530	5470	-55.45	-55.01	6.01	49.02	Average	54	Pass
NVNT	ac80	5610	5725	-50.47	-48.8	6.01	54.69	Peak	68.2	Pass
NVNT	ac80	5610	5725	-58.15	-57.48	6.01	46.45	Average	54	Pass
NVNT	ac80	5610	5725.16	-48.54	-47.99	6.01	55.99	Peak	68.2	Pass
NVNT	ac80	5610	5729.875	-57.24	-57.29	6.01	46.98	Average	54	Pass
NVNT	ac80	5610	5735	-50.41	-50.42	6.01	53.83	Peak	68.2	Pass
NVNT	ac80	5610	5735	-57.8	-57.7	6.01	46.50	Average	54	Pass
NVNT	ax20	5500	5460	-49.5	-49.5	6.01	54.75	Peak	68.2	Pass
NVNT	ax20	5500	5460	-57.92	-57.52	6.01	46.53	Average	54	Pass
NVNT	ax20	5500	5468.6	-44.42	-43.67	6.01	60.22	Peak	68.2	Pass
NVNT	ax20	5500	5469.6	-56.27	-56.48	6.01	47.87	Average	54	Pass
NVNT	ax20	5500	5470	-46.82	-47.68	6.01	57.02	Peak	68.2	Pass
NVNT	ax20	5500	5470	-56.98	-56.54	6.01	47.49	Average	54	Pass
NVNT	ax20	5700	5725	-39.47	-41.31	6.01	63.95	Peak	68.2	Pass
NVNT	ax20	5700	5725	-55.13	-53.06	6.01	50.28	Average	54	Pass
NVNT	ax20	5700	5726	-38.67	-40.23	6.01	64.87	Peak	68.2	Pass
NVNT	ax20	5700	5725.8	-53.78	-53.06	6.01	50.84	Average	54	Pass
NVNT	ax20	5700	5735	-50.31	-49.23	6.01	54.51	Peak	68.2	Pass
NVNT	ax20	5700	5735	-57.52	-57.2	6.01	46.89	Average	54	Pass
NVNT	ax40	5510	5460	-49.51	-48.61	6.01	55.21	Peak	68.2	Pass
NVNT	ax40	5510	5460	-58.12	-57.67	6.01	46.36	Average	54	Pass
NVNT	ax40	5510	5468.4	-42.07	-44.47	6.01	61.14	Peak	68.2	Pass
NVNT	ax40	5510	5469.6	-55.67	-55.12	6.01	48.86	Average	54	Pass
NVNT	ax40	5510	5470	-44.41	-44.93	6.01	59.59	Peak	68.2	Pass
NVNT	ax40	5510	5470	-56.6	-56.29	6.01	47.81	Average	54	Pass
NVNT	ax40	5670	5725	-48.71	-50.65	6.01	54.68	Peak	68.2	Pass
NVNT	ax40	5670	5725	-58.11	-57.73	6.01	46.33	Average	54	Pass
NVNT	ax40	5670	5726.2	-47.8	-48.09	6.01	56.31	Peak	68.2	Pass
NVNT	ax40	5670	5725.6	-57.57	-57.61	6.01	46.66	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5670	5735	-50.65	-51.03	6.01	53.41	Peak	68.2	Pass
NVNT	ax40	5670	5735	-58.56	-58	6.01	45.98	Average	54	Pass
NVNT	ax80	5530	5460	-49.58	-47.01	6.01	56.14	Peak	68.2	Pass
NVNT	ax80	5530	5460	-56.66	-57.12	6.01	47.36	Average	54	Pass
NVNT	ax80	5530	5468.8	-41.98	-43.17	6.01	61.71	Peak	68.2	Pass
NVNT	ax80	5530	5469.4	-55.24	-55.4	6.01	48.93	Average	54	Pass
NVNT	ax80	5530	5470	-45.41	-44.85	6.01	59.13	Peak	68.2	Pass
NVNT	ax80	5530	5470	-55.27	-55.76	6.01	48.74	Average	54	Pass
NVNT	ax80	5610	5725	-49.55	-49.71	6.01	54.62	Peak	68.2	Pass
NVNT	ax80	5610	5725	-58.02	-57.9	6.01	46.29	Average	54	Pass
NVNT	ax80	5610	5725.57	-47.67	-47.05	6.01	56.90	Peak	68.2	Pass
NVNT	ax80	5610	5727.005	-57.52	-57.18	6.01	46.90	Average	54	Pass
NVNT	ax80	5610	5735	-49.46	-50.55	6.01	54.28	Peak	68.2	Pass
NVNT	ax80	5610	5735	-58.23	-57.4	6.01	46.45	Average	54	Pass





F.5 Frequency Stability


Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5500	Ant1	5499.98	-20000	-3.64	25	Pass
NVNT	a	5580	Ant1	5580	0	0	25	Pass
NVNT	a	5700	Ant1	5700	0	0	25	Pass
NVNT	n20	5500	Ant1	5500	0	0	25	Pass
NVNT	n20	5580	Ant1	5580	0	0	25	Pass
NVNT	n20	5700	Ant1	5699.98	-20000	-3.51	25	Pass
NVNT	n40	5510	Ant1	5509.96	-40000	-7.26	25	Pass
NVNT	n40	5550	Ant1	5549.96	-40000	-7.21	25	Pass
NVNT	n40	5670	Ant1	5670	0	0	25	Pass
NVNT	ac20	5500	Ant1	5499.98	-20000	-3.64	25	Pass
NVNT	ac20	5580	Ant1	5579.98	-20000	-3.58	25	Pass
NVNT	ac20	5700	Ant1	5699.98	-20000	-3.51	25	Pass
NVNT	ac40	5510	Ant1	5510	0	0	25	Pass
NVNT	ac40	5550	Ant1	5550	0	0	25	Pass
NVNT	ac40	5670	Ant1	5669.96	-40000	-7.05	25	Pass
NVNT	ac80	5530	Ant1	5530	0	0	25	Pass
NVNT	ac80	5610	Ant1	5610	0	0	25	Pass
NVNT	ax20	5500	Ant1	5499.98	-20000	-3.64	25	Pass
NVNT	ax20	5580	Ant1	5580	0	0	25	Pass
NVNT	ax20	5700	Ant1	5699.98	-20000	-3.51	25	Pass
NVNT	ax40	5510	Ant1	5510	0	0	25	Pass
NVNT	ax40	5550	Ant1	5550	0	0	25	Pass
NVNT	ax40	5670	Ant1	5670	0	0	25	Pass
NVNT	ax80	5530	Ant1	5530	0	0	25	Pass
NVNT	ax80	5610	Ant1	5610	0	0	25	Pass






Test Graphs

Freq. Stability NVNT a 5500MHz Ant1

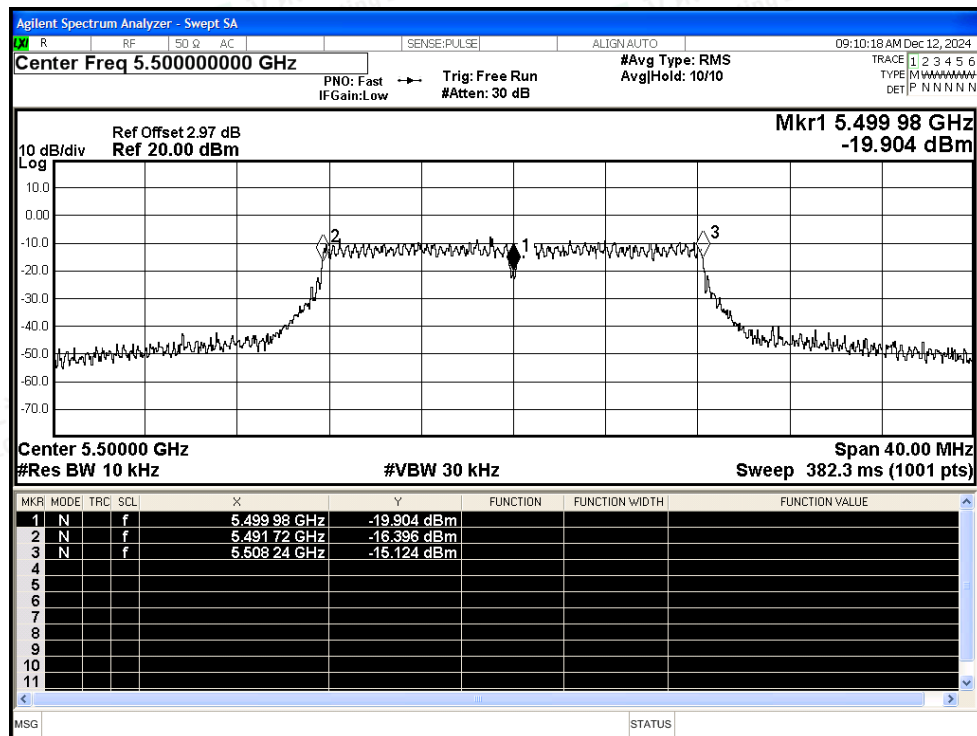

Freq. Stability NVNT a 5580MHz Ant1

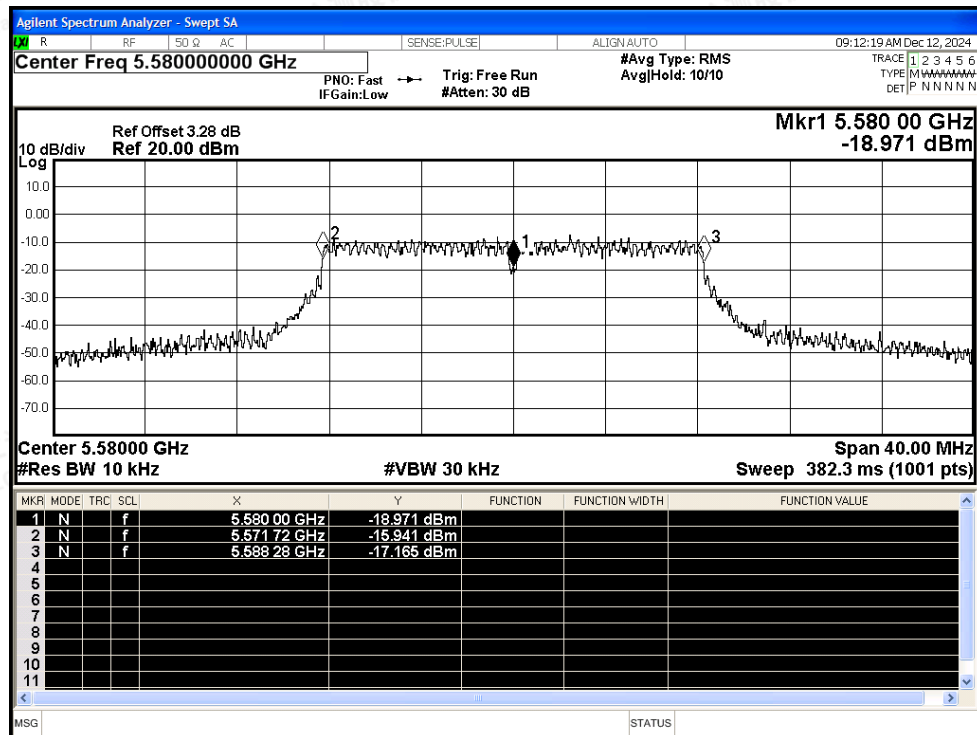

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5700MHz Ant1

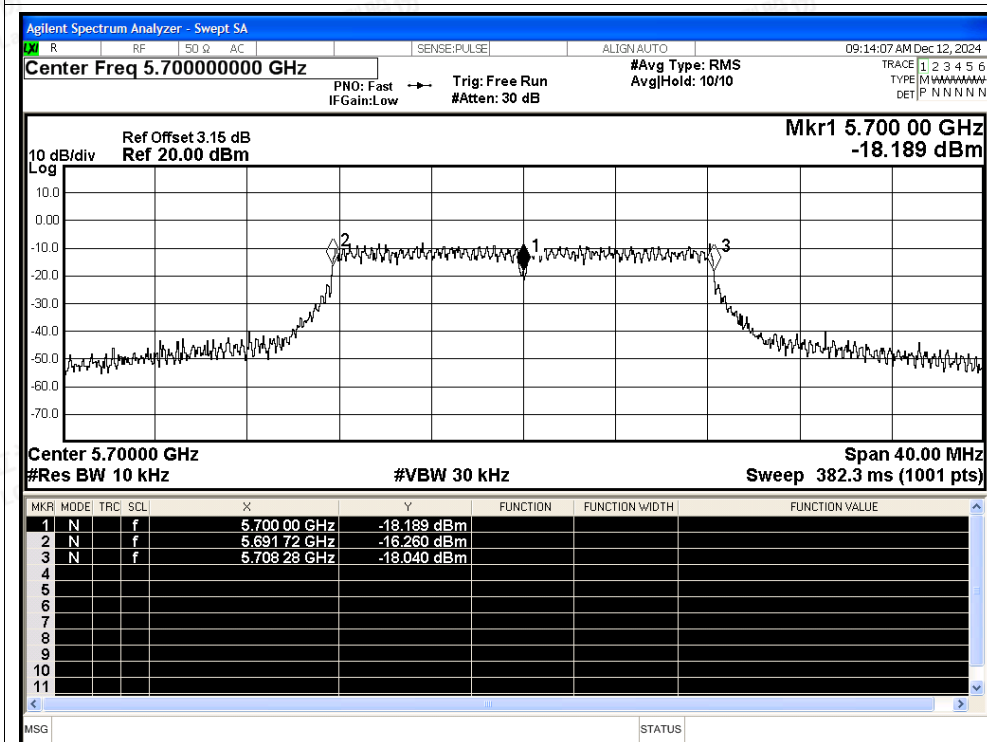

Freq. Stability NVNT n20 5500MHz Ant1

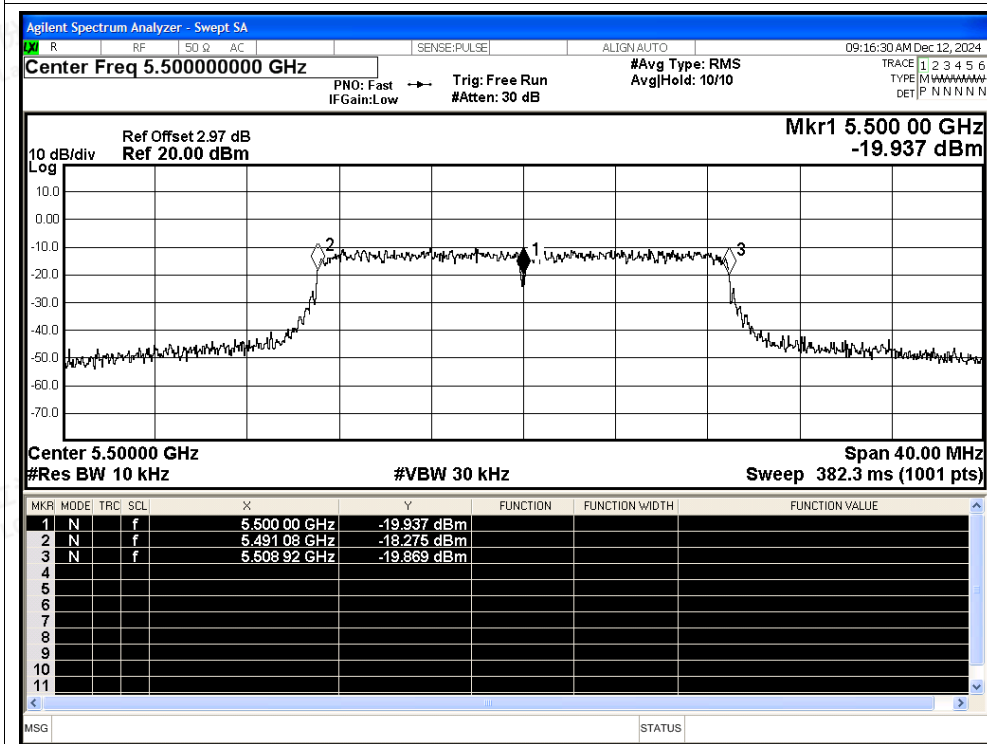

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5580MHz Ant1

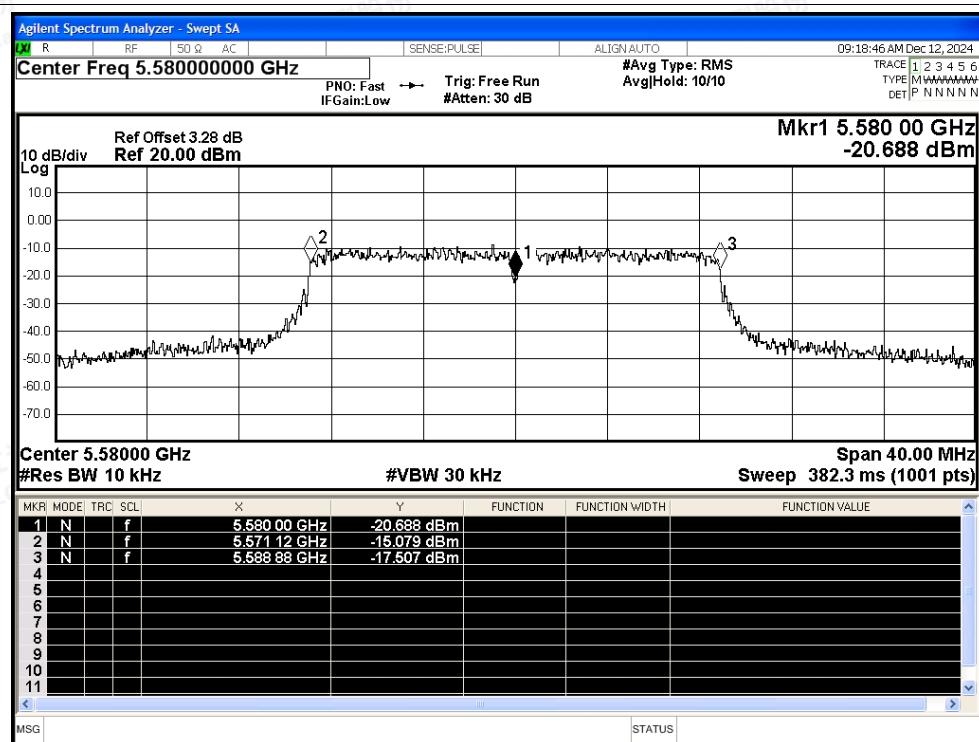

Freq. Stability NVNT n20 5700MHz Ant1

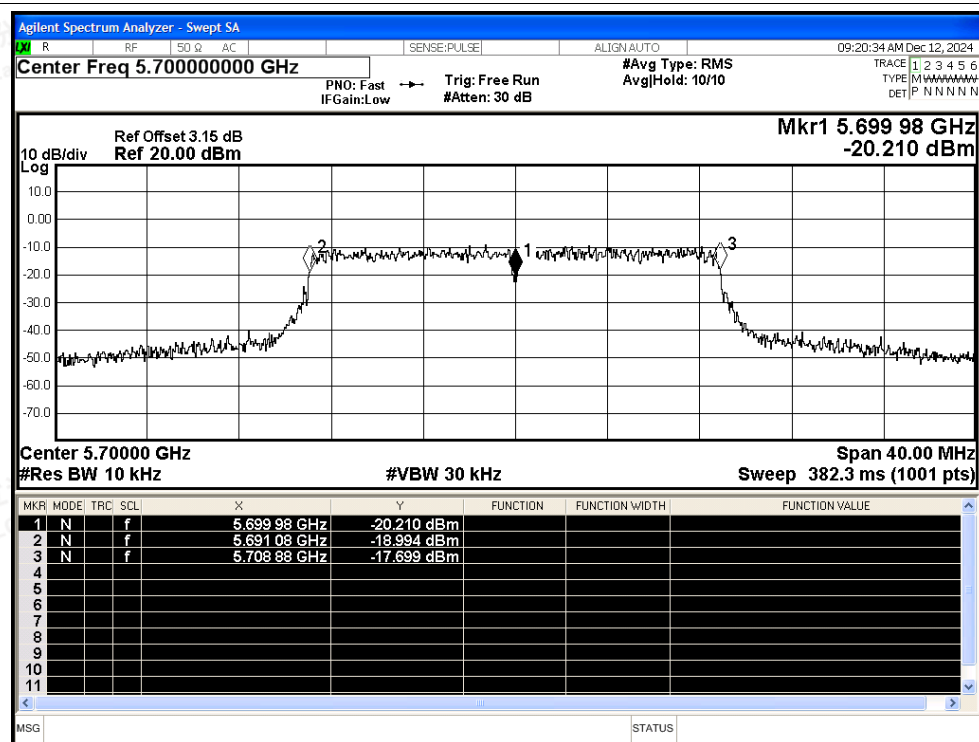

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5510MHz Ant1

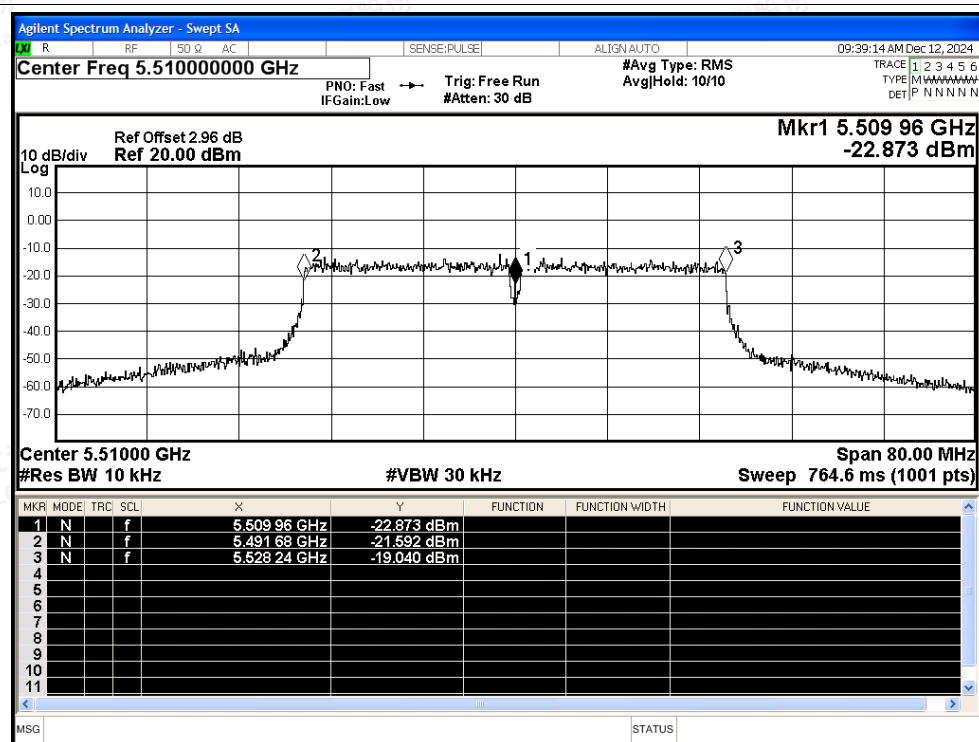

Freq. Stability NVNT n40 5550MHz Ant1

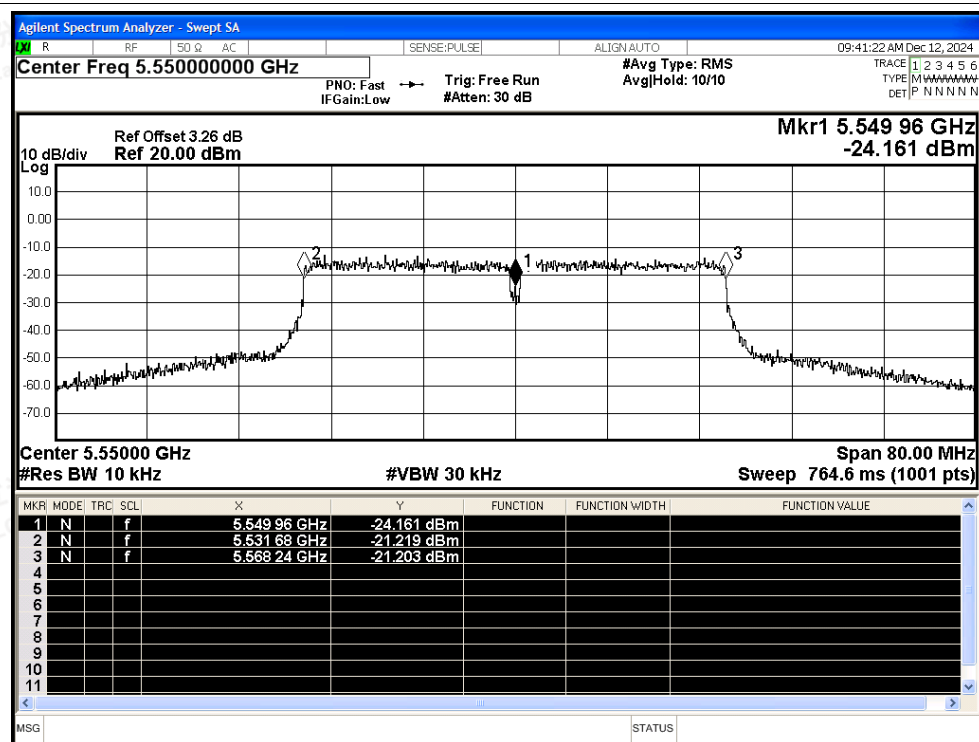

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5670MHz Ant1

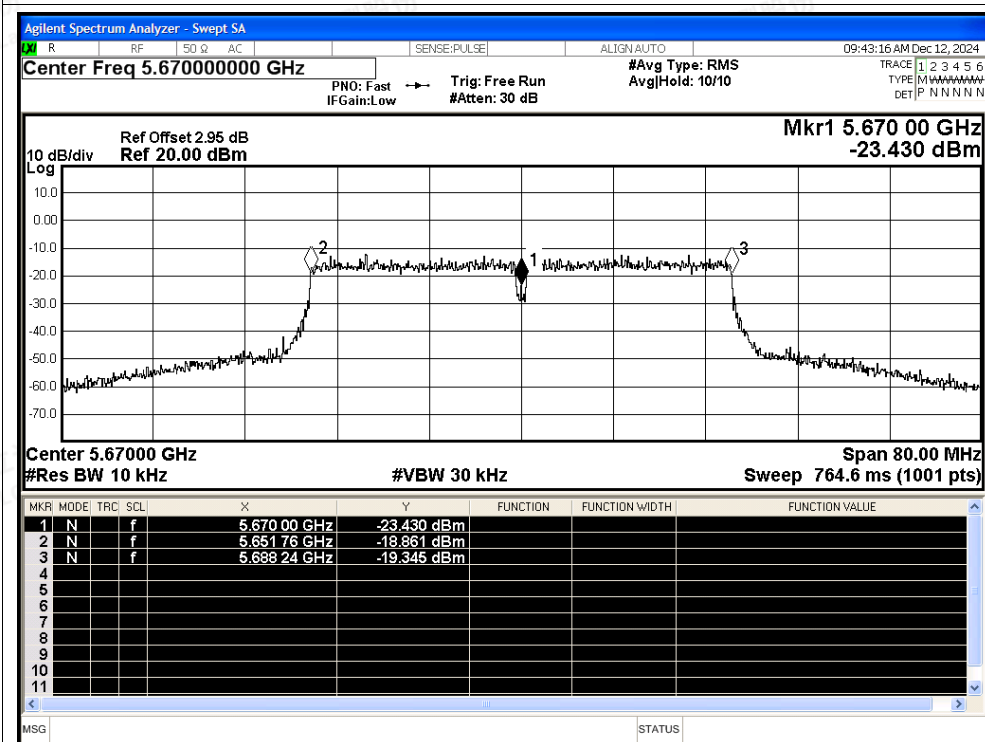

Freq. Stability NVNT ac20 5500MHz Ant1

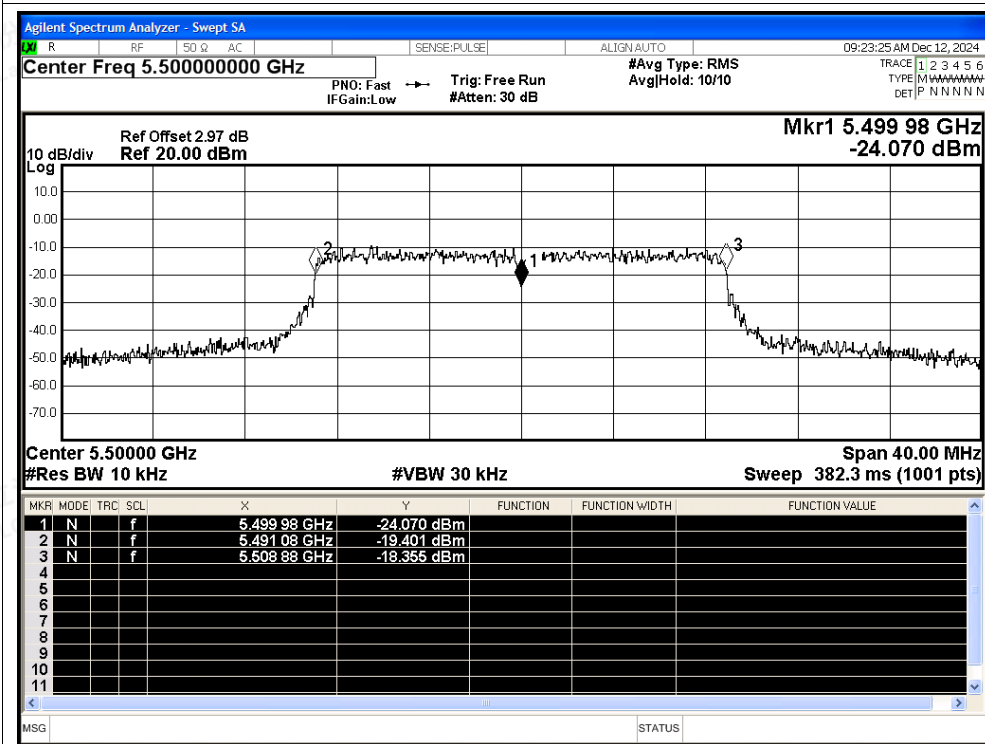

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5580MHz Ant1

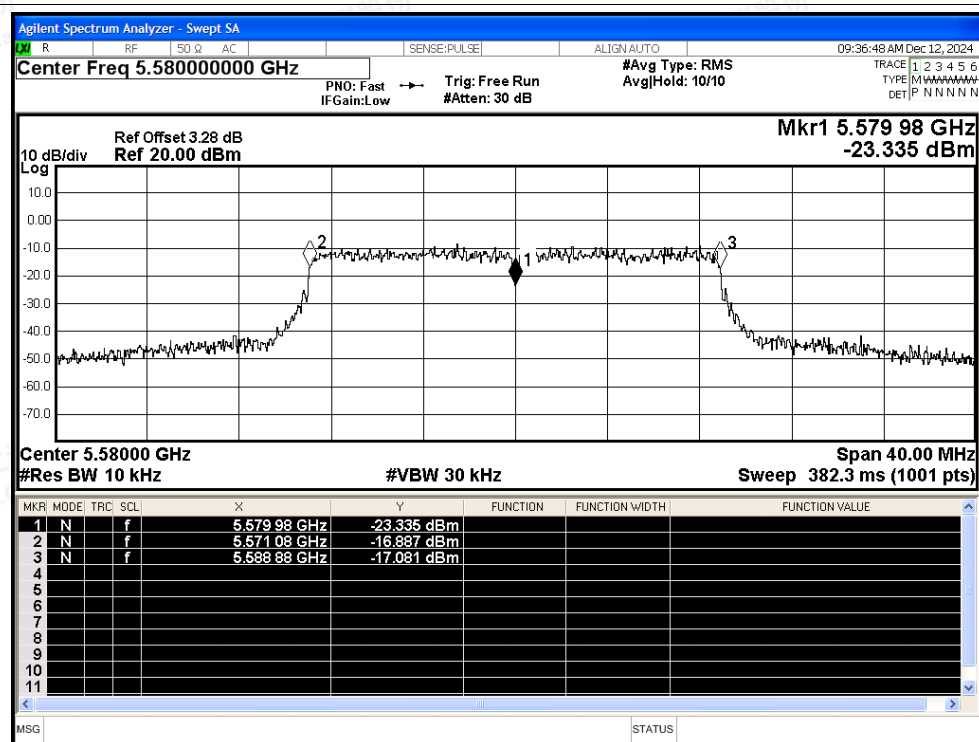

Freq. Stability NVNT ac20 5700MHz Ant1

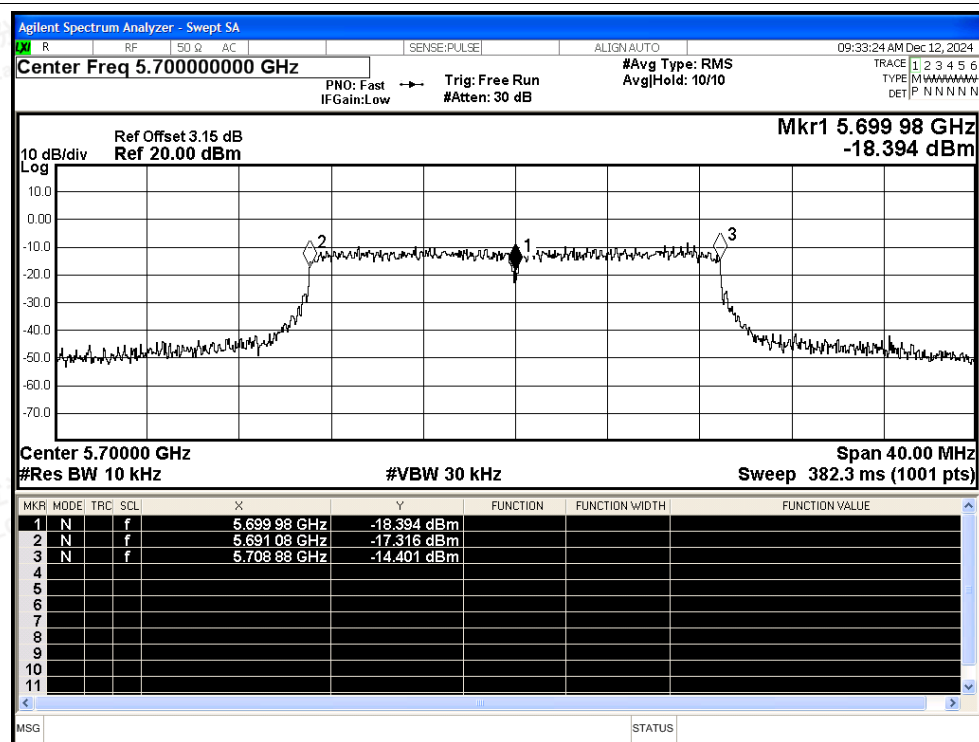

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5510MHz Ant1

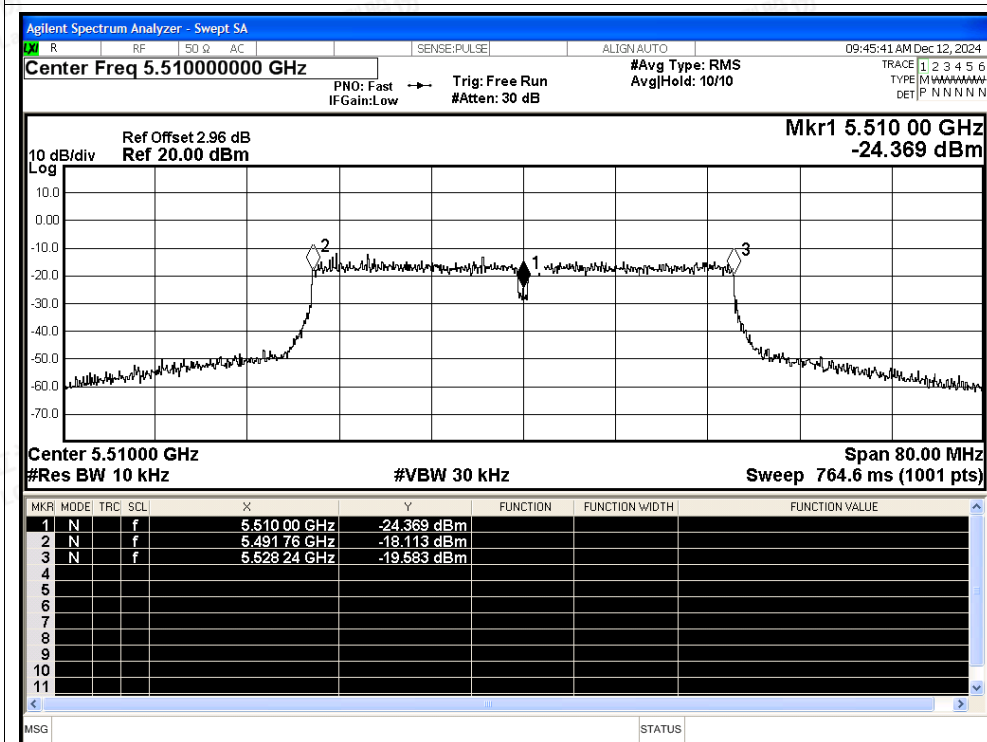

Freq. Stability NVNT ac40 5550MHz Ant1

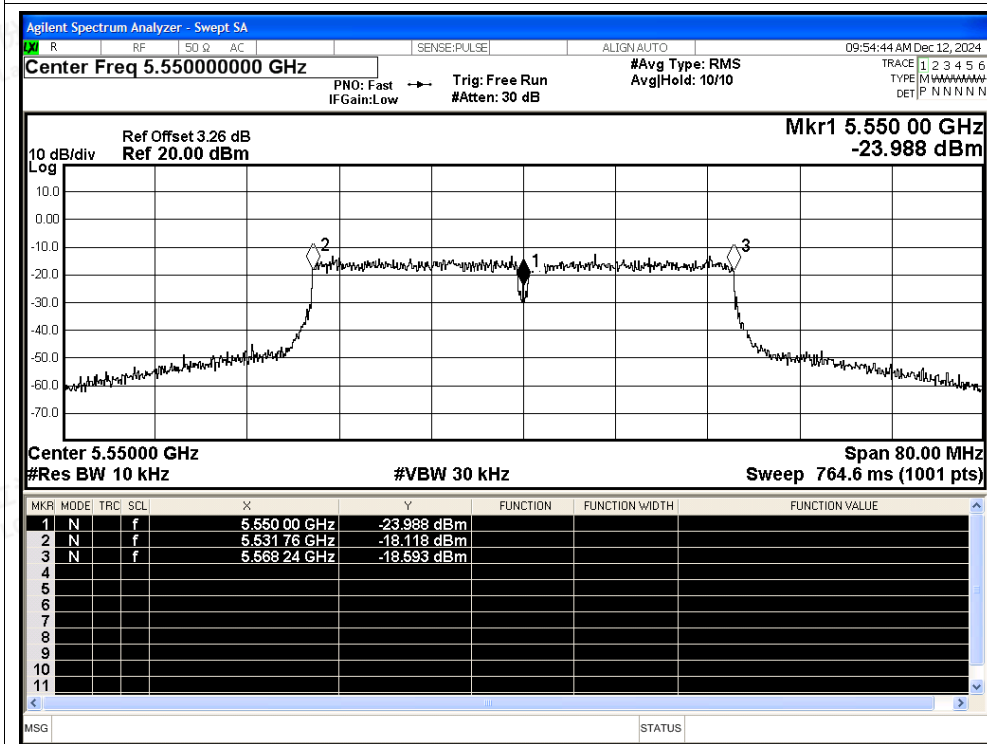

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5670MHz Ant1

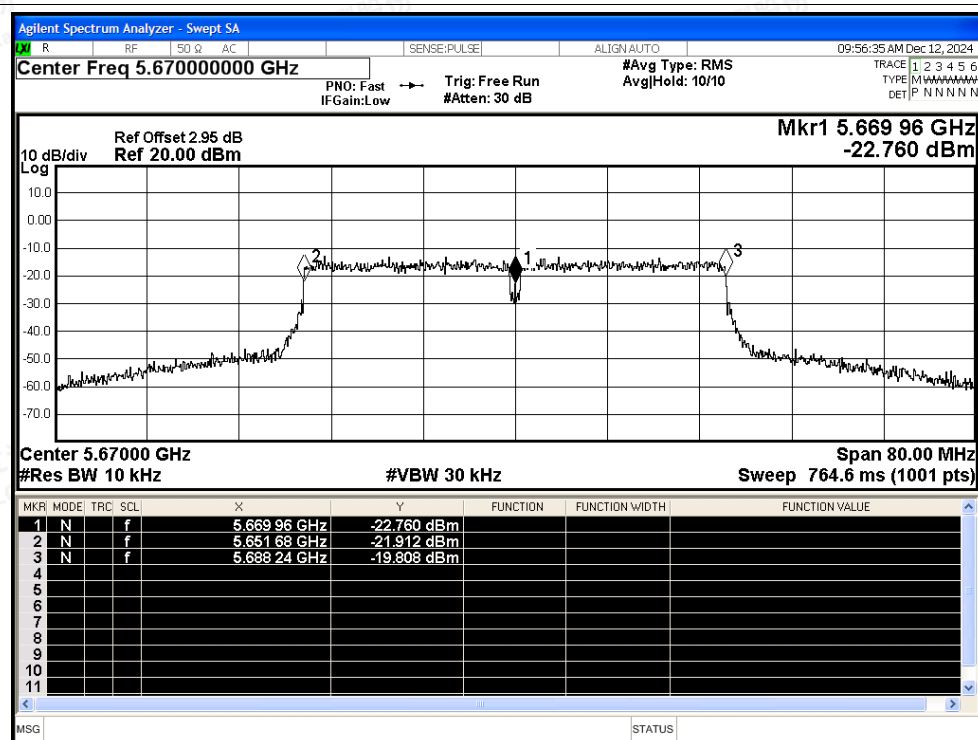

Freq. Stability NVNT ac80 5530MHz Ant1

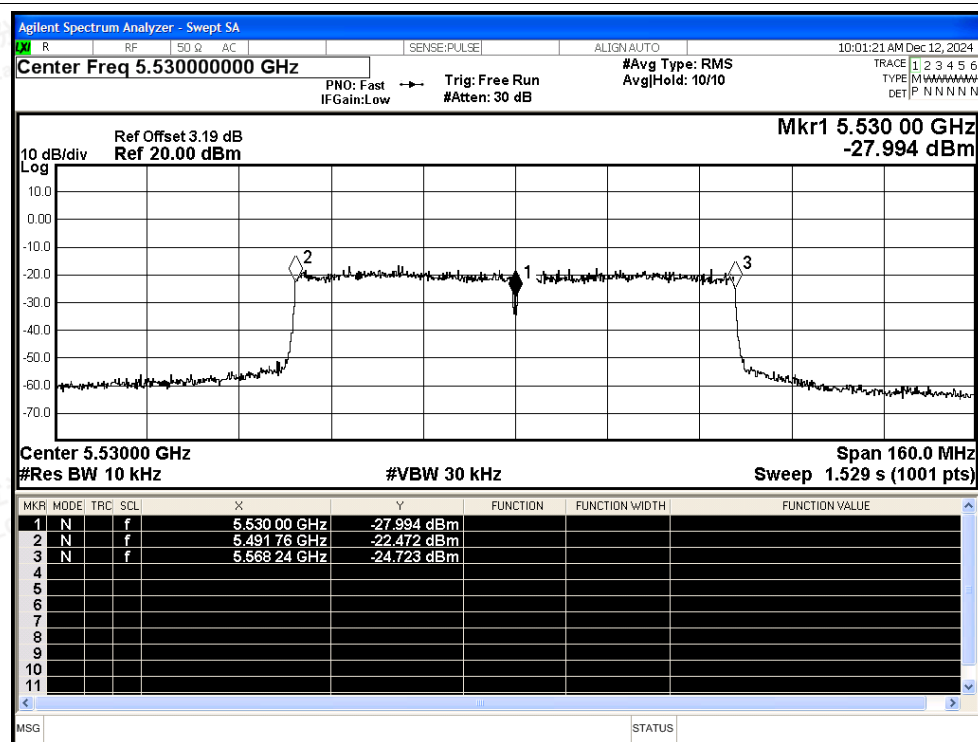

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac80 5610MHz Ant1

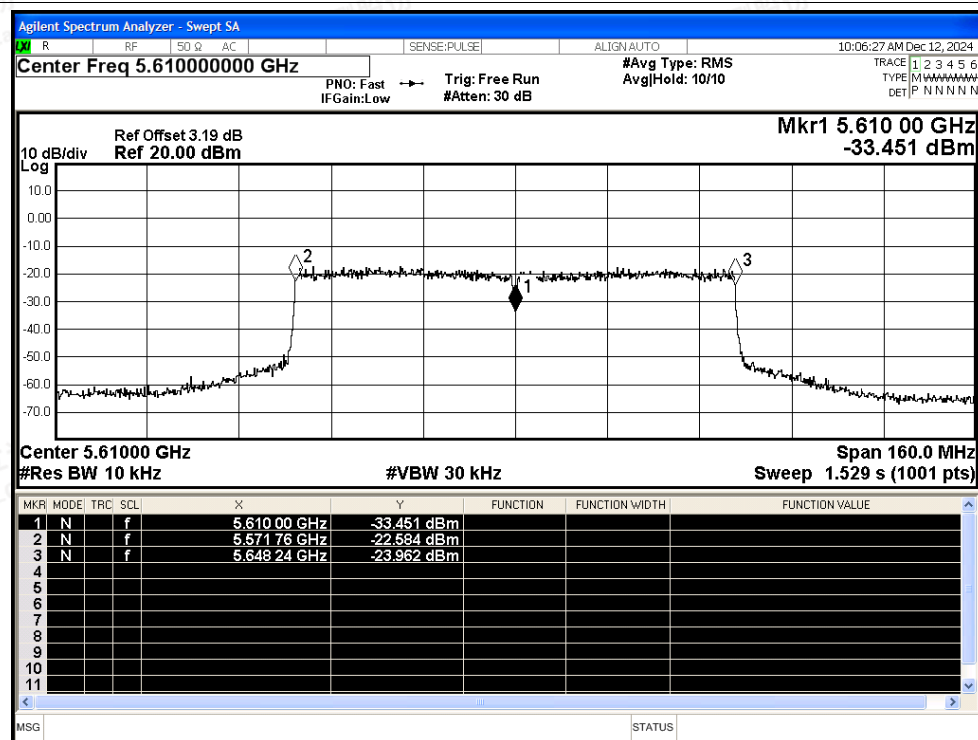

Freq. Stability NVNT ax20 5500MHz Ant1

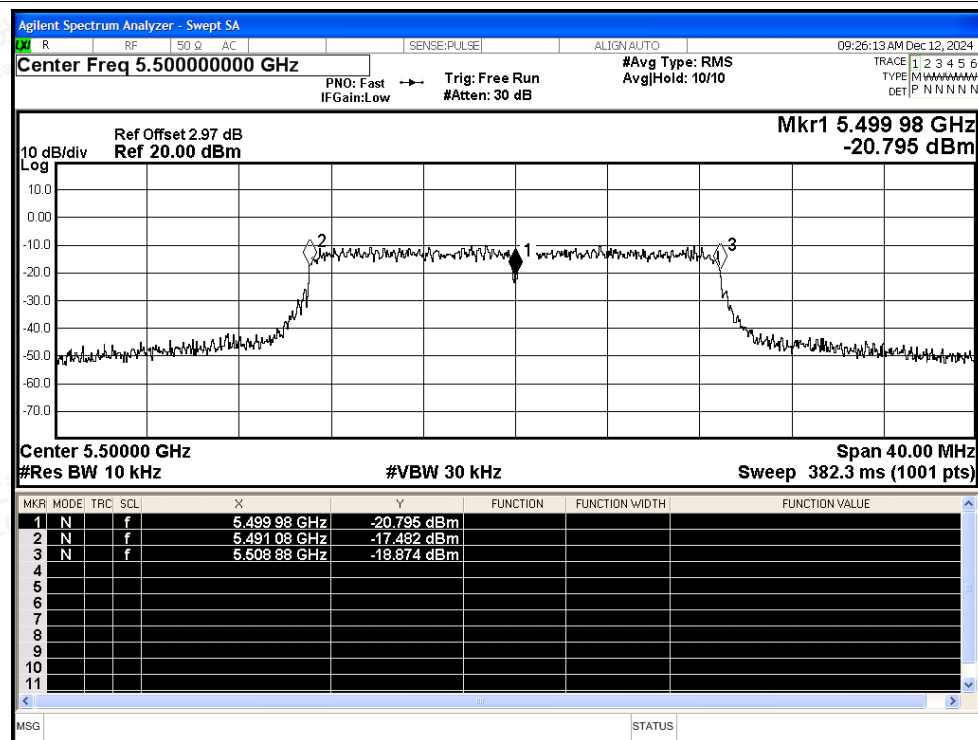

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5580MHz Ant1

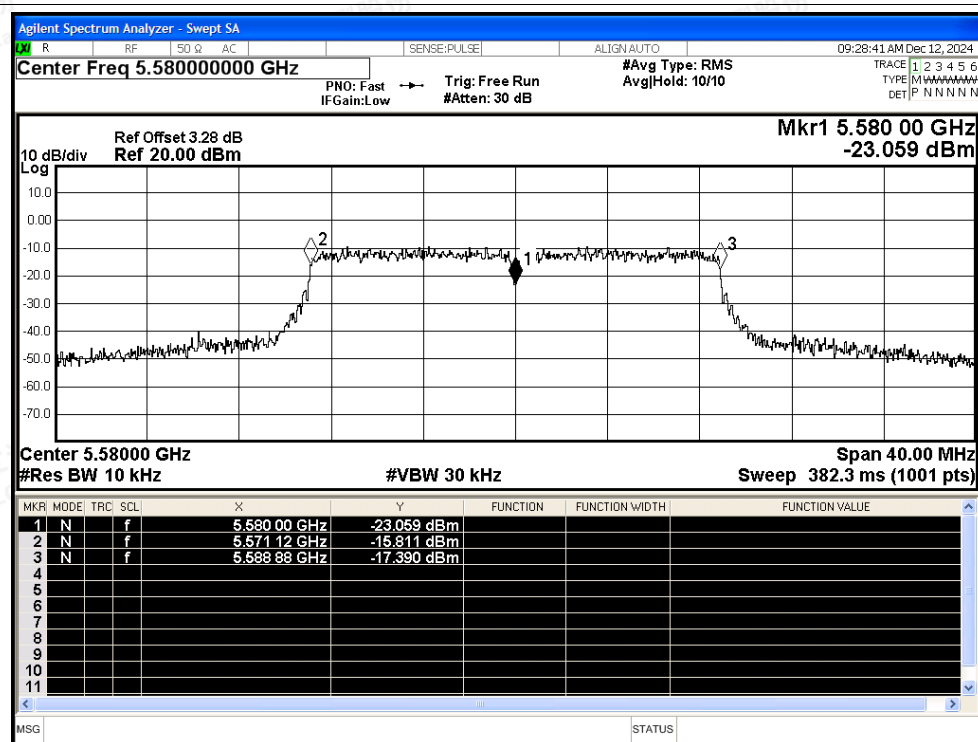

Freq. Stability NVNT ax20 5700MHz Ant1

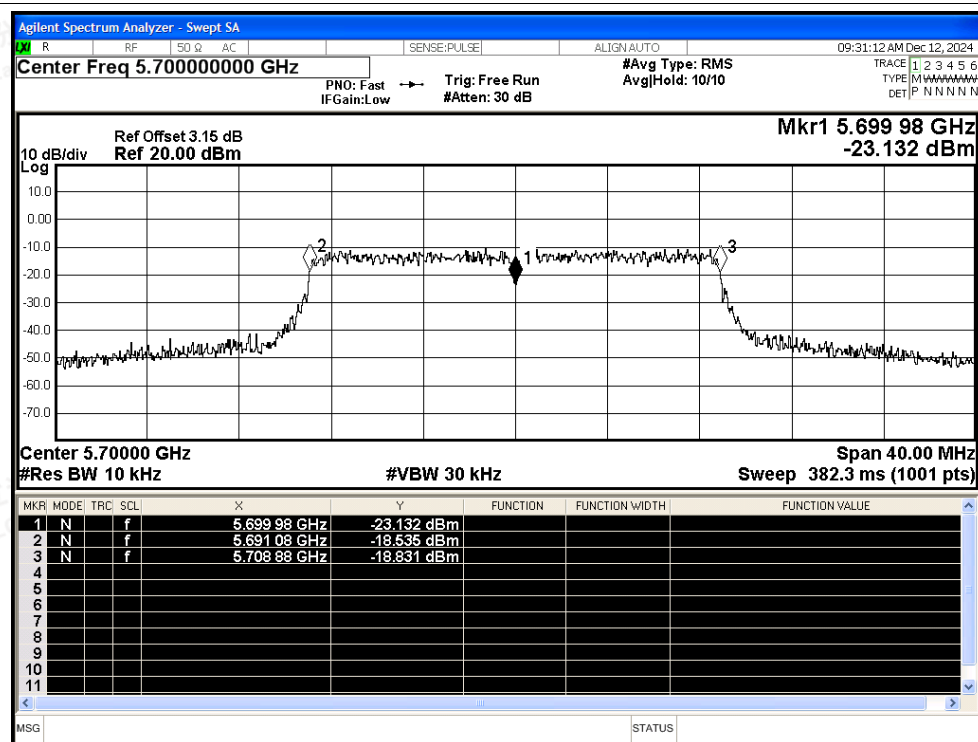

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5510MHz Ant1

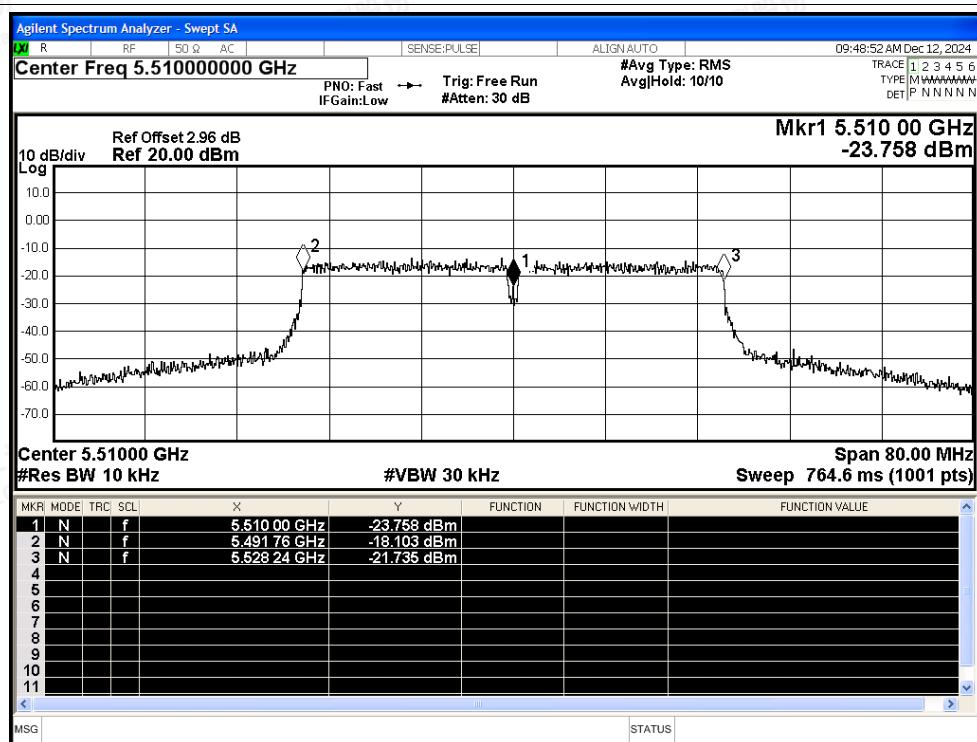

Freq. Stability NVNT ax40 5550MHz Ant1

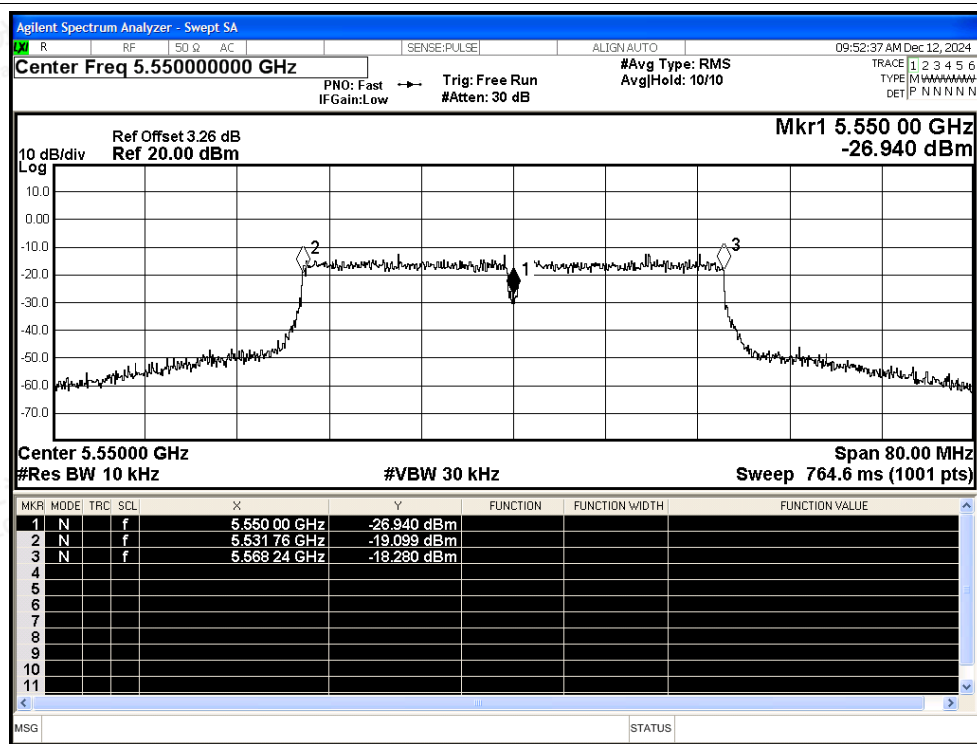

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5670MHz Ant1

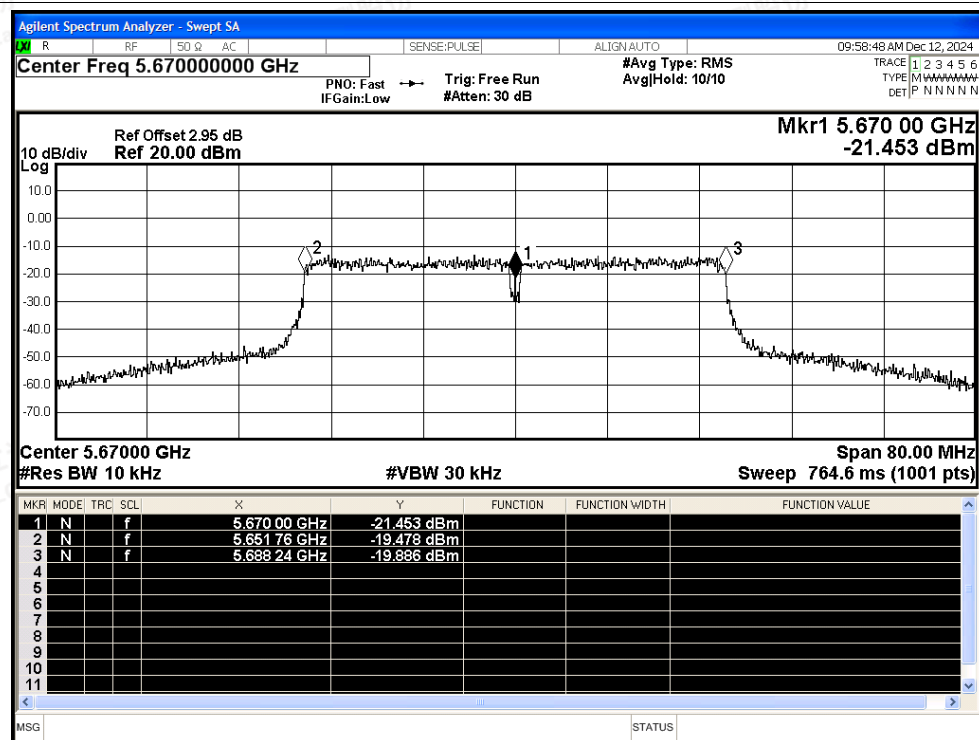

Freq. Stability NVNT ax80 5530MHz Ant1

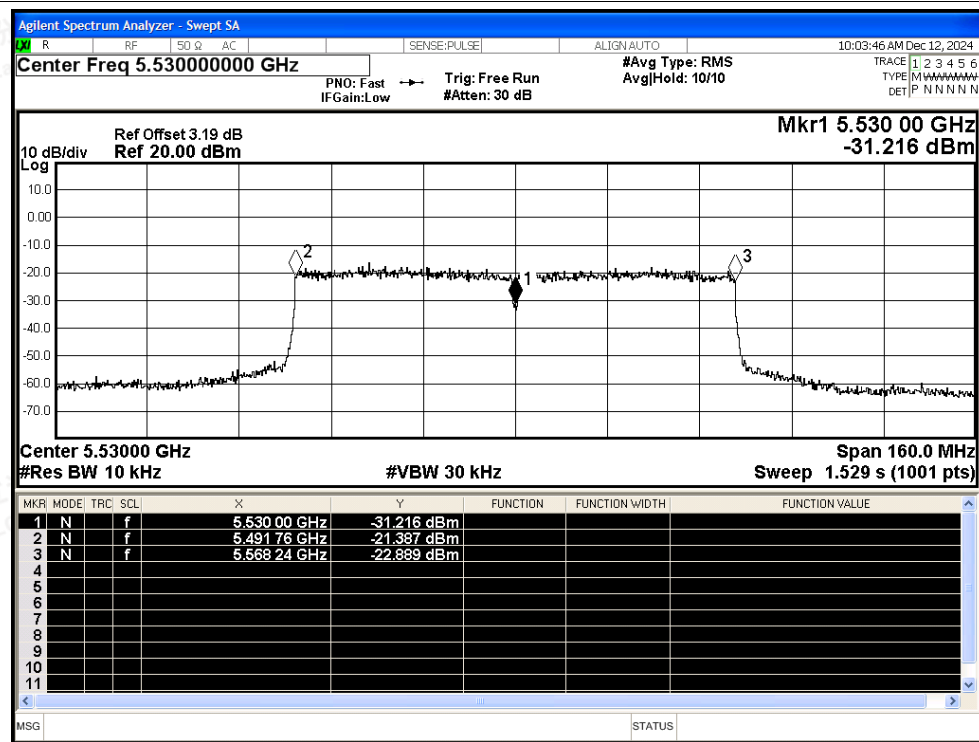


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

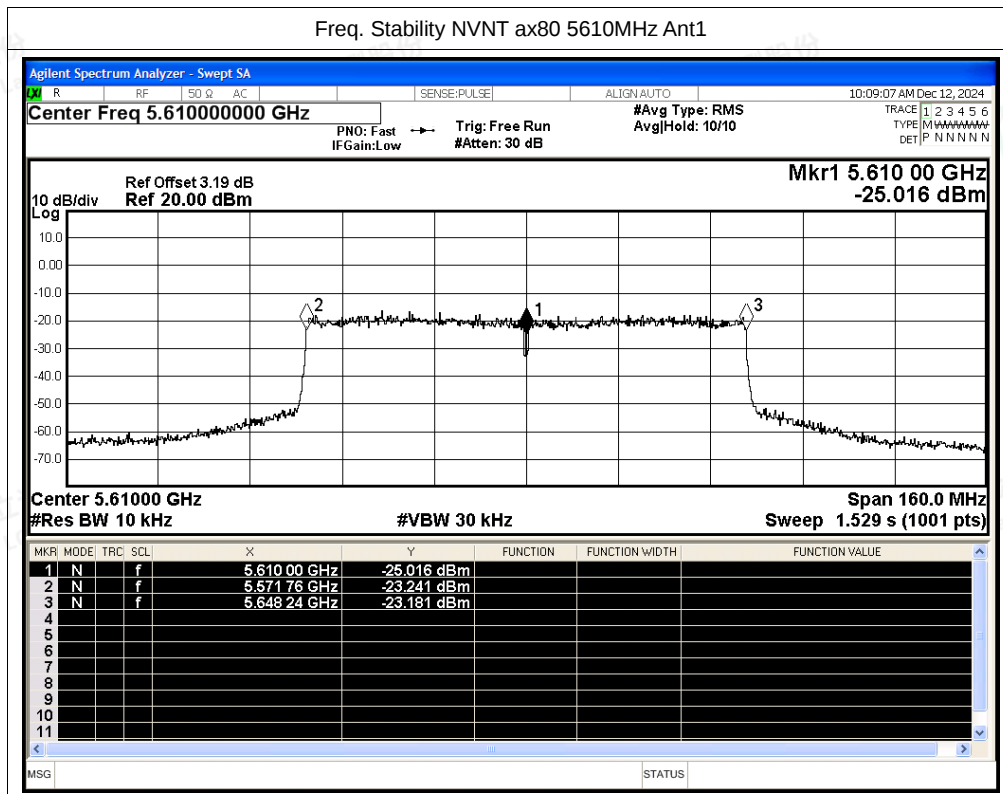

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity