









Restrict Band NVNT n40 5670MHz Peak

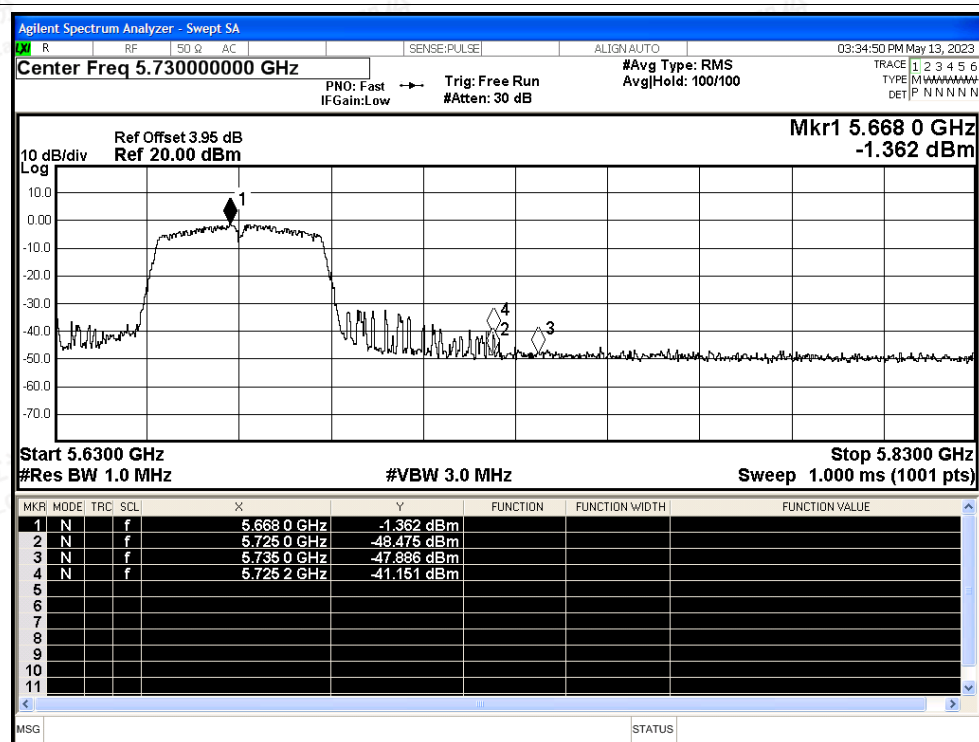

Restrict Band NVNT n40 5670MHz Average

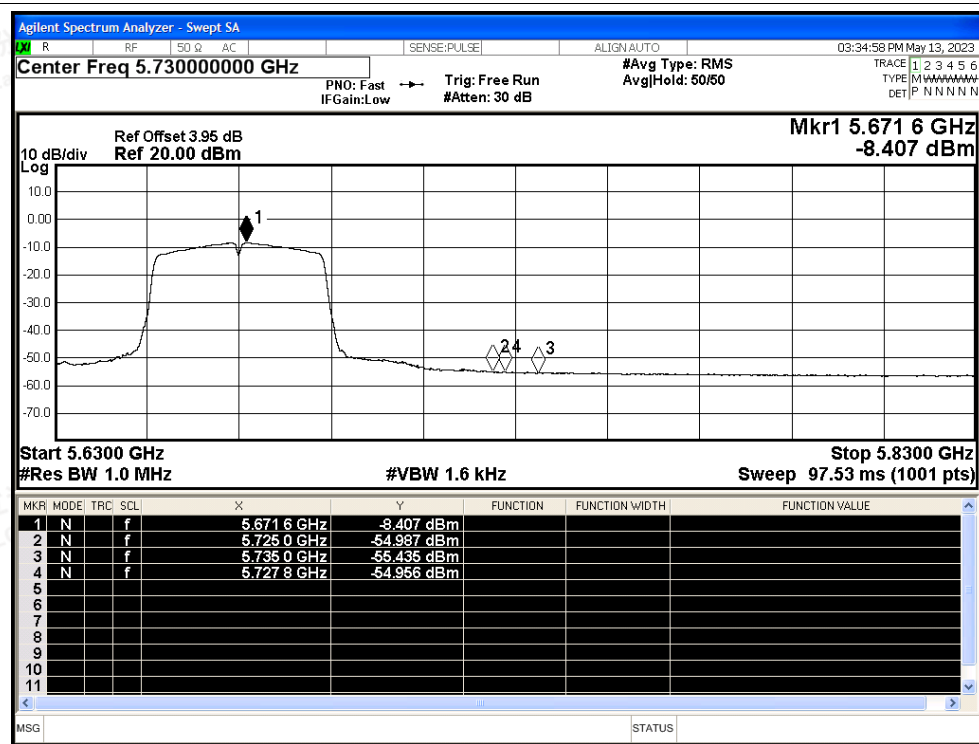

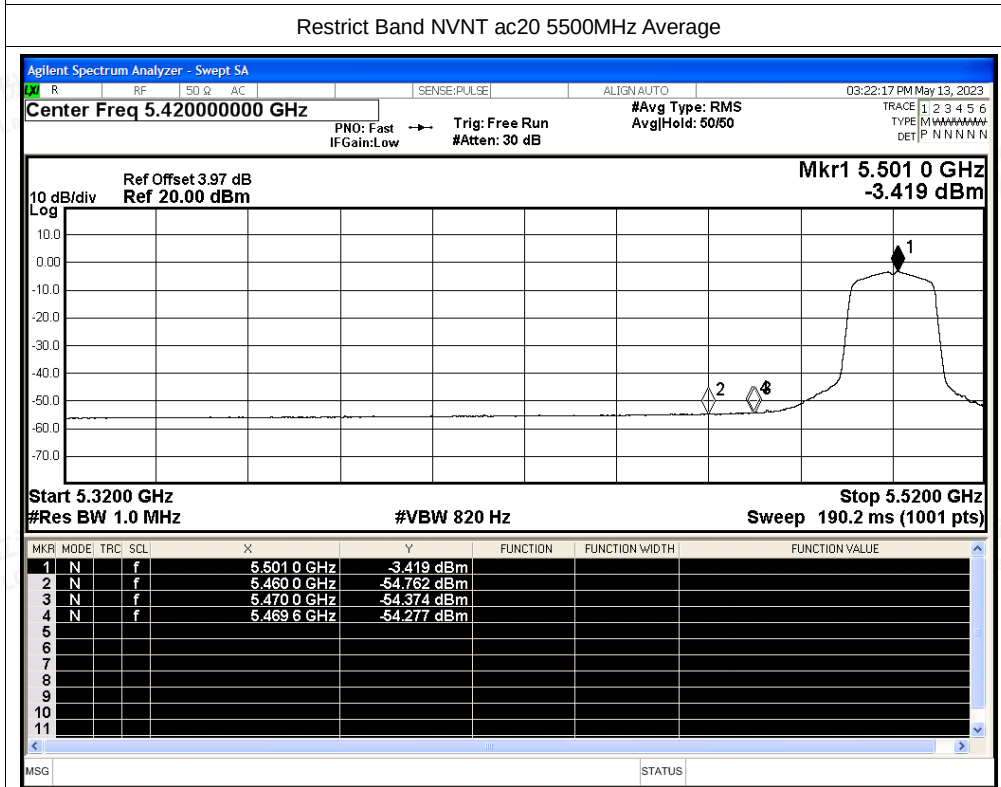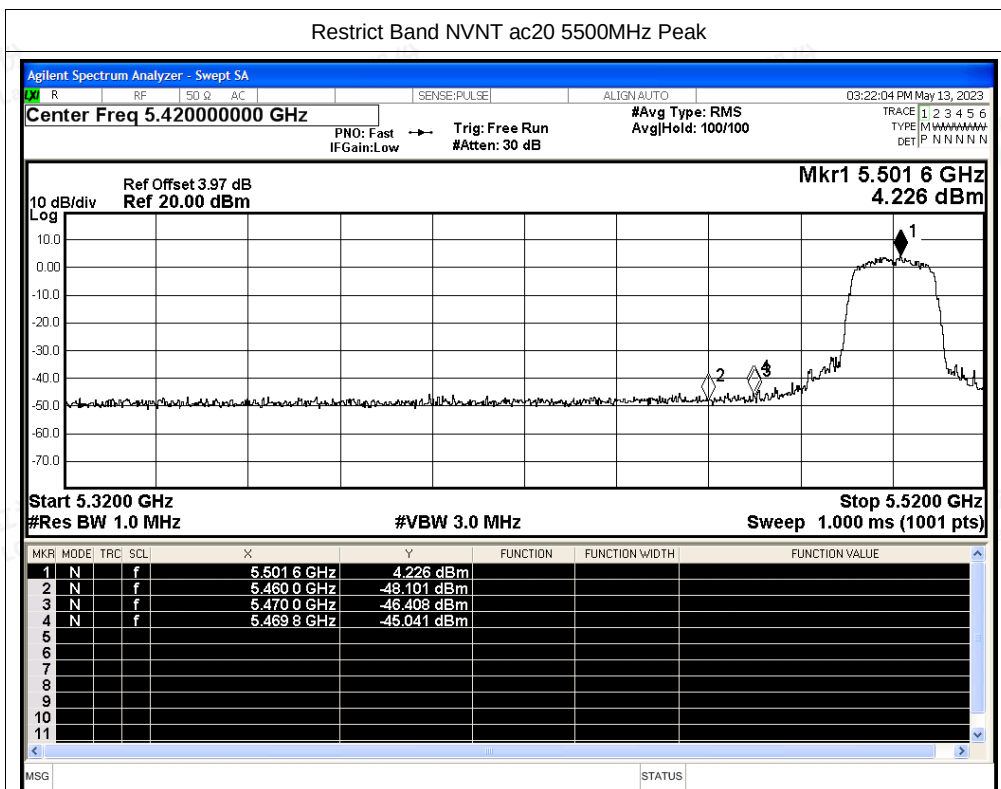

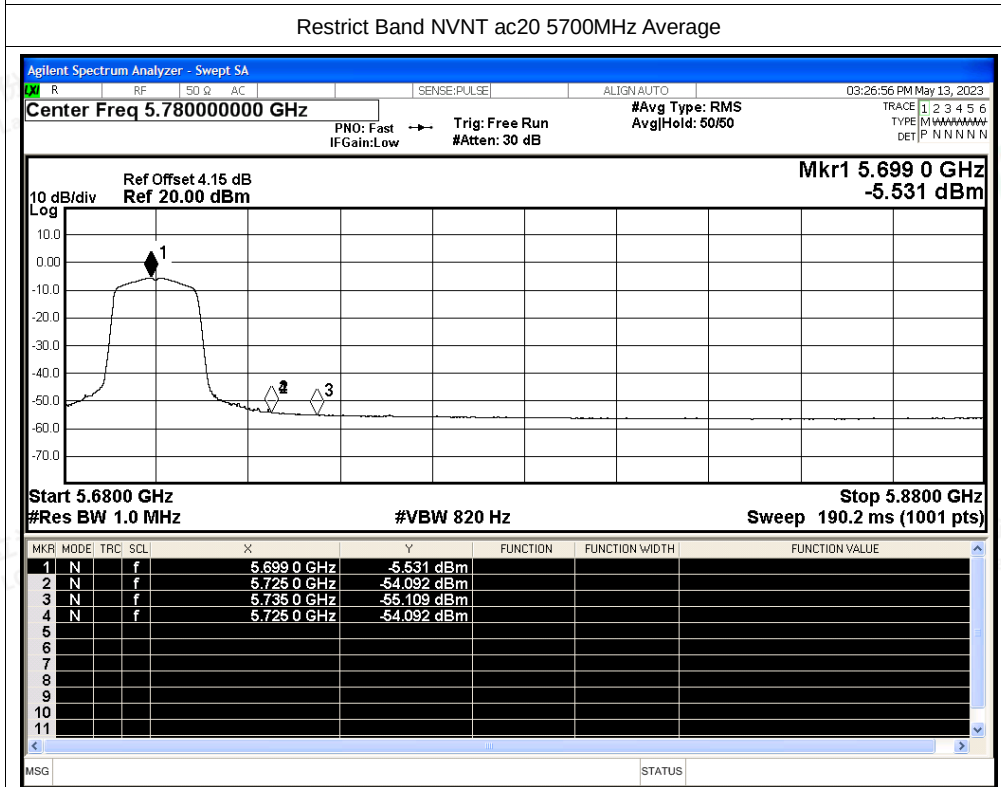
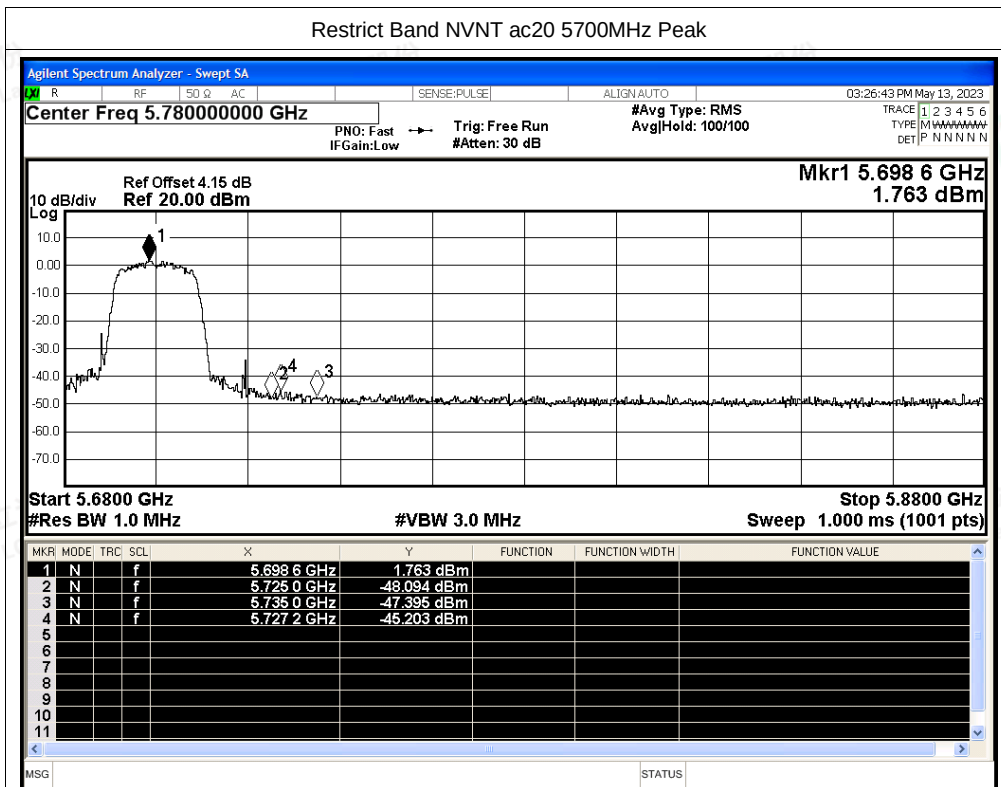




Shenzhen LCS Compliance Testing Laboratory Ltd.



Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

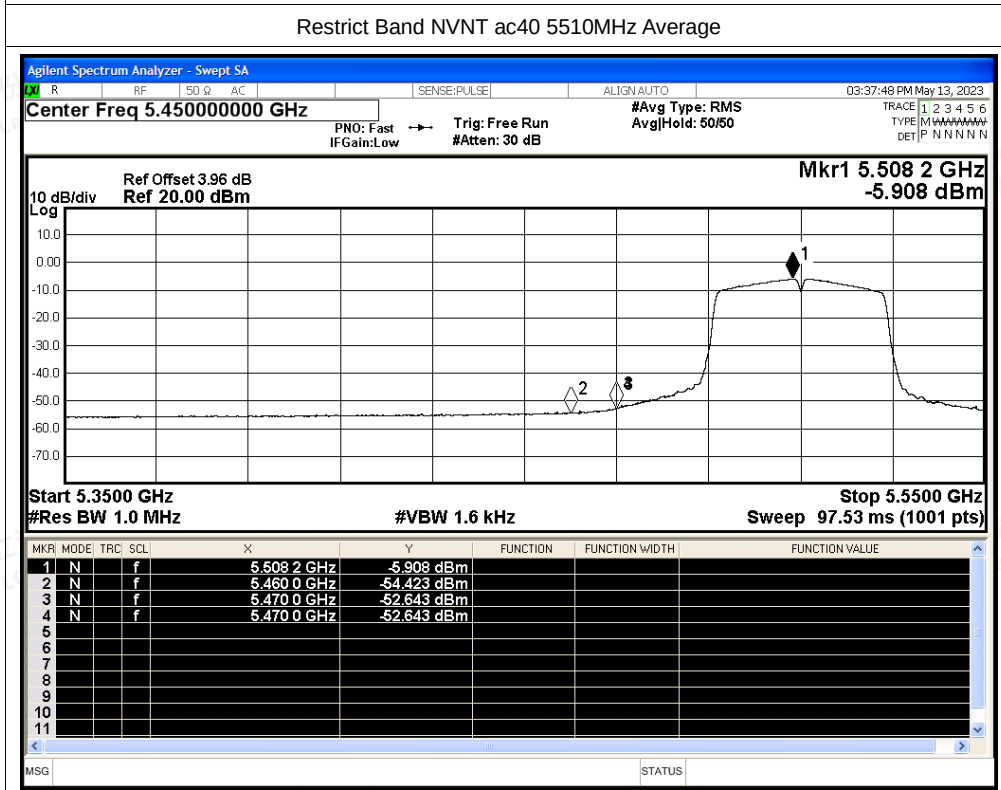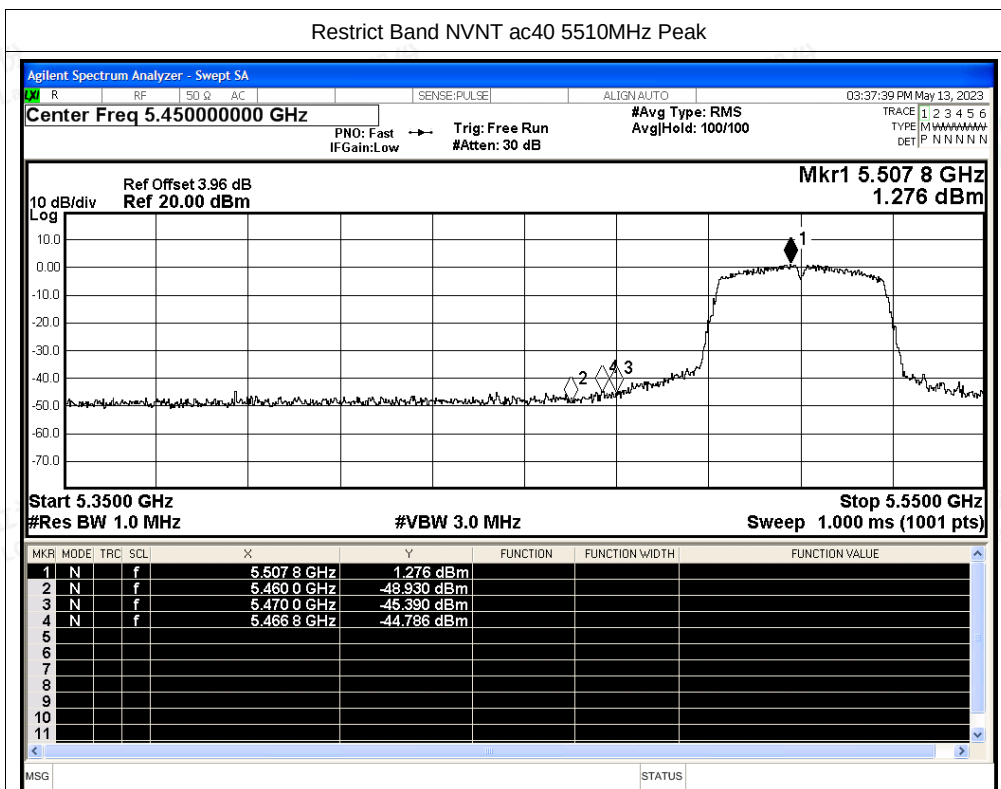

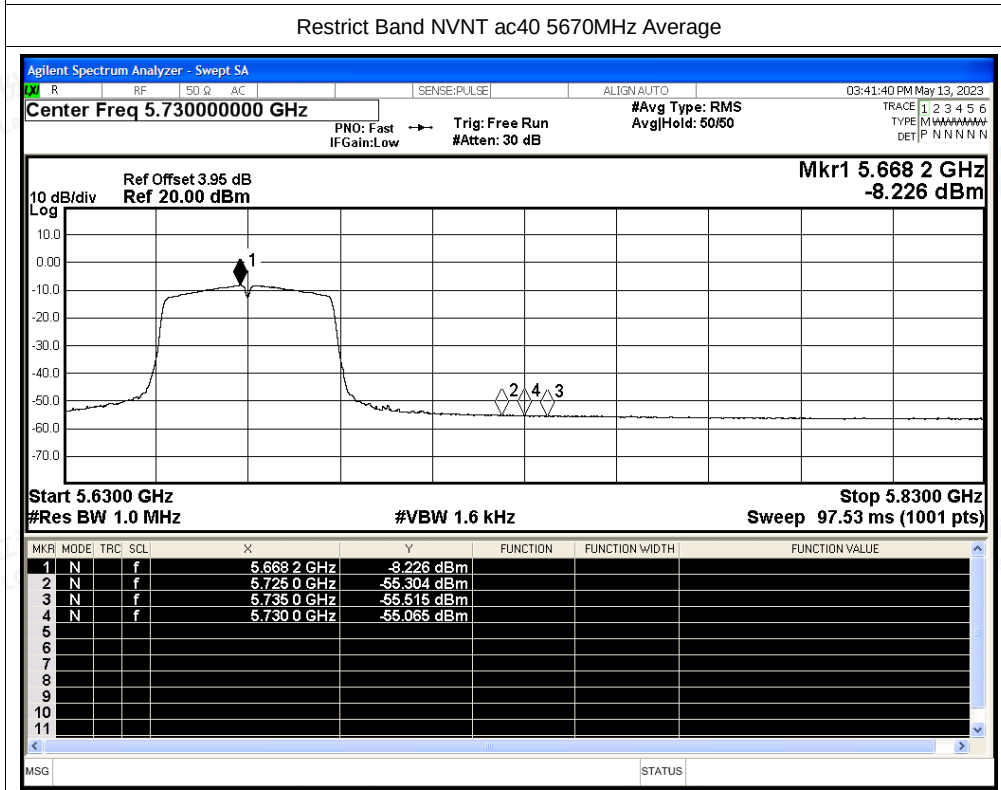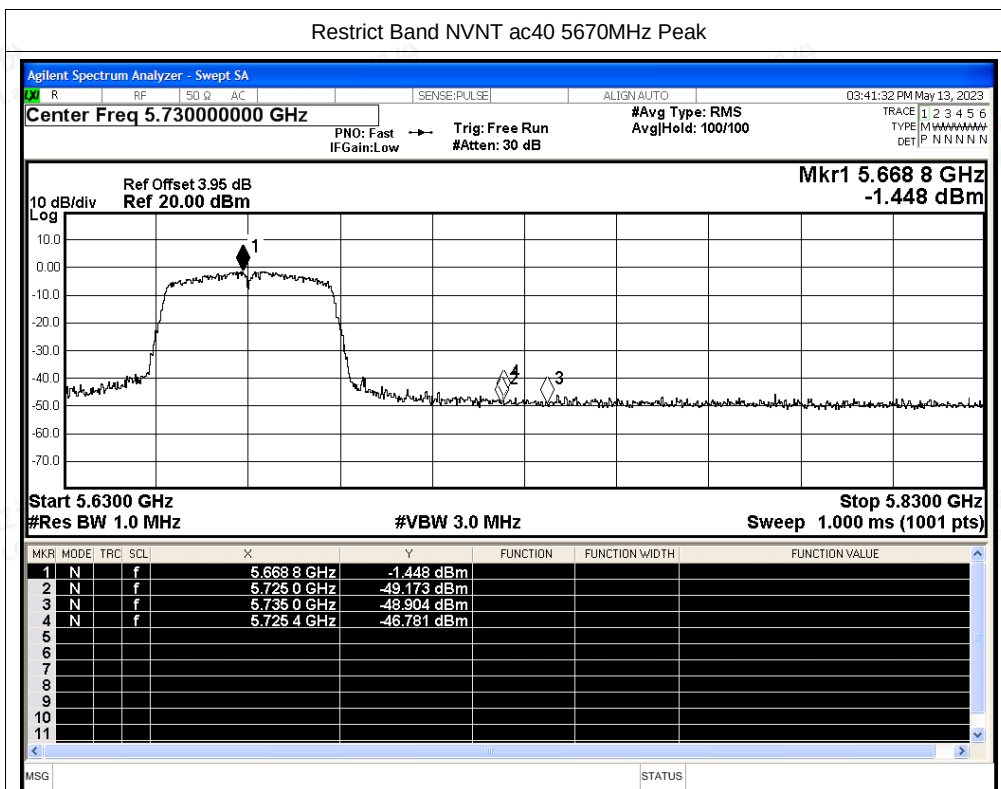

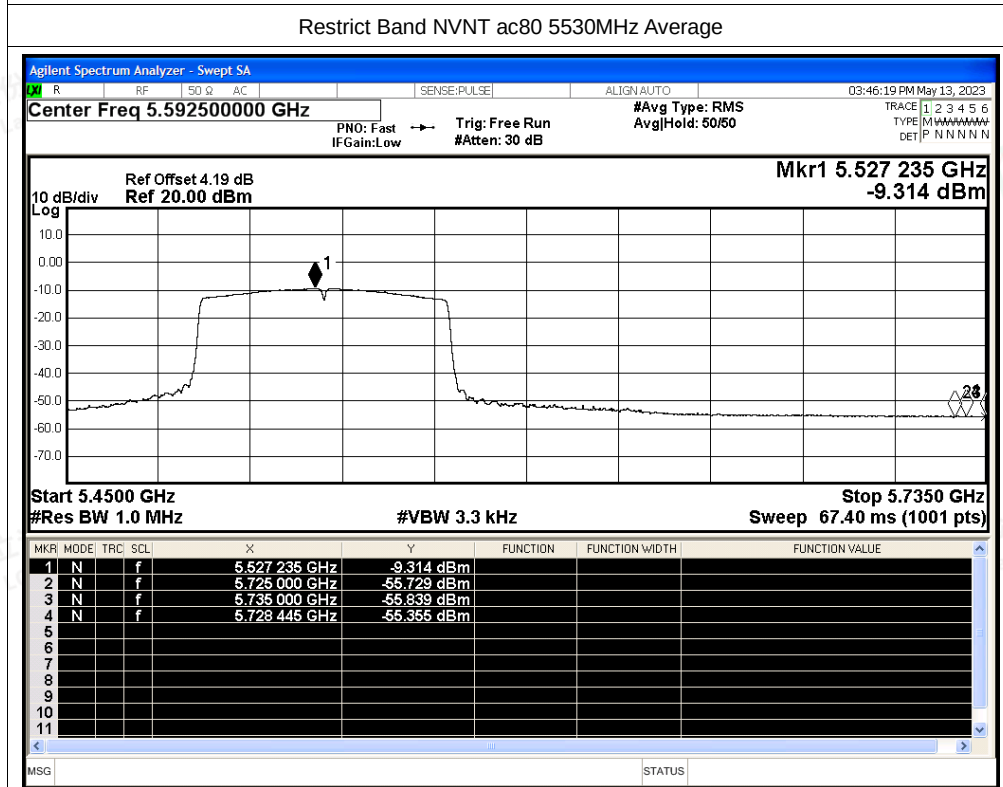
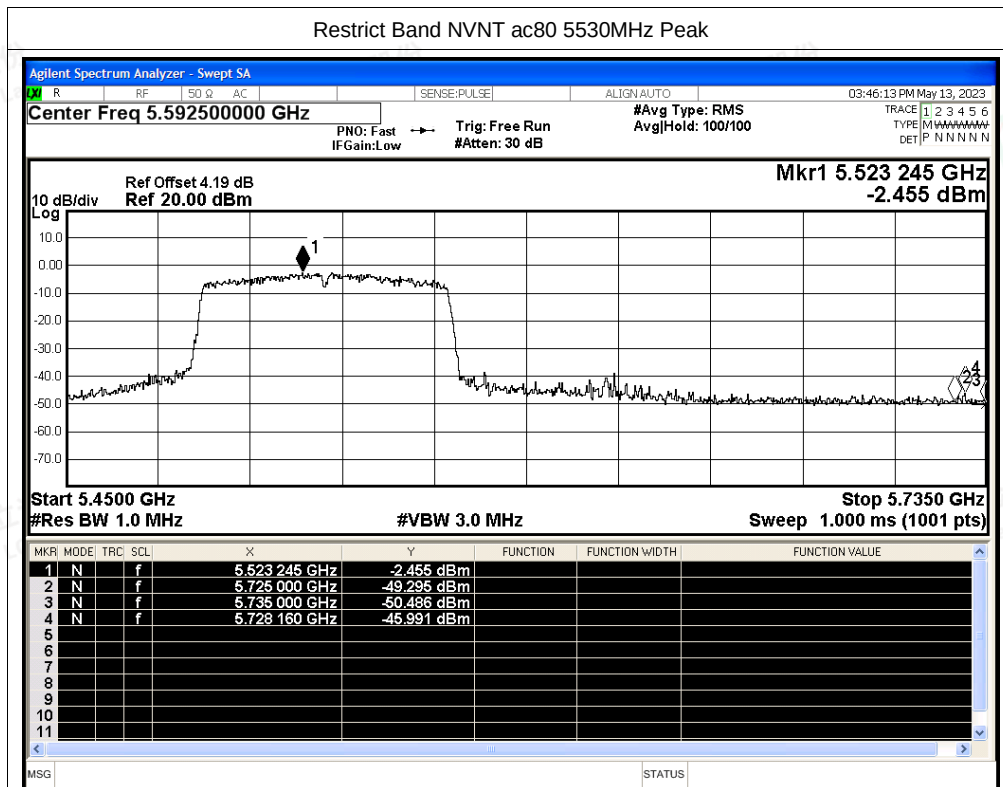




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

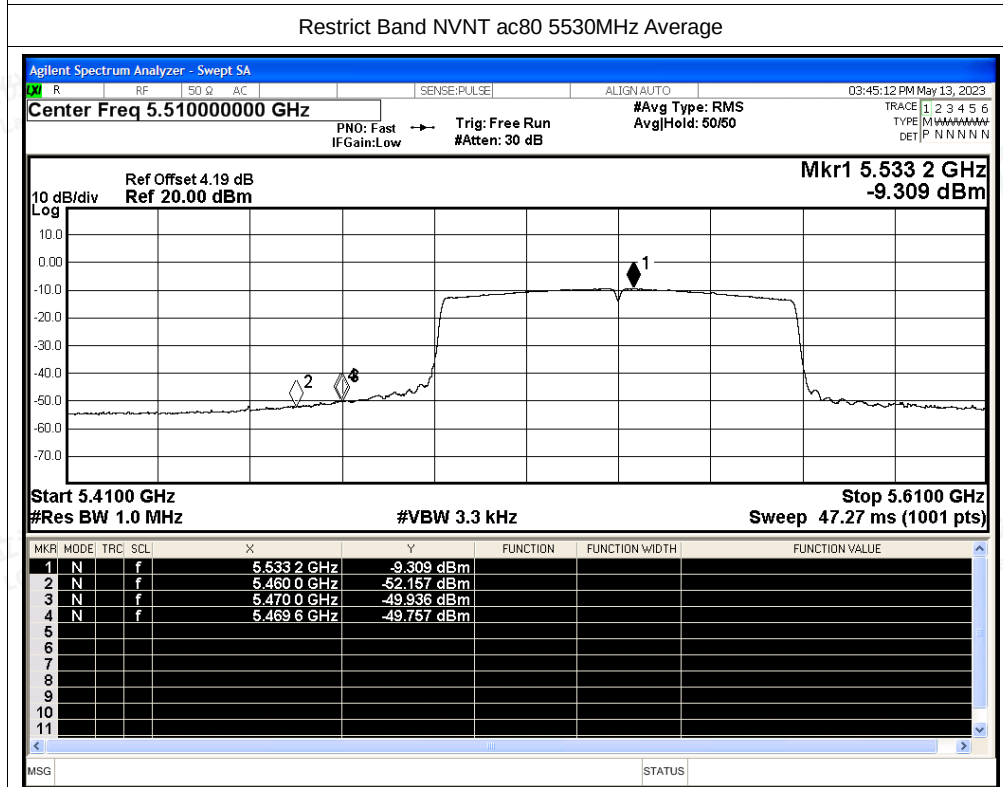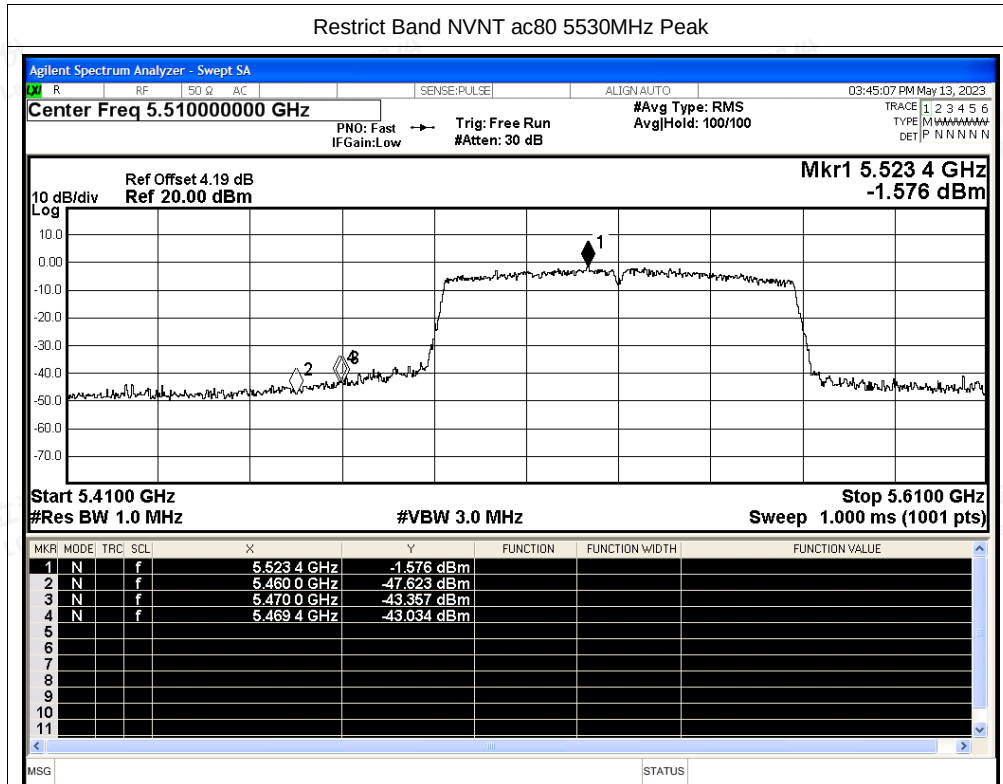

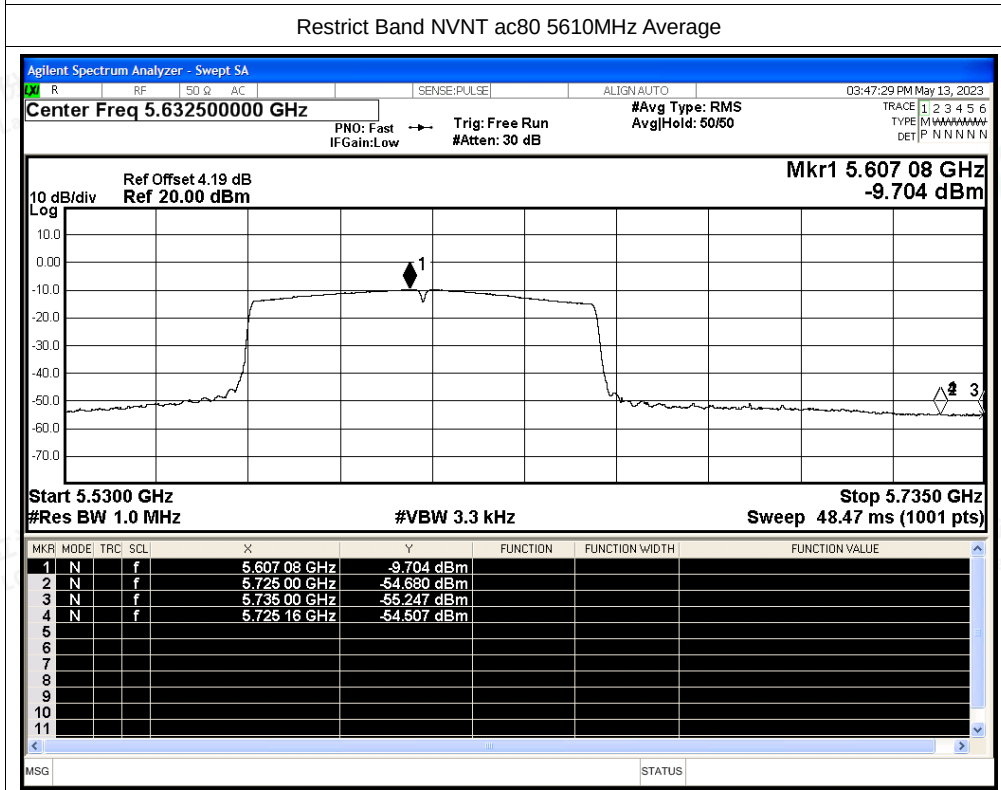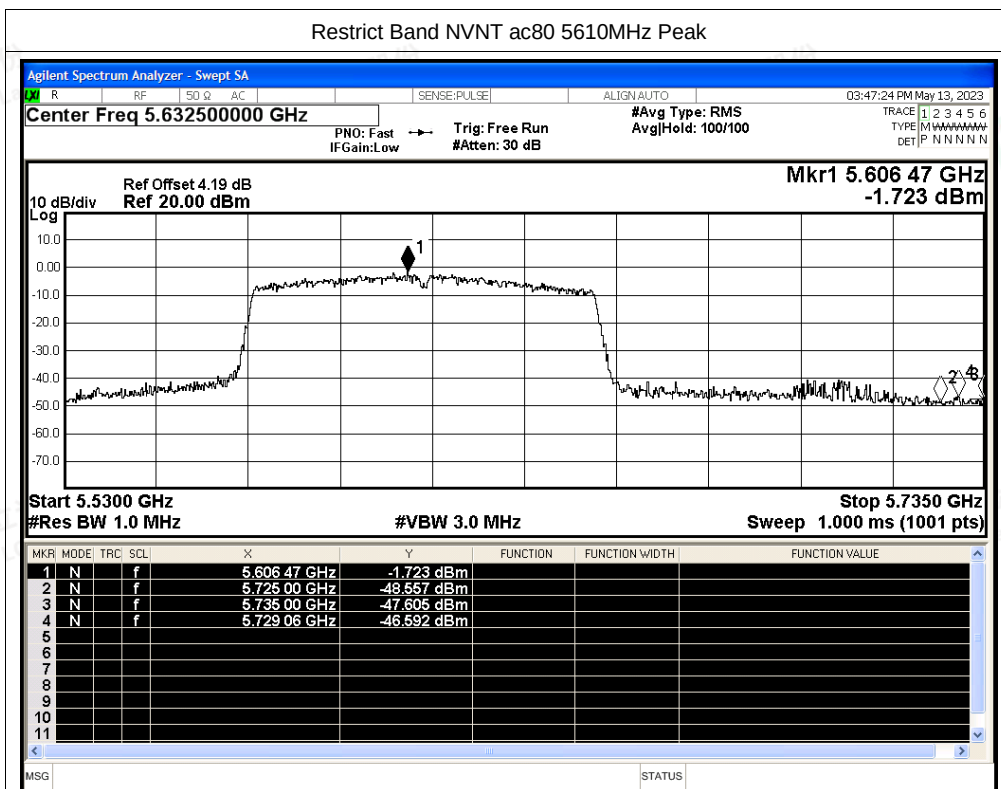



F.5 Frequency Stability


Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	ac20	5500	Ant0	5500	0	0	25	Pass
NVNT	ac20	5580	Ant0	5580	0	0	25	Pass
NVNT	ac20	5700	Ant0	5700	0	0	25	Pass
NVNT	ac40	5510	Ant0	5510.04	40000	7.26	25	Pass
NVNT	ac40	5550	Ant0	5549.96	-40000	-7.21	25	Pass
NVNT	ac40	5670	Ant0	5670	0	0	25	Pass
NVNT	ac80	5530	Ant0	5530	0	0	25	Pass
NVNT	ac80	5610	Ant0	5610	0	0	25	Pass






Test Graphs

Freq. Stability NVNT ac20 5500MHz Ant0

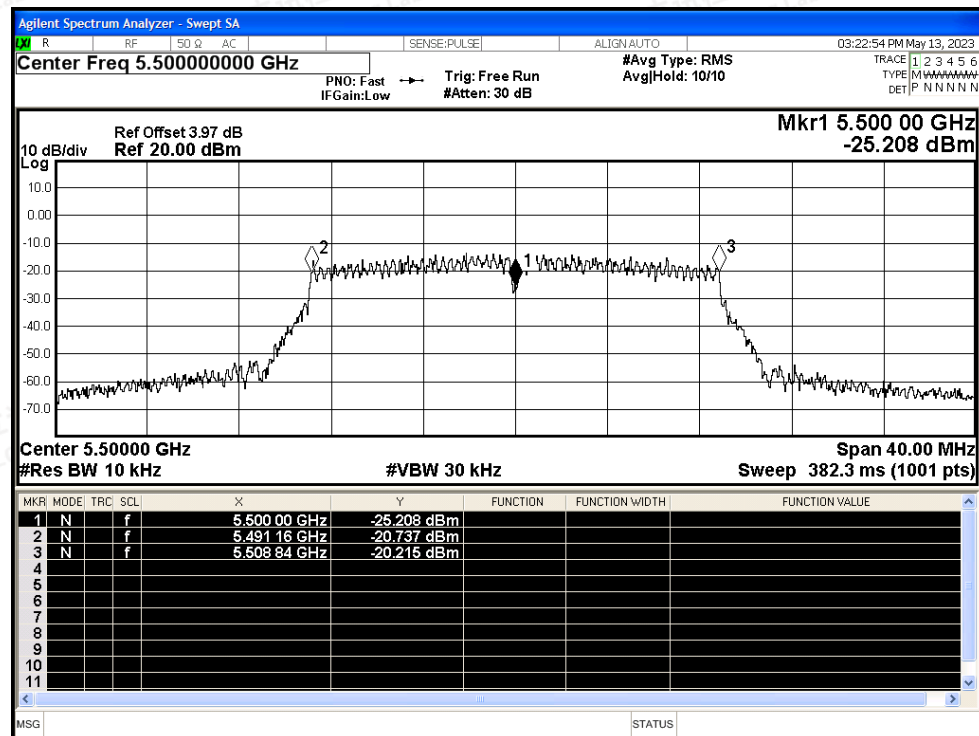

Freq. Stability NVNT ac20 5580MHz Ant0


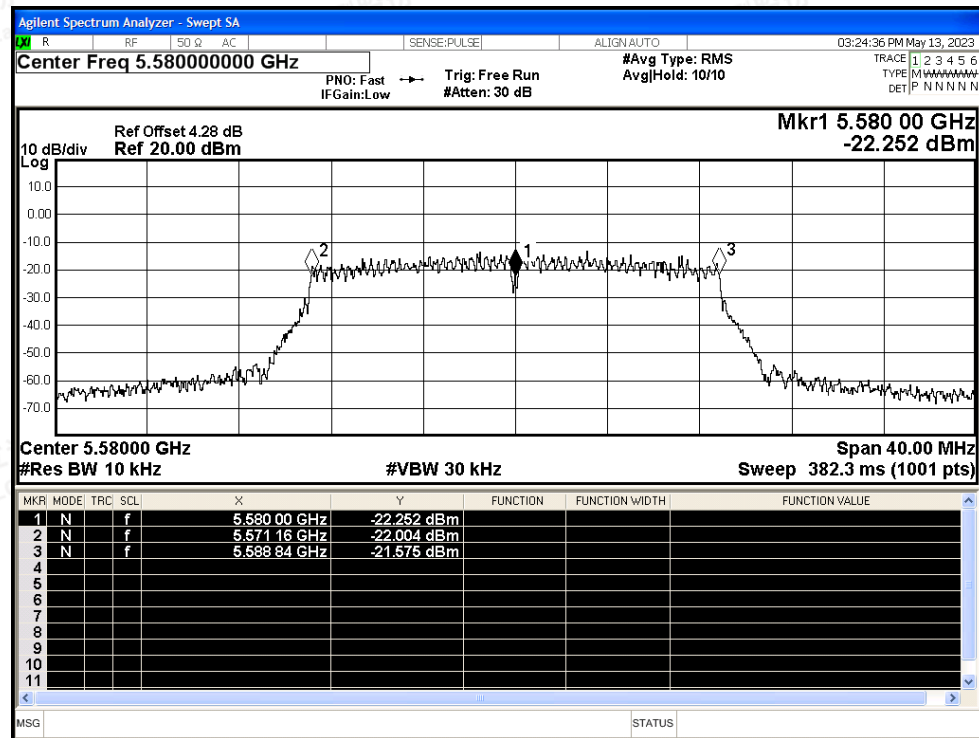




Shenzhen LCS Compliance Testing Laboratory Ltd.



Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

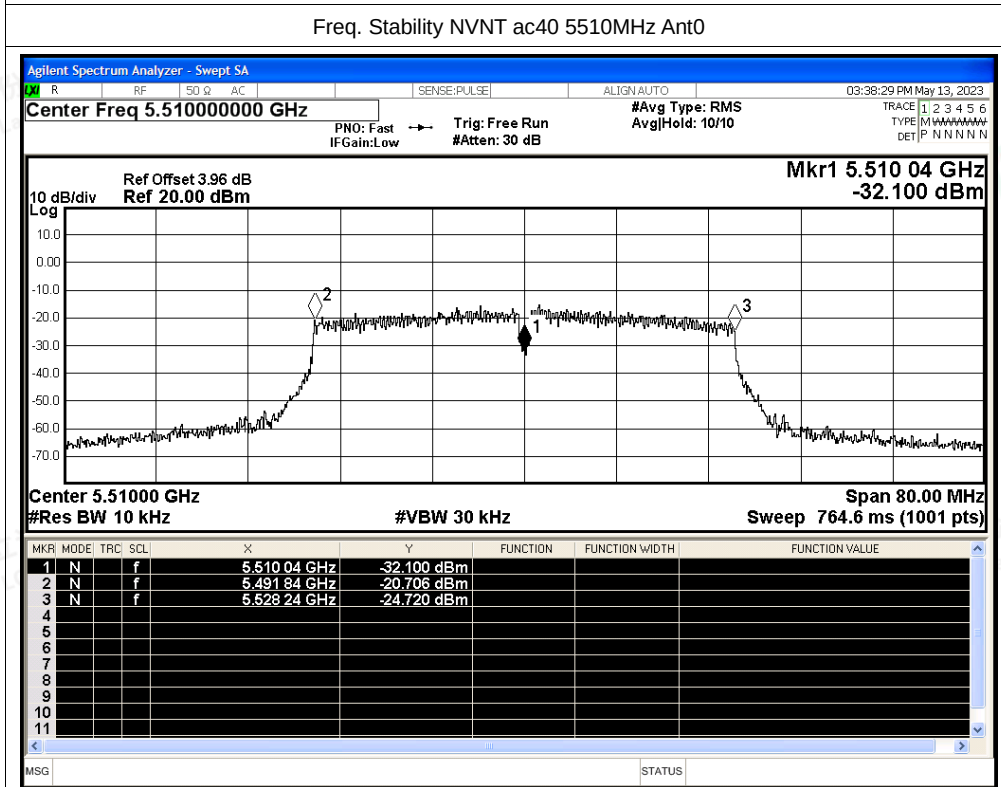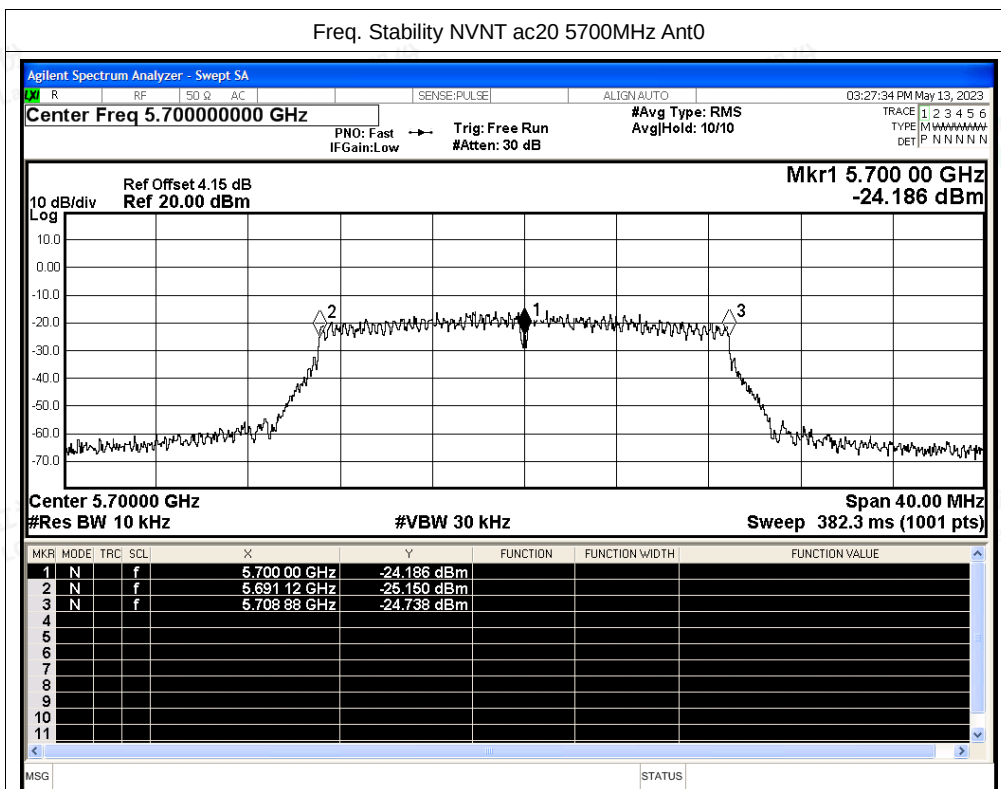

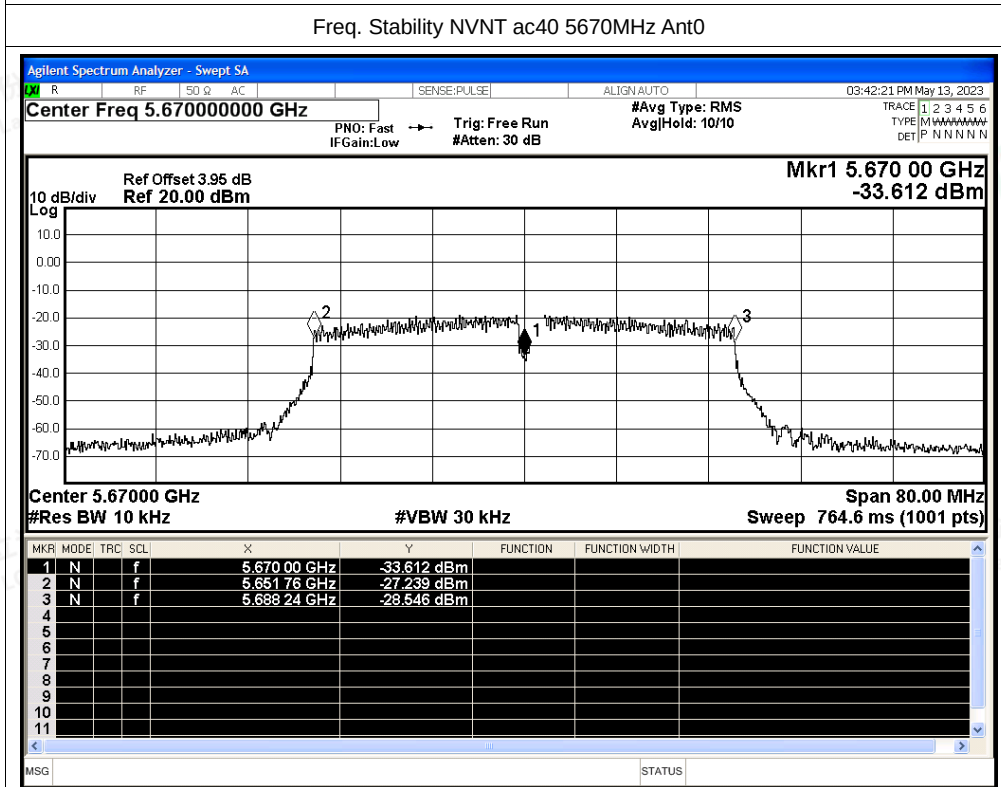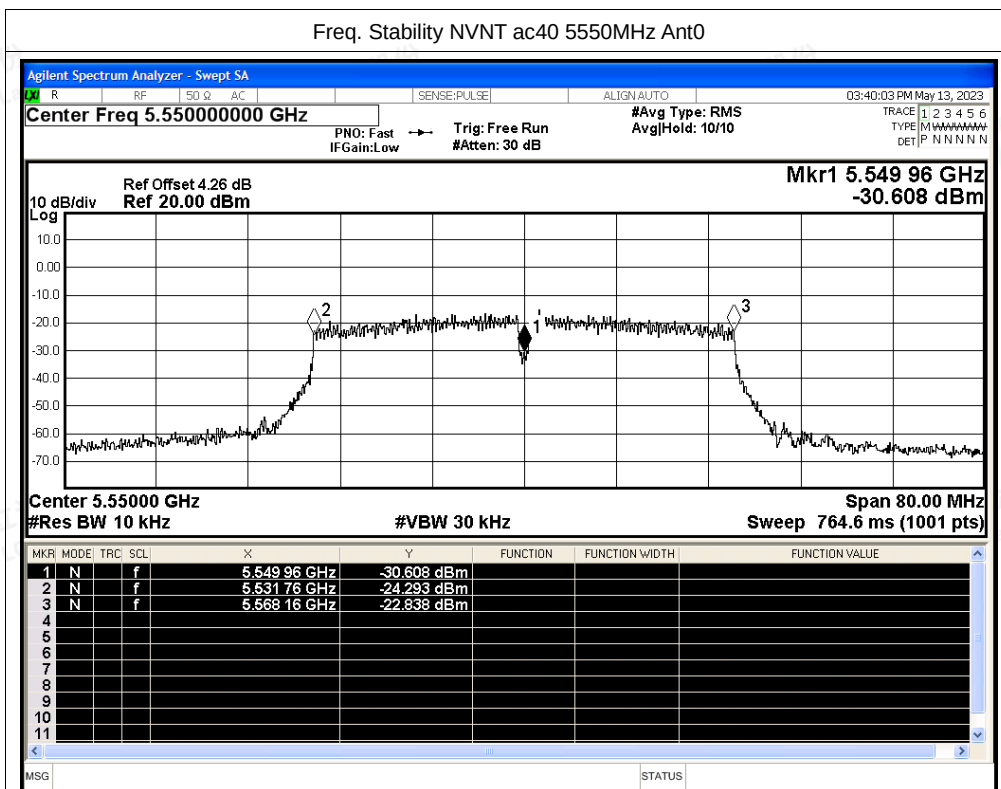

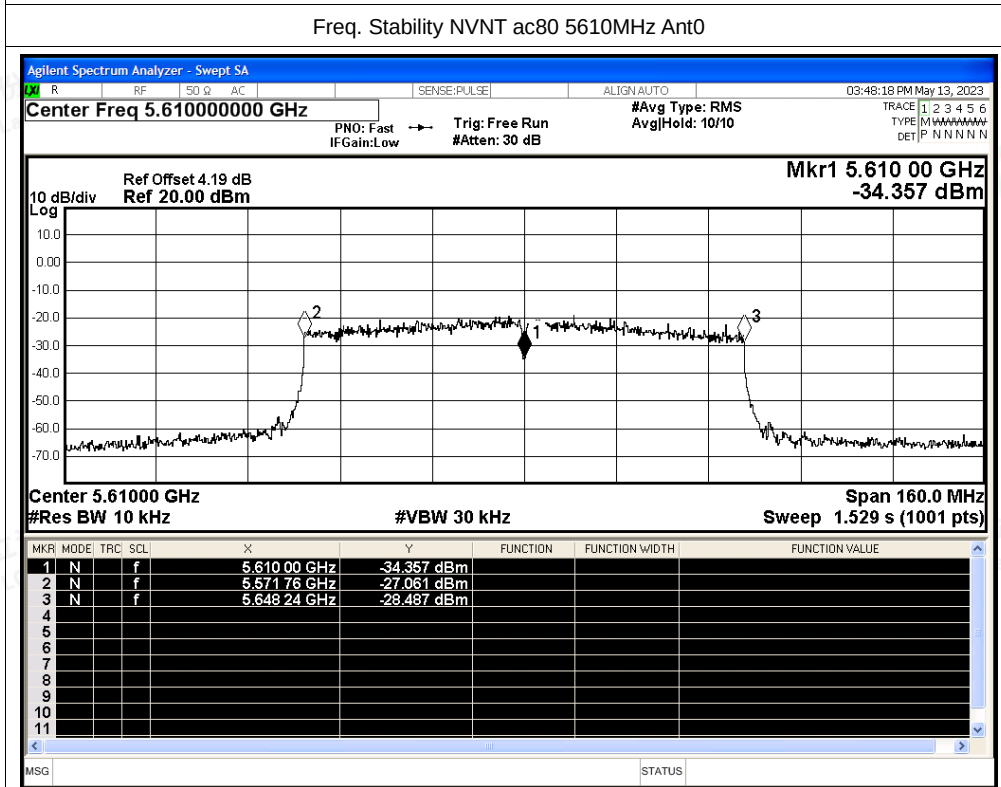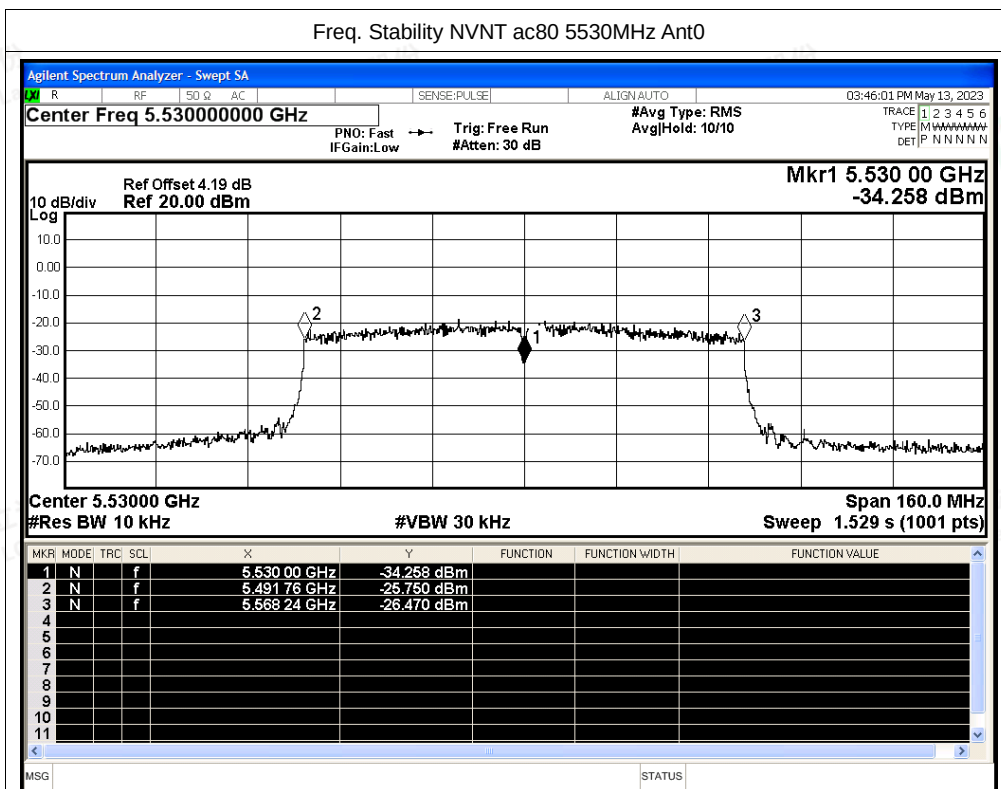




Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	ac20	5500	Ant1	5500	0	0	25	Pass
NVNT	ac20	5580	Ant1	5580	0	0	25	Pass
NVNT	ac20	5700	Ant1	5700	0	0	25	Pass
NVNT	ac40	5510	Ant1	5510	0	0	25	Pass
NVNT	ac40	5550	Ant1	5550	0	0	25	Pass
NVNT	ac40	5670	Ant1	5670	0	0	25	Pass
NVNT	ac80	5530	Ant1	5530	0	0	25	Pass
NVNT	ac80	5610	Ant1	5610	0	0	25	Pass






Test Graphs

Freq. Stability NVNT ac20 5500MHz Ant1

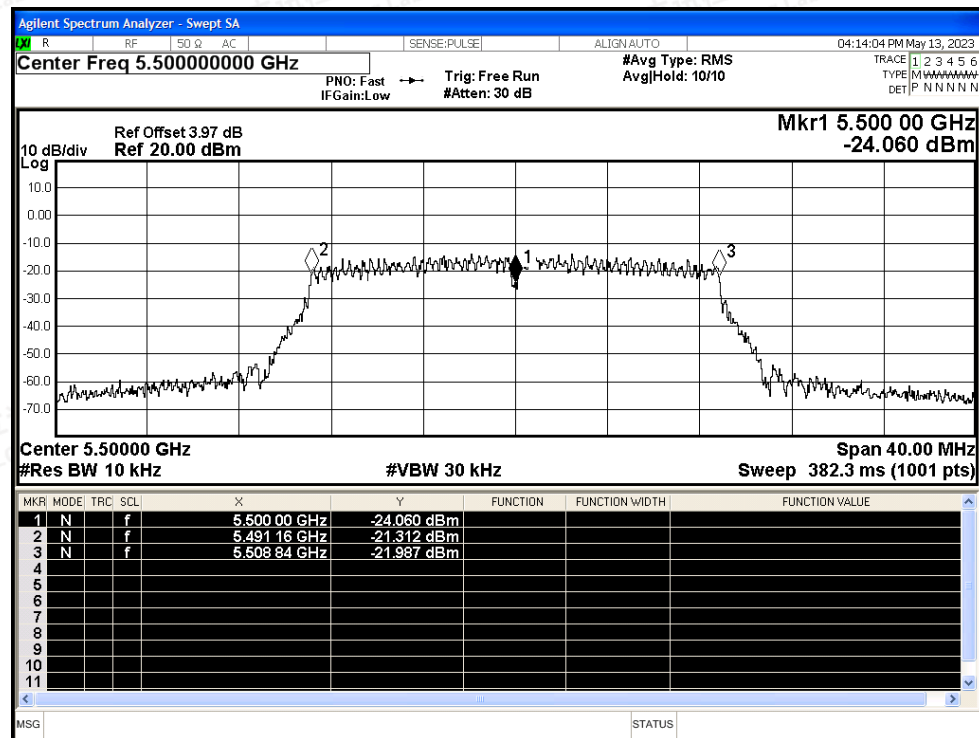

Freq. Stability NVNT ac20 5580MHz Ant1


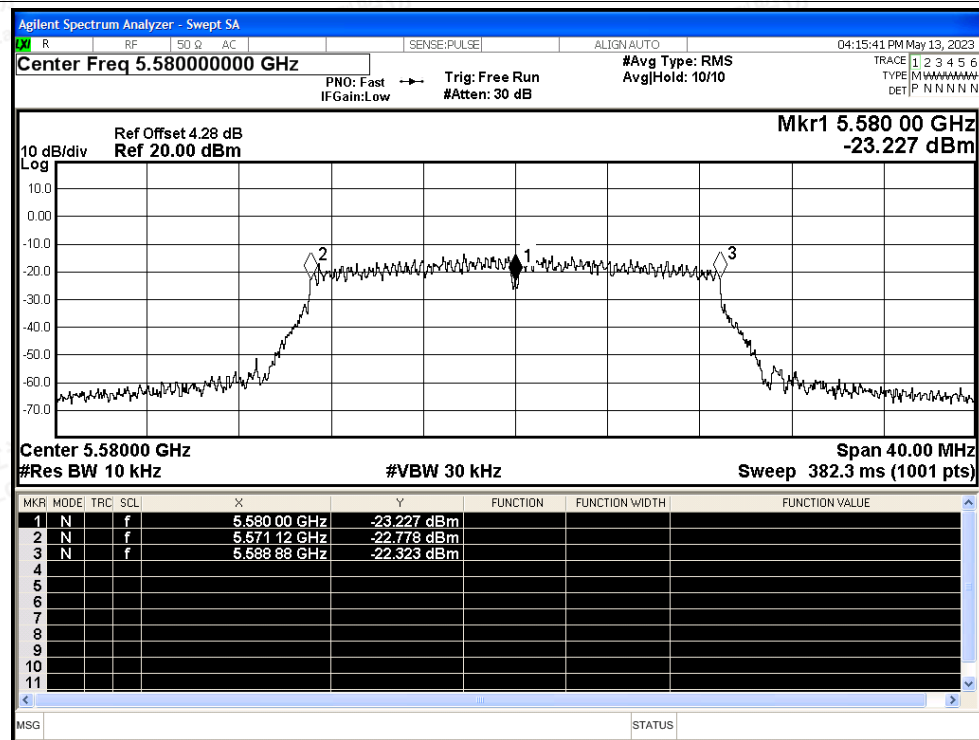


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

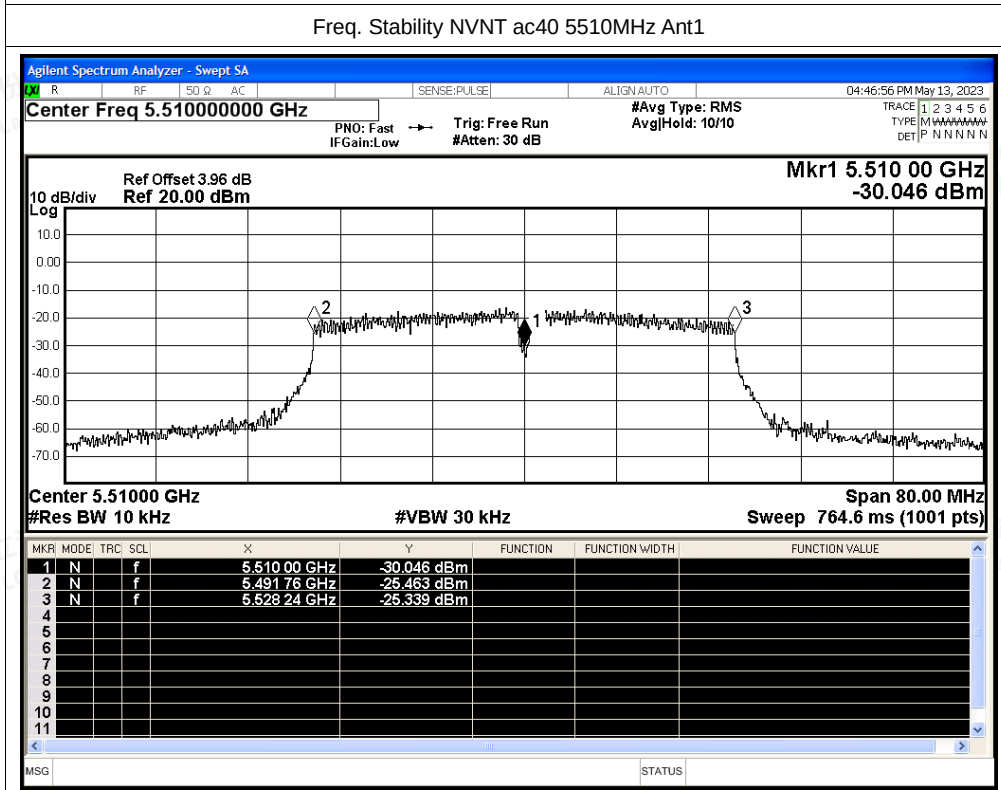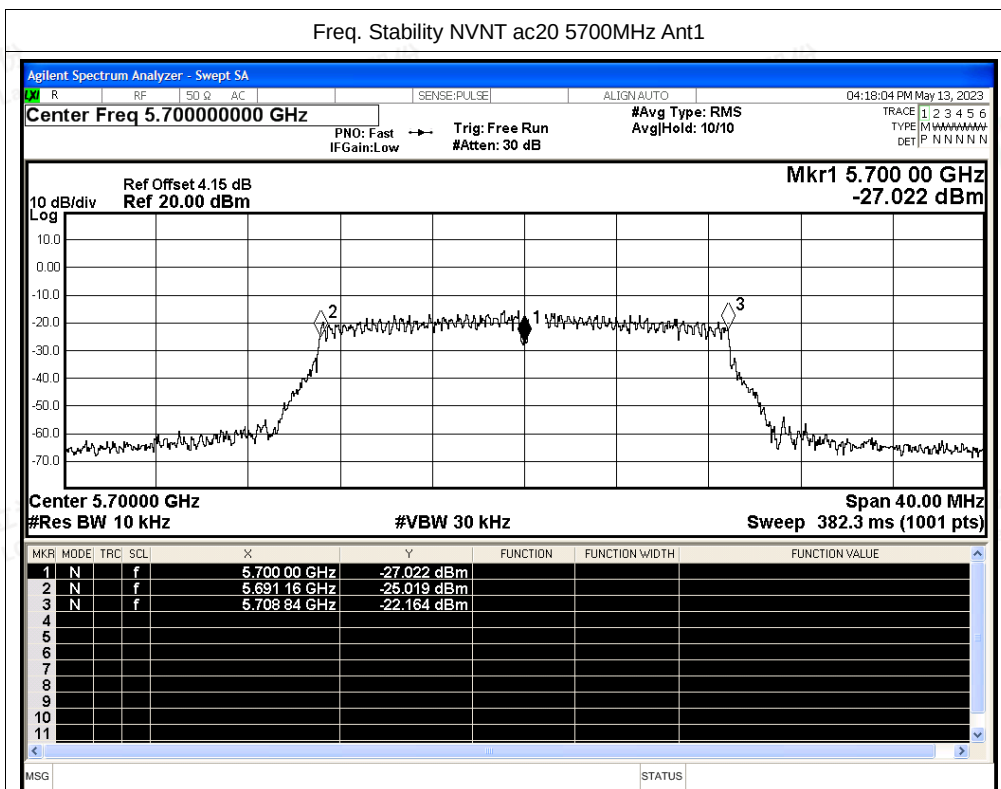






Freq. Stability NVNT ac40 5550MHz Ant1

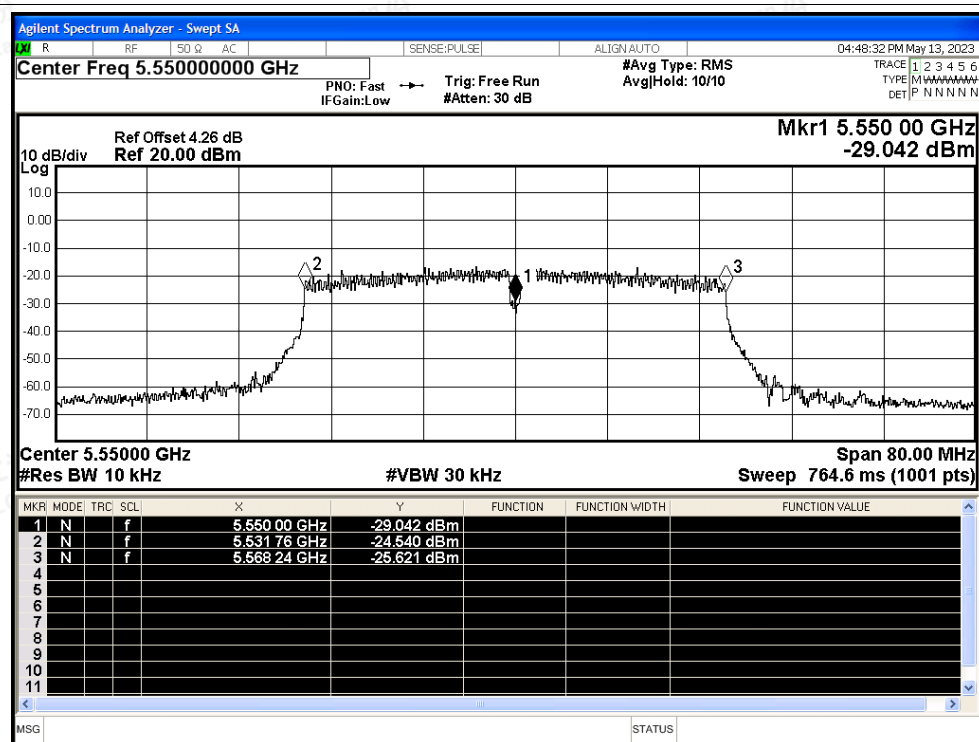

Freq. Stability NVNT ac40 5670MHz Ant1

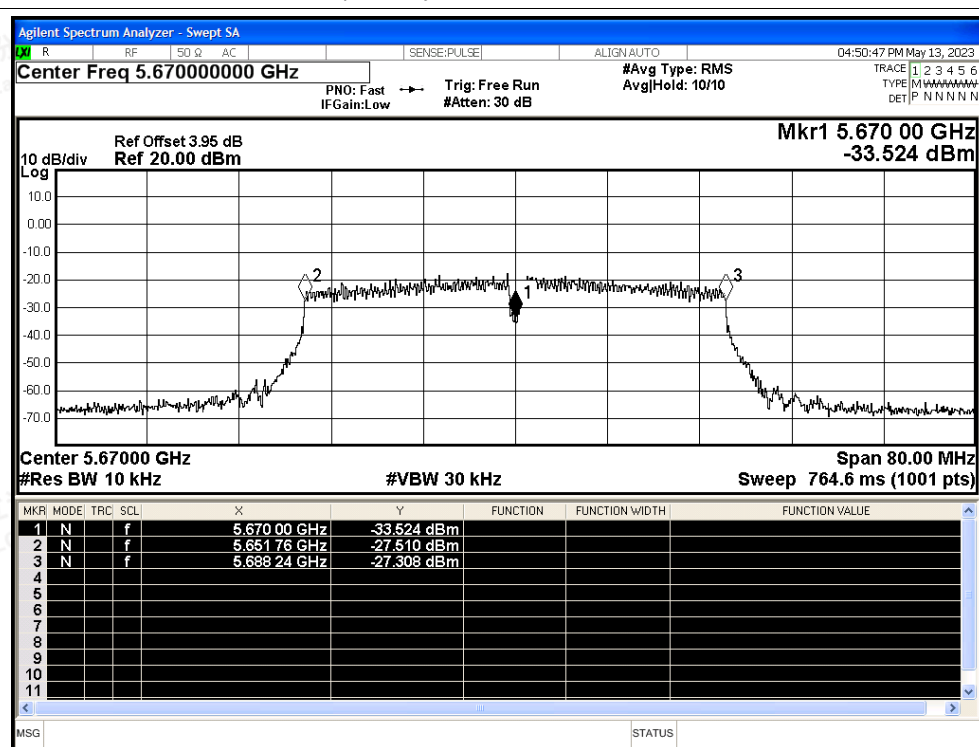

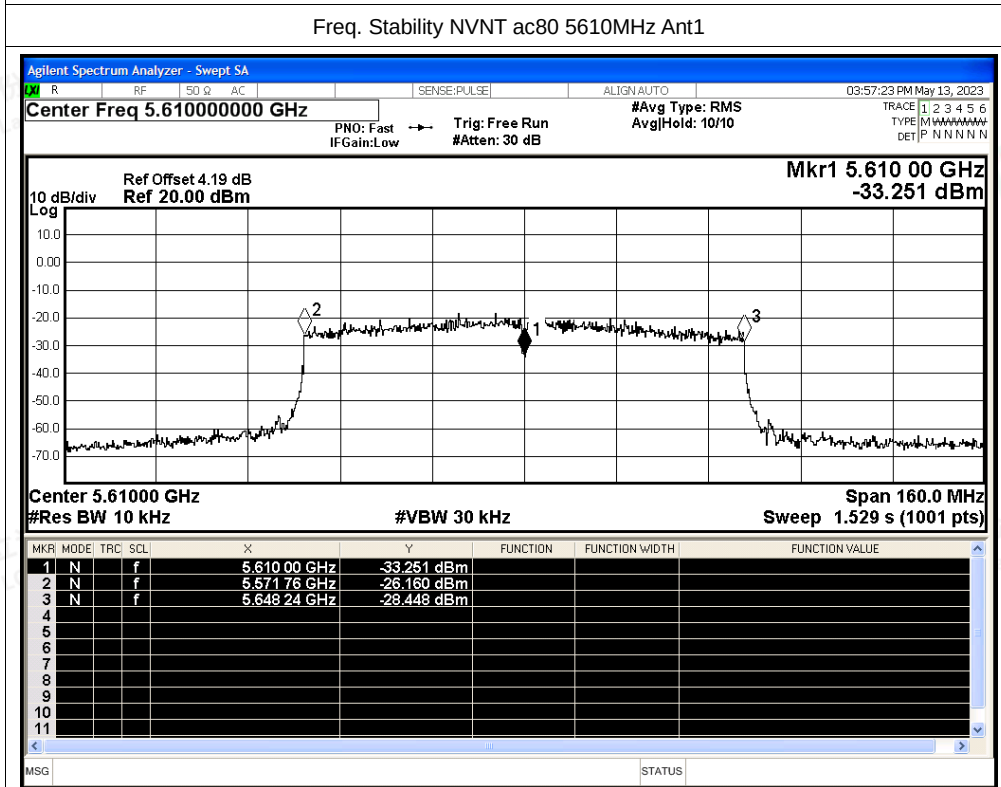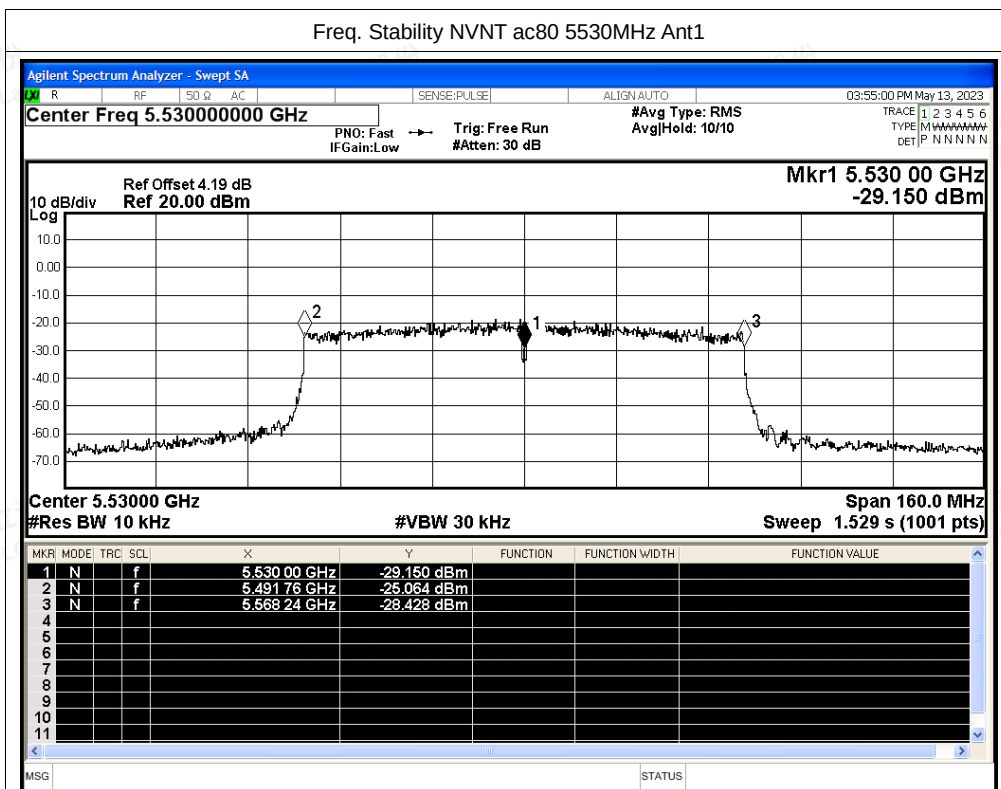



F.6 Duty Cycle


Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5500	Ant0	96.94	0.13	0.72
NVNT	a	5580	Ant0	96.94	0.13	0.72
NVNT	a	5700	Ant0	96.94	0.13	0.72
NVNT	n20	5500	Ant0	96.65	0.15	0.77
NVNT	n20	5580	Ant0	96.73	0.14	0.77
NVNT	n20	5700	Ant0	96.73	0.14	0.77
NVNT	n40	5510	Ant0	93.79	0.28	1.54
NVNT	n40	5550	Ant0	93.79	0.28	1.54
NVNT	n40	5670	Ant0	93.64	0.29	1.54
NVNT	ac20	5500	Ant0	96.76	0.14	0.76
NVNT	ac20	5580	Ant0	96.76	0.14	0.76
NVNT	ac20	5700	Ant0	96.76	0.14	0.76
NVNT	ac40	5510	Ant0	93.68	0.28	1.53
NVNT	ac40	5550	Ant0	93.68	0.28	1.53
NVNT	ac40	5670	Ant0	93.69	0.28	1.53
NVNT	ac80	5530	Ant0	88.08	0.55	3.08
NVNT	ac80	5610	Ant0	88.04	0.55	3.09






Test Graphs

Duty Cycle NVNT a 5500MHz Ant0

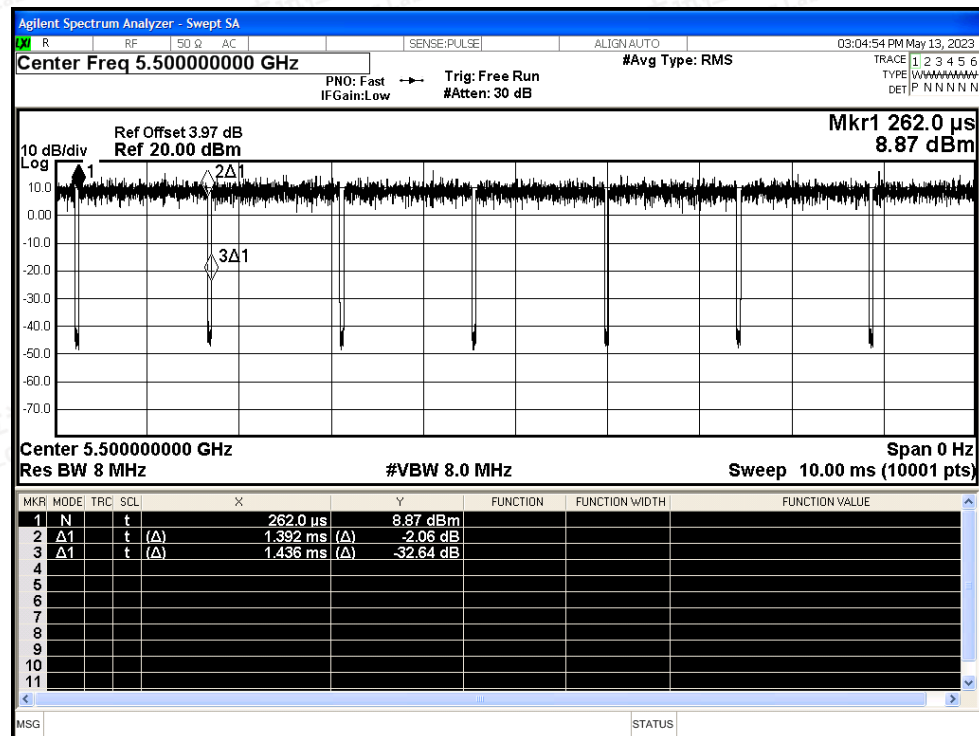

Duty Cycle NVNT a 5580MHz Ant0


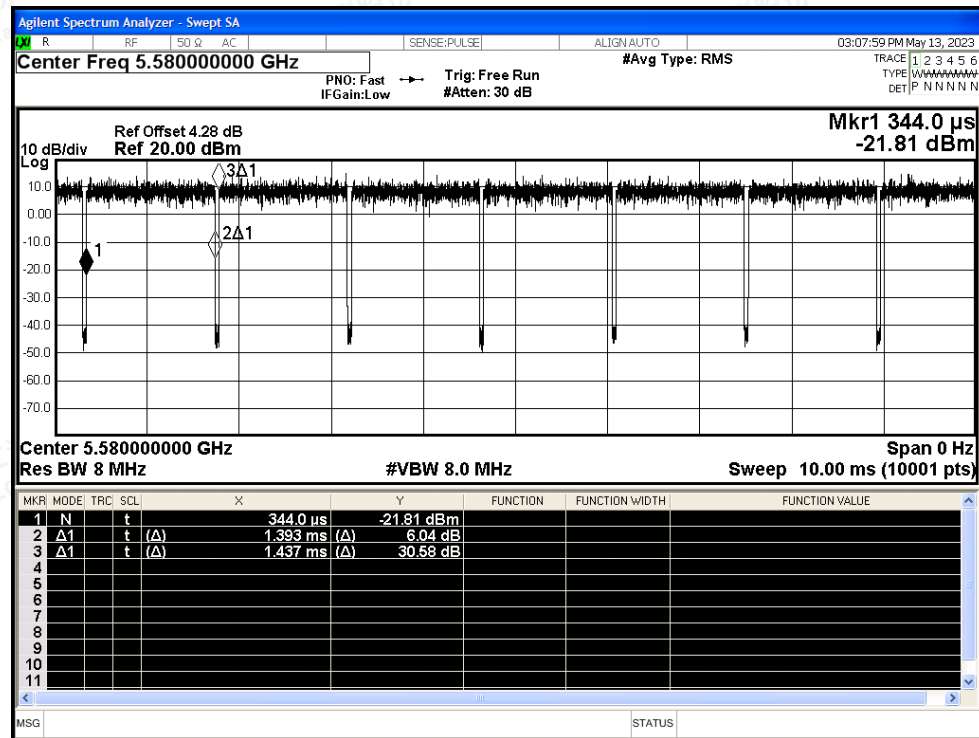


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

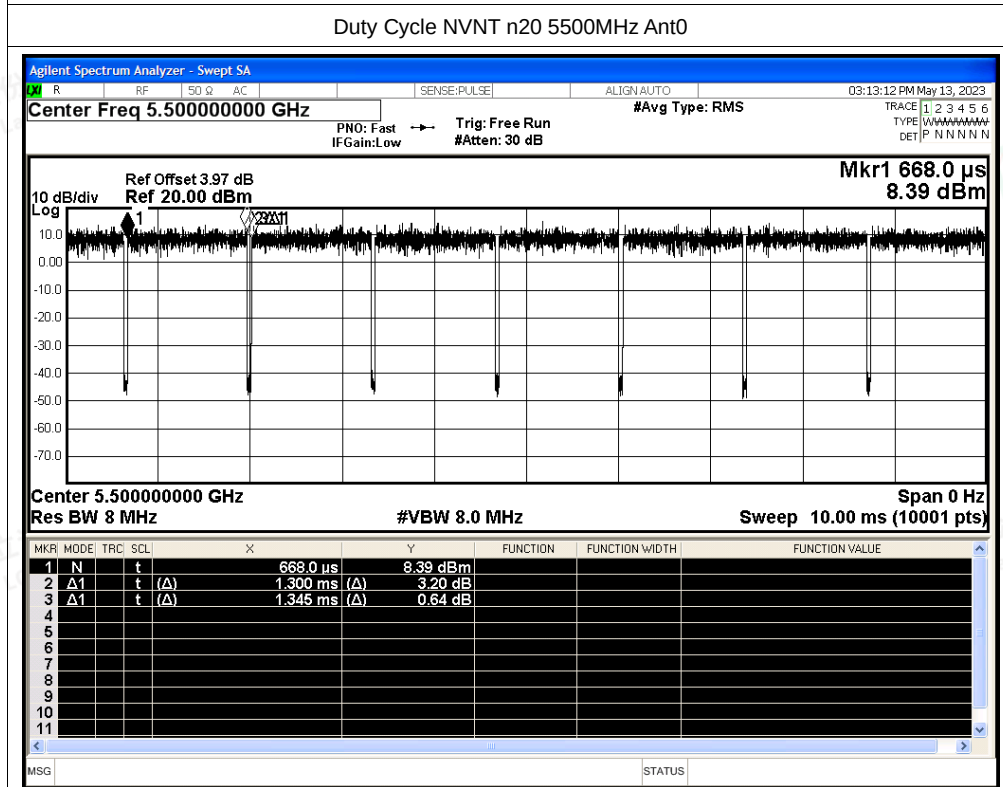
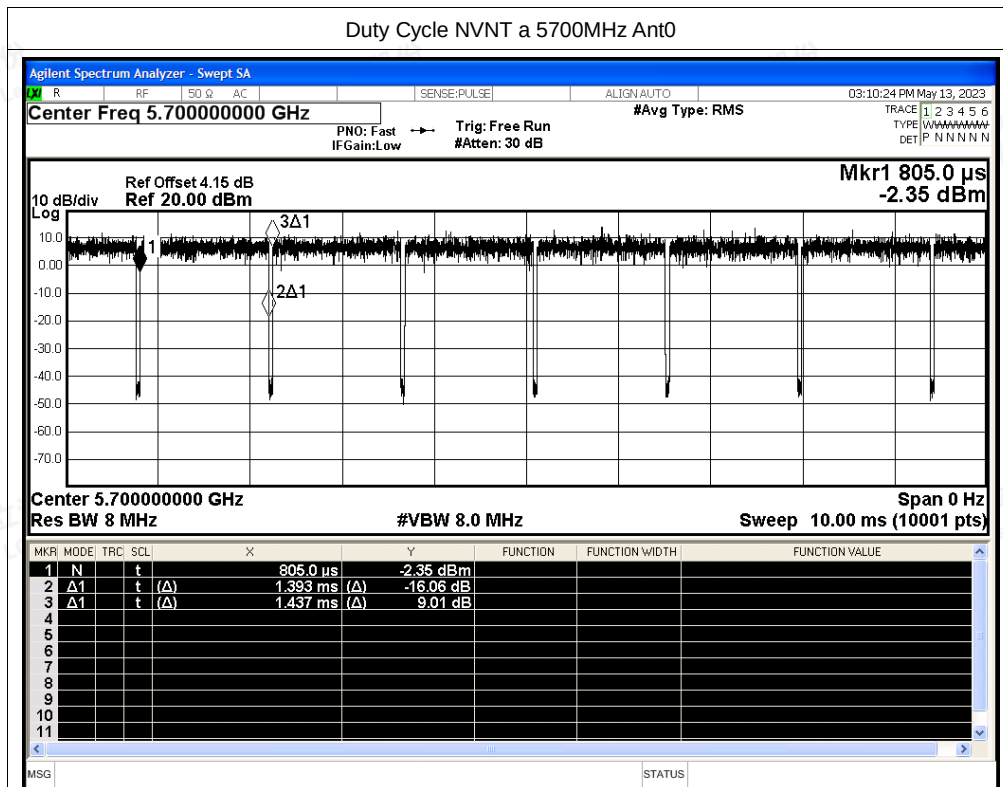




Shenzhen LCS Compliance Testing Laboratory Ltd.



Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

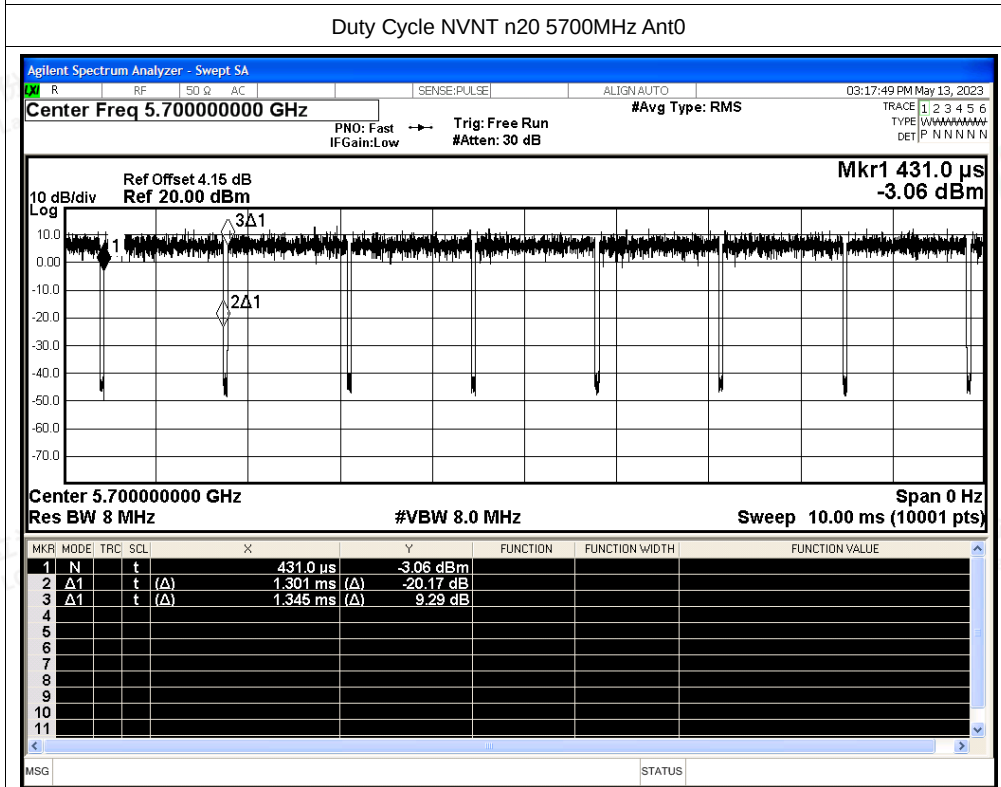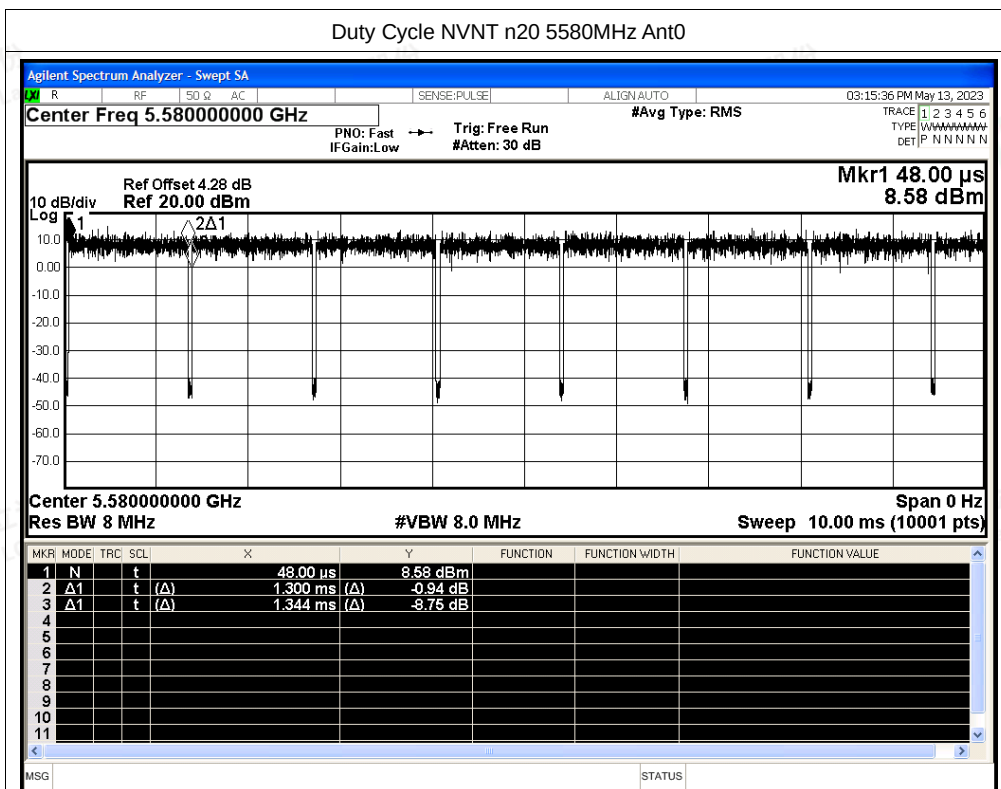

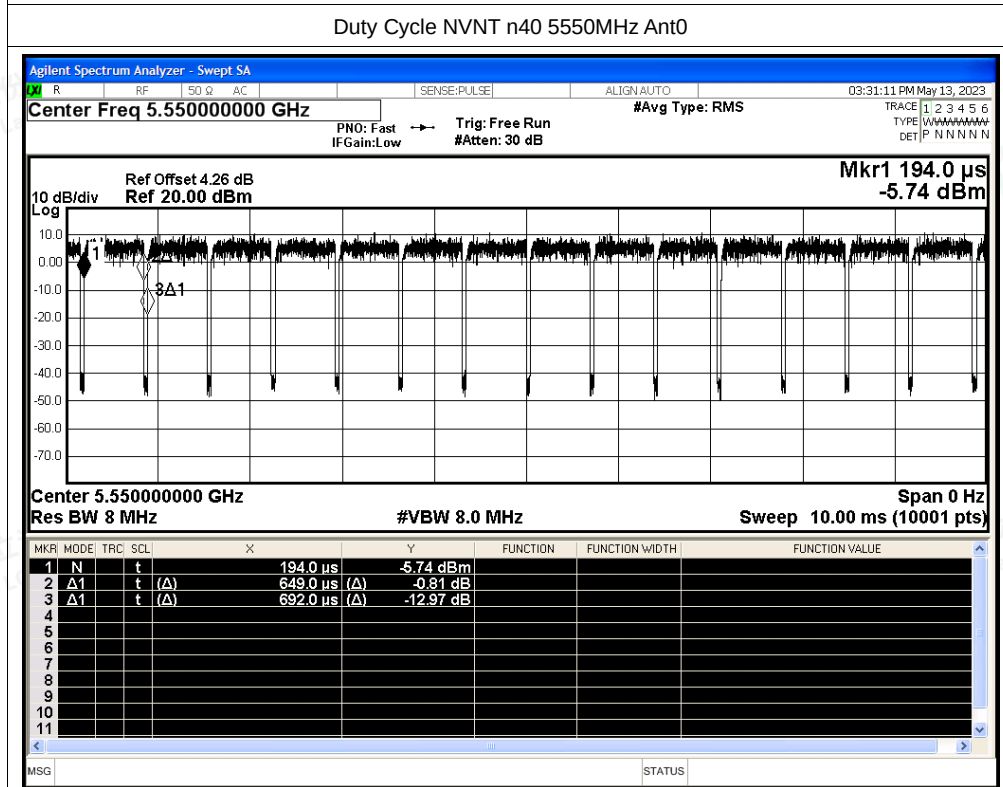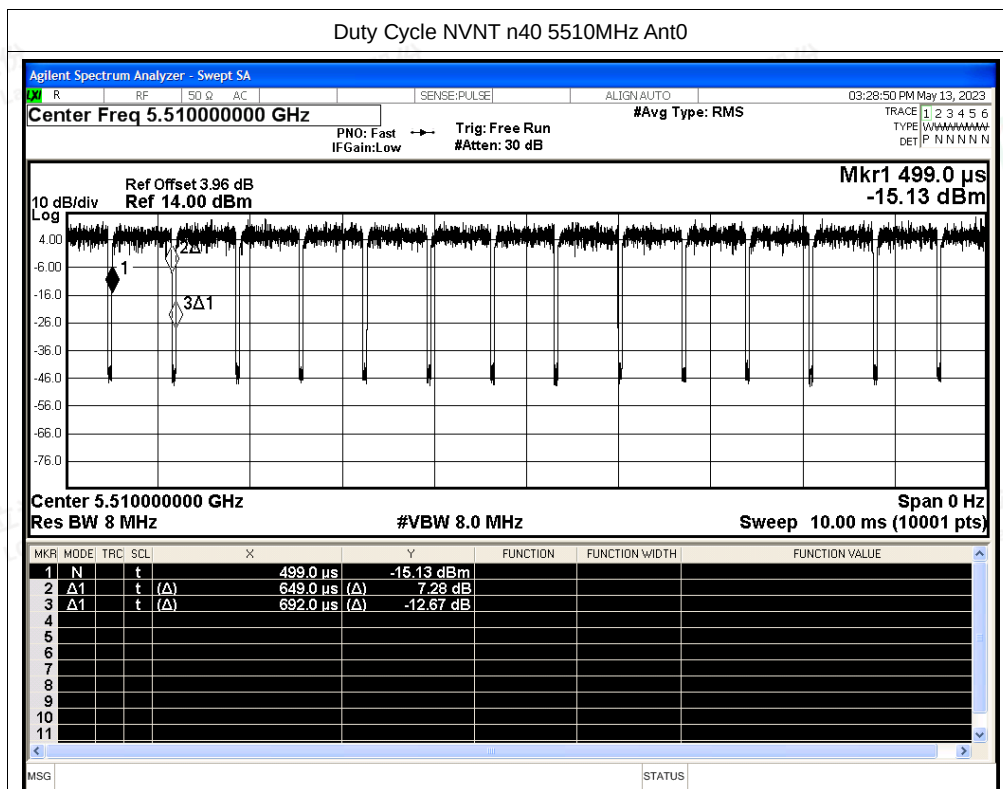

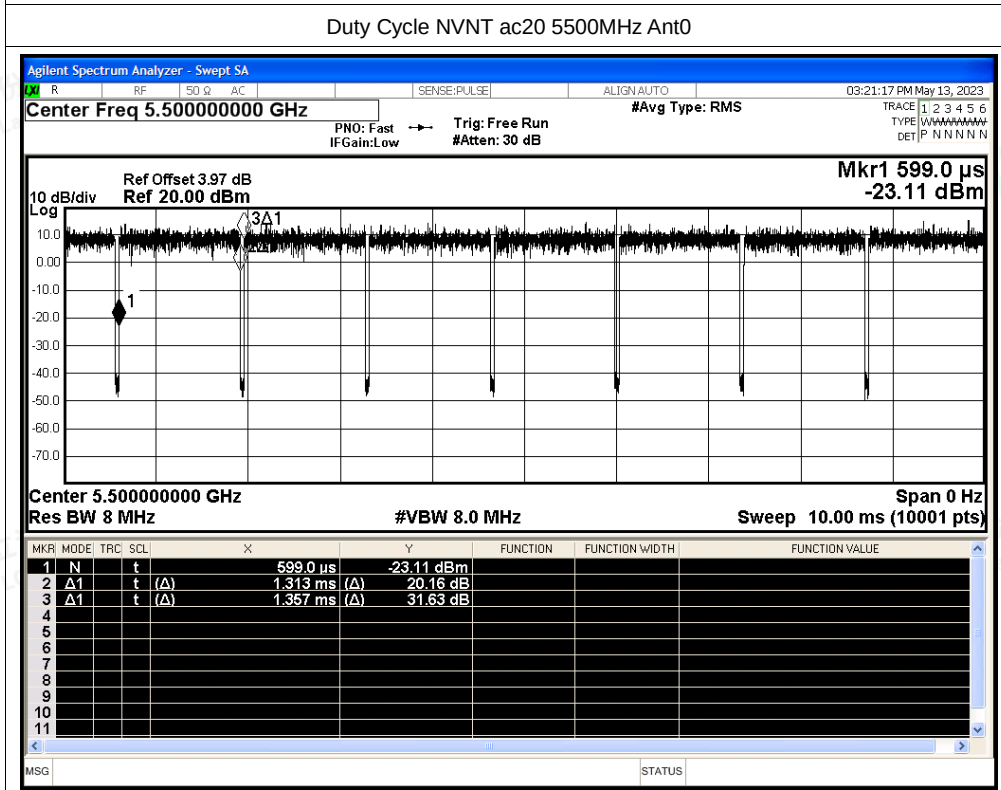
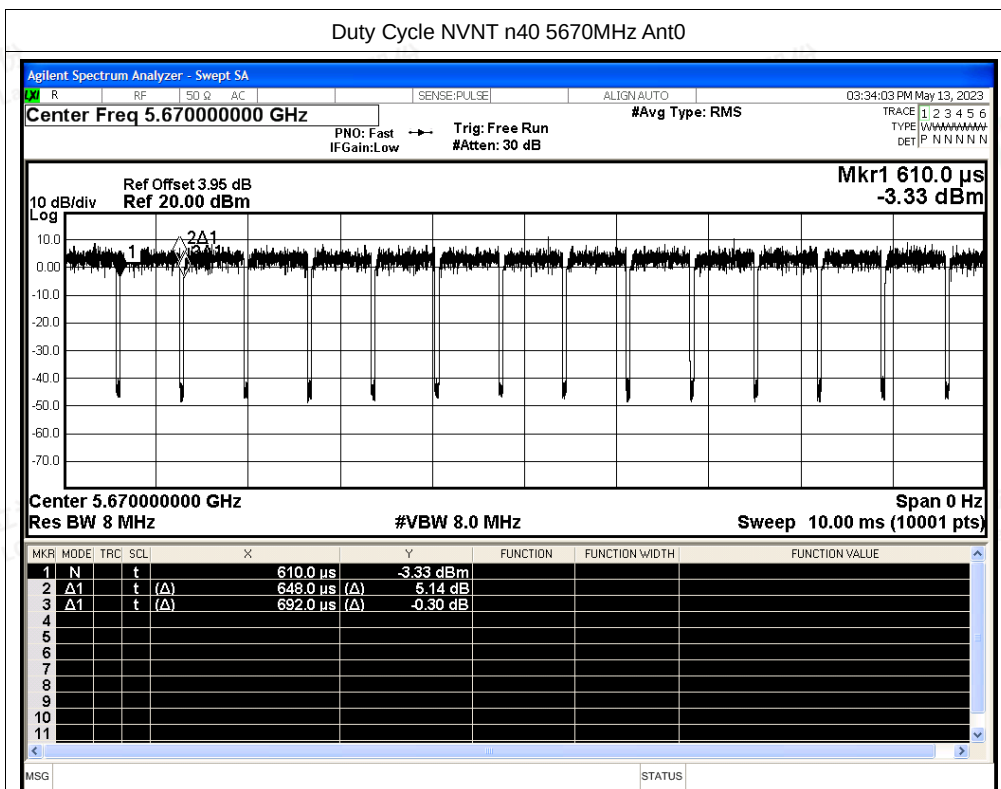


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

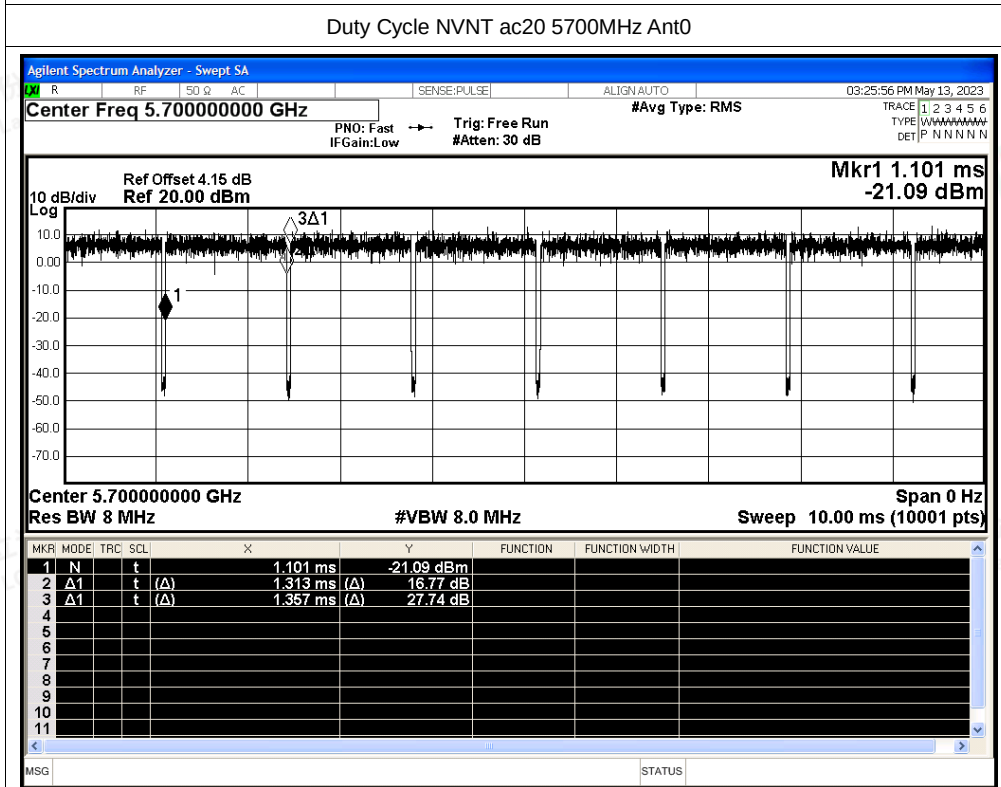
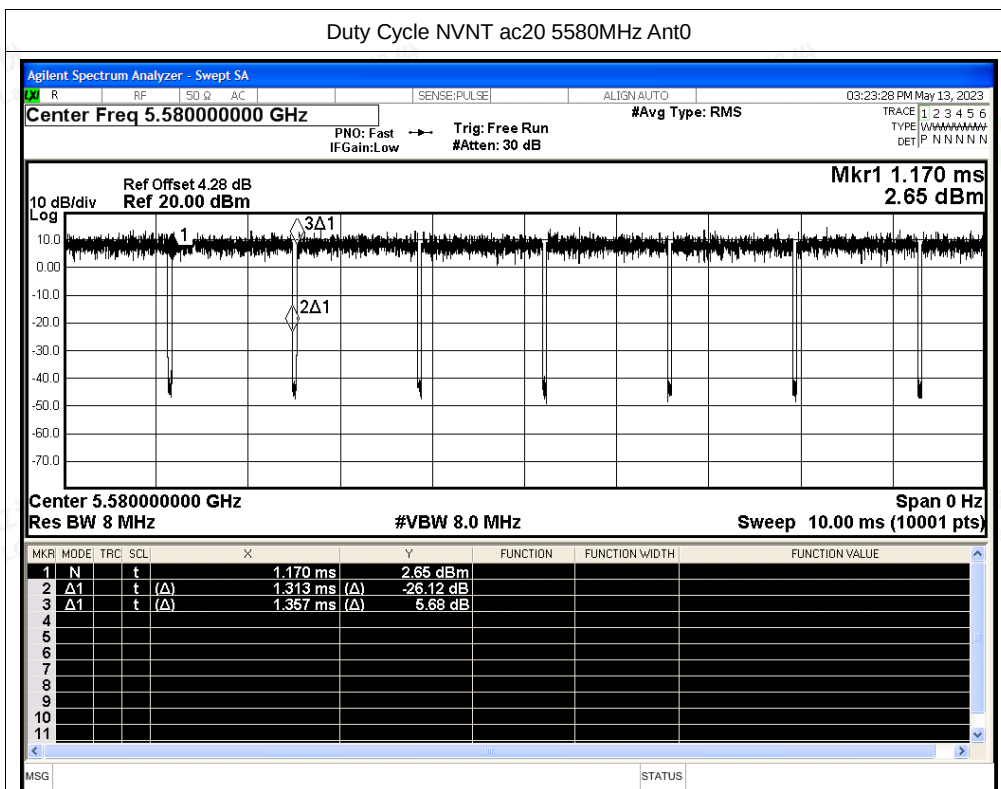




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

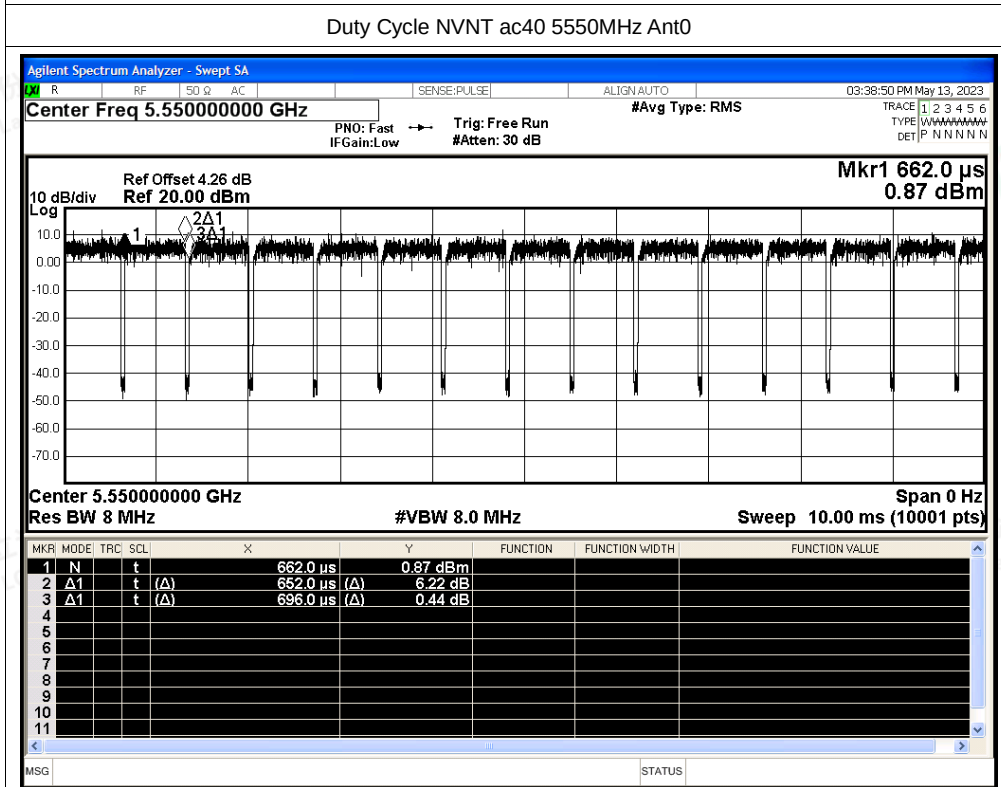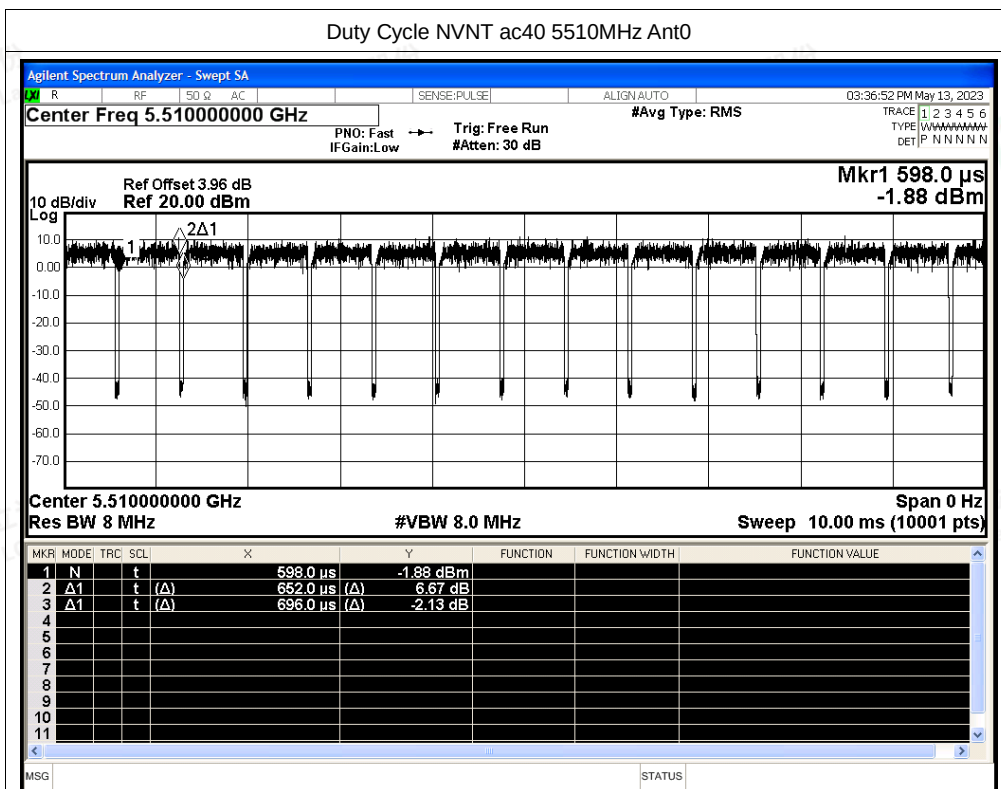

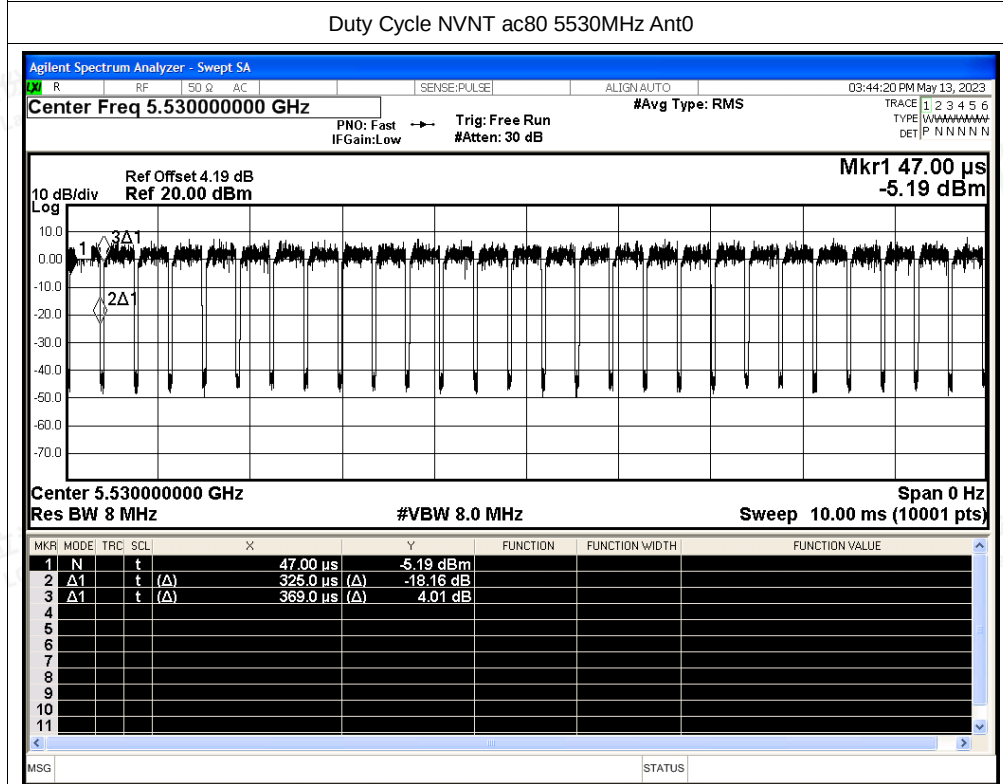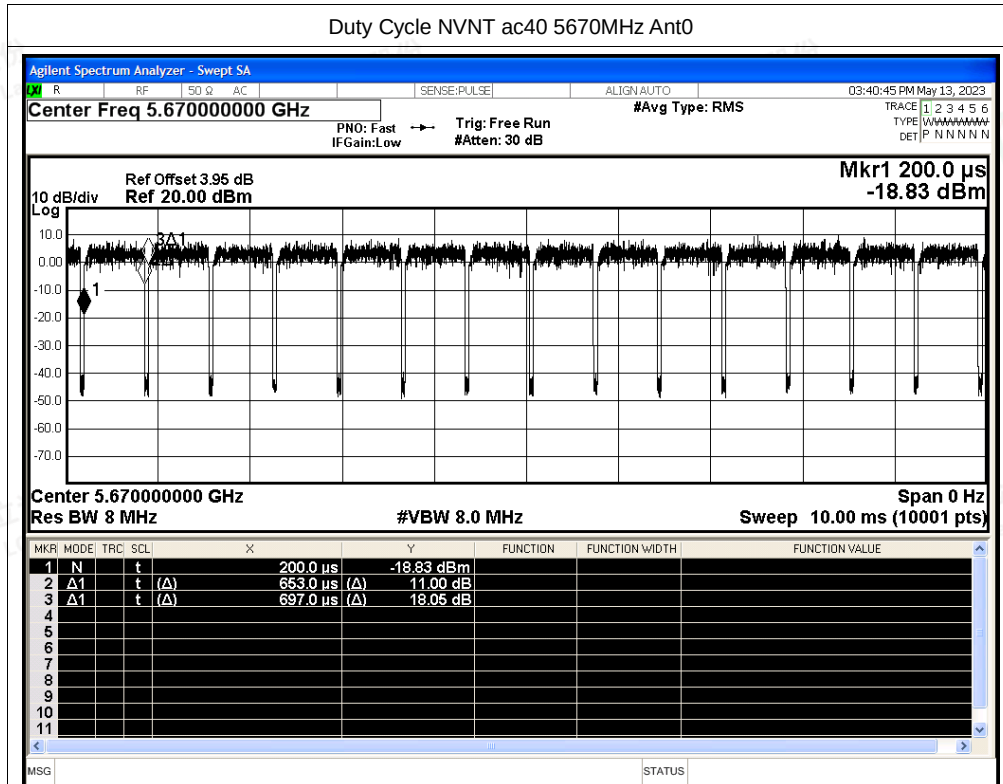


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

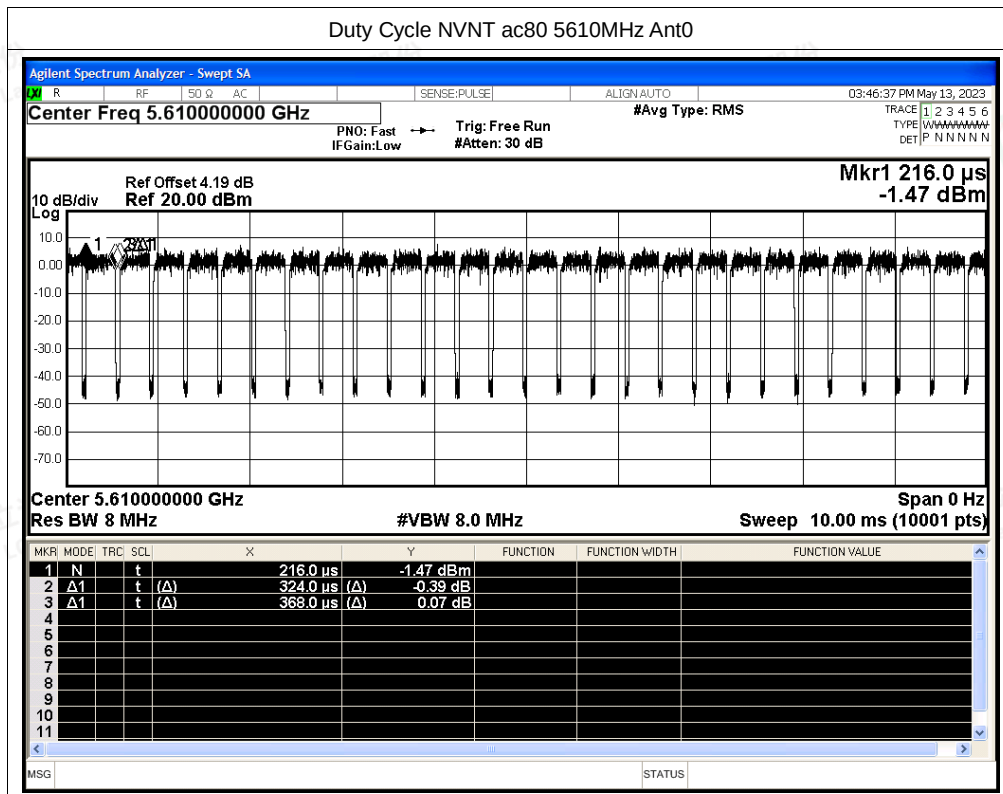




Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5500	Ant1	96.87	0.14	0.72
NVNT	a	5580	Ant1	96.94	0.13	0.72
NVNT	a	5700	Ant1	96.94	0.13	0.72
NVNT	n20	5500	Ant1	96.73	0.14	0.77
NVNT	n20	5580	Ant1	96.73	0.14	0.77
NVNT	n20	5700	Ant1	96.73	0.14	0.77
NVNT	n40	5510	Ant1	93.93	0.27	1.54
NVNT	n40	5550	Ant1	93.64	0.29	1.54
NVNT	n40	5670	Ant1	93.64	0.29	1.54
NVNT	ac20	5500	Ant1	96.76	0.14	0.76
NVNT	ac20	5580	Ant1	96.76	0.14	0.76
NVNT	ac20	5700	Ant1	96.76	0.14	0.76
NVNT	ac40	5510	Ant1	93.68	0.28	1.53
NVNT	ac40	5550	Ant1	93.68	0.28	1.53
NVNT	ac40	5670	Ant1	93.68	0.28	1.53
NVNT	ac80	5530	Ant1	88.04	0.55	3.09
NVNT	ac80	5610	Ant1	88.04	0.55	3.09






Test Graphs

Duty Cycle NVNT a 5500MHz Ant1

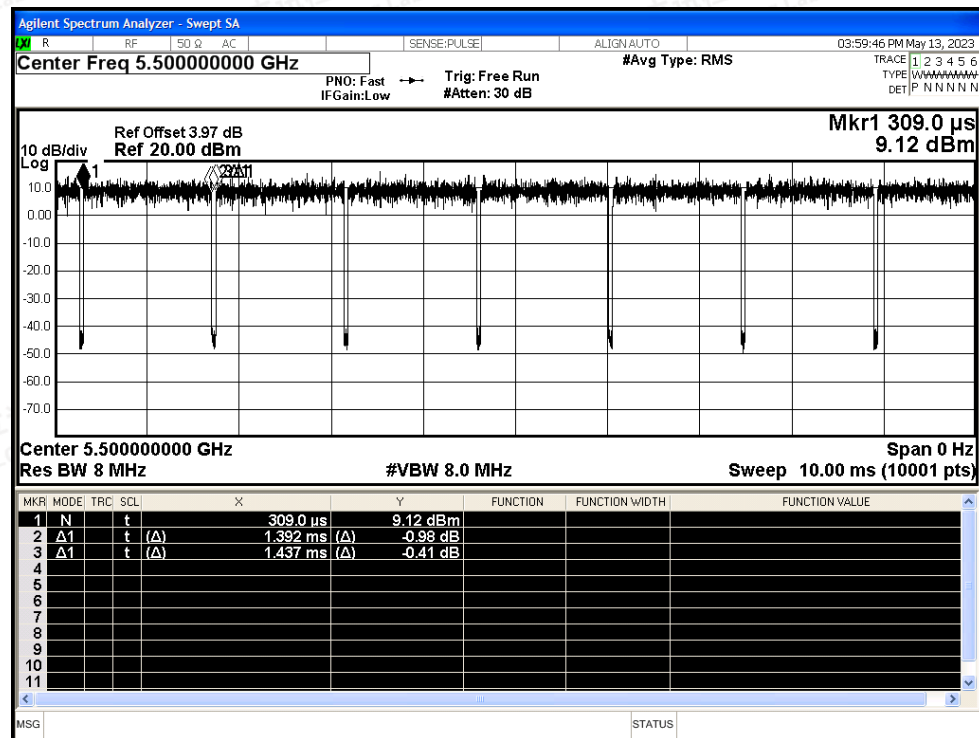

Duty Cycle NVNT a 5580MHz Ant1


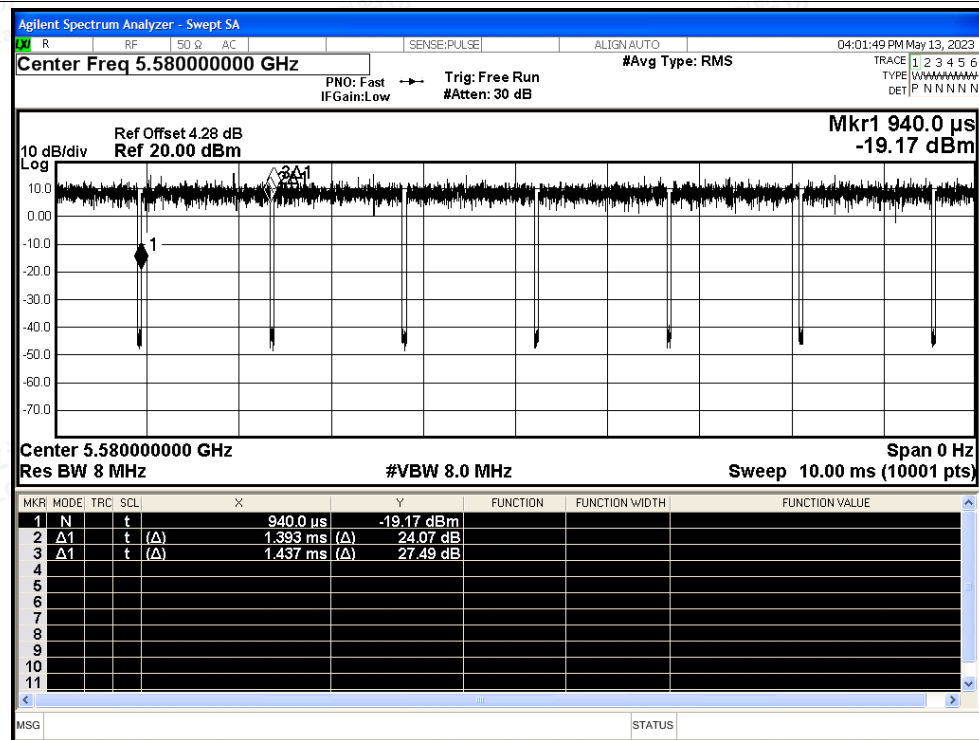


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

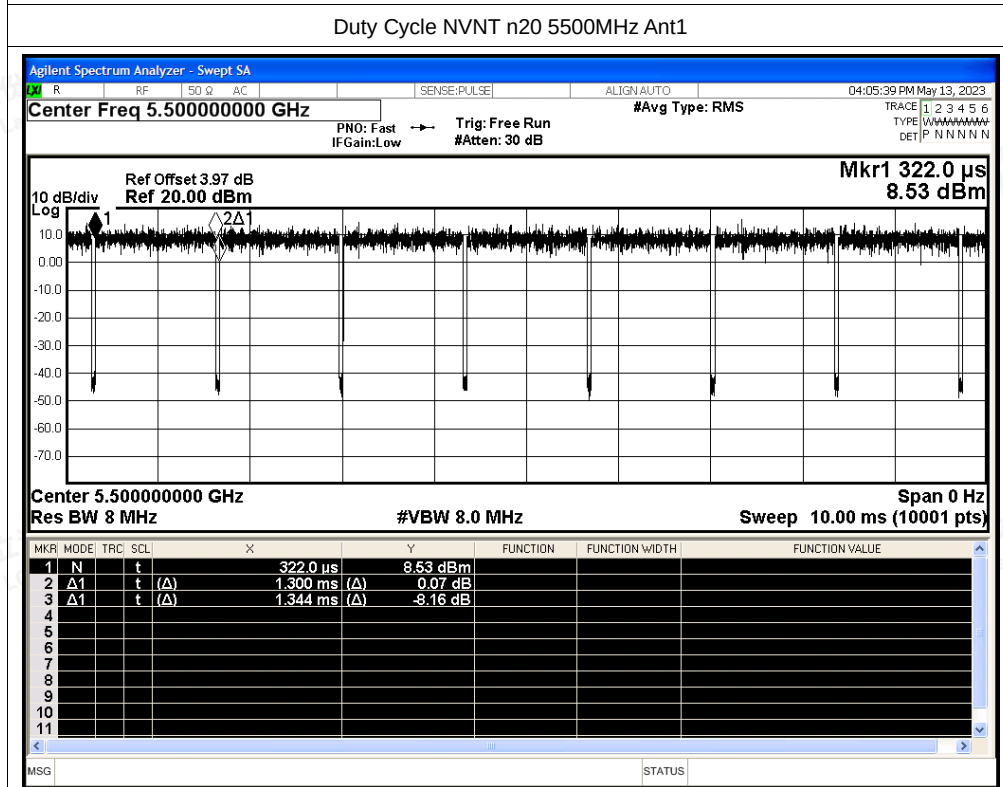
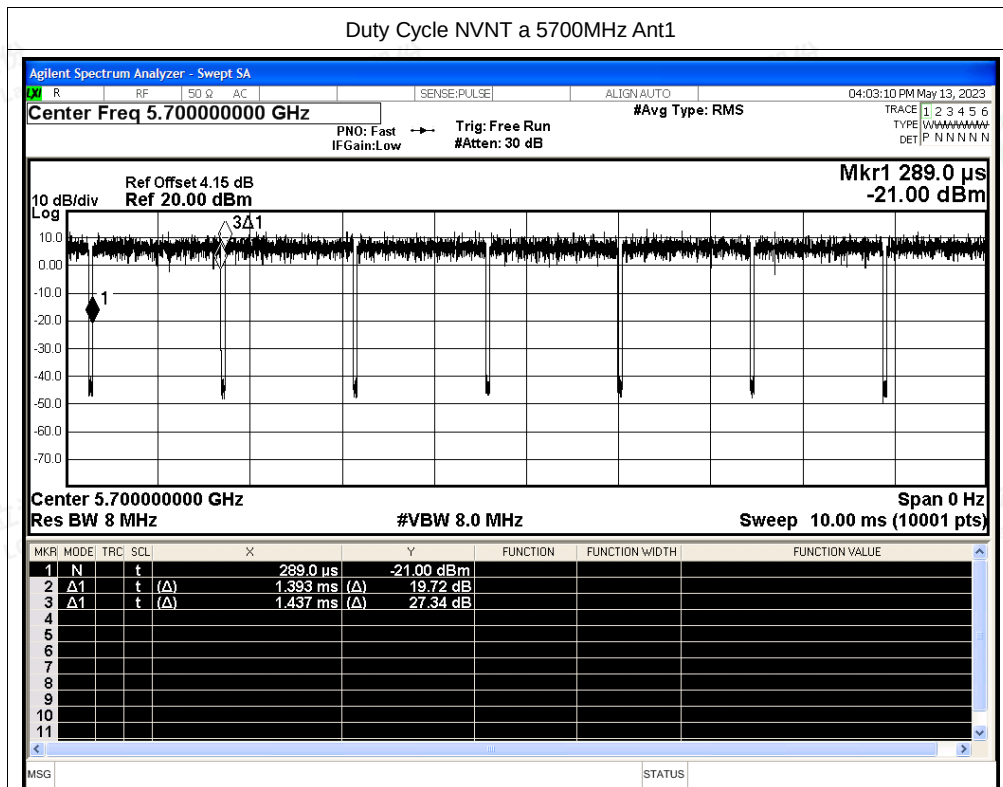




Shenzhen LCS Compliance Testing Laboratory Ltd.



Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China



Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com



Scan code to check authenticity

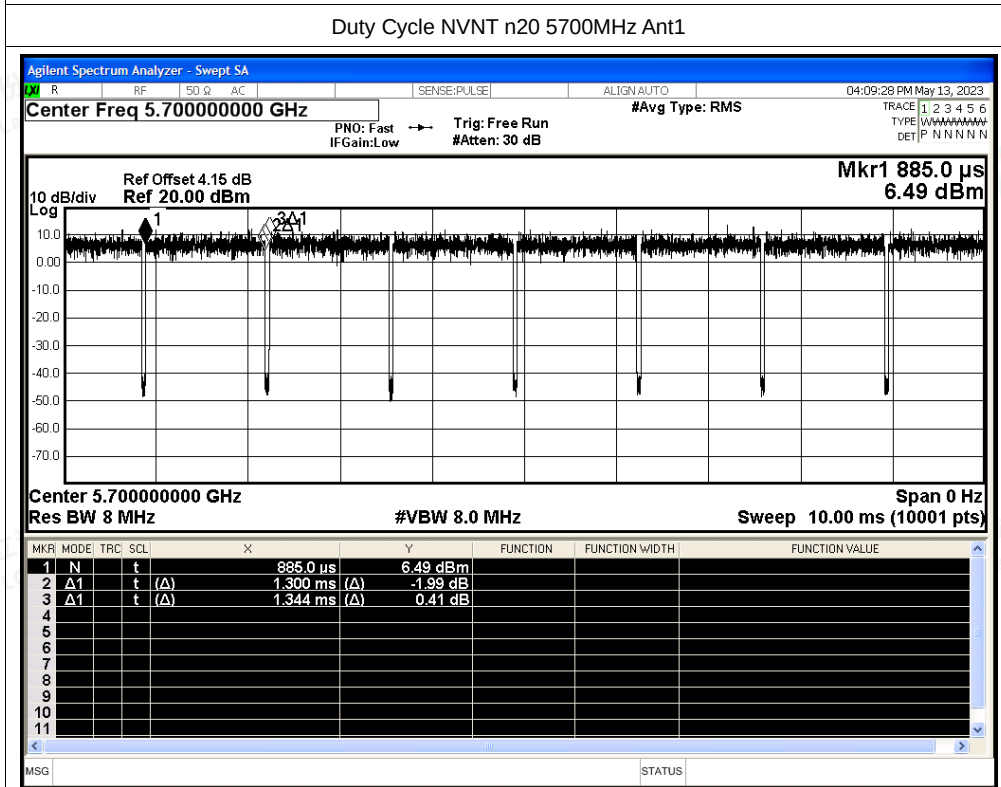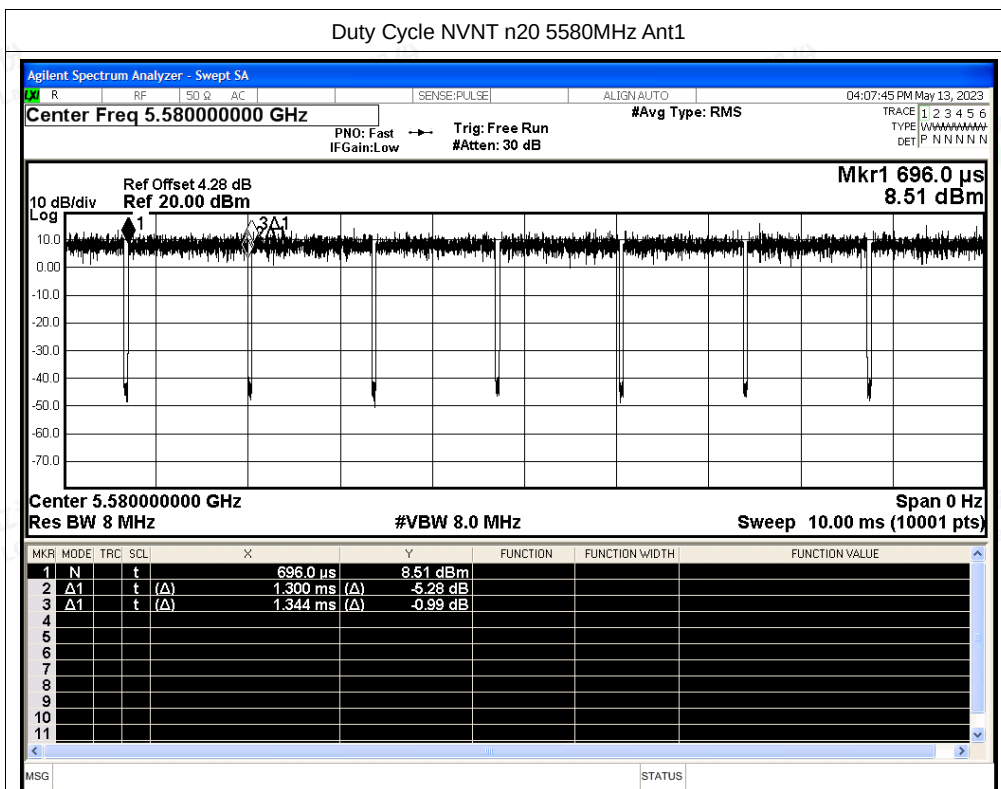

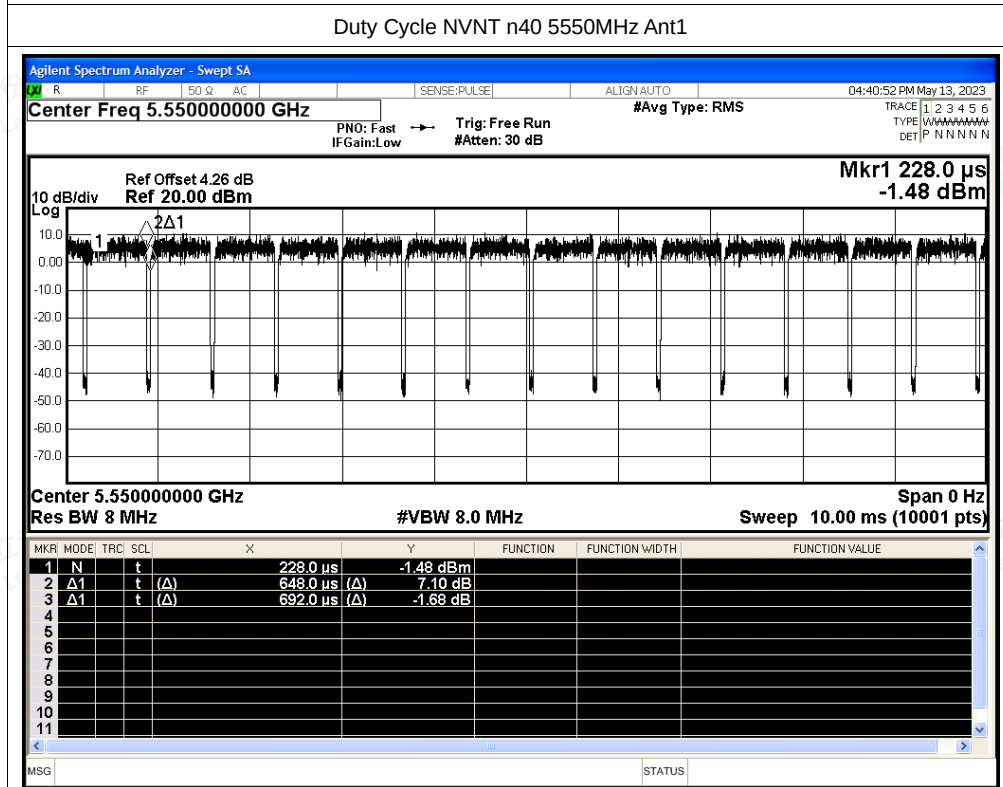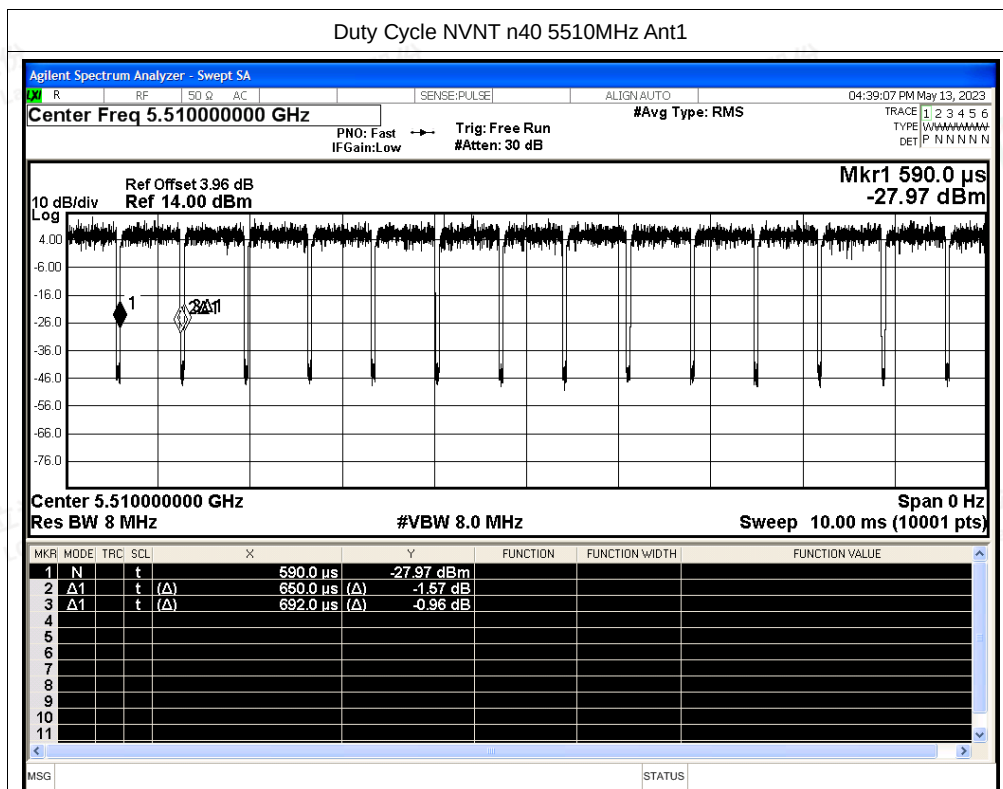

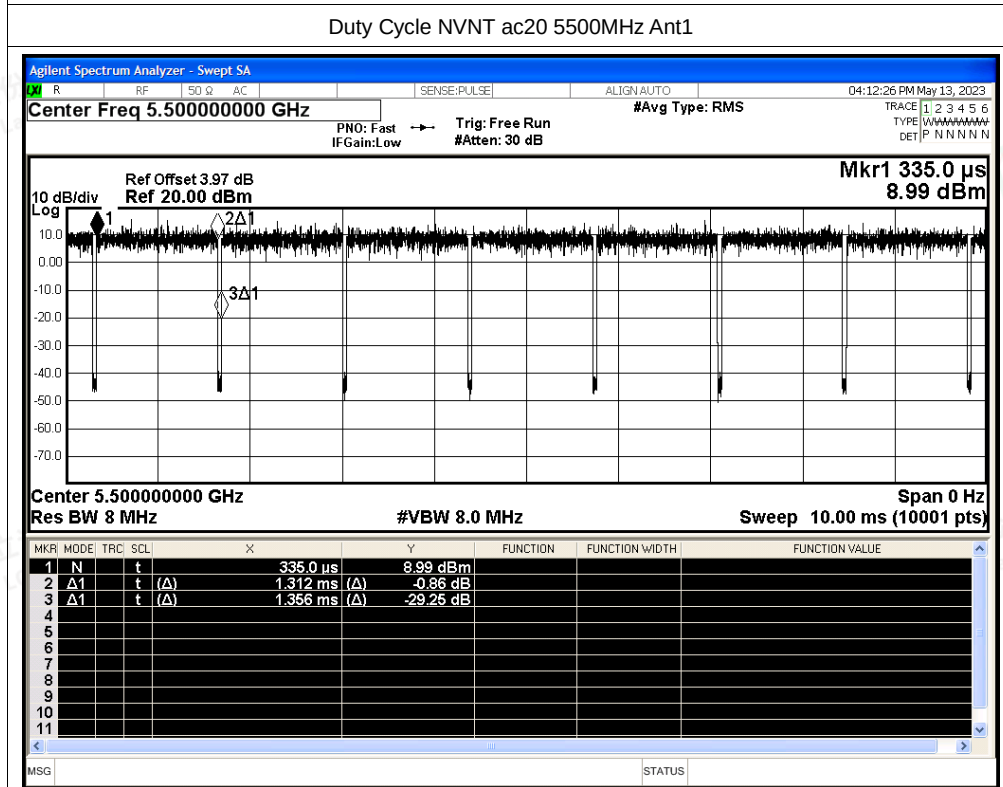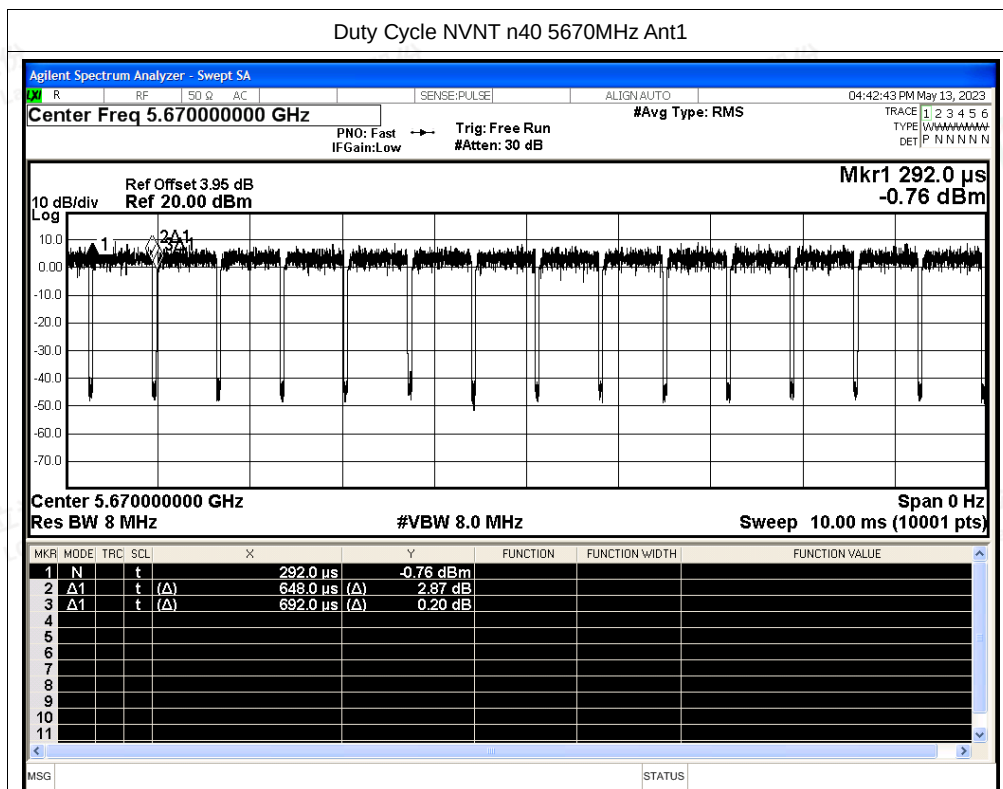

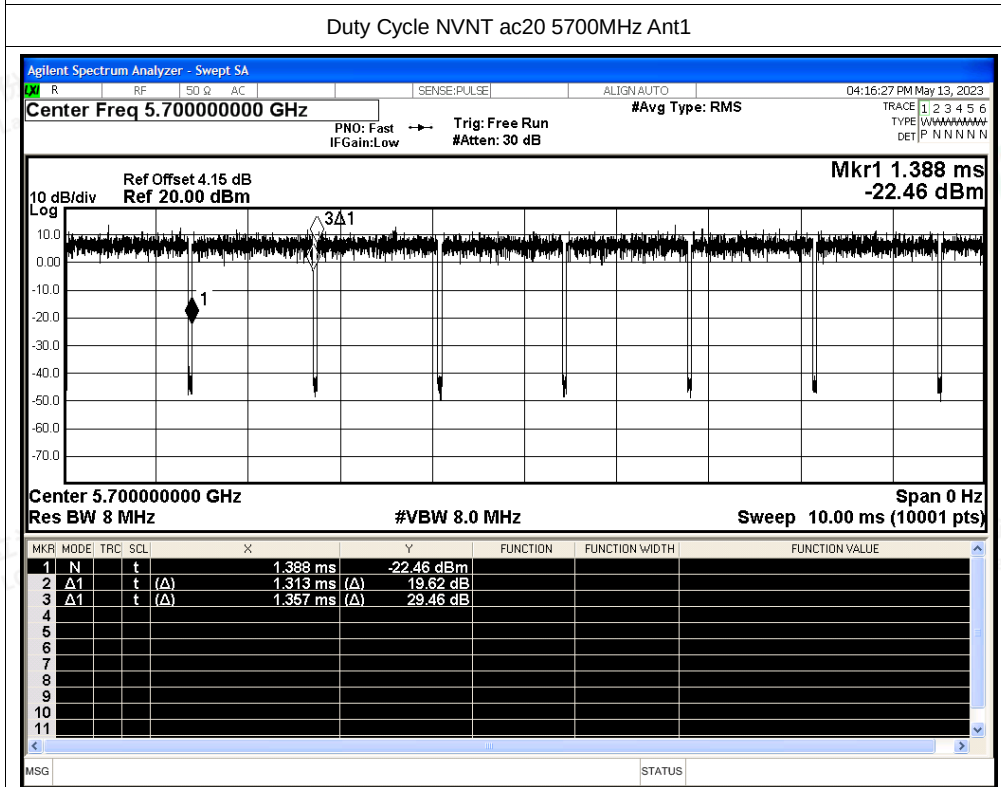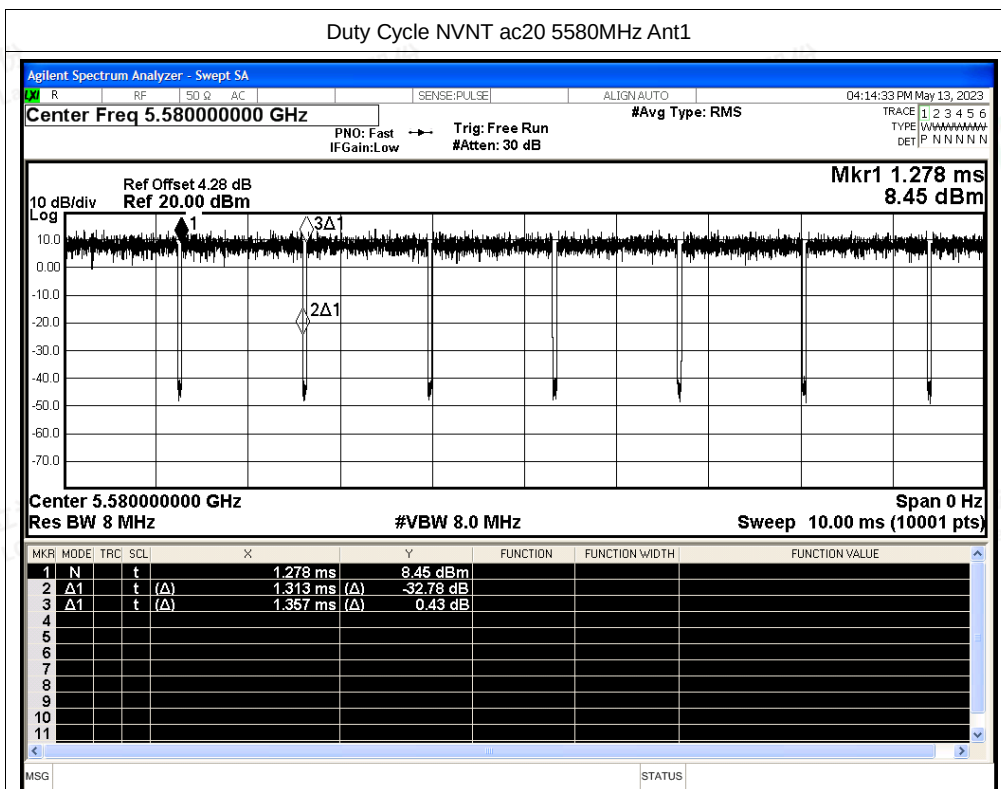

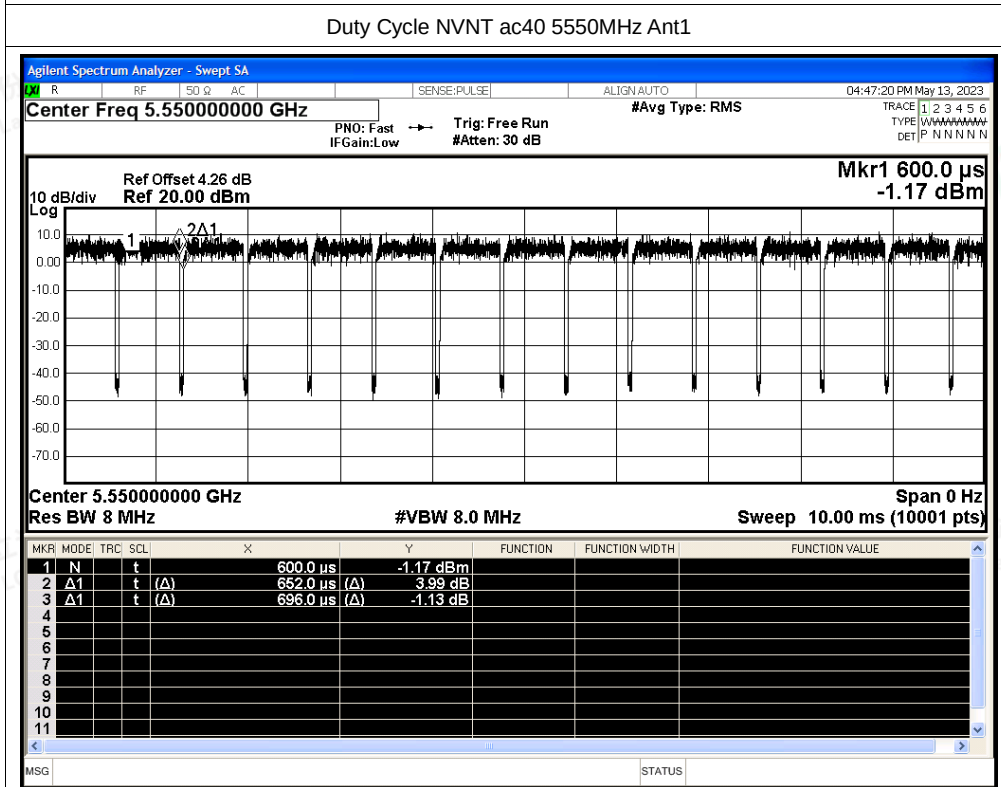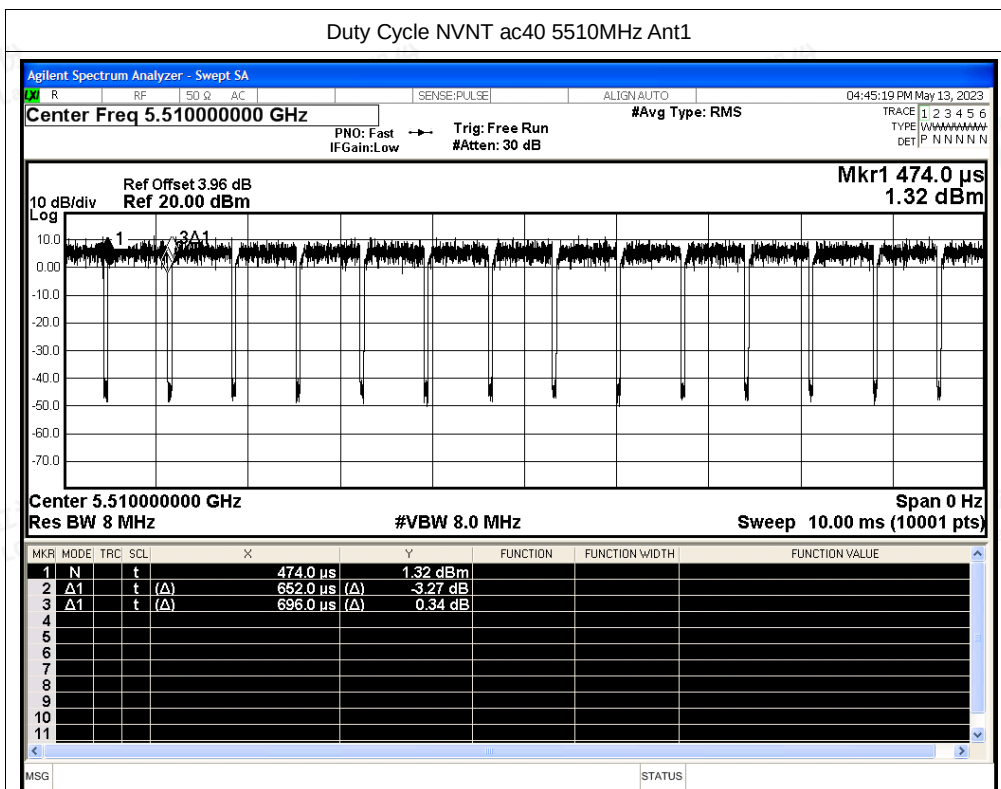

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

