



		5320	12.14	≤ 23.98	PASS
		5500	14.17	≤ 23.98	PASS
		5580	14.03	≤ 23.98	PASS
		5700	13.16	≤ 23.98	PASS
		5745	13.96	≤ 30	PASS
		5785	12.46	≤ 30	PASS
		5825	12.19	≤ 30	PASS
11AC40SISO	Ant1	5190	9.80	≤ 23.98	PASS
		5230	9.60	≤ 23.98	PASS
		5270	8.97	≤ 23.98	PASS
		5310	8.39	≤ 23.98	PASS
		5510	10.68	≤ 23.98	PASS
		5550	11.38	≤ 23.98	PASS
		5670	11.82	≤ 23.98	PASS
		5755	12.39	≤ 30	PASS
		5795	12.18	≤ 30	PASS
11AC80SISO	Ant1	5210	9.72	≤ 23.98	PASS
		5290	8.49	≤ 23.98	PASS
		5530	10.64	≤ 23.98	PASS
		5610	11.43	≤ 23.98	PASS
		5775	12.18	≤ 30	PASS

Note: The Duty Cycle Factor is compensated in the graph.


Test Graphs

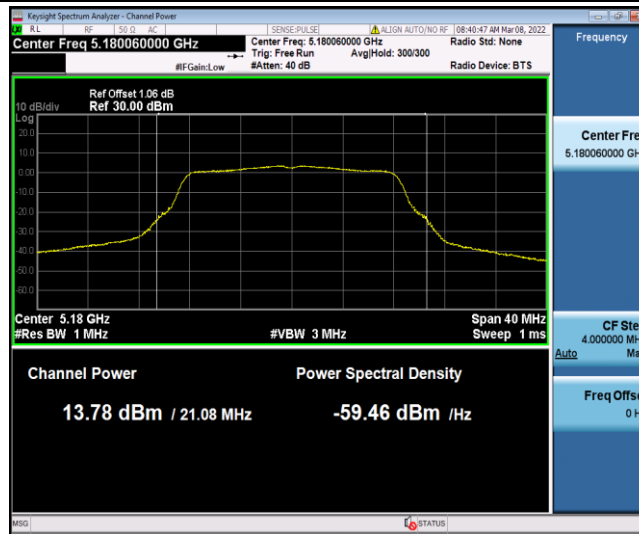


11A_Ant1_5180

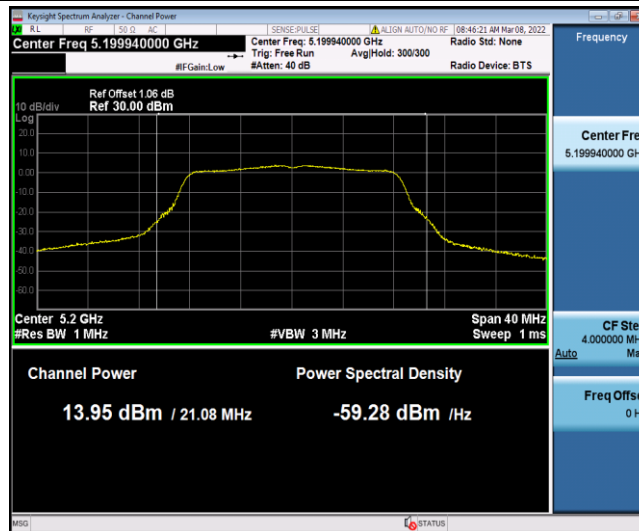

11A_Ant1_5200

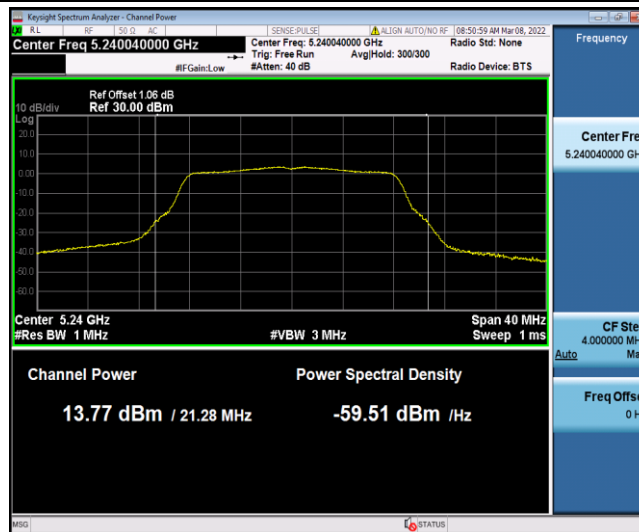

11A_Ant1_5240

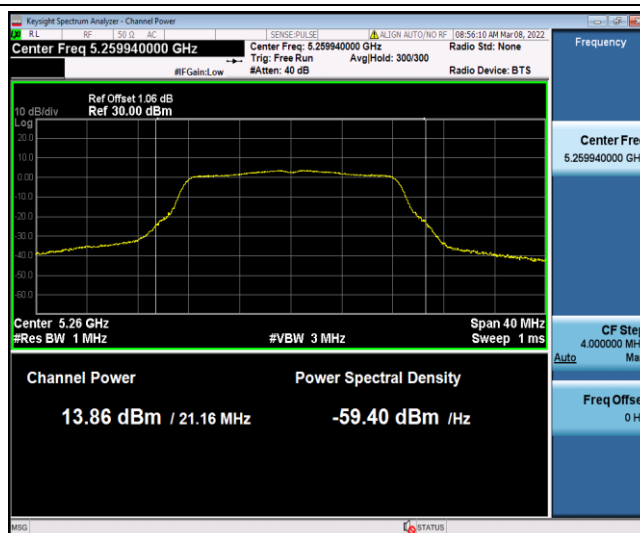


11A_Ant1_5260




11A_Ant1_5280



11A_Ant1_5320

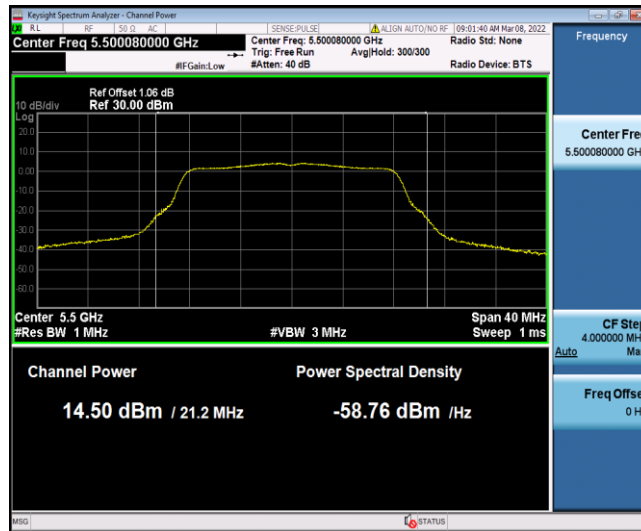


11A_Ant1_5500

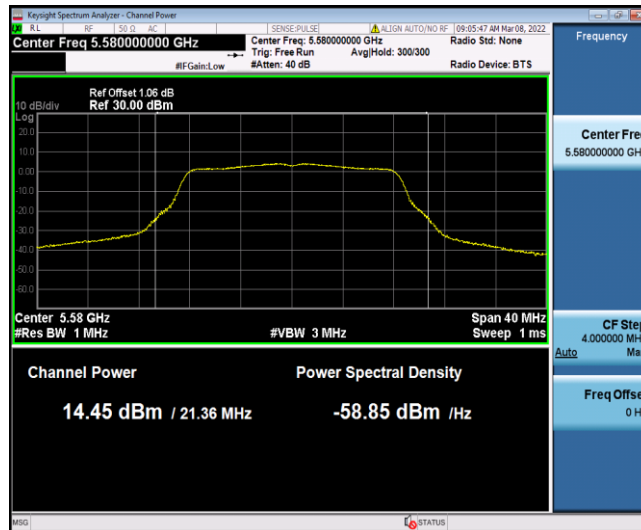


11A_Ant1_5580




11A_Ant1_5700

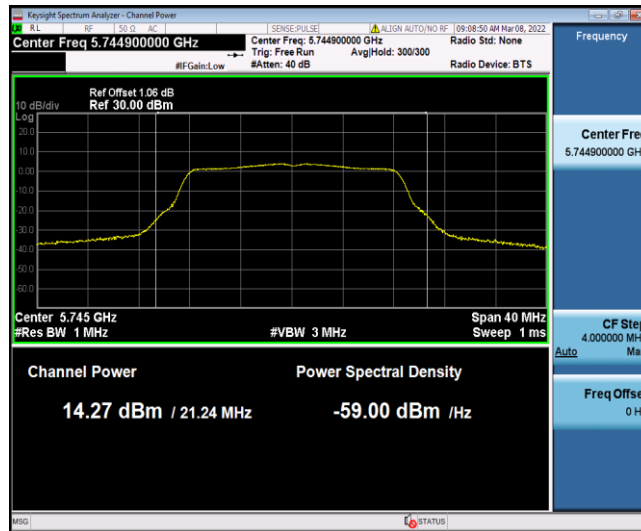

11A_Ant1_5745

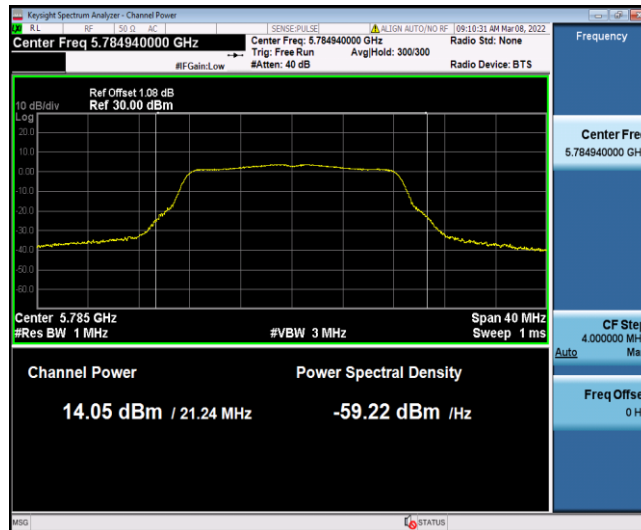


11A_Ant1_5785

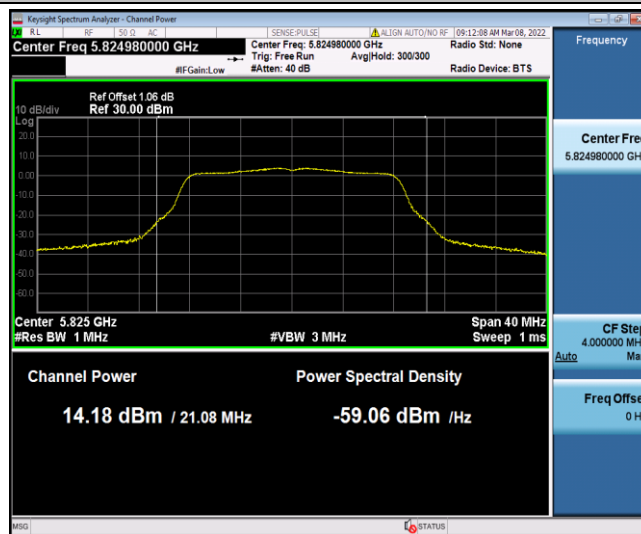

11A_Ant1_5825



11N20SISO_Ant1_5180

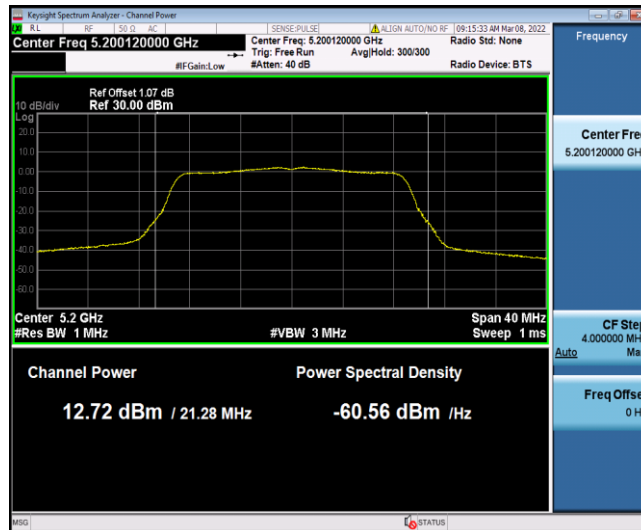


11N20SISO_Ant1_5200




11N20SISO_Ant1_5240




11N20SISO_Ant1_5260

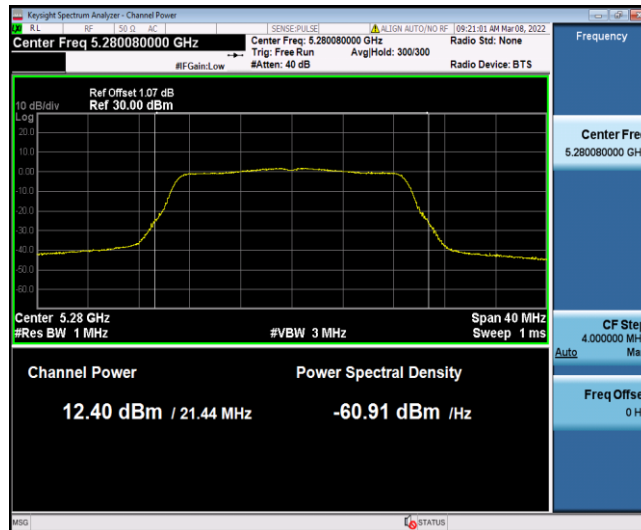

11N20SISO_Ant1_5280

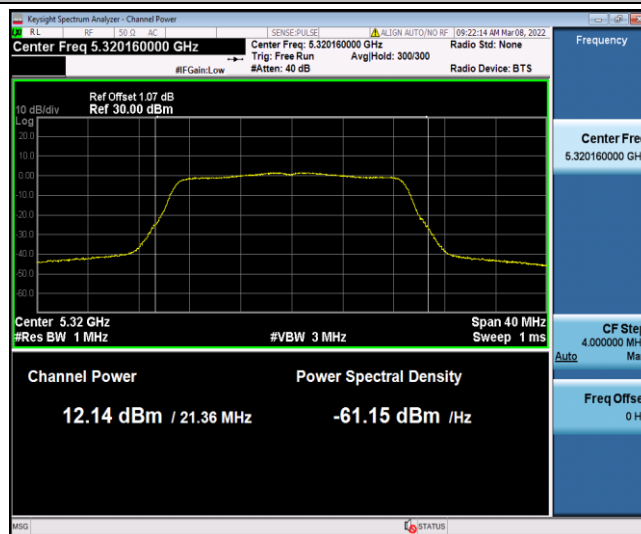


11N20SISO_Ant1_5320

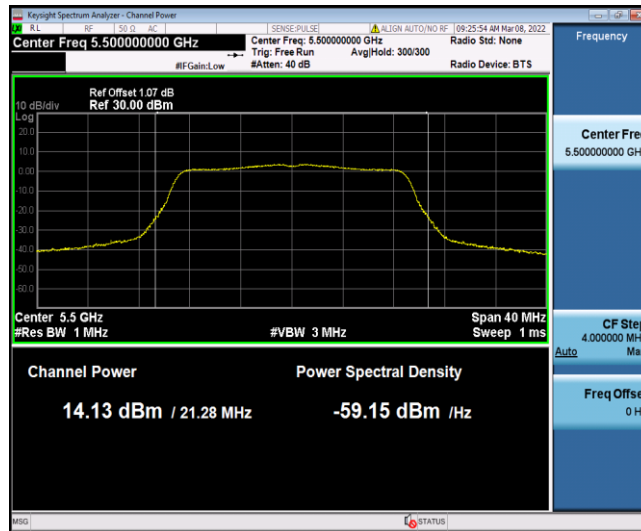

11N20SISO_Ant1_5500




11N20SISO_Ant1_5580

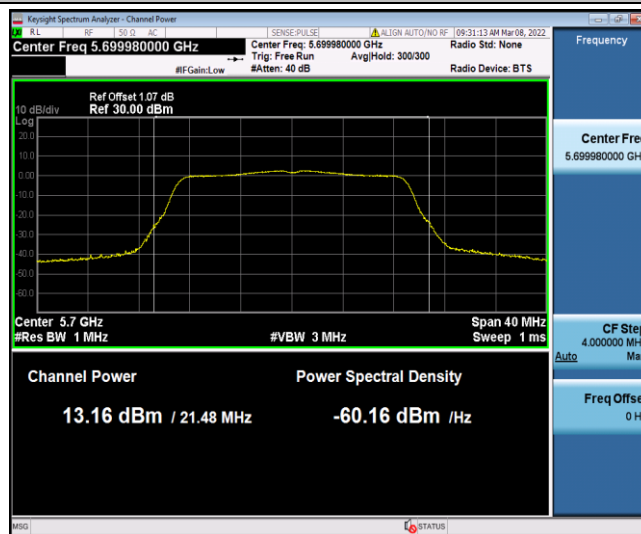

11N20SISO_Ant1_5700



11N20SISO_Ant1_5745

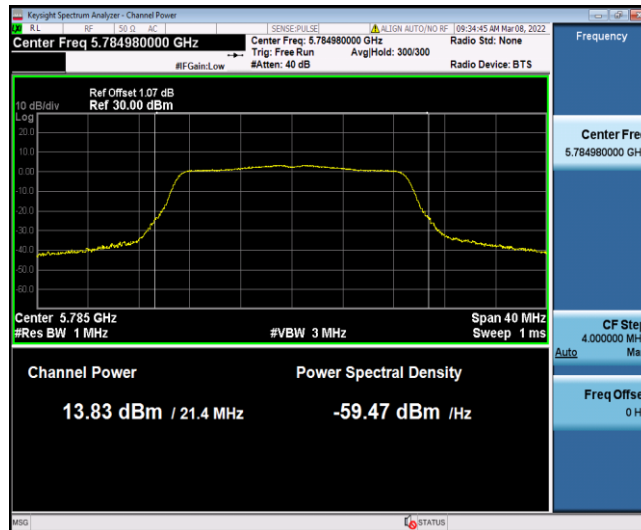


11N20SISO_Ant1_5785



11N20SISO_Ant1_5825




11N40SISO_Ant1_5190

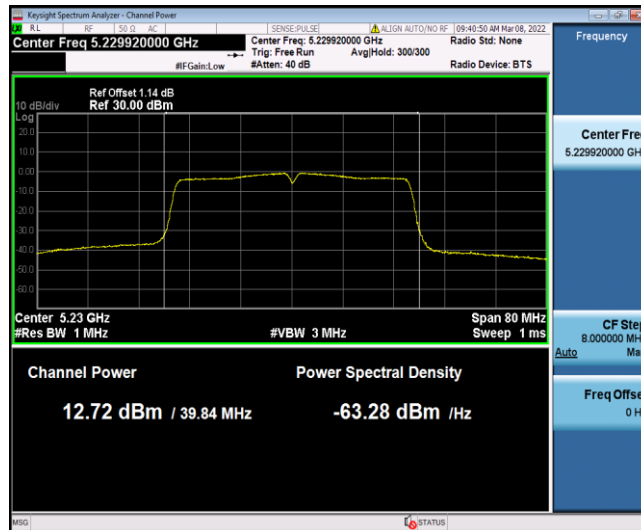


11N40SISO_Ant1_5230




11N40SISO_Ant1_5270

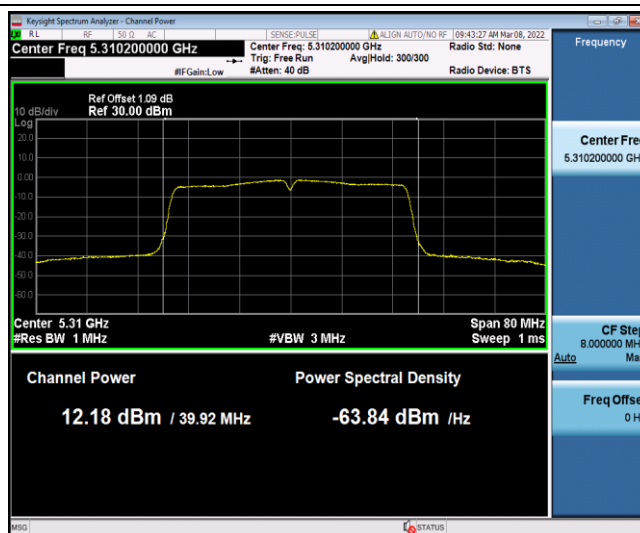


11N40SISO_Ant1_5310

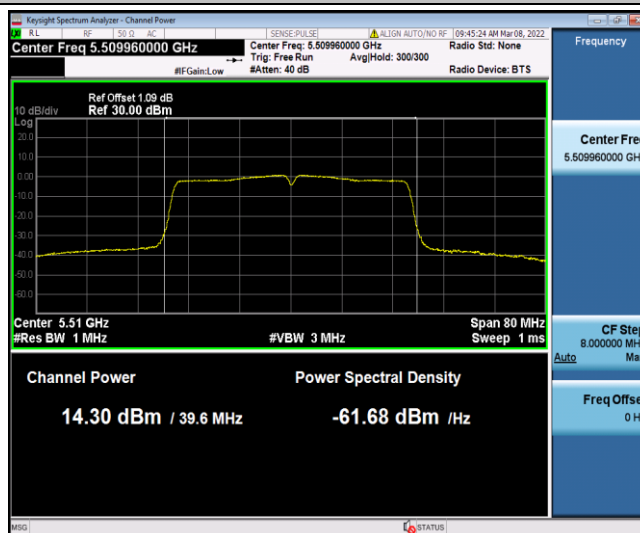


11N40SISO_Ant1_5510

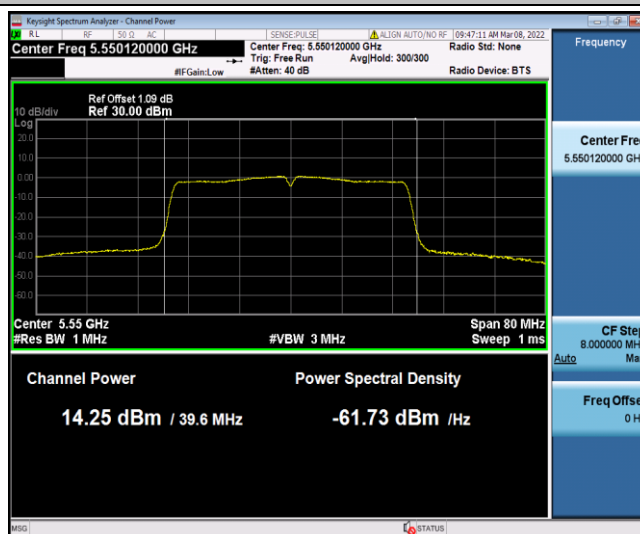


11N40SISO_Ant1_5550

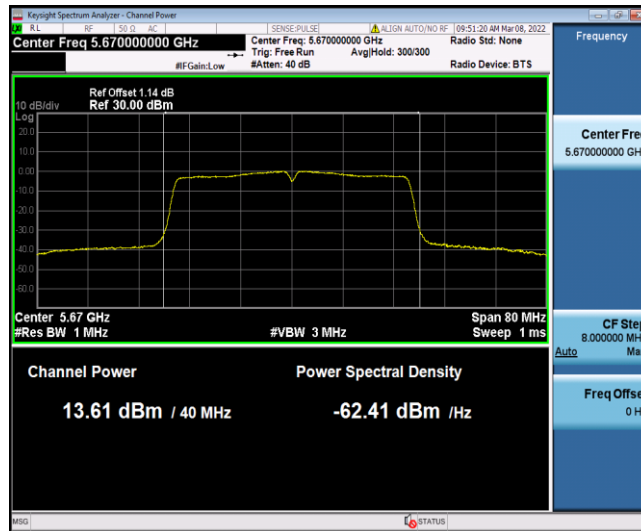


11N40SISO_Ant1_5670

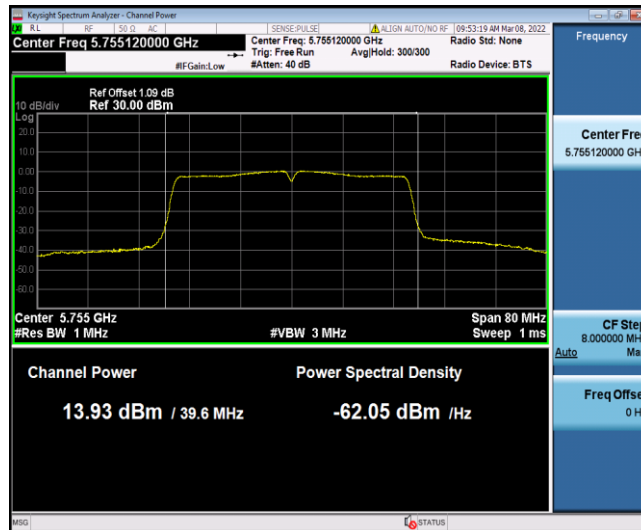

11N40SISO_Ant1_5755

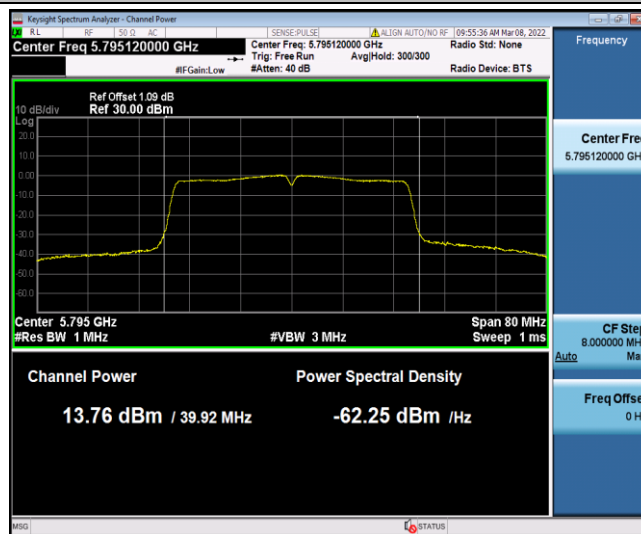


11N40SISO_Ant1_5795

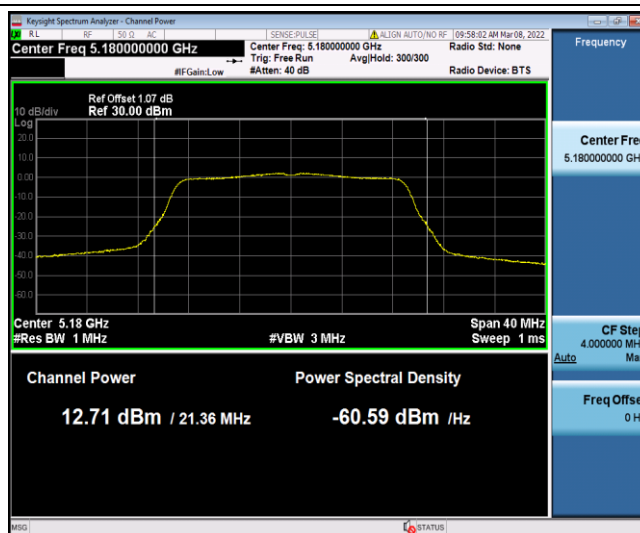

11AC20SISO_Ant1_5180




11AC20SISO_Ant1_5200

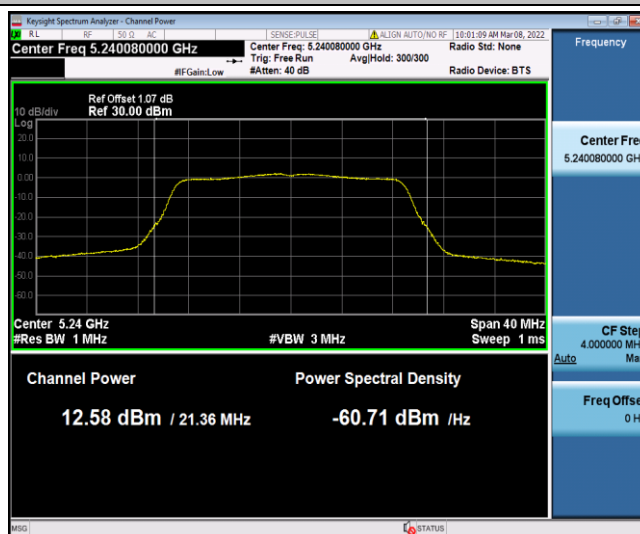


11AC20SISO_Ant1_5240




11AC20SISO_Ant1_5260

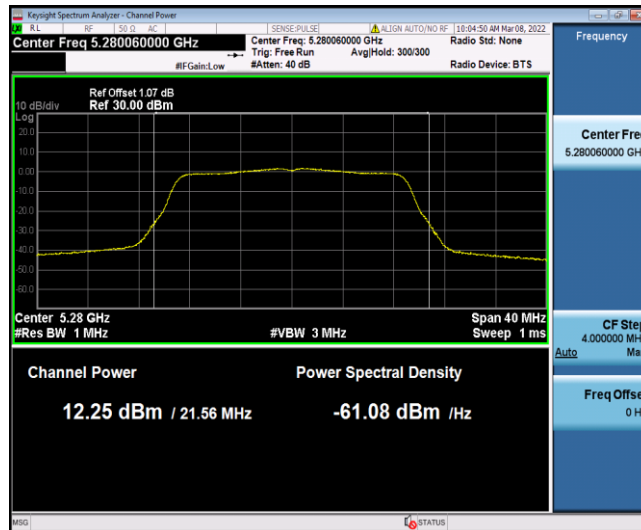


11AC20SISO_Ant1_5280

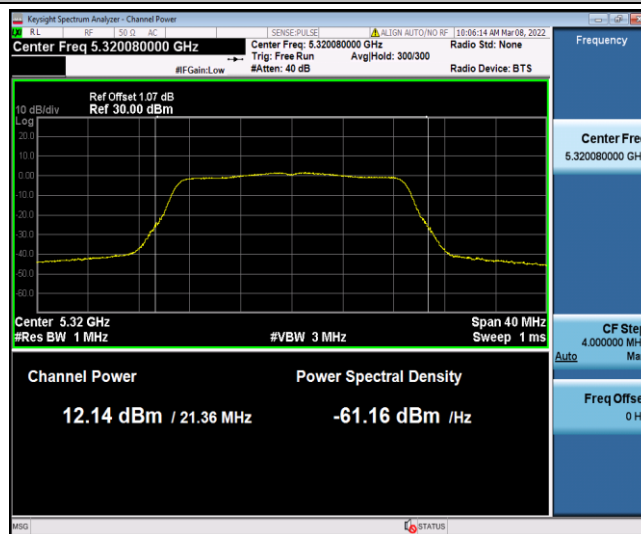


11AC20SISO_Ant1_5320

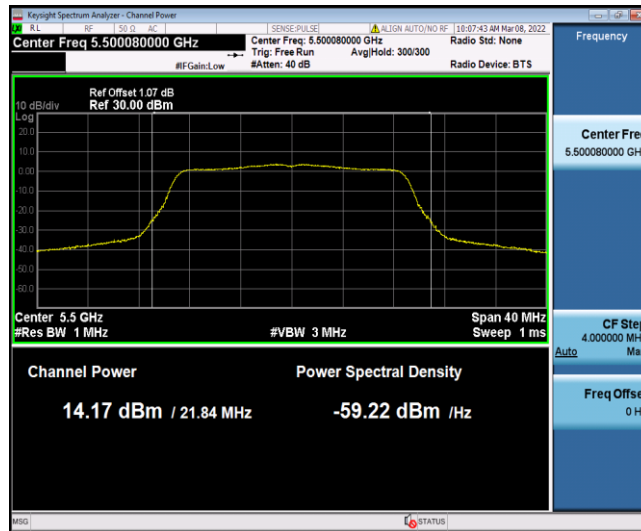

11AC20SISO_Ant1_5500

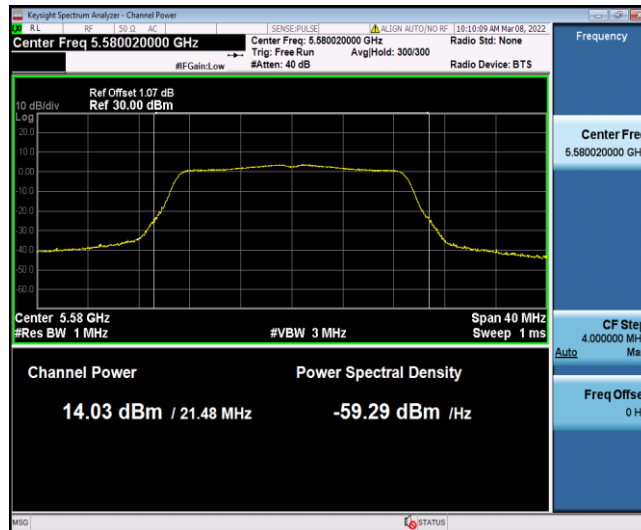

11AC20SISO_Ant1_5580

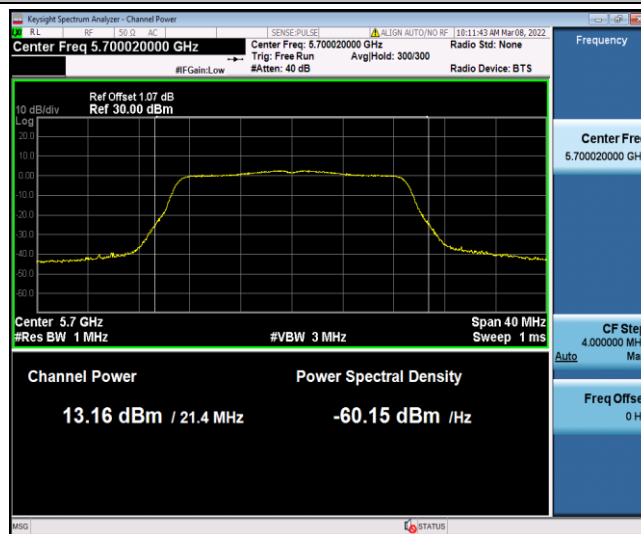

11AC20SISO_Ant1_5700