




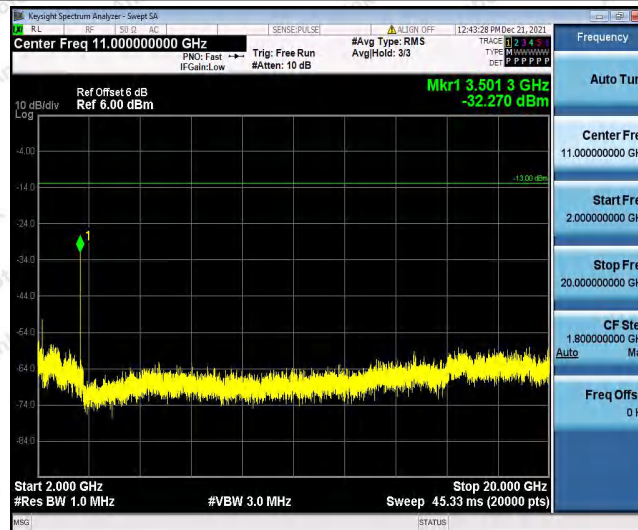

Band4-5MHz-16QAM-19975-1RB#0-Range1:30~1000MHz

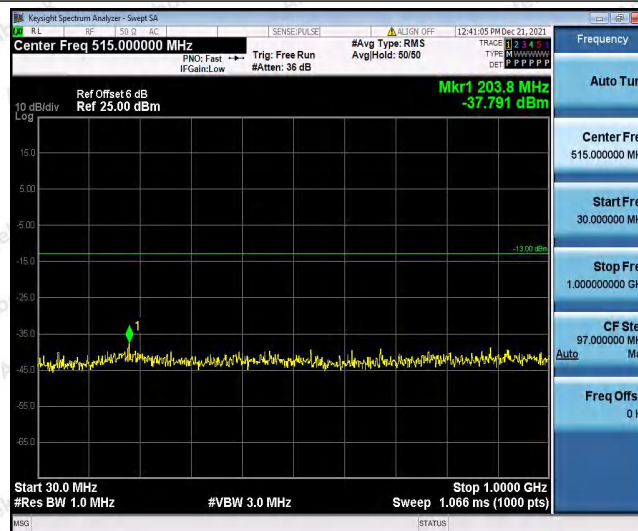

Band4-5MHz-16QAM-19975-1RB#0-Range2:1000~2000MHz

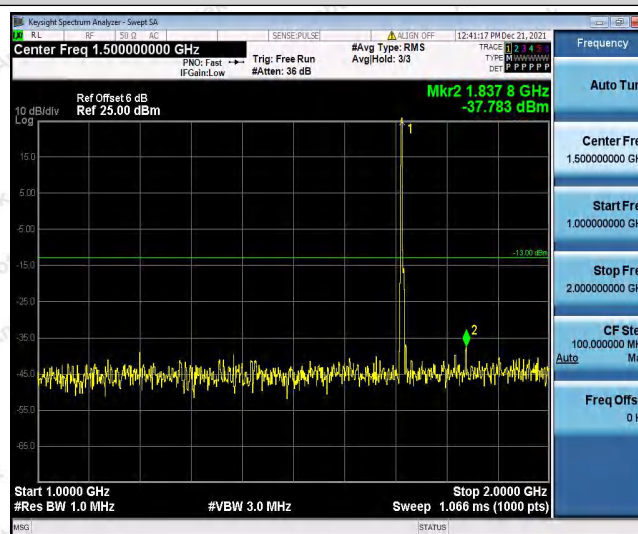


Band4-5MHz-16QAM-19975-1RB#0-Range3:2000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

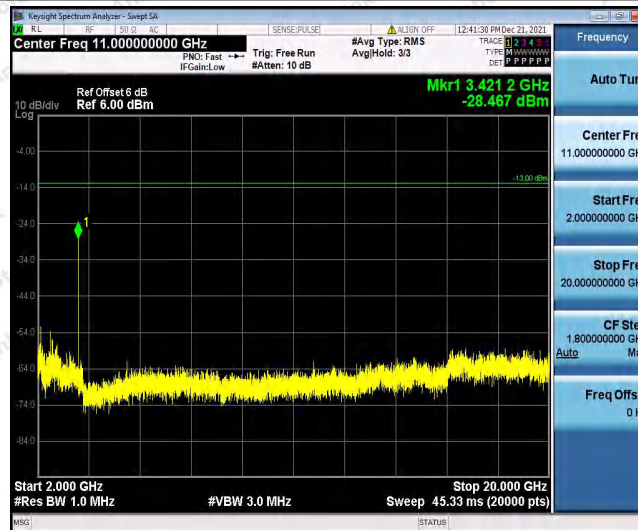

Band4-5MHz-16QAM-20175-1RB#0-Range1:30~1000MHz

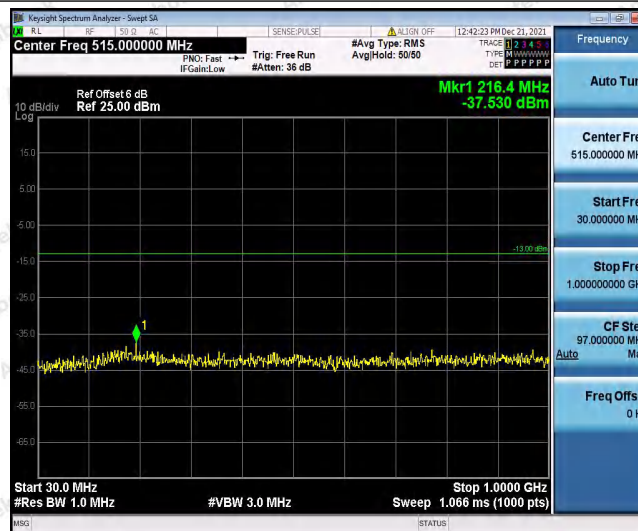

Band4-5MHz-16QAM-20175-1RB#0-Range2:1000~2000MHz

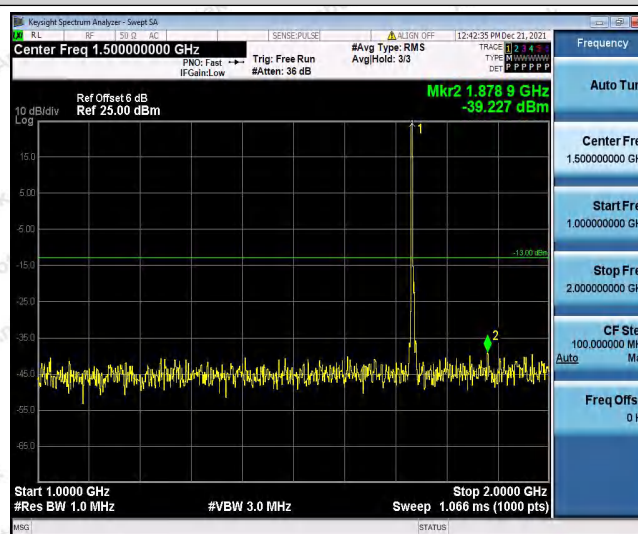


Band4-5MHz-16QAM-20175-1RB#0-Range3:2000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

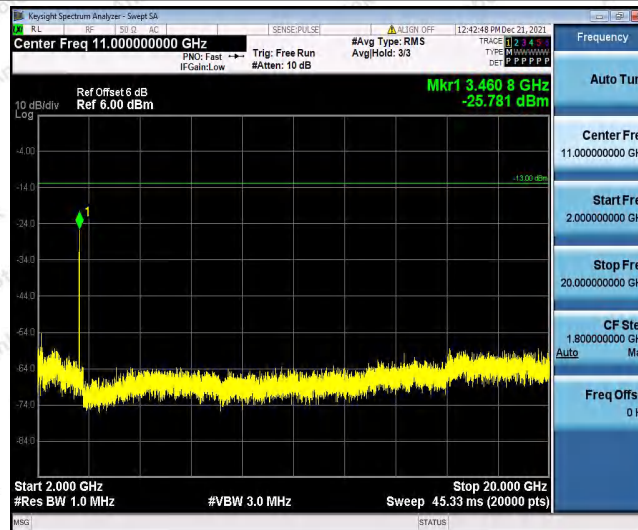

Band4-5MHz-16QAM-20375-1RB#0-Range1:30~1000MHz

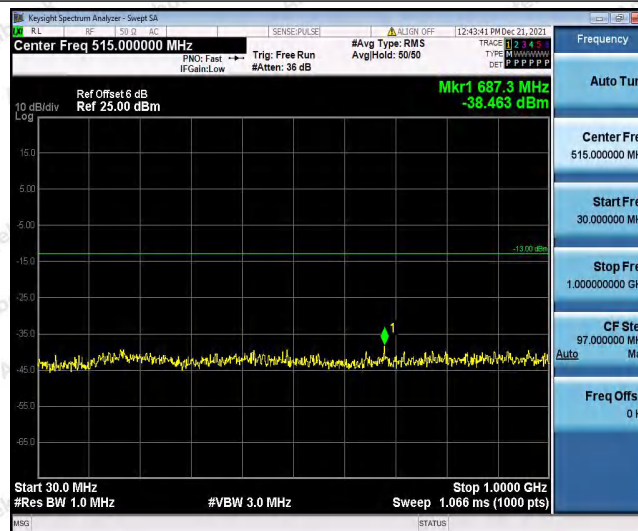

Band4-5MHz-16QAM-20375-1RB#0-Range2:1000~2000MHz

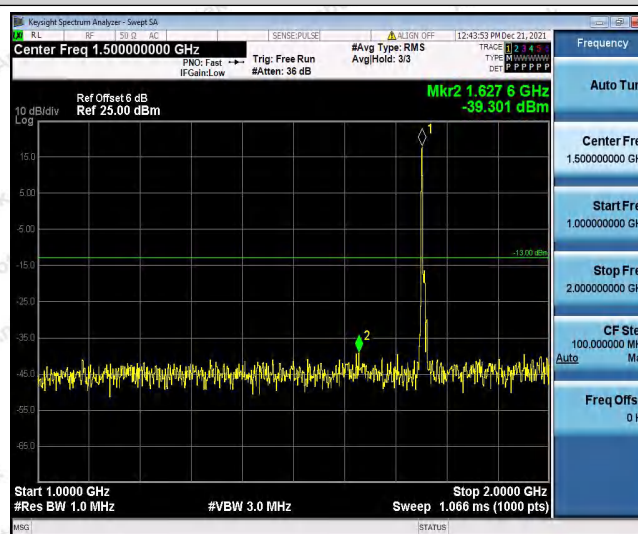


Band4-5MHz-16QAM-20375-1RB#0-Range3:2000~20000MHz

Shenzhen Anbotech Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

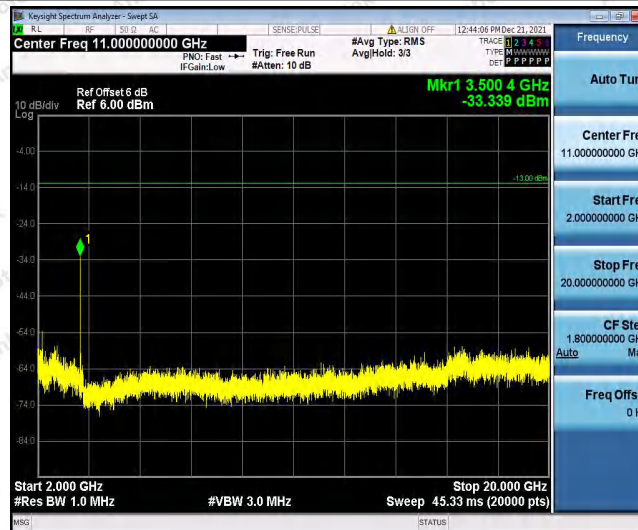

Band4-10MHz-QPSK-20000-1RB#0-Range1:30~1000MHz

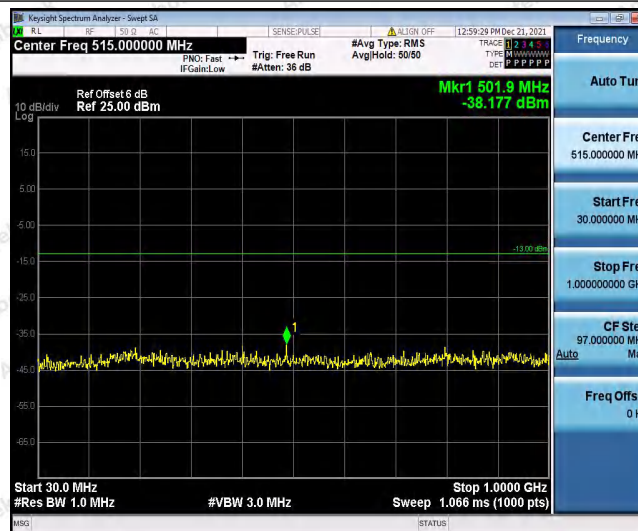

Band4-10MHz-QPSK-20000-1RB#0-Range2:1000~2000MHz

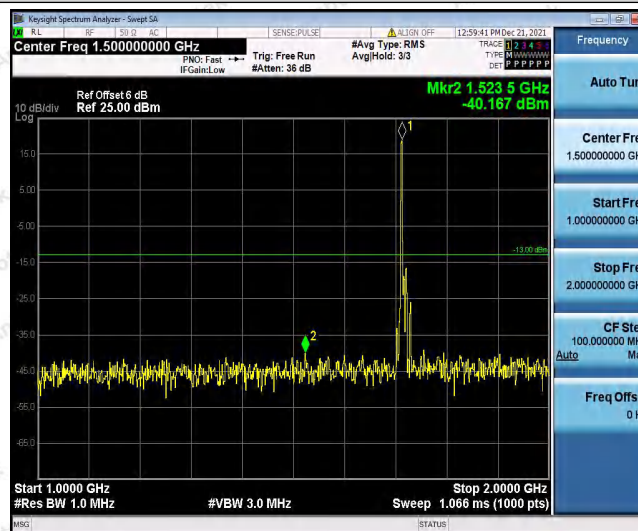

Band4-10MHz-QPSK-20000-1RB#0-Range3:2000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

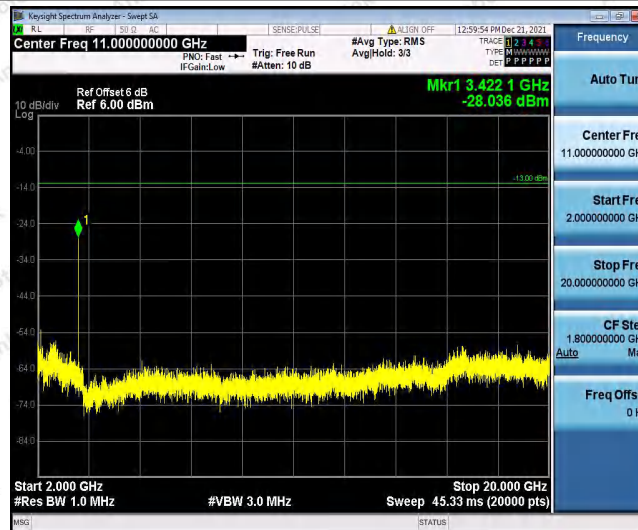

Band4-10MHz-QPSK-20175-1RB#0-Range1:30~1000MHz

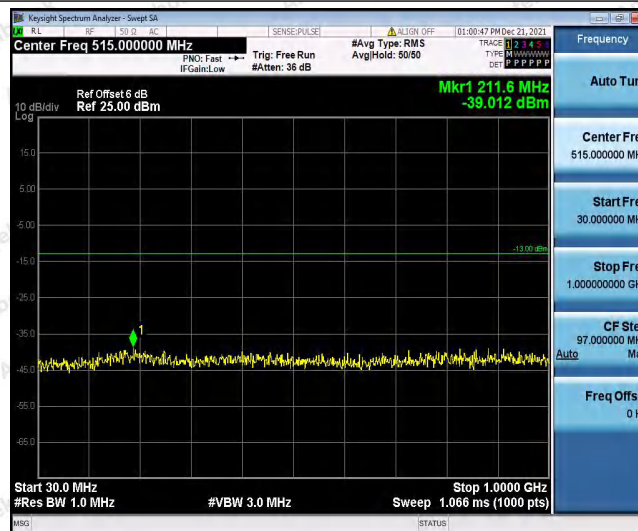

Band4-10MHz-QPSK-20175-1RB#0-Range2:1000~2000MHz

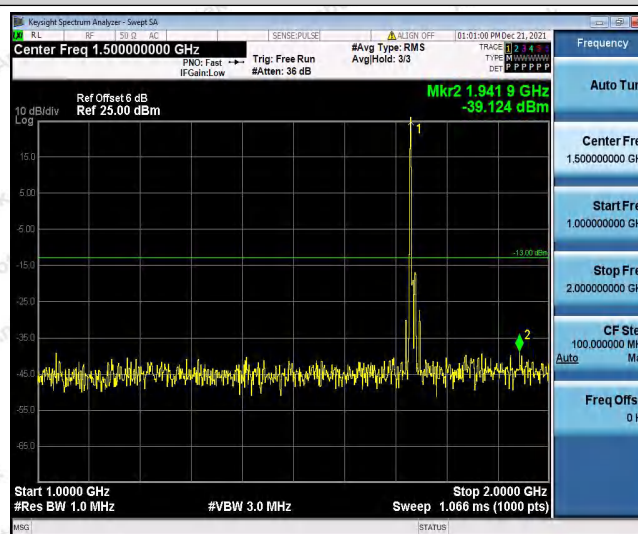


Band4-10MHz-QPSK-20175-1RB#0-Range3:2000~20000MHz

Shenzhen Anbotech Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

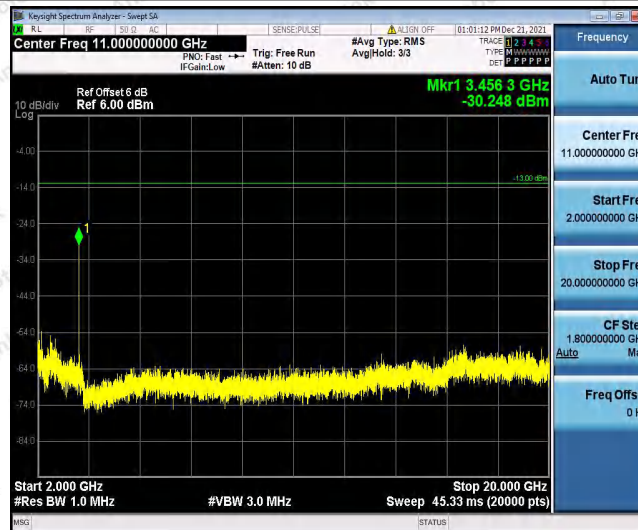

Band4-10MHz-QPSK-20350-1RB#0-Range1:30~1000MHz

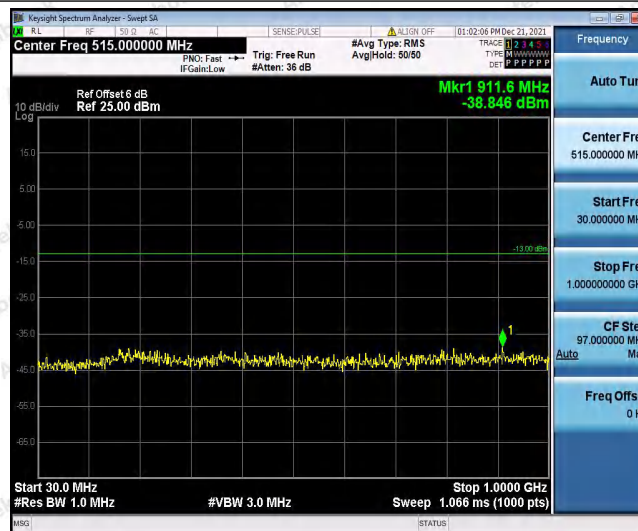

Band4-10MHz-QPSK-20350-1RB#0-Range2:1000~2000MHz

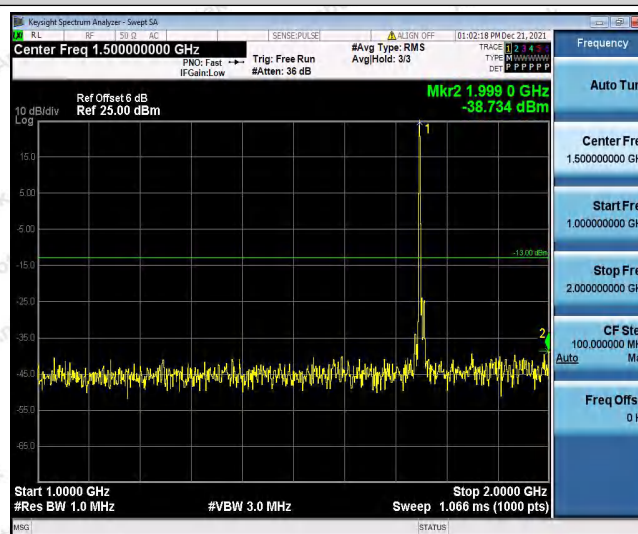

Band4-10MHz-QPSK-20350-1RB#0-Range3:2000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

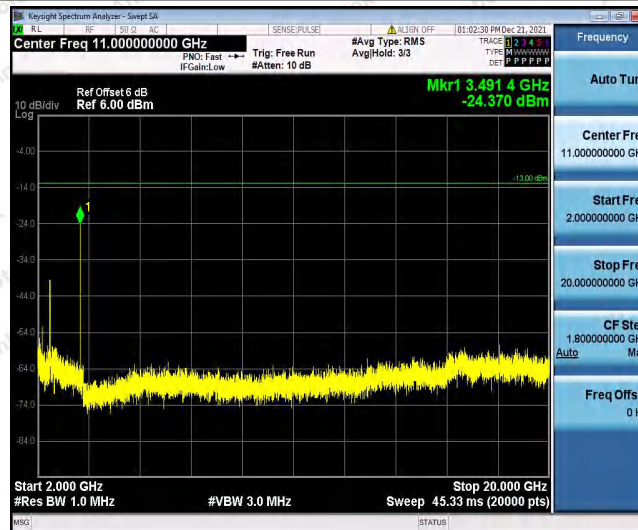

Band4-10MHz-16QAM-20000-1RB#0-Range1:30~1000MHz

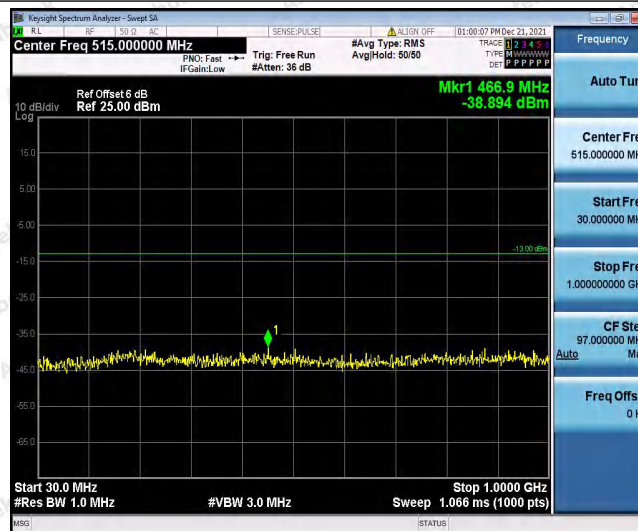

Band4-10MHz-16QAM-20000-1RB#0-Range2:1000~2000MHz

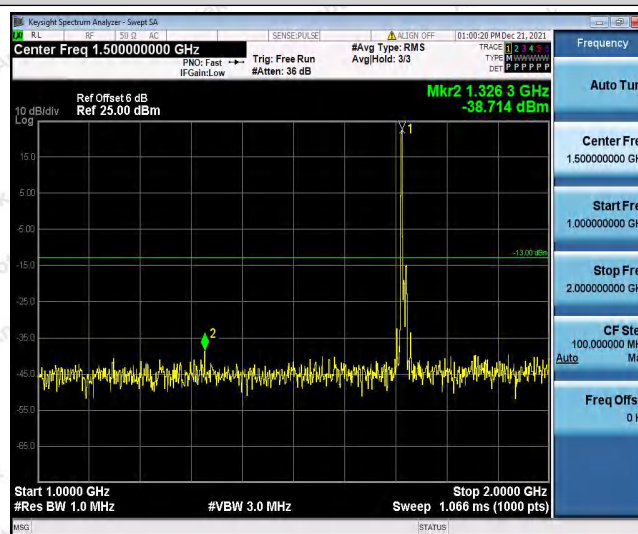

Band4-10MHz-16QAM-20000-1RB#0-Range3:2000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

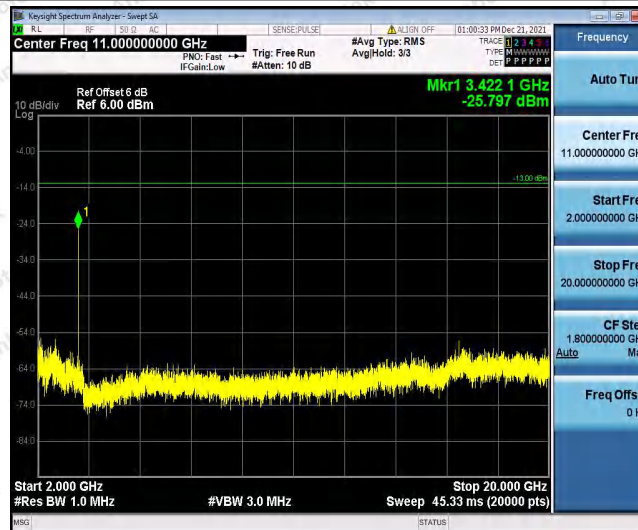

Band4-10MHz-16QAM-20175-1RB#0-Range1:30~1000MHz

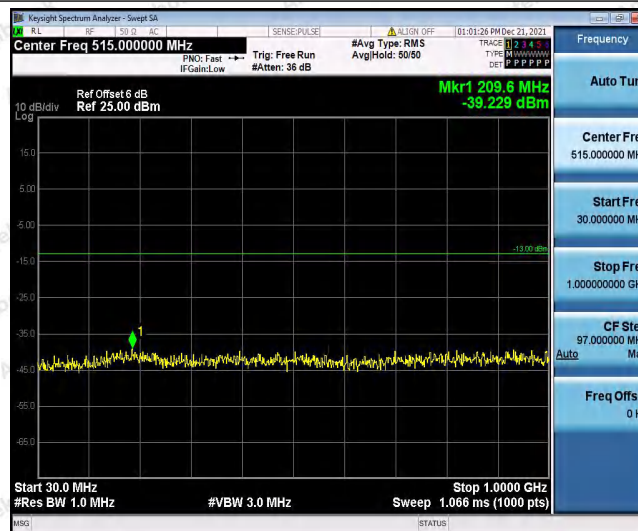

Band4-10MHz-16QAM-20175-1RB#0-Range2:1000~2000MHz

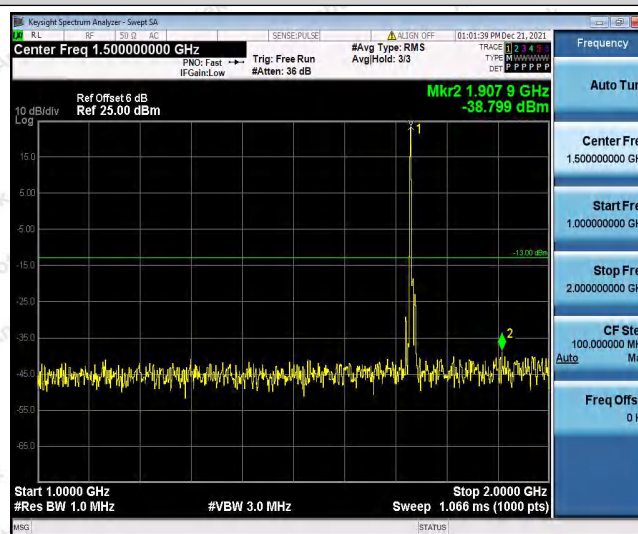


Band4-10MHz-16QAM-20175-1RB#0-Range3:2000~20000MHz

Shenzhen Anbotech Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

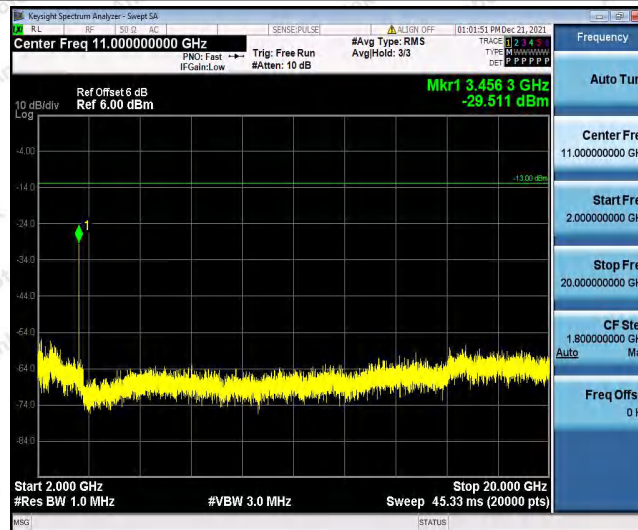

Band4-10MHz-16QAM-20350-1RB#0-Range1:30~1000MHz

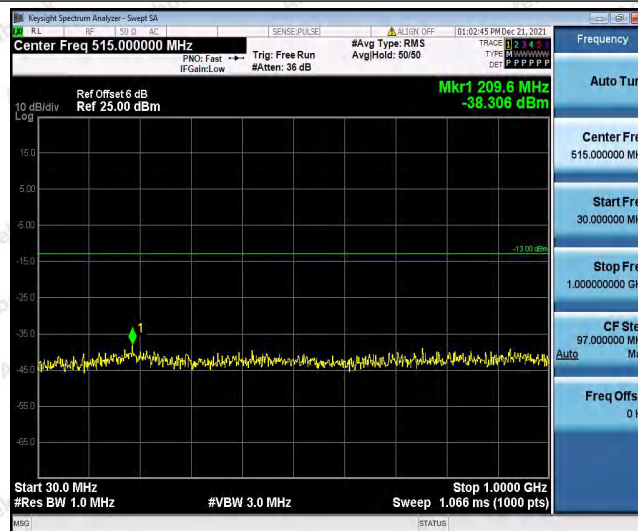

Band4-10MHz-16QAM-20350-1RB#0-Range2:1000~2000MHz

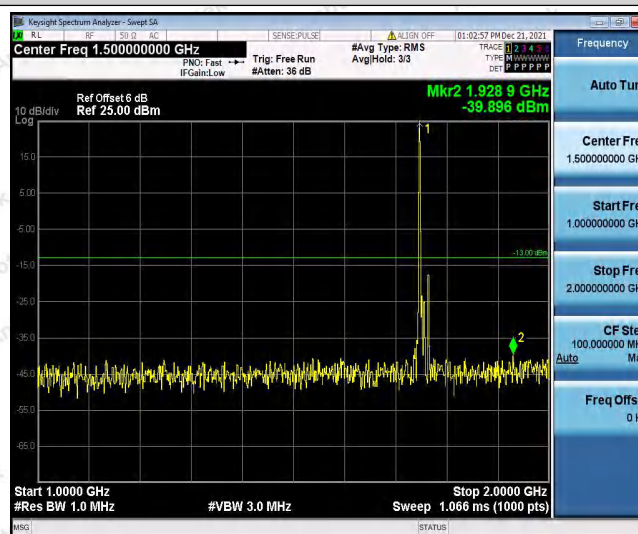


Band4-10MHz-16QAM-20350-1RB#0-Range3:2000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

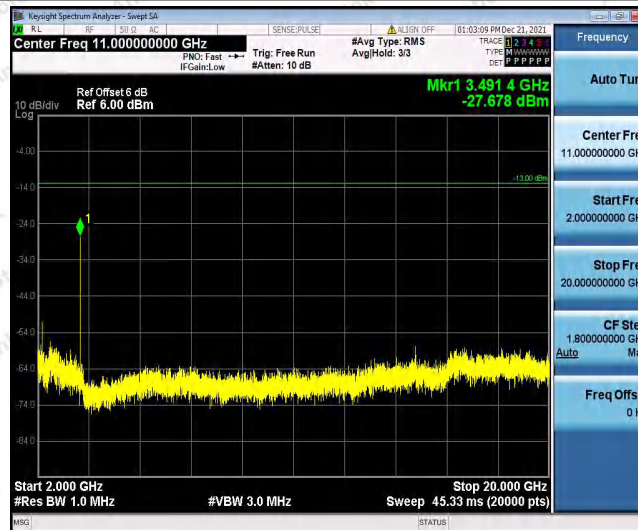

Band4-15MHz-QPSK-20025-1RB#0-Range1:30~1000MHz

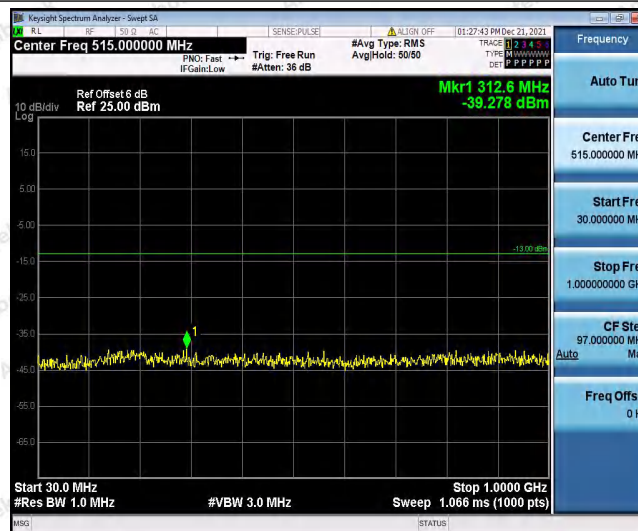

Band4-15MHz-QPSK-20025-1RB#0-Range2:1000~2000MHz

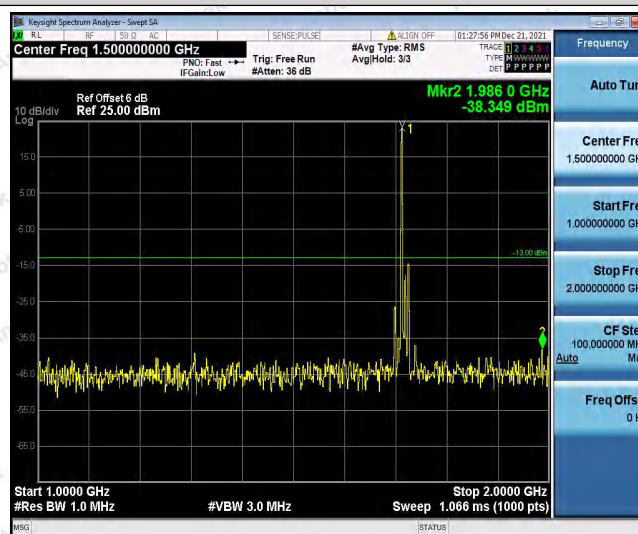

Band4-15MHz-QPSK-20025-1RB#0-Range3:2000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

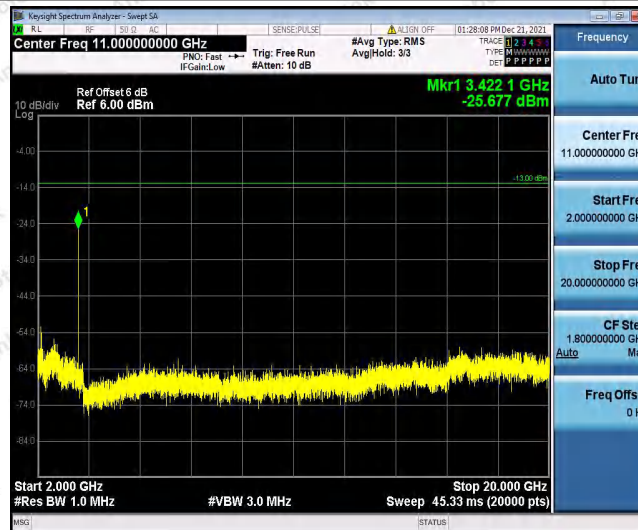

Band4-15MHz-QPSK-20175-1RB#0-Range1:30~1000MHz

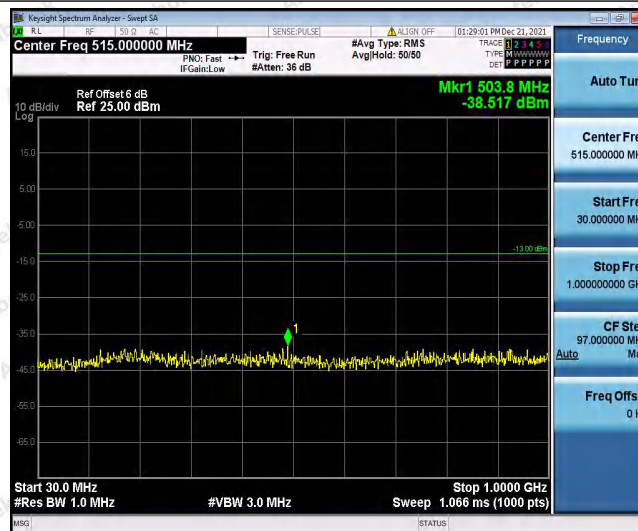

Band4-15MHz-QPSK-20175-1RB#0-Range2:1000~2000MHz

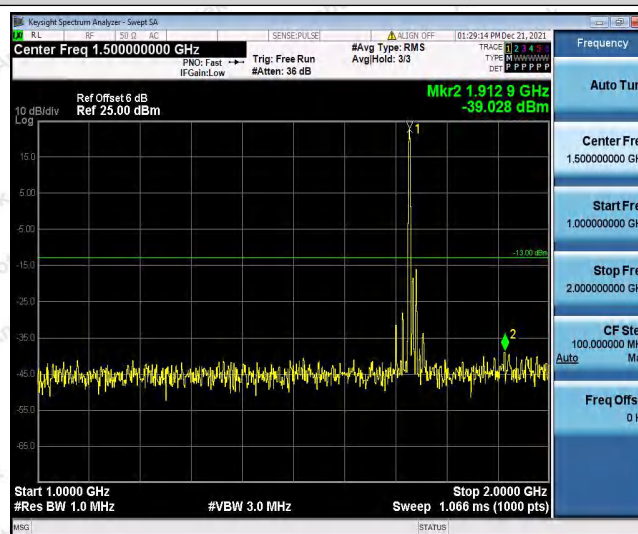

Band4-15MHz-QPSK-20175-1RB#0-Range3:2000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

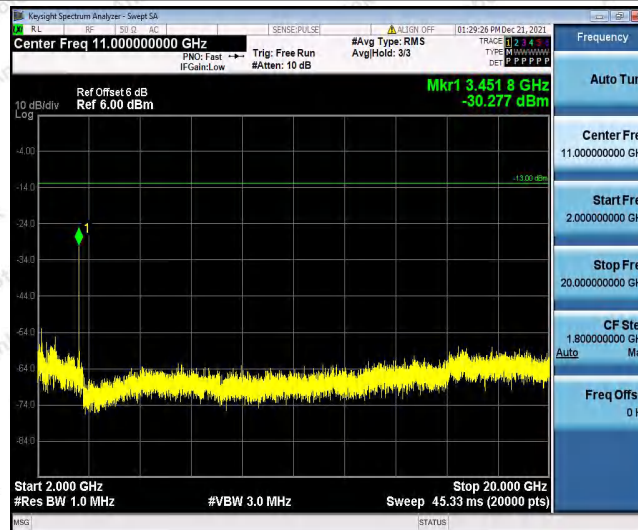

Band4-15MHz-QPSK-20325-1RB#0-Range1:30~1000MHz

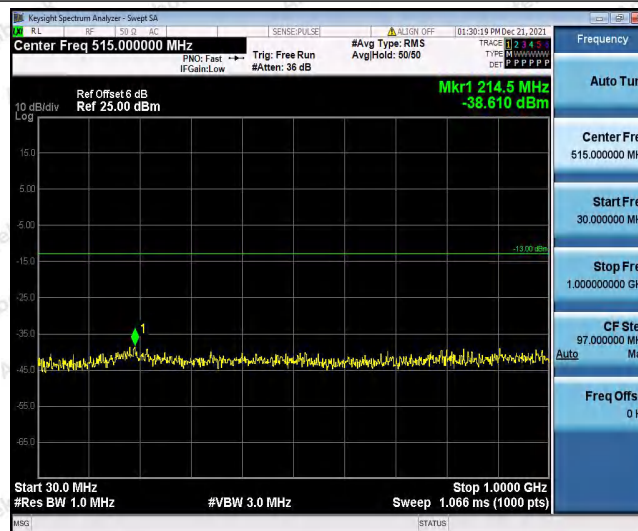

Band4-15MHz-QPSK-20325-1RB#0-Range2:1000~2000MHz

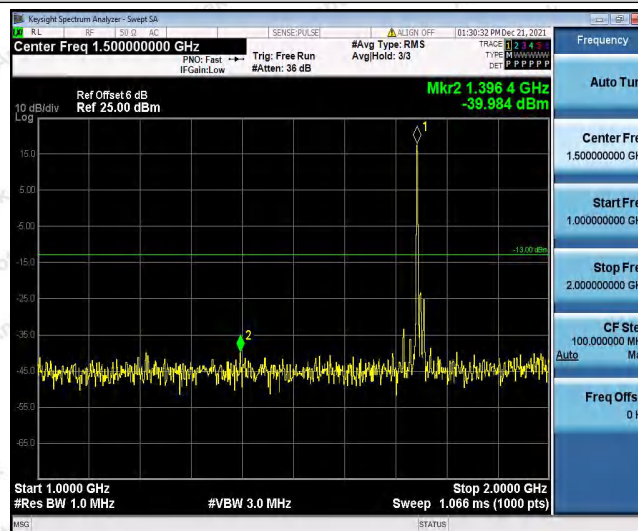


Band4-15MHz-QPSK-20325-1RB#0-Range3:2000~20000MHz

Shenzhen Anbotech Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

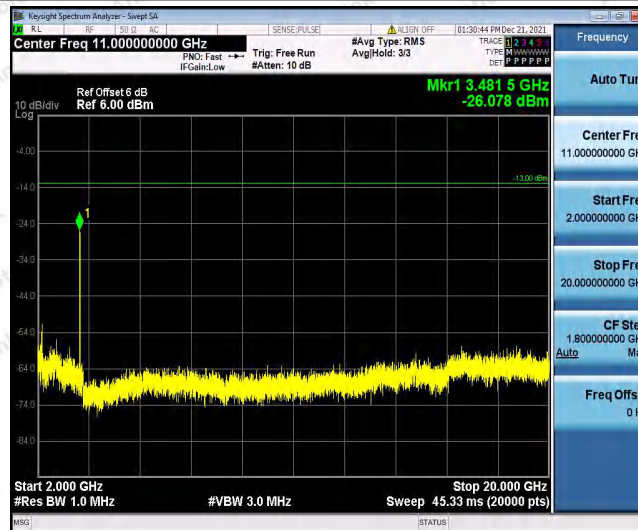

Band4-15MHz-16QAM-20025-1RB#0-Range1:30~1000MHz

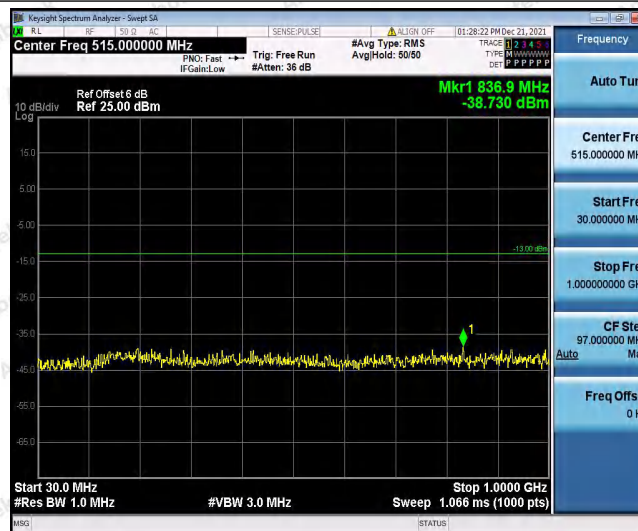

Band4-15MHz-16QAM-20025-1RB#0-Range2:1000~2000MHz

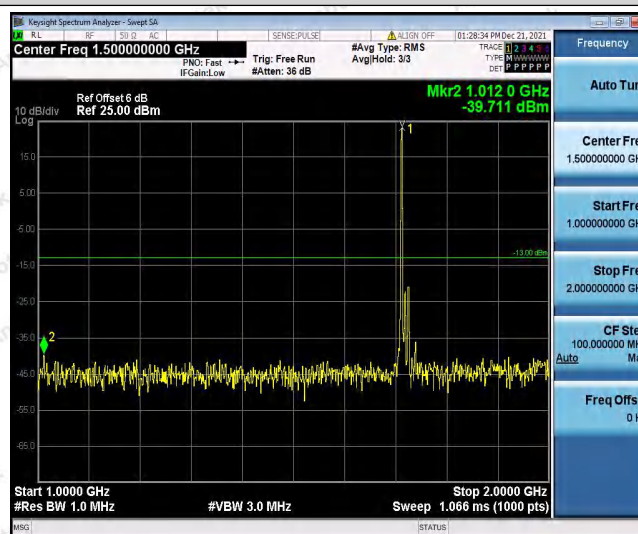

Band4-15MHz-16QAM-20025-1RB#0-Range3:2000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

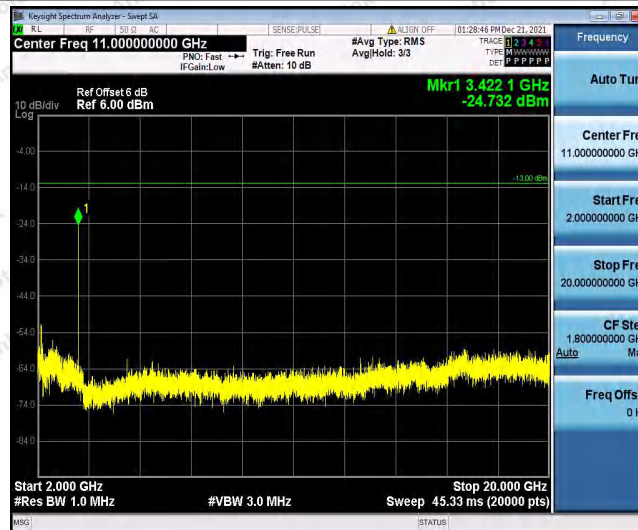

Band4-15MHz-16QAM-20175-1RB#0-Range1:30~1000MHz

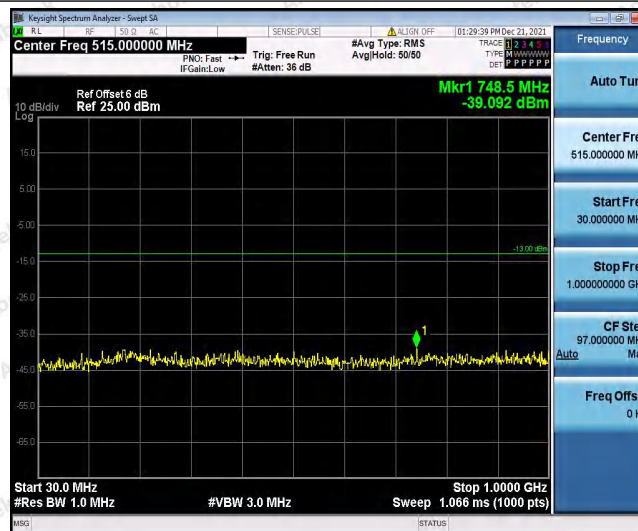

Band4-15MHz-16QAM-20175-1RB#0-Range2:1000~2000MHz

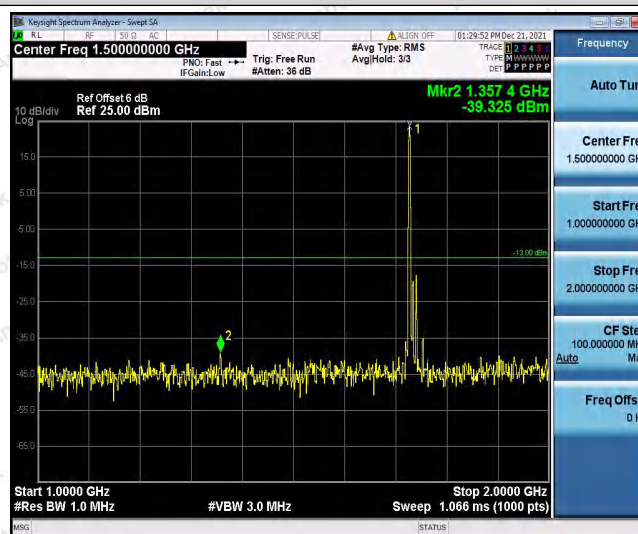

Band4-15MHz-16QAM-20175-1RB#0-Range3:2000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

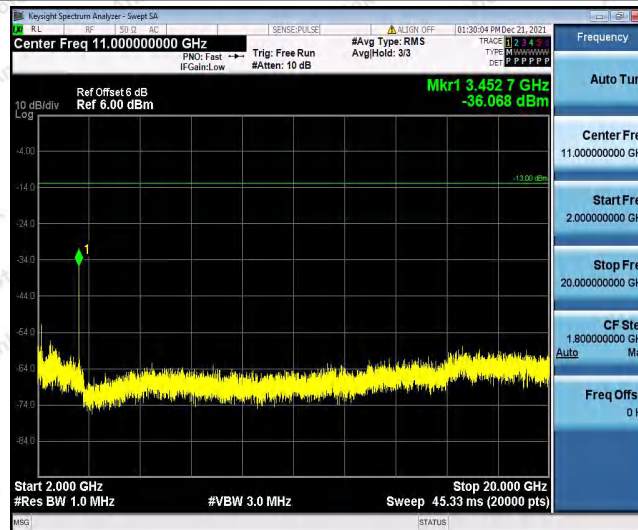

Band4-15MHz-16QAM-20325-1RB#0-Range1:30~1000MHz

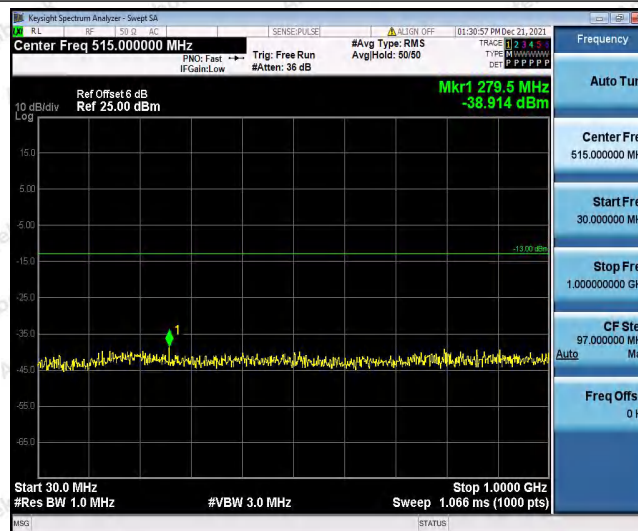

Band4-15MHz-16QAM-20325-1RB#0-Range2:1000~2000MHz

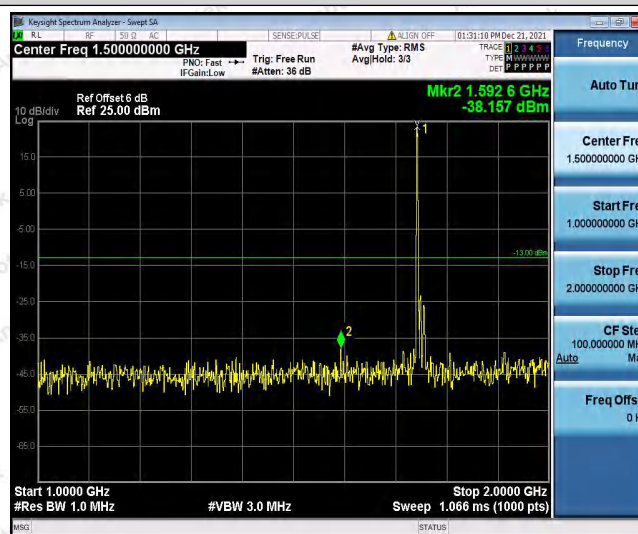

Band4-15MHz-16QAM-20325-1RB#0-Range3:2000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

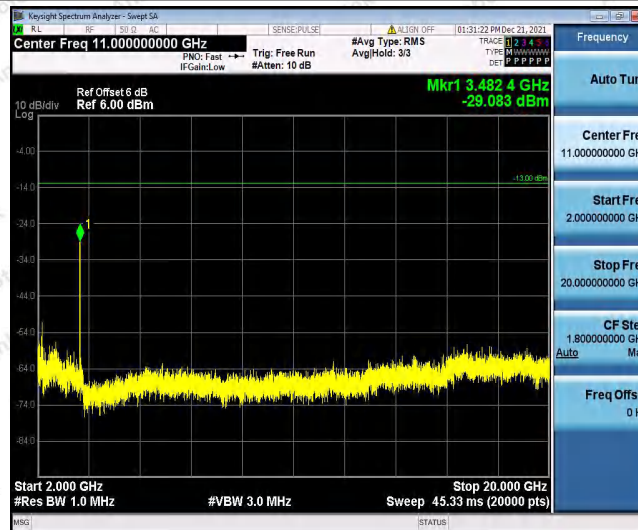

Band4-20MHz-QPSK-20050-1RB#0-Range1:30~1000MHz

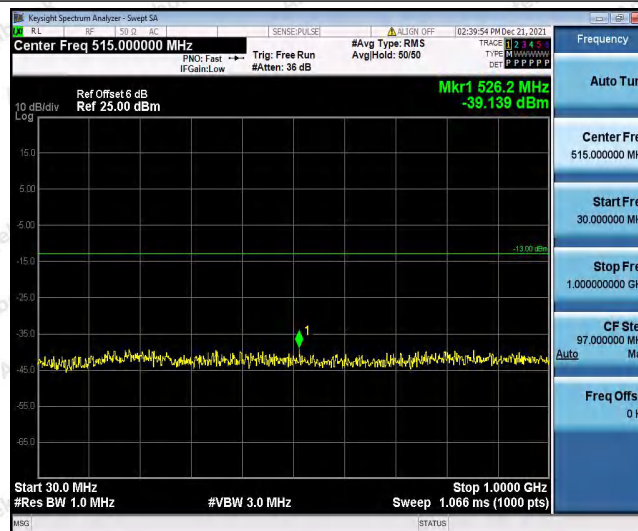

Band4-20MHz-QPSK-20050-1RB#0-Range2:1000~2000MHz

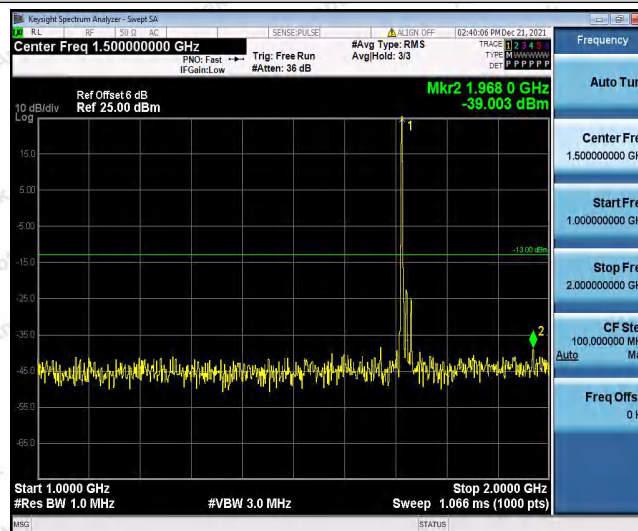


Band4-20MHz-QPSK-20050-1RB#0-Range3:2000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

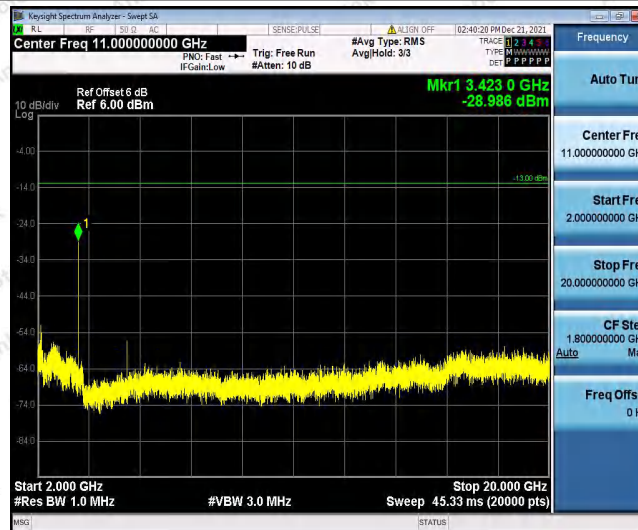

Band4-20MHz-QPSK-20175-1RB#0-Range1:30~1000MHz

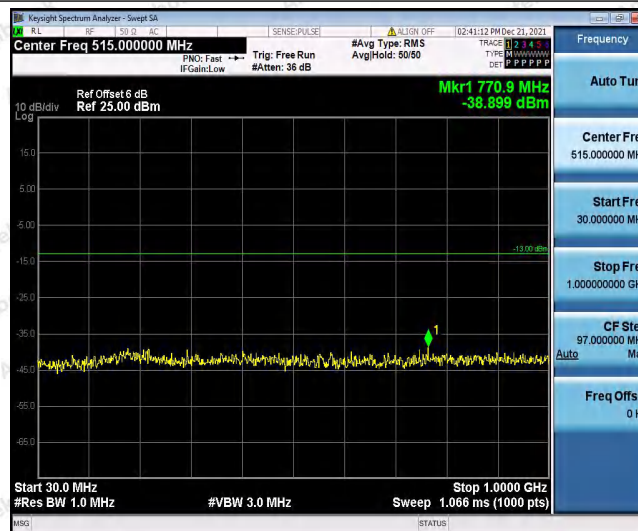

Band4-20MHz-QPSK-20175-1RB#0-Range2:1000~2000MHz

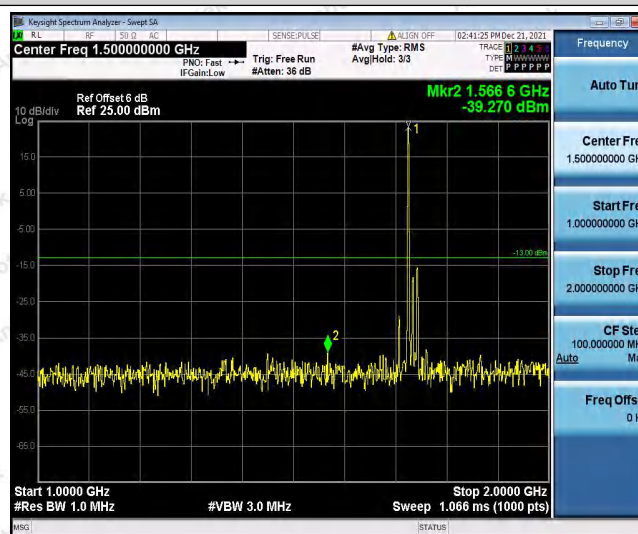

Band4-20MHz-QPSK-20175-1RB#0-Range3:2000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

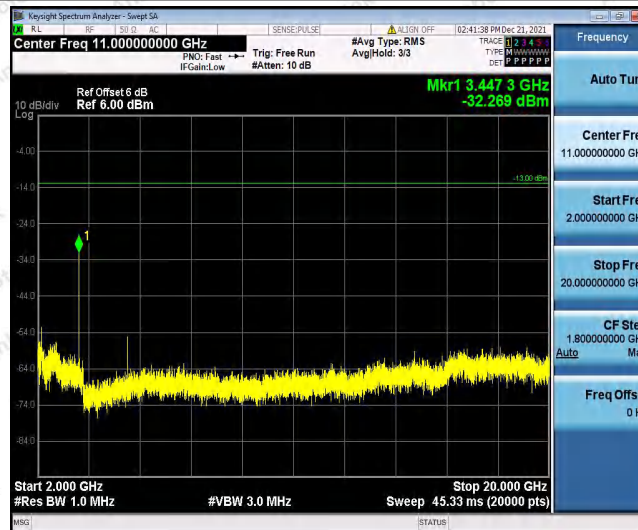

Band4-20MHz-QPSK-20300-1RB#0-Range1:30~1000MHz

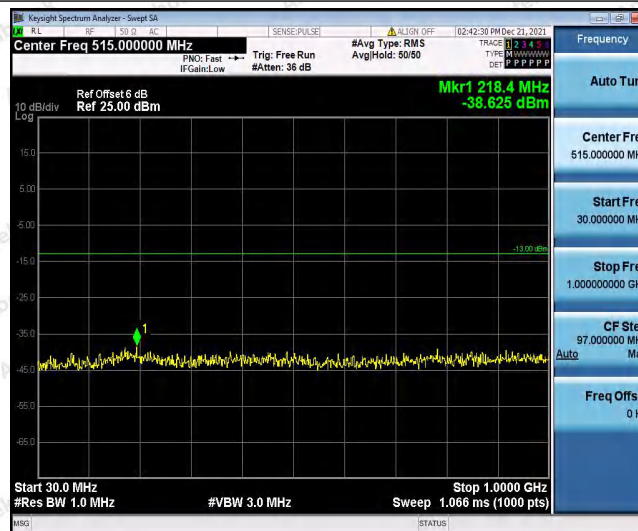

Band4-20MHz-QPSK-20300-1RB#0-Range2:1000~2000MHz

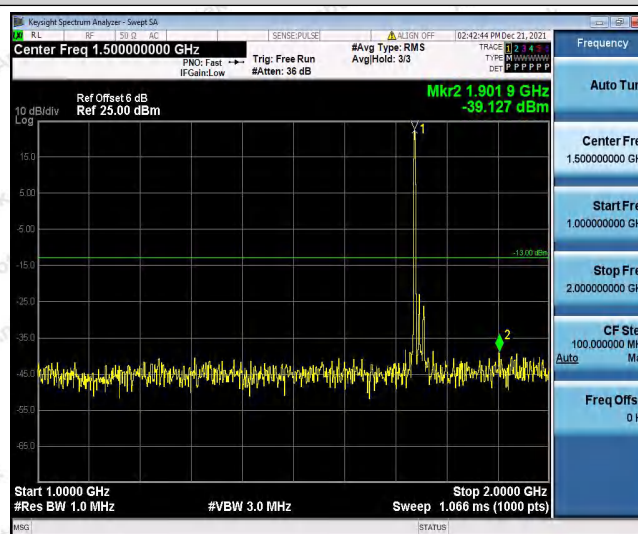

Band4-20MHz-QPSK-20300-1RB#0-Range3:2000~20000MHz

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com




Hotline

400-003-0500


www.anbotech.com

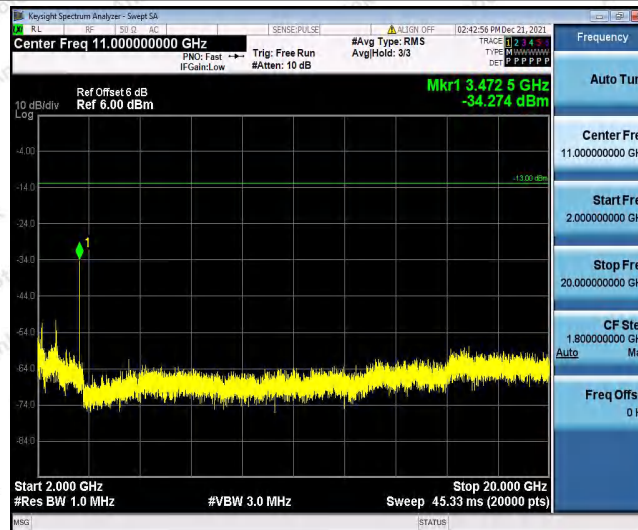

Band4-20MHz-16QAM-20050-1RB#0-Range1:30~1000MHz

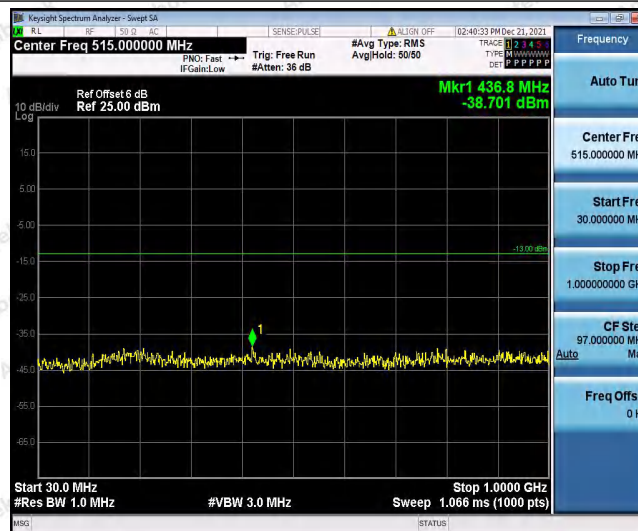

Band4-20MHz-16QAM-20050-1RB#0-Range2:1000~2000MHz

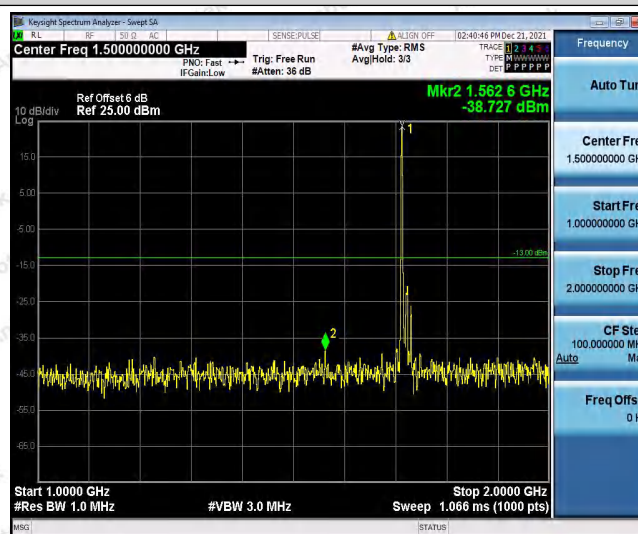

Band4-20MHz-16QAM-20050-1RB#0-Range3:2000~20000MHz

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com




Hotline

400-003-0500


www.anbotech.com

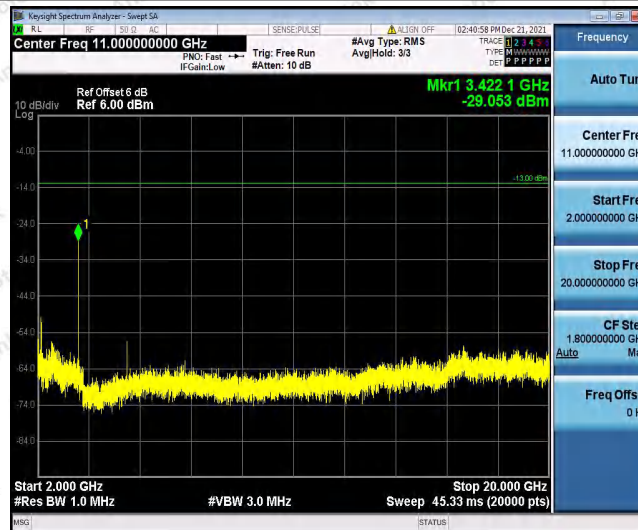

Band4-20MHz-16QAM-20175-1RB#0-Range1:30~1000MHz

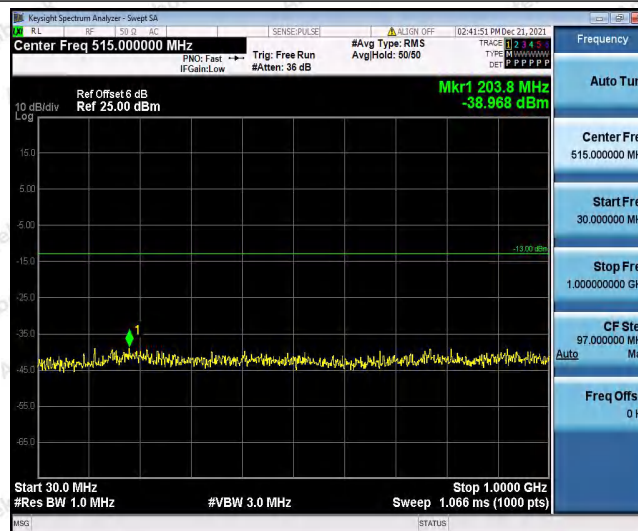

Band4-20MHz-16QAM-20175-1RB#0-Range2:1000~2000MHz

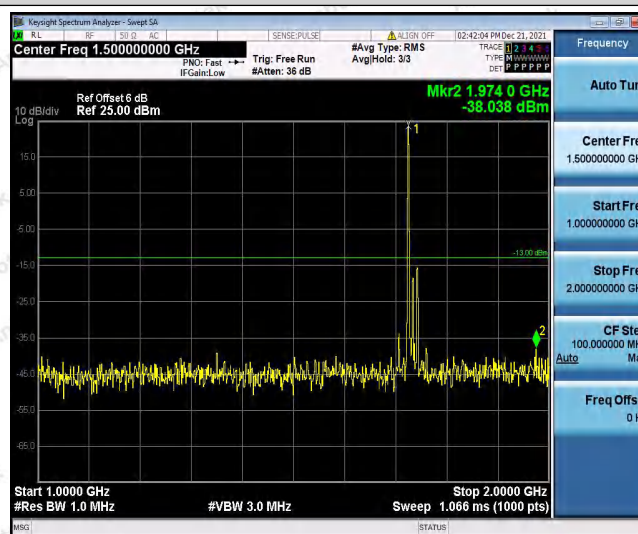

Band4-20MHz-16QAM-20175-1RB#0-Range3:2000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

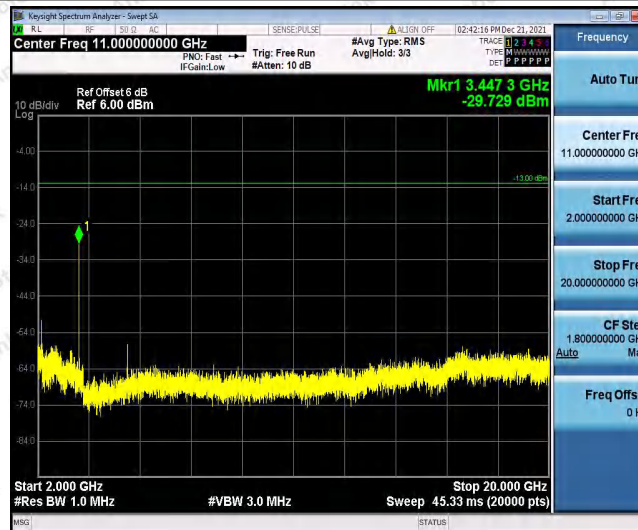

Band4-20MHz-16QAM-20300-1RB#0-Range1:30~1000MHz

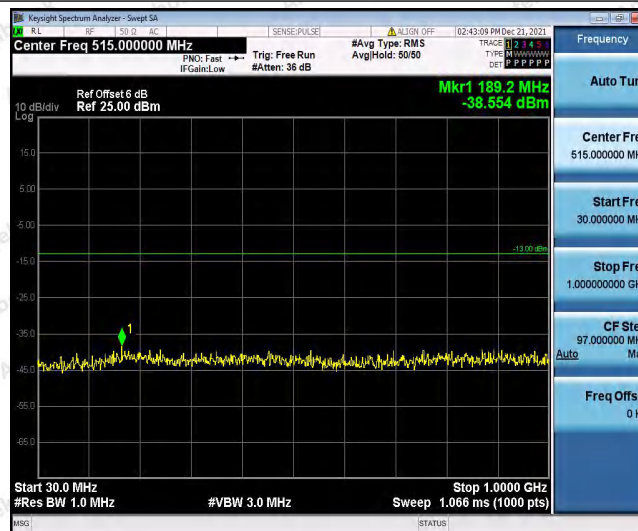

Band4-20MHz-16QAM-20300-1RB#0-Range2:1000~2000MHz

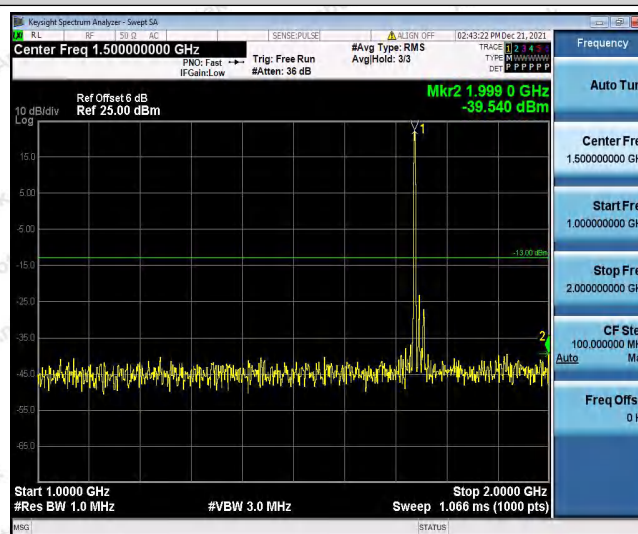


Band4-20MHz-16QAM-20300-1RB#0-Range3:2000~20000MHz

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

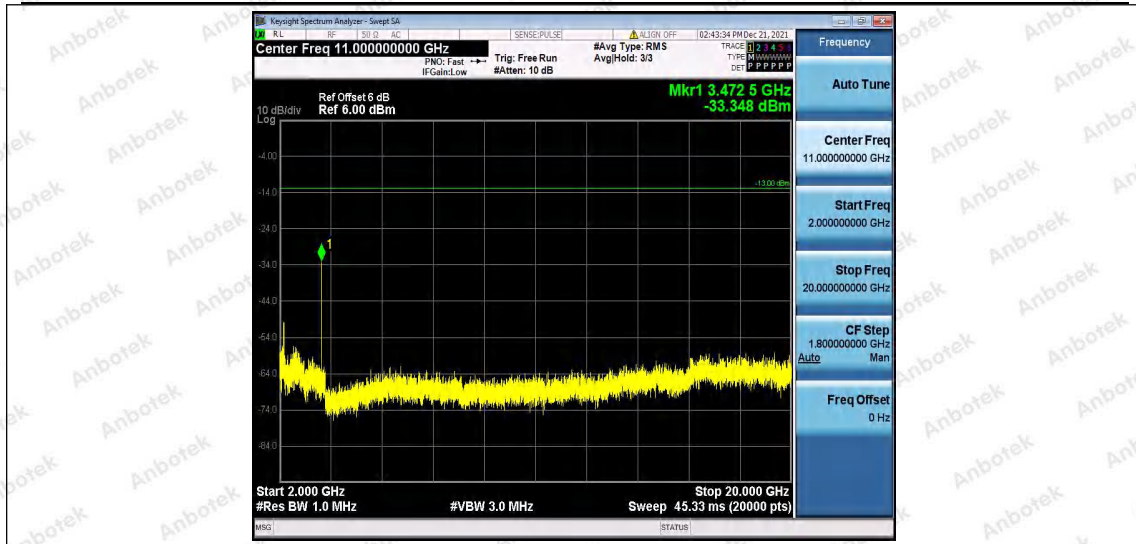

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com

Appendix F: Frequency Stability

Test Result

Voltage										
Band	Bandwidth	Modulation	Channel	RB Configure	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band4	1.4MHz	QPSK	19957	6RB#0	VL	NT	6.32	0.003694	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	VN	NT	5.95	0.003478	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	VH	NT	8.03	0.004694	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	VL	NT	-3.95	-0.002280	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	VN	NT	5.14	0.002967	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	VH	NT	-3.96	-0.002286	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	VL	NT	-5.12	-0.002919	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	VN	NT	5.44	0.003101	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	VH	NT	-5.29	-0.003015	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	VL	NT	6.04	0.003531	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	VN	NT	5.25	0.003069	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	VH	NT	4.65	0.002718	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	VL	NT	-4.61	-0.002661	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	VN	NT	-5.24	-0.003025	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	VH	NT	5.22	0.003013	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	VL	NT	-3.60	-0.002052	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	VN	NT	-6.22	-0.003546	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	VH	NT	-7.27	-0.004144	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	VL	NT	-3.62	-0.002115	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	VN	NT	6.71	0.003921	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	VH	NT	7.31	0.004271	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	VL	NT	4.26	0.002459	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	VN	NT	3.53	0.002038	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	VH	NT	3.38	0.001951	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	VL	NT	10.21	0.005823	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	VN	NT	-5.24	-0.002988	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	VH	NT	-6.91	-0.003941	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	VL	NT	4.81	0.002810	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	VN	NT	7.91	0.004622	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	VH	NT	-4.81	-0.002810	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	VL	NT	6.48	0.003740	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	VN	NT	12.56	0.007250	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	VH	NT	4.29	0.002476	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band4	3MHz	16QAM	20385	15RB#0	VL	NT	5.51	0.003142	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	VN	NT	4.88	0.002783	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	VH	NT	6.27	0.003576	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	VL	NT	5.97	0.003486	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	VN	NT	4.79	0.002797	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	VH	NT	5.08	0.002966	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	VL	NT	3.53	0.002038	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	VN	NT	3.83	0.002211	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	VH	NT	-4.76	-0.002747	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	VL	NT	-5.62	-0.003207	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	VN	NT	-5.78	-0.003298	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	VH	NT	-6.19	-0.003532	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	VL	NT	5.87	0.003428	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	VN	NT	6.31	0.003685	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	VH	NT	4.89	0.002855	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	VL	NT	3.60	0.002078	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	VN	NT	-3.83	-0.002211	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	VH	NT	6.35	0.003665	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	VL	NT	-4.55	-0.002596	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	VN	NT	-6.49	-0.003703	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	VH	NT	-4.29	-0.002448	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	VL	NT	-5.85	-0.003411	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	VN	NT	-5.49	-0.003201	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	VH	NT	-6.77	-0.003948	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	VL	NT	4.68	0.002701	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	VN	NT	4.12	0.002378	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	VH	NT	-2.66	-0.001535	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	VL	NT	5.26	0.003006	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	VN	NT	-3.23	-0.001846	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	VH	NT	5.34	0.003051	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	VL	NT	-5.82	-0.003394	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	VN	NT	-6.67	-0.003889	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	VH	NT	-5.48	-0.003195	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	VL	NT	-4.41	-0.002545	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	VN	NT	5.11	0.002949	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	VH	NT	3.29	0.001899	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	VL	NT	5.16	0.002949	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	VN	NT	3.85	0.002200	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	VH	NT	5.35	0.003057	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	VL	NT	3.99	0.002323	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	VN	NT	3.35	0.001951	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band4	15MHz	QPSK	20025	75RB#0	VH	NT	3.55	0.002067	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	VL	NT	2.13	0.001229	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	VN	NT	6.55	0.003781	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	VH	NT	-3.89	-0.002245	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	VL	NT	-4.05	-0.002318	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	VN	NT	2.79	0.001597	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	VH	NT	-4.32	-0.002472	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	VL	NT	3.25	0.001892	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	VN	NT	3.56	0.002073	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	VH	NT	2.06	0.001199	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	VL	NT	5.85	0.003377	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	VN	NT	-2.23	-0.001287	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	VH	NT	5.41	0.003123	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	VL	NT	-2.96	-0.001694	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	VN	NT	2.23	0.001276	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	VH	NT	-4.98	-0.002850	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	VL	NT	5.18	0.003012	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	VN	NT	4.12	0.002395	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	VH	NT	5.15	0.002994	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	VL	NT	-3.35	-0.001934	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	VN	NT	4.85	0.002799	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	VH	NT	9.71	0.005605	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	VL	NT	-5.14	-0.002946	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	VN	NT	-6.08	-0.003484	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	VH	NT	-4.62	-0.002648	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	VL	NT	10.84	0.006302	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	VN	NT	6.72	0.003907	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	VH	NT	3.91	0.002273	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	VL	NT	-3.15	-0.001818	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	VN	NT	9.68	0.005587	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	VH	NT	3.00	0.001732	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	VL	NT	-4.25	-0.002436	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	VN	NT	-7.30	-0.004183	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	VH	NT	-5.94	-0.003404	±2.5	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com



Hotline

400-003-0500

www.anbotech.com

Appendix G: Frequency Stability VS Temperature

Test Result

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band4	1.4MHz	QPSK	19957	6RB#0	NV	-30	4.02	0.002350	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	-20	7.07	0.004133	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	0	7.11	0.004156	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	10	6.04	0.003531	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	20	6.42	0.003753	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	-30	3.83	0.002211	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	-20	6.07	0.003504	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	0	4.42	0.002551	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	10	4.76	0.002747	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	20	-7.84	-0.004525	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	-30	-7.62	-0.004344	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	-20	-6.15	-0.003506	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	0	-4.35	-0.002480	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	10	-4.73	-0.002696	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	20	4.23	0.002411	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	-30	3.33	0.001947	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	-20	-5.38	-0.003145	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	0	-5.28	-0.003086	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	10	3.66	0.002139	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	20	4.94	0.002888	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	-30	-5.02	-0.002898	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	-20	-5.38	-0.003105	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	0	-5.95	-0.003434	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	10	6.91	0.003988	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	20	-4.26	-0.002459	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	-30	-6.71	-0.003825	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	-20	-4.45	-0.002537	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	0	-5.51	-0.003141	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	10	-7.21	-0.004110	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	20	-5.02	-0.002862	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	-30	4.05	0.002366	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	-20	-5.04	-0.002945	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	0	-2.49	-0.001455	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	10	-4.46	-0.002606	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	20	4.51	0.002635	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band4	3MHz	QPSK	20175	15RB#0	NV	-30	-2.79	-0.001610	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	-20	4.99	0.002880	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	0	6.95	0.004012	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	10	-4.45	-0.002569	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	20	3.82	0.002205	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	-30	2.73	0.001557	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	-20	-8.20	-0.004676	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	0	4.92	0.002806	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	10	3.42	0.001950	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	20	-2.70	-0.001540	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	-30	-2.75	-0.001607	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	-20	3.83	0.002238	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	0	-3.82	-0.002232	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	10	4.13	0.002413	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	20	3.38	0.001975	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	-30	5.75	0.003319	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	-20	5.68	0.003278	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	0	6.18	0.003567	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	10	2.66	0.001535	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	20	5.59	0.003227	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	-30	-2.78	-0.001585	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	-20	-3.59	-0.002047	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	0	7.25	0.004135	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	10	3.36	0.001916	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	20	5.35	0.003051	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	-30	4.43	0.002587	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	-20	4.25	0.002482	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	0	6.21	0.003626	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	10	5.85	0.003416	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	20	7.00	0.004088	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	-30	4.21	0.002430	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	-20	-4.35	-0.002511	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	0	4.28	0.002470	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	10	-3.38	-0.001951	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	20	-2.12	-0.001224	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	-30	-4.09	-0.002334	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	-20	-6.71	-0.003829	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	0	-4.43	-0.002528	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	10	-5.24	-0.002990	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	20	-4.53	-0.002585	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	-30	5.39	0.003147	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band4	5MHz	16QAM	19975	25RB#0	NV	-20	5.31	0.003101	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	0	5.78	0.003375	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	10	5.49	0.003206	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	20	4.31	0.002517	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	-30	4.45	0.002569	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	-20	2.45	0.001414	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	0	-4.79	-0.002765	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	10	-6.39	-0.003688	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	20	3.36	0.001939	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	-30	-5.11	-0.002916	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	-20	-7.64	-0.004359	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	0	-5.35	-0.003053	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	10	-7.50	-0.004280	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	20	-4.22	-0.002408	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	-30	-5.56	-0.003242	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	-20	-4.96	-0.002892	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	0	-4.26	-0.002484	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	10	-4.22	-0.002461	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	20	-7.64	-0.004455	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	-30	3.46	0.001997	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	-20	3.23	0.001864	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	0	2.98	0.001720	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	10	4.62	0.002667	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	20	4.21	0.002430	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	-30	6.25	0.003571	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	-20	3.79	0.002166	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	0	6.97	0.003983	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	10	7.08	0.004046	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	20	4.65	0.002657	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	-30	-6.47	-0.003773	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	-20	-5.81	-0.003388	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	0	-5.82	-0.003394	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	10	3.18	0.001854	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	20	-5.49	-0.003201	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	-30	2.29	0.001322	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	-20	3.55	0.002049	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	0	-3.91	-0.002257	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	10	-3.20	-0.001847	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	20	3.23	0.001864	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	-30	5.36	0.003063	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	-20	5.46	0.003120	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band4	10MHz	16QAM	20350	50RB#0	NV	0	-2.23	-0.001274	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	10	5.32	0.003040	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	20	3.99	0.002280	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	-30	3.12	0.001817	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	-20	3.09	0.001799	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	0	5.21	0.003033	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	10	-2.42	-0.001409	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	20	3.76	0.002189	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	-30	4.84	0.002794	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	-20	4.06	0.002343	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	0	-3.19	-0.001841	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	10	-4.56	-0.002632	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	20	4.99	0.002880	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	-30	5.58	0.003193	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	-20	1.56	0.000893	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	0	-5.65	-0.003233	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	10	5.28	0.003021	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	20	-2.89	-0.001654	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	-30	2.27	0.001322	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	-20	4.75	0.002766	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	0	5.14	0.002993	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	10	-3.12	-0.001817	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	20	3.71	0.002160	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	-30	-3.42	-0.001974	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	-20	4.36	0.002517	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	0	3.68	0.002124	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	10	-4.41	-0.002545	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	20	-4.13	-0.002384	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	-30	-3.50	-0.002003	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	-20	4.95	0.002833	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	0	-3.42	-0.001957	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	10	-3.15	-0.001803	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	20	5.04	0.002884	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	-30	6.57	0.003820	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	-20	4.72	0.002744	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	0	7.01	0.004076	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	10	4.72	0.002744	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	20	4.85	0.002820	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	-30	3.46	0.001997	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	-20	6.29	0.003631	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	0	4.02	0.002320	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band4	20MHz	QPSK	20175	100RB#0	NV	10	2.65	0.001530	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	20	2.35	0.001356	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	-30	-7.54	-0.004321	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	-20	-4.39	-0.002516	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	0	-5.81	-0.003330	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	10	-4.91	-0.002814	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	20	-5.99	-0.003433	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	-30	4.15	0.002413	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	-20	5.66	0.003291	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	0	4.88	0.002837	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	10	6.22	0.003616	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	20	2.52	0.001465	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	-30	6.34	0.003659	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	-20	5.34	0.003082	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	0	6.24	0.003602	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	10	3.71	0.002141	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	20	-3.35	-0.001934	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	-30	-6.15	-0.003524	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	-20	-6.85	-0.003926	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	0	-6.08	-0.003484	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	10	-5.04	-0.002888	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	20	-5.06	-0.002900	±2.5	PASS

---End---