

Band38-15MHz-QPSK-38000-1RB#0-Range2:1000~3000MHz



Band38-15MHz-QPSK-38000-1RB#0-Range3:3000~26500MHz



Band38-15MHz-QPSK-38175-1RB#0-Range1:30~1000MHz

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd

Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd

Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>



Band38-15MHz-QPSK-38175-1RB#0-Range2:1000~3000MHz



Band38-15MHz-QPSK-38175-1RB#0-Range3:3000~26500MHz



Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the “Dedicated Testing/Inspection Stamp” is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38-15MHz-16QAM-37825-1RB#0-Range1:30~1000MHz



Band38-15MHz-16QAM-37825-1RB#0-Range2:1000~3000MHz




Band38-15MHz-16QAM-37825-1RB#0-Range3:3000~26500MHz

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.



Band38-15MHz-16QAM-38000-1RB#0-Range1:30~1000MHz

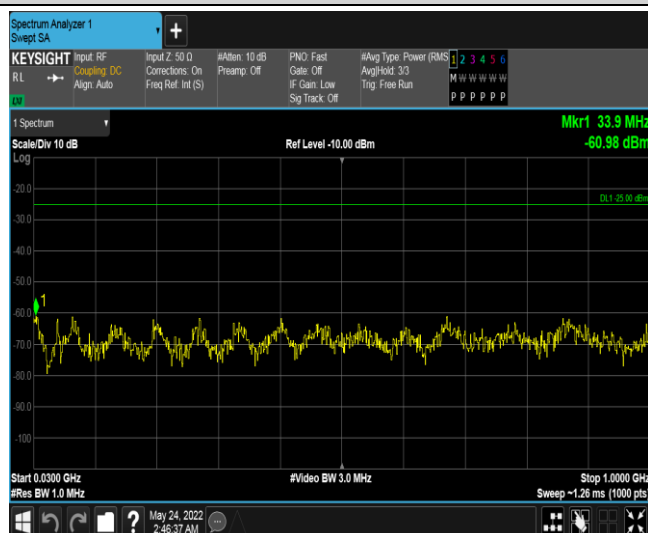

Band38-15MHz-16QAM-38000-1RB#0-Range2:1000~3000MHz



Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38-15MHz-16QAM-38000-1RB#0-Range3:3000~26500MHz



Band38-15MHz-16QAM-38175-1RB#0-Range1:30~1000MHz




Band38-15MHz-16QAM-38175-1RB#0-Range2:1000~3000MHz

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.


Attestation of Global Compliance(Shenzhen)Co., Ltd

Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd

Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>

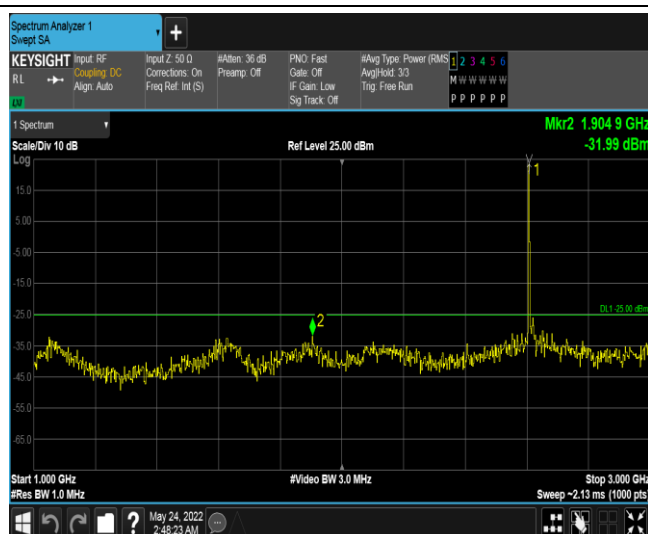

Band38-15MHz-16QAM-38175-1RB#0-Range3:3000~26500MHz

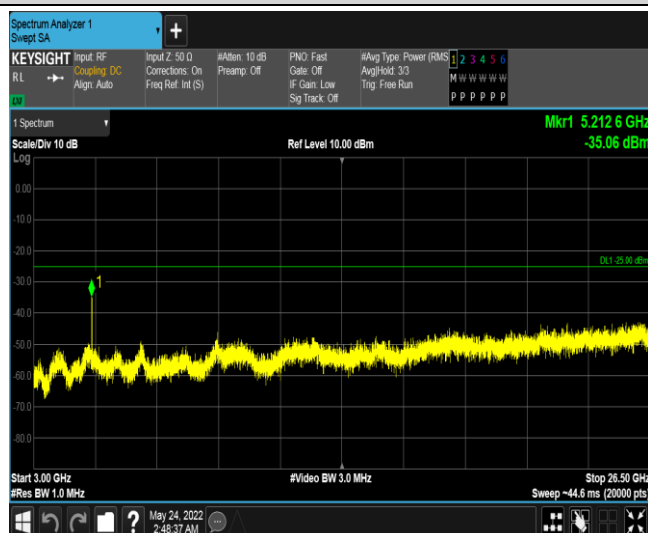


Band38-20MHz-QPSK-37850-1RB#0-Range1:30~1000MHz



Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38-20MHz-QPSK-37850-1RB#0-Range2:1000~3000MHz

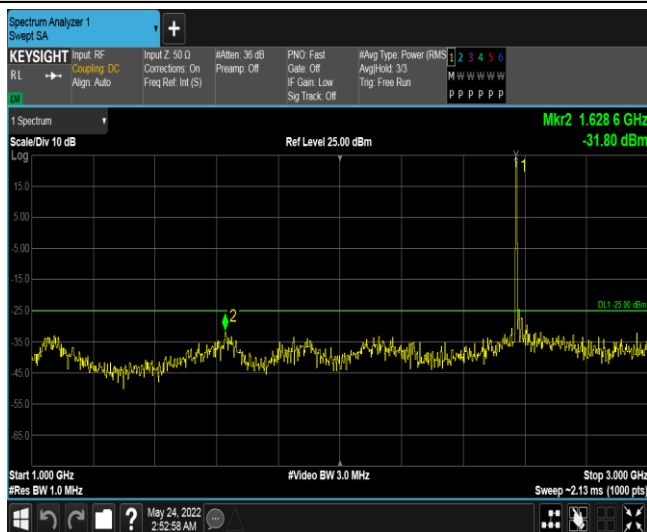

Band38-20MHz-QPSK-37850-1RB#0-Range3:3000~26500MHz




Band38-20MHz-QPSK-38000-1RB#0-Range1:30~1000MHz

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd

Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd

Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>

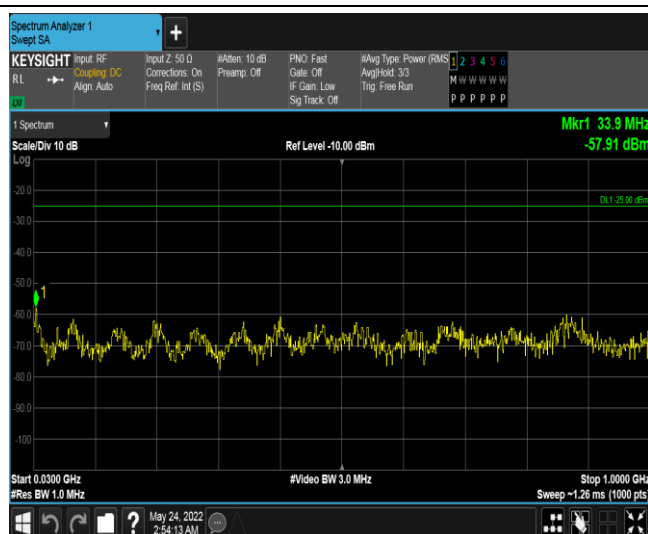

Band38-20MHz-QPSK-38000-1RB#0-Range2:1000~3000MHz



Band38-20MHz-QPSK-38000-1RB#0-Range3:3000~26500MHz



Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38-20MHz-QPSK-38150-1RB#0-Range1:30~1000MHz



Band38-20MHz-QPSK-38150-1RB#0-Range2:1000~3000MHz



Band38-20MHz-QPSK-38150-1RB#0-Range3:3000~26500MHz

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd

Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd

Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>



Band38-20MHz-16QAM-37850-1RB#0-Range1:30~1000MHz



Band38-20MHz-16QAM-37850-1RB#0-Range2:1000~3000MHz



Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd

Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd

Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>

Band38-20MHz-16QAM-37850-1RB#0-Range3:3000~26500MHz



Band38-20MHz-16QAM-38000-1RB#0-Range1:30~1000MHz




Band38-20MHz-16QAM-38000-1RB#0-Range2:1000~3000MHz

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd

Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd

Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>

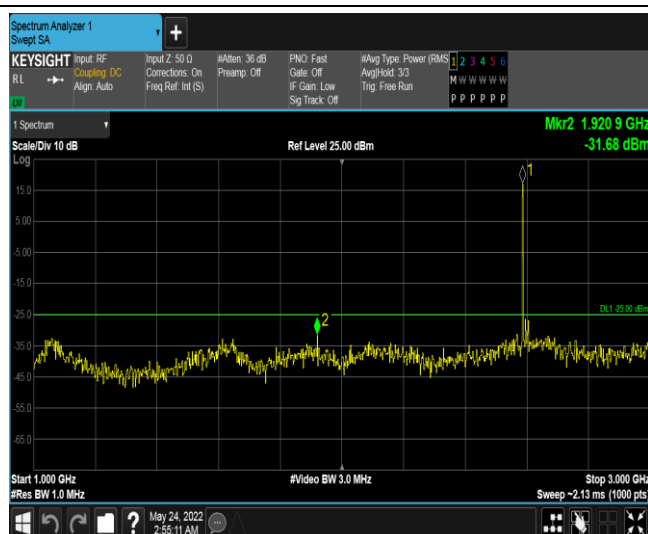

Band38-20MHz-16QAM-38000-1RB#0-Range3:3000~26500MHz



Band38-20MHz-16QAM-38150-1RB#0-Range1:30~1000MHz



Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.



Spectrum Analyzer 1
Swept SA

Input: RF	Input Z: 50 Ω	#Atten: 36 dB	PNO: Fast	#Avg Type: Power (RMS)	1 2 3 4 5 6
Coupling: DC	Corrections: On	Preamp: Off	Gate: Off	Avg/Hold: 3/3	M W W W W W
Align: Auto	Freq Ref: Int (S)		IF Gain: Low	Trig: Free Run	P P P P P P
			Sig Track: Off		

1 Spectrum

Scale/Div 10 dB

Ref Level 25.00 dBm

Log

Mkr2 2.7197 GHz -31.28 dBm

Start 1.000 GHz #Video BW 3.0 MHz Stop 3.000 GHz

Res BW 1.0 MHz Sweep ~2.13 ms (1000 pts)

The screenshot shows the Keysight Spectrum Analyzer interface. The top panel displays various settings: Input RF, Coupling DC, Align Auto, Input Z: 50 Ω, Corrections: On, Freq Ref: Int (S), #Atten: 10 dB, Presamp: Off, PNO: Fast, Gate: Off, IF Gain: Low, Sp Track: Off, #Avg Type: Power (RMS), Avg/Hold: 3/3, Trig: Free Run, and a 6-point histogram showing M W W W W W and P P P P P P. The main display shows a spectrum plot with a yellow trace. A green horizontal line is drawn at -30.31 dBm, and a green vertical line marks a spur at 5.2032 GHz. The plot is labeled 'Scale/Div 10 dB', 'Ref Level 10.00 dBm', 'Log', and 'Div1: 25.00 dBm'. The bottom status bar shows 'Start 3.00 GHz', '#Res BW 1.0 MHz', '#Video BW 3.0 MHz', 'Stop 28.50 GHz', and 'Sweep ~44.6 ms (20000 pts)'.

Attestation of Global Compliance(Shenzhen)Co., Ltd
Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd
Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>

Appendix F: Frequency Stability

Test Result

Voltage										
Band	Bandwidth	Modulation	Channel	RB Configure	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band38	5MHz	QPSK	37775	25RB#0	VL	NT	9.58	0.003724	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	VN	NT	-11.54	-0.004486	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	VH	NT	9.57	0.003720	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	VL	NT	-30.68	-0.011823	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	VN	NT	-13.86	-0.005341	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	VH	NT	-6.28	-0.002420	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	VL	NT	4.49	0.001715	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	VN	NT	17.78	0.006793	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	VH	NT	-4.89	-0.001868	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	VL	NT	7.64	0.002970	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	VN	NT	17.05	0.006628	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	VH	NT	9.06	0.003522	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	VL	NT	-22.50	-0.008671	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	VN	NT	-11.69	-0.004505	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	VH	NT	-5.99	-0.002308	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	VL	NT	31.54	0.012050	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	VN	NT	31.31	0.011962	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	VH	NT	42.94	0.016405	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	VL	NT	-22.99	-0.008928	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	VN	NT	-21.24	-0.008249	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	VH	NT	-13.55	-0.005262	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	VL	NT	-13.30	-0.005125	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	VN	NT	-18.24	-0.007029	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	VH	NT	-21.13	-0.008143	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	VL	NT	-19.00	-0.007266	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	VN	NT	-18.51	-0.007078	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	VH	NT	-17.62	-0.006738	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	VL	NT	-13.46	-0.005227	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	VN	NT	-17.34	-0.006734	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	VH	NT	-25.56	-0.009926	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	VL	NT	-9.48	-0.003653	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	VN	NT	-13.13	-0.005060	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	VH	NT	-11.04	-0.004254	±2.5	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd

Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd

Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>

Band38	10MHz	16QAM	38200	50RB#0	VL	NT	-22.87	-0.008746	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	VN	NT	-27.24	-0.010417	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	VH	NT	-18.41	-0.007040	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	VL	NT	-20.90	-0.008109	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	VN	NT	-8.23	-0.003193	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	VH	NT	-11.90	-0.004617	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	VL	NT	-7.95	-0.003064	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	VN	NT	-18.24	-0.007029	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	VH	NT	-14.28	-0.005503	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	VL	NT	-19.91	-0.007621	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	VN	NT	-21.87	-0.008371	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	VH	NT	-9.38	-0.003590	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	VL	NT	-14.76	-0.005726	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	VN	NT	-20.80	-0.008070	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	VH	NT	-12.42	-0.004819	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	VL	NT	-13.63	-0.005252	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	VN	NT	-10.41	-0.004012	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	VH	NT	-14.55	-0.005607	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	VL	NT	-11.26	-0.004310	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	VN	NT	-16.98	-0.006500	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	VH	NT	-17.29	-0.006618	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	VL	NT	-21.50	-0.008333	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	VN	NT	-10.46	-0.004054	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	VH	NT	-25.46	-0.009868	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	VL	NT	-17.07	-0.006578	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	VN	NT	-20.61	-0.007942	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	VH	NT	-11.06	-0.004262	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	VL	NT	-16.29	-0.006241	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	VN	NT	-20.91	-0.008011	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	VH	NT	-13.22	-0.005065	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	VL	NT	-19.58	-0.007589	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	VN	NT	-19.41	-0.007523	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	VH	NT	-15.44	-0.005984	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	VL	NT	-19.78	-0.007622	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	VN	NT	-15.78	-0.006081	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	VH	NT	-11.53	-0.004443	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	VL	NT	-23.20	-0.008889	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	VN	NT	-18.74	-0.007180	±2.5	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd

Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd

Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>

Band38	20MHz	16QAM	38150	100RB#0	VH	NT	-14.16	-0.005425	±2.5	PASS
--------	-------	-------	-------	---------	----	----	--------	-----------	------	------

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configure	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band38	5MHz	QPSK	37775	25RB#0	NV	-30	13.55	0.005267	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	-20	12.35	0.004801	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	0	10.50	0.004082	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	10	16.58	0.006445	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	20	19.48	0.007572	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	-30	-21.27	-0.008197	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	-20	-19.81	-0.007634	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	0	-20.06	-0.007730	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	10	-25.59	-0.009861	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	20	-23.78	-0.009164	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	-30	16.47	0.006292	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	-20	4.63	0.001769	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	0	20.01	0.007645	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	10	31.24	0.011935	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	20	20.59	0.007866	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	-30	22.07	0.008579	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	-20	21.33	0.008292	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	0	22.66	0.008809	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	10	13.59	0.005283	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	20	24.72	0.009609	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	-30	-21.84	-0.008416	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	-20	-24.49	-0.009437	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	0	-6.17	-0.002378	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	10	-21.30	-0.008208	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	20	-19.48	-0.007507	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	-30	30.33	0.011587	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	-20	45.55	0.017402	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	0	37.35	0.014269	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	10	39.54	0.015106	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	20	43.24	0.016520	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	-30	-9.97	-0.003872	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	-20	-28.44	-0.011045	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	0	-19.45	-0.007553	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	10	-16.54	-0.006423	±2.5	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd

Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd

Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>

Band38	10MHz	QPSK	37800	50RB#0	NV	20	-16.29	-0.006326	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	-30	-18.04	-0.006952	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	-20	-24.58	-0.009472	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	0	-15.92	-0.006135	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	10	-14.12	-0.005441	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	20	-21.43	-0.008258	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	-30	-9.51	-0.003637	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	-20	-21.10	-0.008069	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	0	-16.88	-0.006455	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	10	-25.09	-0.009595	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	20	-20.91	-0.007996	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	-30	-18.63	-0.007235	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	-20	-12.80	-0.004971	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	0	-21.56	-0.008373	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	10	-17.34	-0.006734	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	20	-18.18	-0.007060	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	-30	-13.39	-0.005160	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	-20	-11.74	-0.004524	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	0	-11.04	-0.004254	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	10	-13.30	-0.005125	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	20	-24.40	-0.009403	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	-30	-17.97	-0.006872	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	-20	-21.74	-0.008314	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	0	-17.09	-0.006535	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	10	-12.50	-0.004780	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	20	-16.89	-0.006459	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	-30	-21.09	-0.008182	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	-20	-24.22	-0.009397	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	0	-19.01	-0.007375	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	10	-18.30	-0.007100	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	20	-20.36	-0.007899	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	-30	-20.96	-0.008077	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	-20	-15.32	-0.005904	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	0	-11.77	-0.004536	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	10	-25.96	-0.010004	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	20	-12.85	-0.004952	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	-30	-22.63	-0.008662	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	-20	-12.76	-0.004884	±2.5	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd

Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd

Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>

Band38	15MHz	QPSK	38175	75RB#0	NV	0	-17.87	-0.006840	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	10	-15.68	-0.006002	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	20	-16.85	-0.006450	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	-30	-21.17	-0.008213	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	-20	-15.01	-0.005823	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	0	-18.51	-0.007181	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	10	-15.16	-0.005882	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	20	-23.56	-0.009141	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	-30	-19.58	-0.007545	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	-20	-17.51	-0.006748	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	0	-12.67	-0.004882	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	10	-16.74	-0.006451	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	20	-8.38	-0.003229	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	-30	-15.91	-0.006090	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	-20	-14.66	-0.005611	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	0	-15.09	-0.005776	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	10	-25.59	-0.009795	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	20	-23.10	-0.008842	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	-30	-16.95	-0.006570	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	-20	-16.99	-0.006585	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	0	-6.94	-0.002690	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	10	-19.94	-0.007729	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	20	-16.32	-0.006326	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	-30	-20.54	-0.007915	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	-20	-9.87	-0.003803	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	0	-15.55	-0.005992	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	10	-20.51	-0.007904	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	20	-17.62	-0.006790	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	-30	-16.18	-0.006199	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	-20	-15.95	-0.006111	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	0	-21.10	-0.008084	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	10	-14.12	-0.005410	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	20	-21.54	-0.008253	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	-30	-15.19	-0.005888	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	-20	-24.18	-0.009372	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	0	-21.39	-0.008291	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	10	-16.59	-0.006430	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	20	-17.65	-0.006841	±2.5	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd

Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd

Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>

Band38	20MHz	16QAM	38000	100RB#0	NV	-30	-13.38	-0.005156	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	-20	-13.42	-0.005171	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	0	-19.08	-0.007353	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	10	-11.77	-0.004536	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	20	-11.87	-0.004574	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	-30	-19.35	-0.007414	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	-20	-17.71	-0.006785	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	0	-12.83	-0.004916	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	10	-12.63	-0.004839	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	20	-10.44	-0.004000	±2.5	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd

Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd

Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>