




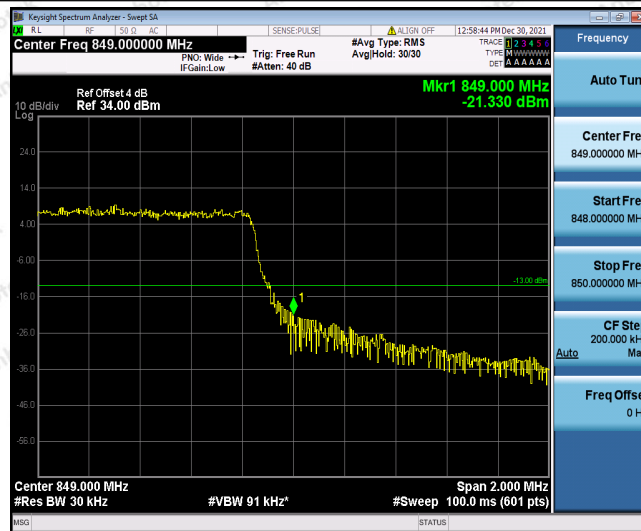

Band5-3MHz-QPSK-20415-1RB#0

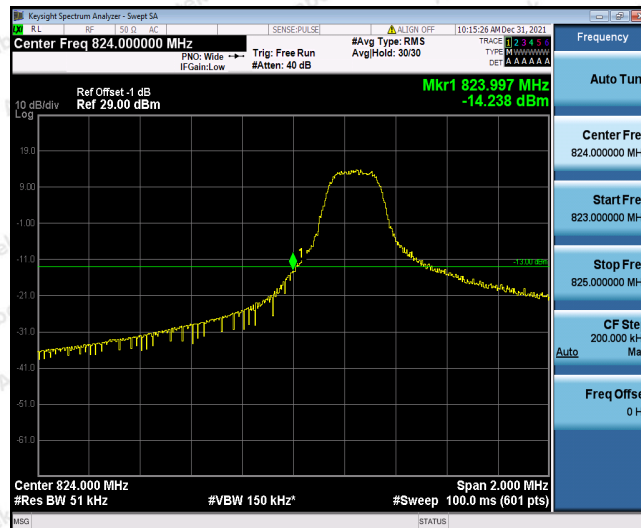

Band5-3MHz-QPSK-20415-1RB#14

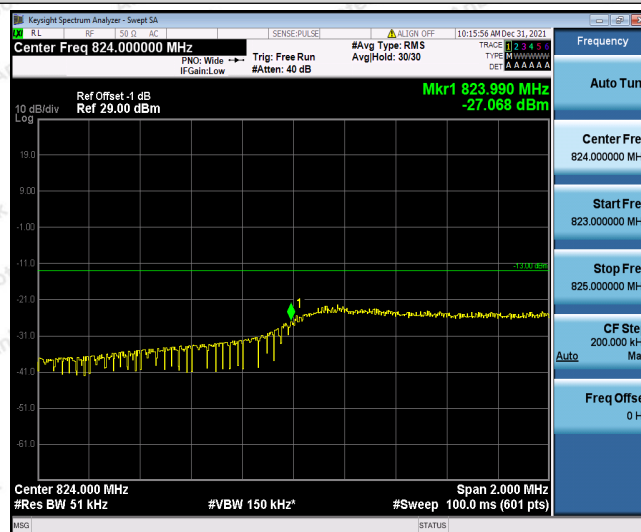

Band5-3MHz-QPSK-20415-15RB#0

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com




Hotline

400-003-0500


www.anbotech.com

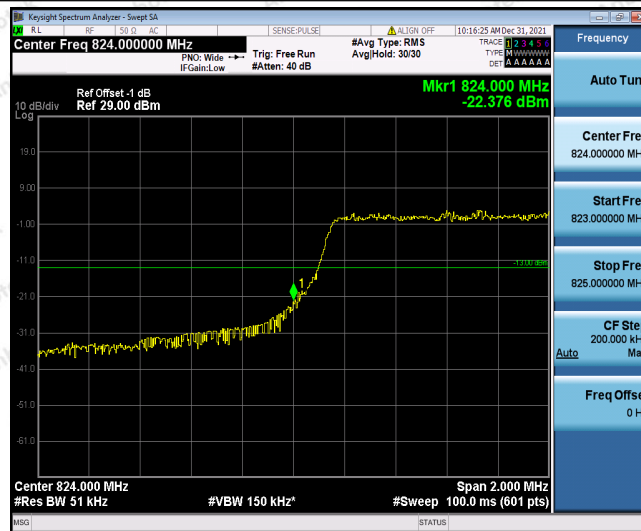

Band5-3MHz-QPSK-20635-1RB#0

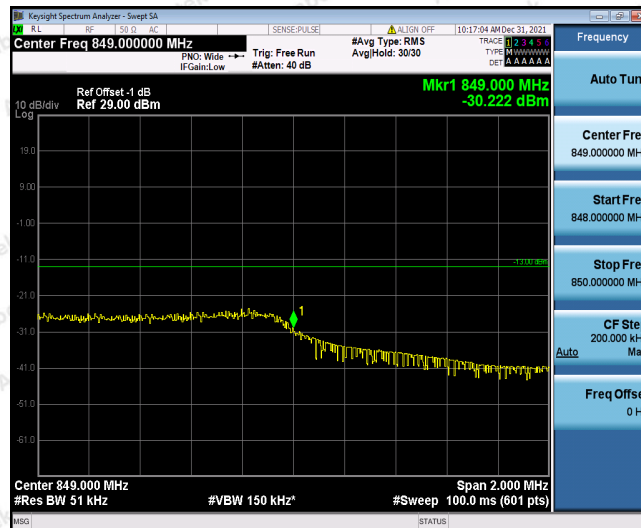

Band5-3MHz-QPSK-20635-1RB#14

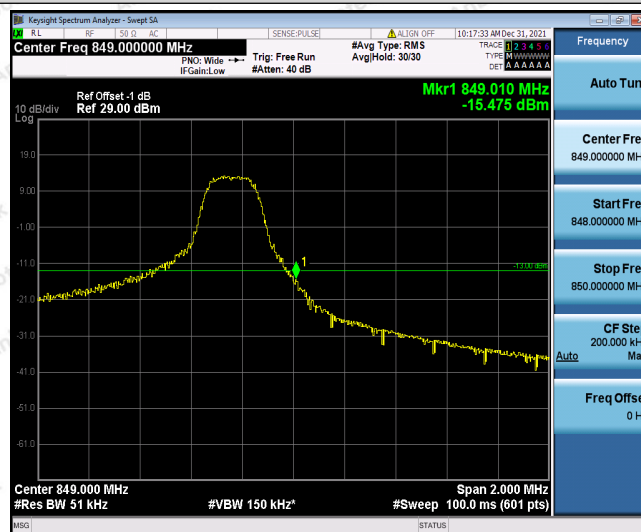

Band5-3MHz-QPSK-20635-15RB#0

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com




Hotline

400-003-0500


www.anbotech.com



Band5-3MHz-16QAM-20415-1RB#0

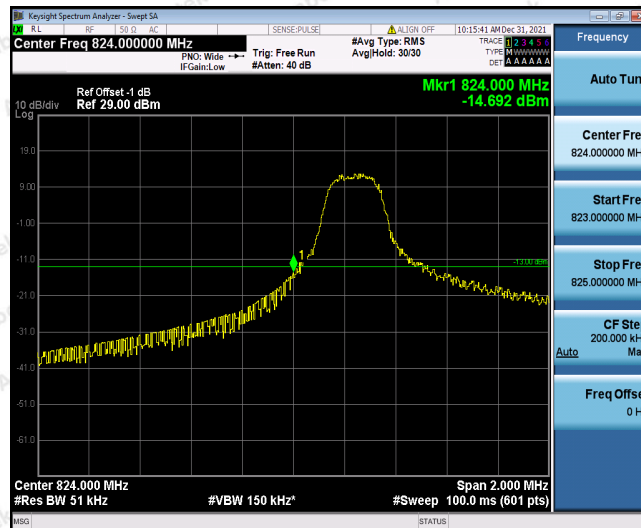

Band5-3MHz-16QAM-20415-1RB#14

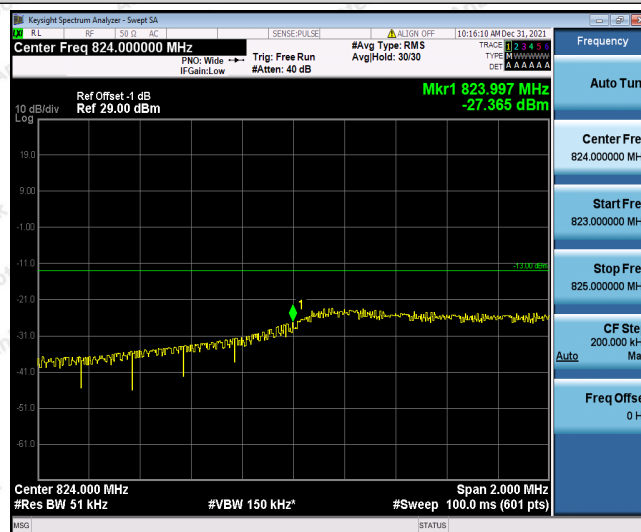

Band5-3MHz-16QAM-20415-15RB#0

Shenzhen Anbotech Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com



Band5-3MHz-16QAM-20635-1RB#0

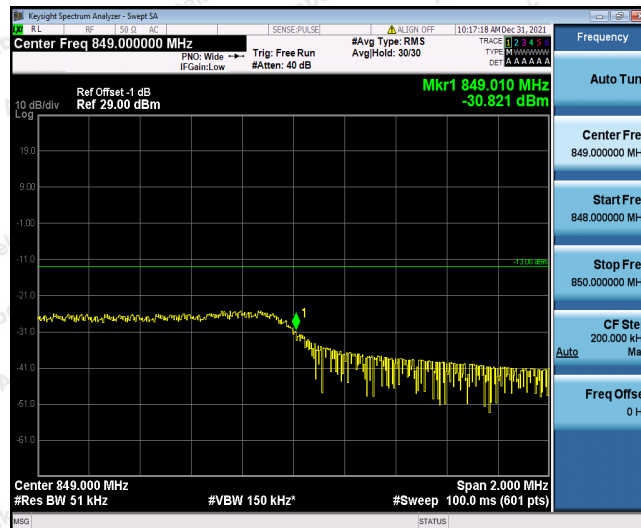

Band5-3MHz-16QAM-20635-1RB#14

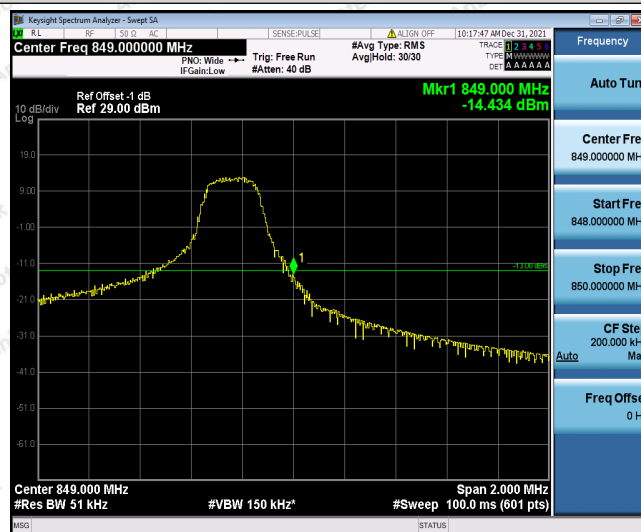

Band5-3MHz-16QAM-20635-15RB#0

Shenzhen Anbotech Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com



Band5-5MHz-QPSK-20425-1RB#0

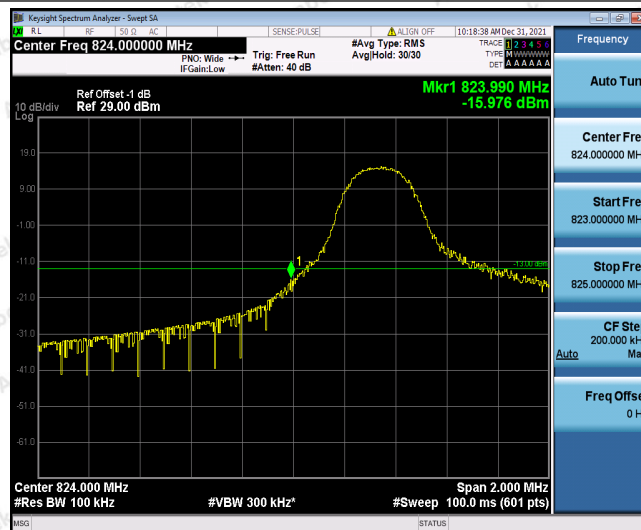

Band5-5MHz-QPSK-20425-1RB#24

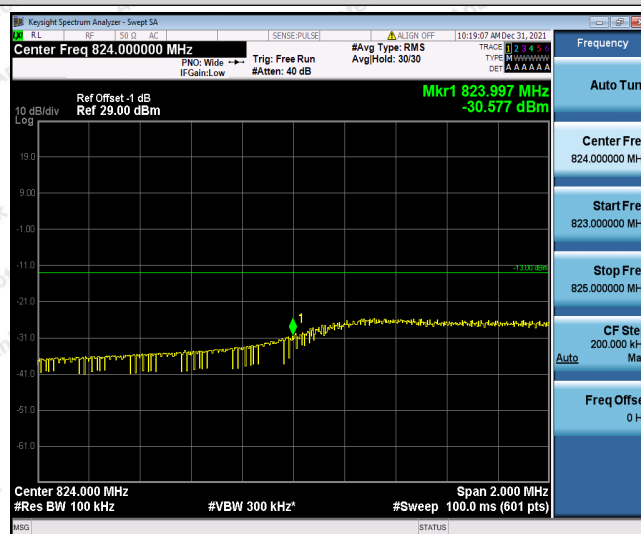


Band5-5MHz-QPSK-20425-25RB#0

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

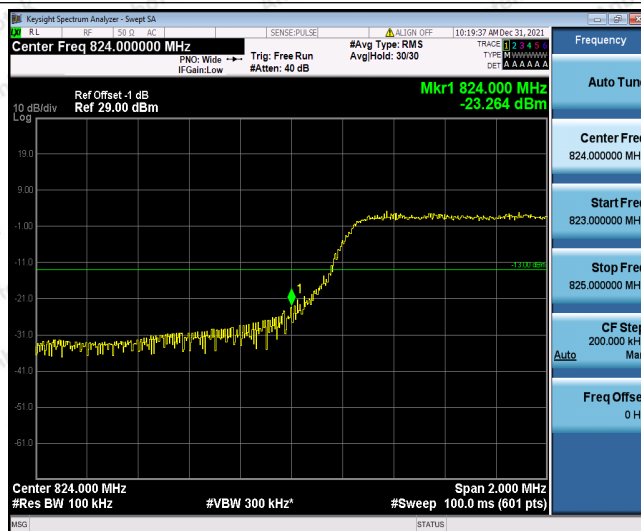

Band5-5MHz-QPSK-20625-1RB#0

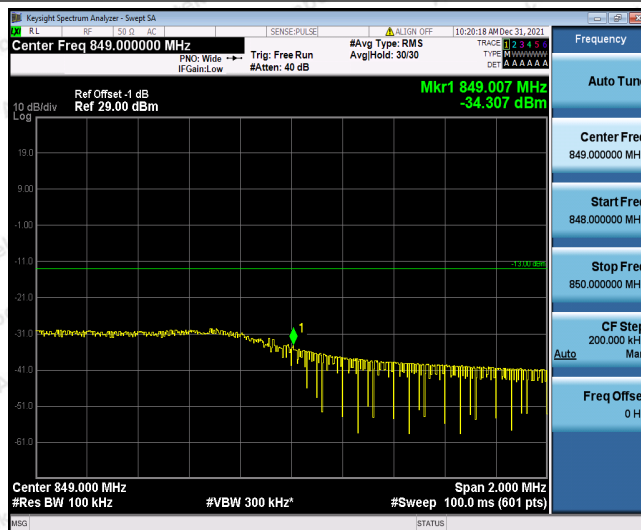

Band5-5MHz-QPSK-20625-1RB#24

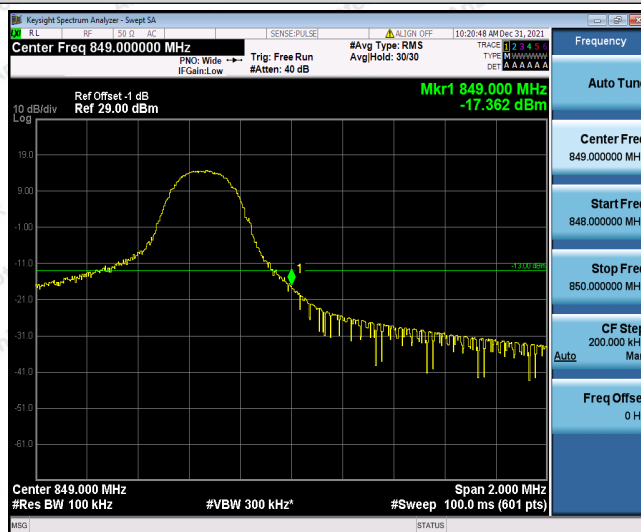

Band5-5MHz-QPSK-20625-25RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com



Band5-5MHz-16QAM-20425-1RB#0

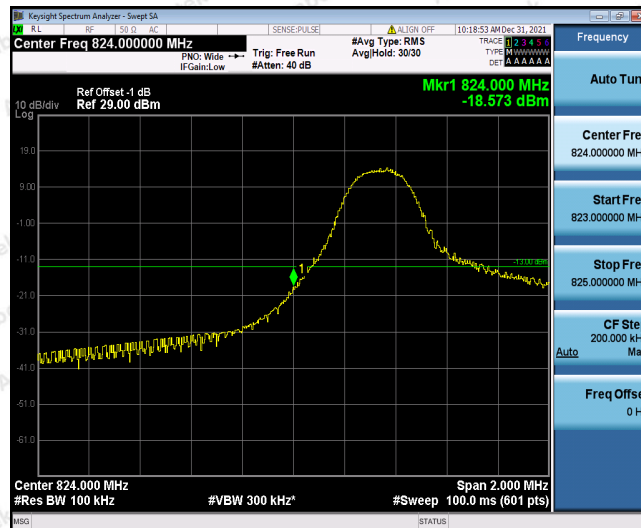

Band5-5MHz-16QAM-20425-1RB#24

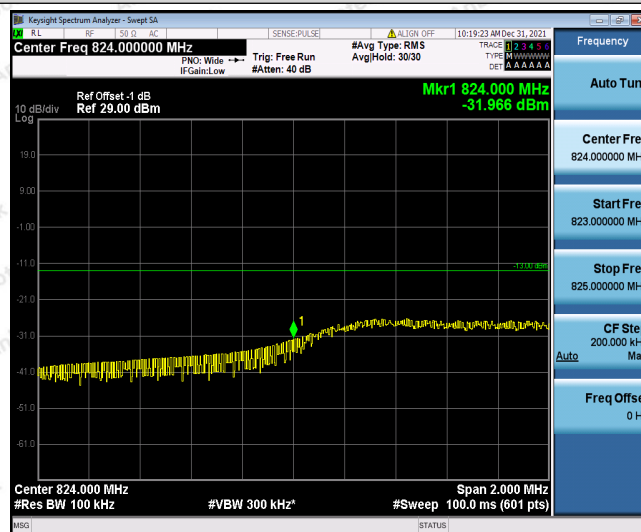

Band5-5MHz-16QAM-20425-25RB#0

Shenzhen Anbotech Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com



Band5-5MHz-16QAM-20625-1RB#0

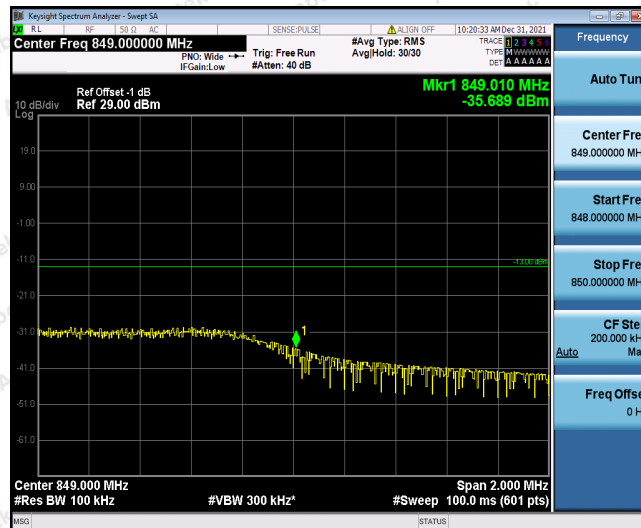

Band5-5MHz-16QAM-20625-1RB#24

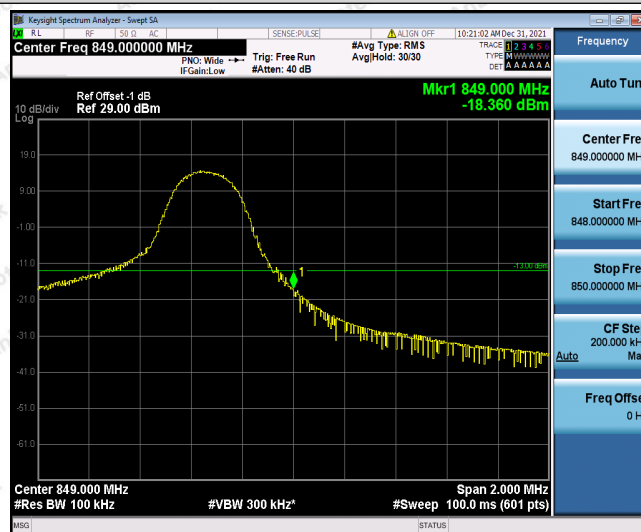

Band5-5MHz-16QAM-20625-25RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com



Band5-10MHz-QPSK-20450-1RB#0

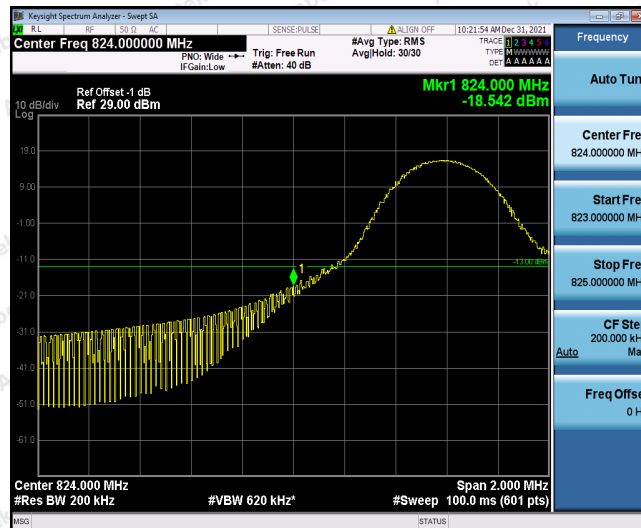

Band5-10MHz-QPSK-20450-1RB#49

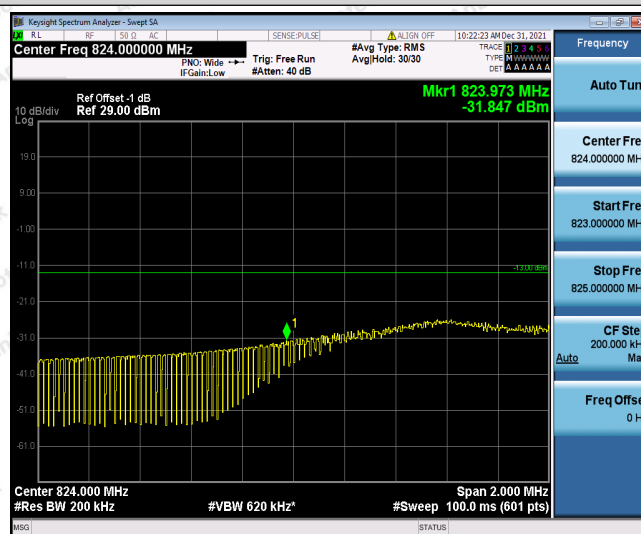

Band5-10MHz-QPSK-20450-50RB#0

Shenzhen Anbotech Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com



Band5-10MHz-QPSK-20600-1RB#0

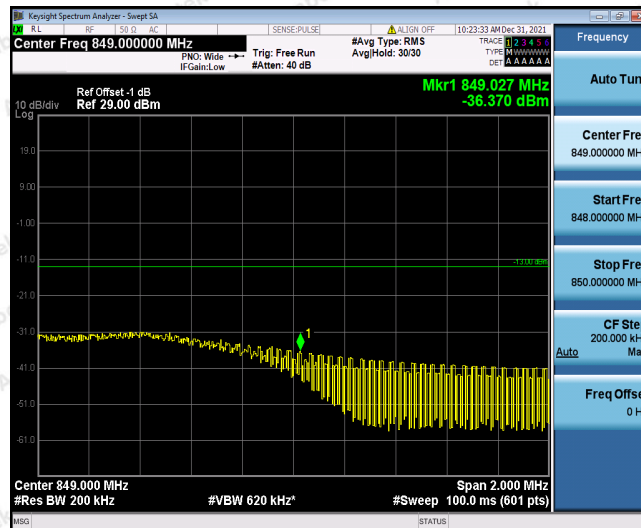

Band5-10MHz-QPSK-20600-1RB#49

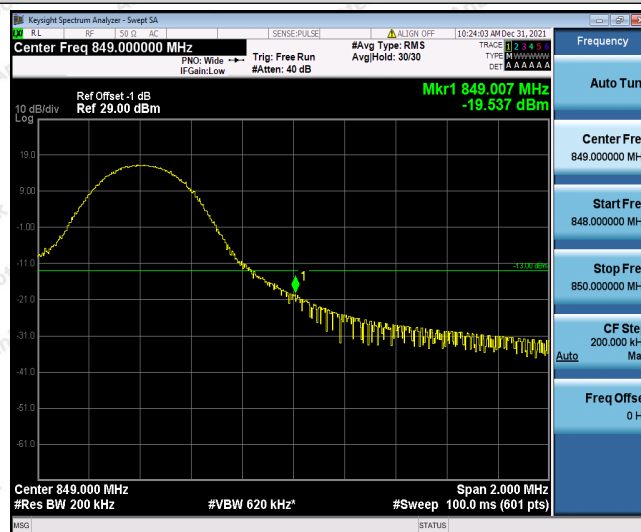

Band5-10MHz-QPSK-20600-50RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com



Band5-10MHz-16QAM-20450-1RB#0

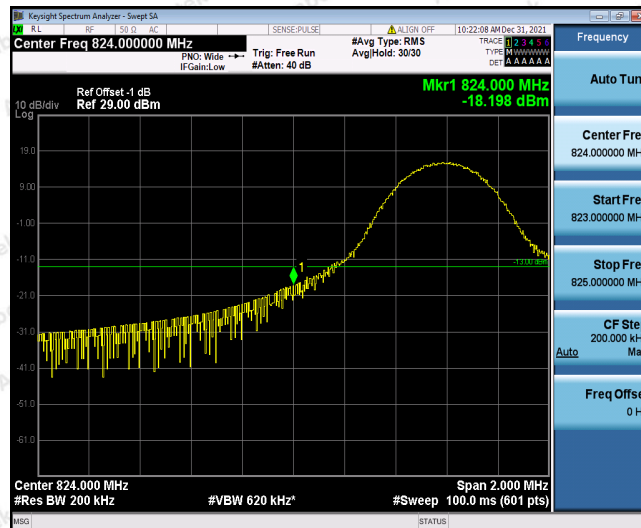

Band5-10MHz-16QAM-20450-1RB#49

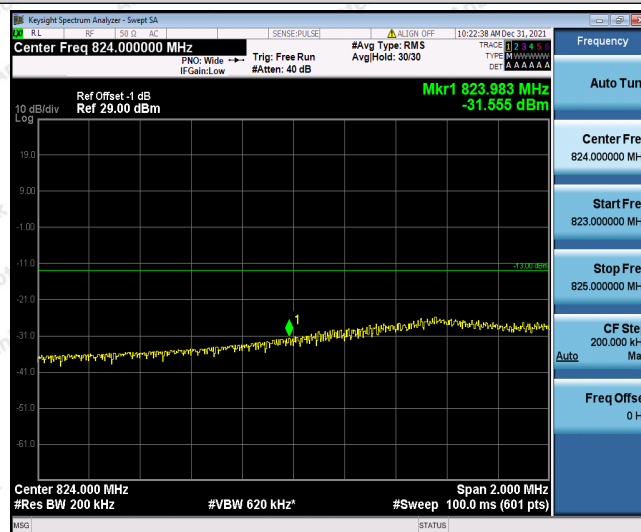


Band5-10MHz-16QAM-20450-50RB#0

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

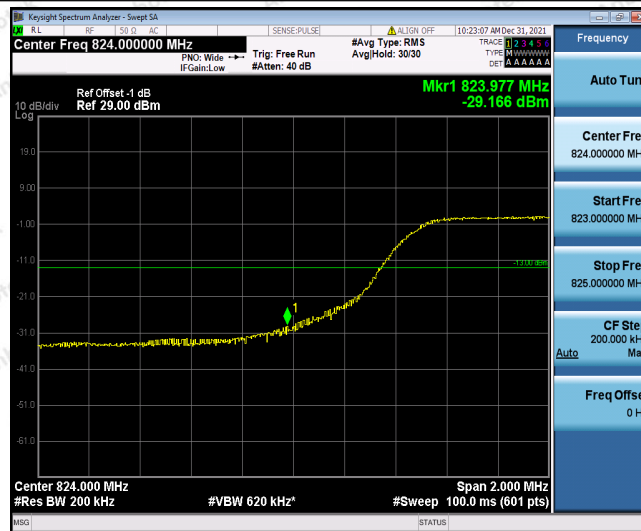

Band5-10MHz-16QAM-20600-1RB#0

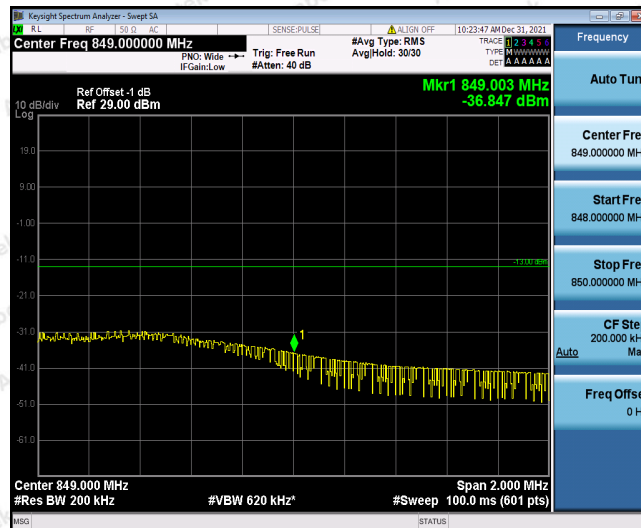

Band5-10MHz-16QAM-20600-1RB#49

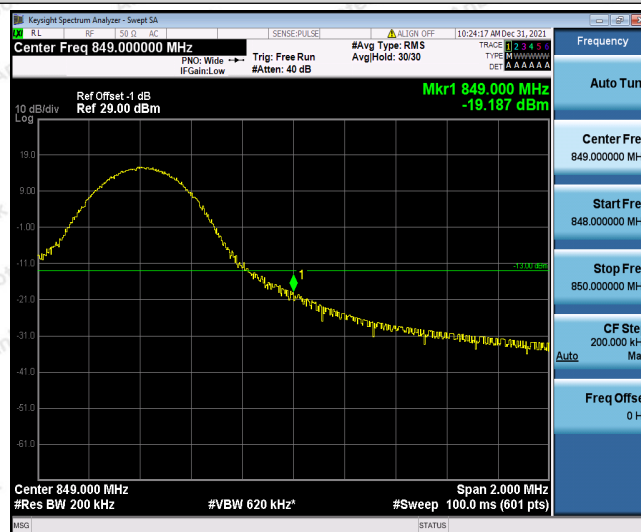

Band5-10MHz-16QAM-20600-50RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

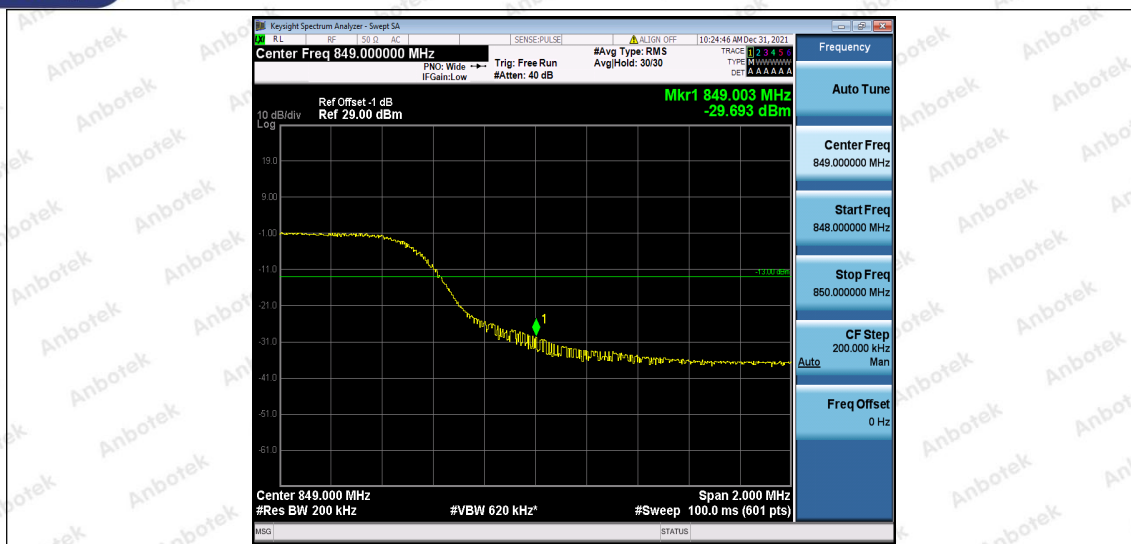

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

Appendix E: Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band5	1.4MHz	QPSK	20407	1RB#0	Range1:30~1000MHz	-56.09	PASS
Band5	1.4MHz	QPSK	20407	1RB#0	Range2:1000~10000MHz	-28.46	PASS
Band5	1.4MHz	QPSK	20525	1RB#0	Range1:30~1000MHz	-55.72	PASS
Band5	1.4MHz	QPSK	20525	1RB#0	Range2:1000~10000MHz	-27	PASS
Band5	1.4MHz	QPSK	20643	1RB#0	Range1:30~1000MHz	-56.09	PASS
Band5	1.4MHz	QPSK	20643	1RB#0	Range2:1000~10000MHz	-31.68	PASS
Band5	1.4MHz	16QAM	20407	1RB#0	Range1:30~1000MHz	-55.98	PASS
Band5	1.4MHz	16QAM	20407	1RB#0	Range2:1000~10000MHz	-26.87	PASS
Band5	1.4MHz	16QAM	20525	1RB#0	Range1:30~1000MHz	-56.38	PASS
Band5	1.4MHz	16QAM	20525	1RB#0	Range2:1000~10000MHz	-27.69	PASS
Band5	1.4MHz	16QAM	20643	1RB#0	Range1:30~1000MHz	-56.19	PASS
Band5	1.4MHz	16QAM	20643	1RB#0	Range2:1000~10000MHz	-32.88	PASS
Band5	3MHz	QPSK	20415	1RB#0	Range1:30~1000MHz	-56.16	PASS
Band5	3MHz	QPSK	20415	1RB#0	Range2:1000~10000MHz	-29.11	PASS
Band5	3MHz	QPSK	20525	1RB#0	Range1:30~1000MHz	-56.61	PASS
Band5	3MHz	QPSK	20525	1RB#0	Range2:1000~10000MHz	-27.9	PASS
Band5	3MHz	QPSK	20635	1RB#0	Range1:30~1000MHz	-56.19	PASS
Band5	3MHz	QPSK	20635	1RB#0	Range2:1000~10000MHz	-29.36	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band5	3MHz	16QAM	20415	1RB#0	Range1:30~1000MHz	-55.97	PASS
Band5	3MHz	16QAM	20415	1RB#0	Range2:1000~10000MHz	-29.27	PASS
Band5	3MHz	16QAM	20525	1RB#0	Range1:30~1000MHz	-56.07	PASS
Band5	3MHz	16QAM	20525	1RB#0	Range2:1000~10000MHz	-28.13	PASS
Band5	3MHz	16QAM	20635	1RB#0	Range1:30~1000MHz	-56.71	PASS
Band5	3MHz	16QAM	20635	1RB#0	Range2:1000~10000MHz	-31.27	PASS
Band5	5MHz	QPSK	20425	1RB#0	Range1:30~1000MHz	-56.25	PASS
Band5	5MHz	QPSK	20425	1RB#0	Range2:1000~10000MHz	-28.11	PASS
Band5	5MHz	QPSK	20525	1RB#0	Range1:30~1000MHz	-56.8	PASS
Band5	5MHz	QPSK	20525	1RB#0	Range2:1000~10000MHz	-27.25	PASS
Band5	5MHz	QPSK	20625	1RB#0	Range1:30~1000MHz	-56.39	PASS
Band5	5MHz	QPSK	20625	1RB#0	Range2:1000~10000MHz	-28.78	PASS
Band5	5MHz	16QAM	20425	1RB#0	Range1:30~1000MHz	-56.28	PASS
Band5	5MHz	16QAM	20425	1RB#0	Range2:1000~10000MHz	-30.82	PASS
Band5	5MHz	16QAM	20525	1RB#0	Range1:30~1000MHz	-56.37	PASS
Band5	5MHz	16QAM	20525	1RB#0	Range2:1000~10000MHz	-29.54	PASS
Band5	5MHz	16QAM	20625	1RB#0	Range1:30~1000MHz	-56.9	PASS
Band5	5MHz	16QAM	20625	1RB#0	Range2:1000~10000MHz	-29.66	PASS
Band5	10MHz	QPSK	20450	1RB#0	Range1:30~1000MHz	-55.9	PASS
Band5	10MHz	QPSK	20450	1RB#0	Range2:1000~10000MHz	-28.62	PASS
Band5	10MHz	QPSK	20525	1RB#0	Range1:30~1000MHz	-56.34	PASS
Band5	10MHz	QPSK	20525	1RB#0	Range2:1000~10000MHz	-31.35	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline


400-003-0500

www.anbotek.com

Band5	10MHz	QPSK	20600	1RB#0	Range1:30~1000MHz	-56.24	PASS
Band5	10MHz	QPSK	20600	1RB#0	Range2:1000~10000MHz	-25.91	PASS
Band5	10MHz	16QAM	20450	1RB#0	Range1:30~1000MHz	-56.13	PASS
Band5	10MHz	16QAM	20450	1RB#0	Range2:1000~10000MHz	-28.53	PASS
Band5	10MHz	16QAM	20525	1RB#0	Range1:30~1000MHz	-56.1	PASS
Band5	10MHz	16QAM	20525	1RB#0	Range2:1000~10000MHz	-32.26	PASS
Band5	10MHz	16QAM	20600	1RB#0	Range1:30~1000MHz	-57.09	PASS
Band5	10MHz	16QAM	20600	1RB#0	Range2:1000~10000MHz	-27.62	PASS

Test Graphs

Band5-1.4MHz-QPSK-20407-1RB#0-Range1:30~1000MHz

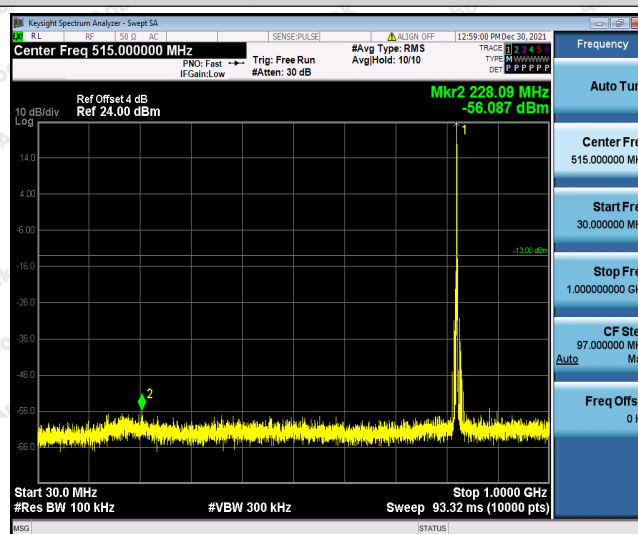

Band5-1.4MHz-QPSK-20407-1RB#0-Range2:1000~10000MHz

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com




Hotline

400-003-0500


www.anbotech.com

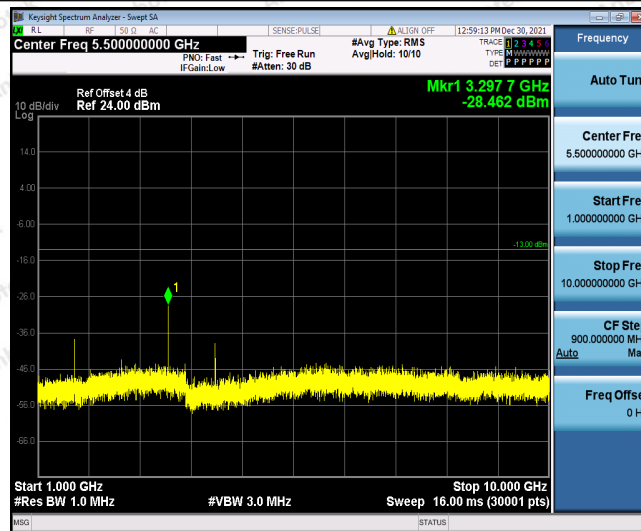

Band5-1.4MHz-QPSK-20525-1RB#0-Range1:30~1000MHz

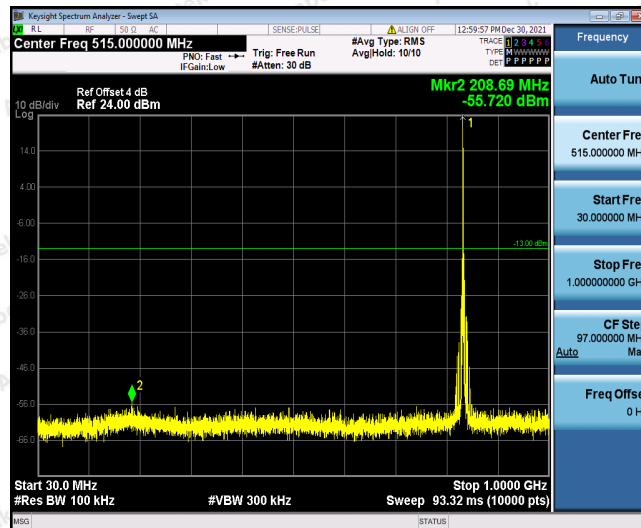

Band5-1.4MHz-QPSK-20525-1RB#0-Range2:1000~10000MHz

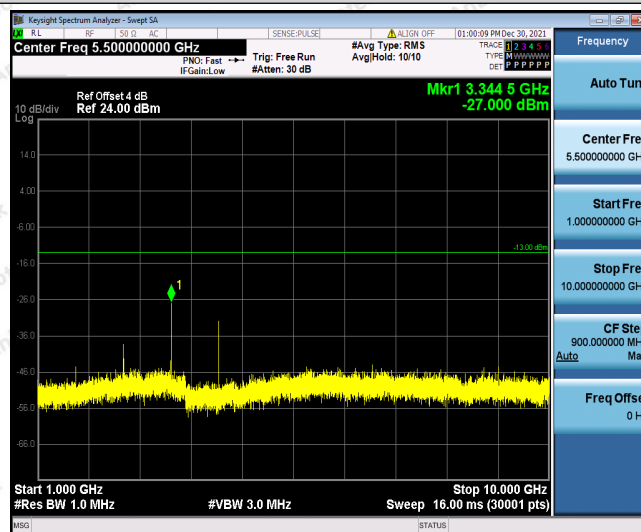

Band5-1.4MHz-QPSK-20643-1RB#0-Range1:30~1000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

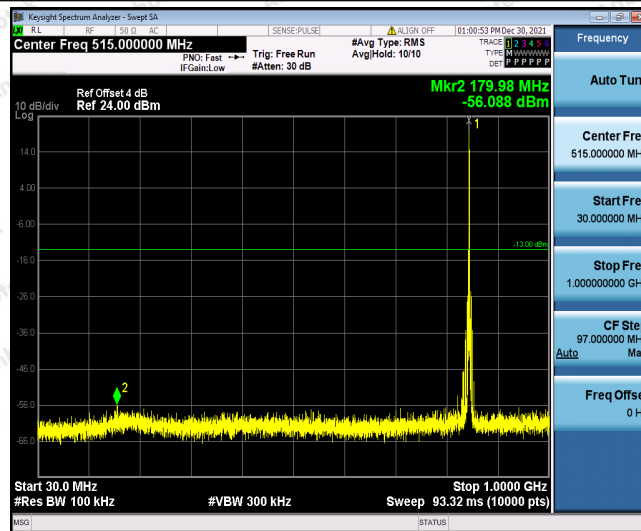

Band5-1.4MHz-QPSK-20643-1RB#0-Range2:1000~10000MHz

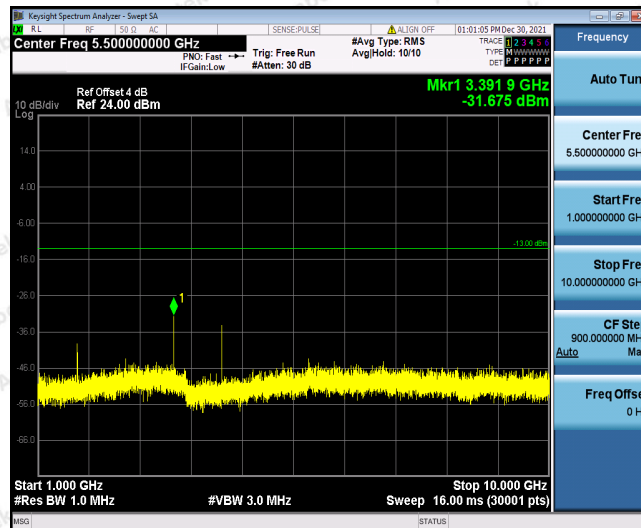

Band5-1.4MHz-16QAM-20407-1RB#0-Range1:30~1000MHz

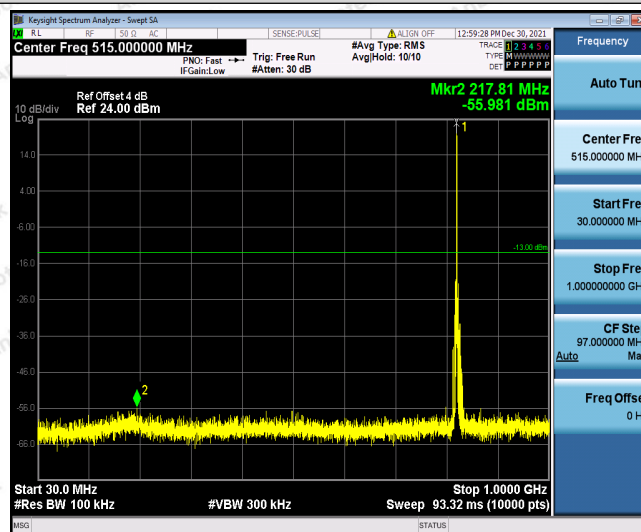

Band5-1.4MHz-16QAM-20407-1RB#0-Range2:1000~10000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

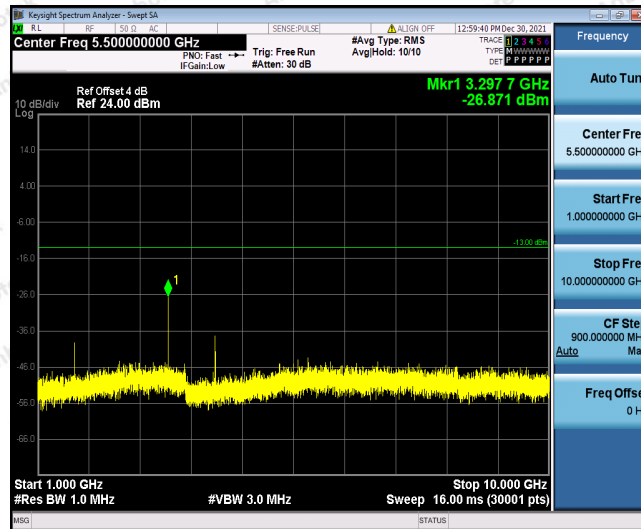

Band5-1.4MHz-16QAM-20525-1RB#0-Range1:30~1000MHz

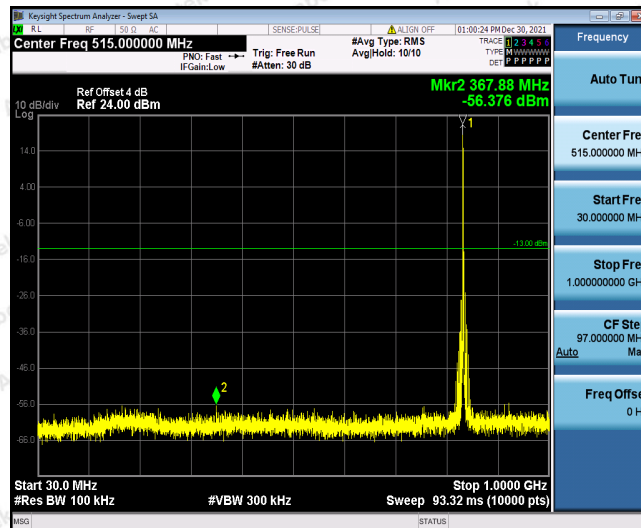

Band5-1.4MHz-16QAM-20525-1RB#0-Range2:1000~10000MHz

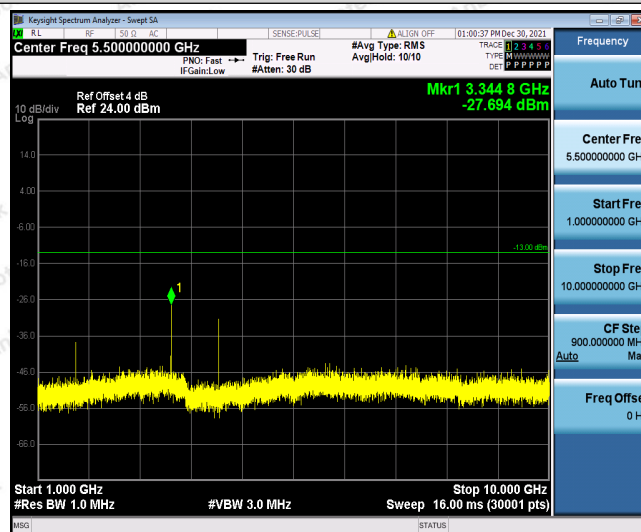


Band5-1.4MHz-16QAM-20643-1RB#0-Range1:30~1000MHz

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

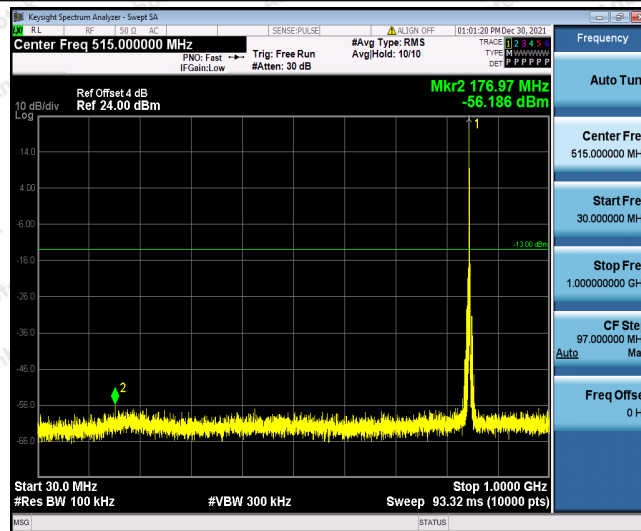

Band5-1.4MHz-16QAM-20643-1RB#0-Range2:1000~10000MHz

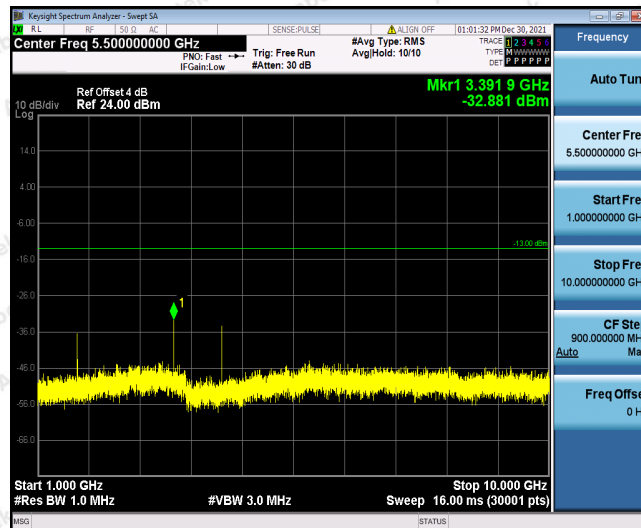

Band5-3MHz-QPSK-20415-1RB#0-Range1:30~1000MHz

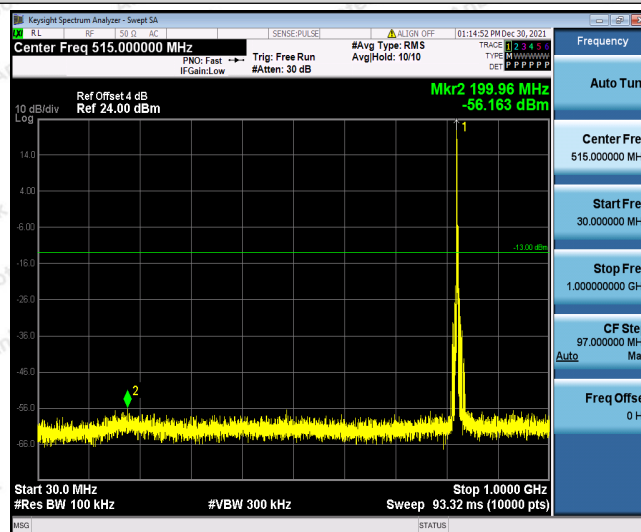

Band5-3MHz-QPSK-20415-1RB#0-Range2:1000~10000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

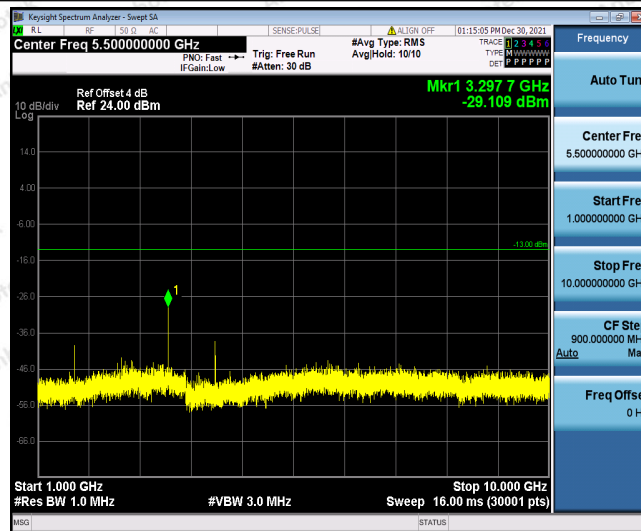

Band5-3MHz-QPSK-20525-1RB#0-Range1:30~1000MHz

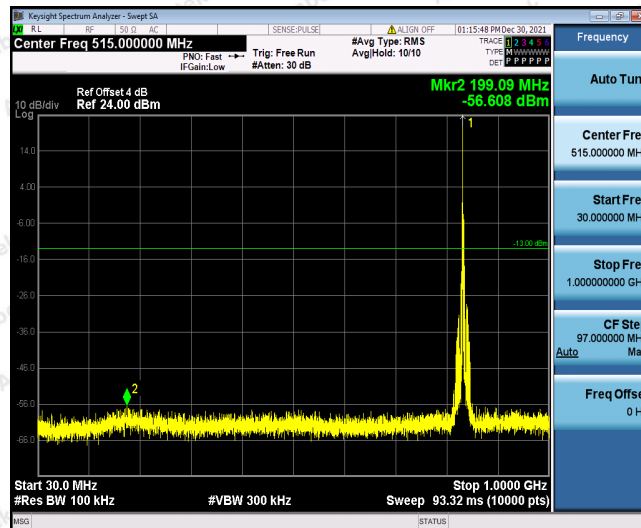

Band5-3MHz-QPSK-20525-1RB#0-Range2:1000~10000MHz

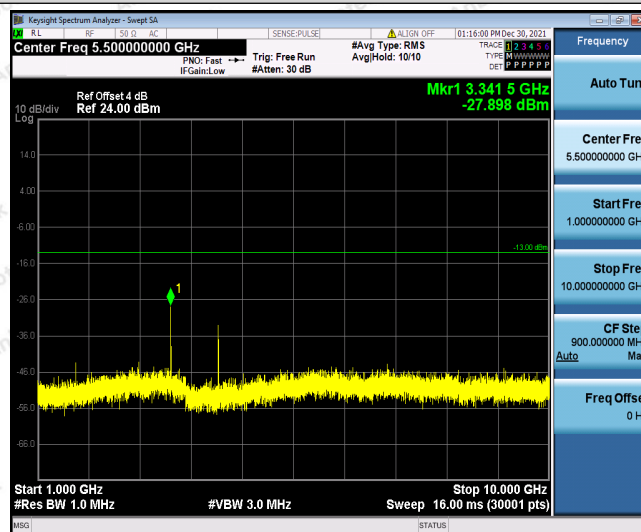

Band5-3MHz-QPSK-20635-1RB#0-Range1:30~1000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

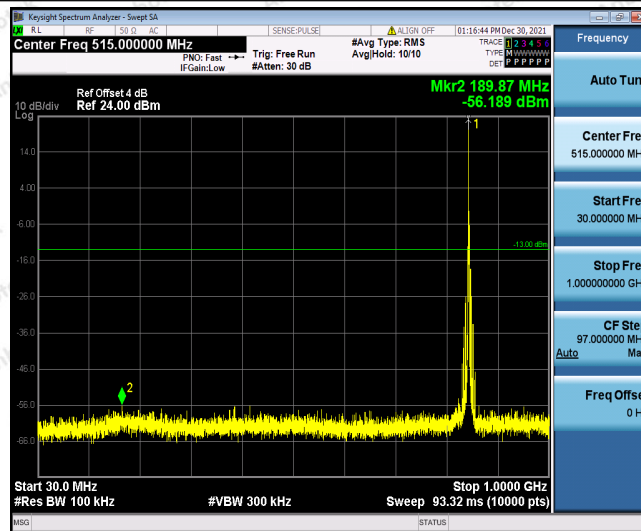

Band5-3MHz-QPSK-20635-1RB#0-Range2:1000~10000MHz

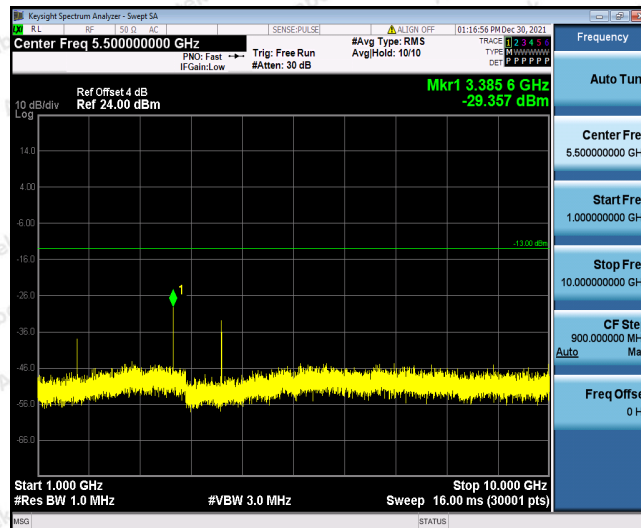

Band5-3MHz-16QAM-20415-1RB#0-Range1:30~1000MHz

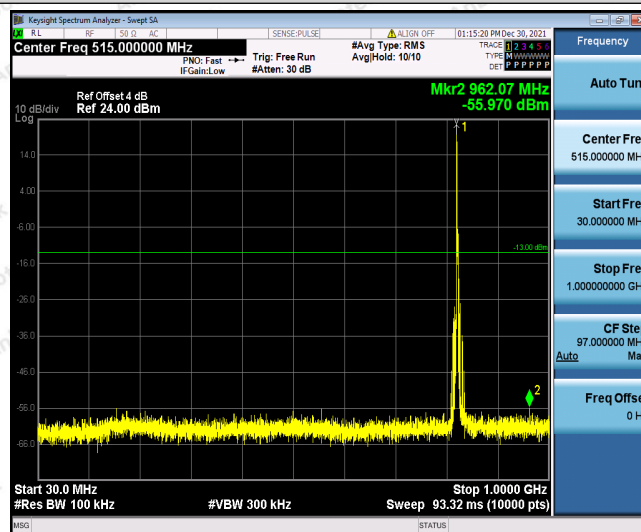


Band5-3MHz-16QAM-20415-1RB#0-Range2:1000~10000MHz

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

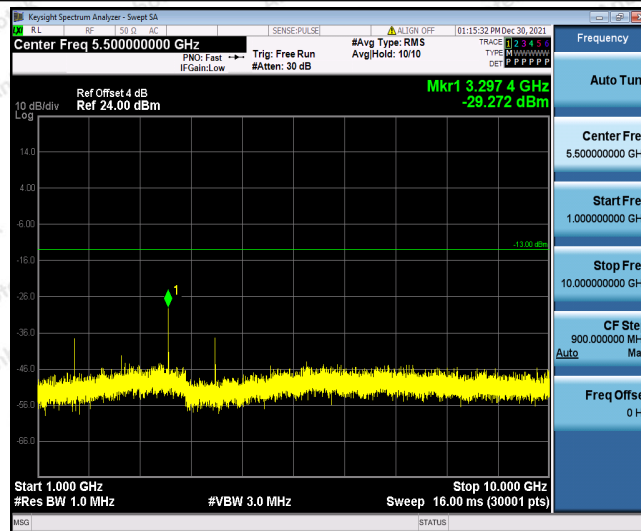

Band5-3MHz-16QAM-20525-1RB#0-Range1:30~1000MHz

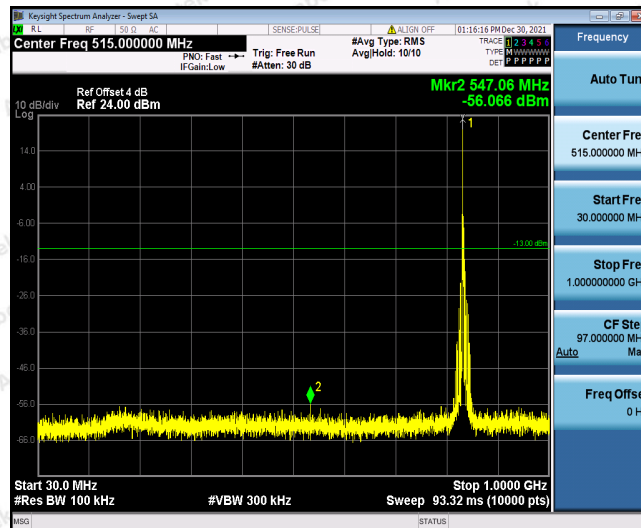

Band5-3MHz-16QAM-20525-1RB#0-Range2:1000~10000MHz

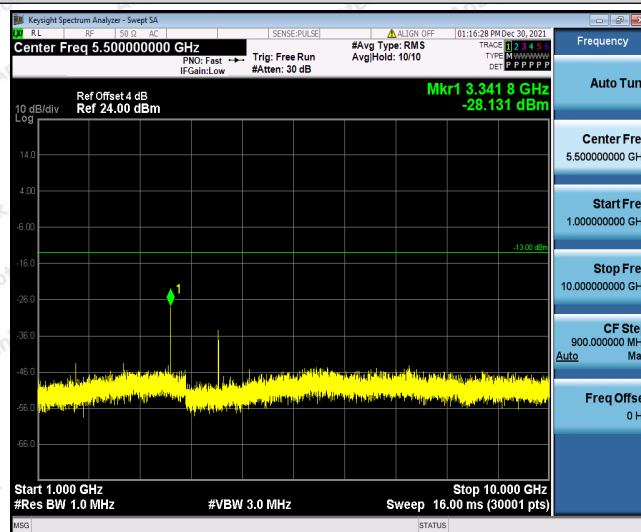


Band5-3MHz-16QAM-20635-1RB#0-Range1:30~1000MHz

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

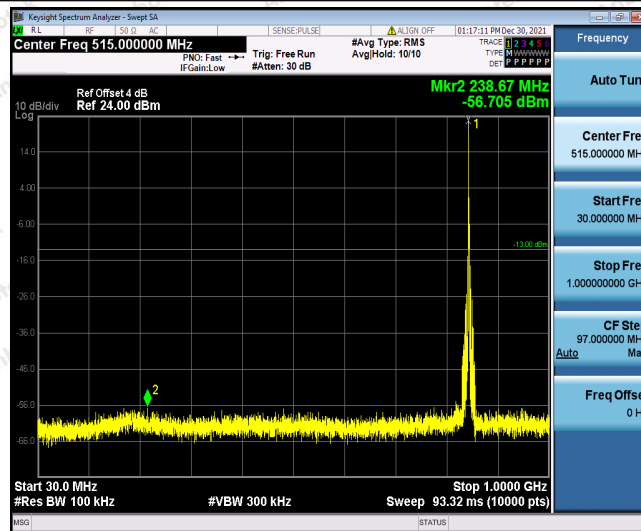

Band5-3MHz-16QAM-20635-1RB#0-Range2:1000~10000MHz

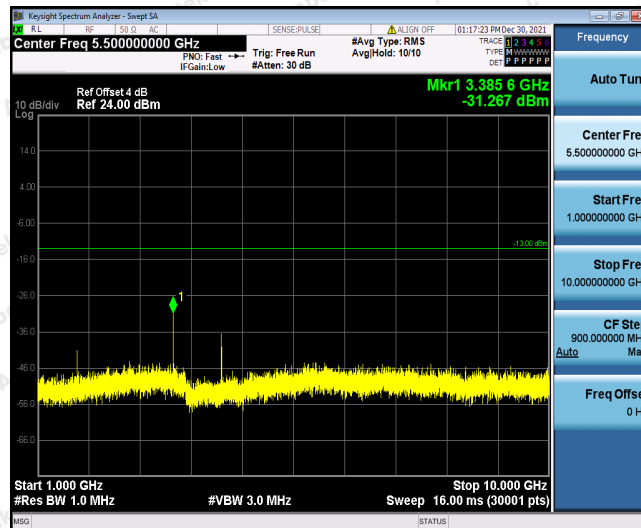

Band5-5MHz-QPSK-20425-1RB#0-Range1:30~1000MHz

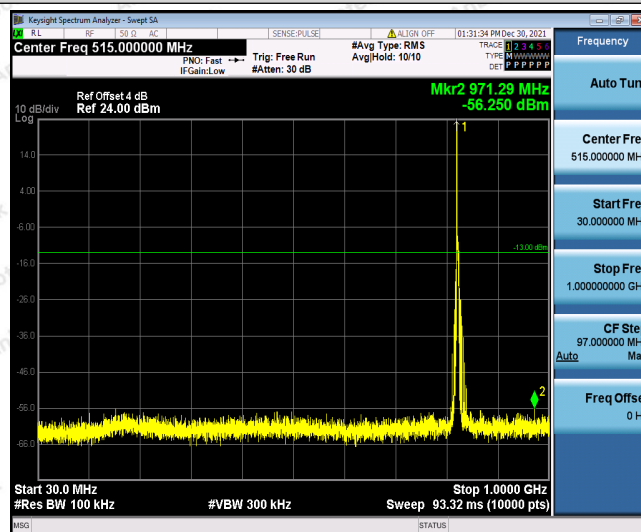


Band5-5MHz-QPSK-20425-1RB#0-Range2:1000~10000MHz

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

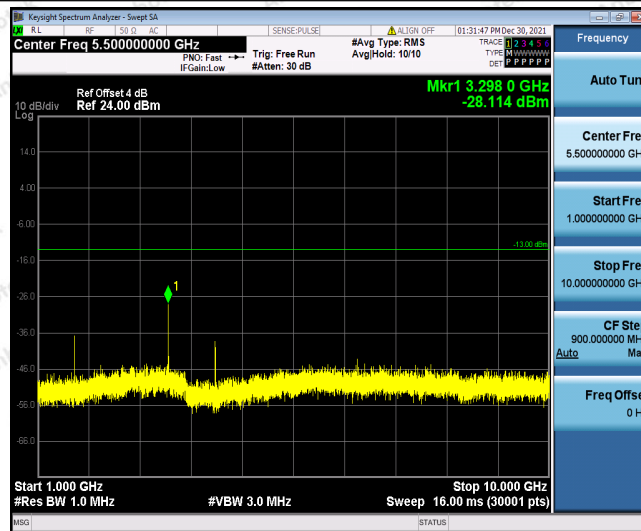

Band5-5MHz-QPSK-20525-1RB#0-Range1:30~1000MHz

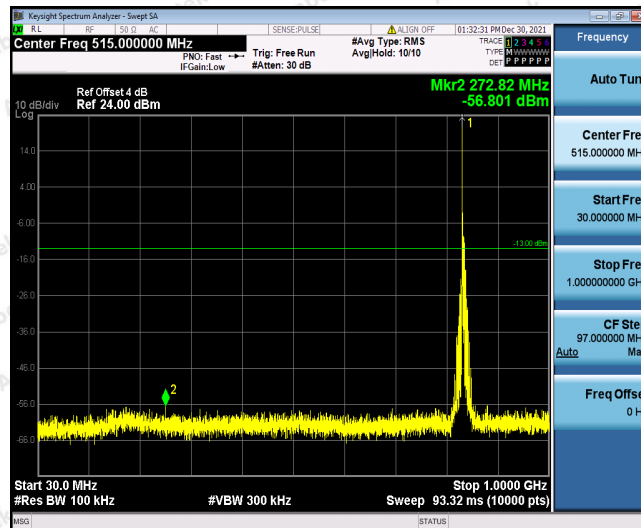

Band5-5MHz-QPSK-20525-1RB#0-Range2:1000~10000MHz

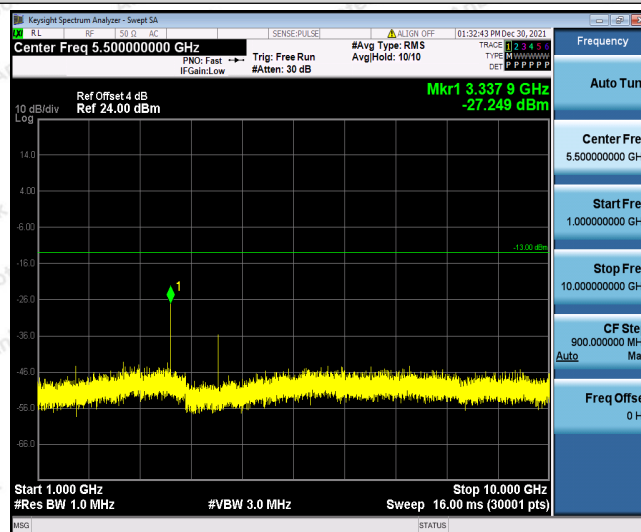

Band5-5MHz-QPSK-20625-1RB#0-Range1:30~1000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

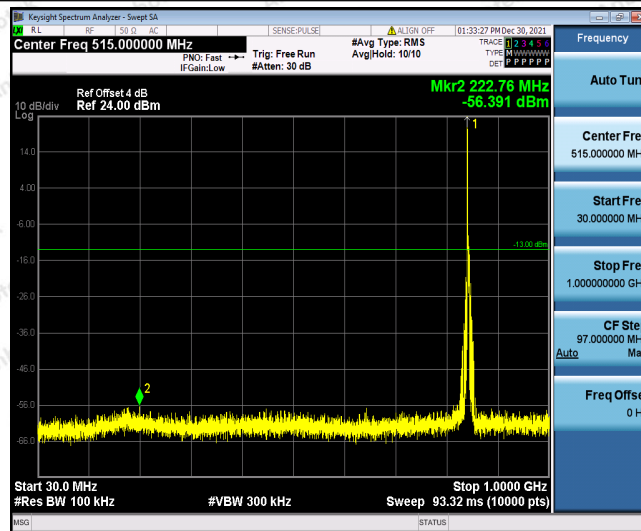

Band5-5MHz-QPSK-20625-1RB#0-Range2:1000~10000MHz

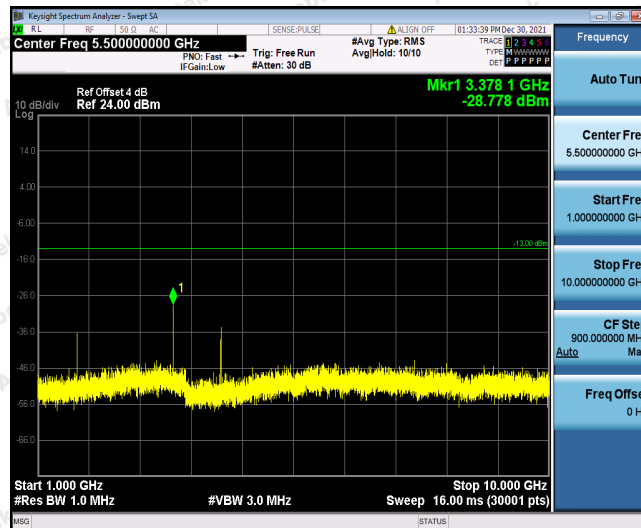

Band5-5MHz-16QAM-20425-1RB#0-Range1:30~1000MHz

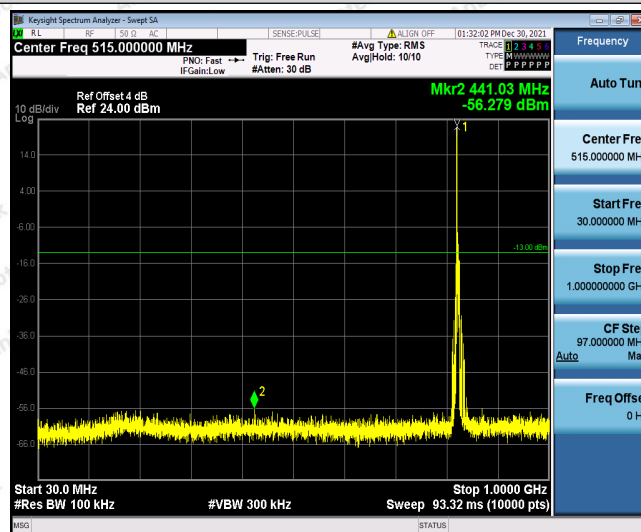


Band5-5MHz-16QAM-20425-1RB#0-Range2:1000~10000MHz

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

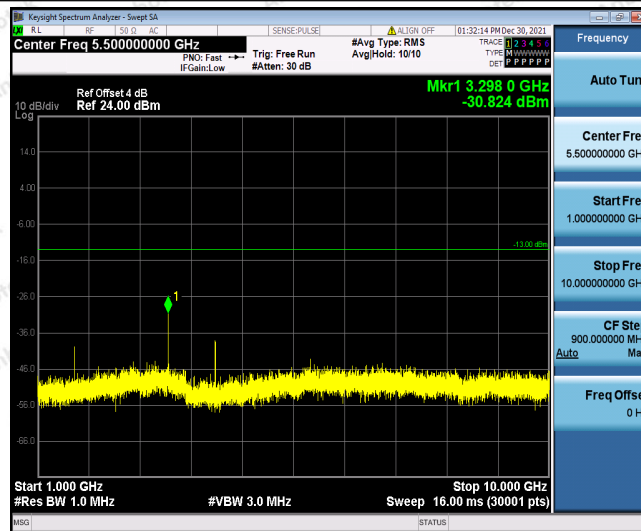

Band5-5MHz-16QAM-20525-1RB#0-Range1:30~1000MHz

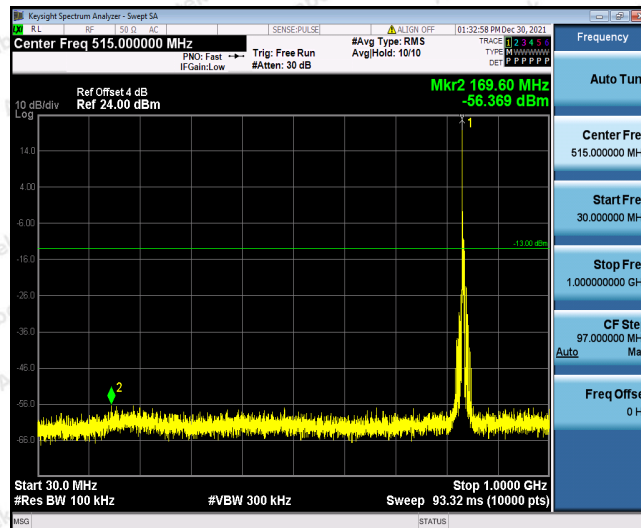

Band5-5MHz-16QAM-20525-1RB#0-Range2:1000~10000MHz

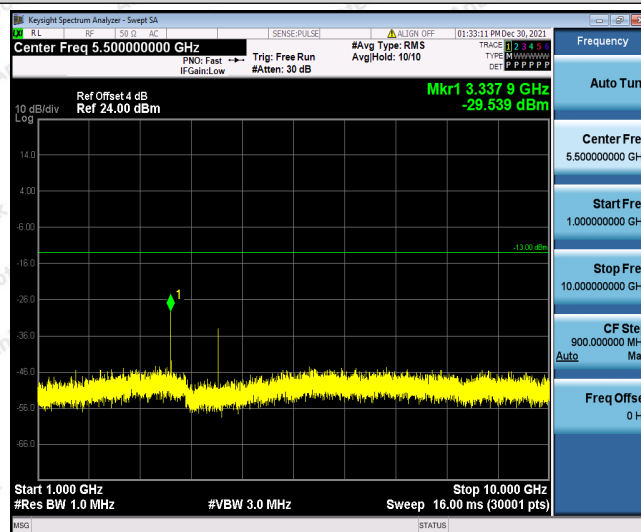

Band5-5MHz-16QAM-20625-1RB#0-Range1:30~1000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

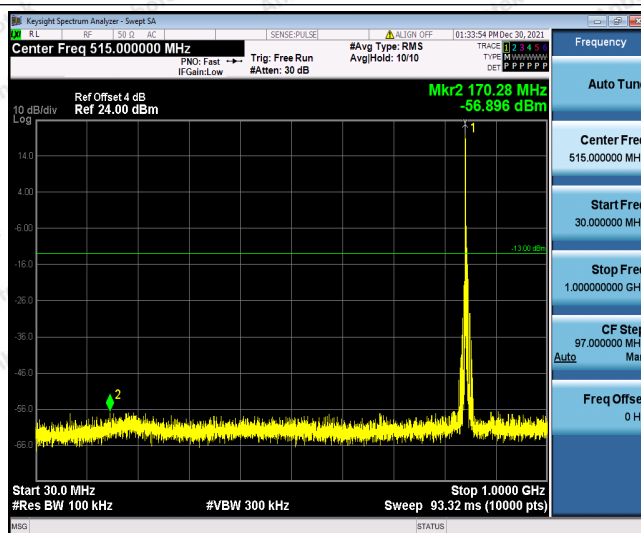

Band5-5MHz-16QAM-20625-1RB#0-Range2:1000~10000MHz

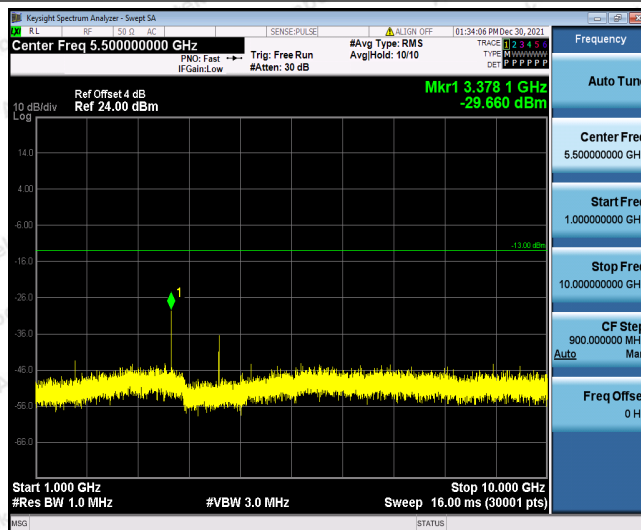

Band5-10MHz-QPSK-20450-1RB#0-Range1:30~1000MHz

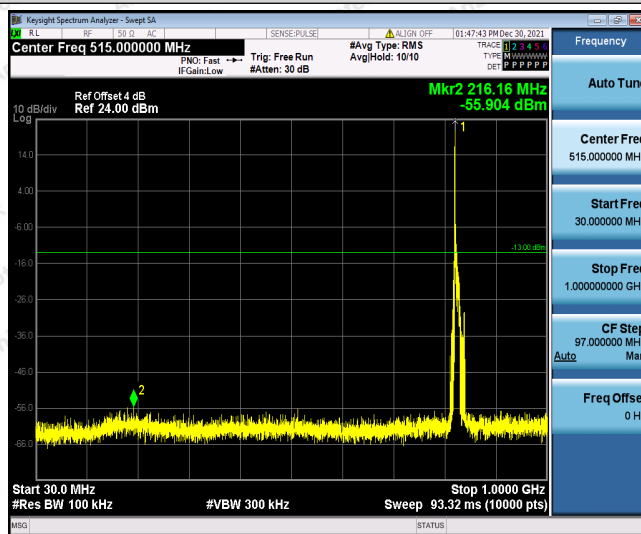

Band5-10MHz-QPSK-20450-1RB#0-Range2:1000~10000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

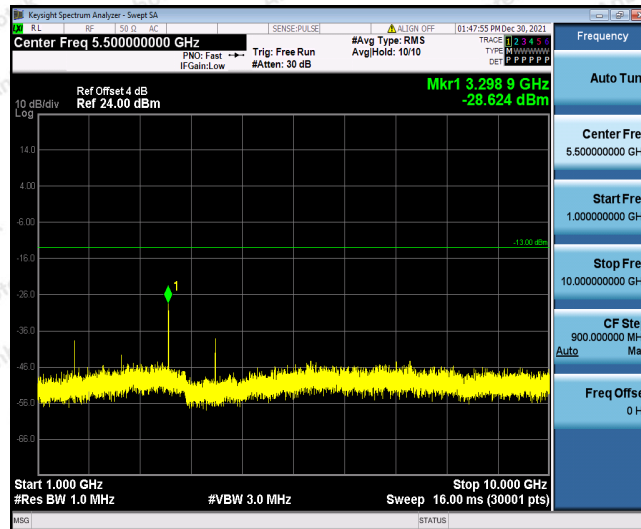

Band5-10MHz-QPSK-20525-1RB#0-Range1:30~1000MHz

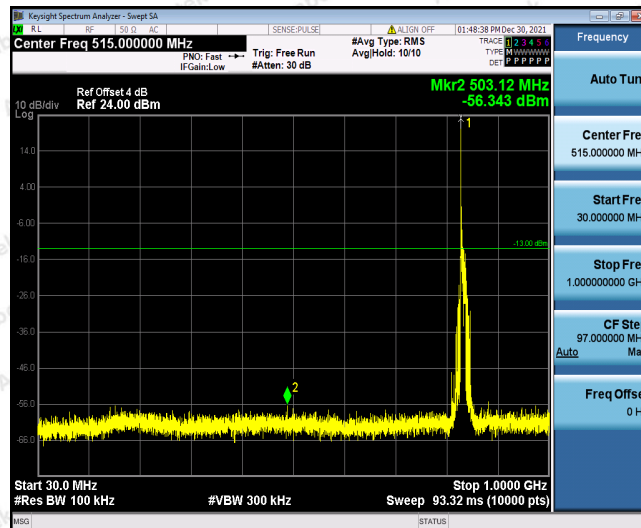

Band5-10MHz-QPSK-20525-1RB#0-Range2:1000~10000MHz

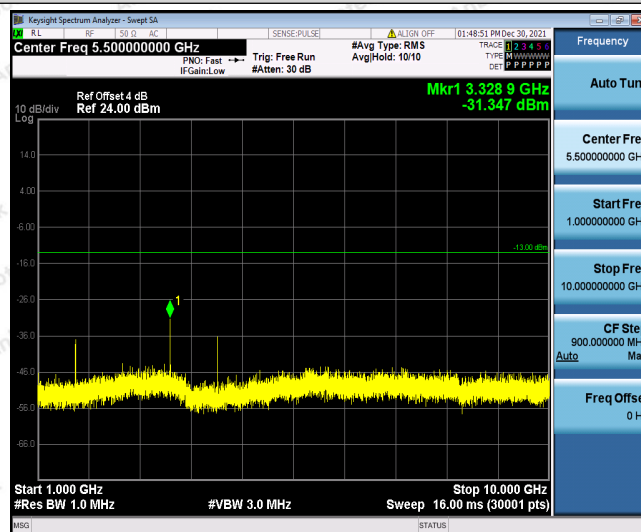


Band5-10MHz-QPSK-20600-1RB#0-Range1:30~1000MHz

Shenzhen Anbotech Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

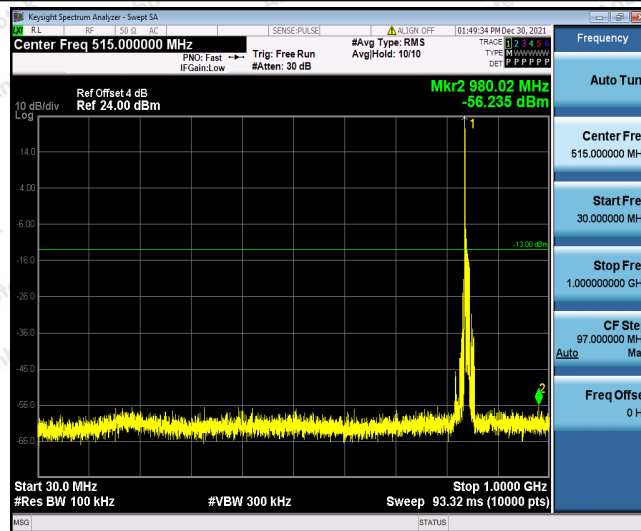

Band5-10MHz-QPSK-20600-1RB#0-Range2:1000~10000MHz

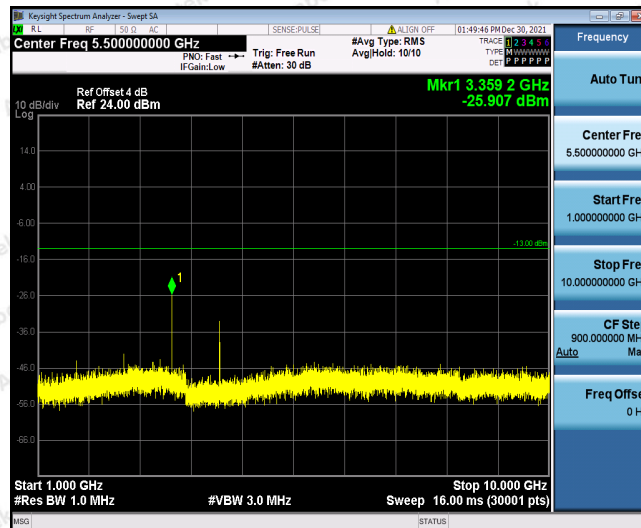

Band5-10MHz-16QAM-20450-1RB#0-Range1:30~1000MHz

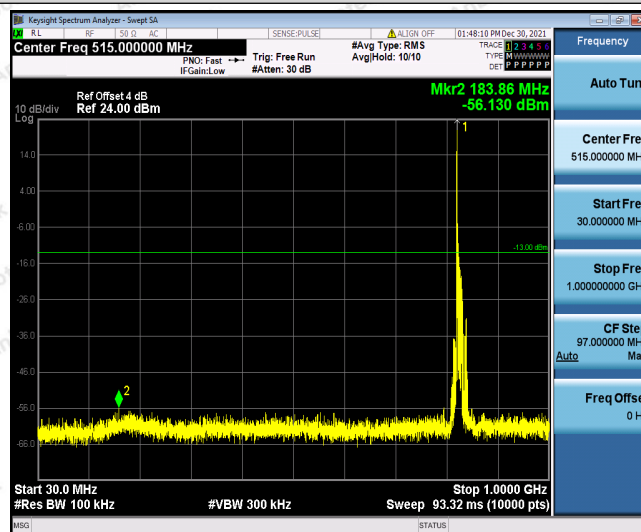

Band5-10MHz-16QAM-20450-1RB#0-Range2:1000~10000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

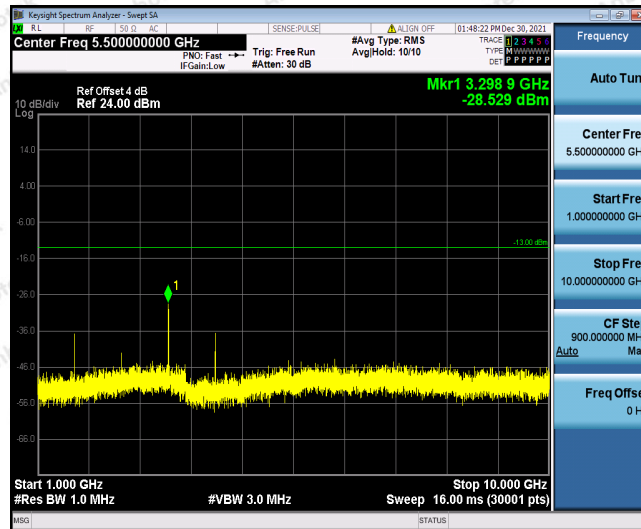

Band5-10MHz-16QAM-20525-1RB#0-Range1:30~1000MHz

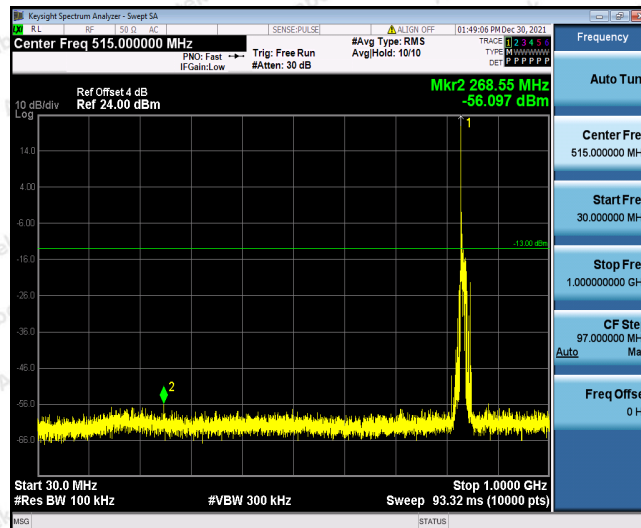

Band5-10MHz-16QAM-20525-1RB#0-Range2:1000~10000MHz

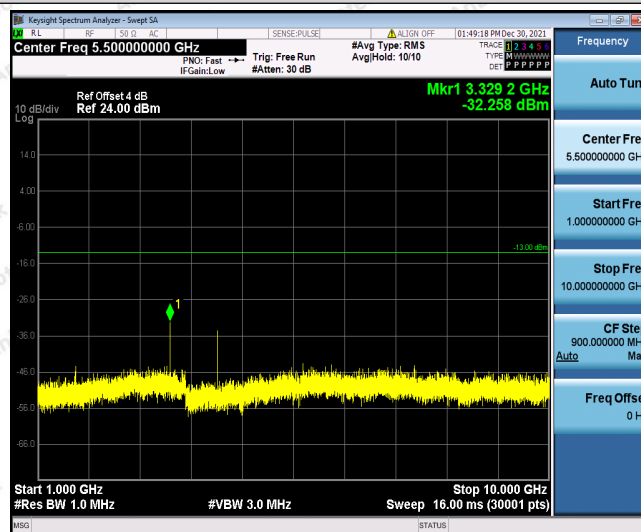


Band5-10MHz-16QAM-20600-1RB#0-Range1:30~1000MHz

Shenzhen Anbotech Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

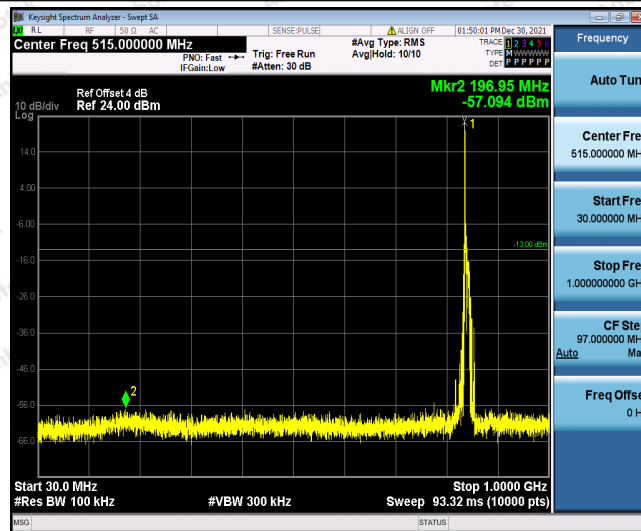

Band5-10MHz-16QAM-20600-1RB#0-Range2:1000~10000MHz

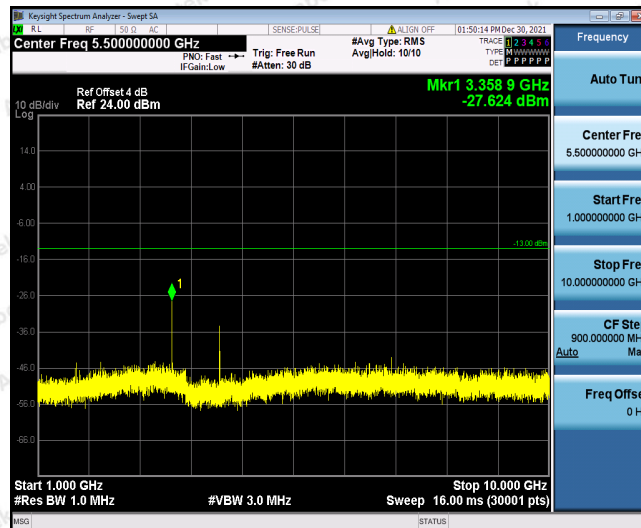

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Appendix F: Frequency Stability VS Voltage

Test Result

Voltage										
Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band5	1.4MHz	QPSK	20407	6RB#0	VL	NT	38.55	0.046744	±2.5	PASS
Band5	1.4MHz	QPSK	20407	6RB#0	VN	NT	34.99	0.042428	±2.5	PASS
Band5	1.4MHz	QPSK	20407	6RB#0	VH	NT	43.53	0.052783	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	VL	NT	23.56	0.028165	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	VN	NT	16.37	0.019570	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	VH	NT	23.63	0.028249	±2.5	PASS
Band5	1.4MHz	QPSK	20643	6RB#0	VL	NT	23.45	0.027644	±2.5	PASS
Band5	1.4MHz	QPSK	20643	6RB#0	VN	NT	28.24	0.033290	±2.5	PASS
Band5	1.4MHz	QPSK	20643	6RB#0	VH	NT	19.07	0.022480	±2.5	PASS
Band5	1.4MHz	16QAM	20407	6RB#0	VL	NT	40.77	0.049436	±2.5	PASS
Band5	1.4MHz	16QAM	20407	6RB#0	VN	NT	34.09	0.041336	±2.5	PASS
Band5	1.4MHz	16QAM	20407	6RB#0	VH	NT	5.18	0.006281	±2.5	PASS
Band5	1.4MHz	16QAM	20525	6RB#0	VL	NT	-26.69	-0.031907	±2.5	PASS
Band5	1.4MHz	16QAM	20525	6RB#0	VN	NT	-20.69	-0.024734	±2.5	PASS
Band5	1.4MHz	16QAM	20525	6RB#0	VH	NT	-30.86	-0.036892	±2.5	PASS
Band5	1.4MHz	16QAM	20643	6RB#0	VL	NT	22.19	0.026158	±2.5	PASS
Band5	1.4MHz	16QAM	20643	6RB#0	VN	NT	18.18	0.021431	±2.5	PASS
Band5	1.4MHz	16QAM	20643	6RB#0	VH	NT	22.85	0.026936	±2.5	PASS
Band5	3MHz	QPSK	20415	15RB#0	VL	NT	28.40	0.034403	±2.5	PASS
Band5	3MHz	QPSK	20415	15RB#0	VN	NT	24.32	0.029461	±2.5	PASS
Band5	3MHz	QPSK	20415	15RB#0	VH	NT	33.82	0.040969	±2.5	PASS
Band5	3MHz	QPSK	20525	15RB#0	VL	NT	21.96	0.026252	±2.5	PASS
Band5	3MHz	QPSK	20525	15RB#0	VN	NT	14.29	0.017083	±2.5	PASS
Band5	3MHz	QPSK	20525	15RB#0	VH	NT	20.66	0.024698	±2.5	PASS
Band5	3MHz	QPSK	20635	15RB#0	VL	NT	-5.25	-0.006195	±2.5	PASS
Band5	3MHz	QPSK	20635	15RB#0	VN	NT	3.40	0.004012	±2.5	PASS
Band5	3MHz	QPSK	20635	15RB#0	VH	NT	-13.12	-0.015481	±2.5	PASS
Band5	3MHz	16QAM	20415	15RB#0	VL	NT	25.16	0.030478	±2.5	PASS
Band5	3MHz	16QAM	20415	15RB#0	VN	NT	18.94	0.022944	±2.5	PASS
Band5	3MHz	16QAM	20415	15RB#0	VH	NT	27.18	0.032925	±2.5	PASS
Band5	3MHz	16QAM	20525	15RB#0	VL	NT	-46.16	-0.055182	±2.5	PASS
Band5	3MHz	16QAM	20525	15RB#0	VN	NT	-35.52	-0.042463	±2.5	PASS
Band5	3MHz	16QAM	20525	15RB#0	VH	NT	-11.17	-0.013353	±2.5	PASS
Band5	3MHz	16QAM	20635	15RB#0	VL	NT	-19.81	-0.023375	±2.5	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com



Hotline

400-003-0500

www.anbotech.com

Band5	3MHz	16QAM	20635	15RB#0	VN	NT	-22.16	-0.026147	±2.5	PASS
Band5	3MHz	16QAM	20635	15RB#0	VH	NT	-17.58	-0.020743	±2.5	PASS
Band5	5MHz	QPSK	20425	25RB#0	VL	NT	-26.76	-0.032377	±2.5	PASS
Band5	5MHz	QPSK	20425	25RB#0	VN	NT	-30.97	-0.037471	±2.5	PASS
Band5	5MHz	QPSK	20425	25RB#0	VH	NT	-22.26	-0.026933	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	VL	NT	18.24	0.021805	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	VN	NT	10.81	0.012923	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	VH	NT	18.05	0.021578	±2.5	PASS
Band5	5MHz	QPSK	20625	25RB#0	VL	NT	-4.89	-0.005777	±2.5	PASS
Band5	5MHz	QPSK	20625	25RB#0	VN	NT	2.70	0.003190	±2.5	PASS
Band5	5MHz	QPSK	20625	25RB#0	VH	NT	-8.33	-0.009841	±2.5	PASS
Band5	5MHz	16QAM	20425	25RB#0	VL	NT	27.85	0.033696	±2.5	PASS
Band5	5MHz	16QAM	20425	25RB#0	VN	NT	21.30	0.025771	±2.5	PASS
Band5	5MHz	16QAM	20425	25RB#0	VH	NT	33.57	0.040617	±2.5	PASS
Band5	5MHz	16QAM	20525	25RB#0	VL	NT	-42.72	-0.051070	±2.5	PASS
Band5	5MHz	16QAM	20525	25RB#0	VN	NT	-33.86	-0.040478	±2.5	PASS
Band5	5MHz	16QAM	20525	25RB#0	VH	NT	-47.59	-0.056892	±2.5	PASS
Band5	5MHz	16QAM	20625	25RB#0	VL	NT	-14.22	-0.016799	±2.5	PASS
Band5	5MHz	16QAM	20625	25RB#0	VN	NT	-16.28	-0.019232	±2.5	PASS
Band5	5MHz	16QAM	20625	25RB#0	VH	NT	-12.22	-0.014436	±2.5	PASS
Band5	10MHz	QPSK	20450	50RB#0	VL	NT	7.47	0.009011	±2.5	PASS
Band5	10MHz	QPSK	20450	50RB#0	VN	NT	5.99	0.007226	±2.5	PASS
Band5	10MHz	QPSK	20450	50RB#0	VH	NT	7.27	0.008770	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	VL	NT	10.96	0.013102	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	VN	NT	5.97	0.007137	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	VH	NT	11.82	0.014130	±2.5	PASS
Band5	10MHz	QPSK	20600	50RB#0	VL	NT	5.39	0.006386	±2.5	PASS
Band5	10MHz	QPSK	20600	50RB#0	VN	NT	5.11	0.006055	±2.5	PASS
Band5	10MHz	QPSK	20600	50RB#0	VH	NT	3.62	0.004289	±2.5	PASS
Band5	10MHz	16QAM	20450	50RB#0	VL	NT	16.74	0.020193	±2.5	PASS
Band5	10MHz	16QAM	20450	50RB#0	VN	NT	13.40	0.016164	±2.5	PASS
Band5	10MHz	16QAM	20450	50RB#0	VH	NT	20.34	0.024536	±2.5	PASS
Band5	10MHz	16QAM	20525	50RB#0	VL	NT	-16.29	-0.019474	±2.5	PASS
Band5	10MHz	16QAM	20525	50RB#0	VN	NT	-12.96	-0.015493	±2.5	PASS
Band5	10MHz	16QAM	20525	50RB#0	VH	NT	-19.81	-0.023682	±2.5	PASS
Band5	10MHz	16QAM	20600	50RB#0	VL	NT	11.09	0.013140	±2.5	PASS
Band5	10MHz	16QAM	20600	50RB#0	VN	NT	9.54	0.011303	±2.5	PASS
Band5	10MHz	16QAM	20600	50RB#0	VH	NT	16.41	0.019443	±2.5	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com



Hotline

400-003-0500

www.anbotech.com

Appendix G: Frequency Stability VS Temperature

Test Result

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band5	1.4MHz	QPSK	20407	6RB#0	NV	-30	-1.92	-0.002328	±2.5	PASS
Band5	1.4MHz	QPSK	20407	6RB#0	NV	-20	7.30	0.008852	±2.5	PASS
Band5	1.4MHz	QPSK	20407	6RB#0	NV	0	12.66	0.015351	±2.5	PASS
Band5	1.4MHz	QPSK	20407	6RB#0	NV	10	17.27	0.020941	±2.5	PASS
Band5	1.4MHz	QPSK	20407	6RB#0	NV	20	23.67	0.028701	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	NV	-30	17.47	0.020885	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	NV	-20	12.29	0.014692	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	NV	0	8.31	0.009934	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	NV	10	1.66	0.001984	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	NV	20	-10.89	-0.013019	±2.5	PASS
Band5	1.4MHz	QPSK	20643	6RB#0	NV	-30	16.75	0.019745	±2.5	PASS
Band5	1.4MHz	QPSK	20643	6RB#0	NV	-20	19.18	0.022610	±2.5	PASS
Band5	1.4MHz	QPSK	20643	6RB#0	NV	0	18.25	0.021514	±2.5	PASS
Band5	1.4MHz	QPSK	20643	6RB#0	NV	10	17.80	0.020983	±2.5	PASS
Band5	1.4MHz	QPSK	20643	6RB#0	NV	20	15.06	0.017753	±2.5	PASS
Band5	1.4MHz	16QAM	20407	6RB#0	NV	-30	11.67	0.014151	±2.5	PASS
Band5	1.4MHz	16QAM	20407	6RB#0	NV	-20	19.27	0.023366	±2.5	PASS
Band5	1.4MHz	16QAM	20407	6RB#0	NV	0	24.79	0.030059	±2.5	PASS
Band5	1.4MHz	16QAM	20407	6RB#0	NV	10	34.42	0.041736	±2.5	PASS
Band5	1.4MHz	16QAM	20407	6RB#0	NV	20	40.13	0.048660	±2.5	PASS
Band5	1.4MHz	16QAM	20525	6RB#0	NV	-30	-39.80	-0.047579	±2.5	PASS
Band5	1.4MHz	16QAM	20525	6RB#0	NV	-20	-45.59	-0.054501	±2.5	PASS
Band5	1.4MHz	16QAM	20525	6RB#0	NV	0	-4.03	-0.004818	±2.5	PASS
Band5	1.4MHz	16QAM	20525	6RB#0	NV	10	-9.28	-0.011094	±2.5	PASS
Band5	1.4MHz	16QAM	20525	6RB#0	NV	20	-15.54	-0.018577	±2.5	PASS
Band5	1.4MHz	16QAM	20643	6RB#0	NV	-30	21.50	0.025345	±2.5	PASS
Band5	1.4MHz	16QAM	20643	6RB#0	NV	-20	24.70	0.029117	±2.5	PASS
Band5	1.4MHz	16QAM	20643	6RB#0	NV	0	27.98	0.032984	±2.5	PASS
Band5	1.4MHz	16QAM	20643	6RB#0	NV	10	34.69	0.040894	±2.5	PASS
Band5	1.4MHz	16QAM	20643	6RB#0	NV	20	39.67	0.046764	±2.5	PASS
Band5	3MHz	QPSK	20415	15RB#0	NV	-30	38.21	0.046287	±2.5	PASS
Band5	3MHz	QPSK	20415	15RB#0	NV	-20	44.96	0.054464	±2.5	PASS
Band5	3MHz	QPSK	20415	15RB#0	NV	0	3.05	0.003695	±2.5	PASS
Band5	3MHz	QPSK	20415	15RB#0	NV	10	8.88	0.010757	±2.5	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com



Hotline

400-003-0500

www.anbotech.com

Band5	3MHz	QPSK	20415	15RB#0	NV	20	16.02	0.019406	±2.5	PASS
Band5	3MHz	QPSK	20525	15RB#0	NV	-30	12.13	0.014501	±2.5	PASS
Band5	3MHz	QPSK	20525	15RB#0	NV	-20	5.72	0.006838	±2.5	PASS
Band5	3MHz	QPSK	20525	15RB#0	NV	0	-9.28	-0.011094	±2.5	PASS
Band5	3MHz	QPSK	20525	15RB#0	NV	10	-16.97	-0.020287	±2.5	PASS
Band5	3MHz	QPSK	20525	15RB#0	NV	20	-27.55	-0.032935	±2.5	PASS
Band5	3MHz	QPSK	20635	15RB#0	NV	-30	-14.08	-0.016614	±2.5	PASS
Band5	3MHz	QPSK	20635	15RB#0	NV	-20	-17.21	-0.020307	±2.5	PASS
Band5	3MHz	QPSK	20635	15RB#0	NV	0	-20.03	-0.023634	±2.5	PASS
Band5	3MHz	QPSK	20635	15RB#0	NV	10	-19.68	-0.023221	±2.5	PASS
Band5	3MHz	QPSK	20635	15RB#0	NV	20	-22.12	-0.026100	±2.5	PASS
Band5	3MHz	16QAM	20415	15RB#0	NV	-30	35.63	0.043162	±2.5	PASS
Band5	3MHz	16QAM	20415	15RB#0	NV	-20	42.06	0.050951	±2.5	PASS
Band5	3MHz	16QAM	20415	15RB#0	NV	0	-3.02	-0.003658	±2.5	PASS
Band5	3MHz	16QAM	20415	15RB#0	NV	10	10.06	0.012187	±2.5	PASS
Band5	3MHz	16QAM	20415	15RB#0	NV	20	18.55	0.022471	±2.5	PASS
Band5	3MHz	16QAM	20525	15RB#0	NV	-30	-17.45	-0.020861	±2.5	PASS
Band5	3MHz	16QAM	20525	15RB#0	NV	-20	-23.39	-0.027962	±2.5	PASS
Band5	3MHz	16QAM	20525	15RB#0	NV	0	-29.41	-0.035158	±2.5	PASS
Band5	3MHz	16QAM	20525	15RB#0	NV	10	-34.95	-0.041781	±2.5	PASS
Band5	3MHz	16QAM	20525	15RB#0	NV	20	-41.13	-0.049169	±2.5	PASS
Band5	3MHz	16QAM	20635	15RB#0	NV	-30	-13.69	-0.016153	±2.5	PASS
Band5	3MHz	16QAM	20635	15RB#0	NV	-20	-10.24	-0.012083	±2.5	PASS
Band5	3MHz	16QAM	20635	15RB#0	NV	0	-6.98	-0.008236	±2.5	PASS
Band5	3MHz	16QAM	20635	15RB#0	NV	10	2.46	0.002903	±2.5	PASS
Band5	3MHz	16QAM	20635	15RB#0	NV	20	7.52	0.008873	±2.5	PASS
Band5	5MHz	QPSK	20425	25RB#0	NV	-30	-15.13	-0.018306	±2.5	PASS
Band5	5MHz	QPSK	20425	25RB#0	NV	-20	-6.44	-0.007792	±2.5	PASS
Band5	5MHz	QPSK	20425	25RB#0	NV	0	3.81	0.004610	±2.5	PASS
Band5	5MHz	QPSK	20425	25RB#0	NV	10	9.51	0.011506	±2.5	PASS
Band5	5MHz	QPSK	20425	25RB#0	NV	20	16.61	0.020097	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	NV	-30	13.15	0.015720	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	NV	-20	5.48	0.006551	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	NV	0	-5.82	-0.006958	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	NV	10	-16.68	-0.019940	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	NV	20	-22.99	-0.027484	±2.5	PASS
Band5	5MHz	QPSK	20625	25RB#0	NV	-30	-10.36	-0.012239	±2.5	PASS
Band5	5MHz	QPSK	20625	25RB#0	NV	-20	-14.32	-0.016917	±2.5	PASS
Band5	5MHz	QPSK	20625	25RB#0	NV	0	-14.89	-0.017590	±2.5	PASS
Band5	5MHz	QPSK	20625	25RB#0	NV	10	-18.38	-0.021713	±2.5	PASS
Band5	5MHz	QPSK	20625	25RB#0	NV	20	-17.07	-0.020165	±2.5	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com



Hotline

400-003-0500

www.anbotech.com

Band5	5MHz	16QAM	20425	25RB#0	NV	-30	38.88	0.047042	±2.5	PASS
Band5	5MHz	16QAM	20425	25RB#0	NV	-20	47.34	0.057278	±2.5	PASS
Band5	5MHz	16QAM	20425	25RB#0	NV	0	6.57	0.007949	±2.5	PASS
Band5	5MHz	16QAM	20425	25RB#0	NV	10	12.63	0.015281	±2.5	PASS
Band5	5MHz	16QAM	20425	25RB#0	NV	20	17.08	0.020665	±2.5	PASS
Band5	5MHz	16QAM	20525	25RB#0	NV	-30	-9.96	-0.011907	±2.5	PASS
Band5	5MHz	16QAM	20525	25RB#0	NV	-20	-16.61	-0.019857	±2.5	PASS
Band5	5MHz	16QAM	20525	25RB#0	NV	0	-22.50	-0.026898	±2.5	PASS
Band5	5MHz	16QAM	20525	25RB#0	NV	10	-30.26	-0.036175	±2.5	PASS
Band5	5MHz	16QAM	20525	25RB#0	NV	20	-35.89	-0.042905	±2.5	PASS
Band5	5MHz	16QAM	20625	25RB#0	NV	-30	-7.48	-0.008836	±2.5	PASS
Band5	5MHz	16QAM	20625	25RB#0	NV	-20	-3.20	-0.003780	±2.5	PASS
Band5	5MHz	16QAM	20625	25RB#0	NV	0	4.71	0.005564	±2.5	PASS
Band5	5MHz	16QAM	20625	25RB#0	NV	10	7.95	0.009392	±2.5	PASS
Band5	5MHz	16QAM	20625	25RB#0	NV	20	13.49	0.015936	±2.5	PASS
Band5	10MHz	QPSK	20450	50RB#0	NV	-30	7.11	0.008577	±2.5	PASS
Band5	10MHz	QPSK	20450	50RB#0	NV	-20	8.64	0.010422	±2.5	PASS
Band5	10MHz	QPSK	20450	50RB#0	NV	0	8.03	0.009686	±2.5	PASS
Band5	10MHz	QPSK	20450	50RB#0	NV	10	10.71	0.012919	±2.5	PASS
Band5	10MHz	QPSK	20450	50RB#0	NV	20	13.50	0.016285	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	NV	-30	10.86	0.012983	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	NV	-20	8.80	0.010520	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	NV	0	4.88	0.005834	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	NV	10	-3.08	-0.003682	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	NV	20	-6.92	-0.008273	±2.5	PASS
Band5	10MHz	QPSK	20600	50RB#0	NV	-30	4.36	0.005166	±2.5	PASS
Band5	10MHz	QPSK	20600	50RB#0	NV	-20	4.38	0.005190	±2.5	PASS
Band5	10MHz	QPSK	20600	50RB#0	NV	0	5.51	0.006528	±2.5	PASS
Band5	10MHz	QPSK	20600	50RB#0	NV	10	7.38	0.008744	±2.5	PASS
Band5	10MHz	QPSK	20600	50RB#0	NV	20	6.49	0.007690	±2.5	PASS
Band5	10MHz	16QAM	20450	50RB#0	NV	-30	24.96	0.030109	±2.5	PASS
Band5	10MHz	16QAM	20450	50RB#0	NV	-20	30.61	0.036924	±2.5	PASS
Band5	10MHz	16QAM	20450	50RB#0	NV	0	38.29	0.046188	±2.5	PASS
Band5	10MHz	16QAM	20450	50RB#0	NV	10	42.72	0.051532	±2.5	PASS
Band5	10MHz	16QAM	20450	50RB#0	NV	20	46.91	0.056586	±2.5	PASS
Band5	10MHz	16QAM	20525	50RB#0	NV	-30	-21.83	-0.026097	±2.5	PASS
Band5	10MHz	16QAM	20525	50RB#0	NV	-20	-24.58	-0.029384	±2.5	PASS
Band5	10MHz	16QAM	20525	50RB#0	NV	0	-28.32	-0.033855	±2.5	PASS
Band5	10MHz	16QAM	20525	50RB#0	NV	10	-29.40	-0.035146	±2.5	PASS
Band5	10MHz	16QAM	20525	50RB#0	NV	20	-35.45	-0.042379	±2.5	PASS
Band5	10MHz	16QAM	20600	50RB#0	NV	-30	17.74	0.021019	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band5	10MHz	16QAM	20600	50RB#0	NV	-20	21.41	0.025367	±2.5	PASS
Band5	10MHz	16QAM	20600	50RB#0	NV	0	27.64	0.032749	±2.5	PASS
Band5	10MHz	16QAM	20600	50RB#0	NV	10	30.28	0.035877	±2.5	PASS
Band5	10MHz	16QAM	20600	50RB#0	NV	20	36.02	0.042678	±2.5	PASS

---End---