




Tx. Spurious ac40 5270MHz Ant2

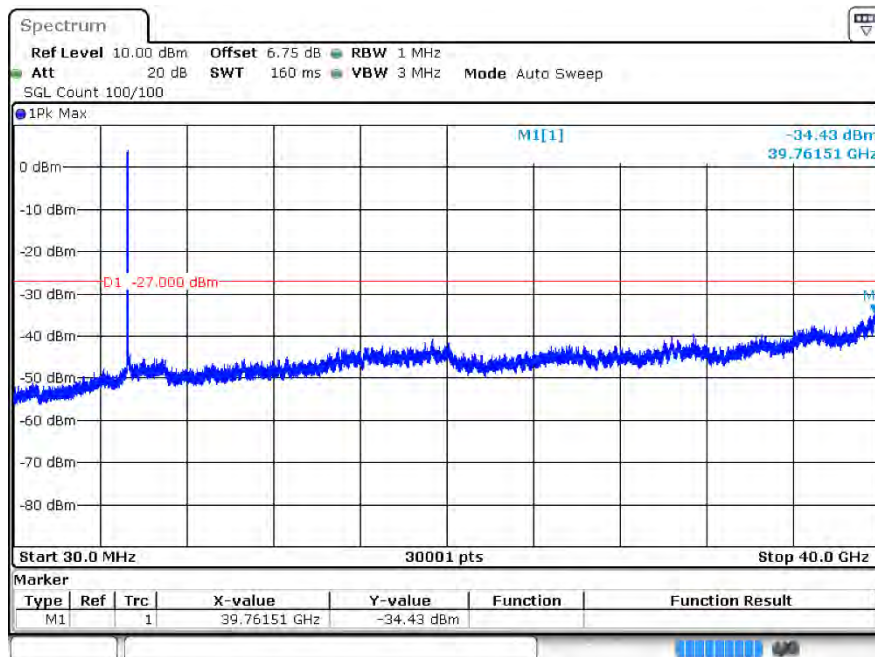


Tx. Spurious ac40 5310MHz Ant2

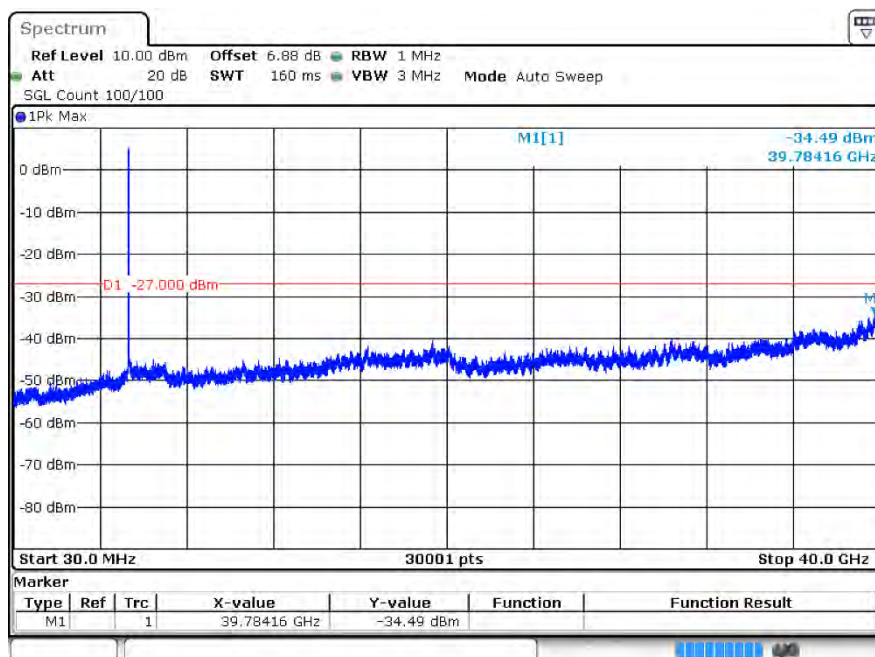


Tx. Spuriousac40 5510MHz Ant2

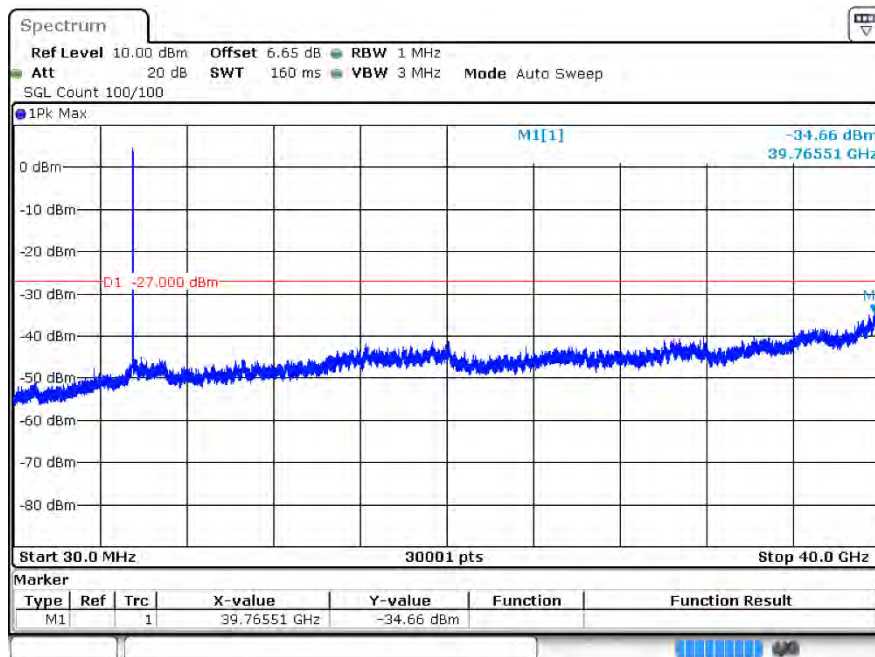


Tx. Spurious ac40 5670MHz Ant2

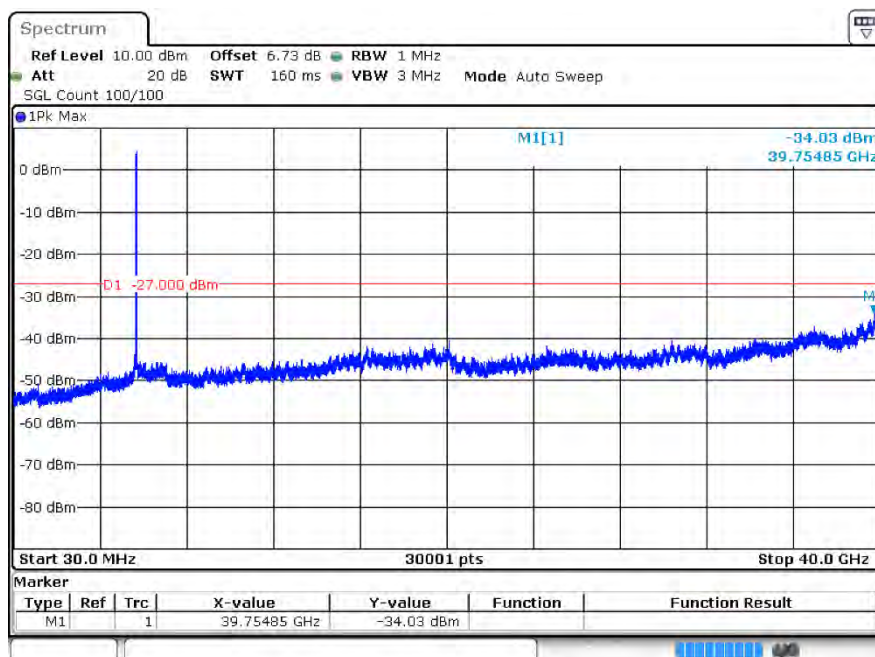


Tx. Spuriousac80 5210MHz Ant2

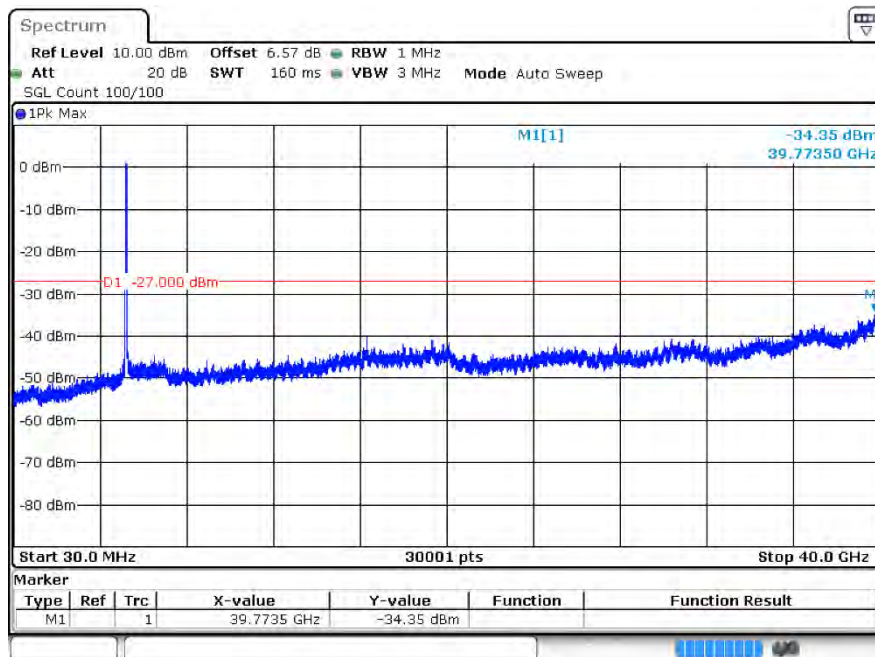


Tx. Spuriousac80 5290MHz Ant2

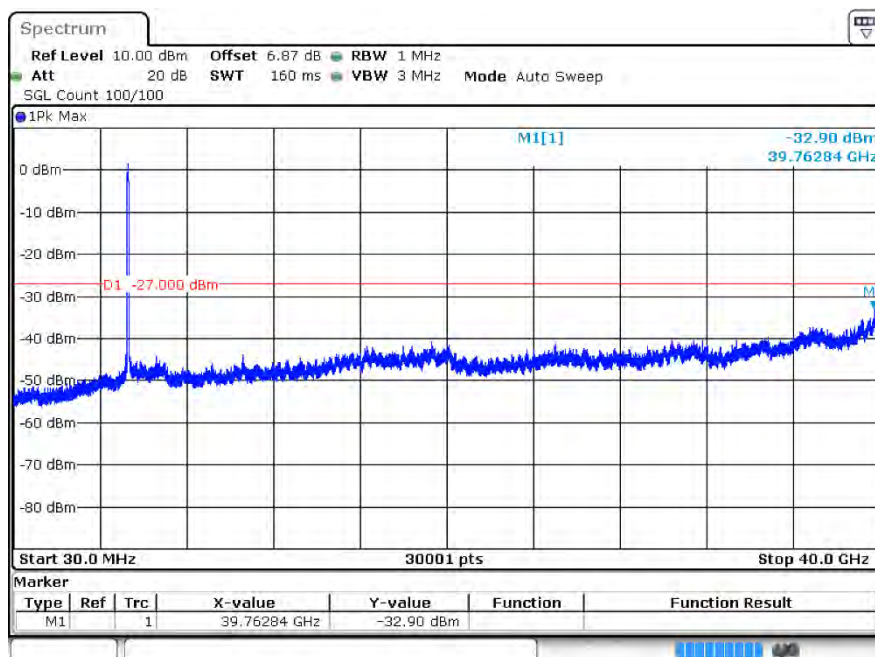

Tx. Spurious ac80 5530MHz Ant2

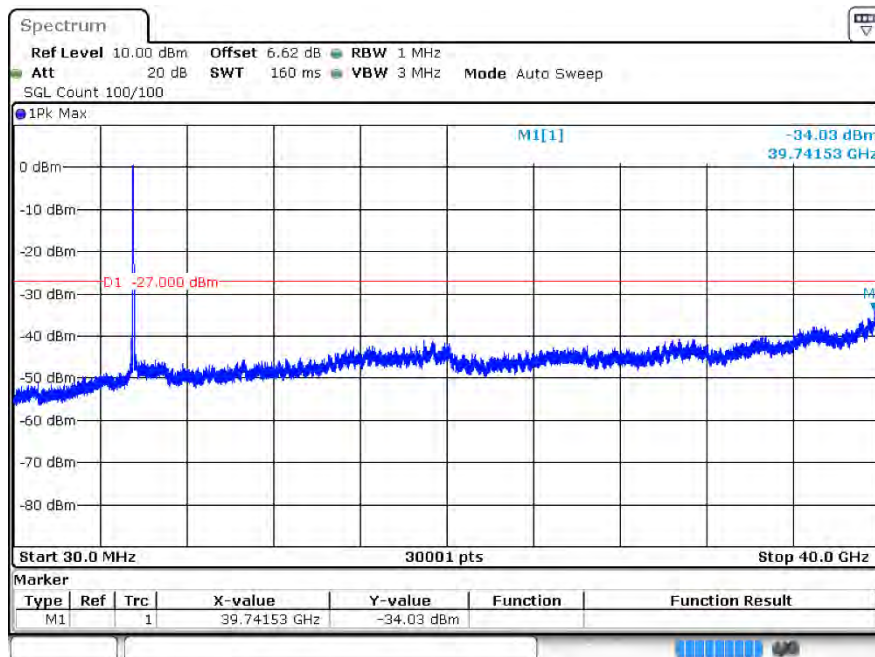

Tx. Spuriousac80 5610MHz Ant2

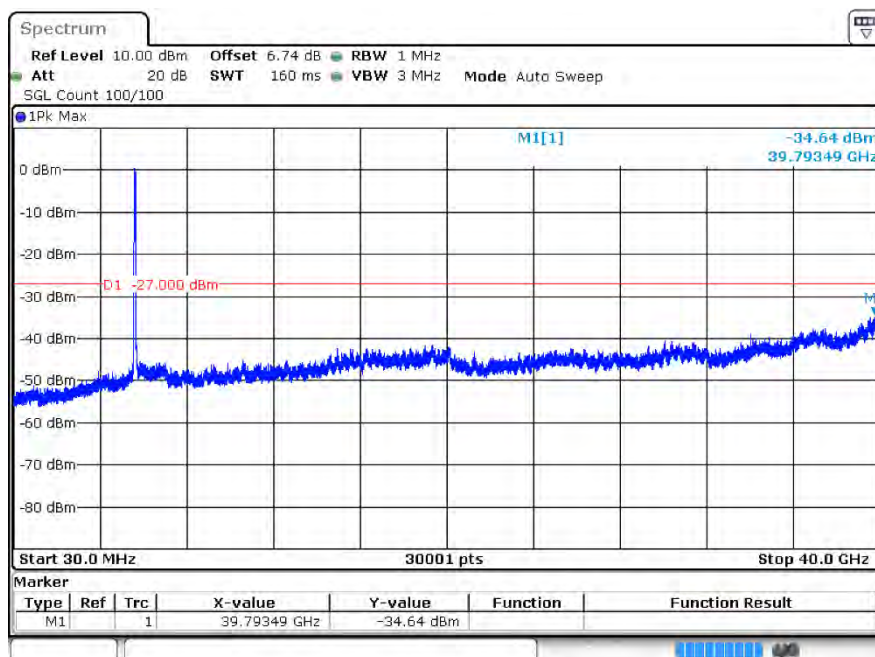



8 Restrict Band

8.1 Test Result

Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Gain (dBi)	Power (dBm)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
a	5180	Ant1	4500	4.5	-42.24	52.99	Peak	68.2	Pass
a	5180	Ant1	4500	4.5	-51.29	43.94	Average	54	Pass
a	5180	Ant1	4882.9	4.5	-38.65	56.58	Peak	68.2	Pass
a	5180	Ant1	4964.1	4.5	-48.1	47.13	Average	54	Pass
a	5180	Ant1	5150	4.5	-40.57	54.66	Peak	68.2	Pass
a	5180	Ant1	5150	4.5	-50.32	44.91	Average	54	Pass
a	5240	Ant1	5350	4.5	-42.02	53.21	Peak	68.2	Pass
a	5240	Ant1	5350	4.5	-50.65	44.58	Average	54	Pass
a	5240	Ant1	5450.4	4.5	-39.72	55.51	Peak	68.2	Pass
a	5240	Ant1	5446.8	4.5	-48.4	46.83	Average	54	Pass
a	5240	Ant1	5460	4.5	-41.57	53.66	Peak	68.2	Pass
a	5240	Ant1	5460	4.5	-50.65	44.58	Average	54	Pass
a	5260	Ant1	4500	4.5	-43.16	52.07	Peak	68.2	Pass
a	5260	Ant1	4500	4.5	-51.11	44.12	Average	54	Pass
a	5260	Ant1	4996.86	4.5	-38.98	56.25	Peak	68.2	Pass
a	5260	Ant1	5027.28	4.5	-48.92	46.31	Average	54	Pass
a	5260	Ant1	5150	4.5	-41.2	54.03	Peak	68.2	Pass
a	5260	Ant1	5150	4.5	-50.12	45.11	Average	54	Pass
a	5320	Ant1	5350	4.5	-40.93	54.3	Peak	68.2	Pass
a	5320	Ant1	5350	4.5	-50.11	45.12	Average	54	Pass
a	5320	Ant1	5351.2	4.5	-39.27	55.96	Peak	68.2	Pass
a	5320	Ant1	5449.4	4.5	-48.42	46.81	Average	54	Pass
a	5320	Ant1	5460	4.5	-43.97	51.26	Peak	68.2	Pass
a	5320	Ant1	5460	4.5	-51.07	44.16	Average	54	Pass
a	5500	Ant1	5460	4.5	-40.53	54.7	Peak	68.2	Pass
a	5500	Ant1	5460	4.5	-49.15	46.08	Average	54	Pass
a	5500	Ant1	5460.6	4.5	-39.84	55.39	Peak	68.2	Pass
a	5500	Ant1	5460	4.5	-49.15	46.08	Average	54	Pass
a	5500	Ant1	5470	4.5	-42.02	53.21	Peak	68.2	Pass
a	5500	Ant1	5470	4.5	-50.36	44.87	Average	54	Pass
a	5700	Ant1	5725	4.5	-48.35	46.88	Peak	68.2	Pass
a	5700	Ant1	5725	4.5	-56.51	38.72	Average	54	Pass
a	5700	Ant1	5727	4.5	-46.9	48.33	Peak	68.2	Pass
a	5700	Ant1	5729.4	4.5	-55.8	39.43	Average	54	Pass
a	5700	Ant1	5735	4.5	-49.89	45.34	Peak	68.2	Pass



a	5700	Ant1	5735	4.5	-57.08	38.15	Average	54	Pass
n20	5180	Ant1	4500	4.5	-41.4	53.83	Peak	68.2	Pass
n20	5180	Ant1	4500	4.5	-51.47	43.76	Average	54	Pass
n20	5180	Ant1	5125.8	4.5	-38.41	56.82	Peak	68.2	Pass
n20	5180	Ant1	4962.7	4.5	-48.53	46.7	Average	54	Pass
n20	5180	Ant1	5150	4.5	-41.34	53.89	Peak	68.2	Pass
n20	5180	Ant1	5150	4.5	-50.77	44.46	Average	54	Pass
n20	5240	Ant1	5350	4.5	-41.78	53.45	Peak	68.2	Pass
n20	5240	Ant1	5350	4.5	-50.86	44.37	Average	54	Pass
n20	5240	Ant1	5405.76	4.5	-39.56	55.67	Peak	68.2	Pass
n20	5240	Ant1	5449.68	4.5	-49.21	46.02	Average	54	Pass
n20	5240	Ant1	5460	4.5	-44.44	50.79	Peak	68.2	Pass
n20	5240	Ant1	5460	4.5	-51.08	44.15	Average	54	Pass
n20	5260	Ant1	4500	4.5	-41.68	53.55	Peak	68.2	Pass
n20	5260	Ant1	4500	4.5	-51.2	44.03	Average	54	Pass
n20	5260	Ant1	4984.38	4.5	-38.78	56.45	Peak	68.2	Pass
n20	5260	Ant1	4756.62	4.5	-49.35	45.88	Average	54	Pass
n20	5260	Ant1	5150	4.5	-41.41	53.82	Peak	68.2	Pass
n20	5260	Ant1	5150	4.5	-51.22	44.01	Average	54	Pass
n20	5320	Ant1	5350	4.5	-40.13	55.1	Peak	68.2	Pass
n20	5320	Ant1	5350	4.5	-50.76	44.47	Average	54	Pass
n20	5320	Ant1	5430.2	4.5	-38.41	56.82	Peak	68.2	Pass
n20	5320	Ant1	5448.6	4.5	-48.84	46.39	Average	54	Pass
n20	5320	Ant1	5460	4.5	-44.56	50.67	Peak	68.2	Pass
n20	5320	Ant1	5460	4.5	-51.31	43.92	Average	54	Pass
n20	5500	Ant1	5460	4.5	-42.35	52.88	Peak	68.2	Pass
n20	5500	Ant1	5460	4.5	-50.05	45.18	Average	54	Pass
n20	5500	Ant1	5467.4	4.5	-40.29	54.94	Peak	68.2	Pass
n20	5500	Ant1	5461.6	4.5	-49.99	45.24	Average	54	Pass
n20	5500	Ant1	5470	4.5	-43.73	51.5	Peak	68.2	Pass
n20	5500	Ant1	5470	4.5	-51.31	43.92	Average	54	Pass
n20	5700	Ant1	5725	4.5	-42.47	52.76	Peak	68.2	Pass
n20	5700	Ant1	5725	4.5	-49.66	45.57	Average	54	Pass
n20	5700	Ant1	5729.8	4.5	-39.68	55.55	Peak	68.2	Pass
n20	5700	Ant1	5728.6	4.5	-48.89	46.34	Average	54	Pass
n20	5700	Ant1	5735	4.5	-42.47	52.76	Peak	68.2	Pass
n20	5700	Ant1	5735	4.5	-49.82	45.41	Average	54	Pass
n40	5190	Ant1	4500	4.5	-41.23	54	Peak	68.2	Pass
n40	5190	Ant1	4500	4.5	-51.51	43.72	Average	54	Pass
n40	5190	Ant1	4741.63	4.5	-39.26	55.97	Peak	68.2	Pass
n40	5190	Ant1	4969.39	4.5	-48.97	46.26	Average	54	Pass
n40	5190	Ant1	5150	4.5	-42.1	53.13	Peak	68.2	Pass
n40	5190	Ant1	5150	4.5	-50.44	44.79	Average	54	Pass



n40	5230	Ant1	5350	4.5	-41.22	54.01	Peak	68.2	Pass
n40	5230	Ant1	5350	4.5	-50.95	44.28	Average	54	Pass
n40	5230	Ant1	5413.83	4.5	-38.64	56.59	Peak	68.2	Pass
n40	5230	Ant1	5448.39	4.5	-48.83	46.4	Average	54	Pass
n40	5230	Ant1	5460	4.5	-43.54	51.69	Peak	68.2	Pass
n40	5230	Ant1	5460	4.5	-51.13	44.1	Average	54	Pass
n40	5270	Ant1	4500	4.5	-42.13	53.1	Peak	68.2	Pass
n40	5270	Ant1	4500	4.5	-51.33	43.9	Average	54	Pass
n40	5270	Ant1	5007.87	4.5	-39.11	56.12	Peak	68.2	Pass
n40	5270	Ant1	4963.32	4.5	-48.86	46.37	Average	54	Pass
n40	5270	Ant1	5150	4.5	-40.82	54.41	Peak	68.2	Pass
n40	5270	Ant1	5150	4.5	-50.97	44.26	Average	54	Pass
n40	5310	Ant1	5350	4.5	-43.72	51.51	Peak	68.2	Pass
n40	5310	Ant1	5350	4.5	-50.77	44.46	Average	54	Pass
n40	5310	Ant1	5354.4	4.5	-39.48	55.75	Peak	68.2	Pass
n40	5310	Ant1	5457.4	4.5	-49.8	45.43	Average	54	Pass
n40	5310	Ant1	5460	4.5	-42.07	53.16	Peak	68.2	Pass
n40	5310	Ant1	5460	4.5	-51.11	44.12	Average	54	Pass
n40	5510	Ant1	5460	4.5	-42.94	52.29	Peak	68.2	Pass
n40	5510	Ant1	5460	4.5	-50.73	44.5	Average	54	Pass
n40	5510	Ant1	5469.2	4.5	-40.28	54.95	Peak	68.2	Pass
n40	5510	Ant1	-50.56	4.5	-50.56	44.67	Average	54	Pass
n40	5510	Ant1	5470	4.5	-42.21	53.02	Peak	68.2	Pass
n40	5510	Ant1	5470	4.5	-50.63	44.6	Average	54	Pass
n40	5670	Ant1	5725	4.5	-40.79	54.44	Peak	68.2	Pass
n40	5670	Ant1	5725	4.5	-49.93	45.3	Average	54	Pass
n40	5670	Ant1	5727.6	4.5	-39.71	55.52	Peak	68.2	Pass
n40	5670	Ant1	5729.2	4.5	-49.14	46.09	Average	54	Pass
n40	5670	Ant1	-41.38	4.5	-41.38	53.85	Peak	68.2	Pass
n40	5670	Ant1	5735	4.5	-49.73	45.5	Average	54	Pass
ac20	5180	Ant1	4500	4.5	-41.95	53.28	Peak	68.2	Pass
ac20	5180	Ant1	4500	4.5	-50.98	44.25	Average	54	Pass
ac20	5180	Ant1	5103.4	4.5	-39.3	55.93	Peak	68.2	Pass
ac20	5180	Ant1	4962.7	4.5	-48.15	47.08	Average	54	Pass
ac20	5180	Ant1	5150	4.5	-41.17	54.06	Peak	68.2	Pass
ac20	5180	Ant1	5150	4.5	-50.42	44.81	Average	54	Pass
ac20	5240	Ant1	5350	4.5	-43.58	51.65	Peak	68.2	Pass
ac20	5240	Ant1	5350	4.5	-50.51	44.72	Average	54	Pass
ac20	5240	Ant1	5392.32	4.5	-39.52	55.71	Peak	68.2	Pass
ac20	5240	Ant1	5446.8	4.5	-48.68	46.55	Average	54	Pass
ac20	5240	Ant1	5460	4.5	-42.59	52.64	Peak	68.2	Pass
ac20	5240	Ant1	5460	4.5	-50.37	44.86	Average	54	Pass
ac20	5260	Ant1	4500	4.5	-42.4	52.83	Peak	68.2	Pass



ac20	5260	Ant1	4500	4.5	-51.3	43.93	Average	54	Pass
ac20	5260	Ant1	5146.62	4.5	-38.66	56.57	Peak	68.2	Pass
ac20	5260	Ant1	4898.58	4.5	-48.14	47.09	Average	54	Pass
ac20	5260	Ant1	5150	4.5	-40.8	54.43	Peak	68.2	Pass
ac20	5260	Ant1	5150	4.5	-50.97	44.26	Average	54	Pass
ac20	5320	Ant1	5350	4.5	-42.65	52.58	Peak	68.2	Pass
ac20	5320	Ant1	5350	4.5	-50.14	45.09	Average	54	Pass
ac20	5320	Ant1	5451	4.5	-38.67	56.56	Peak	68.2	Pass
ac20	5320	Ant1	5447.4	4.5	-48.54	46.69	Average	54	Pass
ac20	5320	Ant1	5460	4.5	-44.49	50.74	Peak	68.2	Pass
ac20	5320	Ant1	5460	4.5	-50.8	44.43	Average	54	Pass
ac20	5500	Ant1	5460	4.5	-42.79	52.44	Peak	68.2	Pass
ac20	5500	Ant1	5460	4.5	-49.59	45.64	Average	54	Pass
ac20	5500	Ant1	5463.8	4.5	-40.26	54.97	Peak	68.2	Pass
ac20	5500	Ant1	5460.2	4.5	-49.47	45.76	Average	54	Pass
ac20	5500	Ant1	5470	4.5	-40.92	54.31	Peak	68.2	Pass
ac20	5500	Ant1	5470	4.5	-50.67	44.56	Average	54	Pass
ac20	5700	Ant1	5725	4.5	-41.83	53.4	Peak	68.2	Pass
ac20	5700	Ant1	5725	4.5	-48.94	46.29	Average	54	Pass
ac20	5700	Ant1	5735	4.5	-39.89	55.34	Peak	68.2	Pass
ac20	5700	Ant1	5730.2	4.5	-48.7	46.53	Average	54	Pass
ac20	5700	Ant1	5735	4.5	-39.89	55.34	Peak	68.2	Pass
ac20	5700	Ant1	5735	4.5	-49.13	46.1	Average	54	Pass
ac40	5190	Ant1	4500	4.5	-41.63	53.6	Peak	68.2	Pass
ac40	5190	Ant1	4500	4.5	-51.74	43.49	Average	54	Pass
ac40	5190	Ant1	5075.24	4.5	-38.22	57.01	Peak	68.2	Pass
ac40	5190	Ant1	4965.01	4.5	-48.31	46.92	Average	54	Pass
ac40	5190	Ant1	5150	4.5	-41.27	53.96	Peak	68.2	Pass
ac40	5190	Ant1	5150	4.5	-49.63	45.6	Average	54	Pass
ac40	5230	Ant1	5350	4.5	-41.13	54.1	Peak	68.2	Pass
ac40	5230	Ant1	5350	4.5	-50.56	44.67	Average	54	Pass
ac40	5230	Ant1	5369.01	4.5	-39	56.23	Peak	68.2	Pass
ac40	5230	Ant1	5450.55	4.5	-48.47	46.76	Average	54	Pass
ac40	5230	Ant1	5460	4.5	-43.1	52.13	Peak	68.2	Pass
ac40	5230	Ant1	5460	4.5	-50.33	44.9	Average	54	Pass
ac40	5270	Ant1	4500	4.5	-41.54	53.69	Peak	68.2	Pass
ac40	5270	Ant1	4500	4.5	-51.14	44.09	Average	54	Pass
ac40	5270	Ant1	5024.07	4.5	-39.2	56.03	Peak	68.2	Pass
ac40	5270	Ant1	5033.79	4.5	-48.54	46.69	Average	54	Pass
ac40	5270	Ant1	5150	4.5	-41.7	53.53	Peak	68.2	Pass
ac40	5270	Ant1	5150	4.5	-50.77	44.46	Average	54	Pass
ac40	5310	Ant1	5350	4.5	-43.92	51.31	Peak	68.2	Pass
ac40	5310	Ant1	5350	4.5	-50.75	44.48	Average	54	Pass



ac40	5310	Ant1	5401.4	4.5	-39.49	55.74	Peak	68.2	Pass
ac40	5310	Ant1	5430.8	4.5	-49.44	45.79	Average	54	Pass
ac40	5310	Ant1	5460	4.5	-43.02	52.21	Peak	68.2	Pass
ac40	5310	Ant1	5460	4.5	-50.29	44.94	Average	54	Pass
ac40	5510	Ant1	5460	4.5	-40.67	54.56	Peak	68.2	Pass
ac40	5510	Ant1	5460	4.5	-50.95	44.28	Average	54	Pass
ac40	5510	Ant1	5460	4.5	-40.67	54.56	Peak	68.2	Pass
ac40	5510	Ant1	-50.02	4.5	-50.02	45.21	Average	54	Pass
ac40	5510	Ant1	5470	4.5	-43.54	51.69	Peak	68.2	Pass
ac40	5510	Ant1	5470	4.5	-50.7	44.53	Average	54	Pass
ac40	5670	Ant1	5725	4.5	-41.58	53.65	Peak	68.2	Pass
ac40	5670	Ant1	5725	4.5	-49.69	45.54	Average	54	Pass
ac40	5670	Ant1	5726.6	4.5	-40.35	54.88	Peak	68.2	Pass
ac40	5670	Ant1	5725.4	4.5	-48.94	46.29	Average	54	Pass
ac40	5670	Ant1	-41.66	4.5	-41.66	53.57	Peak	68.2	Pass
ac40	5670	Ant1	5735	4.5	-49.5	45.73	Average	54	Pass
ac80	5210	Ant1	4500	4.5	-42.53	52.7	Peak	68.2	Pass
ac80	5210	Ant1	4500	4.5	-50.65	44.58	Average	54	Pass
ac80	5210	Ant1	5066.43	4.5	-38.5	56.73	Peak	68.2	Pass
ac80	5210	Ant1	4970.05	4.5	-48.05	47.18	Average	54	Pass
ac80	5210	Ant1	5150	4.5	-41.97	53.26	Peak	68.2	Pass
ac80	5210	Ant1	5150	4.5	-50.57	44.66	Average	54	Pass
ac80	5290	Ant1	4500	4.5	-43.36	51.87	Peak	68.2	Pass
ac80	5290	Ant1	4500	4.5	-51.05	44.18	Average	54	Pass
ac80	5290	Ant1	4955.88	4.5	-38.95	56.28	Peak	68.2	Pass
ac80	5290	Ant1	4963.71	4.5	-48.2	47.03	Average	54	Pass
ac80	5290	Ant1	5150	4.5	-41.64	53.59	Peak	68.2	Pass
ac80	5290	Ant1	5150	4.5	-50.21	45.02	Average	54	Pass
ac80	5530	Ant1	5460	4.5	-43.23	52	Peak	68.2	Pass
ac80	5530	Ant1	5460	4.5	-50.37	44.86	Average	54	Pass
ac80	5530	Ant1	5465	4.5	-41.7	53.53	Peak	68.2	Pass
ac80	5530	Ant1	5466.6	4.5	-50.05	45.18	Average	54	Pass
ac80	5530	Ant1	5470	4.5	-44.18	51.05	Peak	68.2	Pass
ac80	5530	Ant1	5470	4.5	-50.59	44.64	Average	54	Pass
ac80	5610	Ant1	5725	4.5	-40.1	55.13	Peak	68.2	Pass
ac80	5610	Ant1	5725	4.5	-49.59	45.64	Average	54	Pass
ac80	5610	Ant1	5730.08	4.5	-39.46	55.77	Peak	68.2	Pass
ac80	5610	Ant1	5734.795	4.5	-48.79	46.44	Average	54	Pass
ac80	5610	Ant1	5735	4.5	-42.48	52.75	Peak	68.2	Pass
ac80	5610	Ant1	5735	4.5	-48.96	46.27	Average	54	Pass
a	5180	Ant2	4500	4.5	-41.96	53.27	Peak	68.2	Pass
a	5180	Ant2	4500	4.5	-50.92	44.31	Average	54	Pass
a	5180	Ant2	4953.6	4.5	-38.84	56.39	Peak	68.2	Pass



a	5180	Ant2	4964.1	4.5	-48.59	46.64	Average	54	Pass
a	5180	Ant2	5150	4.5	-42.74	52.49	Peak	68.2	Pass
a	5180	Ant2	5150	4.5	-50.99	44.24	Average	54	Pass
a	5240	Ant2	5350	4.5	-42.28	52.95	Peak	68.2	Pass
a	5240	Ant2	5350	4.5	-50.57	44.66	Average	54	Pass
a	5240	Ant2	5401.68	4.5	-39.8	55.43	Peak	68.2	Pass
a	5240	Ant2	5448.48	4.5	-48.3	46.93	Average	54	Pass
a	5240	Ant2	5460	4.5	-43.53	51.7	Peak	68.2	Pass
a	5240	Ant2	5460	4.5	-50.07	45.16	Average	54	Pass
a	5260	Ant2	4500	4.5	-43.21	52.02	Peak	68.2	Pass
a	5260	Ant2	4500	4.5	-50.89	44.34	Average	54	Pass
a	5260	Ant2	5038.98	4.5	-38.05	57.18	Peak	68.2	Pass
a	5260	Ant2	5028.84	4.5	-48.55	46.68	Average	54	Pass
a	5260	Ant2	5150	4.5	-42.03	53.2	Peak	68.2	Pass
a	5260	Ant2	5150	4.5	-50.87	44.36	Average	54	Pass
a	5320	Ant2	5350	4.5	-43.77	51.46	Peak	68.2	Pass
a	5320	Ant2	5350	4.5	-49.85	45.38	Average	54	Pass
a	5320	Ant2	5391.6	4.5	-37.13	58.1	Peak	68.2	Pass
a	5320	Ant2	5447.4	4.5	-48.3	46.93	Average	54	Pass
a	5320	Ant2	5460	4.5	-42.5	52.73	Peak	68.2	Pass
a	5320	Ant2	5460	4.5	-50.7	44.53	Average	54	Pass
a	5500	Ant2	5460	4.5	-41.09	54.14	Peak	68.2	Pass
a	5500	Ant2	5460	4.5	-49.58	45.65	Average	54	Pass
a	5500	Ant2	5469.8	4.5	-40.68	54.55	Peak	68.2	Pass
a	5500	Ant2	5462	4.5	-49.44	45.79	Average	54	Pass
a	5500	Ant2	5470	4.5	-40.96	54.27	Peak	68.2	Pass
a	5500	Ant2	5470	4.5	-50.61	44.62	Average	54	Pass
a	5700	Ant2	5725	4.5	-41.85	53.38	Peak	68.2	Pass
a	5700	Ant2	5725	4.5	-48.95	46.28	Average	54	Pass
a	5700	Ant2	5729.6	4.5	-39.66	55.57	Peak	68.2	Pass
a	5700	Ant2	5729.6	4.5	-48.37	46.86	Average	54	Pass
a	5700	Ant2	5735	4.5	-41.51	53.72	Peak	68.2	Pass
a	5700	Ant2	5735	4.5	-49.1	46.13	Average	54	Pass
n20	5180	Ant2	4500	4.5	-42.91	52.32	Peak	68.2	Pass
n20	5180	Ant2	4500	4.5	-51.66	43.57	Average	54	Pass
n20	5180	Ant2	4525.9	4.5	-38.76	56.47	Peak	68.2	Pass
n20	5180	Ant2	4964.8	4.5	-48.88	46.35	Average	54	Pass
n20	5180	Ant2	5150	4.5	-42.53	52.7	Peak	68.2	Pass
n20	5180	Ant2	5150	4.5	-51.17	44.06	Average	54	Pass
n20	5240	Ant2	5350	4.5	-42.7	52.53	Peak	68.2	Pass
n20	5240	Ant2	5350	4.5	-50.96	44.27	Average	54	Pass
n20	5240	Ant2	5451.6	4.5	-38.44	56.79	Peak	68.2	Pass
n20	5240	Ant2	5449.44	4.5	-48.94	46.29	Average	54	Pass



n20	5240	Ant2	5460	4.5	-42.45	52.78	Peak	68.2	Pass
n20	5240	Ant2	5460	4.5	-50.79	44.44	Average	54	Pass
n20	5260	Ant2	4500	4.5	-41.19	54.04	Peak	68.2	Pass
n20	5260	Ant2	4500	4.5	-51.65	43.58	Average	54	Pass
n20	5260	Ant2	4724.64	4.5	-39.01	56.22	Peak	68.2	Pass
n20	5260	Ant2	5025.72	4.5	-48.91	46.32	Average	54	Pass
n20	5260	Ant2	5150	4.5	-42.46	52.77	Peak	68.2	Pass
n20	5260	Ant2	5150	4.5	-51.22	44.01	Average	54	Pass
n20	5320	Ant2	5350	4.5	-40.84	54.39	Peak	68.2	Pass
n20	5320	Ant2	5350	4.5	-50.49	44.74	Average	54	Pass
n20	5320	Ant2	5354.6	4.5	-38.49	56.74	Peak	68.2	Pass
n20	5320	Ant2	5447.4	4.5	-48.94	46.29	Average	54	Pass
n20	5320	Ant2	5460	4.5	-44.09	51.14	Peak	68.2	Pass
n20	5320	Ant2	5460	4.5	-50.91	44.32	Average	54	Pass
n20	5500	Ant2	5460	4.5	-42.61	52.62	Peak	68.2	Pass
n20	5500	Ant2	5460	4.5	-49.92	45.31	Average	54	Pass
n20	5500	Ant2	5463.8	4.5	-39.16	56.07	Peak	68.2	Pass
n20	5500	Ant2	5462.4	4.5	-49.87	45.36	Average	54	Pass
n20	5500	Ant2	5470	4.5	-42.49	52.74	Peak	68.2	Pass
n20	5500	Ant2	5470	4.5	-51.1	44.13	Average	54	Pass
n20	5700	Ant2	5725	4.5	-42.51	52.72	Peak	68.2	Pass
n20	5700	Ant2	5725	4.5	-49.4	45.83	Average	54	Pass
n20	5700	Ant2	5728	4.5	-39.17	56.06	Peak	68.2	Pass
n20	5700	Ant2	5735	4.5	-48.69	46.54	Average	54	Pass
n20	5700	Ant2	5735	4.5	-41.99	53.24	Peak	68.2	Pass
n20	5700	Ant2	5735	4.5	-48.69	46.54	Average	54	Pass
n40	5190	Ant2	4500	4.5	-41.8	53.43	Peak	68.2	Pass
n40	5190	Ant2	4500	4.5	-51.45	43.78	Average	54	Pass
n40	5190	Ant2	4975.23	4.5	-38.35	56.88	Peak	68.2	Pass
n40	5190	Ant2	4965.01	4.5	-48.7	46.53	Average	54	Pass
n40	5190	Ant2	5150	4.5	-41.88	53.35	Peak	68.2	Pass
n40	5190	Ant2	5150	4.5	-50.32	44.91	Average	54	Pass
n40	5230	Ant2	5350	4.5	-40.91	54.32	Peak	68.2	Pass
n40	5230	Ant2	5350	4.5	-50.88	44.35	Average	54	Pass
n40	5230	Ant2	5442.18	4.5	-39.41	55.82	Peak	68.2	Pass
n40	5230	Ant2	5448.66	4.5	-49.22	46.01	Average	54	Pass
n40	5230	Ant2	5460	4.5	-42.94	52.29	Peak	68.2	Pass
n40	5230	Ant2	5460	4.5	-50.3	44.93	Average	54	Pass
n40	5270	Ant2	4500	4.5	-40.47	54.76	Peak	68.2	Pass
n40	5270	Ant2	4500	4.5	-51.57	43.66	Average	54	Pass
n40	5270	Ant2	4940.64	4.5	-38.76	56.47	Peak	68.2	Pass
n40	5270	Ant2	4961.7	4.5	-48.54	46.69	Average	54	Pass
n40	5270	Ant2	5150	4.5	-40.1	55.13	Peak	68.2	Pass



n40	5270	Ant2	5150	4.5	-51.04	44.19	Average	54	Pass
n40	5310	Ant2	5350	4.5	-43.77	51.46	Peak	68.2	Pass
n40	5310	Ant2	5350	4.5	-50.7	44.53	Average	54	Pass
n40	5310	Ant2	5452.8	4.5	-39.34	55.89	Peak	68.2	Pass
n40	5310	Ant2	5364	4.5	-49.08	46.15	Average	54	Pass
n40	5310	Ant2	5460	4.5	-43.21	52.02	Peak	68.2	Pass
n40	5310	Ant2	5460	4.5	-50.47	44.76	Average	54	Pass
n40	5510	Ant2	5460	4.5	-42.86	52.37	Peak	68.2	Pass
n40	5510	Ant2	5460	4.5	-51.26	43.97	Average	54	Pass
n40	5510	Ant2	5464.2	4.5	-40.76	54.47	Peak	68.2	Pass
n40	5510	Ant2	-50.39	4.5	-50.39	44.84	Average	54	Pass
n40	5510	Ant2	5470	4.5	-45.4	49.83	Peak	68.2	Pass
n40	5510	Ant2	5470	4.5	-50.85	44.38	Average	54	Pass
n40	5670	Ant2	5725	4.5	-40.53	54.7	Peak	68.2	Pass
n40	5670	Ant2	5725	4.5	-49.88	45.35	Average	54	Pass
n40	5670	Ant2	5730.8	4.5	-38.66	56.57	Peak	68.2	Pass
n40	5670	Ant2	5726.8	4.5	-49.03	46.2	Average	54	Pass
n40	5670	Ant2	-40.67	4.5	-40.67	54.56	Peak	68.2	Pass
n40	5670	Ant2	5735	4.5	-49.78	45.45	Average	54	Pass
ac20	5180	Ant2	4500	4.5	-41.58	53.65	Peak	68.2	Pass
ac20	5180	Ant2	4500	4.5	-51.29	43.94	Average	54	Pass
ac20	5180	Ant2	4783.5	4.5	-38.89	56.34	Peak	68.2	Pass
ac20	5180	Ant2	4963.4	4.5	-47.95	47.28	Average	54	Pass
ac20	5180	Ant2	5150	4.5	-42.91	52.32	Peak	68.2	Pass
ac20	5180	Ant2	5150	4.5	-50.92	44.31	Average	54	Pass
ac20	5240	Ant2	5350	4.5	-42.39	52.84	Peak	68.2	Pass
ac20	5240	Ant2	5350	4.5	-50.58	44.65	Average	54	Pass
ac20	5240	Ant2	5421.6	4.5	-39.84	55.39	Peak	68.2	Pass
ac20	5240	Ant2	5450.16	4.5	-48.56	46.67	Average	54	Pass
ac20	5240	Ant2	5460	4.5	-42.58	52.65	Peak	68.2	Pass
ac20	5240	Ant2	5460	4.5	-50.08	45.15	Average	54	Pass
ac20	5260	Ant2	4500	4.5	-42.26	52.97	Peak	68.2	Pass
ac20	5260	Ant2	4500	4.5	-51.23	44	Average	54	Pass
ac20	5260	Ant2	4839.3	4.5	-38.83	56.4	Peak	68.2	Pass
ac20	5260	Ant2	5026.5	4.5	-48.42	46.81	Average	54	Pass
ac20	5260	Ant2	5150	4.5	-41.39	53.84	Peak	68.2	Pass
ac20	5260	Ant2	5150	4.5	-50.68	44.55	Average	54	Pass
ac20	5320	Ant2	5350	4.5	-42.6	52.63	Peak	68.2	Pass
ac20	5320	Ant2	5350	4.5	-49.85	45.38	Average	54	Pass
ac20	5320	Ant2	5388.8	4.5	-38.58	56.65	Peak	68.2	Pass
ac20	5320	Ant2	5447.6	4.5	-48.35	46.88	Average	54	Pass
ac20	5320	Ant2	5460	4.5	-43.53	51.7	Peak	68.2	Pass
ac20	5320	Ant2	5460	4.5	-50.44	44.79	Average	54	Pass



ac20	5500	Ant2	5460	4.5	-41.65	53.58	Peak	68.2	Pass
ac20	5500	Ant2	5460	4.5	-49.38	45.85	Average	54	Pass
ac20	5500	Ant2	5461.2	4.5	-40.12	55.11	Peak	68.2	Pass
ac20	5500	Ant2	5462	4.5	-49.26	45.97	Average	54	Pass
ac20	5500	Ant2	5470	4.5	-41.83	53.4	Peak	68.2	Pass
ac20	5500	Ant2	5470	4.5	-50.89	44.34	Average	54	Pass
ac20	5700	Ant2	5725	4.5	-41.31	53.92	Peak	68.2	Pass
ac20	5700	Ant2	5725	4.5	-48.87	46.36	Average	54	Pass
ac20	5700	Ant2	5730.8	4.5	-39.28	55.95	Peak	68.2	Pass
ac20	5700	Ant2	5735	4.5	-48.35	46.88	Average	54	Pass
ac20	5700	Ant2	5735	4.5	-40.78	54.45	Peak	68.2	Pass
ac20	5700	Ant2	5735	4.5	-48.35	46.88	Average	54	Pass
ac40	5190	Ant2	4500	4.5	-42.65	52.58	Peak	68.2	Pass
ac40	5190	Ant2	4500	4.5	-51.2	44.03	Average	54	Pass
ac40	5190	Ant2	4950.41	4.5	-38.93	56.3	Peak	68.2	Pass
ac40	5190	Ant2	4965.74	4.5	-48.67	46.56	Average	54	Pass
ac40	5190	Ant2	5150	4.5	-41.46	53.77	Peak	68.2	Pass
ac40	5190	Ant2	5150	4.5	-50.87	44.36	Average	54	Pass
ac40	5230	Ant2	5350	4.5	-42.21	53.02	Peak	68.2	Pass
ac40	5230	Ant2	5350	4.5	-50.49	44.74	Average	54	Pass
ac40	5230	Ant2	5447.31	4.5	-38.3	56.93	Peak	68.2	Pass
ac40	5230	Ant2	5450.28	4.5	-48.14	47.09	Average	54	Pass
ac40	5230	Ant2	5460	4.5	-41.7	53.53	Peak	68.2	Pass
ac40	5230	Ant2	5460	4.5	-50.67	44.56	Average	54	Pass
ac40	5270	Ant2	4500	4.5	-42.89	52.34	Peak	68.2	Pass
ac40	5270	Ant2	4500	4.5	-51.18	44.05	Average	54	Pass
ac40	5270	Ant2	4749.48	4.5	-39.17	56.06	Peak	68.2	Pass
ac40	5270	Ant2	5032.17	4.5	-48.34	46.89	Average	54	Pass
ac40	5270	Ant2	5150	4.5	-41.65	53.58	Peak	68.2	Pass
ac40	5270	Ant2	5150	4.5	-50.69	44.54	Average	54	Pass
ac40	5310	Ant2	5350	4.5	-44.61	50.62	Peak	68.2	Pass
ac40	5310	Ant2	5350	4.5	-50.34	44.89	Average	54	Pass
ac40	5310	Ant2	5399.2	4.5	-39.04	56.19	Peak	68.2	Pass
ac40	5310	Ant2	5379.6	4.5	-49.05	46.18	Average	54	Pass
ac40	5310	Ant2	5460	4.5	-42.16	53.07	Peak	68.2	Pass
ac40	5310	Ant2	5460	4.5	-50.46	44.77	Average	54	Pass
ac40	5510	Ant2	5460	4.5	-43.12	52.11	Peak	68.2	Pass
ac40	5510	Ant2	5460	4.5	-50.35	44.88	Average	54	Pass
ac40	5510	Ant2	5462.2	4.5	-41.77	53.46	Peak	68.2	Pass
ac40	5510	Ant2	-49.58	4.5	-49.58	45.65	Average	54	Pass
ac40	5510	Ant2	5470	4.5	-44.67	50.56	Peak	68.2	Pass
ac40	5510	Ant2	5470	4.5	-50.84	44.39	Average	54	Pass
ac40	5670	Ant2	5725	4.5	-41.73	53.5	Peak	68.2	Pass



ac40	5670	Ant2	5725	4.5	-49.14	46.09	Average	54	Pass
ac40	5670	Ant2	5730.8	4.5	-39.6	55.63	Peak	68.2	Pass
ac40	5670	Ant2	5733.2	4.5	-48.6	46.63	Average	54	Pass
ac40	5670	Ant2	-41.63	4.5	-41.63	53.6	Peak	68.2	Pass
ac40	5670	Ant2	5735	4.5	-49.27	45.96	Average	54	Pass
ac80	5210	Ant2	4500	4.5	-41.66	53.57	Peak	68.2	Pass
ac80	5210	Ant2	4500	4.5	-51.24	43.99	Average	54	Pass
ac80	5210	Ant2	5091.71	4.5	-38.6	56.63	Peak	68.2	Pass
ac80	5210	Ant2	4970.05	4.5	-48.1	47.13	Average	54	Pass
ac80	5210	Ant2	5150	4.5	-41.12	54.11	Peak	68.2	Pass
ac80	5210	Ant2	5150	4.5	-50.62	44.61	Average	54	Pass
ac80	5290	Ant2	4500	4.5	-41.9	53.33	Peak	68.2	Pass
ac80	5290	Ant2	4500	4.5	-50.39	44.84	Average	54	Pass
ac80	5290	Ant2	4734.03	4.5	-38.55	56.68	Peak	68.2	Pass
ac80	5290	Ant2	4964.58	4.5	-48.3	46.93	Average	54	Pass
ac80	5290	Ant2	5150	4.5	-41.34	53.89	Peak	68.2	Pass
ac80	5290	Ant2	5150	4.5	-50.34	44.89	Average	54	Pass
ac80	5530	Ant2	5460	4.5	-43.64	51.59	Peak	68.2	Pass
ac80	5530	Ant2	5460	4.5	-50.4	44.83	Average	54	Pass
ac80	5530	Ant2	5465.4	4.5	-39.8	55.43	Peak	68.2	Pass
ac80	5530	Ant2	5468.6	4.5	-49.76	45.47	Average	54	Pass
ac80	5530	Ant2	5470	4.5	-43.58	51.65	Peak	68.2	Pass
ac80	5530	Ant2	5470	4.5	-50.47	44.76	Average	54	Pass
ac80	5610	Ant2	5725	4.5	-41.83	53.4	Peak	68.2	Pass
ac80	5610	Ant2	5725	4.5	-49.67	45.56	Average	54	Pass
ac80	5610	Ant2	5734.385	4.5	-39.11	56.12	Peak	68.2	Pass
ac80	5610	Ant2	5734.18	4.5	-48.32	46.91	Average	54	Pass
ac80	5610	Ant2	5735	4.5	-40.04	55.19	Peak	68.2	Pass
ac80	5610	Ant2	5735	4.5	-49.55	45.68	Average	54	Pass



Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
n20	5180	Sum	4500	-39.08	7.51	63.66	Peak	68.2	Pass
n20	5180	Sum	4500	-50.55	7.51	52.19	Average	54	Pass
n20	5180	Sum	5125.8	-35.57	7.51	67.17	Peak	68.2	Pass
n20	5180	Sum	4962.7	-49.69	7.51	53.05	Average	54	Pass
n20	5180	Sum	5150	-38.88	7.51	63.86	Peak	68.2	Pass
n20	5180	Sum	5150	-50.77	7.51	52.78	Average	54	Pass
n20	5240	Sum	5350	-41.78	7.51	63.53	Peak	68.2	Pass
n20	5240	Sum	5350	-50.86	7.51	52.84	Average	54	Pass
n20	5240	Sum	5405.76	-39.56	7.51	66.79	Peak	68.2	Pass
n20	5240	Sum	5449.68	-49.21	7.51	53.68	Average	54	Pass
n20	5240	Sum	5460	-44.44	7.51	62.42	Peak	68.2	Pass
n20	5240	Sum	5460	-51.08	7.51	52.82	Average	54	Pass
n20	5260	Sum	4500	-41.68	7.51	64.32	Peak	68.2	Pass
n20	5260	Sum	4500	-51.2	7.51	52.33	Average	54	Pass
n20	5260	Sum	4984.38	-38.78	7.51	66.86	Peak	68.2	Pass
n20	5260	Sum	4756.62	-49.35	7.51	53.63	Average	54	Pass
n20	5260	Sum	5150	-41.41	7.51	63.85	Peak	68.2	Pass
n20	5260	Sum	5150	-51.22	7.51	53.53	Average	54	Pass
n20	5320	Sum	5350	-40.13	7.51	65.28	Peak	68.2	Pass
n20	5320	Sum	5350	-50.76	7.51	52.13	Average	54	Pass
n20	5320	Sum	5430.2	-38.41	7.51	67.30	Peak	68.2	Pass
n20	5320	Sum	5448.6	-48.84	7.51	52.86	Average	54	Pass
n20	5320	Sum	5460	-44.56	7.51	61.43	Peak	68.2	Pass
n20	5320	Sum	5460	-51.31	7.51	52.64	Average	54	Pass
n20	5500	Sum	5460	-42.35	7.51	63.27	Peak	68.2	Pass
n20	5500	Sum	5460	-50.05	7.51	52.77	Average	54	Pass
n20	5500	Sum	5467.4	-40.29	7.51	66.06	Peak	68.2	Pass
n20	5500	Sum	5461.6	-49.99	7.51	52.82	Average	54	Pass
n20	5500	Sum	5470	-43.73	7.51	62.68	Peak	68.2	Pass
n20	5500	Sum	5470	-51.31	7.51	52.55	Average	54	Pass
n20	5700	Sum	5725	-42.47	7.51	63.26	Peak	68.2	Pass
n20	5700	Sum	5725	-49.66	7.51	52.22	Average	54	Pass
n20	5700	Sum	5729.8	-39.68	7.51	66.33	Peak	68.2	Pass
n20	5700	Sum	5728.6	-48.89	7.51	52.96	Average	54	Pass
n20	5700	Sum	5735	-42.47	7.51	63.53	Peak	68.2	Pass
n20	5700	Sum	5735	-49.82	7.51	52.53	Average	54	Pass
n40	5190	Sum	4500	-41.23	7.51	64.24	Peak	68.2	Pass
n40	5190	Sum	4500	-51.51	7.51	52.27	Average	54	Pass
n40	5190	Sum	4741.63	-39.26	7.51	63.97	Peak	68.2	Pass
n40	5190	Sum	4969.39	-48.97	7.51	52.92	Average	54	Pass
n40	5190	Sum	5150	-42.1	7.51	63.76	Peak	68.2	Pass



n40	5190	Sum	5150	-50.44	7.51	52.37	Average	54	Pass
n40	5230	Sum	5350	-41.22	7.51	64.69	Peak	68.2	Pass
n40	5230	Sum	5350	-50.95	7.51	51.84	Average	54	Pass
n40	5230	Sum	5413.83	-38.64	7.51	65.74	Peak	68.2	Pass
n40	5230	Sum	5448.39	-48.83	7.51	52.73	Average	54	Pass
n40	5230	Sum	5460	-43.54	7.51	62.52	Peak	68.2	Pass
n40	5230	Sum	5460	-51.13	7.51	52.06	Average	54	Pass
n40	5270	Sum	4500	-42.13	7.51	64.53	Peak	68.2	Pass
n40	5270	Sum	4500	-51.33	7.51	52.30	Average	54	Pass
n40	5270	Sum	5007.87	-39.11	7.51	65.82	Peak	68.2	Pass
n40	5270	Sum	4963.32	-48.86	7.51	53.05	Average	54	Pass
n40	5270	Sum	5150	-40.82	7.51	65.31	Peak	68.2	Pass
n40	5270	Sum	5150	-50.97	7.51	51.75	Average	54	Pass
n40	5310	Sum	5350	-43.72	7.51	62.01	Peak	68.2	Pass
n40	5310	Sum	5350	-50.77	7.51	52.02	Average	54	Pass
n40	5310	Sum	5354.4	-39.48	7.51	65.34	Peak	68.2	Pass
n40	5310	Sum	5457.4	-49.8	7.51	52.33	Average	54	Pass
n40	5310	Sum	5460	-42.07	7.51	63.15	Peak	68.2	Pass
n40	5310	Sum	5460	-51.11	7.51	51.97	Average	54	Pass
n40	5510	Sum	5460	-42.94	7.51	62.85	Peak	68.2	Pass
n40	5510	Sum	5460	-50.73	7.51	52.76	Average	54	Pass
n40	5510	Sum	5469.2	-40.28	7.51	65.24	Peak	68.2	Pass
n40	5510	Sum	-50.56	-50.56	7.51	53.28	Average	54	Pass
n40	5510	Sum	5470	-42.21	7.51	62.23	Peak	68.2	Pass
n40	5510	Sum	5470	-50.63	7.51	53.01	Average	54	Pass
n40	5670	Sum	5725	-40.79	7.51	65.09	Peak	68.2	Pass
n40	5670	Sum	5725	-49.93	7.51	52.85	Average	54	Pass
n40	5670	Sum	5727.6	-39.71	7.51	65.60	Peak	68.2	Pass
n40	5670	Sum	5729.2	-49.14	7.51	52.67	Average	54	Pass
n40	5670	Sum	-41.38	-41.38	7.51	64.74	Peak	68.2	Pass
n40	5670	Sum	5735	-49.73	7.51	52.00	Average	54	Pass
ac20	5180	Sum	4500	-41.95	7.51	63.99	Peak	68.2	Pass
ac20	5180	Sum	4500	-50.98	7.51	51.62	Average	54	Pass
ac20	5180	Sum	5103.4	-39.3	7.51	64.66	Peak	68.2	Pass
ac20	5180	Sum	4962.7	-48.15	7.51	53.70	Average	54	Pass
ac20	5180	Sum	5150	-41.17	7.51	63.80	Peak	68.2	Pass
ac20	5180	Sum	5150	-50.42	7.51	52.09	Average	54	Pass
ac20	5240	Sum	5350	-43.58	7.51	62.81	Peak	68.2	Pass
ac20	5240	Sum	5350	-50.51	7.51	52.21	Average	54	Pass
ac20	5240	Sum	5392.32	-39.52	7.51	66.07	Peak	68.2	Pass
ac20	5240	Sum	5446.8	-48.68	7.51	53.13	Average	54	Pass
ac20	5240	Sum	5460	-42.59	7.51	63.17	Peak	68.2	Pass
ac20	5240	Sum	5460	-50.37	7.51	53.53	Average	54	Pass




ac20	5260	Sum	4500	-42.4	7.51	63.42	Peak	68.2	Pass
ac20	5260	Sum	4500	-51.3	7.51	52.49	Average	54	Pass
ac20	5260	Sum	5146.62	-38.66	7.51	66.01	Peak	68.2	Pass
ac20	5260	Sum	4898.58	-48.14	7.51	53.47	Average	54	Pass
ac20	5260	Sum	5150	-40.8	7.51	64.67	Peak	68.2	Pass
ac20	5260	Sum	5150	-50.97	7.51	52.93	Average	54	Pass
ac20	5320	Sum	5350	-42.65	7.51	63.13	Peak	68.2	Pass
ac20	5320	Sum	5350	-50.14	7.51	52.76	Average	54	Pass
ac20	5320	Sum	5451	-38.67	7.51	66.13	Peak	68.2	Pass
ac20	5320	Sum	5447.4	-48.54	7.51	53.31	Average	54	Pass
ac20	5320	Sum	5460	-44.49	7.51	61.77	Peak	68.2	Pass
ac20	5320	Sum	5460	-50.8	7.51	52.13	Average	54	Pass
ac20	5500	Sum	5460	-42.79	7.51	63.57	Peak	68.2	Pass
ac20	5500	Sum	5460	-49.59	7.51	52.27	Average	54	Pass
ac20	5500	Sum	5463.8	-40.26	7.51	65.56	Peak	68.2	Pass
ac20	5500	Sum	5460.2	-49.47	7.51	52.39	Average	54	Pass
ac20	5500	Sum	5470	-40.92	7.51	64.40	Peak	68.2	Pass
ac20	5500	Sum	5470	-50.67	7.51	51.97	Average	54	Pass
ac20	5700	Sum	5725	-41.83	7.51	64.19	Peak	68.2	Pass
ac20	5700	Sum	5725	-48.94	7.51	52.85	Average	54	Pass
ac20	5700	Sum	5735	-39.89	7.51	66.18	Peak	68.2	Pass
ac20	5700	Sum	5730.2	-48.7	7.51	53.23	Average	54	Pass
ac20	5700	Sum	5735	-39.89	7.51	65.44	Peak	68.2	Pass
ac20	5700	Sum	5735	-49.13	7.51	53.03	Average	54	Pass
ac40	5190	Sum	4500	-41.63	7.51	63.64	Peak	68.2	Pass
ac40	5190	Sum	4500	-51.74	7.51	51.29	Average	54	Pass
ac40	5190	Sum	5075.24	-38.22	7.51	65.19	Peak	68.2	Pass
ac40	5190	Sum	4965.01	-48.31	7.51	53.26	Average	54	Pass
ac40	5190	Sum	5150	-41.27	7.51	64.39	Peak	68.2	Pass
ac40	5190	Sum	5150	-49.63	7.51	52.54	Average	54	Pass
ac40	5230	Sum	5350	-41.13	7.51	64.11	Peak	68.2	Pass
ac40	5230	Sum	5350	-50.56	7.51	52.23	Average	54	Pass
ac40	5230	Sum	5369.01	-39	7.51	65.11	Peak	68.2	Pass
ac40	5230	Sum	5450.55	-48.47	7.51	53.45	Average	54	Pass
ac40	5230	Sum	5460	-43.1	7.51	63.41	Peak	68.2	Pass
ac40	5230	Sum	5460	-50.33	7.51	52.25	Average	54	Pass
ac40	5270	Sum	4500	-41.54	7.51	63.59	Peak	68.2	Pass
ac40	5270	Sum	4500	-51.14	7.51	52.59	Average	54	Pass
ac40	5270	Sum	5024.07	-39.2	7.51	66.57	Peak	68.2	Pass
ac40	5270	Sum	5033.79	-48.54	7.51	53.31	Average	54	Pass
ac40	5270	Sum	5150	-41.7	7.51	64.08	Peak	68.2	Pass
ac40	5270	Sum	5150	-50.77	7.51	51.02	Average	54	Pass
ac40	5310	Sum	5350	-43.92	7.51	61.50	Peak	68.2	Pass




ac40	5310	Sum	5350	-50.75	7.51	52.21	Average	54	Pass
ac40	5310	Sum	5401.4	-39.49	7.51	66.49	Peak	68.2	Pass
ac40	5310	Sum	5430.8	-49.44	7.51	52.51	Average	54	Pass
ac40	5310	Sum	5460	-43.02	7.51	63.18	Peak	68.2	Pass
ac40	5310	Sum	5460	-50.29	7.51	52.38	Average	54	Pass
ac40	5510	Sum	5460	-40.67	7.51	64.03	Peak	68.2	Pass
ac40	5510	Sum	5460	-50.95	7.51	52.11	Average	54	Pass
ac40	5510	Sum	5460	-40.67	7.51	64.57	Peak	68.2	Pass
ac40	5510	Sum	-50.02	-50.02	7.51	52.96	Average	54	Pass
ac40	5510	Sum	5470	-43.54	7.51	61.68	Peak	68.2	Pass
ac40	5510	Sum	5470	-50.7	7.51	51.98	Average	54	Pass
ac40	5670	Sum	5725	-41.58	7.51	64.10	Peak	68.2	Pass
ac40	5670	Sum	5725	-49.69	7.51	53.34	Average	54	Pass
ac40	5670	Sum	5726.6	-40.35	7.51	65.79	Peak	68.2	Pass
ac40	5670	Sum	5725.4	-48.94	7.51	52.98	Average	54	Pass
ac40	5670	Sum	-41.66	-41.66	7.51	64.11	Peak	68.2	Pass
ac40	5670	Sum	5735	-49.5	7.51	52.37	Average	54	Pass
ac80	5210	Sum	4500	-42.53	7.51	63.68	Peak	68.2	Pass
ac80	5210	Sum	4500	-50.65	7.51	51.82	Average	54	Pass
ac80	5210	Sum	5066.43	-38.5	7.51	67.20	Peak	68.2	Pass
ac80	5210	Sum	4970.05	-48.05	7.51	53.68	Average	54	Pass
ac80	5210	Sum	5150	-41.97	7.51	64.23	Peak	68.2	Pass
ac80	5210	Sum	5150	-50.57	7.51	52.16	Average	54	Pass
ac80	5290	Sum	4500	-43.36	7.51	63.18	Peak	68.2	Pass
ac80	5290	Sum	4500	-51.05	7.51	52.04	Average	54	Pass
ac80	5290	Sum	4955.88	-38.95	7.51	67.00	Peak	68.2	Pass
ac80	5290	Sum	4963.71	-48.2	7.51	53.50	Average	54	Pass
ac80	5290	Sum	5150	-41.64	7.51	64.26	Peak	68.2	Pass
ac80	5290	Sum	5150	-50.21	7.51	52.48	Average	54	Pass
ac80	5530	Sum	5460	-43.23	7.51	62.32	Peak	68.2	Pass
ac80	5530	Sum	5460	-50.37	7.51	52.37	Average	54	Pass
ac80	5530	Sum	5465	-41.7	7.51	65.10	Peak	68.2	Pass
ac80	5530	Sum	5466.6	-50.05	7.51	52.85	Average	54	Pass
ac80	5530	Sum	5470	-44.18	7.51	61.88	Peak	68.2	Pass
ac80	5530	Sum	5470	-50.59	7.51	52.22	Average	54	Pass
ac80	5610	Sum	5725	-40.1	7.51	64.87	Peak	68.2	Pass
ac80	5610	Sum	5725	-49.59	7.51	52.12	Average	54	Pass
ac80	5610	Sum	5730.08	-39.46	7.51	66.47	Peak	68.2	Pass
ac80	5610	Sum	5734.795	-48.79	7.51	53.20	Average	54	Pass
ac80	5610	Sum	5735	-42.48	7.51	64.66	Peak	68.2	Pass
ac80	5610	Sum	5735	-48.96	7.51	52.51	Average	54	Pass


8.2 Test Graphs

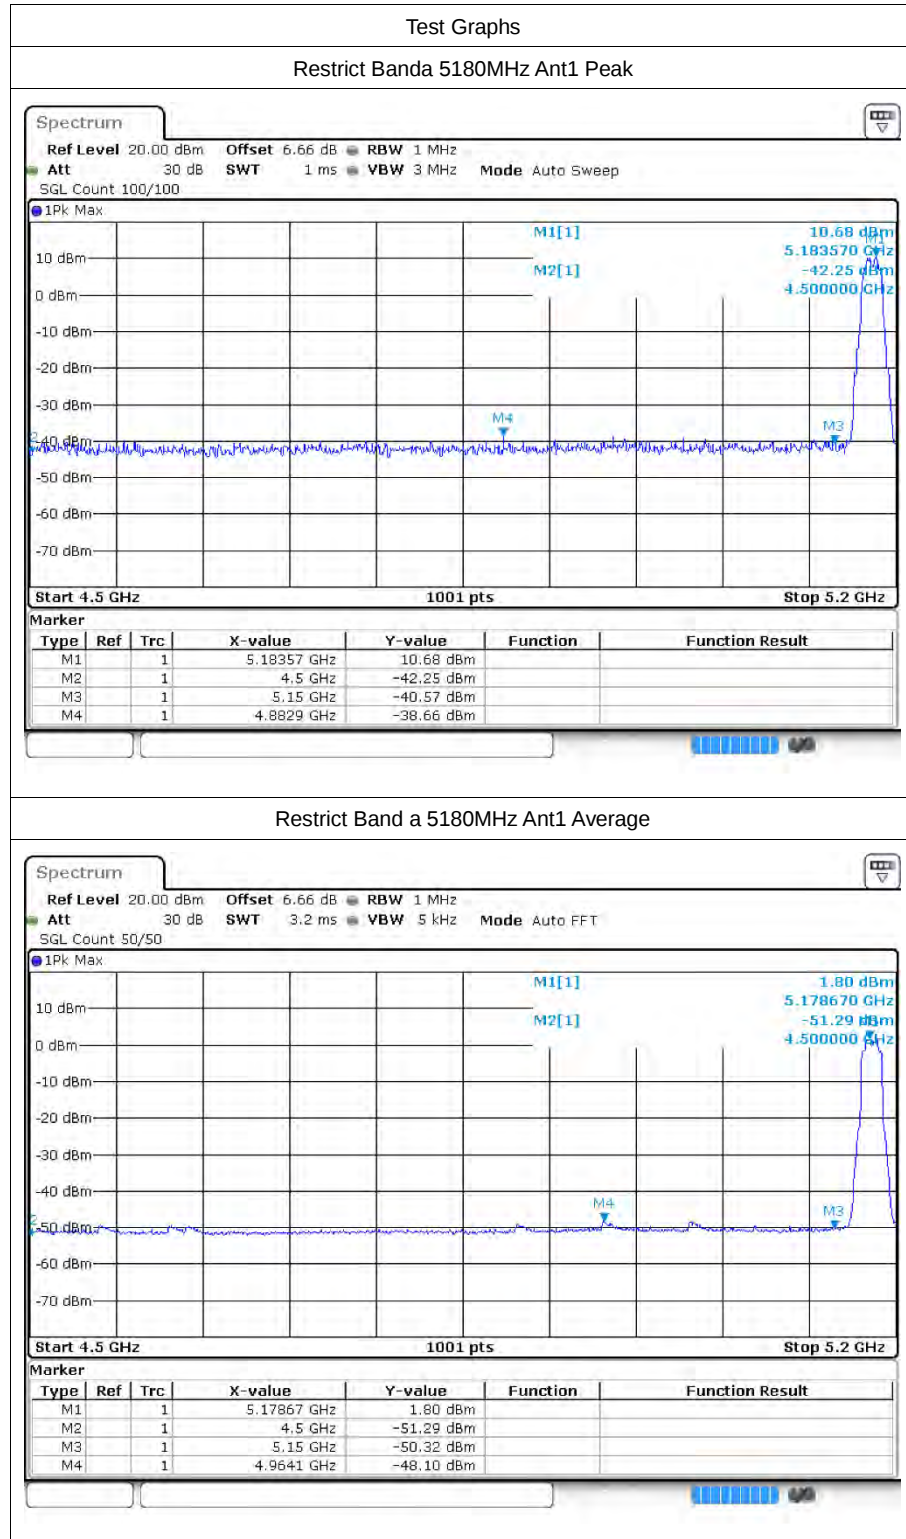

Restrict Banda 5240MHz Ant1 Peak

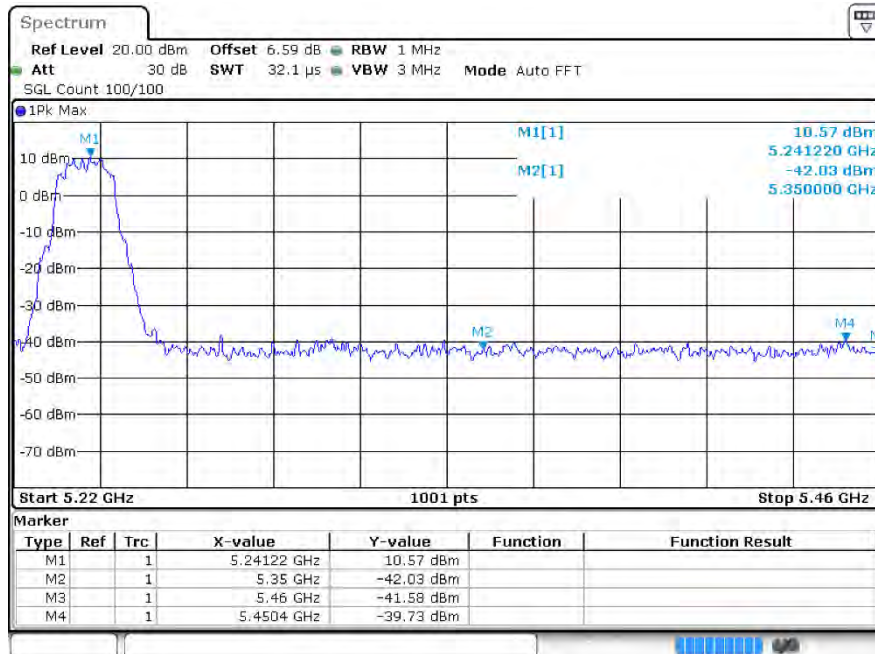


Restrict Band a 5240MHz Ant1 Average

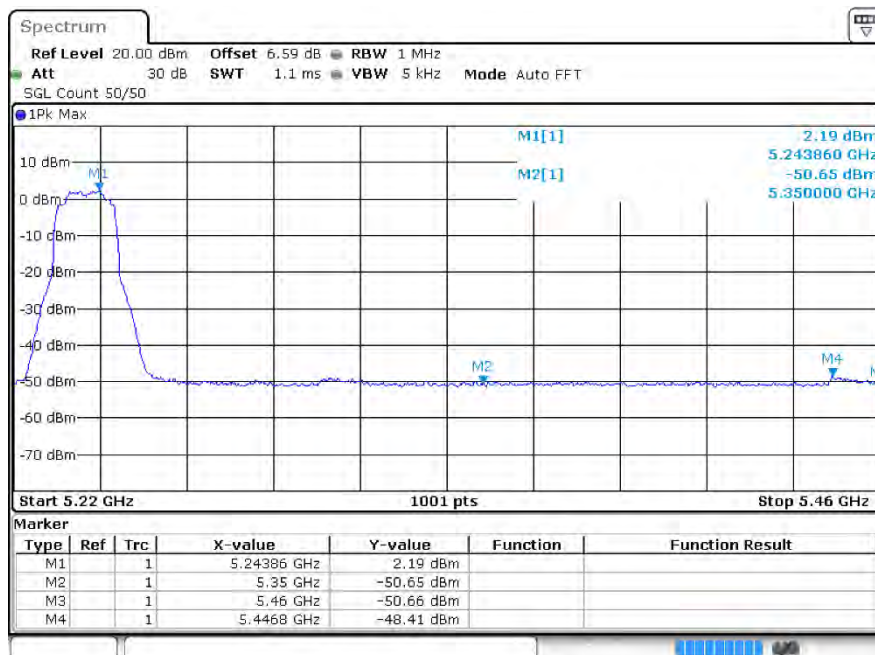





Restrict Banda 5260MHz Ant1 Peak

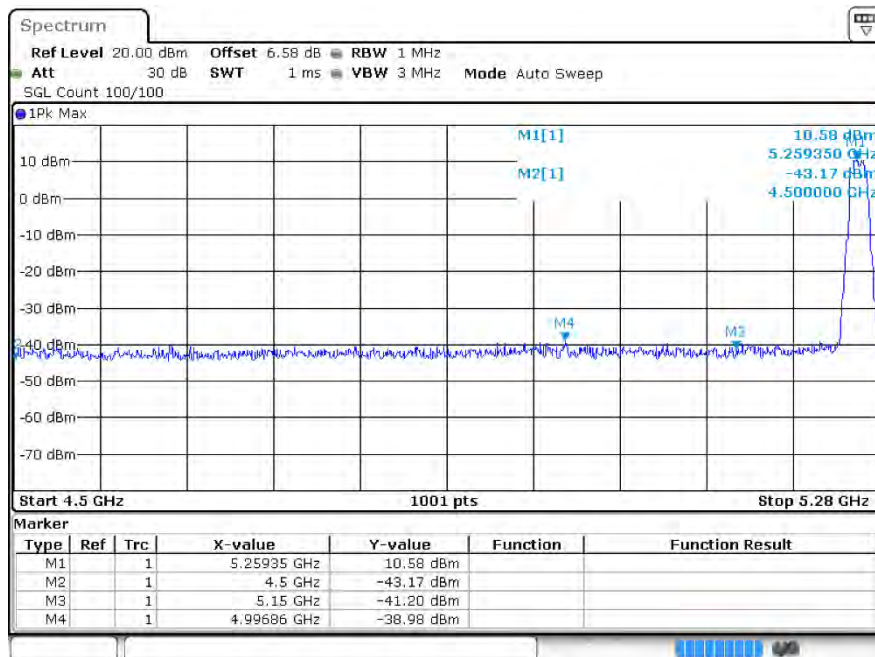

Restrict Band a 5260MHz Ant1 Average

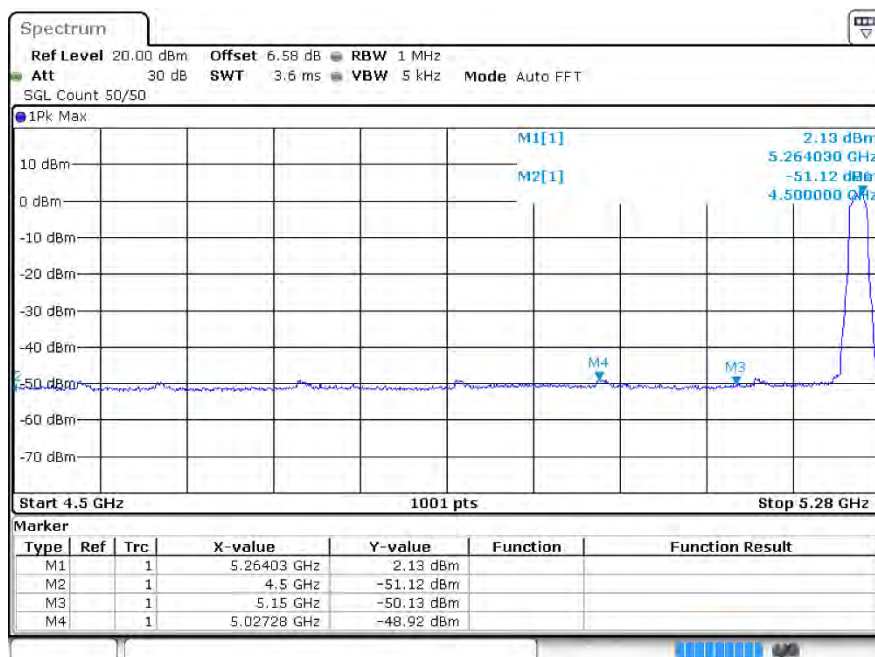


Restrict Banda 5320MHz Ant1 Peak

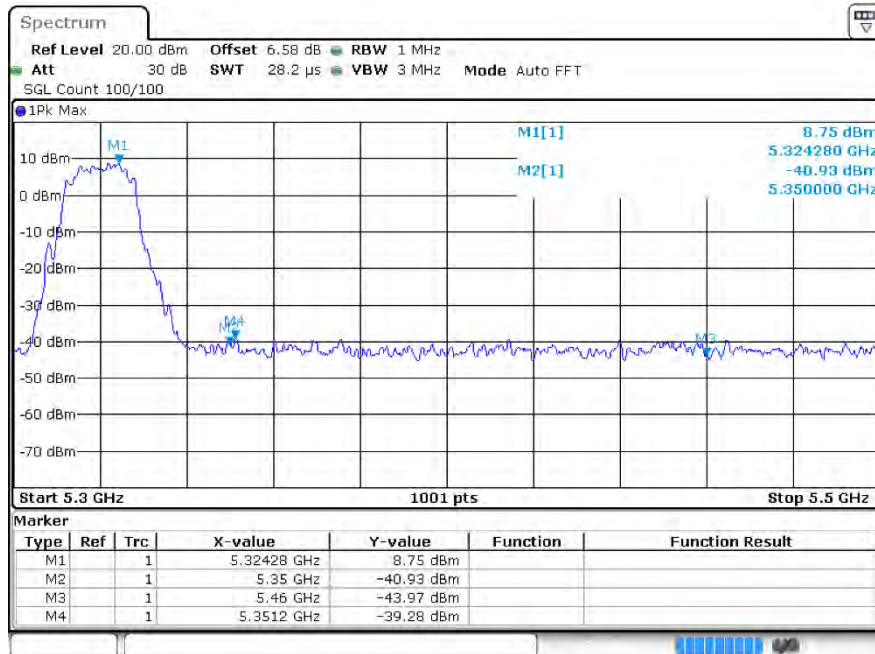


Restrict Band a 5320MHz Ant1 Average




Restrict Banda 5500MHz Ant1 Peak

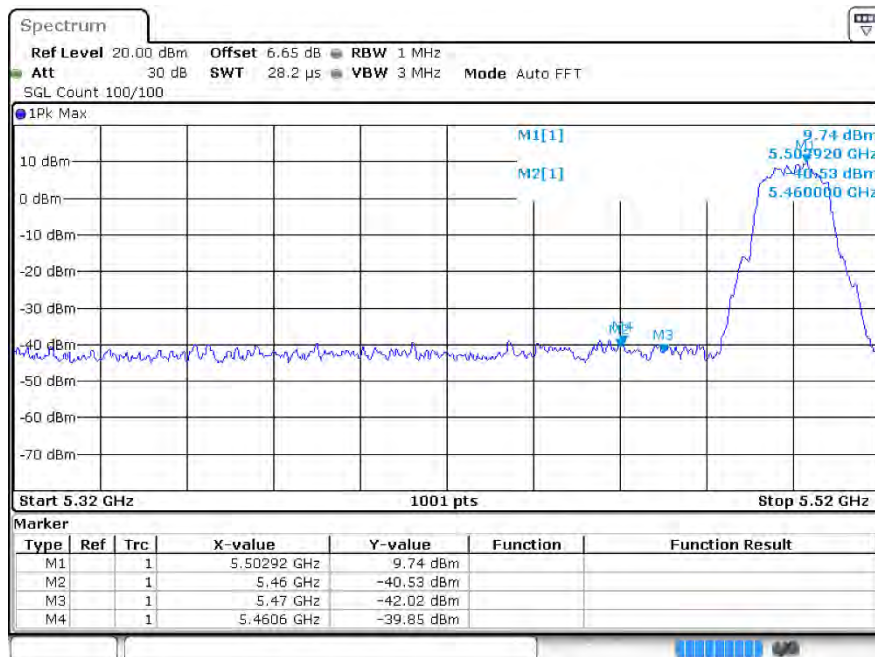

Restrict Band a 5500MHz Ant1 Average

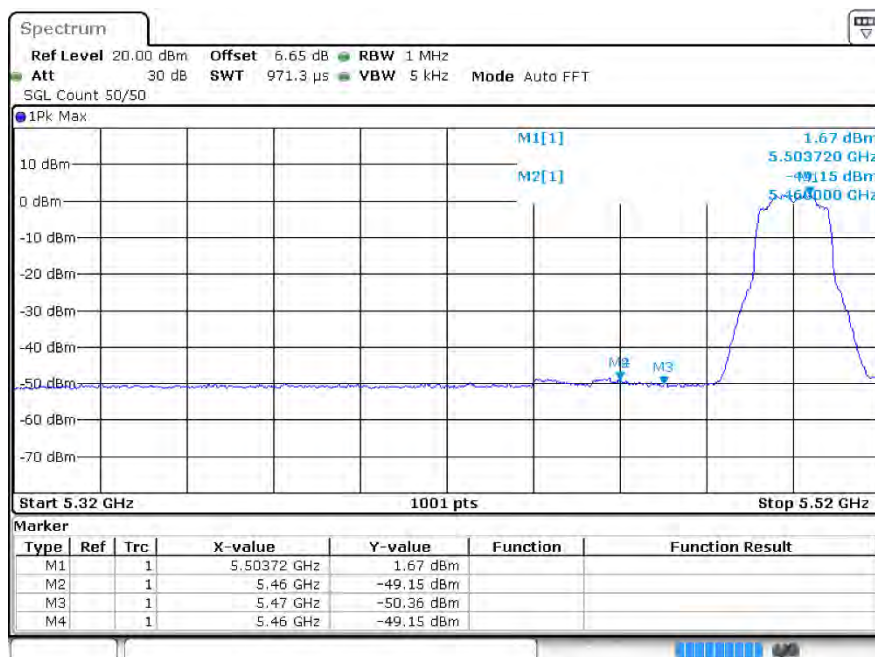


Restrict Banda 5700MHz Ant1 Peak

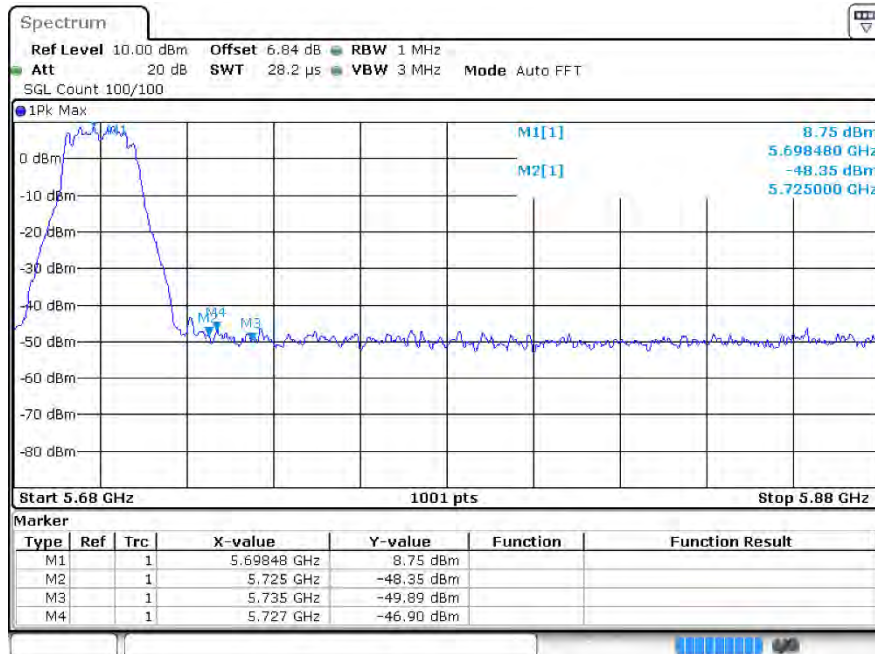


Restrict Band a 5700MHz Ant1 Average




Restrict Bandn20 5180MHz Ant1 Peak

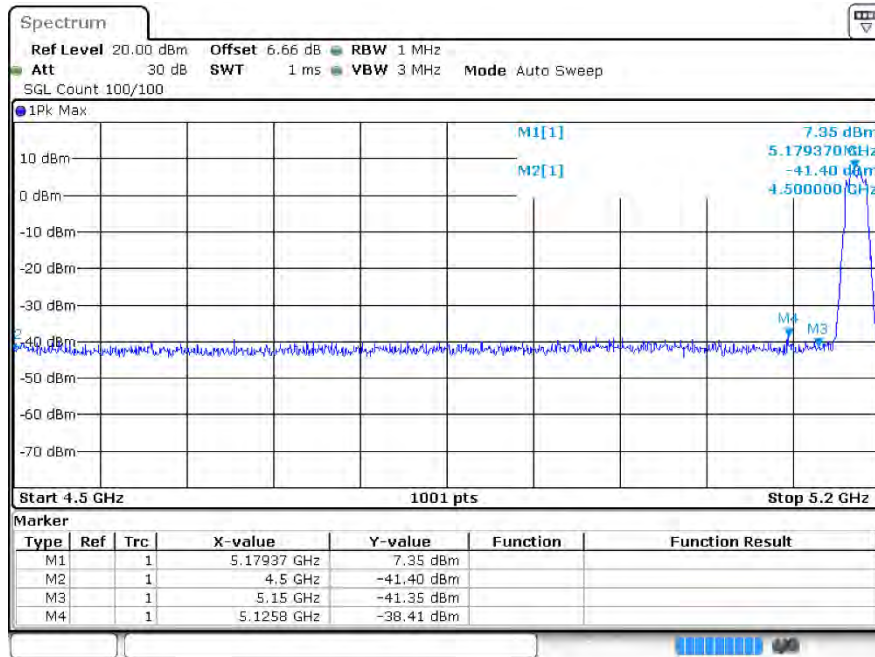


Restrict Band n20 5180MHz Ant1 Average

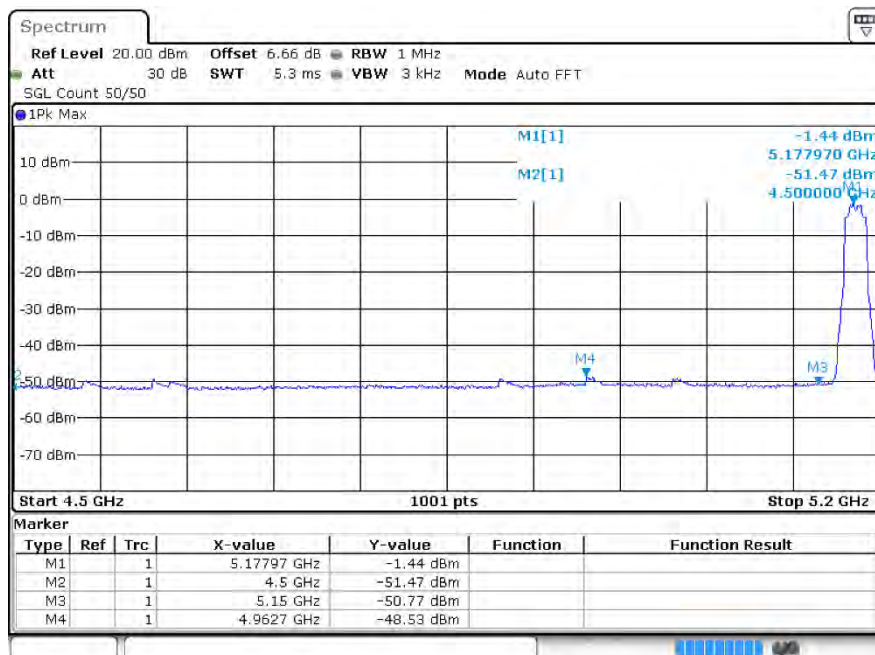


Restrict Bandn20 5240MHz Ant1 Peak

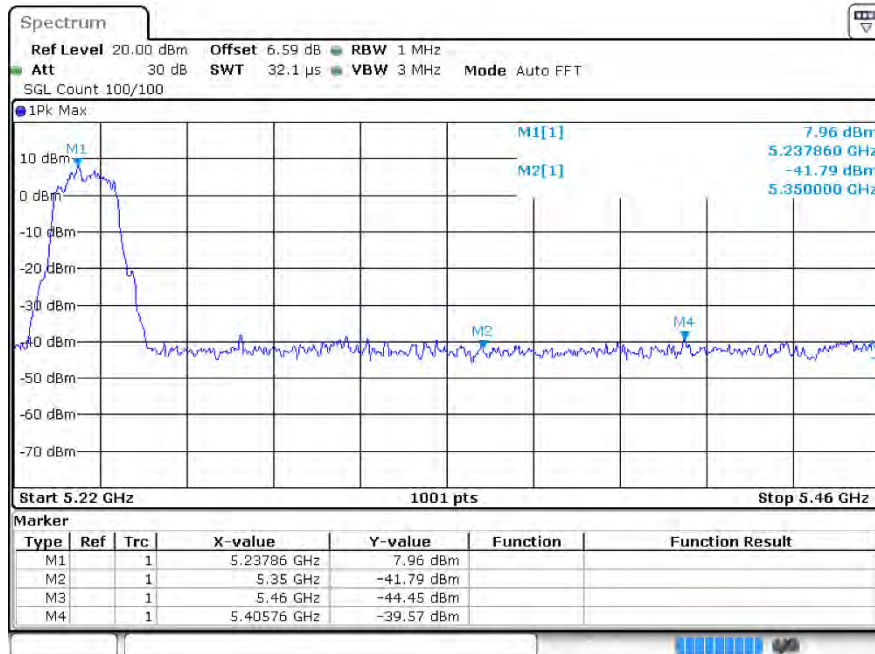


Restrict Band n20 5240MHz Ant1 Average

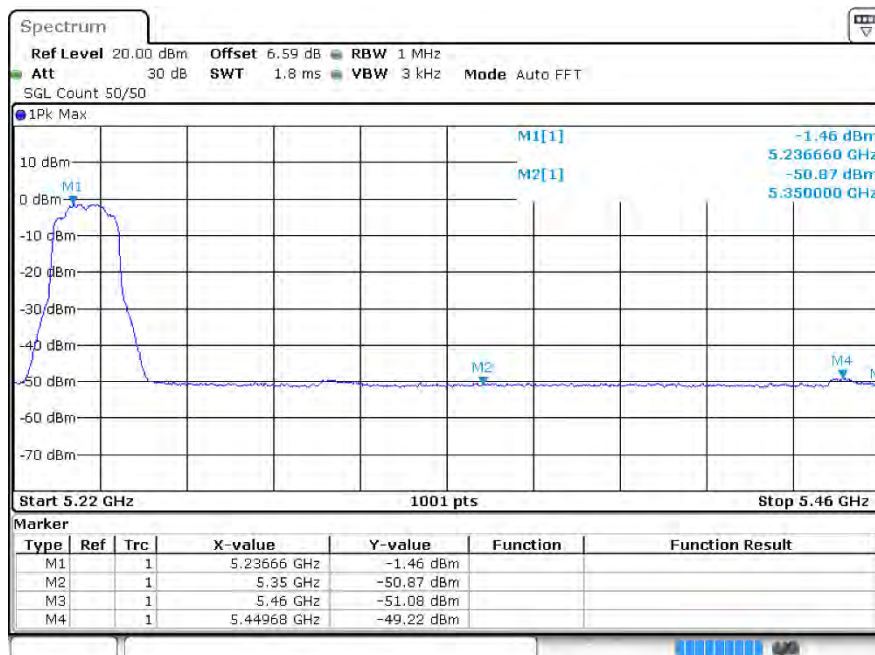


Restrict Bandn20 5260MHz Ant1 Peak

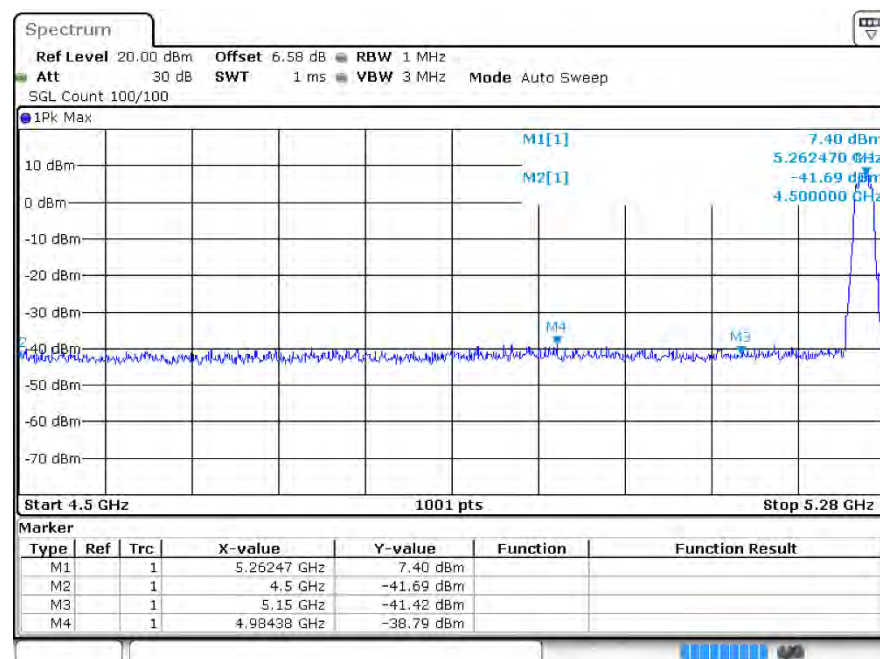


Restrict Band n20 5260MHz Ant1 Average

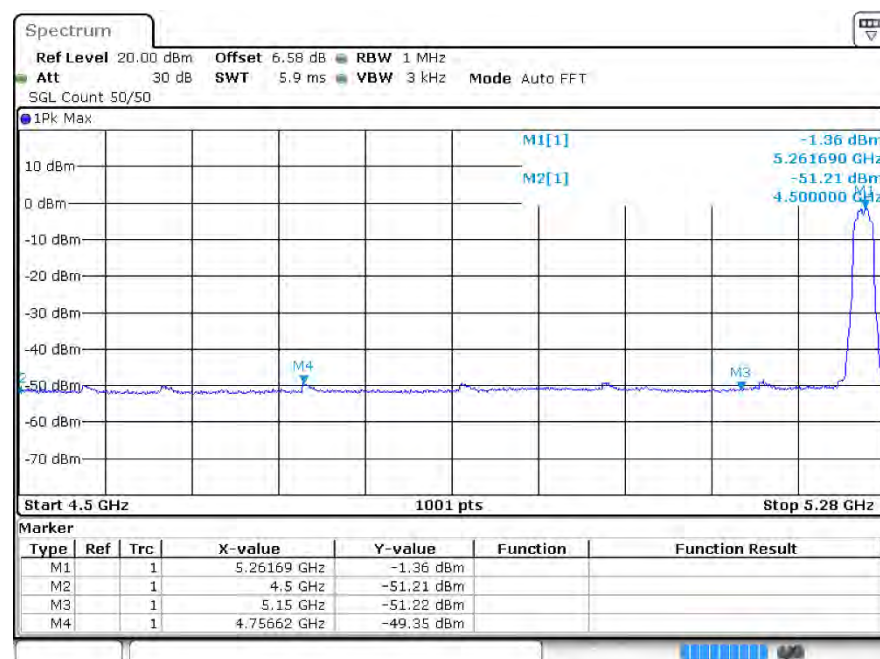


Restrict Bandn20 5320MHz Ant1 Peak

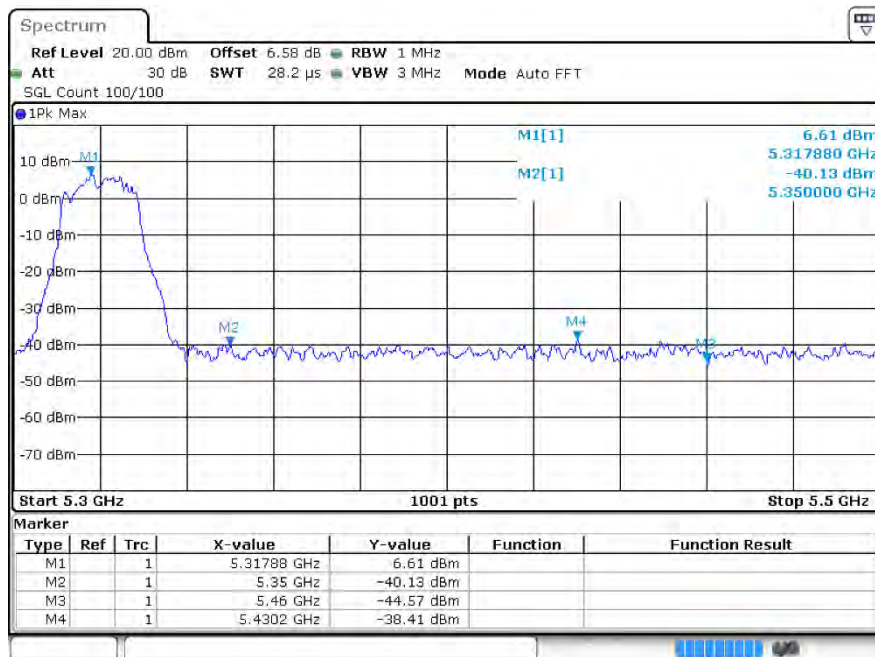


Restrict Band n20 5320MHz Ant1 Average

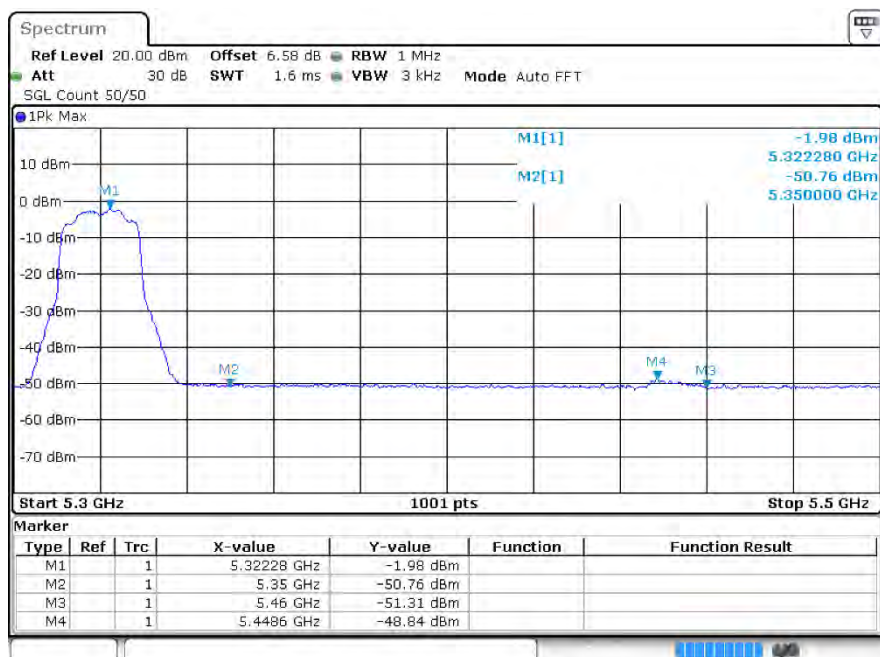


Restrict Band n20 5500MHz Ant1 Peak

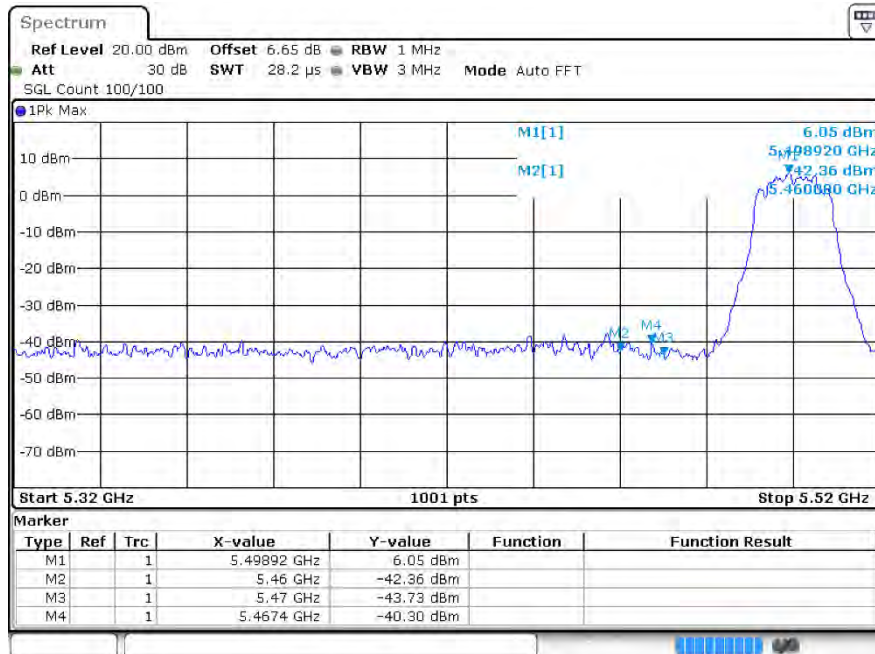


Restrict Band n20 5500MHz Ant1 Average

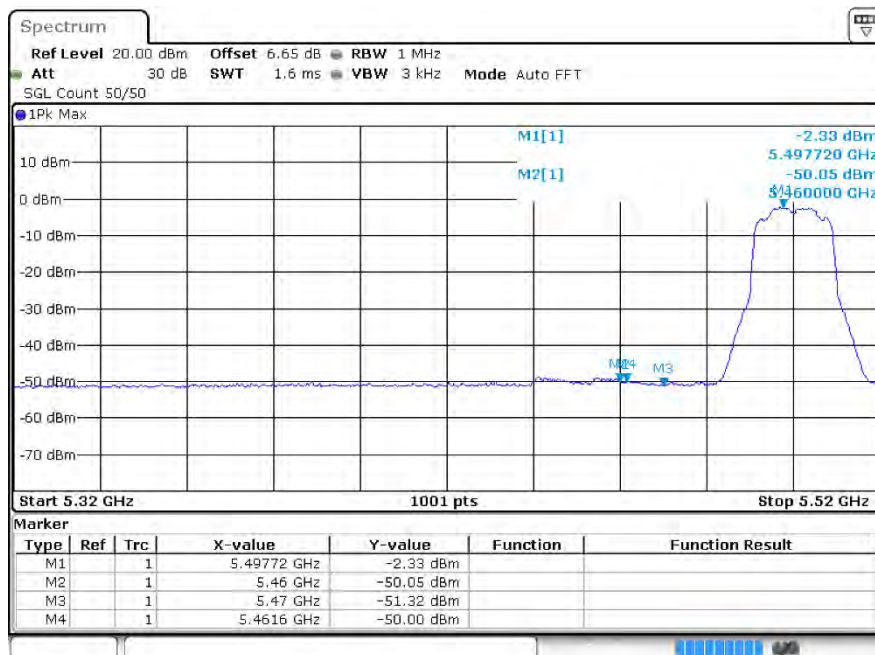


Restrict Bandn20 5700MHz Ant1 Peak

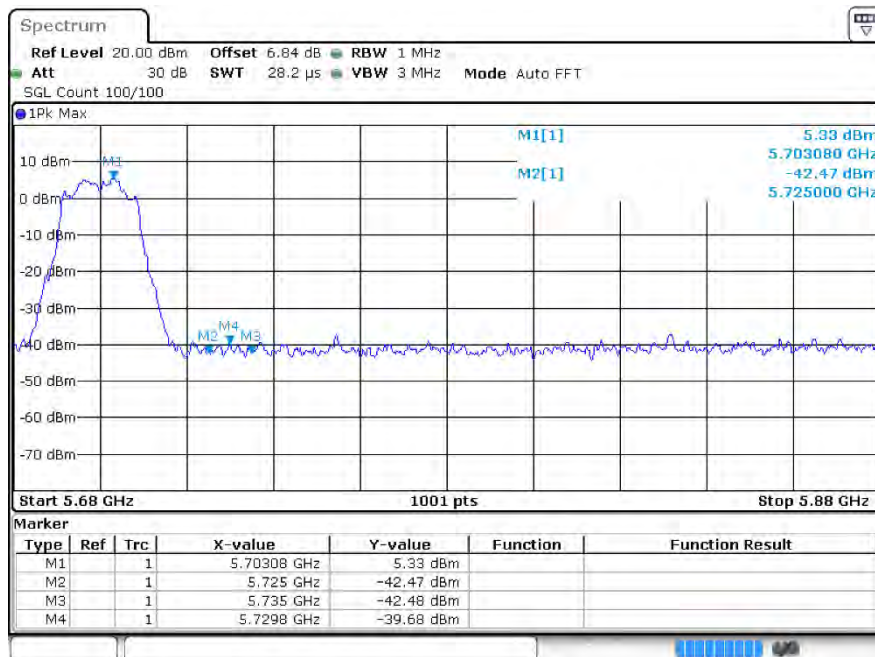


Restrict Band n20 5700MHz Ant1 Average

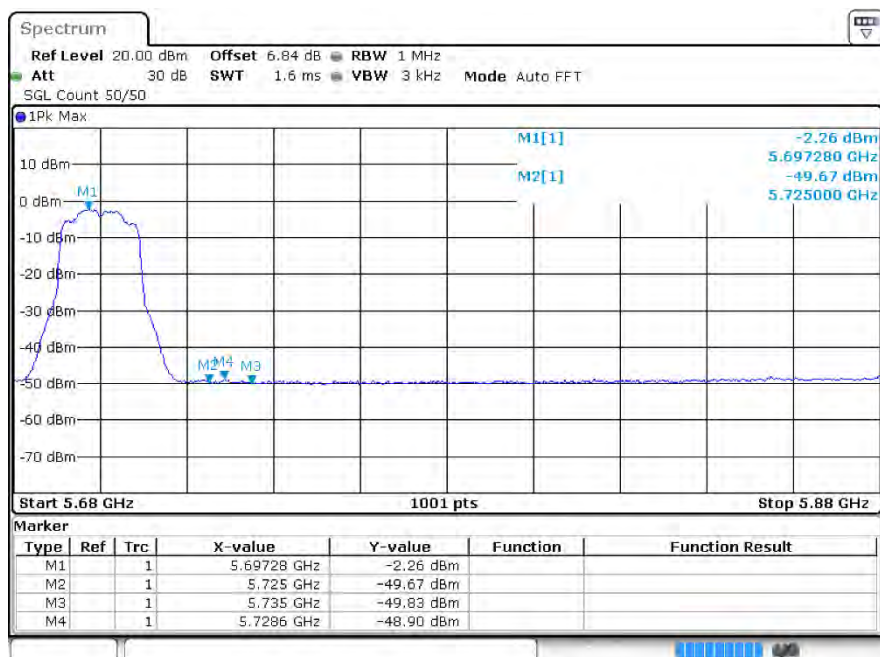


Restrict Bandn40 5190MHz Ant1 Peak

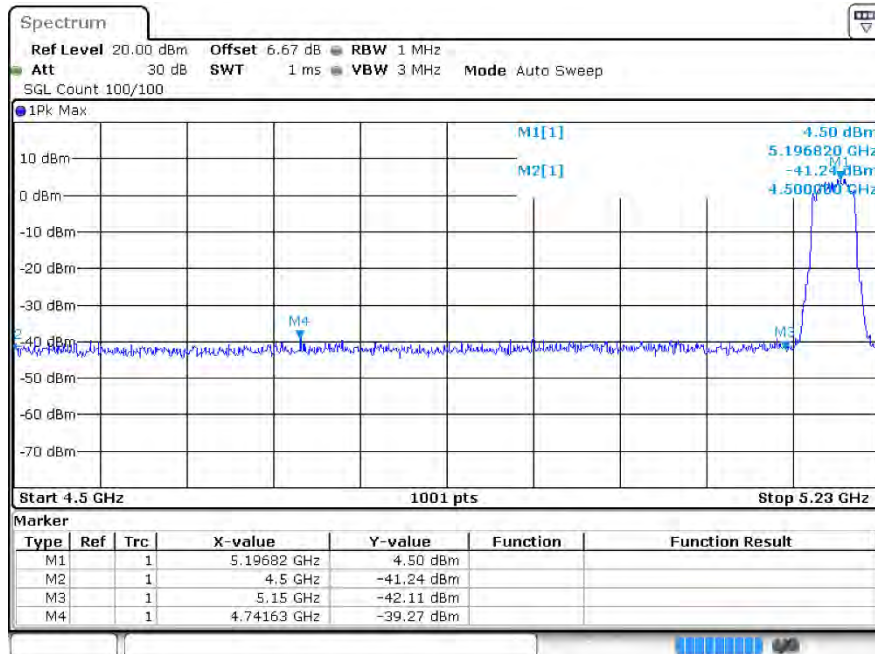


Restrict Band n40 5190MHz Ant1 Average

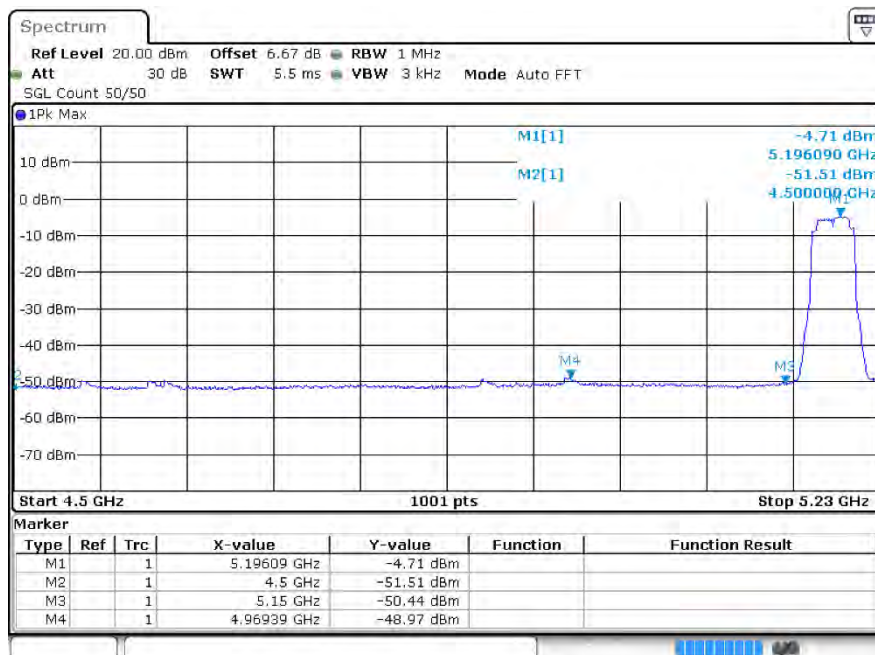


Restrict Bandn40 5230MHz Ant1 Peak

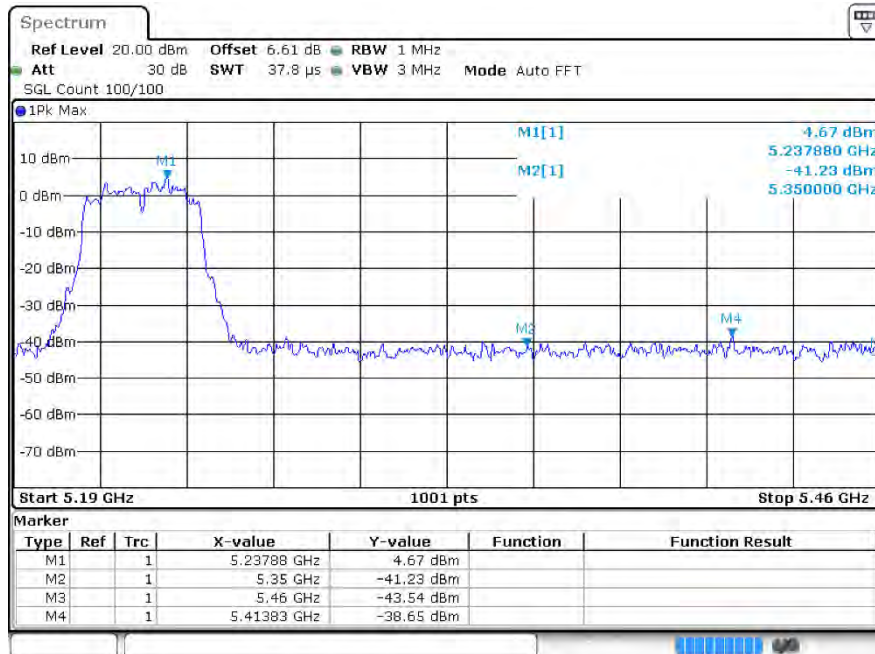


Restrict Band n40 5230MHz Ant1 Average

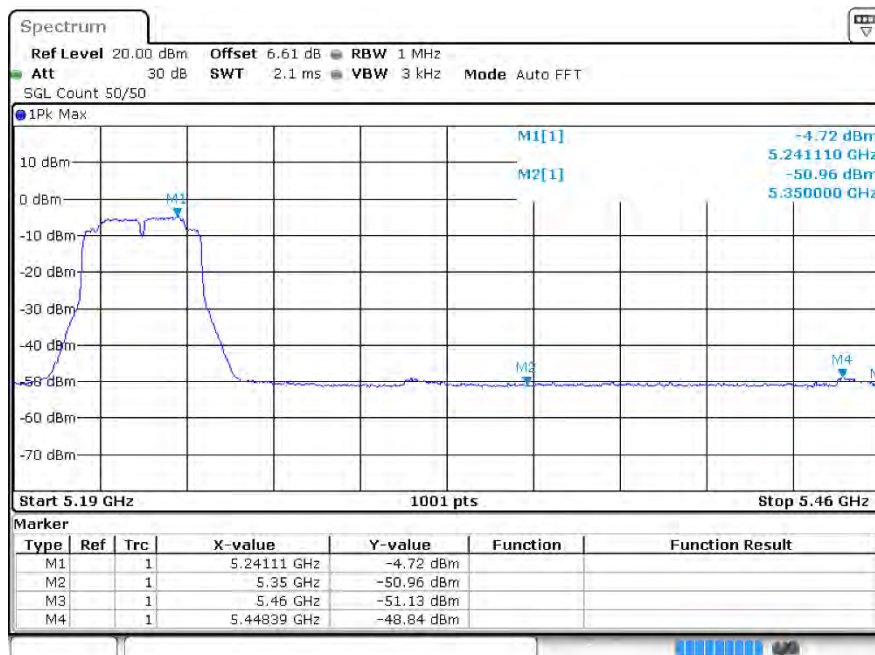


Restrict Bandn40 5270MHz Ant1 Peak

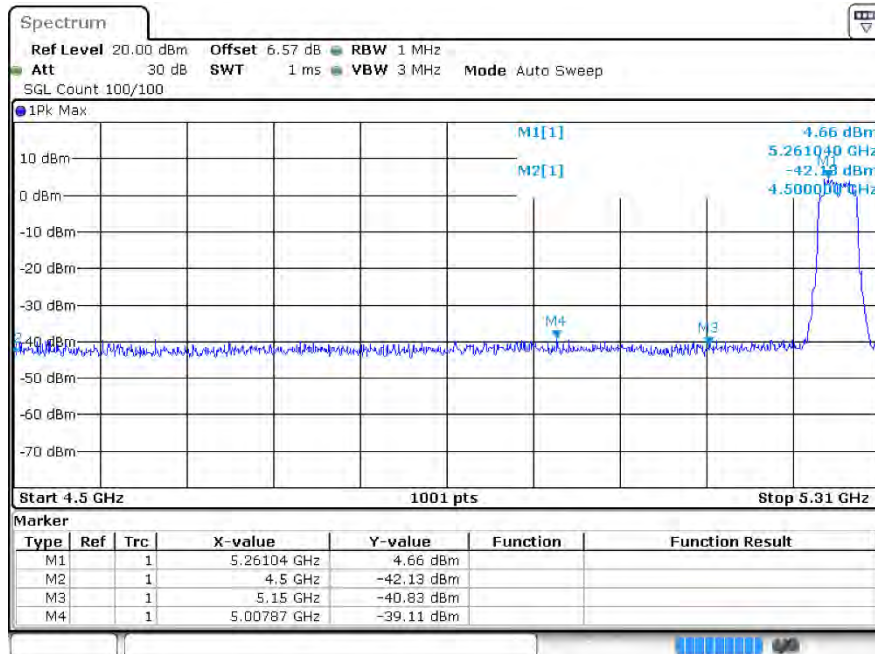


Restrict Band n40 5270MHz Ant1 Average

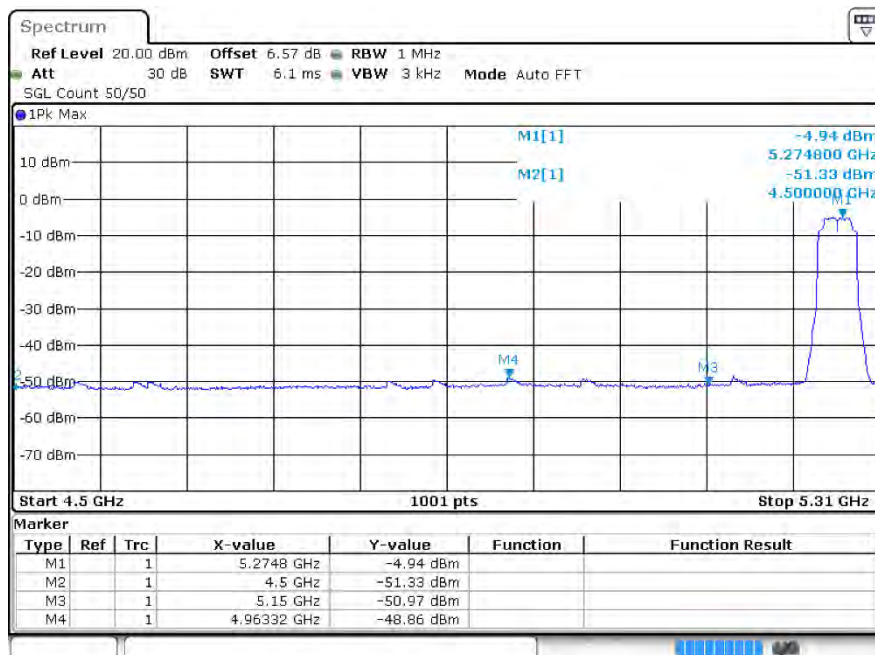


Restrict Bandn40 5310MHz Ant1 Peak

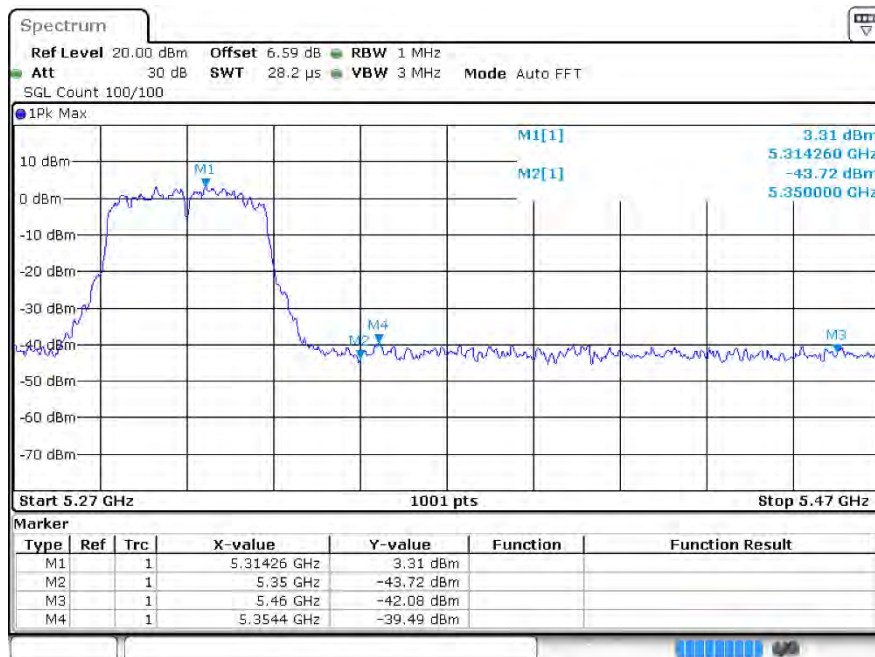


Restrict Band n40 5310MHz Ant1 Average

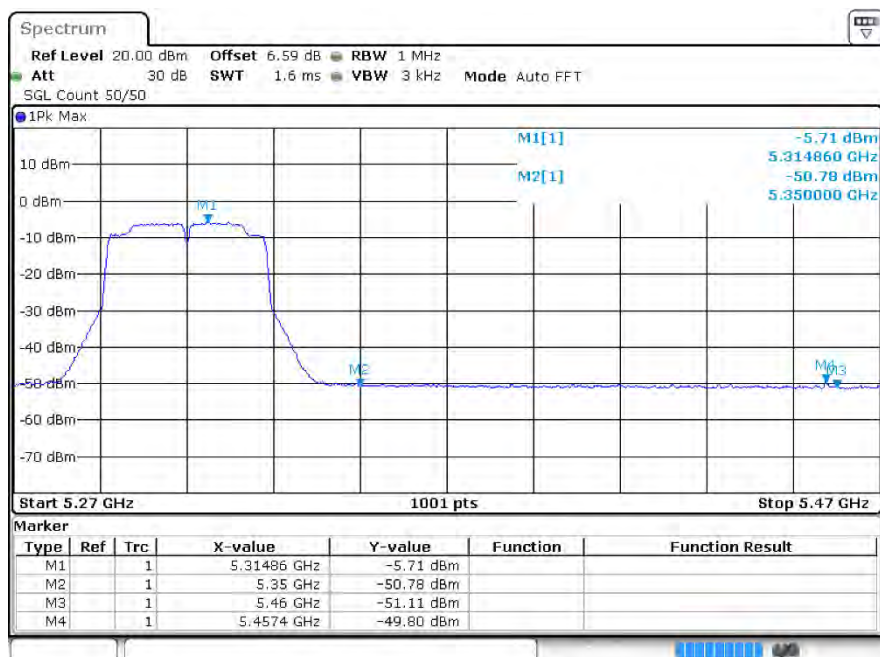


Restrict Bandn40 5510MHz Ant1 Peak

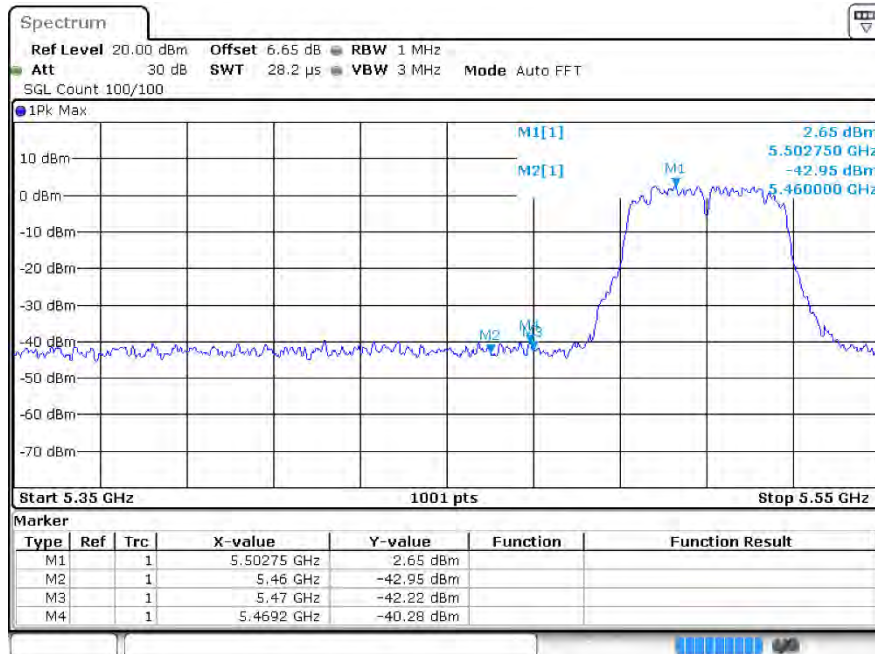

Restrict Band n40 5510MHz Ant1 Average

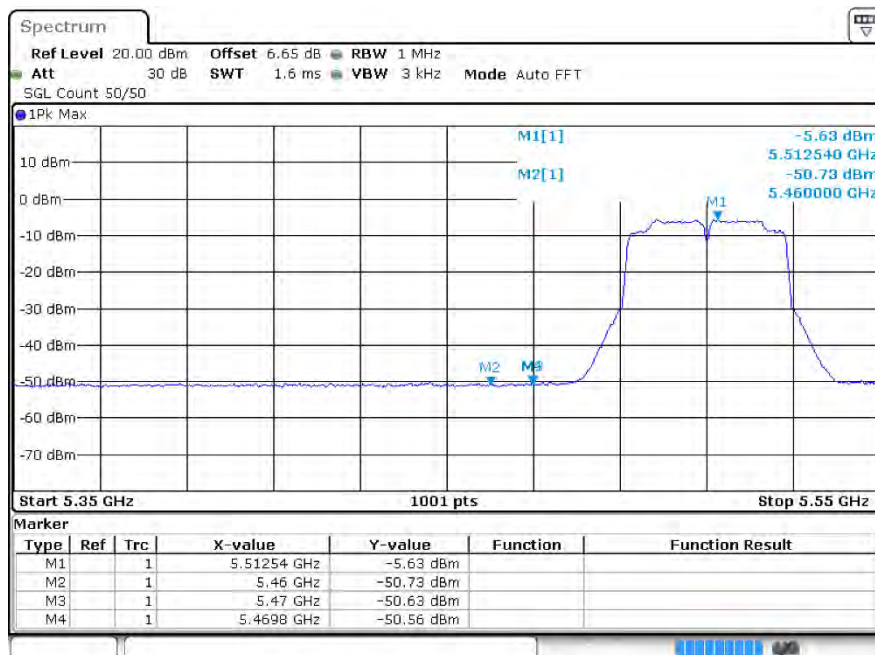


Restrict Bandn40 5670MHz Ant1 Peak

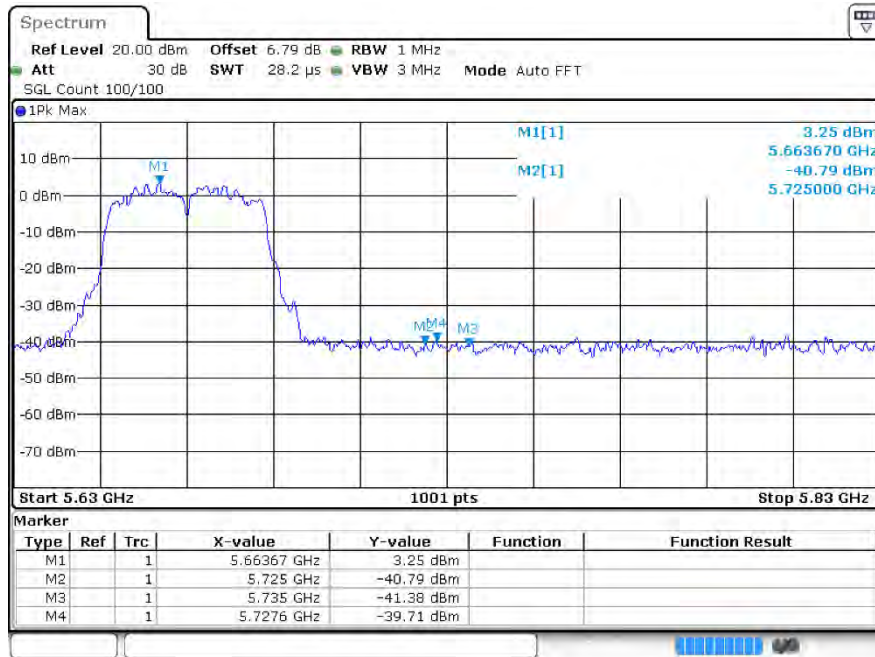


Restrict Band n40 5670MHz Ant1 Average




Restrict Bandac20 5180MHz Ant1 Peak

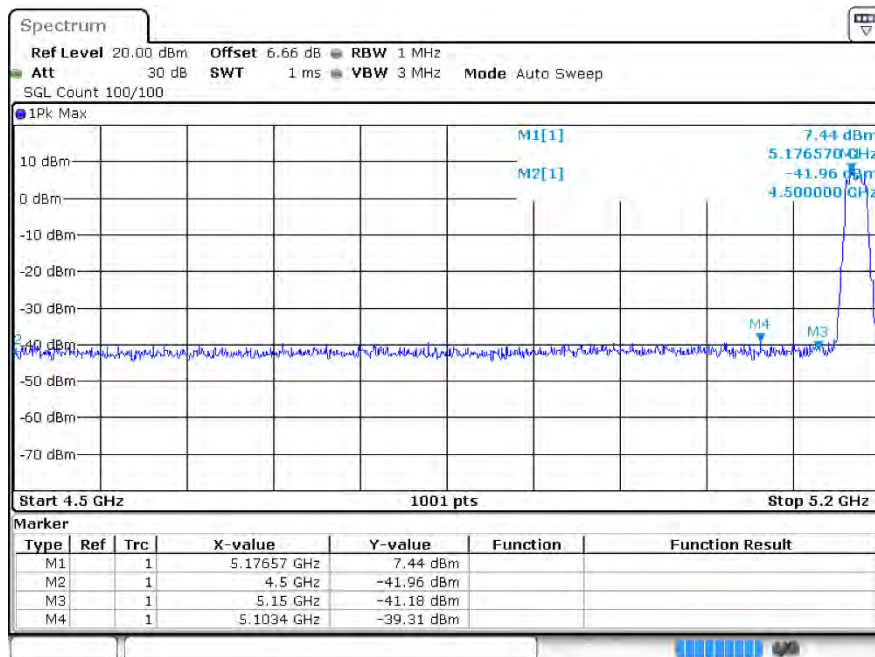


Restrict Band ac20 5180MHz Ant1 Average

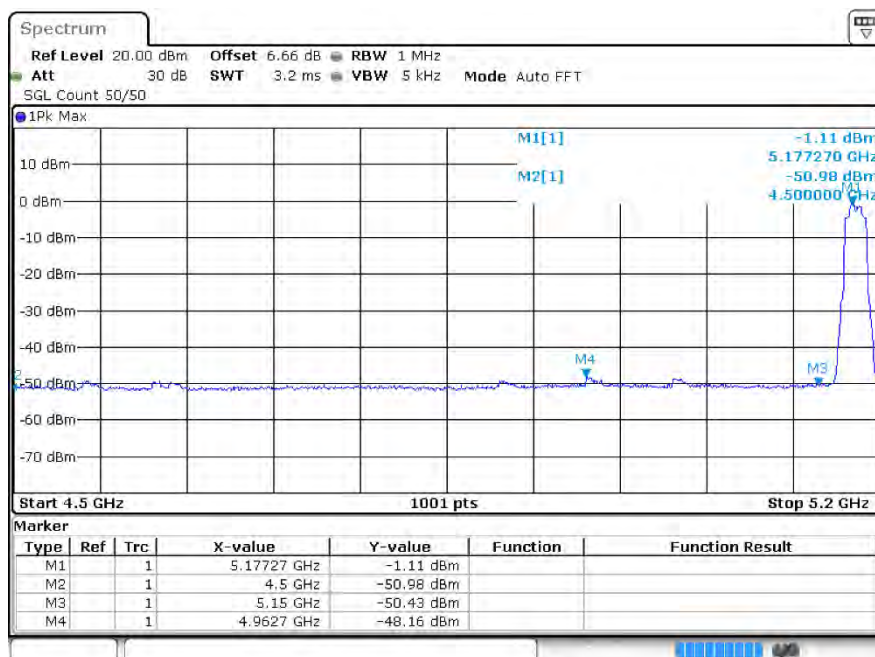


Restrict Bandac20 5240MHz Ant1 Peak

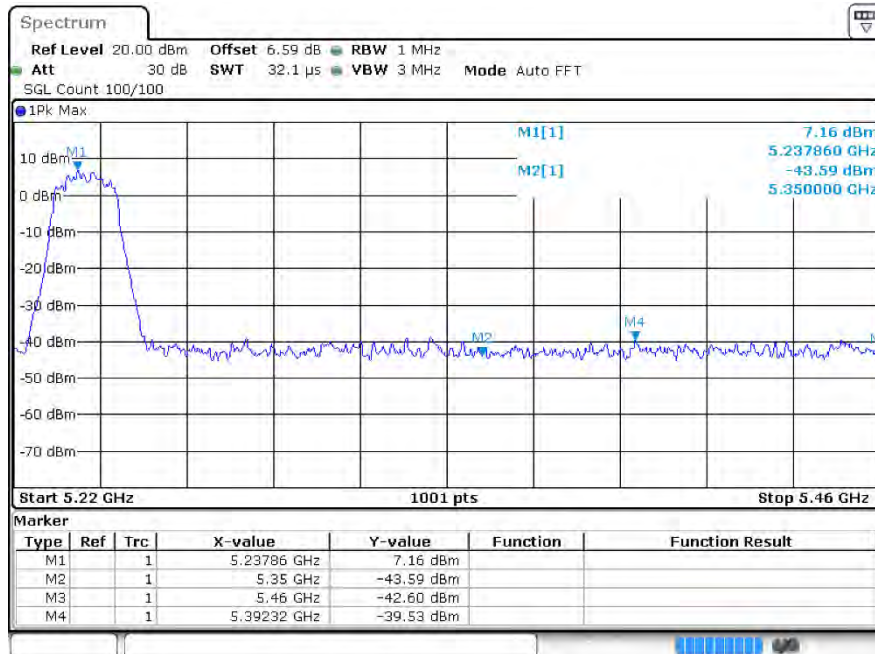


Restrict Band ac20 5240MHz Ant1 Average

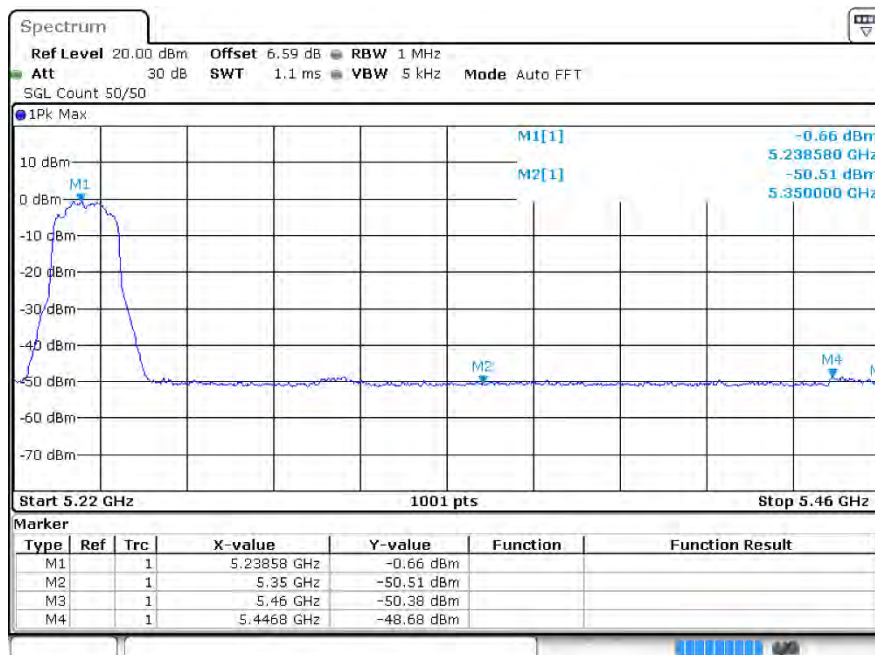


Restrict Bandac20 5260MHz Ant1 Peak

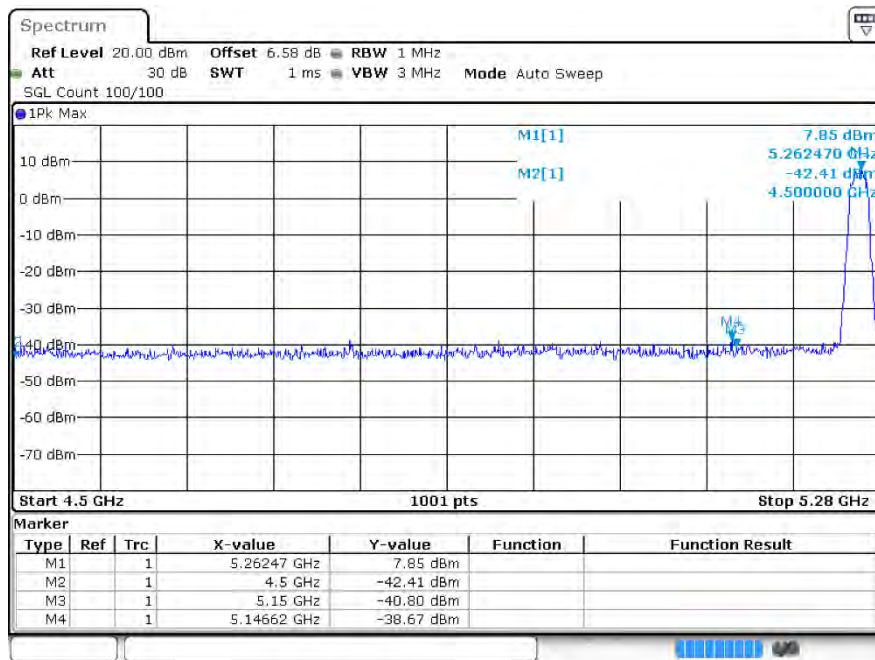

Restrict Band ac20 5260MHz Ant1 Average

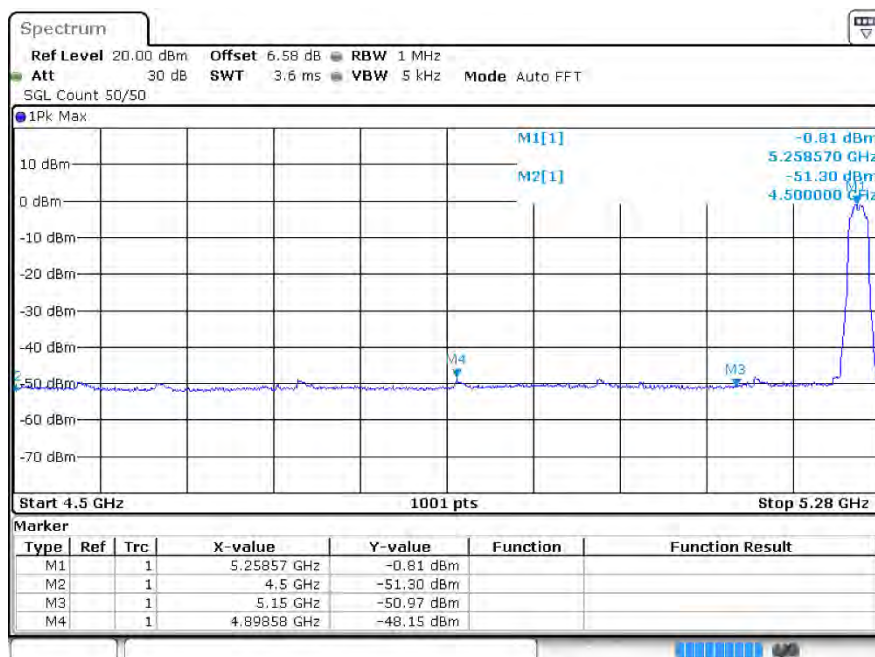


Restrict Bandac20 5320MHz Ant1 Peak

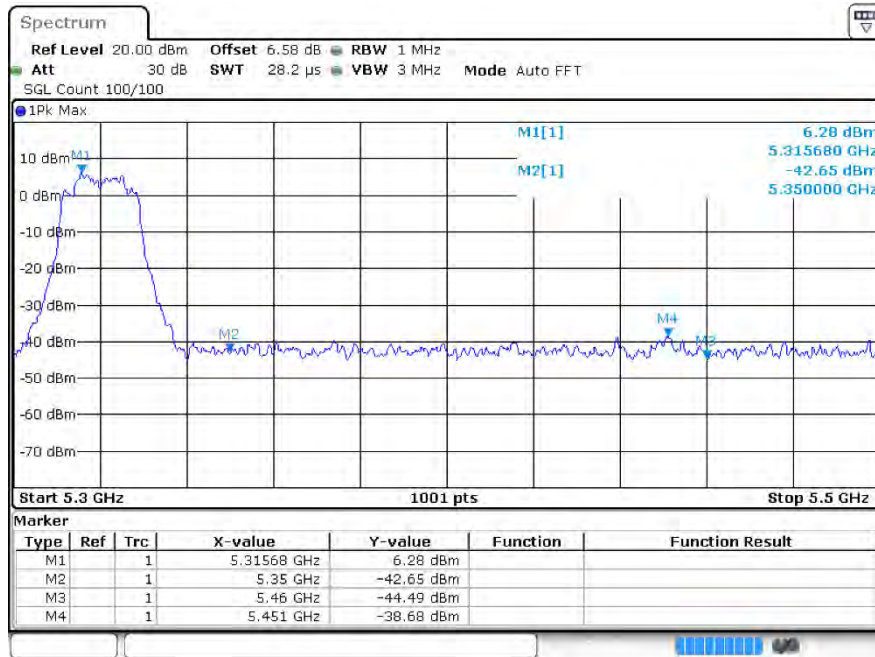


Restrict Band ac20 5320MHz Ant1 Average




Restrict Bandac20 5500MHz Ant1 Peak

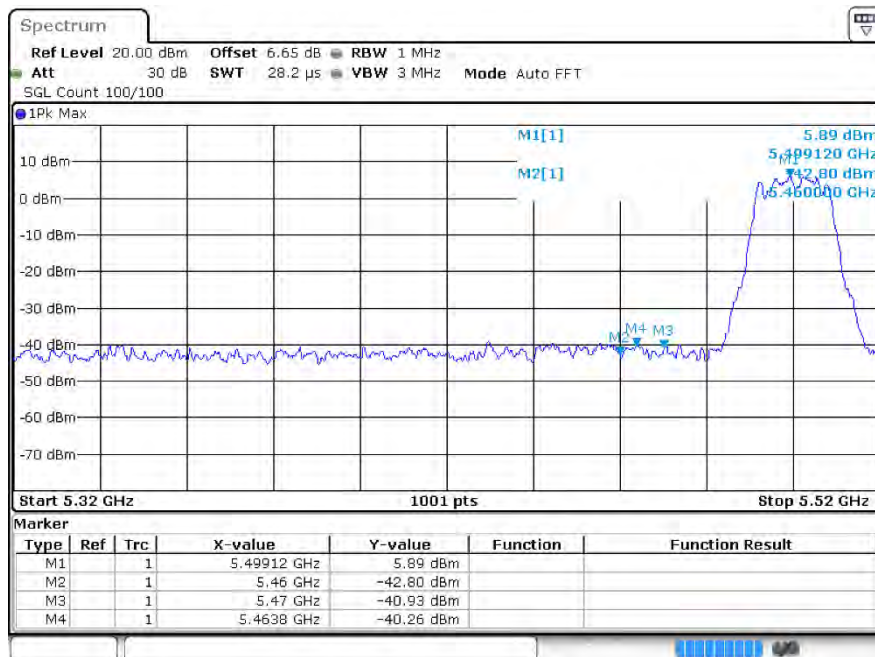


Restrict Band ac20 5500MHz Ant1 Average

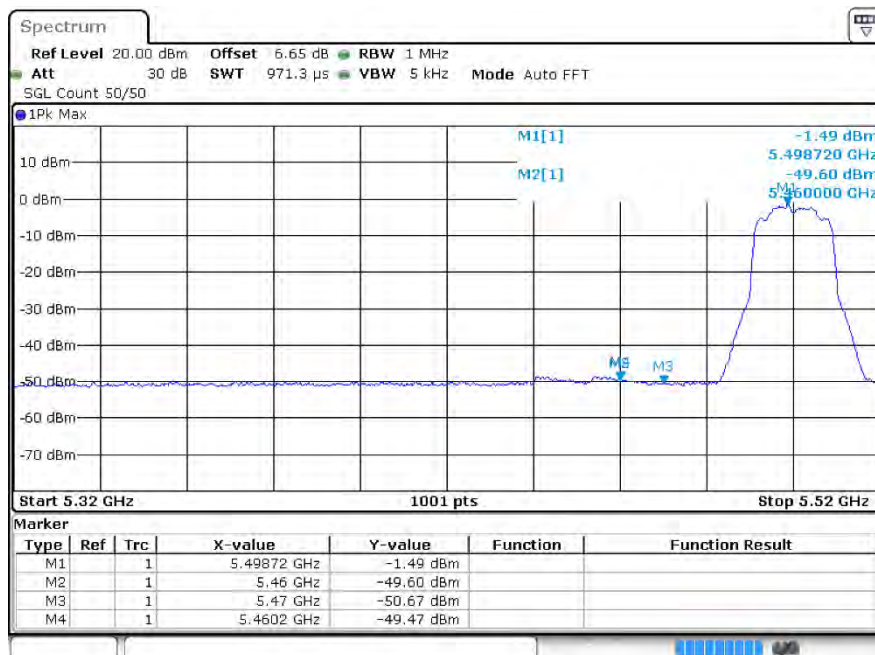

Restrict Bandac20 5700MHz Ant1 Peak

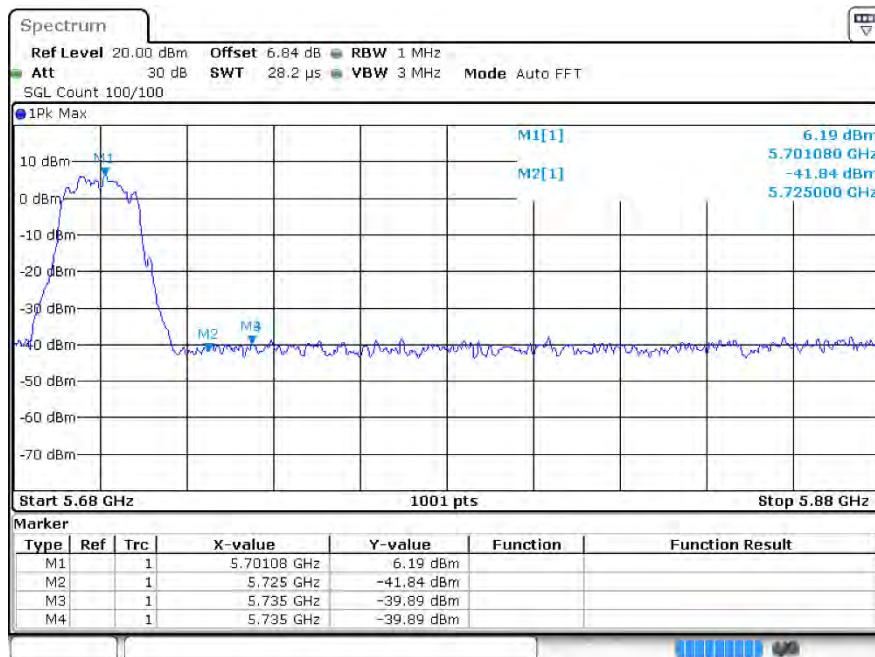


Restrict Band ac20 5700MHz Ant1 Average

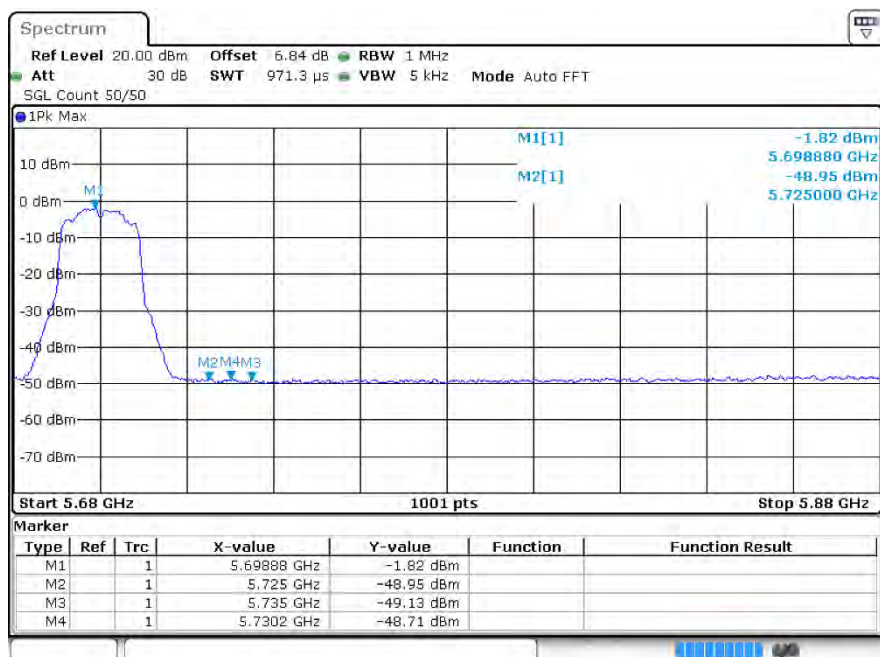





Restrict Bandac40 5190MHz Ant1 Peak

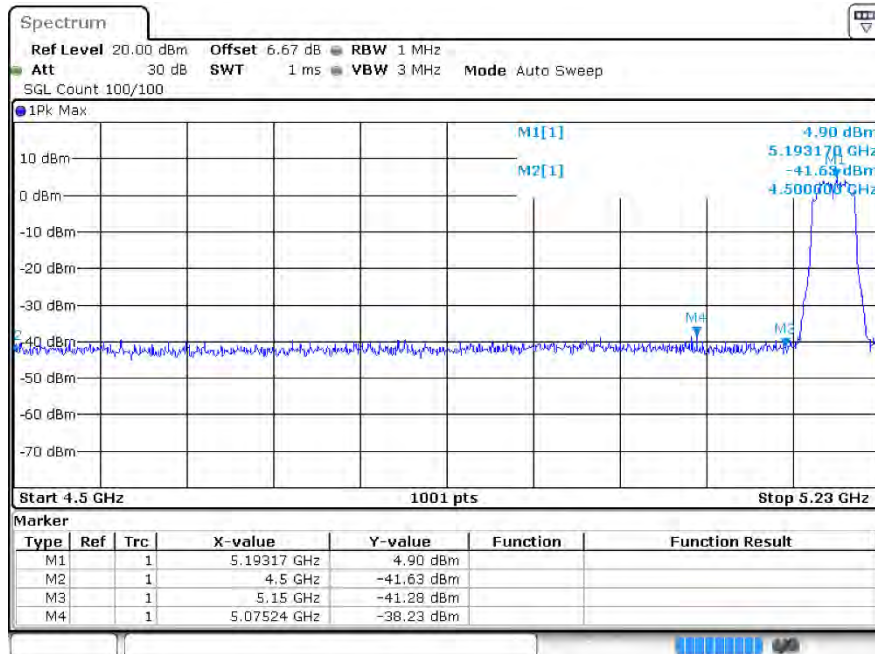


Restrict Band ac40 5190MHz Ant1 Average

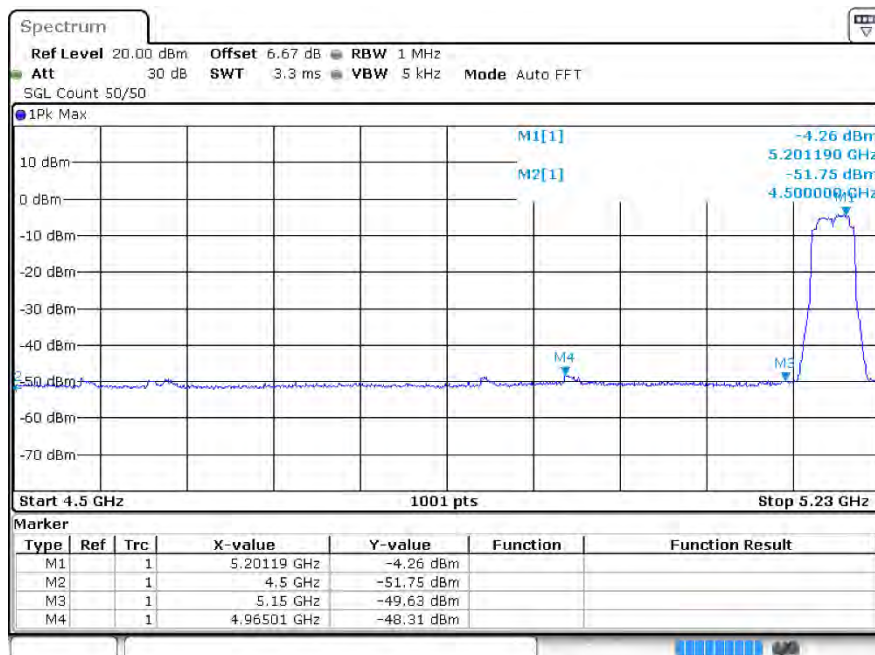


Restrict Bandac40 5230MHz Ant1 Peak

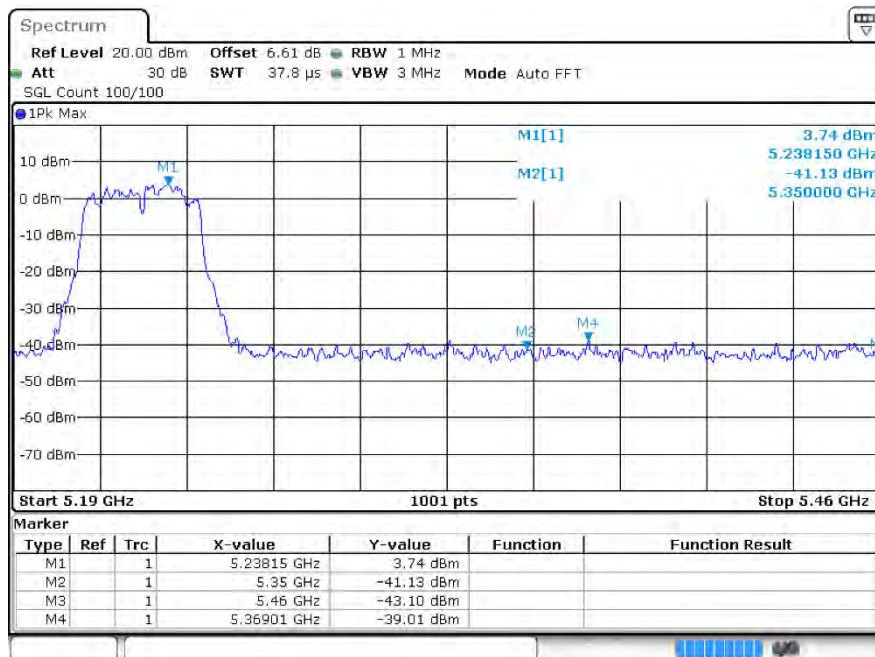


Restrict Band ac40 5230MHz Ant1 Average

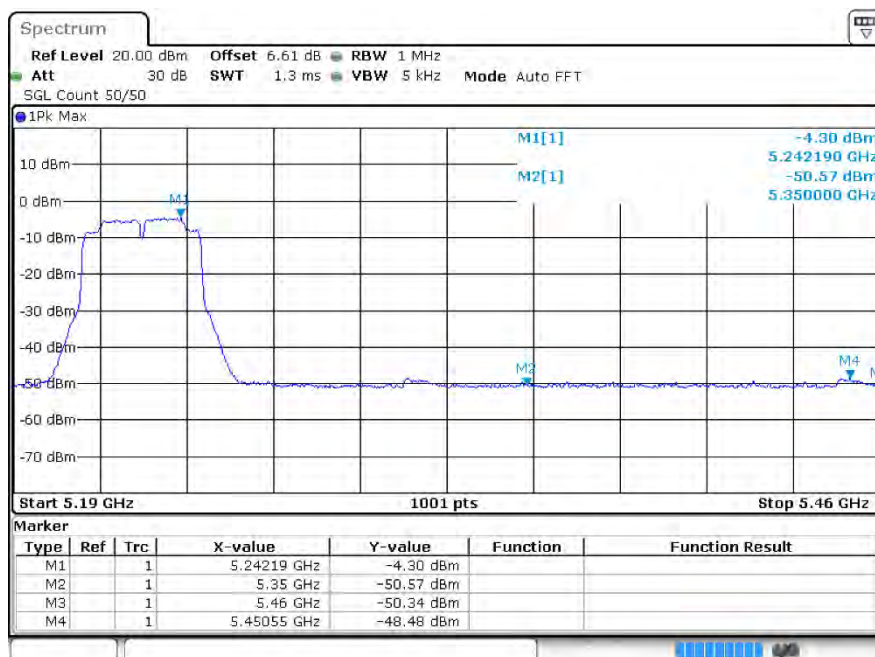


Restrict Bandac40 5270MHz Ant1 Peak

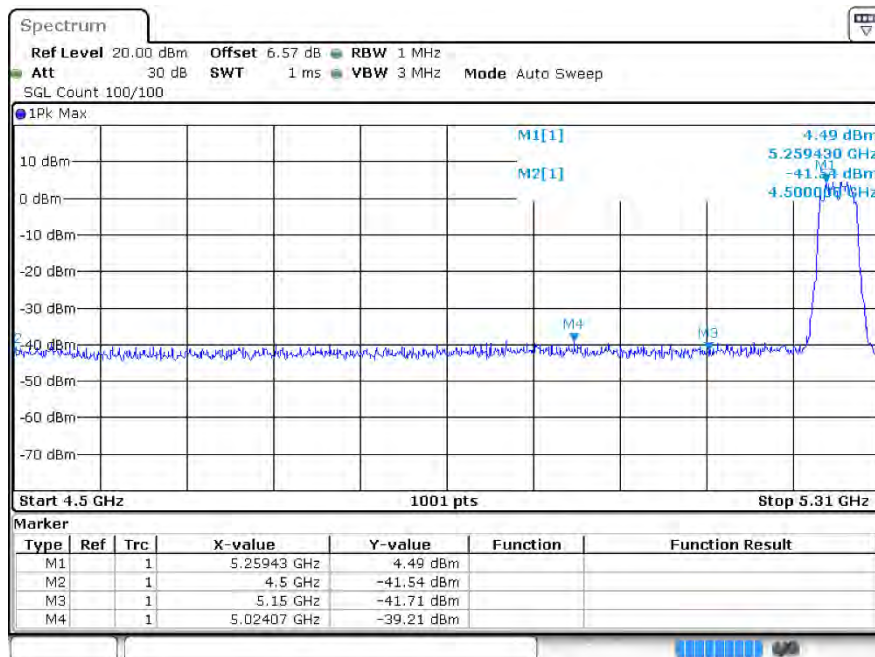


Restrict Band ac40 5270MHz Ant1 Average

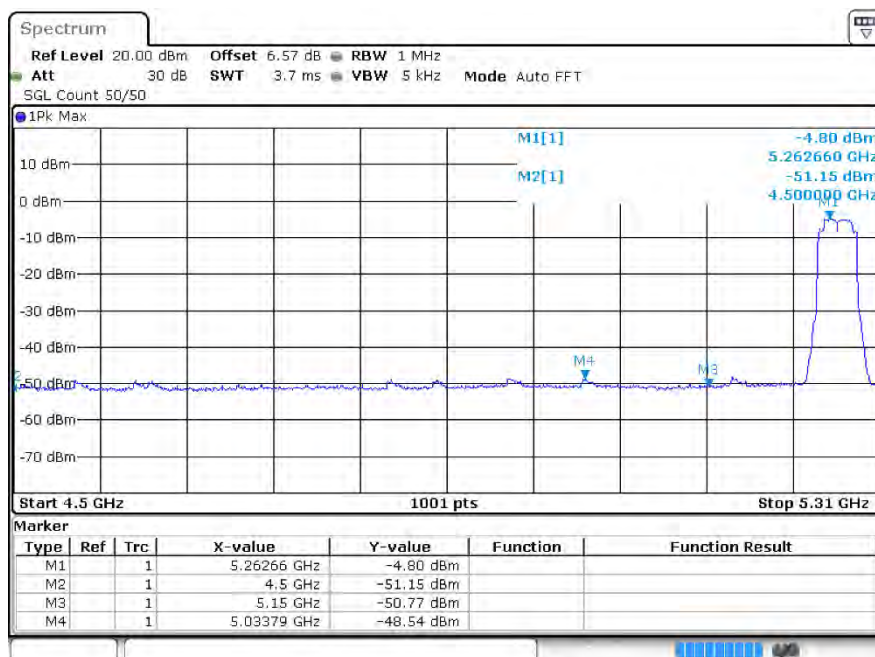


Restrict Bandac40 5310MHz Ant1 Peak

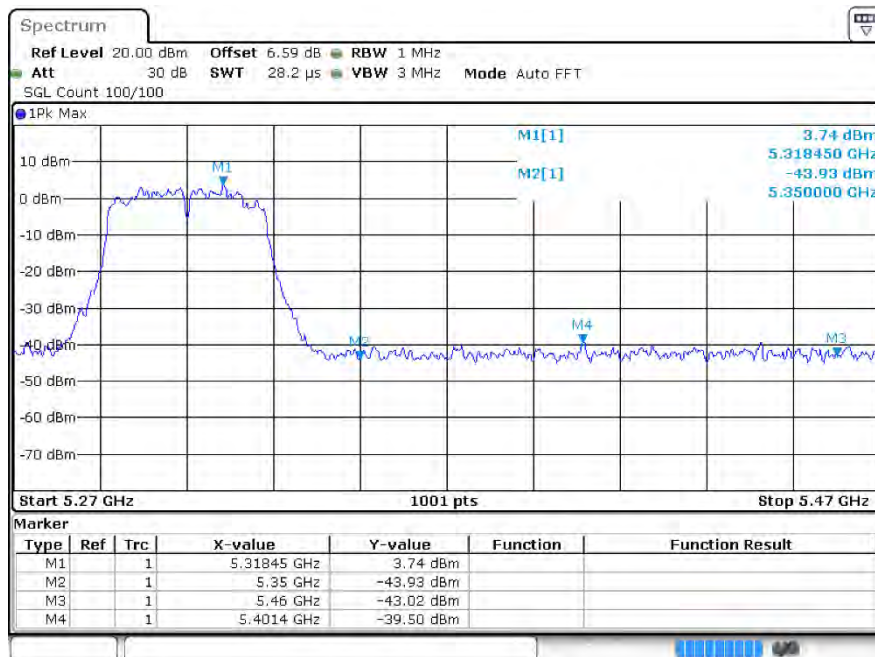

Restrict Band ac40 5310MHz Ant1 Average

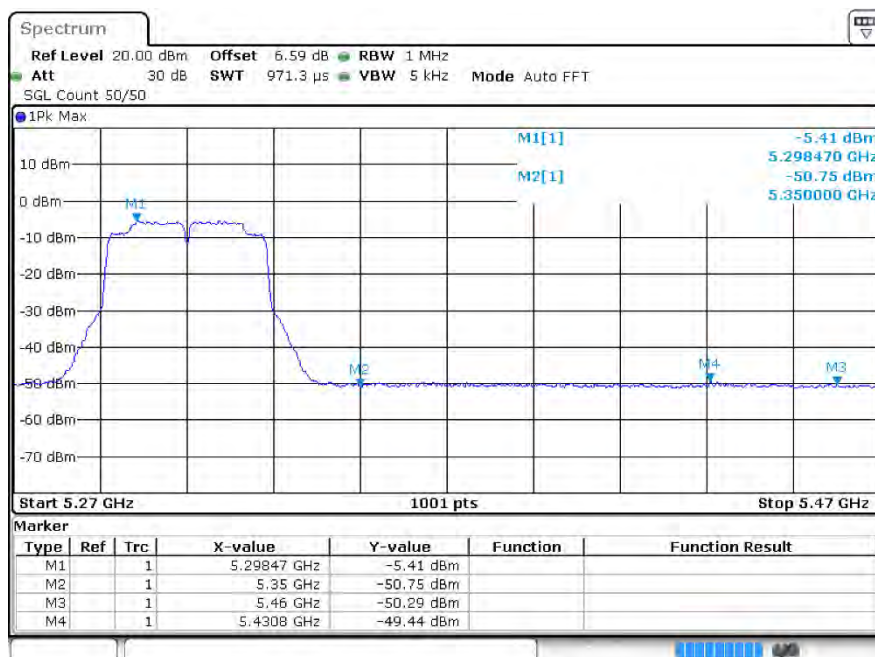


Restrict Bandac40 5510MHz Ant1 Peak

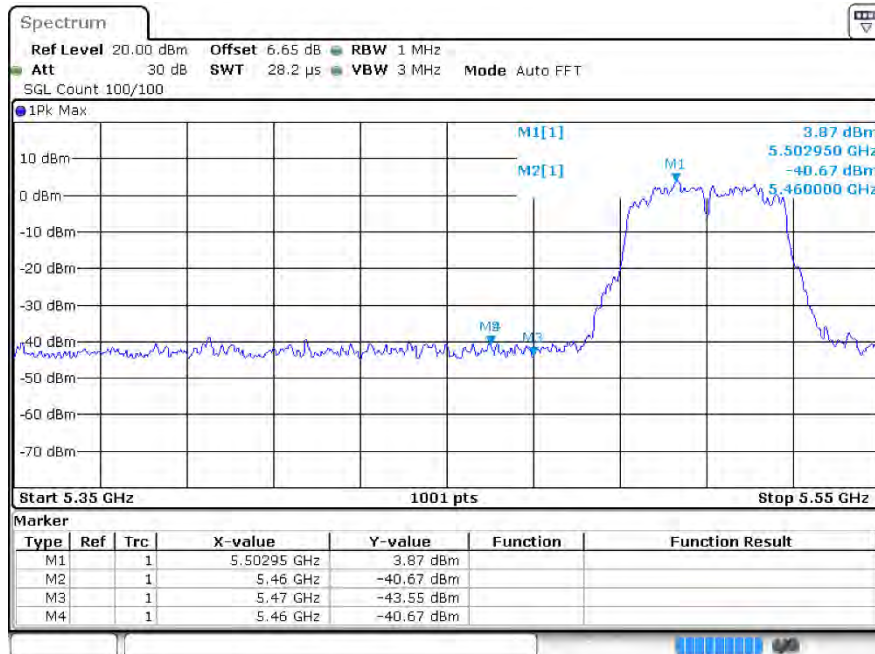


Restrict Band ac40 5510MHz Ant1 Average




Restrict Bandac40 5670MHz Ant1 Peak

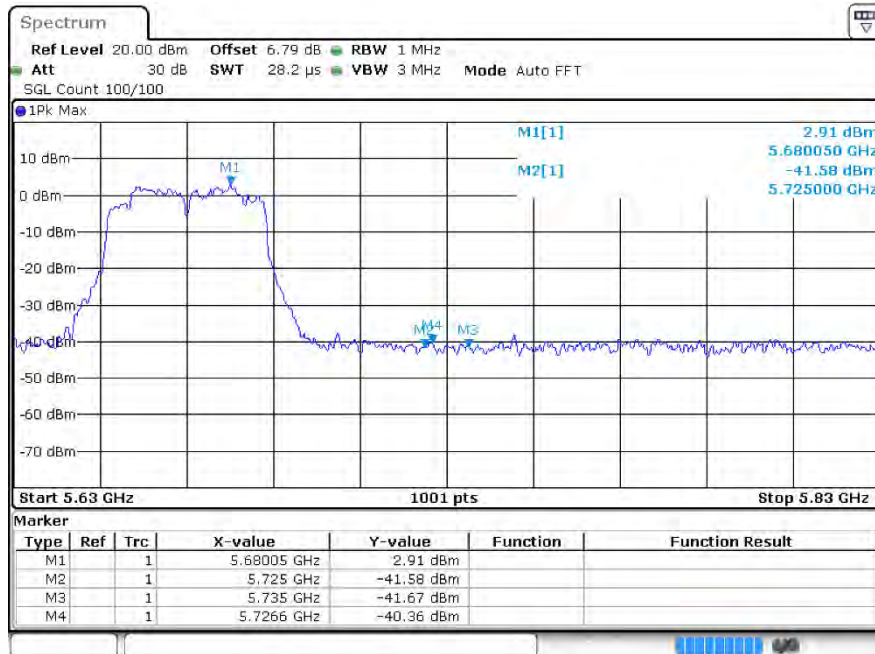


Restrict Band ac40 5670MHz Ant1 Average

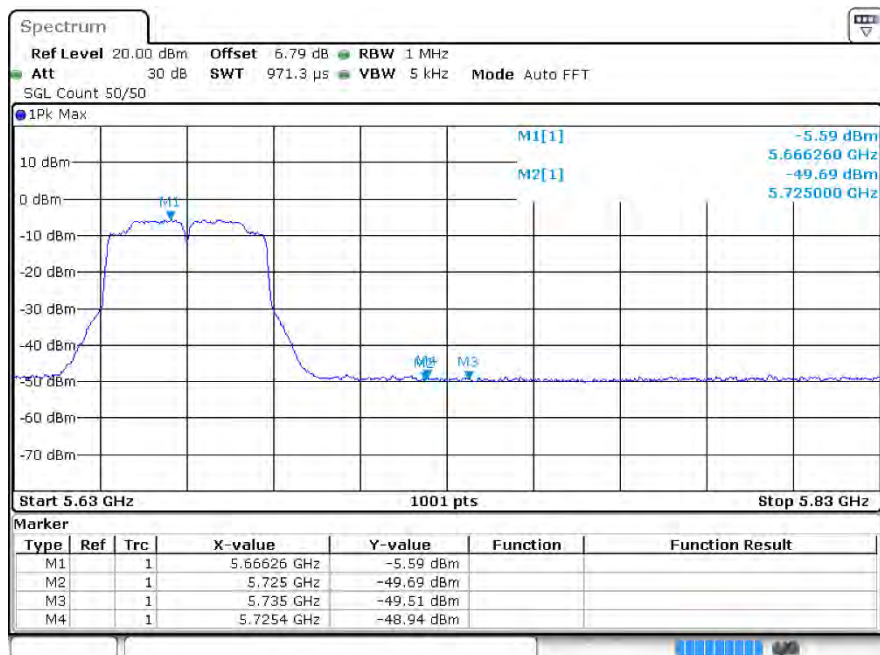


Restrict Bandac80 5210MHz Ant1 Peak

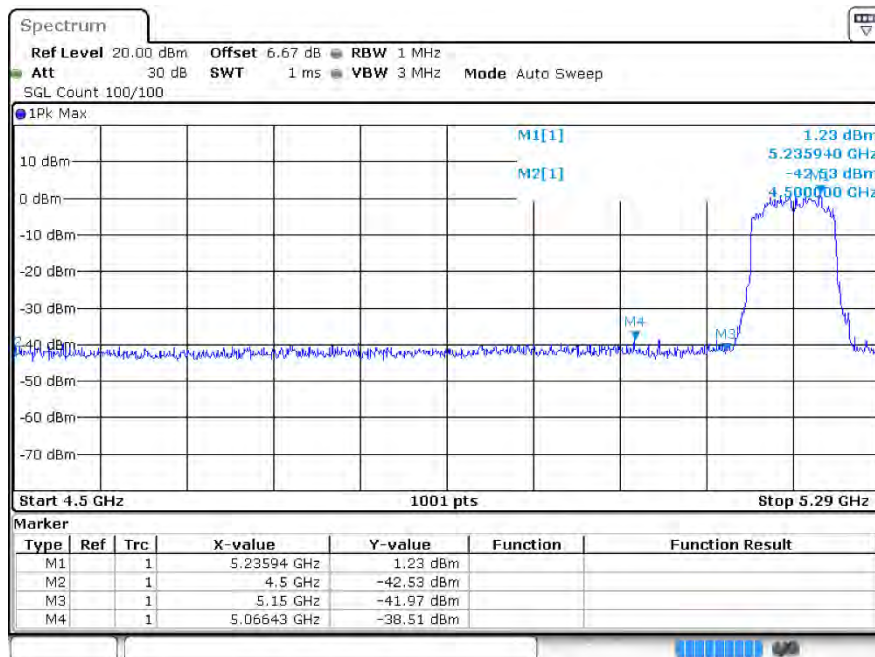


Restrict Band ac80 5210MHz Ant1 Average

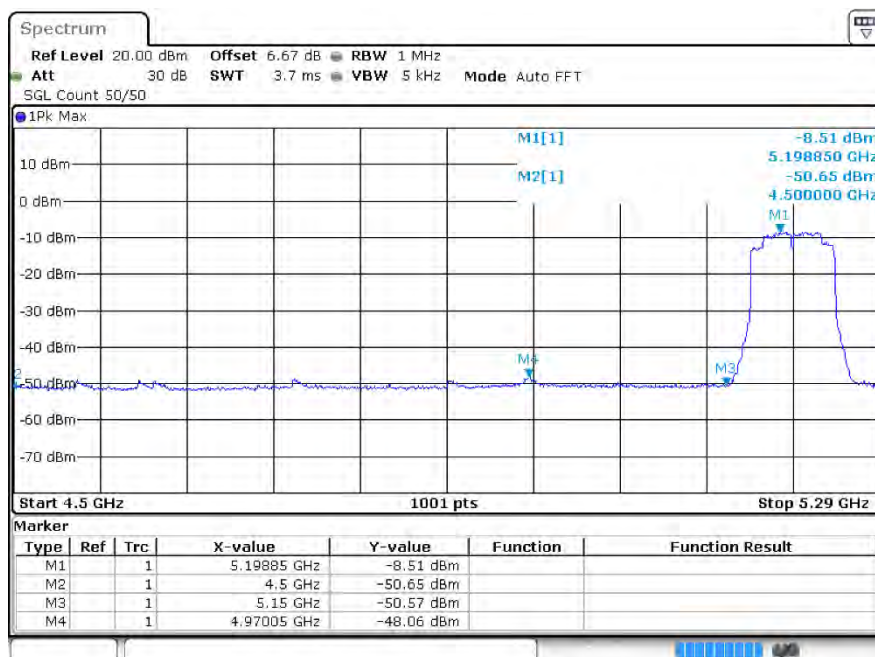


Restrict Bandac80 5290MHz Ant1 Peak

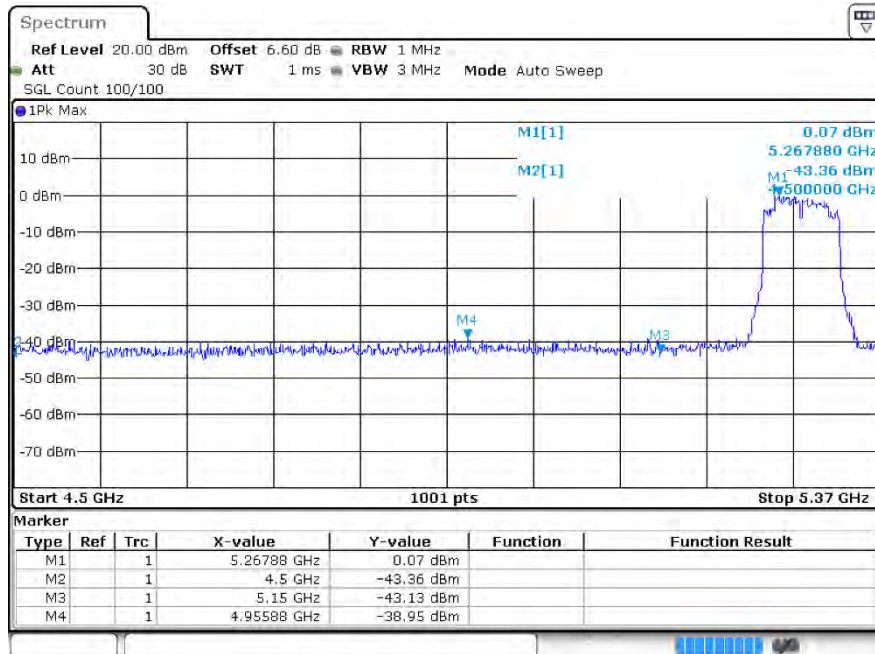


Restrict Band ac80 5290MHz Ant1 Average

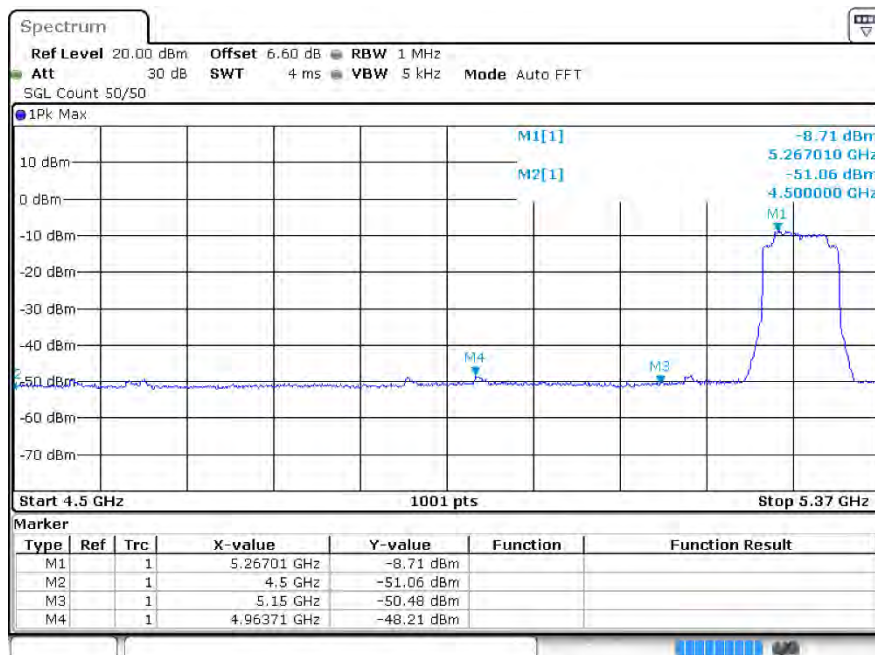


Restrict Bandac80 5530MHz Ant1 Peak

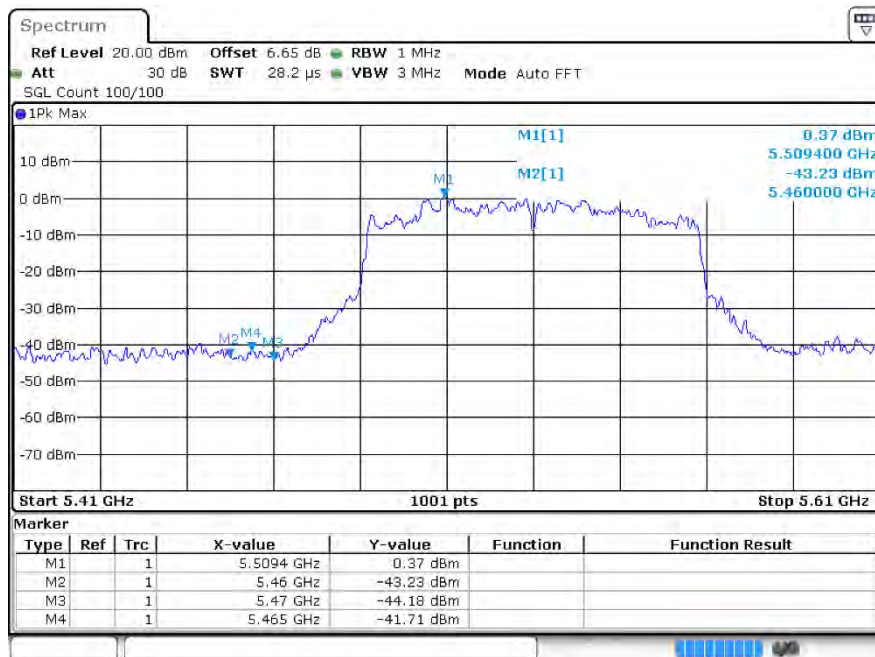


Restrict Band ac80 5530MHz Ant1 Average

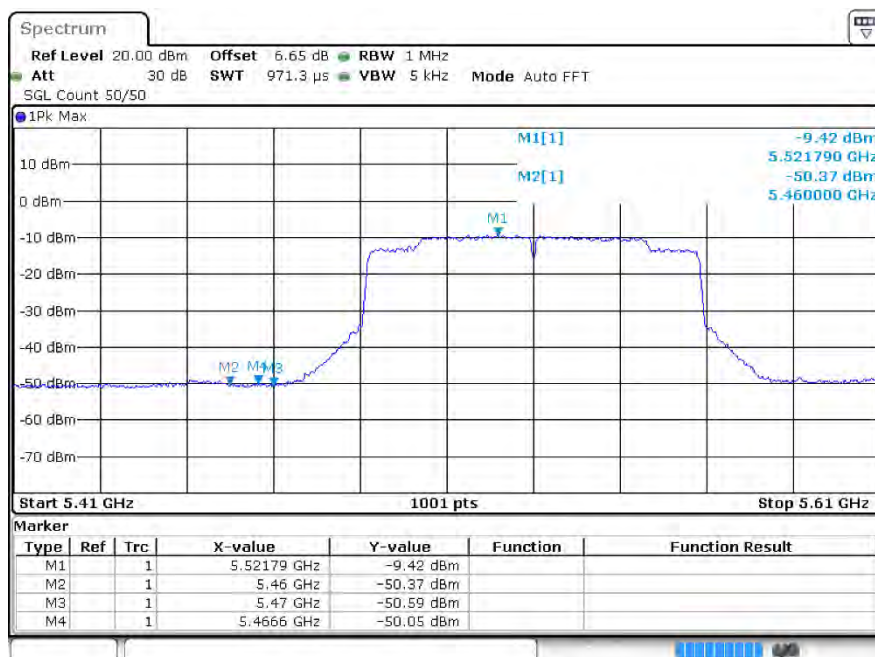


Restrict Bandac80 5610MHz Ant1 Peak

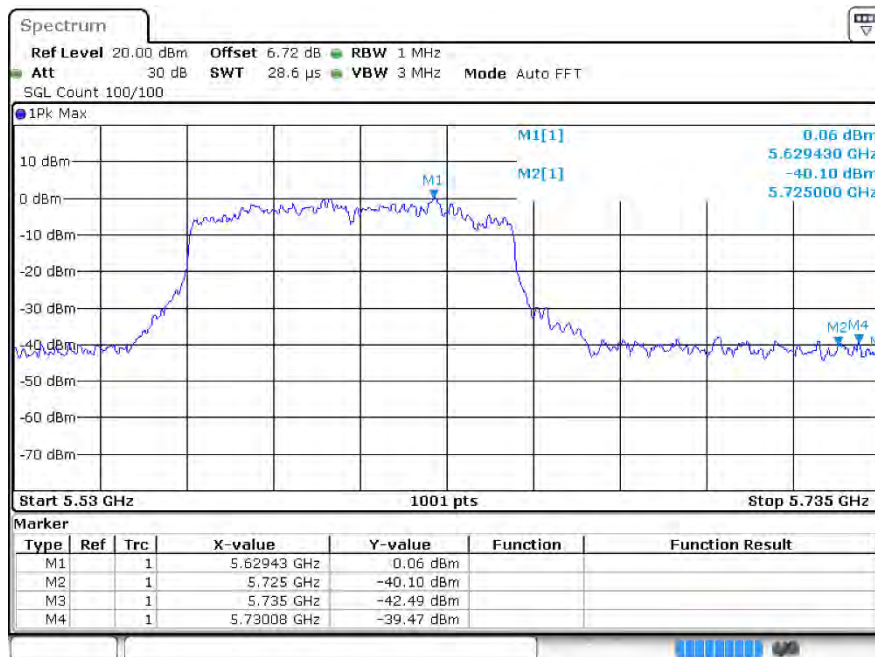


Restrict Band ac80 5610MHz Ant1 Average

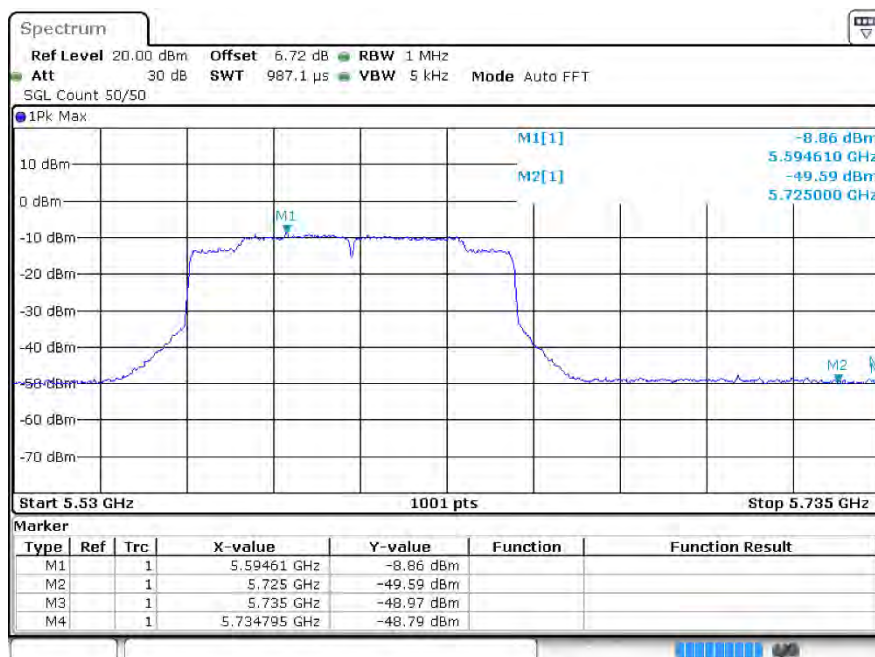


Restrict Banda 5180MHz Ant2 Peak

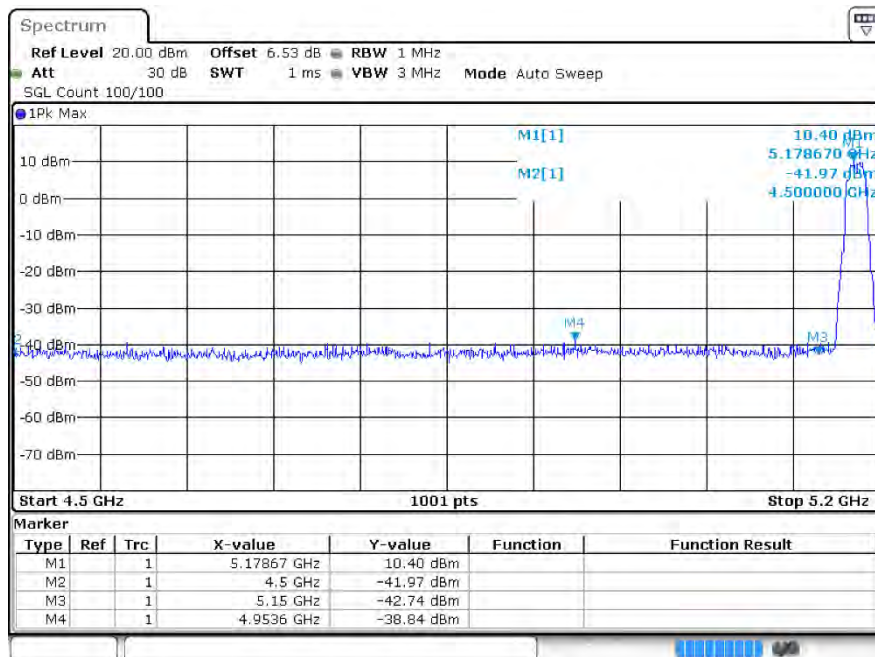


Restrict Band a 5180MHz Ant2 Average

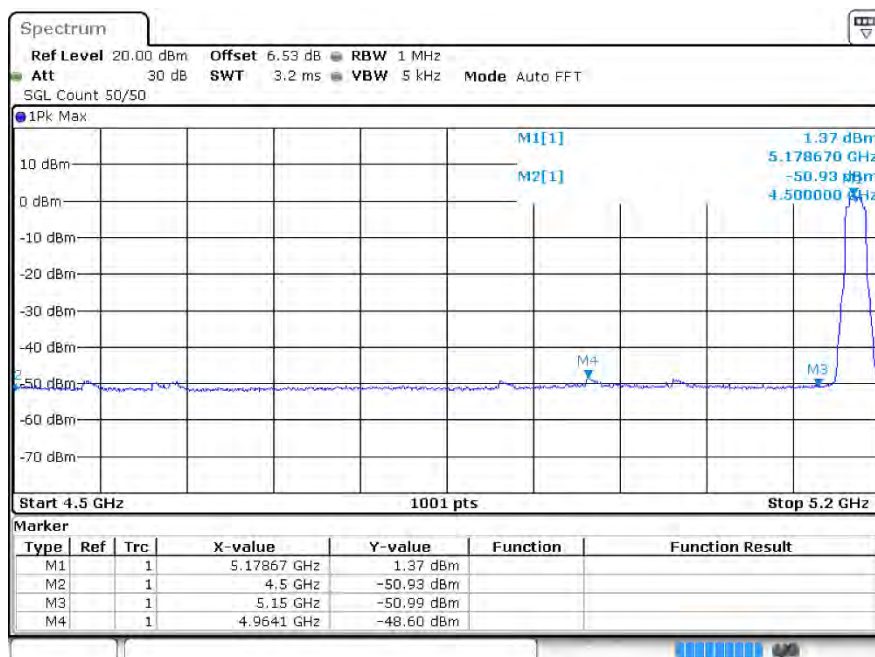


Restrict Banda 5240MHz Ant2 Peak

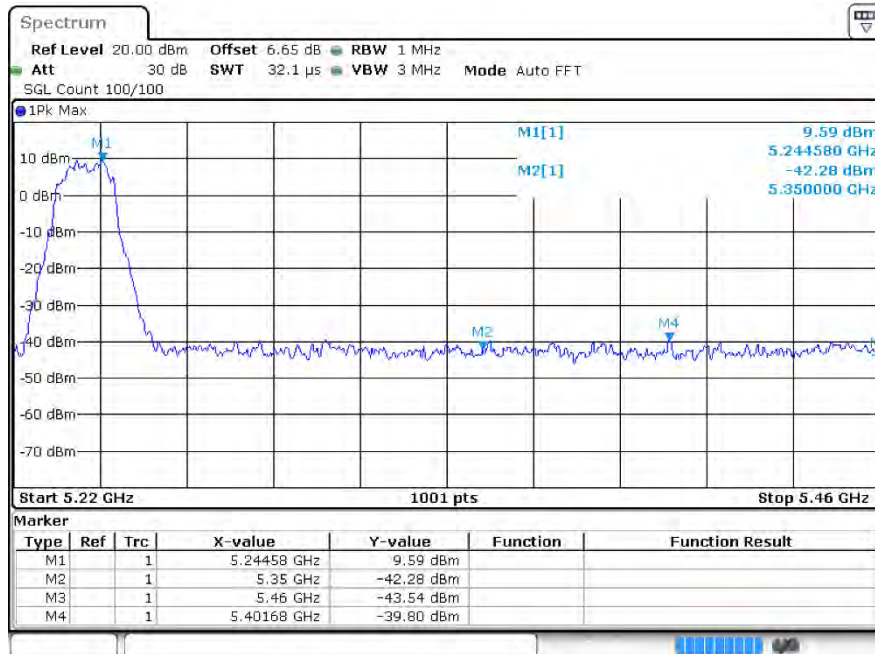


Restrict Band a 5240MHz Ant2 Average

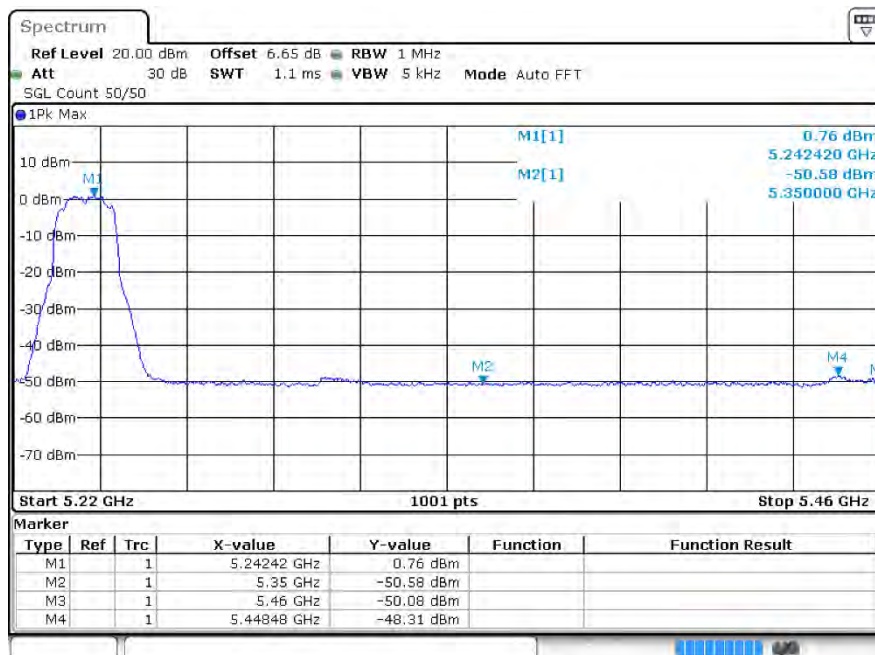


Restrict Banda 5260MHz Ant2 Peak

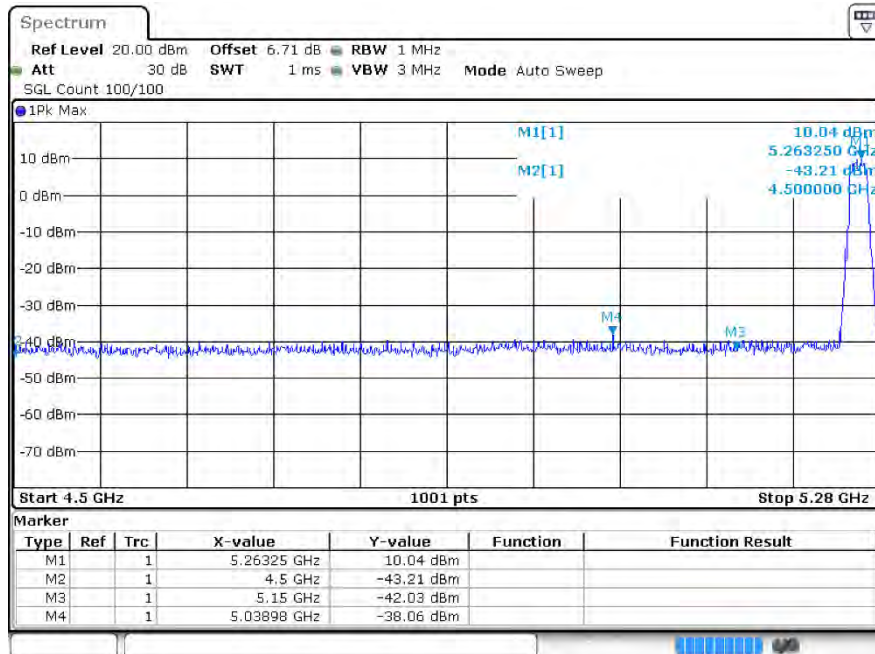


Restrict Band a 5260MHz Ant2 Average

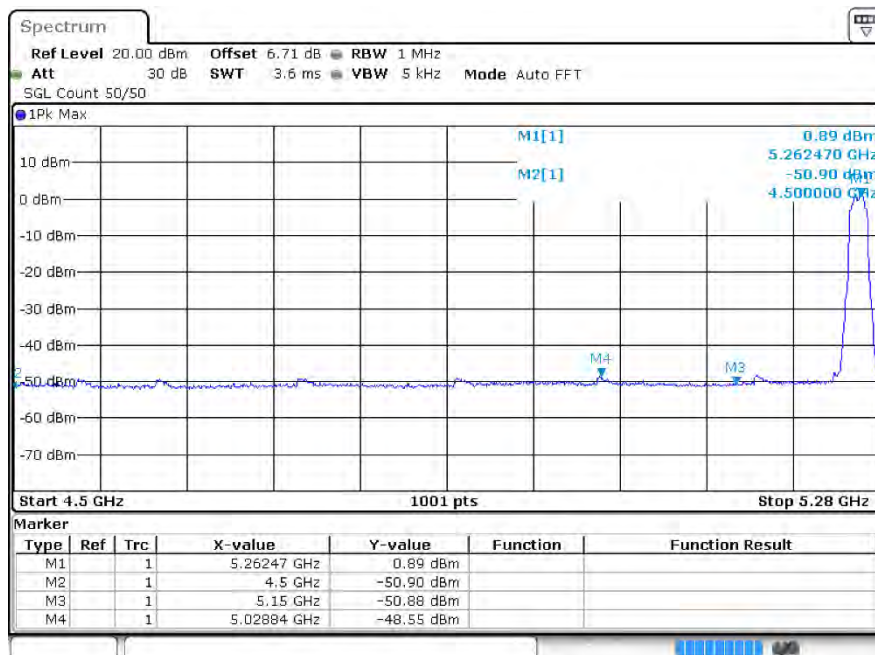


Restrict Banda 5320MHz Ant2 Peak

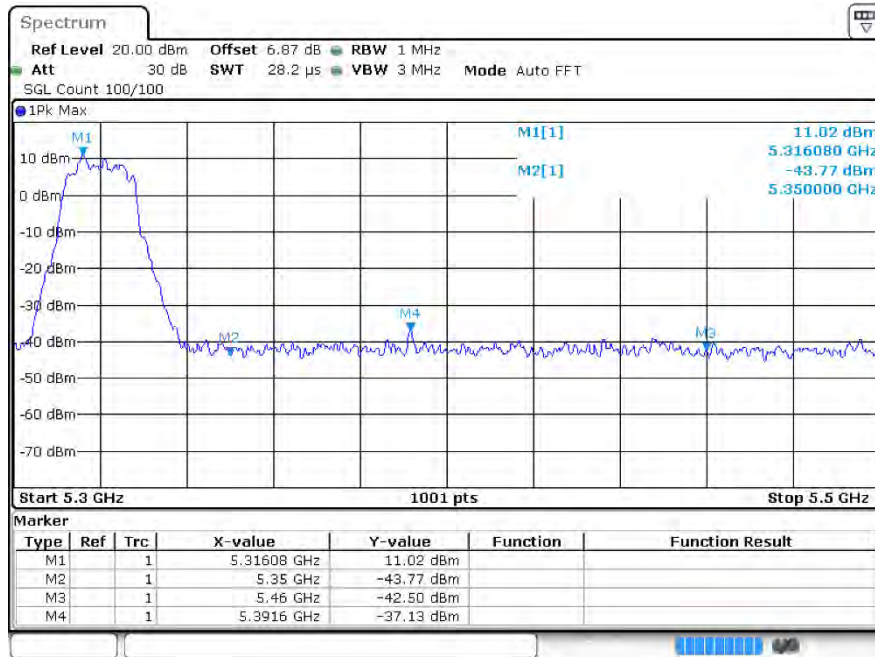


Restrict Band a 5320MHz Ant2 Average

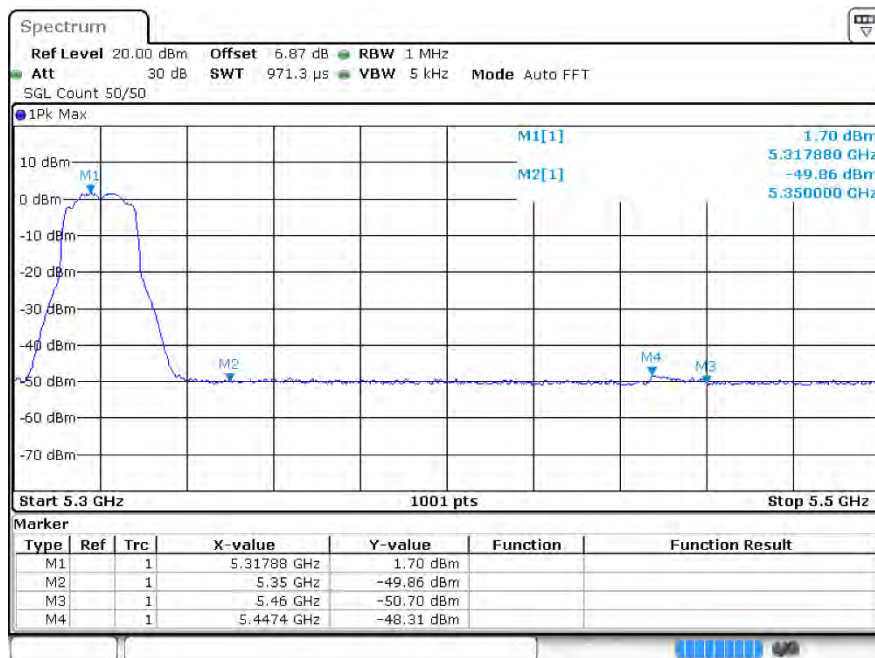


Restrict Banda 5500MHz Ant2 Peak

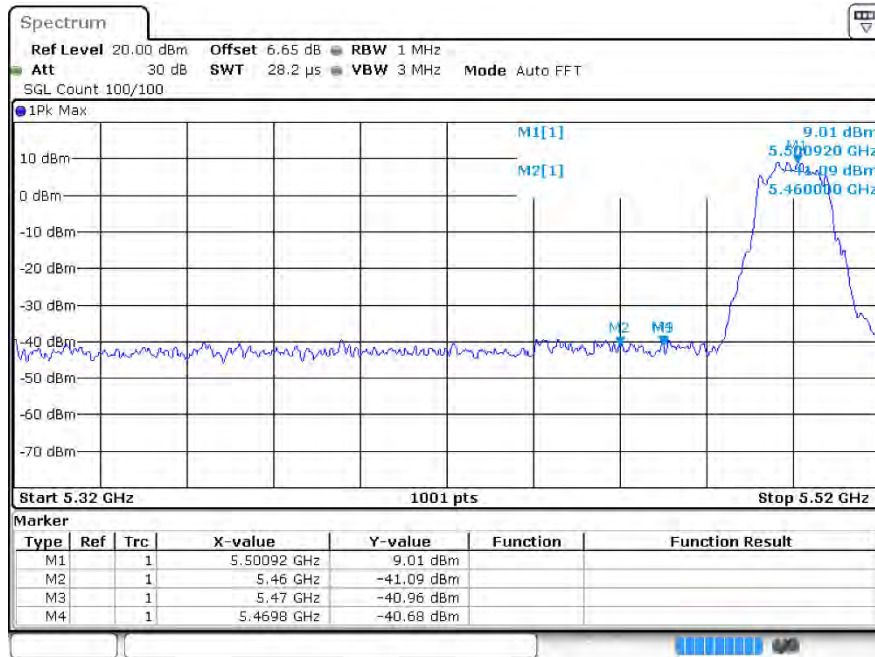

Restrict Band a 5500MHz Ant2 Average

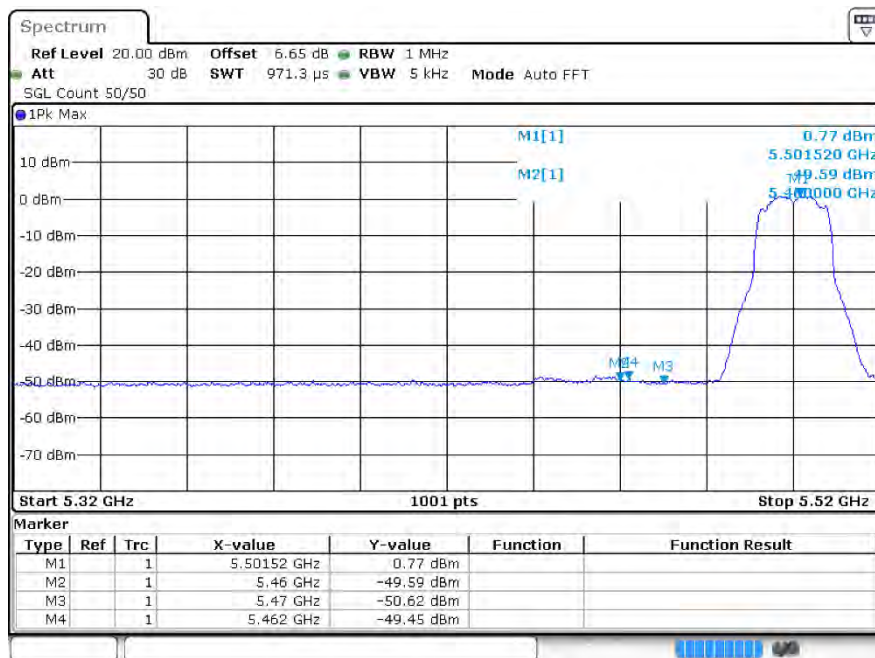


Restrict Banda 5700MHz Ant2 Peak

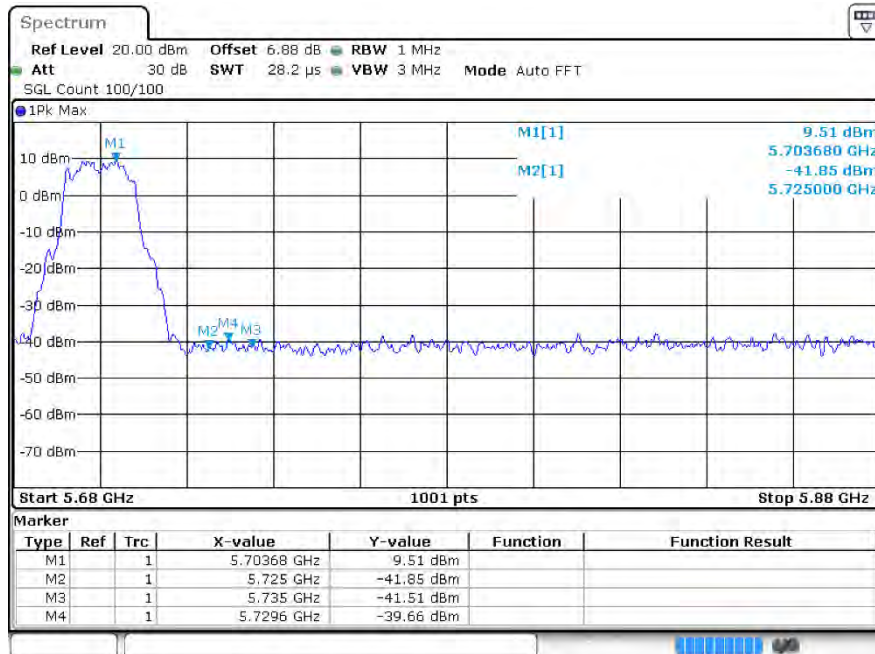


Restrict Band a 5700MHz Ant2 Average




Restrict Bandn20 5180MHz Ant2 Peak

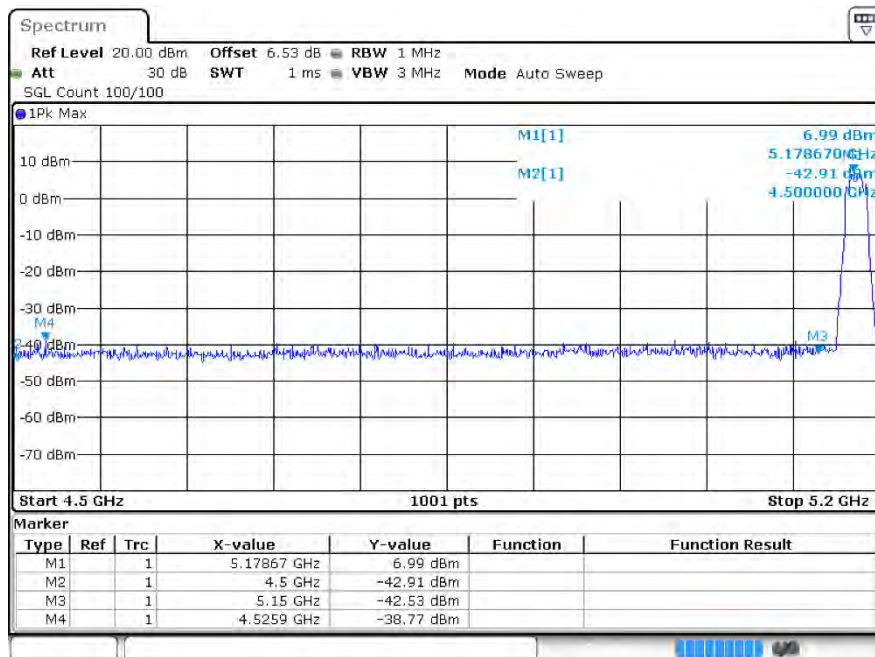


Restrict Band n20 5180MHz Ant2 Average

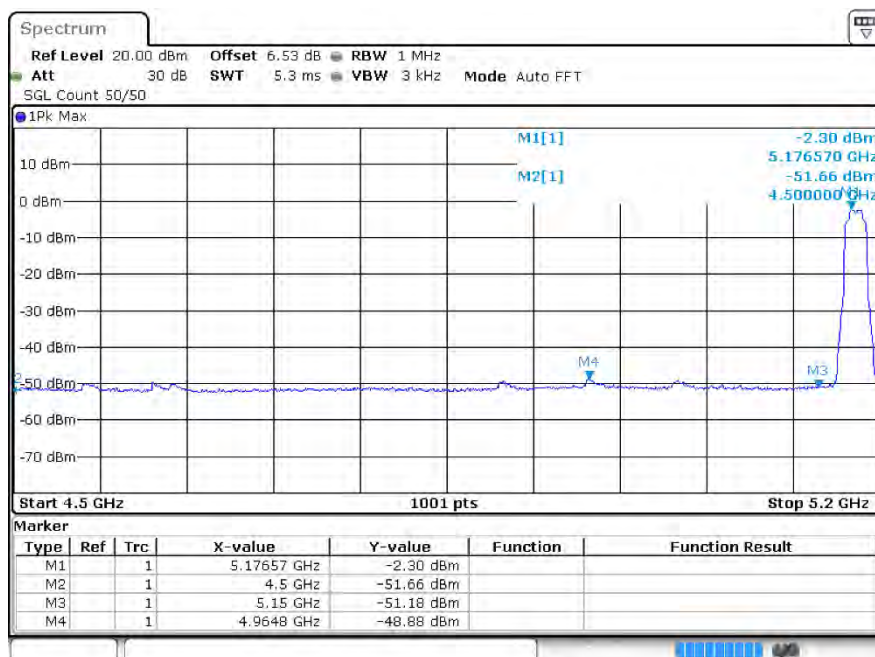


Restrict Bandn20 5240MHz Ant2 Peak

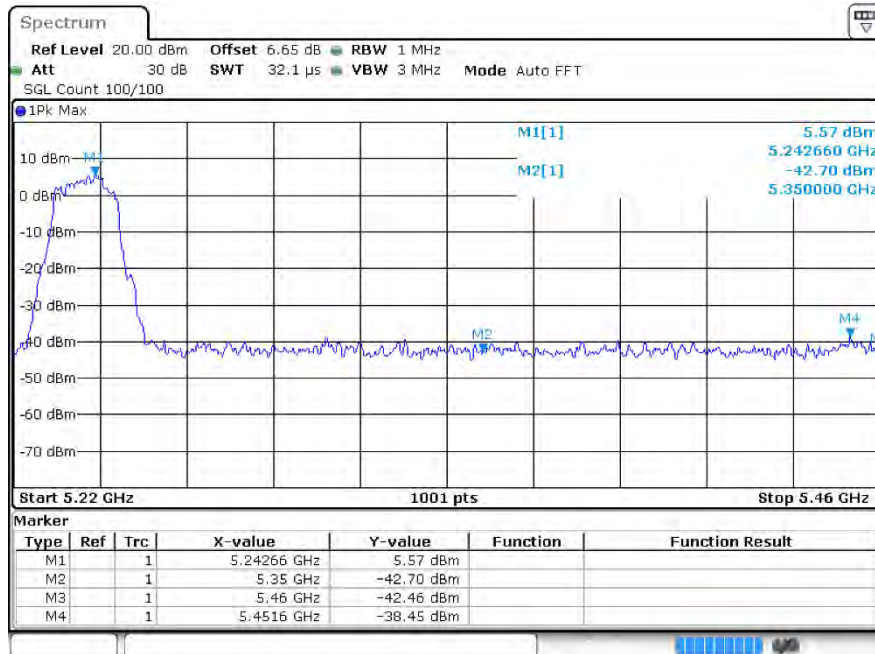


Restrict Band n20 5240MHz Ant2 Average

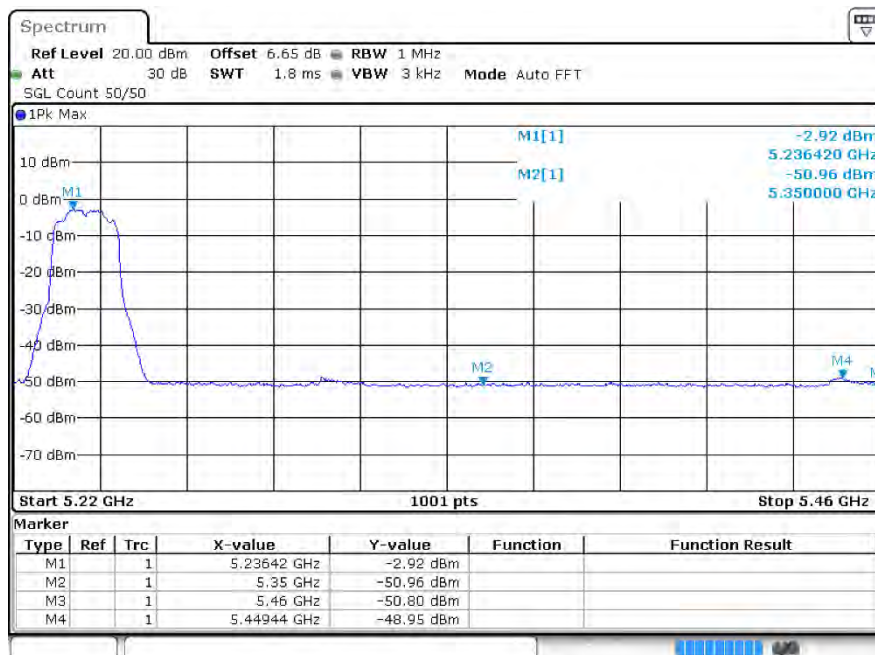


Restrict Bandn20 5260MHz Ant2 Peak

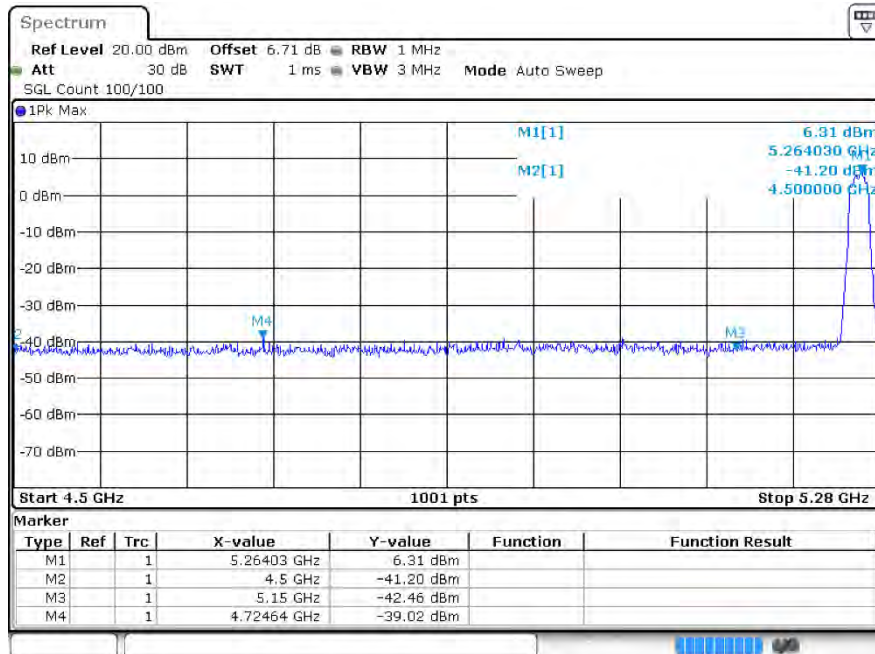


Restrict Band n20 5260MHz Ant2 Average

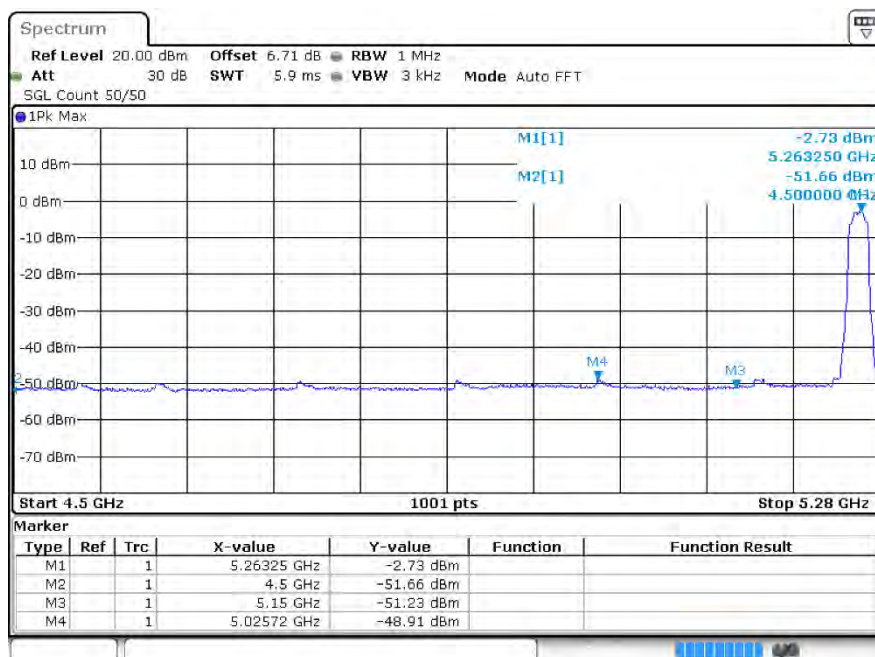


Restrict Bandn20 5320MHz Ant2 Peak

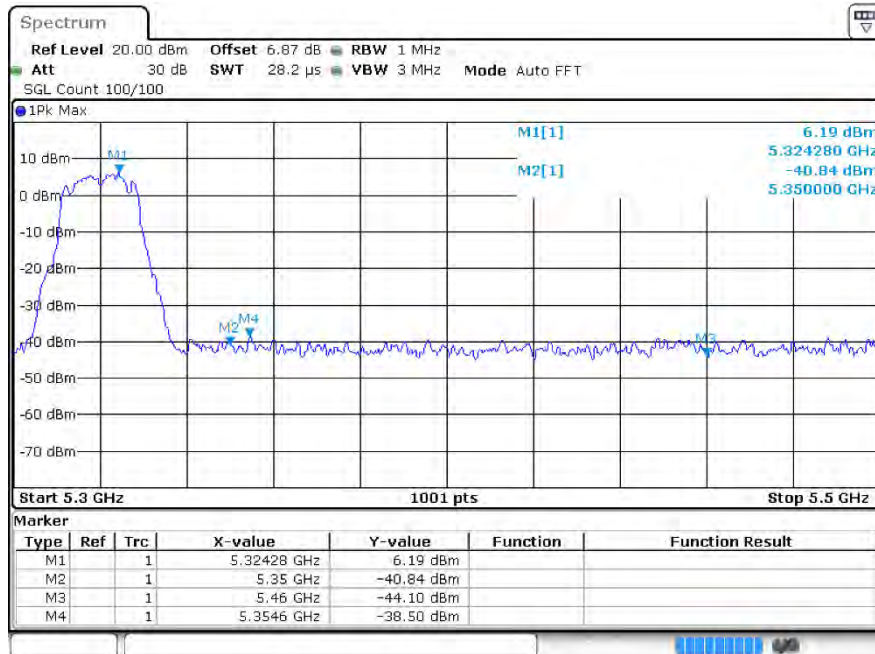


Restrict Band n20 5320MHz Ant2 Average

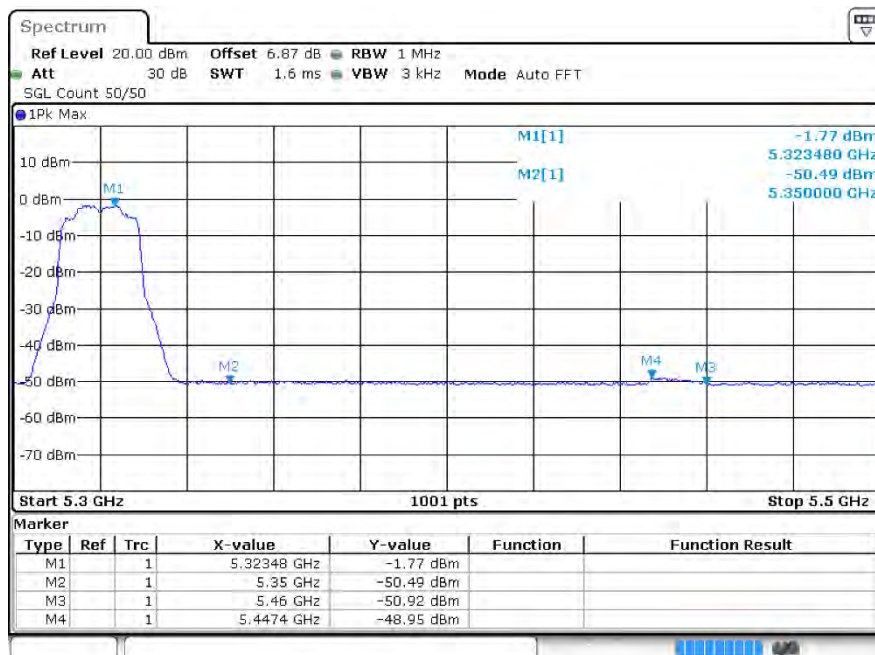


Restrict Bandn20 5500MHz Ant2 Peak

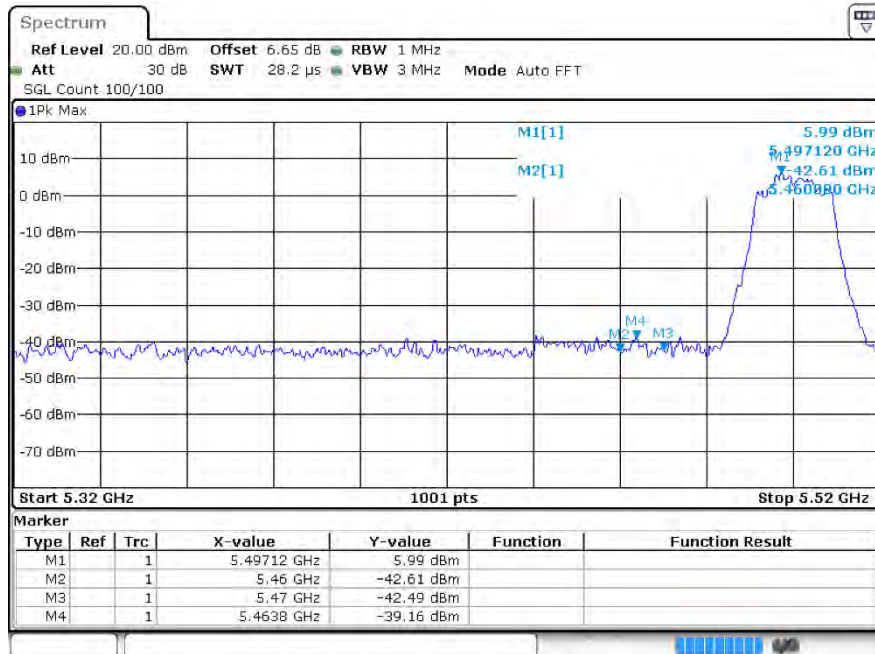


Restrict Band n20 5500MHz Ant2 Average

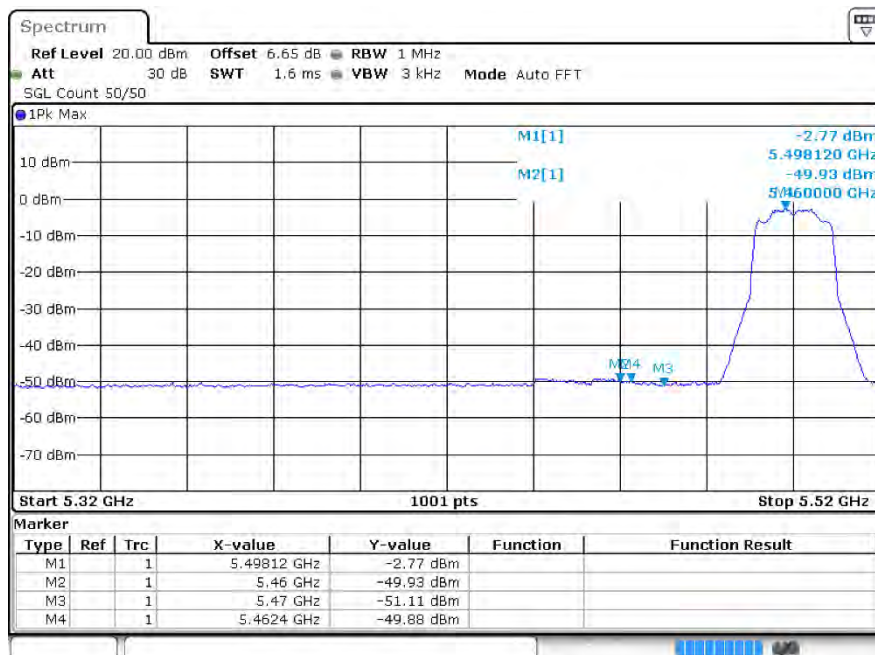


Restrict Bandn20 5700MHz Ant2 Peak

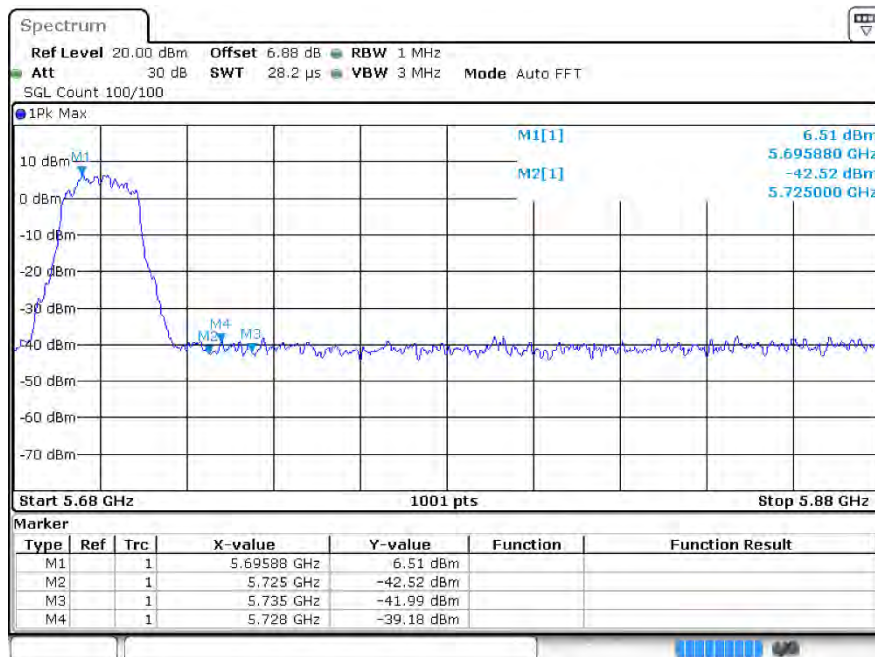


Restrict Band n20 5700MHz Ant2 Average

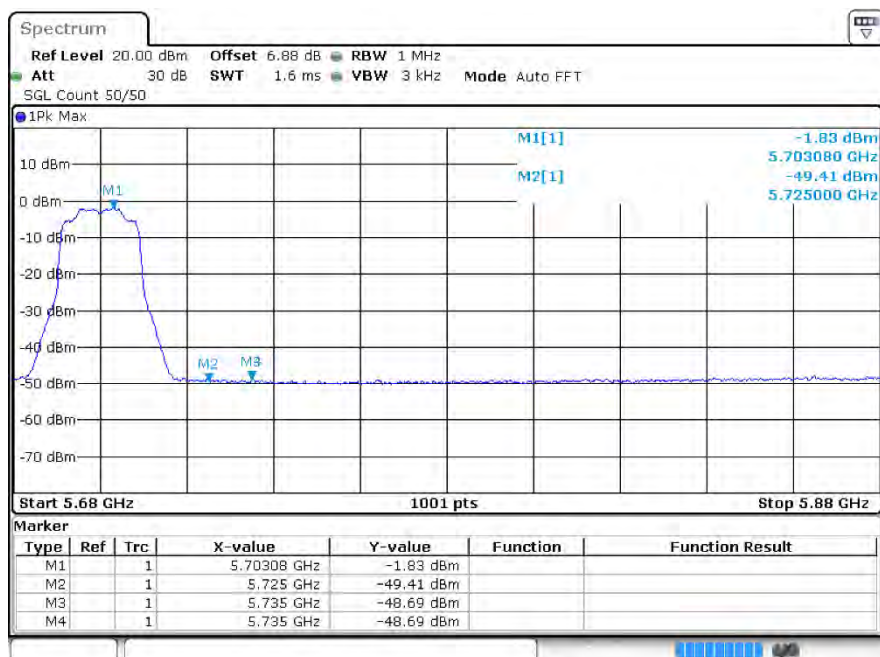


Restrict Bandn40 5190MHz Ant2 Peak

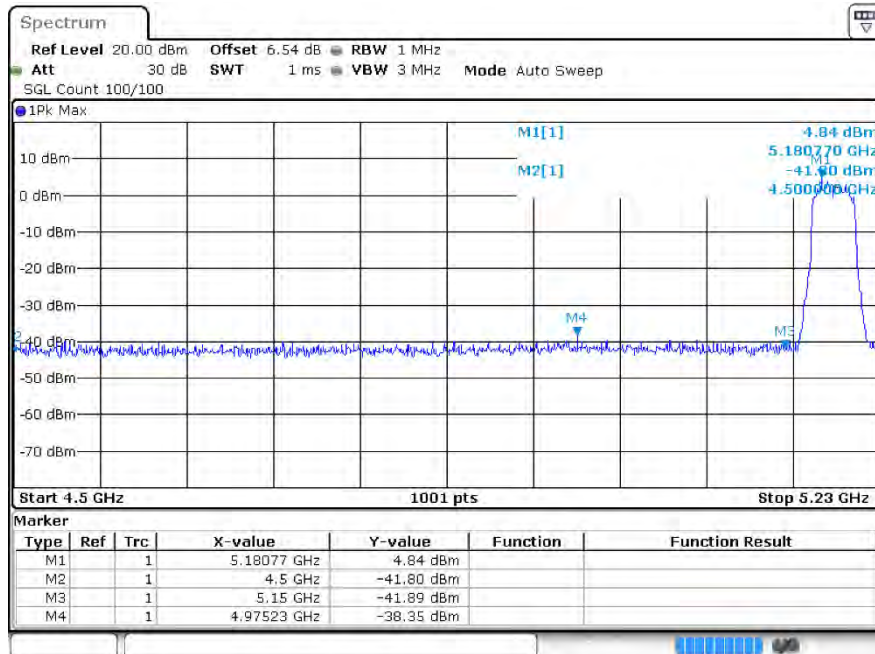


Restrict Band n40 5190MHz Ant2 Average

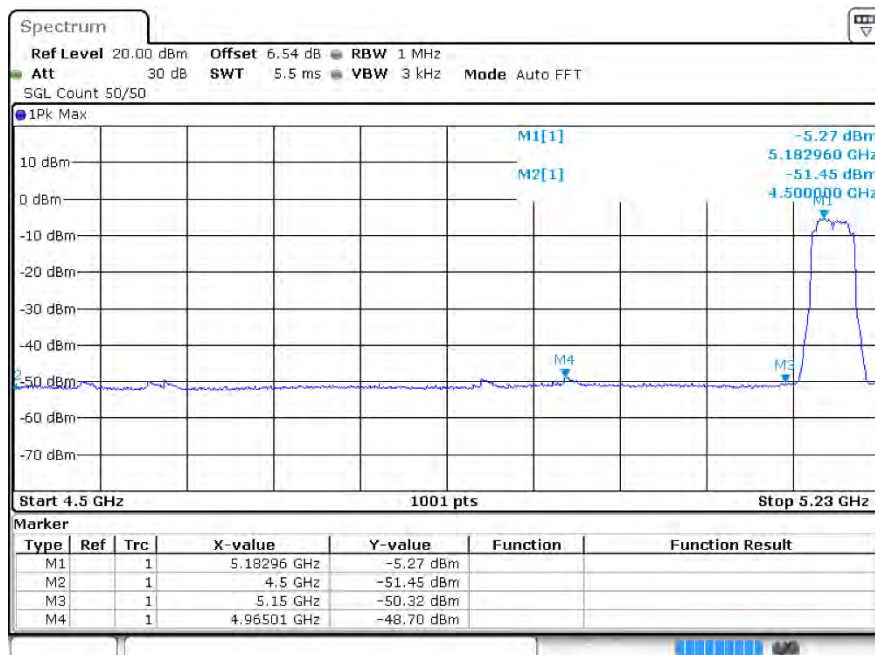


Restrict Bandn40 5230MHz Ant2 Peak

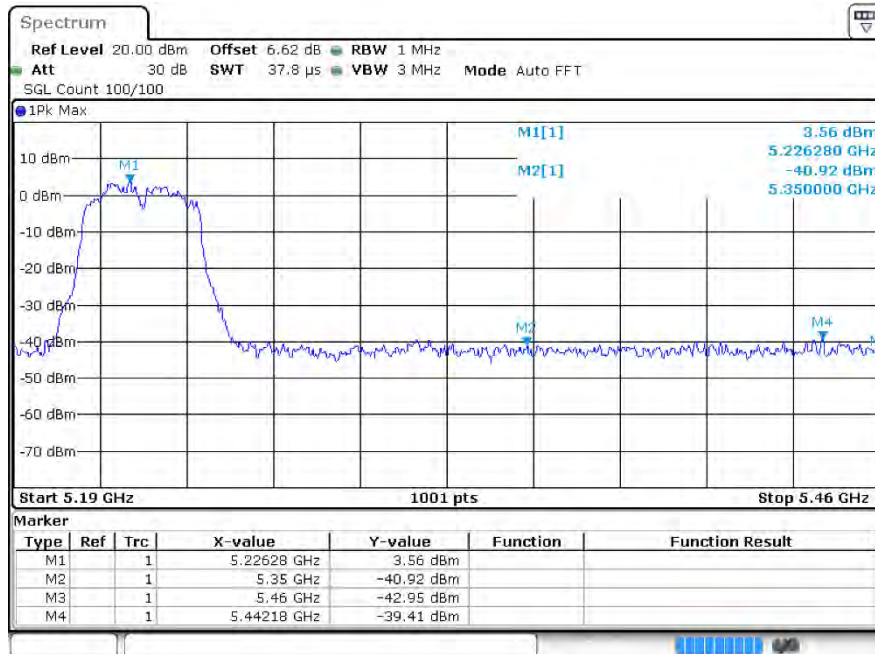


Restrict Band n40 5230MHz Ant2 Average

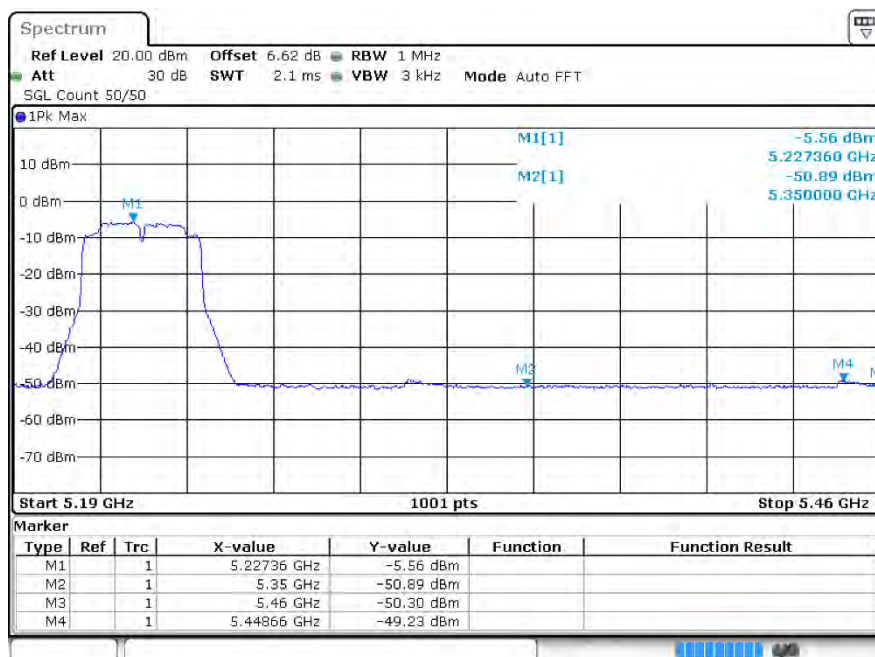


Restrict Bandn40 5270MHz Ant2 Peak

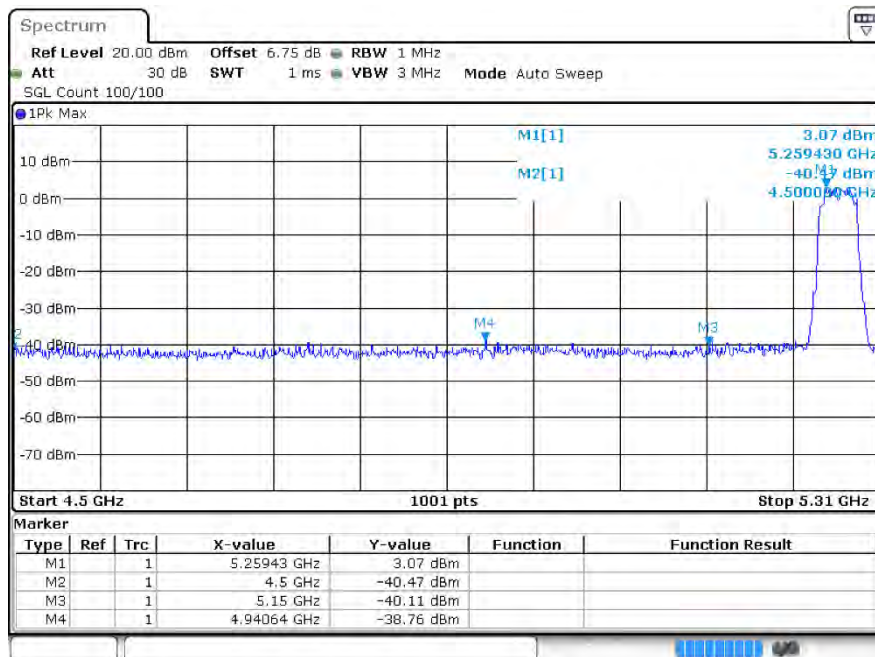


Restrict Band n40 5270MHz Ant2 Average

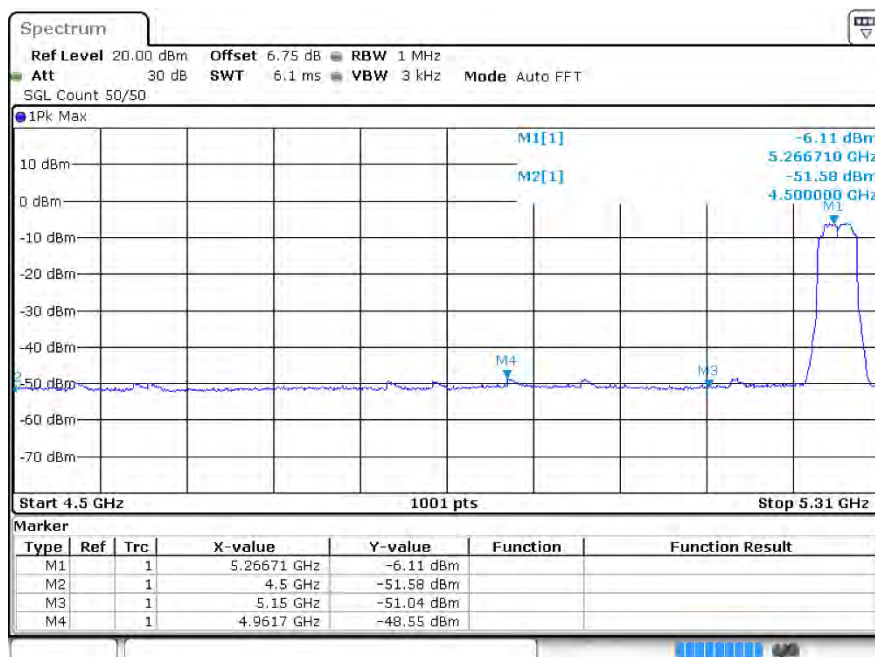


Restrict Bandn40 5310MHz Ant2 Peak

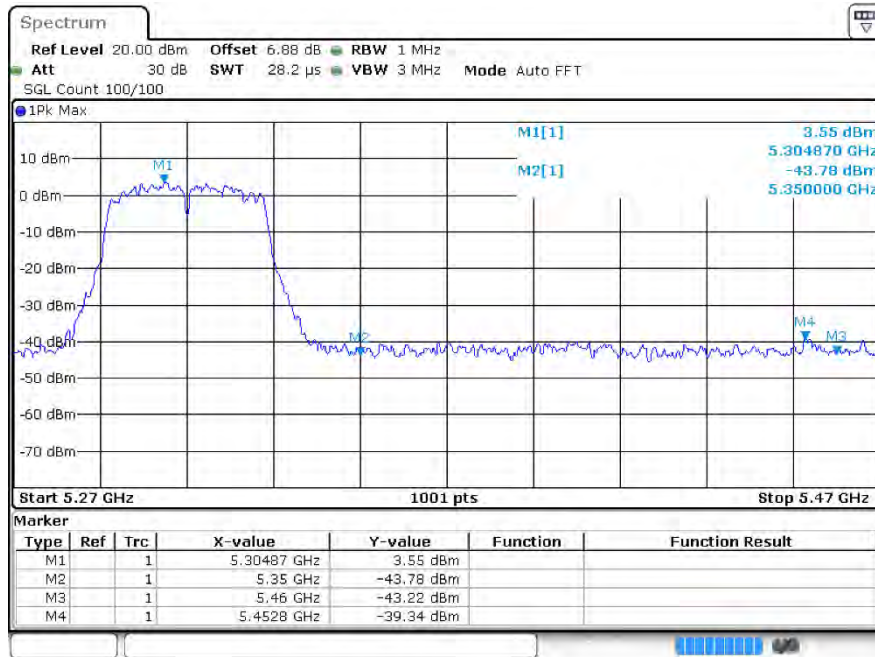


Restrict Band n40 5310MHz Ant2 Average

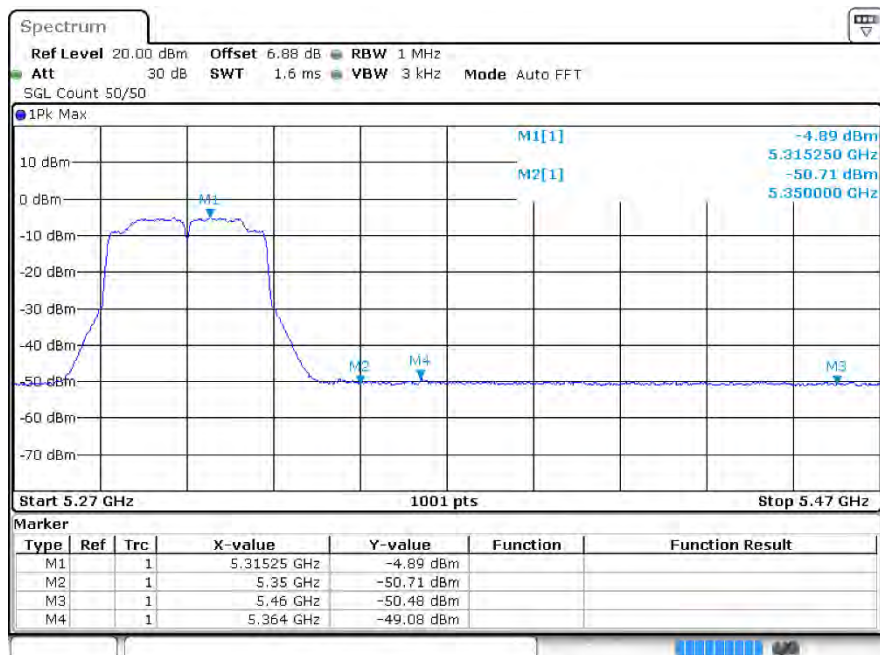


Restrict Band n40 5510MHz Ant2 Peak

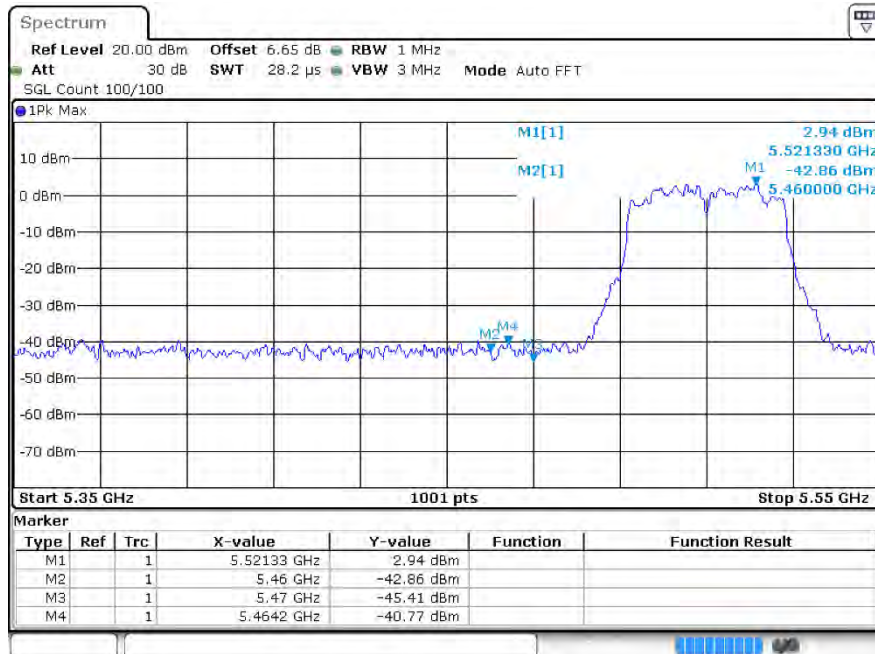


Restrict Band n40 5510MHz Ant2 Average

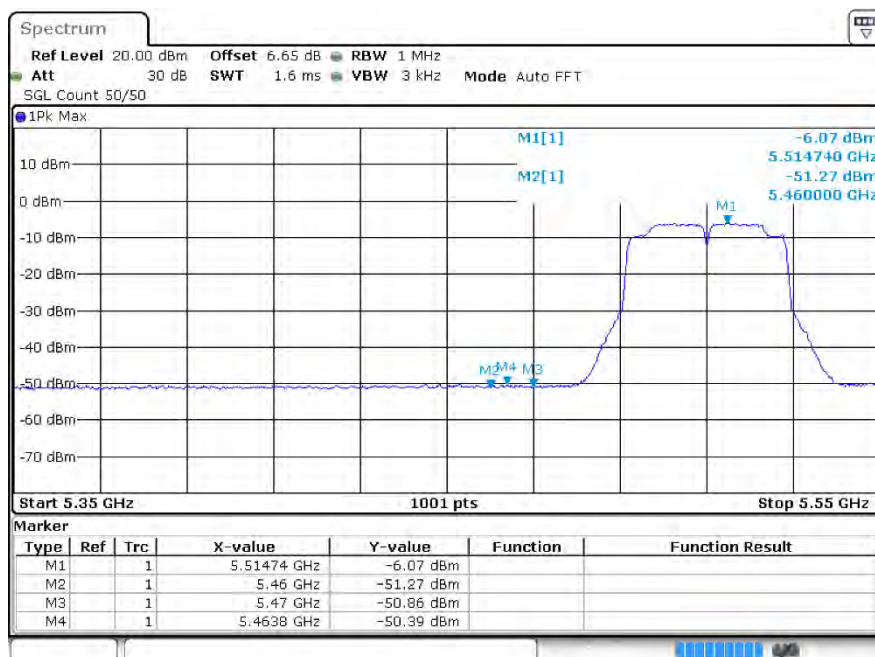

Restrict Bandn40 5670MHz Ant2 Peak

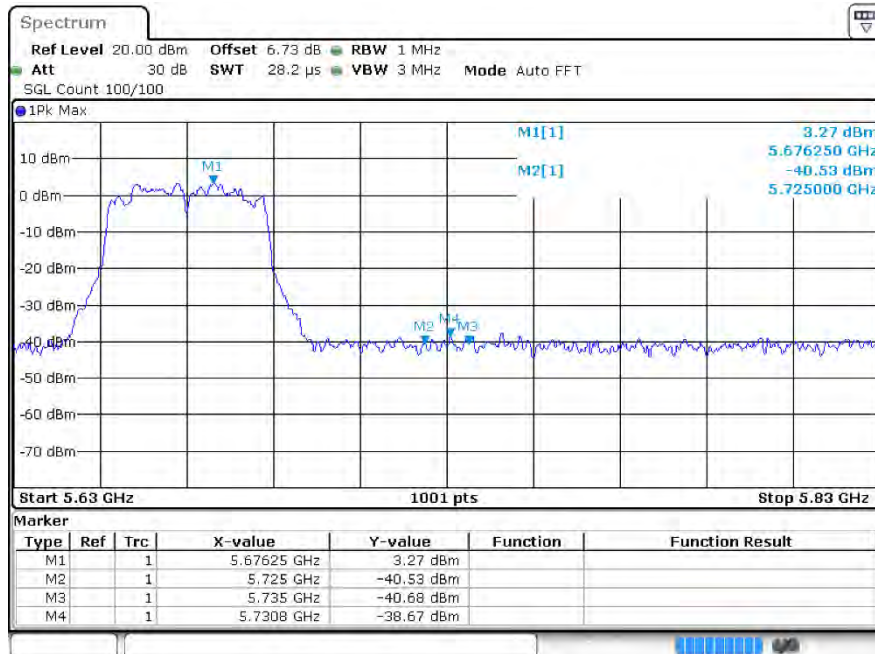


Restrict Band n40 5670MHz Ant2 Average

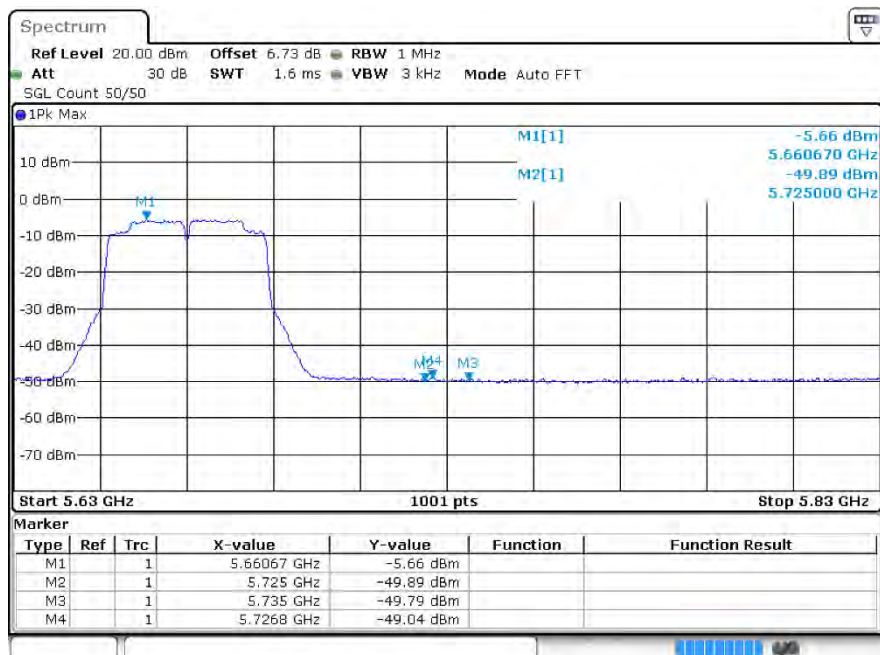





Restrict Bandac20 5180MHz Ant2 Peak

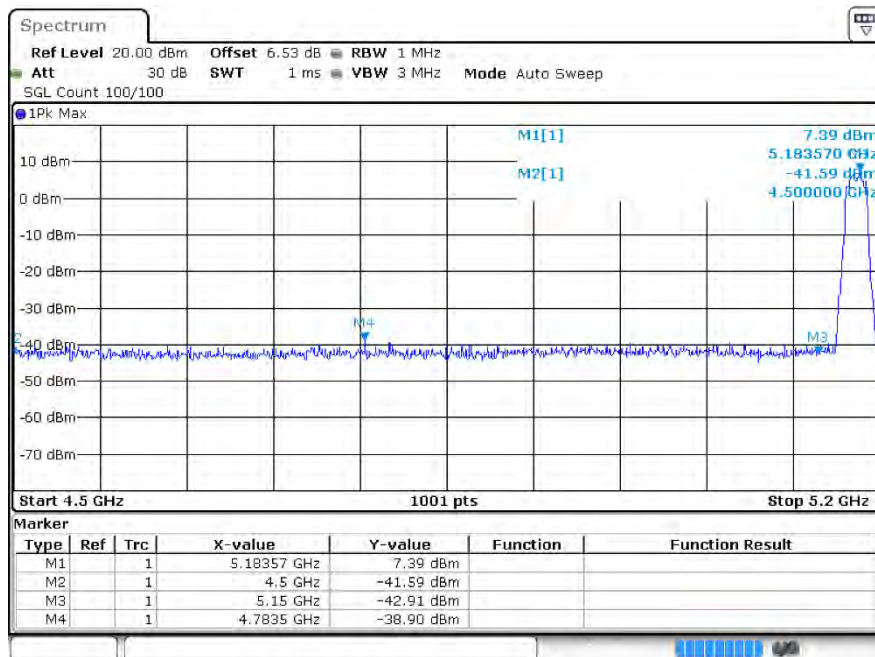


Restrict Band ac20 5180MHz Ant2 Average

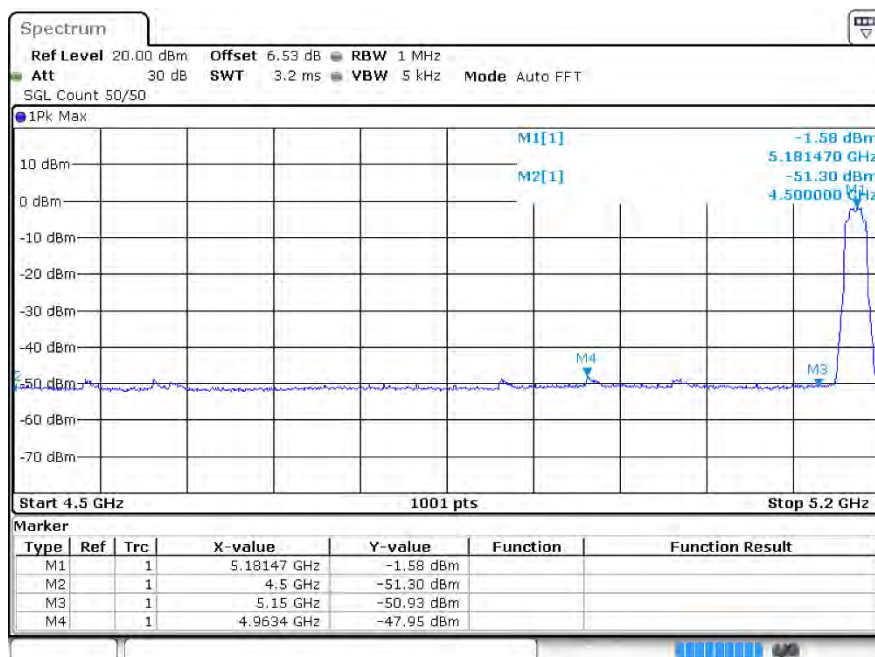

Restrict Bandac20 5240MHz Ant2 Peak

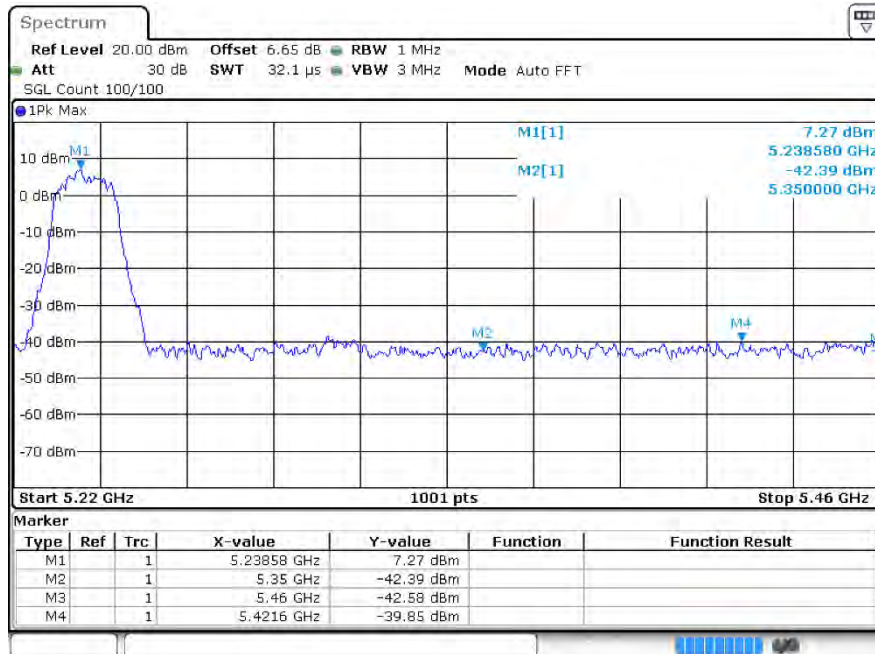


Restrict Band ac20 5240MHz Ant2 Average

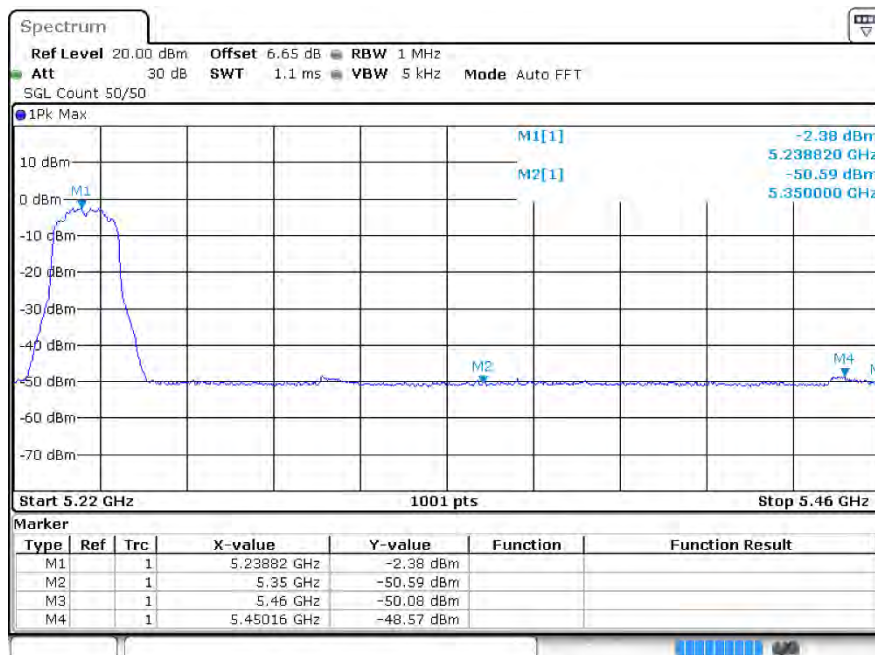





Restrict Bandac20 5260MHz Ant2 Peak

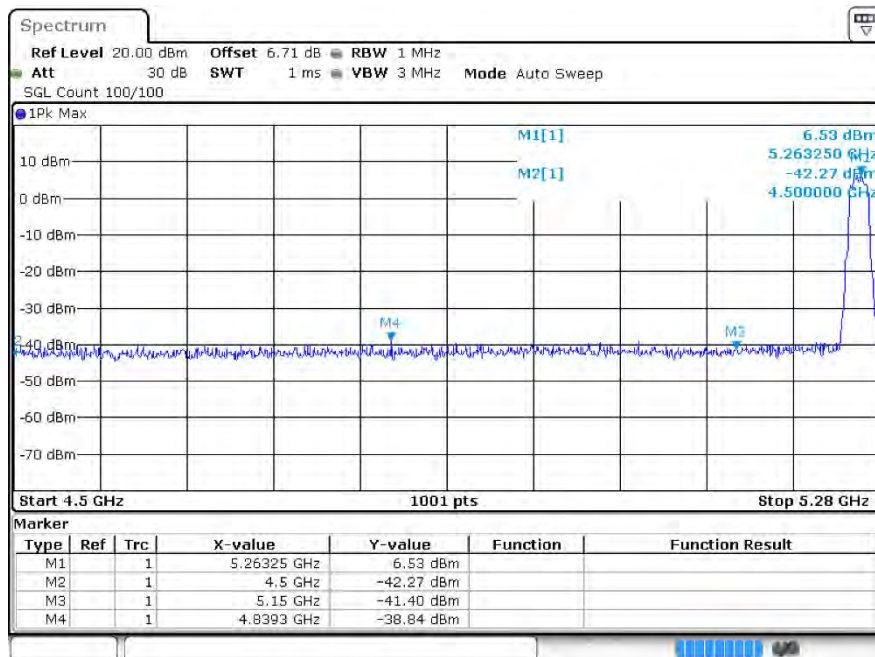


Restrict Band ac20 5260MHz Ant2 Average

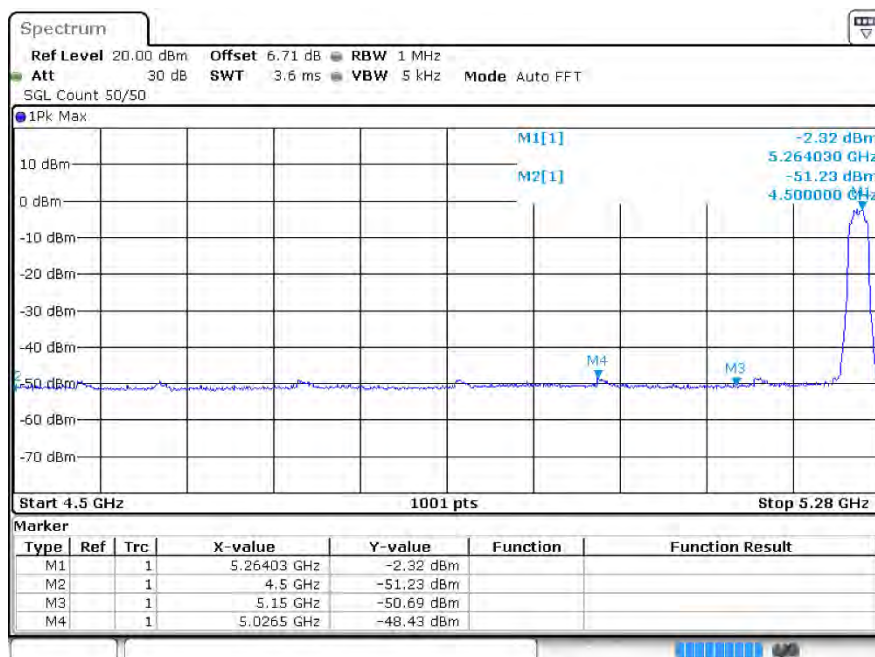


Restrict Bandac20 5320MHz Ant2 Peak

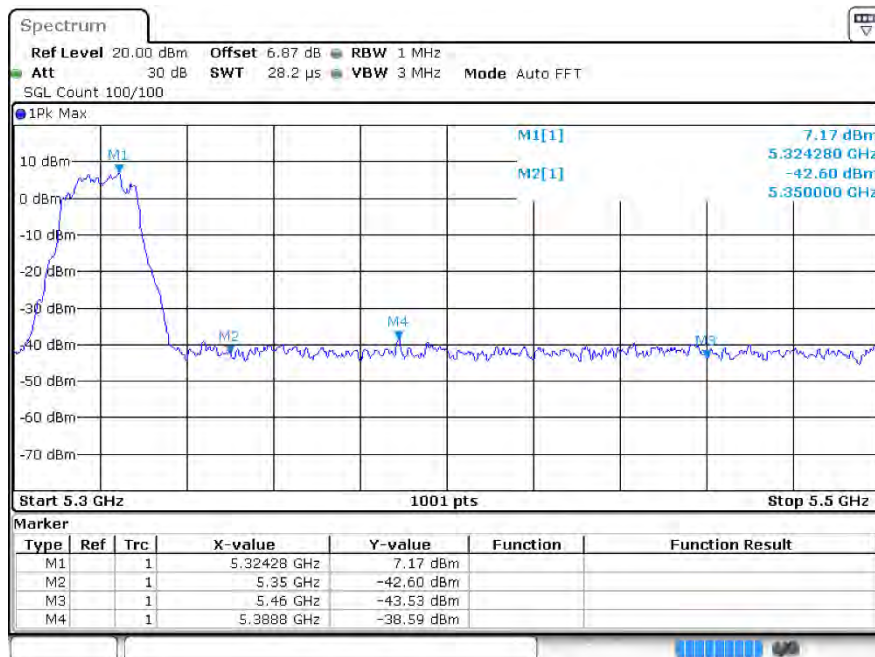

Restrict Band ac20 5320MHz Ant2 Average

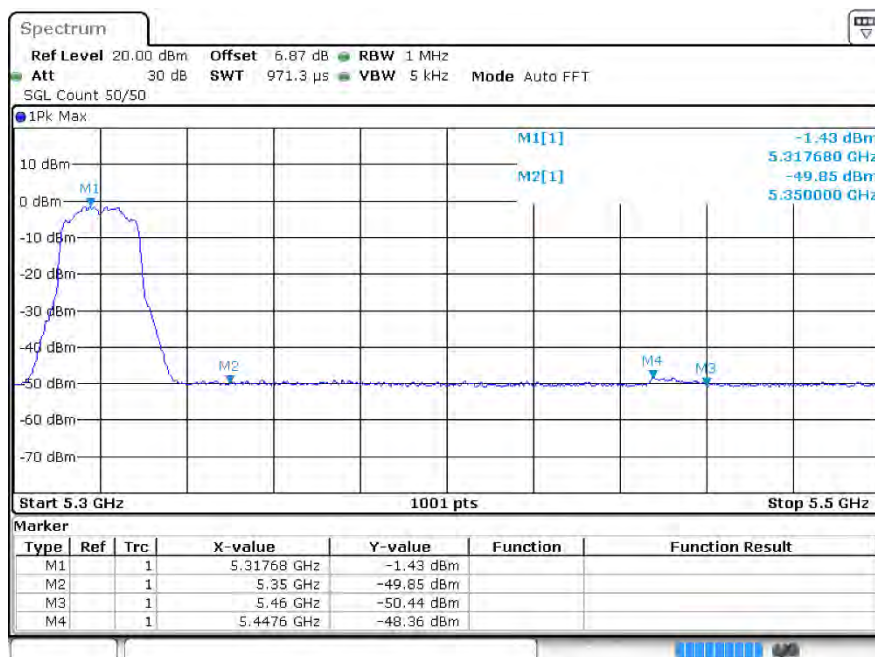


Restrict Bandac20 5500MHz Ant2 Peak

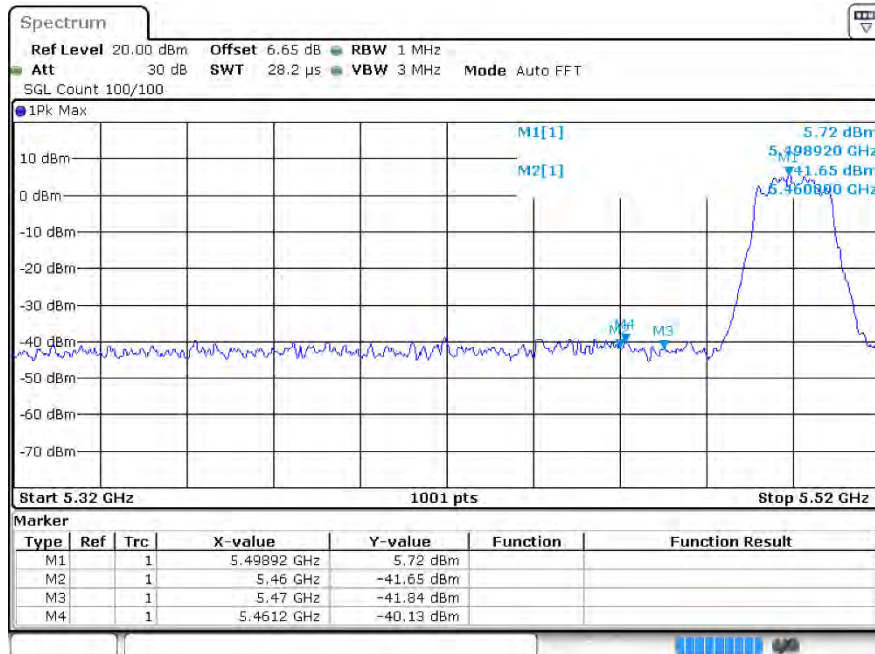


Restrict Band ac20 5500MHz Ant2 Average



Restrict Bandac20 5700MHz Ant2 Peak

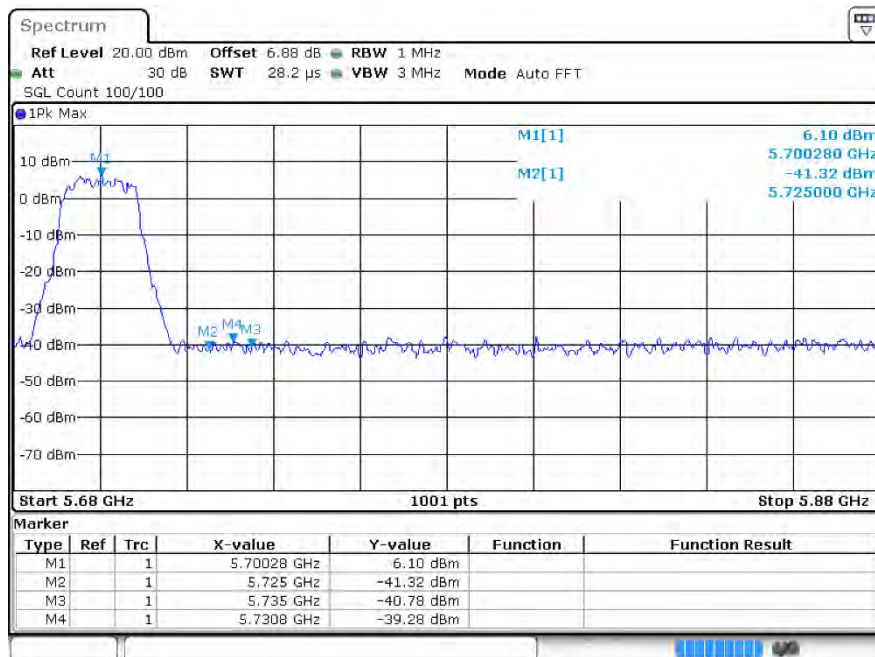


Restrict Band ac20 5700MHz Ant2 Average

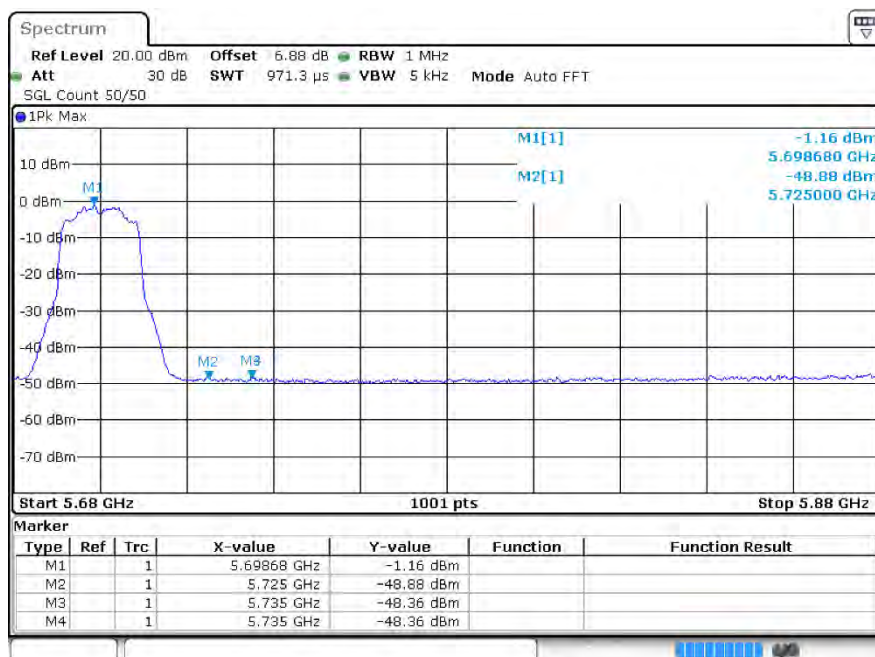





Restrict Bandac40 5190MHz Ant2 Peak

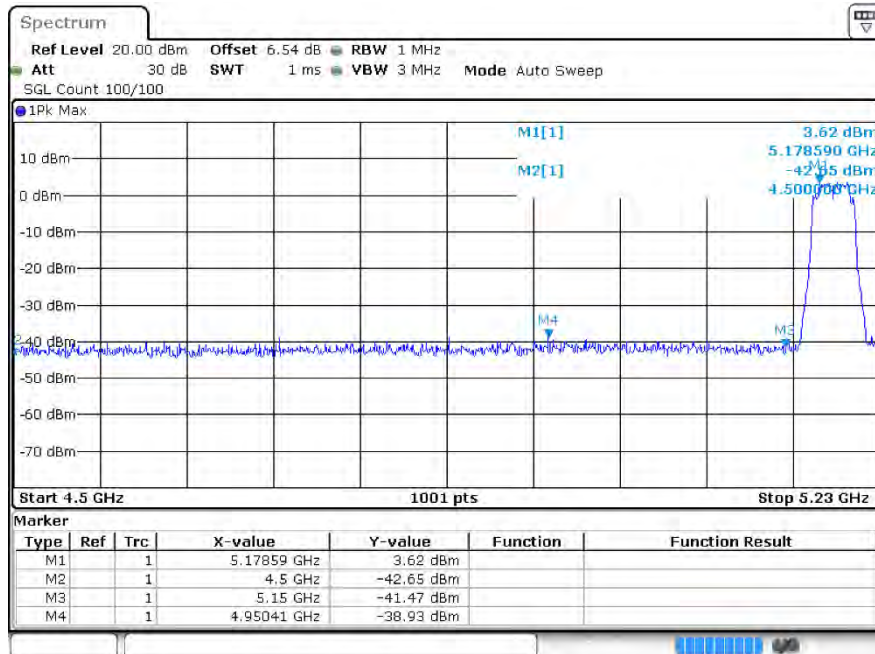


Restrict Band ac40 5190MHz Ant2 Average

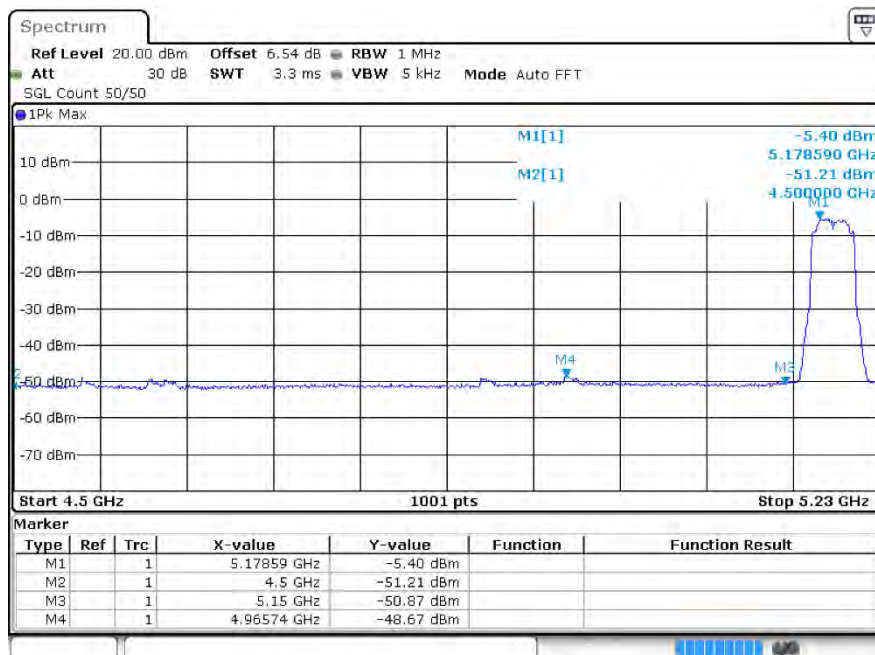


Restrict Bandac40 5230MHz Ant2 Peak

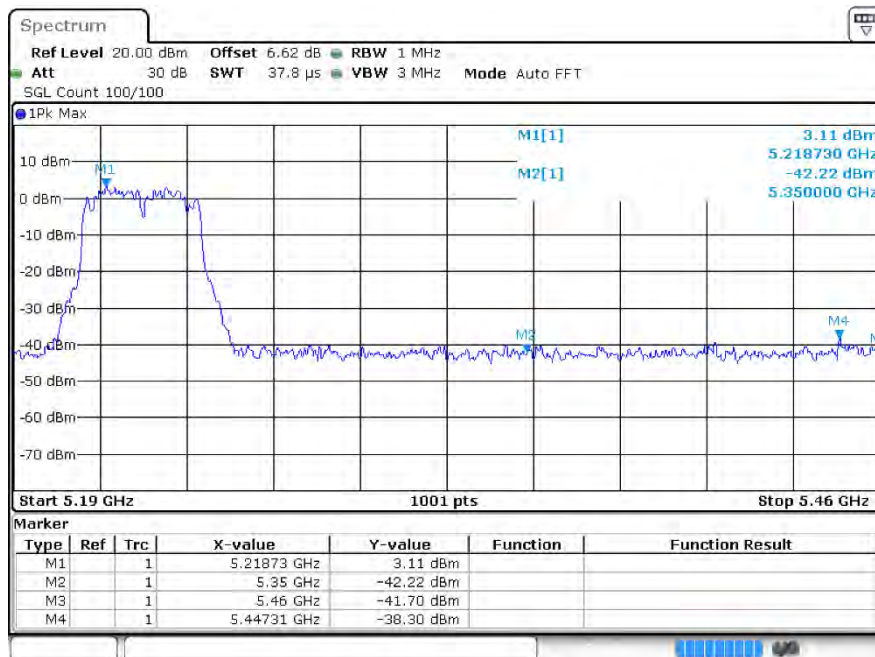


Restrict Band ac40 5230MHz Ant2 Average

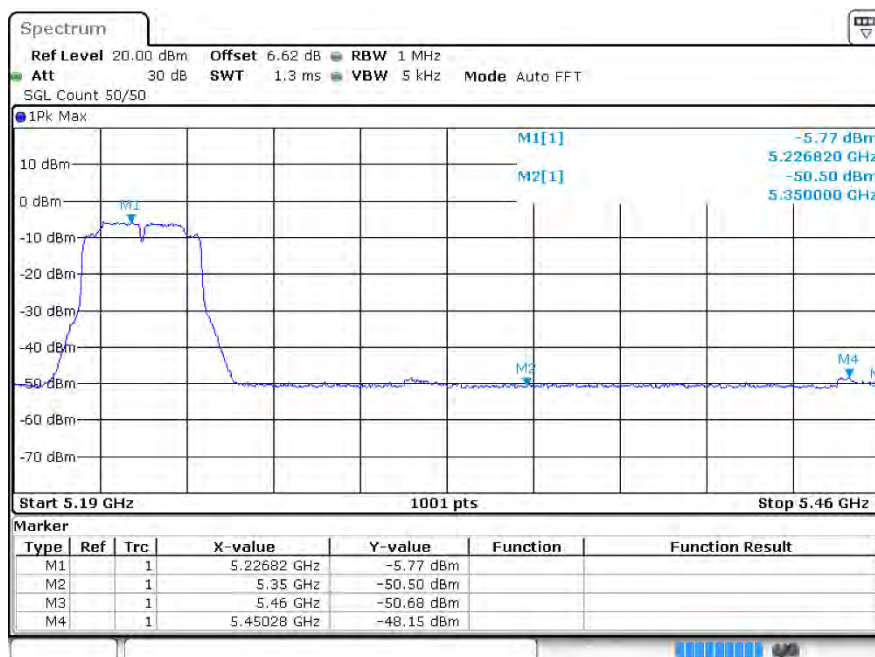


Restrict Bandac40 5270MHz Ant2 Peak

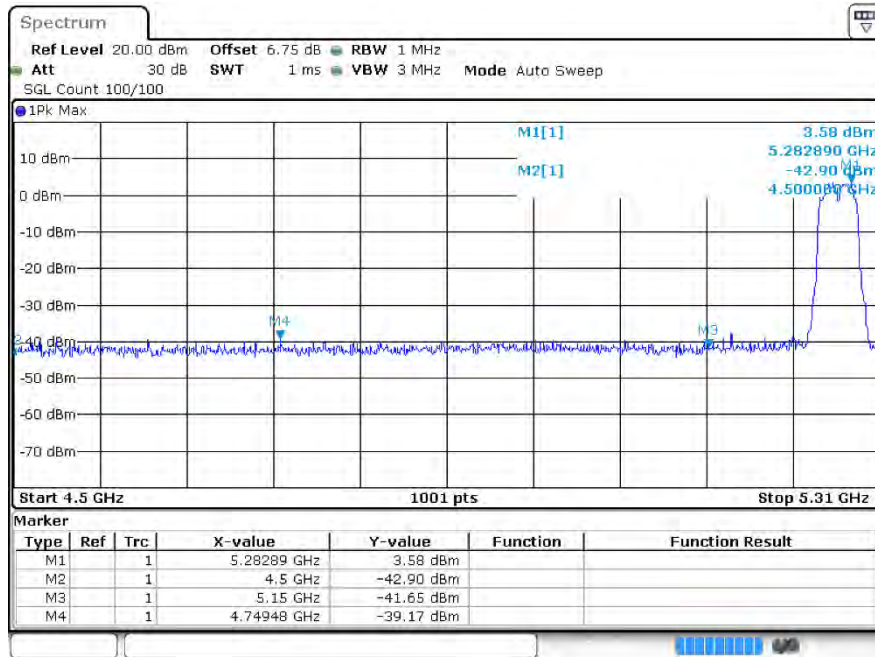


Restrict Band ac40 5270MHz Ant2 Average

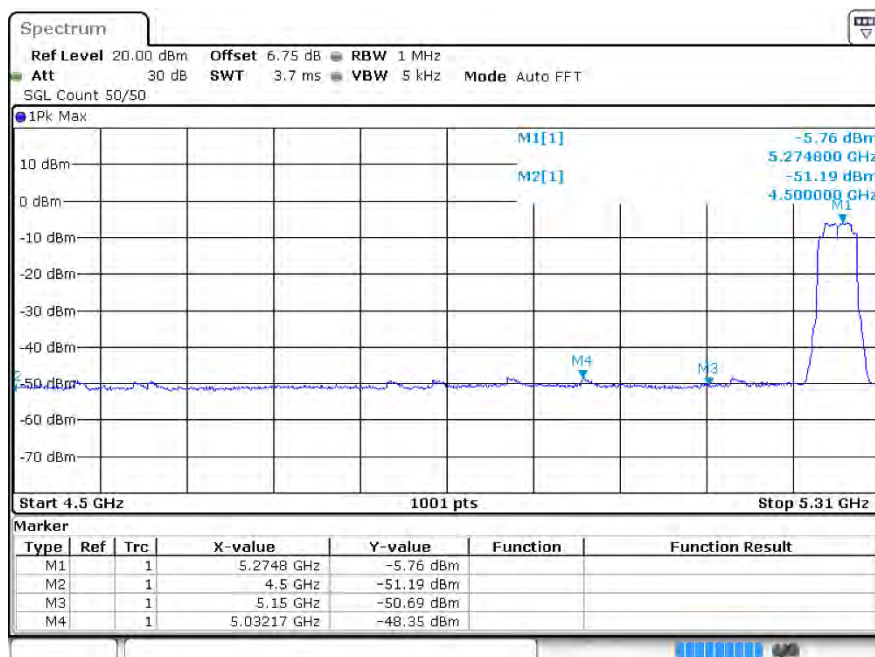


Restrict Bandac40 5310MHz Ant2 Peak

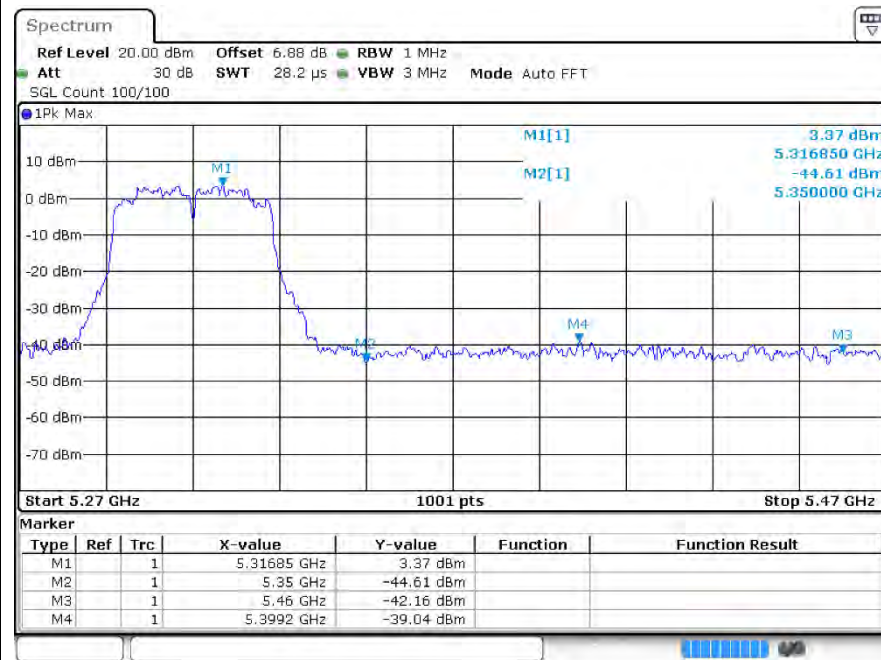


Restrict Band ac40 5310MHz Ant2 Average

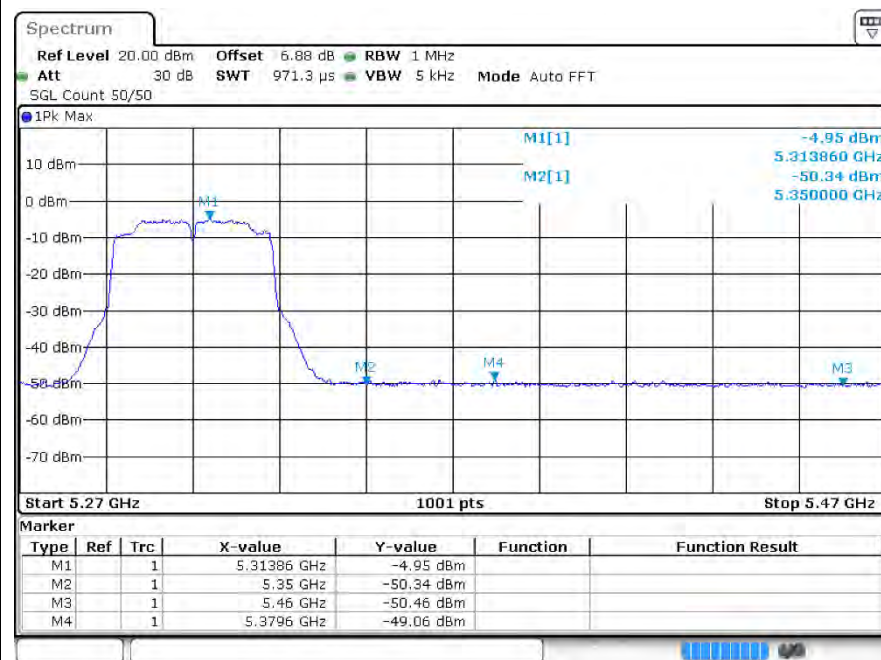


Restrict Bandac40 5510MHz Ant2 Peak

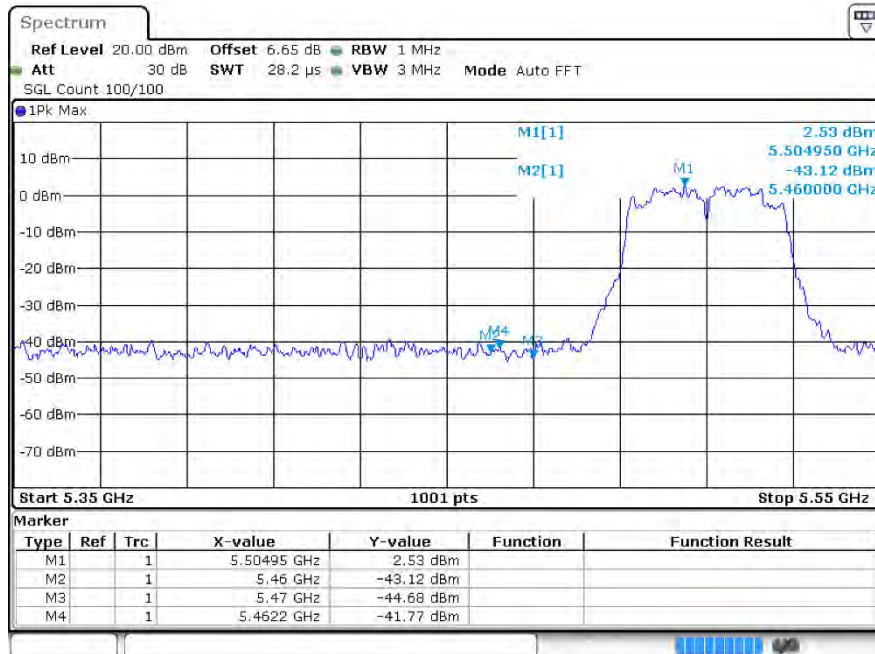


Restrict Band ac40 5510MHz Ant2 Average

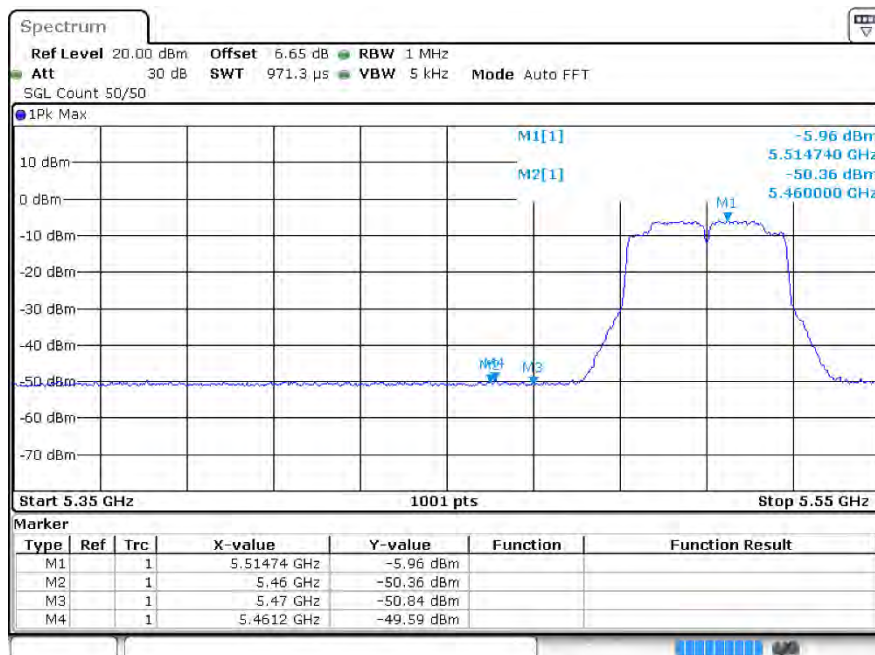


Restrict Bandac40 5670MHz Ant2 Peak

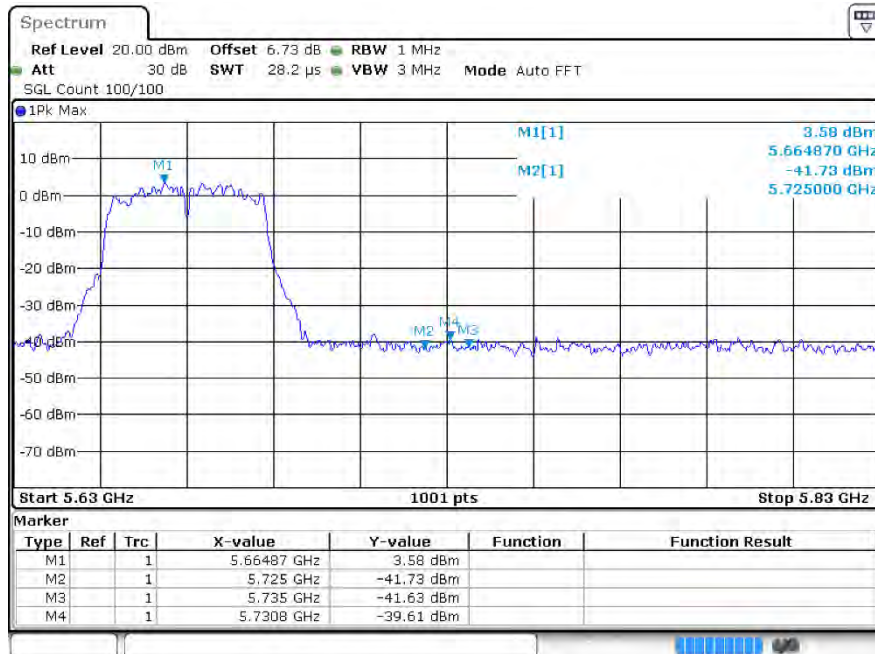


Restrict Band ac40 5670MHz Ant2 Average

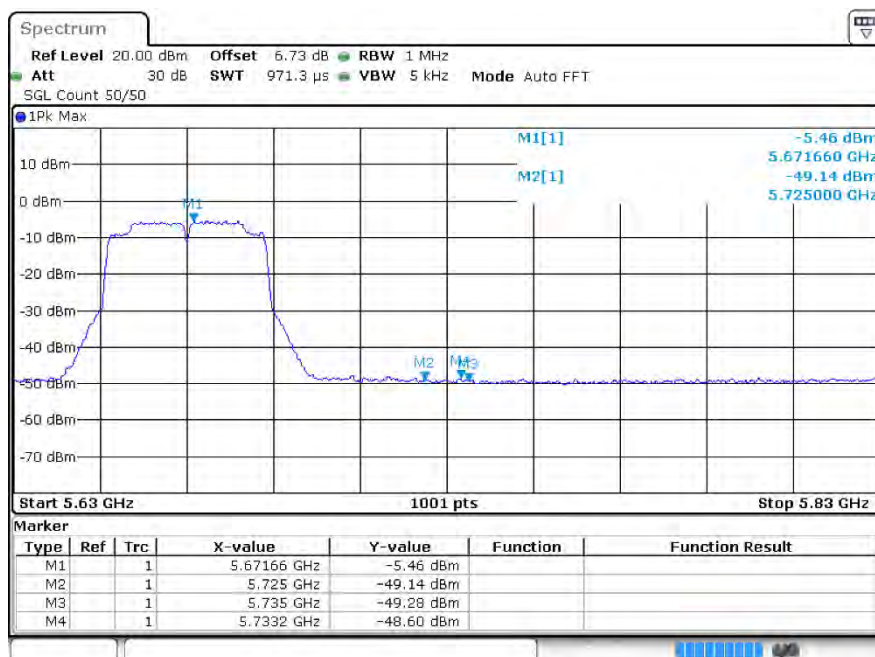


Restrict Bandac80 5210MHz Ant2 Peak

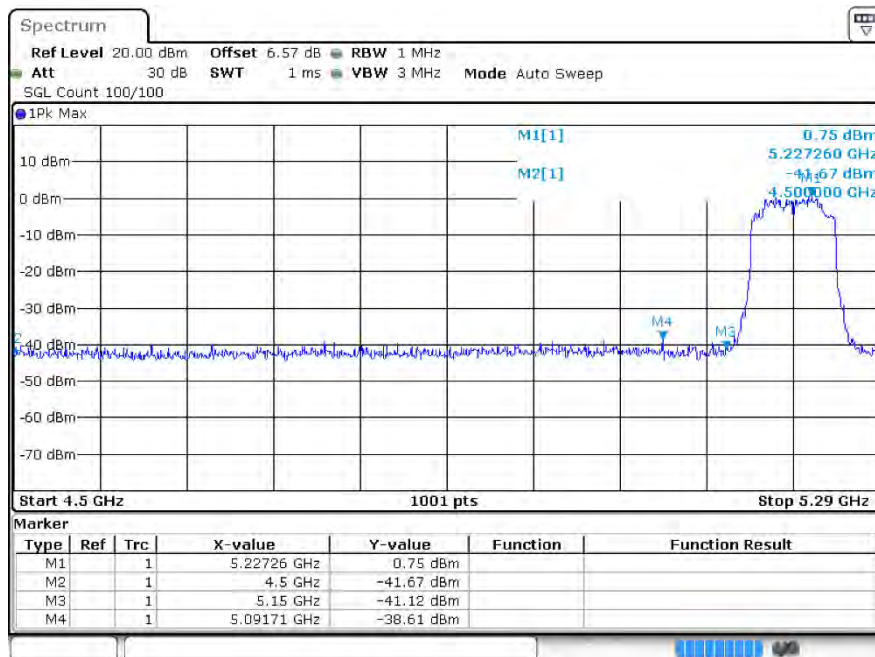


Restrict Band ac80 5210MHz Ant2 Average

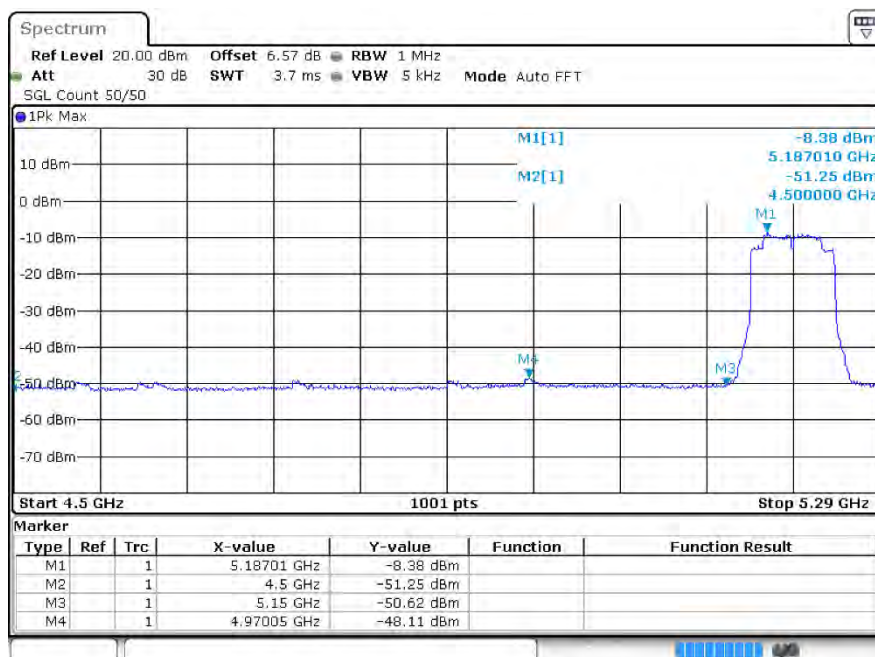


Restrict Bandac80 5290MHz Ant2 Peak

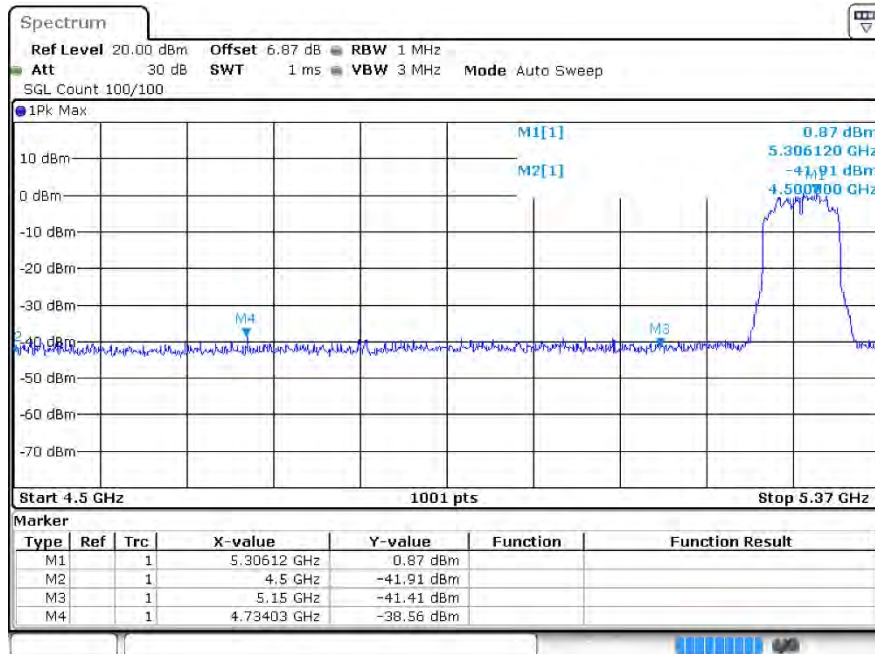


Restrict Band ac80 5290MHz Ant2 Average

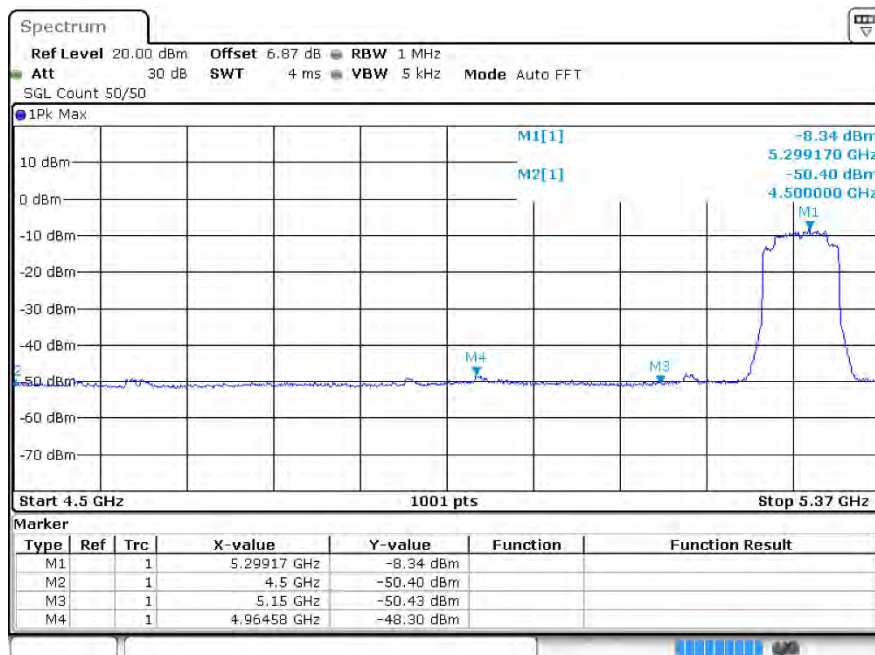


Restrict Bandac80 5530MHz Ant2 Peak

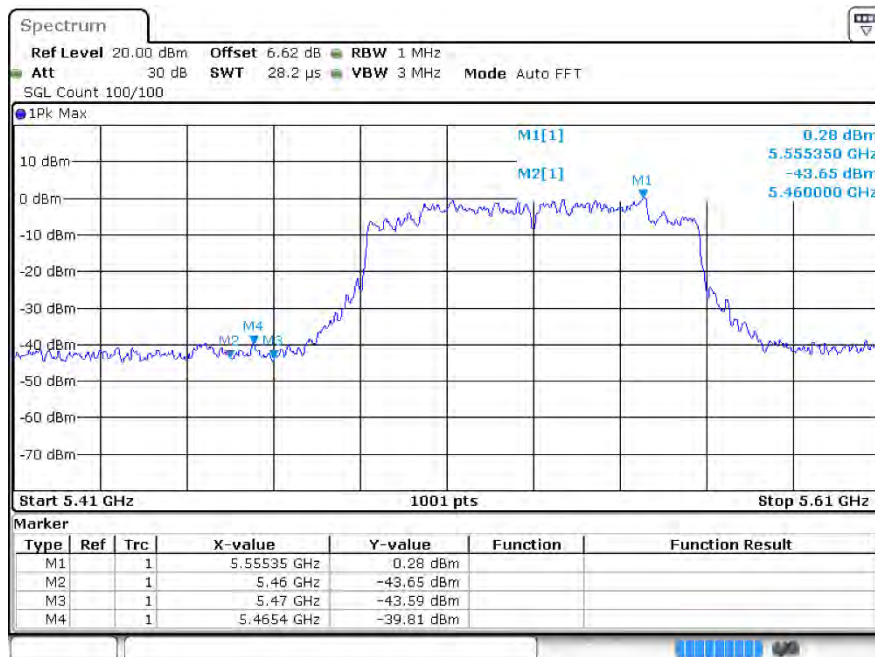

Restrict Band ac80 5530MHz Ant2 Average

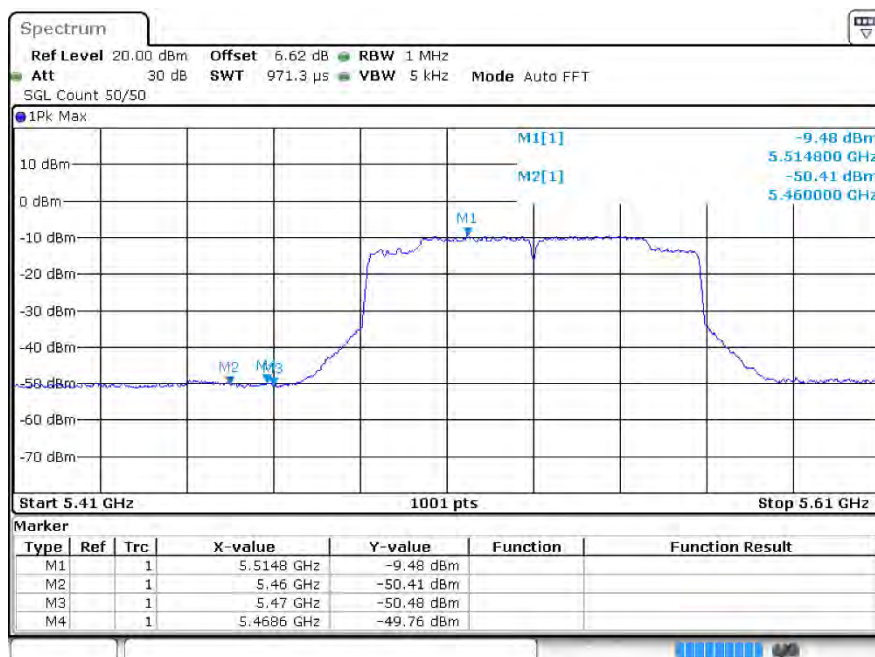

Restrict Bandac80 5610MHz Ant2 Peak

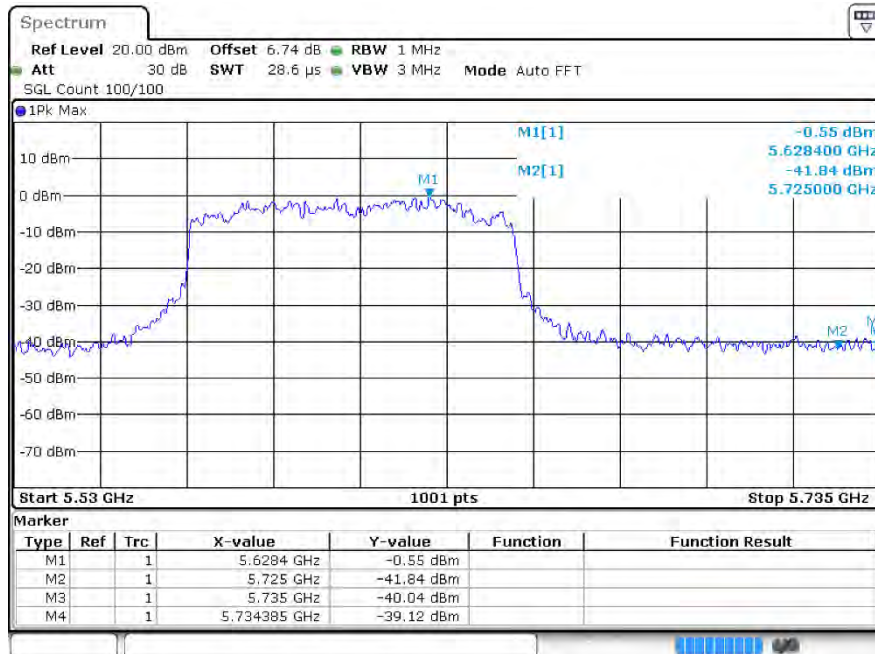

Restrict Band ac80 5610MHz Ant2 Average

