

Appendix A: Conducted Output Power

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band38	5MHz	QPSK	37775	1RB#0	23.07	PASS
Band38	5MHz	QPSK	37775	1RB#12	23.08	PASS
Band38	5MHz	QPSK	37775	1RB#24	23.73	PASS
Band38	5MHz	QPSK	37775	12RB#0	23.09	PASS
Band38	5MHz	QPSK	37775	12RB#6	23.12	PASS
Band38	5MHz	QPSK	37775	12RB#13	22.97	PASS
Band38	5MHz	QPSK	37775	25RB#0	23.02	PASS
Band38	5MHz	QPSK	38000	1RB#0	20.09	PASS
Band38	5MHz	QPSK	38000	1RB#12	20.89	PASS
Band38	5MHz	QPSK	38000	1RB#24	20.50	PASS
Band38	5MHz	QPSK	38000	12RB#0	20.08	PASS
Band38	5MHz	QPSK	38000	12RB#6	20.04	PASS
Band38	5MHz	QPSK	38000	12RB#13	20.69	PASS
Band38	5MHz	QPSK	38000	25RB#0	20.90	PASS
Band38	5MHz	QPSK	38225	1RB#0	20.04	PASS
Band38	5MHz	QPSK	38225	1RB#12	20.84	PASS
Band38	5MHz	QPSK	38225	1RB#24	21.37	PASS
Band38	5MHz	QPSK	38225	12RB#0	19.40	PASS
Band38	5MHz	QPSK	38225	12RB#6	19.44	PASS
Band38	5MHz	QPSK	38225	12RB#13	20.15	PASS
Band38	5MHz	QPSK	38225	25RB#0	19.85	PASS
Band38	5MHz	16QAM	37775	1RB#0	23.40	PASS
Band38	5MHz	16QAM	37775	1RB#12	23.44	PASS
Band38	5MHz	16QAM	37775	1RB#24	23.11	PASS
Band38	5MHz	16QAM	37775	12RB#0	22.11	PASS
Band38	5MHz	16QAM	37775	12RB#6	22.09	PASS
Band38	5MHz	16QAM	37775	12RB#13	21.96	PASS
Band38	5MHz	16QAM	37775	25RB#0	22.06	PASS
Band38	5MHz	16QAM	38000	1RB#0	20.42	PASS
Band38	5MHz	16QAM	38000	1RB#12	21.14	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38	5MHz	16QAM	38000	1RB#24	21.84	PASS
Band38	5MHz	16QAM	38000	12RB#0	21.13	PASS
Band38	5MHz	16QAM	38000	12RB#6	21.08	PASS
Band38	5MHz	16QAM	38000	12RB#13	21.82	PASS
Band38	5MHz	16QAM	38000	25RB#0	20.95	PASS
Band38	5MHz	16QAM	38225	1RB#0	19.22	PASS
Band38	5MHz	16QAM	38225	1RB#12	20.06	PASS
Band38	5MHz	16QAM	38225	1RB#24	20.57	PASS
Band38	5MHz	16QAM	38225	12RB#0	19.33	PASS
Band38	5MHz	16QAM	38225	12RB#6	20.37	PASS
Band38	5MHz	16QAM	38225	12RB#13	19.09	PASS
Band38	5MHz	16QAM	38225	25RB#0	18.82	PASS
Band38	10MHz	QPSK	37800	1RB#0	21.18	PASS
Band38	10MHz	QPSK	37800	1RB#24	23.93	PASS
Band38	10MHz	QPSK	37800	1RB#49	22.46	PASS
Band38	10MHz	QPSK	37800	25RB#0	23.10	PASS
Band38	10MHz	QPSK	37800	25RB#12	23.08	PASS
Band38	10MHz	QPSK	37800	25RB#25	22.33	PASS
Band38	10MHz	QPSK	37800	50RB#0	22.74	PASS
Band38	10MHz	QPSK	38000	1RB#0	20.87	PASS
Band38	10MHz	QPSK	38000	1RB#24	20.10	PASS
Band38	10MHz	QPSK	38000	1RB#49	21.75	PASS
Band38	10MHz	QPSK	38000	25RB#0	21.46	PASS
Band38	10MHz	QPSK	38000	25RB#12	20.45	PASS
Band38	10MHz	QPSK	38000	25RB#25	20.80	PASS
Band38	10MHz	QPSK	38000	50RB#0	20.14	PASS
Band38	10MHz	QPSK	38200	1RB#0	19.01	PASS
Band38	10MHz	QPSK	38200	1RB#24	20.27	PASS
Band38	10MHz	QPSK	38200	1RB#49	21.45	PASS
Band38	10MHz	QPSK	38200	25RB#0	18.59	PASS
Band38	10MHz	QPSK	38200	25RB#12	18.58	PASS
Band38	10MHz	QPSK	38200	25RB#25	19.84	PASS
Band38	10MHz	QPSK	38200	50RB#0	19.28	PASS
Band38	10MHz	16QAM	37800	1RB#0	23.56	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38	10MHz	16QAM	37800	1RB#24	23.32	PASS
Band38	10MHz	16QAM	37800	1RB#49	21.83	PASS
Band38	10MHz	16QAM	37800	25RB#0	22.18	PASS
Band38	10MHz	16QAM	37800	25RB#12	22.19	PASS
Band38	10MHz	16QAM	37800	25RB#25	21.42	PASS
Band38	10MHz	16QAM	37800	50RB#0	21.72	PASS
Band38	10MHz	16QAM	38000	1RB#0	20.81	PASS
Band38	10MHz	16QAM	38000	1RB#24	20.03	PASS
Band38	10MHz	16QAM	38000	1RB#49	20.63	PASS
Band38	10MHz	16QAM	38000	25RB#0	21.48	PASS
Band38	10MHz	16QAM	38000	25RB#12	21.47	PASS
Band38	10MHz	16QAM	38000	25RB#25	20.80	PASS
Band38	10MHz	16QAM	38000	50RB#0	20.17	PASS
Band38	10MHz	16QAM	38200	1RB#0	20.08	PASS
Band38	10MHz	16QAM	38200	1RB#24	19.30	PASS
Band38	10MHz	16QAM	38200	1RB#49	20.47	PASS
Band38	10MHz	16QAM	38200	25RB#0	20.66	PASS
Band38	10MHz	16QAM	38200	25RB#12	21.65	PASS
Band38	10MHz	16QAM	38200	25RB#25	19.90	PASS
Band38	10MHz	16QAM	38200	50RB#0	20.24	PASS
Band38	15MHz	QPSK	37825	1RB#0	21.08	PASS
Band38	15MHz	QPSK	37825	1RB#38	23.14	PASS
Band38	15MHz	QPSK	37825	1RB#74	20.39	PASS
Band38	15MHz	QPSK	37825	38RB#0	22.00	PASS
Band38	15MHz	QPSK	37825	38RB#18	21.99	PASS
Band38	15MHz	QPSK	37825	38RB#37	22.02	PASS
Band38	15MHz	QPSK	37825	75RB#0	22.02	PASS
Band38	15MHz	QPSK	38000	1RB#0	20.58	PASS
Band38	15MHz	QPSK	38000	1RB#38	19.97	PASS
Band38	15MHz	QPSK	38000	1RB#74	20.92	PASS
Band38	15MHz	QPSK	38000	38RB#0	20.34	PASS
Band38	15MHz	QPSK	38000	38RB#18	20.31	PASS
Band38	15MHz	QPSK	38000	38RB#37	20.34	PASS
Band38	15MHz	QPSK	38000	75RB#0	21.34	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38	15MHz	QPSK	38175	1RB#0	20.80	PASS
Band38	15MHz	QPSK	38175	1RB#38	20.44	PASS
Band38	15MHz	QPSK	38175	1RB#74	21.20	PASS
Band38	15MHz	QPSK	38175	38RB#0	18.59	PASS
Band38	15MHz	QPSK	38175	38RB#18	20.61	PASS
Band38	15MHz	QPSK	38175	38RB#37	18.62	PASS
Band38	15MHz	QPSK	38175	75RB#0	19.63	PASS
Band38	15MHz	16QAM	37825	1RB#0	23.46	PASS
Band38	15MHz	16QAM	37825	1RB#38	22.53	PASS
Band38	15MHz	16QAM	37825	1RB#74	19.72	PASS
Band38	15MHz	16QAM	37825	38RB#0	22.03	PASS
Band38	15MHz	16QAM	37825	38RB#18	22.03	PASS
Band38	15MHz	16QAM	37825	38RB#37	22.01	PASS
Band38	15MHz	16QAM	37825	75RB#0	21.05	PASS
Band38	15MHz	16QAM	38000	1RB#0	20.65	PASS
Band38	15MHz	16QAM	38000	1RB#38	20.97	PASS
Band38	15MHz	16QAM	38000	1RB#74	20.91	PASS
Band38	15MHz	16QAM	38000	38RB#0	21.32	PASS
Band38	15MHz	16QAM	38000	38RB#18	20.31	PASS
Band38	15MHz	16QAM	38000	38RB#37	20.35	PASS
Band38	15MHz	16QAM	38000	75RB#0	20.32	PASS
Band38	15MHz	16QAM	38175	1RB#0	20.84	PASS
Band38	15MHz	16QAM	38175	1RB#38	21.57	PASS
Band38	15MHz	16QAM	38175	1RB#74	20.27	PASS
Band38	15MHz	16QAM	38175	38RB#0	18.64	PASS
Band38	15MHz	16QAM	38175	38RB#18	18.61	PASS
Band38	15MHz	16QAM	38175	38RB#37	18.60	PASS
Band38	15MHz	16QAM	38175	75RB#0	20.58	PASS
Band38	20MHz	QPSK	37850	1RB#0	23.91	PASS
Band38	20MHz	QPSK	37850	1RB#49	22.38	PASS
Band38	20MHz	QPSK	37850	1RB#99	18.26	PASS
Band38	20MHz	QPSK	37850	50RB#0	22.44	PASS
Band38	20MHz	QPSK	37850	50RB#25	22.47	PASS
Band38	20MHz	QPSK	37850	50RB#50	19.48	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38	20MHz	QPSK	37850	100RB#0	21.19	PASS
Band38	20MHz	QPSK	38000	1RB#0	19.26	PASS
Band38	20MHz	QPSK	38000	1RB#49	21.04	PASS
Band38	20MHz	QPSK	38000	1RB#99	20.14	PASS
Band38	20MHz	QPSK	38000	50RB#0	20.10	PASS
Band38	20MHz	QPSK	38000	50RB#25	21.09	PASS
Band38	20MHz	QPSK	38000	50RB#50	20.82	PASS
Band38	20MHz	QPSK	38000	100RB#0	20.52	PASS
Band38	20MHz	QPSK	38150	1RB#0	20.64	PASS
Band38	20MHz	QPSK	38150	1RB#49	20.91	PASS
Band38	20MHz	QPSK	38150	1RB#99	20.84	PASS
Band38	20MHz	QPSK	38150	50RB#0	20.82	PASS
Band38	20MHz	QPSK	38150	50RB#25	20.81	PASS
Band38	20MHz	QPSK	38150	50RB#50	21.88	PASS
Band38	20MHz	QPSK	38150	100RB#0	20.95	PASS
Band38	20MHz	16QAM	37850	1RB#0	23.10	PASS
Band38	20MHz	16QAM	37850	1RB#49	21.59	PASS
Band38	20MHz	16QAM	37850	1RB#99	20.46	PASS
Band38	20MHz	16QAM	37850	50RB#0	21.50	PASS
Band38	20MHz	16QAM	37850	50RB#25	21.54	PASS
Band38	20MHz	16QAM	37850	50RB#50	20.56	PASS
Band38	20MHz	16QAM	37850	100RB#0	20.23	PASS
Band38	20MHz	16QAM	38000	1RB#0	21.96	PASS
Band38	20MHz	16QAM	38000	1RB#49	20.74	PASS
Band38	20MHz	16QAM	38000	1RB#99	20.77	PASS
Band38	20MHz	16QAM	38000	50RB#0	20.18	PASS
Band38	20MHz	16QAM	38000	50RB#25	20.16	PASS
Band38	20MHz	16QAM	38000	50RB#50	20.86	PASS
Band38	20MHz	16QAM	38000	100RB#0	21.58	PASS
Band38	20MHz	16QAM	38150	1RB#0	20.63	PASS
Band38	20MHz	16QAM	38150	1RB#49	20.90	PASS
Band38	20MHz	16QAM	38150	1RB#99	19.86	PASS
Band38	20MHz	16QAM	38150	50RB#0	20.81	PASS
Band38	20MHz	16QAM	38150	50RB#25	20.79	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38	20MHz	16QAM	38150	50RB#50	20.89	PASS
Band38	20MHz	16QAM	38150	100RB#0	20.00	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd

Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd

Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>

Appendix B: Peak-to-Average Ratio(CCDF)

Test Result


Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dB)	Limit(dB)	Verdict
Band38	5MHz	QPSK	37775	1RB#0	5.30	13	PASS
Band38	5MHz	QPSK	37775	25RB#0	5.43	13	PASS
Band38	5MHz	QPSK	38000	1RB#0	5.50	13	PASS
Band38	5MHz	QPSK	38000	25RB#0	5.58	13	PASS
Band38	5MHz	QPSK	38225	1RB#0	4.98	13	PASS
Band38	5MHz	QPSK	38225	25RB#0	5.69	13	PASS
Band38	5MHz	16QAM	37775	1RB#0	6.16	13	PASS
Band38	5MHz	16QAM	37775	25RB#0	6.23	13	PASS
Band38	5MHz	16QAM	38000	1RB#0	5.91	13	PASS
Band38	5MHz	16QAM	38000	25RB#0	6.86	13	PASS
Band38	5MHz	16QAM	38225	1RB#0	5.56	13	PASS
Band38	5MHz	16QAM	38225	25RB#0	6.75	13	PASS
Band38	10MHz	QPSK	37800	1RB#0	5.62	13	PASS
Band38	10MHz	QPSK	37800	50RB#0	5.50	13	PASS
Band38	10MHz	QPSK	38000	1RB#0	5.51	13	PASS
Band38	10MHz	QPSK	38000	50RB#0	5.57	13	PASS
Band38	10MHz	QPSK	38200	1RB#0	5.18	13	PASS
Band38	10MHz	QPSK	38200	50RB#0	5.66	13	PASS
Band38	10MHz	16QAM	37800	1RB#0	6.21	13	PASS
Band38	10MHz	16QAM	37800	50RB#0	6.31	13	PASS
Band38	10MHz	16QAM	38000	1RB#0	6.20	13	PASS
Band38	10MHz	16QAM	38000	50RB#0	6.31	13	PASS
Band38	10MHz	16QAM	38200	1RB#0	6.62	13	PASS
Band38	10MHz	16QAM	38200	50RB#0	6.36	13	PASS
Band38	15MHz	QPSK	37825	1RB#0	5.43	13	PASS
Band38	15MHz	QPSK	37825	75RB#0	5.74	13	PASS
Band38	15MHz	QPSK	38000	1RB#0	5.78	13	PASS
Band38	15MHz	QPSK	38000	75RB#0	5.85	13	PASS
Band38	15MHz	QPSK	38175	1RB#0	5.59	13	PASS
Band38	15MHz	QPSK	38175	75RB#0	5.93	13	PASS
Band38	15MHz	16QAM	37825	1RB#0	6.19	13	PASS
Band38	15MHz	16QAM	37825	75RB#0	6.38	13	PASS
Band38	15MHz	16QAM	38000	1RB#0	6.38	13	PASS
Band38	15MHz	16QAM	38000	75RB#0	6.39	13	PASS
Band38	15MHz	16QAM	38175	1RB#0	6.54	13	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38	15MHz	16QAM	38175	75RB#0	6.43	13	PASS
Band38	20MHz	QPSK	37850	1RB#0	5.03	13	PASS
Band38	20MHz	QPSK	37850	100RB#0	5.54	13	PASS
Band38	20MHz	QPSK	38000	1RB#0	5.50	13	PASS
Band38	20MHz	QPSK	38000	100RB#0	5.65	13	PASS
Band38	20MHz	QPSK	38150	1RB#0	5.94	13	PASS
Band38	20MHz	QPSK	38150	100RB#0	5.63	13	PASS
Band38	20MHz	16QAM	37850	1RB#0	5.68	13	PASS
Band38	20MHz	16QAM	37850	100RB#0	6.29	13	PASS
Band38	20MHz	16QAM	38000	1RB#0	6.33	13	PASS
Band38	20MHz	16QAM	38000	100RB#0	6.42	13	PASS
Band38	20MHz	16QAM	38150	1RB#0	6.25	13	PASS
Band38	20MHz	16QAM	38150	100RB#0	6.35	13	PASS


Test Graphs

Band38-5MHz-QPSK-37775-1RB#0

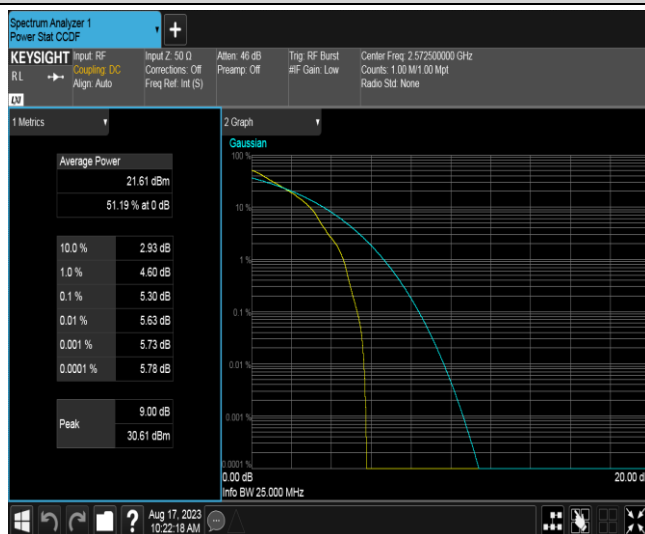


Band38-5MHz-QPSK-37775-25RB#0


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

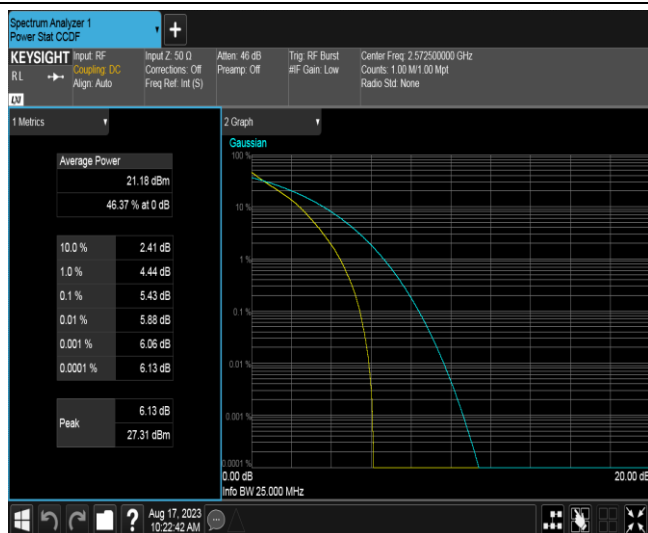

Band38-5MHz-QPSK-38000-1RB#0

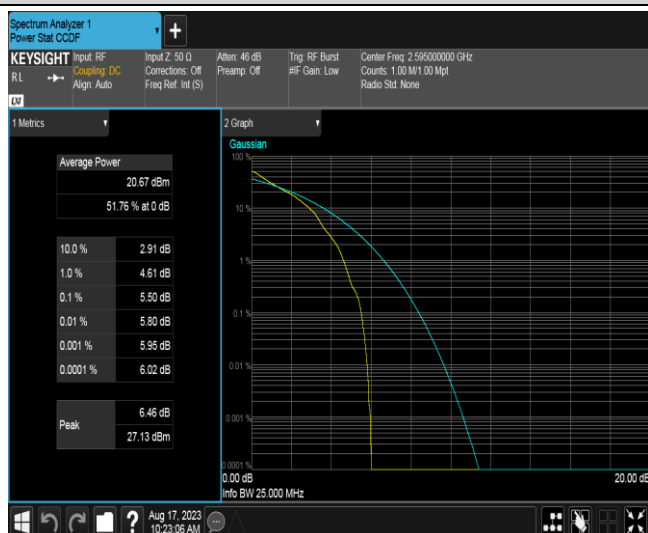


Band38-5MHz-QPSK-38000-25RB#0

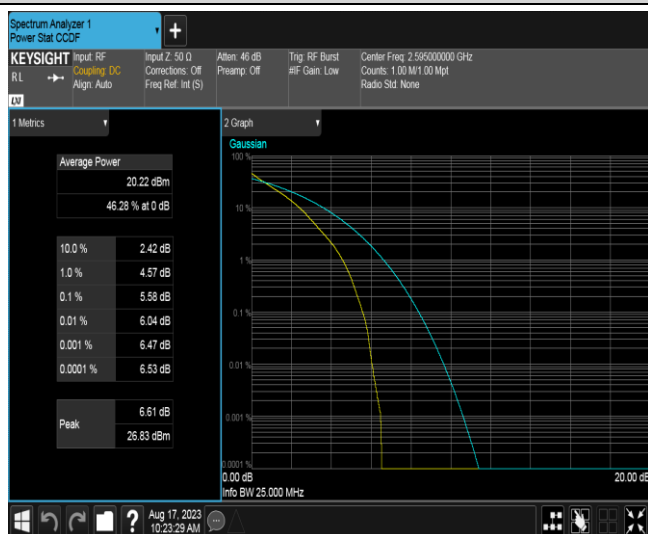


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38-5MHz-QPSK-38225-1RB#0

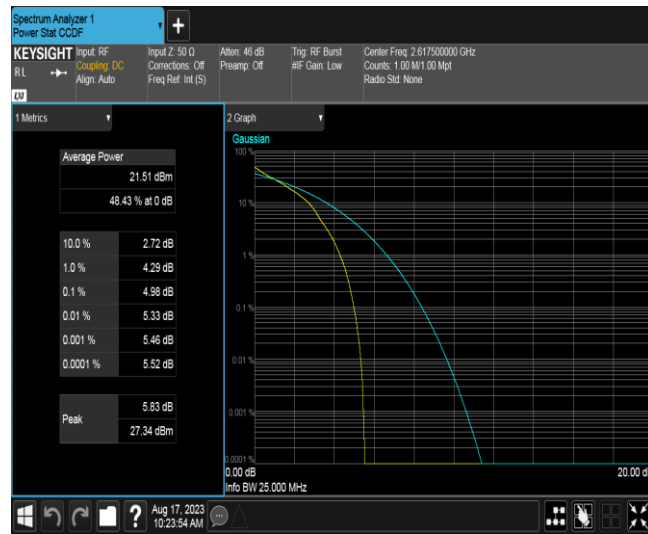


Band38-5MHz-QPSK-38225-25RB#0

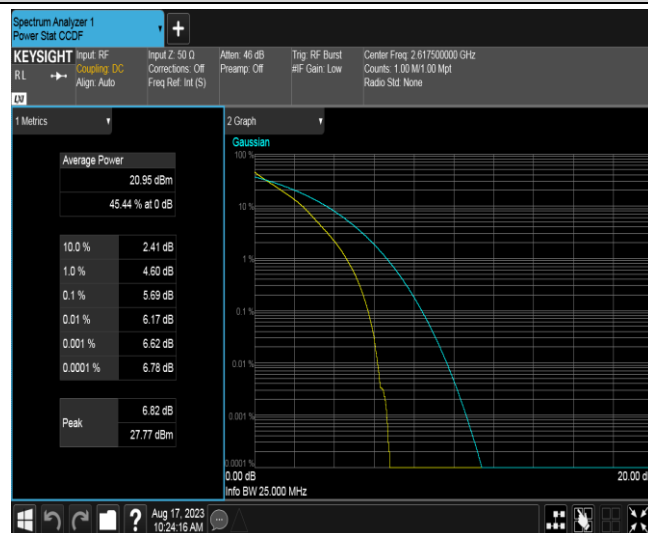

Band38-5MHz-16QAM-37775-1RB#0


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

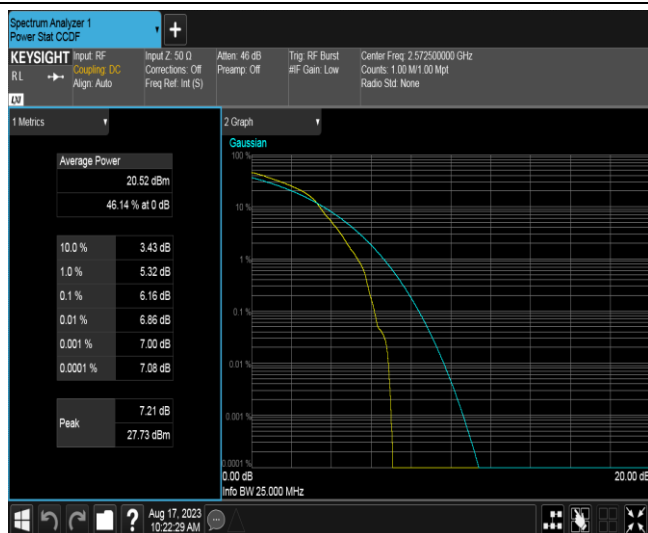

Band38-5MHz-16QAM-37775-25RB#0




Band38-5MHz-16QAM-38000-1RB#0

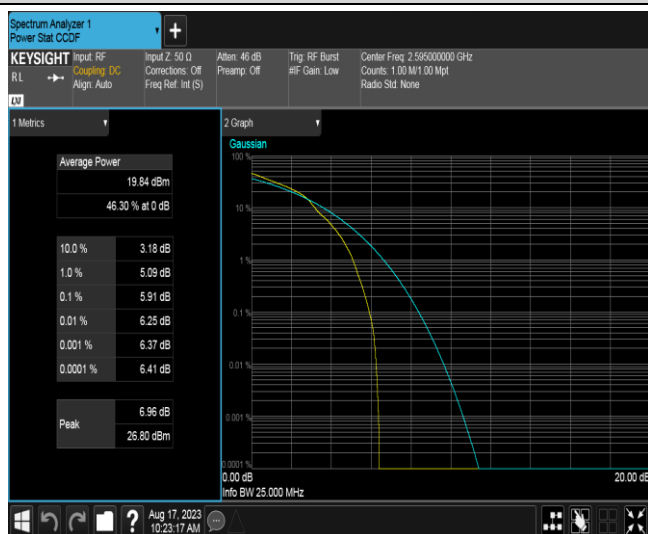


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38-5MHz-16QAM-38000-25RB#0

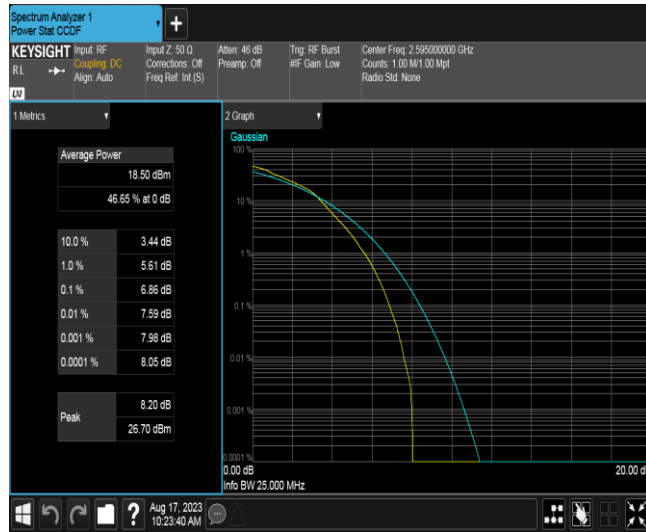


Band38-5MHz-16QAM-38225-1RB#0

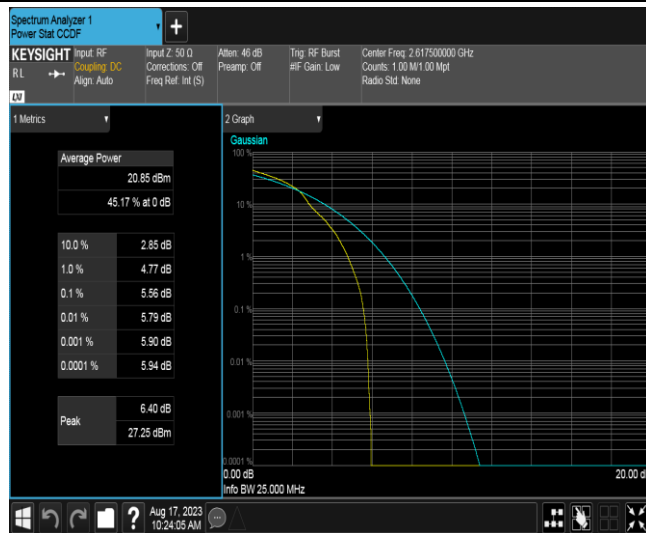


Band38-5MHz-16QAM-38225-25RB#0

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd
Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd
Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>

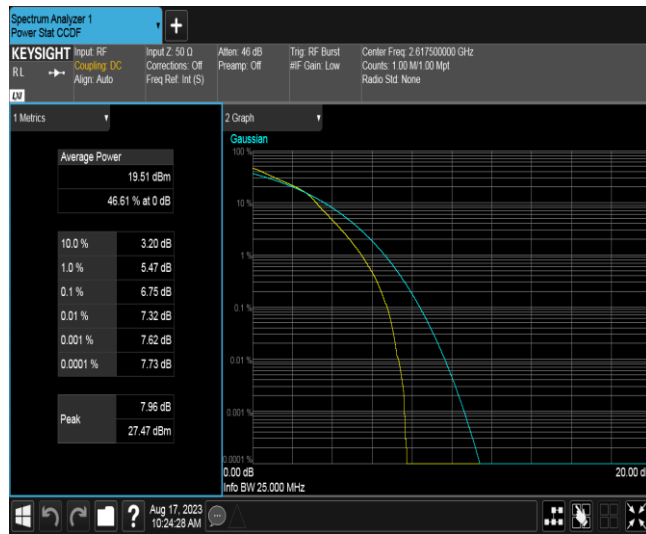

Band38-10MHz-QPSK-37800-1RB#0

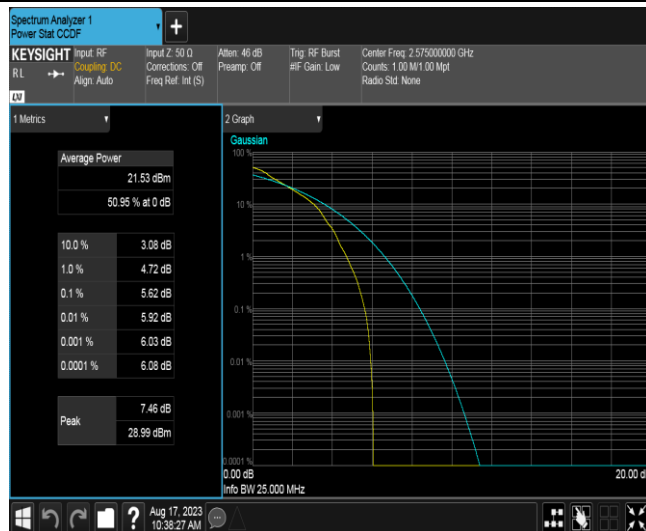


Band38-10MHz-QPSK-37800-50RB#0



Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38-10MHz-QPSK-38000-1RB#0

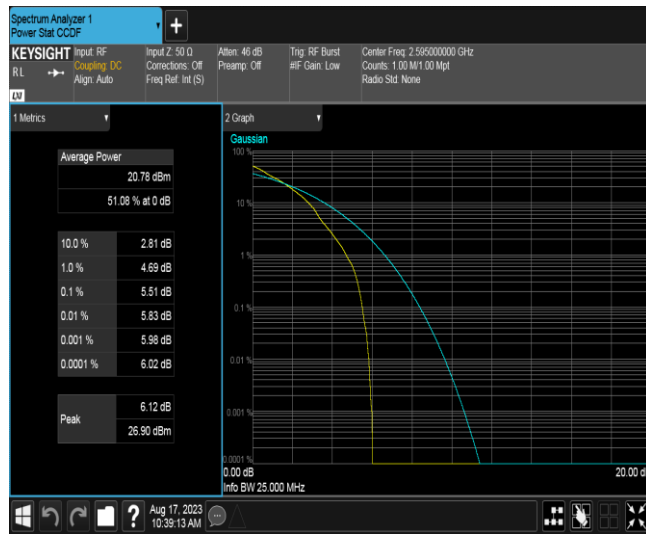


Band38-10MHz-QPSK-38000-50RB#0




Band38-10MHz-QPSK-38200-1RB#0

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.


Attestation of Global Compliance(Shenzhen)Co., Ltd
Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd
Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>

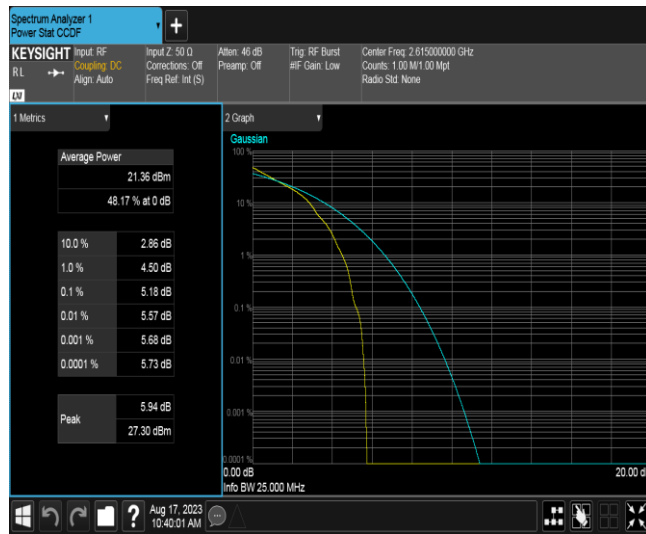

Band38-10MHz-QPSK-38200-50RB#0

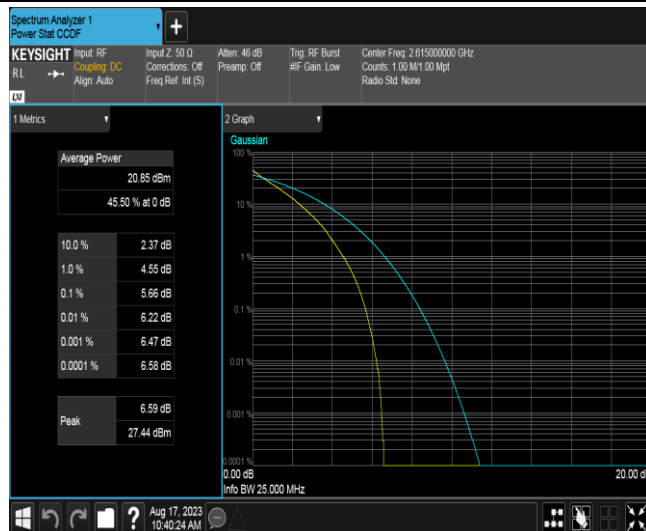


Band38-10MHz-16QAM-37800-1RB#0

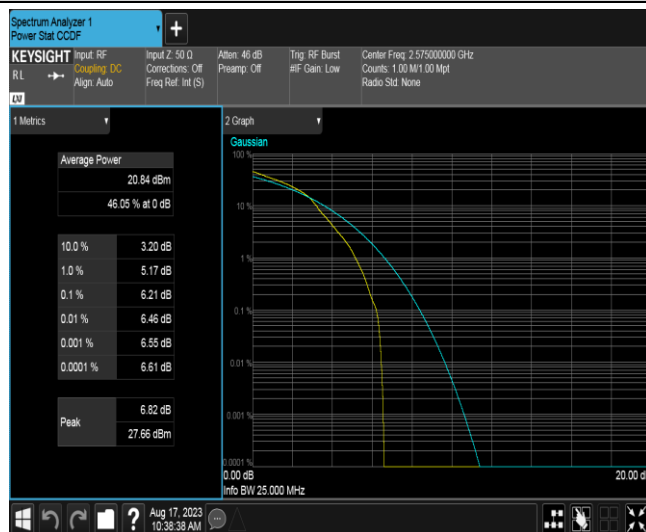


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38-10MHz-16QAM-37800-50RB#0

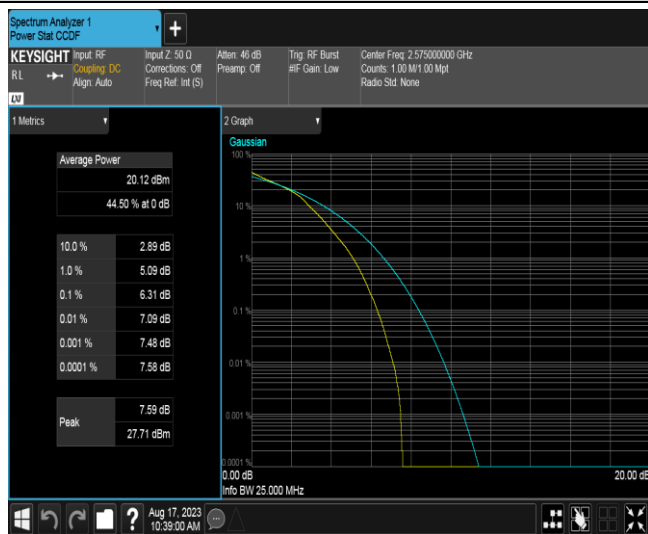

Band38-10MHz-16QAM-38000-1RB#0

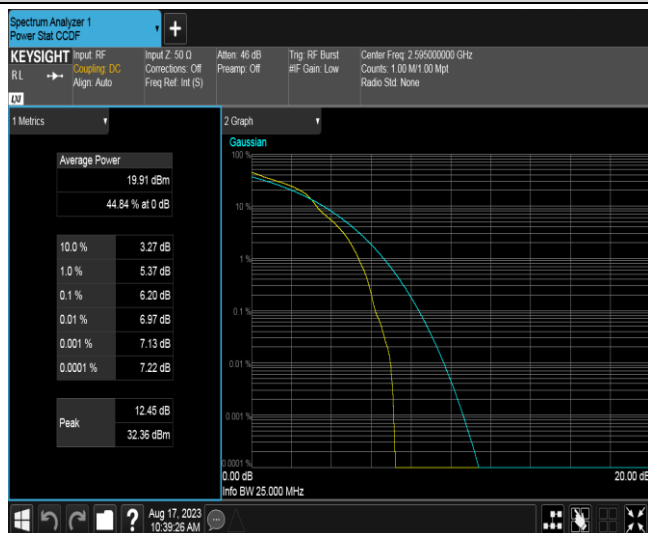

Band38-10MHz-16QAM-38000-50RB#0


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.



Band38-10MHz-16QAM-38200-1RB#0



Band38-10MHz-16QAM-38200-50RB#0

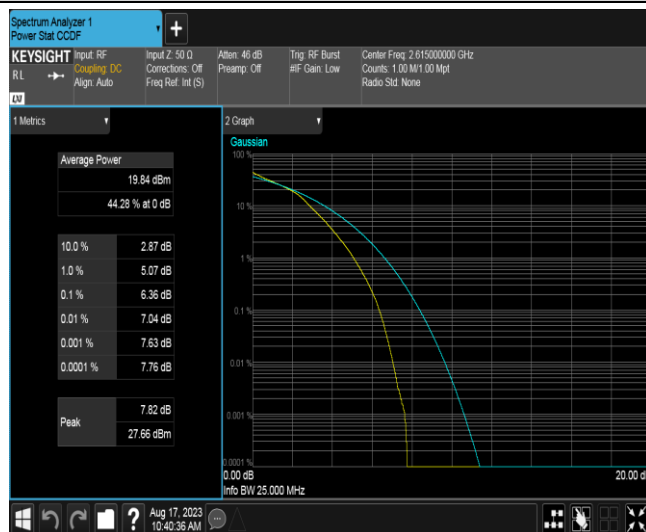


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38-15MHz-QPSK-37825-1RB#0




Band38-15MHz-QPSK-37825-75RB#0

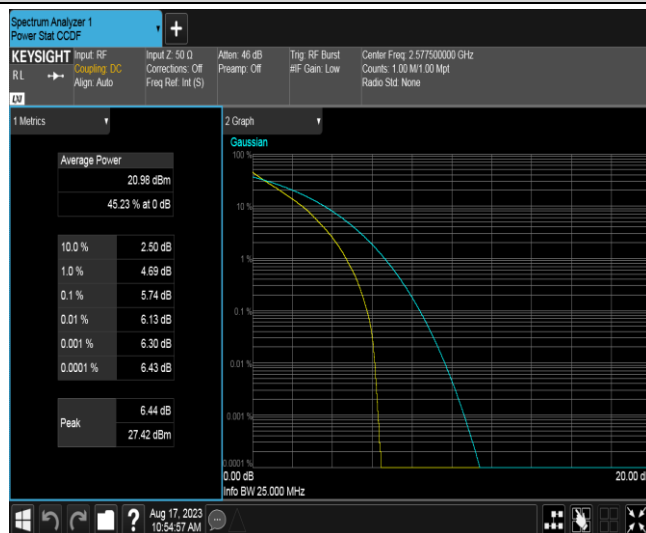


Band38-15MHz-QPSK-38000-1RB#0

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

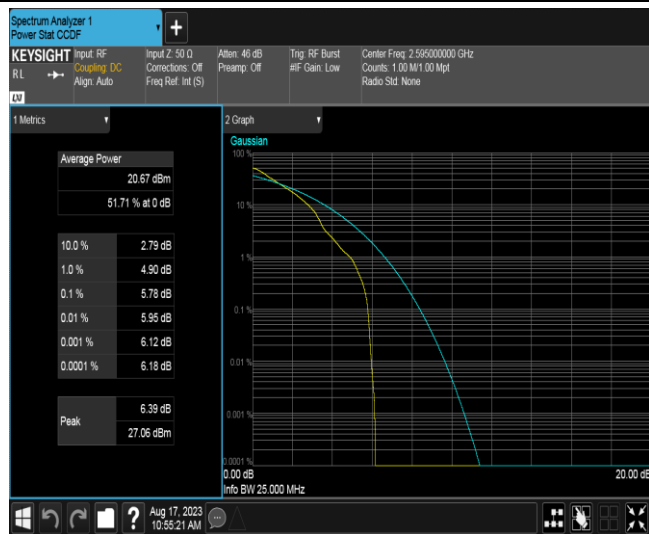

Band38-15MHz-QPSK-38000-75RB#0

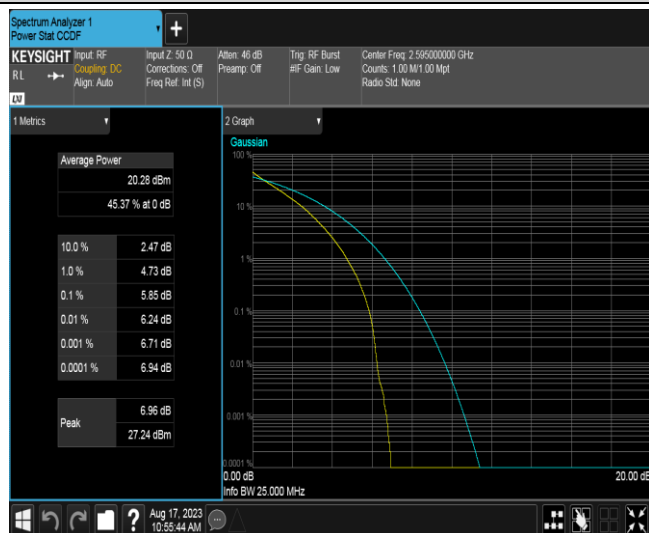


Band38-15MHz-QPSK-38175-1RB#0




Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38-15MHz-QPSK-38175-75RB#0

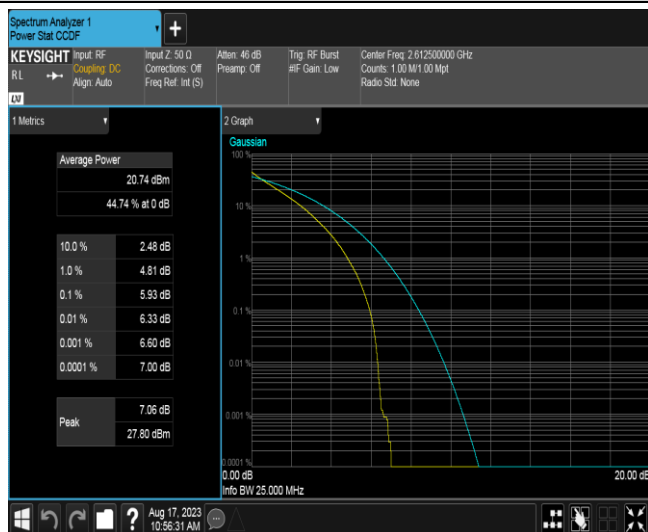


Band38-15MHz-16QAM-37825-1RB#0

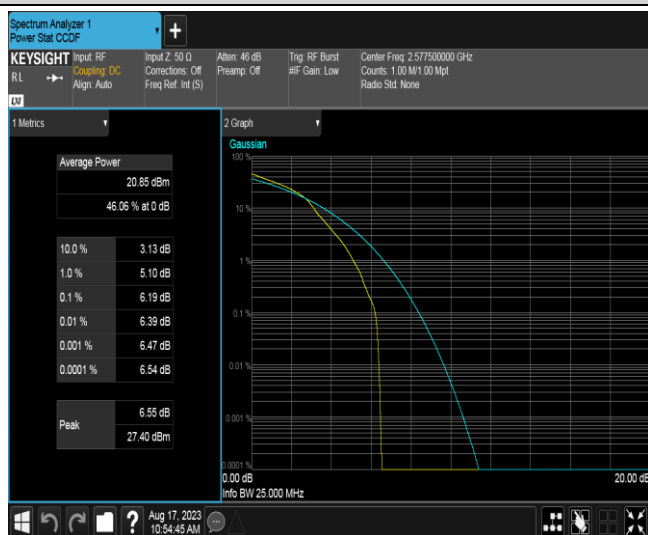

Band38-15MHz-16QAM-37825-75RB#0

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

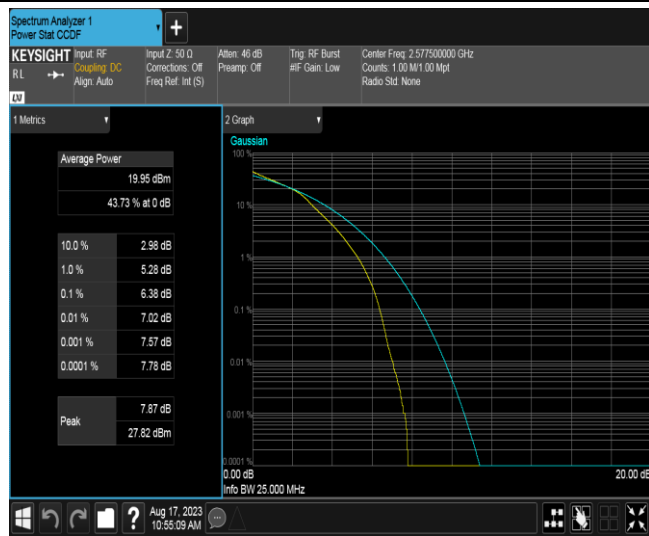

Band38-15MHz-16QAM-38000-1RB#0




Band38-15MHz-16QAM-38000-75RB#0



Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38-15MHz-16QAM-38175-1RB#0

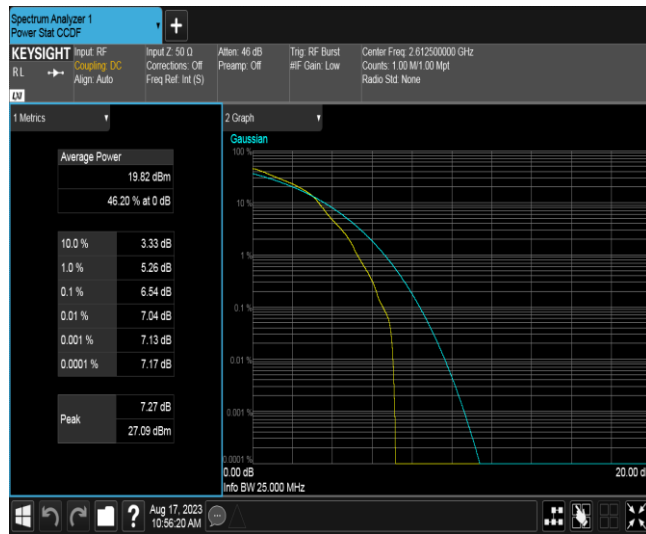


Band38-15MHz-16QAM-38175-75RB#0



Band38-20MHz-QPSK-37850-1RB#0

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.


Attestation of Global Compliance(Shenzhen)Co., Ltd
Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd
Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>

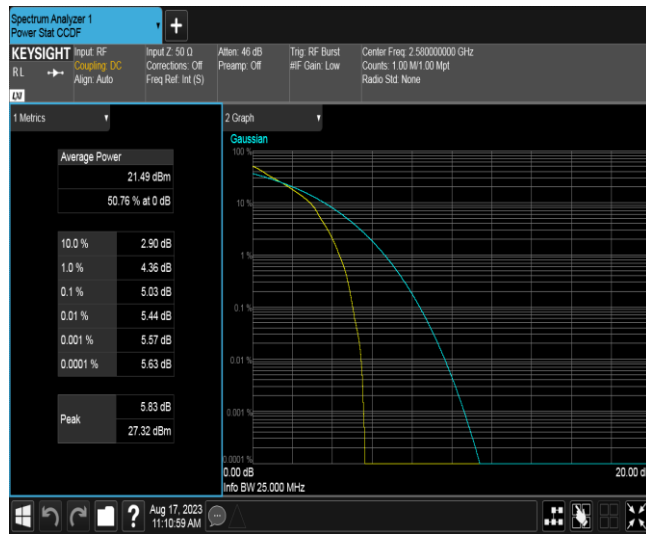

Band38-20MHz-QPSK-37850-100RB#0




Band38-20MHz-QPSK-38000-1RB#0

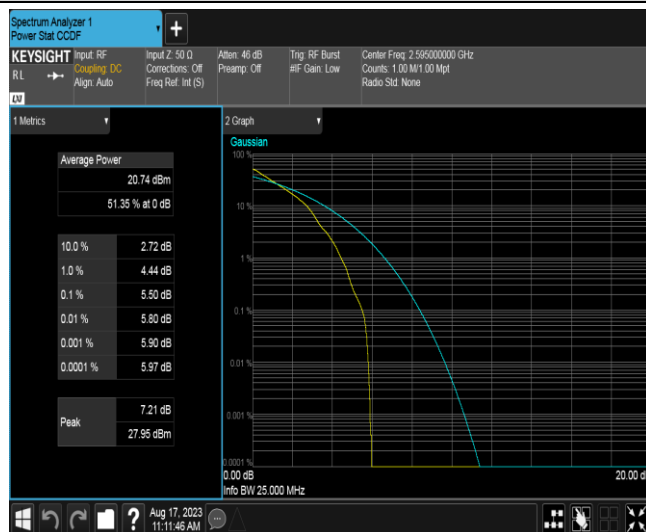


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38-20MHz-QPSK-38000-100RB#0

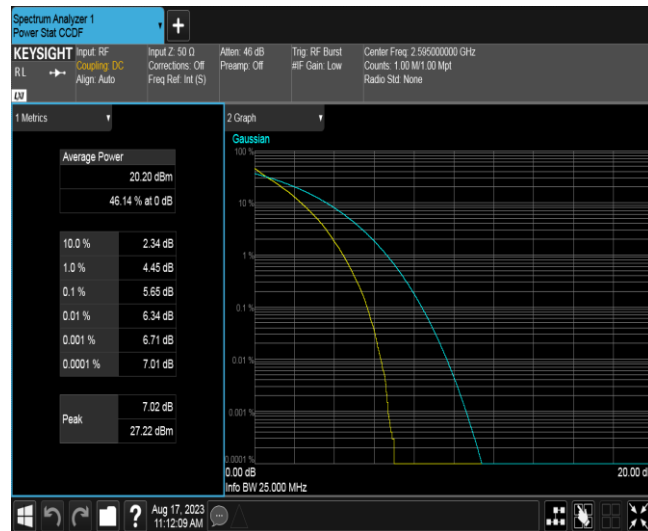


Band38-20MHz-QPSK-38150-1RB#0

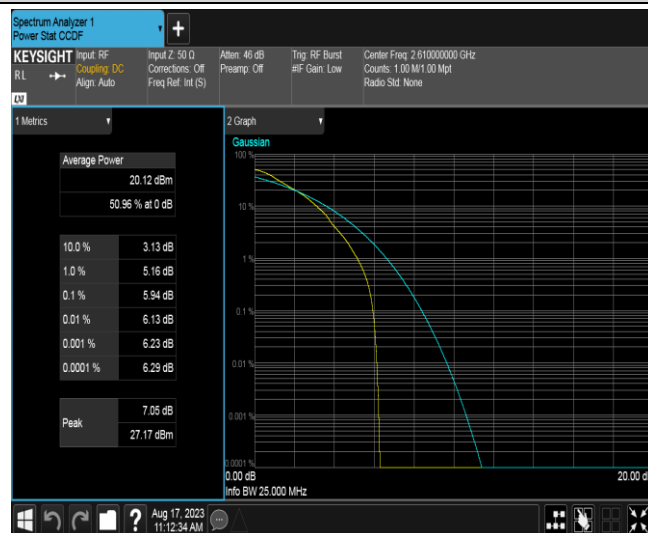


Band38-20MHz-QPSK-38150-100RB#0

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd
Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd
Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>

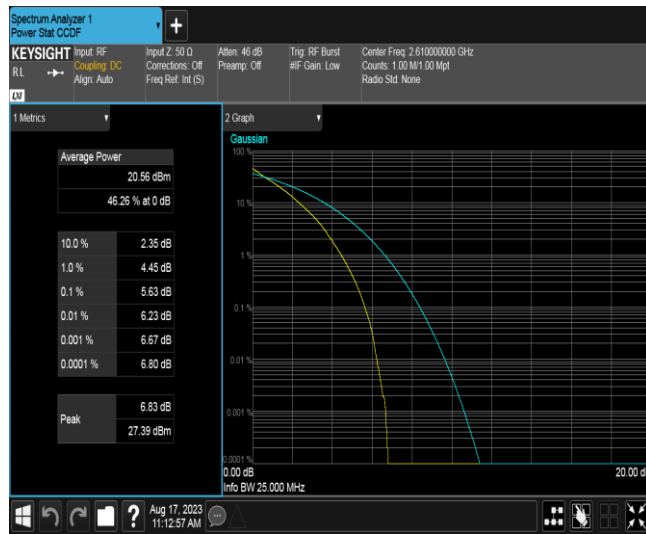

Band38-20MHz-16QAM-37850-1RB#0

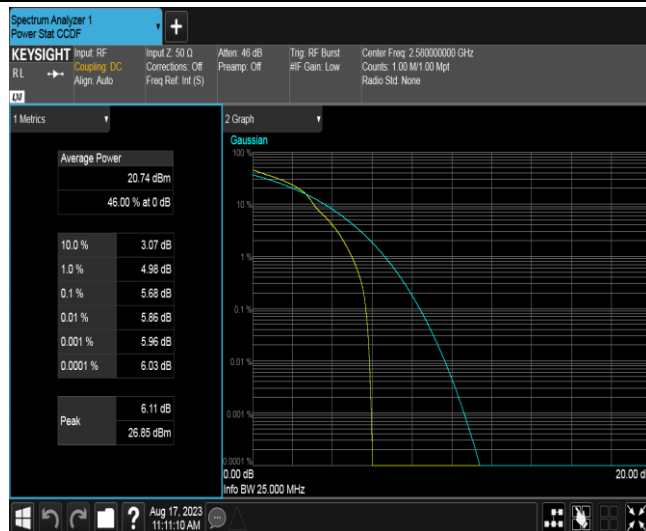


Band38-20MHz-16QAM-37850-100RB#0




Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38-20MHz-16QAM-38000-1RB#0

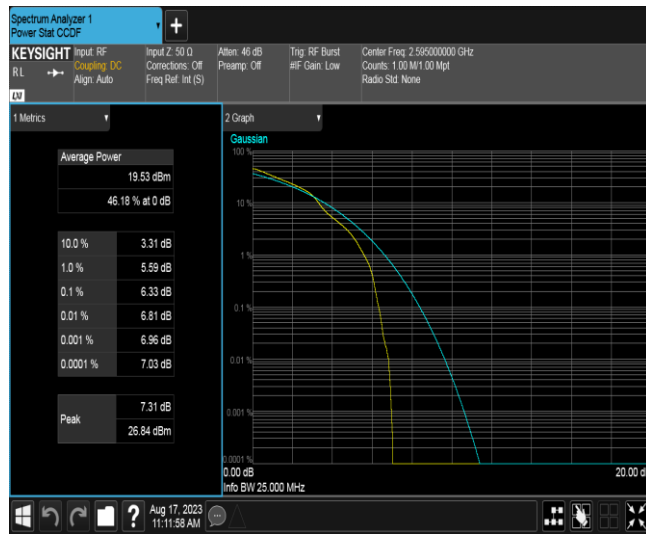


Band38-20MHz-16QAM-38000-100RB#0

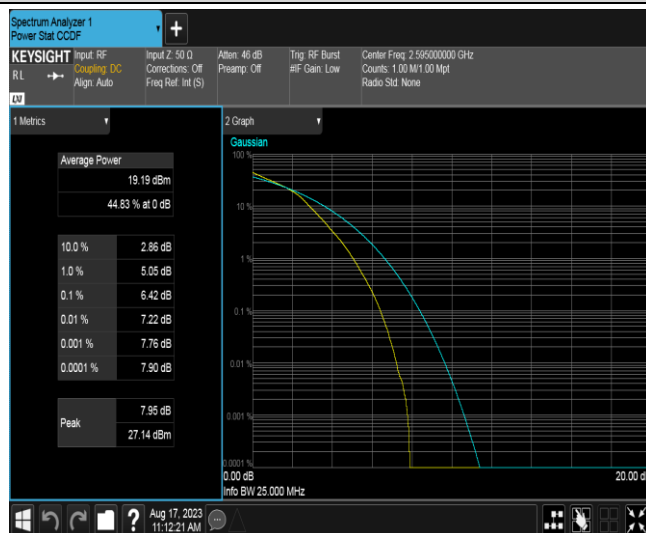

Band38-20MHz-16QAM-38150-1RB#0

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd
Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd
Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>

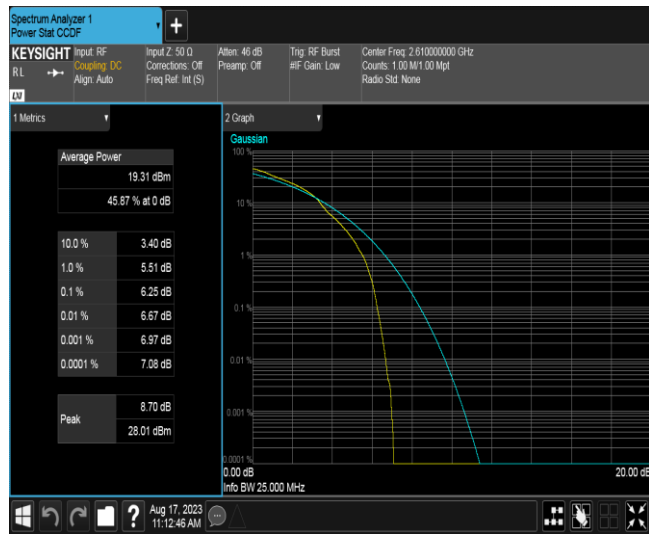

Band38-20MHz-16QAM-38150-100RB#0



Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd
Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd
Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>

Appendix C: 26dB Bandwidth and Occupied Bandwidth

Test Result


Band	Bandwidth	Modulation	Channel	RB Configuration	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band38	5MHz	QPSK	37775	25RB#0	4.4953	4.832	PASS
Band38	5MHz	QPSK	38000	25RB#0	4.5052	4.945	PASS
Band38	5MHz	QPSK	38225	25RB#0	4.5141	4.765	PASS
Band38	5MHz	16QAM	37775	25RB#0	4.4948	4.807	PASS
Band38	5MHz	16QAM	38000	25RB#0	4.5025	4.777	PASS
Band38	5MHz	16QAM	38225	25RB#0	4.4980	4.868	PASS
Band38	10MHz	QPSK	37800	50RB#0	8.9782	9.516	PASS
Band38	10MHz	QPSK	38000	50RB#0	8.9934	9.550	PASS
Band38	10MHz	QPSK	38200	50RB#0	8.9822	9.518	PASS
Band38	10MHz	16QAM	37800	50RB#0	8.9821	9.556	PASS
Band38	10MHz	16QAM	38000	50RB#0	8.9813	9.543	PASS
Band38	10MHz	16QAM	38200	50RB#0	8.9730	9.501	PASS
Band38	15MHz	QPSK	37825	75RB#0	13.475	14.26	PASS
Band38	15MHz	QPSK	38000	75RB#0	13.469	14.26	PASS
Band38	15MHz	QPSK	38175	75RB#0	13.469	14.23	PASS
Band38	15MHz	16QAM	37825	75RB#0	13.456	14.22	PASS
Band38	15MHz	16QAM	38000	75RB#0	13.458	14.22	PASS
Band38	15MHz	16QAM	38175	75RB#0	13.489	14.24	PASS
Band38	20MHz	QPSK	37850	100RB#0	17.918	18.93	PASS
Band38	20MHz	QPSK	38000	100RB#0	17.949	18.96	PASS
Band38	20MHz	QPSK	38150	100RB#0	17.931	18.93	PASS
Band38	20MHz	16QAM	37850	100RB#0	17.924	18.93	PASS
Band38	20MHz	16QAM	38000	100RB#0	17.961	18.95	PASS
Band38	20MHz	16QAM	38150	100RB#0	17.942	18.95	PASS

Test Graphs


Band38-5MHz-QPSK-37775-25RB#0

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.


Attestation of Global Compliance(Shenzhen)Co., Ltd
Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd
Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: http://www.agccert.com/

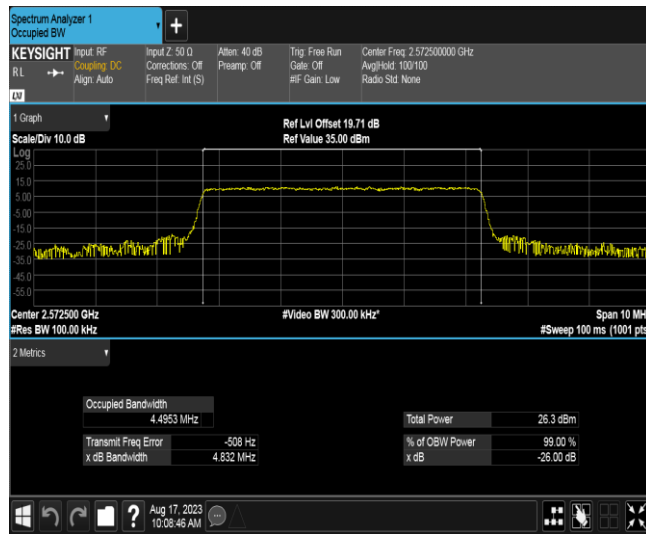

Band38-5MHz-QPSK-38000-25RB#0

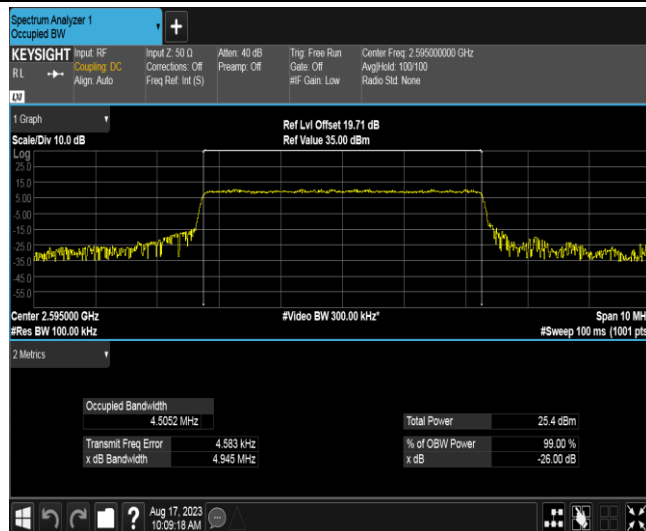


Band38-5MHz-QPSK-38225-25RB#0

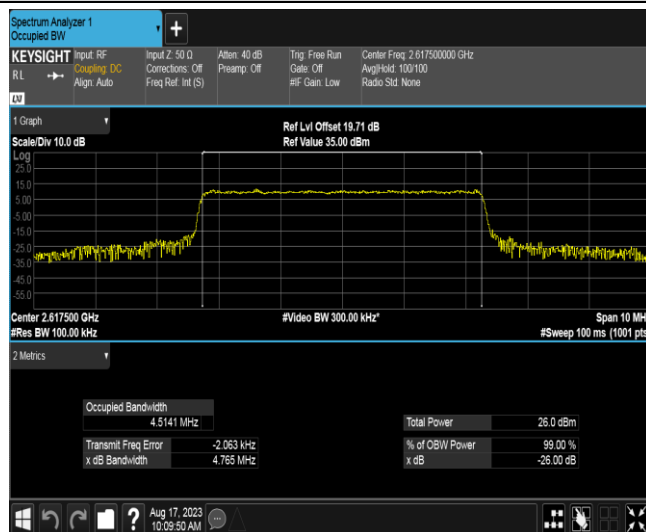

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38-5MHz-16QAM-37775-25RB#0

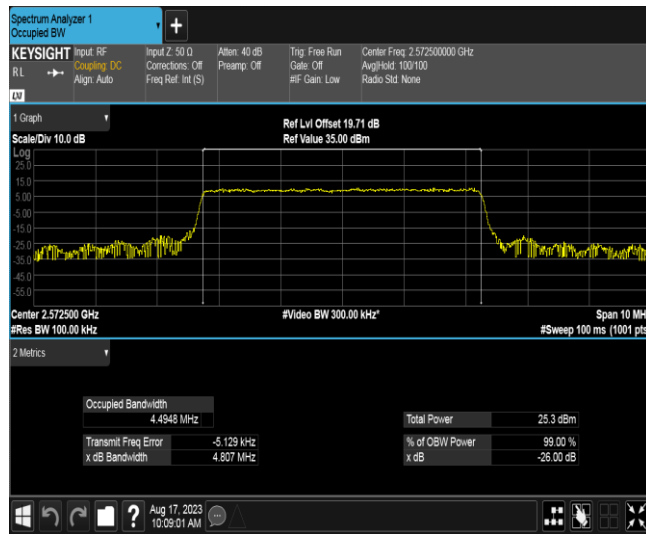


Band38-5MHz-16QAM-38000-25RB#0




Band38-5MHz-16QAM-38225-25RB#0


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

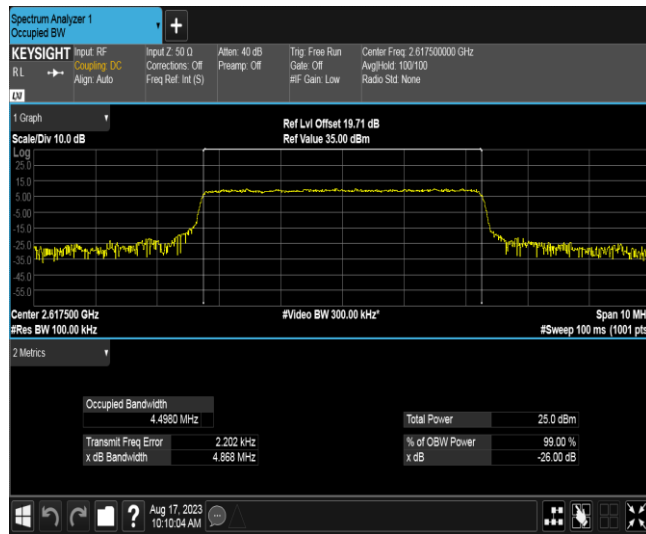

Band38-10MHz-QPSK-37800-50RB#0

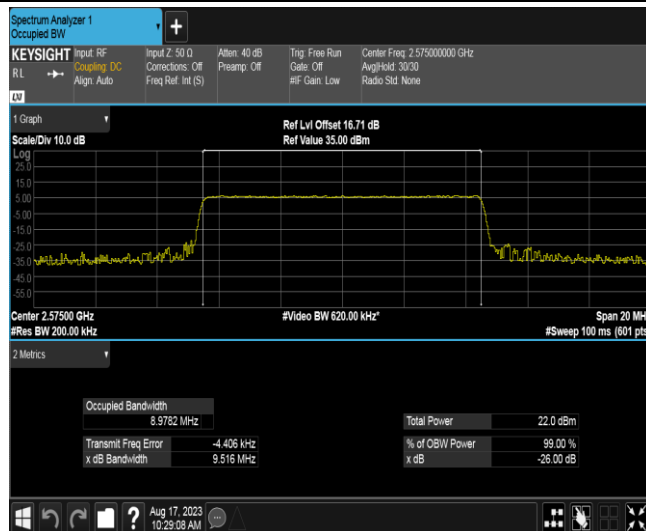


Band38-10MHz-QPSK-38000-50RB#0

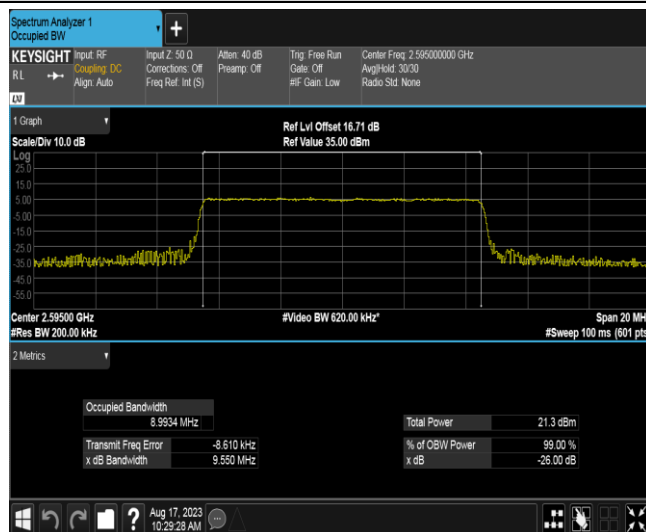


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38-10MHz-QPSK-38200-50RB#0

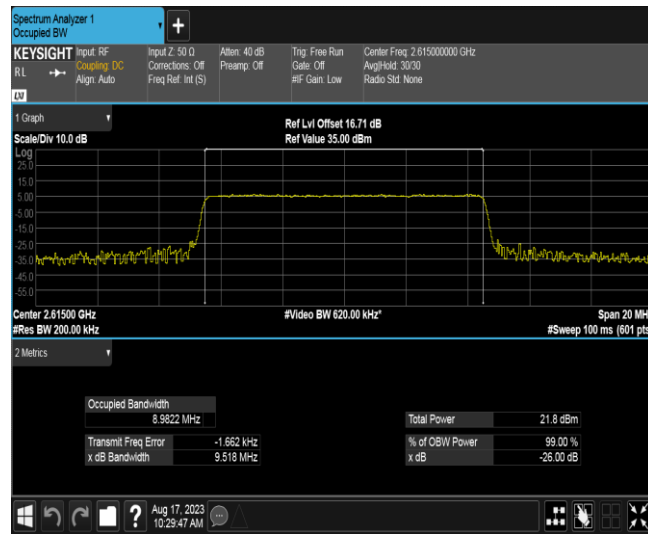


Band38-10MHz-16QAM-37800-50RB#0

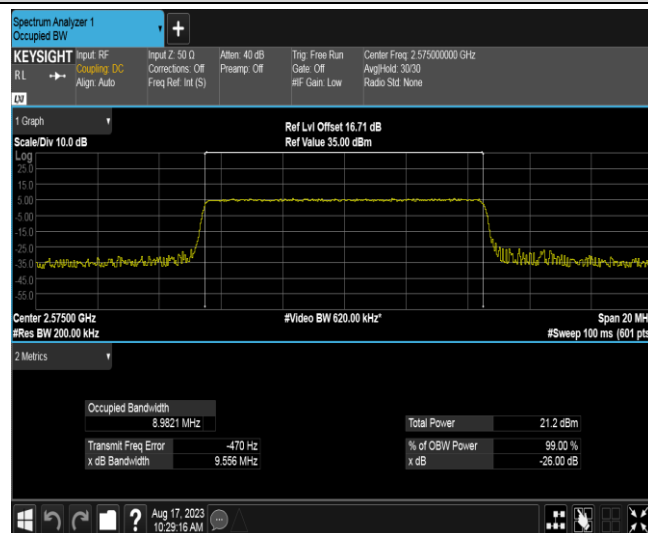


Band38-10MHz-16QAM-38000-50RB#0

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.


Attestation of Global Compliance(Shenzhen)Co., Ltd
Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd
Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>

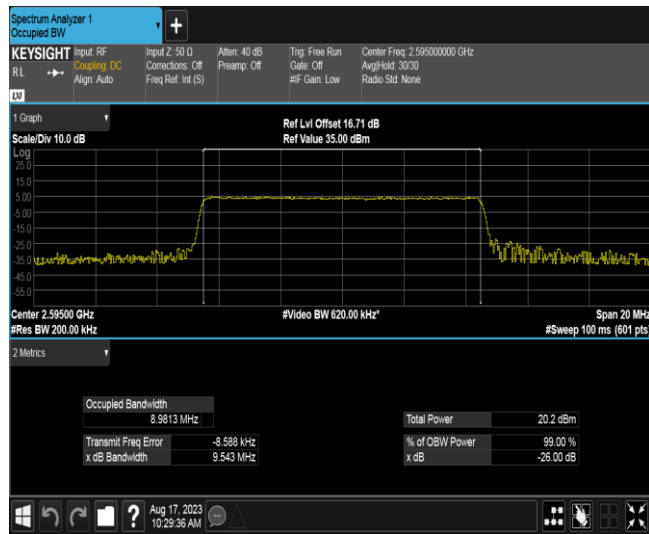

Band38-10MHz-16QAM-38200-50RB#0

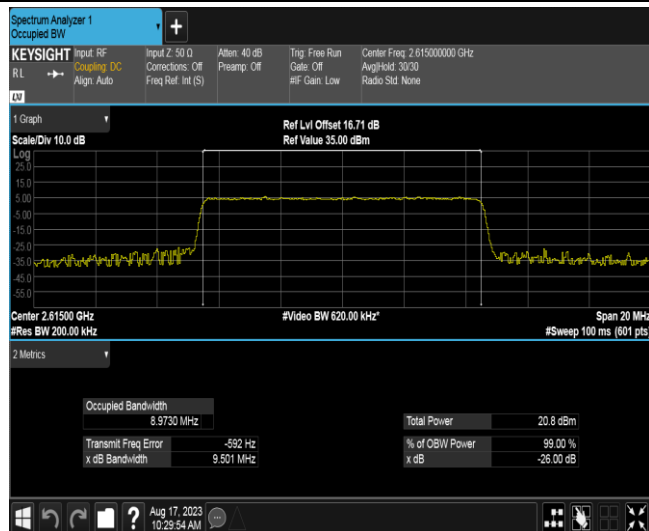


Band38-15MHz-QPSK-37825-75RB#0

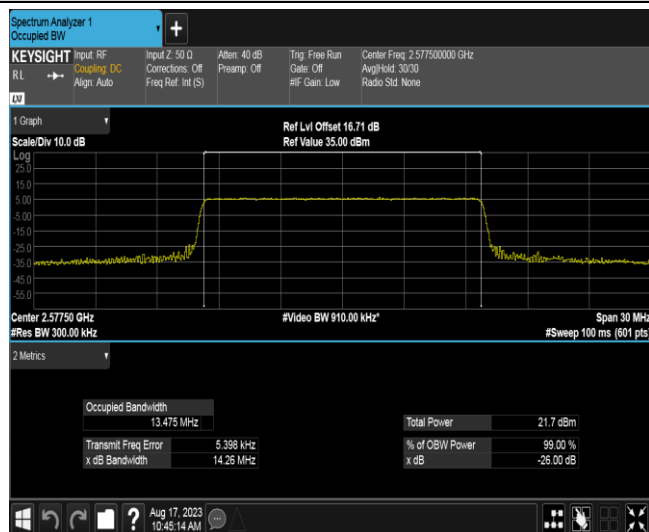


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38-15MHz-QPSK-38000-75RB#0

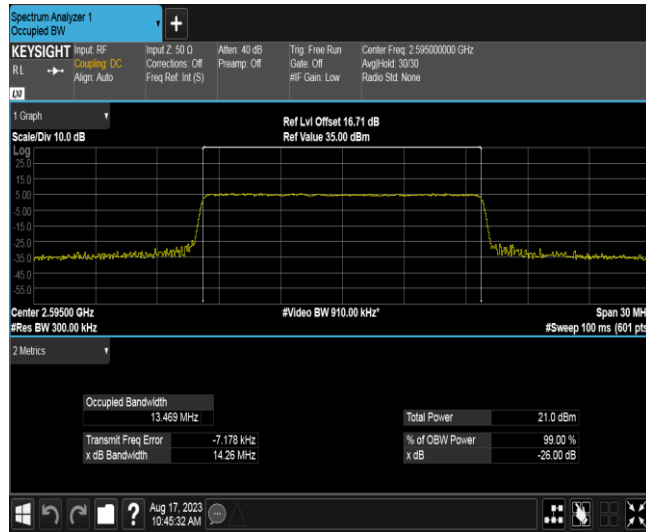


Band38-15MHz-QPSK-38175-75RB#0

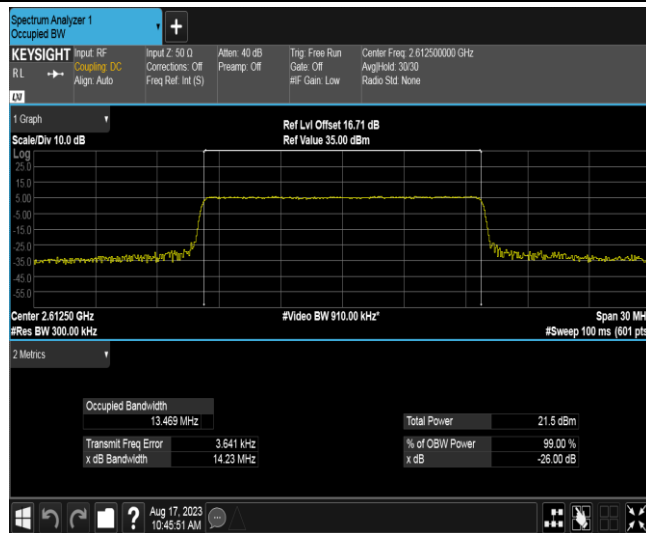


Band38-15MHz-16QAM-37825-75RB#0

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.


Attestation of Global Compliance(Shenzhen)Co., Ltd
Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd
Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>

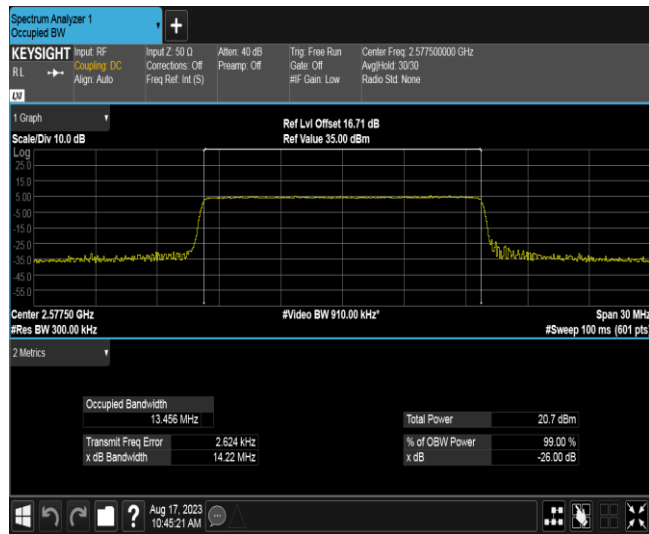

Band38-15MHz-16QAM-38000-75RB#0

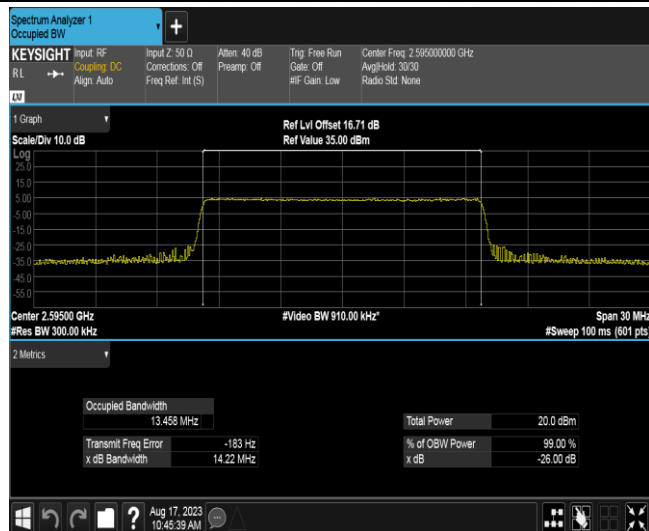


Band38-15MHz-16QAM-38175-75RB#0

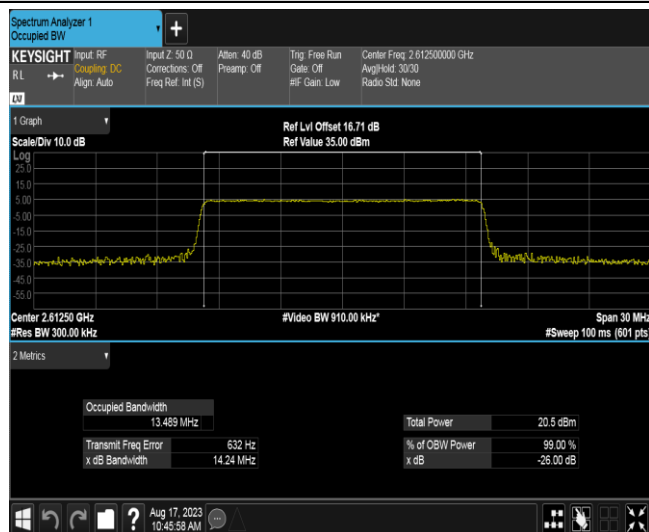


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38-20MHz-QPSK-37850-100RB#0

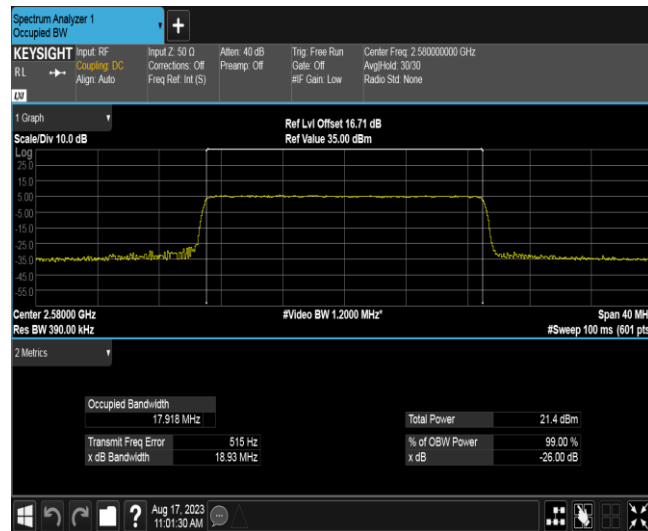


Band38-20MHz-QPSK-38000-100RB#0

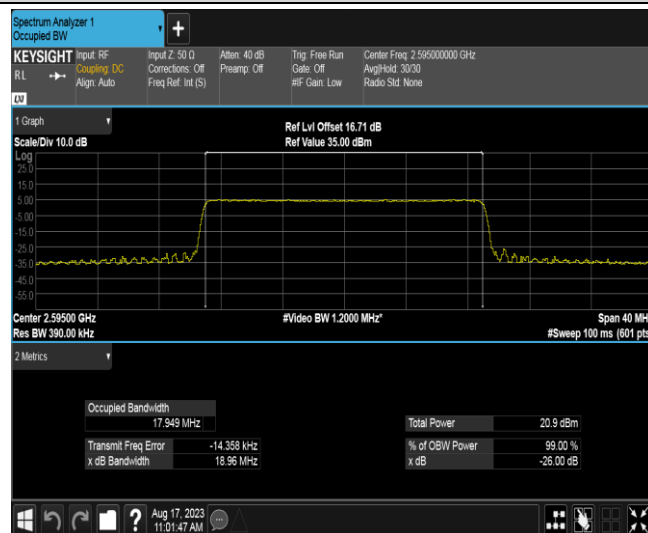


Band38-20MHz-QPSK-38150-100RB#0


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

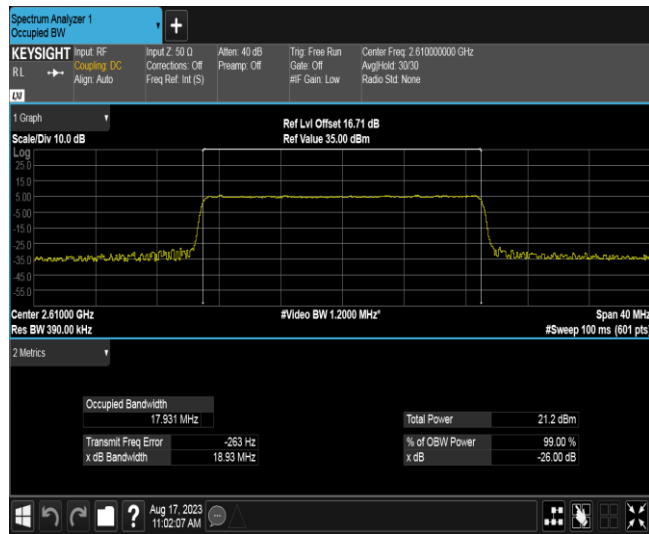

Band38-20MHz-16QAM-37850-100RB#0

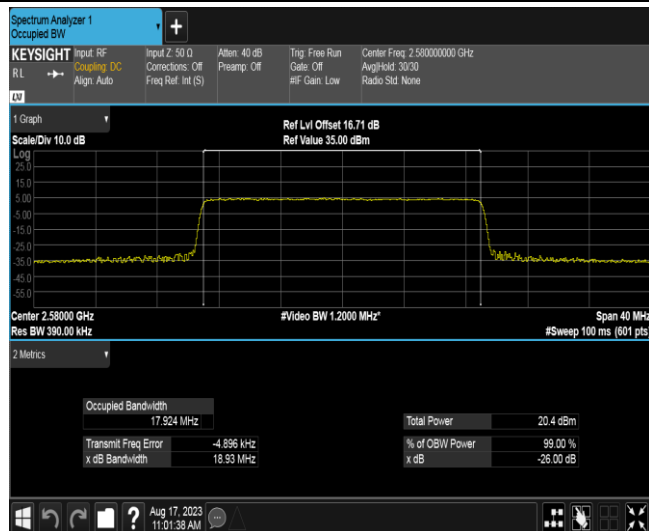


Band38-20MHz-16QAM-38000-100RB#0

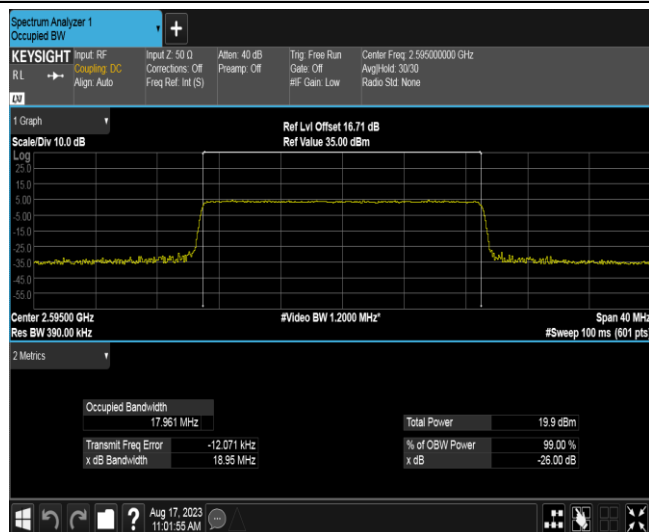

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38-20MHz-16QAM-38150-100RB#0

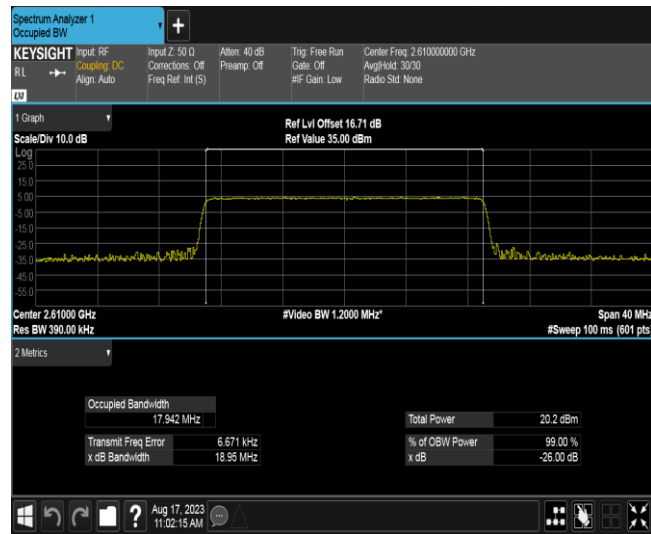

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd
Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd
Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>

Appendix D: Band Edge


Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band38	5MHz	QPSK	37775	1RB#0	-37.30,-35.77,-26.83,-14.31	PASS
Band38	5MHz	QPSK	37775	1RB#24	-39.33,-38.47,-30.69,-34.58	PASS
Band38	5MHz	QPSK	37775	25RB#0	-38.06,-38.24,-30.30,-24.86	PASS
Band38	5MHz	QPSK	38225	1RB#0	-34.29,-28.17,-38.39,-39.60	PASS
Band38	5MHz	QPSK	38225	1RB#24	-13.37,-27.25,-35.50,-37.04	PASS
Band38	5MHz	QPSK	38225	25RB#0	-20.12,-29.59,-38.02,-38.20	PASS
Band38	5MHz	16QAM	37775	1RB#0	-37.28,-36.64,-27.83,-16.44	PASS
Band38	5MHz	16QAM	37775	1RB#24	-40.31,-39.19,-31.19,-35.30	PASS
Band38	5MHz	16QAM	37775	25RB#0	-39.43,-37.05,-30.20,-28.58	PASS
Band38	5MHz	16QAM	38225	1RB#0	-34.24,-27.81,-37.38,-40.21	PASS
Band38	5MHz	16QAM	38225	1RB#24	-12.62,-26.61,-35.32,-36.84	PASS
Band38	5MHz	16QAM	38225	25RB#0	-29.44,-29.74,-38.56,-38.80	PASS
Band38	10MHz	QPSK	37800	1RB#0	-37.79,-30.16,-25.05,-12.66	PASS
Band38	10MHz	QPSK	37800	1RB#49	-37.98,-28.96,-34.76,-34.06	PASS
Band38	10MHz	QPSK	37800	50RB#0	-37.95,-34.36,-30.11,-27.47	PASS
Band38	10MHz	QPSK	38200	1RB#0	-34.39,-34.84,-27.21,-37.89	PASS
Band38	10MHz	QPSK	38200	1RB#49	-13.23,-21.06,-29.47,-36.84	PASS
Band38	10MHz	QPSK	38200	50RB#0	-26.25,-28.50,-32.18,-37.57	PASS
Band38	10MHz	16QAM	37800	1RB#0	-37.92,-31.42,-23.13,-14.57	PASS
Band38	10MHz	16QAM	37800	1RB#49	-38.20,-30.43,-36.56,-36.01	PASS
Band38	10MHz	16QAM	37800	50RB#0	-37.62,-33.93,-30.74,-30.65	PASS
Band38	10MHz	16QAM	38200	1RB#0	-33.75,-34.44,-26.26,-38.49	PASS
Band38	10MHz	16QAM	38200	1RB#49	-12.24,-20.90,-29.08,-37.16	PASS
Band38	10MHz	16QAM	38200	50RB#0	-22.46,-26.06,-31.17,-35.96	PASS
Band38	15MHz	QPSK	37825	1RB#0	-36.81,-31.08,-24.85,-16.72	PASS
Band38	15MHz	QPSK	37825	1RB#74	-36.72,-26.30,-35.34,-36.41	PASS
Band38	15MHz	QPSK	37825	75RB#0	-36.79,-32.89,-29.67,-27.99	PASS
Band38	15MHz	QPSK	38175	1RB#0	-36.37,-35.76,-25.77,-37.00	PASS
Band38	15MHz	QPSK	38175	1RB#74	-15.47,-24.60,-30.06,-35.68	PASS
Band38	15MHz	QPSK	38175	75RB#0	-26.93,-28.78,-30.24,-36.59	PASS
Band38	15MHz	16QAM	37825	1RB#0	-36.64,-31.63,-26.57,-17.70	PASS
Band38	15MHz	16QAM	37825	1RB#74	-36.85,-27.43,-36.72,-36.57	PASS
Band38	15MHz	16QAM	37825	75RB#0	-36.42,-34.04,-29.73,-29.66	PASS
Band38	15MHz	16QAM	38175	1RB#0	-35.64,-36.01,-25.07,-36.85	PASS


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band38	15MHz	16QAM	38175	1RB#74	-15.51,-23.25,-29.23,-35.92	PASS
Band38	15MHz	16QAM	38175	75RB#0	-25.95,-28.69,-32.17,-35.77	PASS
Band38	20MHz	QPSK	37850	1RB#0	-35.84,-30.98,-24.21,-16.56	PASS
Band38	20MHz	QPSK	37850	1RB#99	-35.84,-32.30,-35.20,-35.63	PASS
Band38	20MHz	QPSK	37850	100RB#0	-35.84,-32.69,-29.22,-26.57	PASS
Band38	20MHz	QPSK	38150	1RB#0	-35.47,-35.72,-25.72,-35.92	PASS
Band38	20MHz	QPSK	38150	1RB#99	-17.77,-24.15,-31.01,-36.10	PASS
Band38	20MHz	QPSK	38150	100RB#0	-27.76,-28.84,-31.40,-35.92	PASS
Band38	20MHz	16QAM	37850	1RB#0	-35.88,-31.23,-23.36,-16.86	PASS
Band38	20MHz	16QAM	37850	1RB#99	-35.86,-32.74,-35.47,-35.89	PASS
Band38	20MHz	16QAM	37850	100RB#0	-35.78,-33.14,-30.91,-30.15	PASS
Band38	20MHz	16QAM	38150	1RB#0	-35.88,-35.62,-26.32,-36.02	PASS
Band38	20MHz	16QAM	38150	1RB#99	-17.17,-23.93,-31.32,-35.68	PASS
Band38	20MHz	16QAM	38150	100RB#0	-29.77,-30.60,-32.54,-35.88	PASS


Test Graphs

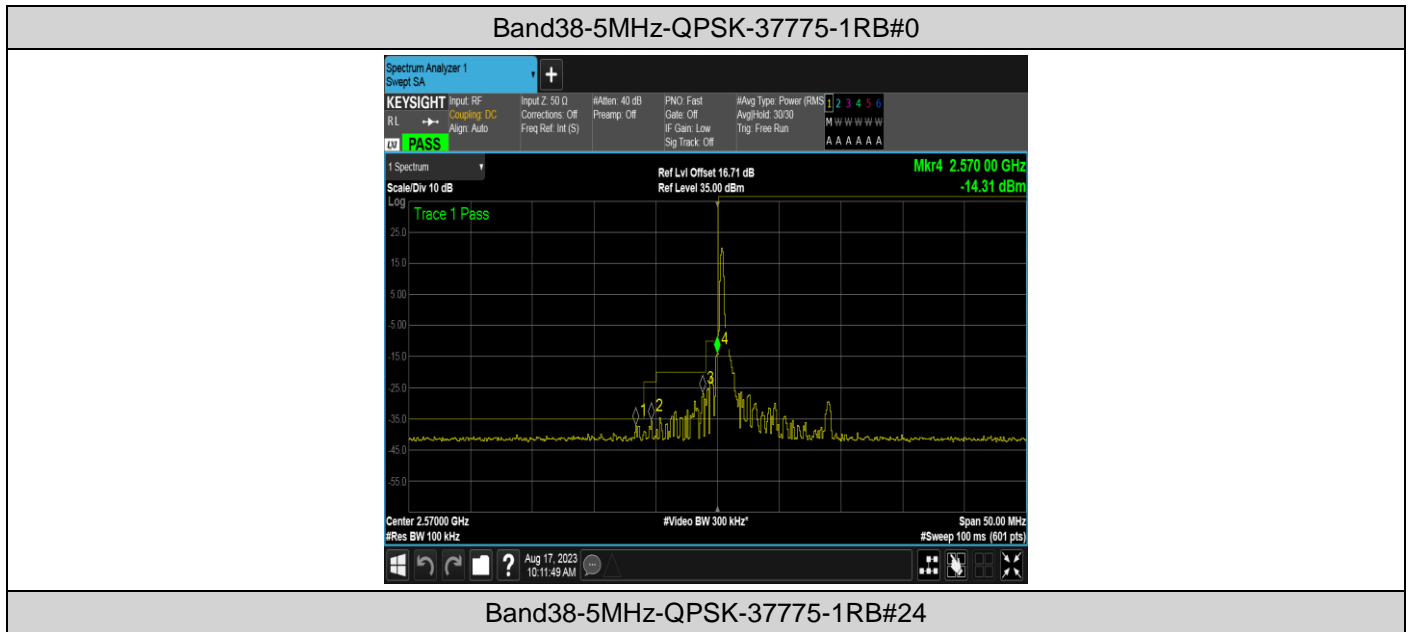


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

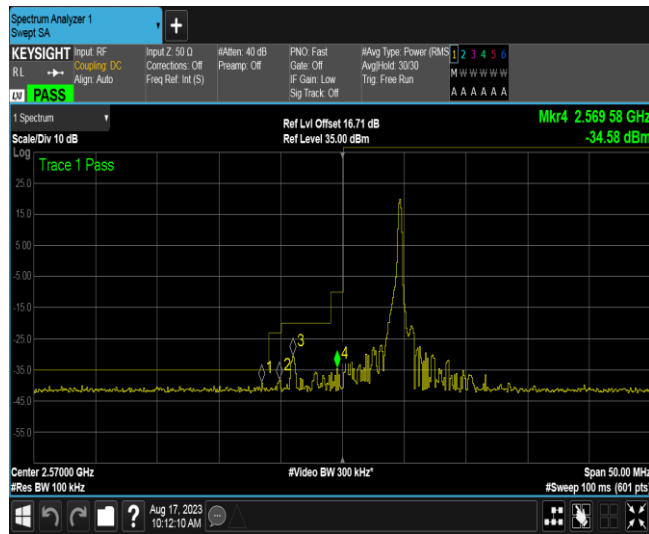

Band38-5MHz-QPSK-37775-25RB#0

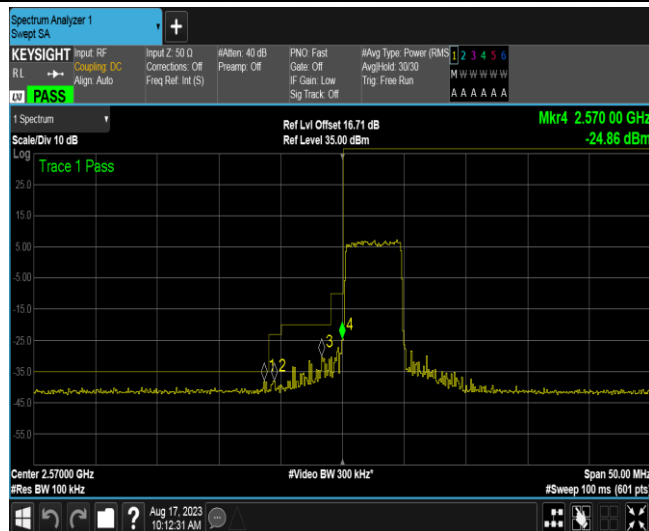

Band38-5MHz-QPSK-38225-1RB#0

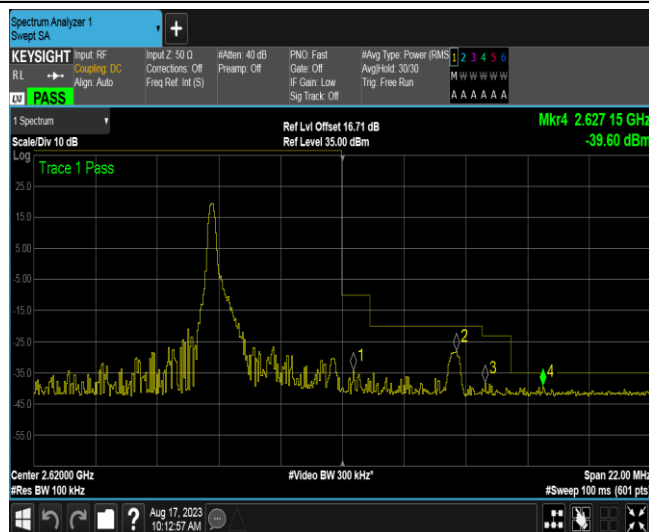

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.