

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd

Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd

Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>

Band38-15MHz-16QAM-38175-1RB#0-Range1:30~1000MHz



Band38-15MHz-16QAM-38175-1RB#0-Range2:1000~27000MHz



Band38-20MHz-QPSK-37850-1RB#0-Range1:30~1000MHz

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15 days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd

Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd

Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>



Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd

Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd

Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>

Band38-20MHz-QPSK-38000-1RB#0-Range2:1000~27000MHz



Band38-20MHz-QPSK-38150-1RB#0-Range1:30~1000MHz




Band38-20MHz-QPSK-38150-1RB#0-Range2:1000~27000MHz

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15 days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd

Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd

Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>

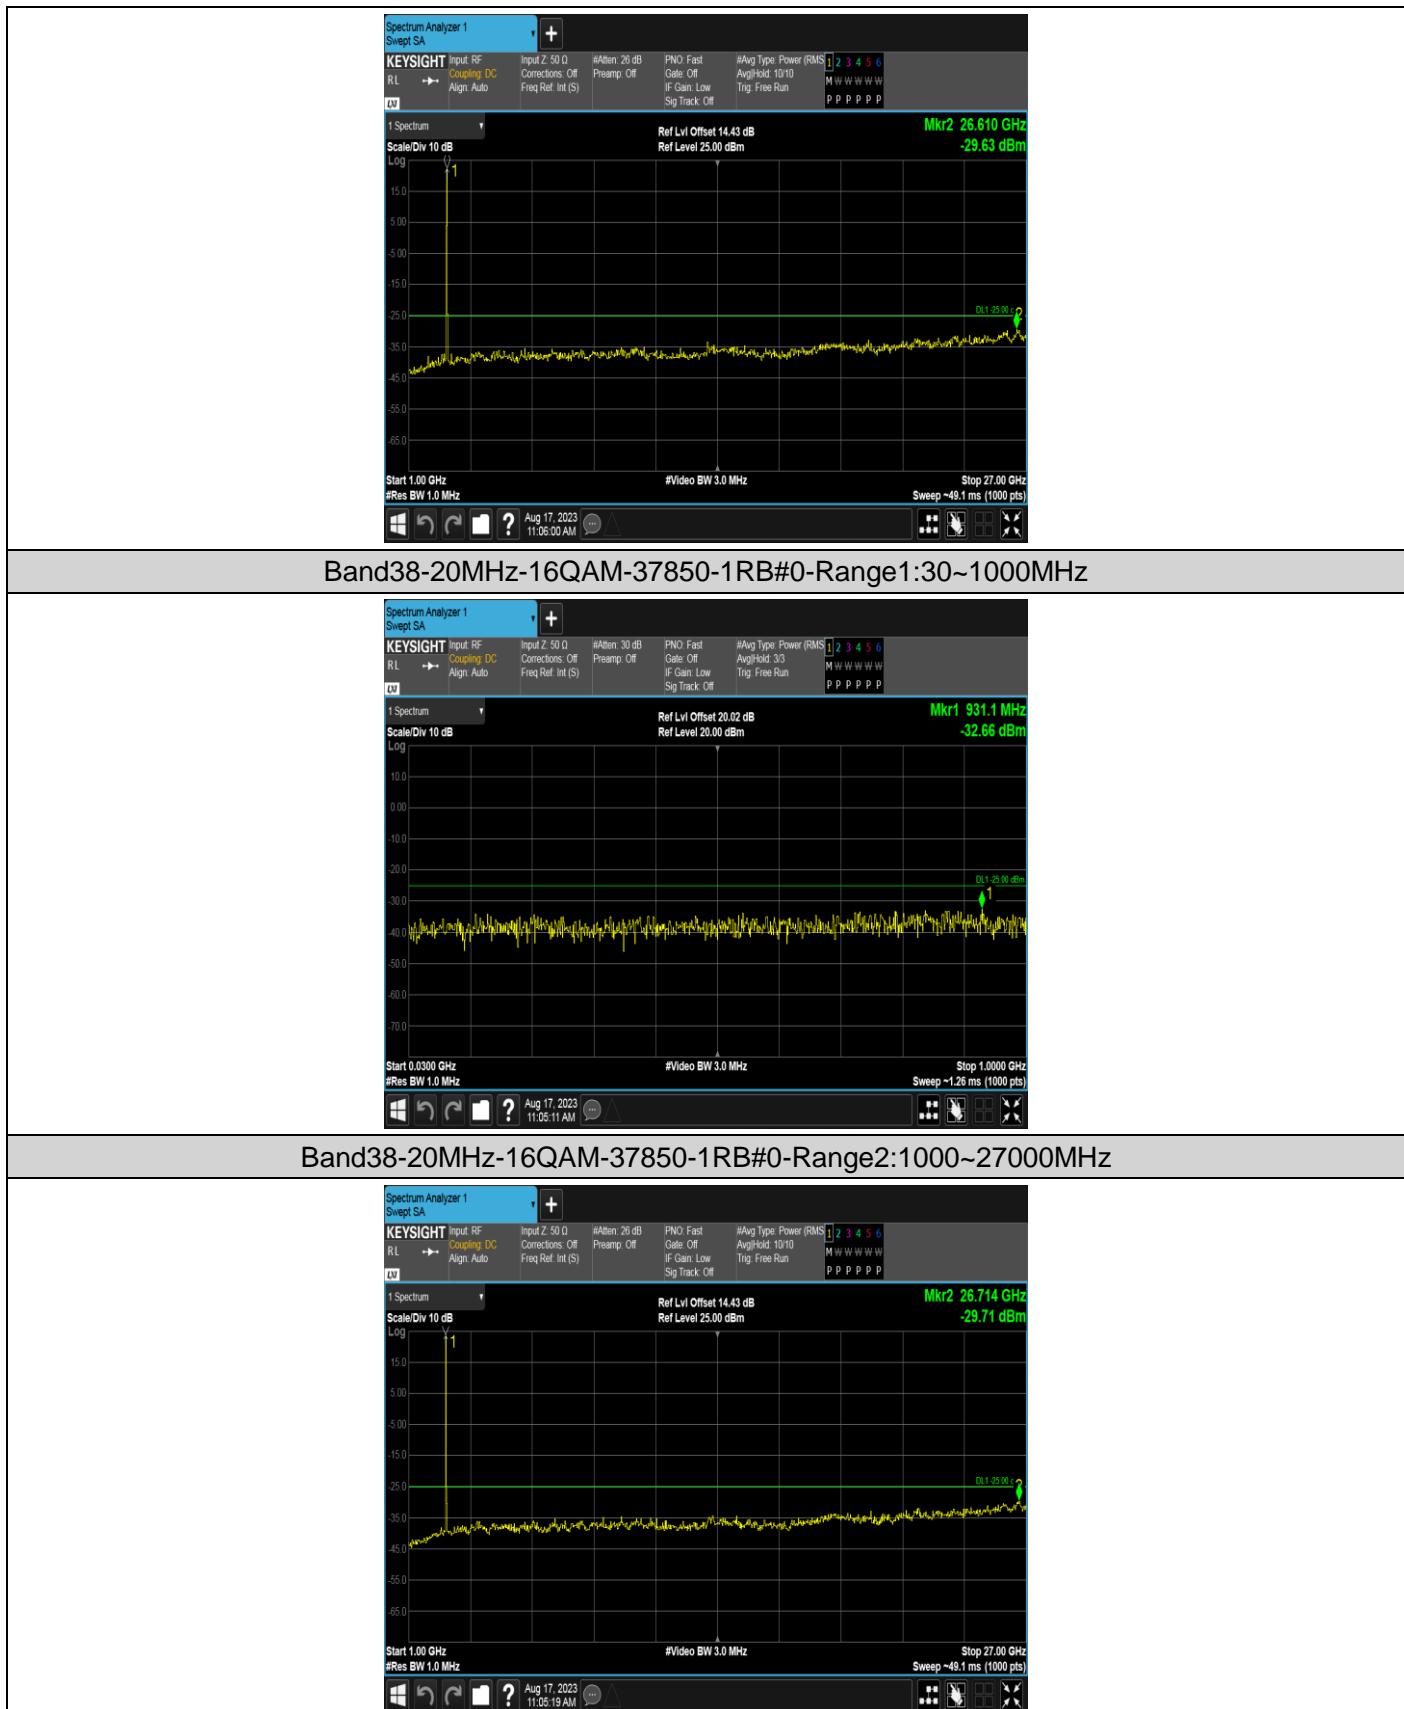

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd

Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd

Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>

Band38-20MHz-16QAM-38000-1RB#0-Range1:30~1000MHz



Band38-20MHz-16QAM-38000-1RB#0-Range2:1000~27000MHz



Band38-20MHz-16QAM-38150-1RB#0-Range1:30~1000MHz

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd

Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd

Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>



Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15 days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd

Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd

Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>

Appendix F: Frequency Stability

Test Result

Band	Bandwidth	Modulation	Channel	RB Configure	Voltage						Verdict
					Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)		
Band38	5MHz	QPSK	37775	25RB#0	VL	NT	17.45	0.006783	±2.5	PASS	
Band38	5MHz	QPSK	37775	25RB#0	VN	NT	17.82	0.006927	±2.5	PASS	
Band38	5MHz	QPSK	37775	25RB#0	VH	NT	49.25	0.019145	±2.5	PASS	
Band38	5MHz	QPSK	38000	25RB#0	VL	NT	-25.68	-0.009896	±2.5	PASS	
Band38	5MHz	QPSK	38000	25RB#0	VN	NT	21.89	0.008435	±2.5	PASS	
Band38	5MHz	QPSK	38000	25RB#0	VH	NT	-17.81	-0.006863	±2.5	PASS	
Band38	5MHz	QPSK	38225	25RB#0	VL	NT	-15.19	-0.005803	±2.5	PASS	
Band38	5MHz	QPSK	38225	25RB#0	VN	NT	18.54	0.007083	±2.5	PASS	
Band38	5MHz	QPSK	38225	25RB#0	VH	NT	-16.09	-0.006147	±2.5	PASS	
Band38	5MHz	16QAM	37775	25RB#0	VL	NT	58.19	0.022620	±2.5	PASS	
Band38	5MHz	16QAM	37775	25RB#0	VN	NT	47.52	0.018472	±2.5	PASS	
Band38	5MHz	16QAM	37775	25RB#0	VH	NT	68.71	0.026709	±2.5	PASS	
Band38	5MHz	16QAM	38000	25RB#0	VL	NT	-43.72	-0.016848	±2.5	PASS	
Band38	5MHz	16QAM	38000	25RB#0	VN	NT	-74.70	-0.028786	±2.5	PASS	
Band38	5MHz	16QAM	38000	25RB#0	VH	NT	-72.47	-0.027927	±2.5	PASS	
Band38	5MHz	16QAM	38225	25RB#0	VL	NT	64.57	0.024669	±2.5	PASS	
Band38	5MHz	16QAM	38225	25RB#0	VN	NT	47.59	0.018181	±2.5	PASS	
Band38	5MHz	16QAM	38225	25RB#0	VH	NT	-19.71	-0.007530	±2.5	PASS	
Band38	10MHz	QPSK	37800	50RB#0	VL	NT	-20.74	-0.008054	±2.5	PASS	
Band38	10MHz	QPSK	37800	50RB#0	VN	NT	-12.30	-0.004777	±2.5	PASS	
Band38	10MHz	QPSK	37800	50RB#0	VH	NT	-17.09	-0.006637	±2.5	PASS	
Band38	10MHz	QPSK	38000	50RB#0	VL	NT	-18.42	-0.007098	±2.5	PASS	
Band38	10MHz	QPSK	38000	50RB#0	VN	NT	14.55	0.005607	±2.5	PASS	
Band38	10MHz	QPSK	38000	50RB#0	VH	NT	-14.20	-0.005472	±2.5	PASS	
Band38	10MHz	QPSK	38200	50RB#0	VL	NT	-18.51	-0.007078	±2.5	PASS	
Band38	10MHz	QPSK	38200	50RB#0	VN	NT	-17.87	-0.006834	±2.5	PASS	
Band38	10MHz	QPSK	38200	50RB#0	VH	NT	-18.34	-0.007013	±2.5	PASS	
Band38	10MHz	16QAM	37800	50RB#0	VL	NT	6.21	0.002412	±2.5	PASS	
Band38	10MHz	16QAM	37800	50RB#0	VN	NT	-19.01	-0.007383	±2.5	PASS	
Band38	10MHz	16QAM	37800	50RB#0	VH	NT	-13.99	-0.005433	±2.5	PASS	
Band38	10MHz	16QAM	38000	50RB#0	VL	NT	-23.76	-0.009156	±2.5	PASS	
Band38	10MHz	16QAM	38000	50RB#0	VN	NT	-21.92	-0.008447	±2.5	PASS	

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd

Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd

Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>

Band38	10MHz	16QAM	38000	50RB#0	VH	NT	-22.40	-0.008632	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	VL	NT	10.59	0.004050	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	VN	NT	-15.49	-0.005924	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	VH	NT	-17.37	-0.006642	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	VL	NT	11.99	0.004652	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	VN	NT	10.16	0.003942	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	VH	NT	-21.60	-0.008380	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	VL	NT	4.82	0.001857	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	VN	NT	-19.21	-0.007403	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	VH	NT	-20.81	-0.008019	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	VL	NT	-23.03	-0.008815	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	VN	NT	11.16	0.004272	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	VH	NT	-9.88	-0.003782	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	VL	NT	10.96	0.004252	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	VN	NT	17.77	0.006894	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	VH	NT	4.84	0.001878	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	VL	NT	-19.67	-0.007580	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	VN	NT	-20.10	-0.007746	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	VH	NT	10.70	0.004123	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	VL	NT	-16.48	-0.006308	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	VN	NT	5.98	0.002289	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	VH	NT	-30.41	-0.011640	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	VL	NT	-23.02	-0.008922	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	VN	NT	-24.89	-0.009647	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	VH	NT	5.32	0.002062	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	VL	NT	-23.25	-0.008960	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	VN	NT	-13.63	-0.005252	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	VH	NT	-10.80	-0.004162	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	VL	NT	-15.88	-0.006084	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	VN	NT	17.42	0.006674	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	VH	NT	-26.48	-0.010146	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	VL	NT	-16.28	-0.006310	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	VN	NT	-15.08	-0.005845	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	VH	NT	-17.57	-0.006810	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	VL	NT	-23.95	-0.009229	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	VN	NT	-16.67	-0.006424	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	VH	NT	7.54	0.002906	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	VL	NT	-17.34	-0.006644	±2.5	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd

Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd

Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>

Band38	20MHz	16QAM	38150	100RB#0	VN	NT	-17.68	-0.006774	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	VH	NT	-24.12	-0.009241	±2.5	PASS

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configure	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band38	5MHz	QPSK	37775	25RB#0	NV	-30	55.53	0.021586	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	-20	57.84	0.022484	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	0	46.53	0.018087	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	10	50.01	0.019440	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	20	41.94	0.016303	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	-30	-20.43	-0.007873	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	-20	-69.81	-0.026902	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	0	-67.23	-0.025908	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	10	-63.06	-0.024301	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	20	-41.44	-0.015969	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	-30	-16.75	-0.006399	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	-20	53.94	0.020607	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	0	49.25	0.018816	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	10	48.74	0.018621	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	20	62.21	0.023767	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	-30	64.60	0.025112	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	-20	51.90	0.020175	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	0	45.30	0.017609	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	10	21.11	0.008206	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	20	-23.82	-0.009259	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	-30	-68.61	-0.026439	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	-20	-69.65	-0.026840	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	0	-47.55	-0.018324	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	10	-49.45	-0.019056	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	20	-60.28	-0.023229	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	-30	-28.02	-0.010705	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	-20	-35.66	-0.013624	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	0	-31.54	-0.012050	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	10	-16.94	-0.006472	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	20	-20.47	-0.007820	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	-30	8.07	0.003134	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	-20	5.12	0.001988	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	0	5.04	0.001957	±2.5	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd

Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd

Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>

Band38	10MHz	QPSK	37800	50RB#0	NV	10	-20.87	-0.008105	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	20	-18.00	-0.006990	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	-30	-6.27	-0.002416	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	-20	-26.04	-0.010035	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	0	-17.80	-0.006859	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	10	-5.32	-0.002050	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	20	-24.88	-0.009588	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	-30	-14.71	-0.005625	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	-20	3.73	0.001426	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	0	-6.09	-0.002329	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	10	6.58	0.002516	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	20	-20.07	-0.007675	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	-30	-17.72	-0.006882	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	-20	-21.87	-0.008493	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	0	-15.76	-0.006120	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	10	-22.27	-0.008649	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	20	-22.30	-0.008660	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	-30	-17.04	-0.006566	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	-20	-29.10	-0.011214	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	0	6.47	0.002493	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	10	-16.18	-0.006235	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	20	-16.38	-0.006312	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	-30	-22.46	-0.008589	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	-20	-17.62	-0.006738	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	0	-20.30	-0.007763	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	10	-17.44	-0.006669	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	20	-19.45	-0.007438	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	-30	-17.09	-0.006630	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	-20	-22.10	-0.008574	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	0	-18.37	-0.007127	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	10	11.04	0.004283	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	20	-17.50	-0.006790	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	-30	2.76	0.001064	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	-20	-22.06	-0.008501	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	0	-19.45	-0.007495	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	10	16.75	0.006455	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	20	7.88	0.003037	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	-30	-18.24	-0.006982	±2.5	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd

Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd

Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>

Band38	15MHz	QPSK	38175	75RB#0	NV	-20	-24.59	-0.009412	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	0	12.26	0.004693	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	10	-3.05	-0.001167	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	20	-15.62	-0.005979	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	-30	3.95	0.001532	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	-20	4.01	0.001556	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	0	-26.75	-0.010378	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	10	14.05	0.005451	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	20	19.17	0.007437	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	-30	5.09	0.001961	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	-20	-18.17	-0.007002	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	0	-17.57	-0.006771	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	10	-24.12	-0.009295	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	20	12.75	0.004913	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	-30	-21.19	-0.008111	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	-20	-19.70	-0.007541	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	0	-30.26	-0.011583	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	10	-24.65	-0.009435	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	20	-17.77	-0.006802	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	-30	-19.41	-0.007523	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	-20	-20.90	-0.008101	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	0	-20.97	-0.008128	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	10	-20.80	-0.008062	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	20	19.53	0.007570	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	-30	-26.85	-0.010347	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	-20	-17.94	-0.006913	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	0	-19.96	-0.007692	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	10	-23.40	-0.009017	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	20	-19.25	-0.007418	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	-30	-20.94	-0.008023	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	-20	-21.09	-0.008080	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	0	-23.16	-0.008874	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	10	-21.86	-0.008375	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	20	-20.57	-0.007881	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	-30	-18.18	-0.007047	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	-20	-24.06	-0.009326	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	0	-5.84	-0.002264	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	10	-24.26	-0.009403	±2.5	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd

Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd

Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>

Band38	20MHz	16QAM	37850	100RB#0	NV	20	-18.18	-0.007047	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	-30	-21.20	-0.008170	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	-20	-19.57	-0.007541	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	0	-25.46	-0.009811	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	10	-17.37	-0.006694	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	20	-26.71	-0.010293	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	-30	-24.06	-0.009218	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	-20	-21.21	-0.008126	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	0	-7.87	-0.003015	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	10	-13.26	-0.005080	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	20	-4.69	-0.001797	±2.5	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd

Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd

Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>