





Test Graphs

Ant0

11A_Ant0_Low_5260_AV

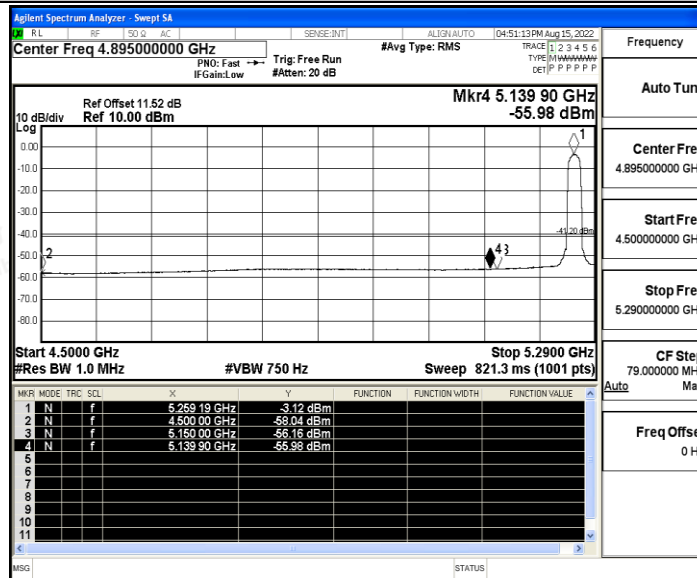

11A_Ant0_Low_5260_Peak

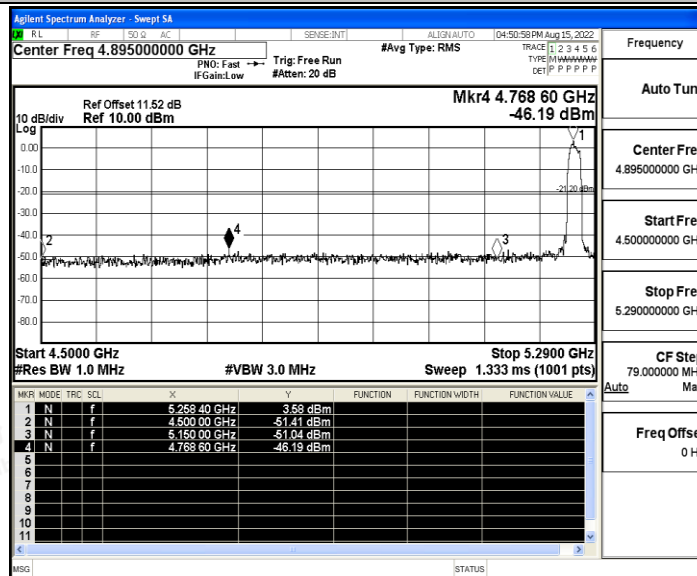

11A_Ant0_High_5320_AV




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

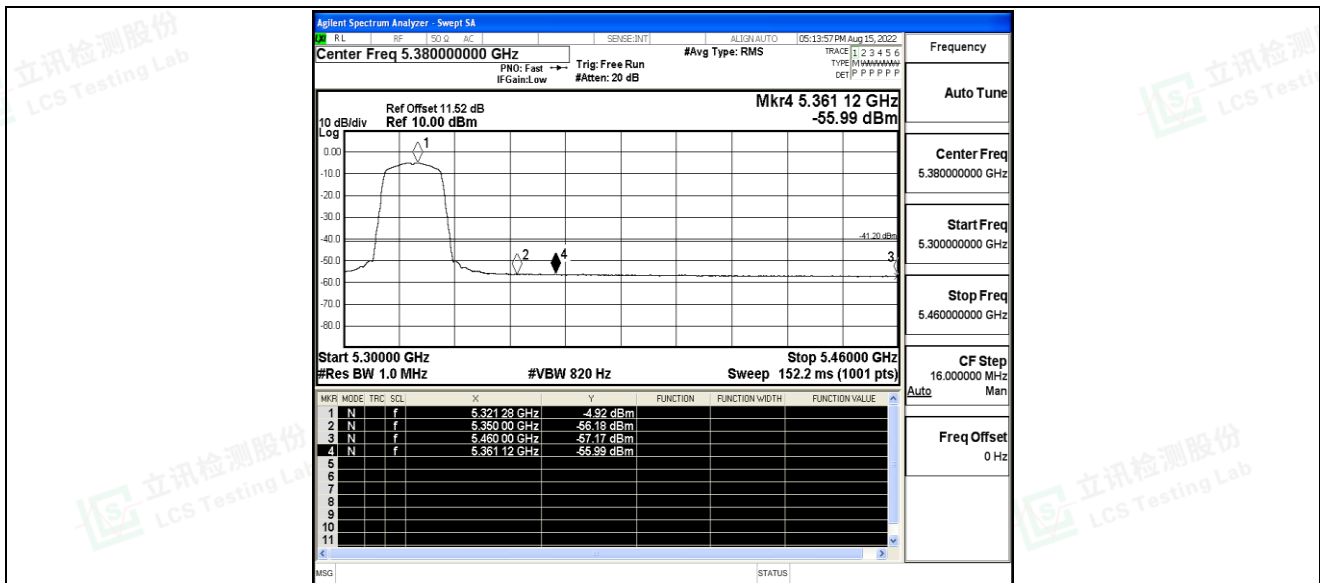

11A_Ant0_High_5320_Peak

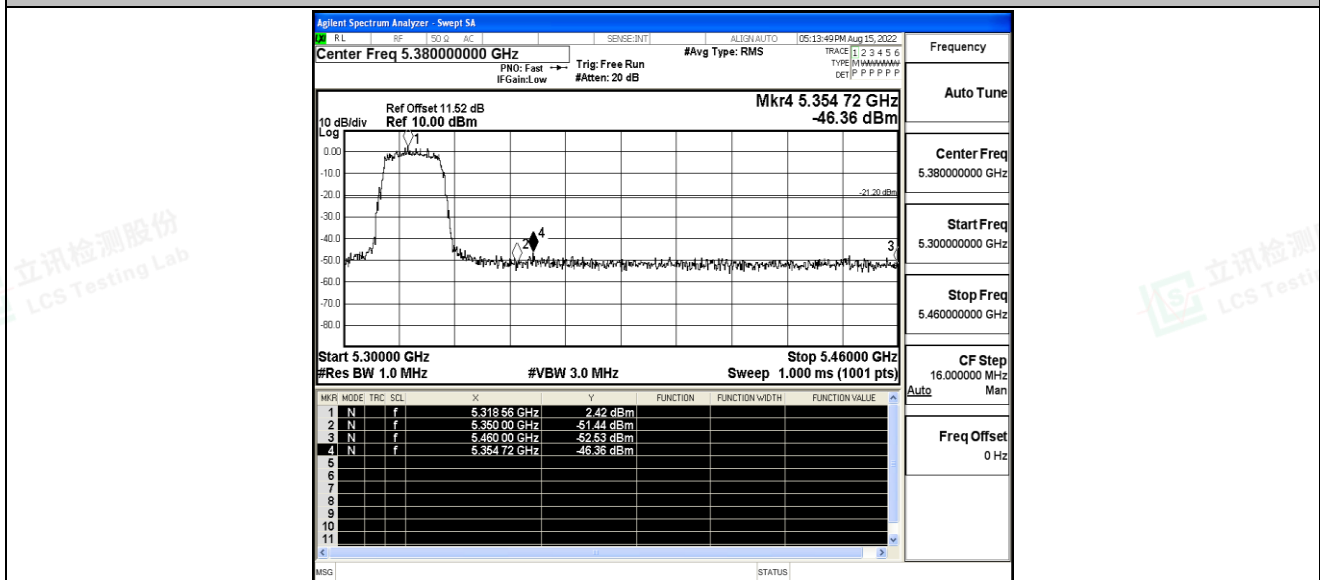

11N20SISO_Ant0_Low_5260_AV




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

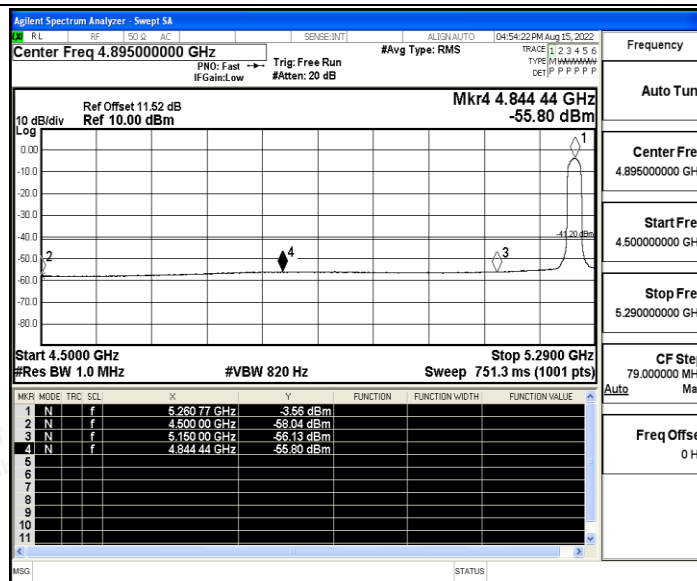

11N20SISO_Ant0_Low_5260_Peak

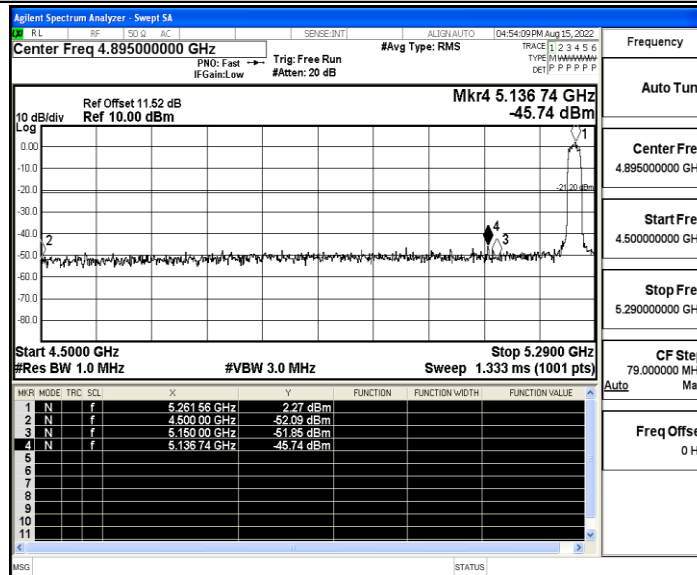

11N20SISO_Ant0_High_5320_AV




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

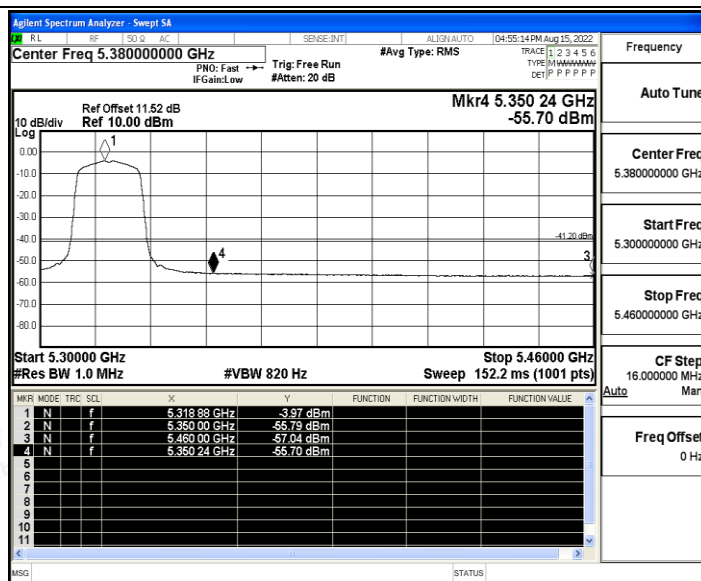

11N20SISO_Ant0_High_5320_Peak

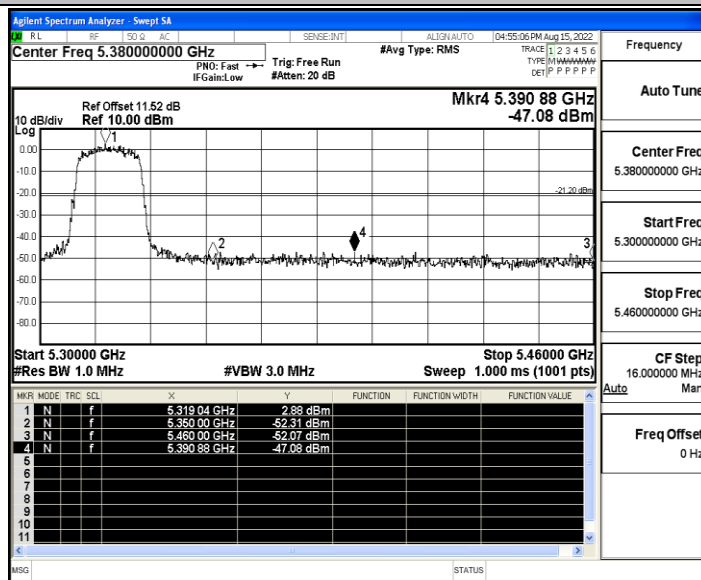

11N40SISO_Ant0_Low_5270_AV




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

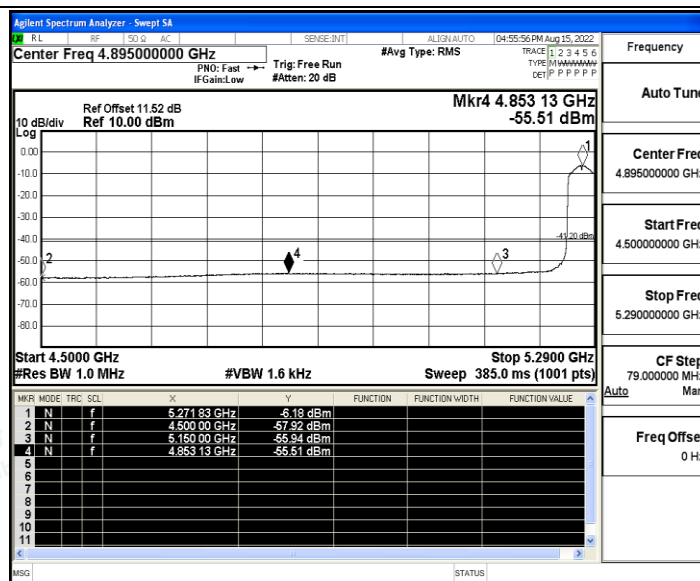

11N40SISO_Ant0_Low_5270_Peak

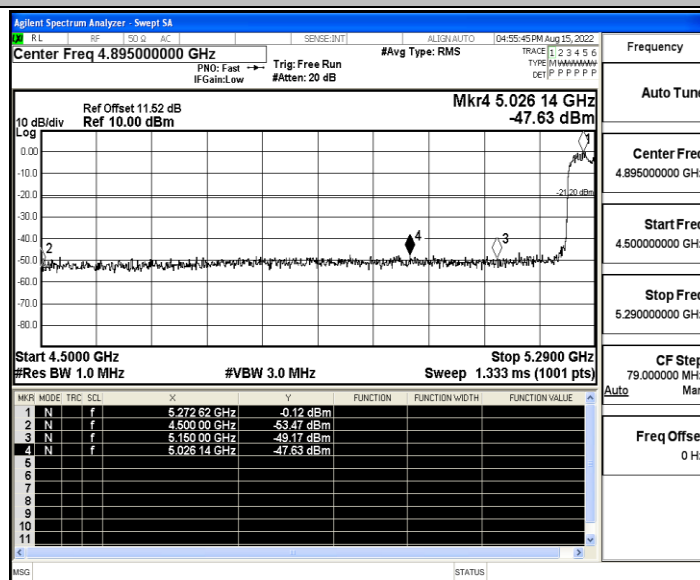

11N40SISO_Ant0_High_5310_AV




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

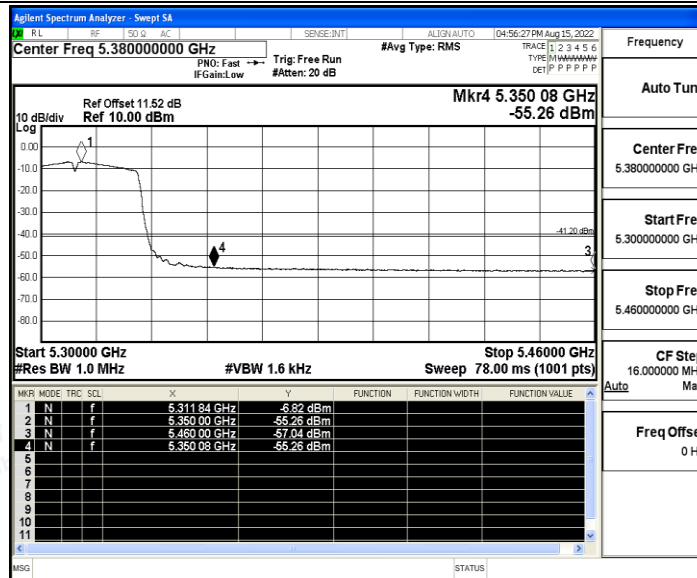

11N40SISO_Ant0_High_5310_Peak

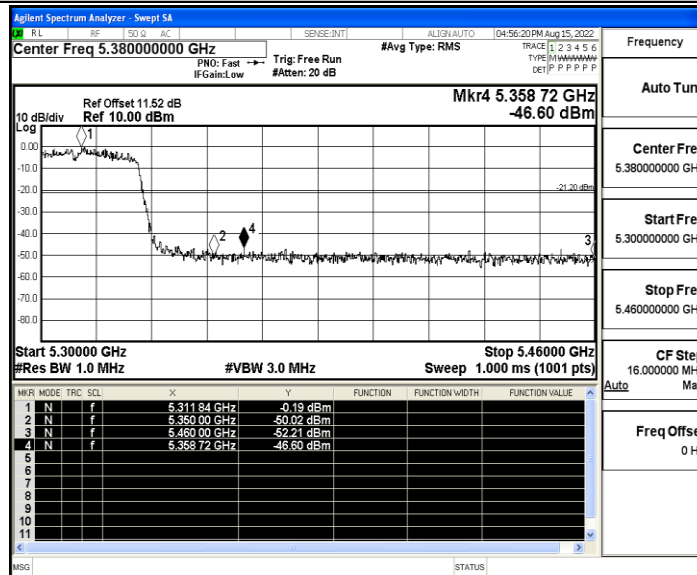

11AC20SISO_Ant0_Low_5260_AV




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

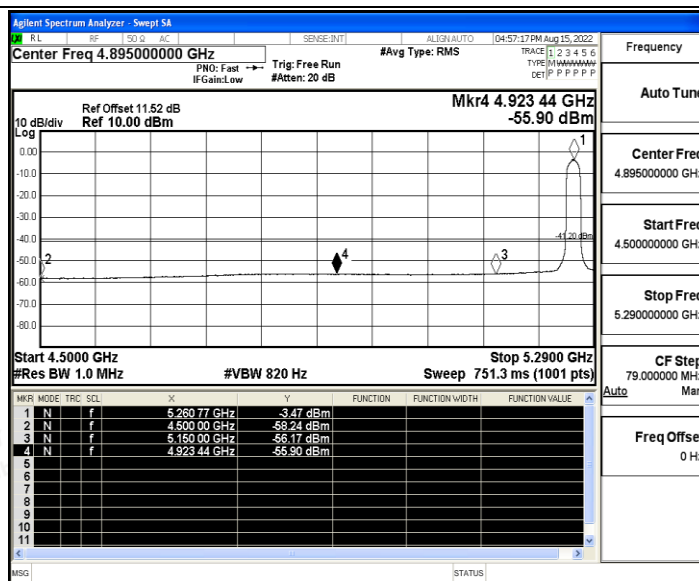

11AC20SISO_Ant0_Low_5260_Peak

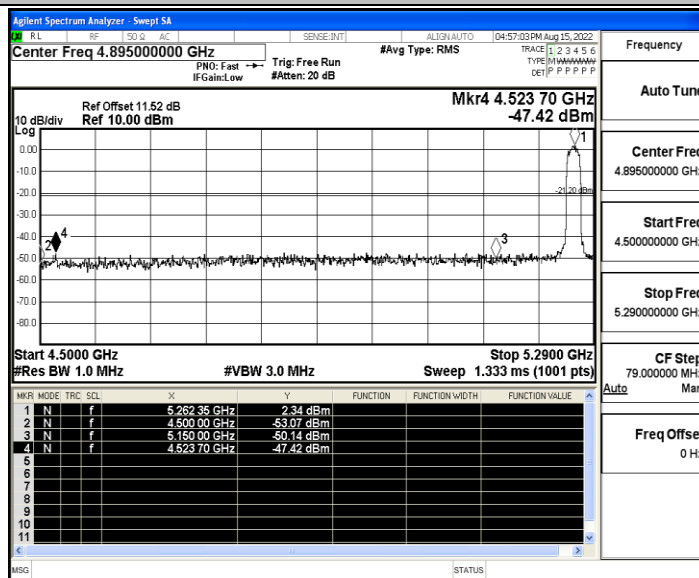

11AC20SISO_Ant0_High_5320_AV




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

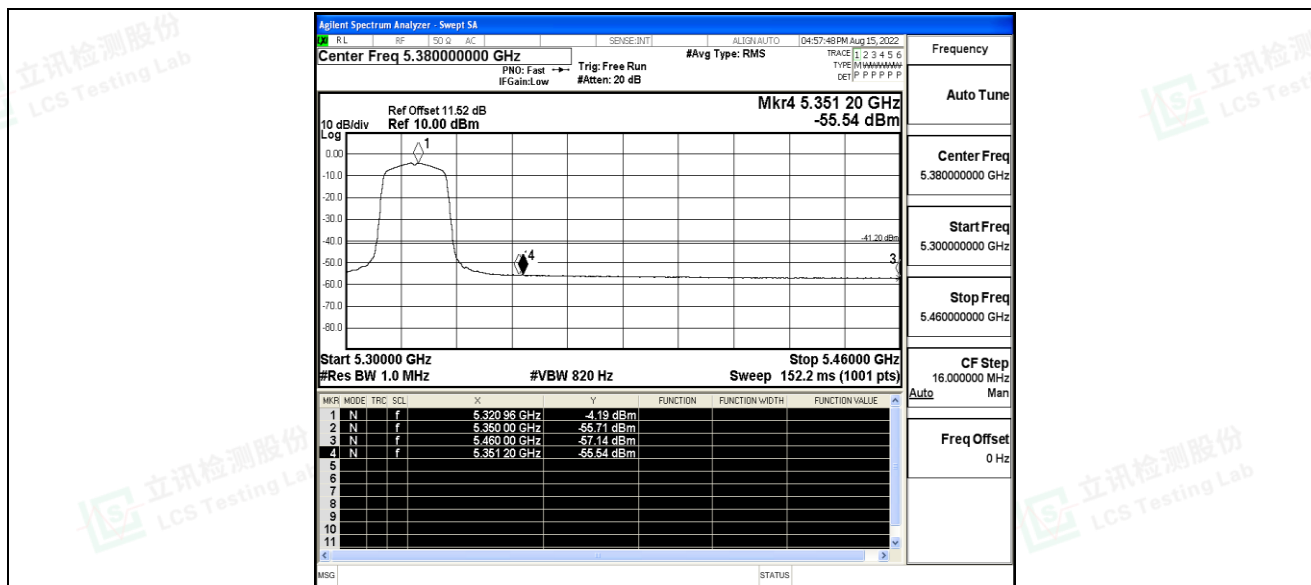

11AC20SISO_Ant0_High_5320_Peak

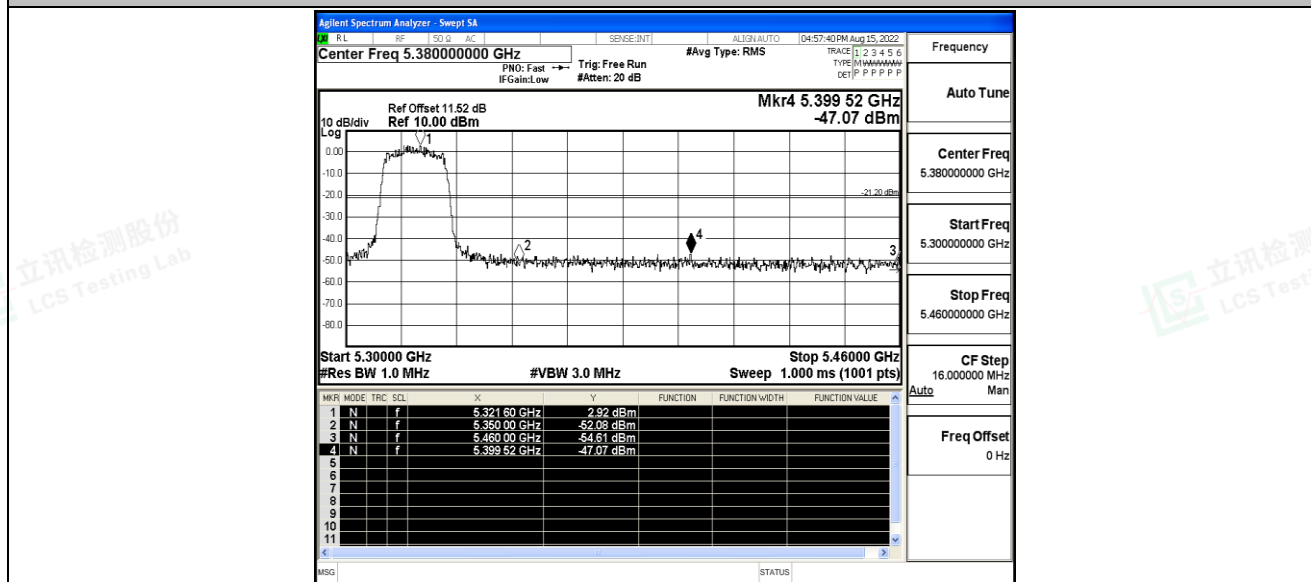

11AC40SISO_Ant0_Low_5270_AV




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

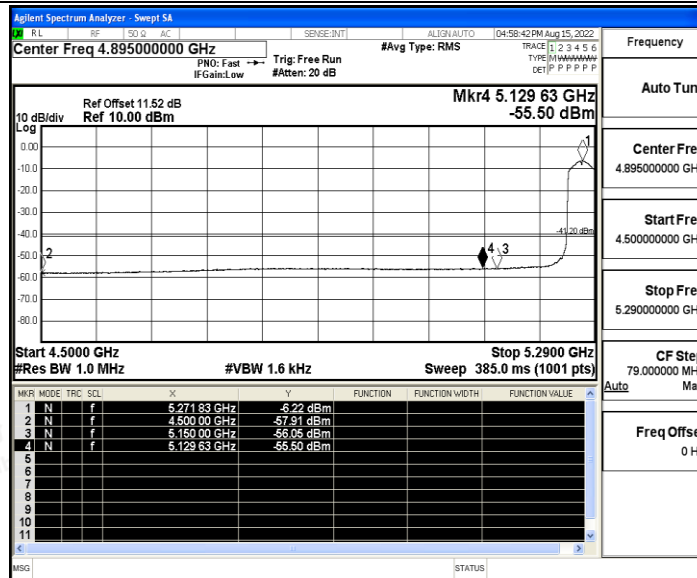

11AC40SISO_Ant0_Low_5270_Peak

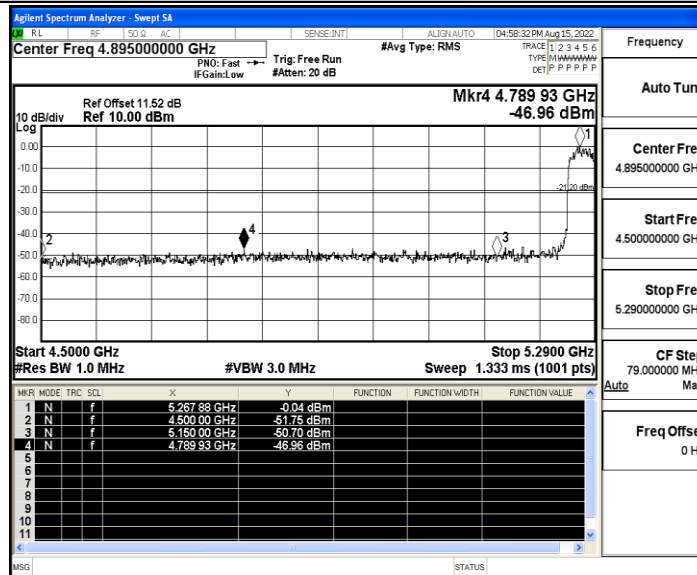

11AC40SISO_Ant0_High_5310_AV




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

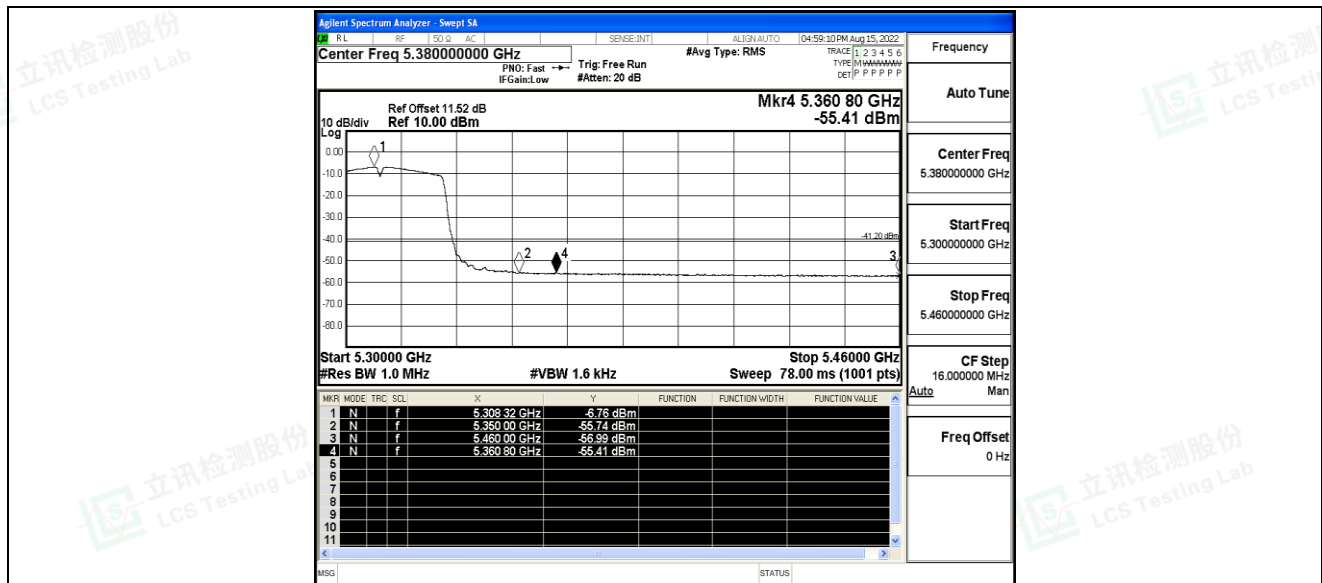

11AC40SISO_Ant0_High_5310_Peak

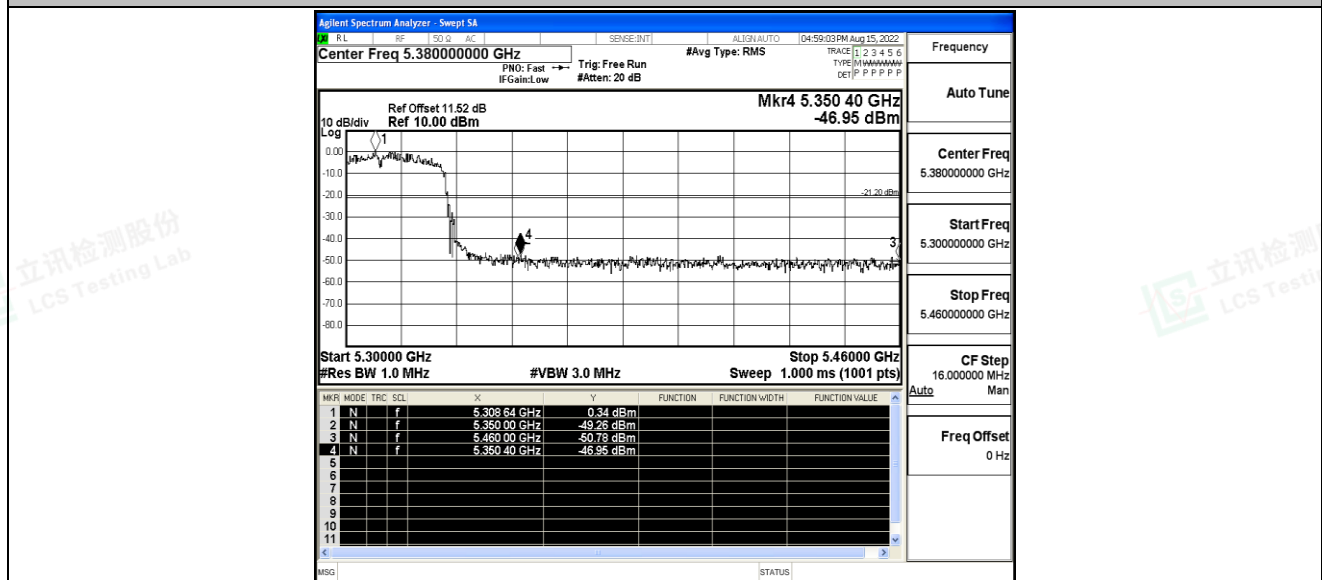

11AC80SISO_Ant0_Low_5290_AV




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

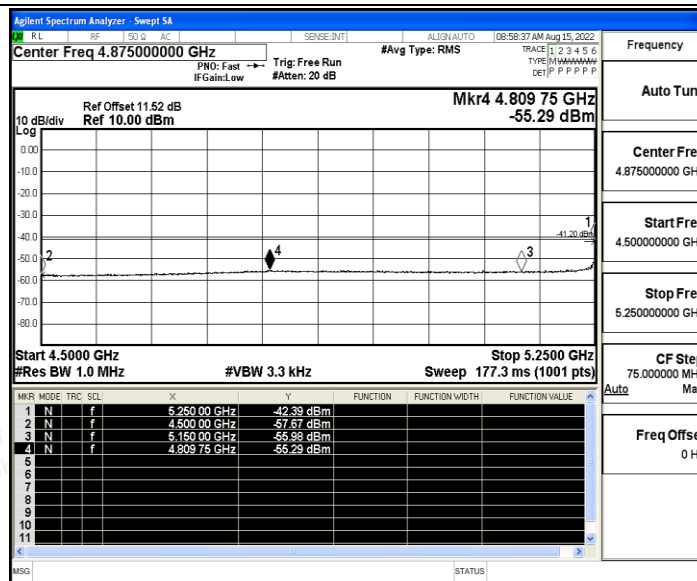

11AC80SISO_Ant0_Low_5290_Peak

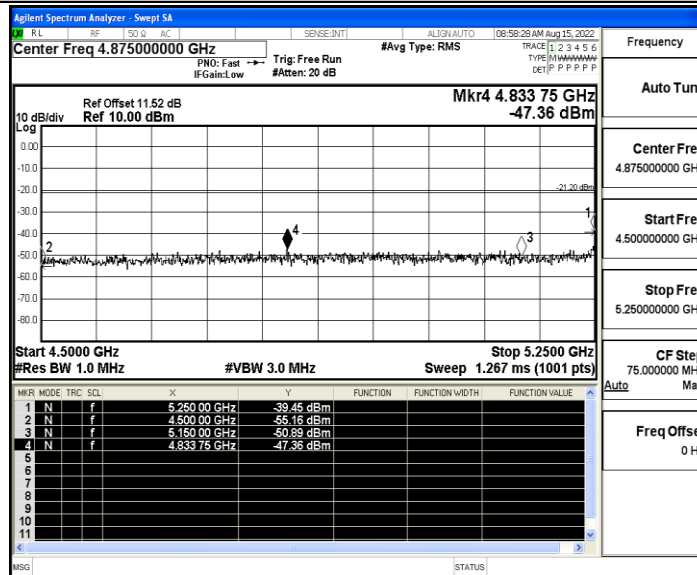

11AC80SISO_Ant0_High_5290_AV




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

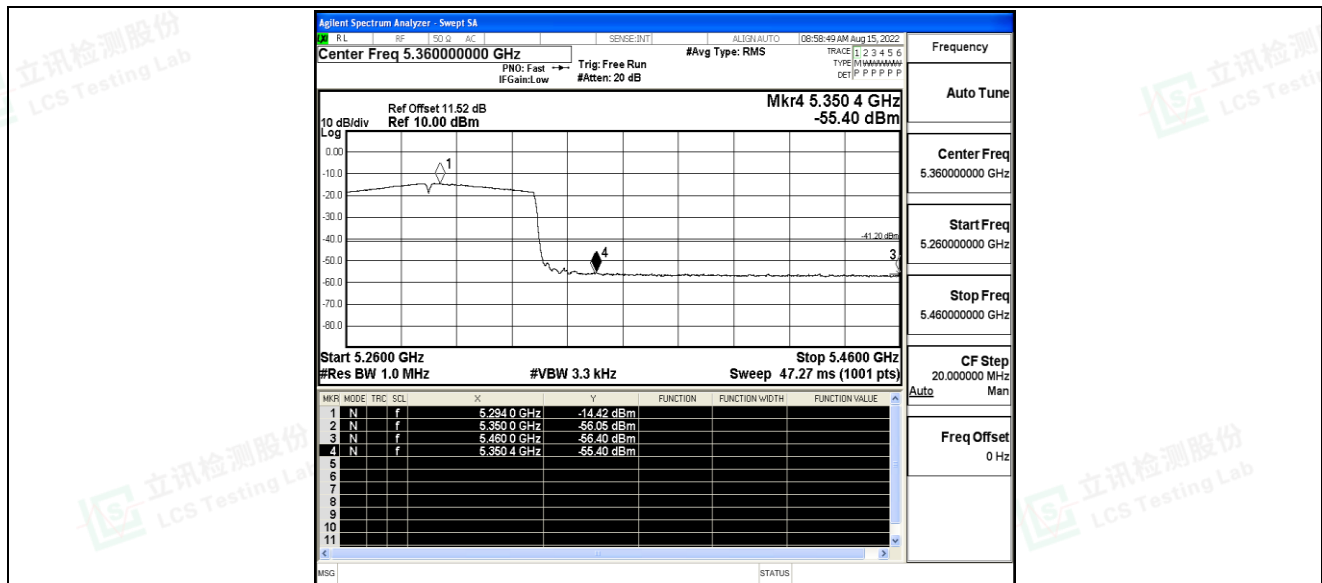

11AC80SISO_Ant0_High_5290_Peak

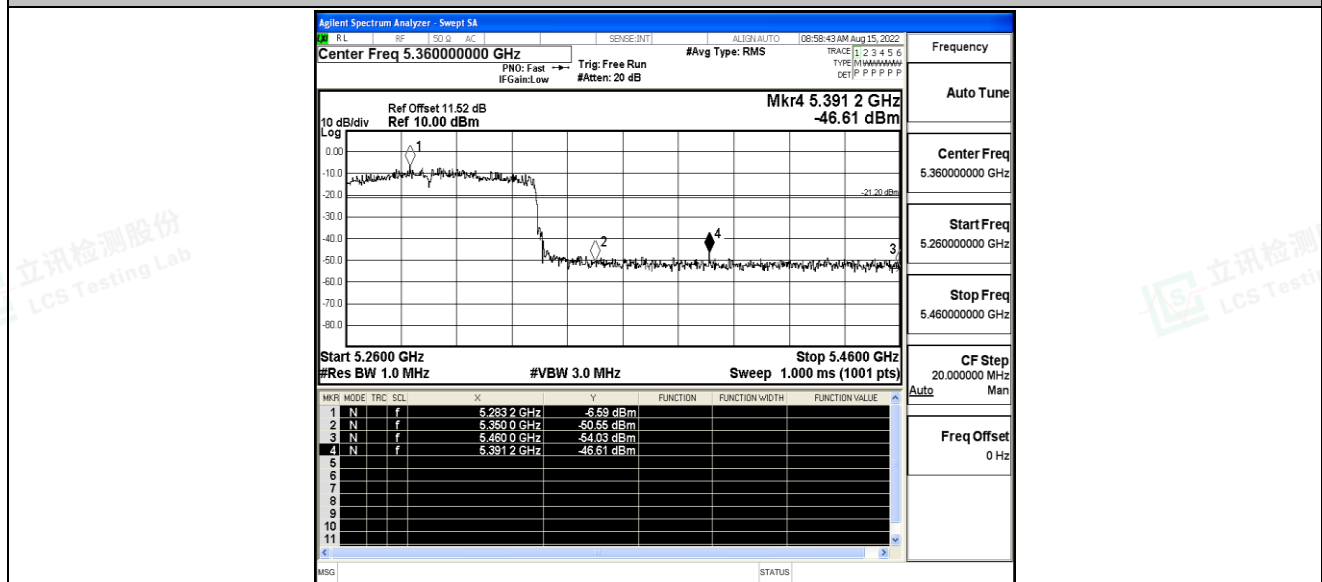

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Ant1

11A_Ant1_Low_5260_AV

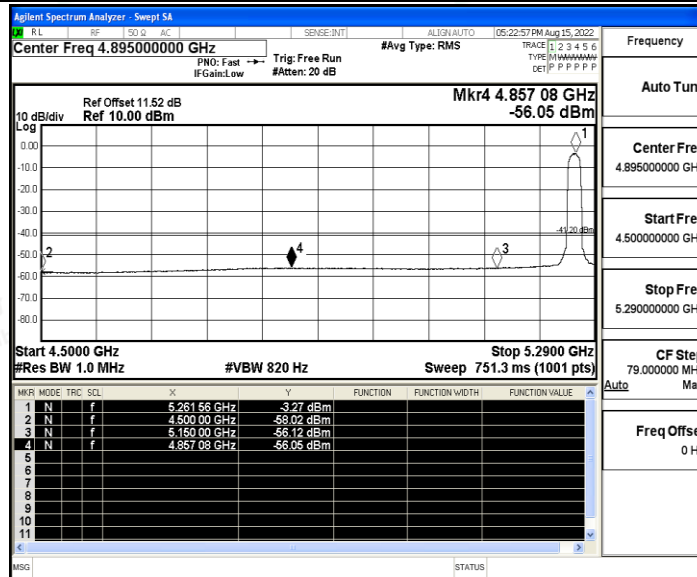

11A_Ant1_Low_5260_Peak

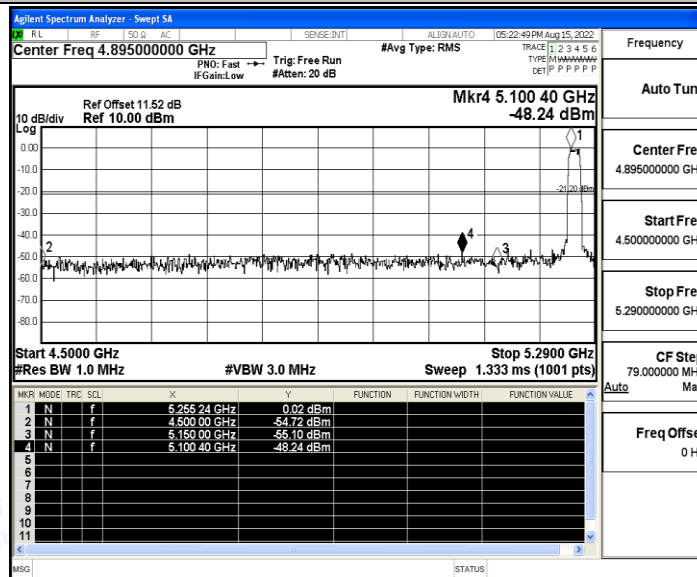

11A_Ant1_High_5320_AV




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

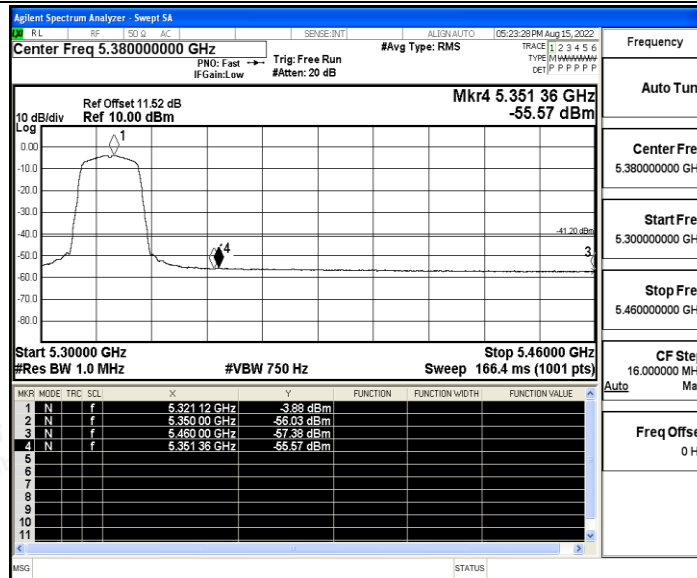

11A_Ant1_High_5320_Peak

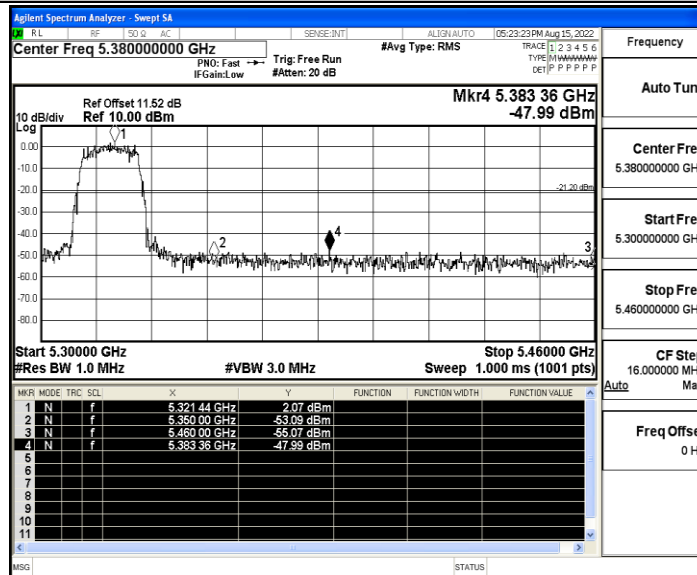

11N20SISO_Ant1_Low_5260_AV




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

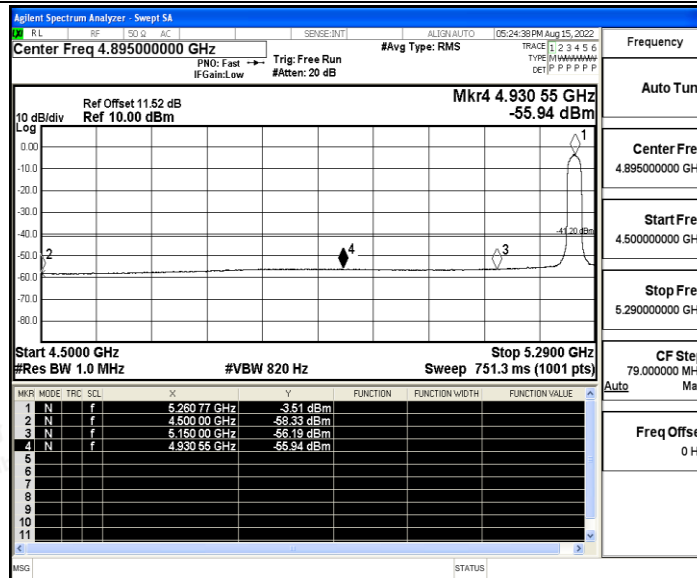

11N20SISO_Ant1_Low_5260_Peak

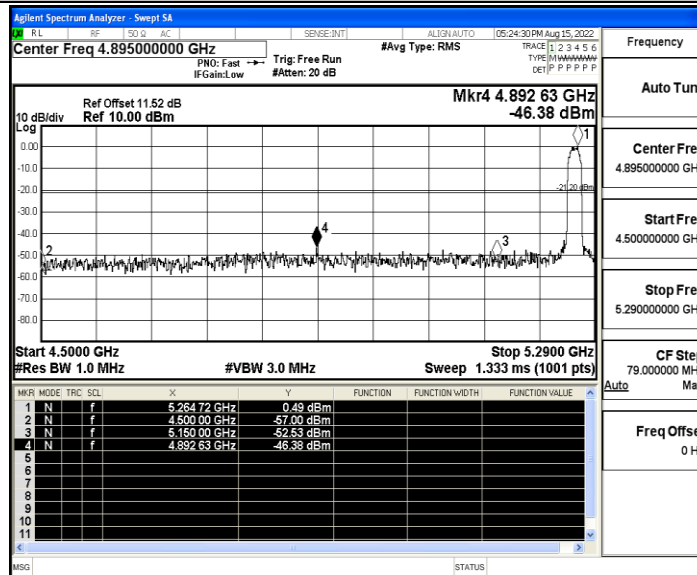

11N20SISO_Ant1_High_5320_AV




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

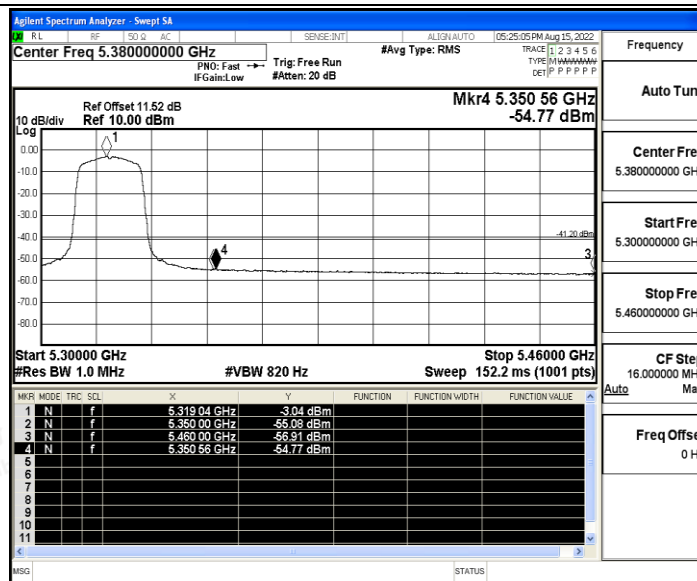

11N20SISO_Ant1_High_5320_Peak

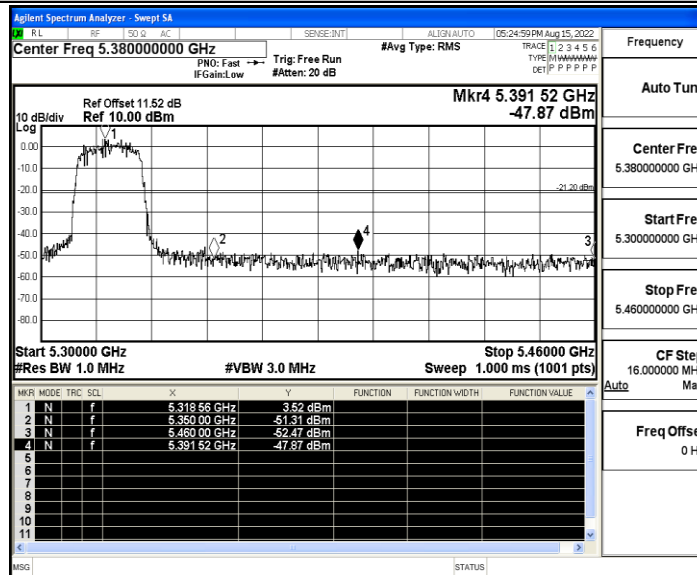

11N40SISO_Ant1_Low_5270_AV




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

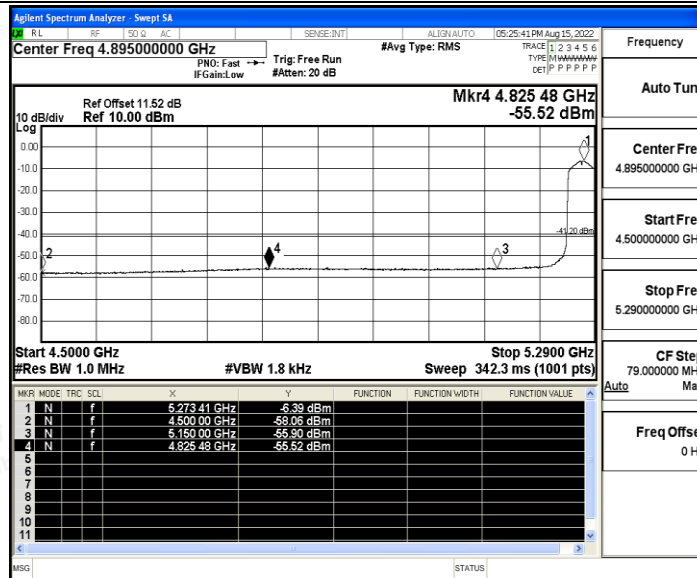

11N40SISO_Ant1_Low_5270_Peak

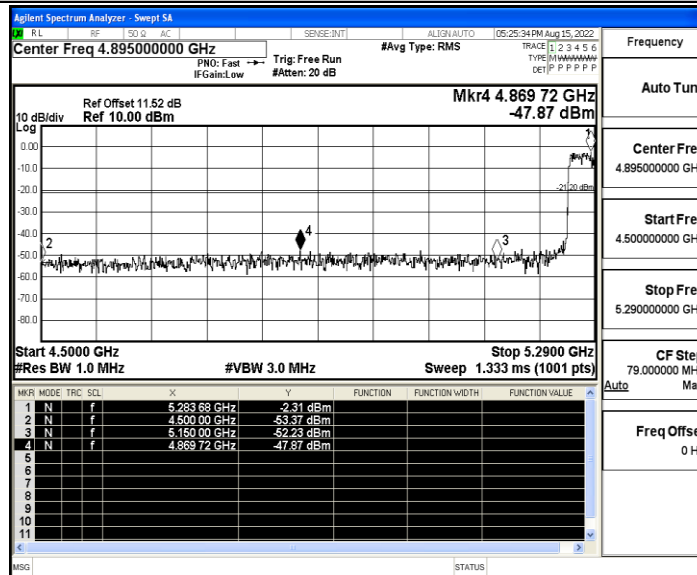

11N40SISO_Ant1_High_5310_AV




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

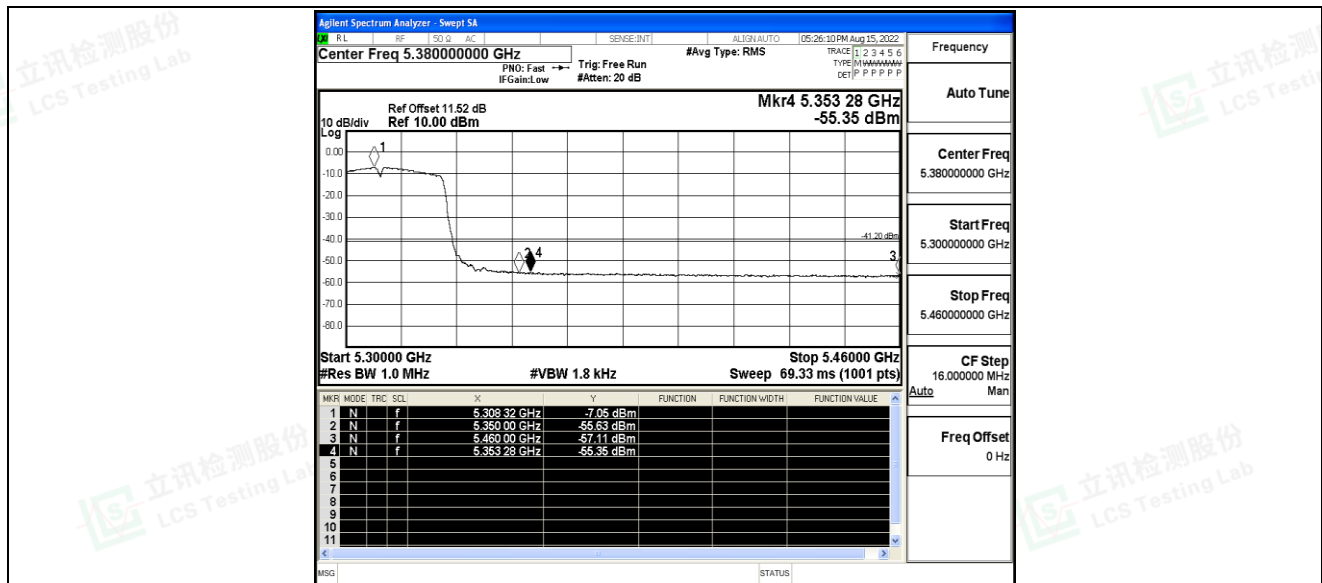

11N40SISO_Ant1_High_5310_Peak

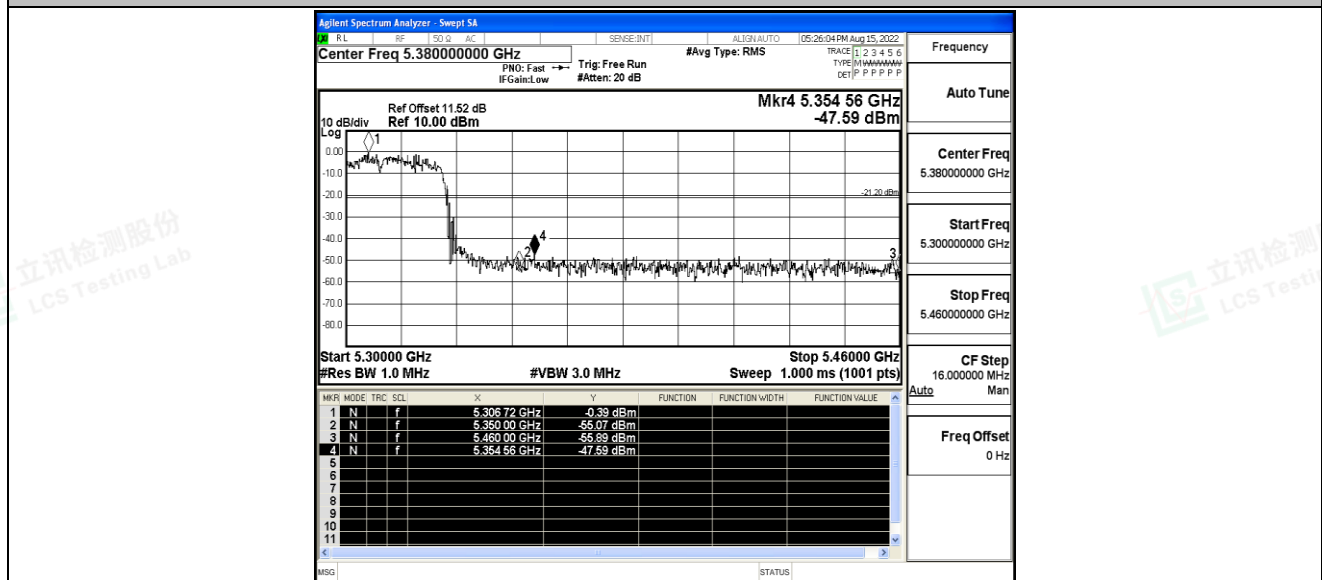

11AC20SISO_Ant1_Low_5260_AV




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

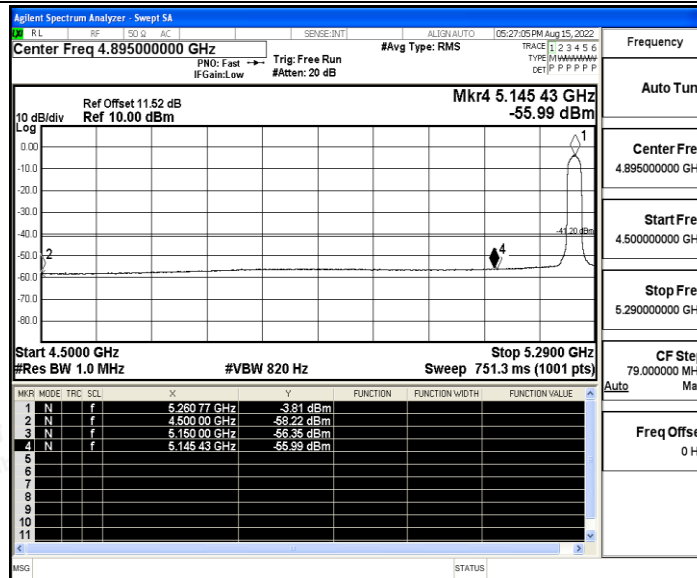

11AC20SISO_Ant1_Low_5260_Peak

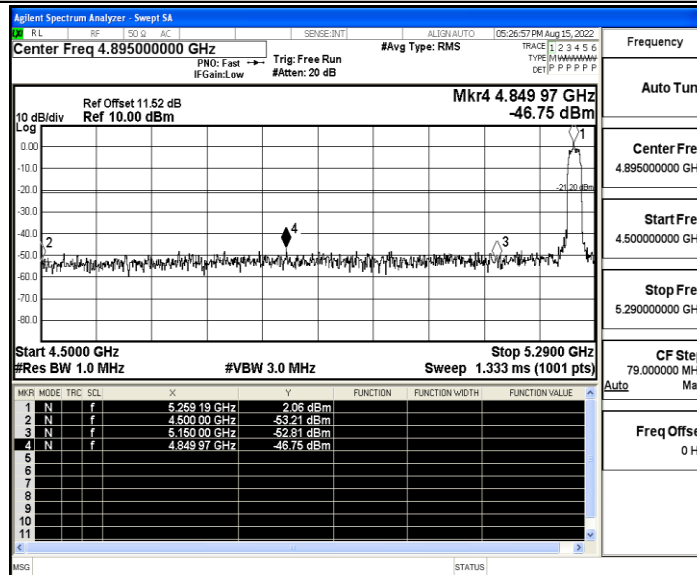

11AC20SISO_Ant1_High_5320_AV




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

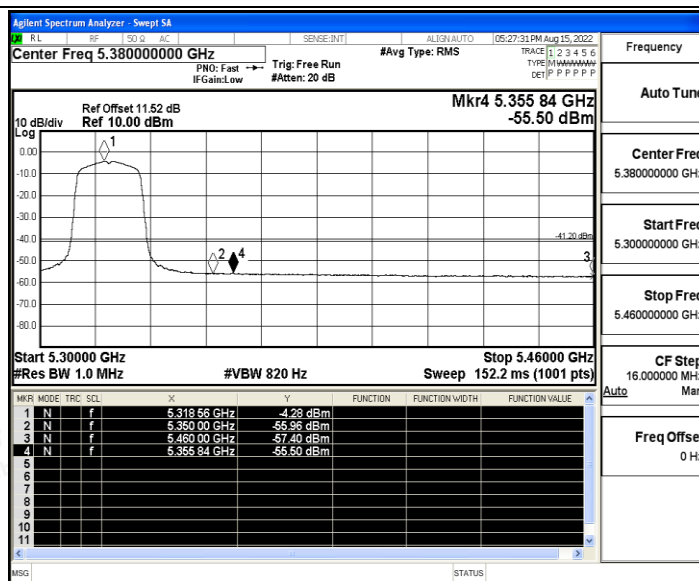

11AC20SISO_Ant1_High_5320_Peak

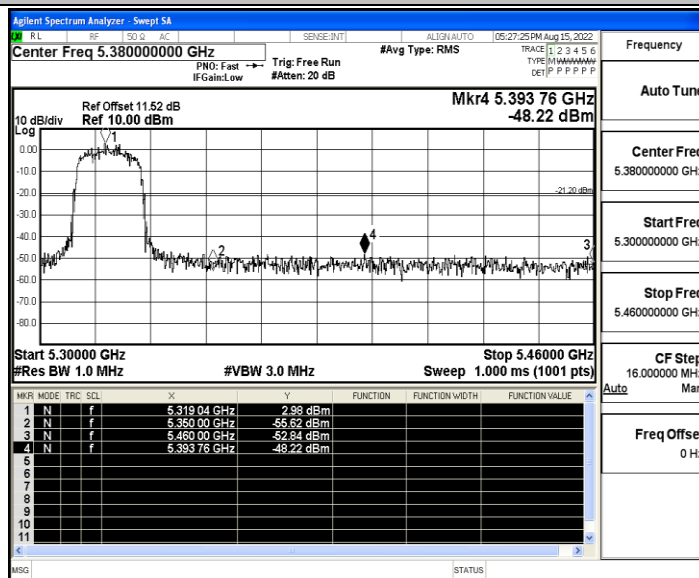

11AC40SISO_Ant1_Low_5270_AV




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

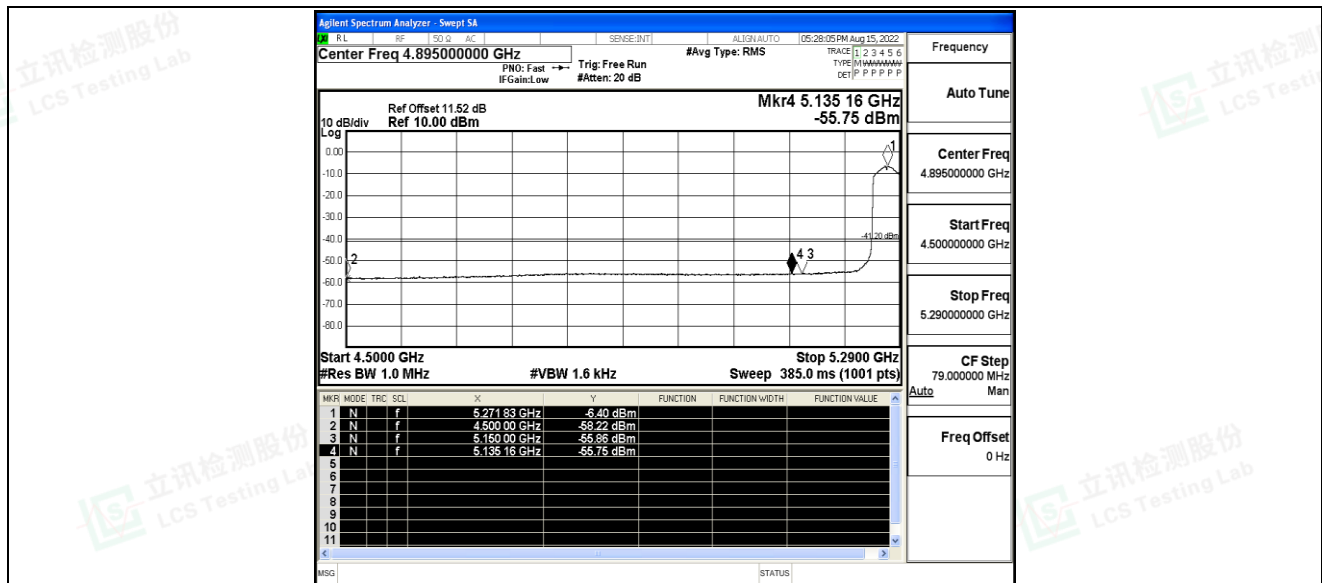

11AC40SISO_Ant1_Low_5270_Peak

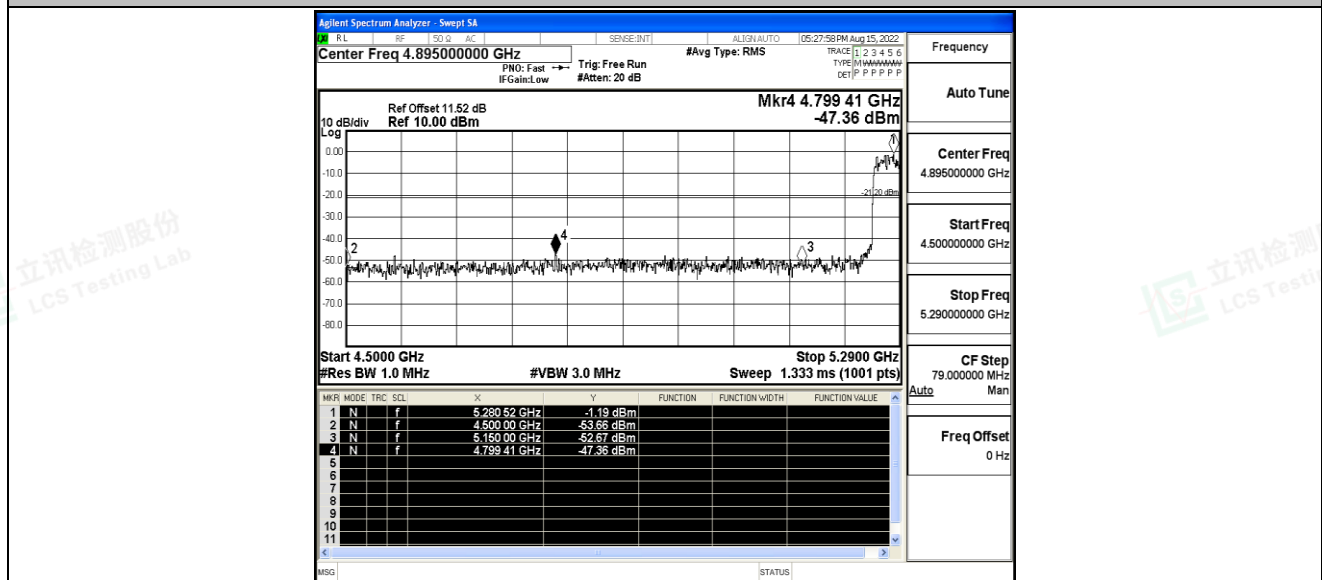

11AC40SISO_Ant1_High_5310_AV




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

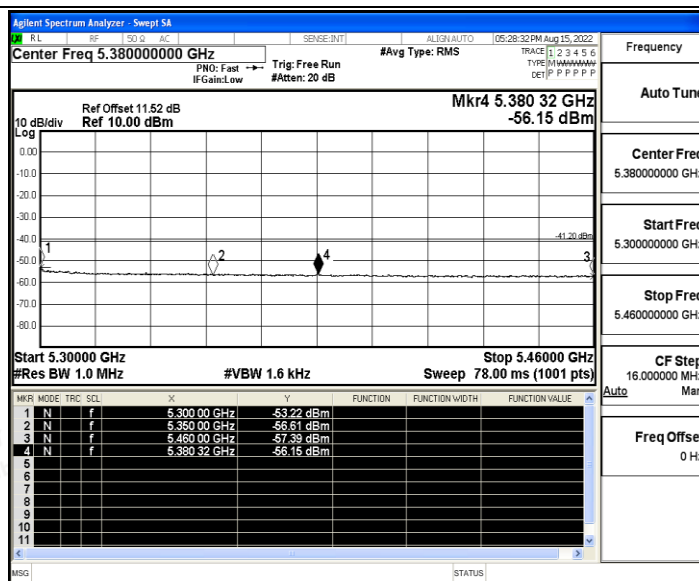

11AC40SISO_Ant1_High_5310_Peak

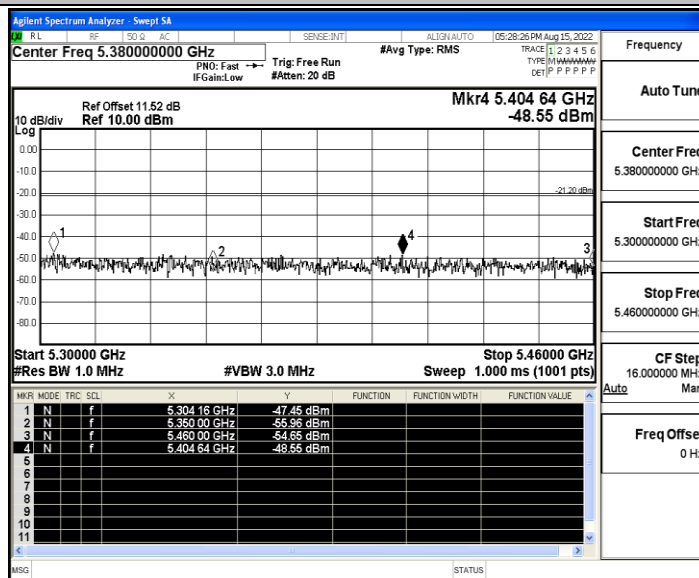

11AC80SISO_Ant1_Low_5290_AV




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

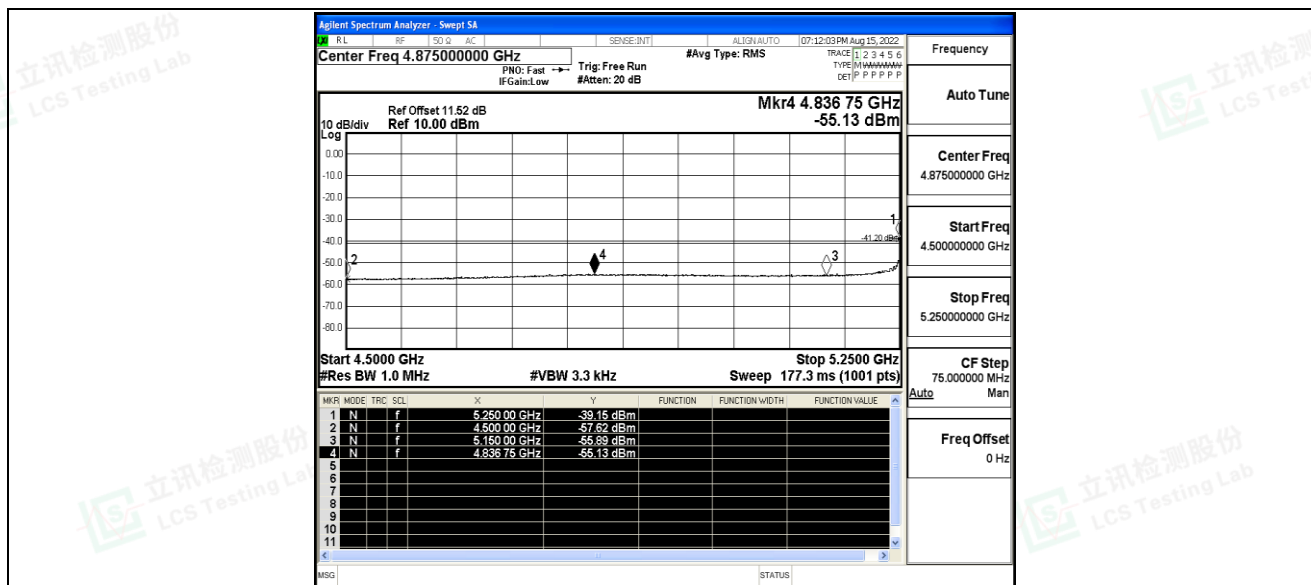

11AC80SISO_Ant1_Low_5290_Peak

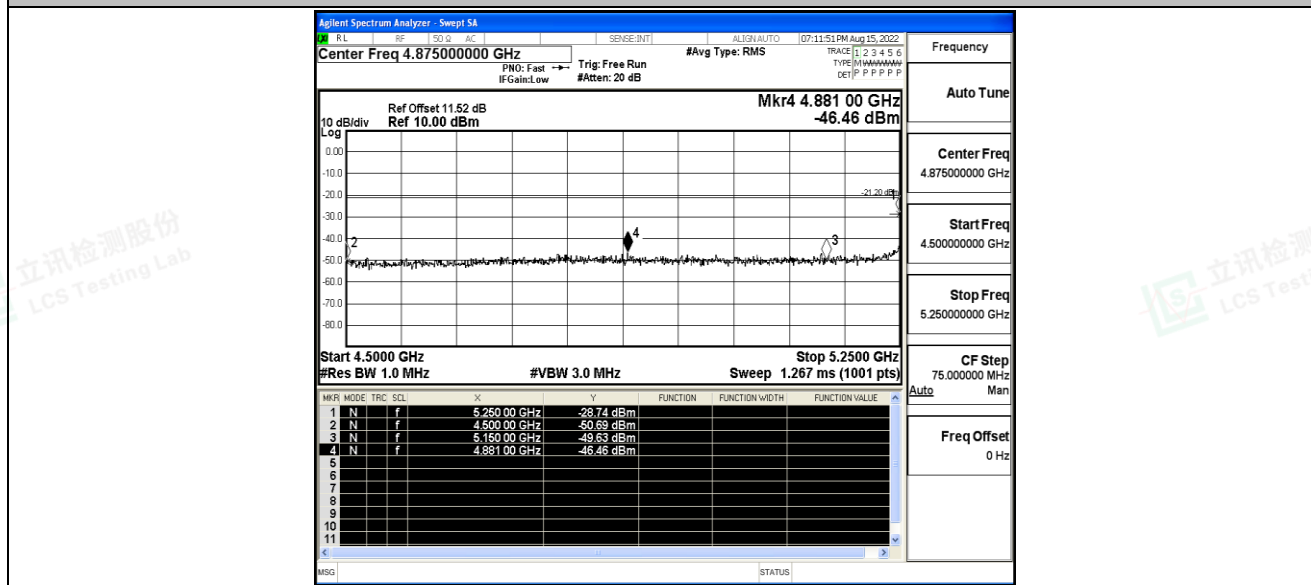

11AC80SISO_Ant1_High_5290_AV




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

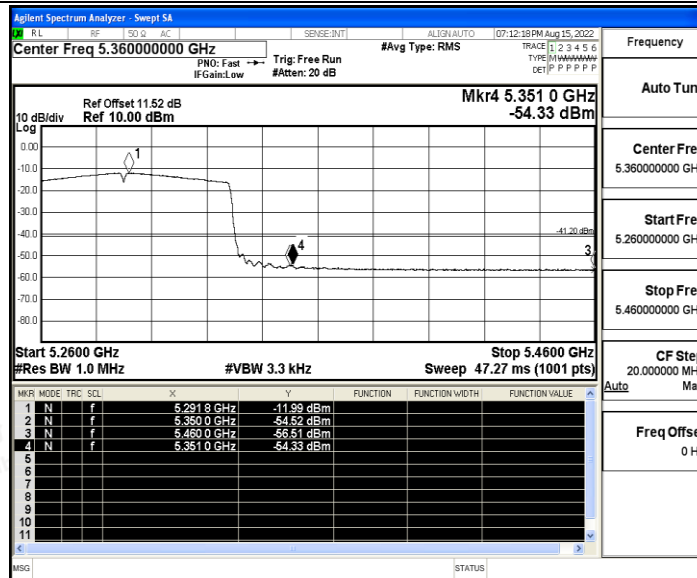

11AC80SISO_Ant1_High_5290_Peak

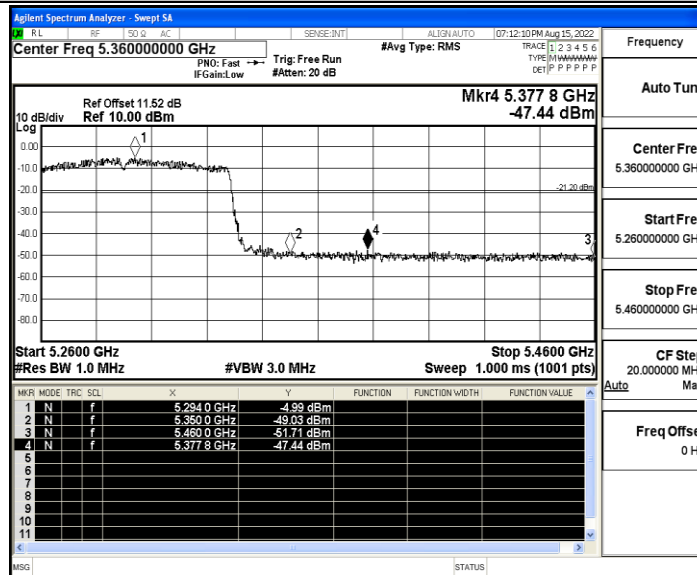

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



E.5 Frequency Stability

Test Result

Voltage								
TestMode	Antenna	Frequency [MHz]	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
11A	Ant0	5260	NV	NT	0	0	20	PASS
			LV	NT	0	0	20	PASS
			HV	NT	0	0	20	PASS
		5300	NV	NT	0	0	20	PASS
			LV	NT	20000	3.773585	20	PASS
			HV	NT	20000	3.773585	20	PASS
		5320	NV	NT	0	0	20	PASS
			LV	NT	20000	3.759398	20	PASS
			HV	NT	20000	3.759398	20	PASS
11N20SISO	Ant0	5260	NV	NT	20000	3.802281	20	PASS
			LV	NT	20000	3.802281	20	PASS
			HV	NT	0	0	20	PASS
		5300	NV	NT	20000	3.773585	20	PASS
			LV	NT	-20000	-3.773585	20	PASS
			HV	NT	0	0	20	PASS
		5320	NV	NT	0	0	20	PASS
			LV	NT	-20000	-3.759398	20	PASS
			HV	NT	-20000	-3.759398	20	PASS
11N40SISO	Ant0	5270	NV	NT	0	0	20	PASS
			LV	NT	0	0	20	PASS
			HV	NT	0	0	20	PASS
		5310	NV	NT	40000	7.532957	20	PASS
			LV	NT	0	0	20	PASS
			HV	NT	0	0	20	PASS
11AC20SISO	Ant0	5260	NV	NT	-20000	-3.802281	20	PASS
			LV	NT	0	0	20	PASS
			HV	NT	0	0	20	PASS
		5300	NV	NT	-20000	-3.773585	20	PASS
			LV	NT	20000	3.773585	20	PASS
			HV	NT	0	0	20	PASS
		5320	NV	NT	0	0	20	PASS
			LV	NT	20000	3.759398	20	PASS
			HV	NT	20000	3.759398	20	PASS
11AC40SIS	Ant0	5270	NV	NT	0	0	20	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



O			LV	NT	0	0	20	PASS
			HV	NT	40000	7.590133	20	PASS
		5310	NV	NT	0	0	20	PASS
			LV	NT	0	0	20	PASS
			HV	NT	40000	7.532957	20	PASS
11AC80SIS O	Ant0	5290	NV	NT	0	0	20	PASS
			LV	NT	-80000	-15.122873	20	PASS
			HV	NT	0	0	20	PASS

Temperature								
TestMode	Antenna	Frequenc y[MHz]	Voltage [Vdc]	Temperat ure (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
11A	Ant0	5260	NV	-30	20000	3.802281	20	PASS
			NV	-20	0	0	20	PASS
			NV	-10	0	0	20	PASS
			NV	0	0	0	20	PASS
			NV	10	0	0	20	PASS
			NV	20	0	0	20	PASS
			NV	30	0	0	20	PASS
			NV	40	0	0	20	PASS
		5300	NV	50	0	0	20	PASS
			NV	-30	20000	3.773585	20	PASS
			NV	-20	0	0	20	PASS
			NV	-10	0	0	20	PASS
			NV	0	20000	3.773585	20	PASS
			NV	10	0	0	20	PASS
			NV	20	-20000	-3.773585	20	PASS
			NV	30	0	0	20	PASS
			NV	40	-20000	-3.773585	20	PASS
			NV	50	-20000	-3.773585	20	PASS
		5320	NV	-30	0	0	20	PASS
			NV	-20	0	0	20	PASS
			NV	-10	20000	3.759398	20	PASS
			NV	0	-20000	-3.759398	20	PASS
			NV	10	0	0	20	PASS
			NV	20	0	0	20	PASS
			NV	30	0	0	20	PASS
			NV	40	20000	3.759398	20	PASS
			NV	50	20000	3.759398	20	PASS
11N20SISO	Ant0	5260	NV	-30	40000	7.604563	20	PASS
			NV	-20	20000	3.802281	20	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



			NV	-10	-20000	-3.802281	20	PASS
			NV	0	-20000	-3.802281	20	PASS
			NV	10	-20000	-3.802281	20	PASS
			NV	20	0	0	20	PASS
			NV	30	20000	3.802281	20	PASS
			NV	40	0	0	20	PASS
			NV	50	-40000	-7.604563	20	PASS
		5300	NV	-30	20000	3.773585	20	PASS
			NV	-20	20000	3.773585	20	PASS
			NV	-10	0	0	20	PASS
			NV	0	-20000	-3.773585	20	PASS
			NV	10	-20000	-3.773585	20	PASS
			NV	20	20000	3.773585	20	PASS
			NV	30	0	0	20	PASS
		5320	NV	-30	0	0	20	PASS
			NV	-20	0	0	20	PASS
			NV	-10	20000	3.759398	20	PASS
			NV	0	20000	3.759398	20	PASS
			NV	10	-20000	-3.759398	20	PASS
			NV	20	0	0	20	PASS
			NV	30	20000	3.759398	20	PASS
11N40SISO	Ant0	5270	NV	-30	0	0	20	PASS
			NV	-20	0	0	20	PASS
			NV	-10	40000	7.590133	20	PASS
			NV	0	0	0	20	PASS
			NV	10	0	0	20	PASS
			NV	20	40000	7.590133	20	PASS
			NV	30	-40000	-7.590133	20	PASS
		5310	NV	40	0	0	20	PASS
			NV	50	0	0	20	PASS
			NV	-30	0	0	20	PASS
			NV	-20	40000	7.532957	20	PASS
			NV	-10	0	0	20	PASS
			NV	0	0	0	20	PASS
			NV	10	0	0	20	PASS
			NV	20	0	0	20	PASS
			NV	30	40000	7.532957	20	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



11AC20SIS O	Ant0		NV	40	0	0	20	PASS
			NV	50	40000	7.532957	20	PASS
		5260	NV	-30	0	0	20	PASS
			NV	-20	40000	7.604563	20	PASS
			NV	-10	0	0	20	PASS
			NV	0	20000	3.802281	20	PASS
			NV	10	-20000	-3.802281	20	PASS
			NV	20	-20000	-3.802281	20	PASS
			NV	30	40000	7.604563	20	PASS
			NV	40	20000	3.802281	20	PASS
			NV	50	-20000	-3.802281	20	PASS
		5300	NV	-30	-20000	-3.773585	20	PASS
			NV	-20	20000	3.773585	20	PASS
			NV	-10	-20000	-3.773585	20	PASS
			NV	0	20000	3.773585	20	PASS
			NV	10	40000	7.54717	20	PASS
			NV	20	0	0	20	PASS
			NV	30	0	0	20	PASS
			NV	40	0	0	20	PASS
		5320	NV	50	20000	3.773585	20	PASS
			NV	-30	-20000	-3.759398	20	PASS
			NV	-20	40000	7.518797	20	PASS
			NV	-10	20000	3.759398	20	PASS
			NV	0	0	0	20	PASS
			NV	10	0	0	20	PASS
			NV	20	0	0	20	PASS
			NV	30	20000	3.759398	20	PASS
11AC40SIS O	Ant0	5270	NV	40	0	0	20	PASS
			NV	50	-20000	-3.759398	20	PASS
			NV	-30	40000	7.590133	20	PASS
			NV	-20	40000	7.590133	20	PASS
			NV	-10	0	0	20	PASS
			NV	0	0	0	20	PASS
			NV	10	40000	7.590133	20	PASS
			NV	20	40000	7.590133	20	PASS
			NV	30	0	0	20	PASS
		5310	NV	40	0	0	20	PASS
			NV	50	0	0	20	PASS
			NV	-30	40000	7.532957	20	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



			NV	0	0	0	20	PASS
			NV	10	0	0	20	PASS
			NV	20	-40000	-7.532957	20	PASS
			NV	30	40000	7.532957	20	PASS
			NV	40	0	0	20	PASS
			NV	50	0	0	20	PASS
11AC80SIS O	Ant0	5290	NV	-30	0	0	20	PASS
			NV	-20	-80000	-15.122873	20	PASS
			NV	-10	0	0	20	PASS
			NV	0	0	0	20	PASS
			NV	10	0	0	20	PASS
			NV	20	80000	15.122873	20	PASS
			NV	30	0	0	20	PASS
			NV	40	-80000	-15.122873	20	PASS
			NV	50	0	0	20	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Voltage								
TestMode	Antenna	Frequenc y[MHz]	Voltage [Vdc]	Temperat ure (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
11A	Ant1	5260	NV	NT	-20000.00	-3.802281	20	PASS
			LV	NT	0.00	0.000000	20	PASS
			HV	NT	0.00	0.000000	20	PASS
		5300	NV	NT	20000.00	3.773585	20	PASS
			LV	NT	0.00	0.000000	20	PASS
			HV	NT	0.00	0.000000	20	PASS
		5320	NV	NT	0.00	0.000000	20	PASS
			LV	NT	-20000.00	-3.759398	20	PASS
			HV	NT	0.00	0.000000	20	PASS
11N20SISO	Ant1	5260	NV	NT	0.00	0.000000	20	PASS
			LV	NT	-20000.00	-3.802281	20	PASS
			HV	NT	0.00	0.000000	20	PASS
		5300	NV	NT	20000.00	3.773585	20	PASS
			LV	NT	0.00	0.000000	20	PASS
			HV	NT	40000.00	7.547170	20	PASS
		5320	NV	NT	-20000.00	-3.759398	20	PASS
			LV	NT	0.00	0.000000	20	PASS
			HV	NT	0.00	0.000000	20	PASS
11N40SISO	Ant1	5270	NV	NT	0.00	0.000000	20	PASS
			LV	NT	0.00	0.000000	20	PASS
			HV	NT	0.00	0.000000	20	PASS
		5310	NV	NT	0.00	0.000000	20	PASS
			LV	NT	0.00	0.000000	20	PASS
			HV	NT	0.00	0.000000	20	PASS
11AC20SISO	Ant1	5260	NV	NT	20000.00	3.802281	20	PASS
			LV	NT	0.00	0.000000	20	PASS
			HV	NT	0.00	0.000000	20	PASS
		5300	NV	NT	20000.00	3.773585	20	PASS
			LV	NT	0.00	0.000000	20	PASS
			HV	NT	-40000.00	-7.547170	20	PASS
		5320	NV	NT	40000.00	7.518797	20	PASS
			LV	NT	-20000.00	-3.759398	20	PASS
			HV	NT	0.00	0.000000	20	PASS
11AC40SISO	Ant1	5270	NV	NT	40000.00	7.590133	20	PASS
			LV	NT	0.00	0.000000	20	PASS
			HV	NT	0.00	0.000000	20	PASS
		5310	NV	NT	0.00	0.000000	20	PASS
			LV	NT	40000.00	7.532957	20	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



11AC80SIS O	Ant1	5290	HV	NT	0.00	0.000000	20	PASS
			NV	NT	-80000.00	-15.122873	20	PASS
			LV	NT	-80000.00	-15.122873	20	PASS
			HV	NT	-80000.00	-15.122873	20	PASS

Temperature								
TestMode	Antenna	Frequenc y[MHz]	Voltage [Vdc]	Temperat ure (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
11A	Ant1	5260	NV	-30	0.00	0.000000	20	PASS
			NV	-20	0.00	0.000000	20	PASS
			NV	-10	0.00	0.000000	20	PASS
			NV	0	0.00	0.000000	20	PASS
			NV	10	0.00	0.000000	20	PASS
			NV	20	0.00	0.000000	20	PASS
			NV	30	20000.00	3.802281	20	PASS
			NV	40	0.00	0.000000	20	PASS
			NV	50	-20000.00	-3.802281	20	PASS
		5300	NV	-30	20000.00	3.773585	20	PASS
			NV	-20	0.00	0.000000	20	PASS
			NV	-10	0.00	0.000000	20	PASS
			NV	0	0.00	0.000000	20	PASS
			NV	10	0.00	0.000000	20	PASS
			NV	20	0.00	0.000000	20	PASS
			NV	30	0.00	0.000000	20	PASS
			NV	40	0.00	0.000000	20	PASS
			NV	50	0.00	0.000000	20	PASS
		5320	NV	-30	0.00	0.000000	20	PASS
			NV	-20	20000.00	3.759398	20	PASS
			NV	-10	20000.00	3.759398	20	PASS
			NV	0	0.00	0.000000	20	PASS
			NV	10	-20000.00	-3.759398	20	PASS
			NV	20	0.00	0.000000	20	PASS
			NV	30	0.00	0.000000	20	PASS
			NV	40	20000.00	3.759398	20	PASS
			NV	50	0.00	0.000000	20	PASS
11N20SISO	Ant1	5260	NV	-30	0.00	0.000000	20	PASS
			NV	-20	20000.00	3.802281	20	PASS
			NV	-10	0.00	0.000000	20	PASS
			NV	0	-20000.00	-3.802281	20	PASS
			NV	10	0.00	0.000000	20	PASS
			NV	20	-20000.00	-3.802281	20	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



			NV	30	-20000.00	-3.802281	20	PASS
			NV	40	-20000.00	-3.802281	20	PASS
			NV	50	20000.00	3.802281	20	PASS
		5300	NV	-30	0.00	0.000000	20	PASS
			NV	-20	20000.00	3.773585	20	PASS
			NV	-10	20000.00	3.773585	20	PASS
			NV	0	0.00	0.000000	20	PASS
			NV	10	0.00	0.000000	20	PASS
			NV	20	20000.00	3.773585	20	PASS
			NV	30	0.00	0.000000	20	PASS
			NV	40	40000.00	7.547170	20	PASS
			NV	50	60000.00	11.320755	20	PASS
		5320	NV	-30	0.00	0.000000	20	PASS
			NV	-20	20000.00	3.759398	20	PASS
			NV	-10	0.00	0.000000	20	PASS
			NV	0	-40000.00	-7.518797	20	PASS
			NV	10	0.00	0.000000	20	PASS
			NV	20	20000.00	3.759398	20	PASS
			NV	30	-20000.00	-3.759398	20	PASS
			NV	40	0.00	0.000000	20	PASS
11N40SISO	Ant1	5270	NV	-30	40000.00	7.590133	20	PASS
			NV	-20	40000.00	7.590133	20	PASS
			NV	-10	40000.00	7.590133	20	PASS
			NV	0	40000.00	7.590133	20	PASS
			NV	10	40000.00	7.590133	20	PASS
			NV	20	40000.00	7.590133	20	PASS
			NV	30	0.00	0.000000	20	PASS
			NV	40	40000.00	7.590133	20	PASS
		5310	NV	50	0.00	0.000000	20	PASS
			NV	-30	0.00	0.000000	20	PASS
			NV	-20	0.00	0.000000	20	PASS
			NV	-10	0.00	0.000000	20	PASS
			NV	0	0.00	0.000000	20	PASS
			NV	10	0.00	0.000000	20	PASS
			NV	20	40000.00	7.532957	20	PASS
			NV	30	0.00	0.000000	20	PASS
			NV	40	40000.00	7.532957	20	PASS
			NV	50	-40000.00	-7.532957	20	PASS
11AC20SISO	Ant1	5260	NV	-30	20000.00	3.802281	20	PASS
			NV	-20	-20000.00	-3.802281	20	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



			NV	-10	-40000.00	-7.604563	20	PASS
			NV	0	20000.00	3.802281	20	PASS
			NV	10	-20000.00	-3.802281	20	PASS
			NV	20	0.00	0.000000	20	PASS
			NV	30	-20000.00	-3.802281	20	PASS
			NV	40	0.00	0.000000	20	PASS
			NV	50	-20000.00	-3.802281	20	PASS
		5300	NV	-30	-20000.00	-3.773585	20	PASS
			NV	-20	20000.00	3.773585	20	PASS
			NV	-10	20000.00	3.773585	20	PASS
			NV	0	0.00	0.000000	20	PASS
			NV	10	-40000.00	-7.547170	20	PASS
			NV	20	40000.00	7.547170	20	PASS
			NV	30	-40000.00	-7.547170	20	PASS
		5320	NV	40	-20000.00	-3.773585	20	PASS
			NV	50	20000.00	3.773585	20	PASS
			NV	-30	0.00	0.000000	20	PASS
			NV	-20	20000.00	3.759398	20	PASS
			NV	-10	0.00	0.000000	20	PASS
			NV	0	-20000.00	-3.759398	20	PASS
			NV	10	0.00	0.000000	20	PASS
11AC40SIS O	Ant1	5270	NV	20	20000.00	3.759398	20	PASS
			NV	30	0.00	0.000000	20	PASS
			NV	40	0.00	0.000000	20	PASS
			NV	50	0.00	0.000000	20	PASS
		5310	NV	-30	0.00	0.000000	20	PASS
			NV	-20	40000.00	7.590133	20	PASS
			NV	-10	0.00	0.000000	20	PASS
			NV	0	-40000.00	-7.590133	20	PASS
			NV	10	40000.00	7.590133	20	PASS
			NV	20	0.00	0.000000	20	PASS
			NV	30	0.00	0.000000	20	PASS
			NV	40	0.00	0.000000	20	PASS
			NV	50	40000.00	7.590133	20	PASS
		5310	NV	-30	120000.00	22.598870	20	FAIL
			NV	-20	0.00	0.000000	20	PASS
			NV	-10	40000.00	7.532957	20	PASS
			NV	0	-40000.00	-7.532957	20	PASS
			NV	10	0.00	0.000000	20	PASS
			NV	20	0.00	0.000000	20	PASS
			NV	30	40000.00	7.532957	20	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



11AC80SIS O	Ant1	5290	NV	40	40000.00	7.532957	20	PASS
			NV	50	40000.00	7.532957	20	PASS
			NV	-30	80000.00	15.122873	20	PASS
			NV	-20	0.00	0.000000	20	PASS
			NV	-10	0.00	0.000000	20	PASS
			NV	0	-80000.00	-15.122873	20	PASS
			NV	10	0.00	0.000000	20	PASS
			NV	20	0.00	0.000000	20	PASS
			NV	30	0.00	0.000000	20	PASS
			NV	40	0.00	0.000000	20	PASS
			NV	50	0.00	0.000000	20	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



E.6 Duty Cycle

Test Result

TestMode	Antenna	Frequency[MHz]	Transmission Duration [ms]	Transmission Period [ms]	Duty Cycle [%]	Factor	1/T
11A	Ant0	5260	1.40	1.50	93.33	0.30	0.71
		5300	1.40	1.50	93.33	0.30	0.71
		5320	1.39	1.49	93.29	0.30	0.72
11N20SISO	Ant0	5260	1.31	1.41	92.91	0.32	0.76
		5300	1.31	1.41	92.91	0.32	0.76
		5320	1.31	1.41	92.91	0.32	0.76
11N40SISO	Ant0	5270	0.65	0.75	86.67	0.62	1.54
		5310	0.65	1.26	51.59	2.87	1.54
11AC20SISO	Ant0	5260	1.31	1.41	92.91	0.32	0.76
		5300	1.32	1.42	92.96	0.32	0.76
		5320	1.32	1.42	92.96	0.32	0.76
11AC40SISO	Ant0	5270	0.66	0.76	86.84	0.61	1.52
		5310	0.65	0.75	86.67	0.62	1.54
11AC80SISO	Ant0	5290	0.32	0.42	76.19	1.18	3.13



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

11A_Ant0_5260

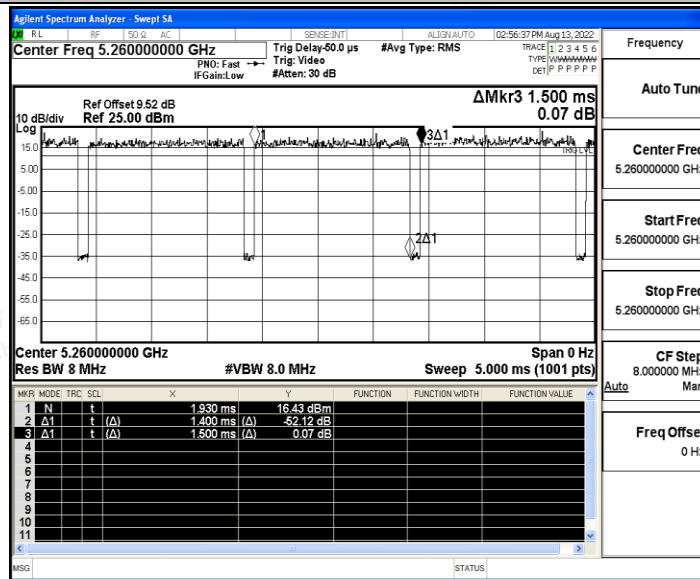

11A_Ant0_5300

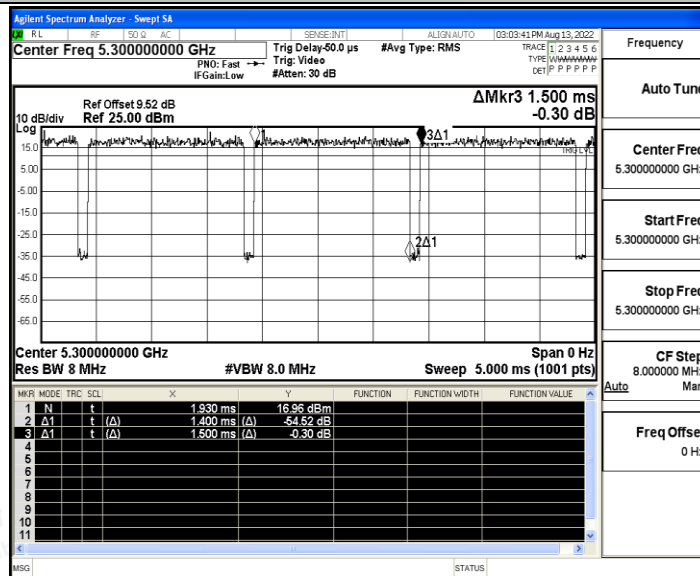

11A_Ant0_5320




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

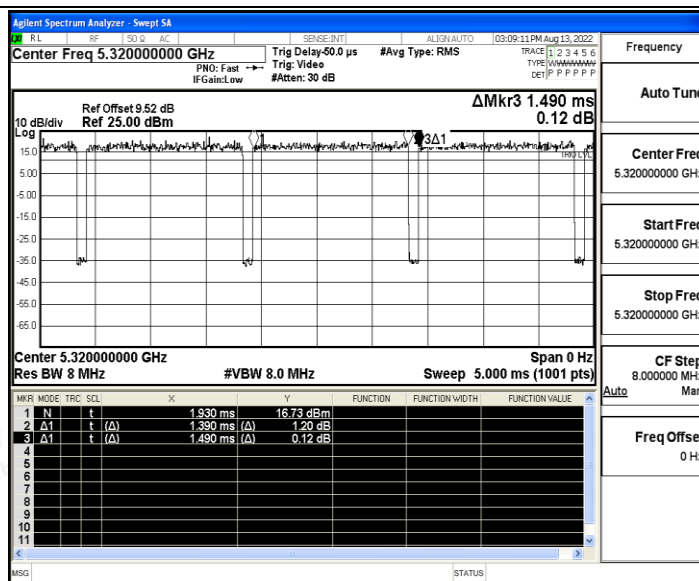

11N20SISO_Ant0_5260

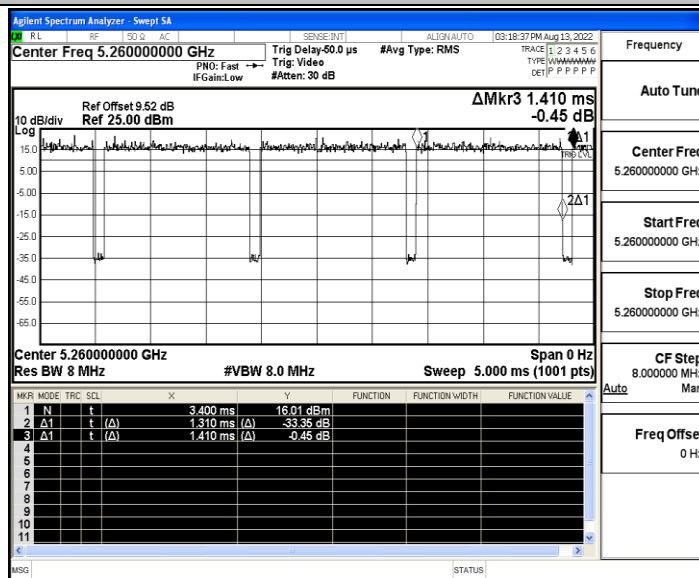

11N20SISO_Ant0_5300





Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

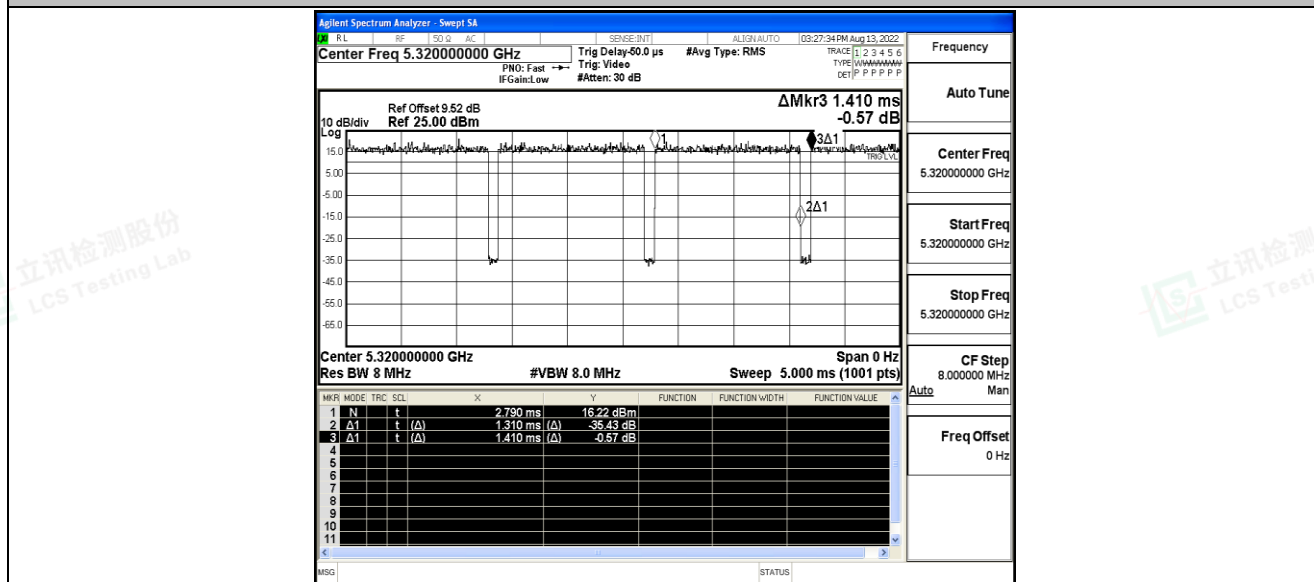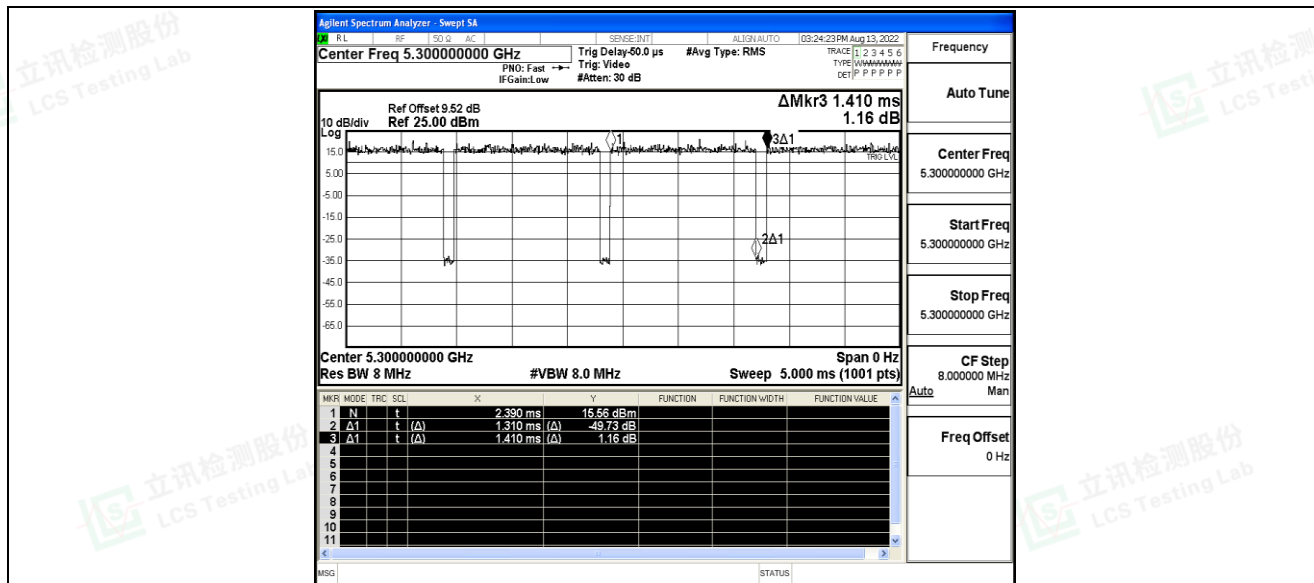


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

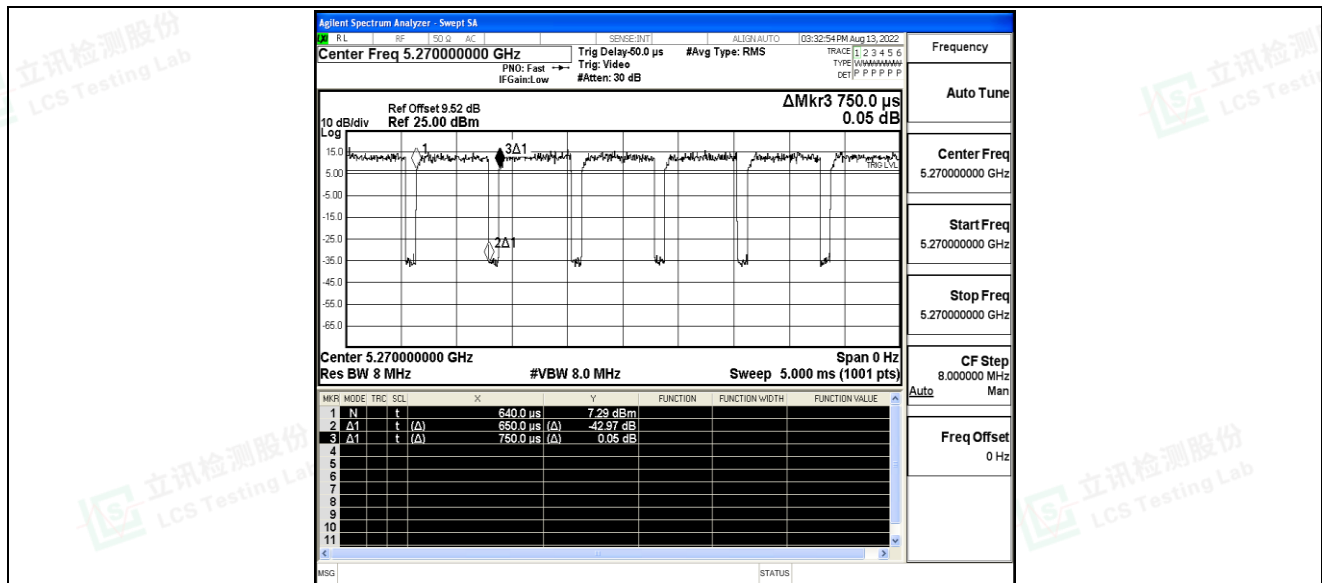

11N40SISO_Ant0_5310

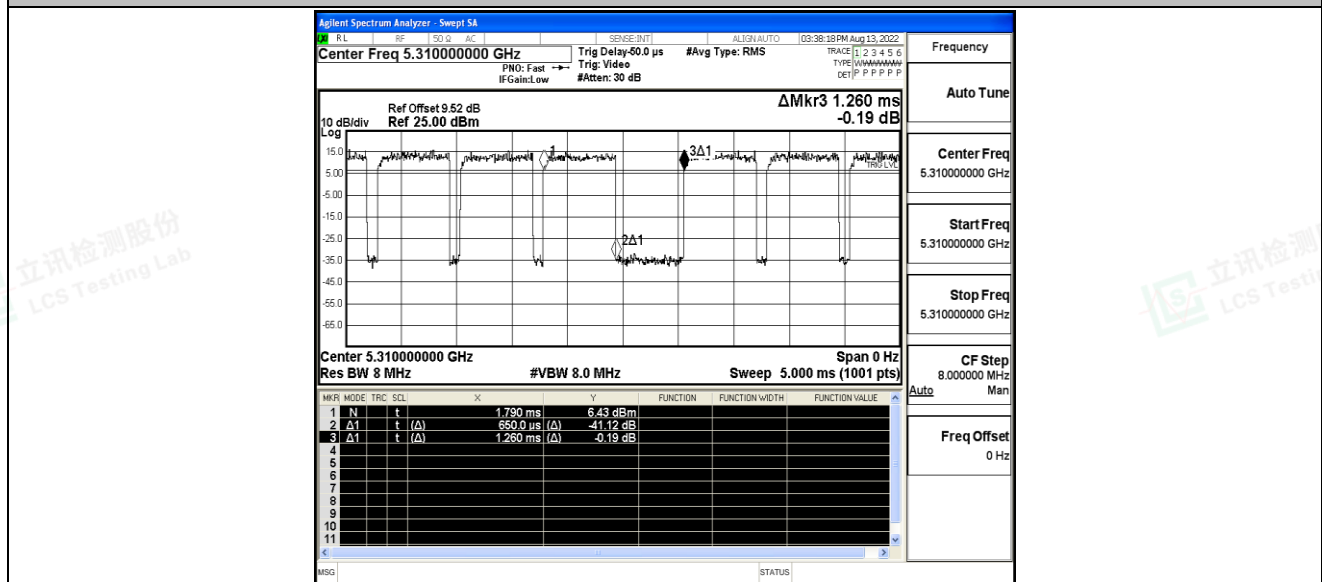

11AC20SISO_Ant0_5260




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

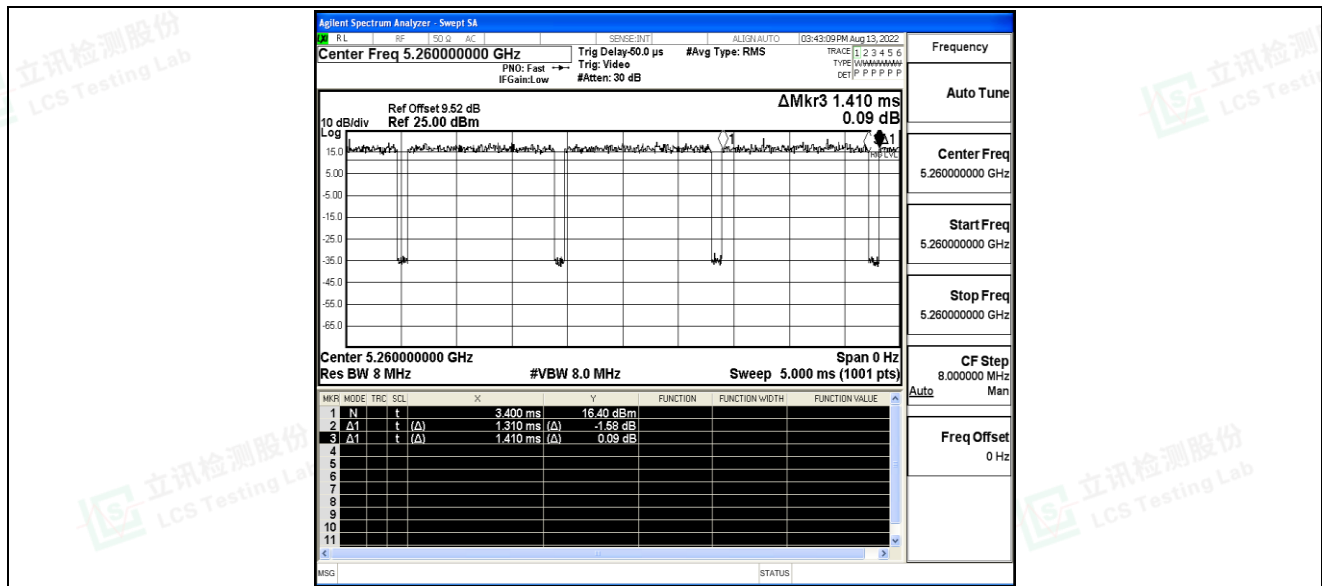

11AC20SISO_Ant0_5300

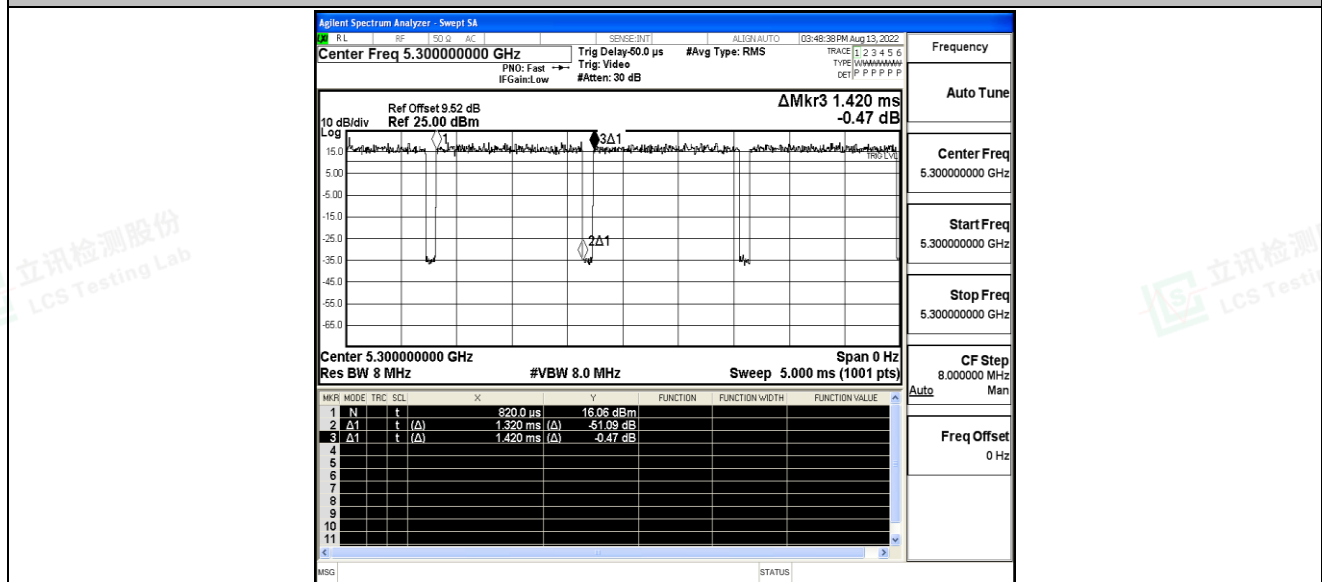

11AC20SISO_Ant0_5320




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

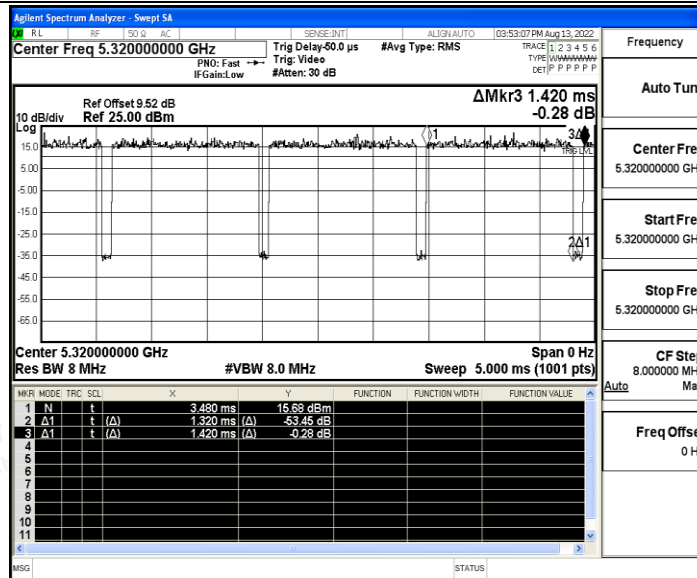

11AC40SISO_Ant0_5270

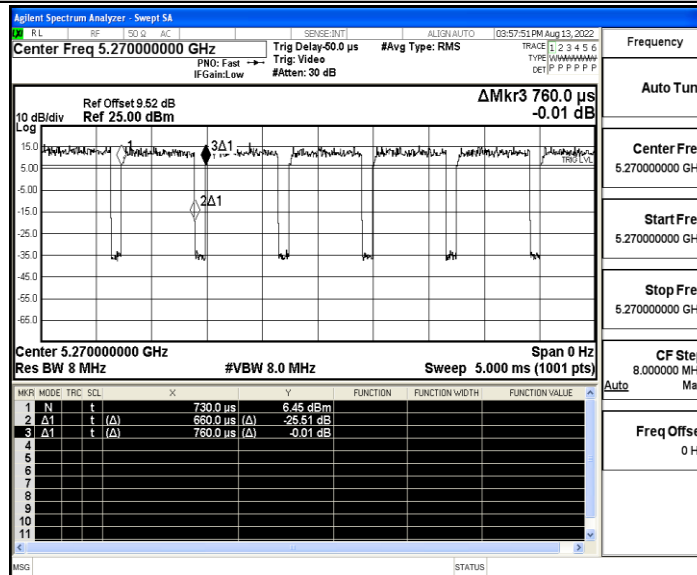

11AC40SISO_Ant0_5310



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity