






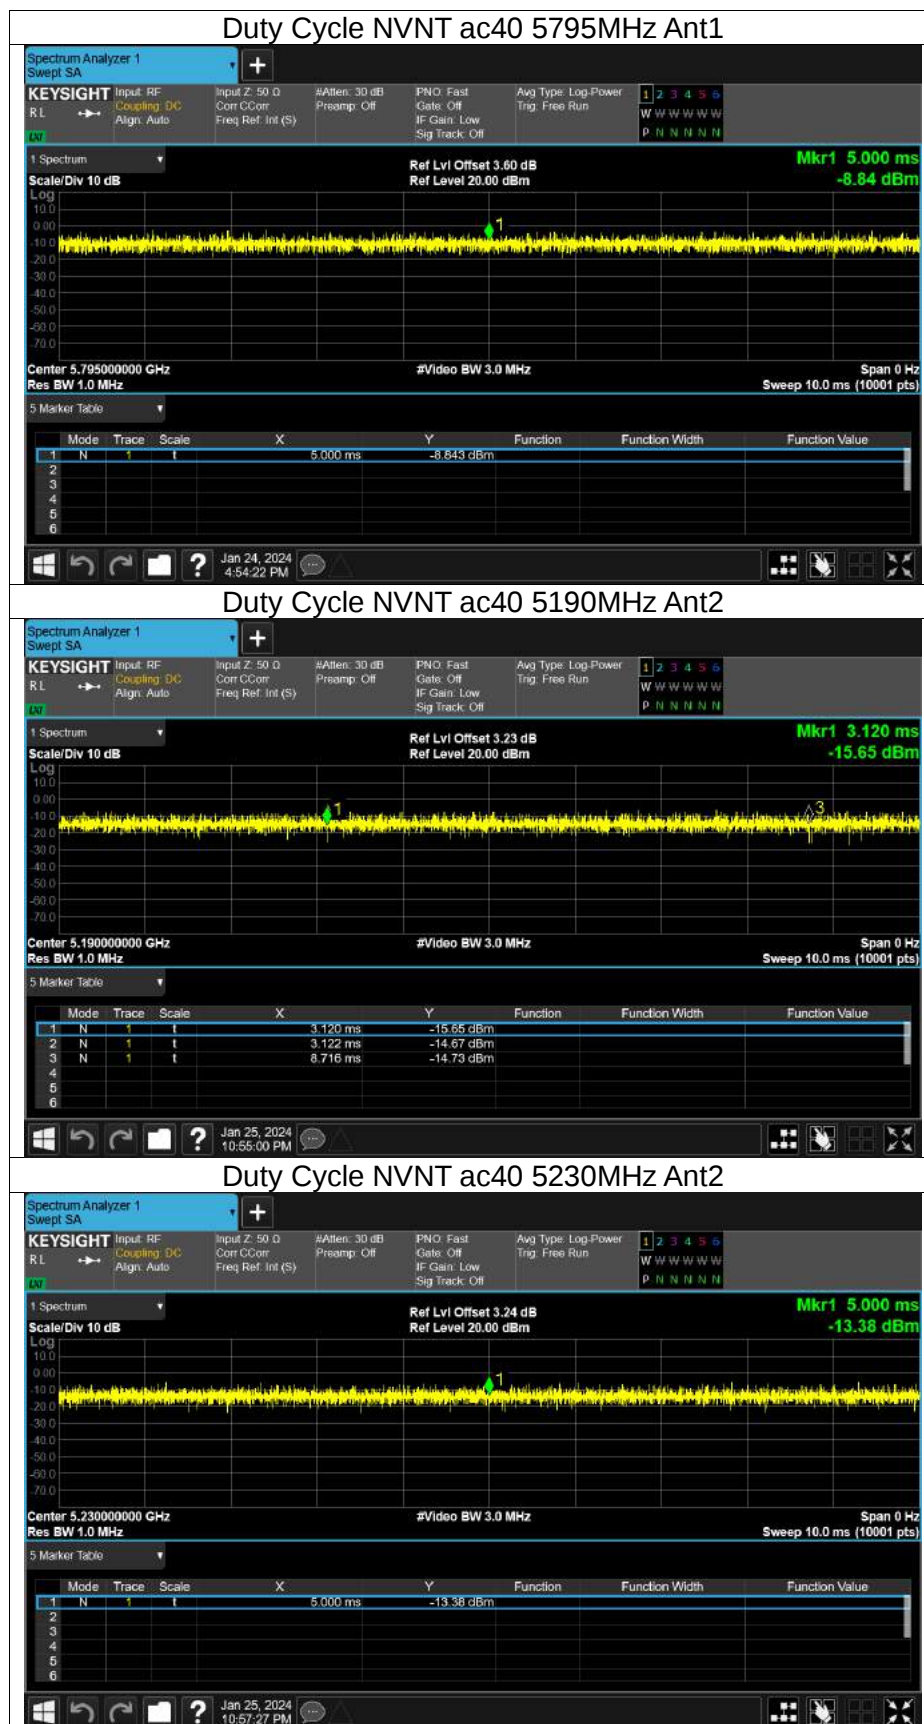


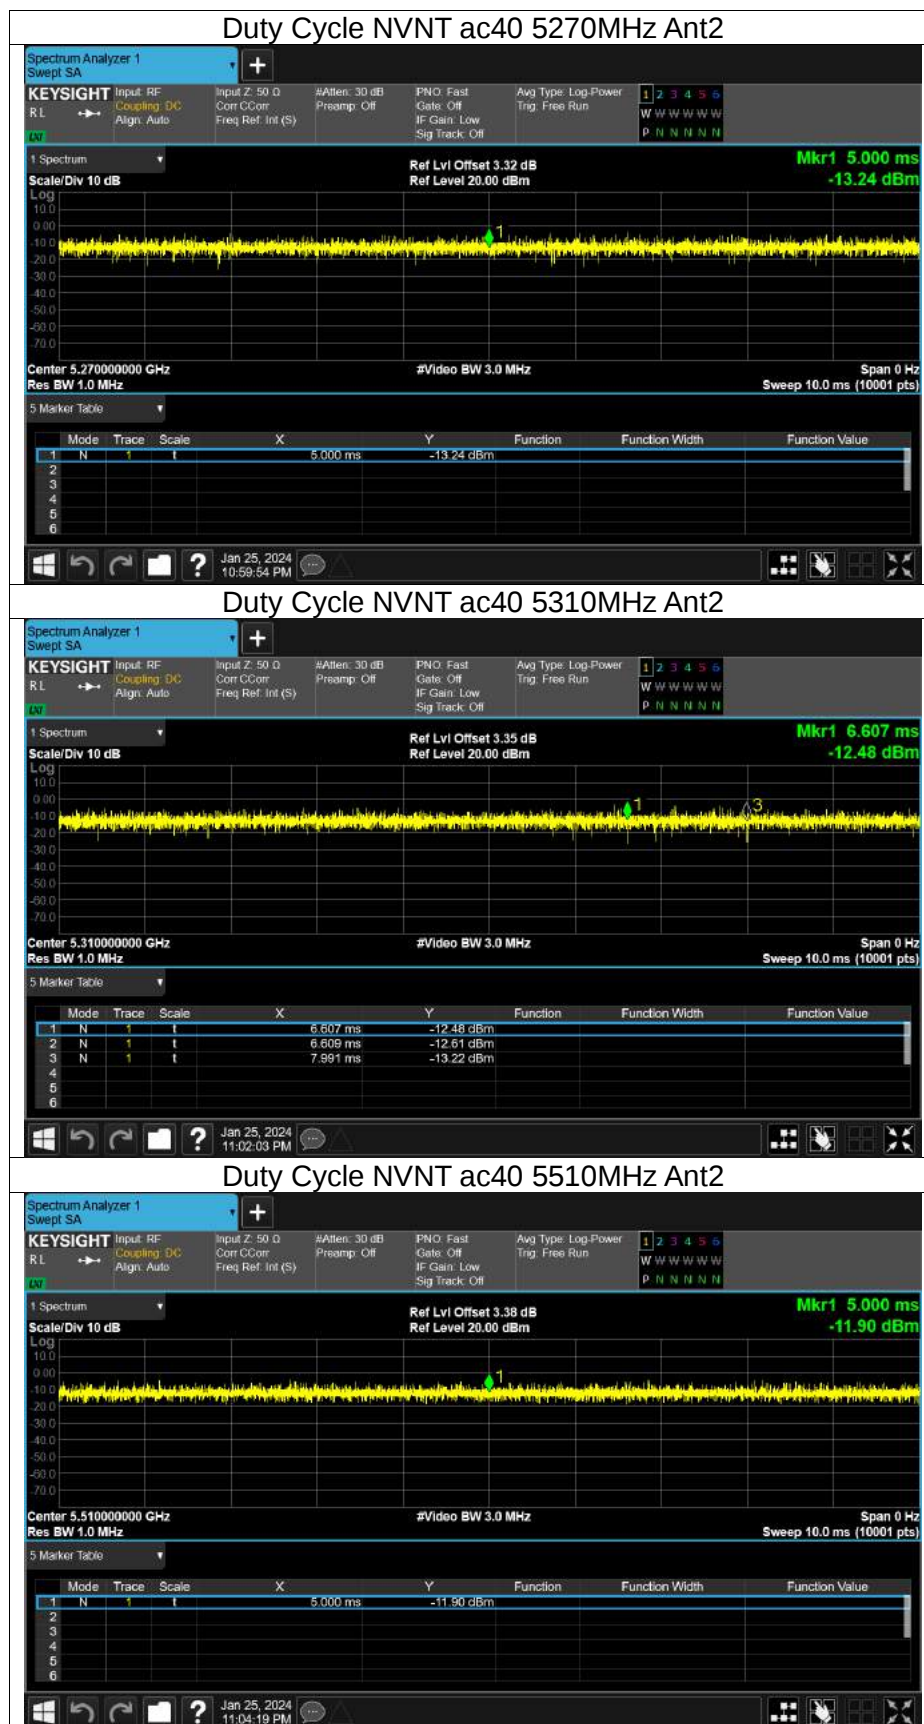


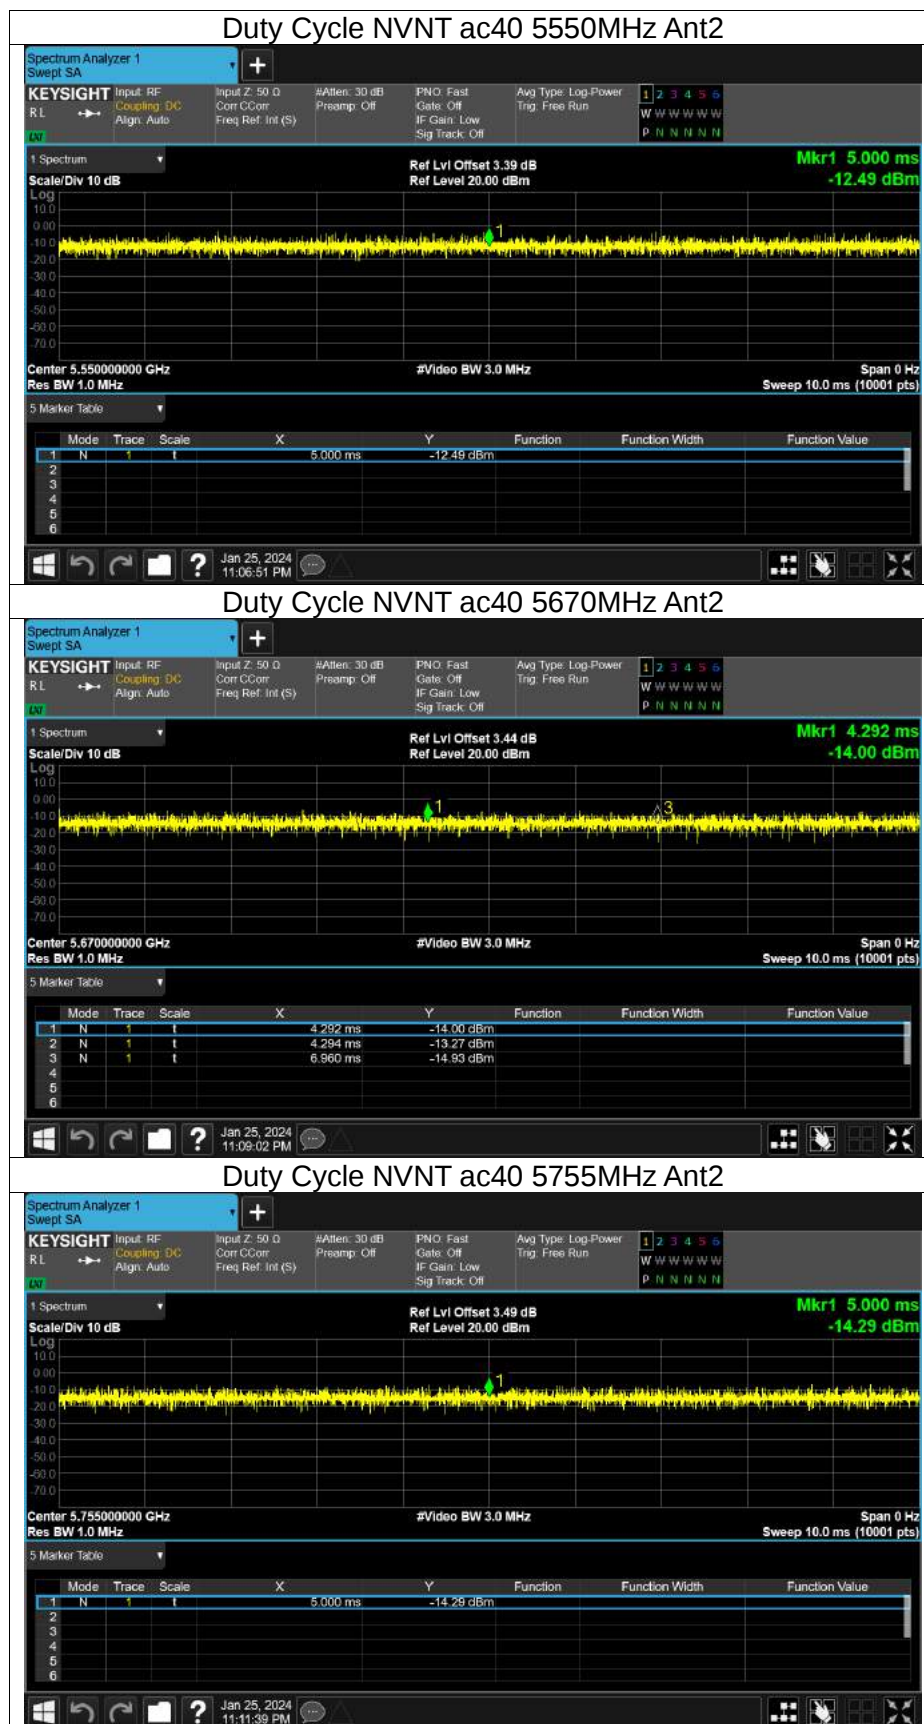


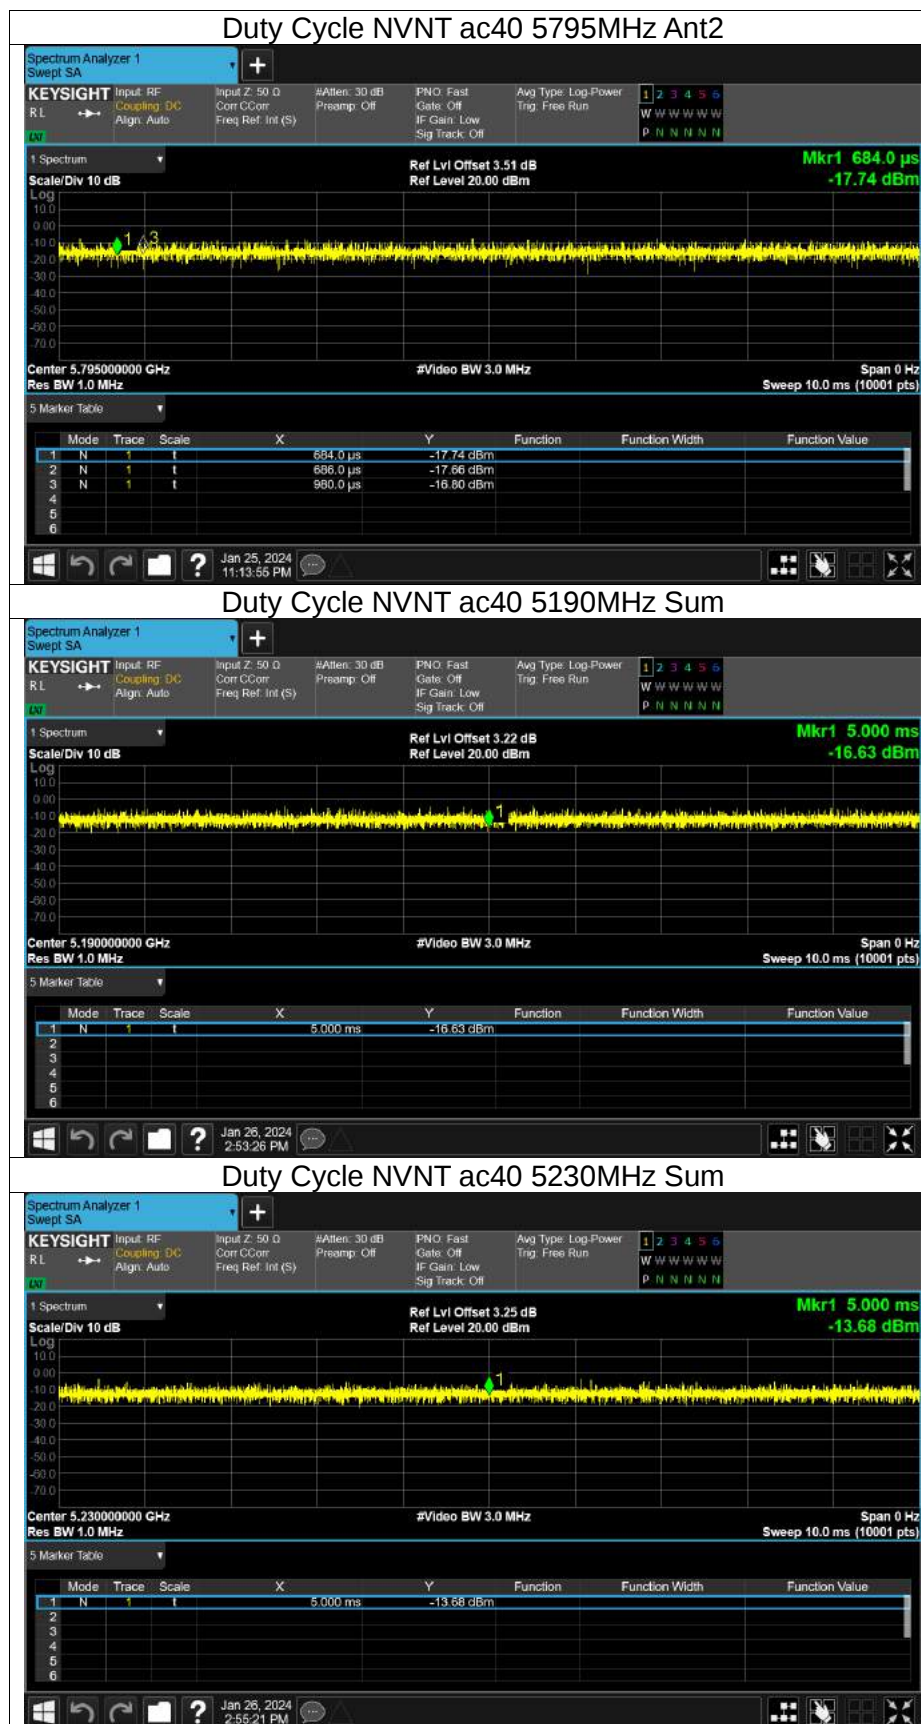


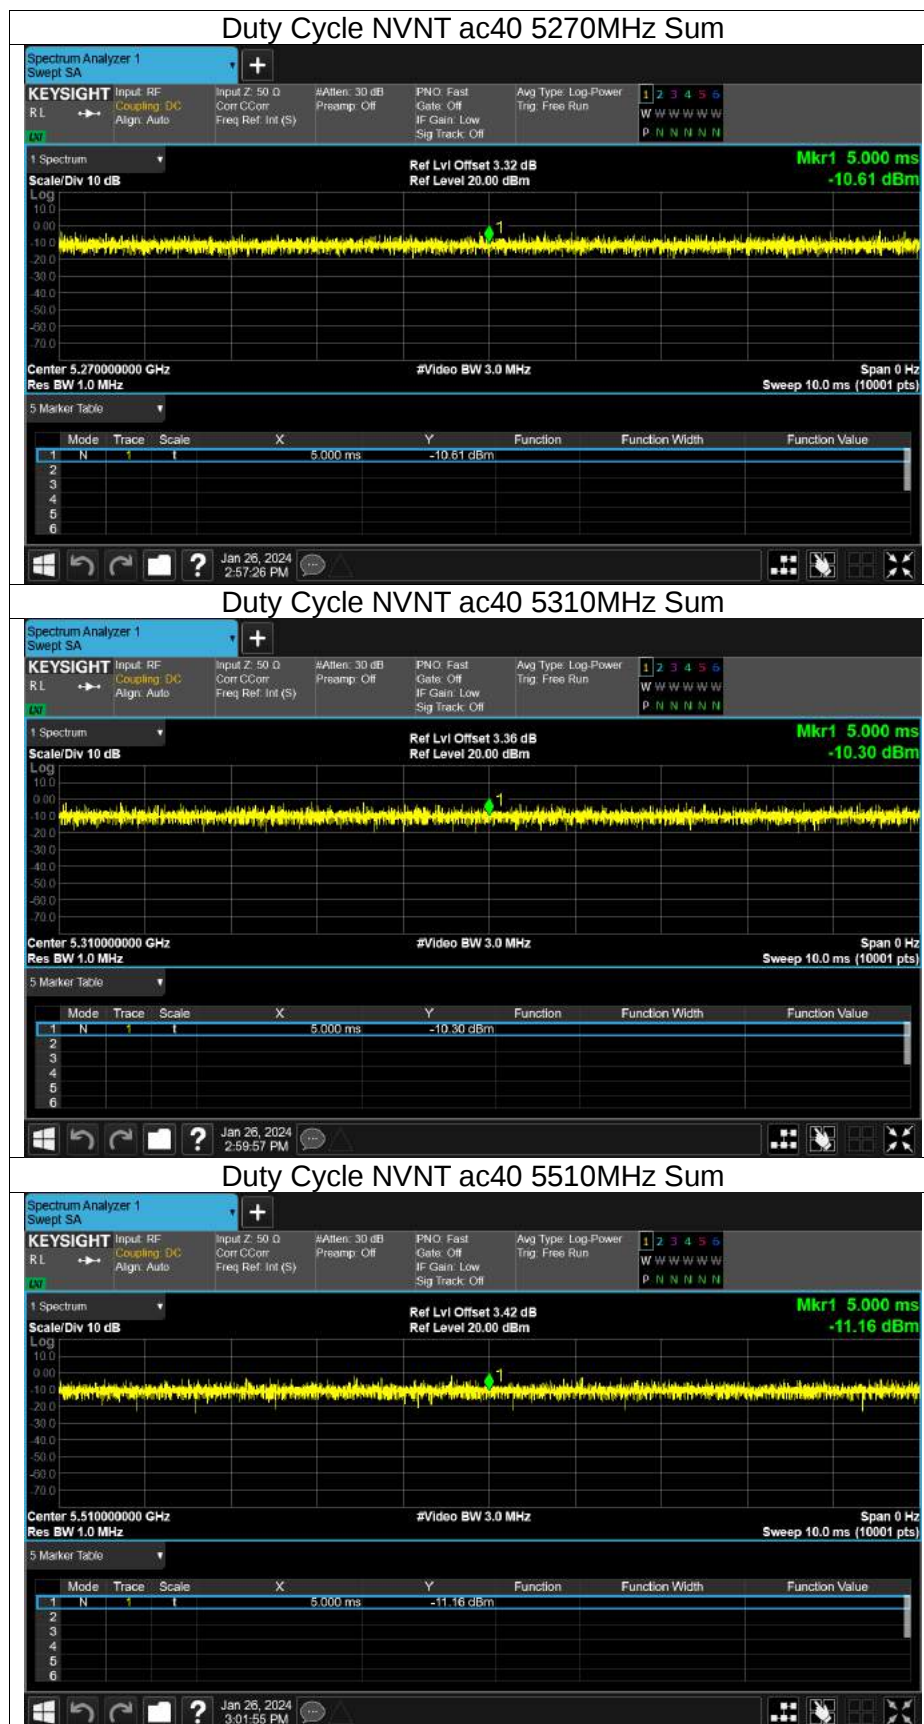

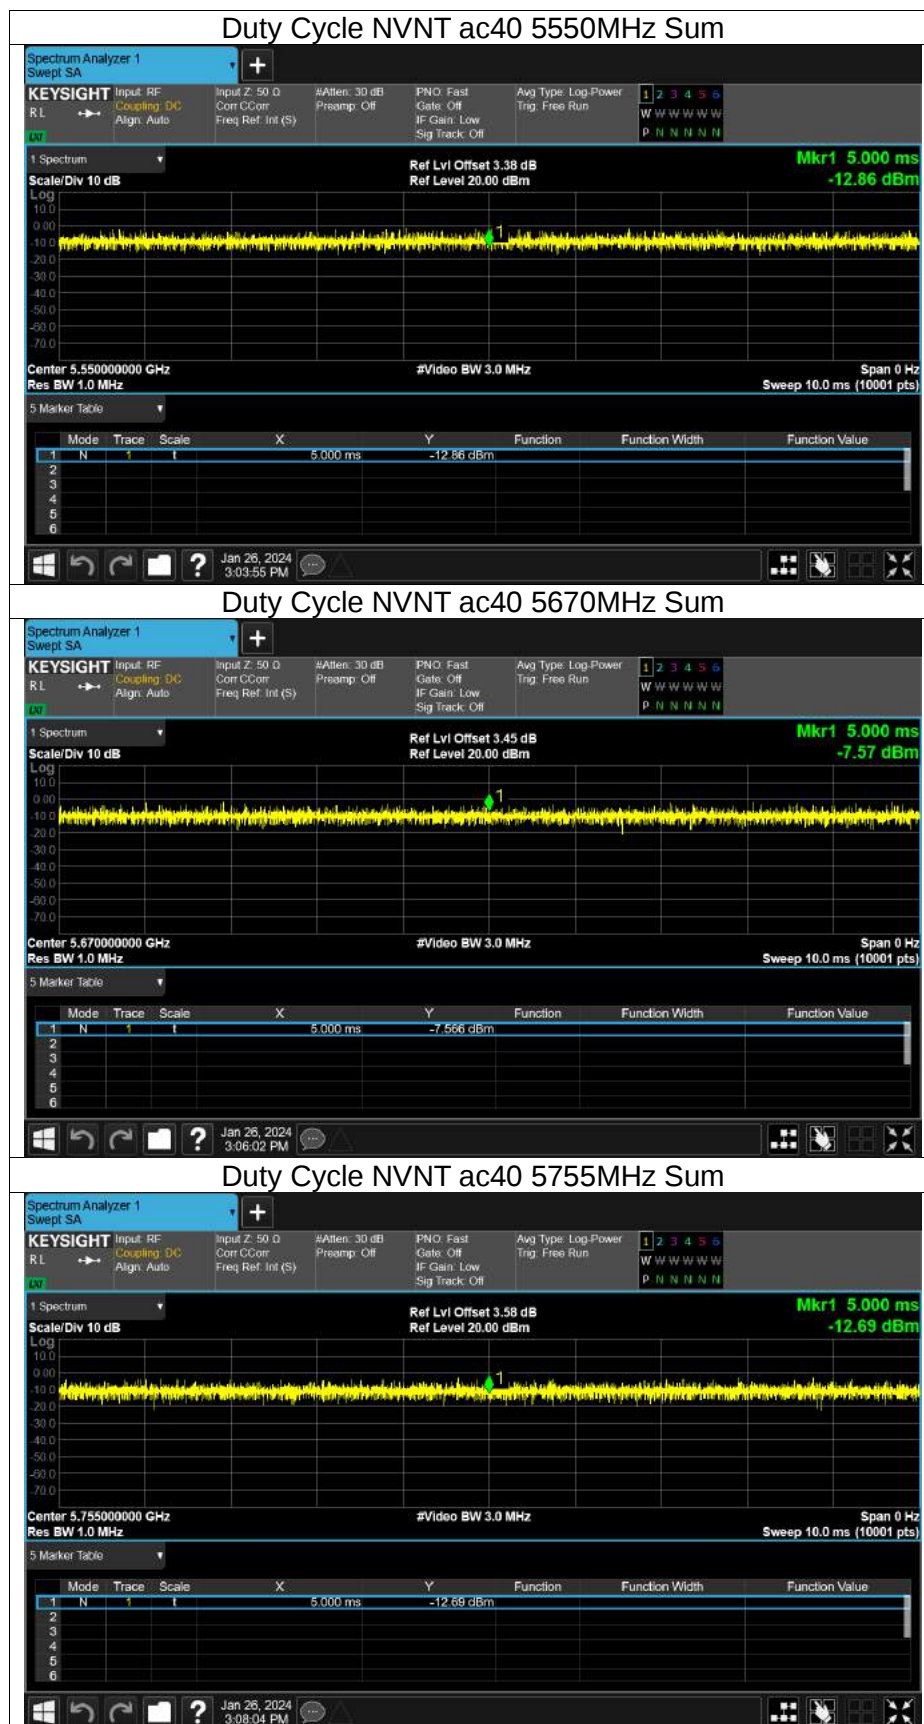


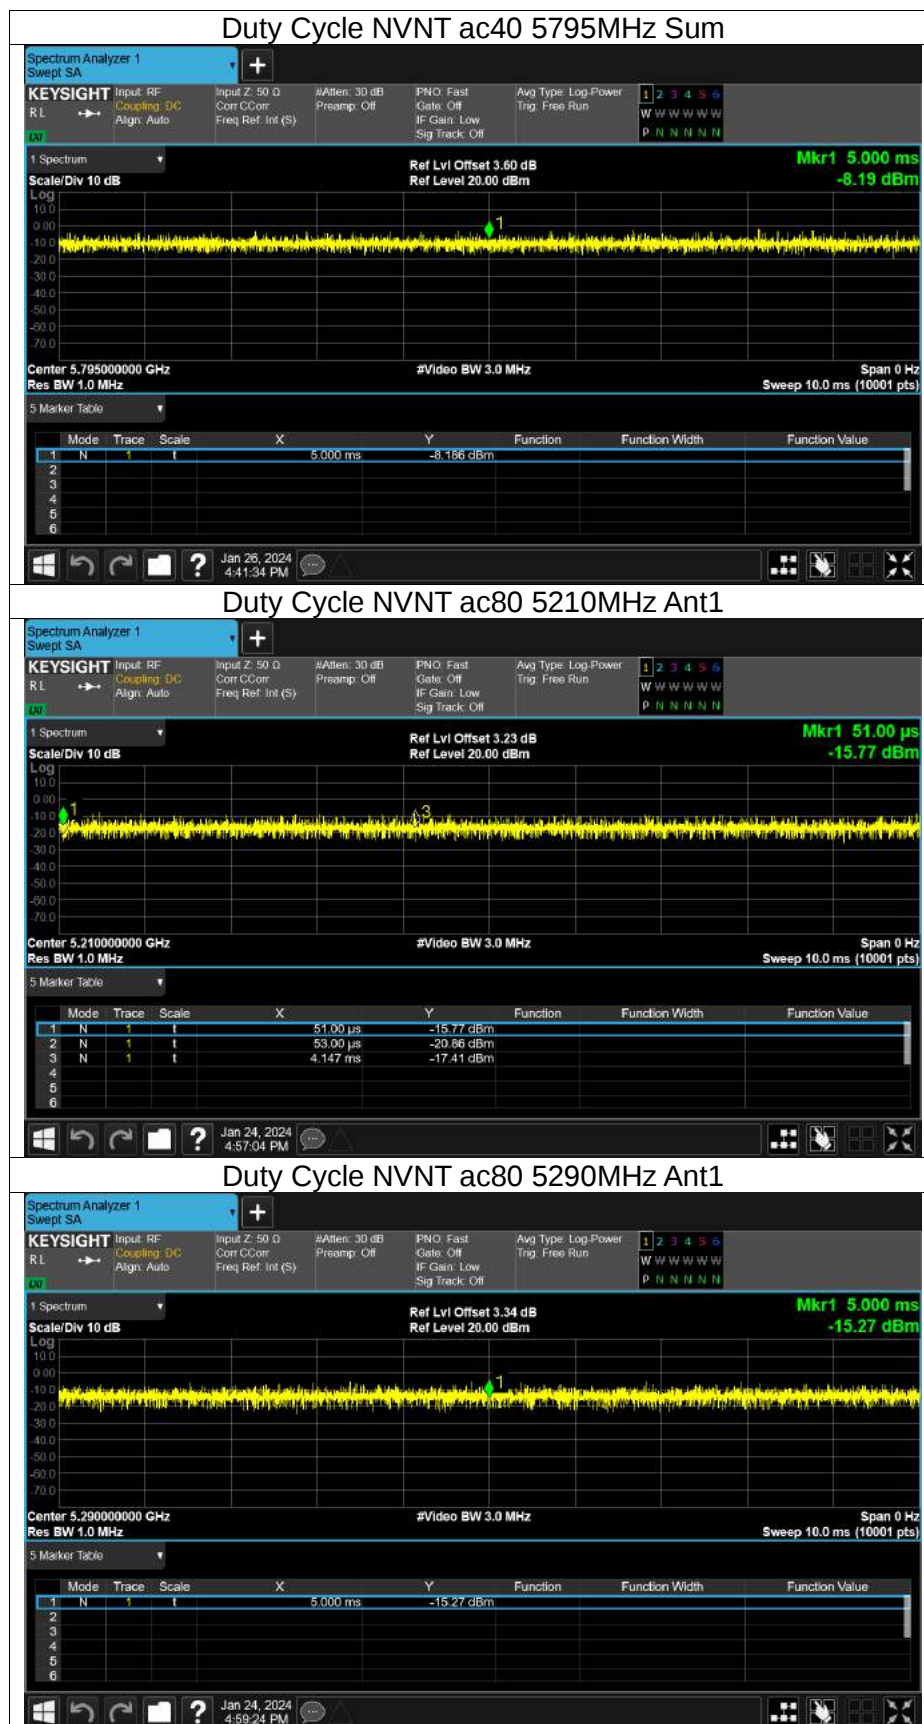


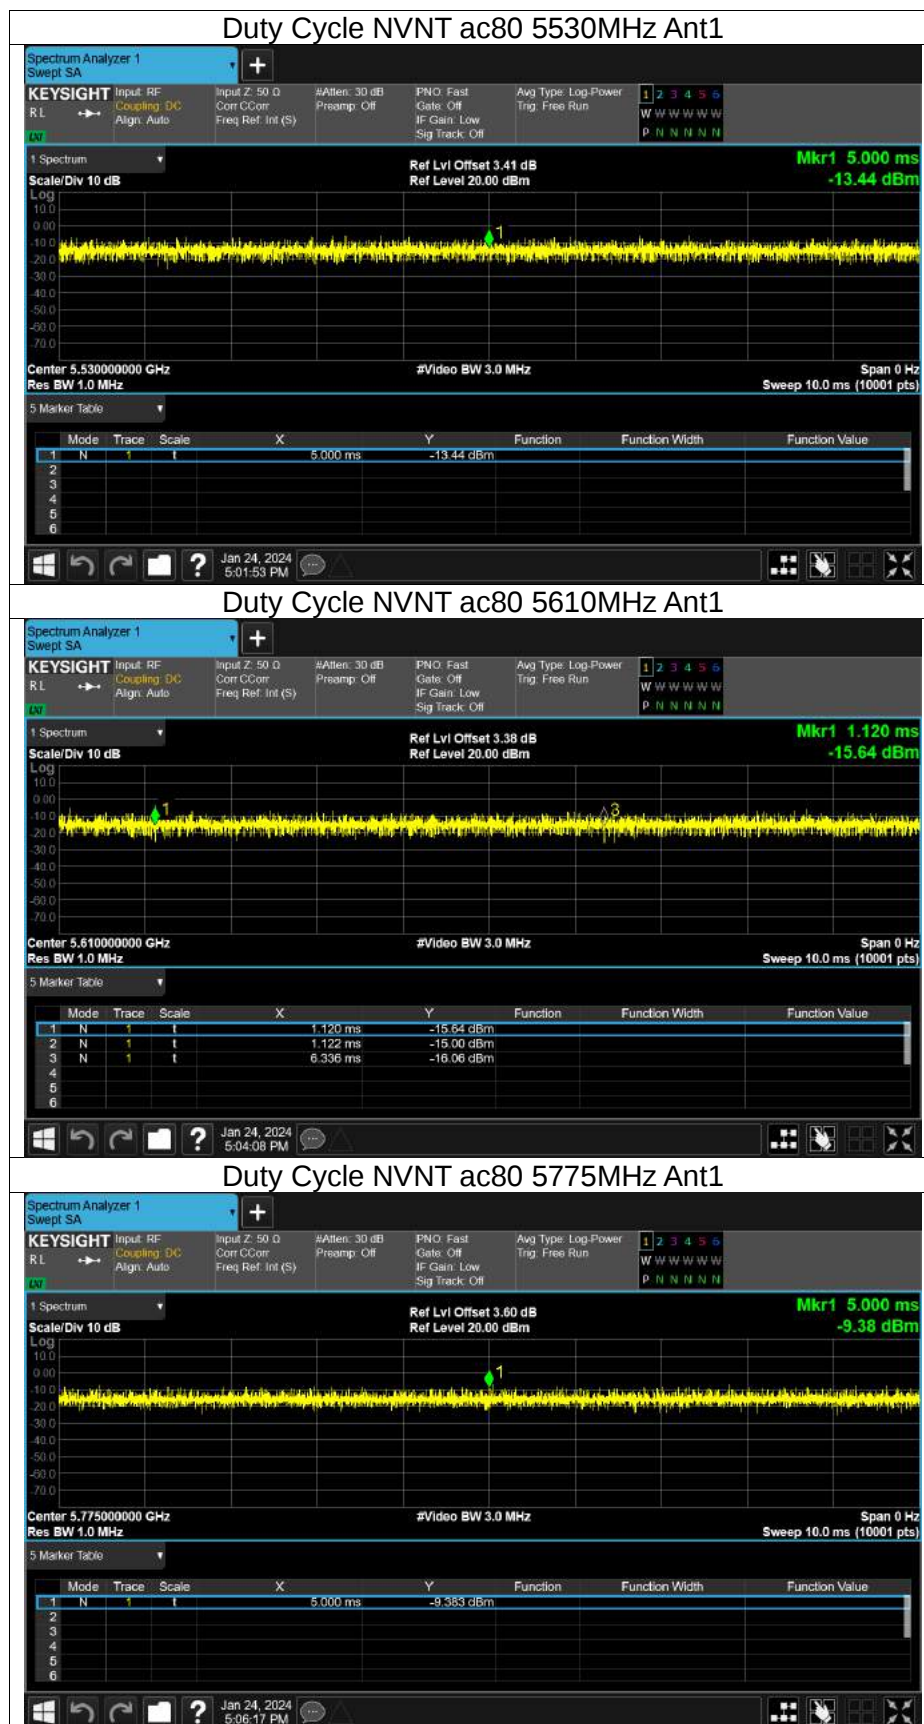


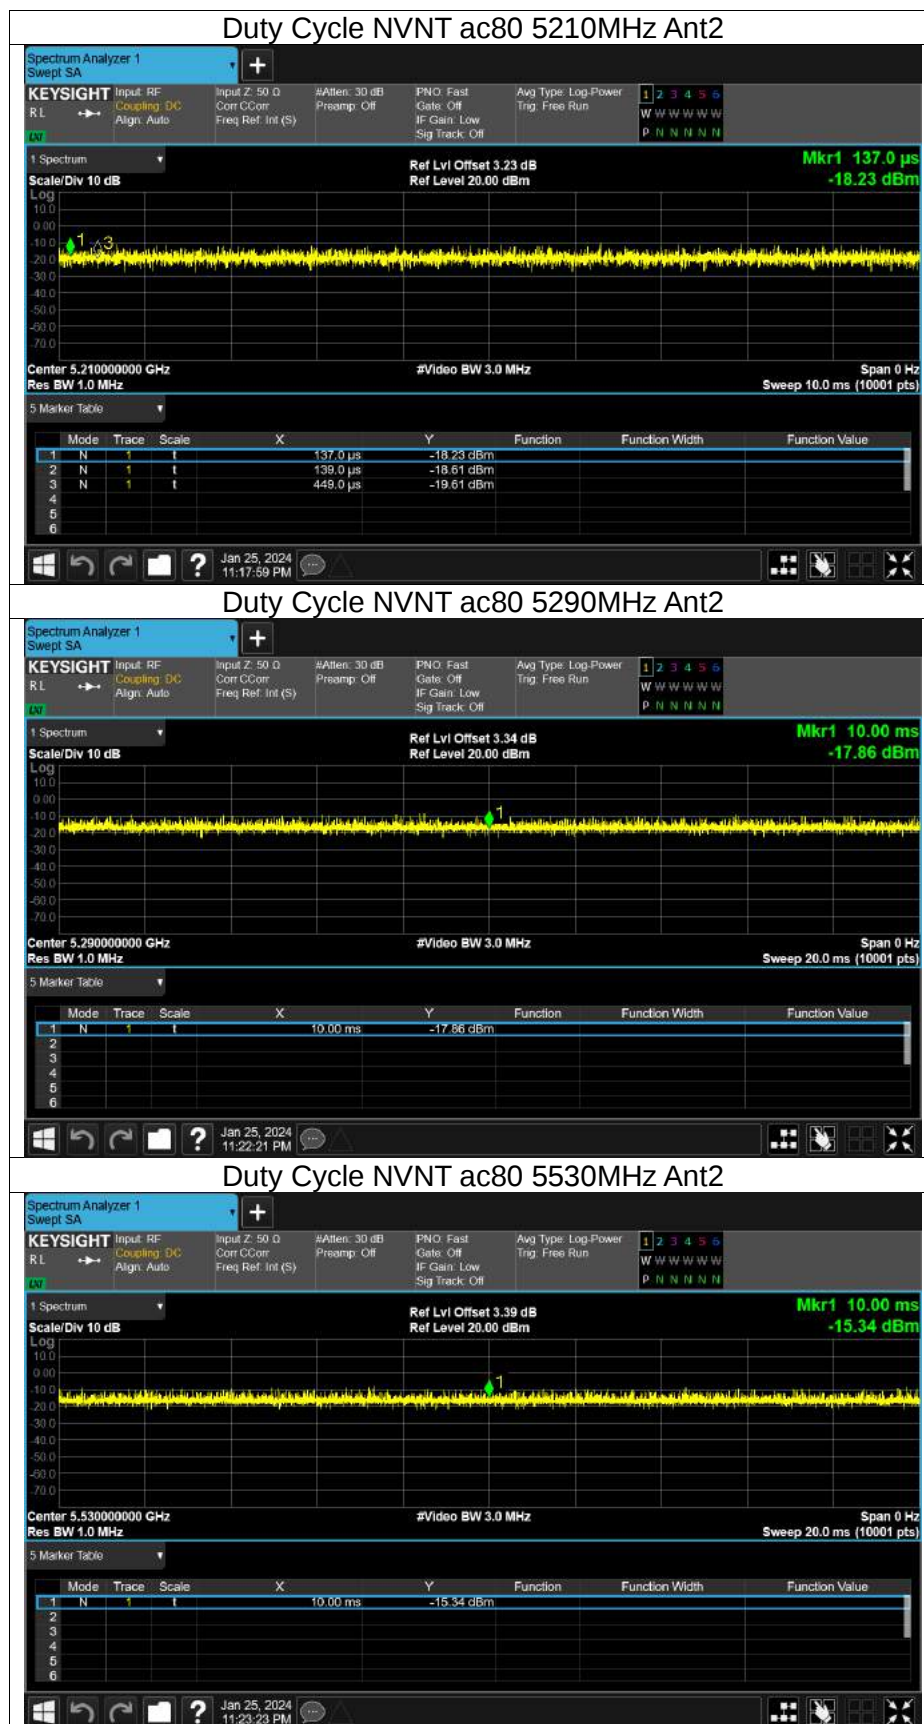





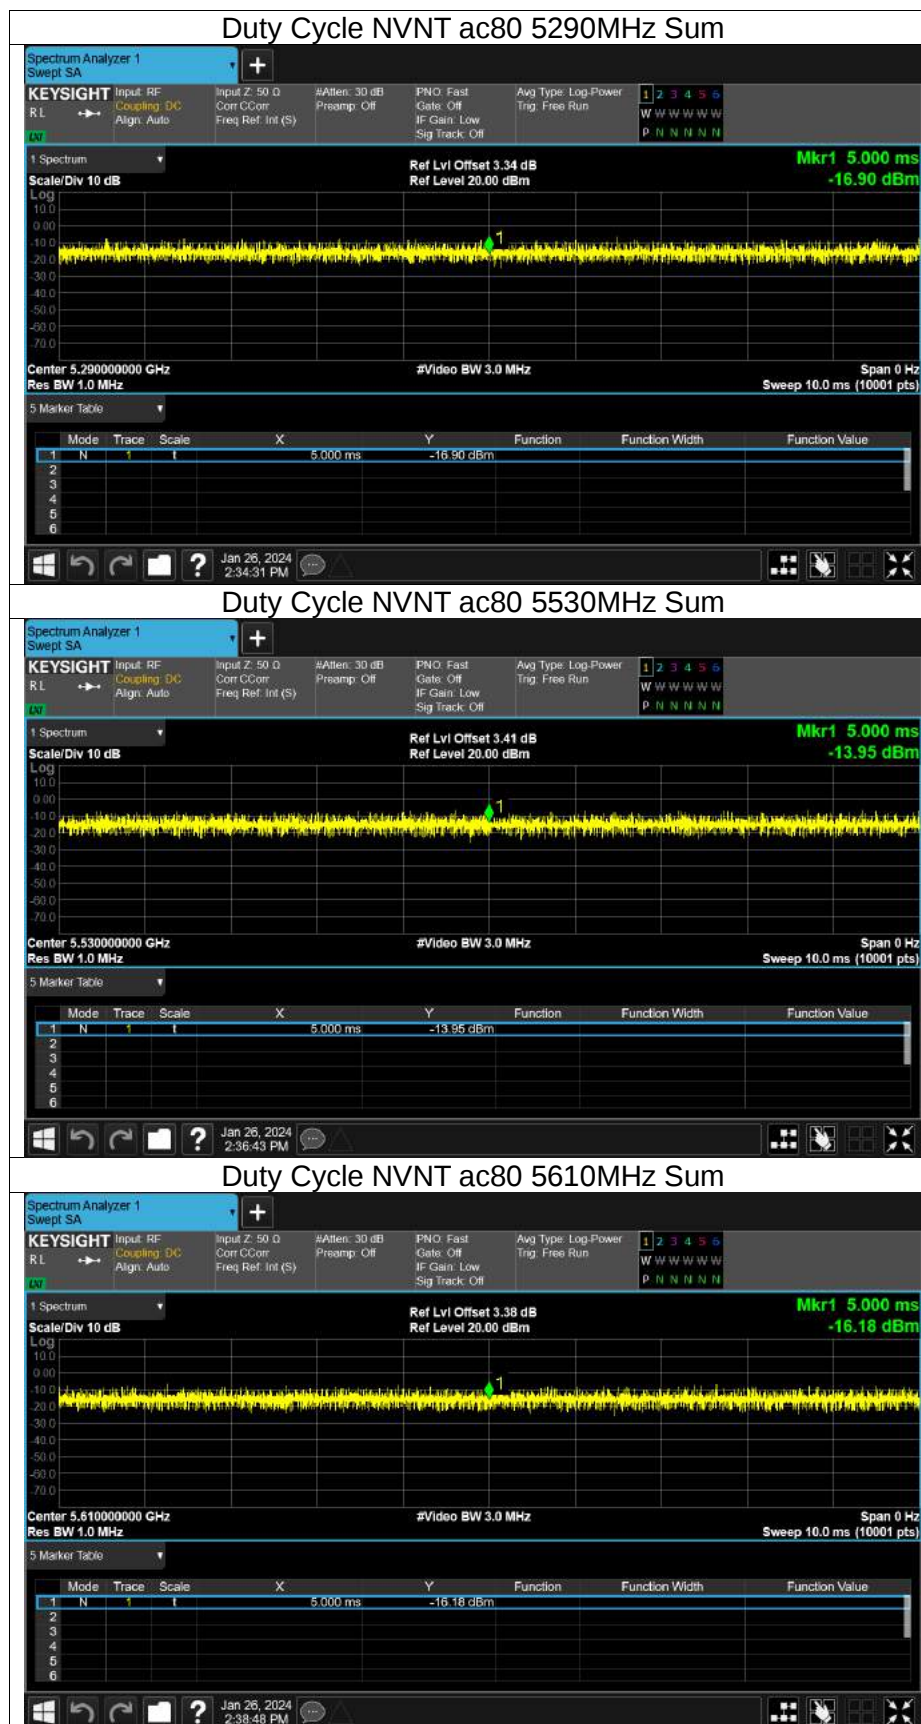


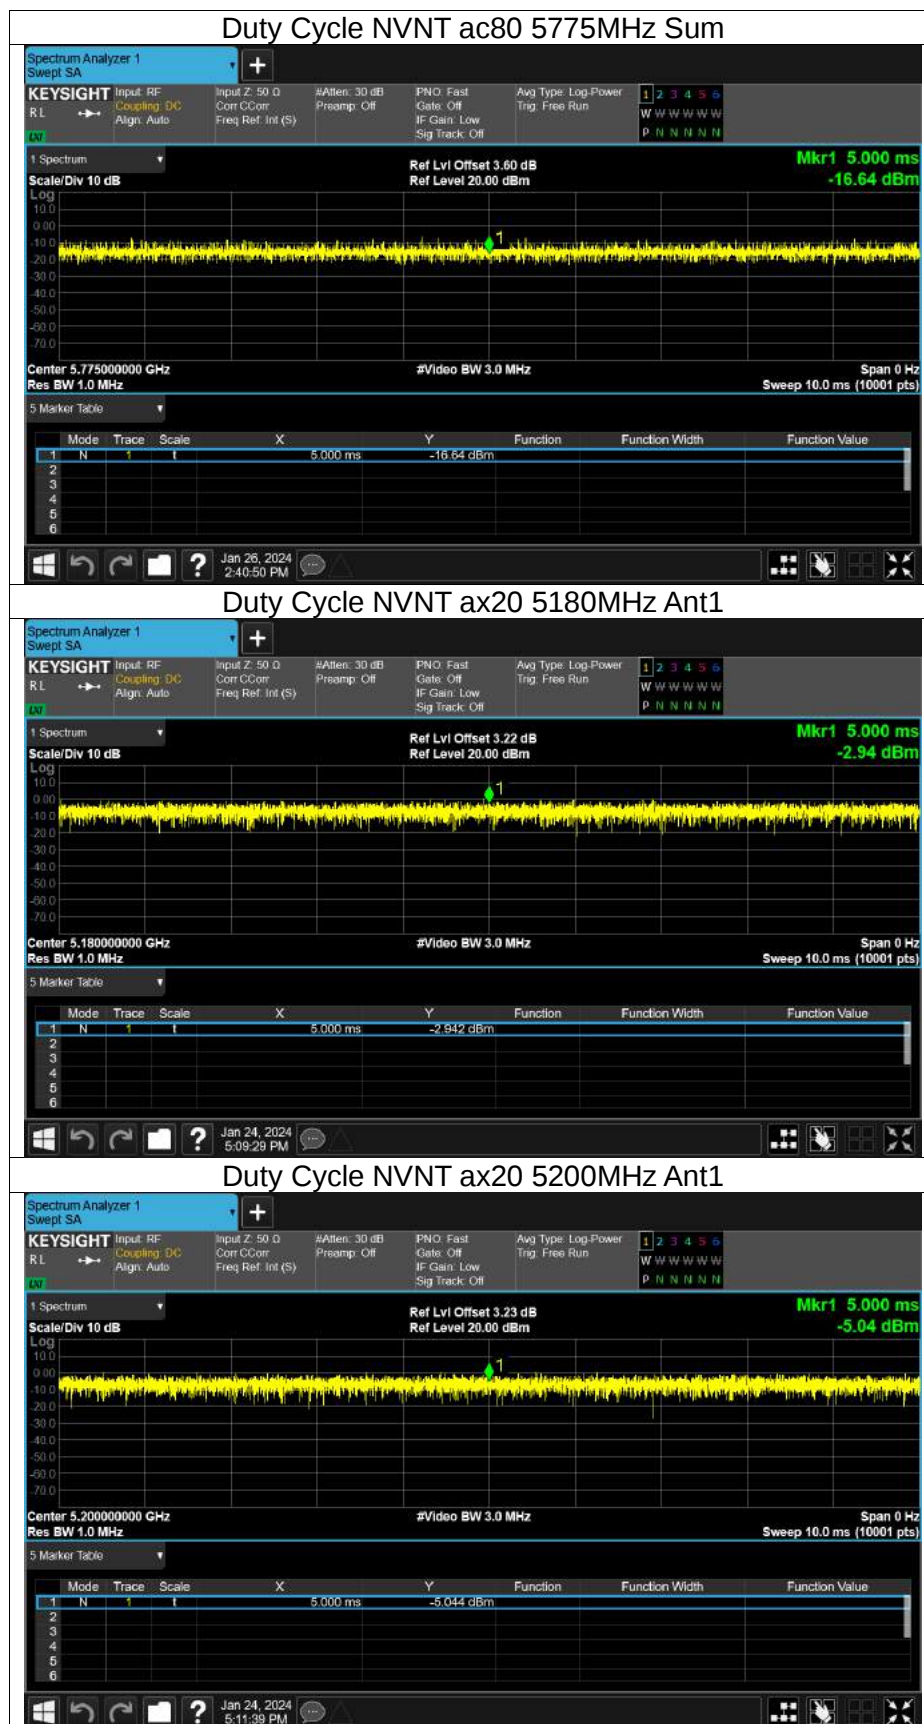


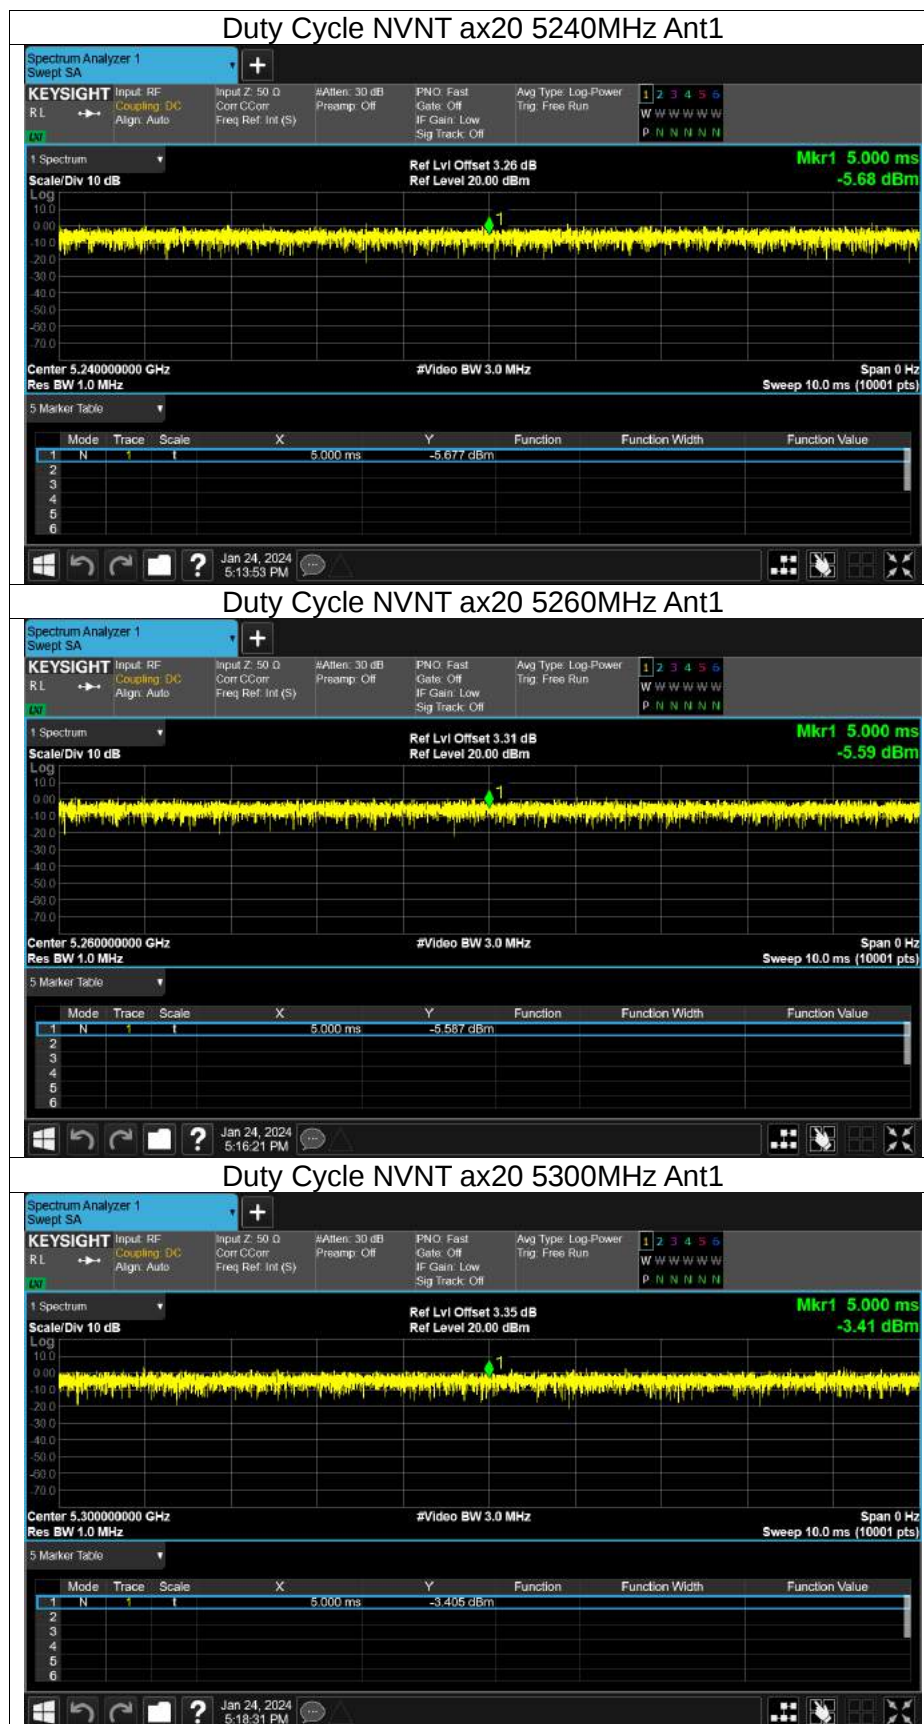


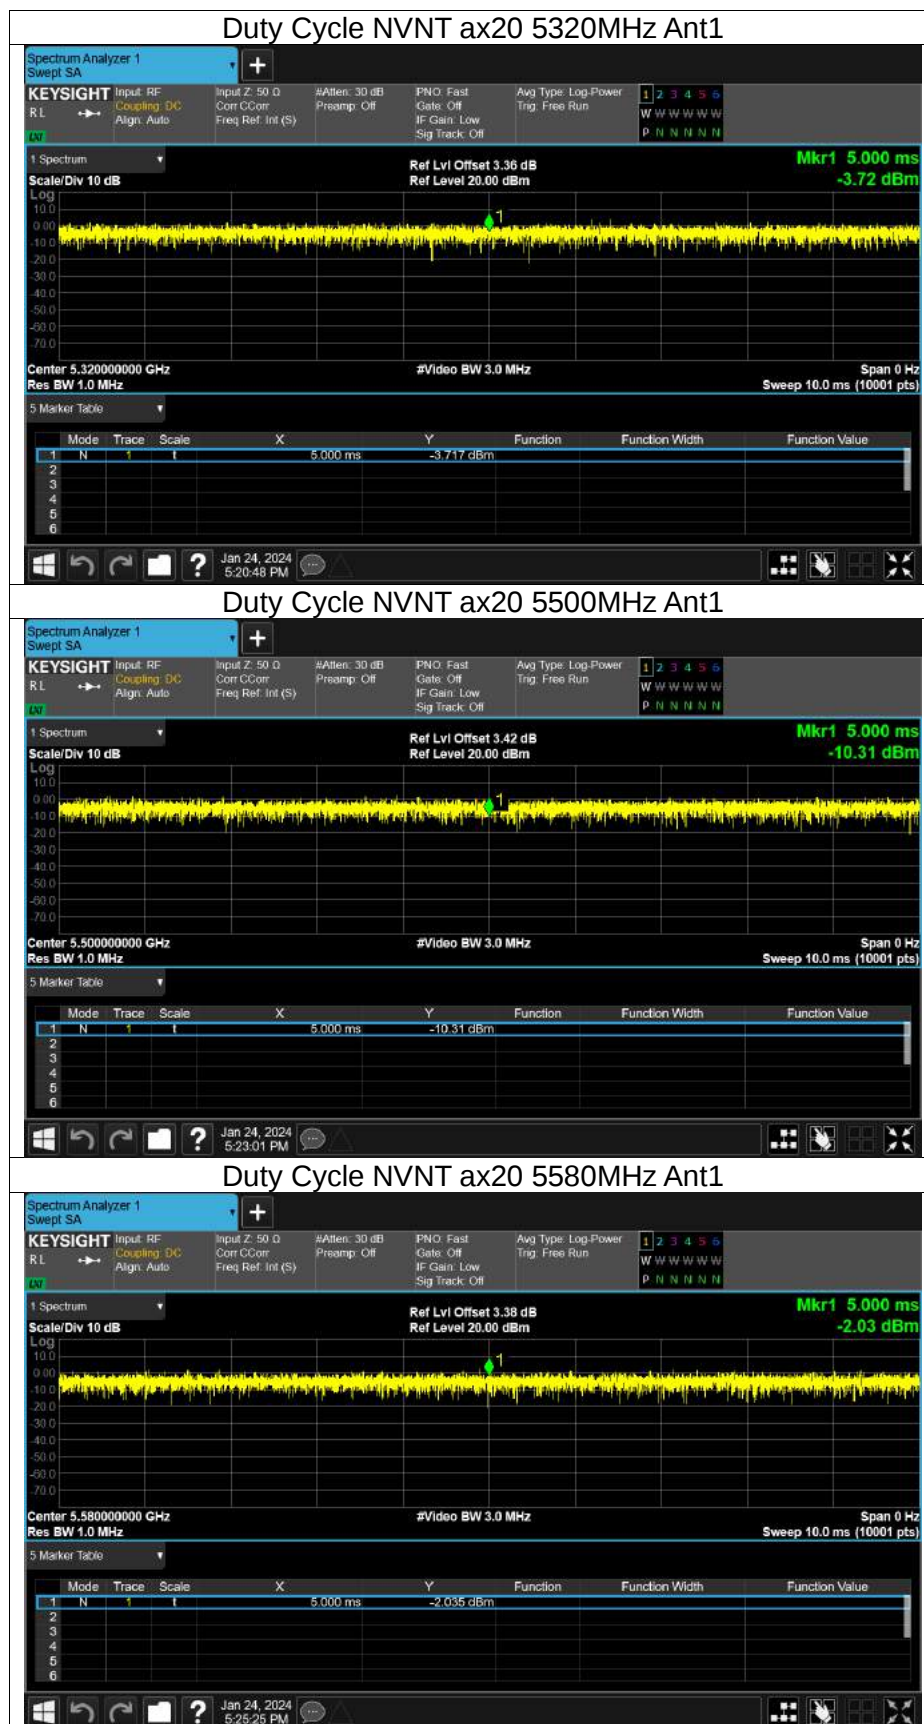


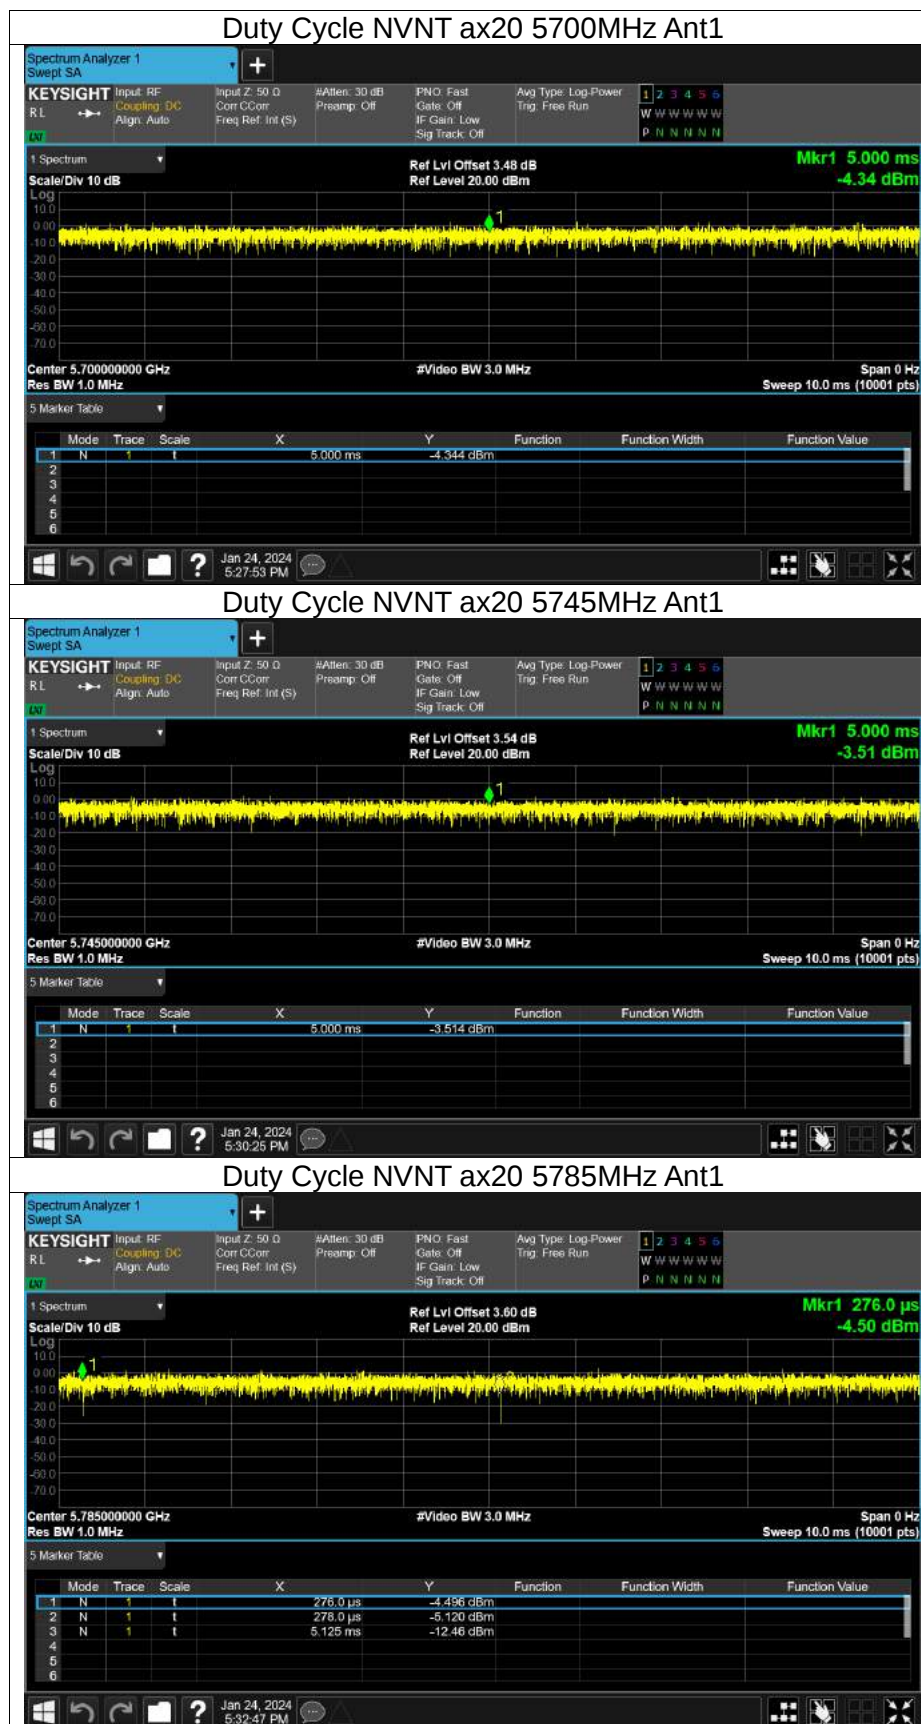


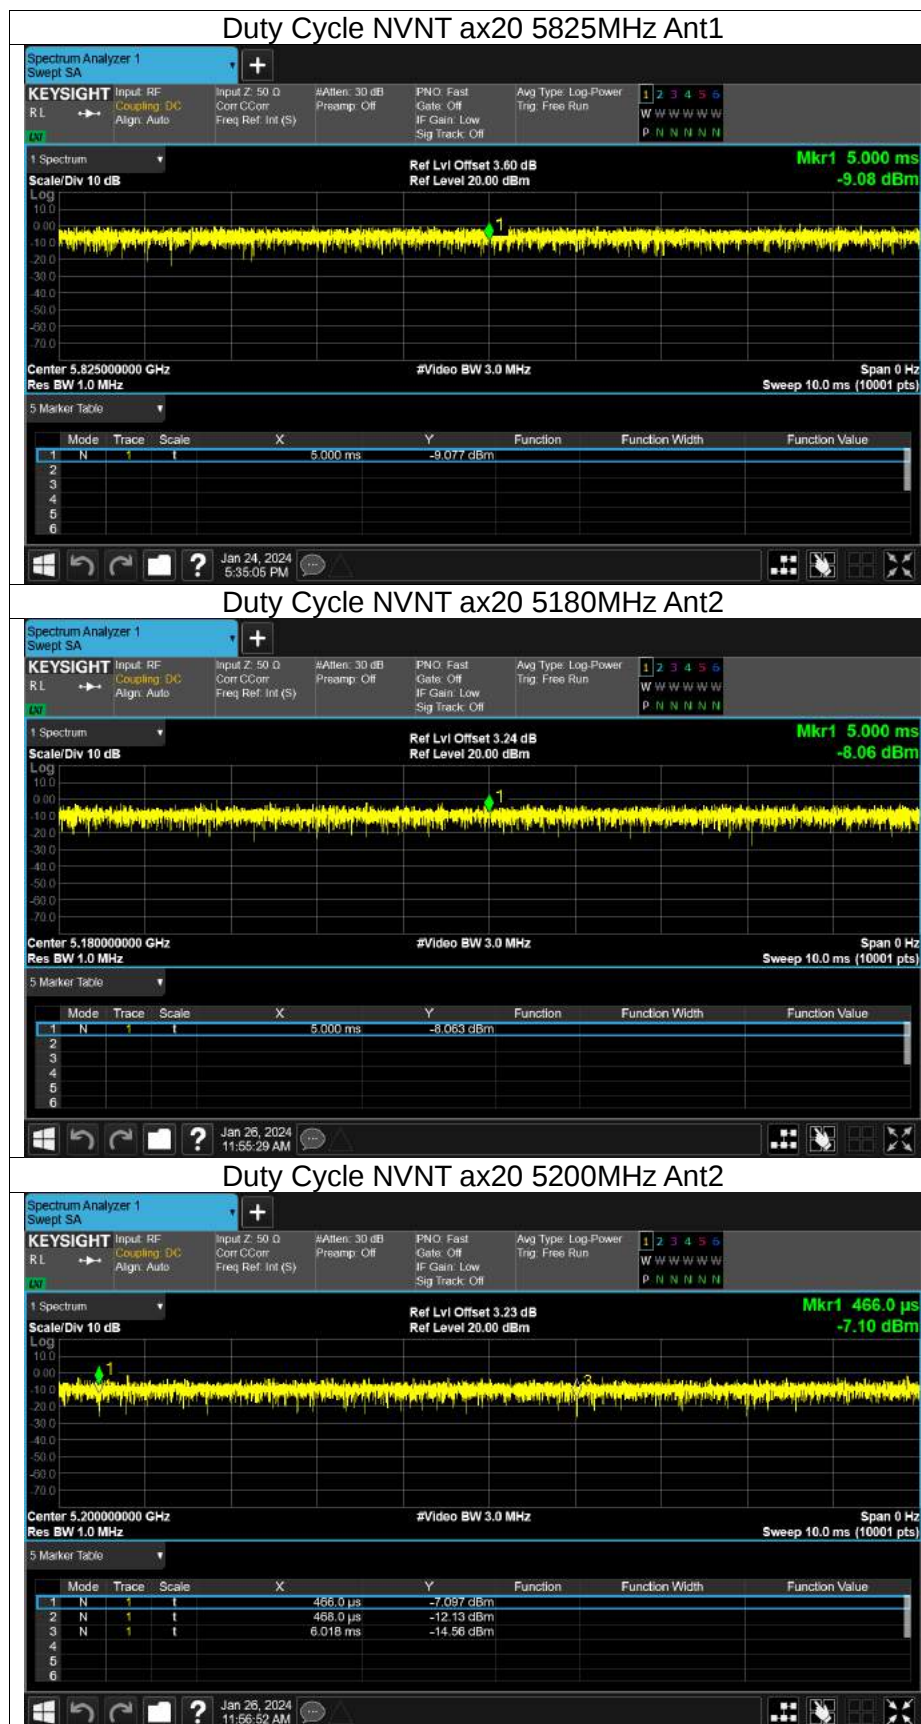


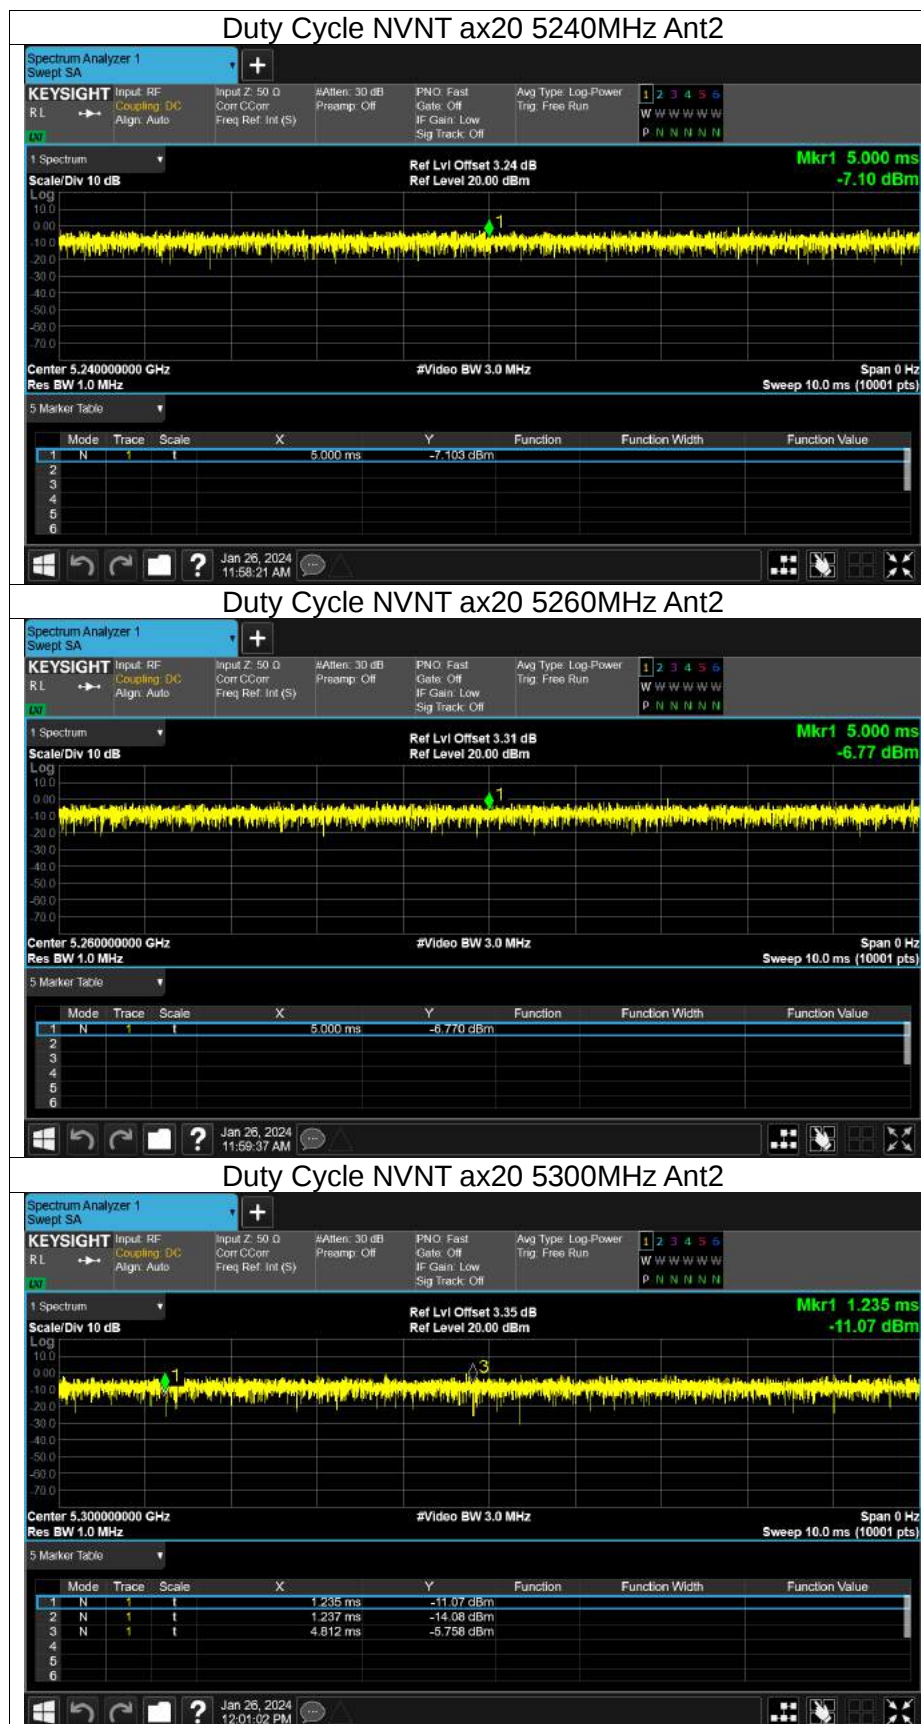


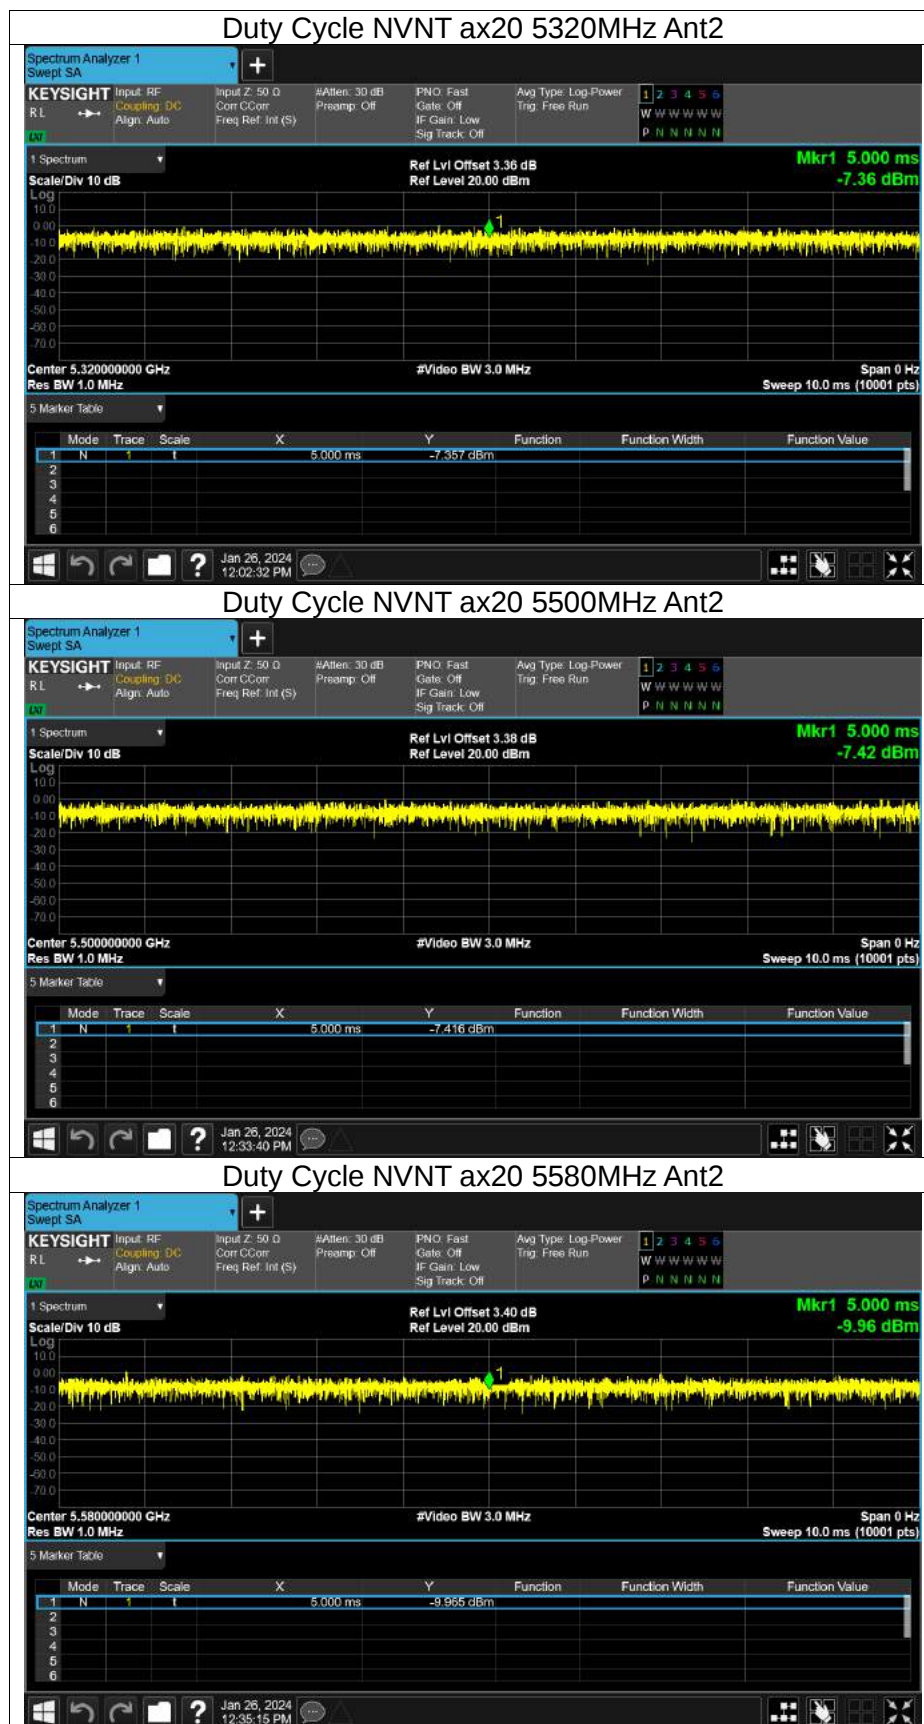


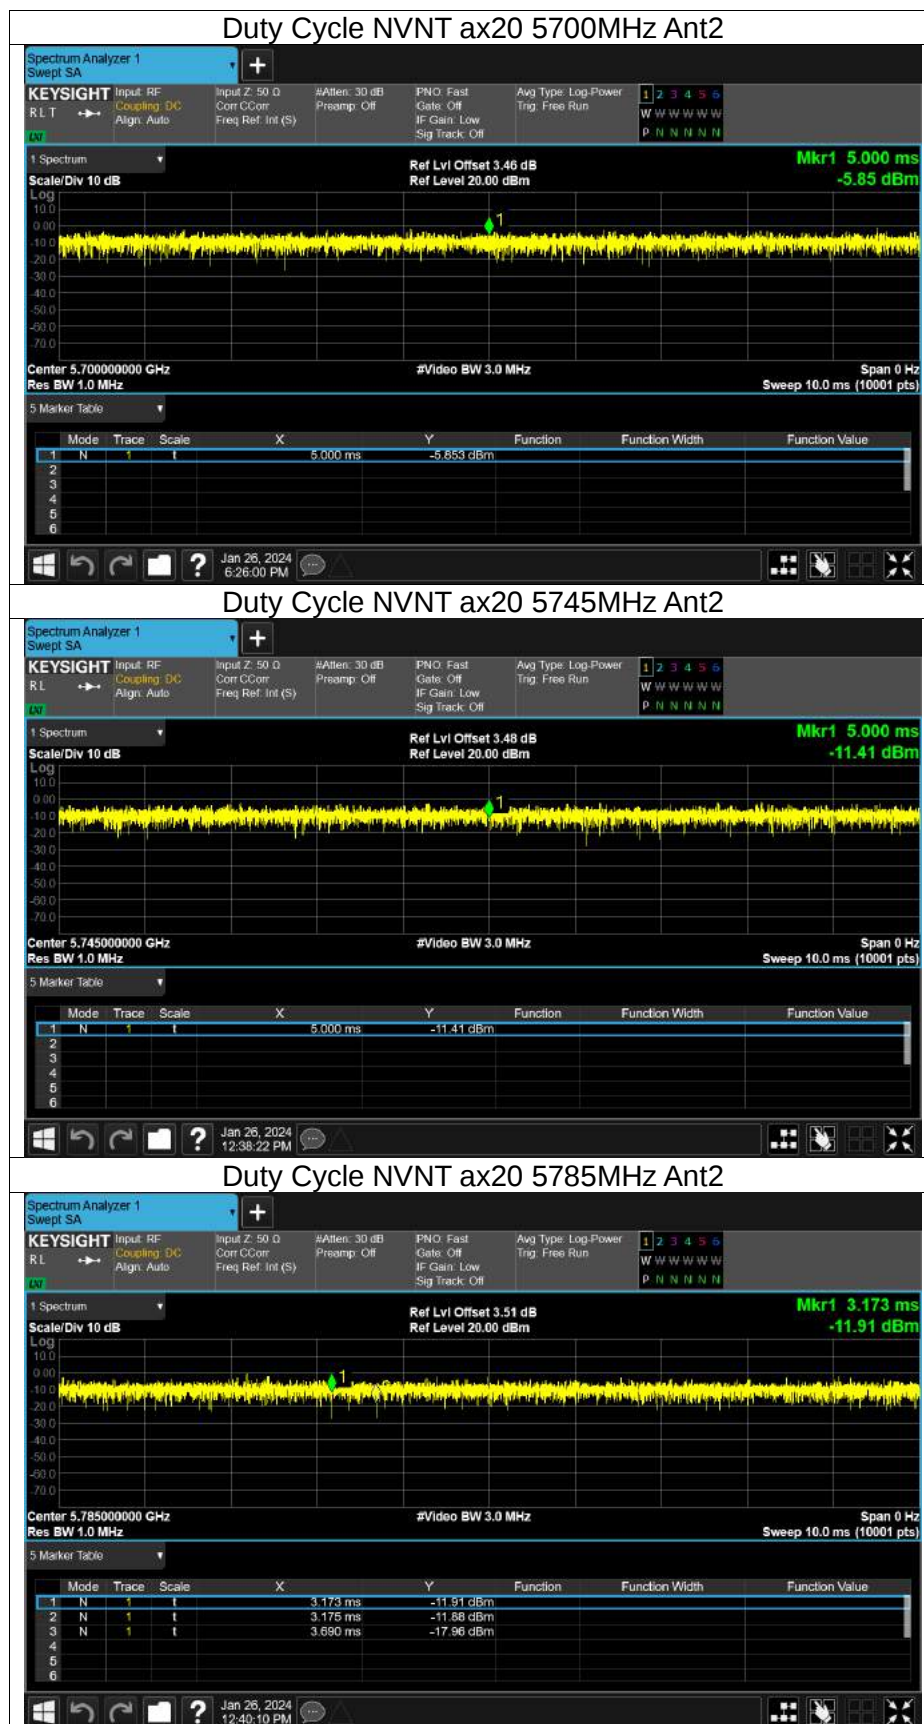


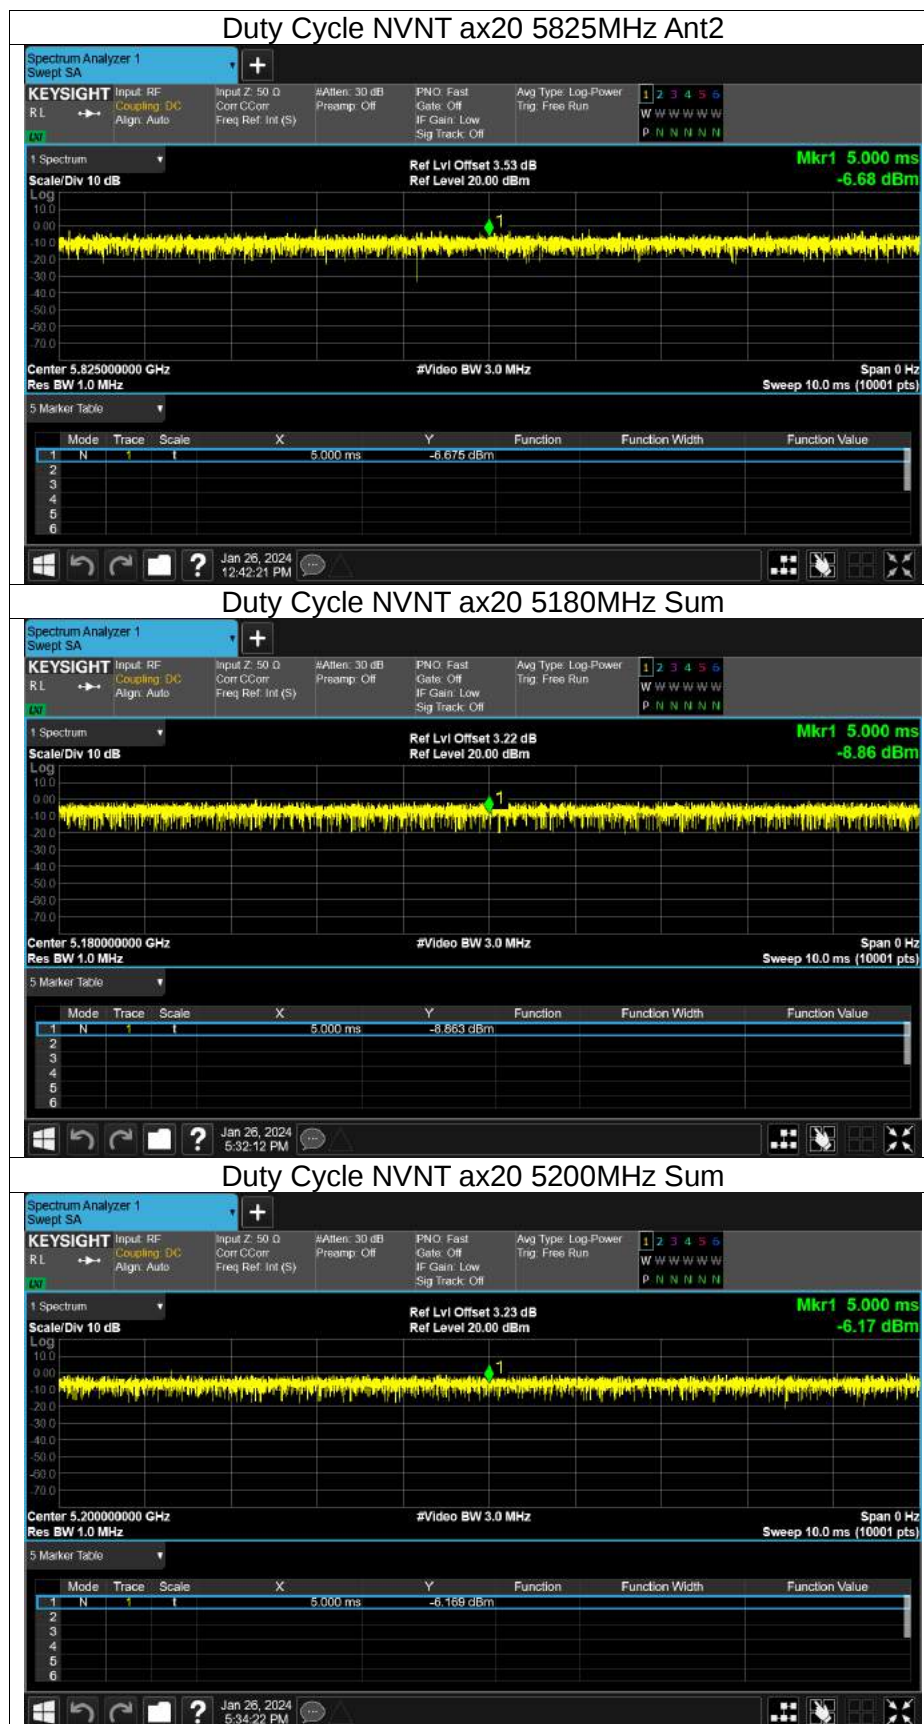


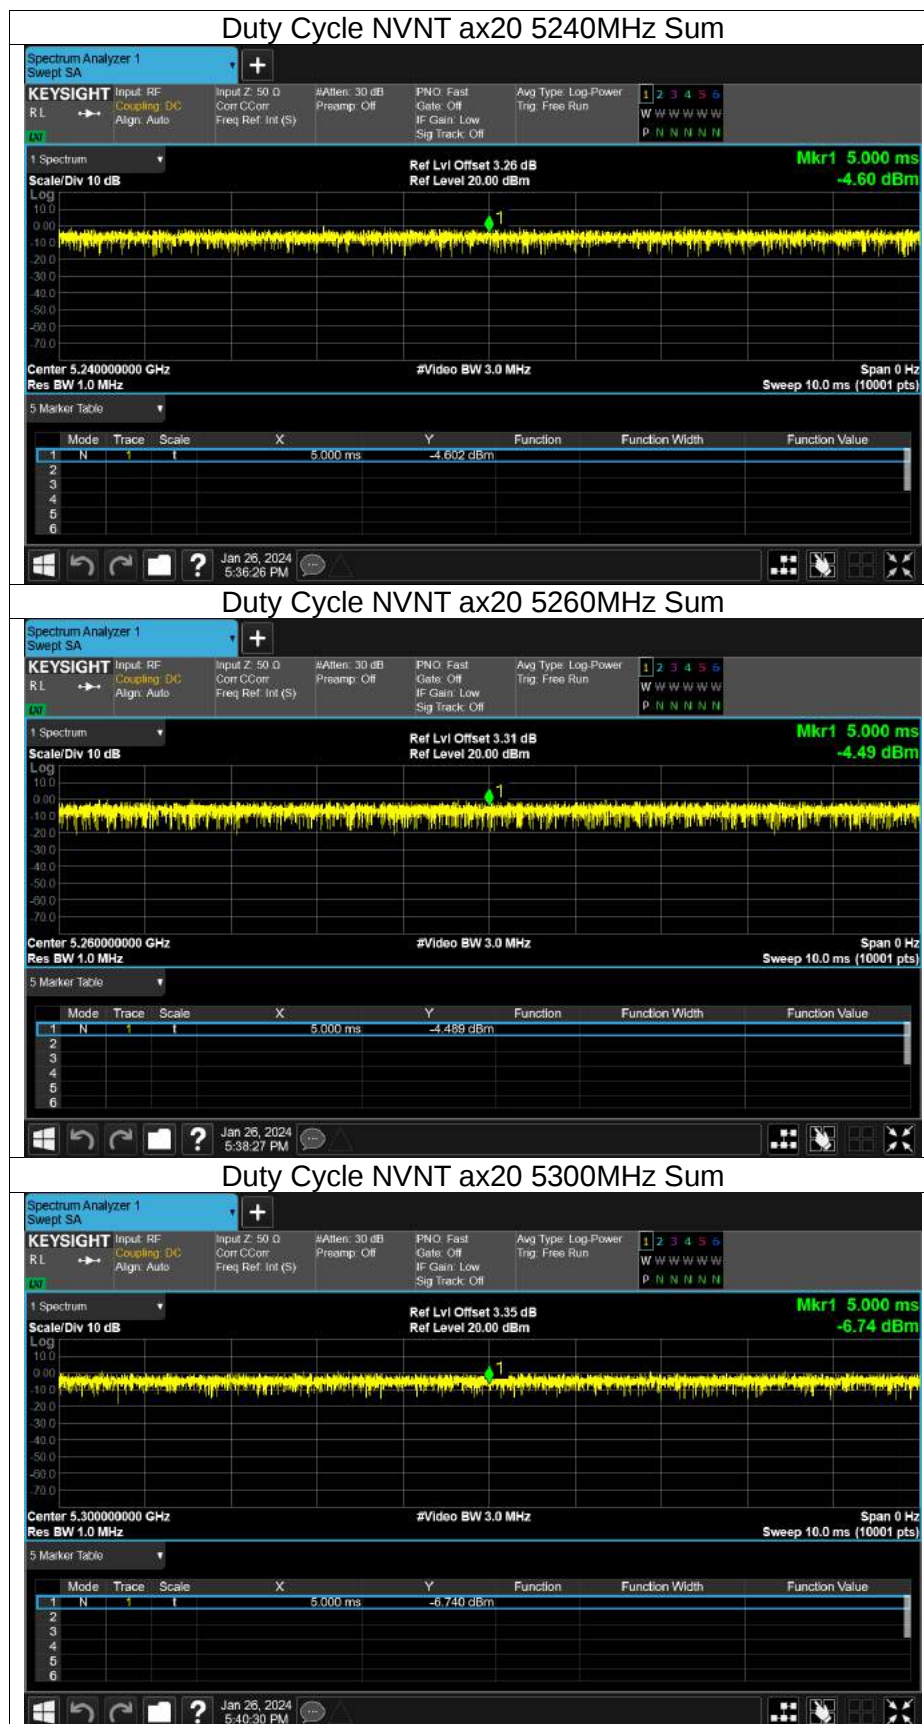


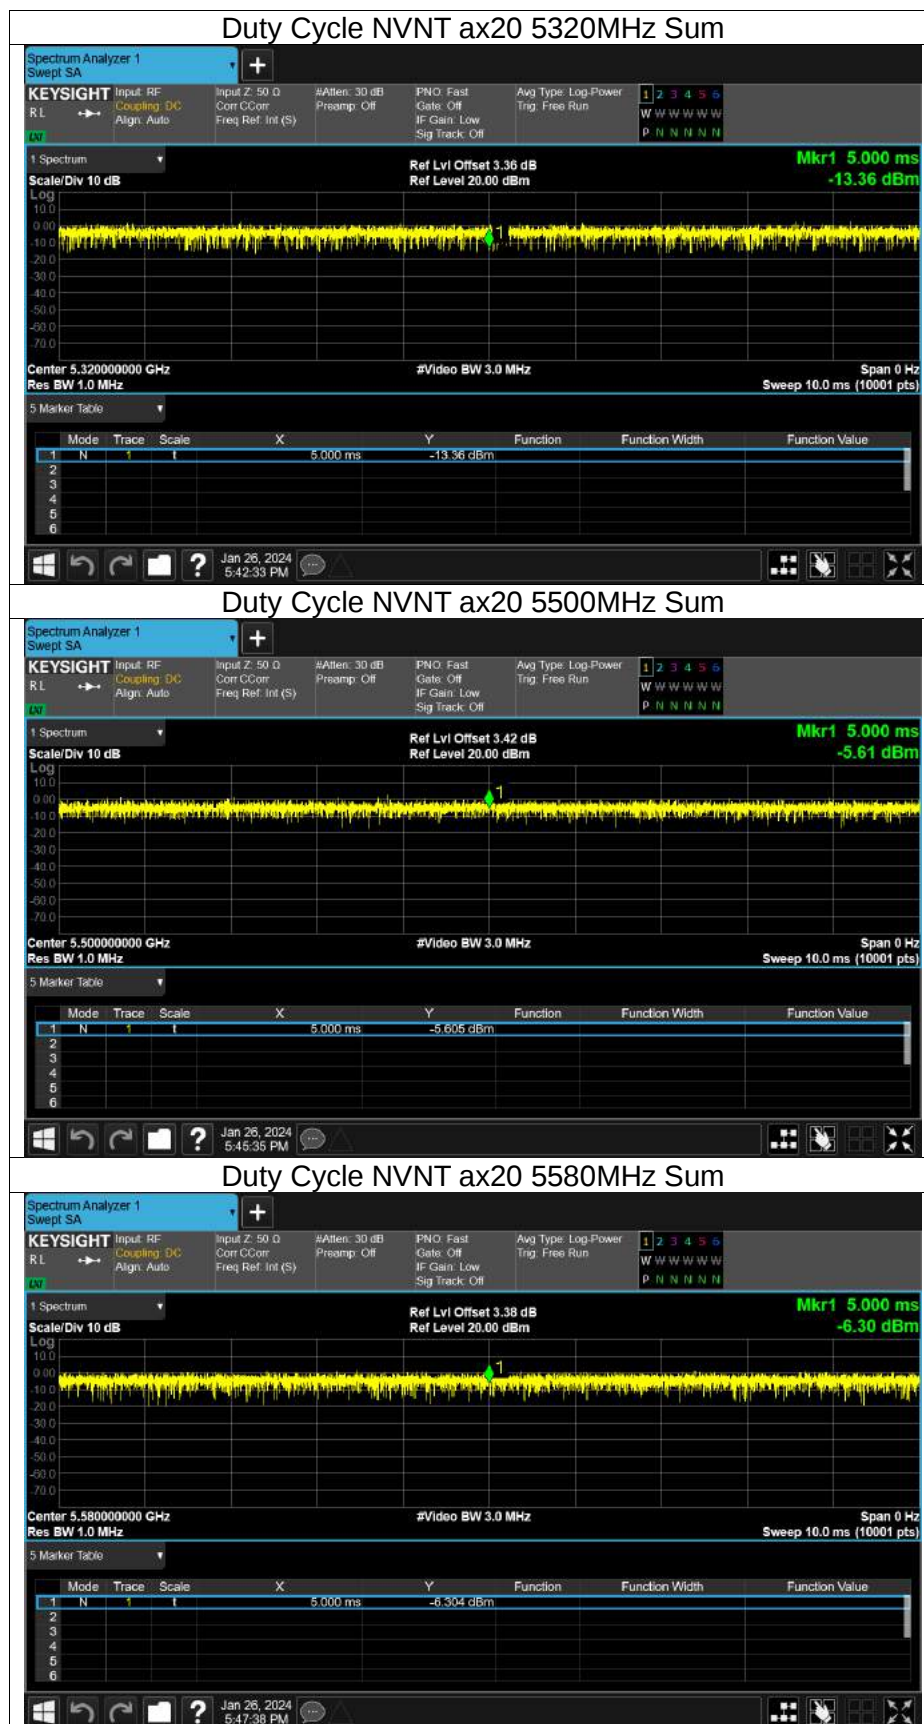


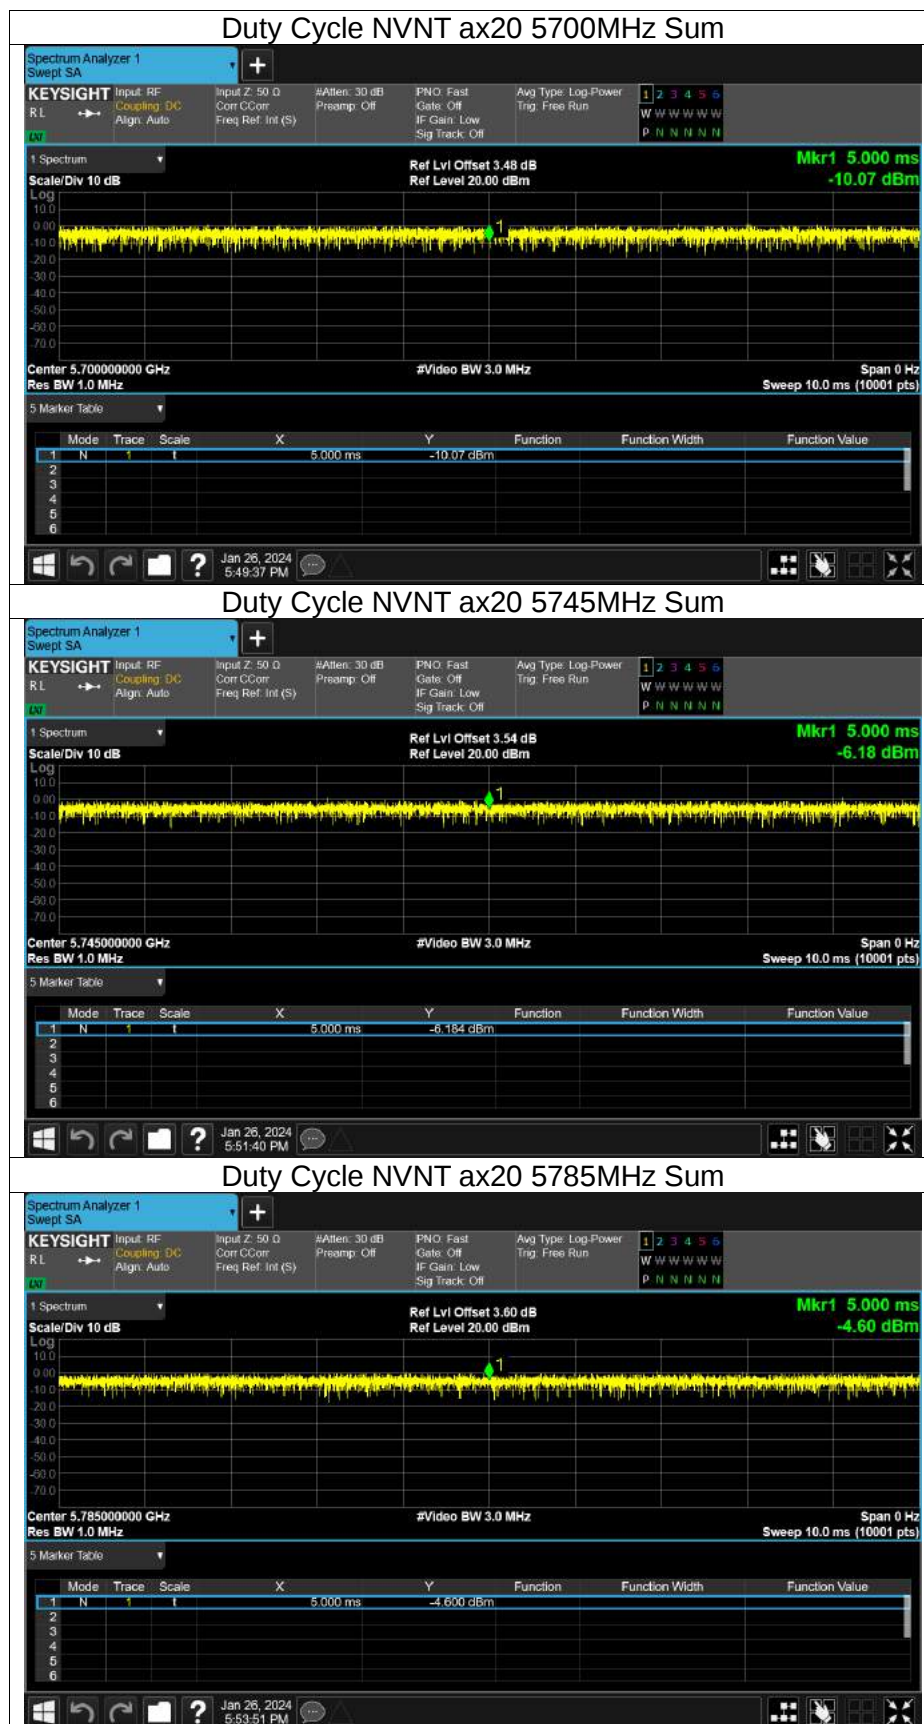


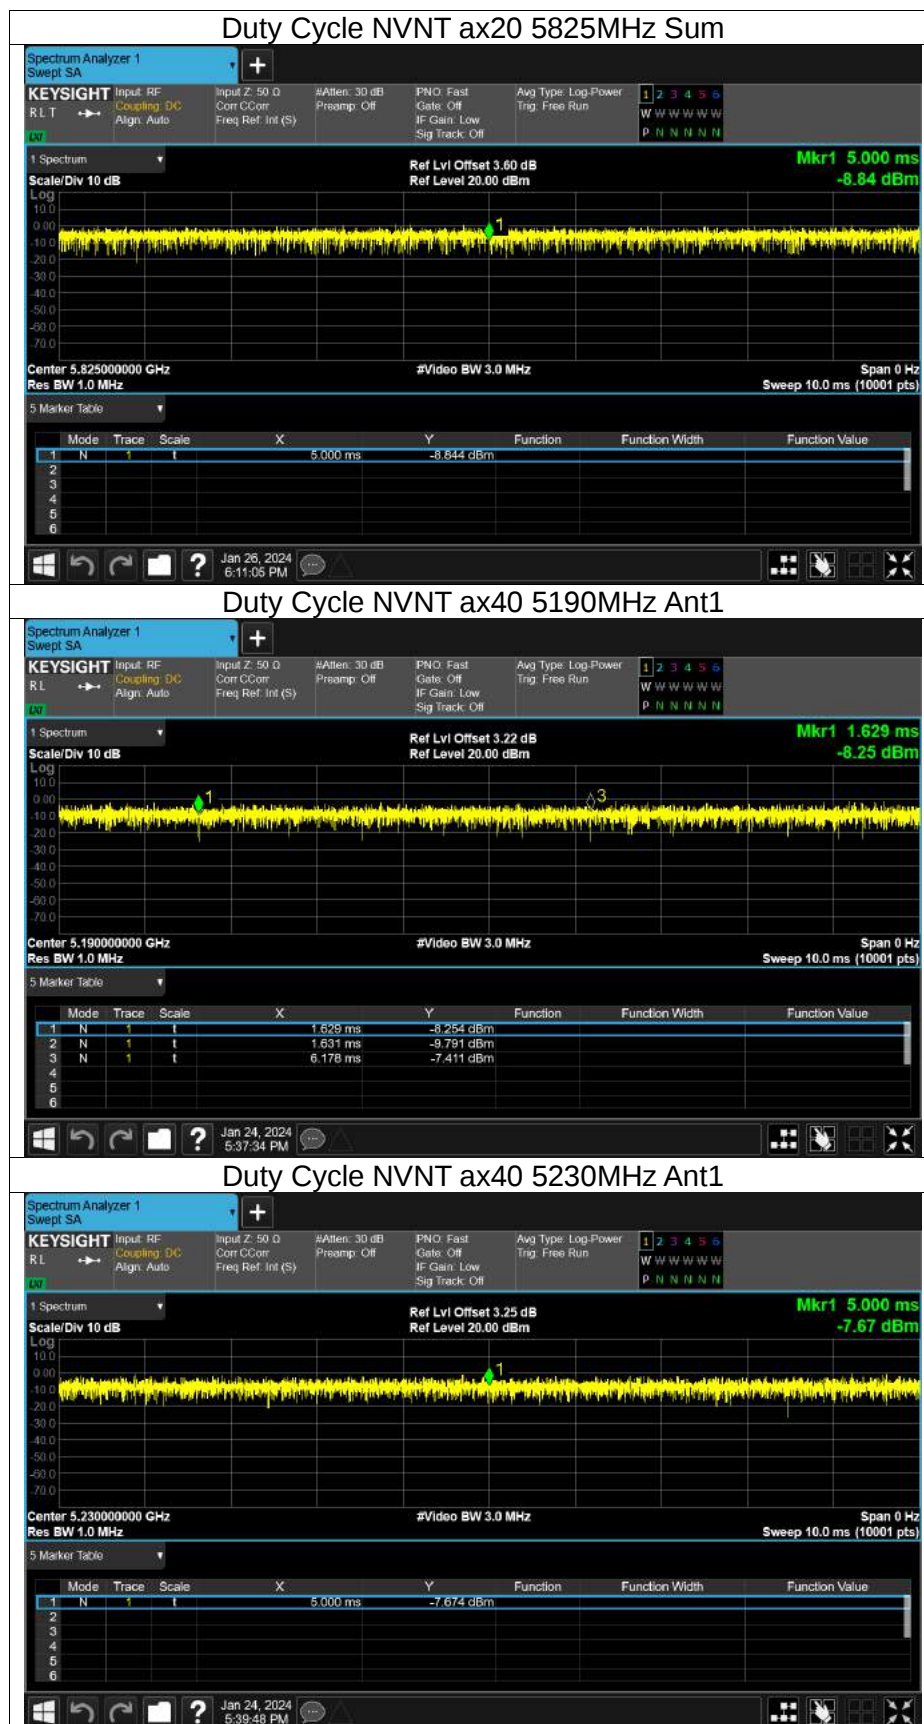


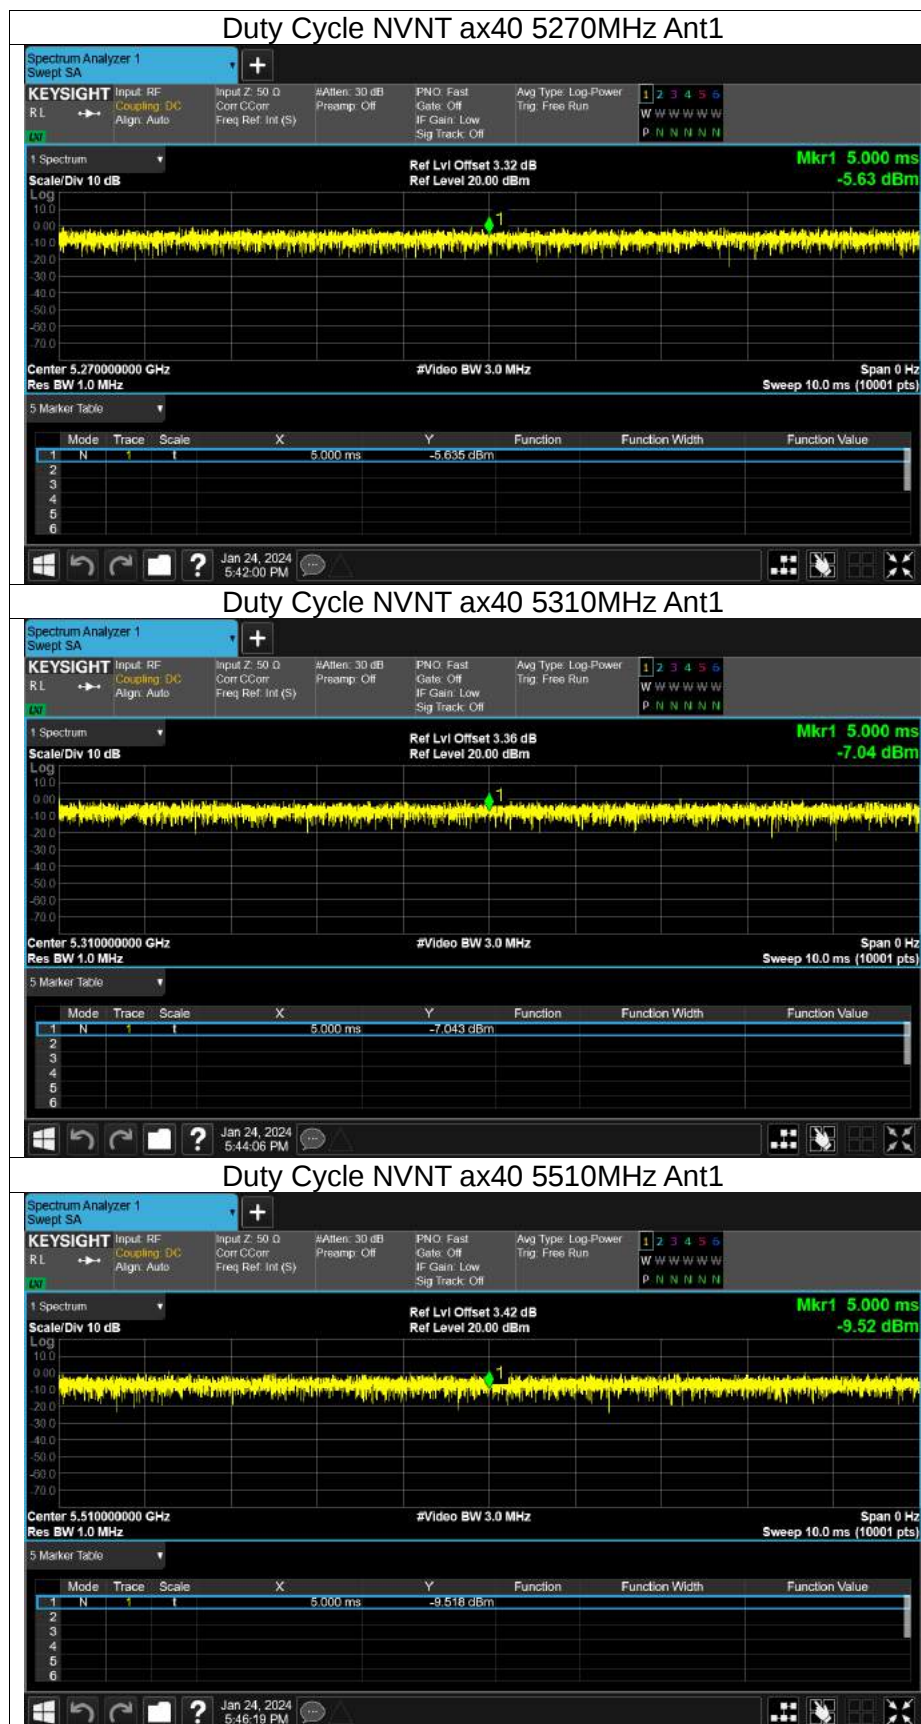


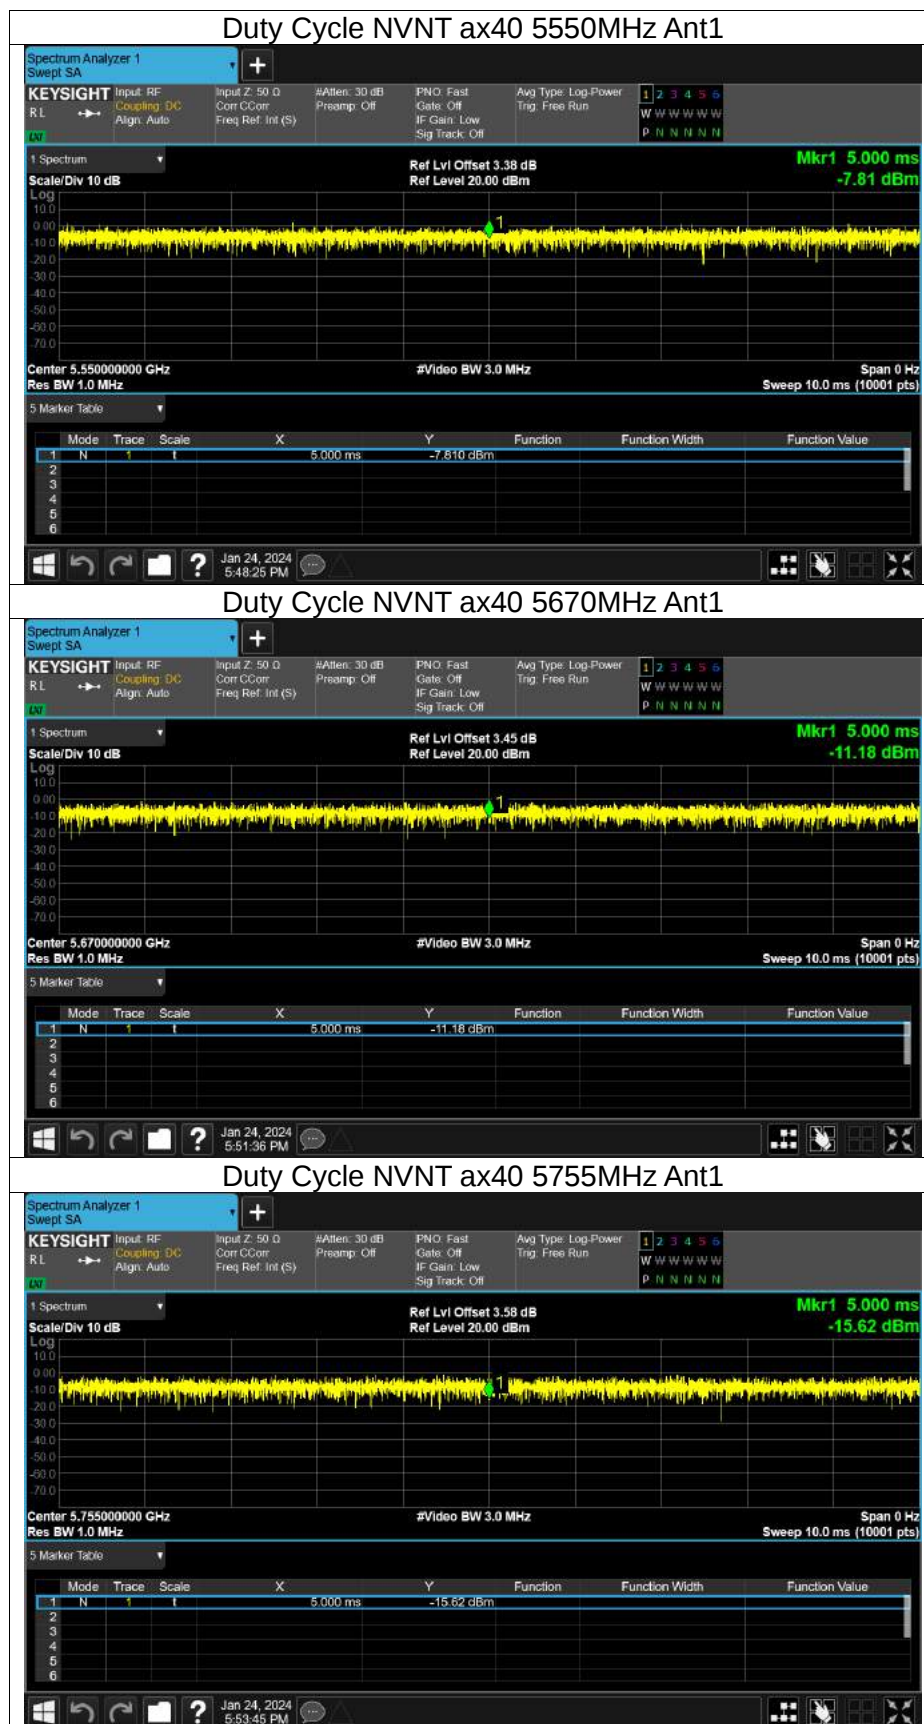


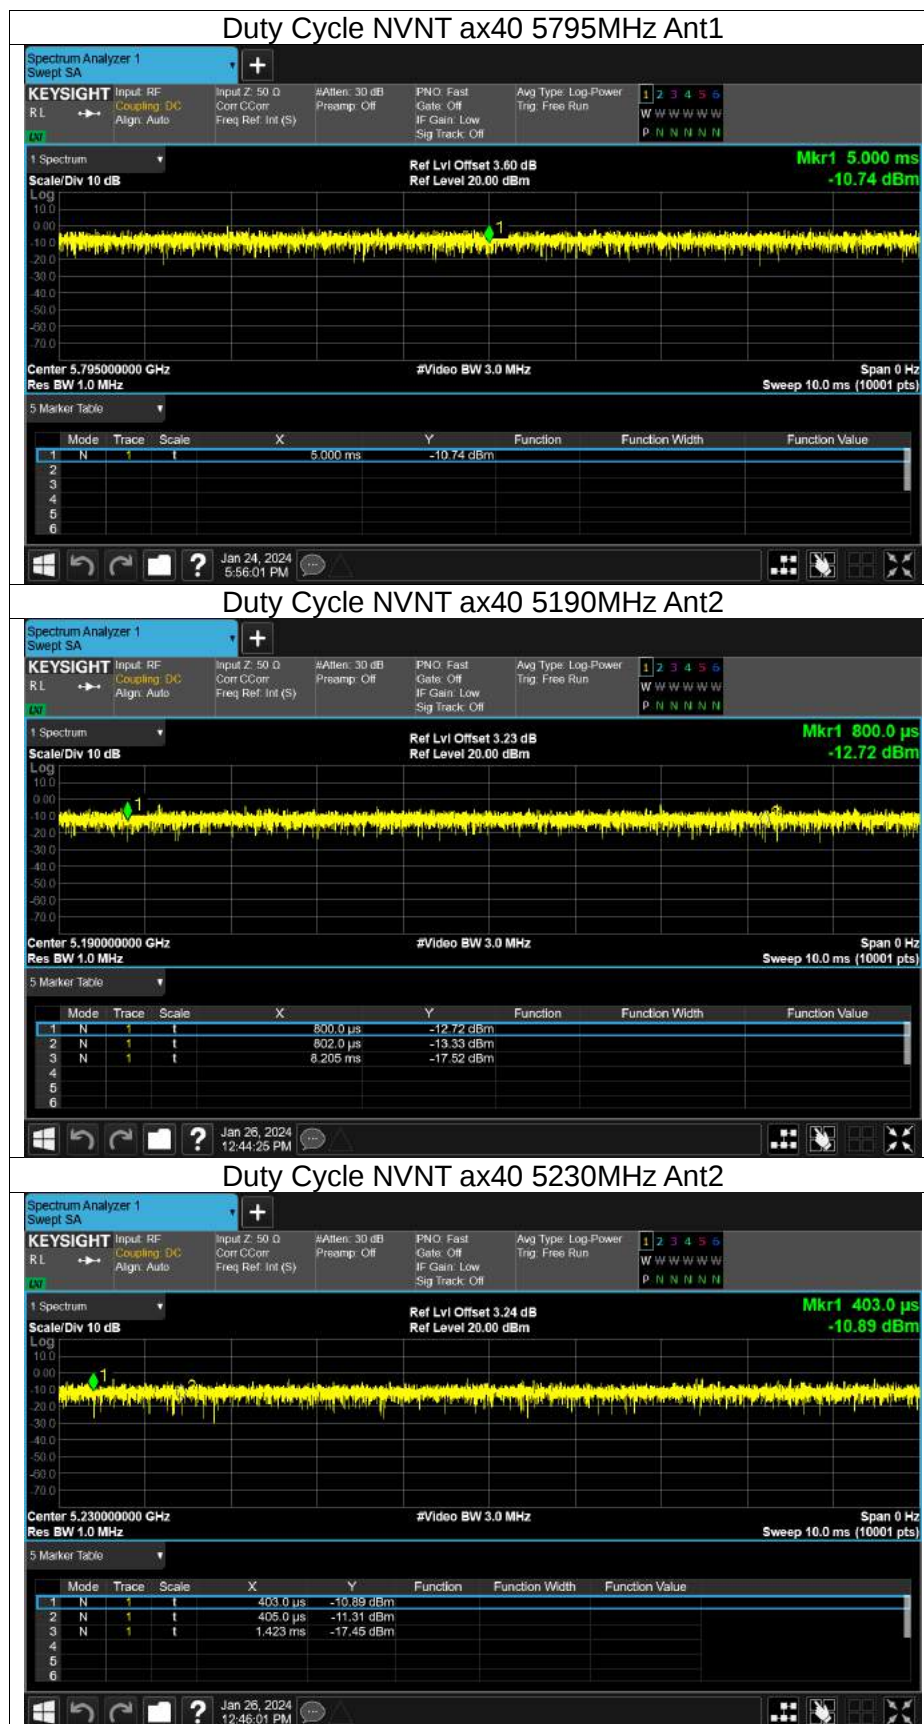


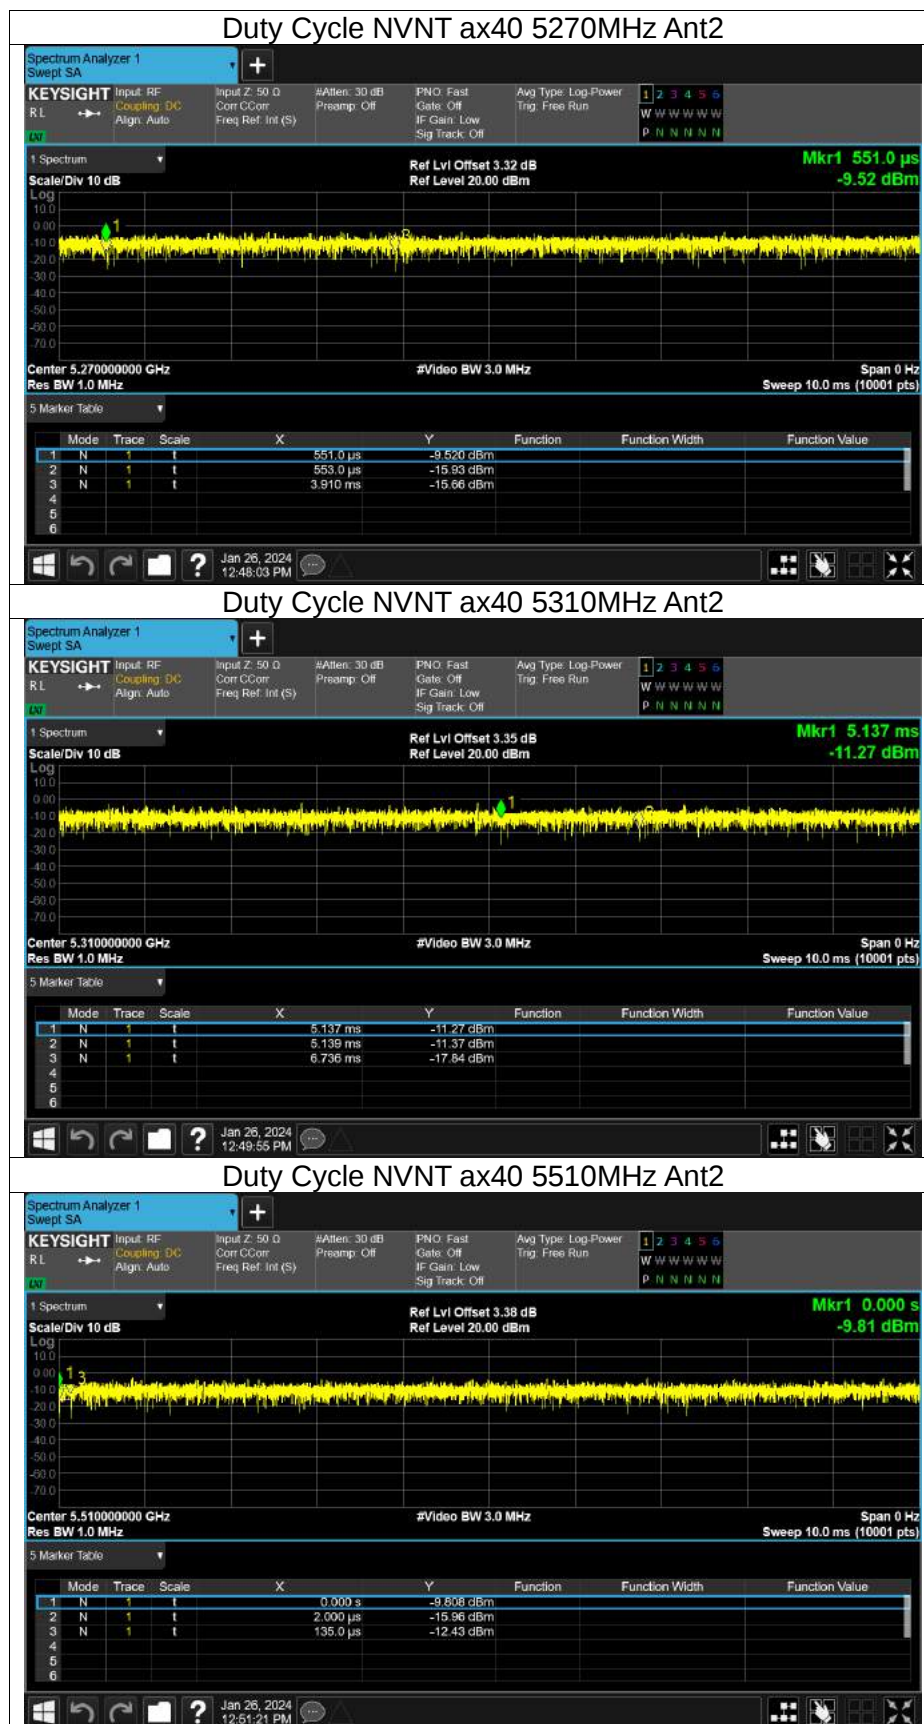


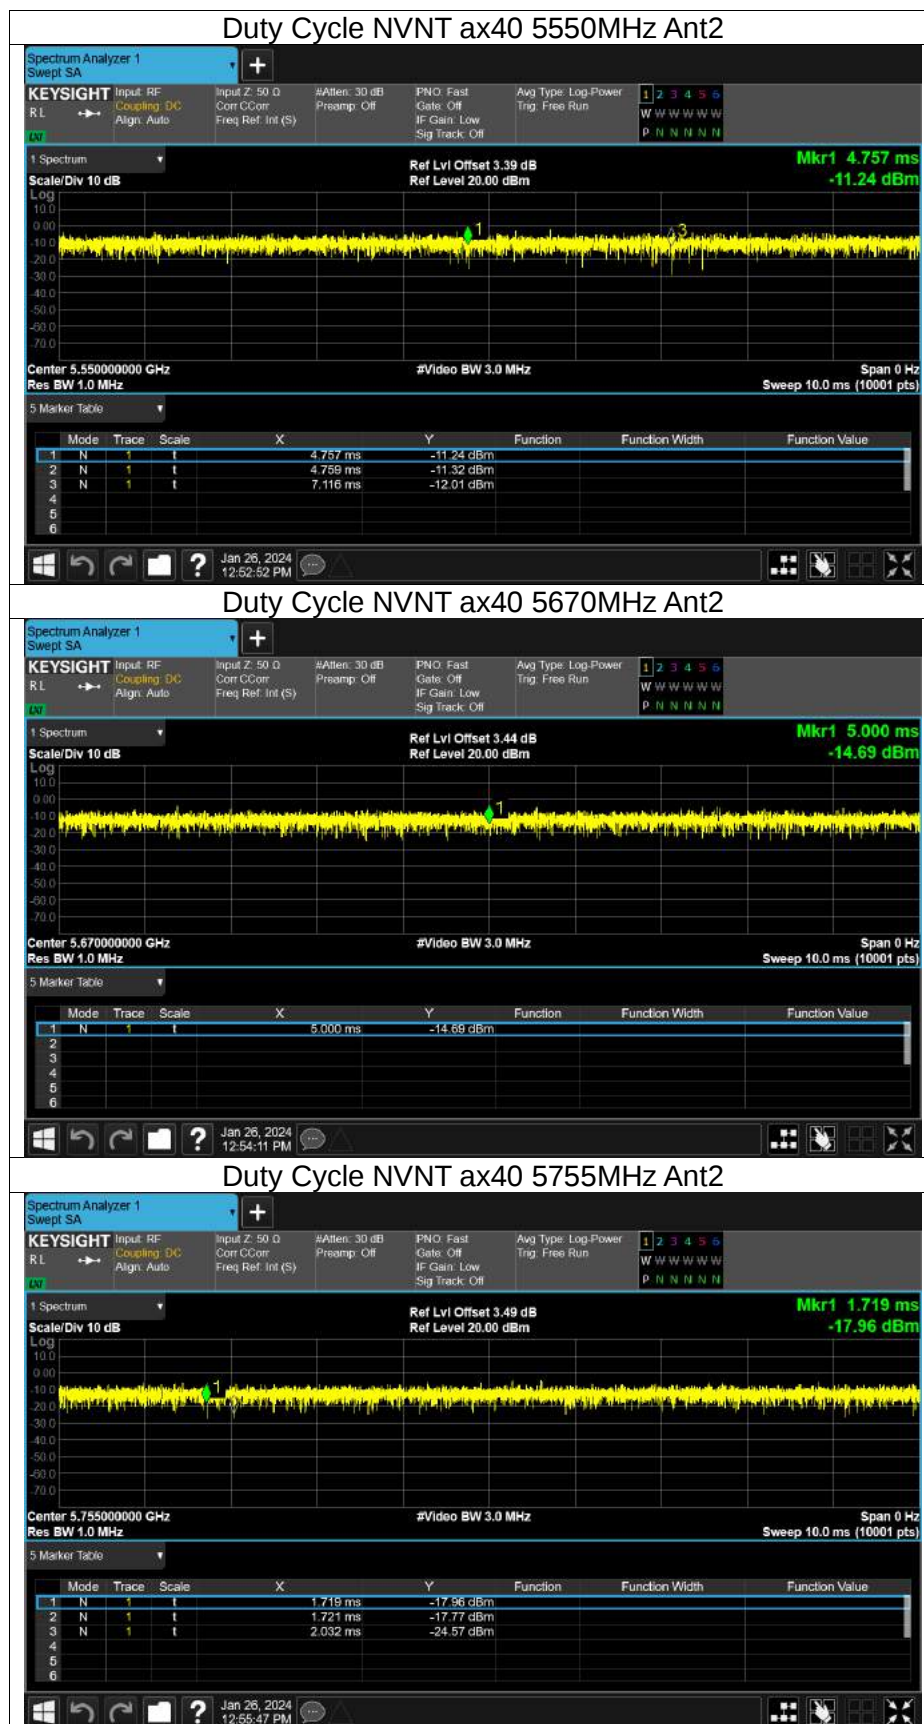


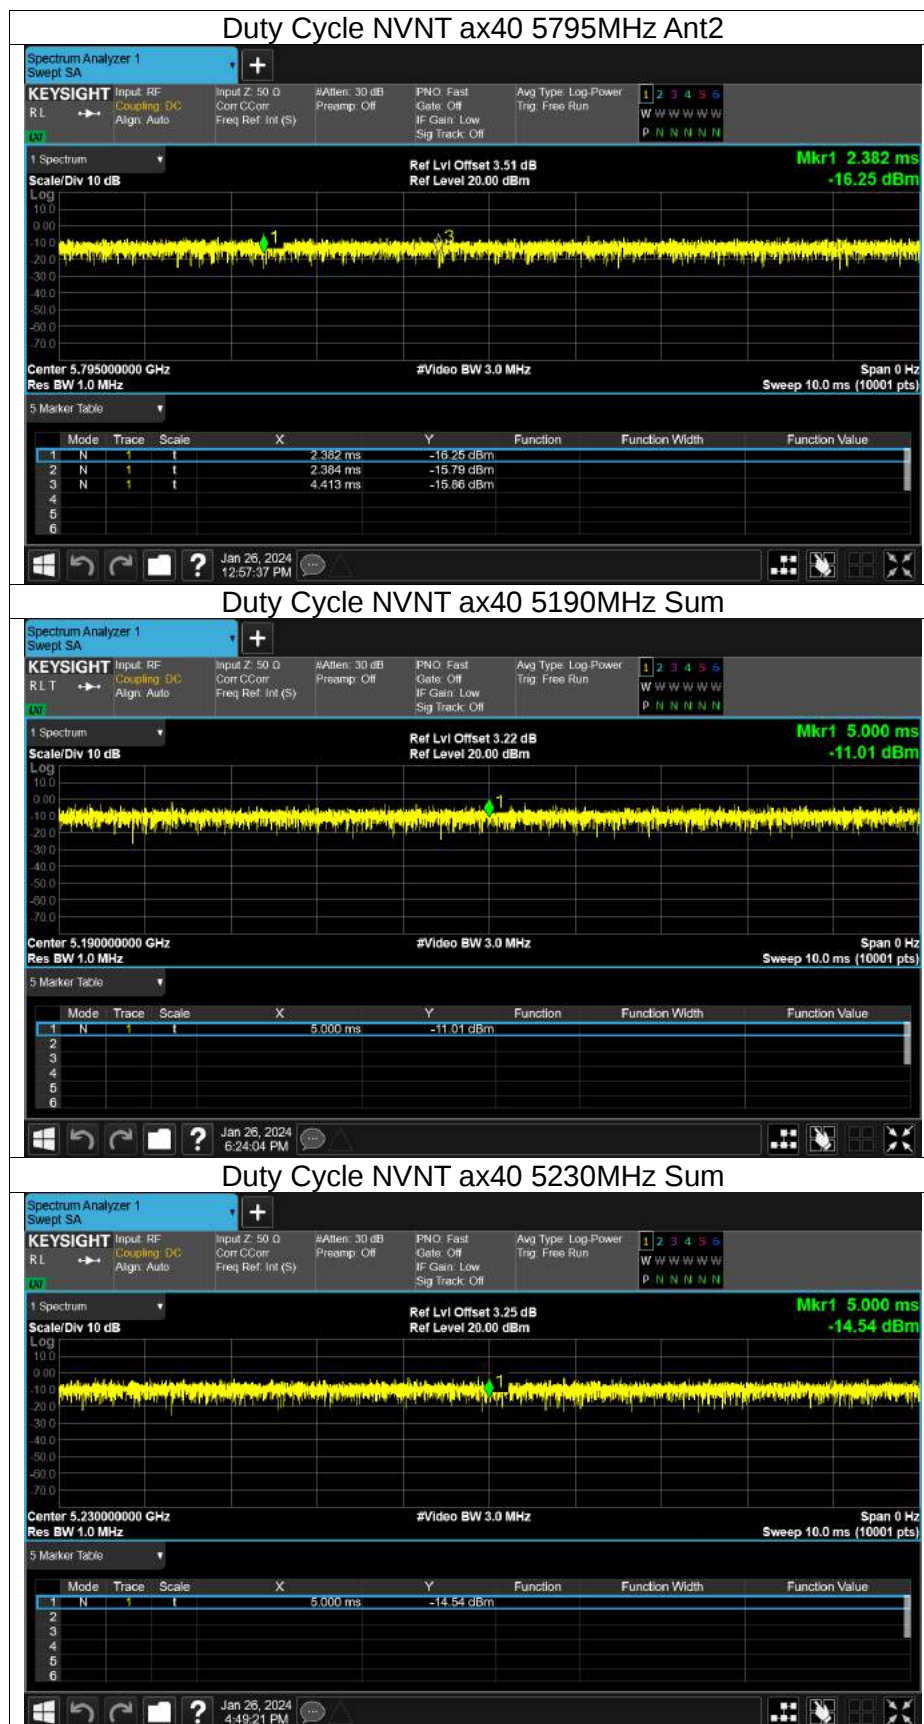


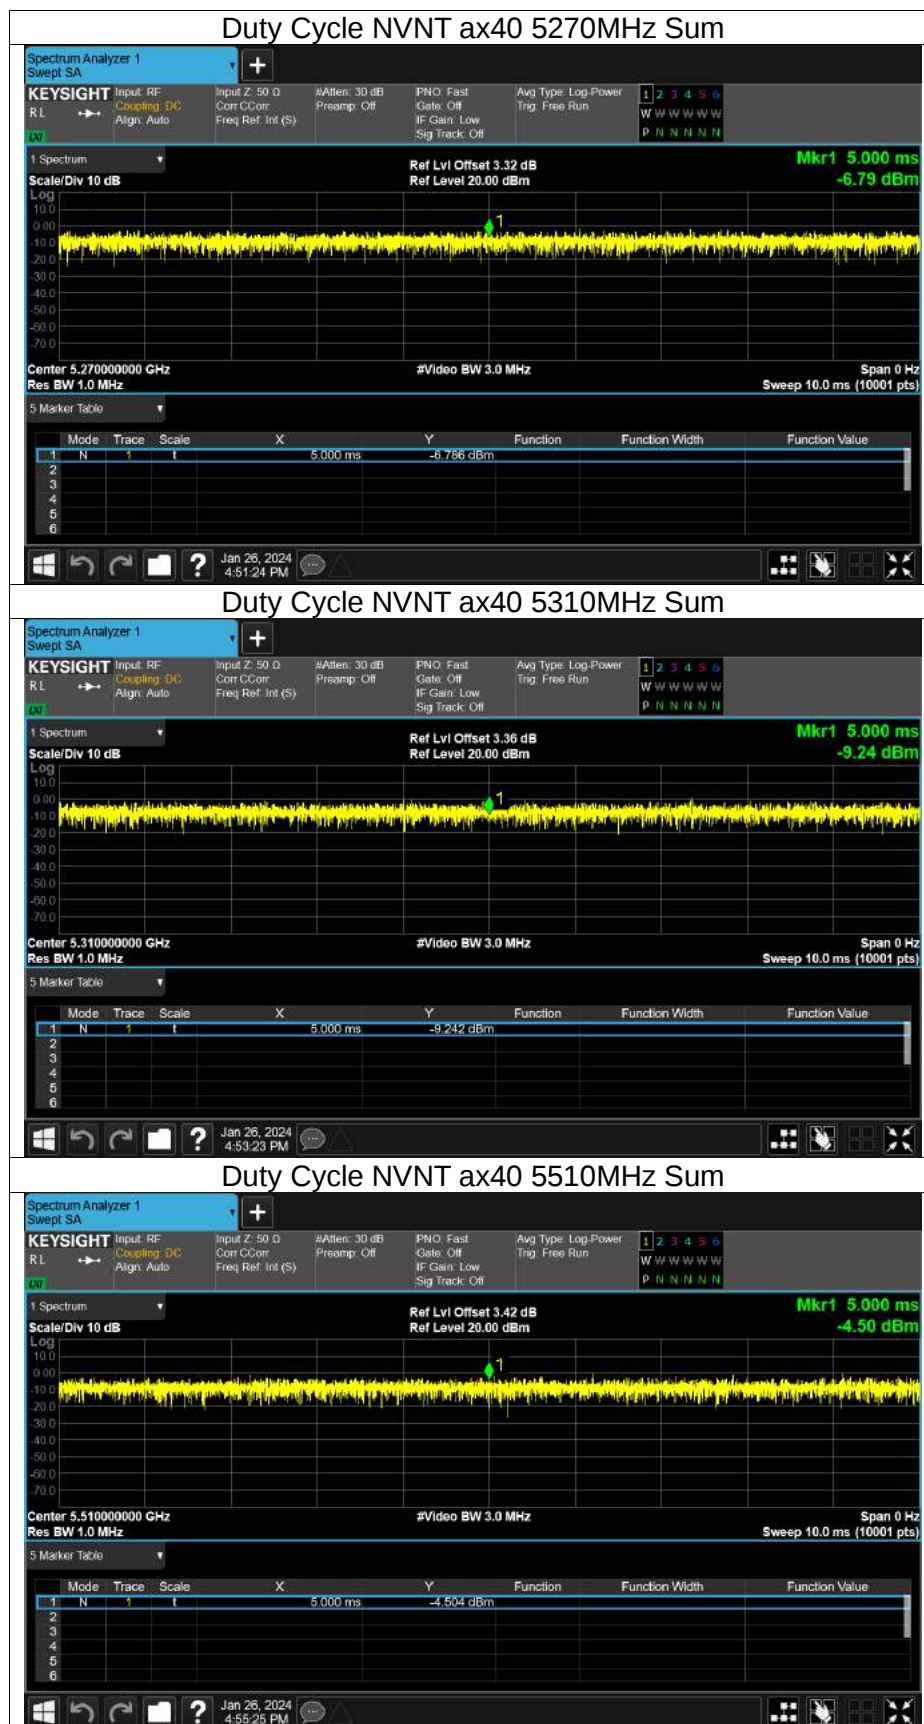


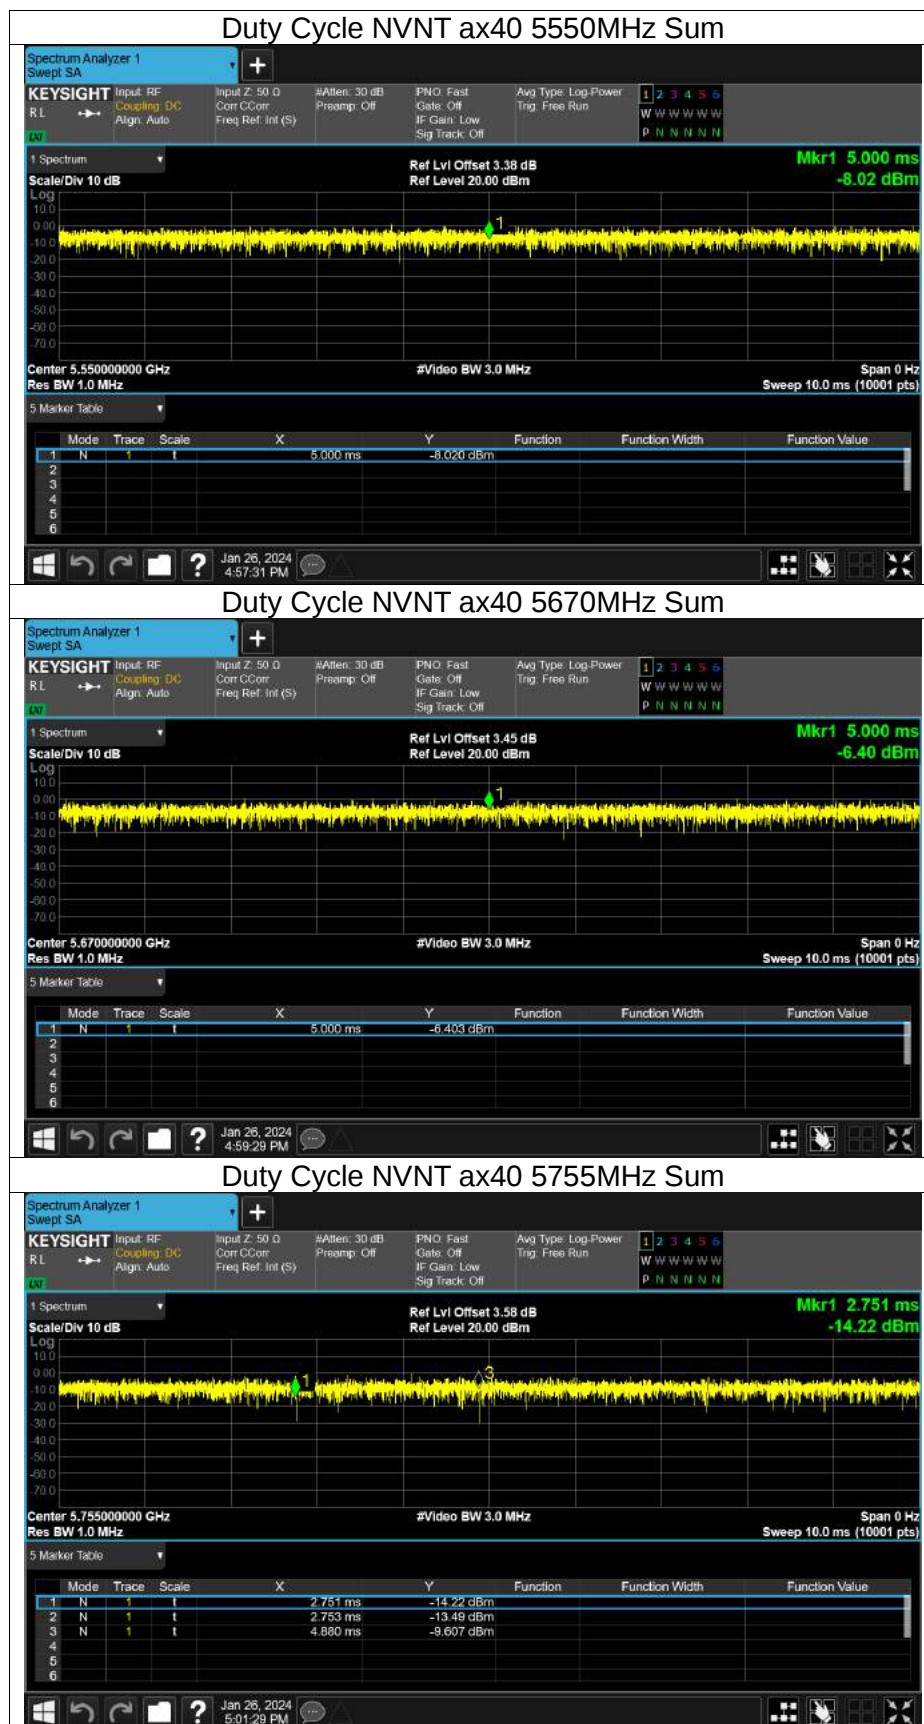


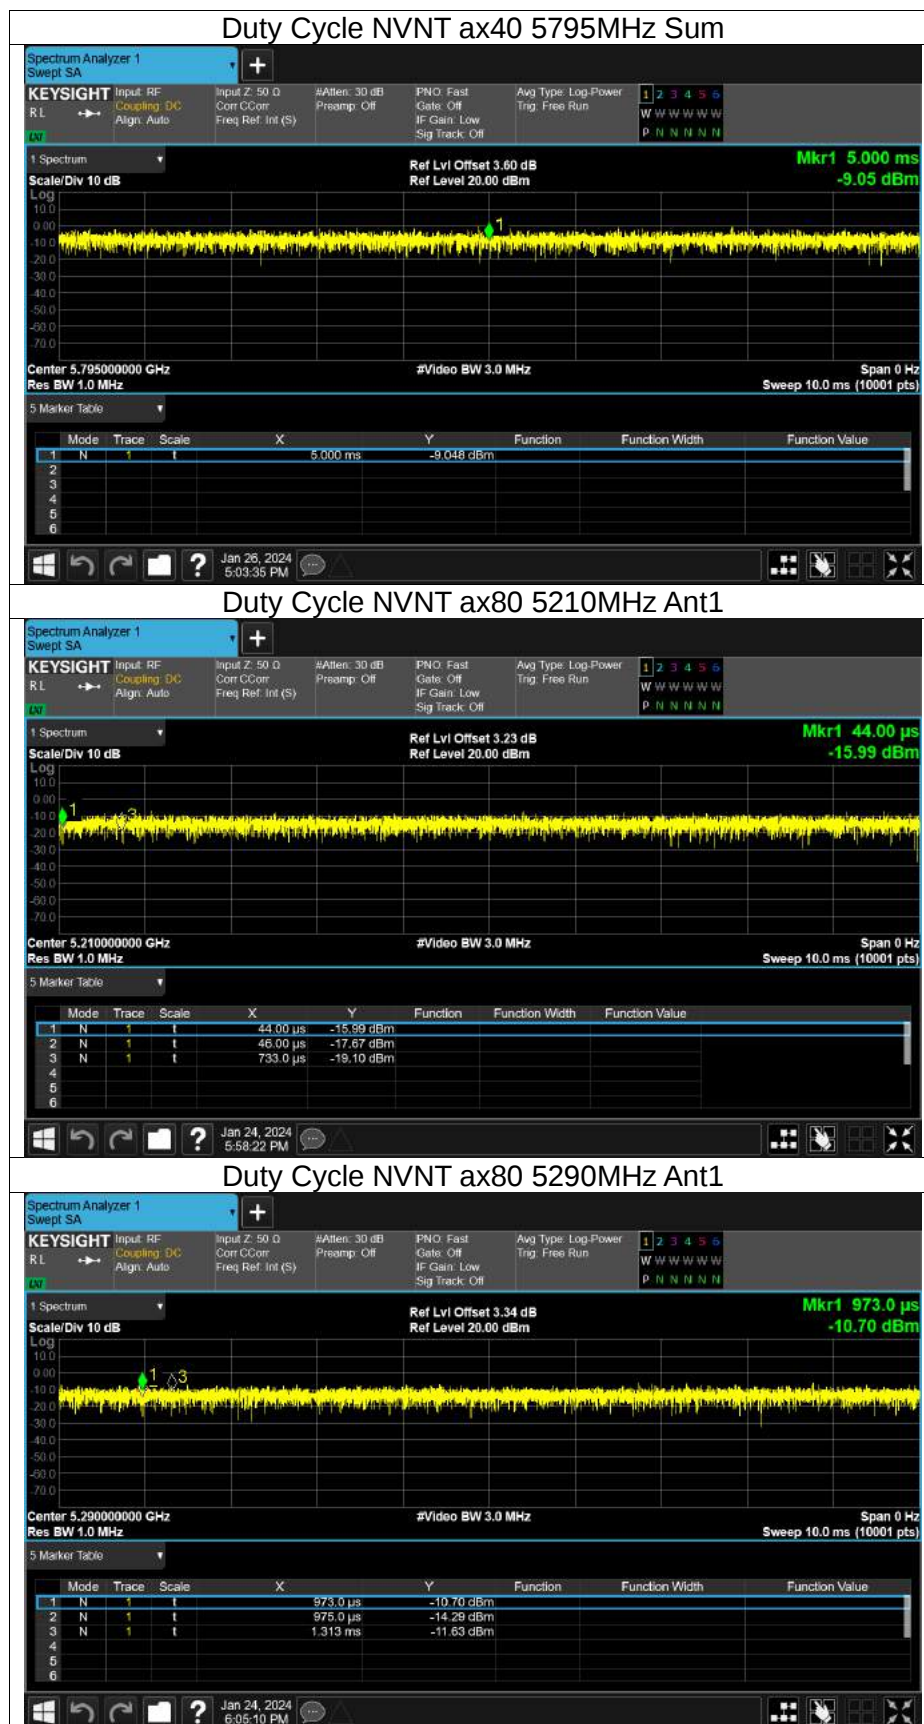


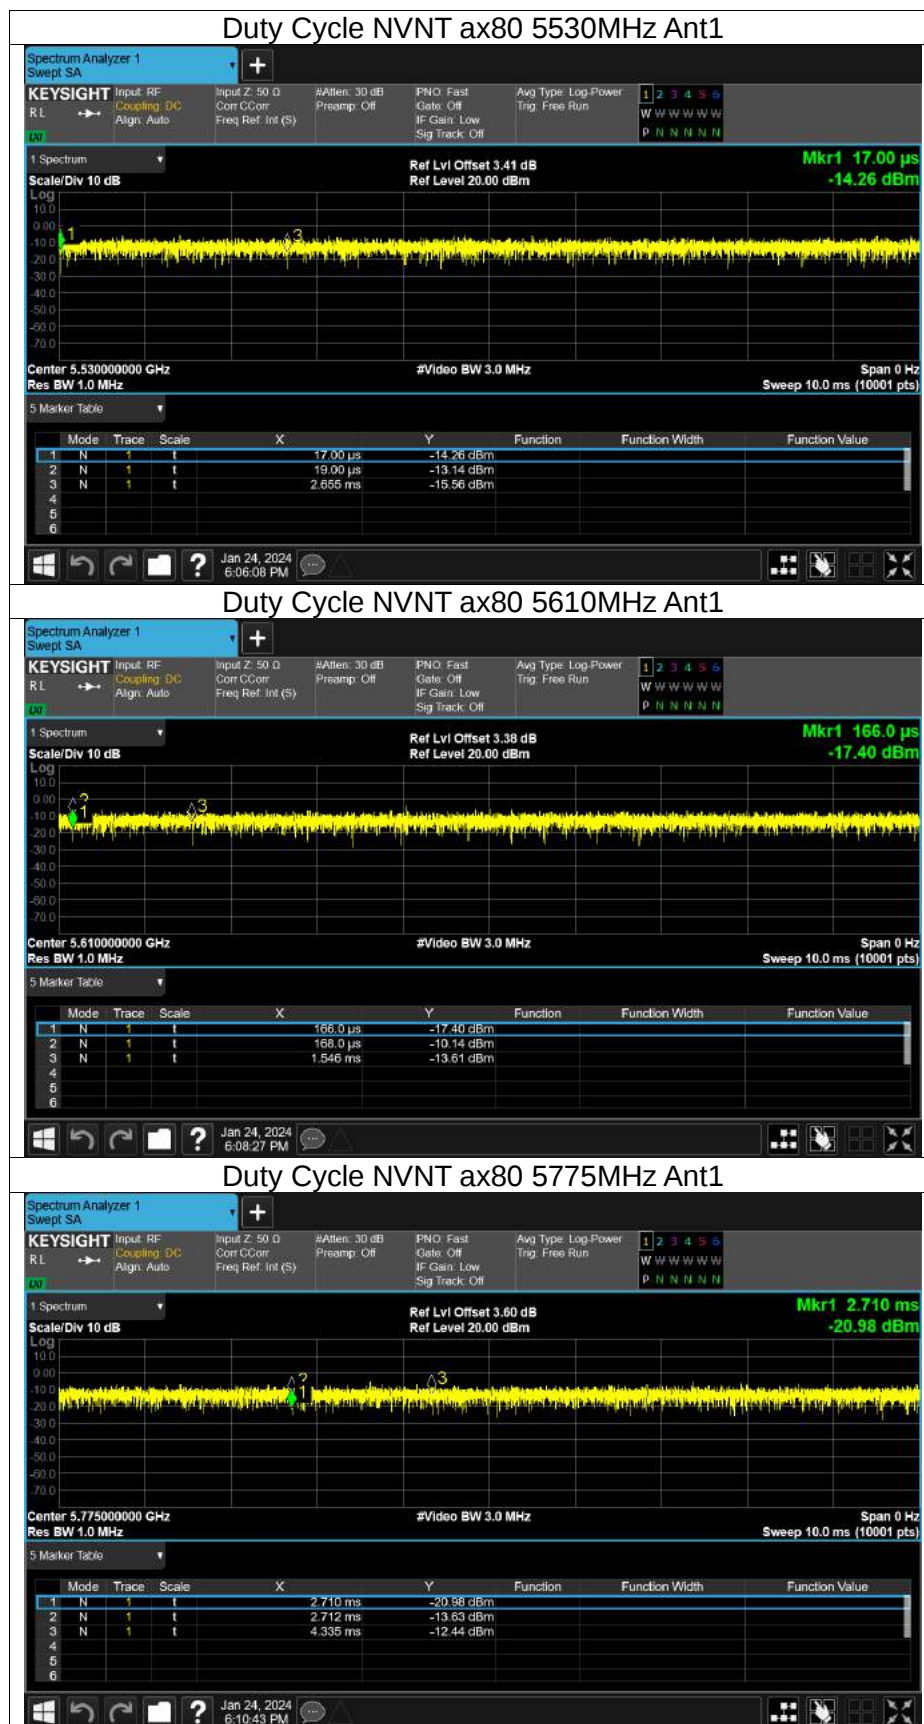

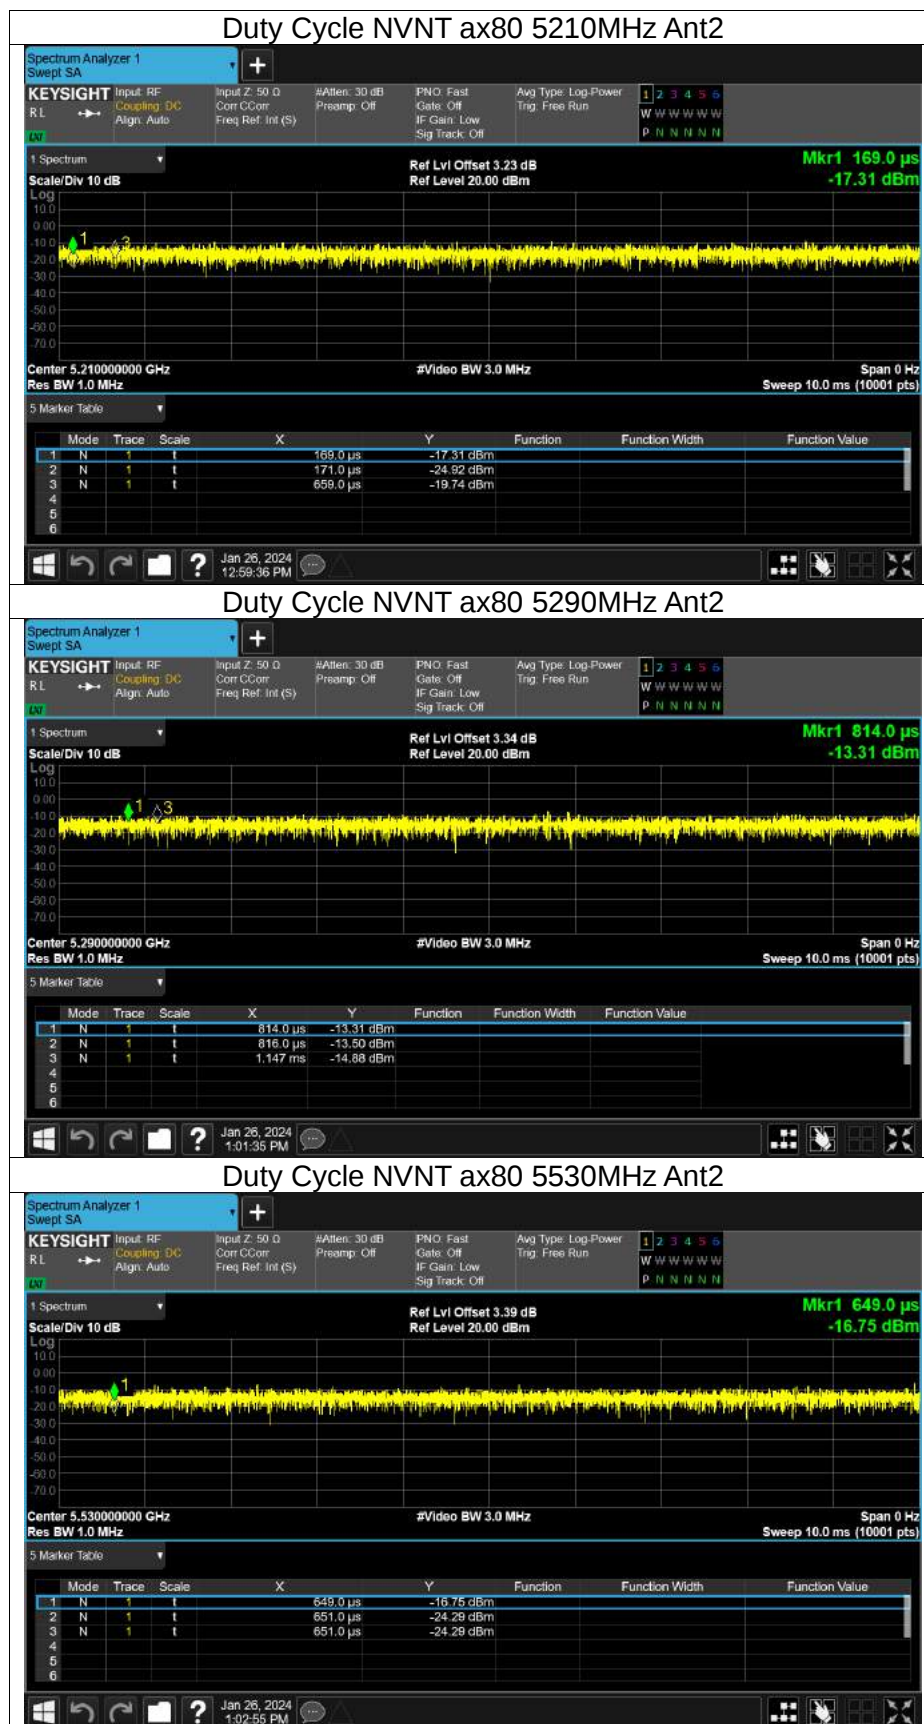

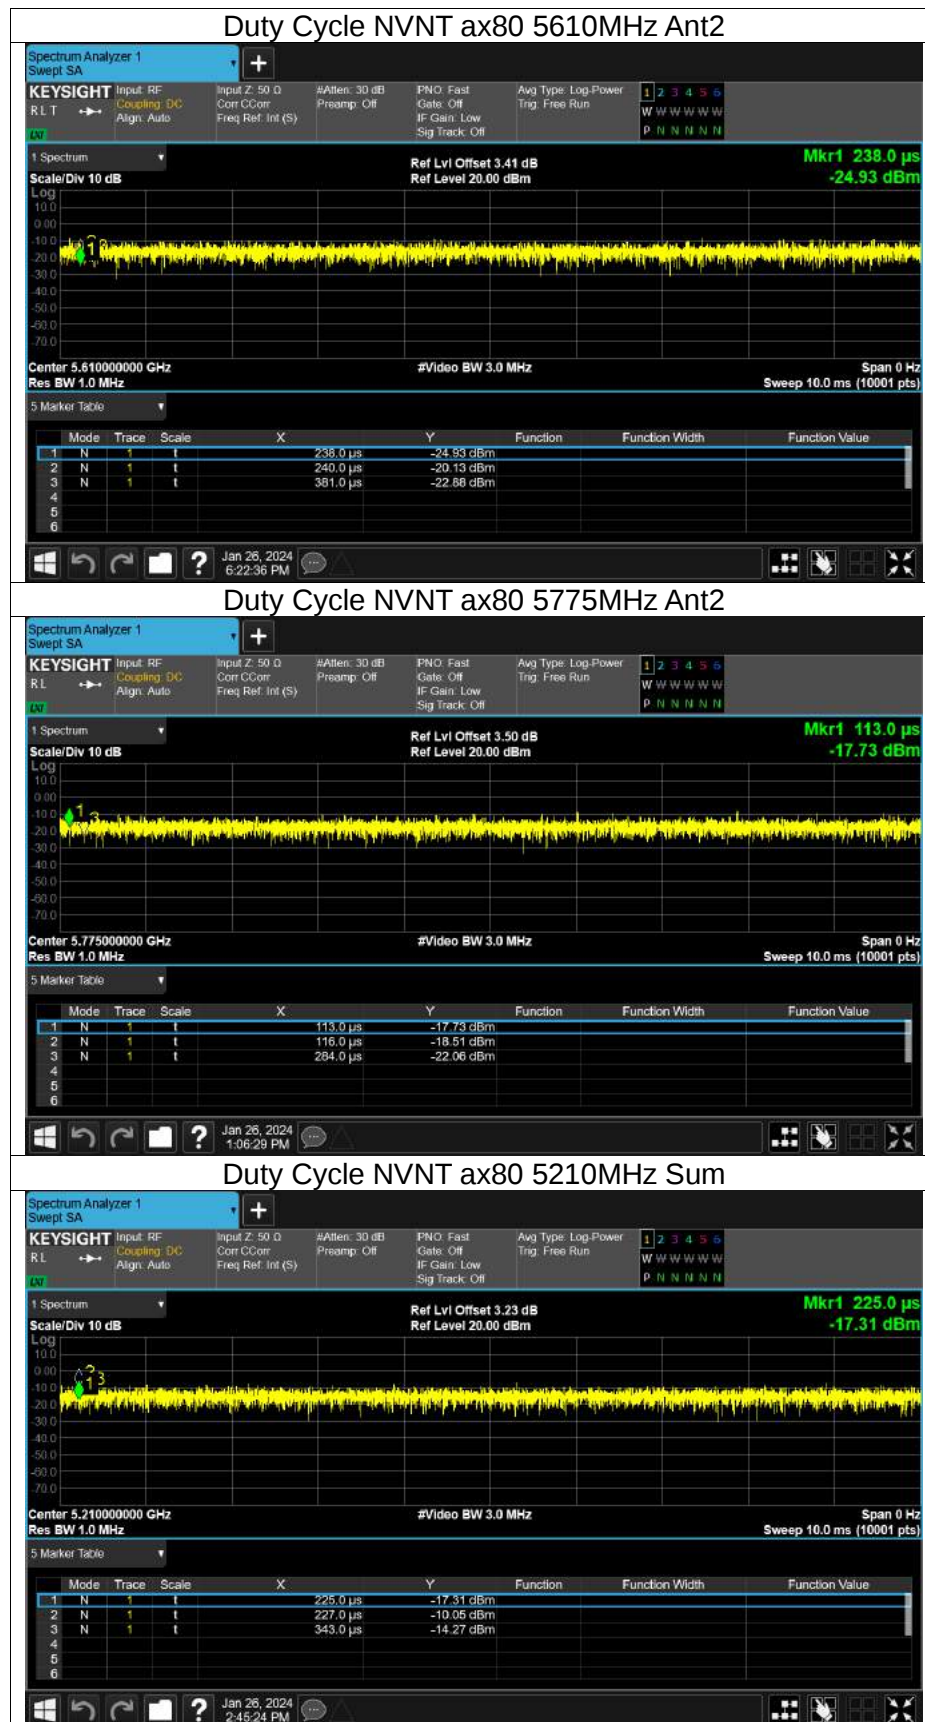

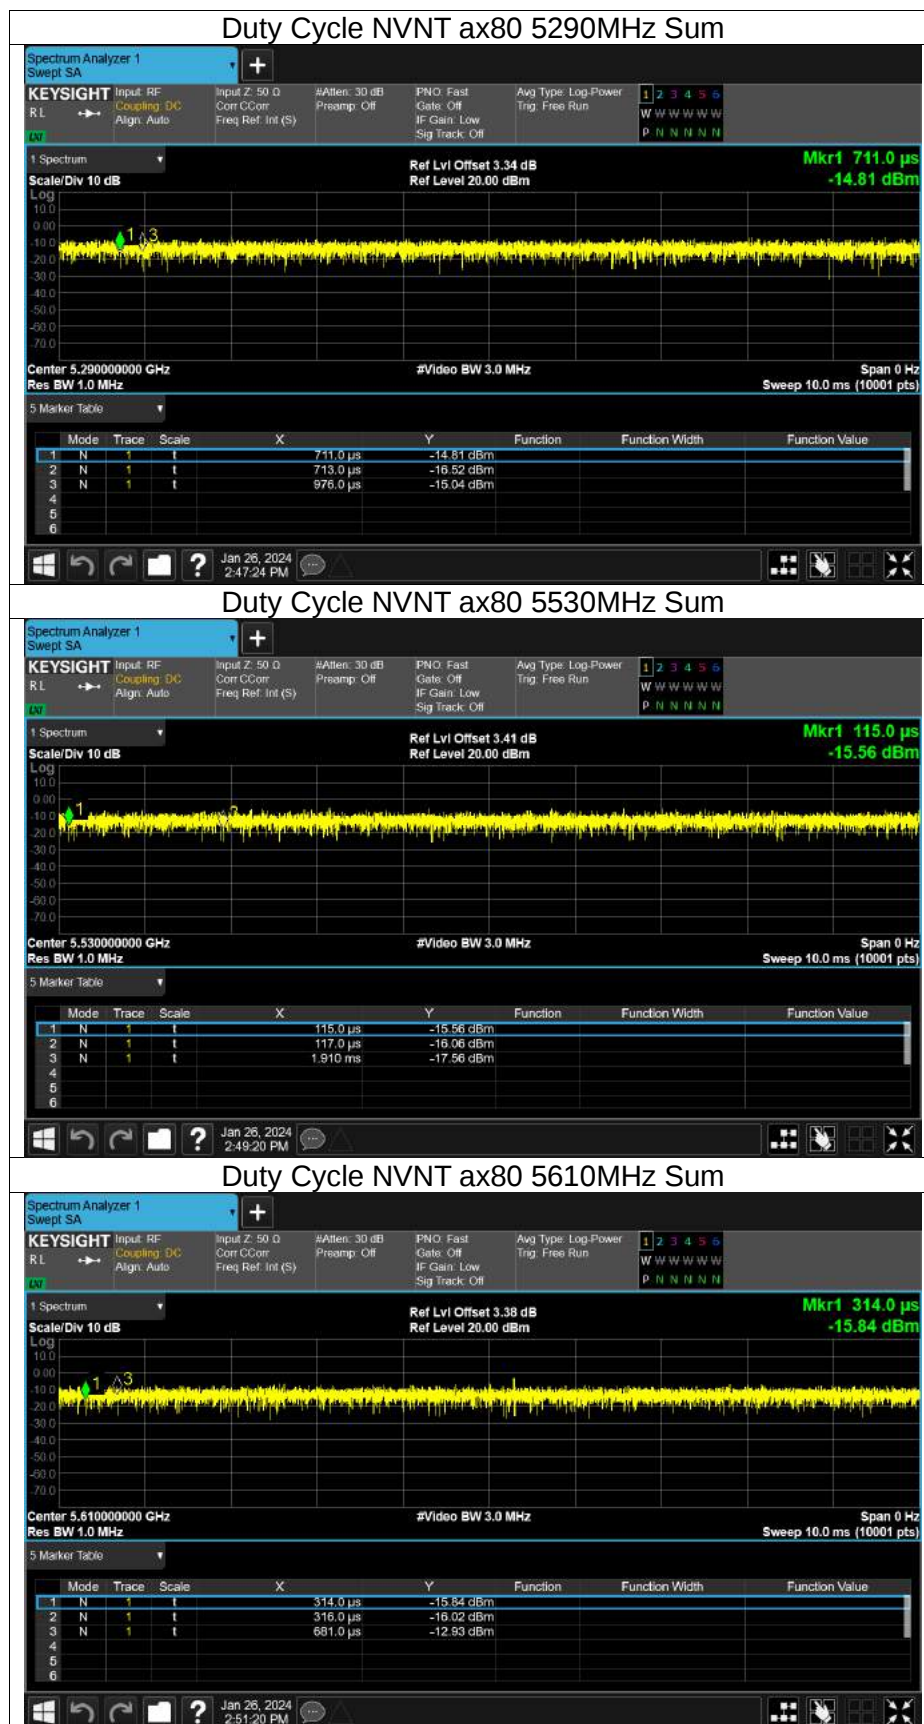

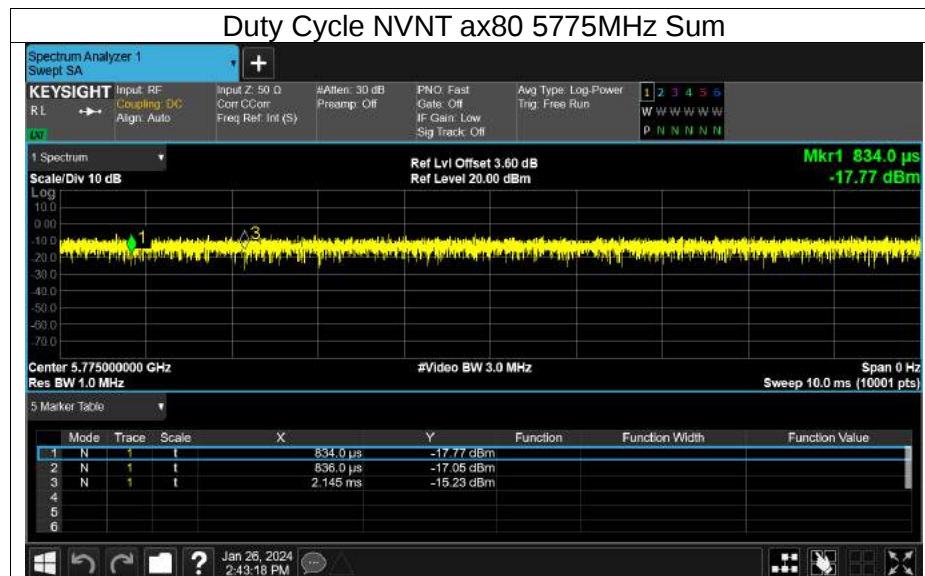



Maximum Conducted Output Power

Condition	Mode	Frequency (MHz)	Antenna	Conducted Power (dBm)	Duty Factor (dB)	Total Power (dBm)	Limit (dBm)	Verdict
NVNT	a	5180	Ant1	5.35	0	5.35	24	Pass
NVNT	a	5200	Ant1	5.04	0	5.04	24	Pass
NVNT	a	5240	Ant1	5.47	0	5.47	24	Pass
NVNT	a	5260	Ant1	5.86	0	5.86	24	Pass
NVNT	a	5300	Ant1	6.63	0	6.63	24	Pass
NVNT	a	5320	Ant1	6.49	0	6.49	24	Pass
NVNT	a	5500	Ant1	6.74	0	6.74	24	Pass
NVNT	a	5580	Ant1	6.71	0	6.71	24	Pass
NVNT	a	5700	Ant1	6.84	0	6.84	24	Pass
NVNT	a	5745	Ant1	6.73	0	6.73	30	Pass
NVNT	a	5785	Ant1	6.94	0	6.94	30	Pass
NVNT	a	5825	Ant1	6.2	0	6.2	30	Pass
NVNT	a	5180	Ant2	4.22	0	4.22	24	Pass
NVNT	a	5200	Ant2	4.61	0	4.61	24	Pass
NVNT	a	5240	Ant2	5.16	0	5.16	24	Pass
NVNT	a	5260	Ant2	5.85	0	5.85	24	Pass
NVNT	a	5300	Ant2	5.8	0	5.8	24	Pass
NVNT	a	5320	Ant2	5.83	0	5.83	24	Pass
NVNT	a	5500	Ant2	6.1	0	6.1	24	Pass
NVNT	a	5580	Ant2	5.37	0	5.37	24	Pass
NVNT	a	5700	Ant2	4.33	0	4.33	24	Pass
NVNT	a	5745	Ant2	4.23	0	4.23	30	Pass
NVNT	a	5785	Ant2	3.85	0	3.85	30	Pass
NVNT	a	5825	Ant2	3.19	0	3.19	30	Pass
NVNT	n20	5180	Ant1	3.63	0	3.63	24	Pass
NVNT	n20	5200	Ant1	3.98	0	3.98	24	Pass
NVNT	n20	5240	Ant1	4.54	0	4.54	24	Pass
NVNT	n20	5260	Ant1	5.19	0	5.19	24	Pass
NVNT	n20	5300	Ant1	5.49	0	5.49	24	Pass
NVNT	n20	5320	Ant1	5.66	0	5.66	24	Pass
NVNT	n20	5500	Ant1	6.01	0	6.01	24	Pass
NVNT	n20	5580	Ant1	5.91	0	5.91	24	Pass
NVNT	n20	5700	Ant1	6.14	0	6.14	24	Pass
NVNT	n20	5745	Ant1	5.64	0	5.64	30	Pass
NVNT	n20	5785	Ant1	5.64	0	5.64	30	Pass
NVNT	n20	5825	Ant1	5.07	0	5.07	30	Pass
NVNT	n20	5180	Ant2	2.29	0	2.29	24	Pass
NVNT	n20	5200	Ant2	2.64	0	2.64	24	Pass
NVNT	n20	5240	Ant2	3.04	0	3.04	24	Pass
NVNT	n20	5260	Ant2	3.94	0	3.94	24	Pass
NVNT	n20	5300	Ant2	3.85	0	3.85	24	Pass
NVNT	n20	5320	Ant2	3.87	0	3.87	24	Pass
NVNT	n20	5500	Ant2	3.9	0	3.9	24	Pass
NVNT	n20	5580	Ant2	3.23	0	3.23	24	Pass
NVNT	n20	5700	Ant2	2.45	0	2.45	24	Pass
NVNT	n20	5745	Ant2	2.19	0	2.19	30	Pass
NVNT	n20	5785	Ant2	1.77	0	1.77	30	Pass
NVNT	n20	5825	Ant2	1.17	0	1.17	30	Pass
NVNT	n20	5180	Ant1	2.08	0	2.08	24	Pass
NVNT	n20	5180	Ant2	1.76	0	1.76	24	Pass
NVNT	n20	5180	Sum	5.85	0	5.85	24	Pass



NVNT	n20	5200	Ant1	2.41	0	2.41	24	Pass
NVNT	n20	5200	Ant2	1.56	0	1.56	24	Pass
NVNT	n20	5200	Sum	5.99	0	5.99	24	Pass
NVNT	n20	5240	Ant1	2.21	0	2.21	24	Pass
NVNT	n20	5240	Ant2	1.68	0	1.68	24	Pass
NVNT	n20	5240	Sum	5.91	0	5.91	24	Pass
NVNT	n20	5260	Ant1	2.47	0	2.47	24	Pass
NVNT	n20	5260	Ant2	2.06	0	2.06	24	Pass
NVNT	n20	5260	Sum	6.56	0	6.56	24	Pass
NVNT	n20	5300	Ant1	2.89	0	2.89	24	Pass
NVNT	n20	5300	Ant2	1.98	0	1.98	24	Pass
NVNT	n20	5300	Sum	6.88	0	6.88	24	Pass
NVNT	n20	5320	Ant1	3.05	0	3.05	24	Pass
NVNT	n20	5320	Ant2	1.88	0	1.88	24	Pass
NVNT	n20	5320	Sum	6.94	0	6.94	24	Pass
NVNT	n20	5500	Ant1	3.05	0	3.05	24	Pass
NVNT	n20	5500	Ant2	1.93	0	1.93	24	Pass
NVNT	n20	5500	Sum	6.97	0	6.97	24	Pass
NVNT	n20	5580	Ant1	3.25	0	3.25	24	Pass
NVNT	n20	5580	Ant2	1.71	0	1.71	24	Pass
NVNT	n20	5580	Sum	6.96	0	6.96	24	Pass
NVNT	n20	5700	Ant1	3.53	0	3.53	24	Pass
NVNT	n20	5700	Ant2	1.42	0	1.42	24	Pass
NVNT	n20	5700	Sum	6.94	0	6.94	24	Pass
NVNT	n20	5745	Ant1	3.24	0	3.24	30	Pass
NVNT	n20	5745	Ant2	1.35	0	1.35	30	Pass
NVNT	n20	5745	Sum	6.62	0	6.62	30	Pass
NVNT	n20	5785	Ant1	3.26	0	3.26	30	Pass
NVNT	n20	5785	Ant2	1.26	0	1.26	30	Pass
NVNT	n20	5785	Sum	6.55	0	6.55	30	Pass
NVNT	n20	5825	Ant1	3.59	0	3.59	30	Pass
NVNT	n20	5825	Ant2	1.17	0	1.17	30	Pass
NVNT	n20	5825	Sum	6.78	0	6.78	30	Pass
NVNT	n40	5190	Ant1	4.89	0	4.89	24	Pass
NVNT	n40	5230	Ant1	5.46	0	5.46	24	Pass
NVNT	n40	5270	Ant1	6.08	0	6.08	24	Pass
NVNT	n40	5310	Ant1	6.43	0	6.43	24	Pass
NVNT	n40	5510	Ant1	6.63	0	6.63	24	Pass
NVNT	n40	5550	Ant1	6.56	0	6.56	24	Pass
NVNT	n40	5670	Ant1	6.7	0	6.7	24	Pass
NVNT	n40	5755	Ant1	6.55	0	6.55	30	Pass
NVNT	n40	5795	Ant1	6.41	0	6.41	30	Pass
NVNT	n40	5190	Ant2	3.4	0	3.4	24	Pass
NVNT	n40	5230	Ant2	2.65	0	2.65	24	Pass
NVNT	n40	5270	Ant2	3.55	0	3.55	24	Pass
NVNT	n40	5310	Ant2	4.01	0	4.01	24	Pass
NVNT	n40	5510	Ant2	3.98	0	3.98	24	Pass
NVNT	n40	5550	Ant2	3.95	0	3.95	24	Pass
NVNT	n40	5670	Ant2	2.52	0	2.52	24	Pass
NVNT	n40	5755	Ant2	1.96	0	1.96	30	Pass
NVNT	n40	5795	Ant2	1.72	0	1.72	30	Pass
NVNT	n40	5190	Ant1	2.30	0	2.30	24	Pass
NVNT	n40	5190	Ant2	1.44	0	1.44	24	Pass
NVNT	n40	5190	Sum	5.73	0	5.73	24	Pass
NVNT	n40	5230	Ant1	2.28	0	2.28	24	Pass
NVNT	n40	5230	Ant2	1.62	0	1.62	24	Pass



NVNT	n40	5230	Sum	5.91	0	5.91	24	Pass
NVNT	n40	5270	Ant1	1.69	0	1.69	24	Pass
NVNT	n40	5270	Ant2	1.28	0	1.28	24	Pass
NVNT	n40	5270	Sum	4.73	0	4.73	24	Pass
NVNT	n40	5310	Ant1	3.15	0	3.15	24	Pass
NVNT	n40	5310	Ant2	1.82	0	1.82	24	Pass
NVNT	n40	5310	Sum	6.96	0	6.96	24	Pass
NVNT	n40	5510	Ant1	2.81	0	2.81	24	Pass
NVNT	n40	5510	Ant2	1.74	0	1.74	24	Pass
NVNT	n40	5510	Sum	6.57	0	6.57	24	Pass
NVNT	n40	5550	Ant1	2.98	0	2.98	24	Pass
NVNT	n40	5550	Ant2	1.75	0	1.75	24	Pass
NVNT	n40	5550	Sum	6.75	0	6.75	24	Pass
NVNT	n40	5670	Ant1	3.60	0	3.60	24	Pass
NVNT	n40	5670	Ant2	1.27	0	1.27	24	Pass
NVNT	n40	5670	Sum	6.88	0	6.88	24	Pass
NVNT	n40	5755	Ant1	3.33	0	3.33	30	Pass
NVNT	n40	5755	Ant2	1.31	0	1.31	30	Pass
NVNT	n40	5755	Sum	6.67	0	6.67	30	Pass
NVNT	n40	5795	Ant1	3.74	0	3.74	30	Pass
NVNT	n40	5795	Ant2	1.21	0	1.21	30	Pass
NVNT	n40	5795	Sum	6.94	0	6.94	30	Pass
NVNT	ac20	5180	Ant1	3.73	0	3.73	24	Pass
NVNT	ac20	5200	Ant1	4.08	0	4.08	24	Pass
NVNT	ac20	5240	Ant1	4.74	0	4.74	24	Pass
NVNT	ac20	5260	Ant1	5.25	0	5.25	24	Pass
NVNT	ac20	5300	Ant1	5.48	0	5.48	24	Pass
NVNT	ac20	5320	Ant1	5.67	0	5.67	24	Pass
NVNT	ac20	5500	Ant1	6.1	0	6.1	24	Pass
NVNT	ac20	5580	Ant1	5.97	0	5.97	24	Pass
NVNT	ac20	5700	Ant1	5.86	0	5.86	24	Pass
NVNT	ac20	5745	Ant1	5.77	0	5.77	30	Pass
NVNT	ac20	5785	Ant1	5.73	0	5.73	30	Pass
NVNT	ac20	5825	Ant1	5.09	0	5.09	30	Pass
NVNT	ac20	5180	Ant2	1.48	0	1.48	24	Pass
NVNT	ac20	5200	Ant2	1.93	0	1.93	24	Pass
NVNT	ac20	5240	Ant2	2.43	0	2.43	24	Pass
NVNT	ac20	5260	Ant2	3.13	0	3.13	24	Pass
NVNT	ac20	5300	Ant2	3.11	0	3.11	24	Pass
NVNT	ac20	5320	Ant2	2.11	0	2.11	24	Pass
NVNT	ac20	5500	Ant2	3.11	0	3.11	24	Pass
NVNT	ac20	5580	Ant2	2.42	0	2.42	24	Pass
NVNT	ac20	5700	Ant2	0.66	0	0.66	24	Pass
NVNT	ac20	5745	Ant2	1.28	0	1.28	30	Pass
NVNT	ac20	5785	Ant2	1.01	0	1.01	30	Pass
NVNT	ac20	5825	Ant2	0.63	0	0.63	30	Pass
NVNT	ac20	5180	Ant1	1.66	0	1.66	24	Pass
NVNT	ac20	5180	Ant2	1.04	0	1.04	24	Pass
NVNT	ac20	5180	Sum	4.33	0	4.33	24	Pass
NVNT	ac20	5200	Ant1	1.73	0	1.73	24	Pass
NVNT	ac20	5200	Ant2	1.09	0	1.09	24	Pass
NVNT	ac20	5200	Sum	4.50	0	4.50	24	Pass
NVNT	ac20	5240	Ant1	1.56	0	1.56	24	Pass
NVNT	ac20	5240	Ant2	1.16	0	1.16	24	Pass
NVNT	ac20	5240	Sum	4.34	0	4.34	24	Pass
NVNT	ac20	5260	Ant1	1.75	0	1.75	24	Pass



NVNT	ac20	5260	Ant2	1.41	0	1.41	24	Pass
NVNT	ac20	5260	Sum	5.00	0	5.00	24	Pass
NVNT	ac20	5300	Ant1	2.37	0	2.37	24	Pass
NVNT	ac20	5300	Ant2	1.39	0	1.39	24	Pass
NVNT	ac20	5300	Sum	5.74	0	5.74	24	Pass
NVNT	ac20	5320	Ant1	2.89	0	2.89	24	Pass
NVNT	ac20	5320	Ant2	1.34	0	1.34	24	Pass
NVNT	ac20	5320	Sum	6.26	0	6.26	24	Pass
NVNT	ac20	5500	Ant1	2.02	0	2.02	24	Pass
NVNT	ac20	5500	Ant2	1.27	0	1.27	24	Pass
NVNT	ac20	5500	Sum	5.17	0	5.17	24	Pass
NVNT	ac20	5580	Ant1	2.68	0	2.68	24	Pass
NVNT	ac20	5580	Ant2	1.16	0	1.16	24	Pass
NVNT	ac20	5580	Sum	5.84	0	5.84	24	Pass
NVNT	ac20	5700	Ant1	2.74	0	2.74	24	Pass
NVNT	ac20	5700	Ant2	0.98	0	0.98	24	Pass
NVNT	ac20	5700	Sum	5.70	0	5.70	24	Pass
NVNT	ac20	5745	Ant1	2.15	0	2.15	30	Pass
NVNT	ac20	5745	Ant2	0.93	0	0.93	30	Pass
NVNT	ac20	5745	Sum	4.89	0	4.89	30	Pass
NVNT	ac20	5785	Ant1	2.57	0	2.57	30	Pass
NVNT	ac20	5785	Ant2	0.88	0	0.88	30	Pass
NVNT	ac20	5785	Sum	5.38	0	5.38	30	Pass
NVNT	ac20	5825	Ant1	2.28	0	2.28	30	Pass
NVNT	ac20	5825	Ant2	0.81	0	0.81	30	Pass
NVNT	ac20	5825	Sum	4.89	0	4.89	30	Pass
NVNT	ac40	5180	Ant1	3.13	0	3.13	24	Pass
NVNT	ac40	5190	Ant1	4	0	4	24	Pass
NVNT	ac40	5230	Ant1	4.59	0	4.59	24	Pass
NVNT	ac40	5270	Ant1	5.33	0	5.33	24	Pass
NVNT	ac40	5310	Ant1	5.47	0	5.47	24	Pass
NVNT	ac40	5510	Ant1	5.68	0	5.68	24	Pass
NVNT	ac40	5550	Ant1	5.64	0	5.64	24	Pass
NVNT	ac40	5670	Ant1	5.52	0	5.52	24	Pass
NVNT	ac40	5755	Ant1	5.6	0	5.6	30	Pass
NVNT	ac40	5795	Ant1	5.62	0	5.62	30	Pass
NVNT	ac40	5190	Ant2	1.57	0	1.57	24	Pass
NVNT	ac40	5230	Ant2	2.32	0	2.32	24	Pass
NVNT	ac40	5270	Ant2	3.16	0	3.16	24	Pass
NVNT	ac40	5310	Ant2	2.93	0	2.93	24	Pass
NVNT	ac40	5510	Ant2	2.79	0	2.79	24	Pass
NVNT	ac40	5550	Ant2	2.93	0	2.93	24	Pass
NVNT	ac40	5670	Ant2	1.58	0	1.58	24	Pass
NVNT	ac40	5755	Ant2	1.14	0	1.14	30	Pass
NVNT	ac40	5795	Ant2	0.64	0	0.64	30	Pass
NVNT	ac40	5190	Ant1	1.94	0	1.94	24	Pass
NVNT	ac40	5190	Ant2	1.20	0	1.20	24	Pass
NVNT	ac40	5190	Sum	4.96	0	4.96	24	Pass
NVNT	ac40	5230	Ant1	1.81	0	1.81	24	Pass
NVNT	ac40	5230	Ant2	1.31	0	1.31	24	Pass
NVNT	ac40	5230	Sum	4.94	0	4.94	24	Pass
NVNT	ac40	5270	Ant1	2.25	0	2.25	24	Pass
NVNT	ac40	5270	Ant2	1.69	0	1.69	24	Pass
NVNT	ac40	5270	Sum	5.96	0	5.96	24	Pass
NVNT	ac40	5310	Ant1	3.11	0	3.11	24	Pass
NVNT	ac40	5310	Ant2	1.64	0	1.64	24	Pass



NVNT	ac40	5310	Sum	6.77	0	6.77	24	Pass
NVNT	ac40	5510	Ant1	2.45	0	2.45	24	Pass
NVNT	ac40	5510	Ant2	1.49	0	1.49	24	Pass
NVNT	ac40	5510	Sum	5.95	0	5.95	24	Pass
NVNT	ac40	5550	Ant1	3.18	0	3.18	24	Pass
NVNT	ac40	5550	Ant2	1.53	0	1.53	24	Pass
NVNT	ac40	5550	Sum	6.73	0	6.73	24	Pass
NVNT	ac40	5670	Ant1	3.05	0	3.05	24	Pass
NVNT	ac40	5670	Ant2	1.10	0	1.10	24	Pass
NVNT	ac40	5670	Sum	6.17	0	6.17	24	Pass
NVNT	ac40	5755	Ant1	2.71	0	2.71	30	Pass
NVNT	ac40	5755	Ant2	1.09	0	1.09	30	Pass
NVNT	ac40	5755	Sum	5.79	0	5.79	30	Pass
NVNT	ac40	5795	Ant2	0.73	0	0.73	30	Pass
NVNT	ac40	5795	Sum	6.84	0	6.84	30	Pass
NVNT	ac80	5210	Ant1	3.95	0	3.95	24	Pass
NVNT	ac80	5290	Ant1	6.97	0	6.97	24	Pass
NVNT	ac80	5530	Ant1	5.67	0	5.67	24	Pass
NVNT	ac80	5610	Ant1	5.57	0	5.57	24	Pass
NVNT	ac80	5775	Ant1	5.62	0	5.62	30	Pass
NVNT	ac80	5210	Ant2	1.47	0	1.47	24	Pass
NVNT	ac80	5290	Ant2	2.73	0	2.73	24	Pass
NVNT	ac80	5530	Ant2	2.84	0	2.84	24	Pass
NVNT	ac80	5610	Ant2	1.91	0	1.91	24	Pass
NVNT	ac80	5775	Ant2	0.51	0	0.51	30	Pass
NVNT	ac80	5210	Ant1	1.84	0	1.84	24	Pass
NVNT	ac80	5210	Ant2	1.17	0	1.17	24	Pass
NVNT	ac80	5210	Sum	4.78	0	4.78	24	Pass
NVNT	ac80	5290	Ant1	2.55	0	2.55	24	Pass
NVNT	ac80	5290	Ant2	1.51	0	1.51	24	Pass
NVNT	ac80	5290	Sum	6.09	0	6.09	24	Pass
NVNT	ac80	5530	Ant1	2.68	0	2.68	24	Pass
NVNT	ac80	5530	Ant2	1.43	0	1.43	24	Pass
NVNT	ac80	5530	Sum	6.13	0	6.13	24	Pass
NVNT	ac80	5610	Ant1	2.55	0	2.55	24	Pass
NVNT	ac80	5610	Ant2	1.18	0	1.18	24	Pass
NVNT	ac80	5610	Sum	5.72	0	5.72	24	Pass
NVNT	ac80	5775	Ant1	2.77	0	2.77	30	Pass
NVNT	ac80	5775	Ant2	0.97	0	0.97	30	Pass
NVNT	ac80	5775	Sum	5.74	0	5.74	30	Pass
NVNT	ax20	5180	Ant1	2.99	0	2.99	24	Pass
NVNT	ax20	5200	Ant1	3.34	0	3.34	24	Pass
NVNT	ax20	5240	Ant1	3.74	0	3.74	24	Pass
NVNT	ax20	5260	Ant1	4.17	0	4.17	24	Pass
NVNT	ax20	5300	Ant1	5.43	0	5.43	24	Pass
NVNT	ax20	5320	Ant1	5.68	0	5.68	24	Pass
NVNT	ax20	5500	Ant1	4.61	0	4.61	24	Pass
NVNT	ax20	5580	Ant1	4.6	0	4.6	24	Pass
NVNT	ax20	5700	Ant1	4.75	0	4.75	24	Pass
NVNT	ax20	5745	Ant1	4.64	0	4.64	30	Pass
NVNT	ax20	5785	Ant1	4.76	0	4.76	30	Pass
NVNT	ax20	5825	Ant1	4.24	0	4.24	30	Pass
NVNT	ax20	5180	Ant2	1.51	0	1.51	24	Pass
NVNT	ax20	5200	Ant2	0.1	0	0.1	24	Pass
NVNT	ax20	5240	Ant2	0.86	0	0.86	24	Pass
NVNT	ax20	5260	Ant2	1.43	0	1.43	24	Pass



NVNT	ax20	5300	Ant2	1.32	0	1.32	24	Pass
NVNT	ax20	5320	Ant2	2.15	0	2.15	24	Pass
NVNT	ax20	5500	Ant2	1.98	0	1.98	24	Pass
NVNT	ax20	5580	Ant2	1.45	0	1.45	24	Pass
NVNT	ax20	5700	Ant2	0.6	0	0.6	24	Pass
NVNT	ax20	5745	Ant2	0.68	0	0.68	30	Pass
NVNT	ax20	5785	Ant2	0.38	0	0.38	30	Pass
NVNT	ax20	5825	Ant2	0.03	0	0.03	30	Pass
NVNT	ax20	5180	Ant1	1.67	0	1.67	24	Pass
NVNT	ax20	5180	Ant2	1.04	0	1.04	24	Pass
NVNT	ax20	5180	Sum	4.33	0	4.33	24	Pass
NVNT	ax20	5200	Ant1	1.81	0	1.81	24	Pass
NVNT	ax20	5200	Ant2	1.11	0	1.11	24	Pass
NVNT	ax20	5200	Sum	4.66	0	4.66	24	Pass
NVNT	ax20	5240	Ant1	1.59	0	1.59	24	Pass
NVNT	ax20	5240	Ant2	1.17	0	1.17	24	Pass
NVNT	ax20	5240	Sum	4.41	0	4.41	24	Pass
NVNT	ax20	5260	Ant1	1.79	0	1.79	24	Pass
NVNT	ax20	5260	Ant2	1.41	0	1.41	24	Pass
NVNT	ax20	5260	Sum	5.05	0	5.05	24	Pass
NVNT	ax20	5300	Ant1	2.37	0	2.37	24	Pass
NVNT	ax20	5300	Ant2	1.37	0	1.37	24	Pass
NVNT	ax20	5300	Sum	5.73	0	5.73	24	Pass
NVNT	ax20	5320	Ant1	2.90	0	2.90	24	Pass
NVNT	ax20	5320	Ant2	1.34	0	1.34	24	Pass
NVNT	ax20	5320	Sum	6.27	0	6.27	24	Pass
NVNT	ax20	5500	Ant1	2.25	0	2.25	24	Pass
NVNT	ax20	5500	Ant2	1.36	0	1.36	24	Pass
NVNT	ax20	5500	Sum	5.59	0	5.59	24	Pass
NVNT	ax20	5580	Ant1	2.66	0	2.66	24	Pass
NVNT	ax20	5580	Ant2	1.13	0	1.13	24	Pass
NVNT	ax20	5580	Sum	5.79	0	5.79	24	Pass
NVNT	ax20	5700	Ant1	2.68	0	2.68	24	Pass
NVNT	ax20	5700	Ant2	0.99	0	0.99	24	Pass
NVNT	ax20	5700	Sum	5.65	0	5.65	24	Pass
NVNT	ax20	5745	Ant1	2.10	0	2.10	30	Pass
NVNT	ax20	5745	Ant2	0.94	0	0.94	30	Pass
NVNT	ax20	5745	Sum	4.84	0	4.84	30	Pass
NVNT	ax20	5785	Ant1	2.54	0	2.54	30	Pass
NVNT	ax20	5785	Ant2	0.89	0	0.89	30	Pass
NVNT	ax20	5785	Sum	5.34	0	5.34	30	Pass
NVNT	ax20	5825	Ant1	2.17	0	2.17	30	Pass
NVNT	ax20	5825	Ant2	0.68	0	0.68	30	Pass
NVNT	ax20	5825	Sum	4.54	0	4.54	30	Pass
NVNT	ax40	5190	Ant1	4.25	0	4.25	24	Pass
NVNT	ax40	5230	Ant1	4.84	0	4.84	24	Pass
NVNT	ax40	5270	Ant1	5.54	0	5.54	24	Pass
NVNT	ax40	5310	Ant1	5.77	0	5.77	24	Pass
NVNT	ax40	5510	Ant1	5.71	0	5.71	24	Pass
NVNT	ax40	5550	Ant1	4.78	0	4.78	24	Pass
NVNT	ax40	5670	Ant1	4.82	0	4.82	24	Pass
NVNT	ax40	5755	Ant1	5.01	0	5.01	30	Pass
NVNT	ax40	5795	Ant1	4.97	0	4.97	30	Pass
NVNT	ax40	5190	Ant2	1.16	0	1.16	24	Pass
NVNT	ax40	5230	Ant2	1.44	0	1.44	24	Pass
NVNT	ax40	5270	Ant2	2.28	0	2.28	24	Pass



NVNT	ax40	5310	Ant2	2.01	0	2.01	24	Pass
NVNT	ax40	5510	Ant2	1.86	0	1.86	24	Pass
NVNT	ax40	5550	Ant2	1.88	0	1.88	24	Pass
NVNT	ax40	5670	Ant2	0.38	0	0.38	24	Pass
NVNT	ax40	5755	Ant2	0.45	0	0.45	30	Pass
NVNT	ax40	5795	Ant2	0.11	0	0.11	30	Pass
NVNT	ax40	5190	Ant1	1.54	0	1.54	24	Pass
NVNT	ax40	5190	Ant2	0.99	0	0.99	24	Pass
NVNT	ax40	5190	Sum	4.02	0	4.02	24	Pass
NVNT	ax40	5230	Ant1	1.65	0	1.65	24	Pass
NVNT	ax40	5230	Ant2	1.14	0	1.14	24	Pass
NVNT	ax40	5230	Sum	4.46	0	4.46	24	Pass
NVNT	ax40	5270	Ant1	1.83	0	1.83	24	Pass
NVNT	ax40	5270	Ant2	1.35	0	1.35	24	Pass
NVNT	ax40	5270	Sum	5.03	0	5.03	24	Pass
NVNT	ax40	5310	Ant1	2.51	0	2.51	24	Pass
NVNT	ax40	5310	Ant2	1.28	0	1.28	24	Pass
NVNT	ax40	5310	Sum	5.78	0	5.78	24	Pass
NVNT	ax40	5510	Ant1	1.79	0	1.79	24	Pass
NVNT	ax40	5510	Ant2	1.08	0	1.08	24	Pass
NVNT	ax40	5510	Sum	4.58	0	4.58	24	Pass
NVNT	ax40	5550	Ant1	2.52	0	2.52	24	Pass
NVNT	ax40	5550	Ant2	1.19	0	1.19	24	Pass
NVNT	ax40	5550	Sum	5.70	0	5.70	24	Pass
NVNT	ax40	5670	Ant1	2.51	0	2.51	24	Pass
NVNT	ax40	5670	Ant2	0.79	0	0.79	24	Pass
NVNT	ax40	5670	Sum	5.19	0	5.19	24	Pass
NVNT	ax40	5755	Ant1	1.99	0	1.99	30	Pass
NVNT	ax40	5755	Ant2	0.78	0	0.78	30	Pass
NVNT	ax40	5755	Sum	4.42	0	4.42	30	Pass
NVNT	ax40	5795	Ant1	2.52	0	2.52	30	Pass
NVNT	ax40	5795	Ant2	0.79	0	0.79	30	Pass
NVNT	ax40	5795	Sum	5.20	0	5.20	30	Pass
NVNT	ax80	5210	Ant1	3.28	0	3.28	24	Pass
NVNT	ax80	5290	Ant1	4.31	0	4.31	24	Pass
NVNT	ax80	5530	Ant1	4.96	0	4.96	24	Pass
NVNT	ax80	5610	Ant1	4.61	0	4.61	24	Pass
NVNT	ax80	5775	Ant1	4.97	0	4.97	30	Pass
NVNT	ax80	5210	Ant2	0.9	0	0.9	24	Pass
NVNT	ax80	5290	Ant2	1.97	0	1.97	24	Pass
NVNT	ax80	5530	Ant2	1.84	0	1.84	24	Pass
NVNT	ax80	5610	Ant2	0.01	0	0.01	24	Pass
NVNT	ax80	5775	Ant2	0.07	0	0.07	30	Pass
NVNT	ax80	5210	Ant1	1.44	0	1.44	24	Pass
NVNT	ax80	5210	Ant2	0.91	0	0.91	24	Pass
NVNT	ax80	5210	Sum	3.69	0	3.69	24	Pass
NVNT	ax80	5290	Ant1	2.08	0	2.08	24	Pass
NVNT	ax80	5290	Ant2	1.23	0	1.23	24	Pass
NVNT	ax80	5290	Sum	5.21	0	5.21	24	Pass
NVNT	ax80	5530	Ant1	2.32	0	2.32	24	Pass
NVNT	ax80	5530	Ant2	1.18	0	1.18	24	Pass
NVNT	ax80	5530	Sum	5.44	0	5.44	24	Pass
NVNT	ax80	5610	Ant1	2.10	0	2.10	24	Pass
NVNT	ax80	5610	Ant2	0.91	0	0.91	24	Pass
NVNT	ax80	5610	Sum	4.79	0	4.79	24	Pass
NVNT	ax80	5775	Ant1	2.31	0	2.31	30	Pass



NVNT	ax80	5775	Ant2	0.78	0	0.78	30	Pass
NVNT	ax80	5775	Sum	4.90	0	4.90	30	Pass



-26dB Bandwidth

Condition	Mode	Frequency (MHz)	Antenna	-26 dB Bandwidth (MHz)	Verdict
NVNT	a	5180	Ant1	23.904	Pass
NVNT	a	5200	Ant1	21.743	Pass
NVNT	a	5240	Ant1	22.129	Pass
NVNT	a	5260	Ant1	22.189	Pass
NVNT	a	5300	Ant1	22.005	Pass
NVNT	a	5320	Ant1	22.604	Pass
NVNT	a	5500	Ant1	22.267	Pass
NVNT	a	5580	Ant1	22.999	Pass
NVNT	a	5700	Ant1	22.671	Pass
NVNT	a	5180	Ant2	22.31	Pass
NVNT	a	5200	Ant2	22.806	Pass
NVNT	a	5240	Ant2	22.398	Pass
NVNT	a	5260	Ant2	22.863	Pass
NVNT	a	5300	Ant2	23.063	Pass
NVNT	a	5320	Ant2	22.79	Pass
NVNT	a	5500	Ant2	22.874	Pass
NVNT	a	5580	Ant2	22.659	Pass
NVNT	a	5700	Ant2	22.493	Pass
NVNT	n20	5180	Ant1	23.282	Pass
NVNT	n20	5200	Ant1	23.229	Pass
NVNT	n20	5240	Ant1	23.059	Pass
NVNT	n20	5260	Ant1	23.397	Pass
NVNT	n20	5300	Ant1	23.222	Pass
NVNT	n20	5320	Ant1	22.692	Pass
NVNT	n20	5500	Ant1	23.523	Pass
NVNT	n20	5580	Ant1	23.664	Pass
NVNT	n20	5700	Ant1	23.24	Pass
NVNT	n20	5180	Ant2	22.647	Pass
NVNT	n20	5200	Ant2	23.191	Pass
NVNT	n20	5240	Ant2	23.577	Pass
NVNT	n20	5260	Ant2	23.152	Pass
NVNT	n20	5300	Ant2	23.359	Pass
NVNT	n20	5320	Ant2	22.624	Pass
NVNT	n20	5500	Ant2	21.203	Pass
NVNT	n20	5580	Ant2	23.212	Pass
NVNT	n20	5700	Ant2	23.438	Pass
NVNT	n40	5190	Ant1	39.772	Pass
NVNT	n40	5230	Ant1	39.792	Pass
NVNT	n40	5270	Ant1	39.474	Pass
NVNT	n40	5310	Ant1	39.895	Pass
NVNT	n40	5510	Ant1	40.037	Pass
NVNT	n40	5550	Ant1	39.855	Pass
NVNT	n40	5670	Ant1	40.444	Pass
NVNT	n40	5190	Ant2	40.218	Pass
NVNT	n40	5230	Ant2	39.66	Pass
NVNT	n40	5270	Ant2	40.113	Pass
NVNT	n40	5310	Ant2	39.278	Pass
NVNT	n40	5510	Ant2	39.494	Pass
NVNT	n40	5550	Ant2	39.41	Pass
NVNT	n40	5670	Ant2	39.431	Pass
NVNT	ac20	5180	Ant1	22.619	Pass
NVNT	ac20	5200	Ant1	22.937	Pass
NVNT	ac20	5240	Ant1	23.331	Pass



NVNT	ac20	5260	Ant1	23.248	Pass
NVNT	ac20	5300	Ant1	23.915	Pass
NVNT	ac20	5320	Ant1	23.197	Pass
NVNT	ac20	5500	Ant1	22.945	Pass
NVNT	ac20	5580	Ant1	22.937	Pass
NVNT	ac20	5700	Ant1	23.397	Pass
NVNT	ac20	5180	Ant2	22.261	Pass
NVNT	ac20	5200	Ant2	21.786	Pass
NVNT	ac20	5240	Ant2	22.425	Pass
NVNT	ac20	5260	Ant2	22.158	Pass
NVNT	ac20	5300	Ant2	22.711	Pass
NVNT	ac20	5320	Ant2	22.644	Pass
NVNT	ac20	5500	Ant2	22.571	Pass
NVNT	ac20	5580	Ant2	19.721	Pass
NVNT	ac20	5700	Ant2	22.561	Pass
NVNT	ac40	5180	Ant1	39.822	Pass
NVNT	ac40	5190	Ant1	40.01	Pass
NVNT	ac40	5230	Ant1	40.417	Pass
NVNT	ac40	5270	Ant1	39.815	Pass
NVNT	ac40	5310	Ant1	40.182	Pass
NVNT	ac40	5510	Ant1	39.865	Pass
NVNT	ac40	5550	Ant1	39.808	Pass
NVNT	ac40	5670	Ant1	39.886	Pass
NVNT	ac40	5190	Ant2	39.56	Pass
NVNT	ac40	5230	Ant2	39.6	Pass
NVNT	ac40	5270	Ant2	39.147	Pass
NVNT	ac40	5310	Ant2	39.431	Pass
NVNT	ac40	5510	Ant2	39.645	Pass
NVNT	ac40	5550	Ant2	39.168	Pass
NVNT	ac40	5670	Ant2	39.592	Pass
NVNT	ac80	5210	Ant1	78.944	Pass
NVNT	ac80	5290	Ant1	79.263	Pass
NVNT	ac80	5530	Ant1	79.538	Pass
NVNT	ac80	5610	Ant1	79.207	Pass
NVNT	ac80	5210	Ant2	78.822	Pass
NVNT	ac80	5290	Ant2	78.792	Pass
NVNT	ac80	5530	Ant2	78.606	Pass
NVNT	ac80	5610	Ant2	78.606	Pass
NVNT	ax20	5180	Ant1	23.11	Pass
NVNT	ax20	5200	Ant1	23.085	Pass
NVNT	ax20	5240	Ant1	23.273	Pass
NVNT	ax20	5260	Ant1	22.209	Pass
NVNT	ax20	5300	Ant1	22.852	Pass
NVNT	ax20	5320	Ant1	23	Pass
NVNT	ax20	5500	Ant1	22.988	Pass
NVNT	ax20	5580	Ant1	23.063	Pass
NVNT	ax20	5700	Ant1	22.518	Pass
NVNT	ax40	5190	Ant1	39.394	Pass
NVNT	ax40	5230	Ant1	39.235	Pass
NVNT	ax40	5270	Ant1	39.321	Pass
NVNT	ax40	5310	Ant1	39.232	Pass
NVNT	ax40	5510	Ant1	39.354	Pass
NVNT	ax40	5550	Ant1	39.191	Pass
NVNT	ax40	5670	Ant1	39.209	Pass
NVNT	ax80	5210	Ant1	79.468	Pass
NVNT	ax80	5290	Ant1	79.392	Pass



NVNT	ax80	5530	Ant1	79.52	Pass
NVNT	ax80	5610	Ant1	79.636	Pass



Test Graphs

-26dB Bandwidth NVNT a 5180MHz Ant1





-26dB Bandwidth NVNT a 5200MHz Ant1





-26dB Bandwidth NVNT a 5240MHz Ant1




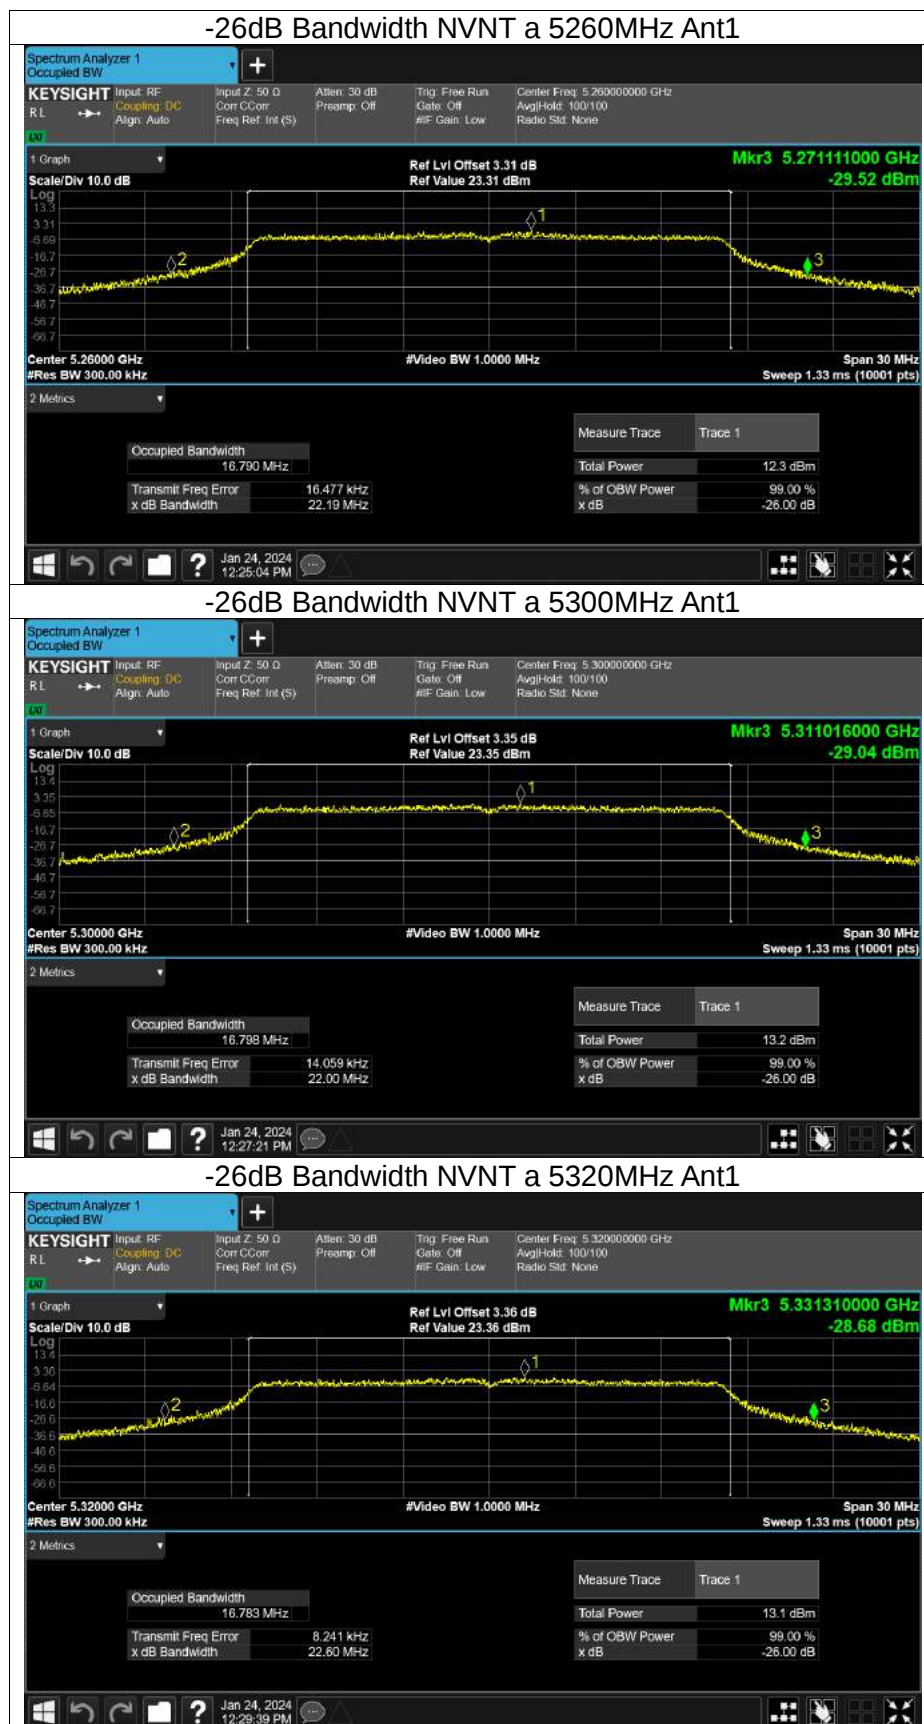

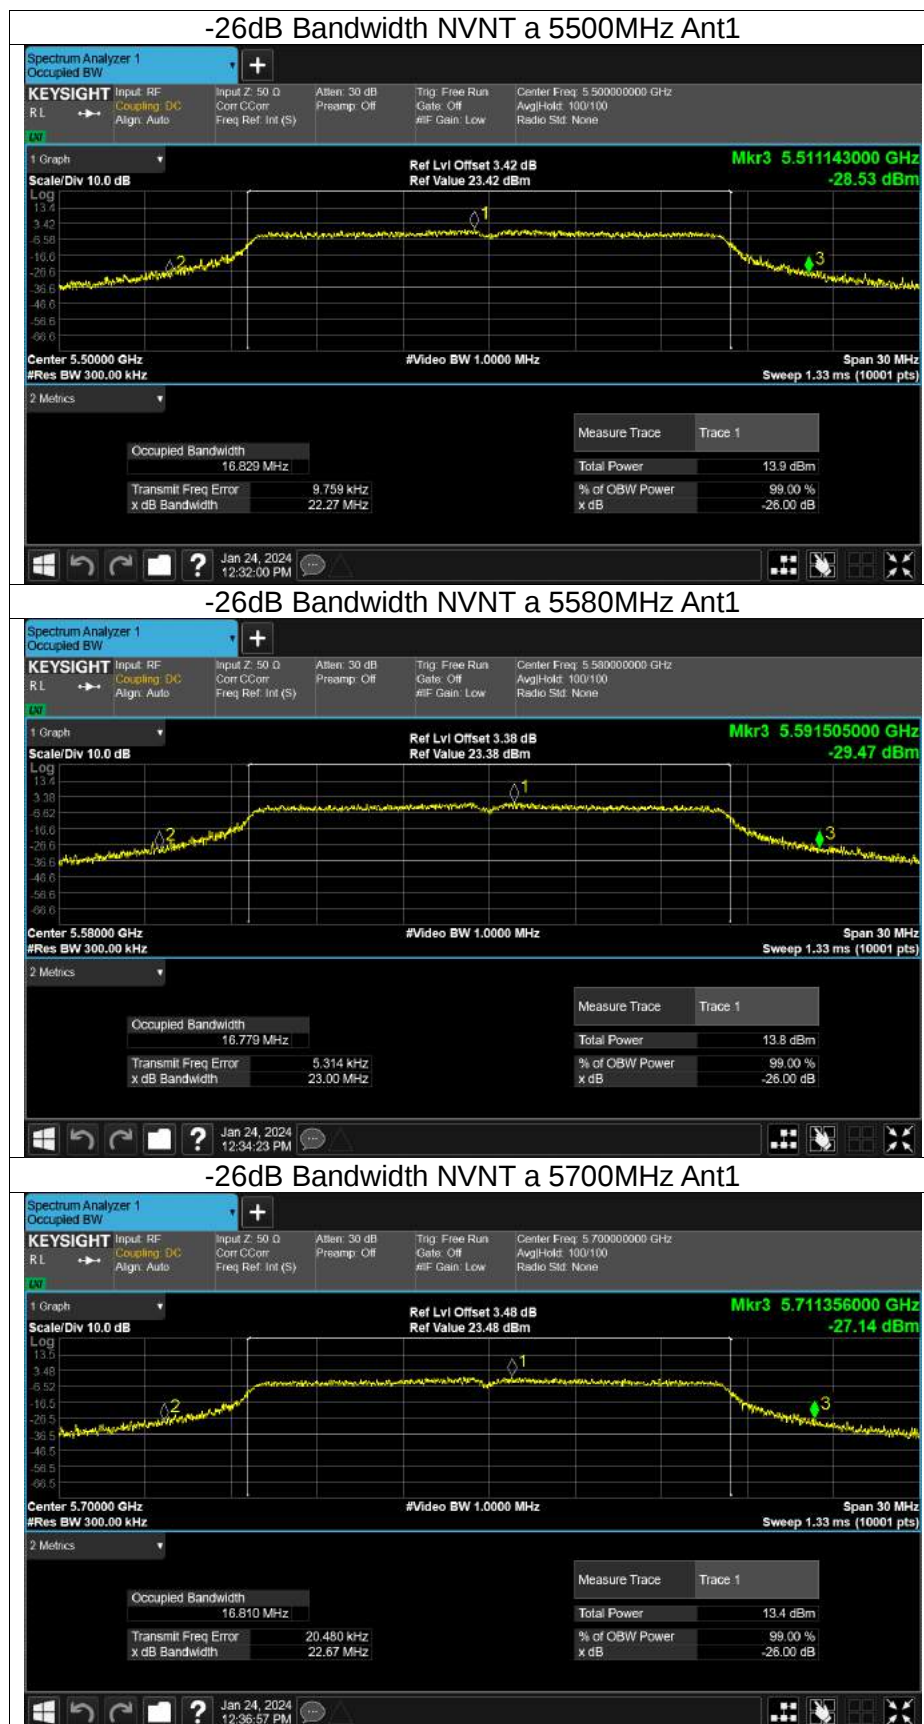

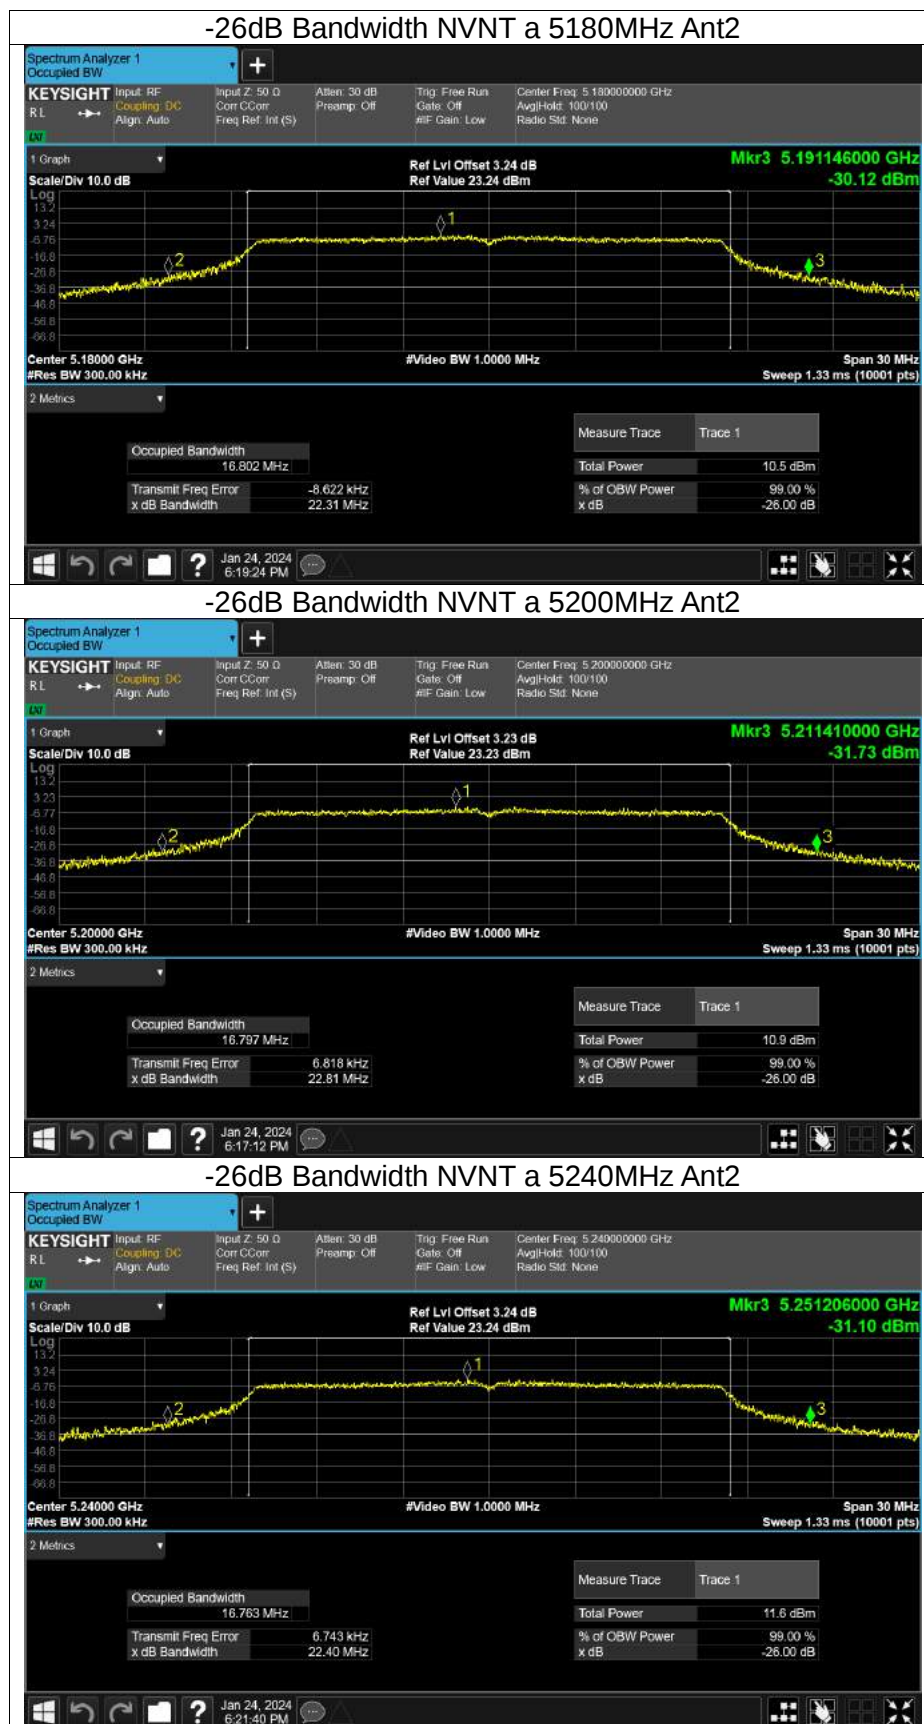

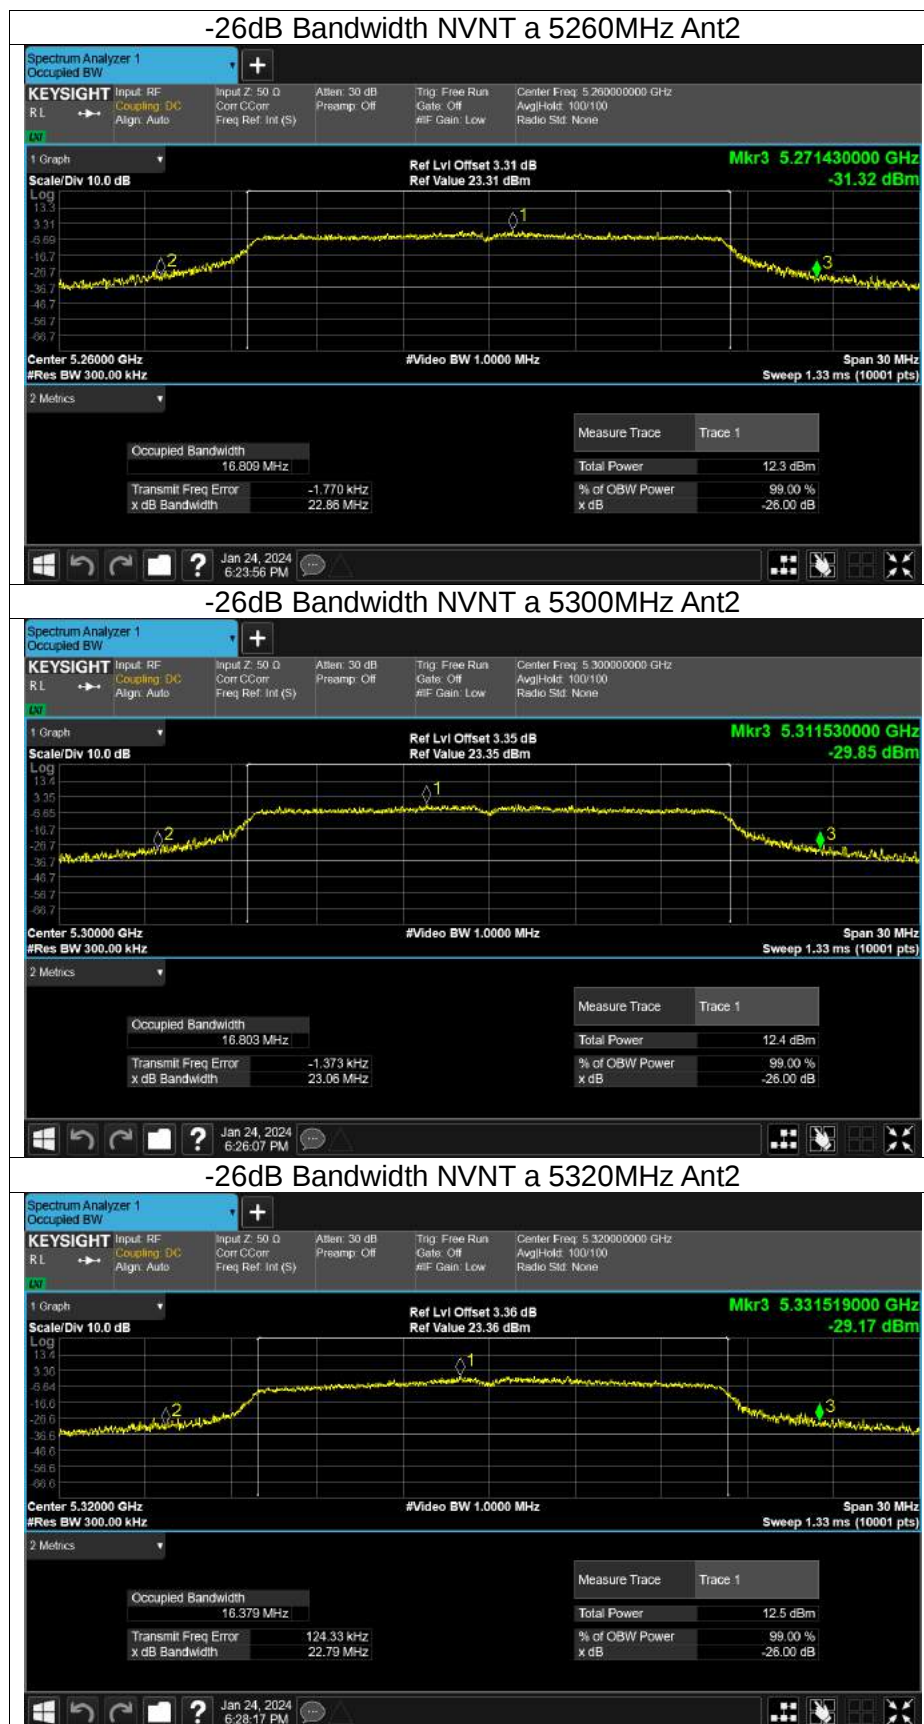

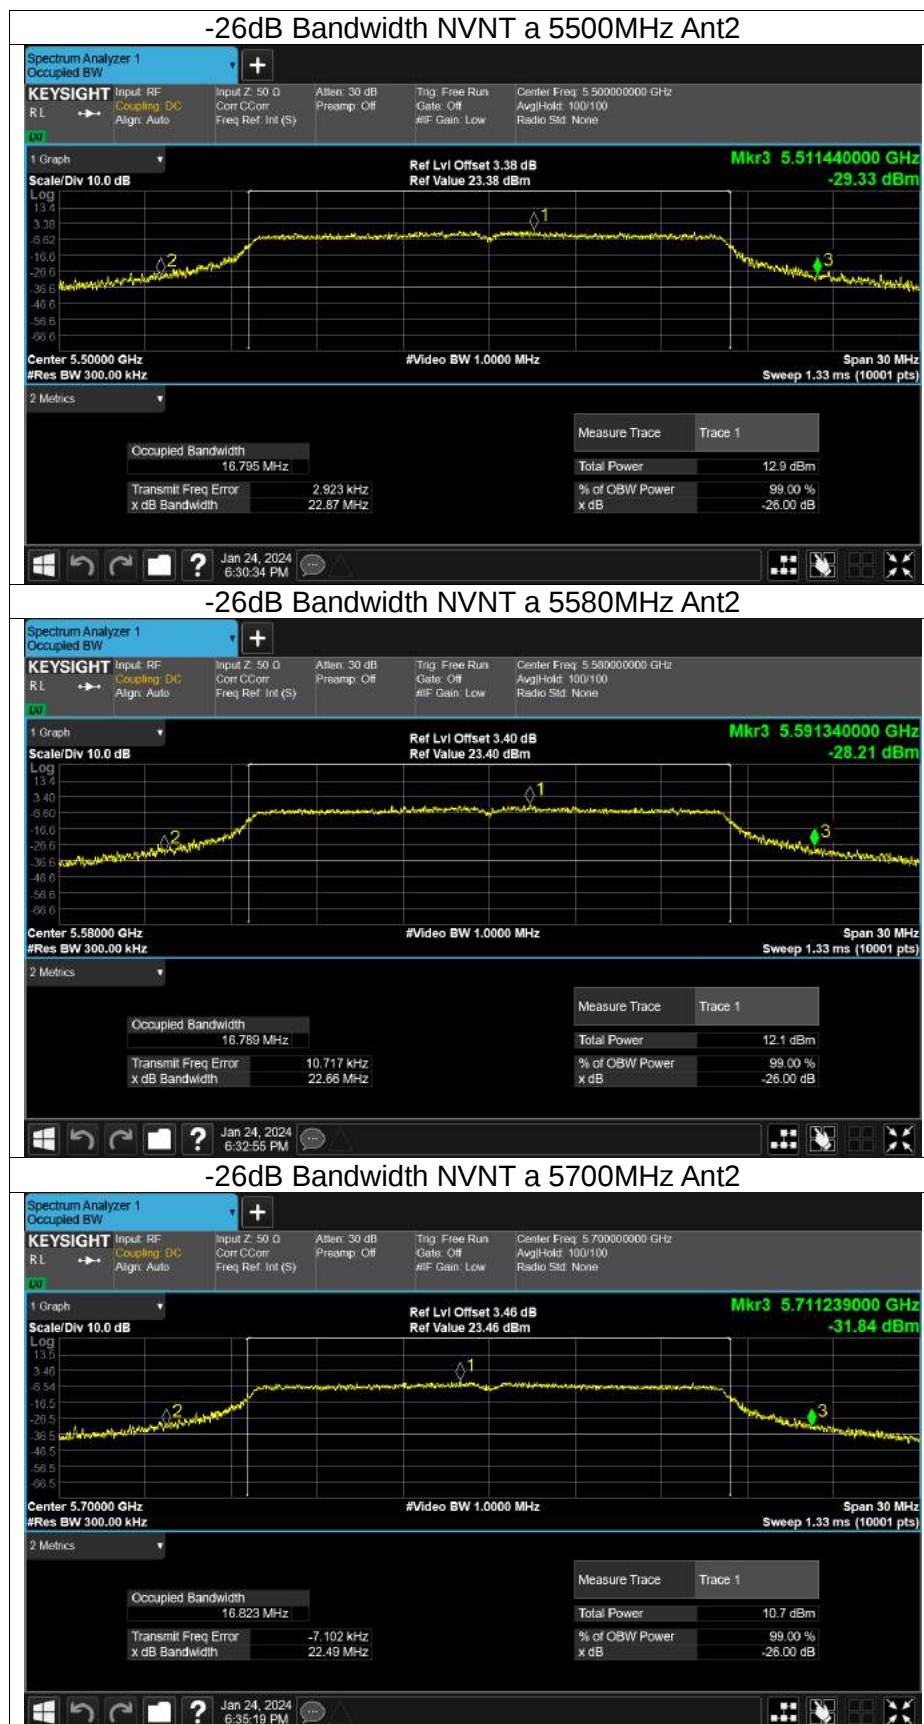



-26dB Bandwidth NVNT n20 5180MHz Ant1



-26dB Bandwidth NVNT n20 5200MHz Ant1



-26dB Bandwidth NVNT n20 5240MHz Ant1





-26dB Bandwidth NVNT n20 5260MHz Ant1



-26dB Bandwidth NVNT n20 5300MHz Ant1



-26dB Bandwidth NVNT n20 5320MHz Ant1





-26dB Bandwidth NVNT n20 5500MHz Ant1



-26dB Bandwidth NVNT n20 5580MHz Ant1



-26dB Bandwidth NVNT n20 5700MHz Ant1





-26dB Bandwidth NVNT n20 5180MHz Ant2



-26dB Bandwidth NVNT n20 5200MHz Ant2



-26dB Bandwidth NVNT n20 5240MHz Ant2





-26dB Bandwidth NVNT n20 5260MHz Ant2



-26dB Bandwidth NVNT n20 5300MHz Ant2



-26dB Bandwidth NVNT n20 5320MHz Ant2





-26dB Bandwidth NVNT n20 5500MHz Ant2



-26dB Bandwidth NVNT n20 5580MHz Ant2



-26dB Bandwidth NVNT n20 5700MHz Ant2





-26dB Bandwidth NVNT n40 5190MHz Ant1



-26dB Bandwidth NVNT n40 5230MHz Ant1



-26dB Bandwidth NVNT n40 5270MHz Ant1





-26dB Bandwidth NVNT n40 5310MHz Ant1



-26dB Bandwidth NVNT n40 5510MHz Ant1



-26dB Bandwidth NVNT n40 5550MHz Ant1





-26dB Bandwidth NVNT n40 5670MHz Ant1



-26dB Bandwidth NVNT n40 5190MHz Ant2



-26dB Bandwidth NVNT n40 5230MHz Ant2





-26dB Bandwidth NVNT n40 5270MHz Ant2



-26dB Bandwidth NVNT n40 5310MHz Ant2



-26dB Bandwidth NVNT n40 5510MHz Ant2

