



Appendix I: Test Data for E-UTRA Band 41

Product Name: Smart phone

Test Model: DL4s

Environmental Conditions

Temperature:	23.8° C
Relative Humidity:	52.1%
ATM Pressure:	100.0 kPa
Test Engineer:	Taylor Hu
Supervised by:	Ling Zhu



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen,
518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



I.1 Conducted Output Power Data

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	20.92	PASS
Band41	5MHz	QPSK	39675	1RB#12	21.16	PASS
Band41	5MHz	QPSK	39675	1RB#24	21.15	PASS
Band41	5MHz	QPSK	39675	12RB#0	20.05	PASS
Band41	5MHz	QPSK	39675	12RB#6	20.05	PASS
Band41	5MHz	QPSK	39675	12RB#13	20.00	PASS
Band41	5MHz	QPSK	39675	25RB#0	19.96	PASS
Band41	5MHz	QPSK	40620	1RB#0	20.95	PASS
Band41	5MHz	QPSK	40620	1RB#12	20.94	PASS
Band41	5MHz	QPSK	40620	1RB#24	20.94	PASS
Band41	5MHz	QPSK	40620	12RB#0	19.78	PASS
Band41	5MHz	QPSK	40620	12RB#6	19.77	PASS
Band41	5MHz	QPSK	40620	12RB#13	19.63	PASS
Band41	5MHz	QPSK	40620	25RB#0	19.66	PASS
Band41	5MHz	QPSK	41565	1RB#0	20.58	PASS
Band41	5MHz	QPSK	41565	1RB#12	20.62	PASS
Band41	5MHz	QPSK	41565	1RB#24	20.45	PASS
Band41	5MHz	QPSK	41565	12RB#0	19.39	PASS
Band41	5MHz	QPSK	41565	12RB#6	19.39	PASS
Band41	5MHz	QPSK	41565	12RB#13	19.45	PASS
Band41	5MHz	QPSK	41565	25RB#0	19.49	PASS
Band41	5MHz	16QAM	39675	1RB#0	20.34	PASS
Band41	5MHz	16QAM	39675	1RB#12	20.92	PASS
Band41	5MHz	16QAM	39675	1RB#24	20.92	PASS
Band41	5MHz	16QAM	39675	12RB#0	19.33	PASS
Band41	5MHz	16QAM	39675	12RB#6	19.33	PASS
Band41	5MHz	16QAM	39675	12RB#13	19.33	PASS
Band41	5MHz	16QAM	39675	25RB#0	19.50	PASS
Band41	5MHz	16QAM	40620	1RB#0	20.31	PASS
Band41	5MHz	16QAM	40620	1RB#12	20.33	PASS
Band41	5MHz	16QAM	40620	1RB#24	20.15	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	5MHz	16QAM	40620	12RB#0	19.19	PASS
Band41	5MHz	16QAM	40620	12RB#6	19.17	PASS
Band41	5MHz	16QAM	40620	12RB#13	19.07	PASS
Band41	5MHz	16QAM	40620	25RB#0	19.15	PASS
Band41	5MHz	16QAM	41565	1RB#0	19.81	PASS
Band41	5MHz	16QAM	41565	1RB#12	19.97	PASS
Band41	5MHz	16QAM	41565	1RB#24	19.77	PASS
Band41	5MHz	16QAM	41565	12RB#0	18.72	PASS
Band41	5MHz	16QAM	41565	12RB#6	18.74	PASS
Band41	5MHz	16QAM	41565	12RB#13	18.77	PASS
Band41	5MHz	16QAM	41565	25RB#0	18.86	PASS
Band41	10MHz	QPSK	39700	1RB#0	20.96	PASS
Band41	10MHz	QPSK	39700	1RB#24	20.76	PASS
Band41	10MHz	QPSK	39700	1RB#49	20.68	PASS
Band41	10MHz	QPSK	39700	25RB#0	20.04	PASS
Band41	10MHz	QPSK	39700	25RB#12	20.05	PASS
Band41	10MHz	QPSK	39700	25RB#25	19.90	PASS
Band41	10MHz	QPSK	39700	50RB#0	19.98	PASS
Band41	10MHz	QPSK	40620	1RB#0	21.32	PASS
Band41	10MHz	QPSK	40620	1RB#24	21.14	PASS
Band41	10MHz	QPSK	40620	1RB#49	21.15	PASS
Band41	10MHz	QPSK	40620	25RB#0	20.12	PASS
Band41	10MHz	QPSK	40620	25RB#12	20.13	PASS
Band41	10MHz	QPSK	40620	25RB#25	20.08	PASS
Band41	10MHz	QPSK	40620	50RB#0	20.03	PASS
Band41	10MHz	QPSK	41540	1RB#0	20.85	PASS
Band41	10MHz	QPSK	41540	1RB#24	20.86	PASS
Band41	10MHz	QPSK	41540	1RB#49	20.88	PASS
Band41	10MHz	QPSK	41540	25RB#0	19.72	PASS
Band41	10MHz	QPSK	41540	25RB#12	19.73	PASS
Band41	10MHz	QPSK	41540	25RB#25	19.58	PASS
Band41	10MHz	QPSK	41540	50RB#0	19.51	PASS
Band41	10MHz	16QAM	39700	1RB#0	20.60	PASS
Band41	10MHz	16QAM	39700	1RB#24	20.37	PASS
Band41	10MHz	16QAM	39700	1RB#49	20.31	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	10MHz	16QAM	39700	25RB#0	19.37	PASS
Band41	10MHz	16QAM	39700	25RB#12	19.37	PASS
Band41	10MHz	16QAM	39700	25RB#25	19.31	PASS
Band41	10MHz	16QAM	39700	50RB#0	19.39	PASS
Band41	10MHz	16QAM	40620	1RB#0	20.98	PASS
Band41	10MHz	16QAM	40620	1RB#24	20.77	PASS
Band41	10MHz	16QAM	40620	1RB#49	20.79	PASS
Band41	10MHz	16QAM	40620	25RB#0	19.43	PASS
Band41	10MHz	16QAM	40620	25RB#12	19.40	PASS
Band41	10MHz	16QAM	40620	25RB#25	19.35	PASS
Band41	10MHz	16QAM	40620	50RB#0	19.38	PASS
Band41	10MHz	16QAM	41540	1RB#0	20.31	PASS
Band41	10MHz	16QAM	41540	1RB#24	20.38	PASS
Band41	10MHz	16QAM	41540	1RB#49	20.39	PASS
Band41	10MHz	16QAM	41540	25RB#0	18.99	PASS
Band41	10MHz	16QAM	41540	25RB#12	18.97	PASS
Band41	10MHz	16QAM	41540	25RB#25	18.87	PASS
Band41	10MHz	16QAM	41540	50RB#0	18.94	PASS
Band41	15MHz	QPSK	39725	1RB#0	21.40	PASS
Band41	15MHz	QPSK	39725	1RB#38	21.22	PASS
Band41	15MHz	QPSK	39725	1RB#74	21.13	PASS
Band41	15MHz	QPSK	39725	38RB#0	20.25	PASS
Band41	15MHz	QPSK	39725	38RB#18	20.25	PASS
Band41	15MHz	QPSK	39725	38RB#37	20.25	PASS
Band41	15MHz	QPSK	39725	75RB#0	20.24	PASS
Band41	15MHz	QPSK	40620	1RB#0	21.36	PASS
Band41	15MHz	QPSK	40620	1RB#38	21.25	PASS
Band41	15MHz	QPSK	40620	1RB#74	21.11	PASS
Band41	15MHz	QPSK	40620	38RB#0	20.20	PASS
Band41	15MHz	QPSK	40620	38RB#18	20.20	PASS
Band41	15MHz	QPSK	40620	38RB#37	20.20	PASS
Band41	15MHz	QPSK	40620	75RB#0	20.20	PASS
Band41	15MHz	QPSK	41515	1RB#0	20.94	PASS
Band41	15MHz	QPSK	41515	1RB#38	20.87	PASS
Band41	15MHz	QPSK	41515	1RB#74	20.93	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	15MHz	QPSK	41515	38RB#0	19.84	PASS
Band41	15MHz	QPSK	41515	38RB#18	19.84	PASS
Band41	15MHz	QPSK	41515	38RB#37	19.84	PASS
Band41	15MHz	QPSK	41515	75RB#0	19.85	PASS
Band41	15MHz	16QAM	39725	1RB#0	21.01	PASS
Band41	15MHz	16QAM	39725	1RB#38	20.82	PASS
Band41	15MHz	16QAM	39725	1RB#74	20.75	PASS
Band41	15MHz	16QAM	39725	38RB#0	20.25	PASS
Band41	15MHz	16QAM	39725	38RB#18	20.25	PASS
Band41	15MHz	16QAM	39725	38RB#37	20.25	PASS
Band41	15MHz	16QAM	39725	75RB#0	19.58	PASS
Band41	15MHz	16QAM	40620	1RB#0	20.99	PASS
Band41	15MHz	16QAM	40620	1RB#38	20.86	PASS
Band41	15MHz	16QAM	40620	1RB#74	20.77	PASS
Band41	15MHz	16QAM	40620	38RB#0	20.20	PASS
Band41	15MHz	16QAM	40620	38RB#18	20.20	PASS
Band41	15MHz	16QAM	40620	38RB#37	20.20	PASS
Band41	15MHz	16QAM	40620	75RB#0	19.47	PASS
Band41	15MHz	16QAM	41515	1RB#0	20.37	PASS
Band41	15MHz	16QAM	41515	1RB#38	20.38	PASS
Band41	15MHz	16QAM	41515	1RB#74	20.44	PASS
Band41	15MHz	16QAM	41515	38RB#0	19.84	PASS
Band41	15MHz	16QAM	41515	38RB#18	19.84	PASS
Band41	15MHz	16QAM	41515	38RB#37	19.84	PASS
Band41	15MHz	16QAM	41515	75RB#0	19.06	PASS
Band41	20MHz	QPSK	39750	1RB#0	20.88	PASS
Band41	20MHz	QPSK	39750	1RB#49	20.77	PASS
Band41	20MHz	QPSK	39750	1RB#99	20.56	PASS
Band41	20MHz	QPSK	39750	50RB#0	20.32	PASS
Band41	20MHz	QPSK	39750	50RB#25	20.33	PASS
Band41	20MHz	QPSK	39750	50RB#50	20.02	PASS
Band41	20MHz	QPSK	39750	100RB#0	20.13	PASS
Band41	20MHz	QPSK	40620	1RB#0	21.42	PASS
Band41	20MHz	QPSK	40620	1RB#49	21.10	PASS
Band41	20MHz	QPSK	40620	1RB#99	20.98	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	20MHz	QPSK	40620	50RB#0	20.19	PASS
Band41	20MHz	QPSK	40620	50RB#25	20.21	PASS
Band41	20MHz	QPSK	40620	50RB#50	20.01	PASS
Band41	20MHz	QPSK	40620	100RB#0	20.12	PASS
Band41	20MHz	QPSK	41490	1RB#0	20.96	PASS
Band41	20MHz	QPSK	41490	1RB#49	20.98	PASS
Band41	20MHz	QPSK	41490	1RB#99	21.10	PASS
Band41	20MHz	QPSK	41490	50RB#0	19.94	PASS
Band41	20MHz	QPSK	41490	50RB#25	19.76	PASS
Band41	20MHz	QPSK	41490	50RB#50	19.91	PASS
Band41	20MHz	QPSK	41490	100RB#0	19.85	PASS
Band41	20MHz	16QAM	39750	1RB#0	20.54	PASS
Band41	20MHz	16QAM	39750	1RB#49	20.52	PASS
Band41	20MHz	16QAM	39750	1RB#99	20.41	PASS
Band41	20MHz	16QAM	39750	50RB#0	19.74	PASS
Band41	20MHz	16QAM	39750	50RB#25	19.74	PASS
Band41	20MHz	16QAM	39750	50RB#50	19.57	PASS
Band41	20MHz	16QAM	39750	100RB#0	19.46	PASS
Band41	20MHz	16QAM	40620	1RB#0	21.29	PASS
Band41	20MHz	16QAM	40620	1RB#49	20.96	PASS
Band41	20MHz	16QAM	40620	1RB#99	20.75	PASS
Band41	20MHz	16QAM	40620	50RB#0	19.72	PASS
Band41	20MHz	16QAM	40620	50RB#25	19.73	PASS
Band41	20MHz	16QAM	40620	50RB#50	19.63	PASS
Band41	20MHz	16QAM	40620	100RB#0	19.56	PASS
Band41	20MHz	16QAM	41490	1RB#0	20.59	PASS
Band41	20MHz	16QAM	41490	1RB#49	20.45	PASS
Band41	20MHz	16QAM	41490	1RB#99	20.63	PASS
Band41	20MHz	16QAM	41490	50RB#0	19.22	PASS
Band41	20MHz	16QAM	41490	50RB#25	19.22	PASS
Band41	20MHz	16QAM	41490	50RB#50	19.28	PASS
Band41	20MHz	16QAM	41490	100RB#0	19.19	PASS





I.2 Peak-to-Average Ratio(CCDF)

Test Result


Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dB)	Limit(dB)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	5.18	13	PASS
Band41	5MHz	QPSK	40620	25RB#0	5.27	13	PASS
Band41	5MHz	QPSK	41565	25RB#0	5.21	13	PASS
Band41	5MHz	16QAM	39675	25RB#0	5.83	13	PASS
Band41	5MHz	16QAM	40620	25RB#0	5.92	13	PASS
Band41	5MHz	16QAM	41565	25RB#0	5.90	13	PASS
Band41	10MHz	QPSK	39700	50RB#0	5.27	13	PASS
Band41	10MHz	QPSK	40620	50RB#0	5.27	13	PASS
Band41	10MHz	QPSK	41540	50RB#0	5.24	13	PASS
Band41	10MHz	16QAM	39700	50RB#0	5.93	13	PASS
Band41	10MHz	16QAM	40620	50RB#0	5.96	13	PASS
Band41	10MHz	16QAM	41540	50RB#0	5.93	13	PASS
Band41	15MHz	QPSK	39725	75RB#0	5.50	13	PASS
Band41	15MHz	QPSK	40620	75RB#0	5.55	13	PASS
Band41	15MHz	QPSK	41515	75RB#0	5.51	13	PASS
Band41	15MHz	16QAM	39725	75RB#0	6.04	13	PASS
Band41	15MHz	16QAM	40620	75RB#0	6.06	13	PASS
Band41	15MHz	16QAM	41515	75RB#0	6.08	13	PASS
Band41	20MHz	QPSK	39750	100RB#0	5.26	13	PASS
Band41	20MHz	QPSK	40620	100RB#0	5.34	13	PASS
Band41	20MHz	QPSK	41490	100RB#0	5.29	13	PASS
Band41	20MHz	16QAM	39750	100RB#0	5.98	13	PASS
Band41	20MHz	16QAM	40620	100RB#0	6.00	13	PASS
Band41	20MHz	16QAM	41490	100RB#0	6.00	13	PASS






Test Graphs

Band41-5MHz-QPSK-39675-25RB#0

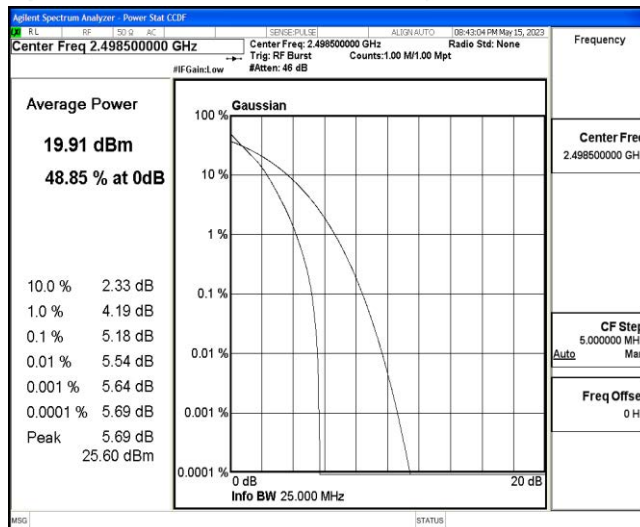

Band41-5MHz-QPSK-40620-25RB#0

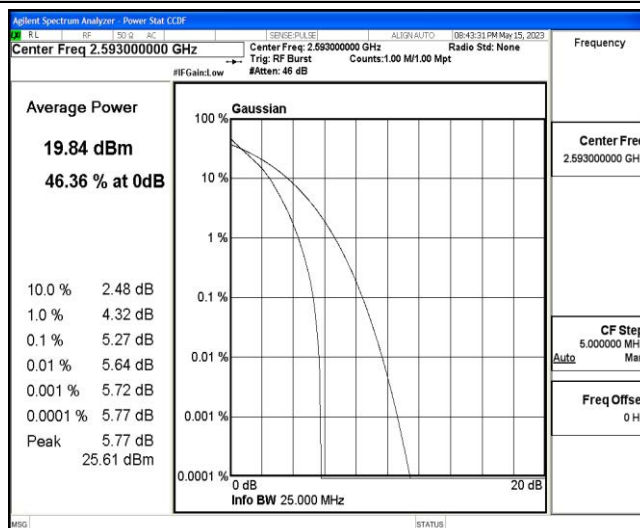

Band41-5MHz-QPSK-41565-25RB#0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

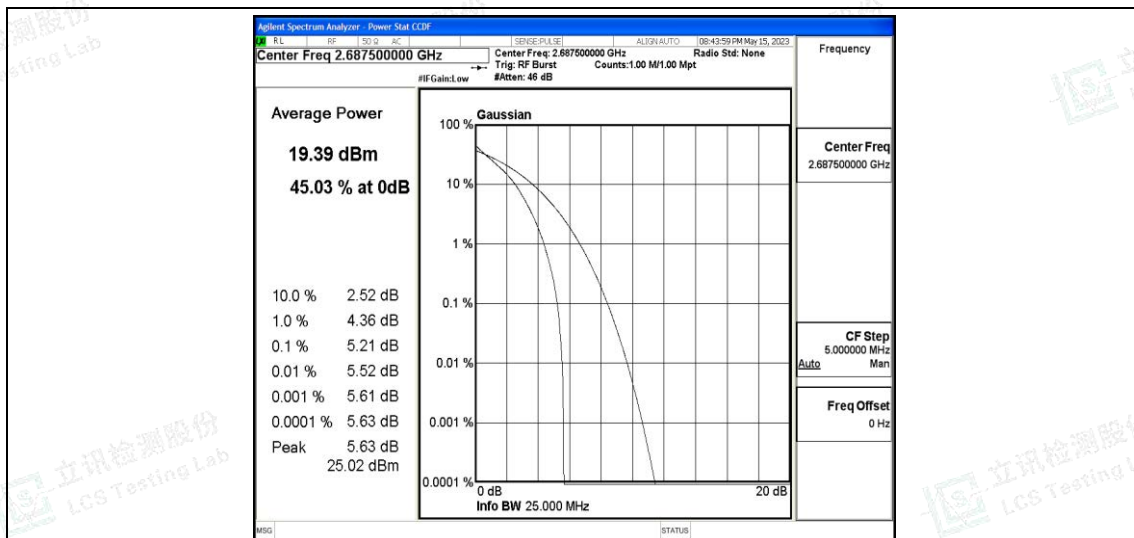

Band41-5MHz-16QAM-39675-25RB#0

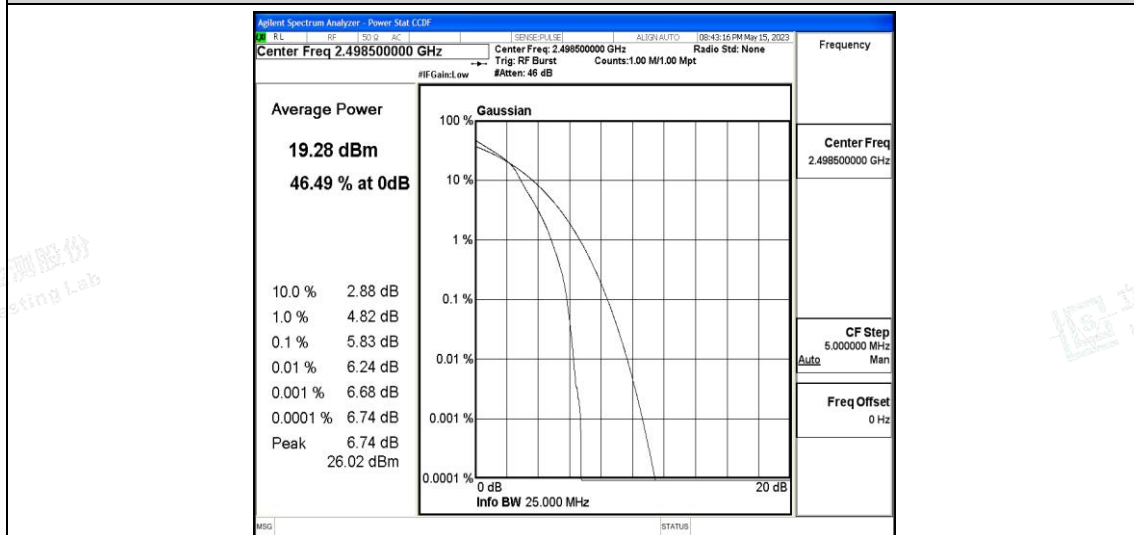


Band41-5MHz-16QAM-40620-25RB#0

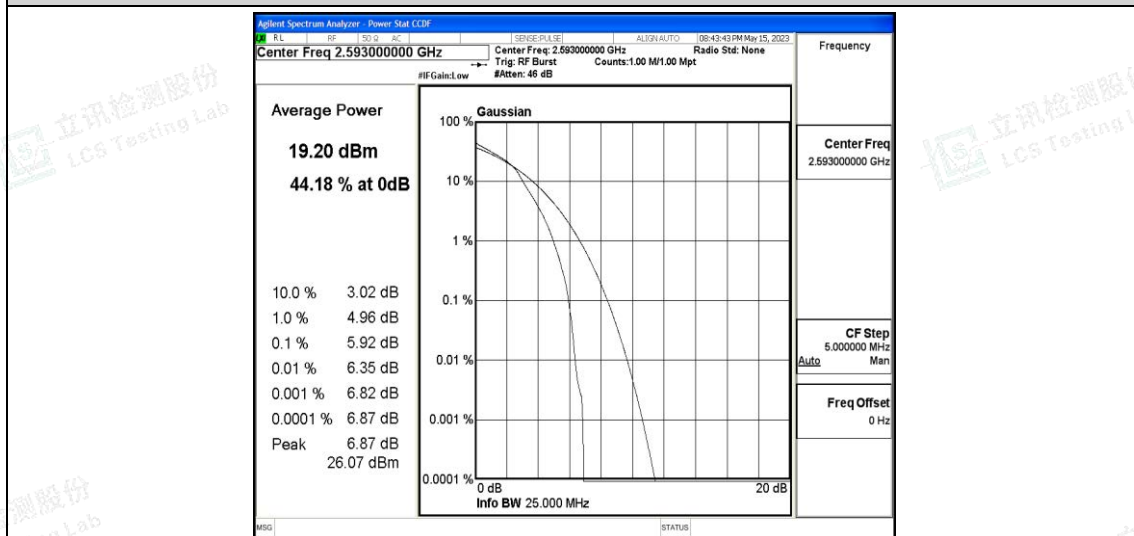


Band41-5MHz-16QAM-41565-25RB#0




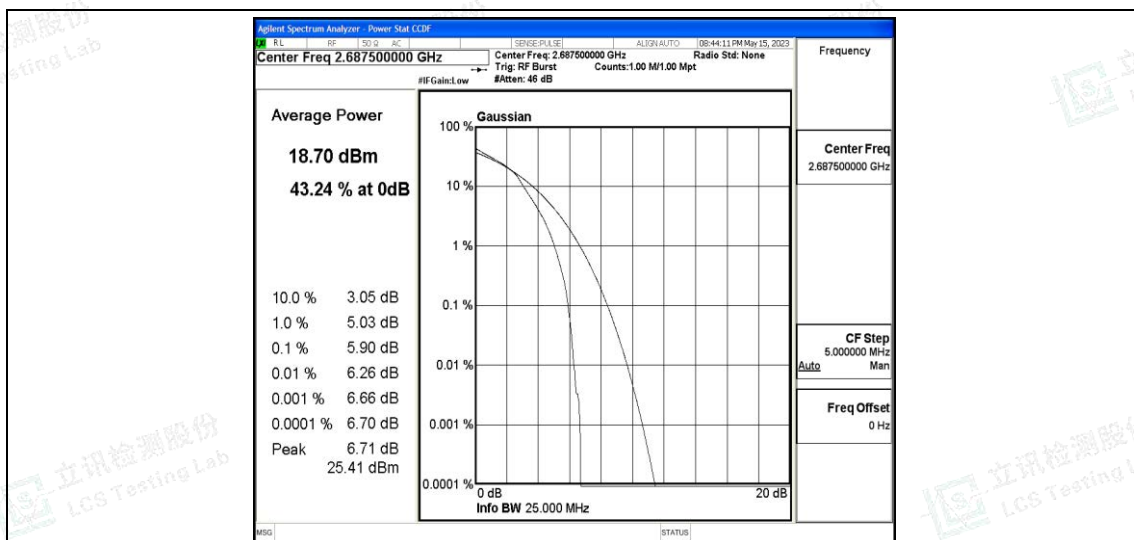

Band41-10MHz-QPSK-39700-50RB#0

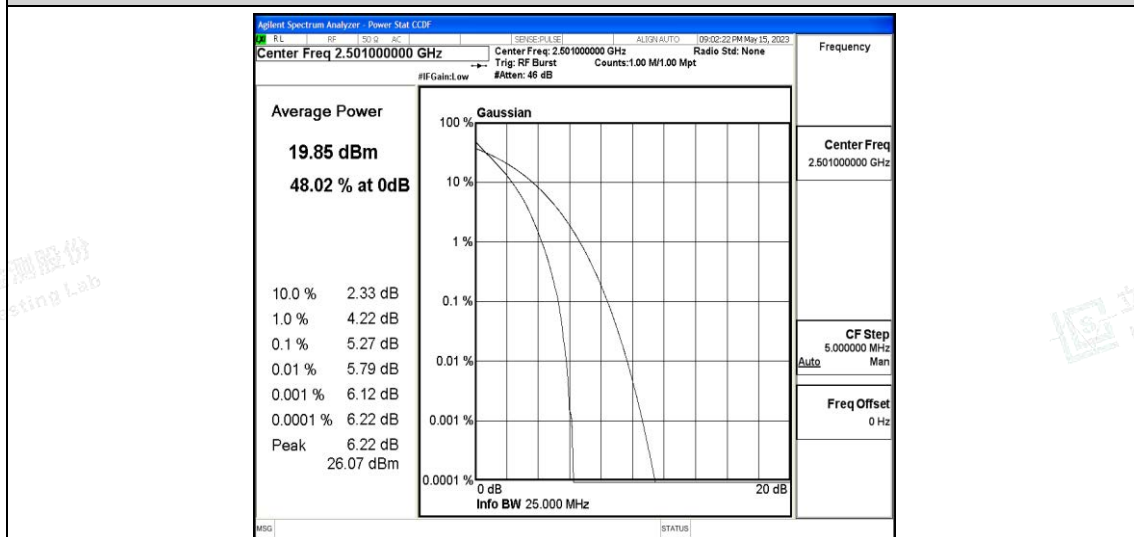


Band41-10MHz-QPSK-40620-50RB#0

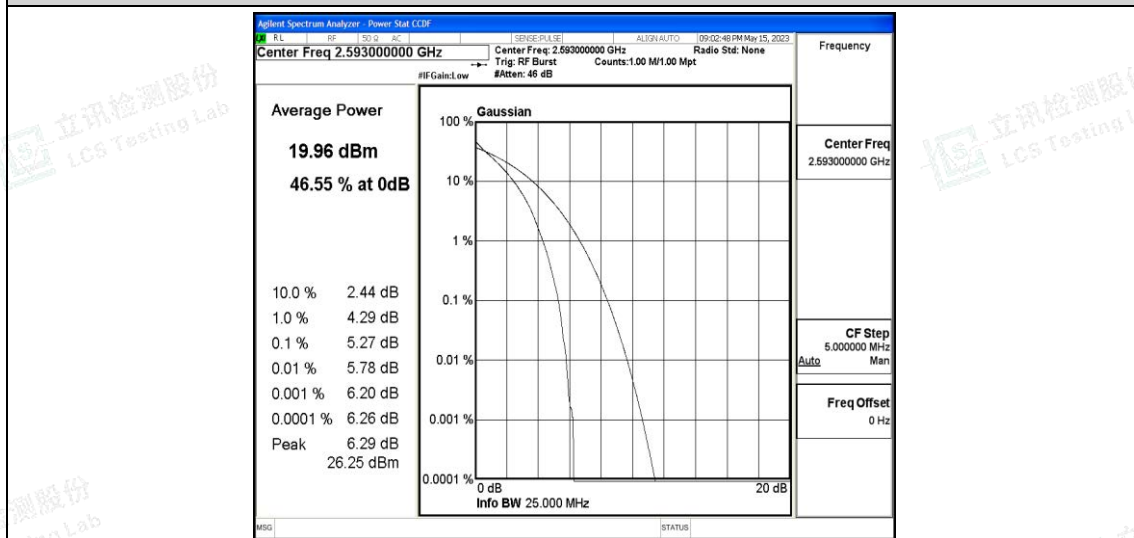


Band41-10MHz-QPSK-41540-50RB#0




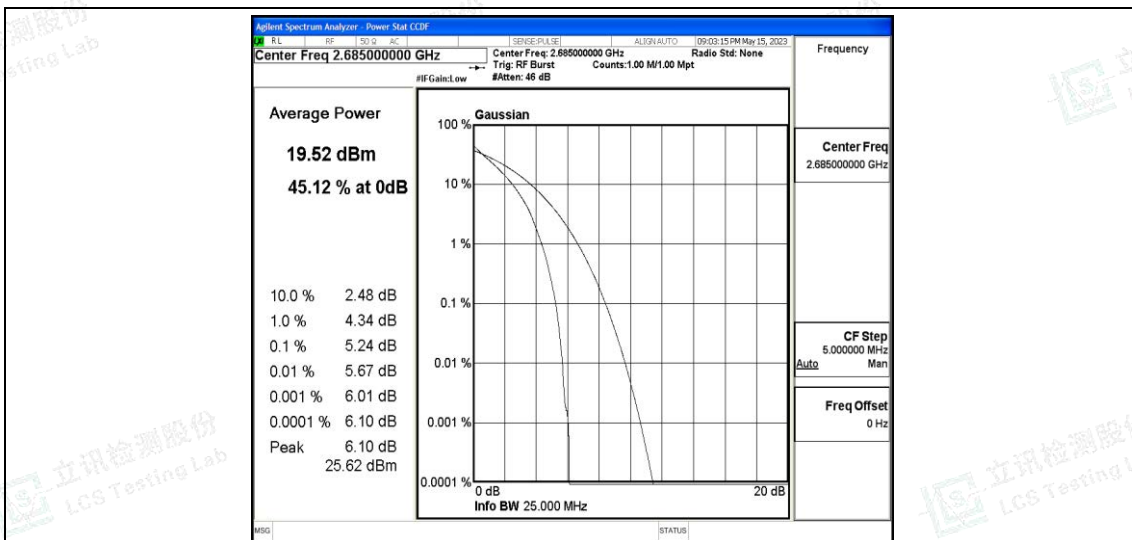

Band41-10MHz-16QAM-39700-50RB#0

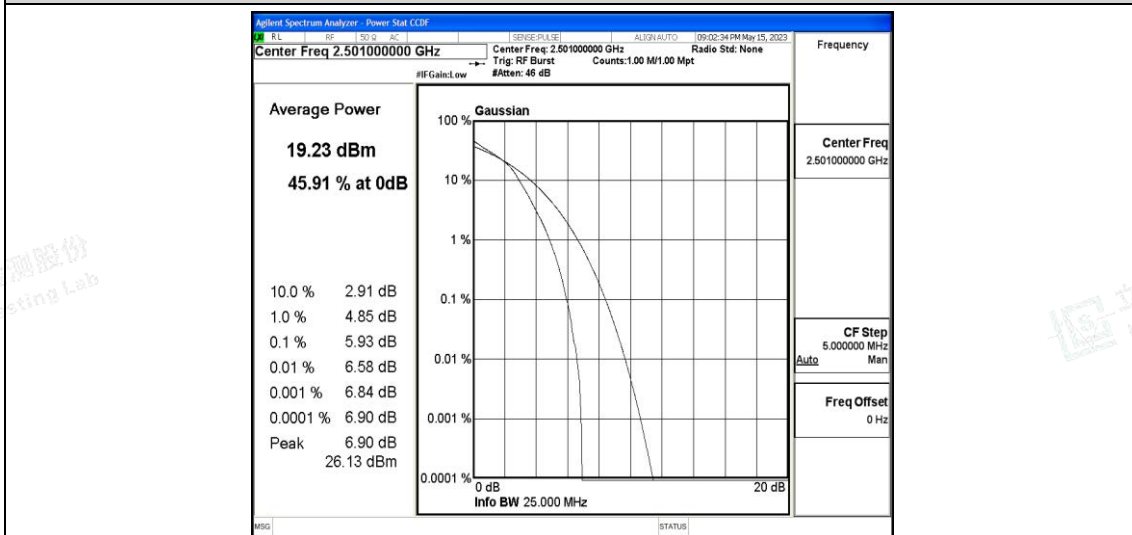


Band41-10MHz-16QAM-40620-50RB#0

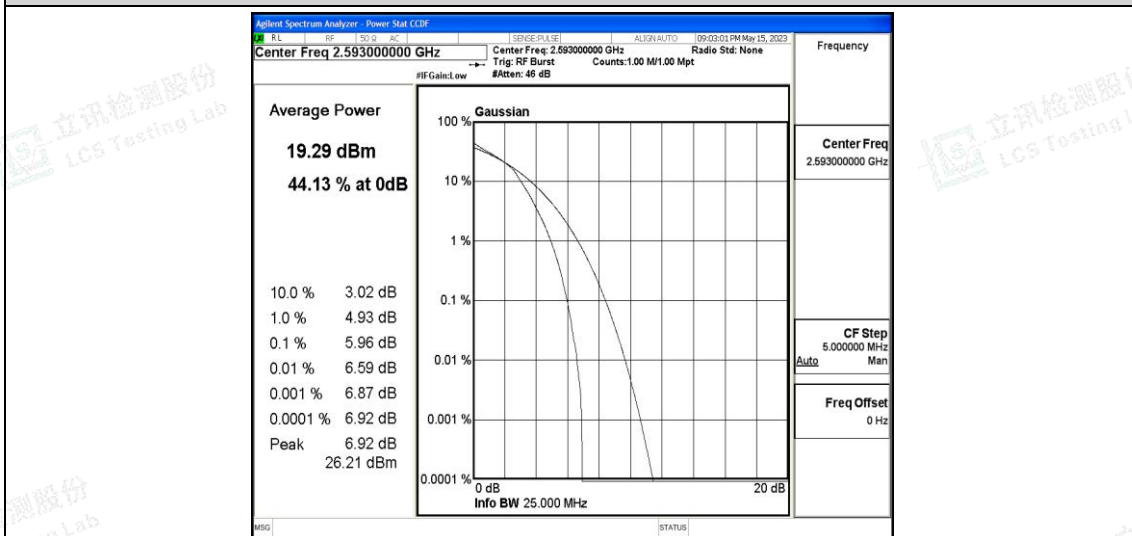


Band41-10MHz-16QAM-41540-50RB#0




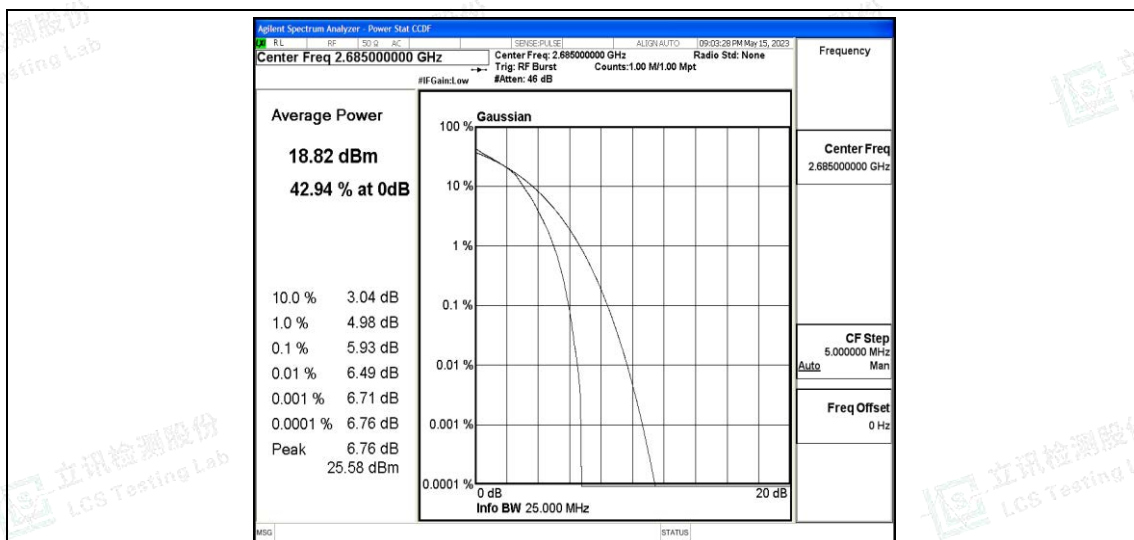

Band41-15MHz-QPSK-39725-75RB#0

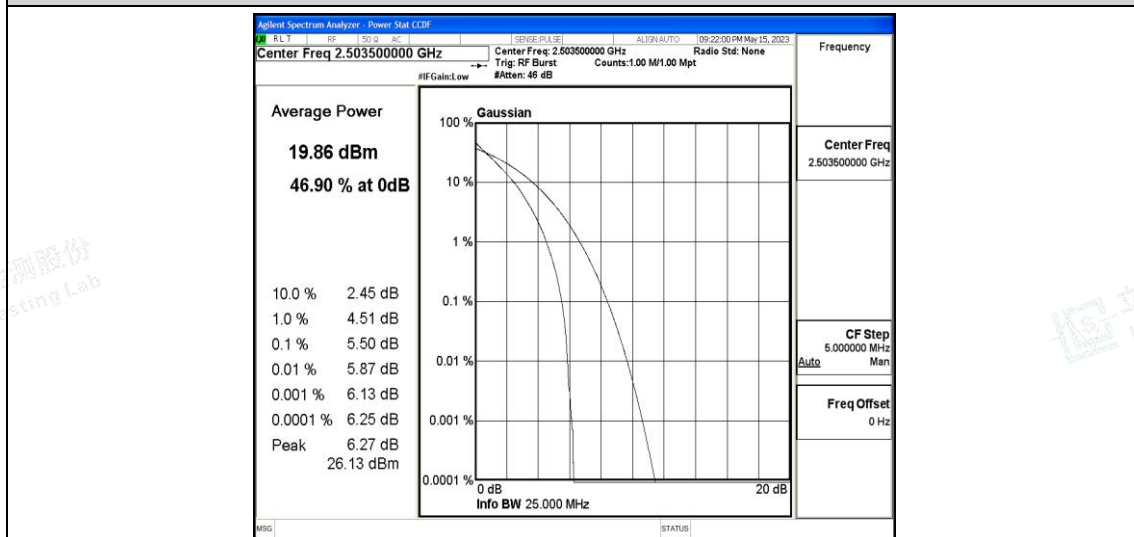


Band41-15MHz-QPSK-40620-75RB#0

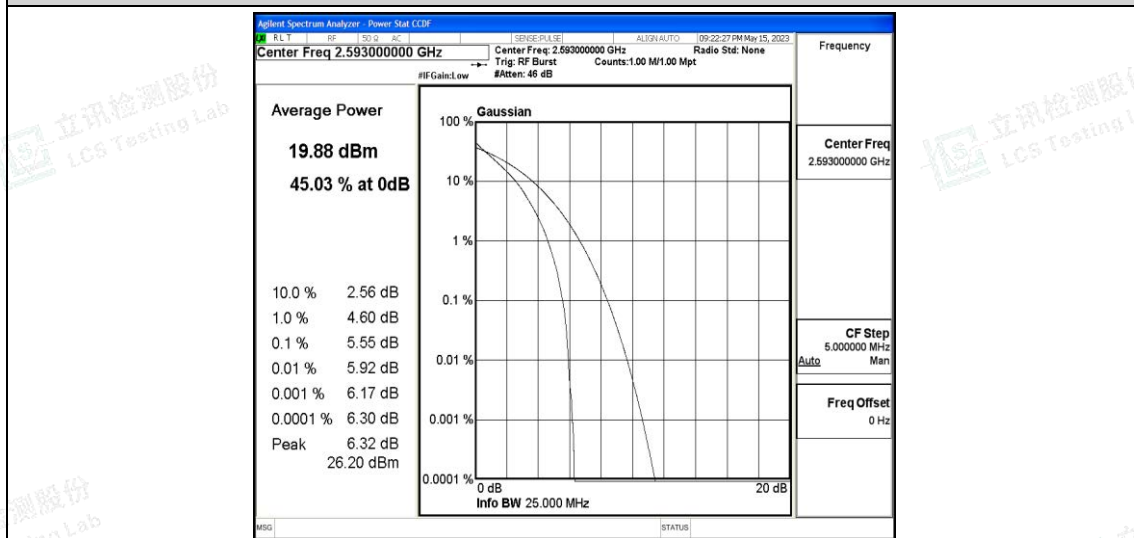


Band41-15MHz-QPSK-41515-75RB#0




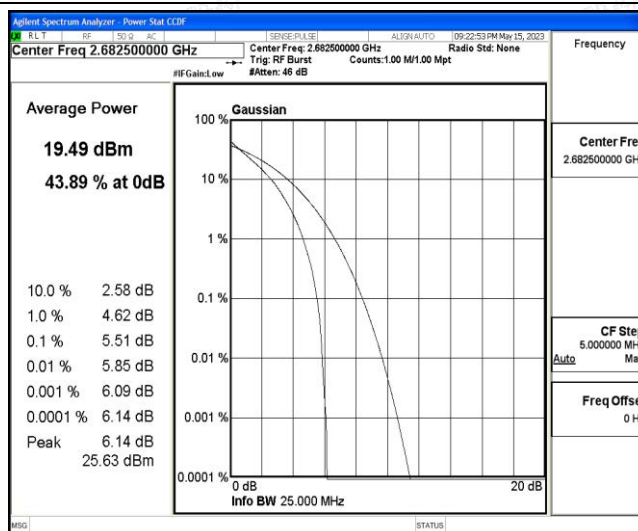

Band41-15MHz-16QAM-39725-75RB#0

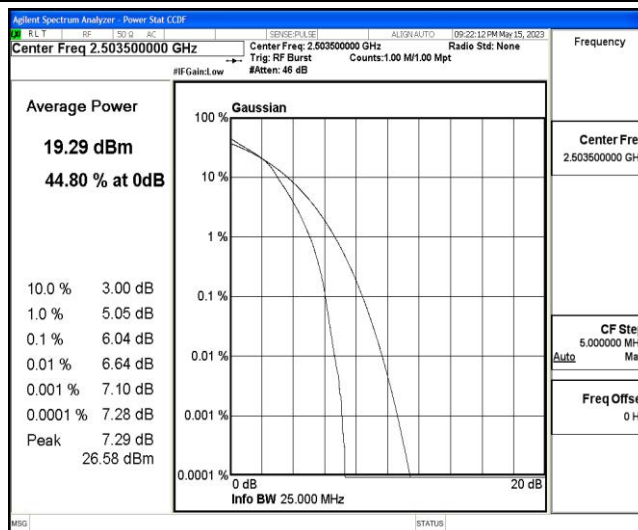


Band41-15MHz-16QAM-40620-75RB#0

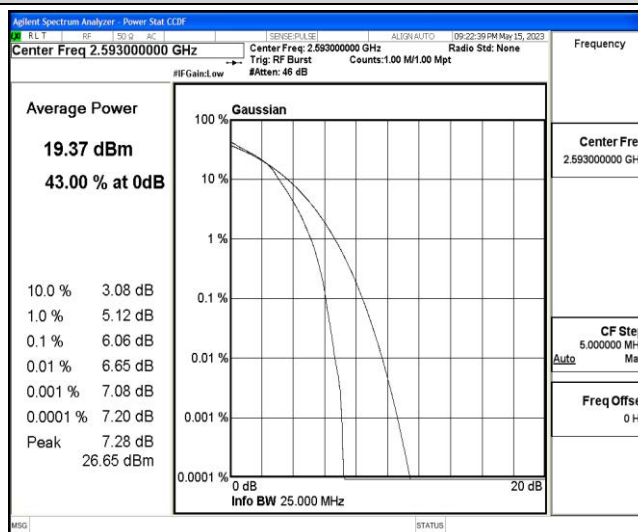


Band41-15MHz-16QAM-41515-75RB#0




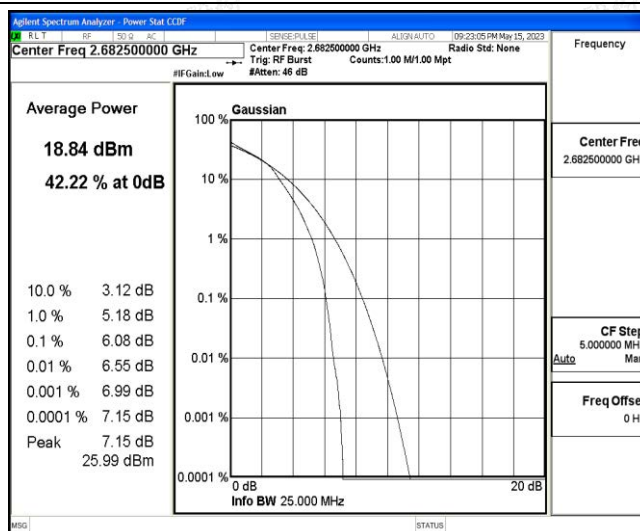

Band41-20MHz-QPSK-39750-100RB#0

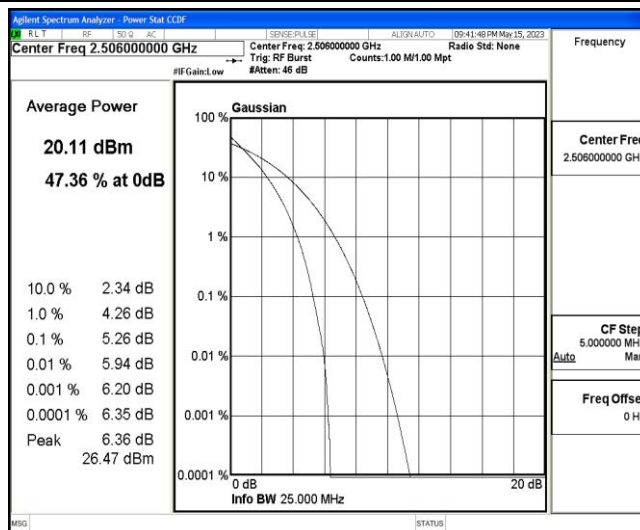


Band41-20MHz-QPSK-40620-100RB#0

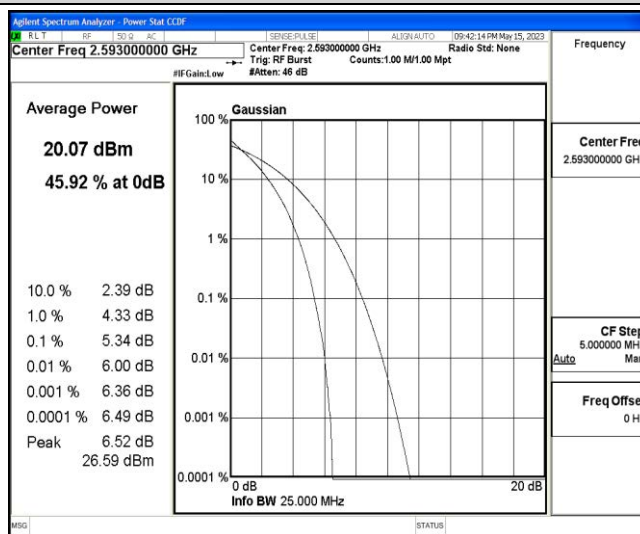


Band41-20MHz-QPSK-41490-100RB#0




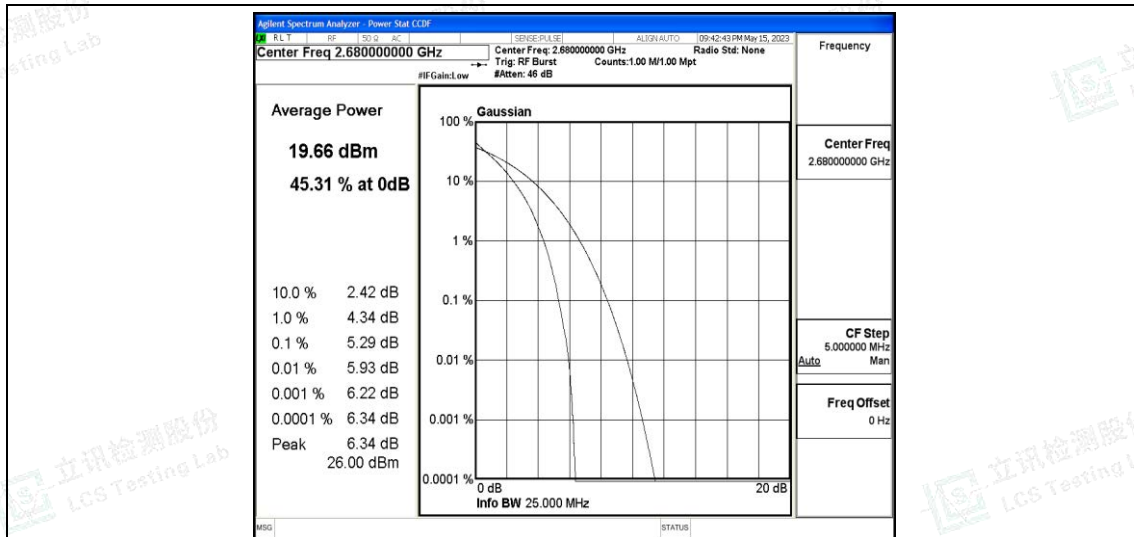

Band41-20MHz-16QAM-39750-100RB#0

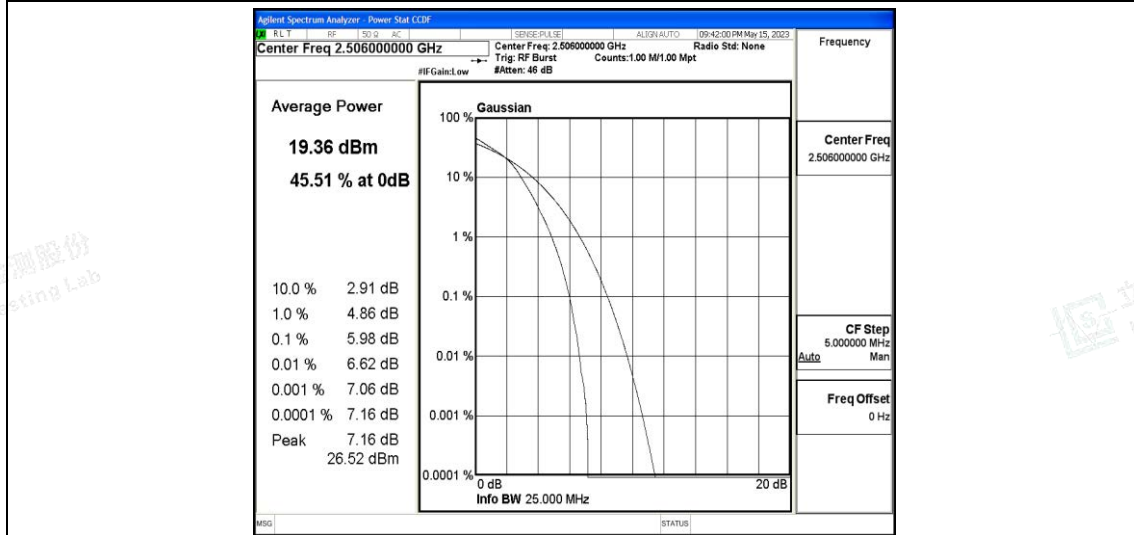


Band41-20MHz-16QAM-40620-100RB#0

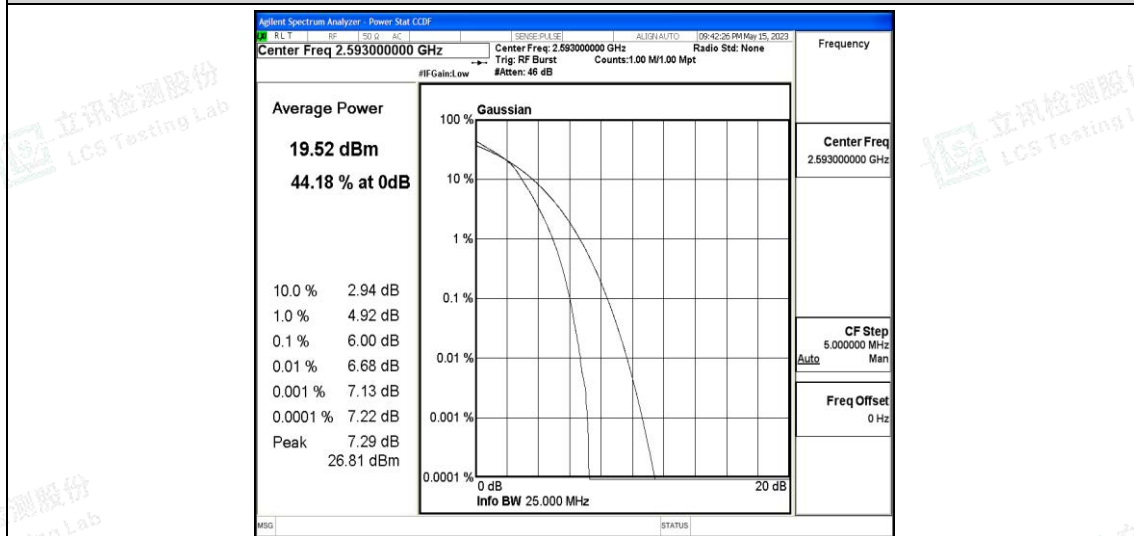

Band41-20MHz-16QAM-41490-100RB#0



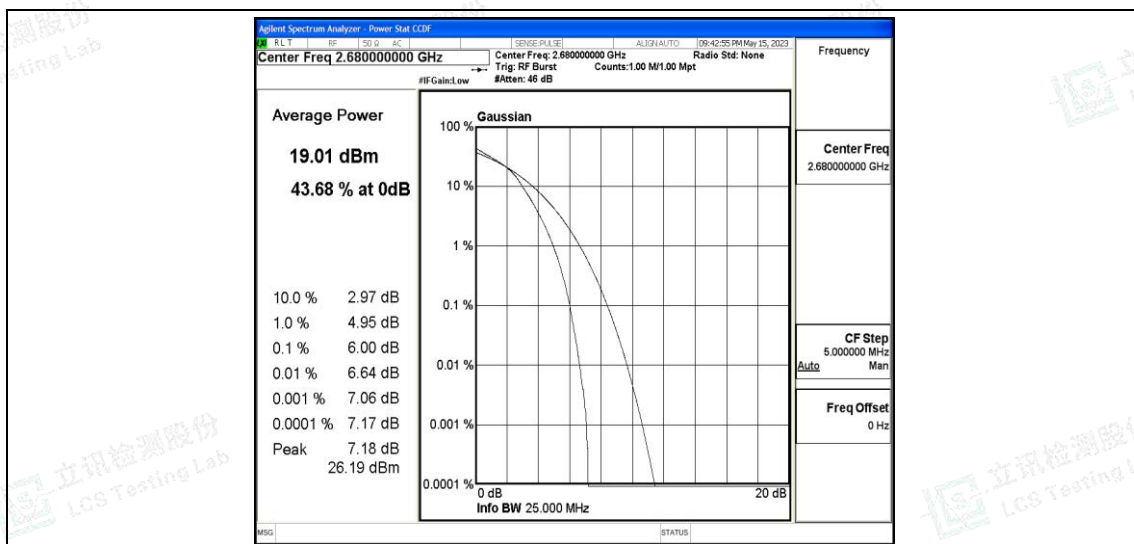



I.3 26dB Bandwidth and Occupied Bandwidth

Test Result


Band	Bandwidth	Modulation	Channel	RB Configuration	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	4.5106	5.261	PASS
Band41	5MHz	QPSK	40620	25RB#0	4.5144	5.241	PASS
Band41	5MHz	QPSK	41565	25RB#0	4.4990	5.206	PASS
Band41	5MHz	16QAM	39675	25RB#0	4.5034	5.382	PASS
Band41	5MHz	16QAM	40620	25RB#0	4.5276	5.415	PASS
Band41	5MHz	16QAM	41565	25RB#0	4.5078	5.367	PASS
Band41	10MHz	QPSK	39700	50RB#0	8.9796	10.12	PASS
Band41	10MHz	QPSK	40620	50RB#0	8.9714	10.03	PASS
Band41	10MHz	QPSK	41540	50RB#0	9.0121	9.825	PASS
Band41	10MHz	16QAM	39700	50RB#0	8.9453	10.13	PASS
Band41	10MHz	16QAM	40620	50RB#0	8.9682	10.15	PASS
Band41	10MHz	16QAM	41540	50RB#0	9.0134	10.04	PASS
Band41	15MHz	QPSK	39725	75RB#0	13.518	15.93	PASS
Band41	15MHz	QPSK	40620	75RB#0	13.520	15.47	PASS
Band41	15MHz	QPSK	41515	75RB#0	13.531	15.92	PASS
Band41	15MHz	16QAM	39725	75RB#0	13.485	15.07	PASS
Band41	15MHz	16QAM	40620	75RB#0	13.484	15.04	PASS
Band41	15MHz	16QAM	41515	75RB#0	13.488	14.91	PASS
Band41	20MHz	QPSK	39750	100RB#0	17.994	20.64	PASS
Band41	20MHz	QPSK	40620	100RB#0	17.998	20.03	PASS
Band41	20MHz	QPSK	41490	100RB#0	17.888	19.75	PASS
Band41	20MHz	16QAM	39750	100RB#0	18.030	20.04	PASS
Band41	20MHz	16QAM	40620	100RB#0	17.889	20.77	PASS
Band41	20MHz	16QAM	41490	100RB#0	17.982	19.91	PASS






Test Graphs

Band41-5MHz-QPSK-39675-25RB#0

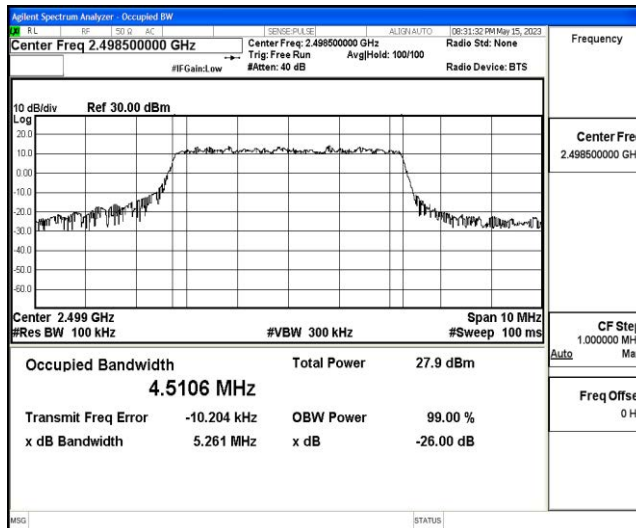


Band41-5MHz-QPSK-40620-25RB#0

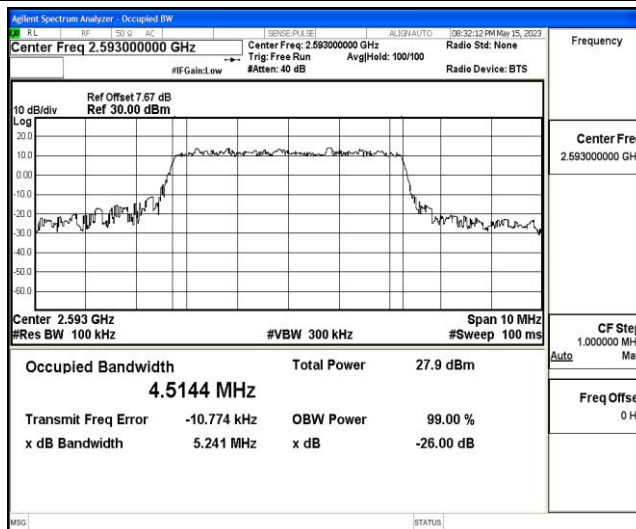


Band41-5MHz-QPSK-41565-25RB#0




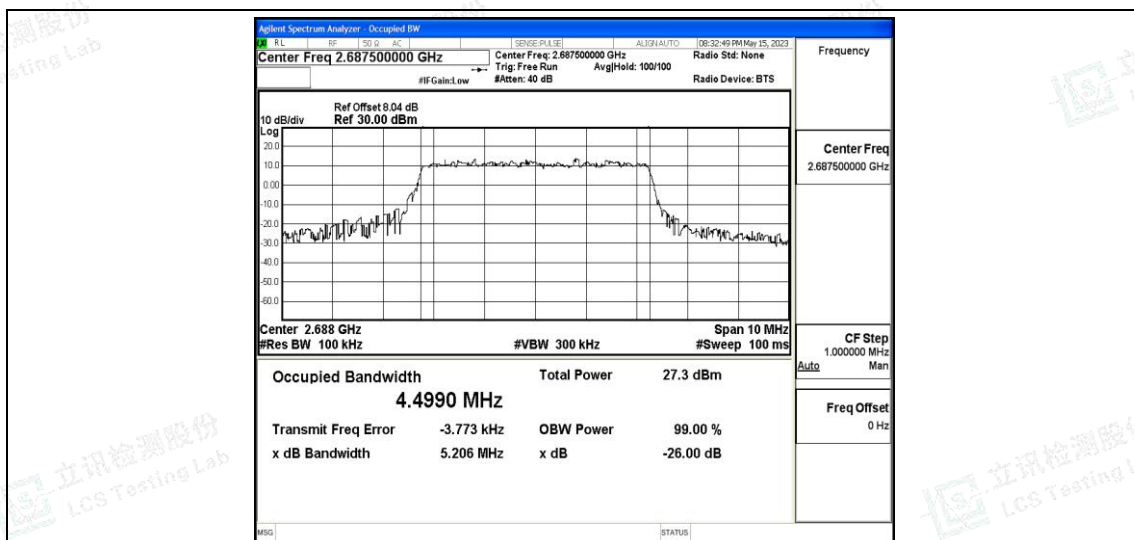

Band41-5MHz-16QAM-39675-25RB#0

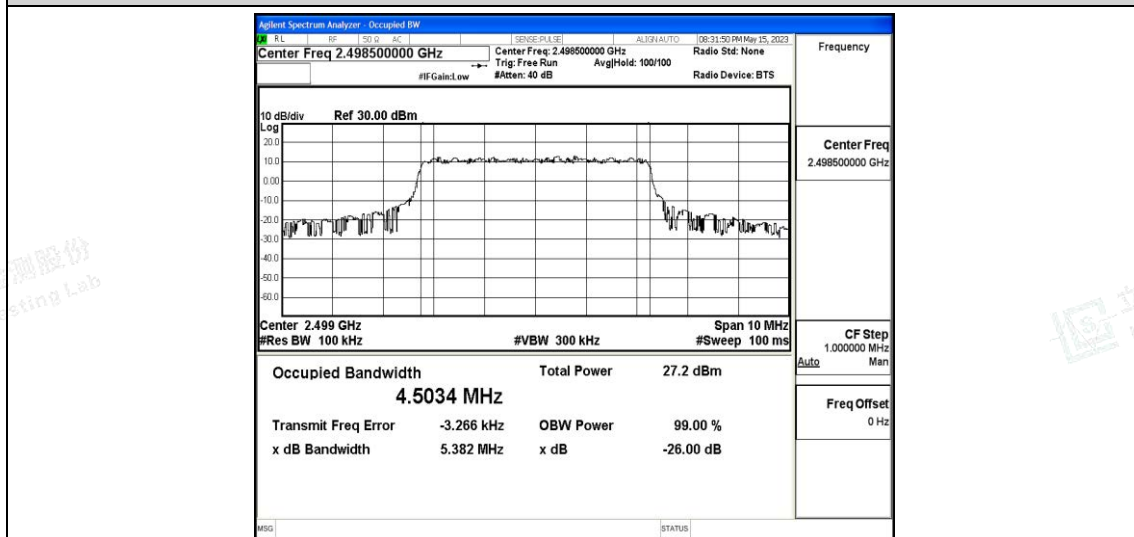


Band41-5MHz-16QAM-40620-25RB#0

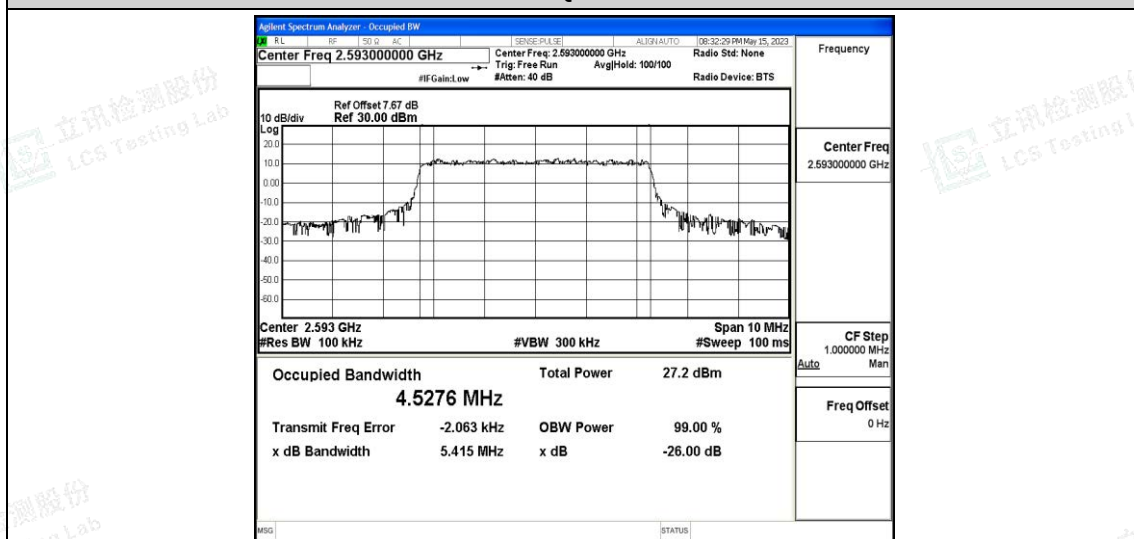


Band41-5MHz-16QAM-41565-25RB#0




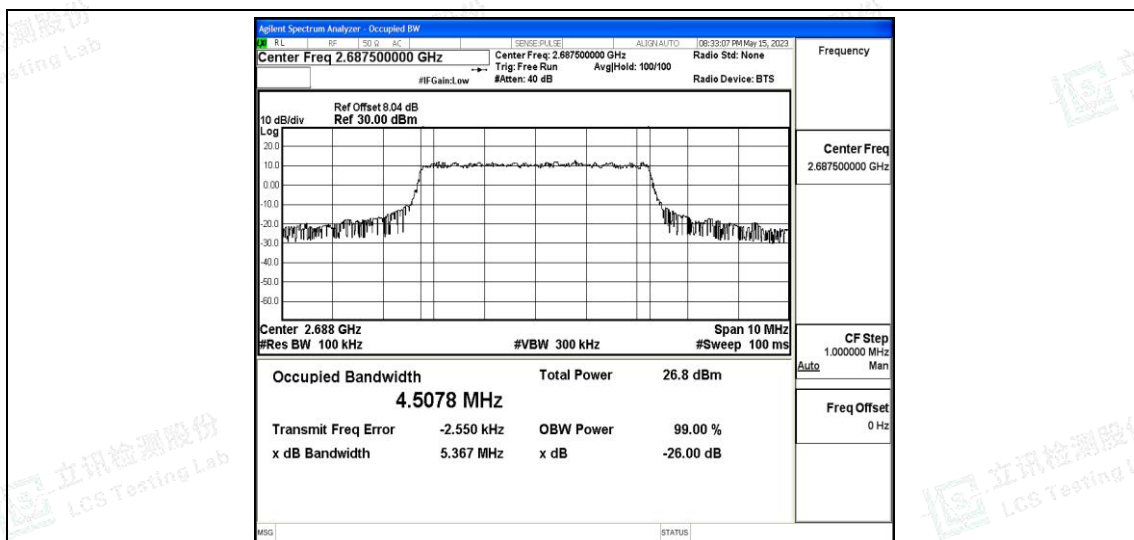

Band41-10MHz-QPSK-39700-50RB#0

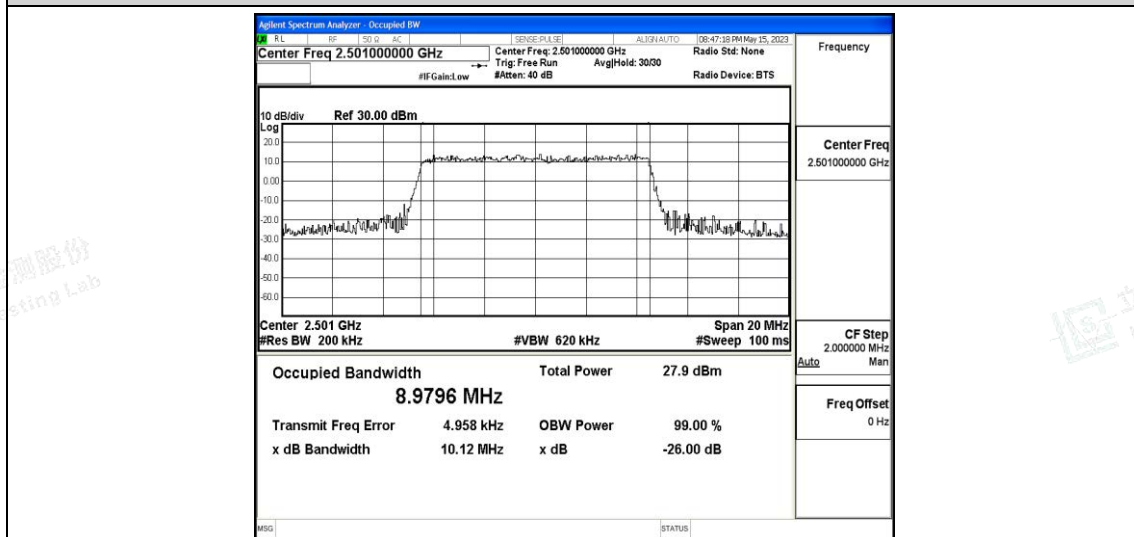


Band41-10MHz-QPSK-40620-50RB#0

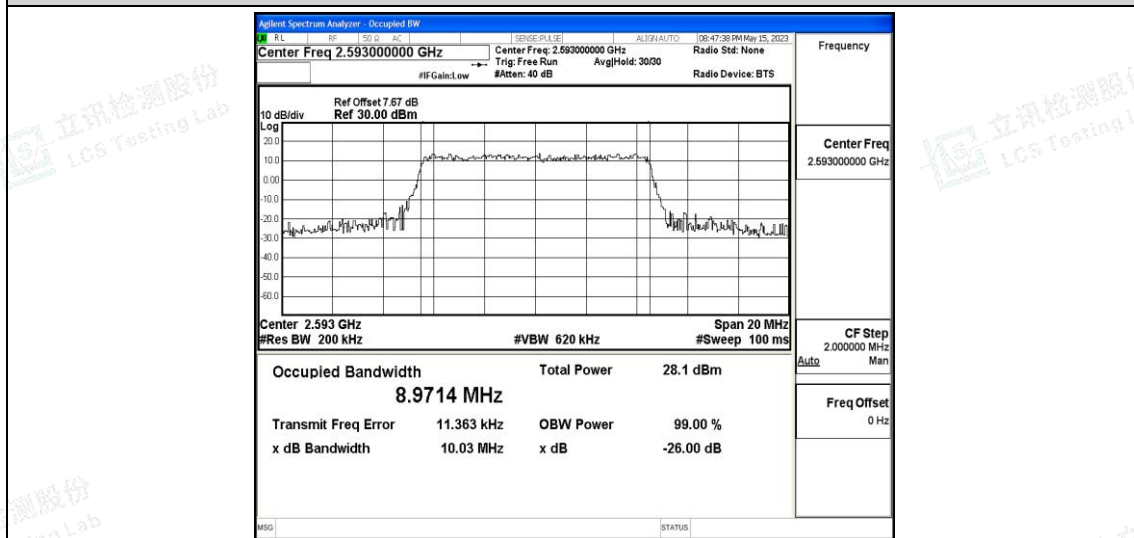


Band41-10MHz-QPSK-41540-50RB#0




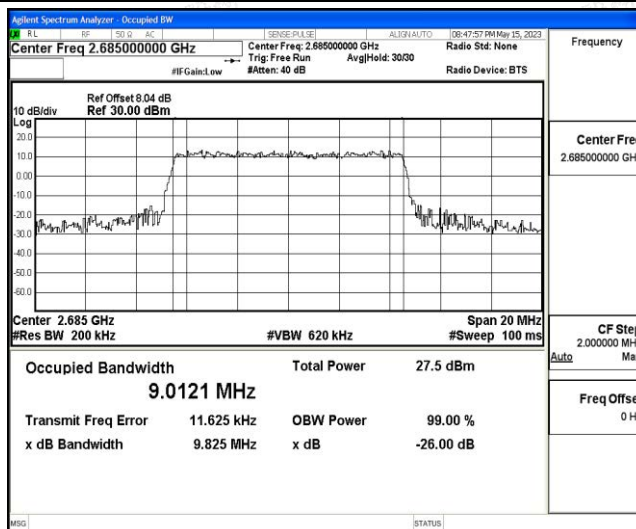

Band41-10MHz-16QAM-39700-50RB#0

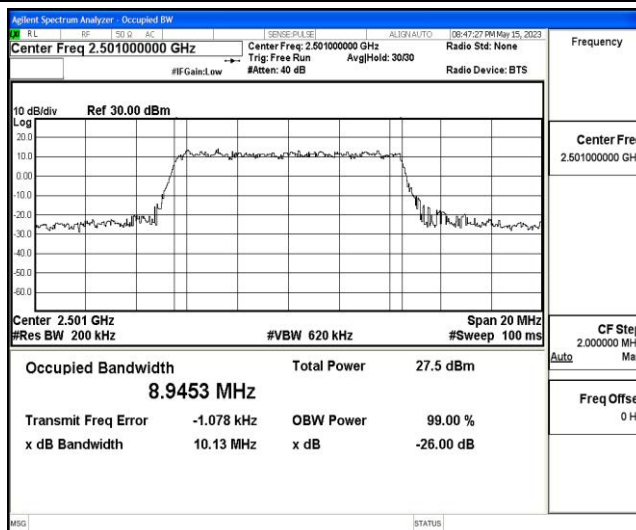


Band41-10MHz-16QAM-40620-50RB#0

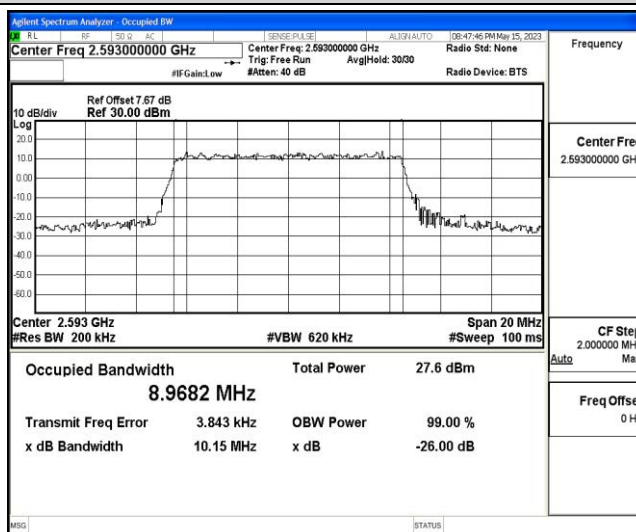


Band41-10MHz-16QAM-41540-50RB#0




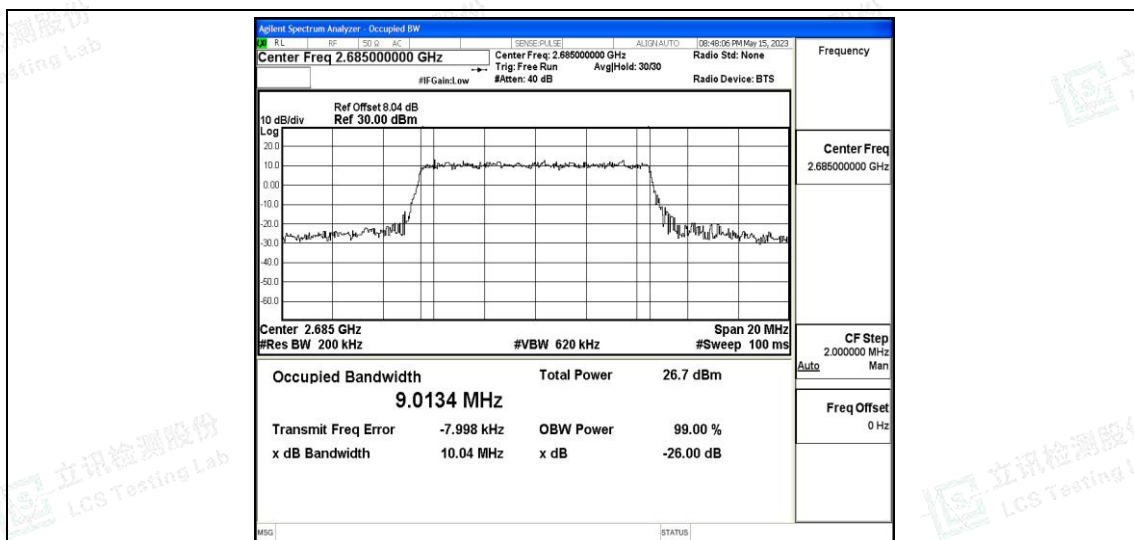

Band41-15MHz-QPSK-39725-75RB#0

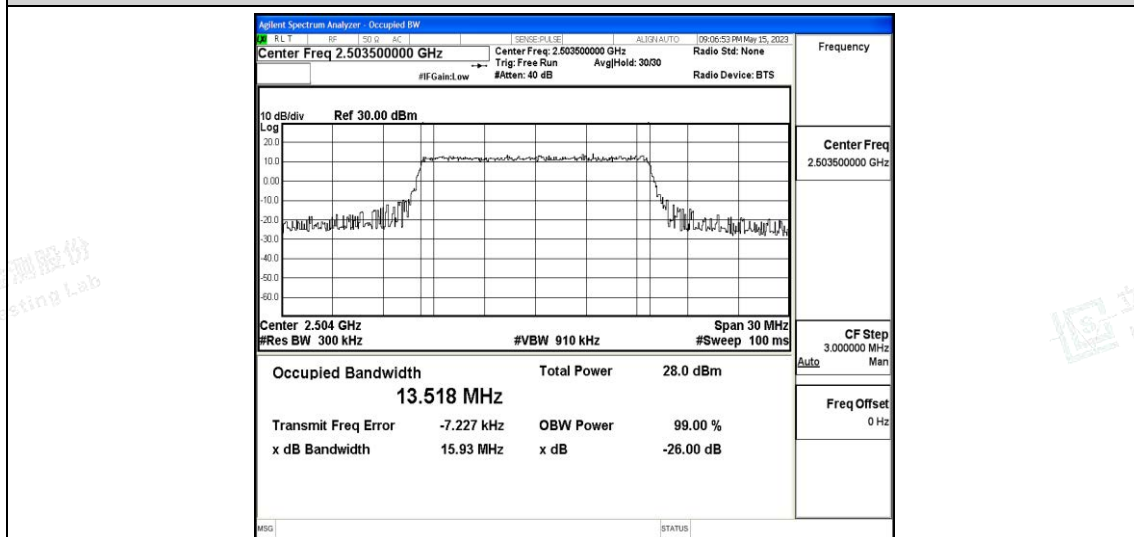


Band41-15MHz-QPSK-40620-75RB#0

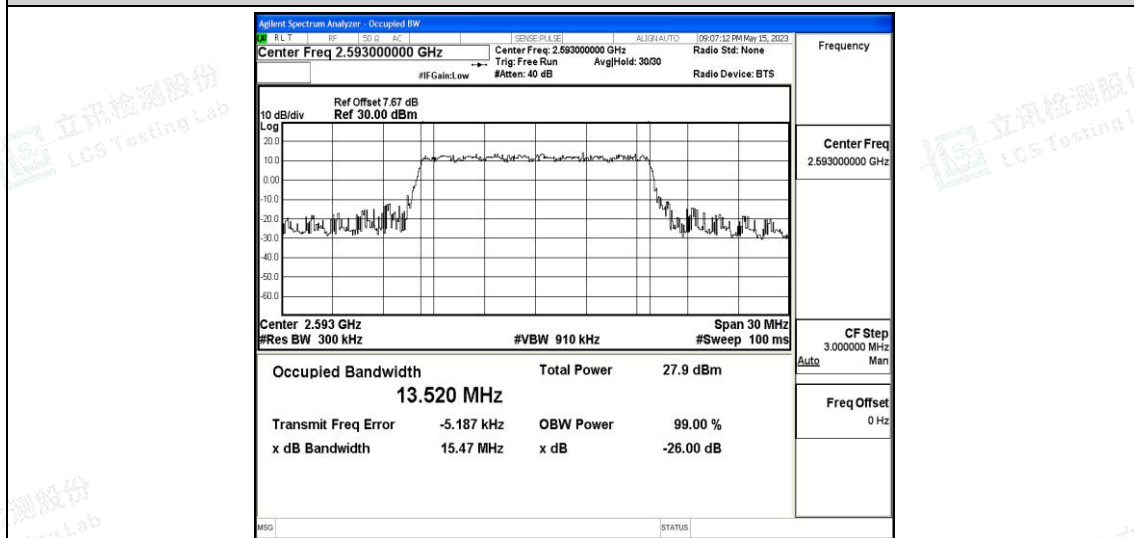


Band41-15MHz-QPSK-41515-75RB#0




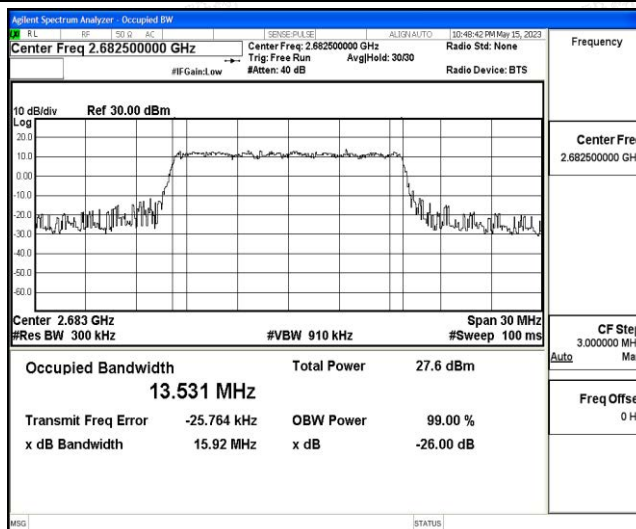

Band41-15MHz-16QAM-39725-75RB#0

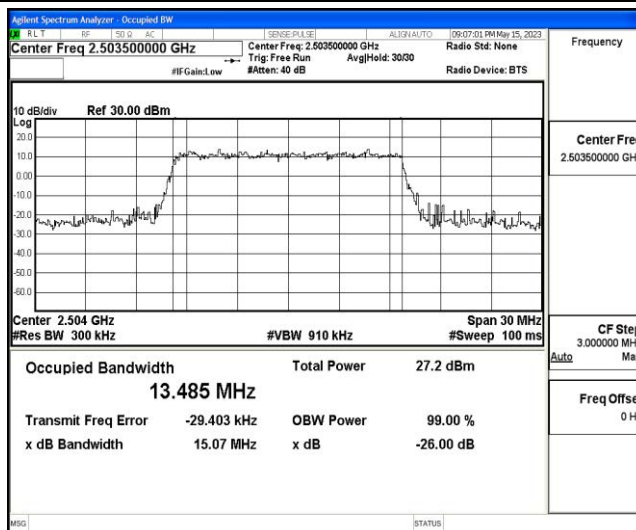

Band41-15MHz-16QAM-40620-75RB#0

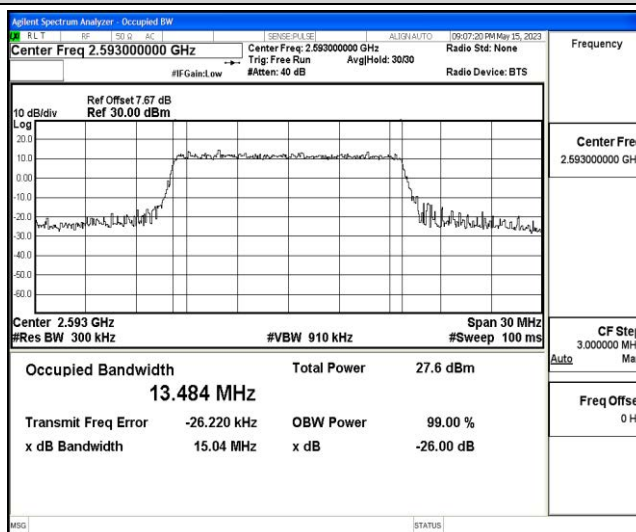

Band41-15MHz-16QAM-41515-75RB#0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

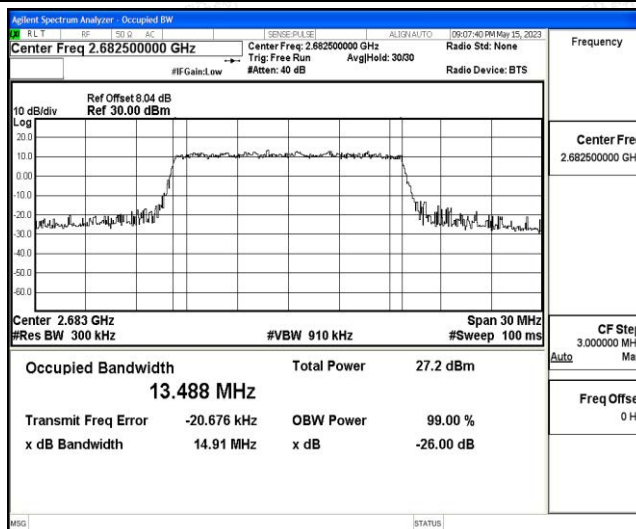

Band41-20MHz-QPSK-39750-100RB#0

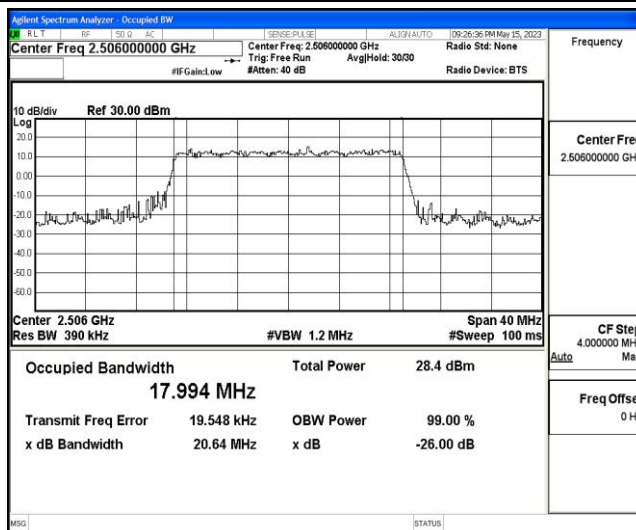


Band41-20MHz-QPSK-40620-100RB#0

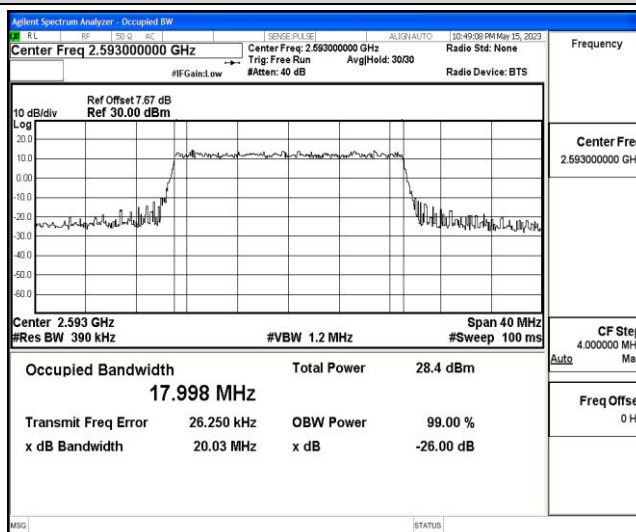


Band41-20MHz-QPSK-41490-100RB#0




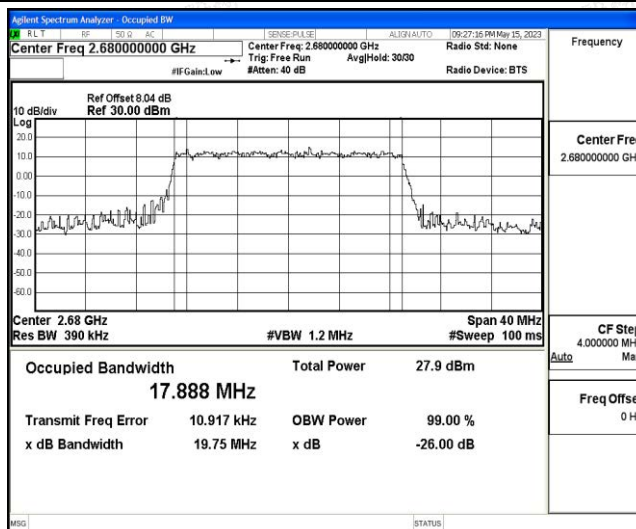

Band41-20MHz-16QAM-39750-100RB#0

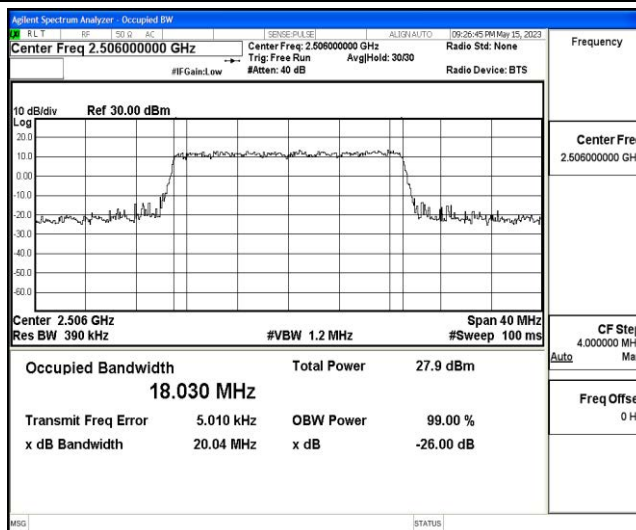

Band41-20MHz-16QAM-40620-100RB#0

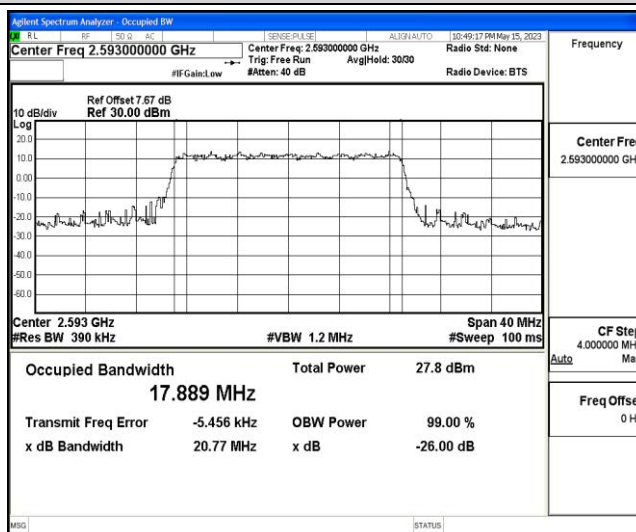

Band41-20MHz-16QAM-41490-100RB#0









I.4 Band Edge

Test Result


Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	-47.98,-38.93,-30.45	PASS
Band41	5MHz	QPSK	41565	25RB#0	-34.57,-39.22,-45.25,-47.69	PASS
Band41	5MHz	16QAM	39675	25RB#0	-46.92,-38.04,-32.34	PASS
Band41	5MHz	16QAM	41565	25RB#0	-33.01,-38.35,-46.71,-47.81	PASS
Band41	10MHz	QPSK	39700	50RB#0	-45.60,-37.38,-34.11	PASS
Band41	10MHz	QPSK	41540	50RB#0	-35.35,-37.64,-39.85,-43.54	PASS
Band41	10MHz	16QAM	39700	50RB#0	-44.96,-36.28,-33.79	PASS
Band41	10MHz	16QAM	41540	50RB#0	-34.43,-37.45,-40.05,-45.20	PASS
Band41	15MHz	QPSK	39725	75RB#0	-46.50,-34.83,-33.58	PASS
Band41	15MHz	QPSK	41515	75RB#0	-35.52,-36.61,-38.34,-43.59	PASS
Band41	15MHz	16QAM	39725	75RB#0	-45.62,-34.43,-33.33	PASS
Band41	15MHz	16QAM	41515	75RB#0	-36.11,-36.16,-38.08,-43.70	PASS
Band41	20MHz	QPSK	39750	100RB#0	-46.51,-33.23,-33.23	PASS
Band41	20MHz	QPSK	41490	100RB#0	-34.58,-36.01,-38.21,-43.41	PASS
Band41	20MHz	16QAM	39750	100RB#0	-46.57,-33.54,-32.92	PASS
Band41	20MHz	16QAM	41490	100RB#0	-35.01,-36.09,-37.74,-43.70	PASS

Test Graphs

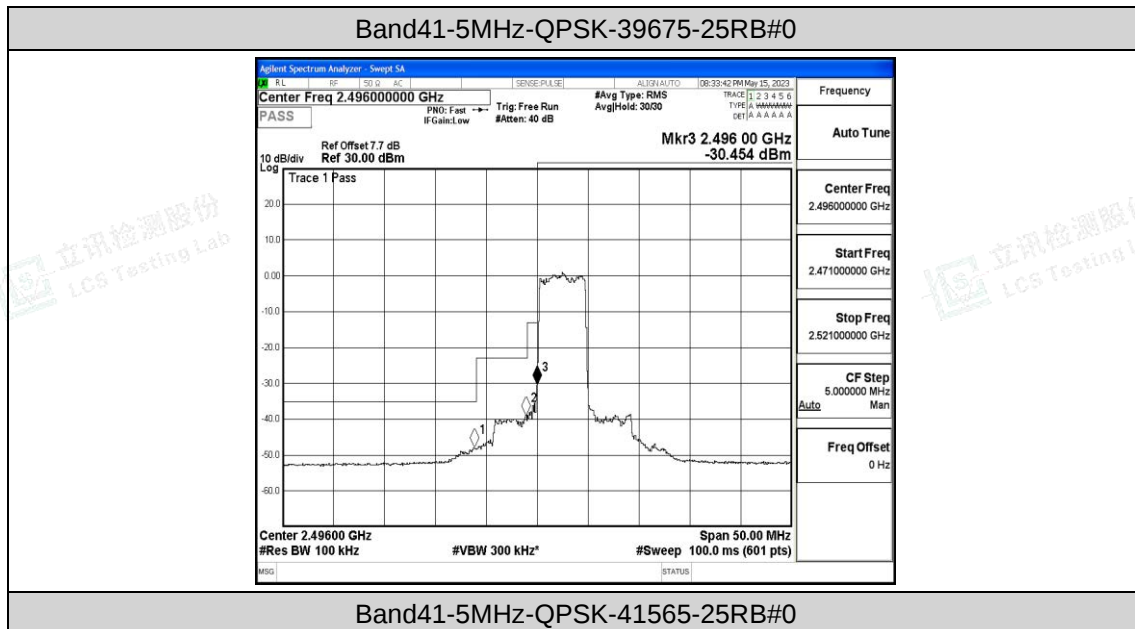


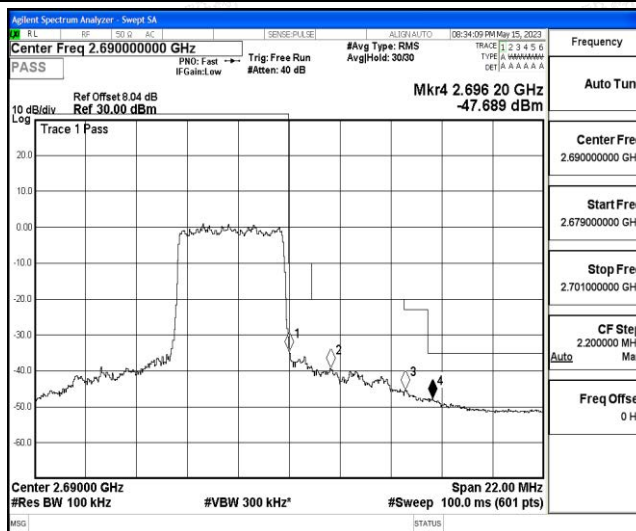

Band41-5MHz-16QAM-39675-25RB#0

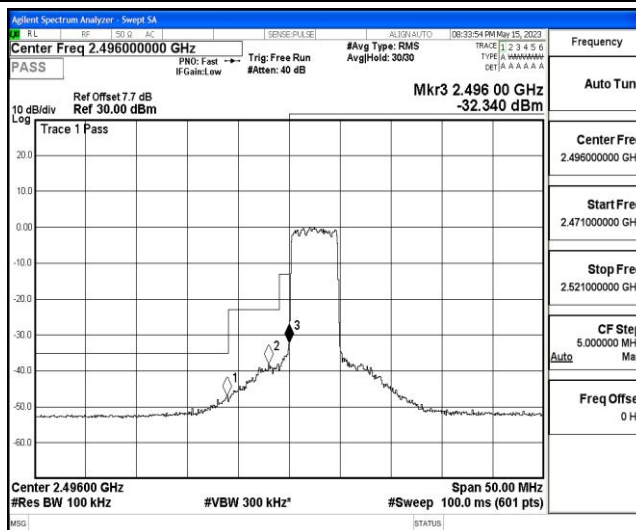

Band41-5MHz-16QAM-41565-25RB#0

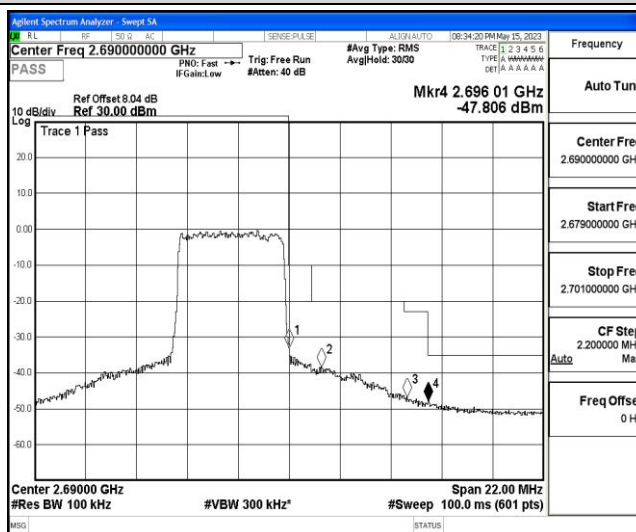


Band41-10MHz-QPSK-39700-50RB#0






Band41-10MHz-QPSK-41540-50RB#0

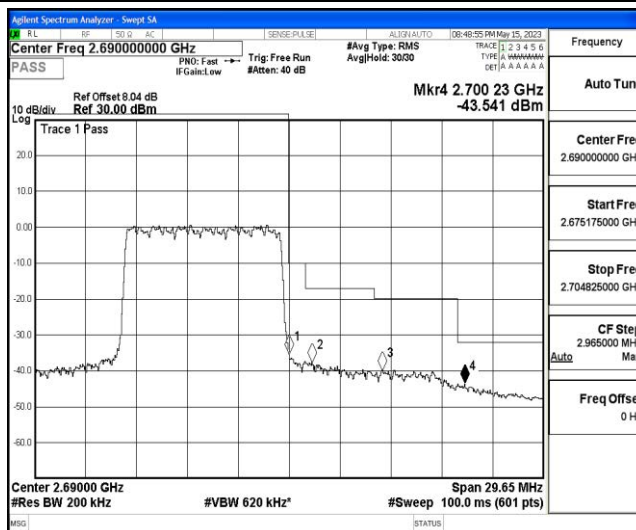


Band41-10MHz-16QAM-39700-50RB#0

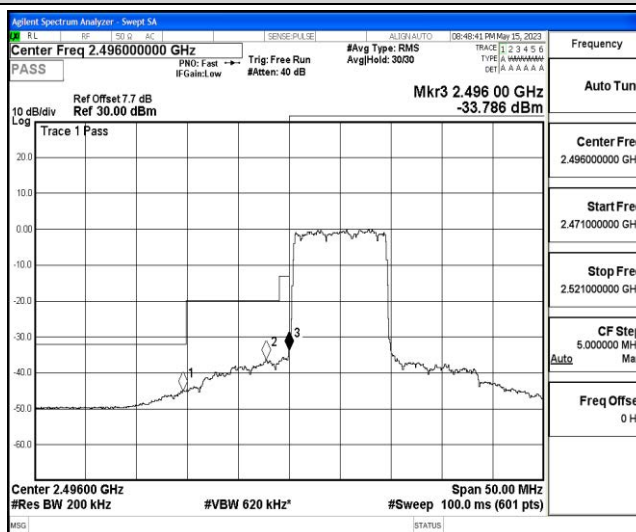

Band41-10MHz-16QAM-41540-50RB#0




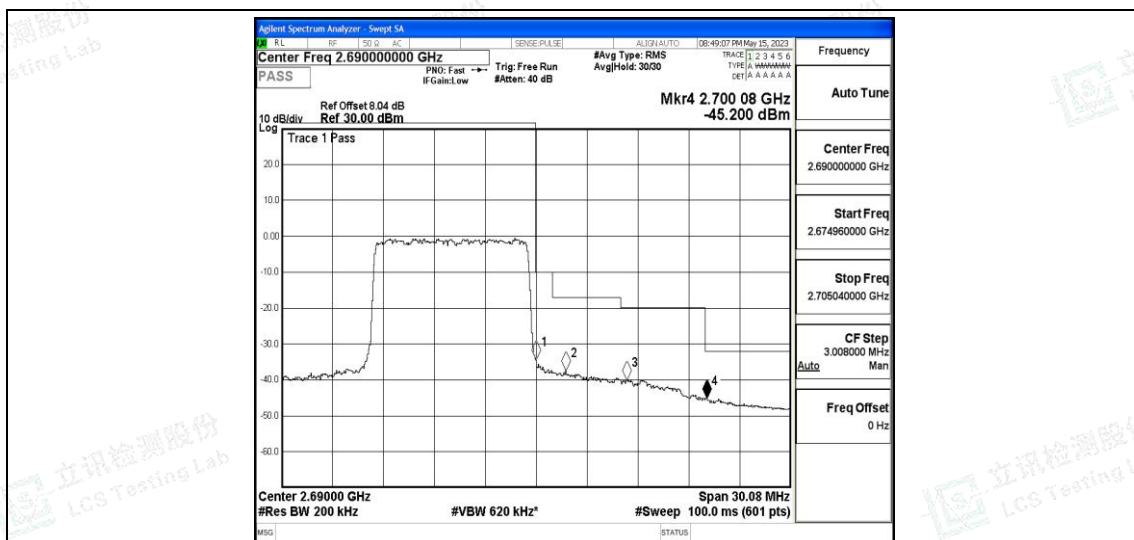

Band41-15MHz-QPSK-39725-75RB#0




Band41-15MHz-QPSK-41515-75RB#0

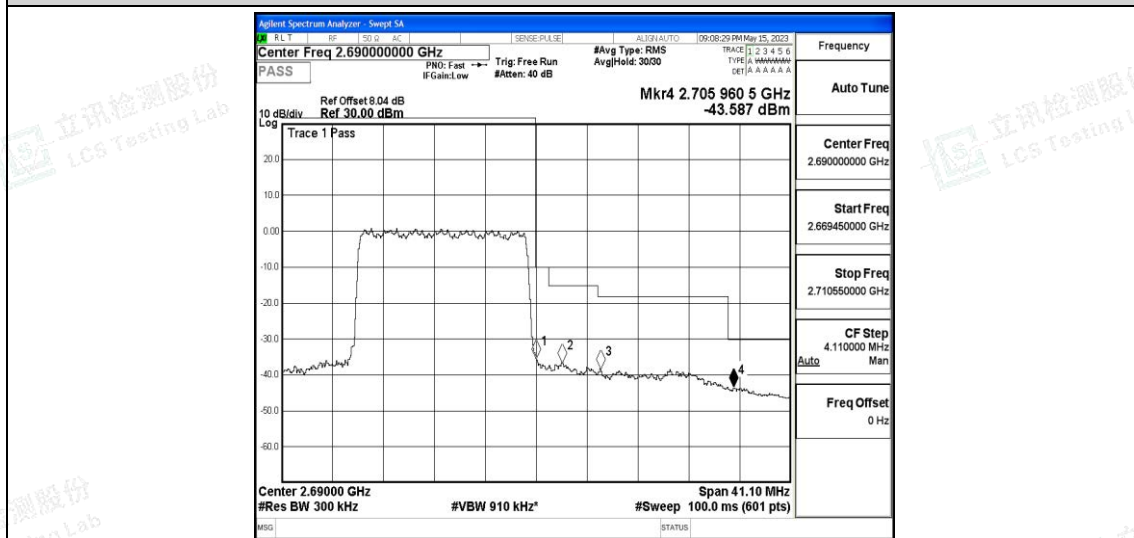


Band41-15MHz-16QAM-39725-75RB#0




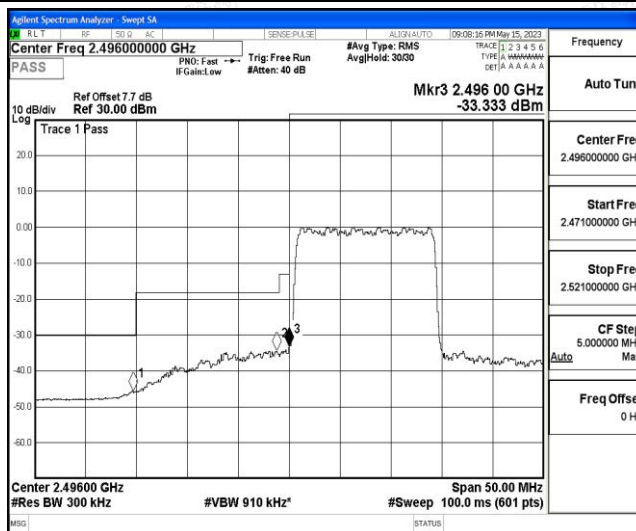

Band41-15MHz-16QAM-41515-75RB#0

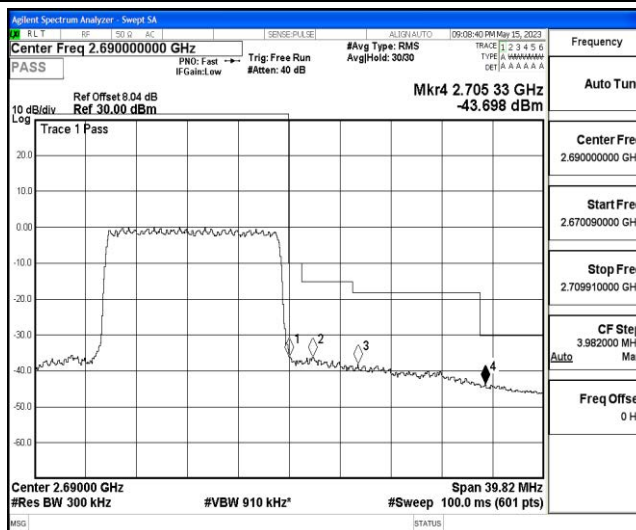


Band41-20MHz-QPSK-39750-100RB#0

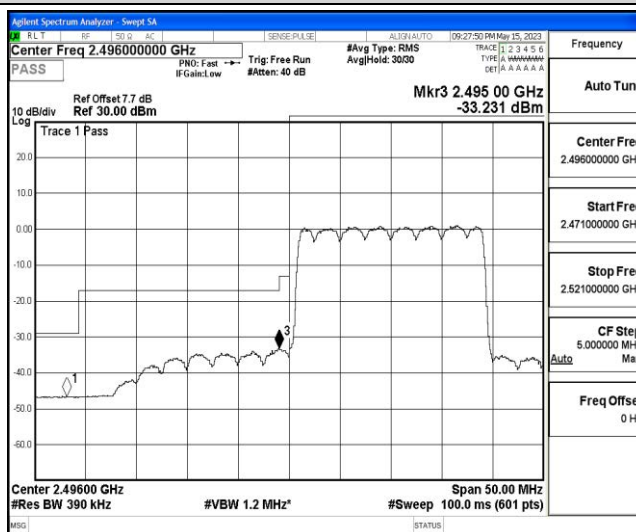


Band41-20MHz-QPSK-41490-100RB#0




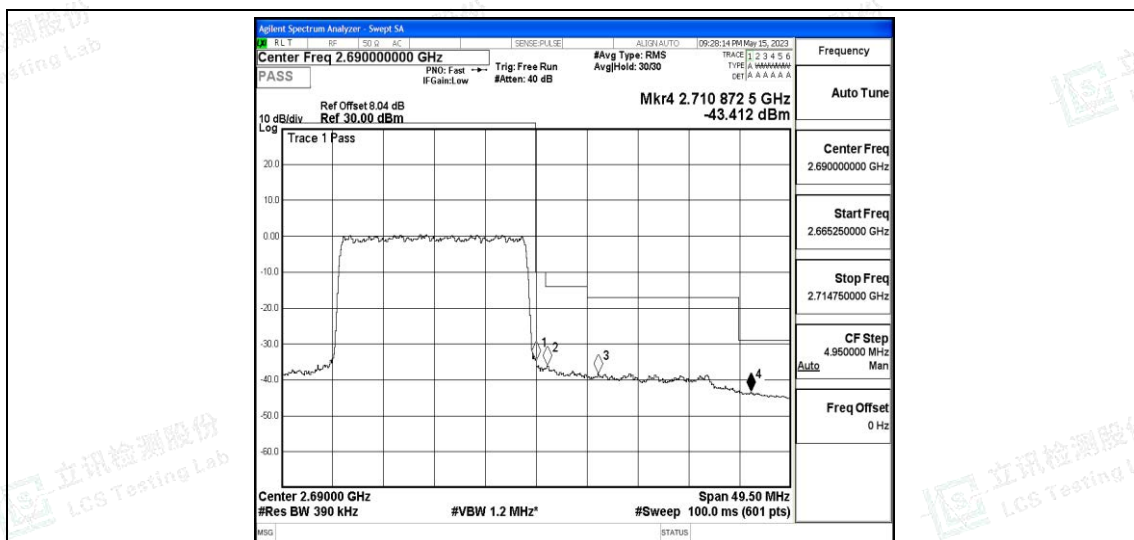

Band41-20MHz-16QAM-39750-100RB#0

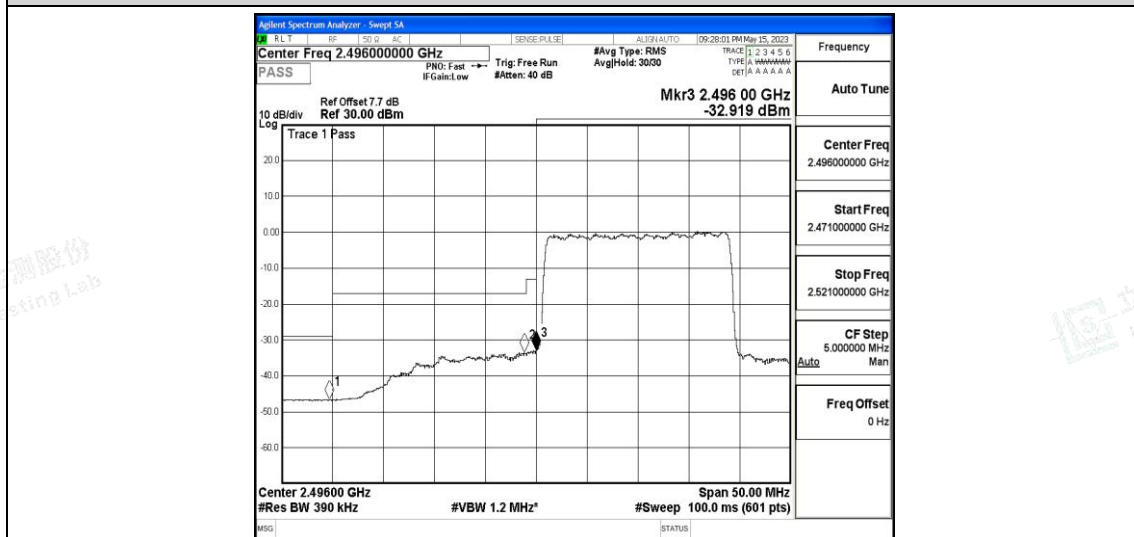

Band41-20MHz-16QAM-41490-100RB#0

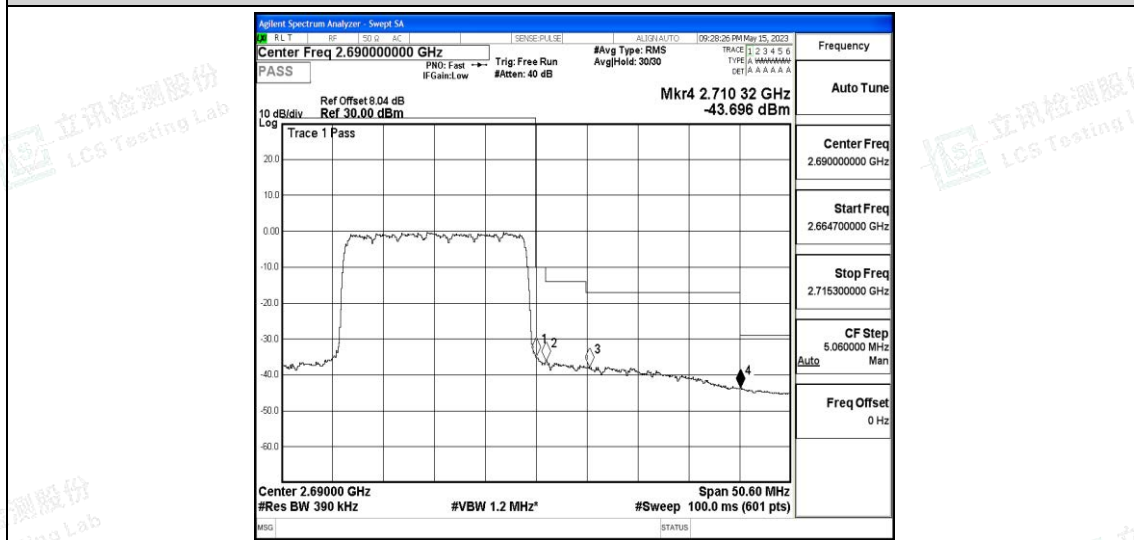



I.5 Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	Range1:0.009~0.15MHz	-65.31	PASS
Band41	5MHz	QPSK	39675	1RB#0	Range2:0.15~30MHz	-50.67	PASS
Band41	5MHz	QPSK	39675	1RB#0	Range3:30~1000MHz	-40.2	PASS
Band41	5MHz	QPSK	39675	1RB#0	Range4:1000~10000MHz	-44.88	PASS
Band41	5MHz	QPSK	39675	1RB#0	Range5:10000~20000MHz	-49.21	PASS
Band41	5MHz	QPSK	39675	1RB#0	Range6:20000~26500MHz	-36.9	PASS
Band41	5MHz	QPSK	40620	1RB#0	Range1:0.009~0.15MHz	-64.43	PASS
Band41	5MHz	QPSK	40620	1RB#0	Range2:0.15~30MHz	-50.05	PASS
Band41	5MHz	QPSK	40620	1RB#0	Range3:30~1000MHz	-40.6	PASS
Band41	5MHz	QPSK	40620	1RB#0	Range4:1000~10000MHz	-44.91	PASS
Band41	5MHz	QPSK	40620	1RB#0	Range5:10000~20000MHz	-49.21	PASS
Band41	5MHz	QPSK	40620	1RB#0	Range6:20000~26500MHz	-36.96	PASS
Band41	5MHz	QPSK	41565	1RB#0	Range1:0.009~0.15MHz	-66.17	PASS
Band41	5MHz	QPSK	41565	1RB#0	Range2:0.15~30MHz	-51.22	PASS
Band41	5MHz	QPSK	41565	1RB#0	Range3:30~1000MHz	-41.84	PASS
Band41	5MHz	QPSK	41565	1RB#0	Range4:1000~10000MHz	-44.61	PASS
Band41	5MHz	QPSK	41565	1RB#0	Range5:10000~20000MHz	-49.13	PASS
Band41	5MHz	QPSK	41565	1RB#0	Range6:20000~26500MHz	-36.96	PASS
Band41	5MHz	16QAM	39675	1RB#0	Range1:0.009~0.15MHz	-67.21	PASS
Band41	5MHz	16QAM	39675	1RB#0	Range2:0.15~30MHz	-51.06	PASS
Band41	5MHz	16QAM	39675	1RB#0	Range3:30~1000MHz	-41.05	PASS
Band41	5MHz	16QAM	39675	1RB#0	Range4:1000~10000MHz	-44.62	PASS
Band41	5MHz	16QAM	39675	1RB#0	Range5:10000~20000MHz	-49.03	PASS
Band41	5MHz	16QAM	39675	1RB#0	Range6:20000~26500MHz	-36.99	PASS
Band41	5MHz	16QAM	40620	1RB#0	Range1:0.009~0.15MHz	-65.64	PASS
Band41	5MHz	16QAM	40620	1RB#0	Range2:0.15~30MHz	-52.86	PASS
Band41	5MHz	16QAM	40620	1RB#0	Range3:30~1000MHz	-42.22	PASS
Band41	5MHz	16QAM	40620	1RB#0	Range4:1000~10000MHz	-44.95	PASS
Band41	5MHz	16QAM	40620	1RB#0	Range5:10000~20000MHz	-49.07	PASS
Band41	5MHz	16QAM	40620	1RB#0	Range6:20000~26500MHz	-36.61	PASS
Band41	5MHz	16QAM	41565	1RB#0	Range1:0.009~0.15MHz	-65.95	PASS
Band41	5MHz	16QAM	41565	1RB#0	Range2:0.15~30MHz	-51.78	PASS
Band41	5MHz	16QAM	41565	1RB#0	Range3:30~1000MHz	-41.96	PASS
Band41	5MHz	16QAM	41565	1RB#0	Range4:1000~10000MHz	-44.89	PASS
Band41	5MHz	16QAM	41565	1RB#0	Range5:10000~20000MHz	-49.08	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	5MHz	16QAM	41565	1RB#0	Range6:20000~26500MHz	-36.88	PASS
Band41	10MHz	QPSK	39700	1RB#0	Range1:0.009~0.15MHz	-64.93	PASS
Band41	10MHz	QPSK	39700	1RB#0	Range2:0.15~30MHz	-51.55	PASS
Band41	10MHz	QPSK	39700	1RB#0	Range3:30~1000MHz	-42.69	PASS
Band41	10MHz	QPSK	39700	1RB#0	Range4:1000~10000MHz	-44.86	PASS
Band41	10MHz	QPSK	39700	1RB#0	Range5:10000~20000MHz	-49.14	PASS
Band41	10MHz	QPSK	39700	1RB#0	Range6:20000~26500MHz	-36.91	PASS
Band41	10MHz	QPSK	40620	1RB#0	Range1:0.009~0.15MHz	-66.75	PASS
Band41	10MHz	QPSK	40620	1RB#0	Range2:0.15~30MHz	-51.75	PASS
Band41	10MHz	QPSK	40620	1RB#0	Range3:30~1000MHz	-42.87	PASS
Band41	10MHz	QPSK	40620	1RB#0	Range4:1000~10000MHz	-44.83	PASS
Band41	10MHz	QPSK	40620	1RB#0	Range5:10000~20000MHz	-49.08	PASS
Band41	10MHz	QPSK	40620	1RB#0	Range6:20000~26500MHz	-36.72	PASS
Band41	10MHz	QPSK	41540	1RB#0	Range1:0.009~0.15MHz	-65.05	PASS
Band41	10MHz	QPSK	41540	1RB#0	Range2:0.15~30MHz	-50.85	PASS
Band41	10MHz	QPSK	41540	1RB#0	Range3:30~1000MHz	-41.87	PASS
Band41	10MHz	QPSK	41540	1RB#0	Range4:1000~10000MHz	-44.88	PASS
Band41	10MHz	QPSK	41540	1RB#0	Range5:10000~20000MHz	-49.1	PASS
Band41	10MHz	QPSK	41540	1RB#0	Range6:20000~26500MHz	-37	PASS
Band41	10MHz	16QAM	39700	1RB#0	Range1:0.009~0.15MHz	-65	PASS
Band41	10MHz	16QAM	39700	1RB#0	Range2:0.15~30MHz	-49.64	PASS
Band41	10MHz	16QAM	39700	1RB#0	Range3:30~1000MHz	-41.94	PASS
Band41	10MHz	16QAM	39700	1RB#0	Range4:1000~10000MHz	-44.86	PASS
Band41	10MHz	16QAM	39700	1RB#0	Range5:10000~20000MHz	-49.09	PASS
Band41	10MHz	16QAM	39700	1RB#0	Range6:20000~26500MHz	-36.93	PASS
Band41	10MHz	16QAM	40620	1RB#0	Range1:0.009~0.15MHz	-64.3	PASS
Band41	10MHz	16QAM	40620	1RB#0	Range2:0.15~30MHz	-51.94	PASS
Band41	10MHz	16QAM	40620	1RB#0	Range3:30~1000MHz	-43.2	PASS
Band41	10MHz	16QAM	40620	1RB#0	Range4:1000~10000MHz	-44.8	PASS
Band41	10MHz	16QAM	40620	1RB#0	Range5:10000~20000MHz	-49.19	PASS
Band41	10MHz	16QAM	40620	1RB#0	Range6:20000~26500MHz	-36.82	PASS
Band41	10MHz	16QAM	41540	1RB#0	Range1:0.009~0.15MHz	-64.87	PASS
Band41	10MHz	16QAM	41540	1RB#0	Range2:0.15~30MHz	-50.9	PASS
Band41	10MHz	16QAM	41540	1RB#0	Range3:30~1000MHz	-43.37	PASS
Band41	10MHz	16QAM	41540	1RB#0	Range4:1000~10000MHz	-44.88	PASS
Band41	10MHz	16QAM	41540	1RB#0	Range5:10000~20000MHz	-49.12	PASS
Band41	10MHz	16QAM	41540	1RB#0	Range6:20000~26500MHz	-36.75	PASS
Band41	15MHz	QPSK	39725	1RB#0	Range1:0.009~0.15MHz	-65.25	PASS
Band41	15MHz	QPSK	39725	1RB#0	Range2:0.15~30MHz	-51.69	PASS
Band41	15MHz	QPSK	39725	1RB#0	Range3:30~1000MHz	-41.02	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	15MHz	QPSK	39725	1RB#0	Range4:1000~10000MHz	-44.87	PASS
Band41	15MHz	QPSK	39725	1RB#0	Range5:10000~20000MHz	-48.95	PASS
Band41	15MHz	QPSK	39725	1RB#0	Range6:20000~26500MHz	-37	PASS
Band41	15MHz	QPSK	40620	1RB#0	Range1:0.009~0.15MHz	-66.23	PASS
Band41	15MHz	QPSK	40620	1RB#0	Range2:0.15~30MHz	-50.78	PASS
Band41	15MHz	QPSK	40620	1RB#0	Range3:30~1000MHz	-41.73	PASS
Band41	15MHz	QPSK	40620	1RB#0	Range4:1000~10000MHz	-44.83	PASS
Band41	15MHz	QPSK	40620	1RB#0	Range5:10000~20000MHz	-49.14	PASS
Band41	15MHz	QPSK	40620	1RB#0	Range6:20000~26500MHz	-36.85	PASS
Band41	15MHz	QPSK	41515	1RB#0	Range1:0.009~0.15MHz	-65.84	PASS
Band41	15MHz	QPSK	41515	1RB#0	Range2:0.15~30MHz	-52.61	PASS
Band41	15MHz	QPSK	41515	1RB#0	Range3:30~1000MHz	-43.34	PASS
Band41	15MHz	QPSK	41515	1RB#0	Range4:1000~10000MHz	-44.12	PASS
Band41	15MHz	QPSK	41515	1RB#0	Range5:10000~20000MHz	-49.03	PASS
Band41	15MHz	QPSK	41515	1RB#0	Range6:20000~26500MHz	-36.83	PASS
Band41	15MHz	16QAM	39725	1RB#0	Range1:0.009~0.15MHz	-63.51	PASS
Band41	15MHz	16QAM	39725	1RB#0	Range2:0.15~30MHz	-50.38	PASS
Band41	15MHz	16QAM	39725	1RB#0	Range3:30~1000MHz	-42.42	PASS
Band41	15MHz	16QAM	39725	1RB#0	Range4:1000~10000MHz	-44.85	PASS
Band41	15MHz	16QAM	39725	1RB#0	Range5:10000~20000MHz	-48.94	PASS
Band41	15MHz	16QAM	39725	1RB#0	Range6:20000~26500MHz	-36.99	PASS
Band41	15MHz	16QAM	40620	1RB#0	Range1:0.009~0.15MHz	-66.86	PASS
Band41	15MHz	16QAM	40620	1RB#0	Range2:0.15~30MHz	-50.69	PASS
Band41	15MHz	16QAM	40620	1RB#0	Range3:30~1000MHz	-42.17	PASS
Band41	15MHz	16QAM	40620	1RB#0	Range4:1000~10000MHz	-44.86	PASS
Band41	15MHz	16QAM	40620	1RB#0	Range5:10000~20000MHz	-49.15	PASS
Band41	15MHz	16QAM	40620	1RB#0	Range6:20000~26500MHz	-36.82	PASS
Band41	15MHz	16QAM	41515	1RB#0	Range1:0.009~0.15MHz	-65.35	PASS
Band41	15MHz	16QAM	41515	1RB#0	Range2:0.15~30MHz	-50.48	PASS
Band41	15MHz	16QAM	41515	1RB#0	Range3:30~1000MHz	-43.08	PASS
Band41	15MHz	16QAM	41515	1RB#0	Range4:1000~10000MHz	-44.92	PASS
Band41	15MHz	16QAM	41515	1RB#0	Range5:10000~20000MHz	-49.13	PASS
Band41	15MHz	16QAM	41515	1RB#0	Range6:20000~26500MHz	-36.74	PASS
Band41	20MHz	QPSK	39750	1RB#0	Range1:0.009~0.15MHz	-66.38	PASS
Band41	20MHz	QPSK	39750	1RB#0	Range2:0.15~30MHz	-52.15	PASS
Band41	20MHz	QPSK	39750	1RB#0	Range3:30~1000MHz	-40.79	PASS
Band41	20MHz	QPSK	39750	1RB#0	Range4:1000~10000MHz	-45	PASS
Band41	20MHz	QPSK	39750	1RB#0	Range5:10000~20000MHz	-49.18	PASS
Band41	20MHz	QPSK	39750	1RB#0	Range6:20000~26500MHz	-36.81	PASS
Band41	20MHz	QPSK	40620	1RB#0	Range1:0.009~0.15MHz	-63.16	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Band41	20MHz	QPSK	40620	1RB#0	Range2:0.15~30MHz	-51.43	PASS
Band41	20MHz	QPSK	40620	1RB#0	Range3:30~1000MHz	-41.76	PASS
Band41	20MHz	QPSK	40620	1RB#0	Range4:1000~10000MHz	-44.86	PASS
Band41	20MHz	QPSK	40620	1RB#0	Range5:10000~20000MHz	-49.16	PASS
Band41	20MHz	QPSK	40620	1RB#0	Range6:20000~26500MHz	-37.01	PASS
Band41	20MHz	QPSK	41490	1RB#0	Range1:0.009~0.15MHz	-65.09	PASS
Band41	20MHz	QPSK	41490	1RB#0	Range2:0.15~30MHz	-50	PASS
Band41	20MHz	QPSK	41490	1RB#0	Range3:30~1000MHz	-41.1	PASS
Band41	20MHz	QPSK	41490	1RB#0	Range4:1000~10000MHz	-44.3	PASS
Band41	20MHz	QPSK	41490	1RB#0	Range5:10000~20000MHz	-49.02	PASS
Band41	20MHz	QPSK	41490	1RB#0	Range6:20000~26500MHz	-36.94	PASS
Band41	20MHz	16QAM	39750	1RB#0	Range1:0.009~0.15MHz	-65.44	PASS
Band41	20MHz	16QAM	39750	1RB#0	Range2:0.15~30MHz	-51.58	PASS
Band41	20MHz	16QAM	39750	1RB#0	Range3:30~1000MHz	-41.72	PASS
Band41	20MHz	16QAM	39750	1RB#0	Range4:1000~10000MHz	-45.06	PASS
Band41	20MHz	16QAM	39750	1RB#0	Range5:10000~20000MHz	-49.18	PASS
Band41	20MHz	16QAM	39750	1RB#0	Range6:20000~26500MHz	-36.76	PASS
Band41	20MHz	16QAM	40620	1RB#0	Range1:0.009~0.15MHz	-66.04	PASS
Band41	20MHz	16QAM	40620	1RB#0	Range2:0.15~30MHz	-51.41	PASS
Band41	20MHz	16QAM	40620	1RB#0	Range3:30~1000MHz	-42.3	PASS
Band41	20MHz	16QAM	40620	1RB#0	Range4:1000~10000MHz	-44.94	PASS
Band41	20MHz	16QAM	40620	1RB#0	Range5:10000~20000MHz	-49.15	PASS
Band41	20MHz	16QAM	40620	1RB#0	Range6:20000~26500MHz	-36.99	PASS
Band41	20MHz	16QAM	41490	1RB#0	Range1:0.009~0.15MHz	-64.05	PASS
Band41	20MHz	16QAM	41490	1RB#0	Range2:0.15~30MHz	-51.7	PASS
Band41	20MHz	16QAM	41490	1RB#0	Range3:30~1000MHz	-41.94	PASS
Band41	20MHz	16QAM	41490	1RB#0	Range4:1000~10000MHz	-44.93	PASS
Band41	20MHz	16QAM	41490	1RB#0	Range5:10000~20000MHz	-49.19	PASS
Band41	20MHz	16QAM	41490	1RB#0	Range6:20000~26500MHz	-36.85	PASS





Test Graphs

Band41-5MHz-QPSK-39675-1RB#0-Range1:0.009~0.15MHz

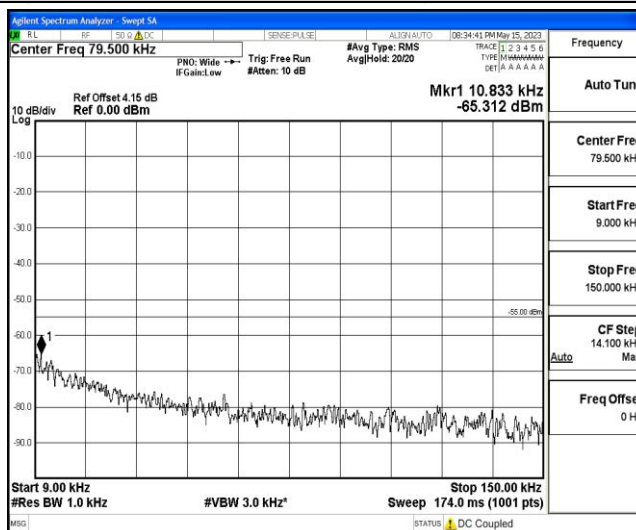


Band41-5MHz-QPSK-39675-1RB#0-Range2:0.15~30MHz




Band41-5MHz-QPSK-39675-1RB#0-Range3:30~1000MHz




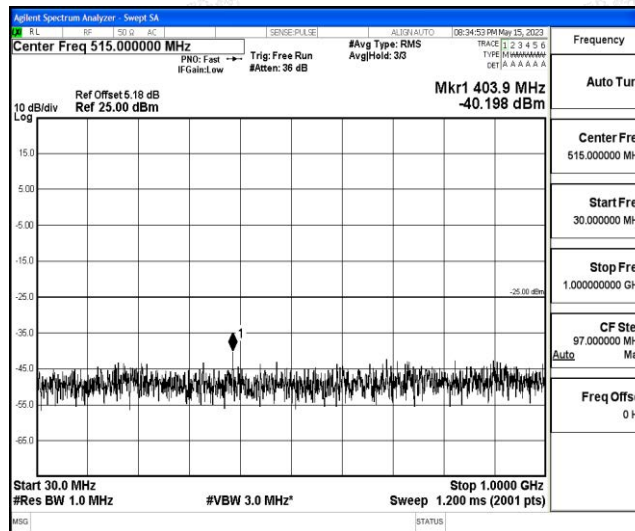

Band41-5MHz-QPSK-39675-1RB#0-Range4:1000~10000MHz

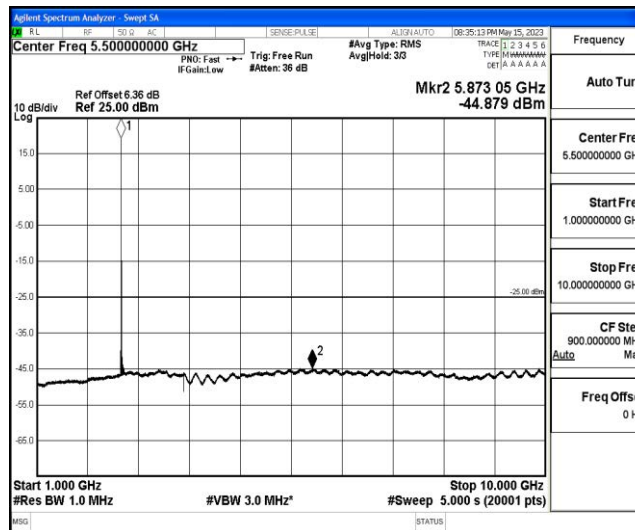


Band41-5MHz-QPSK-39675-1RB#0-Range5:10000~20000MHz

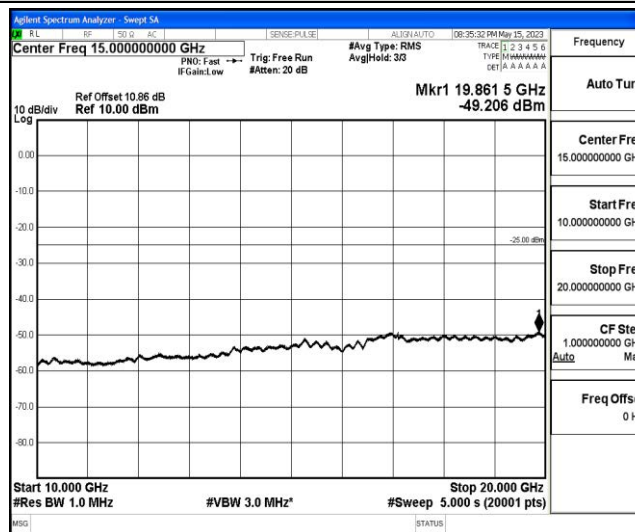


Band41-5MHz-QPSK-39675-1RB#0-Range6:20000~26500MHz




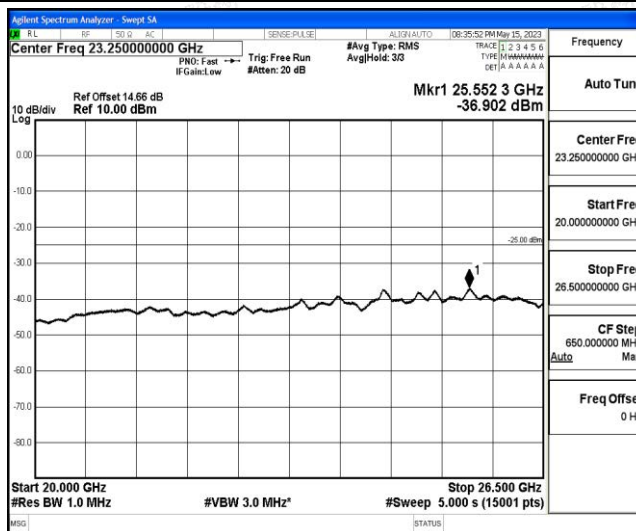

Band41-5MHz-QPSK-40620-1RB#0-Range1:0.009~0.15MHz

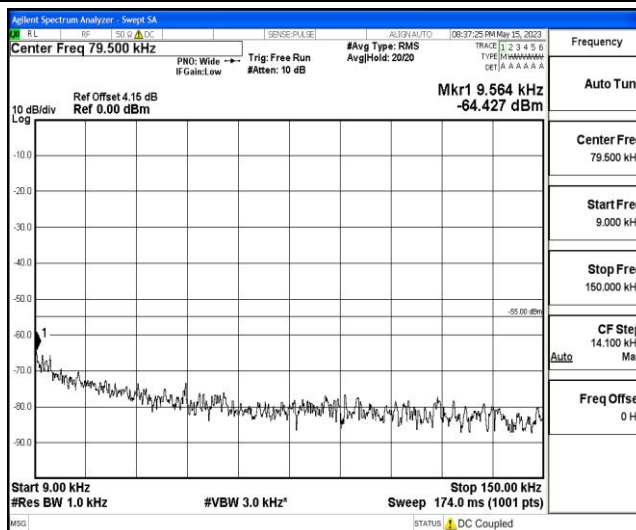


Band41-5MHz-QPSK-40620-1RB#0-Range2:0.15~30MHz

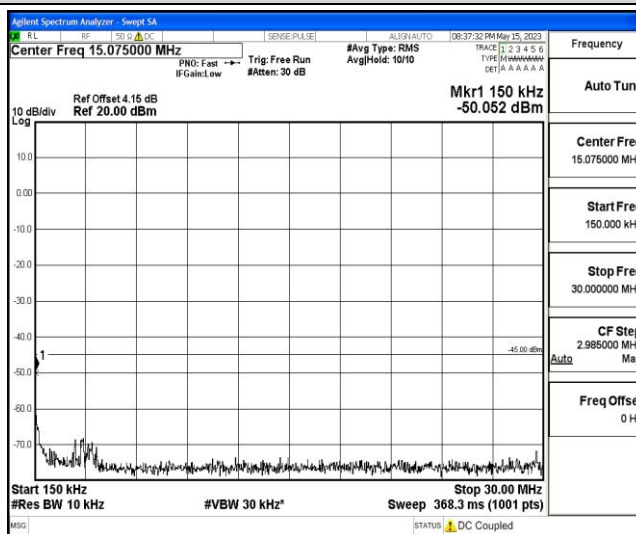


Band41-5MHz-QPSK-40620-1RB#0-Range3:30~1000MHz




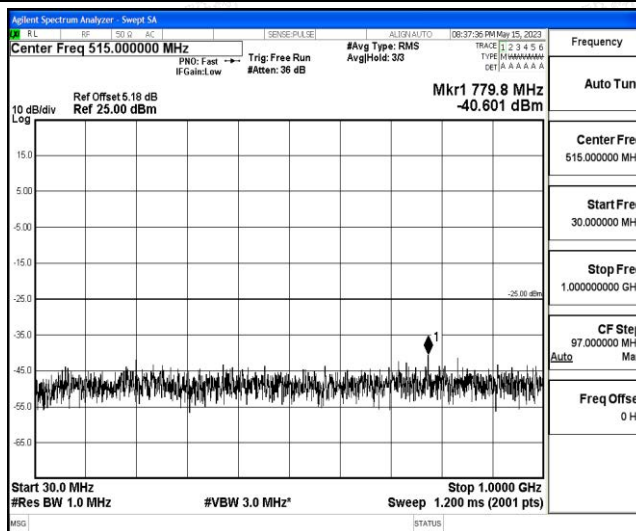

Band41-5MHz-QPSK-40620-1RB#0-Range4:1000~10000MHz

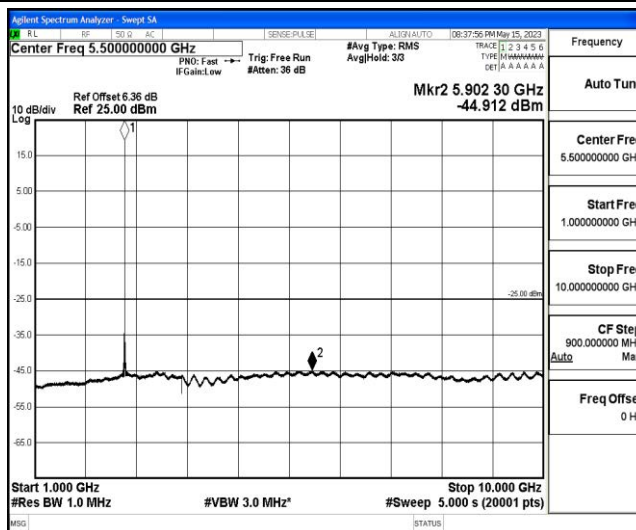


Band41-5MHz-QPSK-40620-1RB#0-Range5:10000~20000MHz

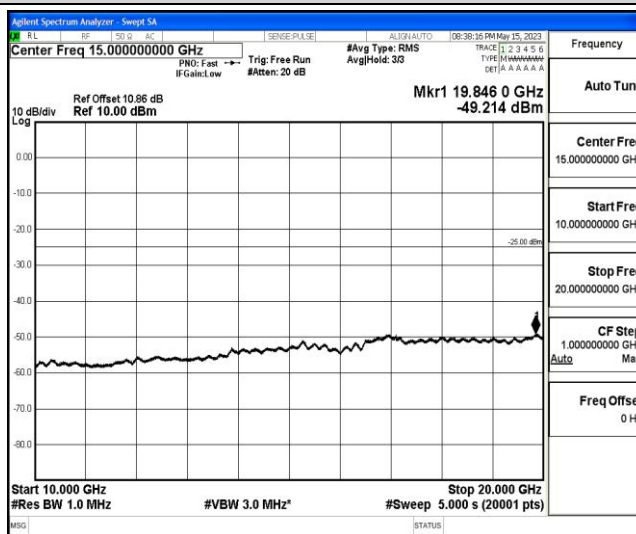


Band41-5MHz-QPSK-40620-1RB#0-Range6:20000~26500MHz




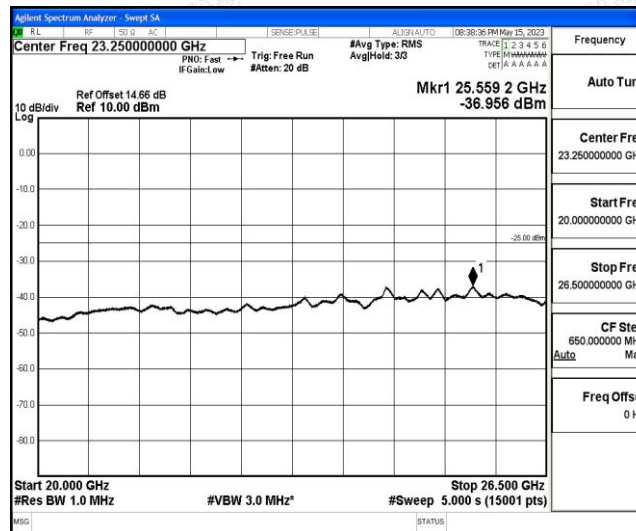

Band41-5MHz-QPSK-41565-1RB#0-Range1:0.009~0.15MHz

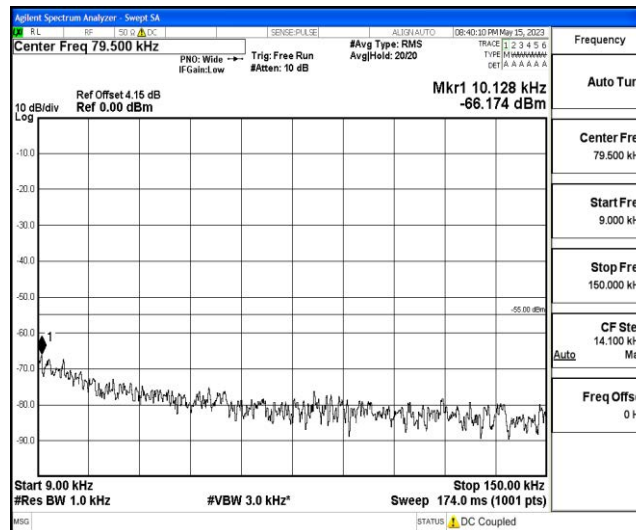


Band41-5MHz-QPSK-41565-1RB#0-Range2:0.15~30MHz

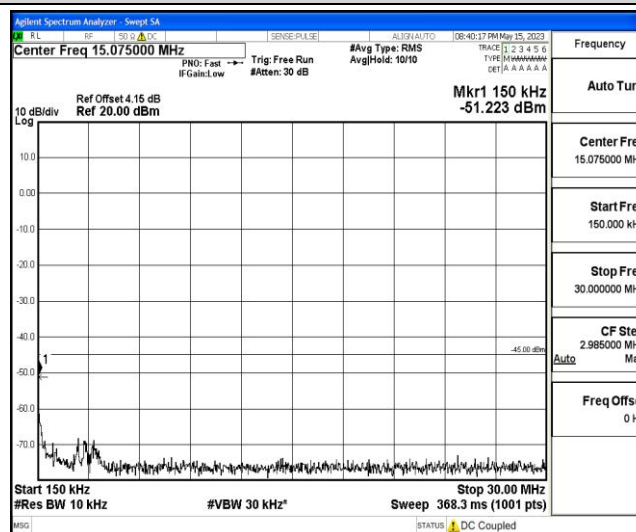


Band41-5MHz-QPSK-41565-1RB#0-Range3:30~1000MHz




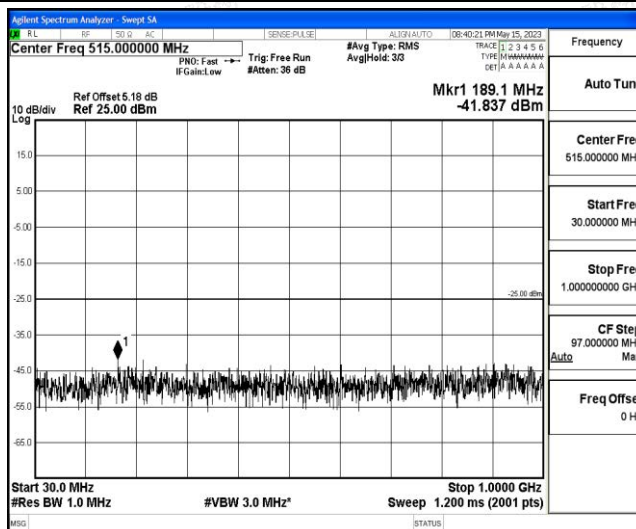

Band41-5MHz-QPSK-41565-1RB#0-Range4:1000~10000MHz

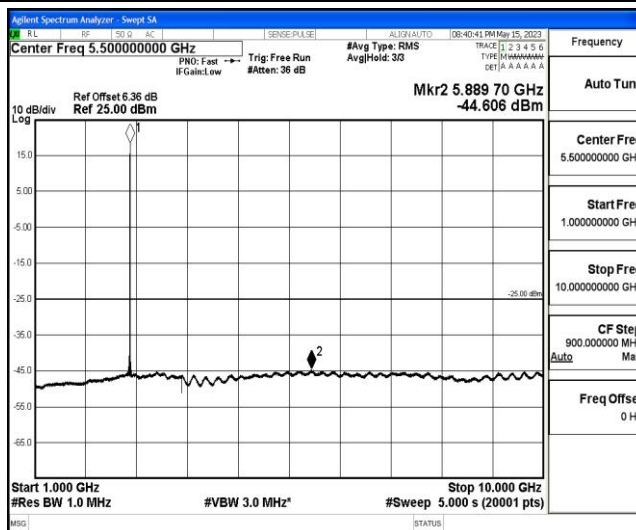


Band41-5MHz-QPSK-41565-1RB#0-Range5:10000~20000MHz

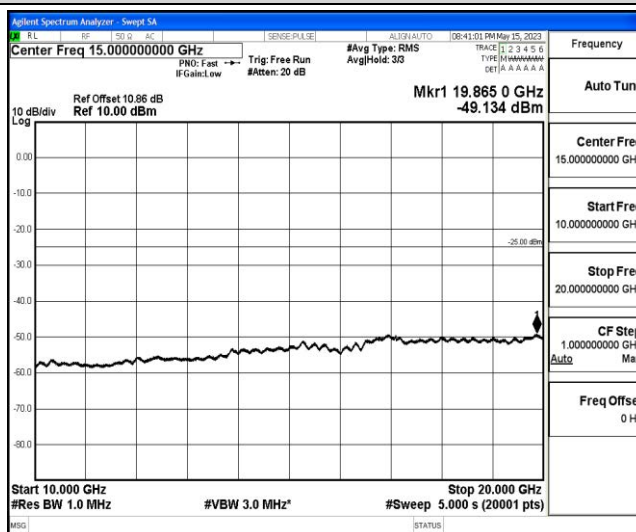


Band41-5MHz-QPSK-41565-1RB#0-Range6:20000~26500MHz




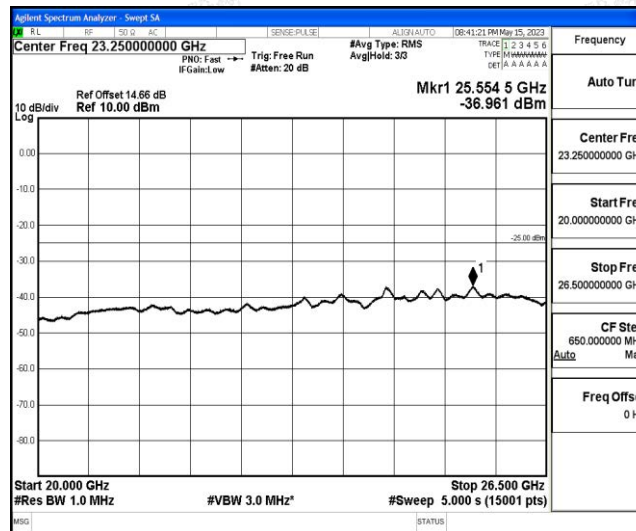

Band41-5MHz-16QAM-39675-1RB#0-Range1:0.009~0.15MHz

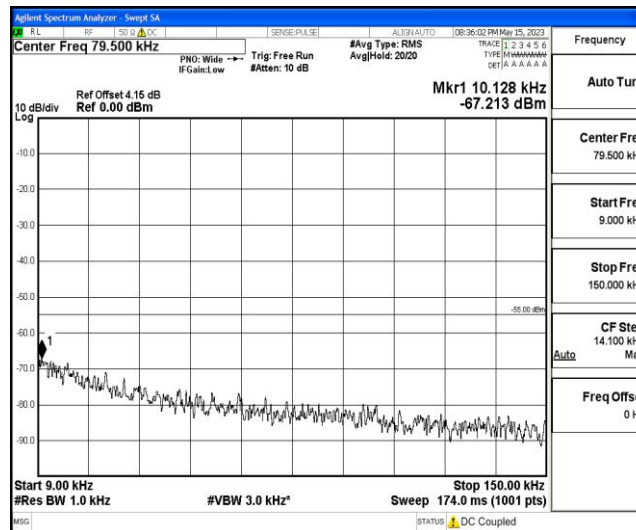


Band41-5MHz-16QAM-39675-1RB#0-Range2:0.15~30MHz

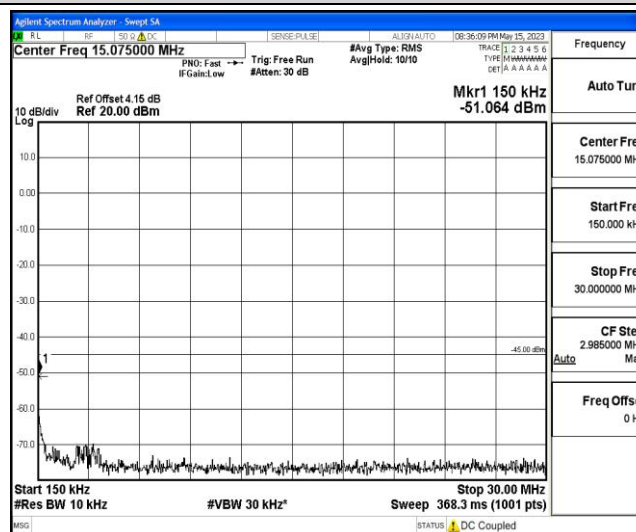


Band41-5MHz-16QAM-39675-1RB#0-Range3:30~1000MHz




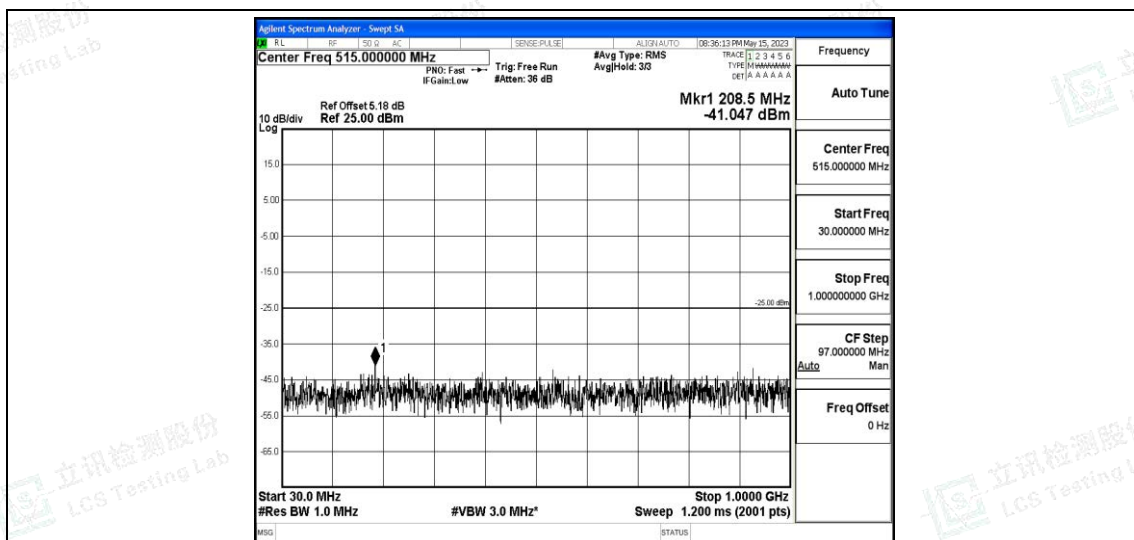

Band41-5MHz-16QAM-39675-1RB#0-Range4:1000~10000MHz

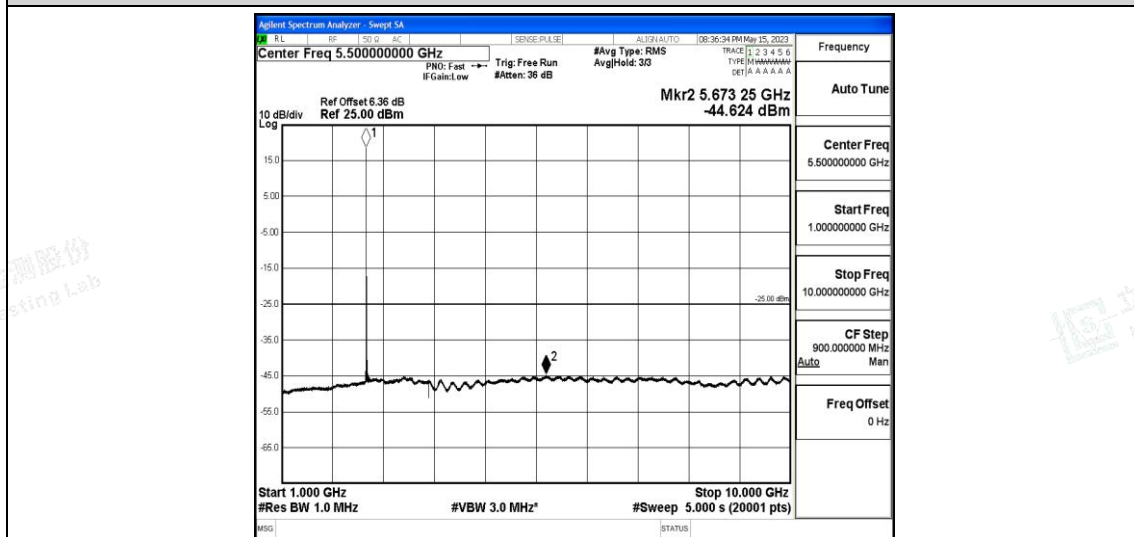


Band41-5MHz-16QAM-39675-1RB#0-Range5:10000~20000MHz

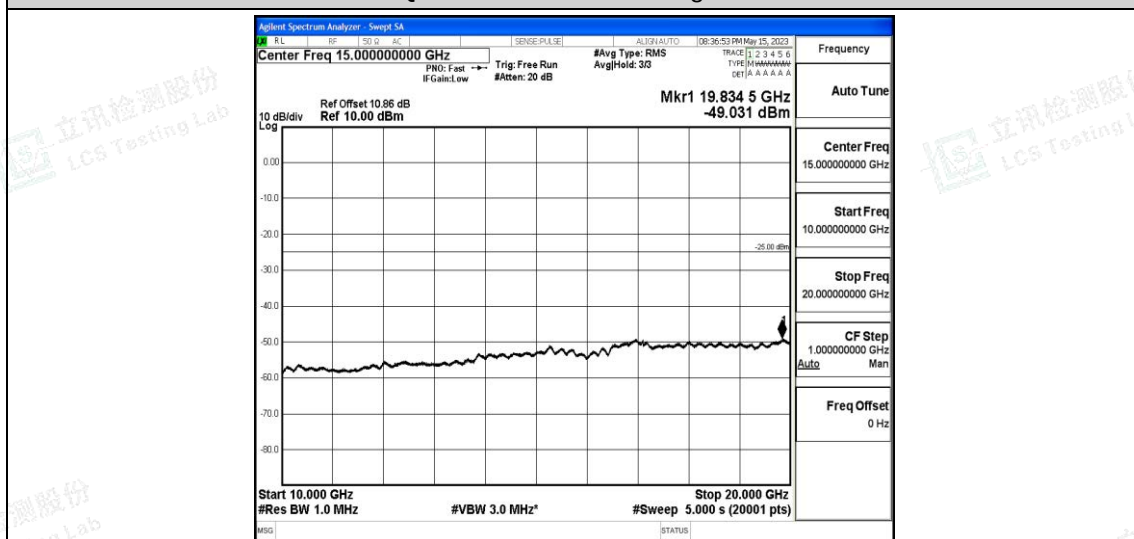


Band41-5MHz-16QAM-39675-1RB#0-Range6:20000~26500MHz




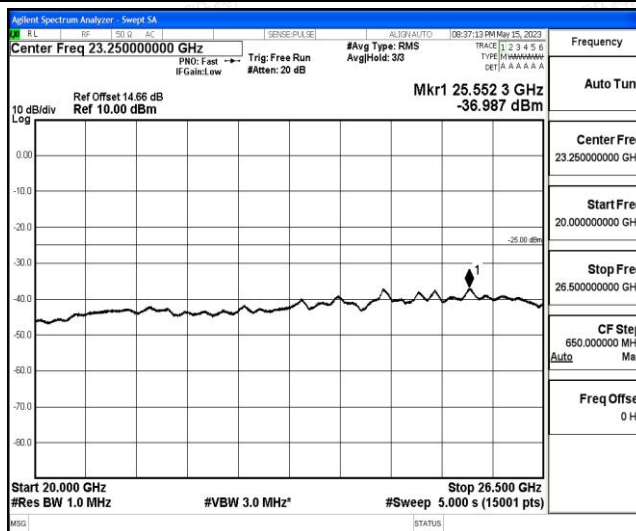

Band41-5MHz-16QAM-40620-1RB#0-Range1:0.009~0.15MHz

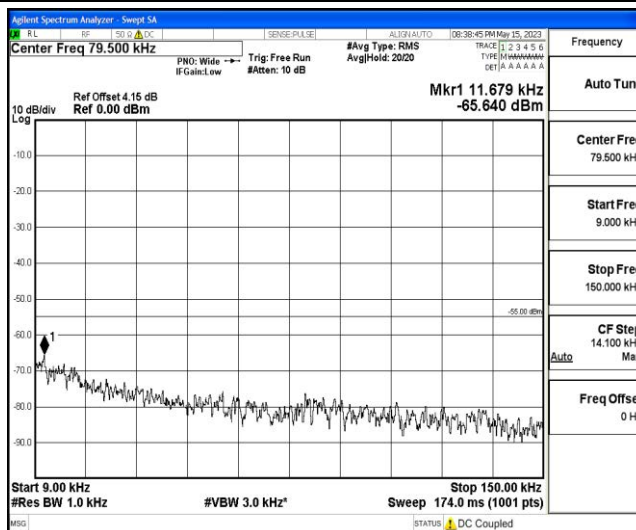


Band41-5MHz-16QAM-40620-1RB#0-Range2:0.15~30MHz

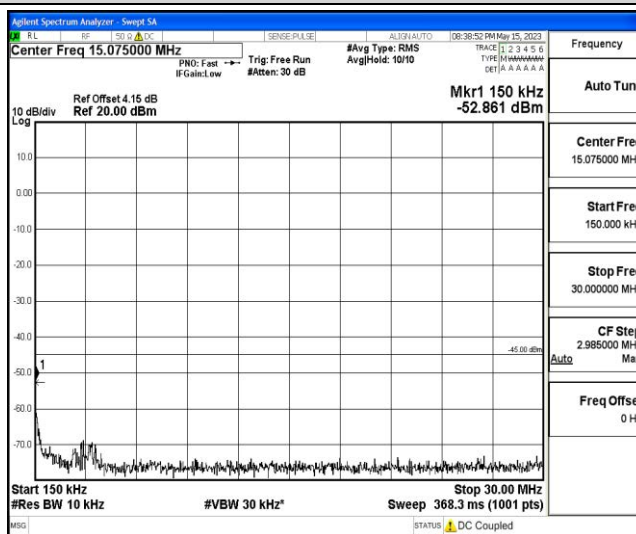


Band41-5MHz-16QAM-40620-1RB#0-Range3:30~1000MHz




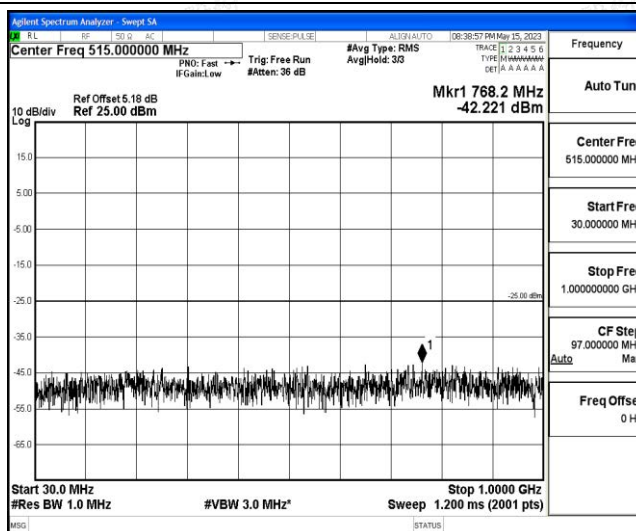

Band41-5MHz-16QAM-40620-1RB#0-Range4:1000~10000MHz

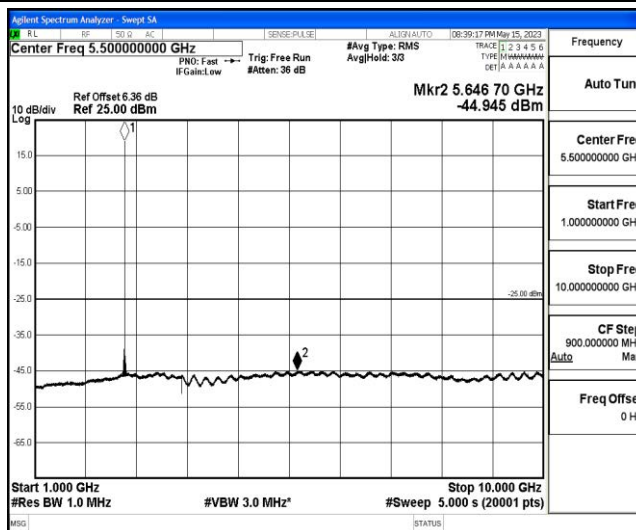


Band41-5MHz-16QAM-40620-1RB#0-Range5:10000~20000MHz

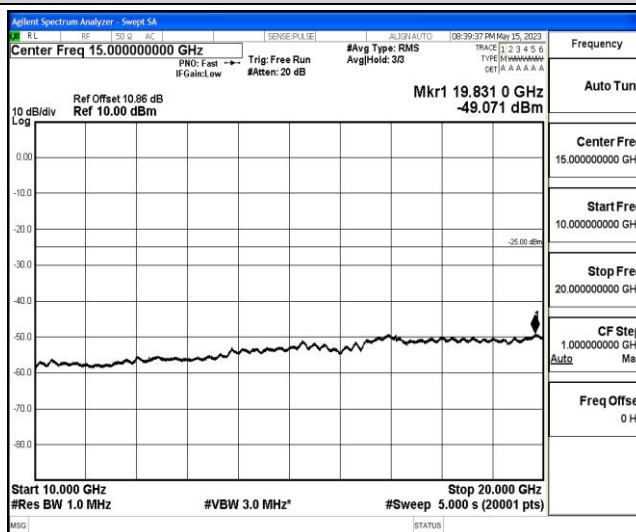


Band41-5MHz-16QAM-40620-1RB#0-Range6:20000~26500MHz




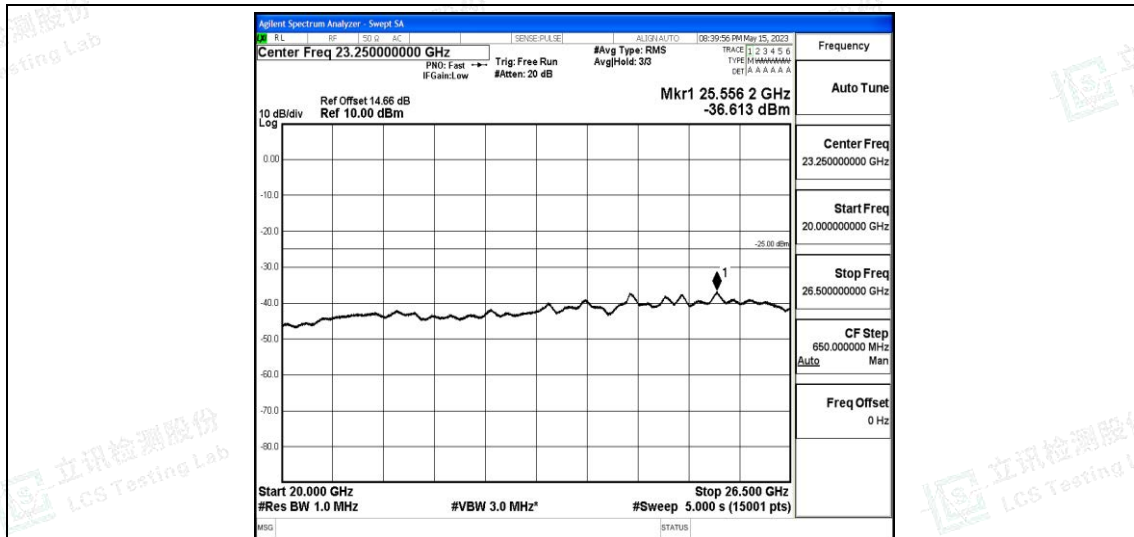

Band41-5MHz-16QAM-41565-1RB#0-Range1:0.009~0.15MHz

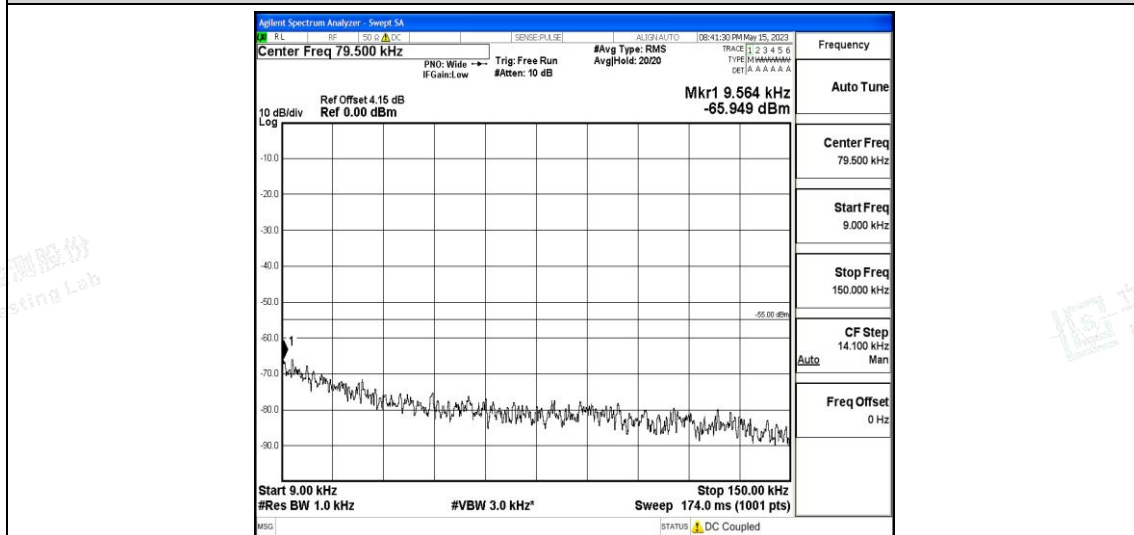


Band41-5MHz-16QAM-41565-1RB#0-Range2:0.15~30MHz

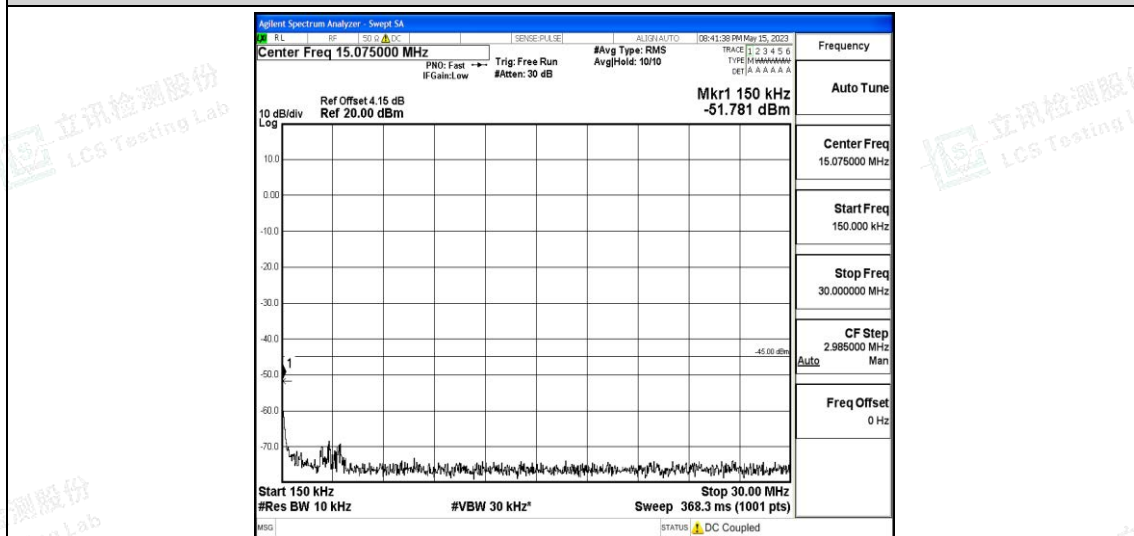


Band41-5MHz-16QAM-41565-1RB#0-Range3:30~1000MHz




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

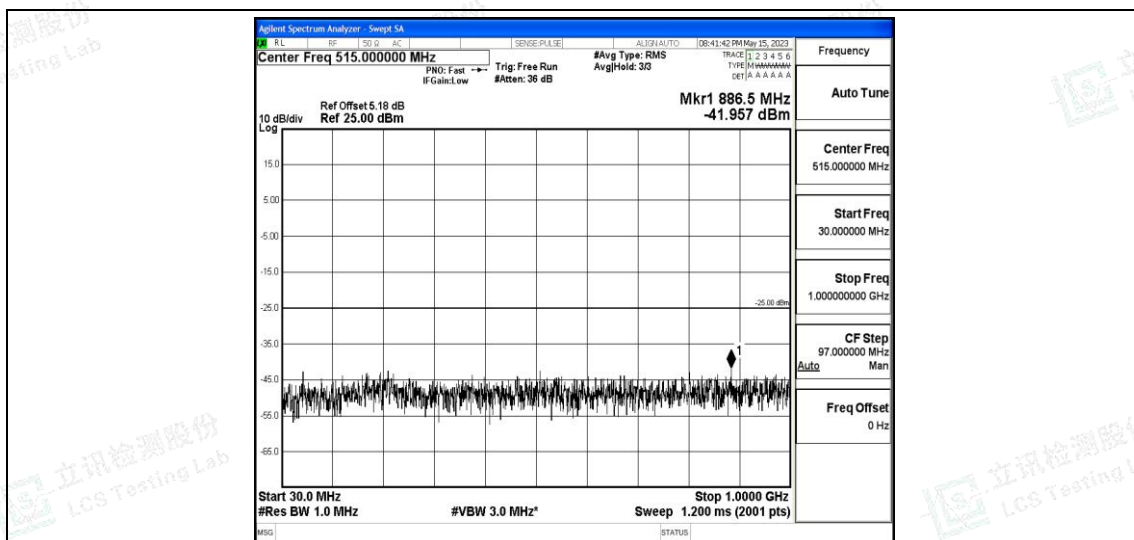

Band41-5MHz-16QAM-41565-1RB#0-Range4:1000~10000MHz

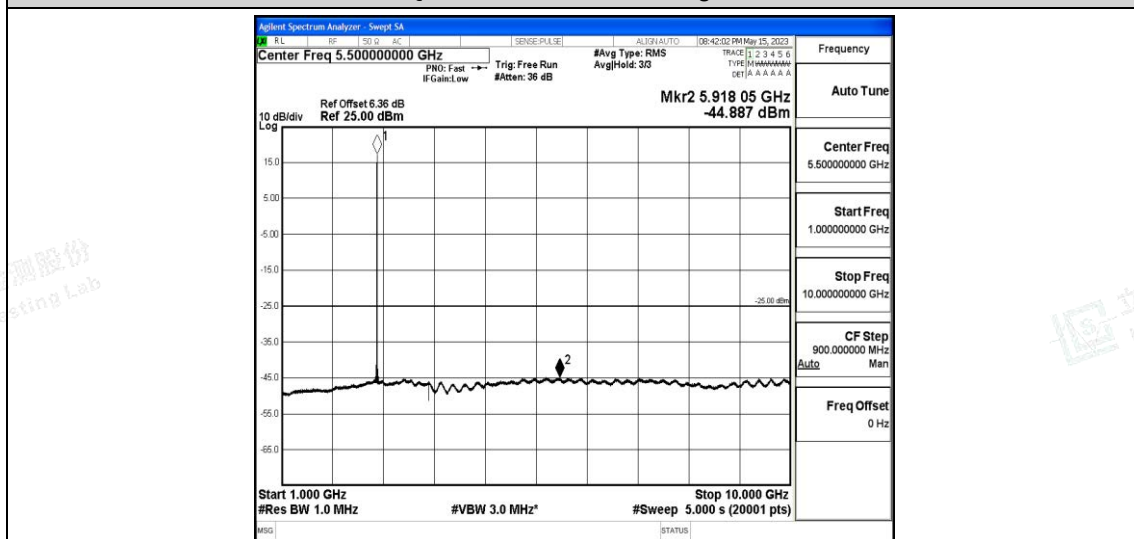

Band41-5MHz-16QAM-41565-1RB#0-Range5:10000~20000MHz

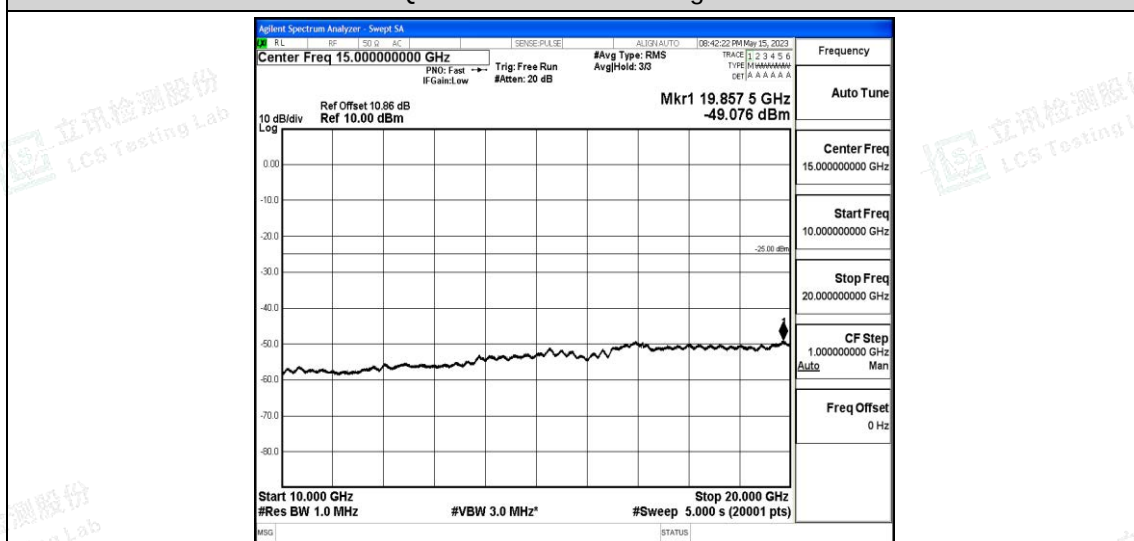

Band41-5MHz-16QAM-41565-1RB#0-Range6:20000~26500MHz



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity