



Appendix I: Test Data for E-UTRA Band 41

Product Name: Smart phone

Test Model: DL4s

Environmental Conditions

Temperature:	23.8 ° C
Relative Humidity:	52.1%
ATM Pressure:	100.0 kPa
Test Engineer:	Ling Zhu
Supervised by:	Li Huan





I.1 Effective (Isotropic) Radiated Power Output Data

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	20.87	PASS
Band41	5MHz	QPSK	39675	1RB#12	20.90	PASS
Band41	5MHz	QPSK	39675	1RB#24	20.88	PASS
Band41	5MHz	QPSK	39675	12RB#0	20.01	PASS
Band41	5MHz	QPSK	39675	12RB#6	19.99	PASS
Band41	5MHz	QPSK	39675	12RB#13	20.07	PASS
Band41	5MHz	QPSK	39675	25RB#0	20.08	PASS
Band41	5MHz	QPSK	40620	1RB#0	21.15	PASS
Band41	5MHz	QPSK	40620	1RB#12	21.34	PASS
Band41	5MHz	QPSK	40620	1RB#24	21.17	PASS
Band41	5MHz	QPSK	40620	12RB#0	20.52	PASS
Band41	5MHz	QPSK	40620	12RB#6	20.51	PASS
Band41	5MHz	QPSK	40620	12RB#13	20.58	PASS
Band41	5MHz	QPSK	40620	25RB#0	20.48	PASS
Band41	5MHz	QPSK	41565	1RB#0	22.01	PASS
Band41	5MHz	QPSK	41565	1RB#12	22.13	PASS
Band41	5MHz	QPSK	41565	1RB#24	22.02	PASS
Band41	5MHz	QPSK	41565	12RB#0	21.23	PASS
Band41	5MHz	QPSK	41565	12RB#6	21.20	PASS
Band41	5MHz	QPSK	41565	12RB#13	21.20	PASS
Band41	5MHz	QPSK	41565	25RB#0	21.16	PASS
Band41	5MHz	16QAM	39675	1RB#0	19.95	PASS
Band41	5MHz	16QAM	39675	1RB#12	19.88	PASS
Band41	5MHz	16QAM	39675	1RB#24	19.84	PASS
Band41	5MHz	16QAM	39675	12RB#0	19.02	PASS
Band41	5MHz	16QAM	39675	12RB#6	19.01	PASS
Band41	5MHz	16QAM	39675	12RB#13	18.96	PASS
Band41	5MHz	16QAM	39675	25RB#0	19.10	PASS
Band41	5MHz	16QAM	40620	1RB#0	20.91	PASS
Band41	5MHz	16QAM	40620	1RB#12	21.04	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	5MHz	16QAM	40620	1RB#24	20.88	PASS
Band41	5MHz	16QAM	40620	12RB#0	19.41	PASS
Band41	5MHz	16QAM	40620	12RB#6	19.40	PASS
Band41	5MHz	16QAM	40620	12RB#13	19.47	PASS
Band41	5MHz	16QAM	40620	25RB#0	19.47	PASS
Band41	5MHz	16QAM	41565	1RB#0	21.20	PASS
Band41	5MHz	16QAM	41565	1RB#12	21.09	PASS
Band41	5MHz	16QAM	41565	1RB#24	21.10	PASS
Band41	5MHz	16QAM	41565	12RB#0	20.18	PASS
Band41	5MHz	16QAM	41565	12RB#6	20.14	PASS
Band41	5MHz	16QAM	41565	12RB#13	20.22	PASS
Band41	5MHz	16QAM	41565	25RB#0	20.32	PASS
Band41	10MHz	QPSK	39700	1RB#0	21.03	PASS
Band41	10MHz	QPSK	39700	1RB#24	21.30	PASS
Band41	10MHz	QPSK	39700	1RB#49	21.18	PASS
Band41	10MHz	QPSK	39700	25RB#0	20.27	PASS
Band41	10MHz	QPSK	39700	25RB#12	20.37	PASS
Band41	10MHz	QPSK	39700	25RB#25	20.35	PASS
Band41	10MHz	QPSK	39700	50RB#0	20.31	PASS
Band41	10MHz	QPSK	40620	1RB#0	21.28	PASS
Band41	10MHz	QPSK	40620	1RB#24	21.60	PASS
Band41	10MHz	QPSK	40620	1RB#49	21.45	PASS
Band41	10MHz	QPSK	40620	25RB#0	20.57	PASS
Band41	10MHz	QPSK	40620	25RB#12	20.57	PASS
Band41	10MHz	QPSK	40620	25RB#25	20.80	PASS
Band41	10MHz	QPSK	40620	50RB#0	20.65	PASS
Band41	10MHz	QPSK	41540	1RB#0	22.02	PASS
Band41	10MHz	QPSK	41540	1RB#24	22.27	PASS
Band41	10MHz	QPSK	41540	1RB#49	22.19	PASS
Band41	10MHz	QPSK	41540	25RB#0	21.39	PASS
Band41	10MHz	QPSK	41540	25RB#12	21.34	PASS
Band41	10MHz	QPSK	41540	25RB#25	21.30	PASS
Band41	10MHz	QPSK	41540	50RB#0	21.40	PASS
Band41	10MHz	16QAM	39700	1RB#0	20.42	PASS
Band41	10MHz	16QAM	39700	1RB#24	20.60	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	10MHz	16QAM	39700	1RB#49	20.31	PASS
Band41	10MHz	16QAM	39700	25RB#0	19.35	PASS
Band41	10MHz	16QAM	39700	25RB#12	19.35	PASS
Band41	10MHz	16QAM	39700	25RB#25	19.36	PASS
Band41	10MHz	16QAM	39700	50RB#0	19.33	PASS
Band41	10MHz	16QAM	40620	1RB#0	20.56	PASS
Band41	10MHz	16QAM	40620	1RB#24	20.92	PASS
Band41	10MHz	16QAM	40620	1RB#49	20.76	PASS
Band41	10MHz	16QAM	40620	25RB#0	19.66	PASS
Band41	10MHz	16QAM	40620	25RB#12	19.66	PASS
Band41	10MHz	16QAM	40620	25RB#25	19.82	PASS
Band41	10MHz	16QAM	40620	50RB#0	19.68	PASS
Band41	10MHz	16QAM	41540	1RB#0	21.45	PASS
Band41	10MHz	16QAM	41540	1RB#24	21.31	PASS
Band41	10MHz	16QAM	41540	1RB#49	21.47	PASS
Band41	10MHz	16QAM	41540	25RB#0	20.38	PASS
Band41	10MHz	16QAM	41540	25RB#12	20.37	PASS
Band41	10MHz	16QAM	41540	25RB#25	20.52	PASS
Band41	10MHz	16QAM	41540	50RB#0	20.47	PASS
Band41	15MHz	QPSK	39725	1RB#0	21.01	PASS
Band41	15MHz	QPSK	39725	1RB#38	21.12	PASS
Band41	15MHz	QPSK	39725	1RB#74	21.18	PASS
Band41	15MHz	QPSK	39725	38RB#0	20.33	PASS
Band41	15MHz	QPSK	39725	38RB#18	20.33	PASS
Band41	15MHz	QPSK	39725	38RB#37	20.32	PASS
Band41	15MHz	QPSK	39725	75RB#0	20.32	PASS
Band41	15MHz	QPSK	40620	1RB#0	21.19	PASS
Band41	15MHz	QPSK	40620	1RB#38	21.54	PASS
Band41	15MHz	QPSK	40620	1RB#74	21.55	PASS
Band41	15MHz	QPSK	40620	38RB#0	20.65	PASS
Band41	15MHz	QPSK	40620	38RB#18	20.64	PASS
Band41	15MHz	QPSK	40620	38RB#37	20.64	PASS
Band41	15MHz	QPSK	40620	75RB#0	20.63	PASS
Band41	15MHz	QPSK	41515	1RB#0	22.04	PASS
Band41	15MHz	QPSK	41515	1RB#38	22.30	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	15MHz	QPSK	41515	1RB#74	22.12	PASS
Band41	15MHz	QPSK	41515	38RB#0	21.45	PASS
Band41	15MHz	QPSK	41515	38RB#18	21.44	PASS
Band41	15MHz	QPSK	41515	38RB#37	21.43	PASS
Band41	15MHz	QPSK	41515	75RB#0	21.42	PASS
Band41	15MHz	16QAM	39725	1RB#0	20.12	PASS
Band41	15MHz	16QAM	39725	1RB#38	20.44	PASS
Band41	15MHz	16QAM	39725	1RB#74	20.30	PASS
Band41	15MHz	16QAM	39725	38RB#0	20.33	PASS
Band41	15MHz	16QAM	39725	38RB#18	20.32	PASS
Band41	15MHz	16QAM	39725	38RB#37	20.32	PASS
Band41	15MHz	16QAM	39725	75RB#0	19.37	PASS
Band41	15MHz	16QAM	40620	1RB#0	20.75	PASS
Band41	15MHz	16QAM	40620	1RB#38	20.68	PASS
Band41	15MHz	16QAM	40620	1RB#74	20.66	PASS
Band41	15MHz	16QAM	40620	38RB#0	20.65	PASS
Band41	15MHz	16QAM	40620	38RB#18	20.64	PASS
Band41	15MHz	16QAM	40620	38RB#37	20.64	PASS
Band41	15MHz	16QAM	40620	75RB#0	19.80	PASS
Band41	15MHz	16QAM	41515	1RB#0	21.44	PASS
Band41	15MHz	16QAM	41515	1RB#38	21.26	PASS
Band41	15MHz	16QAM	41515	1RB#74	21.38	PASS
Band41	15MHz	16QAM	41515	38RB#0	21.45	PASS
Band41	15MHz	16QAM	41515	38RB#18	21.44	PASS
Band41	15MHz	16QAM	41515	38RB#37	21.42	PASS
Band41	15MHz	16QAM	41515	75RB#0	20.63	PASS
Band41	20MHz	QPSK	39750	1RB#0	21.05	PASS
Band41	20MHz	QPSK	39750	1RB#49	21.31	PASS
Band41	20MHz	QPSK	39750	1RB#99	21.09	PASS
Band41	20MHz	QPSK	39750	50RB#0	20.37	PASS
Band41	20MHz	QPSK	39750	50RB#25	20.37	PASS
Band41	20MHz	QPSK	39750	50RB#50	20.32	PASS
Band41	20MHz	QPSK	39750	100RB#0	20.39	PASS
Band41	20MHz	QPSK	40620	1RB#0	21.23	PASS
Band41	20MHz	QPSK	40620	1RB#49	21.72	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	20MHz	QPSK	40620	1RB#99	21.33	PASS
Band41	20MHz	QPSK	40620	50RB#0	20.62	PASS
Band41	20MHz	QPSK	40620	50RB#25	20.61	PASS
Band41	20MHz	QPSK	40620	50RB#50	20.79	PASS
Band41	20MHz	QPSK	40620	100RB#0	20.60	PASS
Band41	20MHz	QPSK	41490	1RB#0	21.99	PASS
Band41	20MHz	QPSK	41490	1RB#49	22.16	PASS
Band41	20MHz	QPSK	41490	1RB#99	22.15	PASS
Band41	20MHz	QPSK	41490	50RB#0	21.38	PASS
Band41	20MHz	QPSK	41490	50RB#25	21.30	PASS
Band41	20MHz	QPSK	41490	50RB#50	21.41	PASS
Band41	20MHz	QPSK	41490	100RB#0	21.44	PASS
Band41	20MHz	16QAM	39750	1RB#0	20.69	PASS
Band41	20MHz	16QAM	39750	1RB#49	21.11	PASS
Band41	20MHz	16QAM	39750	1RB#99	20.88	PASS
Band41	20MHz	16QAM	39750	50RB#0	19.42	PASS
Band41	20MHz	16QAM	39750	50RB#25	19.41	PASS
Band41	20MHz	16QAM	39750	50RB#50	19.38	PASS
Band41	20MHz	16QAM	39750	100RB#0	19.42	PASS
Band41	20MHz	16QAM	40620	1RB#0	21.04	PASS
Band41	20MHz	16QAM	40620	1RB#49	21.55	PASS
Band41	20MHz	16QAM	40620	1RB#99	21.22	PASS
Band41	20MHz	16QAM	40620	50RB#0	19.77	PASS
Band41	20MHz	16QAM	40620	50RB#25	19.76	PASS
Band41	20MHz	16QAM	40620	50RB#50	19.85	PASS
Band41	20MHz	16QAM	40620	100RB#0	19.74	PASS
Band41	20MHz	16QAM	41490	1RB#0	21.70	PASS
Band41	20MHz	16QAM	41490	1RB#49	22.05	PASS
Band41	20MHz	16QAM	41490	1RB#99	21.76	PASS
Band41	20MHz	16QAM	41490	50RB#0	20.48	PASS
Band41	20MHz	16QAM	41490	50RB#25	20.47	PASS
Band41	20MHz	16QAM	41490	50RB#50	20.57	PASS
Band41	20MHz	16QAM	41490	100RB#0	20.50	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



I.2 Peak-to-Average Ratio(CCDF)

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dB)	Limit(dB)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	5.20	13	PASS
Band41	5MHz	QPSK	40620	25RB#0	5.34	13	PASS
Band41	5MHz	QPSK	41565	25RB#0	3.37	13	PASS
Band41	5MHz	16QAM	39675	25RB#0	6.79	13	PASS
Band41	5MHz	16QAM	40620	25RB#0	6.10	13	PASS
Band41	5MHz	16QAM	41565	25RB#0	4.45	13	PASS
Band41	10MHz	QPSK	39700	50RB#0	5.09	13	PASS
Band41	10MHz	QPSK	40620	50RB#0	5.37	13	PASS
Band41	10MHz	QPSK	41540	50RB#0	3.60	13	PASS
Band41	10MHz	16QAM	39700	50RB#0	5.96	13	PASS
Band41	10MHz	16QAM	40620	50RB#0	6.21	13	PASS
Band41	10MHz	16QAM	41540	50RB#0	4.63	13	PASS
Band41	15MHz	QPSK	39725	75RB#0	5.29	13	PASS
Band41	15MHz	QPSK	40620	75RB#0	5.68	13	PASS
Band41	15MHz	QPSK	41515	75RB#0	4.01	13	PASS
Band41	15MHz	16QAM	39725	75RB#0	6.02	13	PASS
Band41	15MHz	16QAM	40620	75RB#0	6.33	13	PASS
Band41	15MHz	16QAM	41515	75RB#0	5.01	13	PASS
Band41	20MHz	QPSK	39750	100RB#0	5.09	13	PASS
Band41	20MHz	QPSK	40620	100RB#0	5.45	13	PASS
Band41	20MHz	QPSK	41490	100RB#0	4.51	13	PASS
Band41	20MHz	16QAM	39750	100RB#0	5.95	13	PASS
Band41	20MHz	16QAM	40620	100RB#0	6.24	13	PASS
Band41	20MHz	16QAM	41490	100RB#0	5.39	13	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Band41-5MHz-QPSK-39675-25RB#0

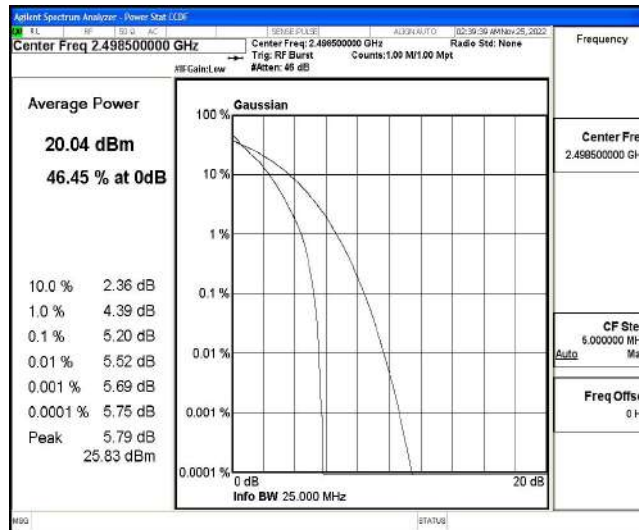


Band41-5MHz-QPSK-40620-25RB#0

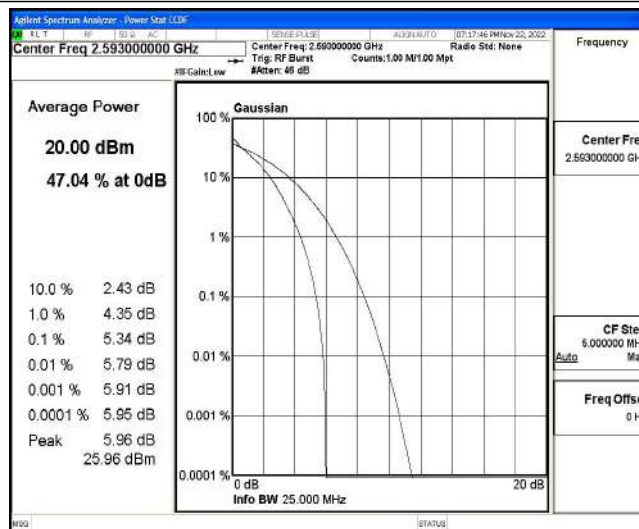


Band41-5MHz-QPSK-41565-25RB#0




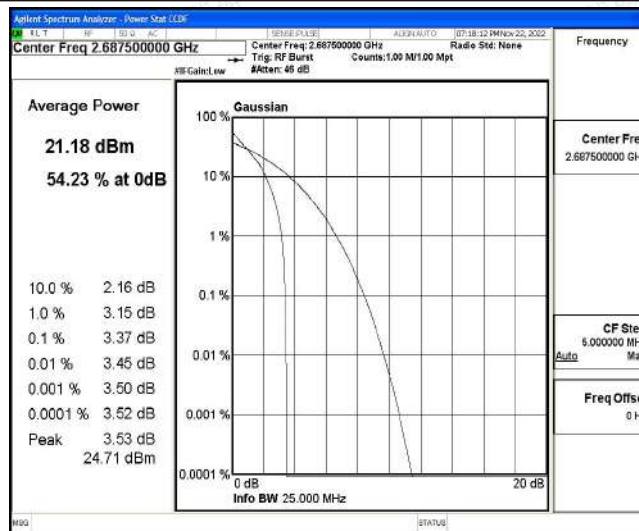

Band41-5MHz-16QAM-39675-25RB#0

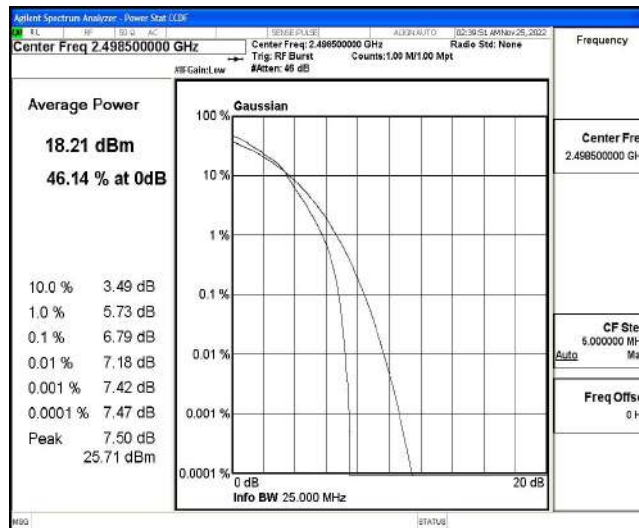


Band41-5MHz-16QAM-40620-25RB#0

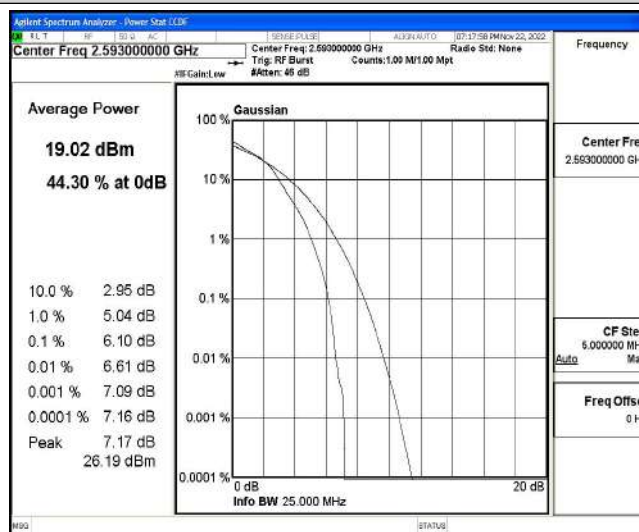


Band41-5MHz-16QAM-41565-25RB#0




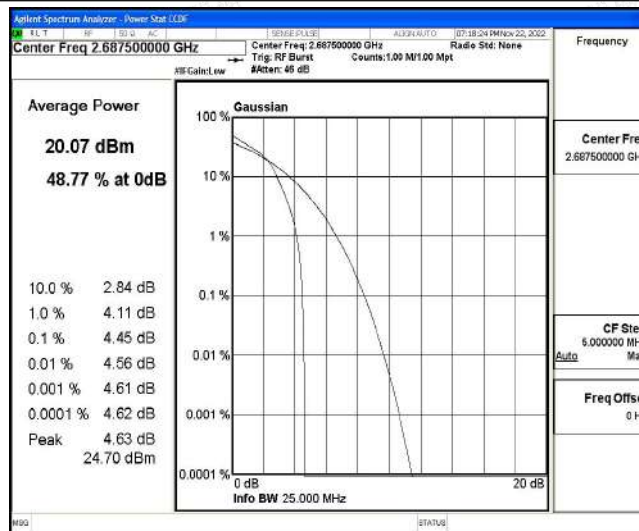

Band41-10MHz-QPSK-39700-50RB#0

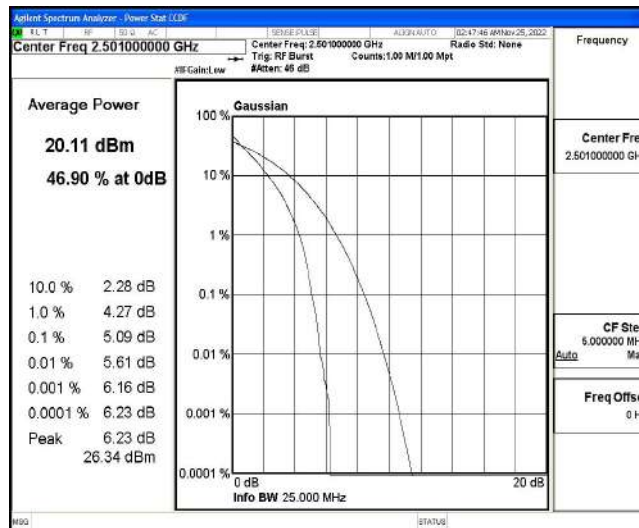


Band41-10MHz-QPSK-40620-50RB#0

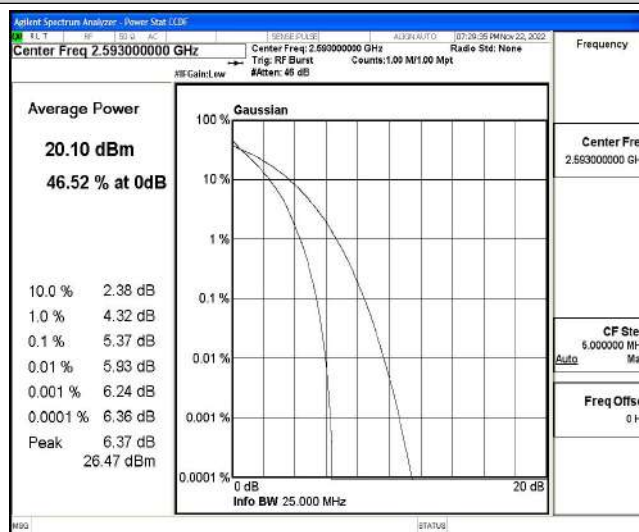


Band41-10MHz-QPSK-41540-50RB#0




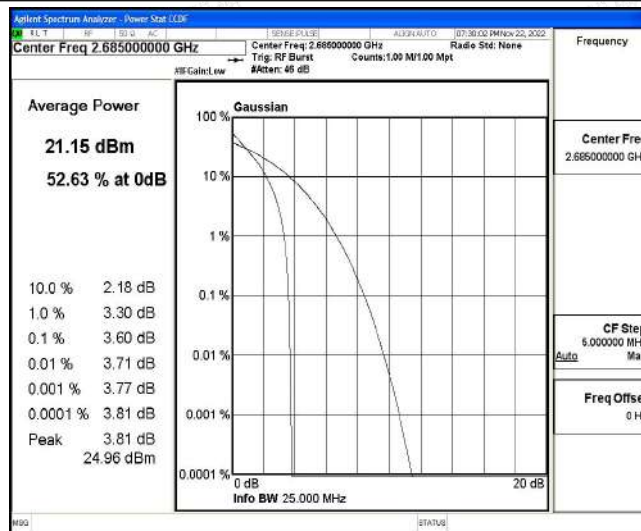

Band41-10MHz-16QAM-39700-50RB#0

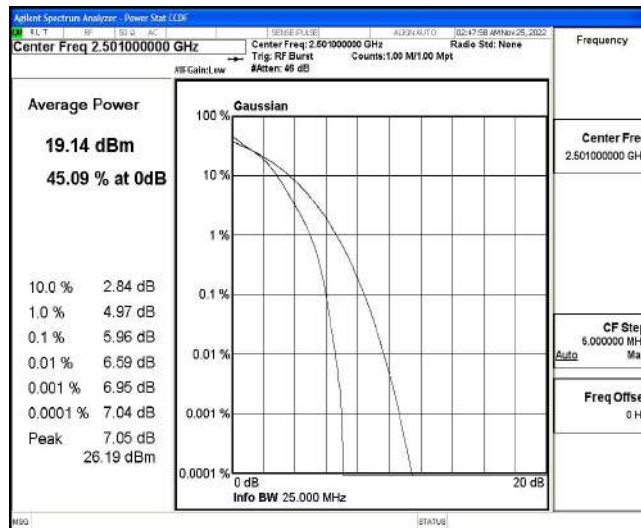


Band41-10MHz-16QAM-40620-50RB#0

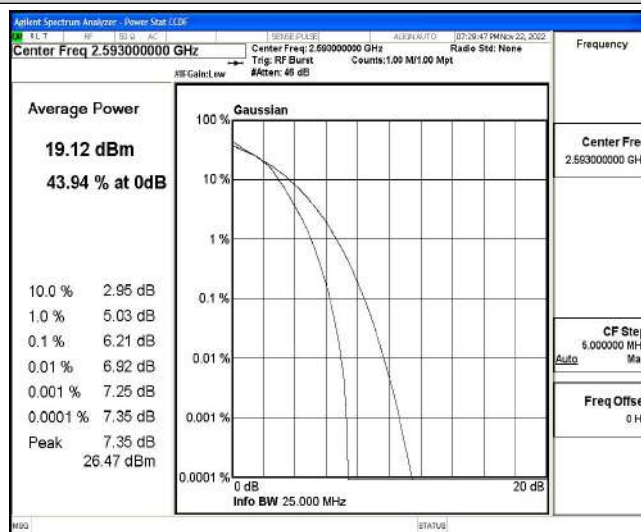


Band41-10MHz-16QAM-41540-50RB#0




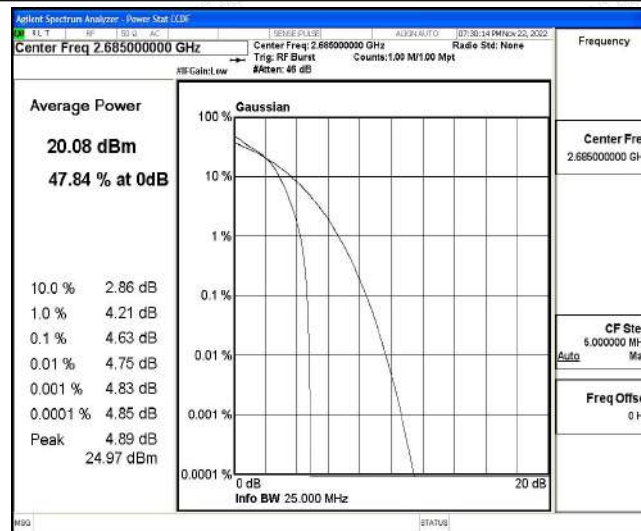

Band41-15MHz-QPSK-39725-75RB#0

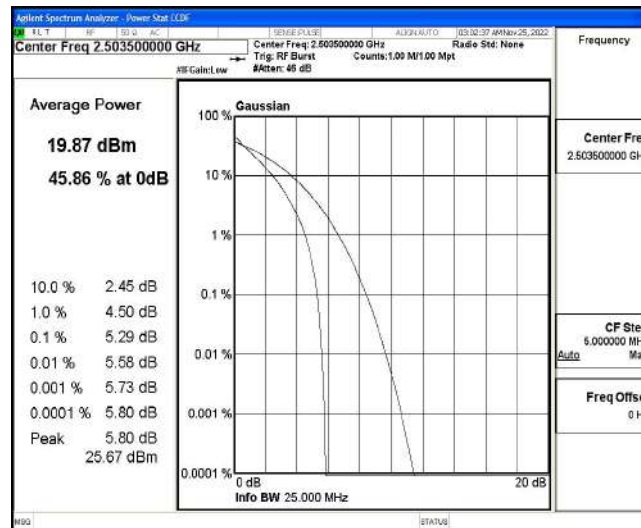


Band41-15MHz-QPSK-40620-75RB#0

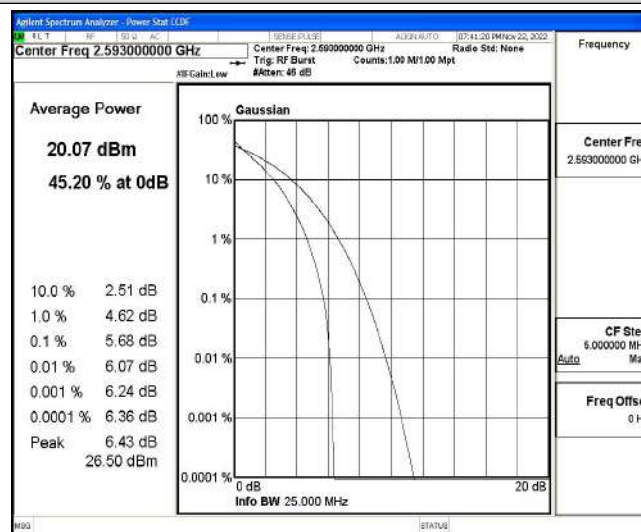


Band41-15MHz-QPSK-41515-75RB#0




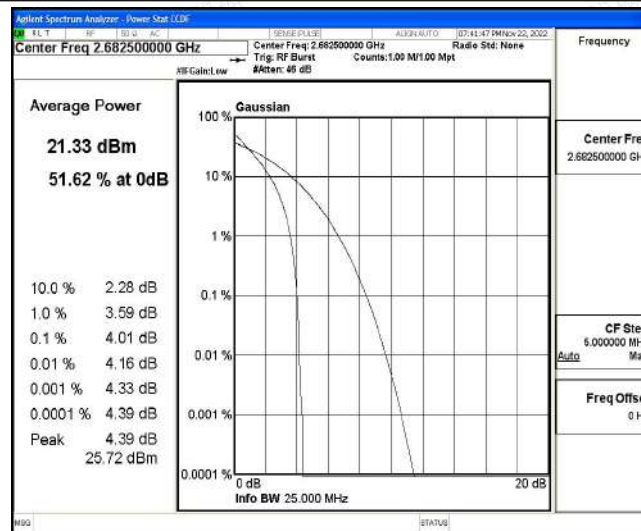

Band41-15MHz-16QAM-39725-75RB#0

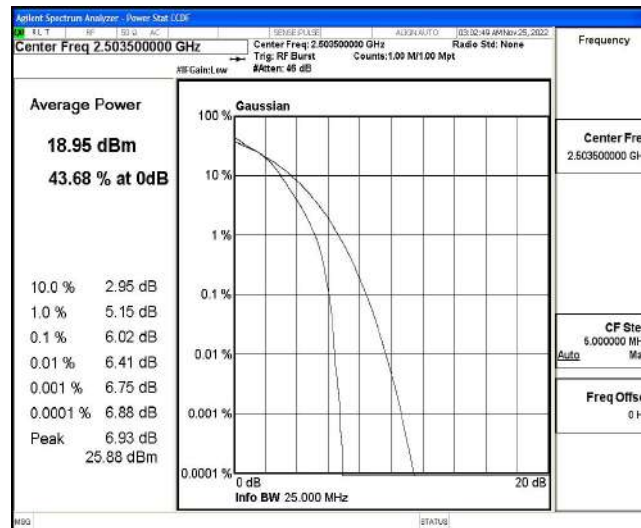


Band41-15MHz-16QAM-40620-75RB#0

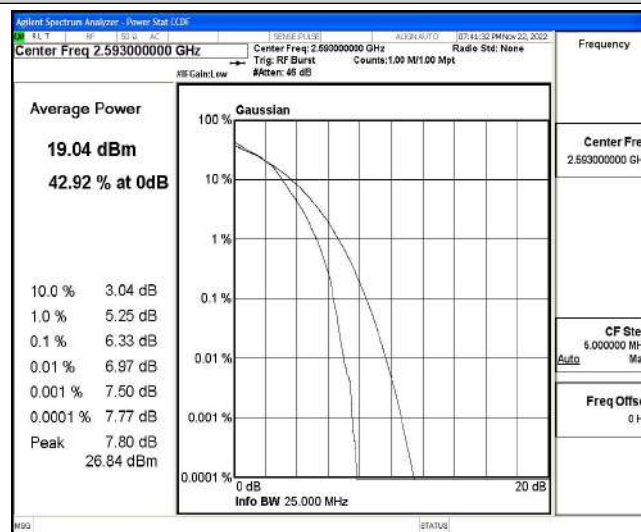


Band41-15MHz-16QAM-41515-75RB#0




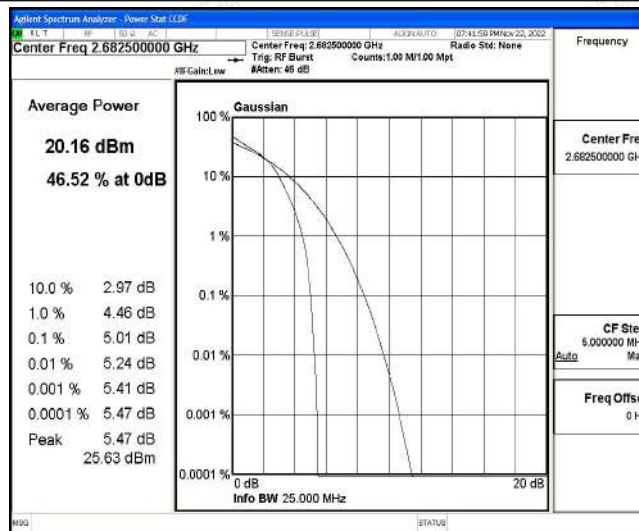

Band41-20MHz-QPSK-39750-100RB#0

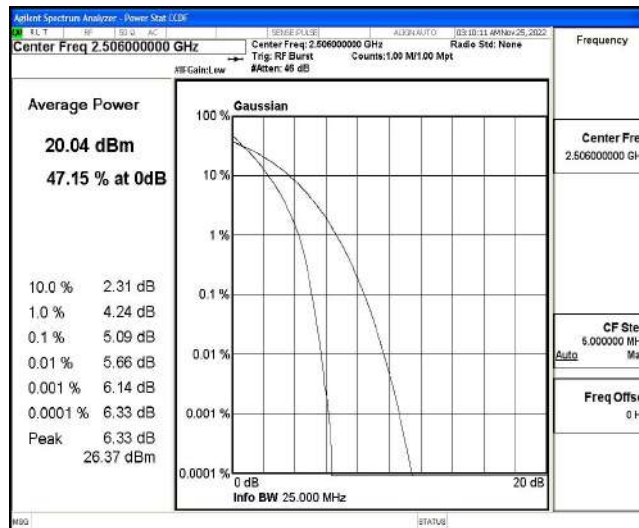


Band41-20MHz-QPSK-40620-100RB#0

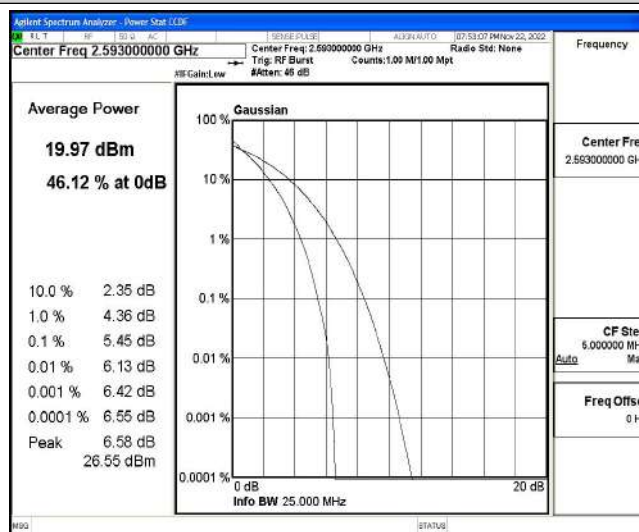


Band41-20MHz-QPSK-41490-100RB#0




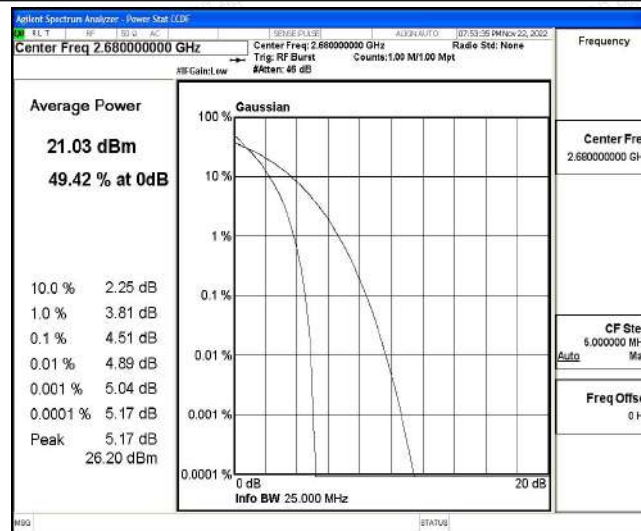

Band41-20MHz-16QAM-39750-100RB#0

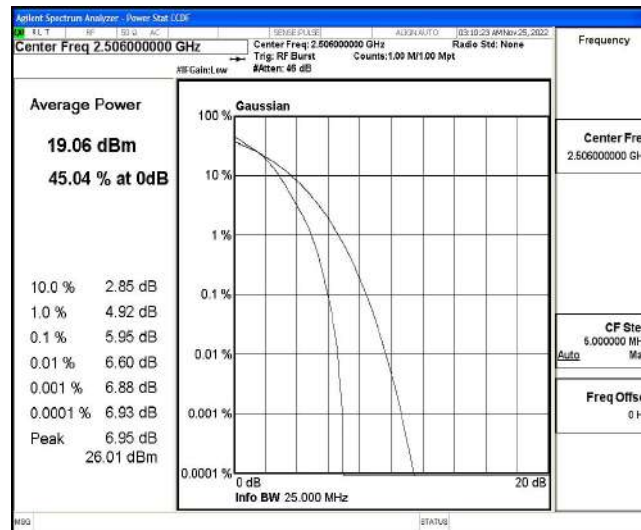


Band41-20MHz-16QAM-40620-100RB#0

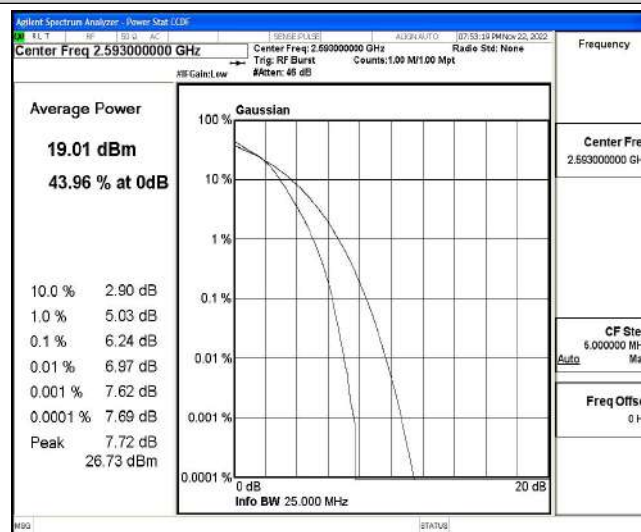

Band41-20MHz-16QAM-41490-100RB#0



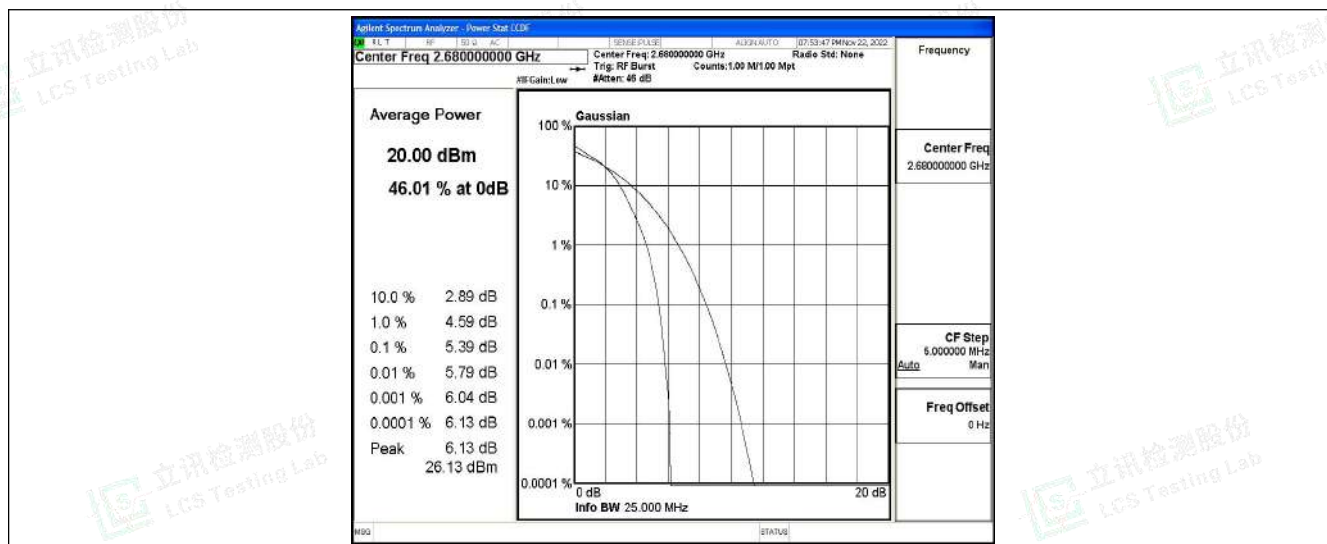

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



I.3 26dB Bandwidth and Occupied Bandwidth

Test Result


Band	Bandwidth	Modulation	Channel	RB Configuration	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	4.5002	4.945	PASS
Band41	5MHz	QPSK	40620	25RB#0	4.5244	5.136	PASS
Band41	5MHz	QPSK	41565	25RB#0	4.5080	5.269	PASS
Band41	5MHz	16QAM	39675	25RB#0	4.4920	5.024	PASS
Band41	5MHz	16QAM	40620	25RB#0	4.5094	5.377	PASS
Band41	5MHz	16QAM	41565	25RB#0	4.5222	5.413	PASS
Band41	10MHz	QPSK	39700	50RB#0	8.9844	10.85	PASS
Band41	10MHz	QPSK	40620	50RB#0	9.0135	10.24	PASS
Band41	10MHz	QPSK	41540	50RB#0	9.0188	10.86	PASS
Band41	10MHz	16QAM	39700	50RB#0	8.9763	10.03	PASS
Band41	10MHz	16QAM	40620	50RB#0	8.9929	10.04	PASS
Band41	10MHz	16QAM	41540	50RB#0	9.0049	10.10	PASS
Band41	15MHz	QPSK	39725	75RB#0	13.427	15.74	PASS
Band41	15MHz	QPSK	40620	75RB#0	13.409	15.74	PASS
Band41	15MHz	QPSK	41515	75RB#0	13.449	15.69	PASS
Band41	15MHz	16QAM	39725	75RB#0	13.488	15.15	PASS
Band41	15MHz	16QAM	40620	75RB#0	13.484	15.98	PASS
Band41	15MHz	16QAM	41515	75RB#0	13.389	15.20	PASS
Band41	20MHz	QPSK	39750	100RB#0	17.899	19.14	PASS
Band41	20MHz	QPSK	40620	100RB#0	17.991	19.69	PASS
Band41	20MHz	QPSK	41490	100RB#0	17.999	20.52	PASS
Band41	20MHz	16QAM	39750	100RB#0	17.816	19.41	PASS
Band41	20MHz	16QAM	40620	100RB#0	17.926	19.99	PASS
Band41	20MHz	16QAM	41490	100RB#0	17.861	20.29	PASS






Test Graphs

Band41-5MHz-QPSK-39675-25RB#0

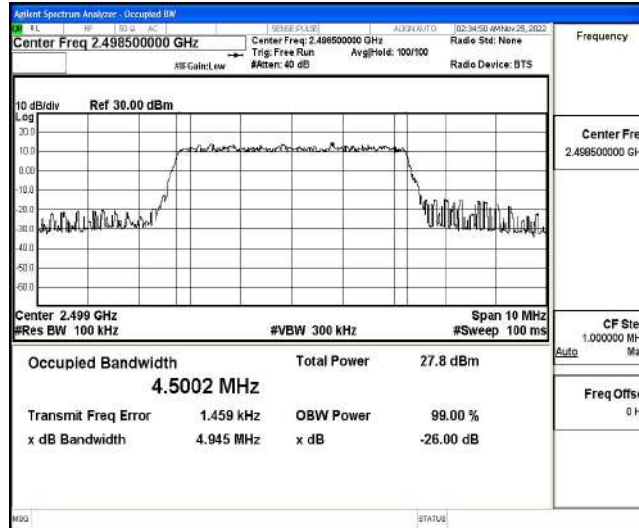


Band41-5MHz-QPSK-40620-25RB#0

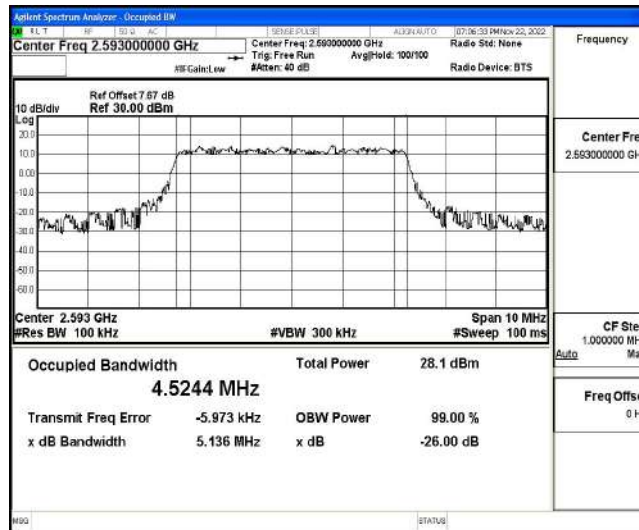


Band41-5MHz-QPSK-41565-25RB#0




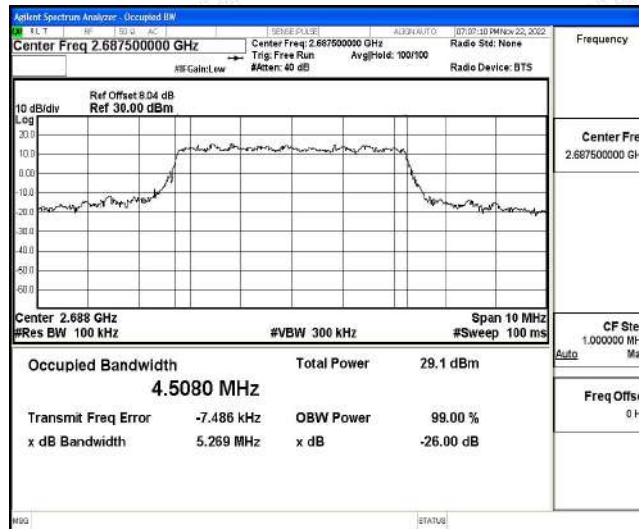

Band41-5MHz-16QAM-39675-25RB#0

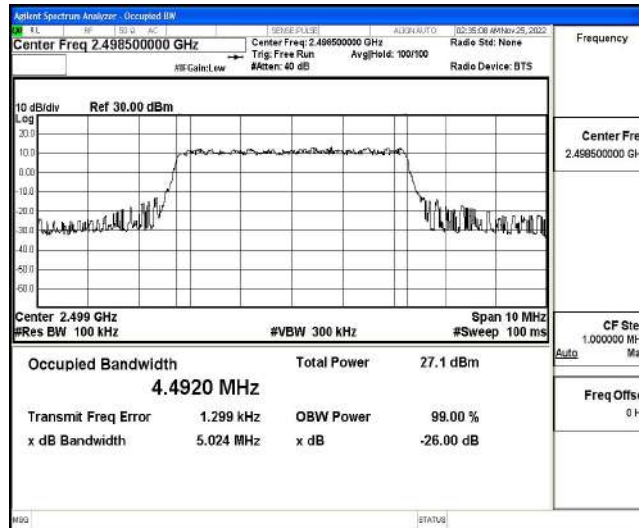


Band41-5MHz-16QAM-40620-25RB#0

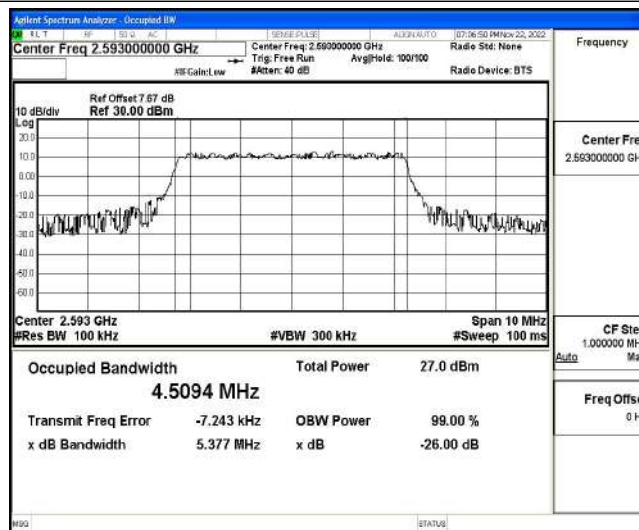


Band41-5MHz-16QAM-41565-25RB#0




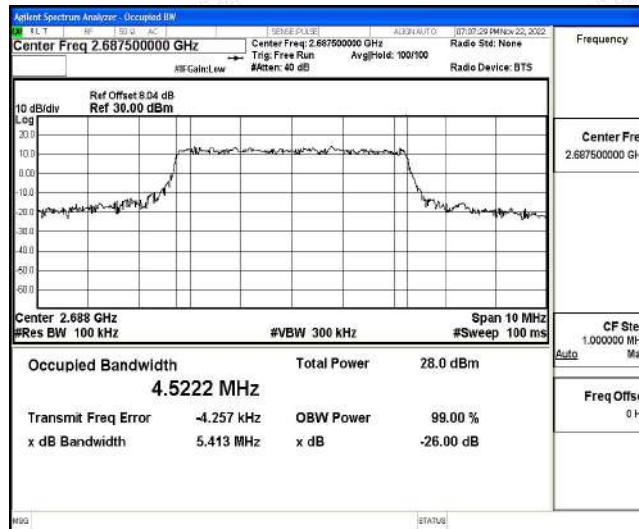

Band41-10MHz-QPSK-39700-50RB#0

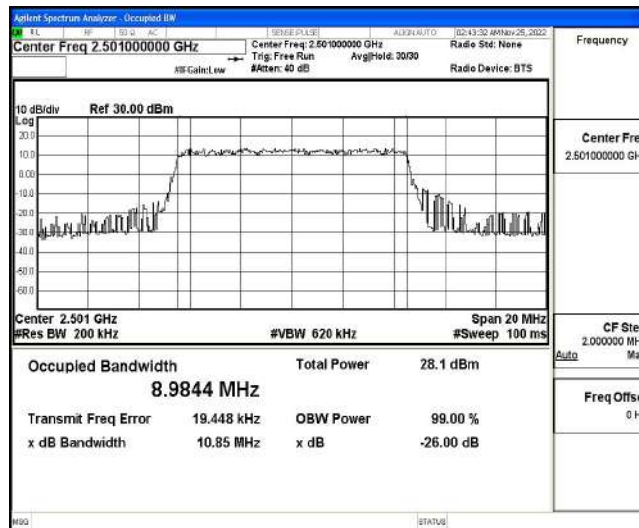


Band41-10MHz-QPSK-40620-50RB#0

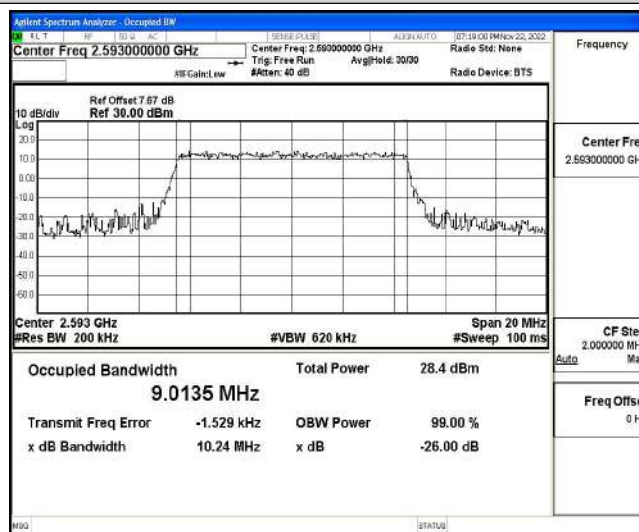


Band41-10MHz-QPSK-41540-50RB#0




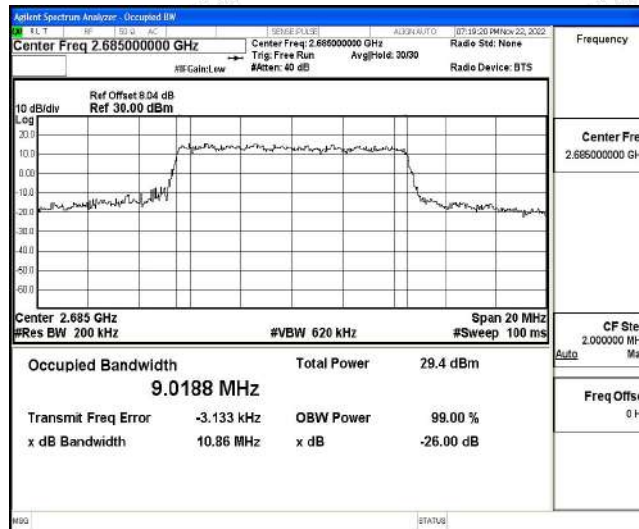

Band41-10MHz-16QAM-39700-50RB#0

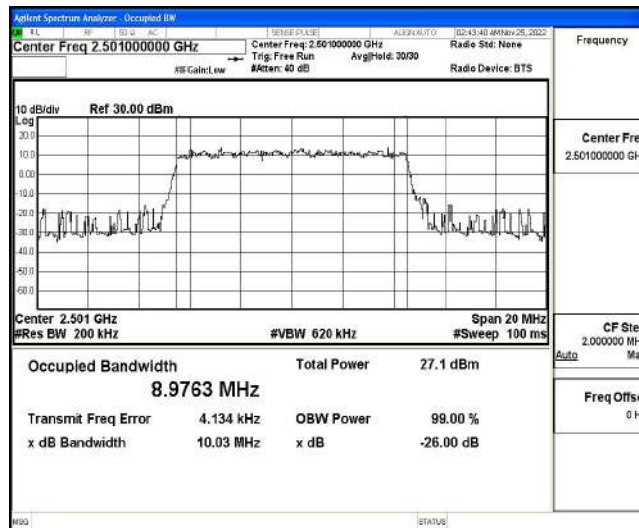

Band41-10MHz-16QAM-40620-50RB#0

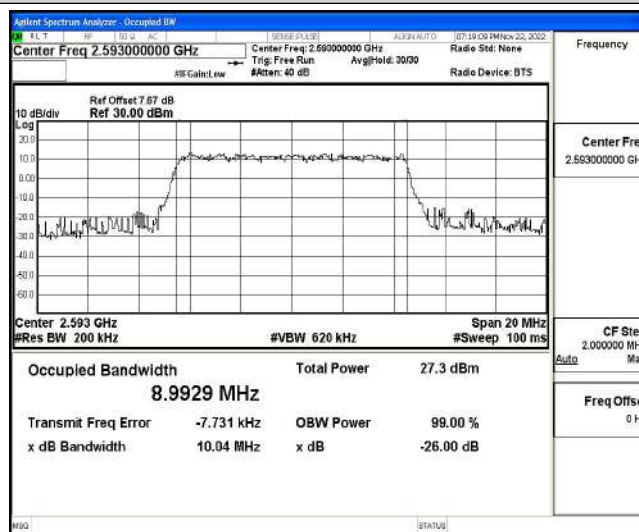

Band41-10MHz-16QAM-41540-50RB#0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

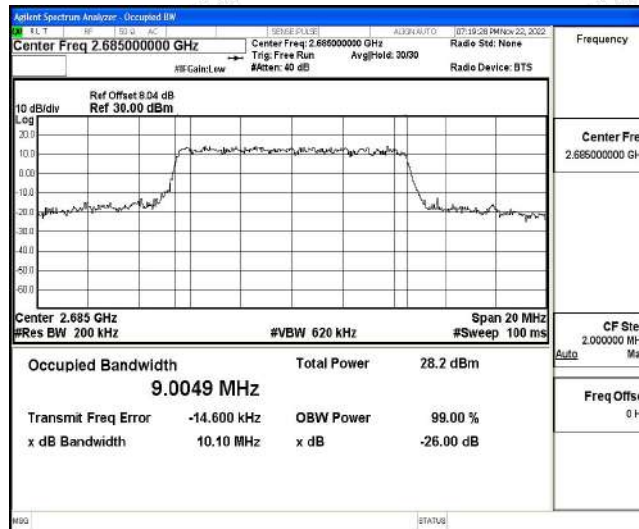

Band41-15MHz-QPSK-39725-75RB#0

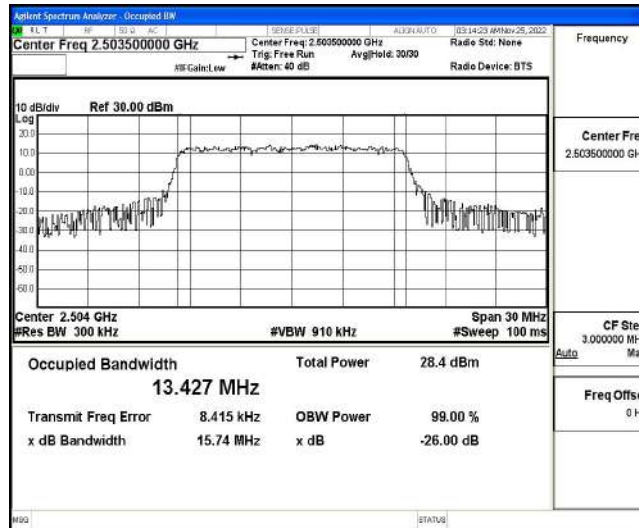


Band41-15MHz-QPSK-40620-75RB#0

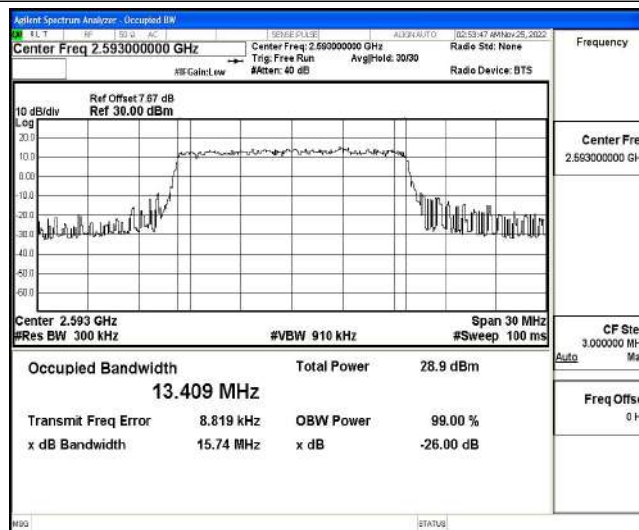


Band41-15MHz-QPSK-41515-75RB#0




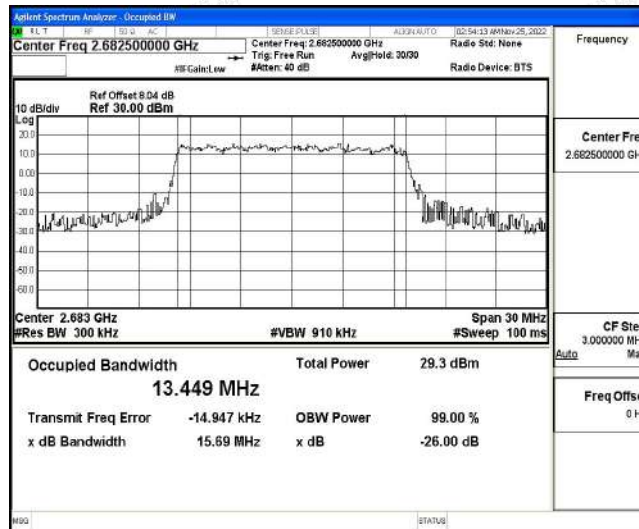

Band41-15MHz-16QAM-39725-75RB#0

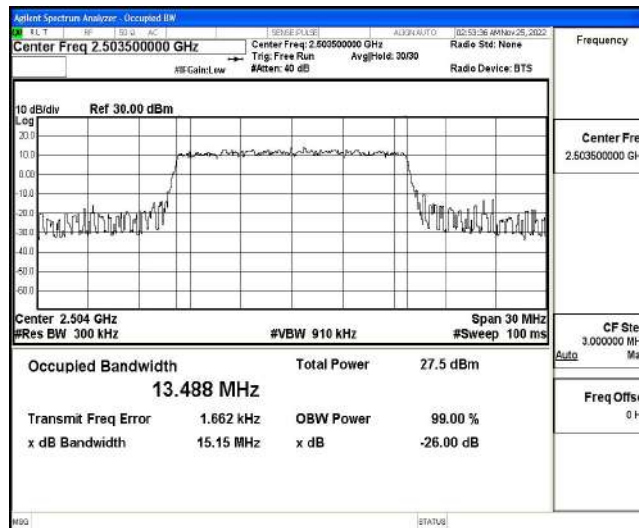

Band41-15MHz-16QAM-40620-75RB#0

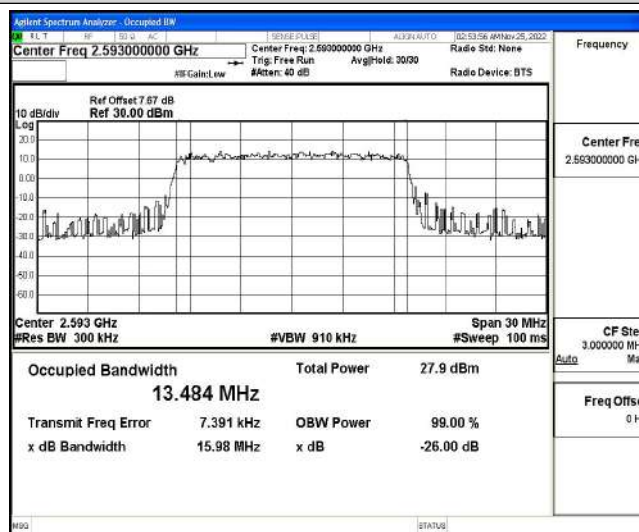

Band41-15MHz-16QAM-41515-75RB#0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

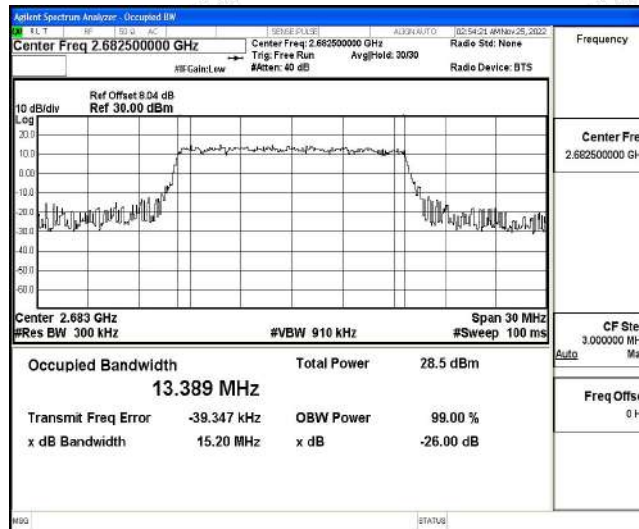

Band41-20MHz-QPSK-39750-100RB#0

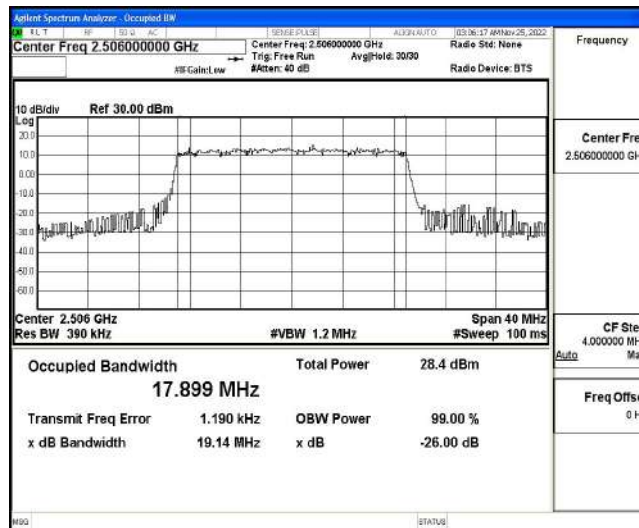


Band41-20MHz-QPSK-40620-100RB#0

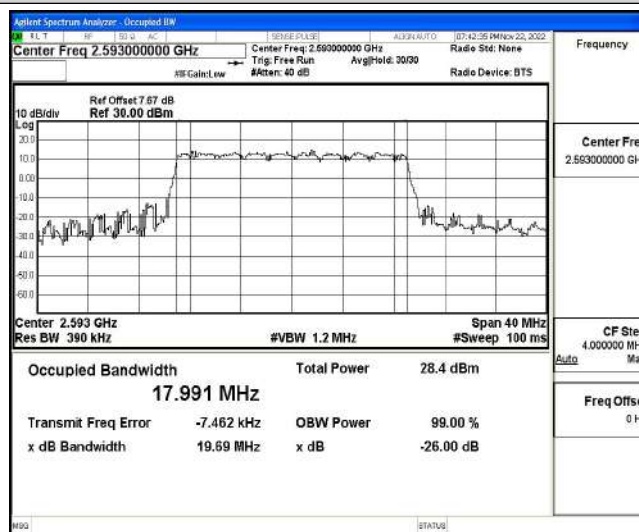


Band41-20MHz-QPSK-41490-100RB#0




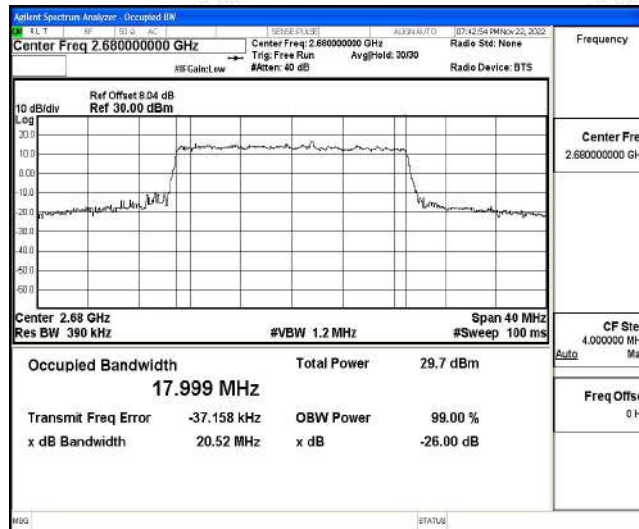

Band41-20MHz-16QAM-39750-100RB#0

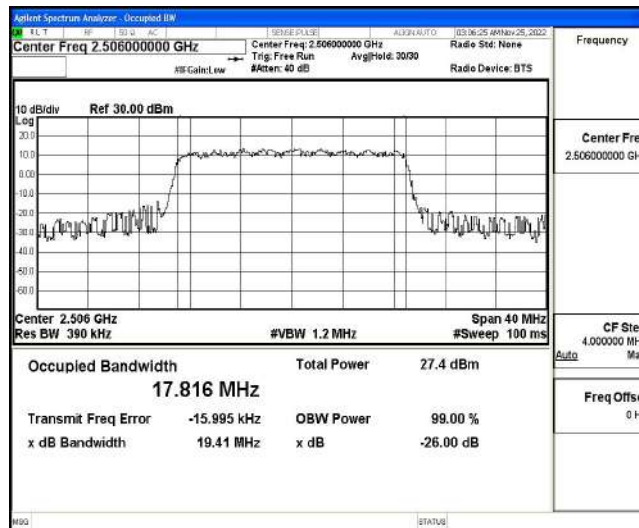


Band41-20MHz-16QAM-40620-100RB#0

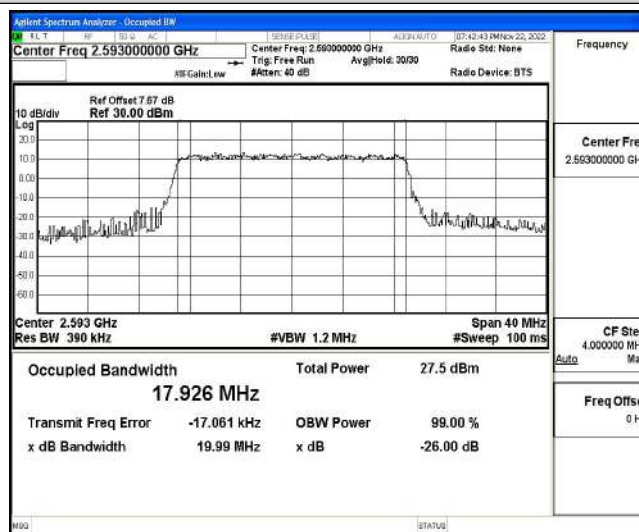

Band41-20MHz-16QAM-41490-100RB#0



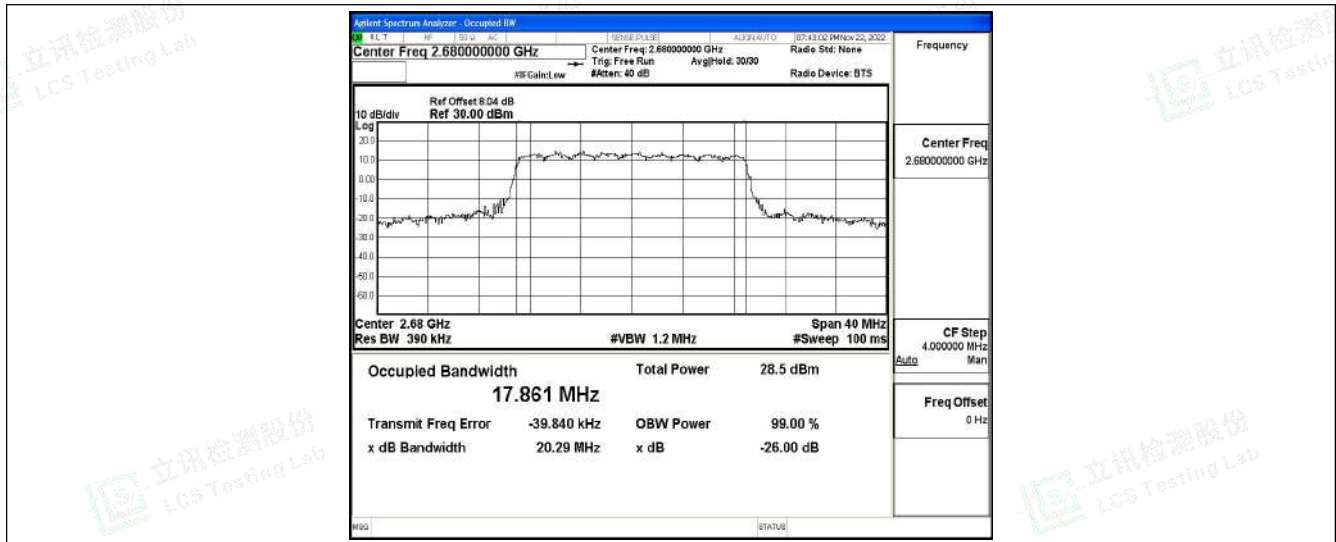



I.4 Band Edge

Test Result


Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	-49.04,-40.49,-31.64	PASS
Band41	5MHz	QPSK	41565	25RB#0	-24.87,-29.00,-43.41,-44.25	PASS
Band41	5MHz	16QAM	39675	25RB#0	-49.08,-40.87,-33.27	PASS
Band41	5MHz	16QAM	41565	25RB#0	-27.64,-32.16,-43.92,-45.80	PASS
Band41	10MHz	QPSK	39700	50RB#0	-47.69,-39.86,-35.27	PASS
Band41	10MHz	QPSK	41540	50RB#0	-26.45,-28.00,-33.24,-44.25	PASS
Band41	10MHz	16QAM	39700	50RB#0	-48.56,-42.34,-39.45	PASS
Band41	10MHz	16QAM	41540	50RB#0	-29.23,-30.55,-35.23,-42.81	PASS
Band41	15MHz	QPSK	39725	75RB#0	-46.67,-38.19,-35.42	PASS
Band41	15MHz	QPSK	41515	75RB#0	-24.90,-25.94,-29.64,-42.56	PASS
Band41	15MHz	16QAM	39725	75RB#0	-46.59,-38.91,-35.52	PASS
Band41	15MHz	16QAM	41515	75RB#0	-29.08,-30.06,-32.69,-42.84	PASS
Band41	20MHz	QPSK	39750	100RB#0	-46.46,-39.88,-37.19	PASS
Band41	20MHz	QPSK	41490	100RB#0	-29.50,-30.63,-32.33,-43.31	PASS
Band41	20MHz	16QAM	39750	100RB#0	-46.48,-39.57,-38.26	PASS
Band41	20MHz	16QAM	41490	100RB#0	-31.12,-32.48,-33.83,-43.12	PASS





Test Graphs

Band41-5MHz-QPSK-39675-25RB#0

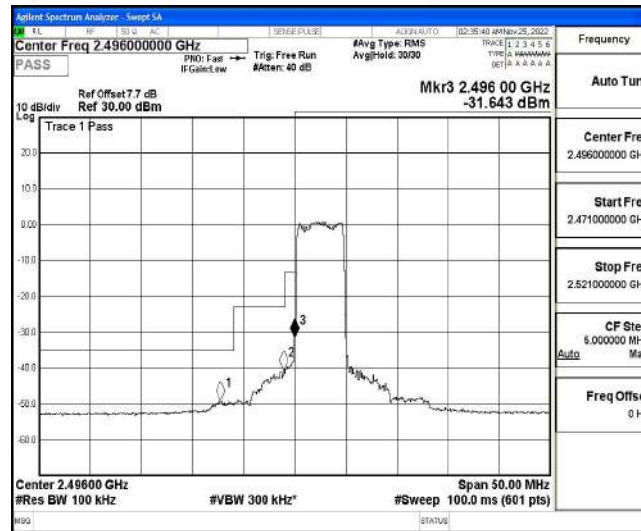


Band41-5MHz-QPSK-41565-25RB#0




Band41-5MHz-16QAM-39675-25RB#0




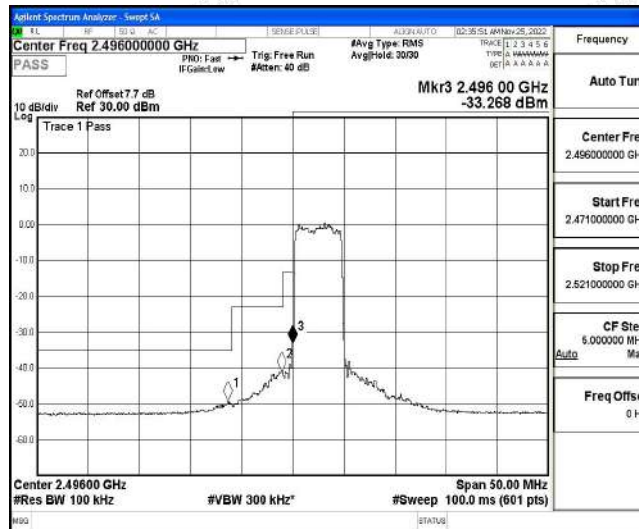

Band41-5MHz-16QAM-41565-25RB#0

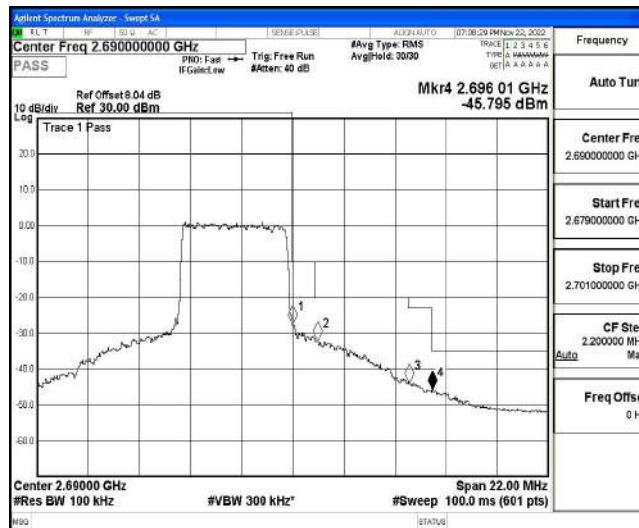


Band41-10MHz-QPSK-39700-50RB#0

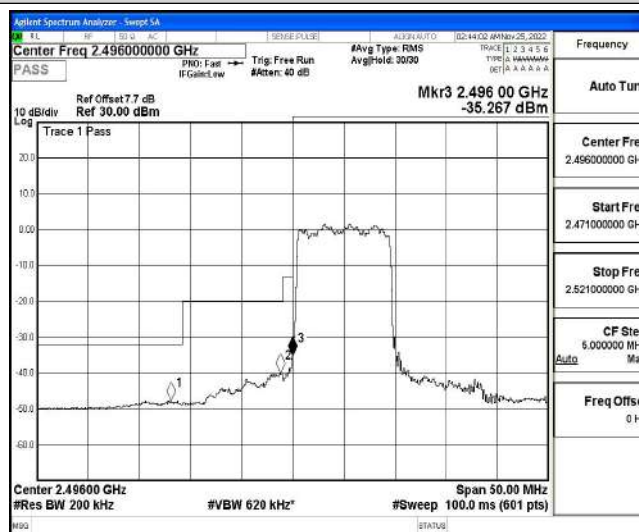


Band41-10MHz-QPSK-41540-50RB#0




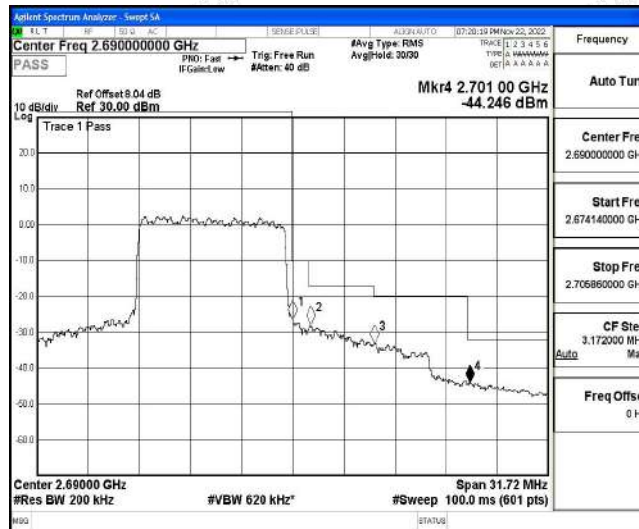

Band41-10MHz-16QAM-39700-50RB#0

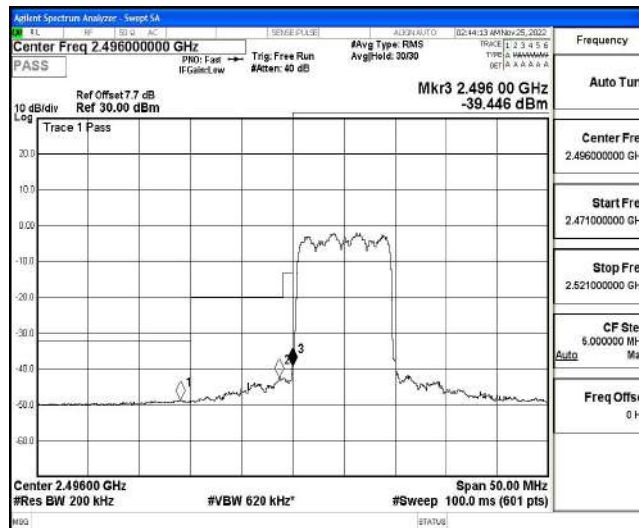


Band41-10MHz-16QAM-41540-50RB#0

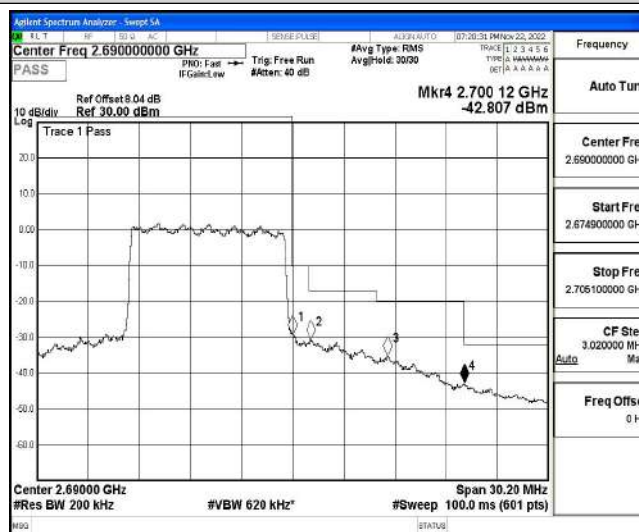


Band41-15MHz-QPSK-39725-75RB#0




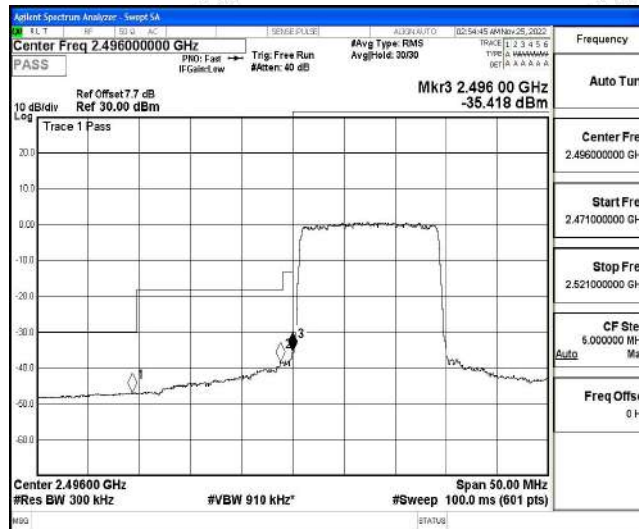

Band41-15MHz-QPSK-41515-75RB#0

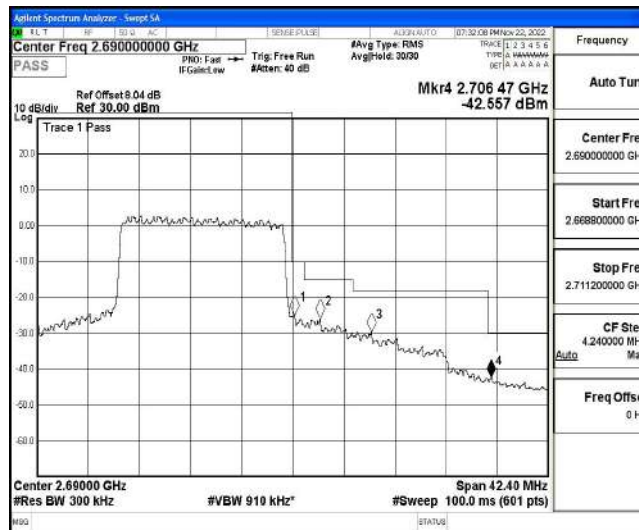


Band41-15MHz-16QAM-39725-75RB#0

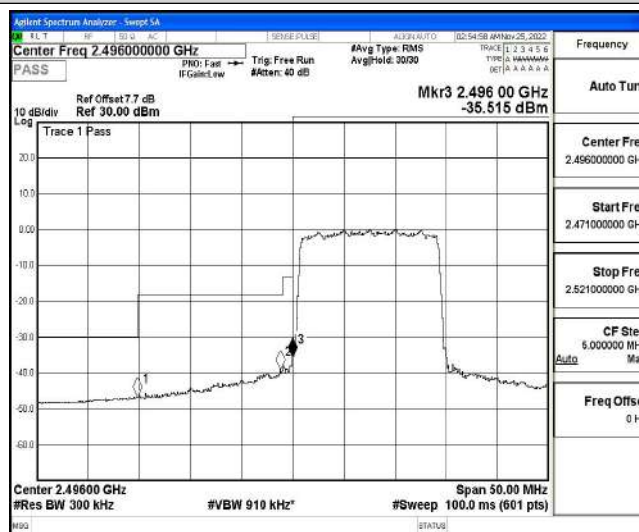


Band41-15MHz-16QAM-41515-75RB#0




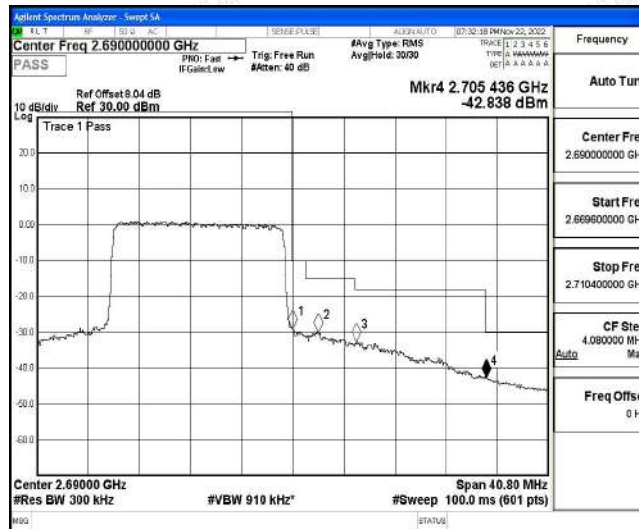

Band41-20MHz-QPSK-39750-100RB#0

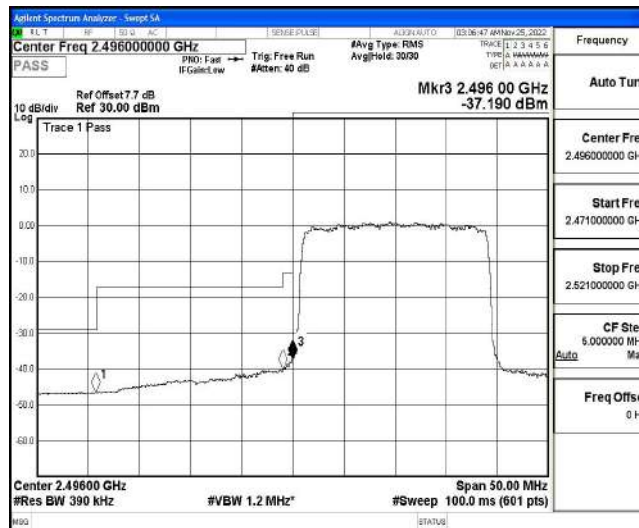


Band41-20MHz-QPSK-41490-100RB#0

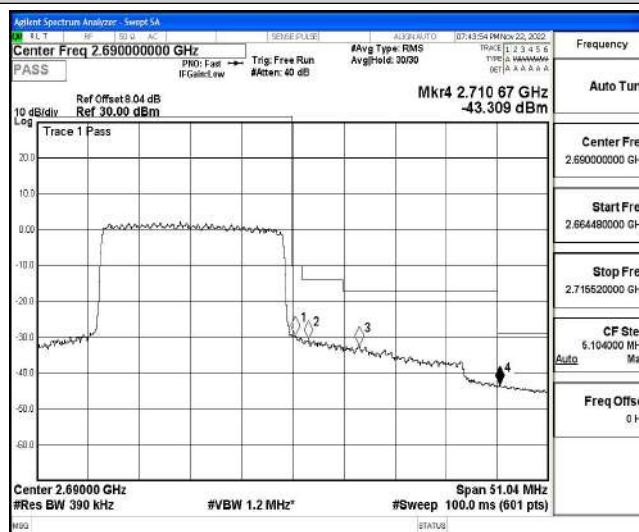


Band41-20MHz-16QAM-39750-100RB#0



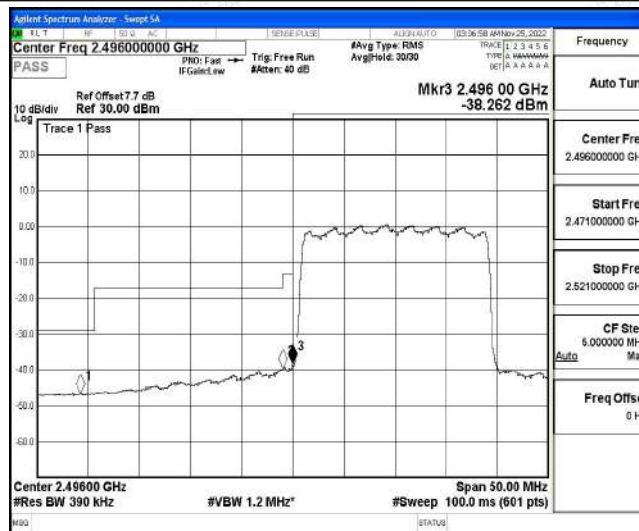

Band41-20MHz-16QAM-41490-100RB#0

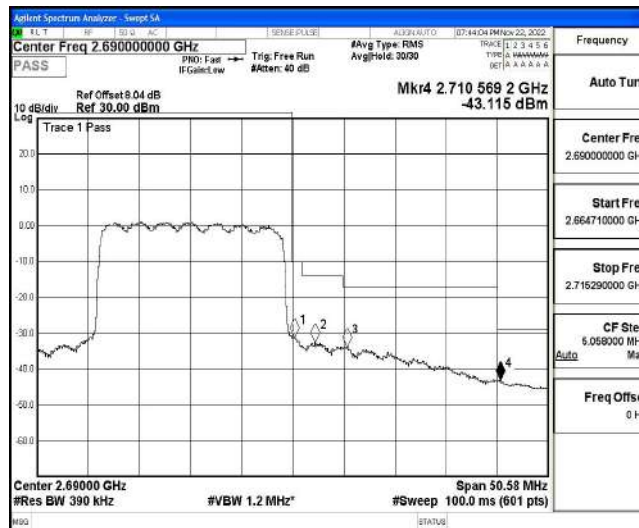

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



I.5 Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	Range1:0.009~0.15MHz	-64.32	PASS
Band41	5MHz	QPSK	39675	1RB#0	Range2:0.15~30MHz	-51.7	PASS
Band41	5MHz	QPSK	39675	1RB#0	Range3:30~1000MHz	-40.44	PASS
Band41	5MHz	QPSK	39675	1RB#0	Range4:1000~10000MHz	-44.92	PASS
Band41	5MHz	QPSK	39675	1RB#0	Range5:10000~20000MHz	-49.17	PASS
Band41	5MHz	QPSK	39675	1RB#0	Range6:20000~26500MHz	-37.03	PASS
Band41	5MHz	QPSK	40620	1RB#0	Range1:0.009~0.15MHz	-65.47	PASS
Band41	5MHz	QPSK	40620	1RB#0	Range2:0.15~30MHz	-52.19	PASS
Band41	5MHz	QPSK	40620	1RB#0	Range3:30~1000MHz	-42.12	PASS
Band41	5MHz	QPSK	40620	1RB#0	Range4:1000~10000MHz	-45.11	PASS
Band41	5MHz	QPSK	40620	1RB#0	Range5:10000~20000MHz	-49.31	PASS
Band41	5MHz	QPSK	40620	1RB#0	Range6:20000~26500MHz	-37.34	PASS
Band41	5MHz	QPSK	41565	1RB#0	Range1:0.009~0.15MHz	-64.05	PASS
Band41	5MHz	QPSK	41565	1RB#0	Range2:0.15~30MHz	-51.25	PASS
Band41	5MHz	QPSK	41565	1RB#0	Range3:30~1000MHz	-41.88	PASS
Band41	5MHz	QPSK	41565	1RB#0	Range4:1000~10000MHz	-45.11	PASS
Band41	5MHz	QPSK	41565	1RB#0	Range5:10000~20000MHz	-49.21	PASS
Band41	5MHz	QPSK	41565	1RB#0	Range6:20000~26500MHz	-37.08	PASS
Band41	5MHz	16QAM	39675	1RB#0	Range1:0.009~0.15MHz	-65.56	PASS
Band41	5MHz	16QAM	39675	1RB#0	Range2:0.15~30MHz	-50.47	PASS
Band41	5MHz	16QAM	39675	1RB#0	Range3:30~1000MHz	-40.95	PASS
Band41	5MHz	16QAM	39675	1RB#0	Range4:1000~10000MHz	-45.06	PASS
Band41	5MHz	16QAM	39675	1RB#0	Range5:10000~20000MHz	-49.08	PASS
Band41	5MHz	16QAM	39675	1RB#0	Range6:20000~26500MHz	-36.95	PASS
Band41	5MHz	16QAM	40620	1RB#0	Range1:0.009~0.15MHz	-62.93	PASS
Band41	5MHz	16QAM	40620	1RB#0	Range2:0.15~30MHz	-50.94	PASS
Band41	5MHz	16QAM	40620	1RB#0	Range3:30~1000MHz	-42.1	PASS
Band41	5MHz	16QAM	40620	1RB#0	Range4:1000~10000MHz	-45.05	PASS
Band41	5MHz	16QAM	40620	1RB#0	Range5:10000~20000MHz	-49.25	PASS
Band41	5MHz	16QAM	40620	1RB#0	Range6:20000~26500MHz	-37.18	PASS
Band41	5MHz	16QAM	41565	1RB#0	Range1:0.009~0.15MHz	-64.42	PASS
Band41	5MHz	16QAM	41565	1RB#0	Range2:0.15~30MHz	-50.78	PASS
Band41	5MHz	16QAM	41565	1RB#0	Range3:30~1000MHz	-41.78	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	5MHz	16QAM	41565	1RB#0	Range4:1000~10000MHz	-45.05	PASS
Band41	5MHz	16QAM	41565	1RB#0	Range5:10000~20000MHz	-49.02	PASS
Band41	5MHz	16QAM	41565	1RB#0	Range6:20000~26500MHz	-37.25	PASS
Band41	10MHz	QPSK	39700	1RB#0	Range1:0.009~0.15MHz	-64.73	PASS
Band41	10MHz	QPSK	39700	1RB#0	Range2:0.15~30MHz	-49.94	PASS
Band41	10MHz	QPSK	39700	1RB#0	Range3:30~1000MHz	-42.04	PASS
Band41	10MHz	QPSK	39700	1RB#0	Range4:1000~10000MHz	-44.92	PASS
Band41	10MHz	QPSK	39700	1RB#0	Range5:10000~20000MHz	-49.21	PASS
Band41	10MHz	QPSK	39700	1RB#0	Range6:20000~26500MHz	-36.92	PASS
Band41	10MHz	QPSK	40620	1RB#0	Range1:0.009~0.15MHz	-65.01	PASS
Band41	10MHz	QPSK	40620	1RB#0	Range2:0.15~30MHz	-51.72	PASS
Band41	10MHz	QPSK	40620	1RB#0	Range3:30~1000MHz	-40.96	PASS
Band41	10MHz	QPSK	40620	1RB#0	Range4:1000~10000MHz	-45	PASS
Band41	10MHz	QPSK	40620	1RB#0	Range5:10000~20000MHz	-49.21	PASS
Band41	10MHz	QPSK	40620	1RB#0	Range6:20000~26500MHz	-37.28	PASS
Band41	10MHz	QPSK	41540	1RB#0	Range1:0.009~0.15MHz	-63.71	PASS
Band41	10MHz	QPSK	41540	1RB#0	Range2:0.15~30MHz	-51.54	PASS
Band41	10MHz	QPSK	41540	1RB#0	Range3:30~1000MHz	-42.64	PASS
Band41	10MHz	QPSK	41540	1RB#0	Range4:1000~10000MHz	-44.99	PASS
Band41	10MHz	QPSK	41540	1RB#0	Range5:10000~20000MHz	-49.14	PASS
Band41	10MHz	QPSK	41540	1RB#0	Range6:20000~26500MHz	-37.06	PASS
Band41	10MHz	16QAM	39700	1RB#0	Range1:0.009~0.15MHz	-63.98	PASS
Band41	10MHz	16QAM	39700	1RB#0	Range2:0.15~30MHz	-51.17	PASS
Band41	10MHz	16QAM	39700	1RB#0	Range3:30~1000MHz	-41.88	PASS
Band41	10MHz	16QAM	39700	1RB#0	Range4:1000~10000MHz	-45.02	PASS
Band41	10MHz	16QAM	39700	1RB#0	Range5:10000~20000MHz	-49.23	PASS
Band41	10MHz	16QAM	39700	1RB#0	Range6:20000~26500MHz	-37.11	PASS
Band41	10MHz	16QAM	40620	1RB#0	Range1:0.009~0.15MHz	-67	PASS
Band41	10MHz	16QAM	40620	1RB#0	Range2:0.15~30MHz	-51.78	PASS
Band41	10MHz	16QAM	40620	1RB#0	Range3:30~1000MHz	-39.47	PASS
Band41	10MHz	16QAM	40620	1RB#0	Range4:1000~10000MHz	-45.03	PASS
Band41	10MHz	16QAM	40620	1RB#0	Range5:10000~20000MHz	-49.32	PASS
Band41	10MHz	16QAM	40620	1RB#0	Range6:20000~26500MHz	-37.22	PASS
Band41	10MHz	16QAM	41540	1RB#0	Range1:0.009~0.15MHz	-66.54	PASS
Band41	10MHz	16QAM	41540	1RB#0	Range2:0.15~30MHz	-52.5	PASS
Band41	10MHz	16QAM	41540	1RB#0	Range3:30~1000MHz	-42.47	PASS
Band41	10MHz	16QAM	41540	1RB#0	Range4:1000~10000MHz	-45.02	PASS
Band41	10MHz	16QAM	41540	1RB#0	Range5:10000~20000MHz	-49.21	PASS
Band41	10MHz	16QAM	41540	1RB#0	Range6:20000~26500MHz	-37.14	PASS
Band41	15MHz	QPSK	39725	1RB#0	Range1:0.009~0.15MHz	-64.95	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	15MHz	QPSK	39725	1RB#0	Range2:0.15~30MHz	-53.34	PASS
Band41	15MHz	QPSK	39725	1RB#0	Range3:30~1000MHz	-41.34	PASS
Band41	15MHz	QPSK	39725	1RB#0	Range4:1000~10000MHz	-45.02	PASS
Band41	15MHz	QPSK	39725	1RB#0	Range5:10000~20000MHz	-49.2	PASS
Band41	15MHz	QPSK	39725	1RB#0	Range6:20000~26500MHz	-37.08	PASS
Band41	15MHz	QPSK	40620	1RB#0	Range1:0.009~0.15MHz	-65.52	PASS
Band41	15MHz	QPSK	40620	1RB#0	Range2:0.15~30MHz	-52.29	PASS
Band41	15MHz	QPSK	40620	1RB#0	Range3:30~1000MHz	-41.71	PASS
Band41	15MHz	QPSK	40620	1RB#0	Range4:1000~10000MHz	-44.82	PASS
Band41	15MHz	QPSK	40620	1RB#0	Range5:10000~20000MHz	-49.15	PASS
Band41	15MHz	QPSK	40620	1RB#0	Range6:20000~26500MHz	-36.96	PASS
Band41	15MHz	QPSK	41515	1RB#0	Range1:0.009~0.15MHz	-65.27	PASS
Band41	15MHz	QPSK	41515	1RB#0	Range2:0.15~30MHz	-51.21	PASS
Band41	15MHz	QPSK	41515	1RB#0	Range3:30~1000MHz	-41.48	PASS
Band41	15MHz	QPSK	41515	1RB#0	Range4:1000~10000MHz	-44.87	PASS
Band41	15MHz	QPSK	41515	1RB#0	Range5:10000~20000MHz	-49.02	PASS
Band41	15MHz	QPSK	41515	1RB#0	Range6:20000~26500MHz	-37.14	PASS
Band41	15MHz	16QAM	39725	1RB#0	Range1:0.009~0.15MHz	-64.29	PASS
Band41	15MHz	16QAM	39725	1RB#0	Range2:0.15~30MHz	-50.05	PASS
Band41	15MHz	16QAM	39725	1RB#0	Range3:30~1000MHz	-42.07	PASS
Band41	15MHz	16QAM	39725	1RB#0	Range4:1000~10000MHz	-45.02	PASS
Band41	15MHz	16QAM	39725	1RB#0	Range5:10000~20000MHz	-49.13	PASS
Band41	15MHz	16QAM	39725	1RB#0	Range6:20000~26500MHz	-36.98	PASS
Band41	15MHz	16QAM	40620	1RB#0	Range1:0.009~0.15MHz	-65.6	PASS
Band41	15MHz	16QAM	40620	1RB#0	Range2:0.15~30MHz	-50.3	PASS
Band41	15MHz	16QAM	40620	1RB#0	Range3:30~1000MHz	-41.61	PASS
Band41	15MHz	16QAM	40620	1RB#0	Range4:1000~10000MHz	-45.01	PASS
Band41	15MHz	16QAM	40620	1RB#0	Range5:10000~20000MHz	-49.07	PASS
Band41	15MHz	16QAM	40620	1RB#0	Range6:20000~26500MHz	-37.15	PASS
Band41	15MHz	16QAM	41515	1RB#0	Range1:0.009~0.15MHz	-65.24	PASS
Band41	15MHz	16QAM	41515	1RB#0	Range2:0.15~30MHz	-51.23	PASS
Band41	15MHz	16QAM	41515	1RB#0	Range3:30~1000MHz	-41.56	PASS
Band41	15MHz	16QAM	41515	1RB#0	Range4:1000~10000MHz	-45.02	PASS
Band41	15MHz	16QAM	41515	1RB#0	Range5:10000~20000MHz	-49.36	PASS
Band41	15MHz	16QAM	41515	1RB#0	Range6:20000~26500MHz	-37.17	PASS
Band41	20MHz	QPSK	39750	1RB#0	Range1:0.009~0.15MHz	-65.86	PASS
Band41	20MHz	QPSK	39750	1RB#0	Range2:0.15~30MHz	-51.6	PASS
Band41	20MHz	QPSK	39750	1RB#0	Range3:30~1000MHz	-41.39	PASS
Band41	20MHz	QPSK	39750	1RB#0	Range4:1000~10000MHz	-44.99	PASS
Band41	20MHz	QPSK	39750	1RB#0	Range5:10000~20000MHz	-49.17	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	20MHz	QPSK	39750	1RB#0	Range6:20000~26500MHz	-37.14	PASS
Band41	20MHz	QPSK	40620	1RB#0	Range1:0.009~0.15MHz	-65.1	PASS
Band41	20MHz	QPSK	40620	1RB#0	Range2:0.15~30MHz	-51.92	PASS
Band41	20MHz	QPSK	40620	1RB#0	Range3:30~1000MHz	-42.37	PASS
Band41	20MHz	QPSK	40620	1RB#0	Range4:1000~10000MHz	-44.81	PASS
Band41	20MHz	QPSK	40620	1RB#0	Range5:10000~20000MHz	-49.35	PASS
Band41	20MHz	QPSK	40620	1RB#0	Range6:20000~26500MHz	-36.98	PASS
Band41	20MHz	QPSK	41490	1RB#0	Range1:0.009~0.15MHz	-66.48	PASS
Band41	20MHz	QPSK	41490	1RB#0	Range2:0.15~30MHz	-51.5	PASS
Band41	20MHz	QPSK	41490	1RB#0	Range3:30~1000MHz	-41.04	PASS
Band41	20MHz	QPSK	41490	1RB#0	Range4:1000~10000MHz	-45.02	PASS
Band41	20MHz	QPSK	41490	1RB#0	Range5:10000~20000MHz	-49.3	PASS
Band41	20MHz	QPSK	41490	1RB#0	Range6:20000~26500MHz	-37.18	PASS
Band41	20MHz	16QAM	39750	1RB#0	Range1:0.009~0.15MHz	-66.11	PASS
Band41	20MHz	16QAM	39750	1RB#0	Range2:0.15~30MHz	-52.12	PASS
Band41	20MHz	16QAM	39750	1RB#0	Range3:30~1000MHz	-41.39	PASS
Band41	20MHz	16QAM	39750	1RB#0	Range4:1000~10000MHz	-45.02	PASS
Band41	20MHz	16QAM	39750	1RB#0	Range5:10000~20000MHz	-49.22	PASS
Band41	20MHz	16QAM	39750	1RB#0	Range6:20000~26500MHz	-37.01	PASS
Band41	20MHz	16QAM	40620	1RB#0	Range1:0.009~0.15MHz	-66.97	PASS
Band41	20MHz	16QAM	40620	1RB#0	Range2:0.15~30MHz	-50.65	PASS
Band41	20MHz	16QAM	40620	1RB#0	Range3:30~1000MHz	-40.92	PASS
Band41	20MHz	16QAM	40620	1RB#0	Range4:1000~10000MHz	-45.03	PASS
Band41	20MHz	16QAM	40620	1RB#0	Range5:10000~20000MHz	-49.28	PASS
Band41	20MHz	16QAM	40620	1RB#0	Range6:20000~26500MHz	-37.1	PASS
Band41	20MHz	16QAM	41490	1RB#0	Range1:0.009~0.15MHz	-64.21	PASS
Band41	20MHz	16QAM	41490	1RB#0	Range2:0.15~30MHz	-50.06	PASS
Band41	20MHz	16QAM	41490	1RB#0	Range3:30~1000MHz	-41.91	PASS
Band41	20MHz	16QAM	41490	1RB#0	Range4:1000~10000MHz	-44.97	PASS
Band41	20MHz	16QAM	41490	1RB#0	Range5:10000~20000MHz	-49.26	PASS
Band41	20MHz	16QAM	41490	1RB#0	Range6:20000~26500MHz	-37.22	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Band41-5MHz-QPSK-39675-1RB#0-Range1:0.009~0.15MHz

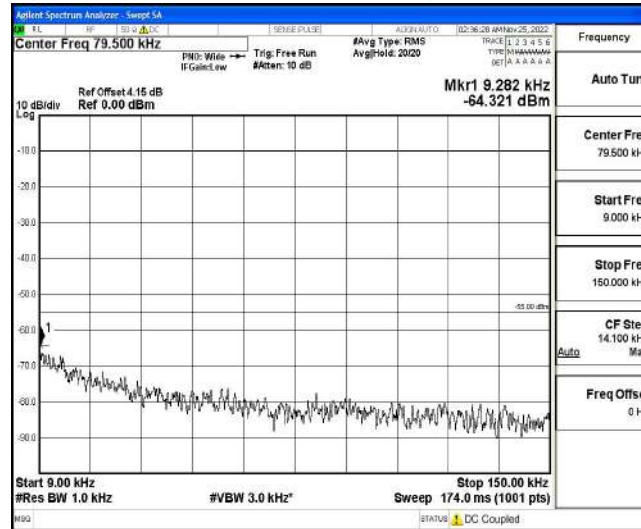


Band41-5MHz-QPSK-39675-1RB#0-Range2:0.15~30MHz

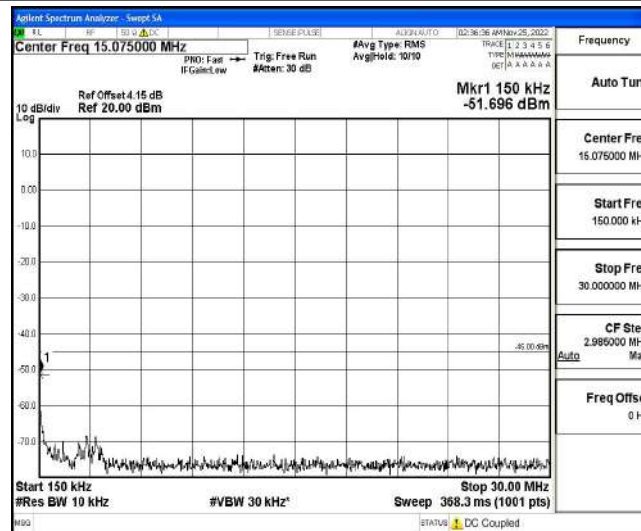


Band41-5MHz-QPSK-39675-1RB#0-Range3:30~1000MHz




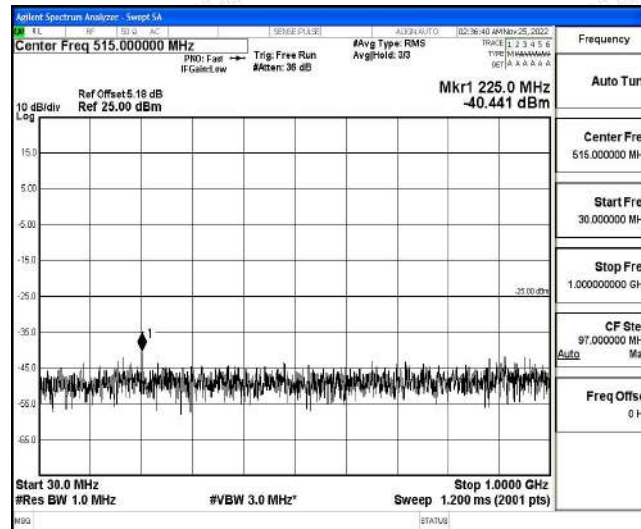

Band41-5MHz-QPSK-39675-1RB#0-Range4:1000~10000MHz

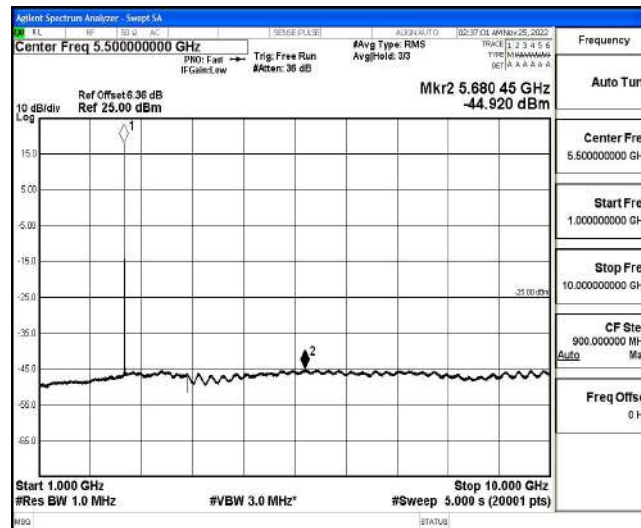


Band41-5MHz-QPSK-39675-1RB#0-Range5:10000~20000MHz

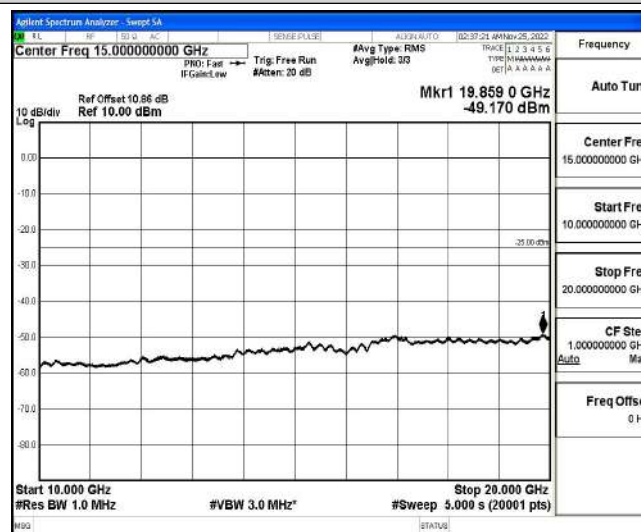


Band41-5MHz-QPSK-39675-1RB#0-Range6:20000~26500MHz




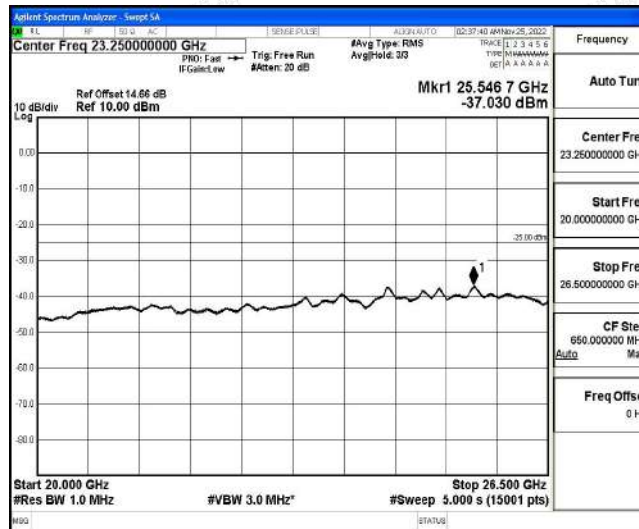

Band41-5MHz-QPSK-40620-1RB#0-Range1:0.009~0.15MHz

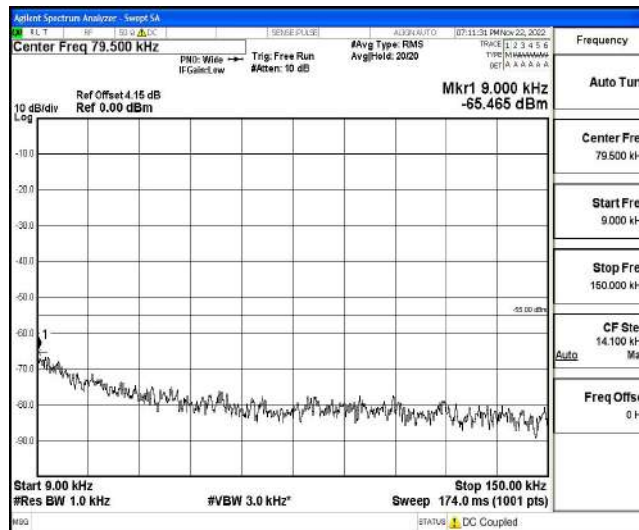


Band41-5MHz-QPSK-40620-1RB#0-Range2:0.15~30MHz

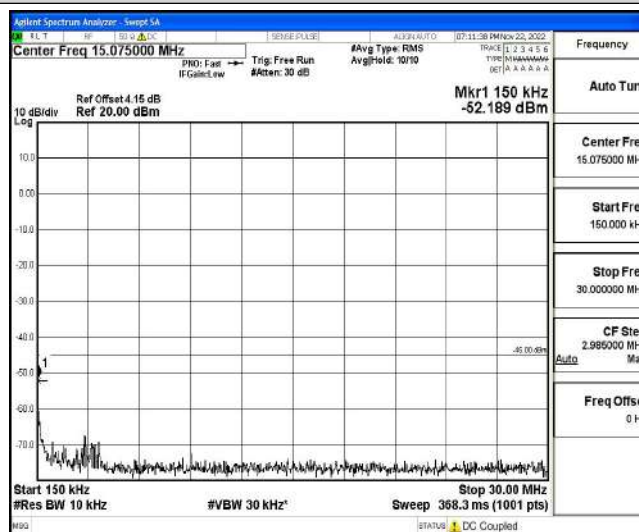


Band41-5MHz-QPSK-40620-1RB#0-Range3:30~1000MHz




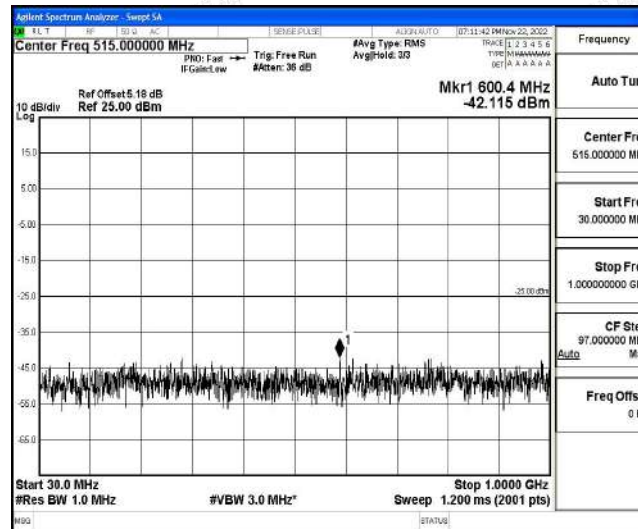

Band41-5MHz-QPSK-40620-1RB#0-Range4:1000~10000MHz

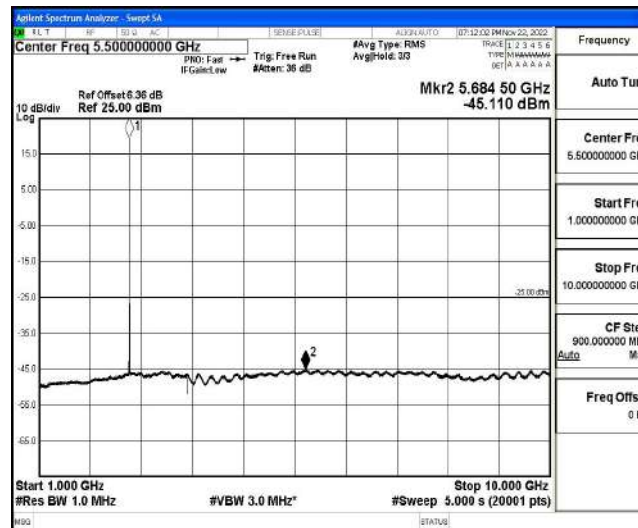


Band41-5MHz-QPSK-40620-1RB#0-Range5:10000~20000MHz

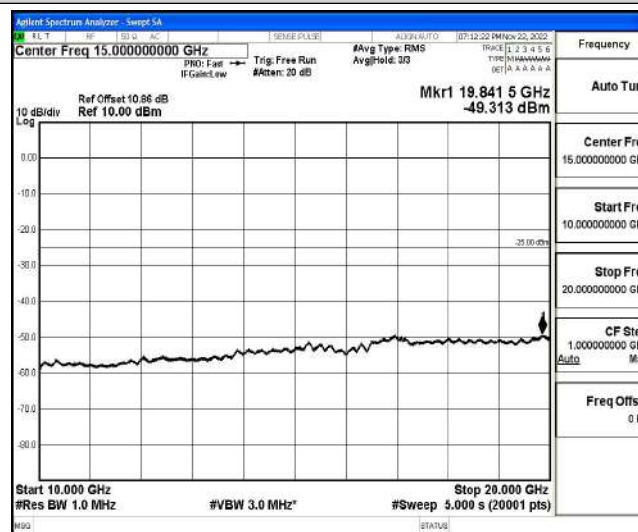


Band41-5MHz-QPSK-40620-1RB#0-Range6:20000~26500MHz




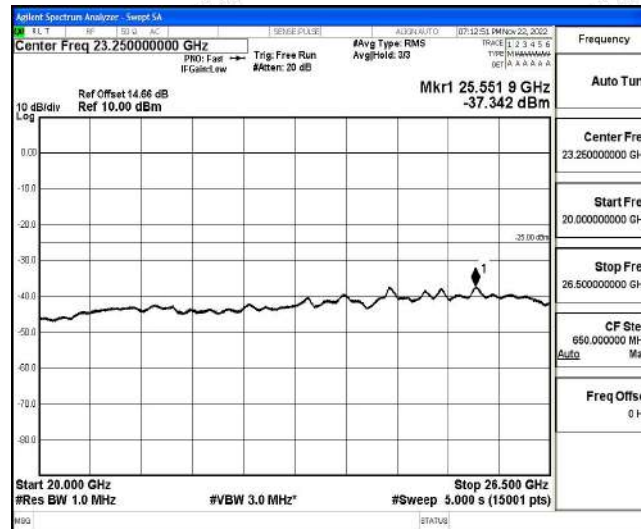

Band41-5MHz-QPSK-41565-1RB#0-Range1:0.009~0.15MHz

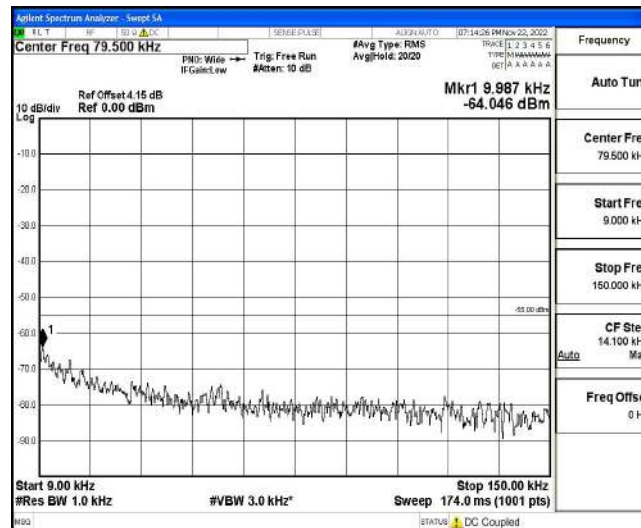


Band41-5MHz-QPSK-41565-1RB#0-Range2:0.15~30MHz

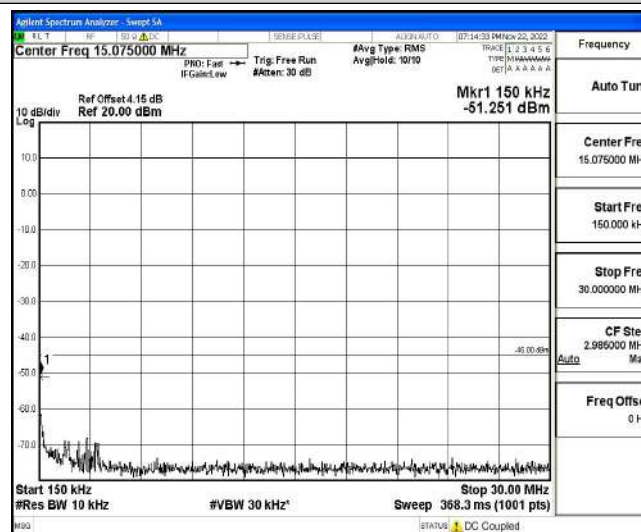


Band41-5MHz-QPSK-41565-1RB#0-Range3:30~1000MHz




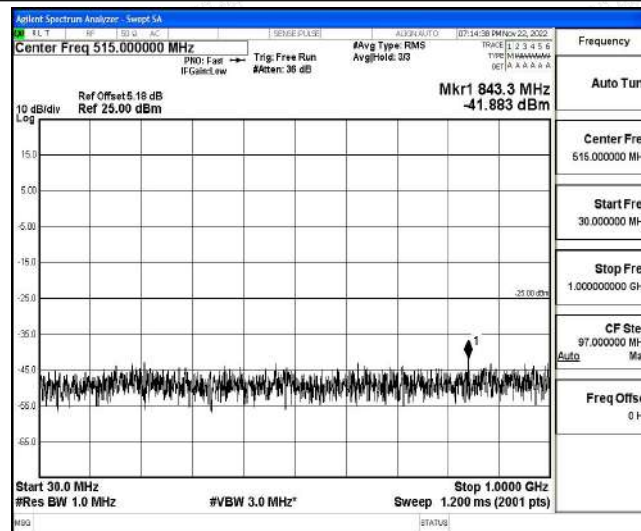

Band41-5MHz-QPSK-41565-1RB#0-Range4:1000~10000MHz

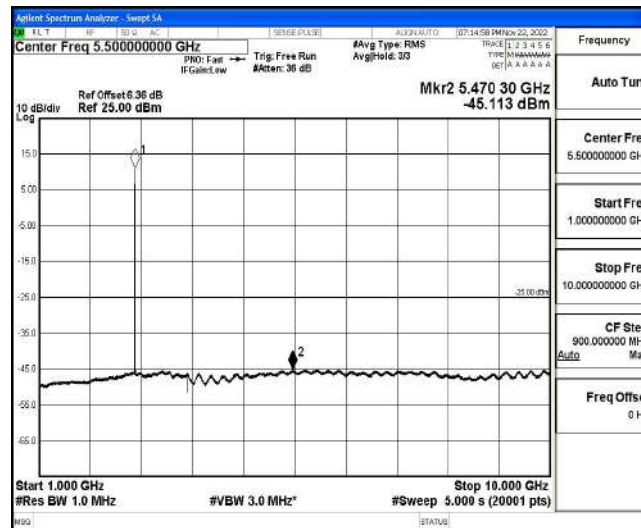


Band41-5MHz-QPSK-41565-1RB#0-Range5:10000~20000MHz

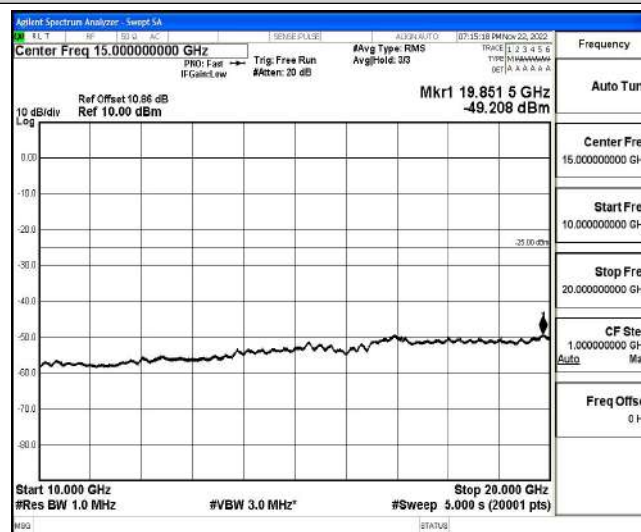


Band41-5MHz-QPSK-41565-1RB#0-Range6:20000~26500MHz




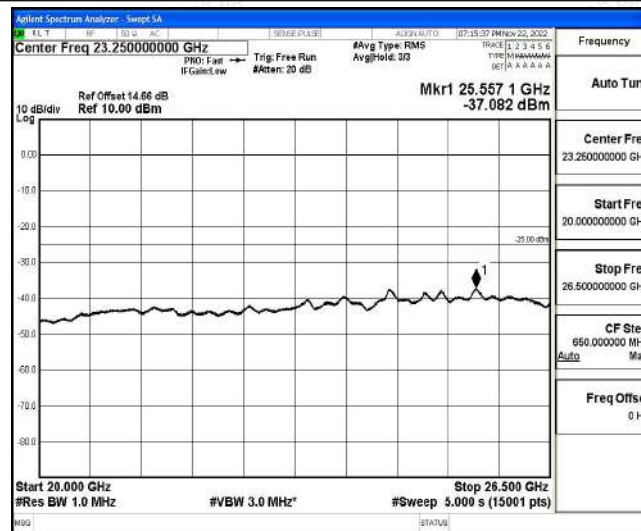

Band41-5MHz-16QAM-39675-1RB#0-Range1:0.009~0.15MHz

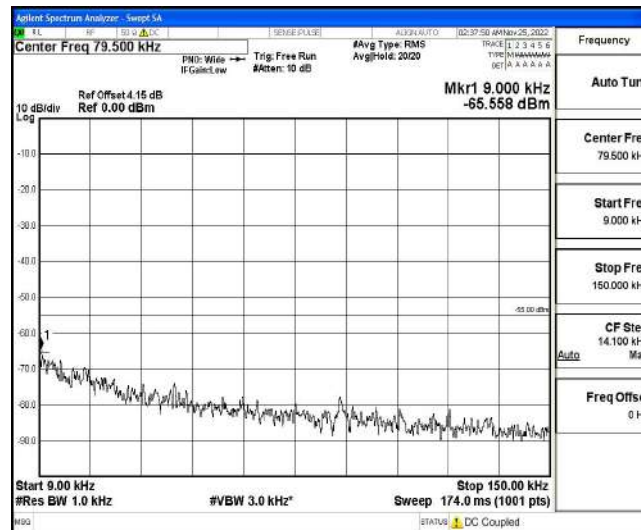


Band41-5MHz-16QAM-39675-1RB#0-Range2:0.15~30MHz

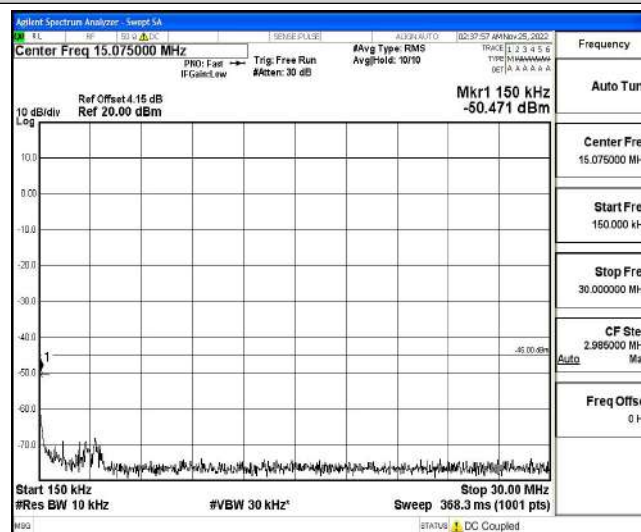


Band41-5MHz-16QAM-39675-1RB#0-Range3:30~1000MHz




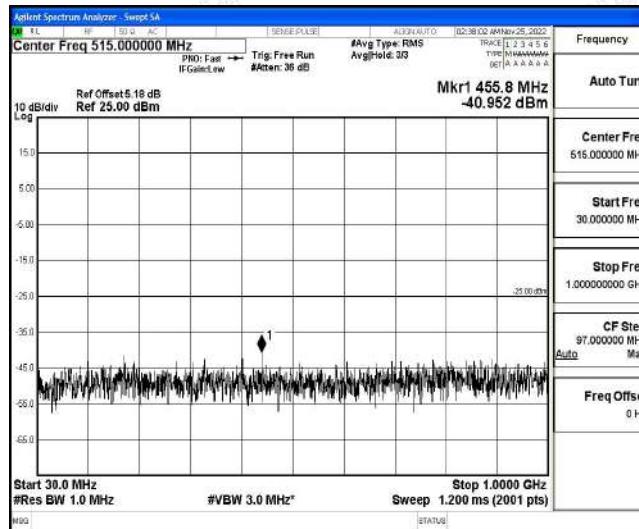

Band41-5MHz-16QAM-39675-1RB#0-Range4:1000~10000MHz

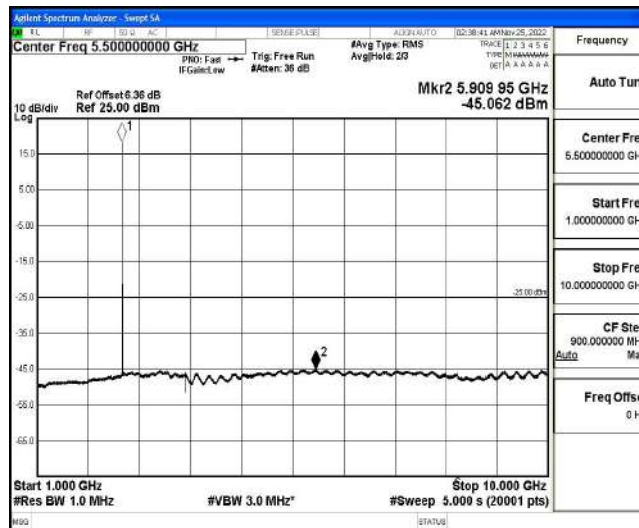


Band41-5MHz-16QAM-39675-1RB#0-Range5:10000~20000MHz

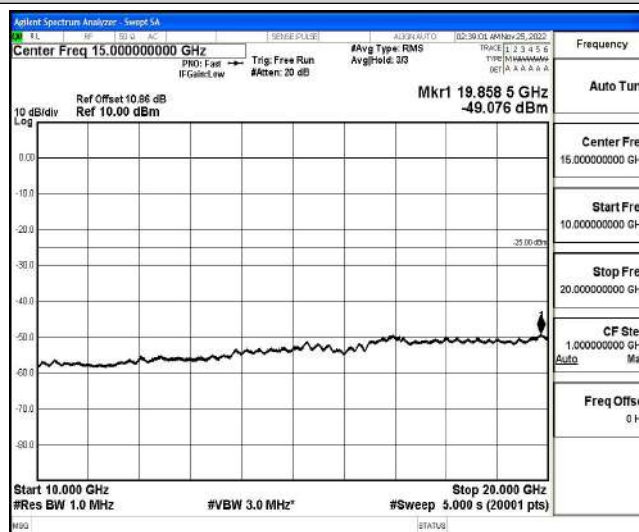


Band41-5MHz-16QAM-39675-1RB#0-Range6:20000~26500MHz




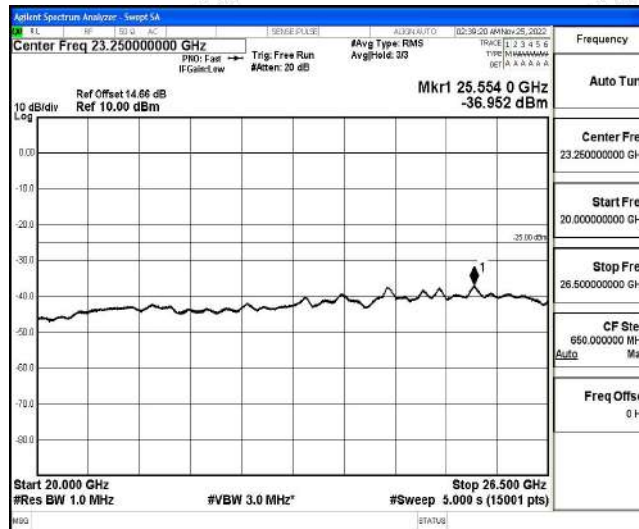

Band41-5MHz-16QAM-40620-1RB#0-Range1:0.009~0.15MHz

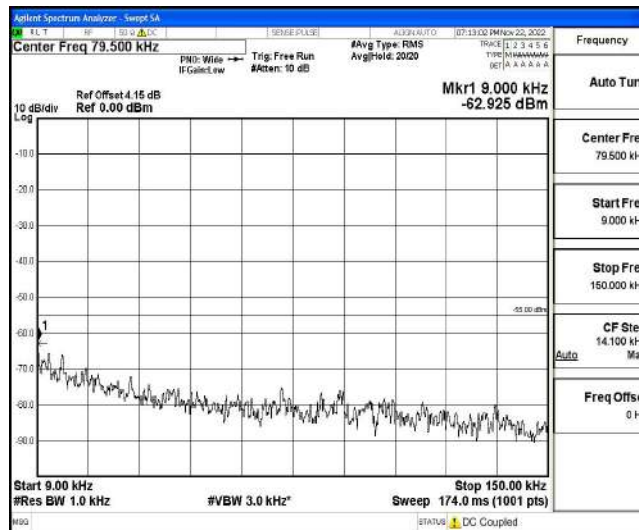


Band41-5MHz-16QAM-40620-1RB#0-Range2:0.15~30MHz

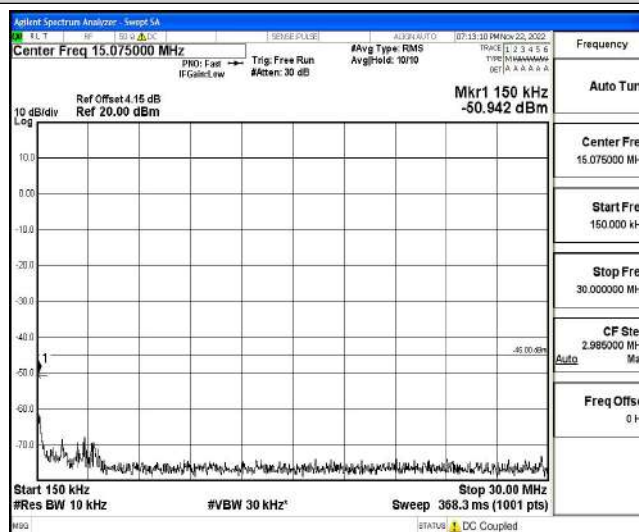


Band41-5MHz-16QAM-40620-1RB#0-Range3:30~1000MHz




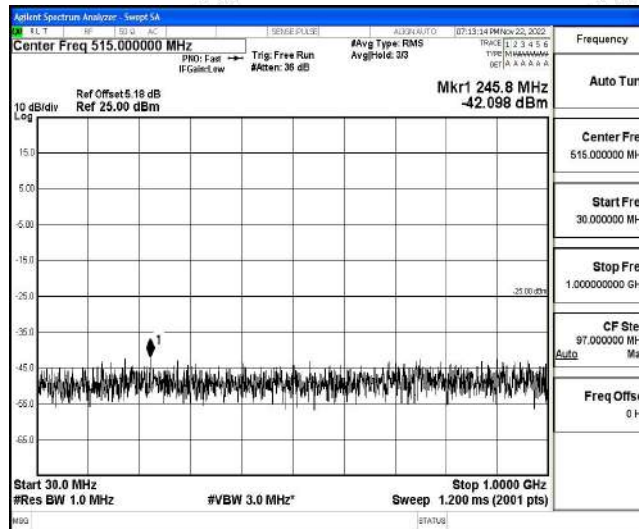

Band41-5MHz-16QAM-40620-1RB#0-Range4:1000~10000MHz

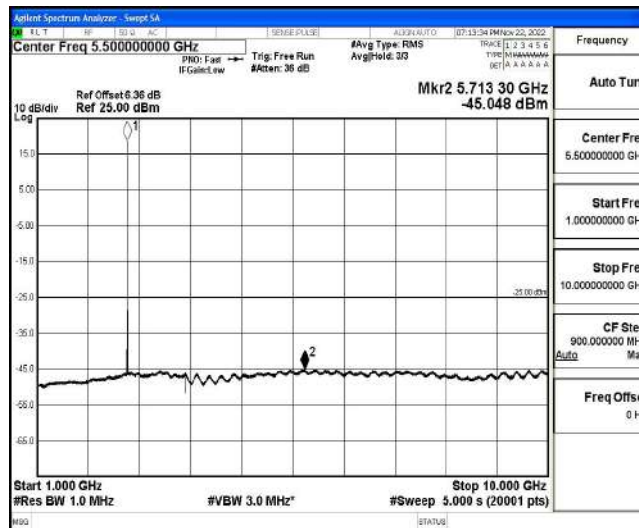


Band41-5MHz-16QAM-40620-1RB#0-Range5:10000~20000MHz

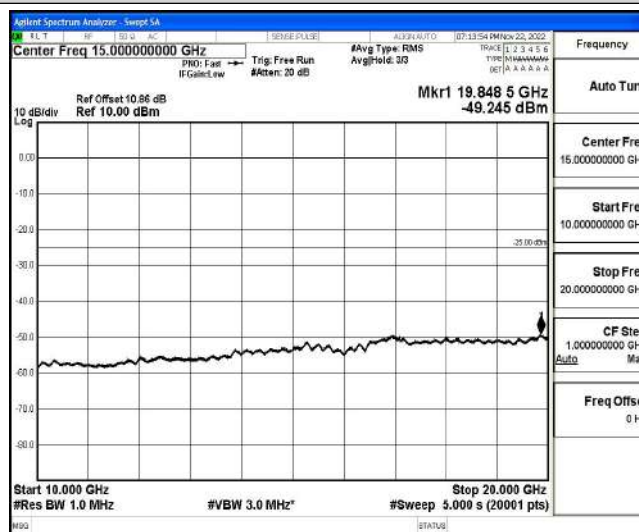


Band41-5MHz-16QAM-40620-1RB#0-Range6:20000~26500MHz




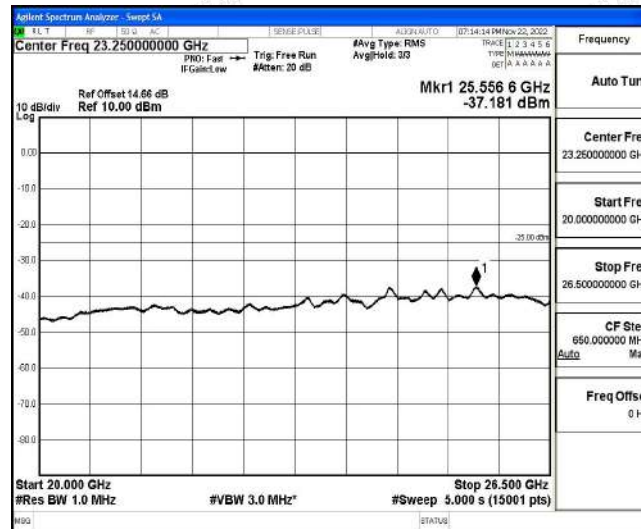

Band41-5MHz-16QAM-41565-1RB#0-Range1:0.009~0.15MHz

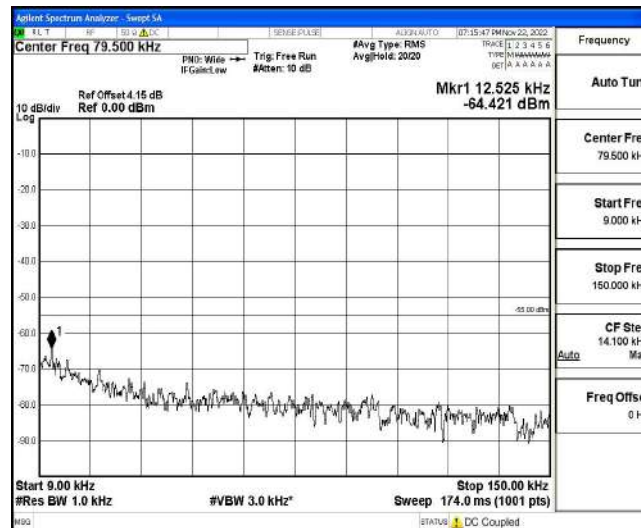


Band41-5MHz-16QAM-41565-1RB#0-Range2:0.15~30MHz

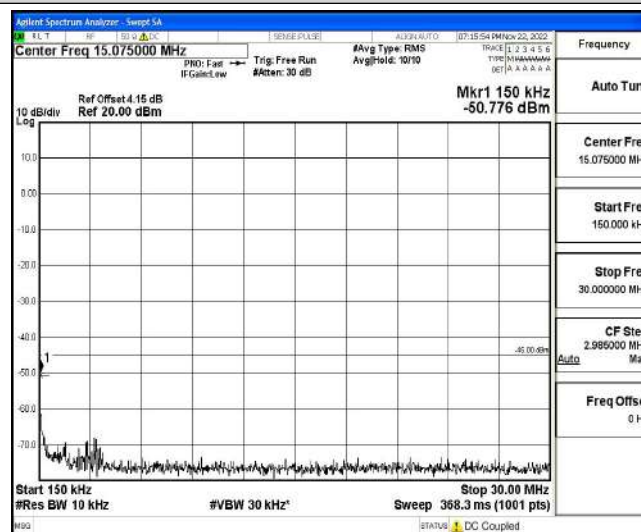


Band41-5MHz-16QAM-41565-1RB#0-Range3:30~1000MHz




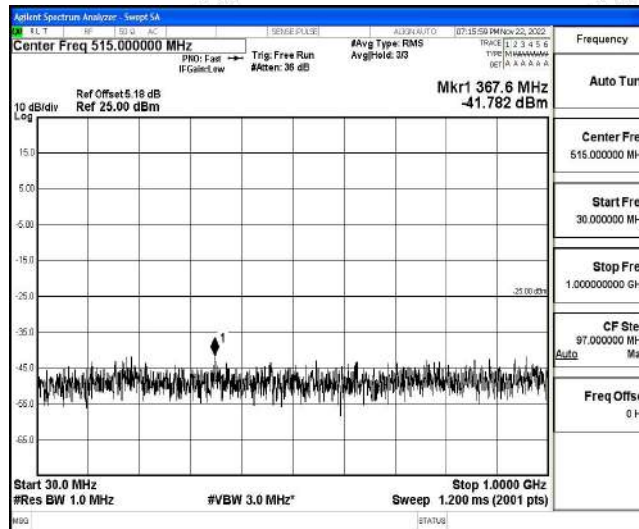

Band41-5MHz-16QAM-41565-1RB#0-Range4:1000~10000MHz

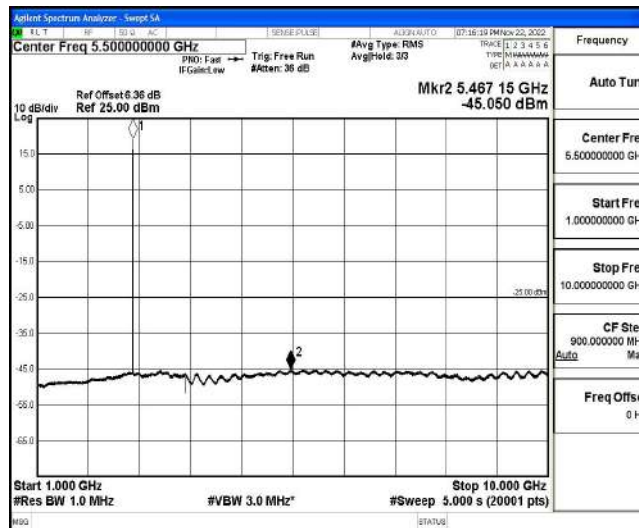


Band41-5MHz-16QAM-41565-1RB#0-Range5:10000~20000MHz

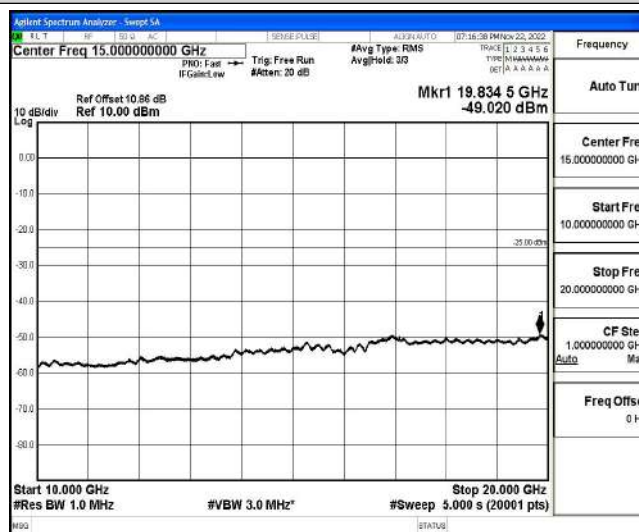


Band41-5MHz-16QAM-41565-1RB#0-Range6:20000~26500MHz




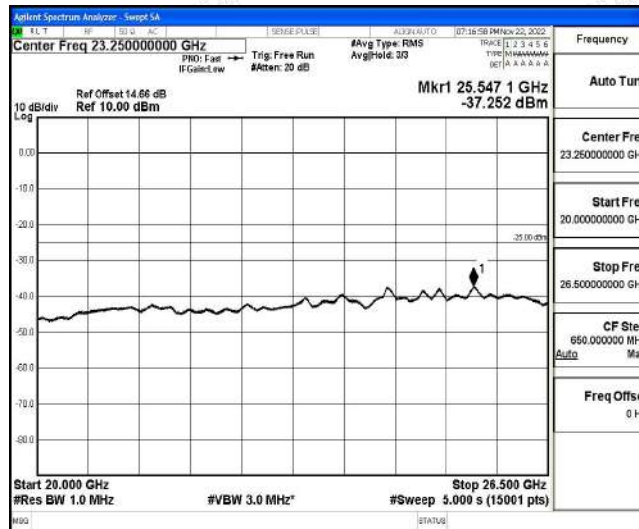

Band41-10MHz-QPSK-39700-1RB#0-Range1:0.009~0.15MHz

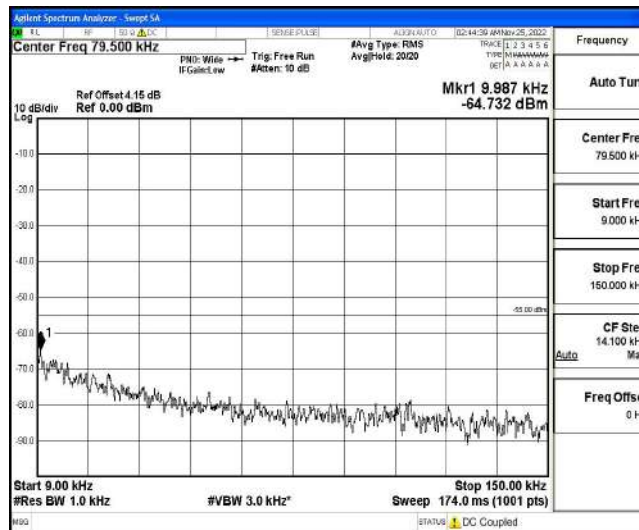


Band41-10MHz-QPSK-39700-1RB#0-Range2:0.15~30MHz

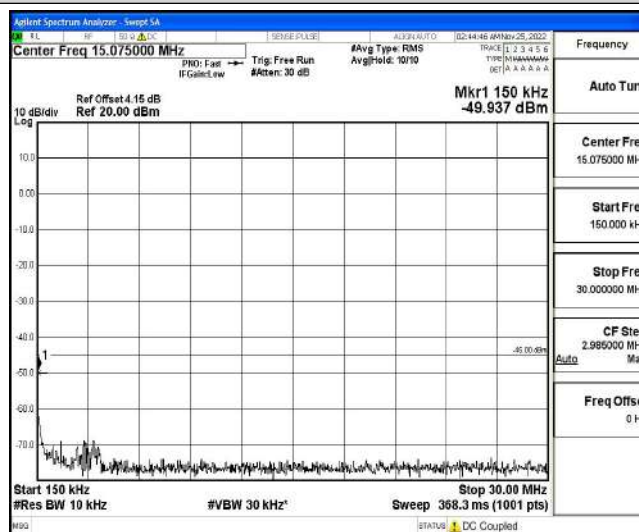


Band41-10MHz-QPSK-39700-1RB#0-Range3:30~1000MHz




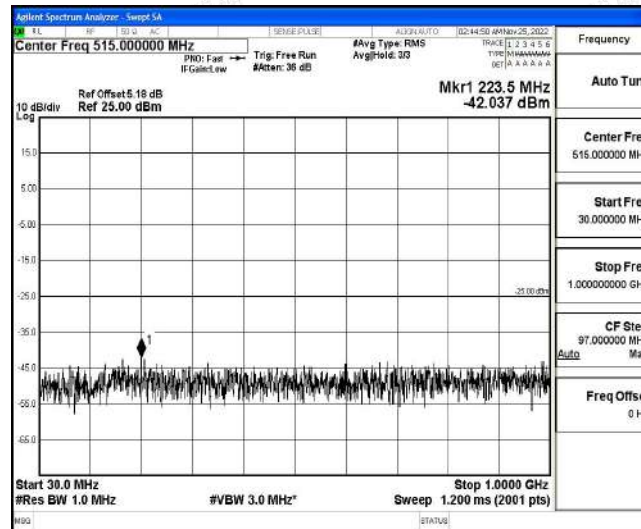

Band41-10MHz-QPSK-39700-1RB#0-Range4:1000~10000MHz

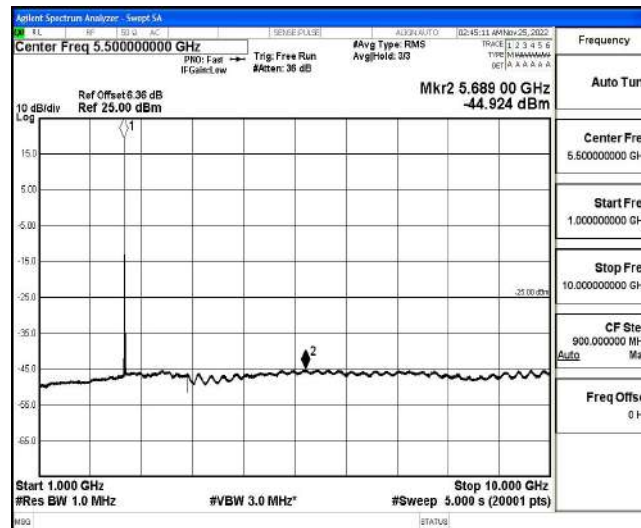


Band41-10MHz-QPSK-39700-1RB#0-Range5:10000~20000MHz

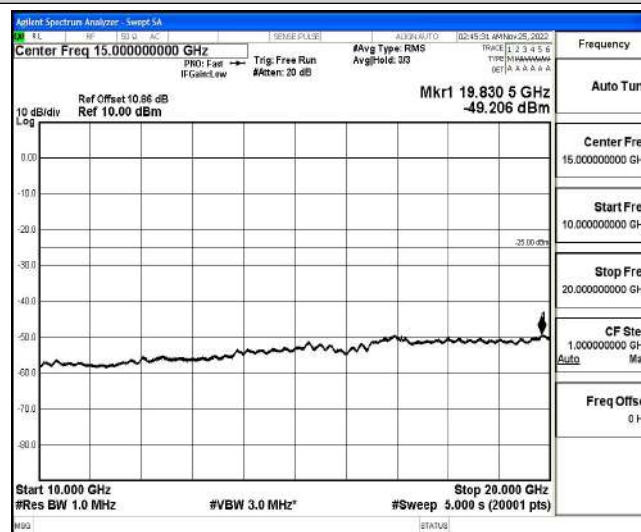


Band41-10MHz-QPSK-39700-1RB#0-Range6:20000~26500MHz




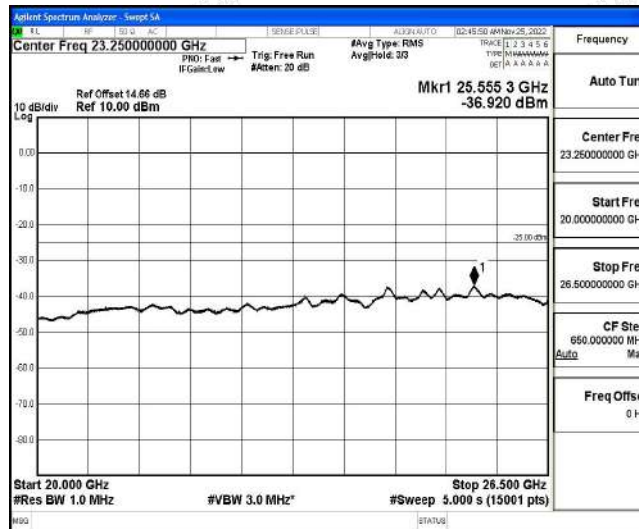

Band41-10MHz-QPSK-40620-1RB#0-Range1:0.009~0.15MHz

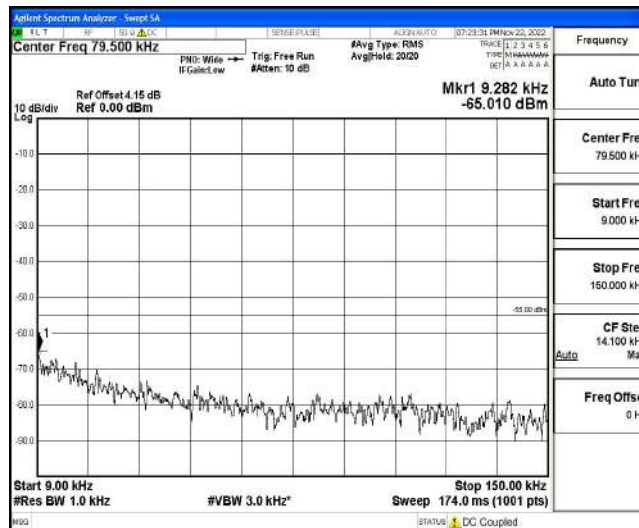


Band41-10MHz-QPSK-40620-1RB#0-Range2:0.15~30MHz

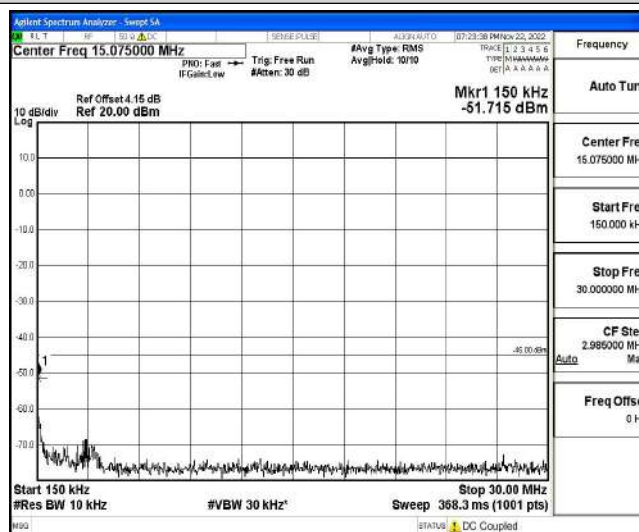


Band41-10MHz-QPSK-40620-1RB#0-Range3:30~1000MHz




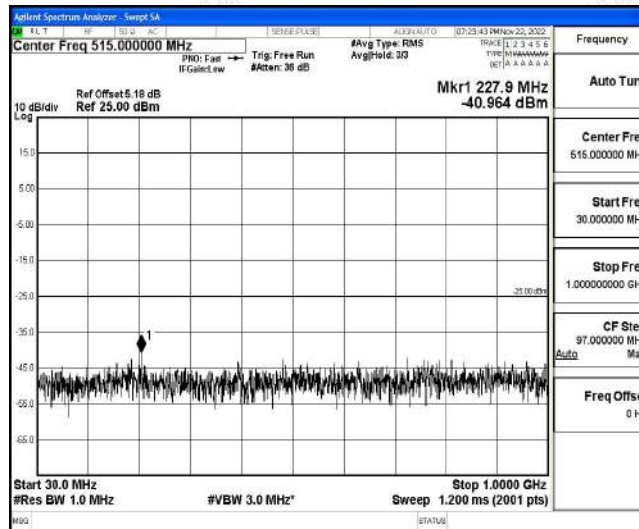

Band41-10MHz-QPSK-40620-1RB#0-Range4:1000~10000MHz

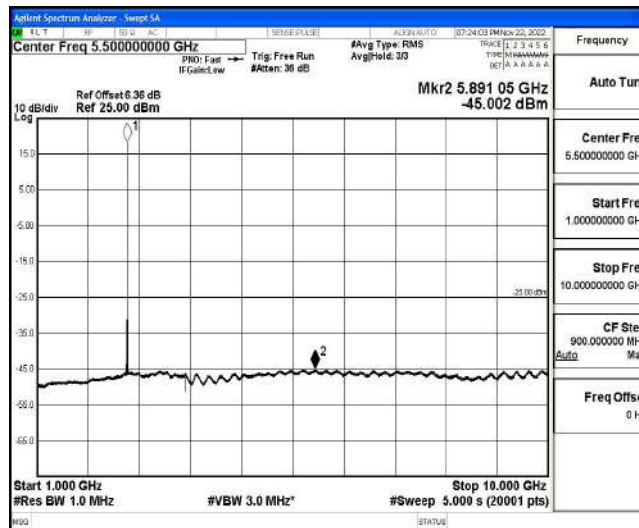


Band41-10MHz-QPSK-40620-1RB#0-Range5:10000~20000MHz

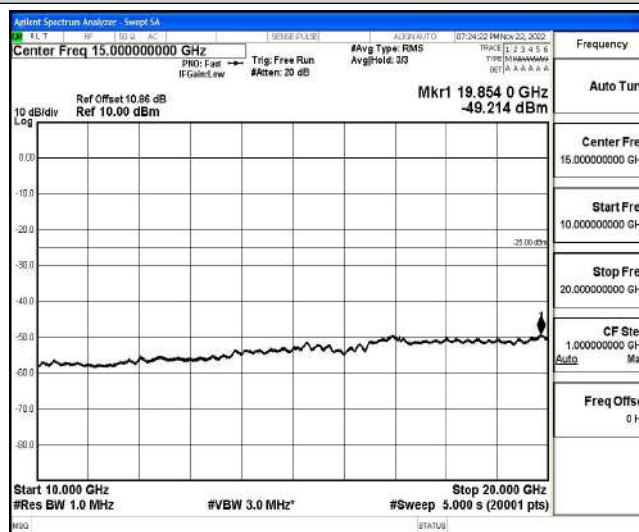


Band41-10MHz-QPSK-40620-1RB#0-Range6:20000~26500MHz




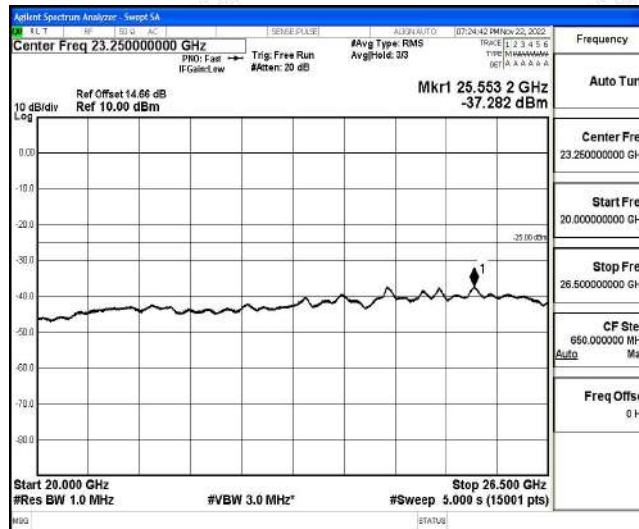

Band41-10MHz-QPSK-41540-1RB#0-Range1:0.009~0.15MHz

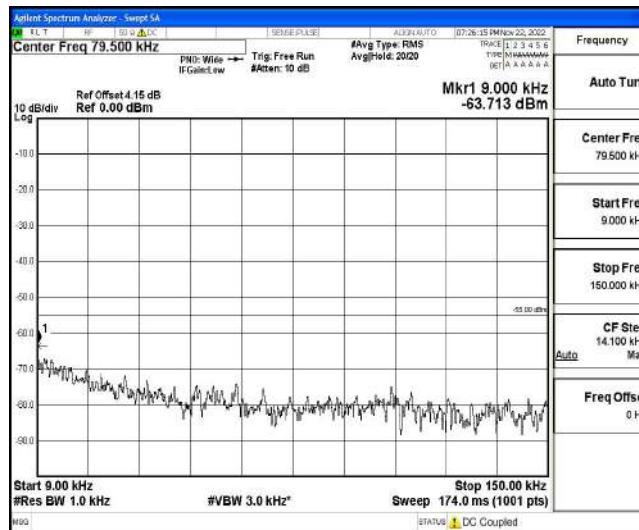


Band41-10MHz-QPSK-41540-1RB#0-Range2:0.15~30MHz

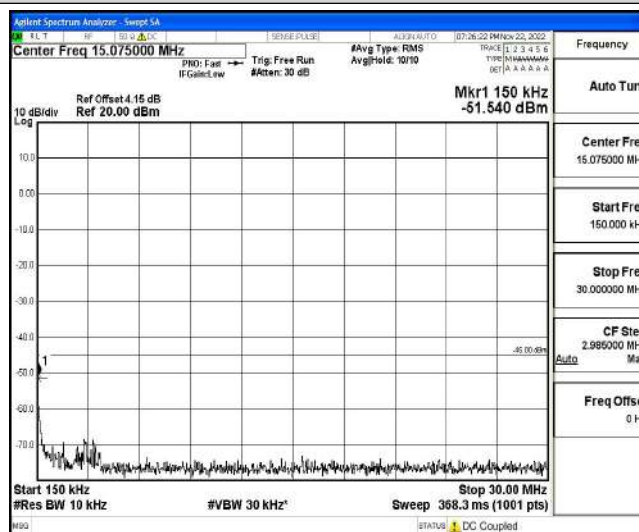


Band41-10MHz-QPSK-41540-1RB#0-Range3:30~1000MHz




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

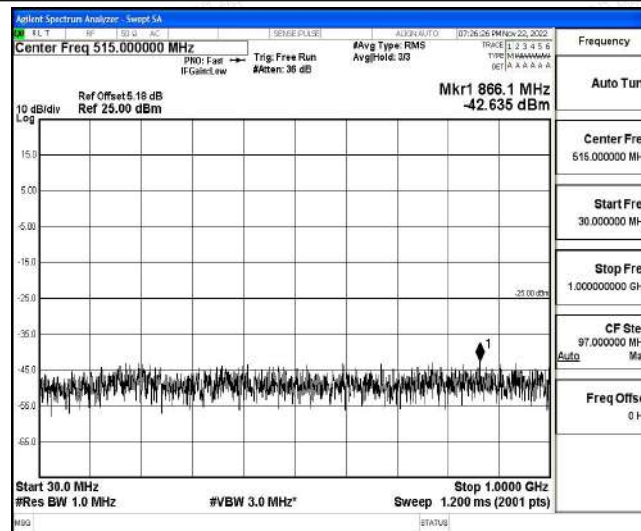

Band41-10MHz-QPSK-41540-1RB#0-Range4:1000~10000MHz

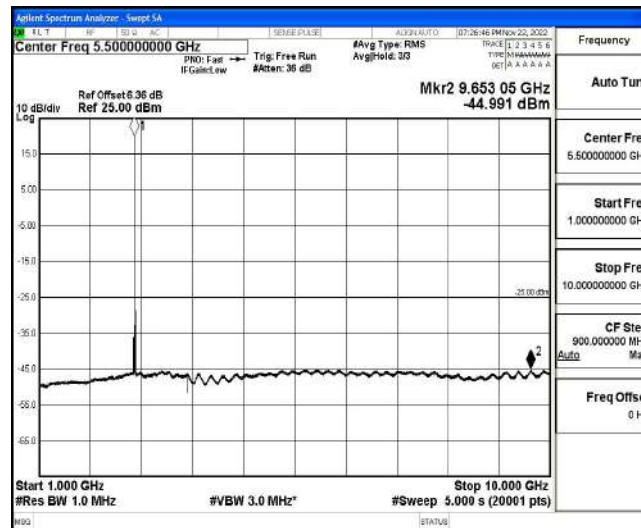


Band41-10MHz-QPSK-41540-1RB#0-Range5:10000~20000MHz

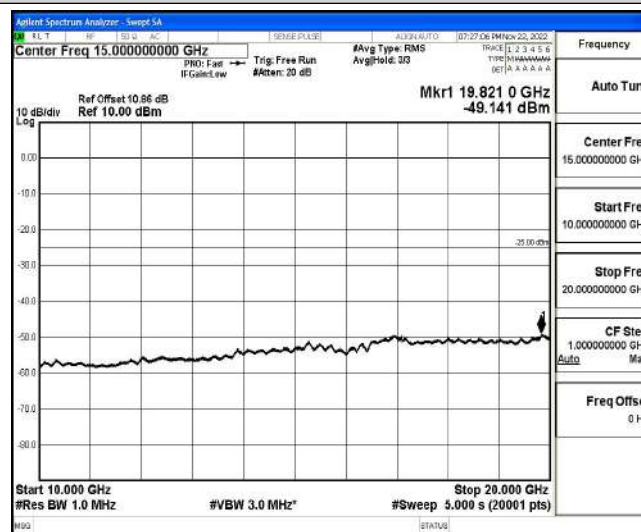


Band41-10MHz-QPSK-41540-1RB#0-Range6:20000~26500MHz




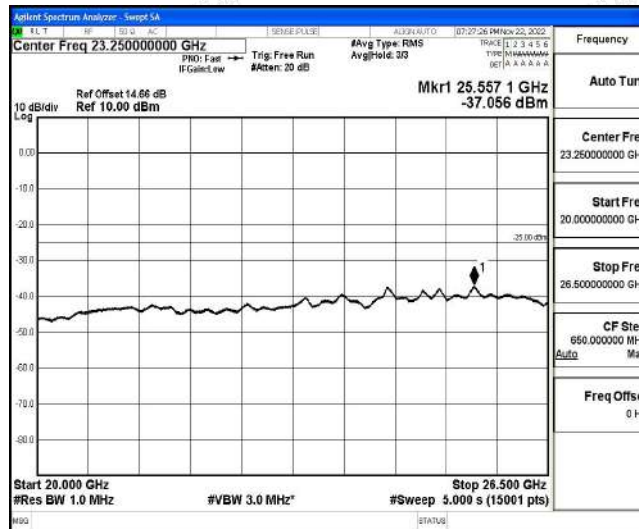

Band41-10MHz-16QAM-39700-1RB#0-Range1:0.009~0.15MHz

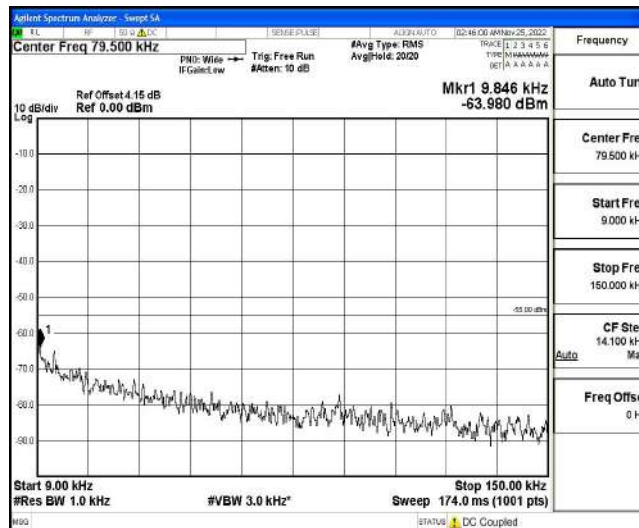


Band41-10MHz-16QAM-39700-1RB#0-Range2:0.15~30MHz

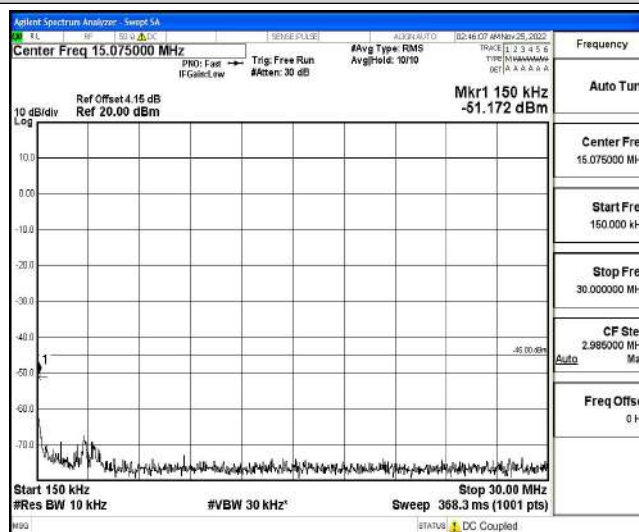


Band41-10MHz-16QAM-39700-1RB#0-Range3:30~1000MHz




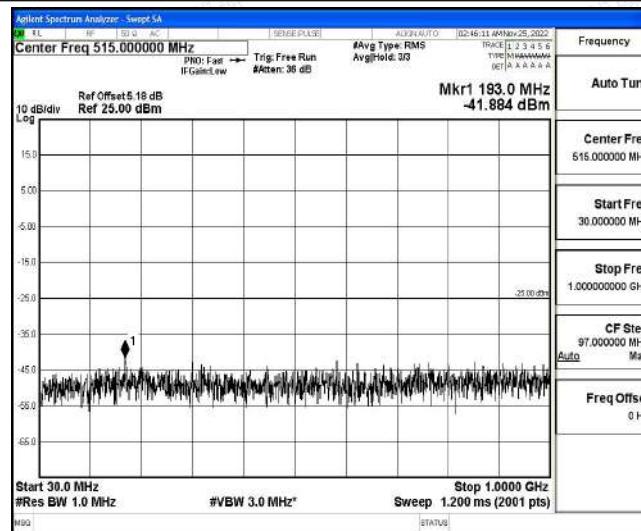

Band41-10MHz-16QAM-39700-1RB#0-Range4:1000~10000MHz

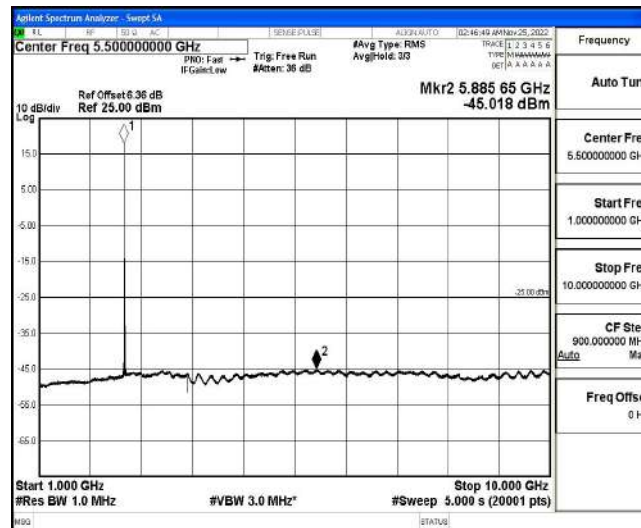

Band41-10MHz-16QAM-39700-1RB#0-Range5:10000~20000MHz

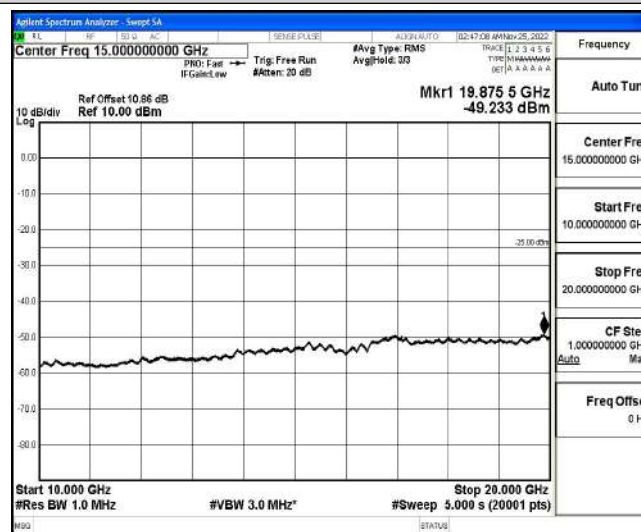

Band41-10MHz-16QAM-39700-1RB#0-Range6:20000~26500MHz



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity