

Band66	20MHz	QPSK	132072	1RB#0	Range1:30~1000MHz	-48.28	PASS
Band66	20MHz	QPSK	132072	1RB#0	Range2:1000~20000MHz	-31.53	PASS
Band66	20MHz	QPSK	132322	1RB#0	Range1:30~1000MHz	-47.33	PASS
Band66	20MHz	QPSK	132322	1RB#0	Range2:1000~20000MHz	-33.28	PASS
Band66	20MHz	QPSK	132572	1RB#0	Range1:30~1000MHz	-47.4	PASS
Band66	20MHz	QPSK	132572	1RB#0	Range2:1000~20000MHz	-33.2	PASS
Band66	20MHz	16QAM	132072	1RB#0	Range1:30~1000MHz	-48.32	PASS
Band66	20MHz	16QAM	132072	1RB#0	Range2:1000~20000MHz	-33.51	PASS
Band66	20MHz	16QAM	132322	1RB#0	Range1:30~1000MHz	-47.66	PASS
Band66	20MHz	16QAM	132322	1RB#0	Range2:1000~20000MHz	-33.32	PASS
Band66	20MHz	16QAM	132572	1RB#0	Range1:30~1000MHz	-47.55	PASS
Band66	20MHz	16QAM	132572	1RB#0	Range2:1000~20000MHz	-33.56	PASS

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
 400-003-0500
 www.anbotek.com.cn






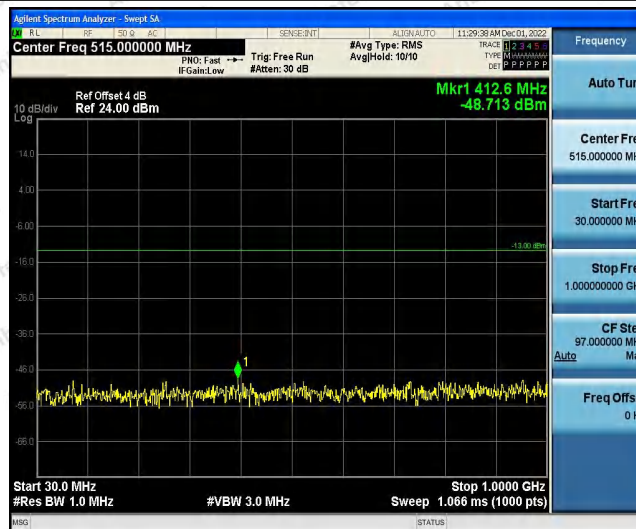

Band66-1.4MHz-QPSK-132322-1RB#0-Range2:1000~20000MHz

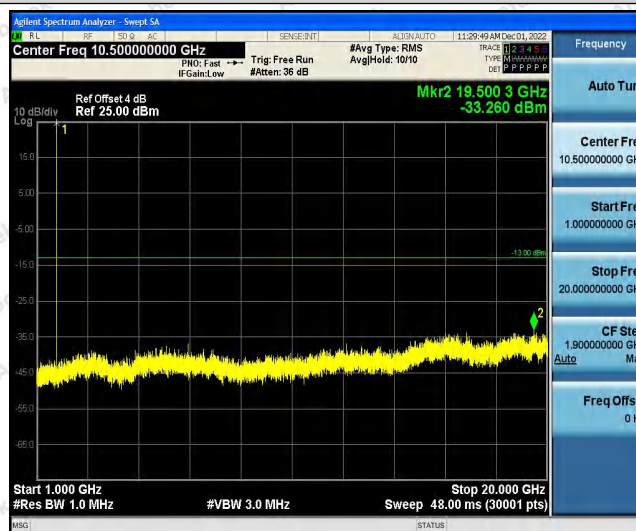

Band66-1.4MHz-QPSK-132665-1RB#0-Range1:30~1000MHz

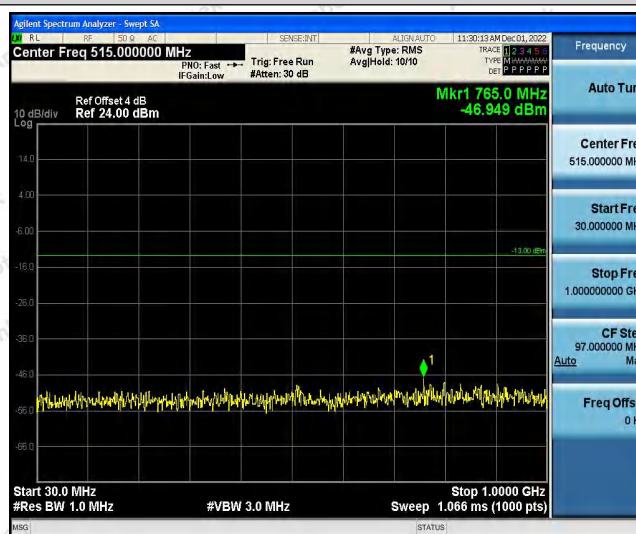

Band66-1.4MHz-QPSK-132665-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn



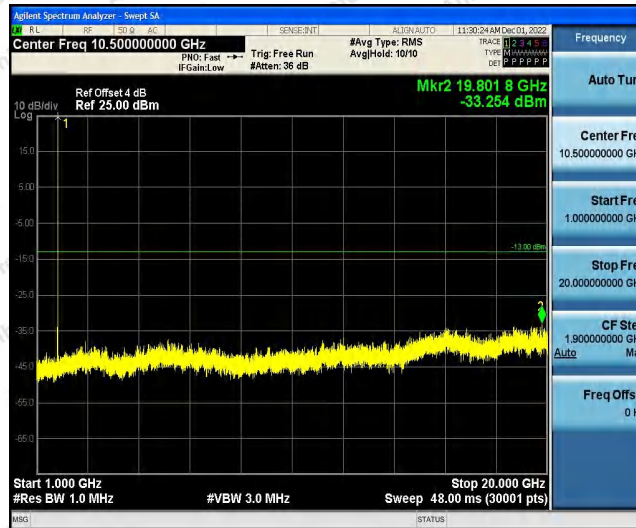

Band66-1.4MHz-16QAM-131979-1RB#0-Range1:30~1000MHz

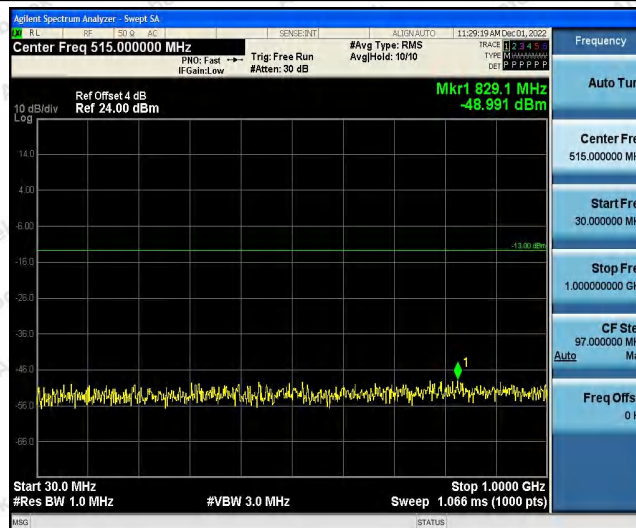

Band66-1.4MHz-16QAM-131979-1RB#0-Range2:1000~20000MHz



Band66-1.4MHz-16QAM-132322-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




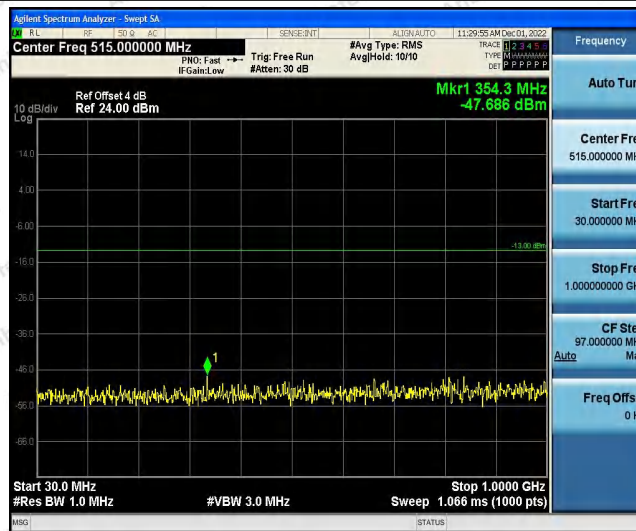

Band66-1.4MHz-16QAM-132322-1RB#0-Range2:1000~20000MHz

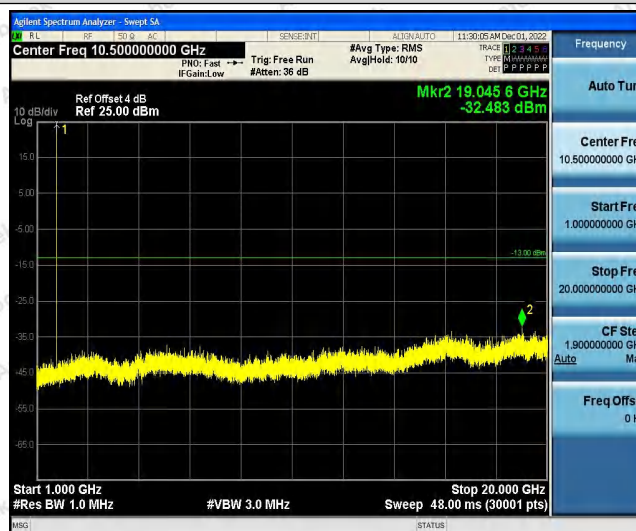

Band66-1.4MHz-16QAM-132665-1RB#0-Range1:30~1000MHz

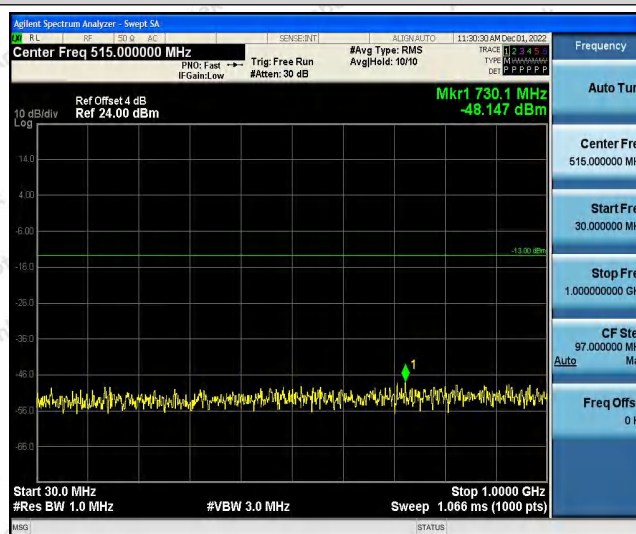

Band66-1.4MHz-16QAM-132665-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn



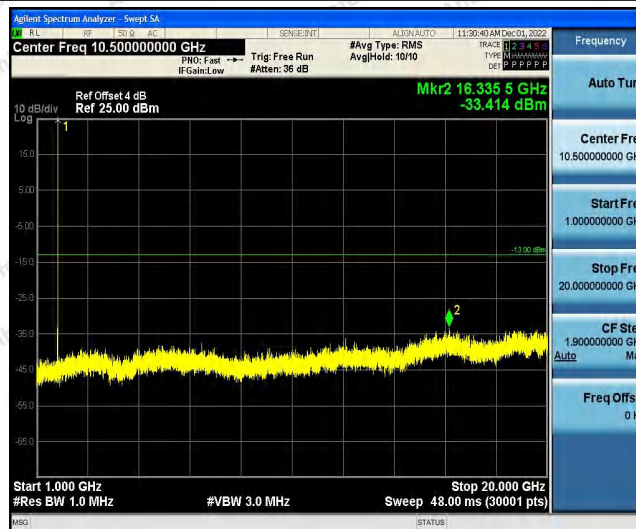

Band66-3MHz-QPSK-131987-1RB#0-Range1:30~1000MHz

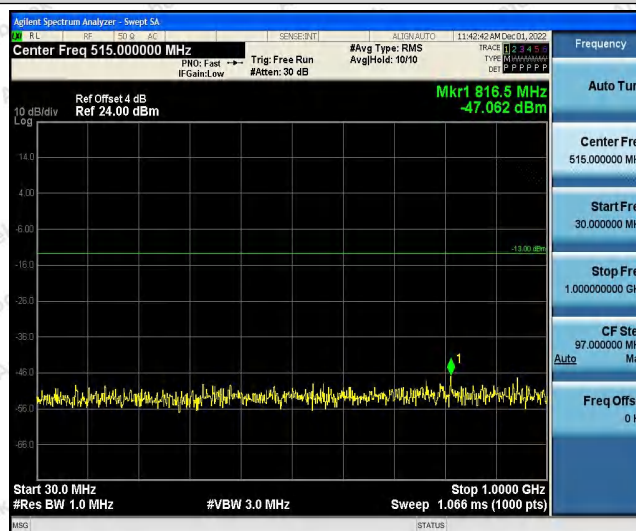

Band66-3MHz-QPSK-131987-1RB#0-Range2:1000~20000MHz



Band66-3MHz-QPSK-132322-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




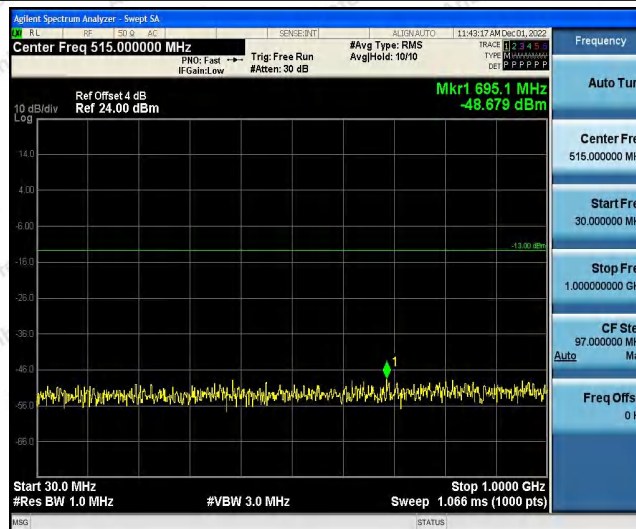

Band66-3MHz-QPSK-132322-1RB#0-Range2:1000~20000MHz

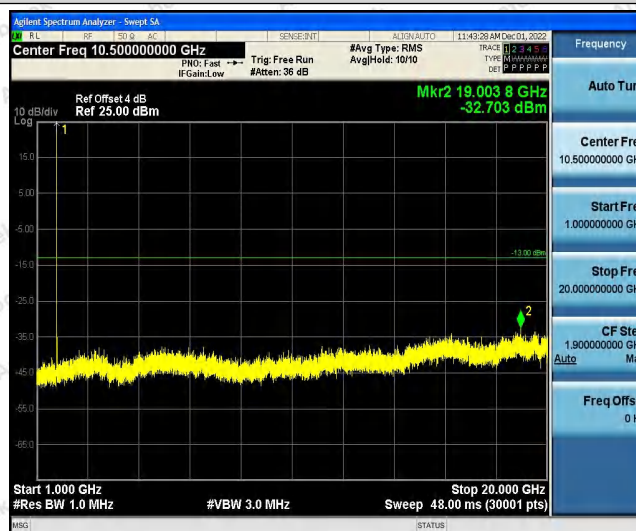

Band66-3MHz-QPSK-132657-1RB#0-Range1:30~1000MHz

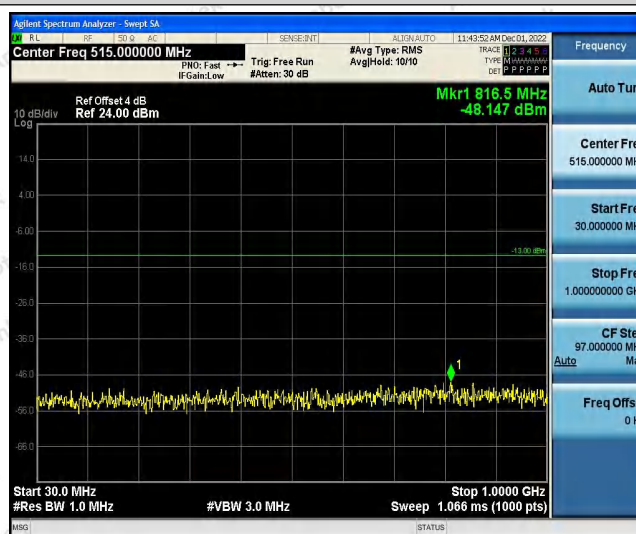

Band66-3MHz-QPSK-132657-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




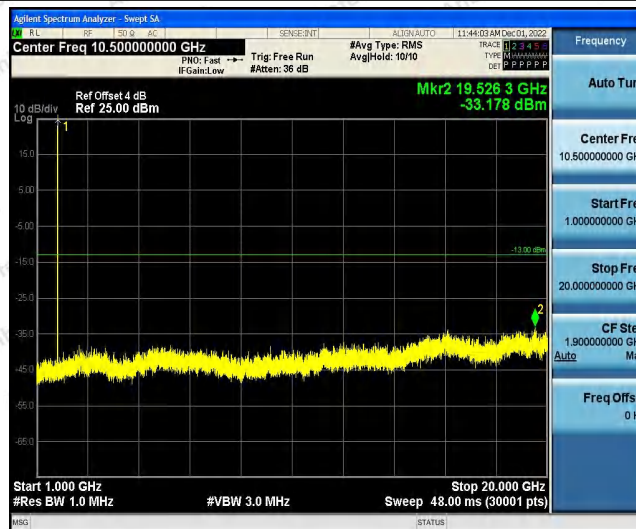

Band66-3MHz-16QAM-131987-1RB#0-Range1:30~1000MHz

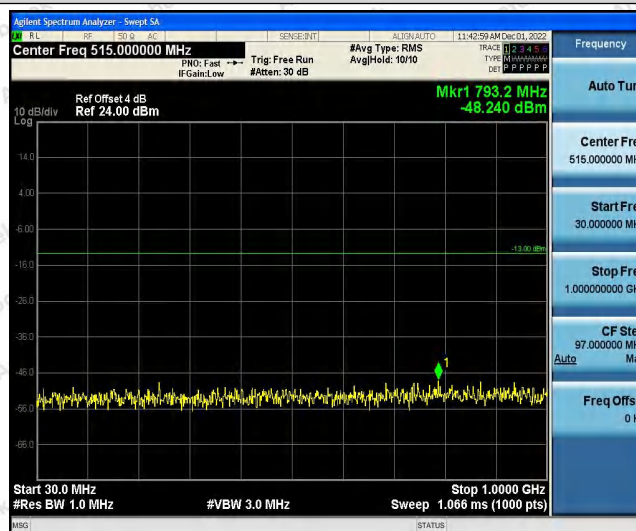

Band66-3MHz-16QAM-131987-1RB#0-Range2:1000~20000MHz

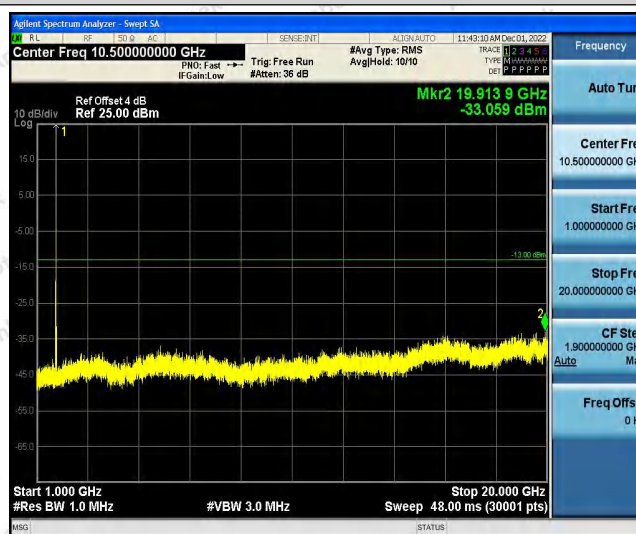

Band66-3MHz-16QAM-132322-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




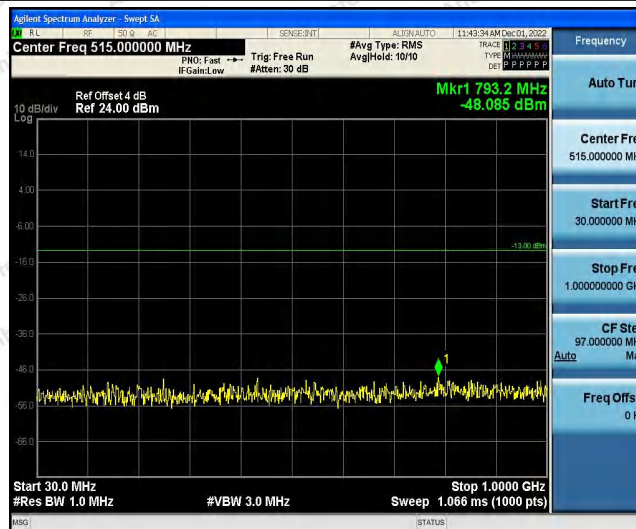

Band66-3MHz-16QAM-132322-1RB#0-Range2:1000~20000MHz

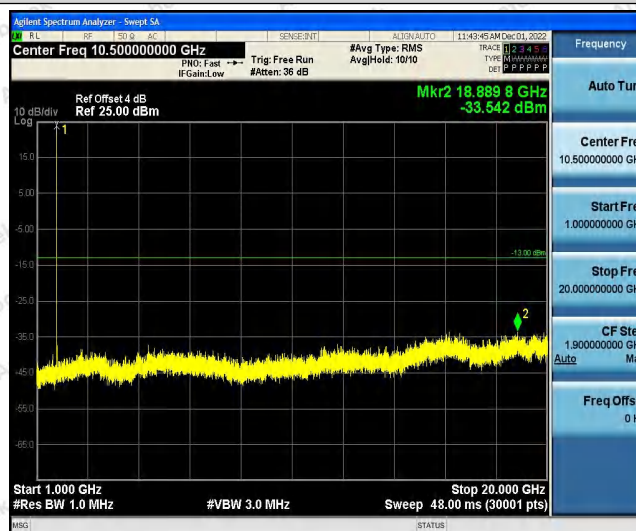

Band66-3MHz-16QAM-132657-1RB#0-Range1:30~1000MHz

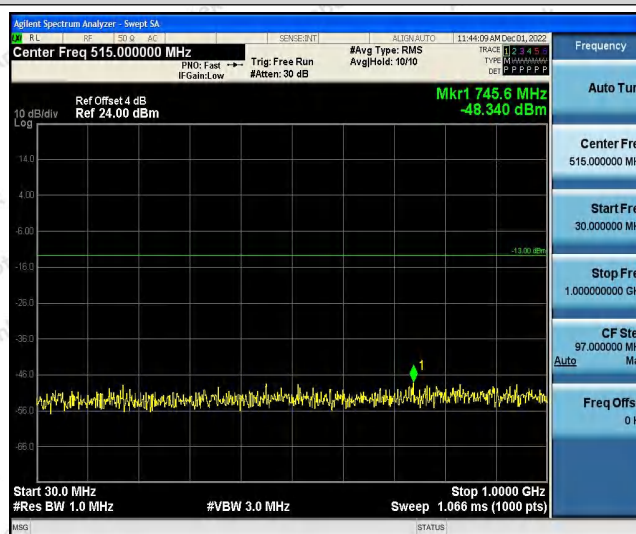

Band66-3MHz-16QAM-132657-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




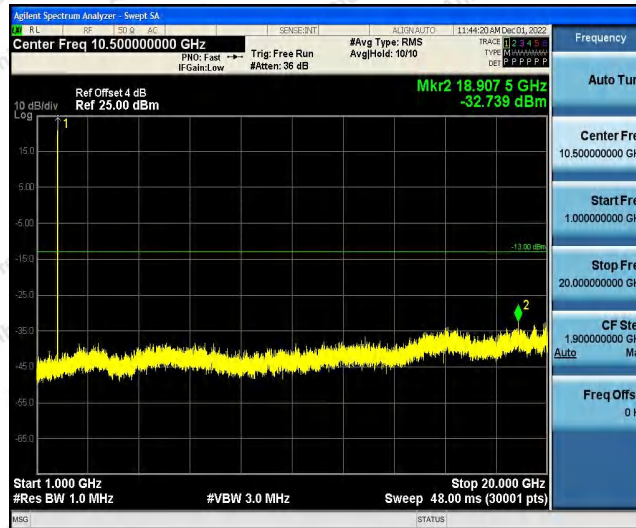

Band66-5MHz-QPSK-131997-1RB#0-Range1:30~1000MHz

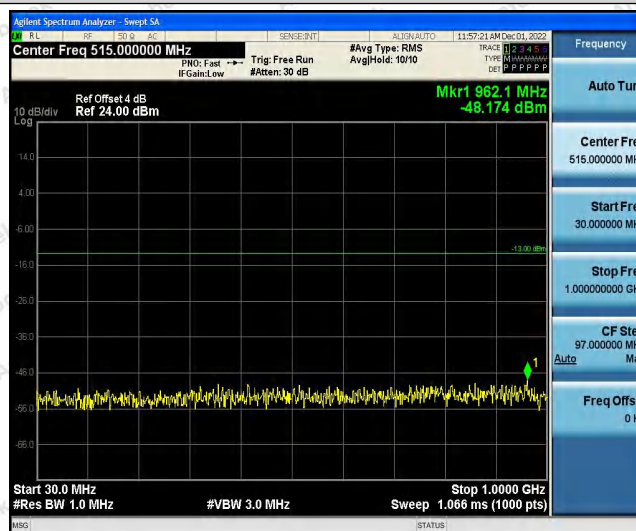


Band66-5MHz-QPSK-131997-1RB#0-Range2:1000~20000MHz

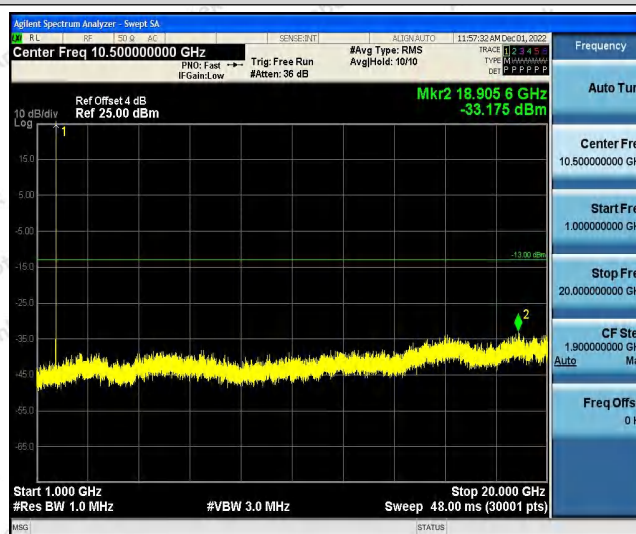


Band66-5MHz-QPSK-132322-1RB#0-Range1:30~1000MHz




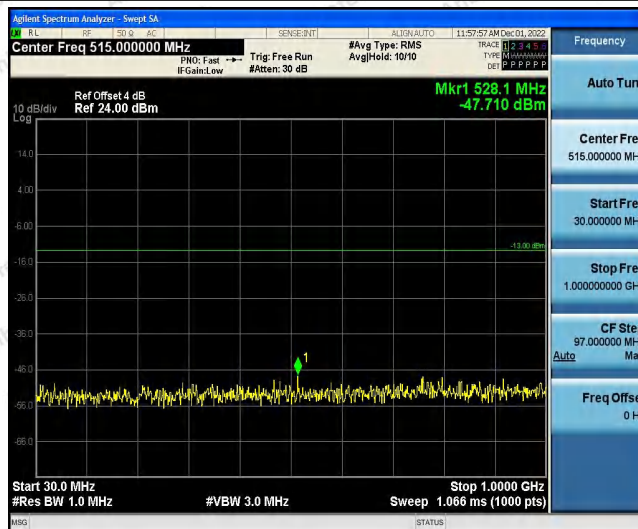

Band66-5MHz-QPSK-132322-1RB#0-Range2:1000~20000MHz

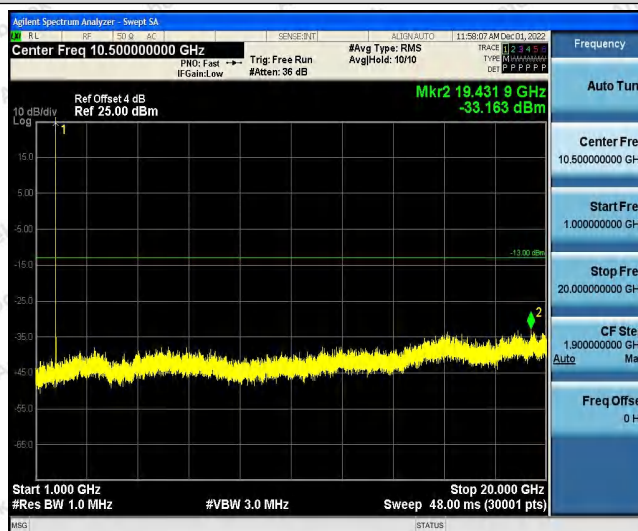

Band66-5MHz-QPSK-132647-1RB#0-Range1:30~1000MHz

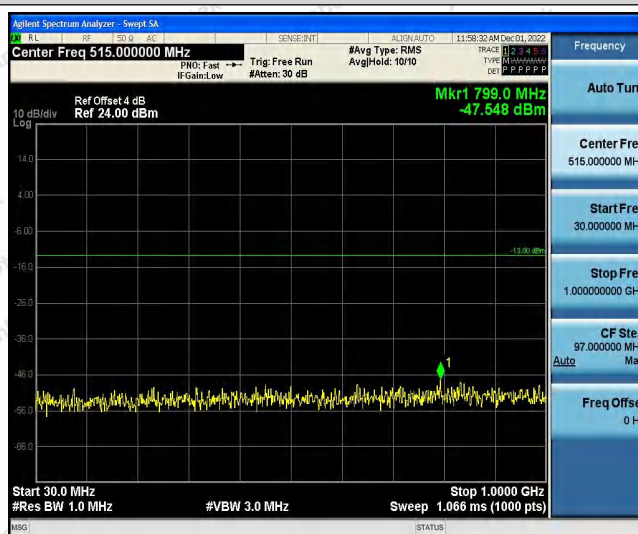

Band66-5MHz-QPSK-132647-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn



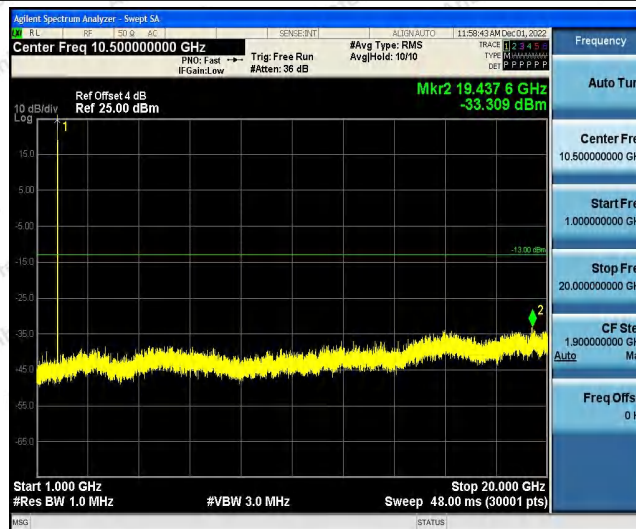

Band66-5MHz-16QAM-131997-1RB#0-Range1:30~1000MHz

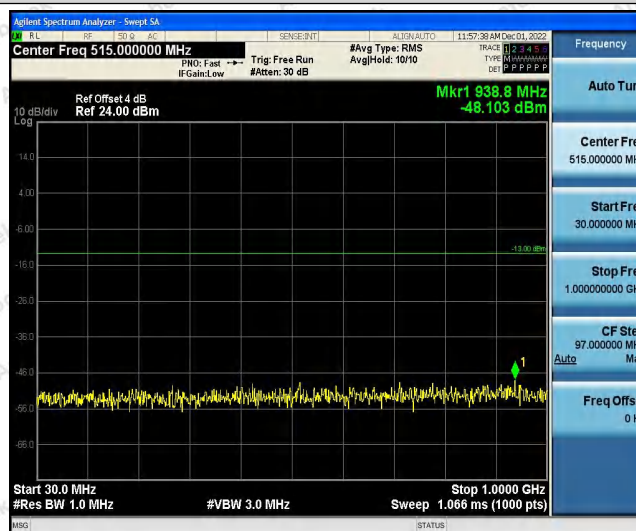

Band66-5MHz-16QAM-131997-1RB#0-Range2:1000~20000MHz



Band66-5MHz-16QAM-132322-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




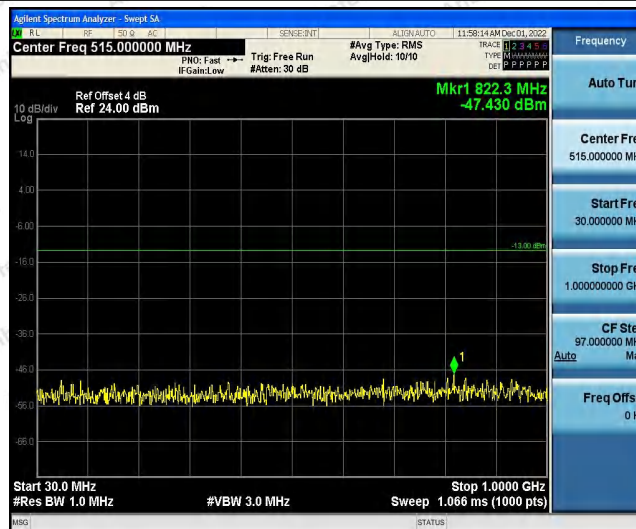

Band66-5MHz-16QAM-132322-1RB#0-Range2:1000~20000MHz

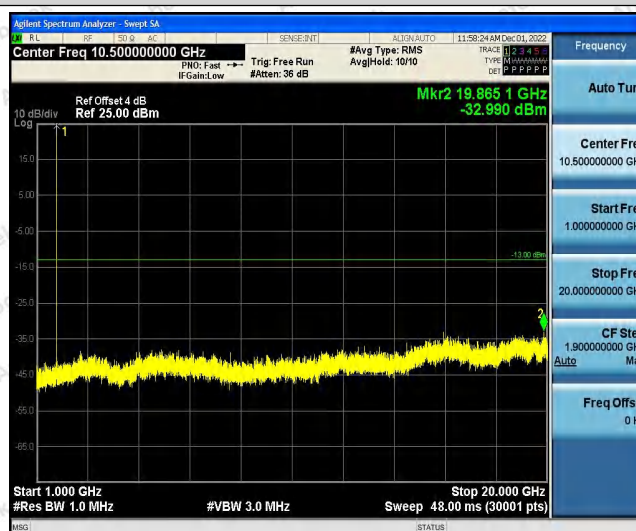

Band66-5MHz-16QAM-132647-1RB#0-Range1:30~1000MHz

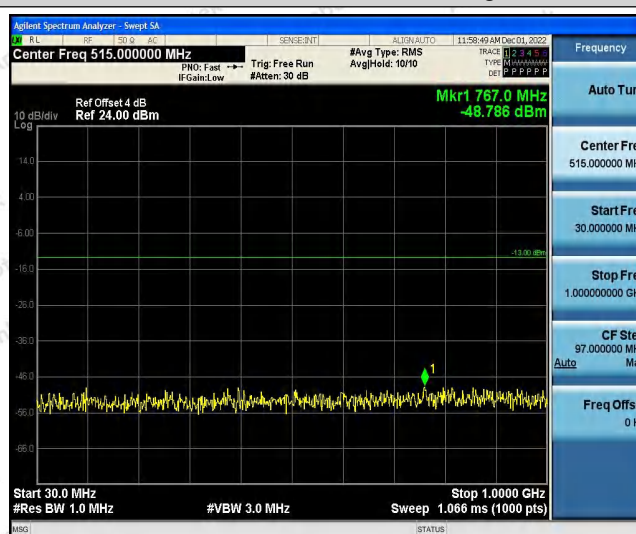

Band66-5MHz-16QAM-132647-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn





Band66-10MHz-QPSK-132022-1RB#0-Range1:30~1000MHz

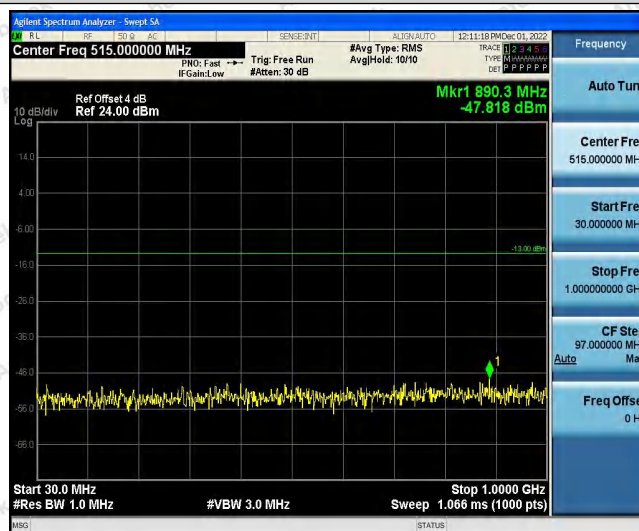

Band66-10MHz-QPSK-132022-1RB#0-Range2:1000~20000MHz



Band66-10MHz-QPSK-132322-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




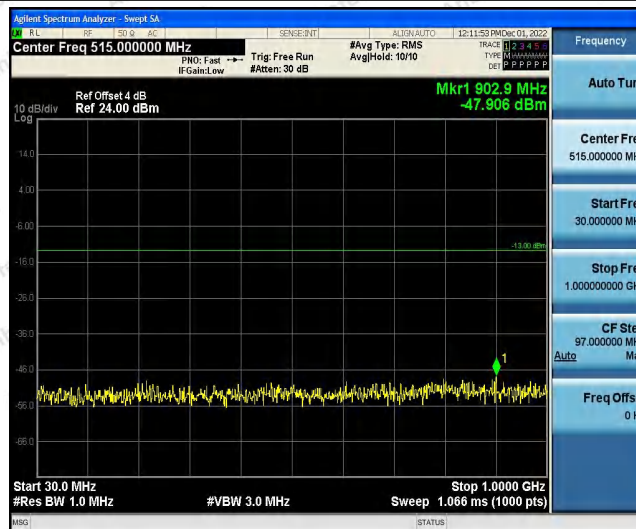

Band66-10MHz-QPSK-132322-1RB#0-Range2:1000~20000MHz

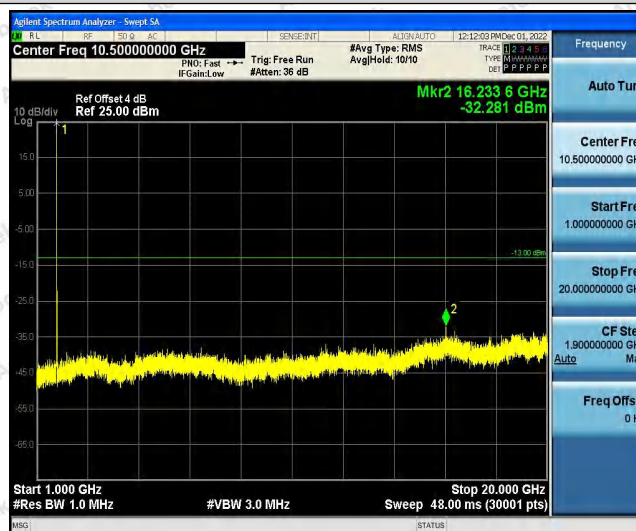

Band66-10MHz-QPSK-132622-1RB#0-Range1:30~1000MHz

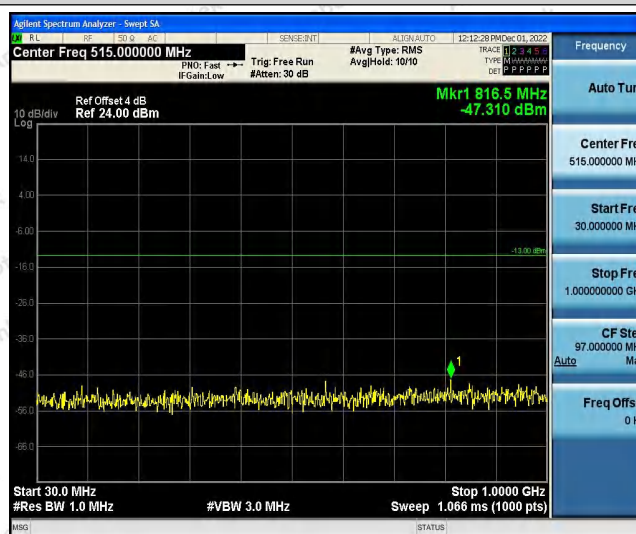

Band66-10MHz-QPSK-132622-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




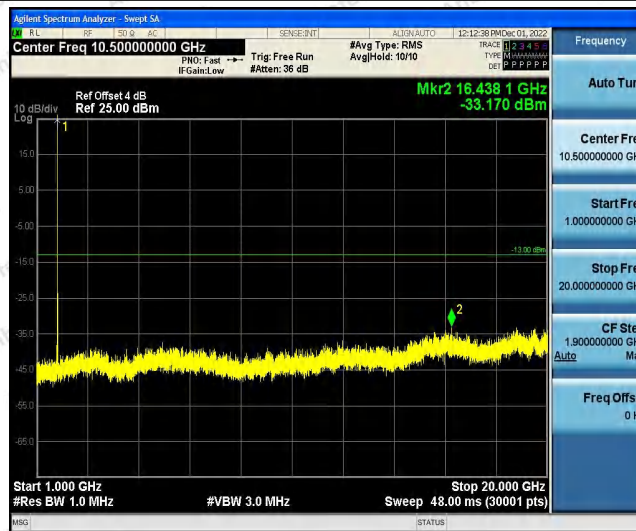

Band66-10MHz-16QAM-132022-1RB#0-Range1:30~1000MHz

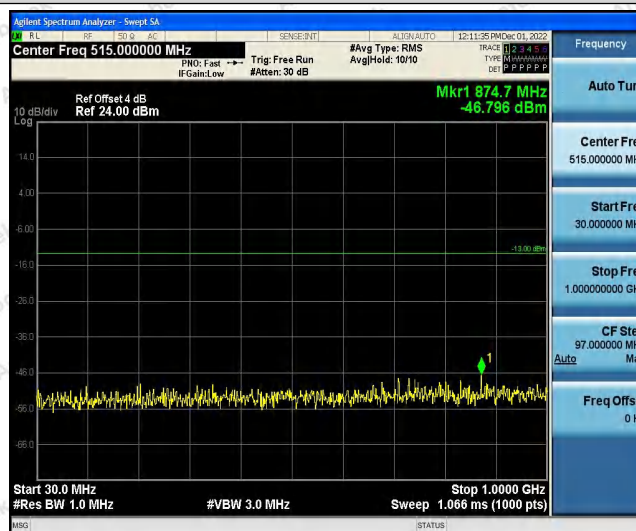

Band66-10MHz-16QAM-132022-1RB#0-Range2: 1000~20000MHz

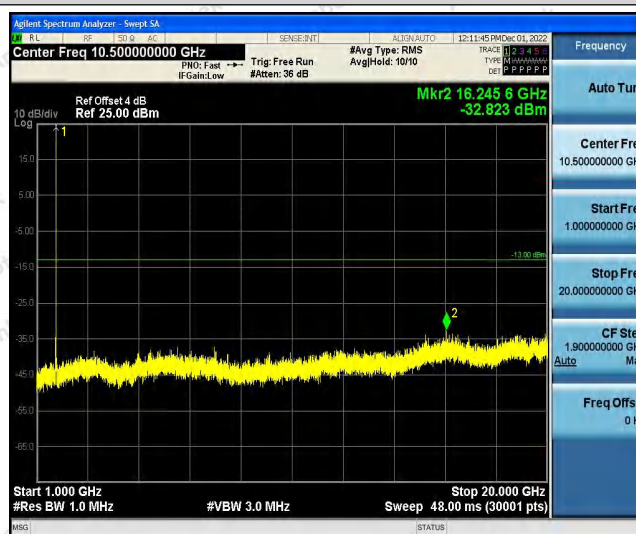

Band66-10MHz-16QAM-132322-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




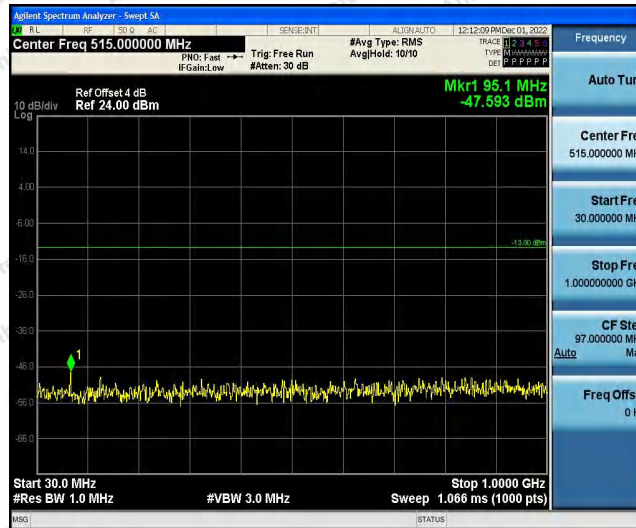

Band66-10MHz-16QAM-132322-1RB#0-Range2:1000~20000MHz

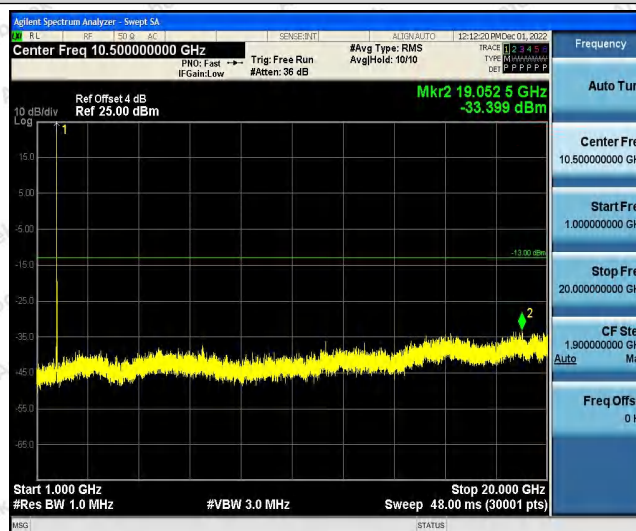

Band66-10MHz-16QAM-132622-1RB#0-Range1:30~1000MHz

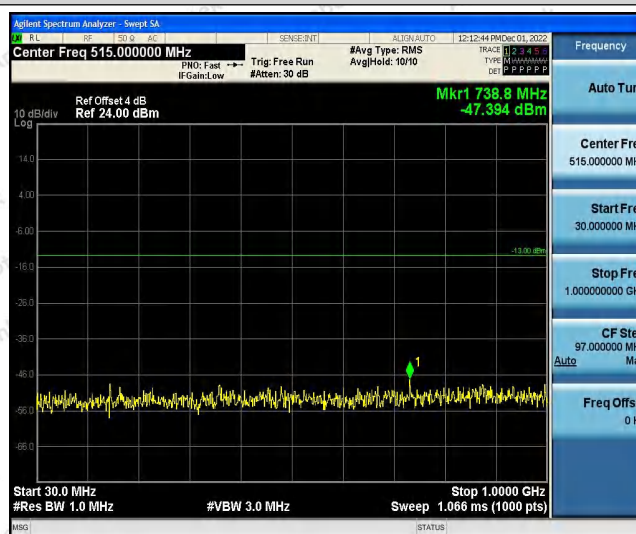

Band66-10MHz-16QAM-132622-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn



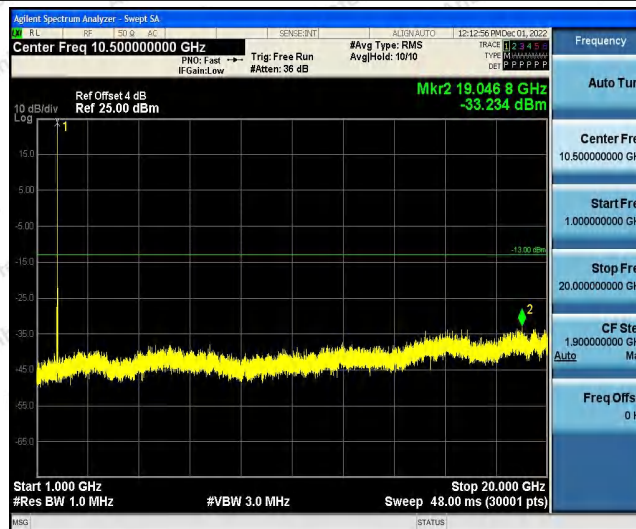

Band66-15MHz-QPSK-132047-1RB#0-Range1:30~1000MHz

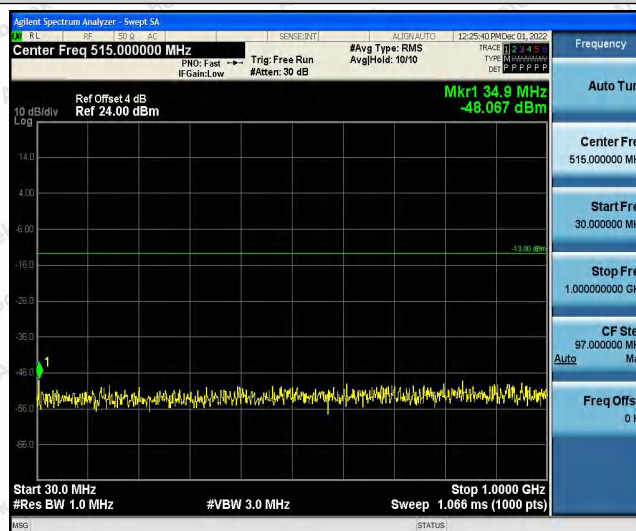

Band66-15MHz-QPSK-132047-1RB#0-Range2:1000~20000MHz



Band66-15MHz-QPSK-132322-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




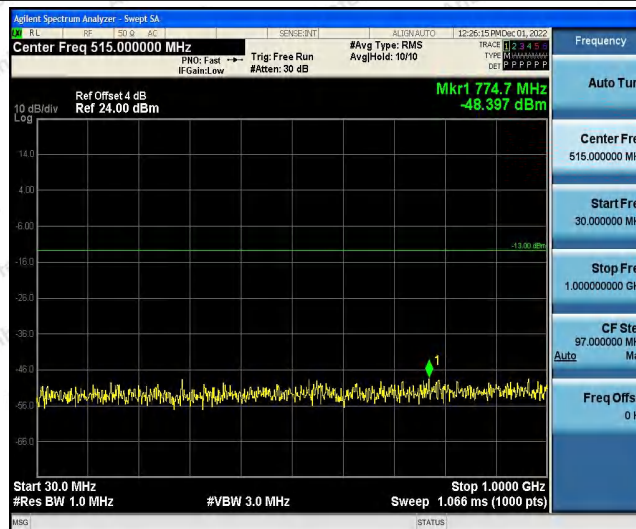

Band66-15MHz-QPSK-132322-1RB#0-Range2:1000~20000MHz

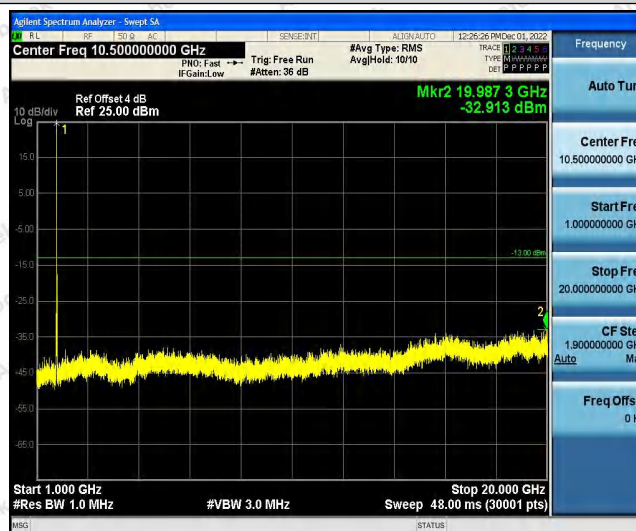

Band66-15MHz-QPSK-132597-1RB#0-Range1:30~1000MHz

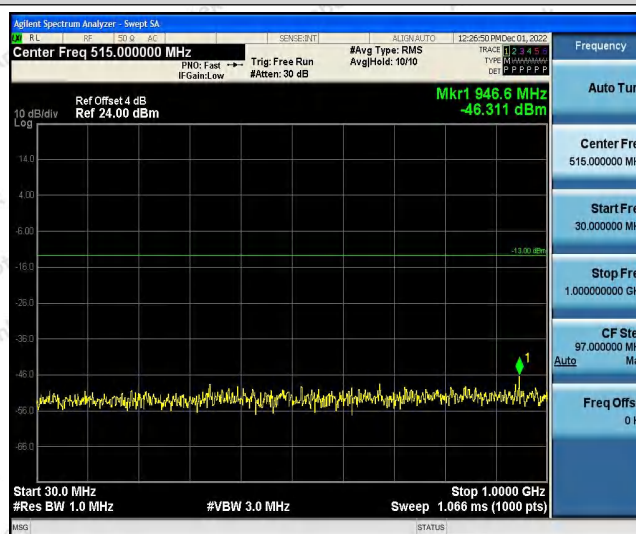

Band66-15MHz-QPSK-132597-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn



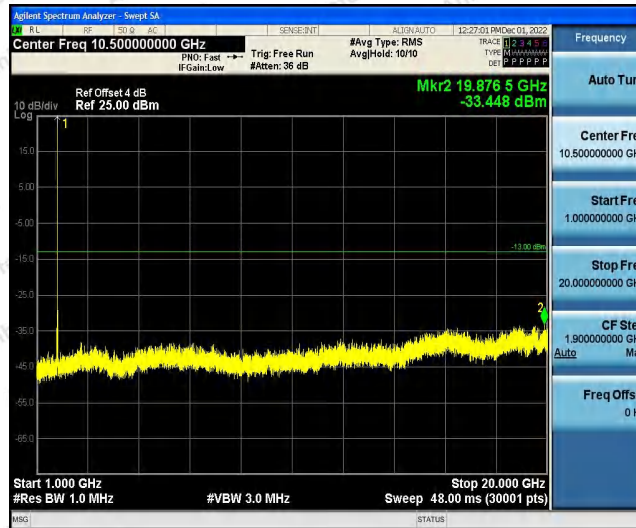

Band66-15MHz-16QAM-132047-1RB#0-Range1:30~1000MHz

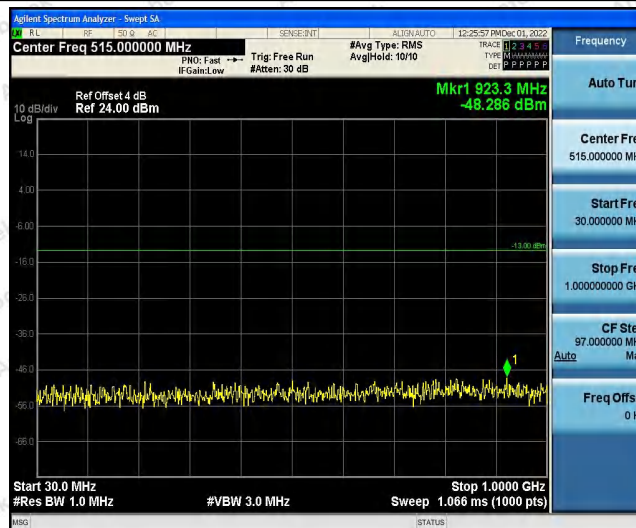

Band66-15MHz-16QAM-132047-1RB#0-Range2: 1000~20000MHz



Band66-15MHz-16QAM-132322-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




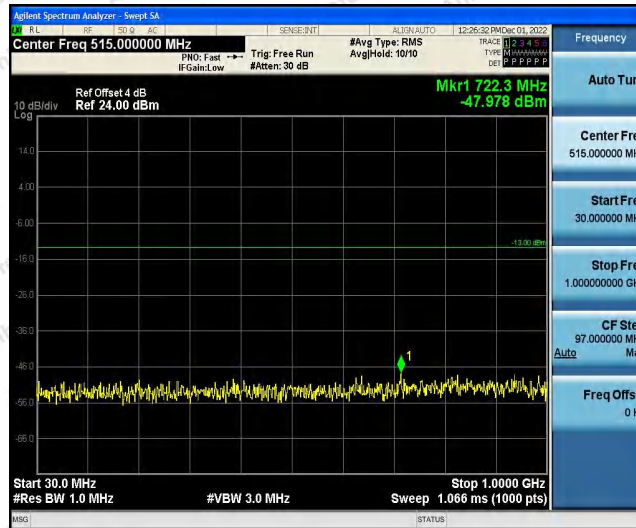

Band66-15MHz-16QAM-132322-1RB#0-Range2:1000~20000MHz

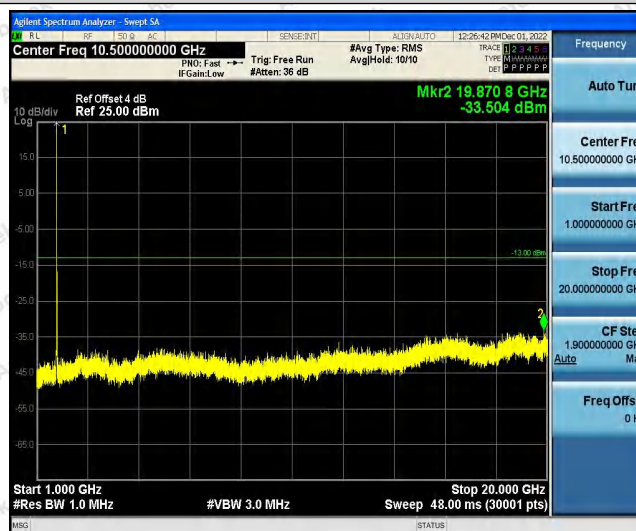


Band66-15MHz-16QAM-132597-1RB#0-Range1:30~1000MHz

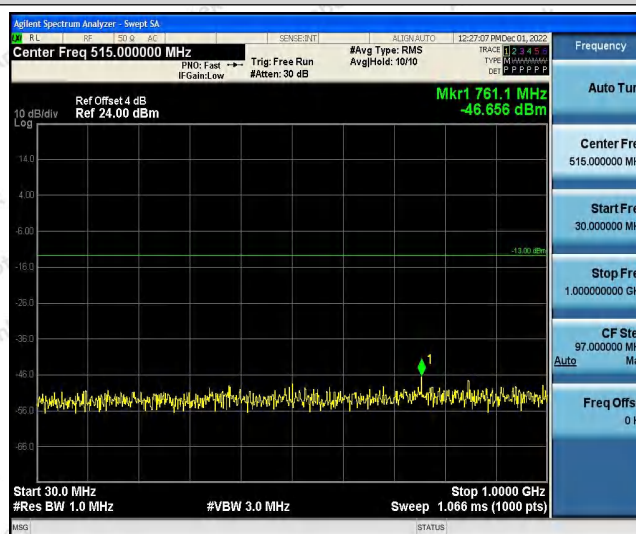


Band66-15MHz-16QAM-132597-1RB#0-Range2:1000~20000MHz



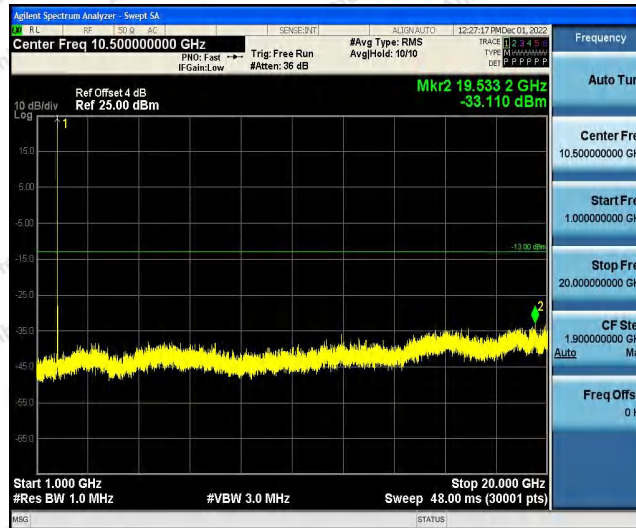

Band66-20MHz-QPSK-132072-1RB#0-Range1:30~1000MHz

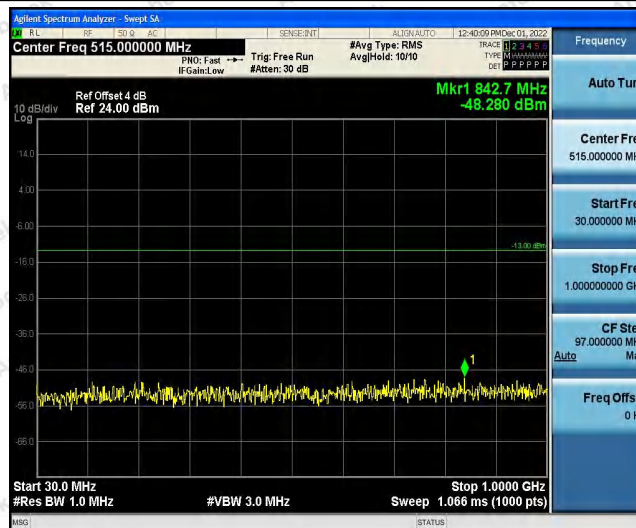

Band66-20MHz-QPSK-132072-1RB#0-Range2:1000~20000MHz



Band66-20MHz-QPSK-132322-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




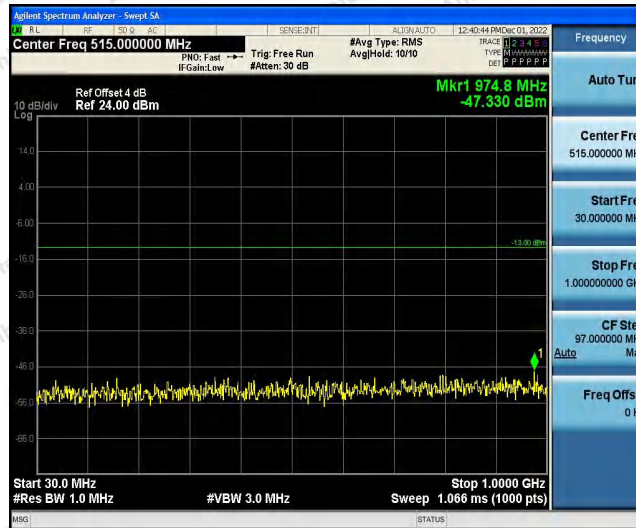

Band66-20MHz-QPSK-132322-1RB#0-Range2:1000~20000MHz

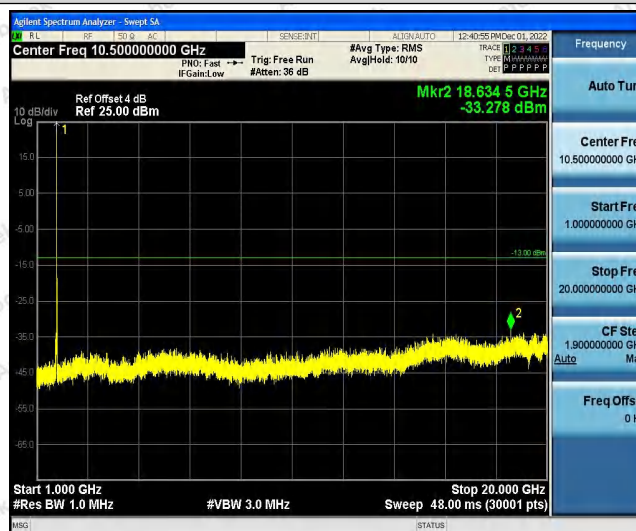

Band66-20MHz-QPSK-132572-1RB#0-Range1:30~1000MHz

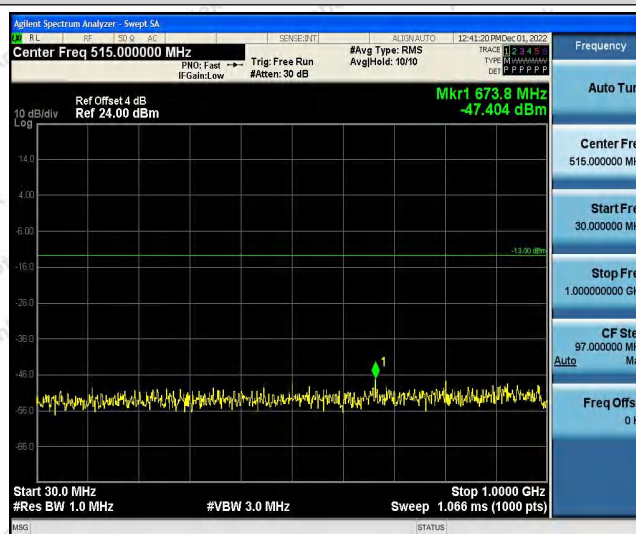

Band66-20MHz-QPSK-132572-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




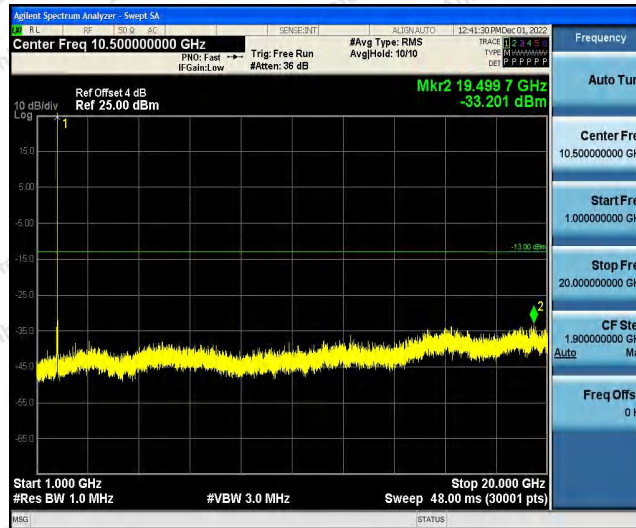

Band66-20MHz-16QAM-132072-1RB#0-Range1:30~1000MHz

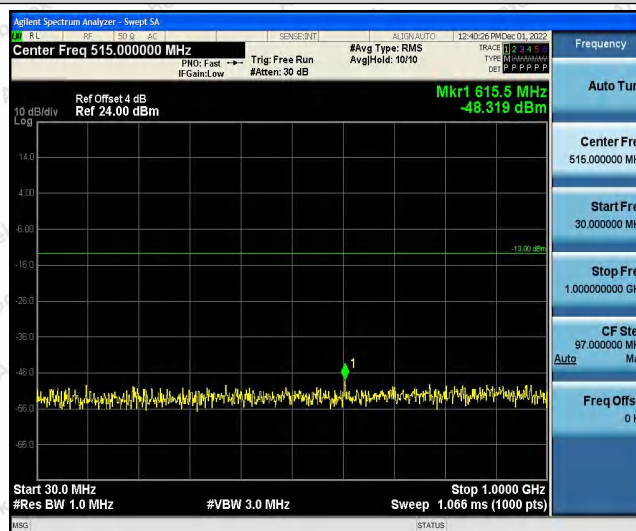

Band66-20MHz-16QAM-132072-1RB#0-Range2: 1000~20000MHz

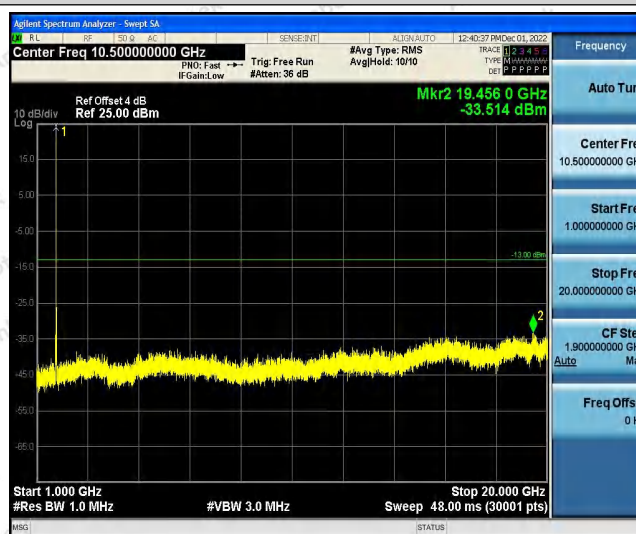

Band66-20MHz-16QAM-132322-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




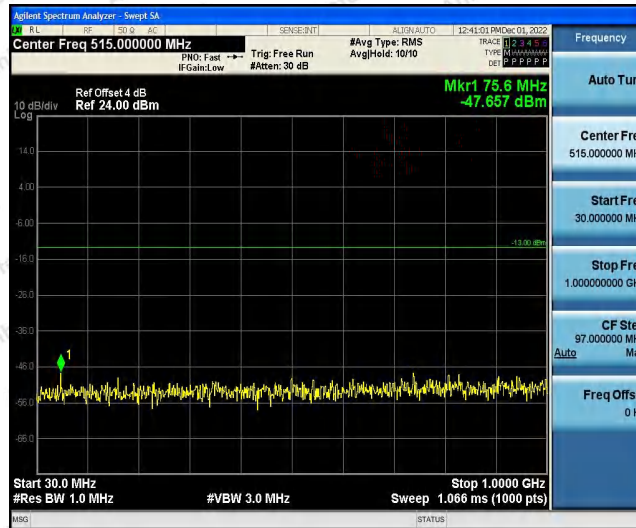

Band66-20MHz-16QAM-132322-1RB#0-Range2:1000~20000MHz

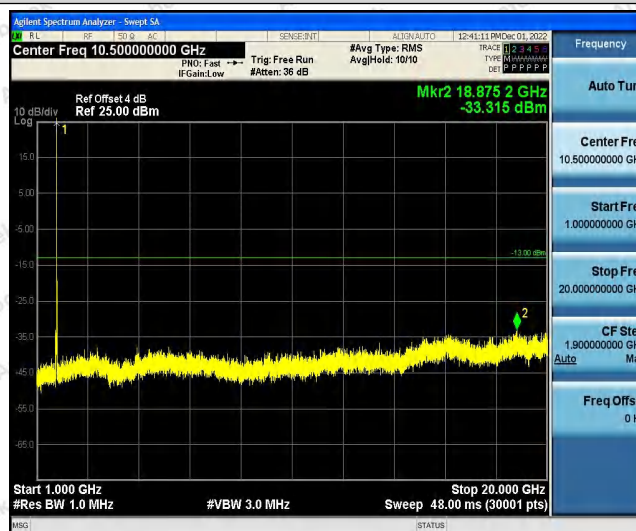

Band66-20MHz-16QAM-132572-1RB#0-Range1:30~1000MHz

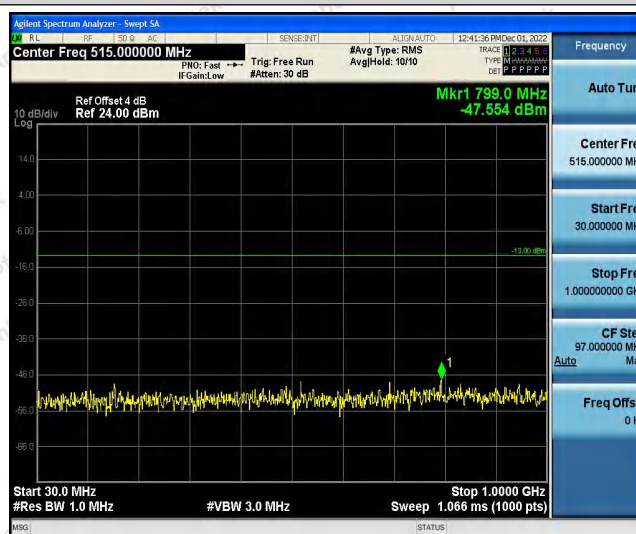

Band66-20MHz-16QAM-132572-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



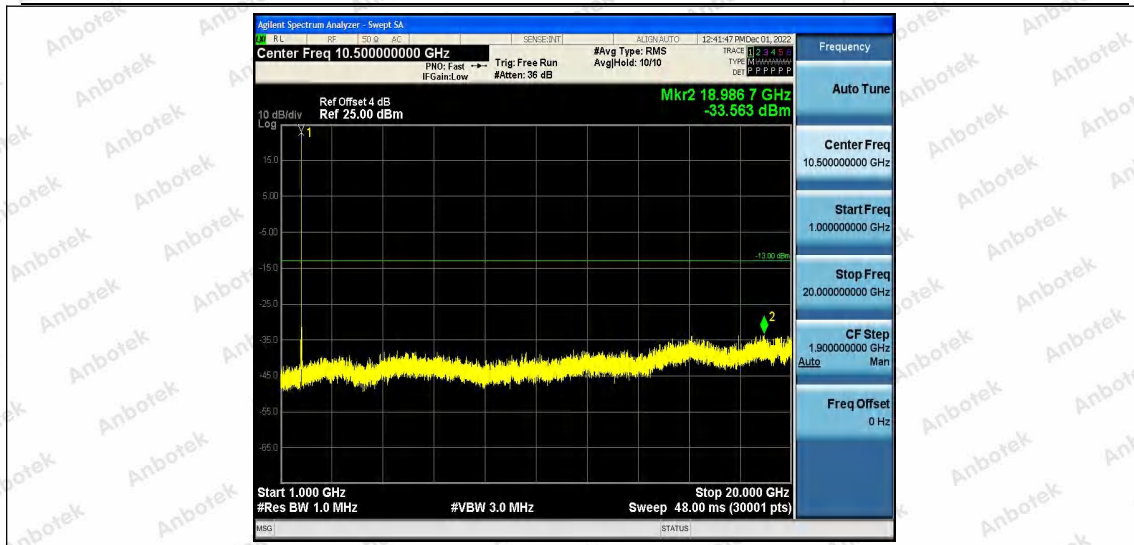

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Appendix F: Frequency stability VS Voltage measurement

Test Result

Band	Bandwidth	Modulation	Channel	RB Configure	Voltage					
					Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band66	1.4MHz	QPSK	131979	6RB#0	VL	NT	-8.17	-0.004776	±2.5	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	VN	NT	5.21	0.003046	±2.5	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	VH	NT	-9.03	-0.005279	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	VL	NT	-8.73	-0.005003	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	VN	NT	8.23	0.004716	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	VH	NT	-5.41	-0.003100	±2.5	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	VL	NT	-13.89	-0.007806	±2.5	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	VN	NT	-3.91	-0.002197	±2.5	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	VH	NT	-7.61	-0.004277	±2.5	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	VL	NT	-4.29	-0.002508	±2.5	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	VN	NT	-9.16	-0.005355	±2.5	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	VH	NT	-10.64	-0.006220	±2.5	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	VL	NT	-4.45	-0.002550	±2.5	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	VN	NT	-9.30	-0.005330	±2.5	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	VH	NT	-4.59	-0.002630	±2.5	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	VL	NT	-5.35	-0.003007	±2.5	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	VN	NT	-5.06	-0.002844	±2.5	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	VH	NT	-10.23	-0.005749	±2.5	PASS
Band66	3MHz	QPSK	131987	15RB#0	VL	NT	-4.75	-0.002775	±2.5	PASS
Band66	3MHz	QPSK	131987	15RB#0	VN	NT	10.47	0.006117	±2.5	PASS
Band66	3MHz	QPSK	131987	15RB#0	VH	NT	-7.81	-0.004563	±2.5	PASS
Band66	3MHz	QPSK	132322	15RB#0	VL	NT	-5.76	-0.003301	±2.5	PASS
Band66	3MHz	QPSK	132322	15RB#0	VN	NT	11.19	0.006413	±2.5	PASS
Band66	3MHz	QPSK	132322	15RB#0	VH	NT	-10.89	-0.006241	±2.5	PASS
Band66	3MHz	QPSK	132657	15RB#0	VL	NT	-12.49	-0.007023	±2.5	PASS
Band66	3MHz	QPSK	132657	15RB#0	VN	NT	8.05	0.004526	±2.5	PASS
Band66	3MHz	QPSK	132657	15RB#0	VH	NT	-15.74	-0.008850	±2.5	PASS
Band66	3MHz	16QAM	131987	15RB#0	VL	NT	-4.72	-0.002758	±2.5	PASS
Band66	3MHz	16QAM	131987	15RB#0	VN	NT	-7.31	-0.004271	±2.5	PASS
Band66	3MHz	16QAM	131987	15RB#0	VH	NT	-6.18	-0.003611	±2.5	PASS
Band66	3MHz	16QAM	132322	15RB#0	VL	NT	-4.81	-0.002756	±2.5	PASS
Band66	3MHz	16QAM	132322	15RB#0	VN	NT	-9.04	-0.005181	±2.5	PASS
Band66	3MHz	16QAM	132322	15RB#0	VH	NT	-6.39	-0.003662	±2.5	PASS
Band66	3MHz	16QAM	132657	15RB#0	VL	NT	-3.91	-0.002198	±2.5	PASS



Band66	3MHz	16QAM	132657	15RB#0	VN	NT	-8.61	-0.004841	±2.5	PASS
Band66	3MHz	16QAM	132657	15RB#0	VH	NT	-5.81	-0.003267	±2.5	PASS
Band66	5MHz	QPSK	131997	25RB#0	VL	NT	-10.96	-0.006400	±2.5	PASS
Band66	5MHz	QPSK	131997	25RB#0	VN	NT	-6.62	-0.003866	±2.5	PASS
Band66	5MHz	QPSK	131997	25RB#0	VH	NT	-6.32	-0.003691	±2.5	PASS
Band66	5MHz	QPSK	132322	25RB#0	VL	NT	-6.45	-0.003696	±2.5	PASS
Band66	5MHz	QPSK	132322	25RB#0	VN	NT	6.17	0.003536	±2.5	PASS
Band66	5MHz	QPSK	132322	25RB#0	VH	NT	-7.21	-0.004132	±2.5	PASS
Band66	5MHz	QPSK	132647	25RB#0	VL	NT	-9.97	-0.005609	±2.5	PASS
Band66	5MHz	QPSK	132647	25RB#0	VN	NT	2.27	0.001277	±2.5	PASS
Band66	5MHz	QPSK	132647	25RB#0	VH	NT	-6.55	-0.003685	±2.5	PASS
Band66	5MHz	16QAM	131997	25RB#0	VL	NT	-5.28	-0.003083	±2.5	PASS
Band66	5MHz	16QAM	131997	25RB#0	VN	NT	-7.98	-0.004660	±2.5	PASS
Band66	5MHz	16QAM	131997	25RB#0	VH	NT	-4.33	-0.002528	±2.5	PASS
Band66	5MHz	16QAM	132322	25RB#0	VL	NT	2.73	0.001564	±2.5	PASS
Band66	5MHz	16QAM	132322	25RB#0	VN	NT	-3.48	-0.001994	±2.5	PASS
Band66	5MHz	16QAM	132322	25RB#0	VH	NT	-1.73	-0.000991	±2.5	PASS
Band66	5MHz	16QAM	132647	25RB#0	VL	NT	-6.12	-0.003443	±2.5	PASS
Band66	5MHz	16QAM	132647	25RB#0	VN	NT	-8.27	-0.004653	±2.5	PASS
Band66	5MHz	16QAM	132647	25RB#0	VH	NT	-4.31	-0.002425	±2.5	PASS
Band66	10MHz	QPSK	132022	50RB#0	VL	NT	-9.74	-0.005679	±2.5	PASS
Band66	10MHz	QPSK	132022	50RB#0	VN	NT	-7.94	-0.004630	±2.5	PASS
Band66	10MHz	QPSK	132022	50RB#0	VH	NT	-11.04	-0.006437	±2.5	PASS
Band66	10MHz	QPSK	132322	50RB#0	VL	NT	-5.91	-0.003387	±2.5	PASS
Band66	10MHz	QPSK	132322	50RB#0	VN	NT	-3.12	-0.001788	±2.5	PASS
Band66	10MHz	QPSK	132322	50RB#0	VH	NT	-5.01	-0.002871	±2.5	PASS
Band66	10MHz	QPSK	132622	50RB#0	VL	NT	-13.62	-0.007673	±2.5	PASS
Band66	10MHz	QPSK	132622	50RB#0	VN	NT	-4.68	-0.002637	±2.5	PASS
Band66	10MHz	QPSK	132622	50RB#0	VH	NT	-10.56	-0.005949	±2.5	PASS
Band66	10MHz	16QAM	132022	50RB#0	VL	NT	-11.89	-0.006933	±2.5	PASS
Band66	10MHz	16QAM	132022	50RB#0	VN	NT	-12.39	-0.007224	±2.5	PASS
Band66	10MHz	16QAM	132022	50RB#0	VH	NT	-6.34	-0.003697	±2.5	PASS
Band66	10MHz	16QAM	132322	50RB#0	VL	NT	-5.88	-0.003370	±2.5	PASS
Band66	10MHz	16QAM	132322	50RB#0	VN	NT	2.30	0.001318	±2.5	PASS
Band66	10MHz	16QAM	132322	50RB#0	VH	NT	-3.75	-0.002149	±2.5	PASS
Band66	10MHz	16QAM	132622	50RB#0	VL	NT	-7.98	-0.004496	±2.5	PASS
Band66	10MHz	16QAM	132622	50RB#0	VN	NT	-5.69	-0.003206	±2.5	PASS
Band66	10MHz	16QAM	132622	50RB#0	VH	NT	-9.03	-0.005087	±2.5	PASS
Band66	15MHz	QPSK	132047	75RB#0	VL	NT	-8.44	-0.004914	±2.5	PASS
Band66	15MHz	QPSK	132047	75RB#0	VN	NT	-7.68	-0.004472	±2.5	PASS
Band66	15MHz	QPSK	132047	75RB#0	VH	NT	-6.29	-0.003662	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band66	15MHz	QPSK	132322	75RB#0	VL	NT	-7.91	-0.004533	±2.5	PASS
Band66	15MHz	QPSK	132322	75RB#0	VN	NT	-4.66	-0.002670	±2.5	PASS
Band66	15MHz	QPSK	132322	75RB#0	VH	NT	-9.74	-0.005582	±2.5	PASS
Band66	15MHz	QPSK	132597	75RB#0	VL	NT	-8.24	-0.004649	±2.5	PASS
Band66	15MHz	QPSK	132597	75RB#0	VN	NT	-4.52	-0.002550	±2.5	PASS
Band66	15MHz	QPSK	132597	75RB#0	VH	NT	-6.41	-0.003616	±2.5	PASS
Band66	15MHz	16QAM	132047	75RB#0	VL	NT	-6.44	-0.003750	±2.5	PASS
Band66	15MHz	16QAM	132047	75RB#0	VN	NT	-9.40	-0.005473	±2.5	PASS
Band66	15MHz	16QAM	132047	75RB#0	VH	NT	-7.97	-0.004640	±2.5	PASS
Band66	15MHz	16QAM	132322	75RB#0	VL	NT	3.19	0.001828	±2.5	PASS
Band66	15MHz	16QAM	132322	75RB#0	VN	NT	-12.60	-0.007221	±2.5	PASS
Band66	15MHz	16QAM	132322	75RB#0	VH	NT	-6.37	-0.003650	±2.5	PASS
Band66	15MHz	16QAM	132597	75RB#0	VL	NT	-9.90	-0.005585	±2.5	PASS
Band66	15MHz	16QAM	132597	75RB#0	VN	NT	-8.74	-0.004931	±2.5	PASS
Band66	15MHz	16QAM	132597	75RB#0	VH	NT	-9.20	-0.005190	±2.5	PASS
Band66	20MHz	QPSK	132072	100RB#0	VL	NT	-10.54	-0.006128	±2.5	PASS
Band66	20MHz	QPSK	132072	100RB#0	VN	NT	-6.59	-0.003831	±2.5	PASS
Band66	20MHz	QPSK	132072	100RB#0	VH	NT	-8.34	-0.004849	±2.5	PASS
Band66	20MHz	QPSK	132322	100RB#0	VL	NT	-6.38	-0.003656	±2.5	PASS
Band66	20MHz	QPSK	132322	100RB#0	VN	NT	3.86	0.002212	±2.5	PASS
Band66	20MHz	QPSK	132322	100RB#0	VH	NT	-10.24	-0.005868	±2.5	PASS
Band66	20MHz	QPSK	132572	100RB#0	VL	NT	-9.63	-0.005441	±2.5	PASS
Band66	20MHz	QPSK	132572	100RB#0	VN	NT	-3.59	-0.002028	±2.5	PASS
Band66	20MHz	QPSK	132572	100RB#0	VH	NT	-9.78	-0.005525	±2.5	PASS
Band66	20MHz	16QAM	132072	100RB#0	VL	NT	-7.78	-0.004523	±2.5	PASS
Band66	20MHz	16QAM	132072	100RB#0	VN	NT	-7.45	-0.004331	±2.5	PASS
Band66	20MHz	16QAM	132072	100RB#0	VH	NT	-9.67	-0.005622	±2.5	PASS
Band66	20MHz	16QAM	132322	100RB#0	VL	NT	-8.83	-0.005060	±2.5	PASS
Band66	20MHz	16QAM	132322	100RB#0	VN	NT	-9.74	-0.005582	±2.5	PASS
Band66	20MHz	16QAM	132322	100RB#0	VH	NT	-10.97	-0.006287	±2.5	PASS
Band66	20MHz	16QAM	132572	100RB#0	VL	NT	-5.15	-0.002910	±2.5	PASS
Band66	20MHz	16QAM	132572	100RB#0	VN	NT	-7.11	-0.004017	±2.5	PASS
Band66	20MHz	16QAM	132572	100RB#0	VH	NT	-7.58	-0.004282	±2.5	PASS



Appendix G: Frequency stability VS Temperature measurement

Test Result

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configure	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band66	1.4MHz	QPSK	131979	6RB#0	NV	-30	-9.56	-0.005588	±2.5	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	NV	-20	-4.82	-0.002818	±2.5	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	NV	0	-9.97	-0.005828	±2.5	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	NV	10	-7.40	-0.004326	±2.5	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	NV	20	-10.46	-0.006114	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	NV	-30	-6.54	-0.003748	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	NV	-20	-5.51	-0.003158	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	NV	0	-9.36	-0.005364	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	NV	10	-8.41	-0.004819	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	NV	20	-5.44	-0.003117	±2.5	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	NV	-30	-10.39	-0.005839	±2.5	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	NV	-20	-4.68	-0.002630	±2.5	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	NV	0	-5.85	-0.003288	±2.5	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	NV	10	-3.93	-0.002209	±2.5	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	NV	20	-4.88	-0.002743	±2.5	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	NV	-30	-5.78	-0.003379	±2.5	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	NV	-20	-7.21	-0.004215	±2.5	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	NV	0	-7.50	-0.004384	±2.5	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	NV	10	-7.67	-0.004484	±2.5	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	NV	20	-10.31	-0.006027	±2.5	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	NV	-30	-5.84	-0.003347	±2.5	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	NV	-20	-6.37	-0.003650	±2.5	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	NV	0	-3.93	-0.002252	±2.5	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	NV	10	-4.22	-0.002418	±2.5	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	NV	20	-8.78	-0.005032	±2.5	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	NV	-30	-4.39	-0.002467	±2.5	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	NV	-20	-9.91	-0.005570	±2.5	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	NV	0	-5.97	-0.003355	±2.5	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	NV	10	-5.84	-0.003282	±2.5	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	NV	20	-5.79	-0.003254	±2.5	PASS
Band66	3MHz	QPSK	131987	15RB#0	NV	-30	-8.71	-0.005089	±2.5	PASS
Band66	3MHz	QPSK	131987	15RB#0	NV	-20	-4.31	-0.002518	±2.5	PASS
Band66	3MHz	QPSK	131987	15RB#0	NV	0	-5.48	-0.003202	±2.5	PASS
Band66	3MHz	QPSK	131987	15RB#0	NV	10	-4.12	-0.002407	±2.5	PASS



Band66	3MHz	QPSK	131987	15RB#0	NV	20	-5.39	-0.003149	±2.5	PASS
Band66	3MHz	QPSK	132322	15RB#0	NV	-30	-6.12	-0.003507	±2.5	PASS
Band66	3MHz	QPSK	132322	15RB#0	NV	-20	-6.01	-0.003444	±2.5	PASS
Band66	3MHz	QPSK	132322	15RB#0	NV	0	-10.19	-0.005840	±2.5	PASS
Band66	3MHz	QPSK	132322	15RB#0	NV	10	-6.95	-0.003983	±2.5	PASS
Band66	3MHz	QPSK	132322	15RB#0	NV	20	-5.18	-0.002968	±2.5	PASS
Band66	3MHz	QPSK	132657	15RB#0	NV	-30	-6.98	-0.003925	±2.5	PASS
Band66	3MHz	QPSK	132657	15RB#0	NV	-20	-8.77	-0.004931	±2.5	PASS
Band66	3MHz	QPSK	132657	15RB#0	NV	0	-7.90	-0.004442	±2.5	PASS
Band66	3MHz	QPSK	132657	15RB#0	NV	10	-6.45	-0.003627	±2.5	PASS
Band66	3MHz	QPSK	132657	15RB#0	NV	20	-10.70	-0.006016	±2.5	PASS
Band66	3MHz	16QAM	131987	15RB#0	NV	-30	-8.60	-0.005025	±2.5	PASS
Band66	3MHz	16QAM	131987	15RB#0	NV	-20	-6.67	-0.003897	±2.5	PASS
Band66	3MHz	16QAM	131987	15RB#0	NV	0	6.17	0.003605	±2.5	PASS
Band66	3MHz	16QAM	131987	15RB#0	NV	10	-5.81	-0.003395	±2.5	PASS
Band66	3MHz	16QAM	131987	15RB#0	NV	20	-7.10	-0.004148	±2.5	PASS
Band66	3MHz	16QAM	132322	15RB#0	NV	-30	-5.26	-0.003014	±2.5	PASS
Band66	3MHz	16QAM	132322	15RB#0	NV	-20	-8.68	-0.004974	±2.5	PASS
Band66	3MHz	16QAM	132322	15RB#0	NV	0	-8.47	-0.004854	±2.5	PASS
Band66	3MHz	16QAM	132322	15RB#0	NV	10	-3.03	-0.001736	±2.5	PASS
Band66	3MHz	16QAM	132322	15RB#0	NV	20	-6.39	-0.003662	±2.5	PASS
Band66	3MHz	16QAM	132657	15RB#0	NV	-30	-7.98	-0.004487	±2.5	PASS
Band66	3MHz	16QAM	132657	15RB#0	NV	-20	-9.41	-0.005291	±2.5	PASS
Band66	3MHz	16QAM	132657	15RB#0	NV	0	-10.00	-0.005623	±2.5	PASS
Band66	3MHz	16QAM	132657	15RB#0	NV	10	-11.96	-0.006725	±2.5	PASS
Band66	3MHz	16QAM	132657	15RB#0	NV	20	-4.43	-0.002491	±2.5	PASS
Band66	5MHz	QPSK	131997	25RB#0	NV	-30	-6.97	-0.004070	±2.5	PASS
Band66	5MHz	QPSK	131997	25RB#0	NV	-20	-3.09	-0.001804	±2.5	PASS
Band66	5MHz	QPSK	131997	25RB#0	NV	0	-6.87	-0.004012	±2.5	PASS
Band66	5MHz	QPSK	131997	25RB#0	NV	10	-10.79	-0.006301	±2.5	PASS
Band66	5MHz	QPSK	131997	25RB#0	NV	20	-7.42	-0.004333	±2.5	PASS
Band66	5MHz	QPSK	132322	25RB#0	NV	-30	-4.41	-0.002527	±2.5	PASS
Band66	5MHz	QPSK	132322	25RB#0	NV	-20	-6.81	-0.003903	±2.5	PASS
Band66	5MHz	QPSK	132322	25RB#0	NV	0	-3.82	-0.002189	±2.5	PASS
Band66	5MHz	QPSK	132322	25RB#0	NV	10	-7.07	-0.004052	±2.5	PASS
Band66	5MHz	QPSK	132322	25RB#0	NV	20	-4.81	-0.002756	±2.5	PASS
Band66	5MHz	QPSK	132647	25RB#0	NV	-30	3.19	0.001795	±2.5	PASS
Band66	5MHz	QPSK	132647	25RB#0	NV	-20	-4.79	-0.002695	±2.5	PASS
Band66	5MHz	QPSK	132647	25RB#0	NV	0	-5.82	-0.003274	±2.5	PASS
Band66	5MHz	QPSK	132647	25RB#0	NV	10	-8.25	-0.004641	±2.5	PASS
Band66	5MHz	QPSK	132647	25RB#0	NV	20	-4.81	-0.002706	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band66	5MHz	16QAM	131997	25RB#0	NV	-30	-9.66	-0.005641	±2.5	PASS
Band66	5MHz	16QAM	131997	25RB#0	NV	-20	-5.51	-0.003218	±2.5	PASS
Band66	5MHz	16QAM	131997	25RB#0	NV	0	-5.22	-0.003048	±2.5	PASS
Band66	5MHz	16QAM	131997	25RB#0	NV	10	-7.65	-0.004467	±2.5	PASS
Band66	5MHz	16QAM	131997	25RB#0	NV	20	-6.77	-0.003953	±2.5	PASS
Band66	5MHz	16QAM	132322	25RB#0	NV	-30	2.88	0.001650	±2.5	PASS
Band66	5MHz	16QAM	132322	25RB#0	NV	-20	-5.36	-0.003072	±2.5	PASS
Band66	5MHz	16QAM	132322	25RB#0	NV	0	-6.71	-0.003845	±2.5	PASS
Band66	5MHz	16QAM	132322	25RB#0	NV	10	-3.13	-0.001794	±2.5	PASS
Band66	5MHz	16QAM	132322	25RB#0	NV	20	-6.24	-0.003576	±2.5	PASS
Band66	5MHz	16QAM	132647	25RB#0	NV	-30	-5.94	-0.003342	±2.5	PASS
Band66	5MHz	16QAM	132647	25RB#0	NV	-20	-4.59	-0.002582	±2.5	PASS
Band66	5MHz	16QAM	132647	25RB#0	NV	0	-8.50	-0.004782	±2.5	PASS
Band66	5MHz	16QAM	132647	25RB#0	NV	10	-4.65	-0.002616	±2.5	PASS
Band66	5MHz	16QAM	132647	25RB#0	NV	20	-3.62	-0.002037	±2.5	PASS
Band66	10MHz	QPSK	132022	50RB#0	NV	-30	-9.91	-0.005778	±2.5	PASS
Band66	10MHz	QPSK	132022	50RB#0	NV	-20	-8.83	-0.005149	±2.5	PASS
Band66	10MHz	QPSK	132022	50RB#0	NV	0	-4.06	-0.002367	±2.5	PASS
Band66	10MHz	QPSK	132022	50RB#0	NV	10	-9.08	-0.005294	±2.5	PASS
Band66	10MHz	QPSK	132022	50RB#0	NV	20	-3.79	-0.002210	±2.5	PASS
Band66	10MHz	QPSK	132322	50RB#0	NV	-30	-5.72	-0.003278	±2.5	PASS
Band66	10MHz	QPSK	132322	50RB#0	NV	-20	-5.79	-0.003318	±2.5	PASS
Band66	10MHz	QPSK	132322	50RB#0	NV	0	-5.75	-0.003295	±2.5	PASS
Band66	10MHz	QPSK	132322	50RB#0	NV	10	-5.34	-0.003060	±2.5	PASS
Band66	10MHz	QPSK	132322	50RB#0	NV	20	-5.56	-0.003186	±2.5	PASS
Band66	10MHz	QPSK	132622	50RB#0	NV	-30	-7.52	-0.004237	±2.5	PASS
Band66	10MHz	QPSK	132622	50RB#0	NV	-20	-8.14	-0.004586	±2.5	PASS
Band66	10MHz	QPSK	132622	50RB#0	NV	0	-6.17	-0.003476	±2.5	PASS
Band66	10MHz	QPSK	132622	50RB#0	NV	10	-7.28	-0.004101	±2.5	PASS
Band66	10MHz	QPSK	132622	50RB#0	NV	20	-6.45	-0.003634	±2.5	PASS
Band66	10MHz	16QAM	132022	50RB#0	NV	-30	-7.60	-0.004431	±2.5	PASS
Band66	10MHz	16QAM	132022	50RB#0	NV	-20	-6.90	-0.004023	±2.5	PASS
Band66	10MHz	16QAM	132022	50RB#0	NV	0	-5.14	-0.002997	±2.5	PASS
Band66	10MHz	16QAM	132022	50RB#0	NV	10	-9.87	-0.005755	±2.5	PASS
Band66	10MHz	16QAM	132022	50RB#0	NV	20	-2.90	-0.001691	±2.5	PASS
Band66	10MHz	16QAM	132322	50RB#0	NV	-30	-7.60	-0.004355	±2.5	PASS
Band66	10MHz	16QAM	132322	50RB#0	NV	-20	-5.46	-0.003129	±2.5	PASS
Band66	10MHz	16QAM	132322	50RB#0	NV	0	-7.20	-0.004126	±2.5	PASS
Band66	10MHz	16QAM	132322	50RB#0	NV	10	-8.80	-0.005043	±2.5	PASS
Band66	10MHz	16QAM	132322	50RB#0	NV	20	-6.62	-0.003794	±2.5	PASS
Band66	10MHz	16QAM	132622	50RB#0	NV	-30	-11.47	-0.006462	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com.cn



Band66	10MHz	16QAM	132622	50RB#0	NV	-20	-9.90	-0.005577	±2.5	PASS
Band66	10MHz	16QAM	132622	50RB#0	NV	0	-2.72	-0.001532	±2.5	PASS
Band66	10MHz	16QAM	132622	50RB#0	NV	10	-6.32	-0.003561	±2.5	PASS
Band66	10MHz	16QAM	132622	50RB#0	NV	20	-8.11	-0.004569	±2.5	PASS
Band66	15MHz	QPSK	132047	75RB#0	NV	-30	-3.18	-0.001852	±2.5	PASS
Band66	15MHz	QPSK	132047	75RB#0	NV	-20	-10.96	-0.006381	±2.5	PASS
Band66	15MHz	QPSK	132047	75RB#0	NV	0	-7.54	-0.004390	±2.5	PASS
Band66	15MHz	QPSK	132047	75RB#0	NV	10	-9.67	-0.005630	±2.5	PASS
Band66	15MHz	QPSK	132047	75RB#0	NV	20	-9.78	-0.005694	±2.5	PASS
Band66	15MHz	QPSK	132322	75RB#0	NV	-30	-4.94	-0.002831	±2.5	PASS
Band66	15MHz	QPSK	132322	75RB#0	NV	-20	-6.34	-0.003633	±2.5	PASS
Band66	15MHz	QPSK	132322	75RB#0	NV	0	-7.47	-0.004281	±2.5	PASS
Band66	15MHz	QPSK	132322	75RB#0	NV	10	-6.35	-0.003639	±2.5	PASS
Band66	15MHz	QPSK	132322	75RB#0	NV	20	-8.50	-0.004871	±2.5	PASS
Band66	15MHz	QPSK	132597	75RB#0	NV	-30	-11.34	-0.006398	±2.5	PASS
Band66	15MHz	QPSK	132597	75RB#0	NV	-20	-5.39	-0.003041	±2.5	PASS
Band66	15MHz	QPSK	132597	75RB#0	NV	0	-10.41	-0.005873	±2.5	PASS
Band66	15MHz	QPSK	132597	75RB#0	NV	10	-4.82	-0.002719	±2.5	PASS
Band66	15MHz	QPSK	132597	75RB#0	NV	20	-5.46	-0.003080	±2.5	PASS
Band66	15MHz	16QAM	132047	75RB#0	NV	-30	-8.24	-0.004798	±2.5	PASS
Band66	15MHz	16QAM	132047	75RB#0	NV	-20	-8.96	-0.005217	±2.5	PASS
Band66	15MHz	16QAM	132047	75RB#0	NV	0	-6.98	-0.004064	±2.5	PASS
Band66	15MHz	16QAM	132047	75RB#0	NV	10	-9.34	-0.005438	±2.5	PASS
Band66	15MHz	16QAM	132047	75RB#0	NV	20	-7.08	-0.004122	±2.5	PASS
Band66	15MHz	16QAM	132322	75RB#0	NV	-30	-10.77	-0.006172	±2.5	PASS
Band66	15MHz	16QAM	132322	75RB#0	NV	-20	-8.10	-0.004642	±2.5	PASS
Band66	15MHz	16QAM	132322	75RB#0	NV	0	-6.82	-0.003908	±2.5	PASS
Band66	15MHz	16QAM	132322	75RB#0	NV	10	-5.06	-0.002900	±2.5	PASS
Band66	15MHz	16QAM	132322	75RB#0	NV	20	-5.92	-0.003393	±2.5	PASS
Band66	15MHz	16QAM	132597	75RB#0	NV	-30	-5.02	-0.002832	±2.5	PASS
Band66	15MHz	16QAM	132597	75RB#0	NV	-20	-2.95	-0.001664	±2.5	PASS
Band66	15MHz	16QAM	132597	75RB#0	NV	0	-7.20	-0.004062	±2.5	PASS
Band66	15MHz	16QAM	132597	75RB#0	NV	10	-5.62	-0.003171	±2.5	PASS
Band66	15MHz	16QAM	132597	75RB#0	NV	20	-4.84	-0.002731	±2.5	PASS
Band66	20MHz	QPSK	132072	100RB#0	NV	-30	-8.81	-0.005122	±2.5	PASS
Band66	20MHz	QPSK	132072	100RB#0	NV	-20	-6.25	-0.003634	±2.5	PASS
Band66	20MHz	QPSK	132072	100RB#0	NV	0	-10.67	-0.006203	±2.5	PASS
Band66	20MHz	QPSK	132072	100RB#0	NV	10	-10.09	-0.005866	±2.5	PASS
Band66	20MHz	QPSK	132072	100RB#0	NV	20	-10.73	-0.006238	±2.5	PASS
Band66	20MHz	QPSK	132322	100RB#0	NV	-30	-7.88	-0.004516	±2.5	PASS
Band66	20MHz	QPSK	132322	100RB#0	NV	-20	-8.88	-0.005089	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band66	20MHz	QPSK	132322	100RB#0	NV	0	-8.71	-0.004991	±2.5	PASS
Band66	20MHz	QPSK	132322	100RB#0	NV	10	-9.13	-0.005232	±2.5	PASS
Band66	20MHz	QPSK	132322	100RB#0	NV	20	-4.19	-0.002401	±2.5	PASS
Band66	20MHz	QPSK	132572	100RB#0	NV	-30	-5.78	-0.003266	±2.5	PASS
Band66	20MHz	QPSK	132572	100RB#0	NV	-20	-5.35	-0.003023	±2.5	PASS
Band66	20MHz	QPSK	132572	100RB#0	NV	0	-7.41	-0.004186	±2.5	PASS
Band66	20MHz	QPSK	132572	100RB#0	NV	10	-8.40	-0.004746	±2.5	PASS
Band66	20MHz	QPSK	132572	100RB#0	NV	20	-4.86	-0.002746	±2.5	PASS
Band66	20MHz	16QAM	132072	100RB#0	NV	-30	-9.57	-0.005564	±2.5	PASS
Band66	20MHz	16QAM	132072	100RB#0	NV	-20	-9.48	-0.005512	±2.5	PASS
Band66	20MHz	16QAM	132072	100RB#0	NV	0	-5.68	-0.003302	±2.5	PASS
Band66	20MHz	16QAM	132072	100RB#0	NV	10	-12.03	-0.006994	±2.5	PASS
Band66	20MHz	16QAM	132072	100RB#0	NV	20	-9.74	-0.005663	±2.5	PASS
Band66	20MHz	16QAM	132322	100RB#0	NV	-30	-3.73	-0.002138	±2.5	PASS
Band66	20MHz	16QAM	132322	100RB#0	NV	-20	-4.84	-0.002774	±2.5	PASS
Band66	20MHz	16QAM	132322	100RB#0	NV	0	-6.24	-0.003576	±2.5	PASS
Band66	20MHz	16QAM	132322	100RB#0	NV	10	-4.28	-0.002453	±2.5	PASS
Band66	20MHz	16QAM	132322	100RB#0	NV	20	-4.12	-0.002361	±2.5	PASS
Band66	20MHz	16QAM	132572	100RB#0	NV	-30	-7.88	-0.004452	±2.5	PASS
Band66	20MHz	16QAM	132572	100RB#0	NV	-20	-5.65	-0.003192	±2.5	PASS
Band66	20MHz	16QAM	132572	100RB#0	NV	0	-5.22	-0.002949	±2.5	PASS
Band66	20MHz	16QAM	132572	100RB#0	NV	10	-12.86	-0.007266	±2.5	PASS
Band66	20MHz	16QAM	132572	100RB#0	NV	20	-9.34	-0.005277	±2.5	PASS

---End---

