

Band4	20MHz	QPSK	20050	1RB#0	Range1:30~1000MHz	-48.72	PASS
Band4	20MHz	QPSK	20050	1RB#0	Range2:1000~20000MHz	-33.01	PASS
Band4	20MHz	QPSK	20175	1RB#0	Range1:30~1000MHz	-48.47	PASS
Band4	20MHz	QPSK	20175	1RB#0	Range2:1000~20000MHz	-33.07	PASS
Band4	20MHz	QPSK	20300	1RB#0	Range1:30~1000MHz	-47.99	PASS
Band4	20MHz	QPSK	20300	1RB#0	Range2:1000~20000MHz	-33.58	PASS
Band4	20MHz	16QAM	20050	1RB#0	Range1:30~1000MHz	-47.67	PASS
Band4	20MHz	16QAM	20050	1RB#0	Range2:1000~20000MHz	-33.72	PASS
Band4	20MHz	16QAM	20175	1RB#0	Range1:30~1000MHz	-48	PASS
Band4	20MHz	16QAM	20175	1RB#0	Range2:1000~20000MHz	-33.6	PASS
Band4	20MHz	16QAM	20300	1RB#0	Range1:30~1000MHz	-47.87	PASS
Band4	20MHz	16QAM	20300	1RB#0	Range2:1000~20000MHz	-32.97	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
 400-003-0500
 www.anbotek.com.cn




Test Graphs

Band4-1.4MHz-QPSK-19957-1RB#0-Range1:30~1000MHz

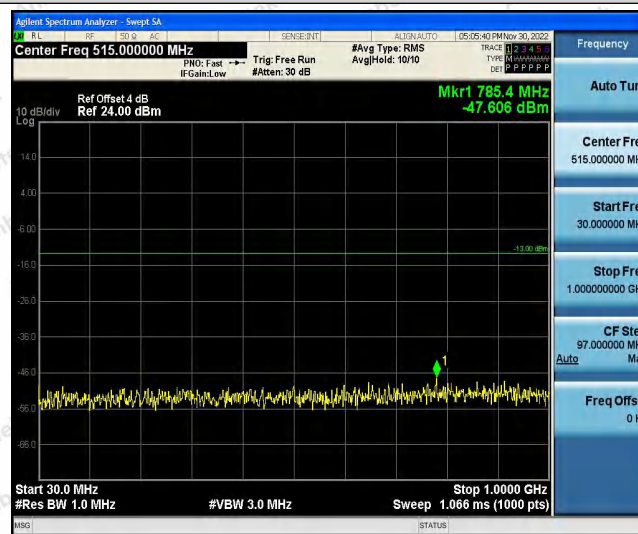

Band4-1.4MHz-QPSK-19957-1RB#0-Range2:1000~20000MHz

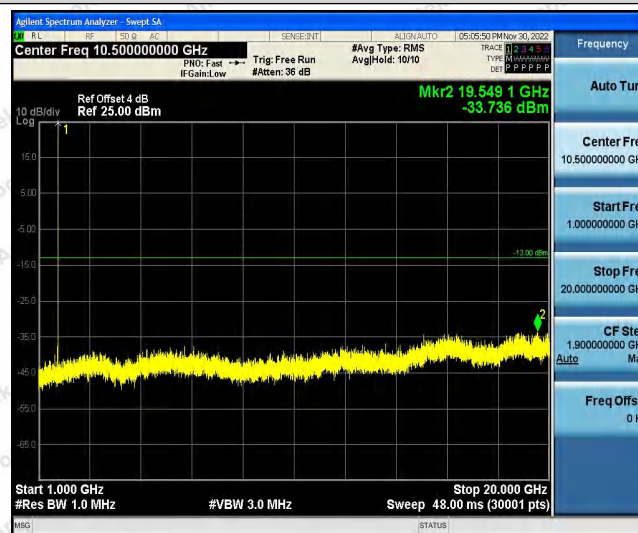

Band4-1.4MHz-QPSK-20175-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




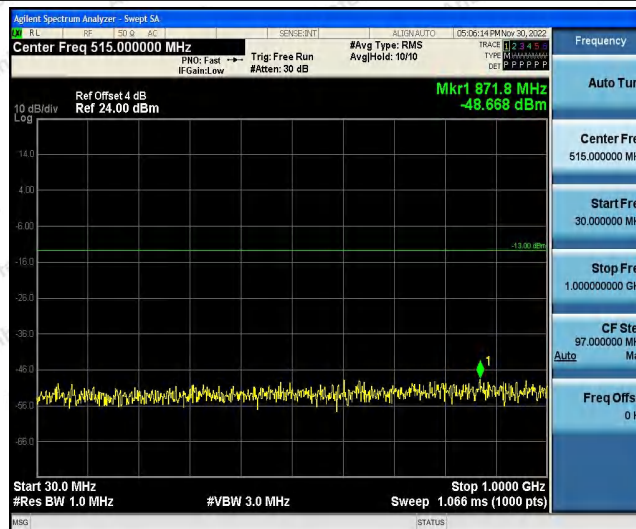

Band4-1.4MHz-QPSK-20175-1RB#0-Range2:1000~20000MHz

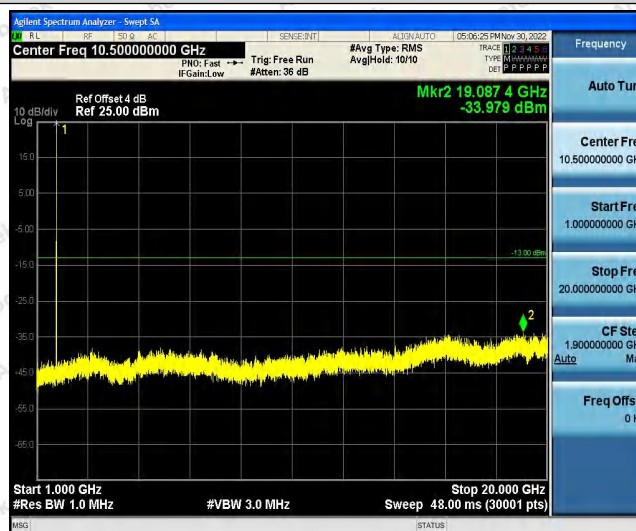

Band4-1.4MHz-QPSK-20393-1RB#0-Range1:30~1000MHz

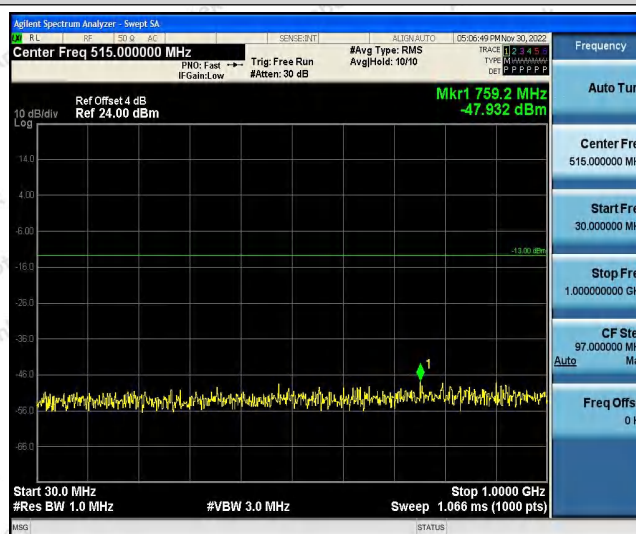

Band4-1.4MHz-QPSK-20393-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn





Band4-1.4MHz-16QAM-19957-1RB#0-Range1:30~1000MHz

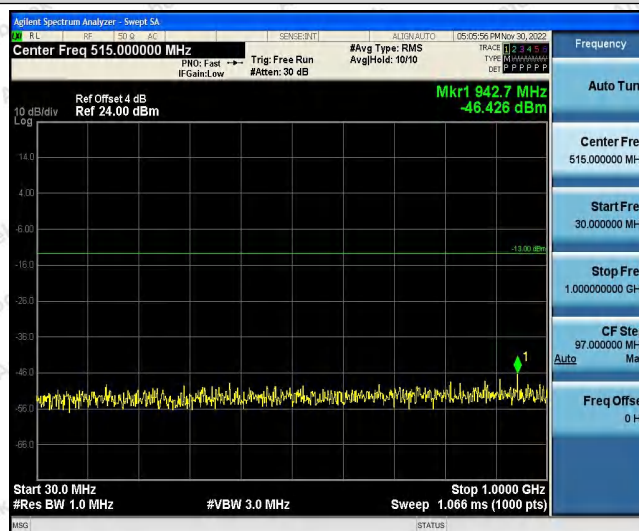

Band4-1.4MHz-16QAM-19957-1RB#0-Range2:1000~20000MHz



Band4-1.4MHz-16QAM-20175-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




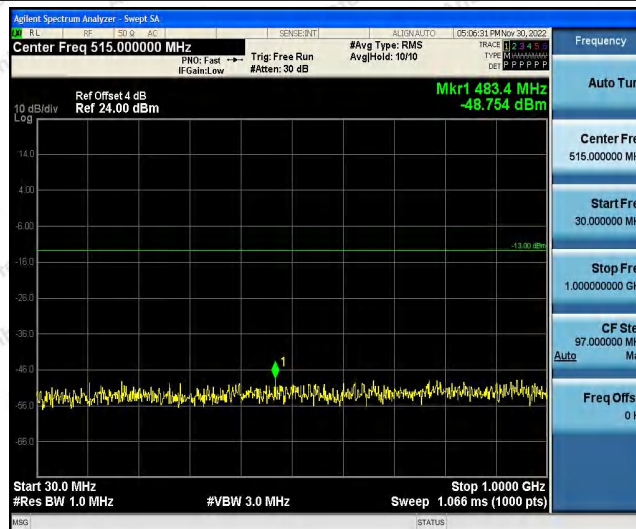

Band4-1.4MHz-16QAM-20175-1RB#0-Range2:1000~20000MHz

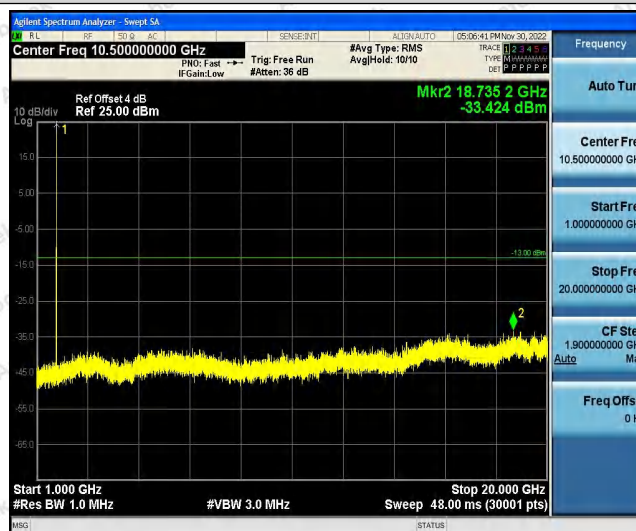

Band4-1.4MHz-16QAM-20393-1RB#0-Range1:30~1000MHz

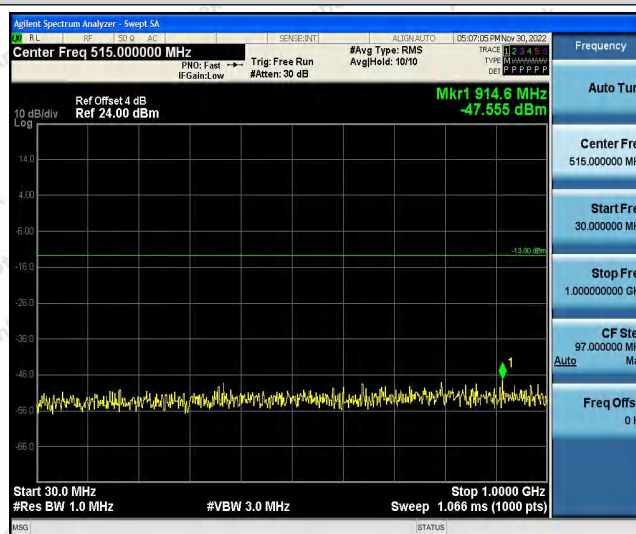

Band4-1.4MHz-16QAM-20393-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn





Band4-3MHz-QPSK-19965-1RB#0-Range1:30~1000MHz

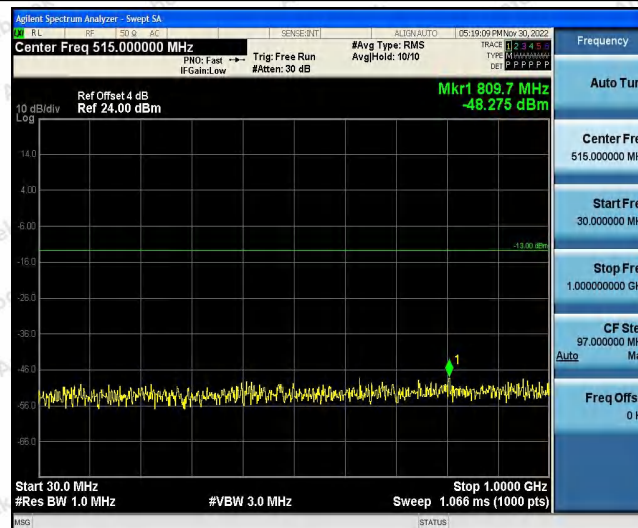

Band4-3MHz-QPSK-19965-1RB#0-Range2:1000~20000MHz



Band4-3MHz-QPSK-20175-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




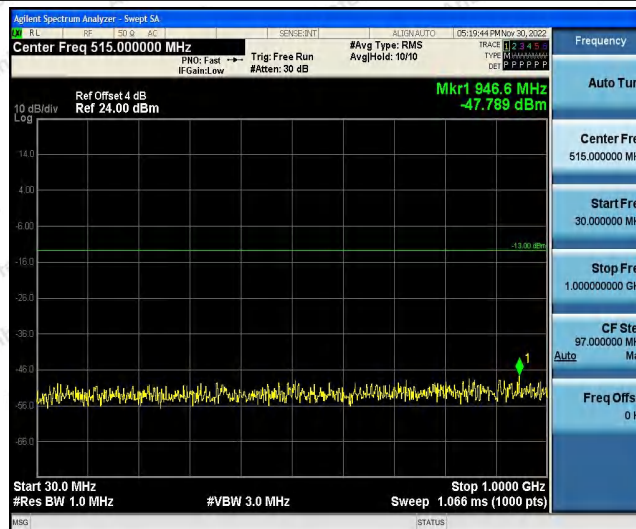

Band4-3MHz-QPSK-20175-1RB#0-Range2:1000~20000MHz

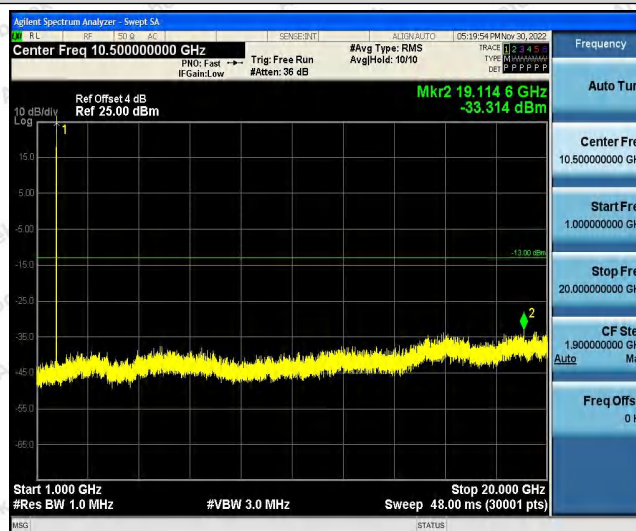

Band4-3MHz-QPSK-20385-1RB#0-Range1:30~1000MHz

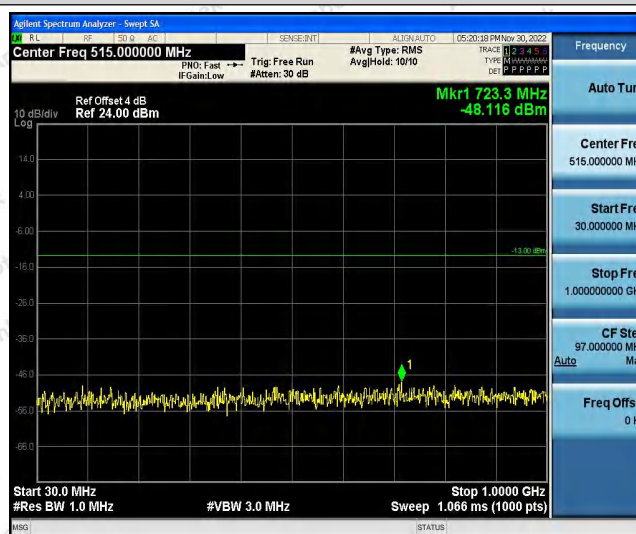

Band4-3MHz-QPSK-20385-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn





Band4-3MHz-16QAM-19965-1RB#0-Range1:30~1000MHz

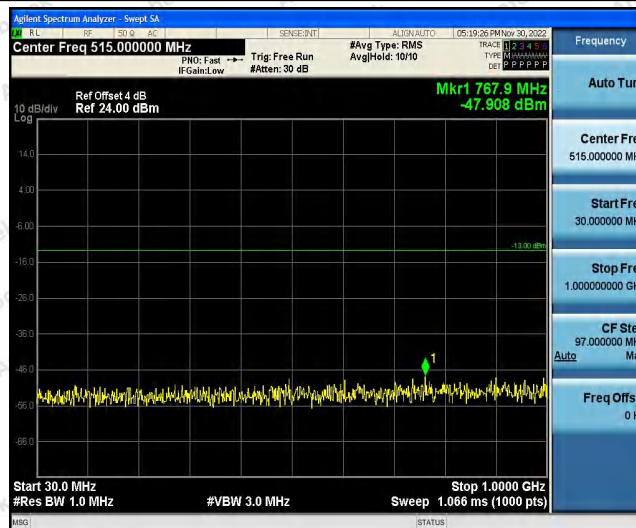


Band4-3MHz-16QAM-19965-1RB#0-Range2:1000~20000MHz




Band4-3MHz-16QAM-20175-1RB#0-Range1:30~1000MHz




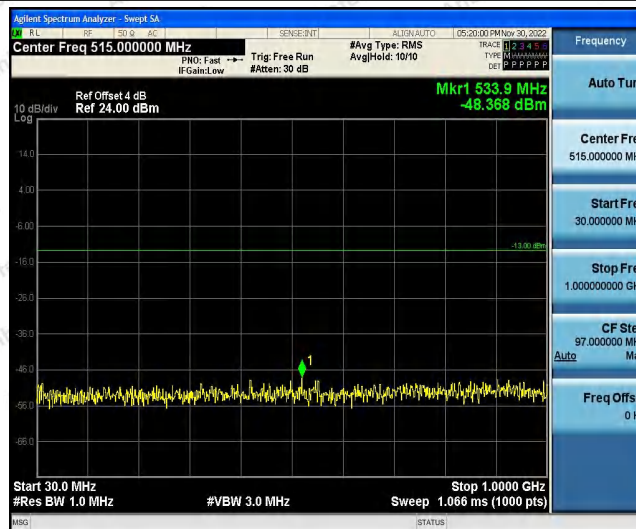

Band4-3MHz-16QAM-20175-1RB#0-Range2:1000~20000MHz

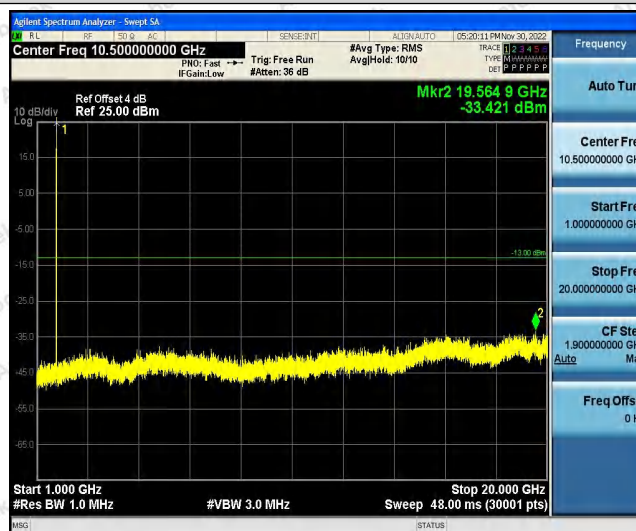

Band4-3MHz-16QAM-20385-1RB#0-Range1:30~1000MHz

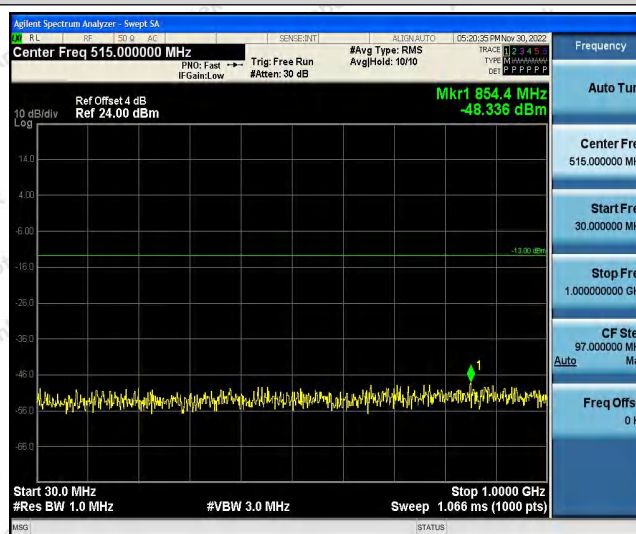

Band4-3MHz-16QAM-20385-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn






Band4-5MHz-QPSK-19975-1RB#0-Range1:30~1000MHz

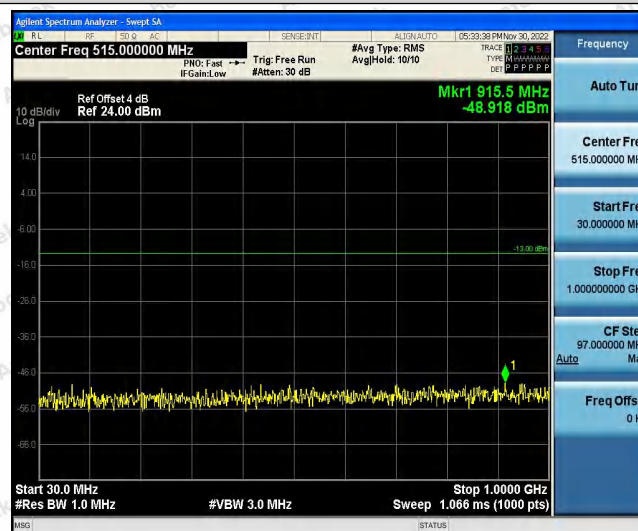

Band4-5MHz-QPSK-19975-1RB#0-Range2:1000~20000MHz

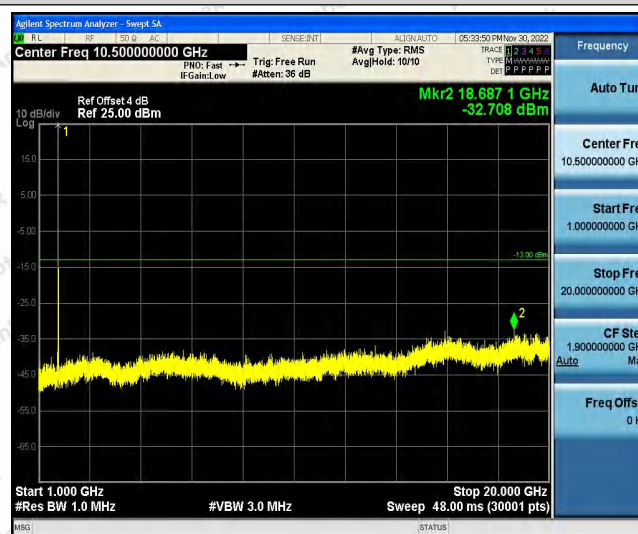

Band4-5MHz-QPSK-20175-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




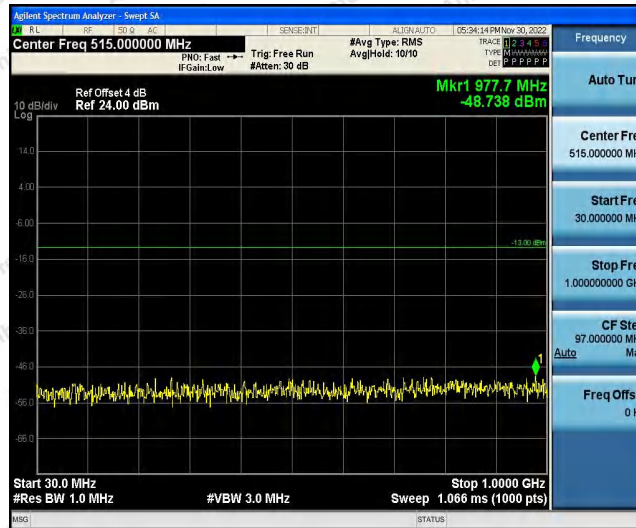

Band4-5MHz-QPSK-20175-1RB#0-Range2:1000~20000MHz

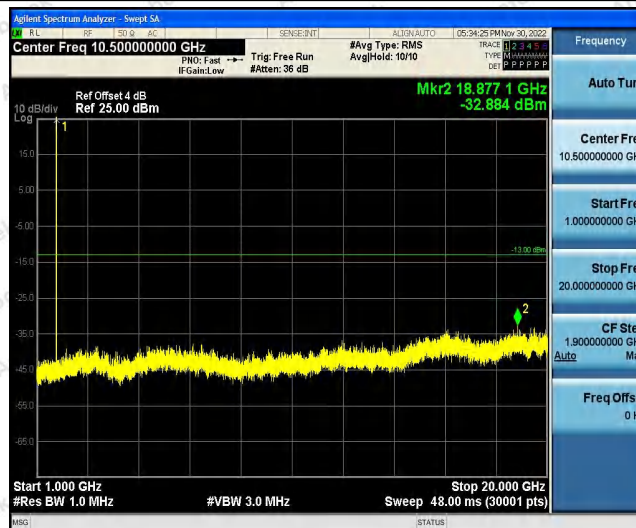

Band4-5MHz-QPSK-20375-1RB#0-Range1:30~1000MHz

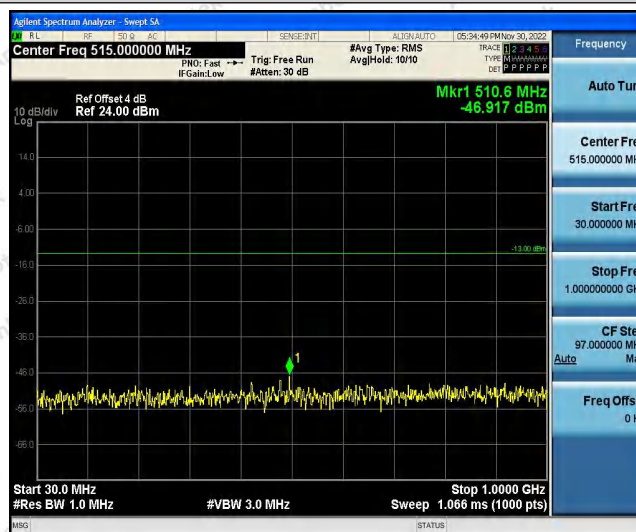

Band4-5MHz-QPSK-20375-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




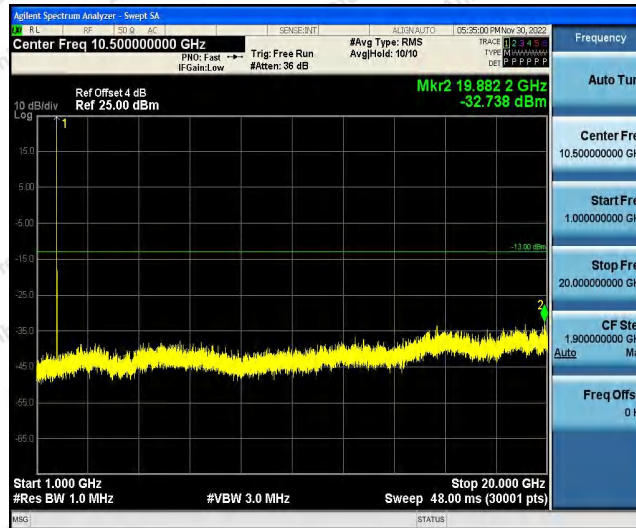

Band4-5MHz-16QAM-19975-1RB#0-Range1:30~1000MHz

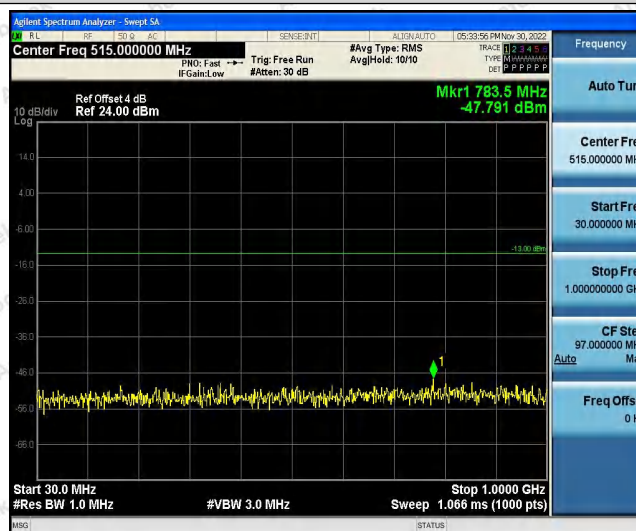

Band4-5MHz-16QAM-19975-1RB#0-Range2:1000~20000MHz

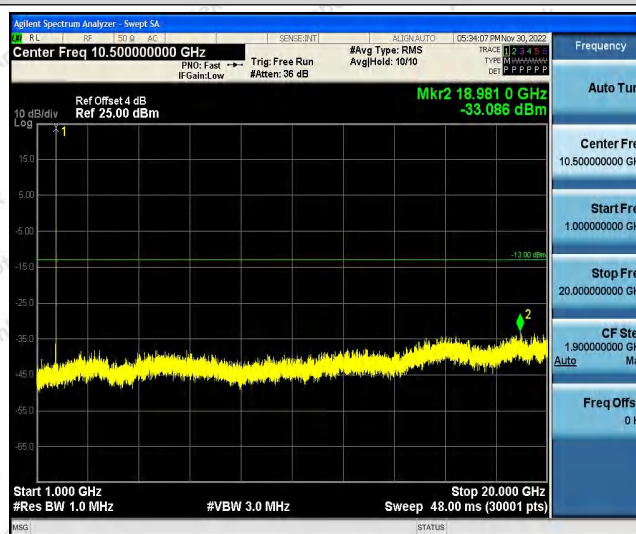

Band4-5MHz-16QAM-20175-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




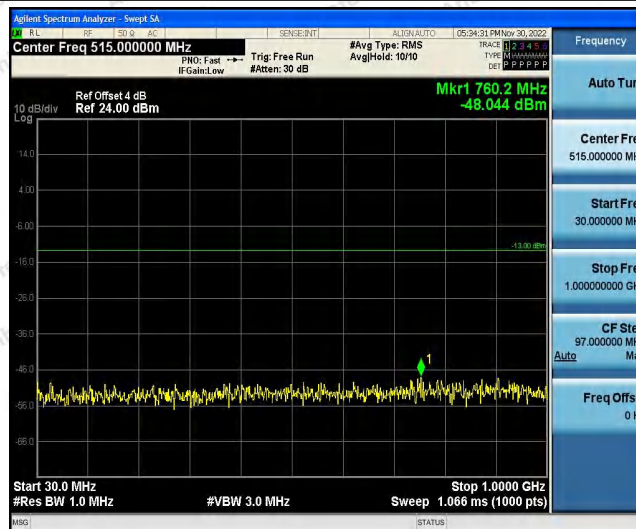

Band4-5MHz-16QAM-20175-1RB#0-Range2:1000~20000MHz

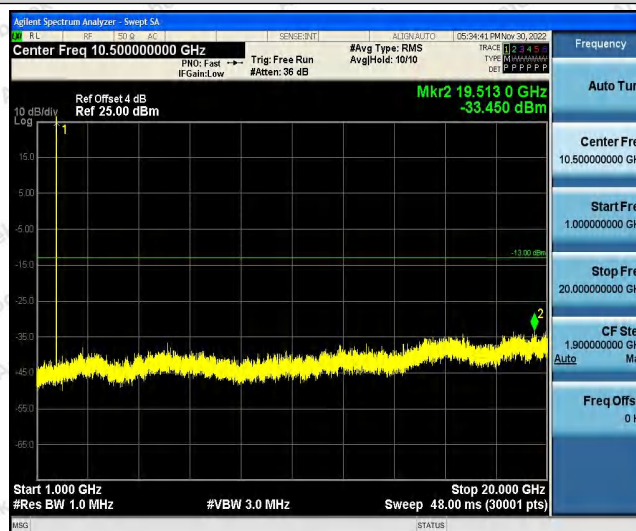

Band4-5MHz-16QAM-20375-1RB#0-Range1:30~1000MHz

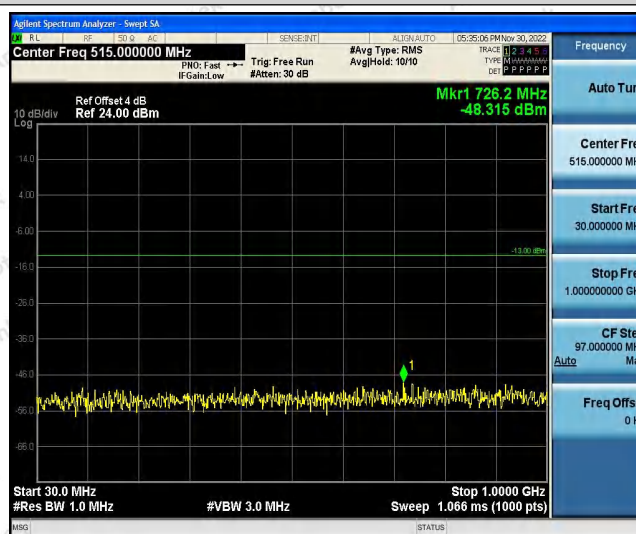

Band4-5MHz-16QAM-20375-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn






Band4-10MHz-QPSK-20000-1RB#0-Range1:30~1000MHz

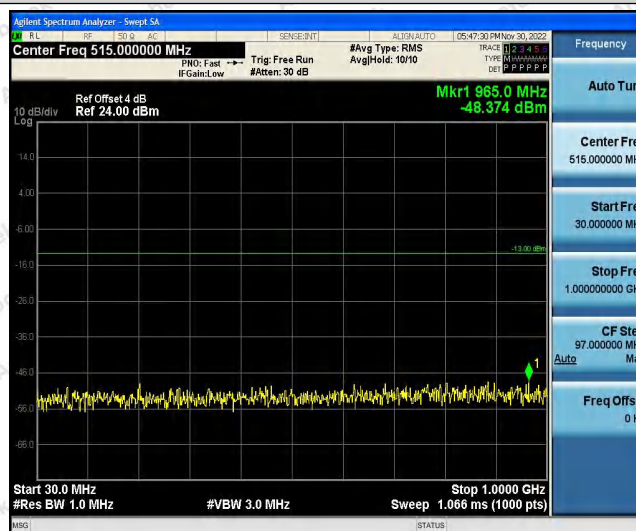


Band4-10MHz-QPSK-20000-1RB#0-Range2:1000~20000MHz

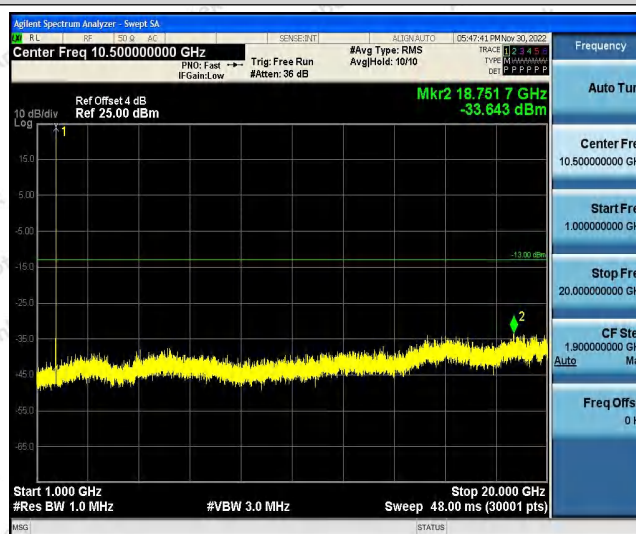


Band4-10MHz-QPSK-20175-1RB#0-Range1:30~1000MHz




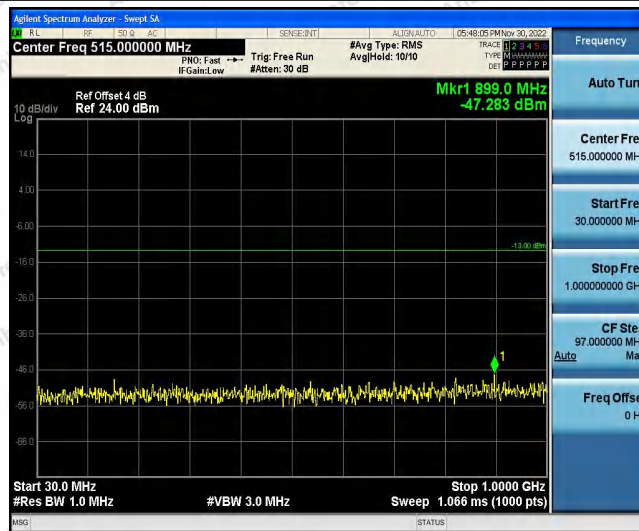

Band4-10MHz-QPSK-20175-1RB#0-Range2:1000~20000MHz

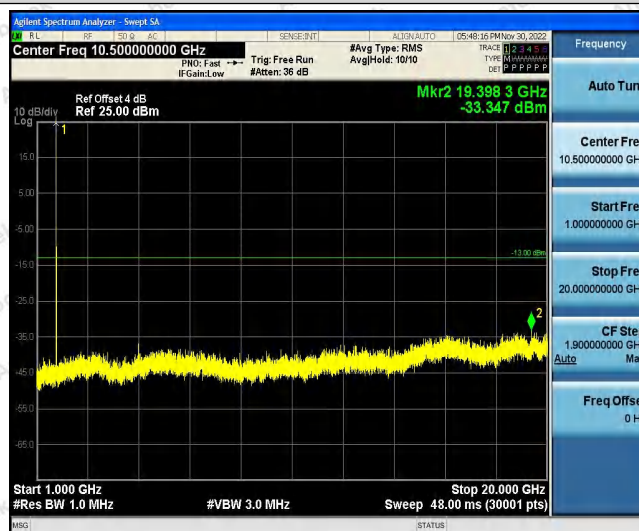

Band4-10MHz-QPSK-20350-1RB#0-Range1:30~1000MHz

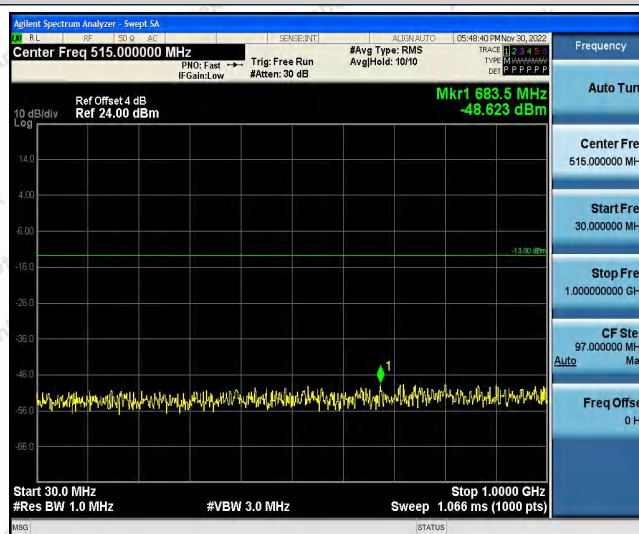

Band4-10MHz-QPSK-20350-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn



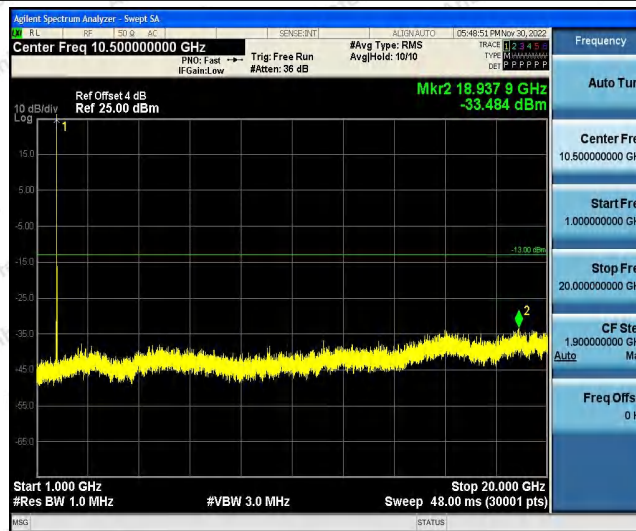

Band4-10MHz-16QAM-20000-1RB#0-Range1:30~1000MHz

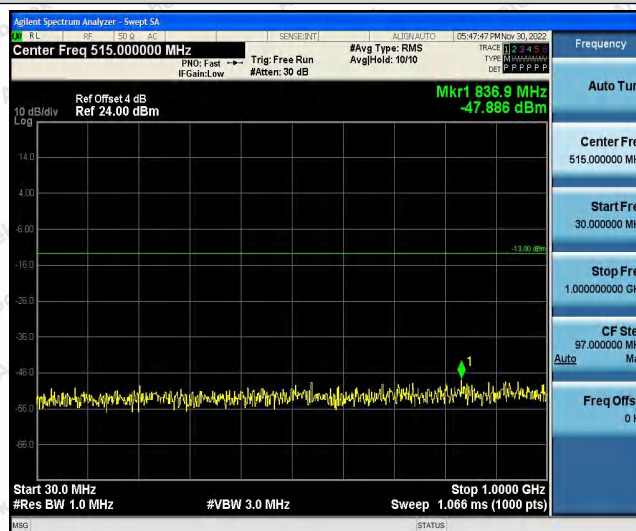

Band4-10MHz-16QAM-20000-1RB#0-Range2:1000~20000MHz



Band4-10MHz-16QAM-20175-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




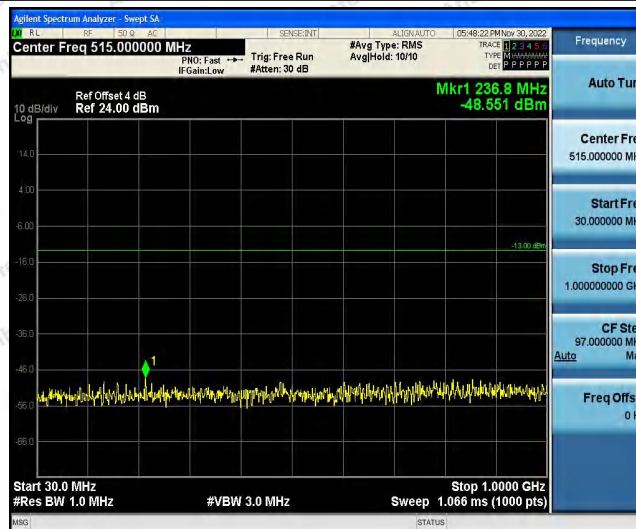

Band4-10MHz-16QAM-20175-1RB#0-Range2:1000~20000MHz

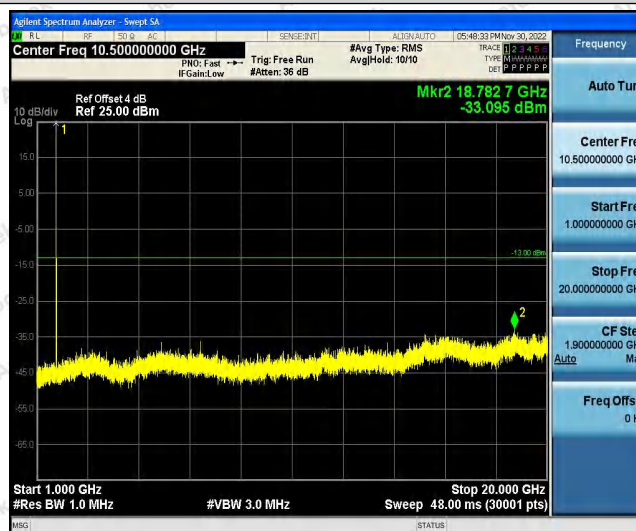

Band4-10MHz-16QAM-20350-1RB#0-Range1:30~1000MHz

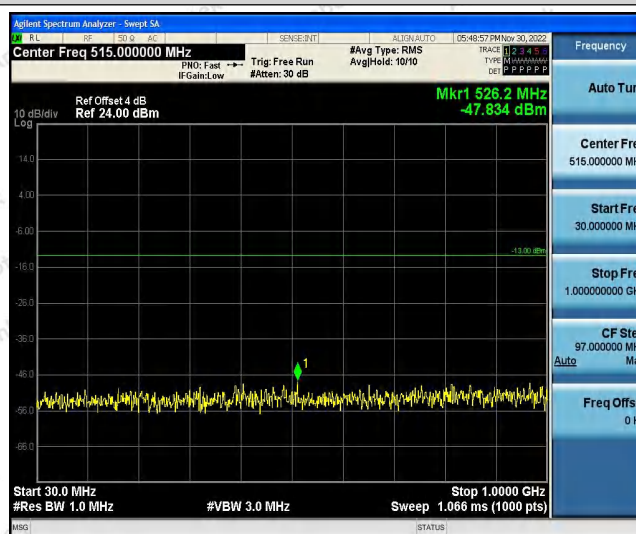

Band4-10MHz-16QAM-20350-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn






Band4-15MHz-QPSK-20025-1RB#0-Range1:30~1000MHz

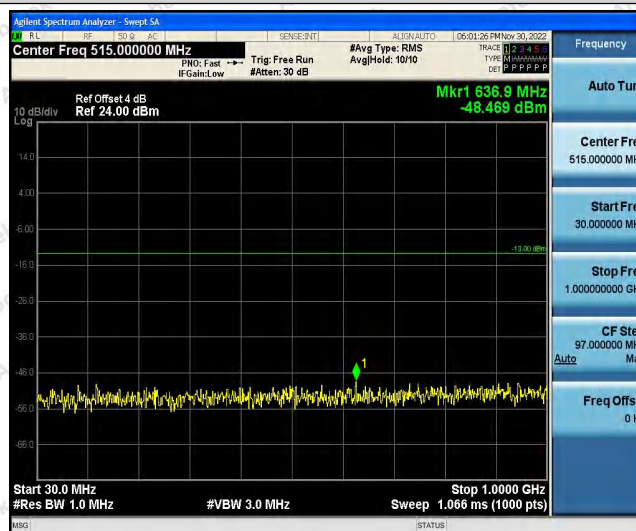

Band4-15MHz-QPSK-20025-1RB#0-Range2:1000~20000MHz

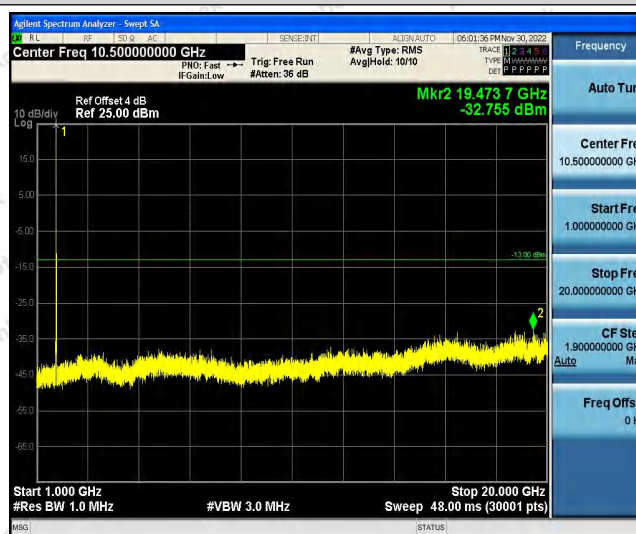

Band4-15MHz-QPSK-20175-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn




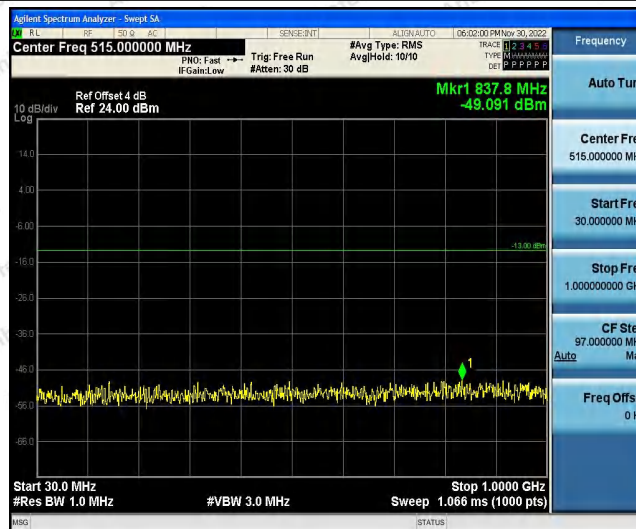

Band4-15MHz-QPSK-20175-1RB#0-Range2:1000~20000MHz



Band4-15MHz-QPSK-20325-1RB#0-Range1:30~1000MHz

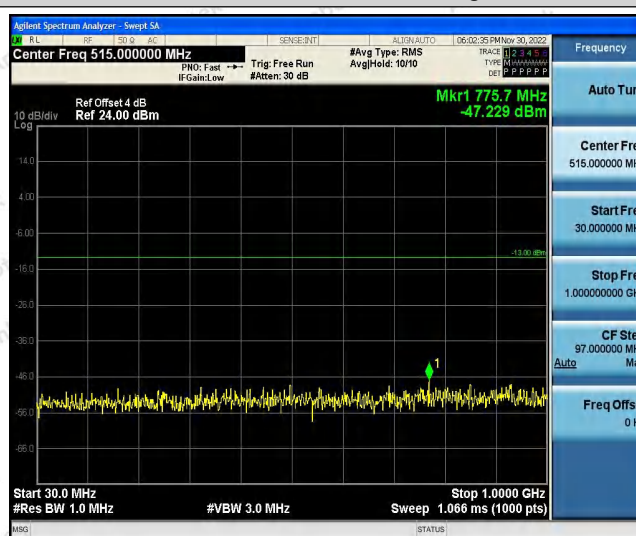


Band4-15MHz-QPSK-20325-1RB#0-Range2:1000~20000MHz






Band4-15MHz-16QAM-20025-1RB#0-Range1:30~1000MHz

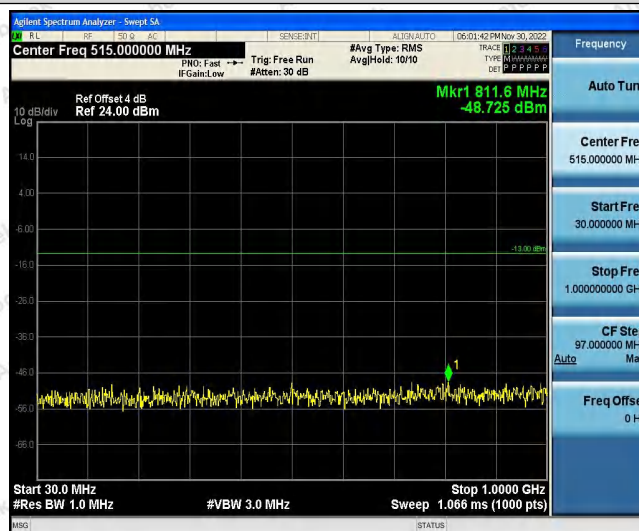

Band4-15MHz-16QAM-20025-1RB#0-Range2: 1000~20000MHz

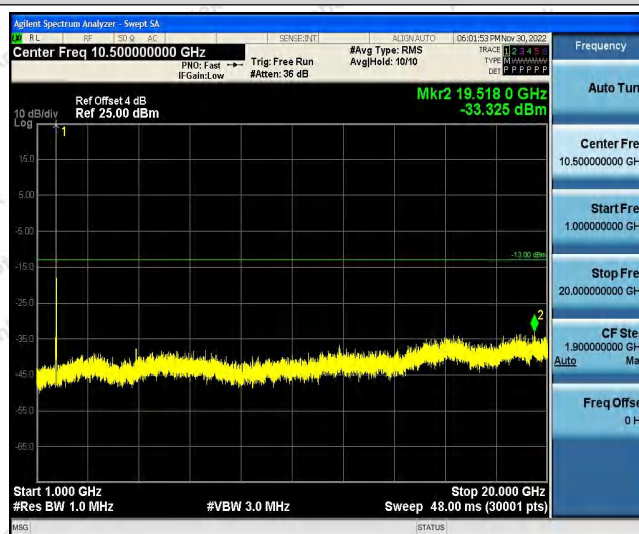

Band4-15MHz-16QAM-20175-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




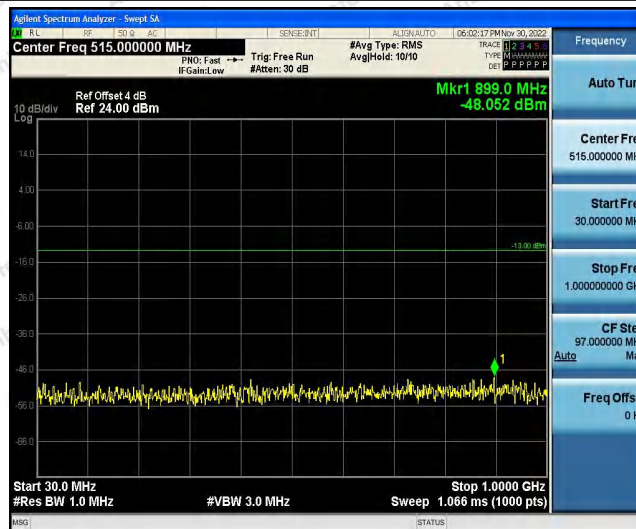

Band4-15MHz-16QAM-20175-1RB#0-Range2:1000~20000MHz

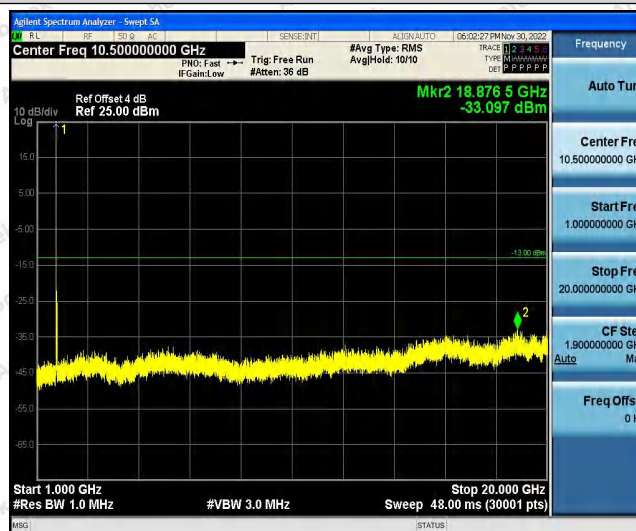

Band4-15MHz-16QAM-20325-1RB#0-Range1:30~1000MHz

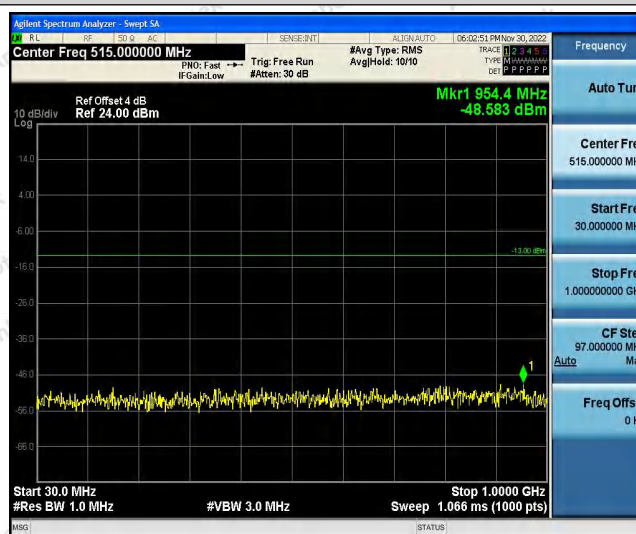

Band4-15MHz-16QAM-20325-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn






Band4-20MHz-QPSK-20050-1RB#0-Range1:30~1000MHz

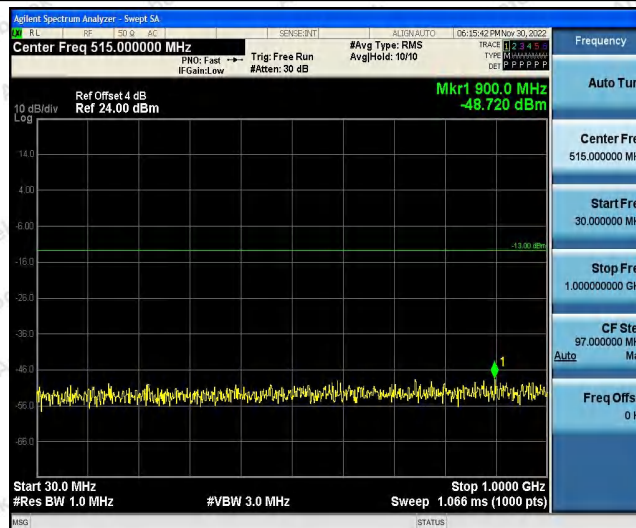


Band4-20MHz-QPSK-20050-1RB#0-Range2:1000~20000MHz

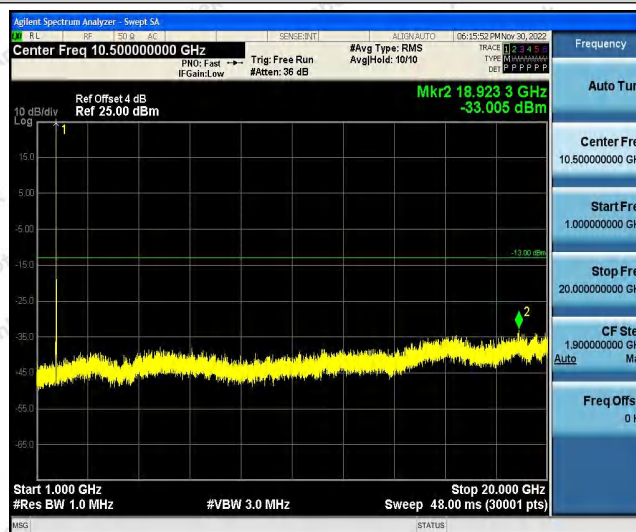


Band4-20MHz-QPSK-20175-1RB#0-Range1:30~1000MHz




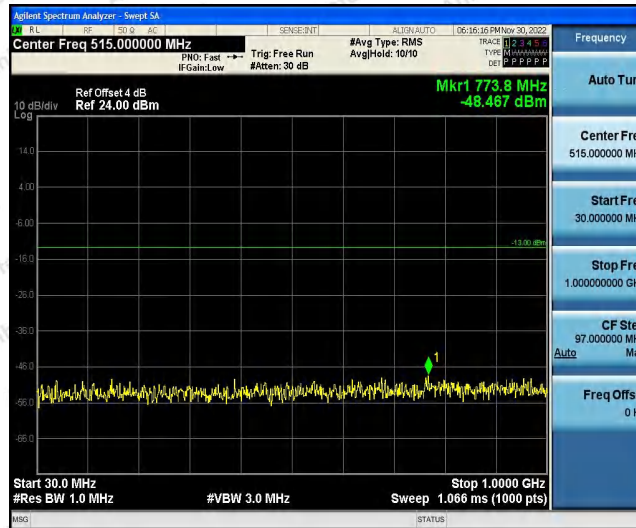

Band4-20MHz-QPSK-20175-1RB#0-Range2:1000~20000MHz

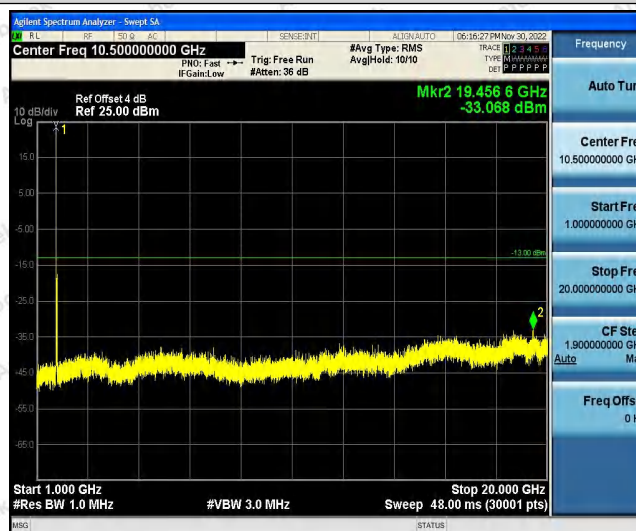

Band4-20MHz-QPSK-20300-1RB#0-Range1:30~1000MHz

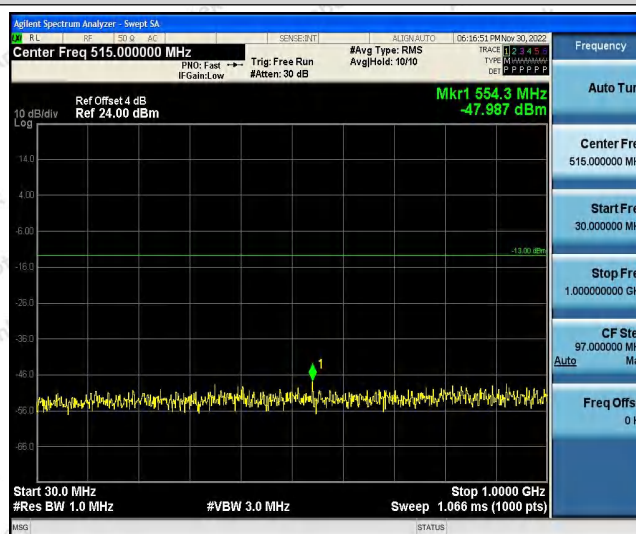

Band4-20MHz-QPSK-20300-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn





Band4-20MHz-16QAM-20050-1RB#0-Range1:30~1000MHz

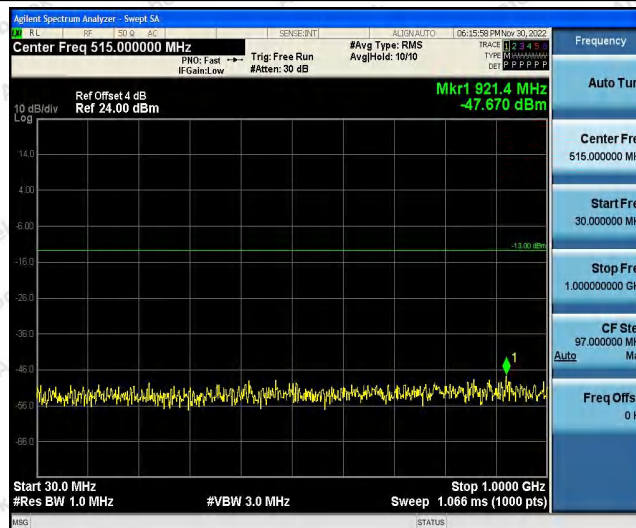

Band4-20MHz-16QAM-20050-1RB#0-Range2:1000~20000MHz



Band4-20MHz-16QAM-20175-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




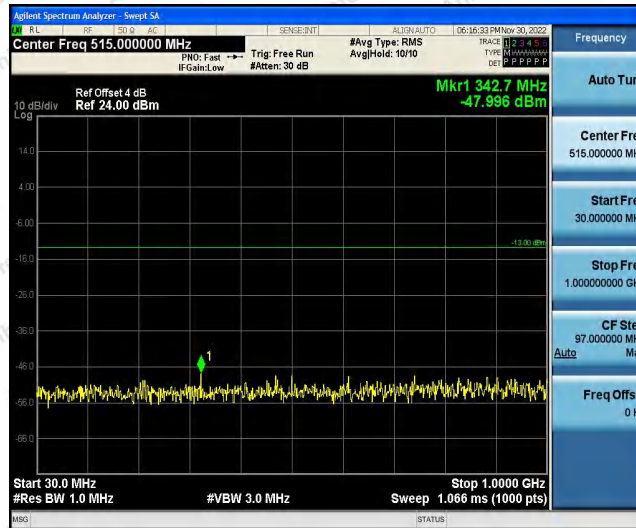

Band4-20MHz-16QAM-20175-1RB#0-Range2:1000~20000MHz

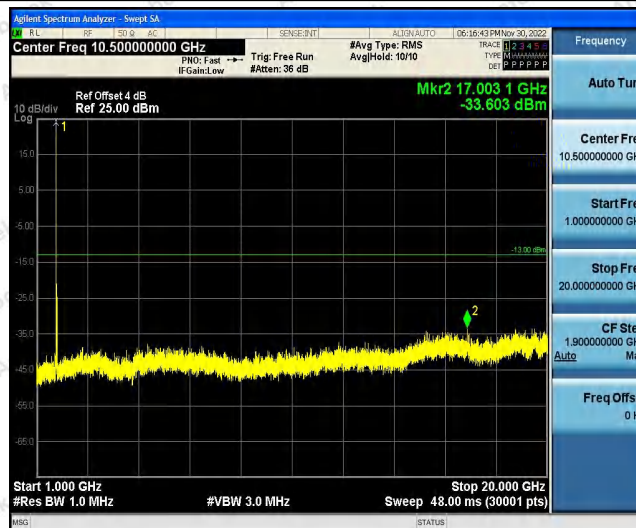

Band4-20MHz-16QAM-20300-1RB#0-Range1:30~1000MHz

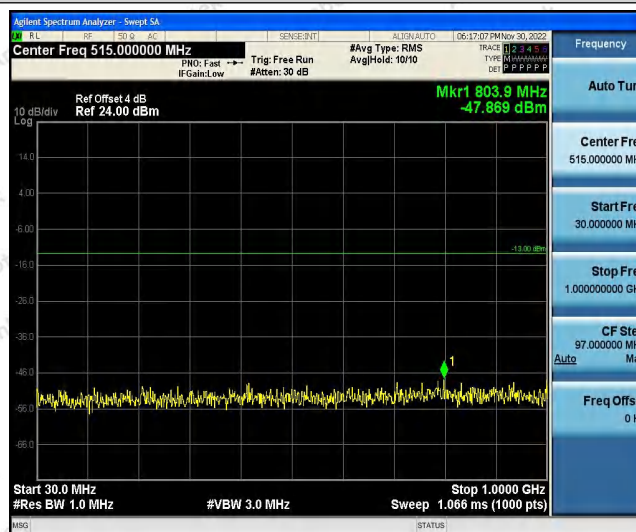

Band4-20MHz-16QAM-20300-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn

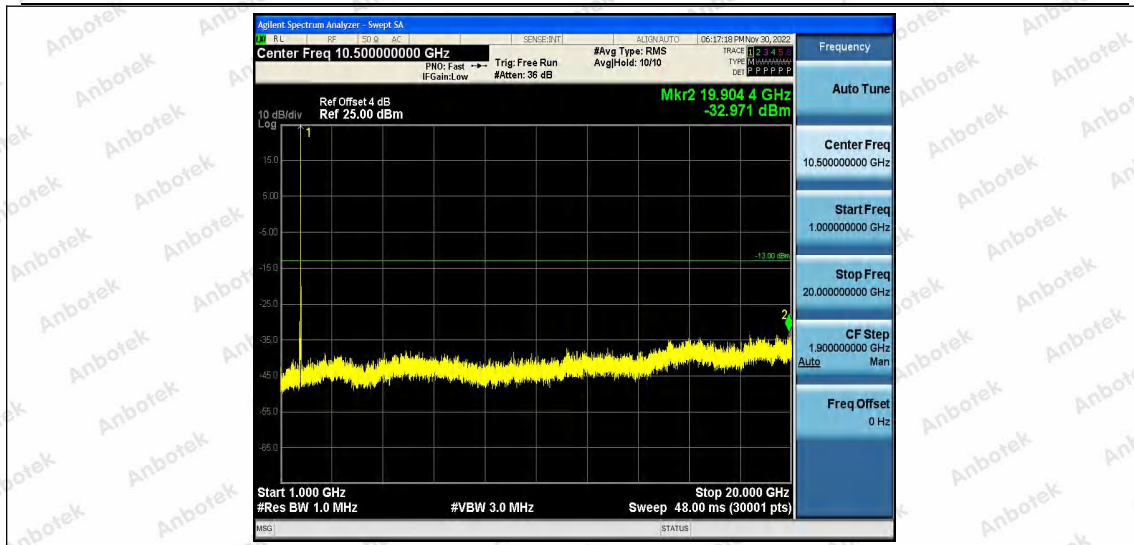

**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Appendix F: Frequency stability VS Voltage measurement

Test Result

Band	Bandwidth	Modulation	Channel	RB Configure	Voltage					
					Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band4	1.4MHz	QPSK	19957	6RB#0	VL	NT	-7.31	-0.004273	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	VN	NT	3.99	0.002332	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	VH	NT	-8.44	-0.004934	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	VL	NT	-2.79	-0.001610	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	VN	NT	11.04	0.006372	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	VH	NT	-3.25	-0.001876	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	VL	NT	-5.36	-0.003055	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	VN	NT	4.63	0.002639	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	VH	NT	-7.98	-0.004549	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	VL	NT	-8.37	-0.004893	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	VN	NT	-7.61	-0.004448	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	VH	NT	-3.25	-0.001900	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	VL	NT	-5.28	-0.003048	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	VN	NT	-8.81	-0.005085	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	VH	NT	-4.29	-0.002476	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	VL	NT	-7.75	-0.004418	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	VN	NT	-4.56	-0.002599	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	VH	NT	-3.10	-0.001767	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	VL	NT	-8.05	-0.004703	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	VN	NT	-2.62	-0.001531	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	VH	NT	-8.28	-0.004838	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	VL	NT	-4.36	-0.002517	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	VN	NT	6.79	0.003919	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	VH	NT	-3.88	-0.002240	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	VL	NT	-7.50	-0.004277	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	VN	NT	-4.94	-0.002817	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	VH	NT	-10.81	-0.006165	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	VL	NT	-4.08	-0.002384	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	VN	NT	-6.55	-0.003827	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	VH	NT	-2.85	-0.001665	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	VL	NT	-3.60	-0.002078	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	VN	NT	-3.79	-0.002188	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	VH	NT	2.92	0.001685	±2.5	PASS



Band4	3MHz	16QAM	20385	15RB#0	VL	NT	-6.55	-0.003735	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	VN	NT	-12.62	-0.007197	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	VH	NT	-9.17	-0.005230	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	VL	NT	-11.10	-0.006482	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	VN	NT	4.05	0.002365	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	VH	NT	-10.64	-0.006213	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	VL	NT	-6.41	-0.003700	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	VN	NT	3.53	0.002038	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	VH	NT	-5.94	-0.003429	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	VL	NT	-13.20	-0.007532	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	VN	NT	-4.28	-0.002442	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	VH	NT	-12.75	-0.007275	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	VL	NT	-10.70	-0.006248	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	VN	NT	-9.04	-0.005279	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	VH	NT	-7.48	-0.004368	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	VL	NT	-5.29	-0.003053	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	VN	NT	-6.01	-0.003469	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	VH	NT	-3.39	-0.001957	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	VL	NT	-10.96	-0.006254	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	VN	NT	-10.13	-0.005780	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	VH	NT	-13.98	-0.007977	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	VL	NT	-13.70	-0.007988	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	VN	NT	-9.90	-0.005773	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	VH	NT	-6.77	-0.003948	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	VL	NT	-2.96	-0.001709	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	VN	NT	5.69	0.003284	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	VH	NT	-8.75	-0.005051	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	VL	NT	-7.38	-0.004217	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	VN	NT	7.14	0.004080	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	VH	NT	-10.83	-0.006189	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	VL	NT	-10.67	-0.006222	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	VN	NT	-5.14	-0.002997	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	VH	NT	-7.41	-0.004321	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	VL	NT	-5.01	-0.002892	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	VN	NT	-8.24	-0.004756	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	VH	NT	-3.60	-0.002078	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	VL	NT	-8.00	-0.004571	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	VN	NT	-8.63	-0.004931	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	VH	NT	-5.09	-0.002909	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	VL	NT	-8.54	-0.004972	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	VN	NT	-7.28	-0.004239	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com.cn



Band4	15MHz	QPSK	20025	75RB#0	VH	NT	-11.03	-0.006422	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	VL	NT	-7.38	-0.004260	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	VN	NT	-9.28	-0.005356	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	VH	NT	-4.72	-0.002724	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	VL	NT	-6.41	-0.003668	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	VN	NT	2.47	0.001413	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	VH	NT	-12.59	-0.007205	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	VL	NT	-9.81	-0.005712	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	VN	NT	-9.70	-0.005648	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	VH	NT	-5.18	-0.003016	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	VL	NT	-4.66	-0.002690	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	VN	NT	-8.83	-0.005097	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	VH	NT	-4.96	-0.002863	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	VL	NT	-8.74	-0.005001	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	VN	NT	-12.70	-0.007268	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	VH	NT	-9.66	-0.005528	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	VL	NT	-8.40	-0.004884	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	VN	NT	-8.85	-0.005145	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	VH	NT	-8.81	-0.005122	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	VL	NT	-6.08	-0.003509	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	VN	NT	-4.49	-0.002592	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	VH	NT	-3.45	-0.001991	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	VL	NT	-7.94	-0.004550	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	VN	NT	5.54	0.003175	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	VH	NT	-6.75	-0.003868	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	VL	NT	-5.29	-0.003076	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	VN	NT	-11.50	-0.006686	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	VH	NT	-9.43	-0.005483	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	VL	NT	-5.45	-0.003146	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	VN	NT	6.02	0.003475	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	VH	NT	-3.18	-0.001835	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	VL	NT	-5.74	-0.003289	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	VN	NT	-5.59	-0.003203	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	VH	NT	3.46	0.001983	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com.cn



Appendix G: Frequency stability VS Temperature measurement

Test Result

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configure	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band4	1.4MHz	QPSK	19957	6RB#0	NV	-30	-4.28	-0.002502	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	-20	-4.15	-0.002426	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	0	-12.77	-0.007465	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	10	-11.07	-0.006471	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	20	-5.19	-0.003034	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	-30	-5.45	-0.003146	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	-20	-8.01	-0.004623	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	0	4.29	0.002476	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	10	-5.66	-0.003267	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	20	-3.52	-0.002032	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	-30	-6.45	-0.003677	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	-20	-7.38	-0.004207	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	0	5.16	0.002941	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	10	-9.11	-0.005193	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	20	-6.97	-0.003973	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	-30	-5.09	-0.002975	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	-20	-4.85	-0.002835	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	0	-5.35	-0.003127	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	10	-4.66	-0.002724	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	20	-5.46	-0.003192	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	-30	-8.10	-0.004675	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	-20	-6.52	-0.003763	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	0	-9.88	-0.005703	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	10	-9.36	-0.005403	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	20	-6.77	-0.003908	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	-30	2.29	0.001305	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	-20	-3.73	-0.002126	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	0	-4.48	-0.002554	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	10	-9.60	-0.005472	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	20	-4.21	-0.002400	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	-30	-8.04	-0.004698	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	-20	-6.98	-0.004078	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	0	-3.93	-0.002296	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	10	-6.48	-0.003786	±2.5	PASS



Band4	3MHz	QPSK	19965	15RB#0	NV	20	-6.38	-0.003728	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	-30	-3.33	-0.001922	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	-20	-5.42	-0.003128	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	0	3.42	0.001974	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	10	-2.15	-0.001241	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	20	-7.42	-0.004283	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	-30	-13.19	-0.007522	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	-20	-9.81	-0.005595	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	0	-8.51	-0.004853	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	10	-7.71	-0.004397	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	20	-9.18	-0.005235	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	-30	-3.99	-0.002331	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	-20	-4.85	-0.002834	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	0	-5.74	-0.003354	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	10	-5.61	-0.003278	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	20	-6.28	-0.003669	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	-30	5.12	0.002955	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	-20	-3.85	-0.002222	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	0	-4.66	-0.002690	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	10	-5.12	-0.002955	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	20	-7.85	-0.004531	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	-30	-9.78	-0.005577	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	-20	-12.29	-0.007009	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	0	-12.75	-0.007271	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	10	-12.42	-0.007083	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	20	-7.11	-0.004055	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	-30	-7.87	-0.004596	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	-20	-11.89	-0.006943	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	0	-10.16	-0.005933	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	10	-11.90	-0.006949	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	20	-14.56	-0.008502	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	-30	-4.08	-0.002355	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	-20	-8.50	-0.004906	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	0	-2.88	-0.001662	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	10	3.50	0.002020	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	20	-3.71	-0.002141	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	-30	-8.80	-0.005021	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	-20	-10.87	-0.006203	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	0	-11.66	-0.006653	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	10	-11.17	-0.006374	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	20	-12.77	-0.007287	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band4	5MHz	16QAM	19975	25RB#0	NV	-30	-6.48	-0.003784	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	-20	-7.60	-0.004438	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	0	-5.22	-0.003048	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	10	-10.31	-0.006020	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	20	-7.08	-0.004134	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	-30	3.02	0.001743	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	-20	-5.85	-0.003377	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	0	-5.56	-0.003209	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	10	2.62	0.001512	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	20	-7.25	-0.004185	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	-30	-13.05	-0.007447	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	-20	-9.61	-0.005484	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	0	-8.81	-0.005027	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	10	-4.72	-0.002693	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	20	-6.62	-0.003777	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	-30	-6.12	-0.003569	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	-20	-11.37	-0.006630	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	0	-15.62	-0.009108	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	10	-9.21	-0.005370	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	20	-6.97	-0.004064	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	-30	-6.87	-0.003965	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	-20	-7.22	-0.004167	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	0	-7.18	-0.004144	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	10	-6.22	-0.003590	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	20	-4.22	-0.002436	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	-30	-10.49	-0.005994	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	-20	-9.67	-0.005526	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	0	-9.87	-0.005640	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	10	-7.78	-0.004446	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	20	-9.03	-0.005160	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	-30	-4.81	-0.002805	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	-20	-4.38	-0.002554	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	0	-9.14	-0.005329	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	10	-7.10	-0.004140	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	20	-7.87	-0.004589	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	-30	3.92	0.002263	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	-20	-7.25	-0.004185	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	0	-6.27	-0.003619	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	10	-5.45	-0.003146	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	20	-9.58	-0.005530	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	-30	-9.93	-0.005674	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band4	10MHz	16QAM	20350	50RB#0	NV	-20	-8.24	-0.004709	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	0	-5.51	-0.003149	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	10	-6.77	-0.003869	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	20	-2.95	-0.001686	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	-30	-7.41	-0.004314	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	-20	-8.57	-0.004990	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	0	-7.18	-0.004180	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	10	-11.66	-0.006789	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	20	-9.43	-0.005491	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	-30	-7.50	-0.004329	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	-20	-8.50	-0.004906	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	0	-6.61	-0.003815	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	10	-9.47	-0.005466	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	20	-8.18	-0.004722	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	-30	-10.19	-0.005831	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	-20	-10.19	-0.005831	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	0	-9.10	-0.005207	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	10	-7.31	-0.004183	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	20	-12.20	-0.006981	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	-30	-9.07	-0.005281	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	-20	-6.41	-0.003732	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	0	-8.70	-0.005066	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	10	-8.24	-0.004798	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	20	-10.54	-0.006137	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	-30	-7.91	-0.004566	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	-20	-7.84	-0.004525	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	0	-8.34	-0.004814	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	10	-5.11	-0.002949	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	20	-3.73	-0.002153	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	-30	-10.89	-0.006232	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	-20	-11.69	-0.006690	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	0	-7.48	-0.004280	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	10	-10.69	-0.006117	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	20	-8.94	-0.005116	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	-30	-11.43	-0.006645	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	-20	-12.00	-0.006977	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	0	-9.86	-0.005733	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	10	-8.24	-0.004791	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	20	-8.51	-0.004948	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	-30	-6.11	-0.003527	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	-20	-6.08	-0.003509	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
www.anbotek.com.cn



Band4	20MHz	QPSK	20175	100RB#0	NV	0	-8.83	-0.005097	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	10	-6.14	-0.003544	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	20	-8.44	-0.004872	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	-30	-6.82	-0.003908	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	-20	-8.01	-0.004590	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	0	-7.61	-0.004361	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	10	-5.08	-0.002911	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	20	-8.23	-0.004716	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	-30	-9.26	-0.005384	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	-20	-5.76	-0.003349	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	0	-8.93	-0.005192	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	10	-10.33	-0.006006	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	20	-3.96	-0.002302	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	-30	-5.91	-0.003411	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	-20	-5.04	-0.002909	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	0	-5.46	-0.003152	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	10	-5.49	-0.003169	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	20	-3.13	-0.001807	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	-30	3.10	0.001777	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	-20	-4.09	-0.002344	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	0	-4.43	-0.002539	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	10	5.18	0.002968	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	20	-8.80	-0.005043	±2.5	PASS

---End---

