




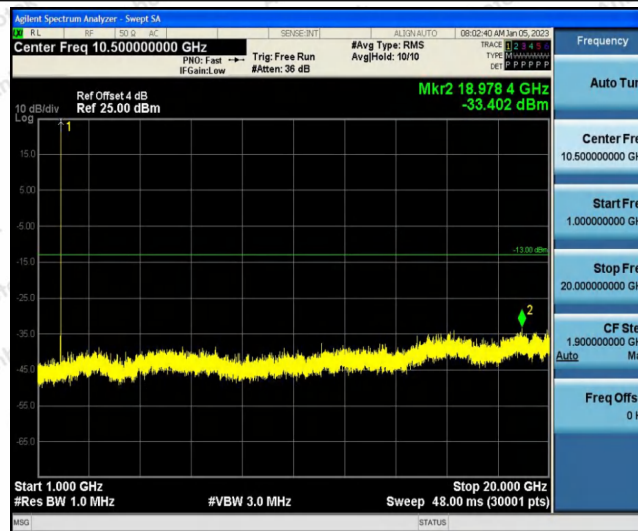

Band2-1.4MHz-QPSK-18900-1RB#0-Range1:30~1000MHz

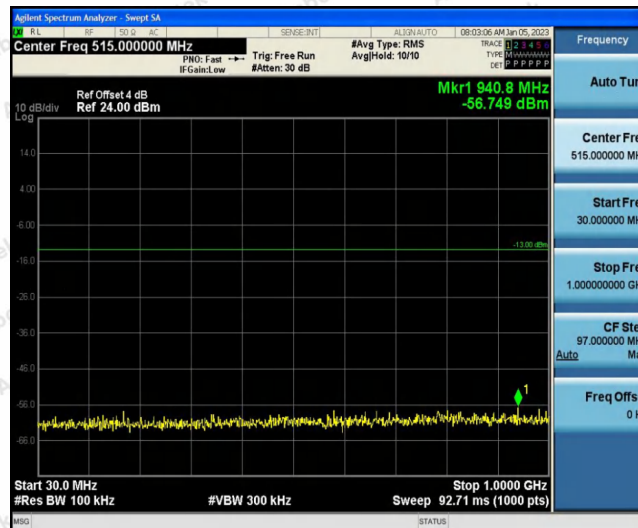

Band2-1.4MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz

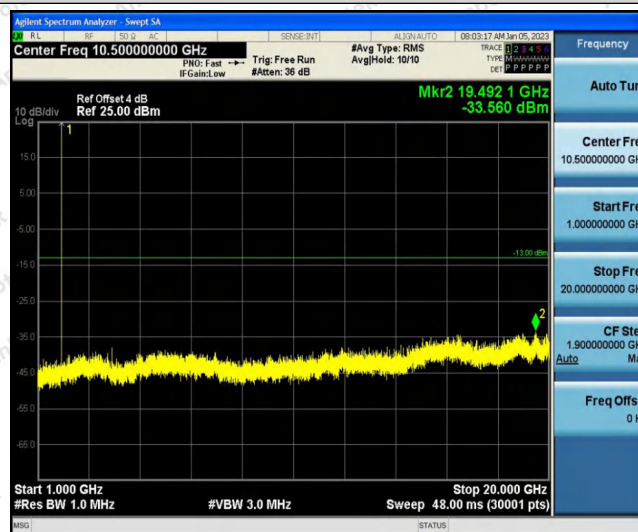

Band2-1.4MHz-QPSK-19193-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




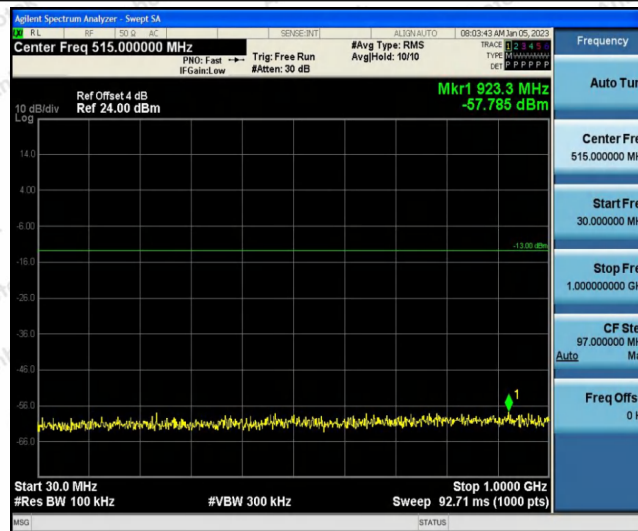

Band2-1.4MHz-QPSK-19193-1RB#0-Range2:1000~20000MHz

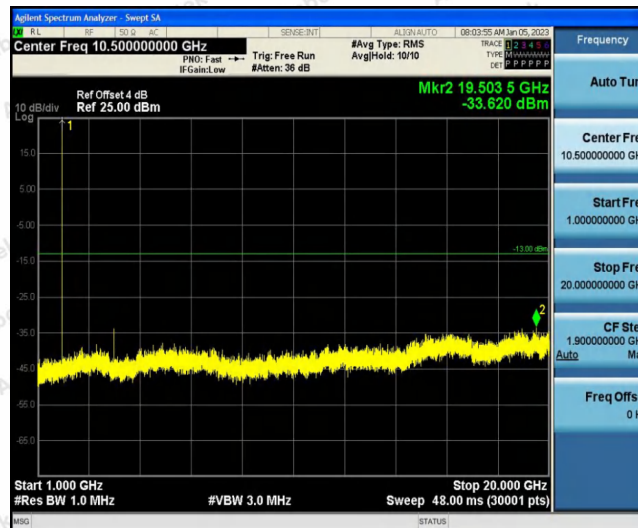

Band2-1.4MHz-16QAM-18607-1RB#0-Range1:30~1000MHz

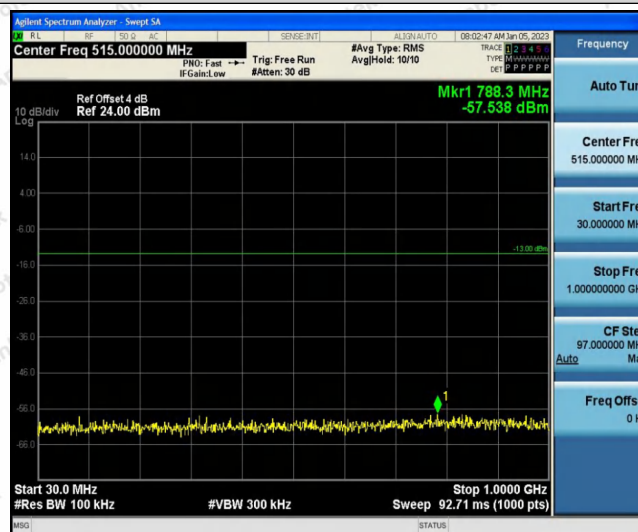

Band2-1.4MHz-16QAM-18607-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




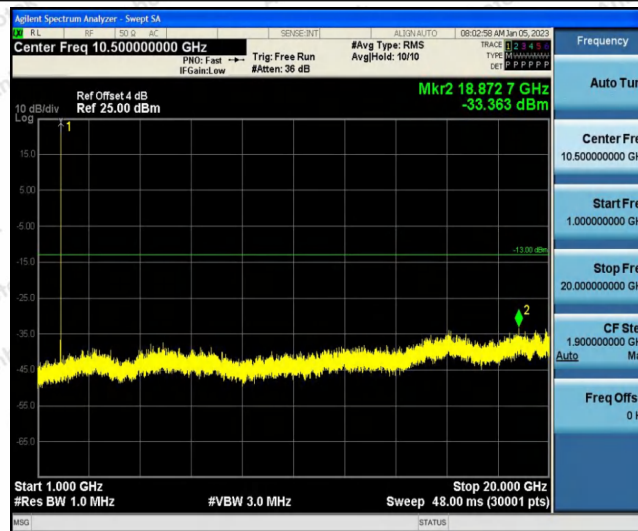

Band2-1.4MHz-16QAM-18900-1RB#0-Range1:30~1000MHz

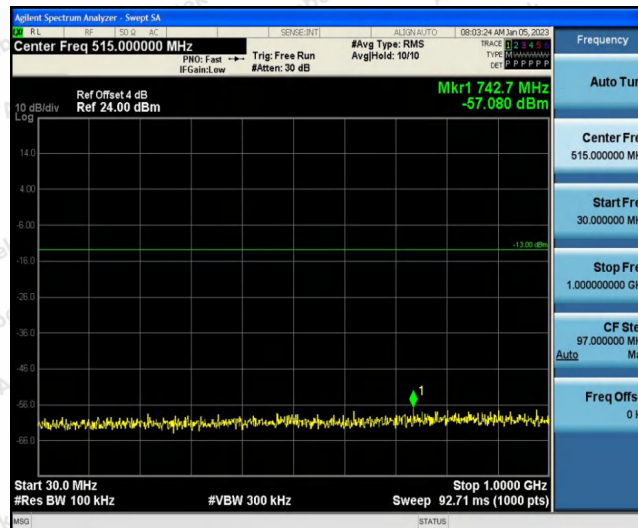

Band2-1.4MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz

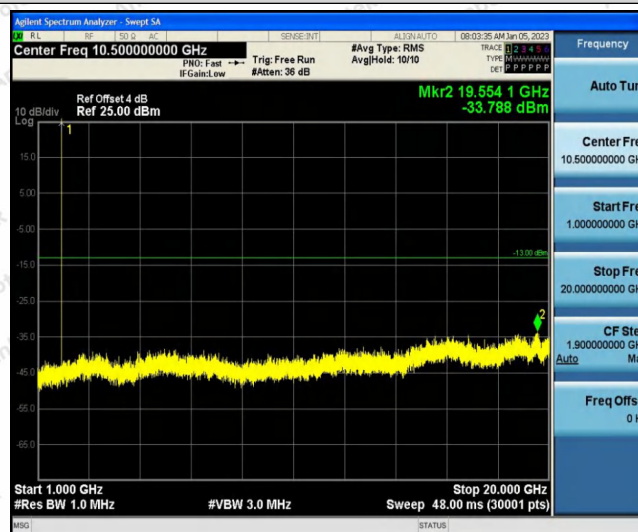

Band2-1.4MHz-16QAM-19193-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




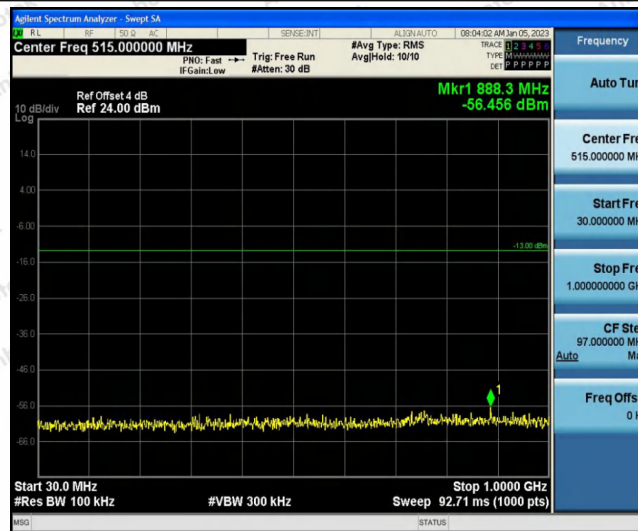

Band2-1.4MHz-16QAM-19193-1RB#0-Range2:1000~20000MHz

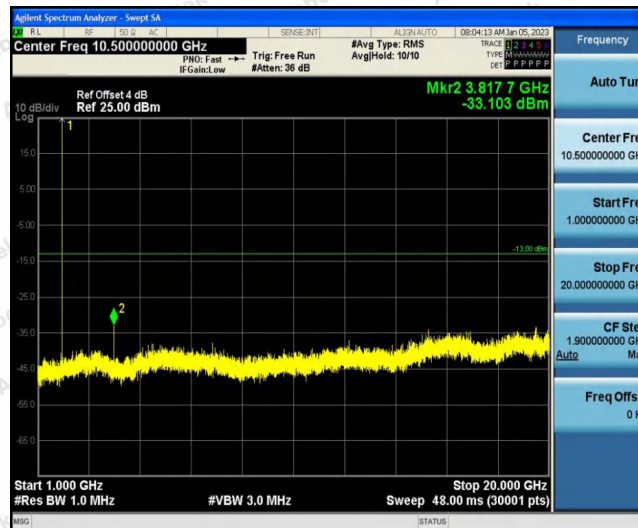

Band2-3MHz-QPSK-18615-1RB#0-Range1:30~1000MHz

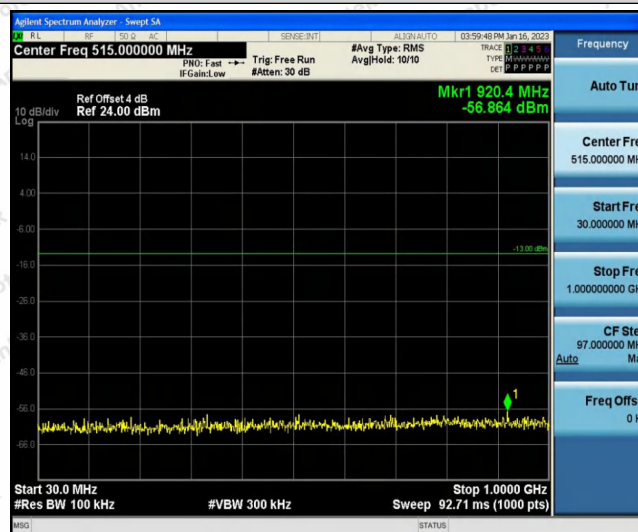

Band2-3MHz-QPSK-18615-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




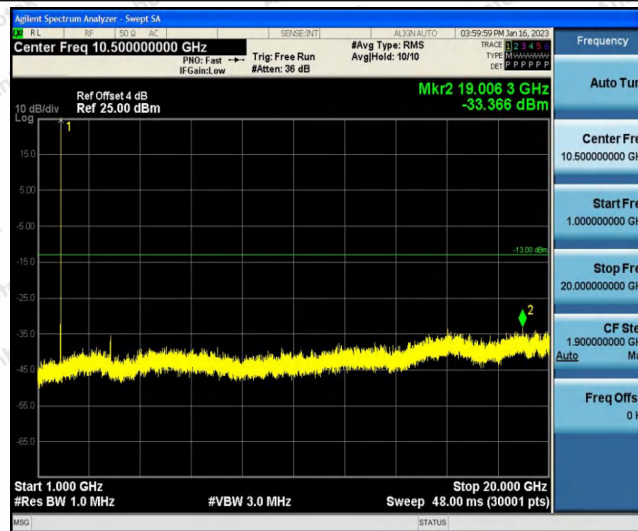

Band2-3MHz-QPSK-18900-1RB#0-Range1:30~1000MHz

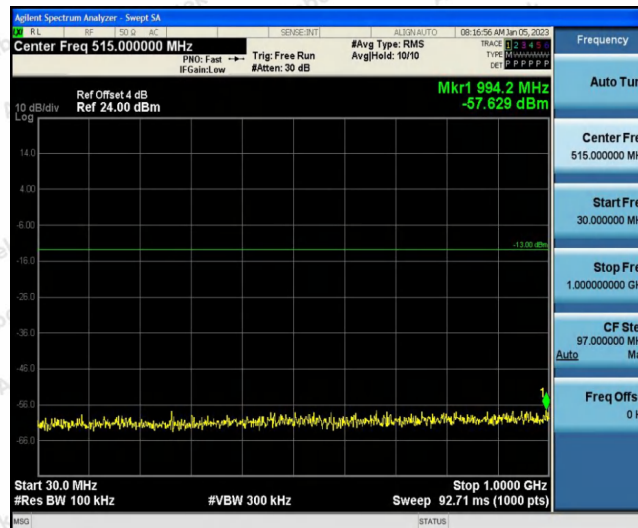

Band2-3MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz

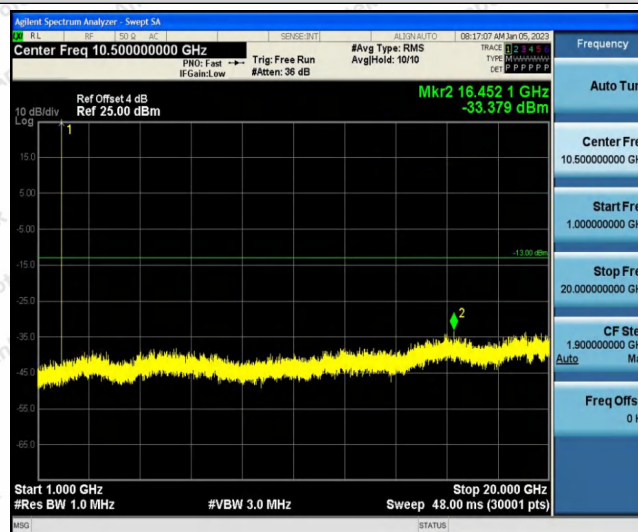

Band2-3MHz-QPSK-19185-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




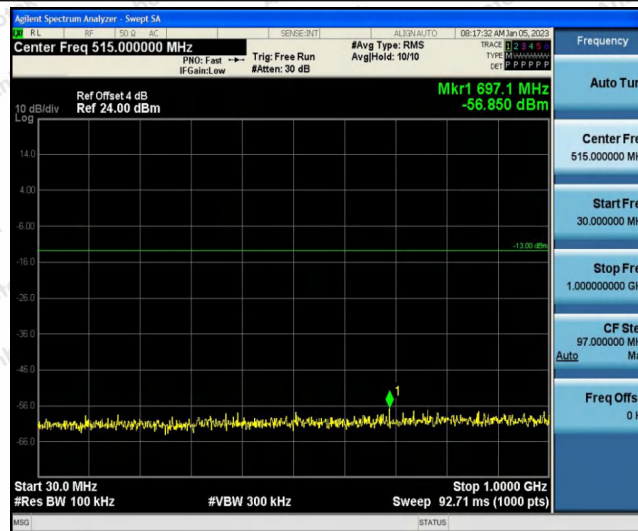

Band2-3MHz-QPSK-19185-1RB#0-Range2:1000~20000MHz

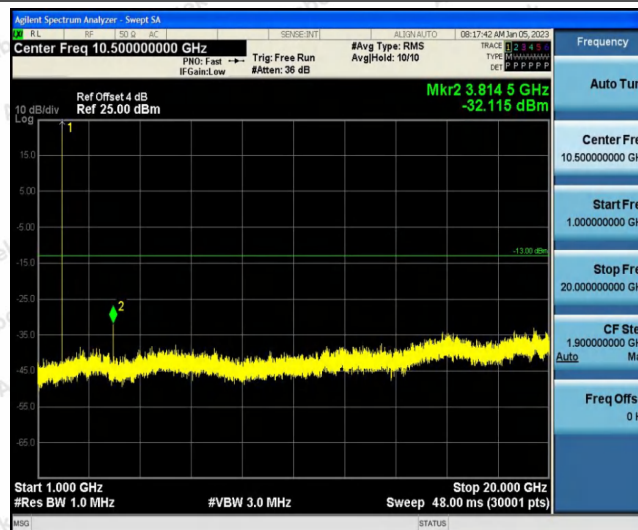

Band2-3MHz-16QAM-18615-1RB#0-Range1:30~1000MHz

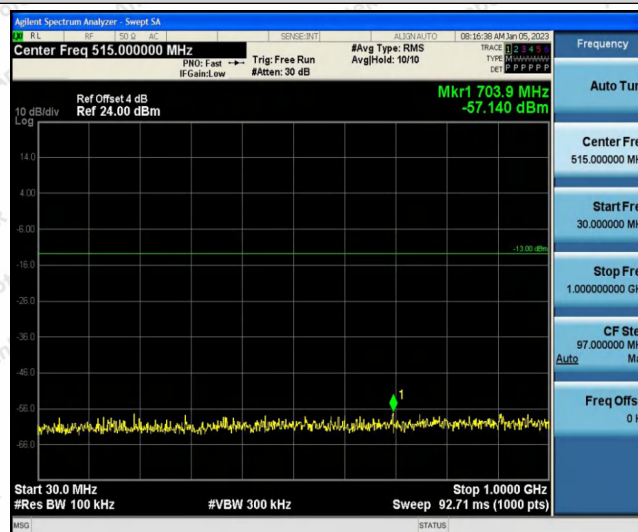

Band2-3MHz-16QAM-18615-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




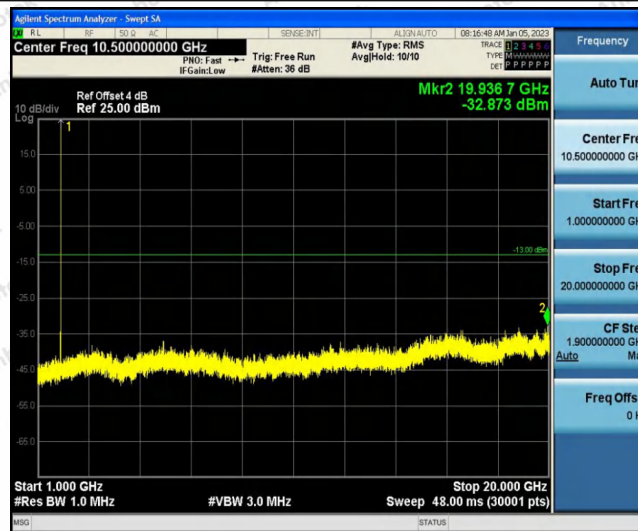

Band2-3MHz-16QAM-18900-1RB#0-Range1:30~1000MHz

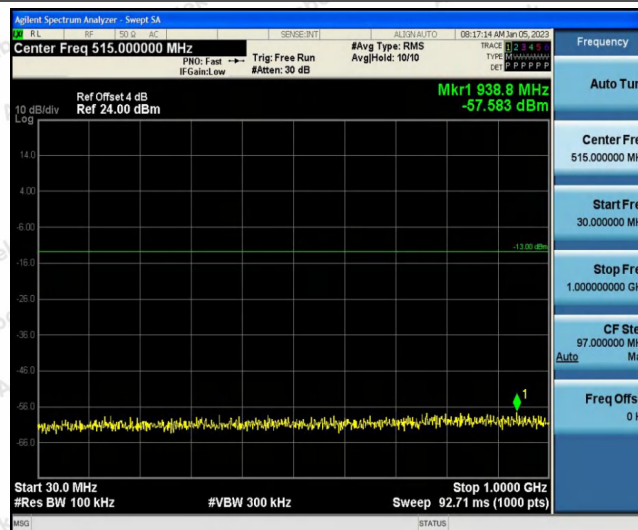

Band2-3MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz

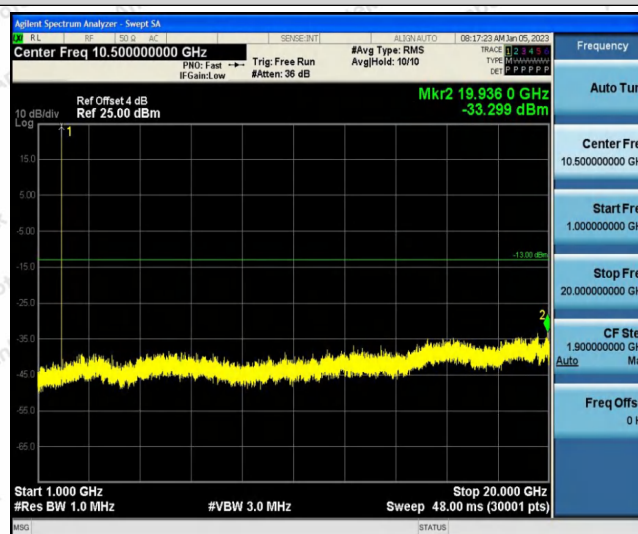


Band2-3MHz-16QAM-19185-1RB#0-Range1:30~1000MHz

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com.cn




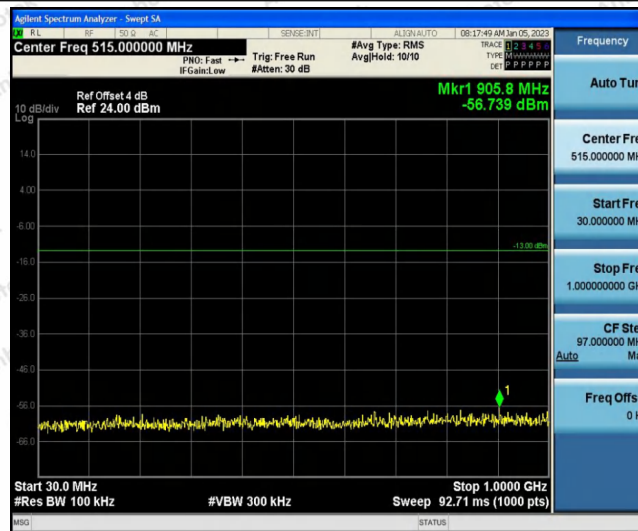

Band2-3MHz-16QAM-19185-1RB#0-Range2:1000~20000MHz

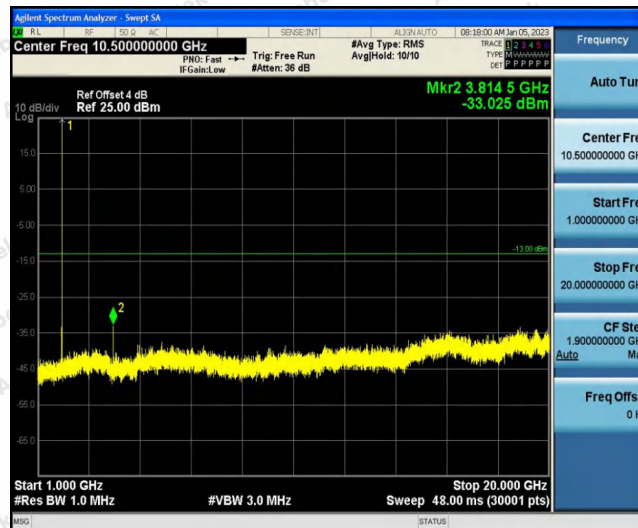

Band2-5MHz-QPSK-18625-1RB#0-Range1:30~1000MHz

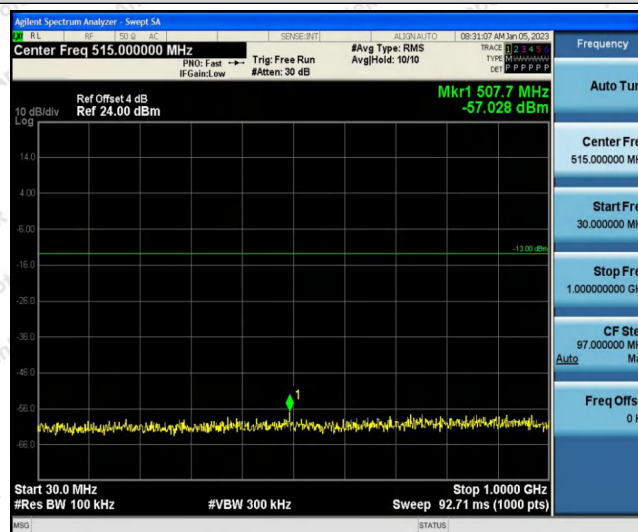

Band2-5MHz-QPSK-18625-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




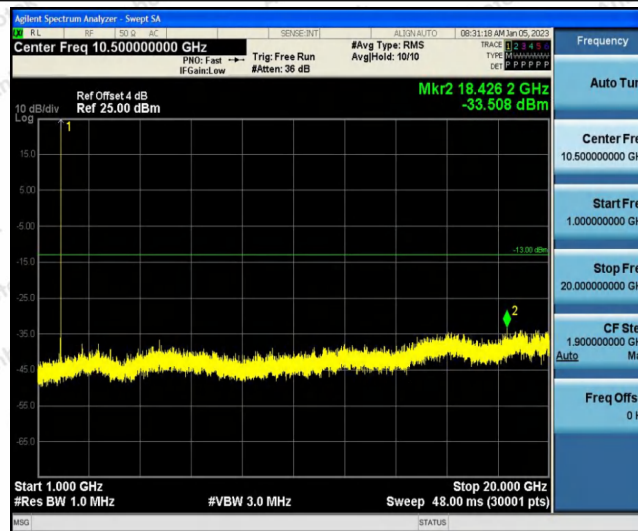

Band2-5MHz-QPSK-18900-1RB#0-Range1:30~1000MHz

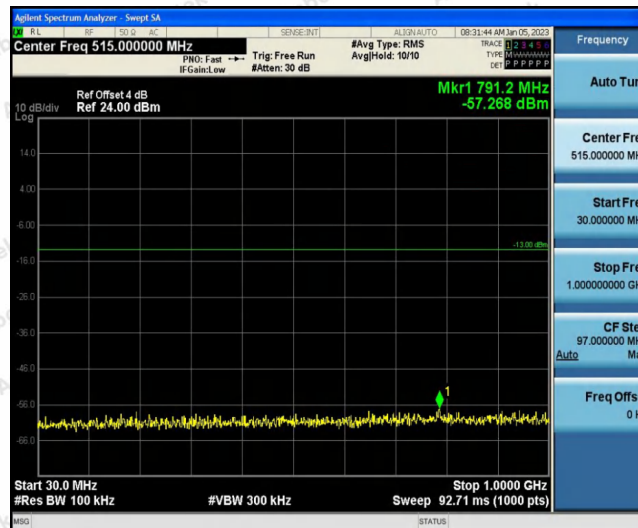

Band2-5MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz

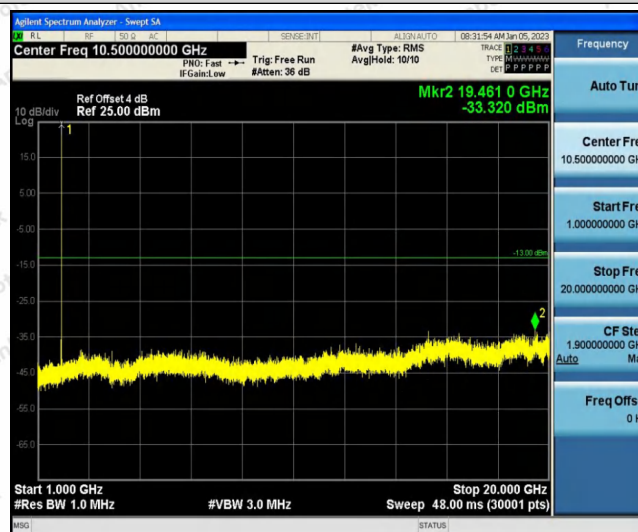

Band2-5MHz-QPSK-19175-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




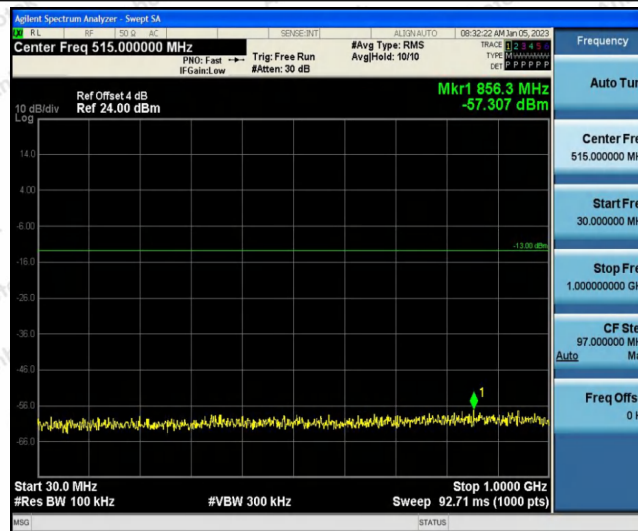

Band2-5MHz-QPSK-19175-1RB#0-Range2:1000~20000MHz

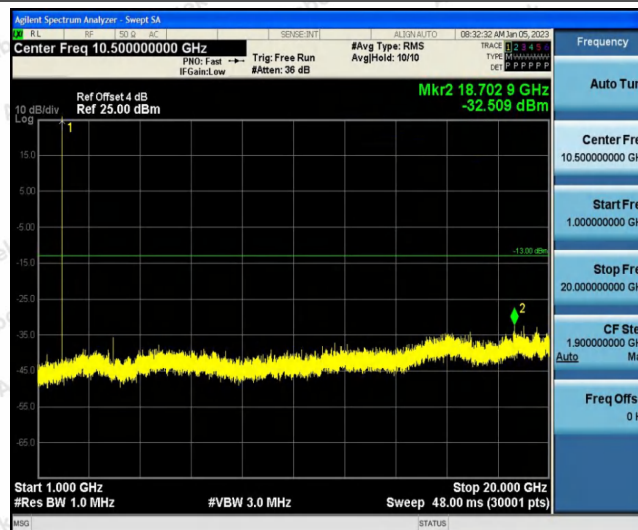

Band2-5MHz-16QAM-18625-1RB#0-Range1:30~1000MHz

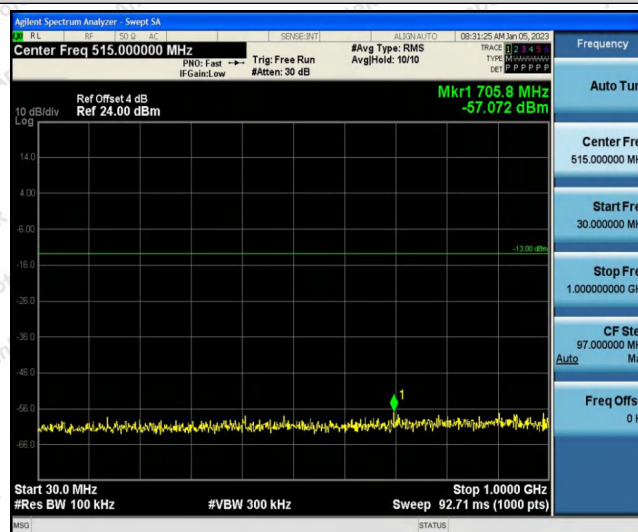

Band2-5MHz-16QAM-18625-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




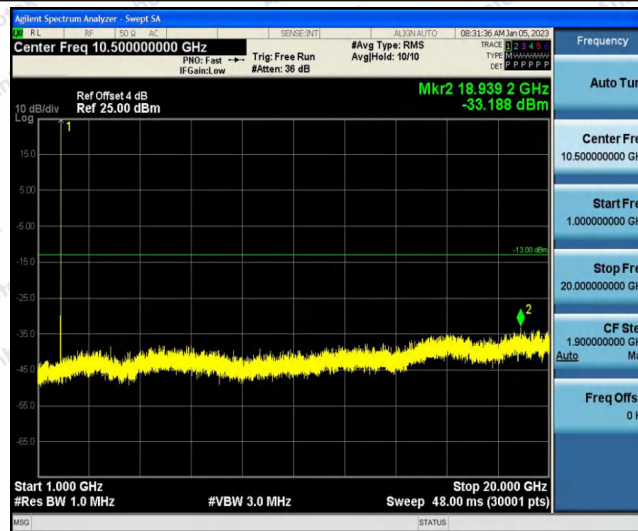

Band2-5MHz-16QAM-18900-1RB#0-Range1:30~1000MHz

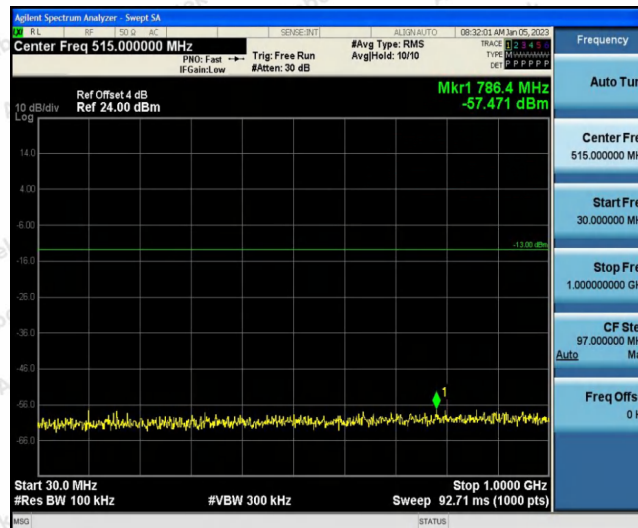

Band2-5MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz

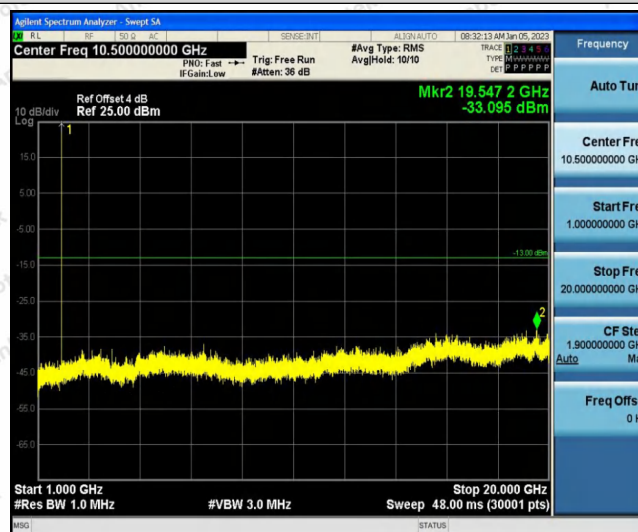

Band2-5MHz-16QAM-19175-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn




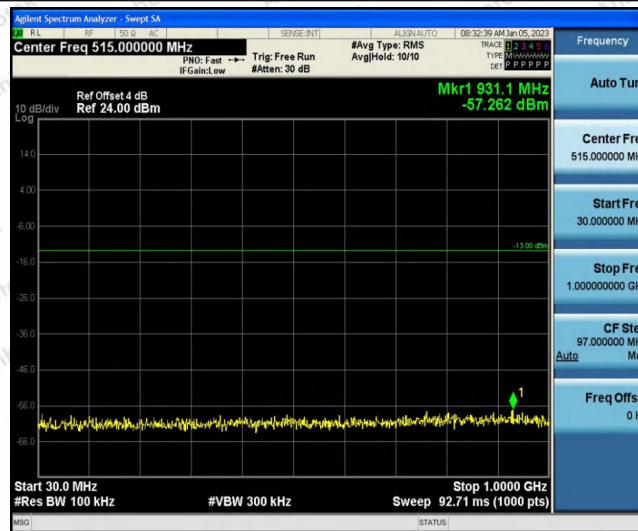

Band2-5MHz-16QAM-19175-1RB#0-Range2:1000~20000MHz



Band2-10MHz-QPSK-18650-1RB#0-Range1:30~1000MHz

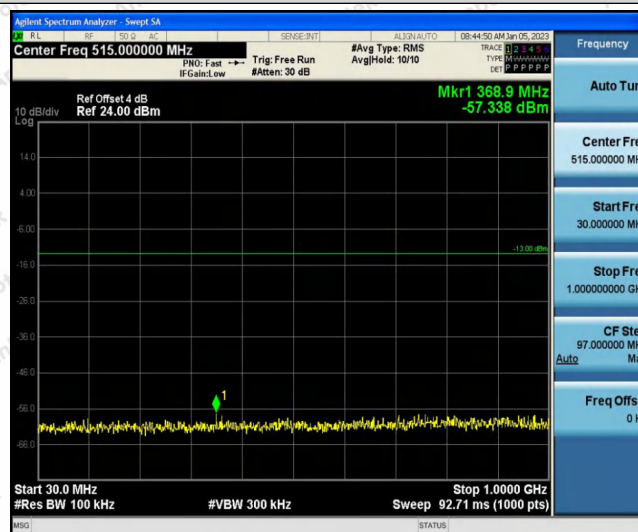

Band2-10MHz-QPSK-18650-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




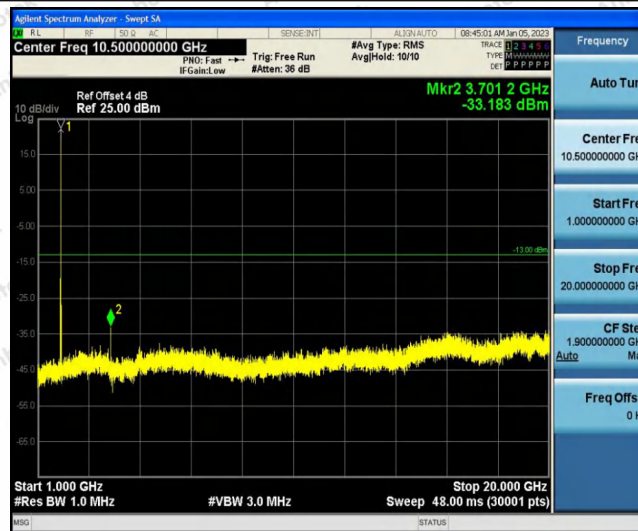

Band2-10MHz-QPSK-18900-1RB#0-Range1:30~1000MHz

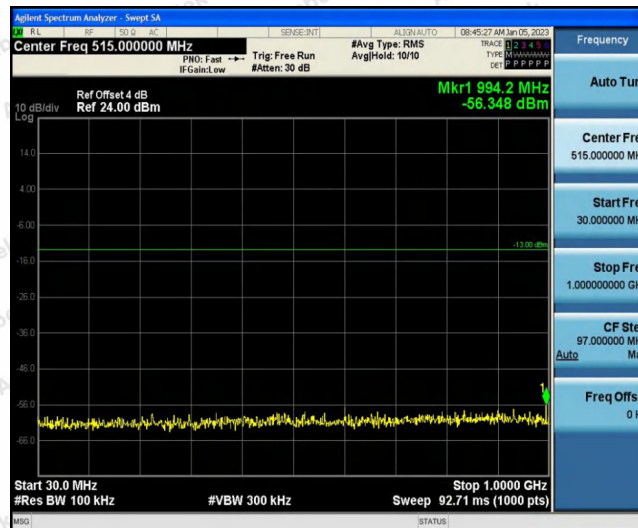

Band2-10MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz

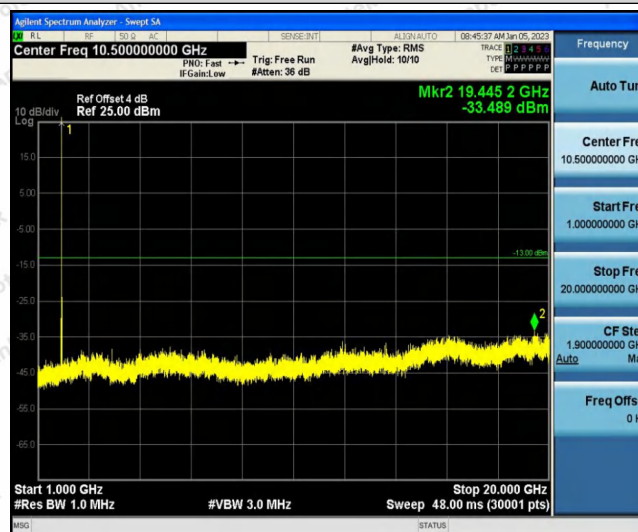

Band2-10MHz-QPSK-19150-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




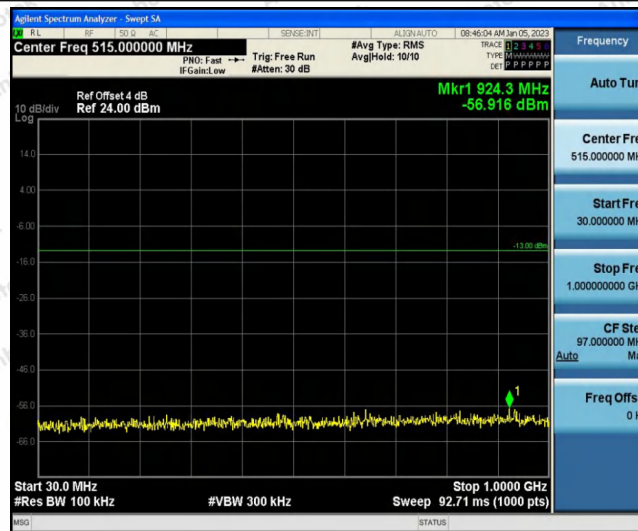

Band2-10MHz-QPSK-19150-1RB#0-Range2:1000~20000MHz

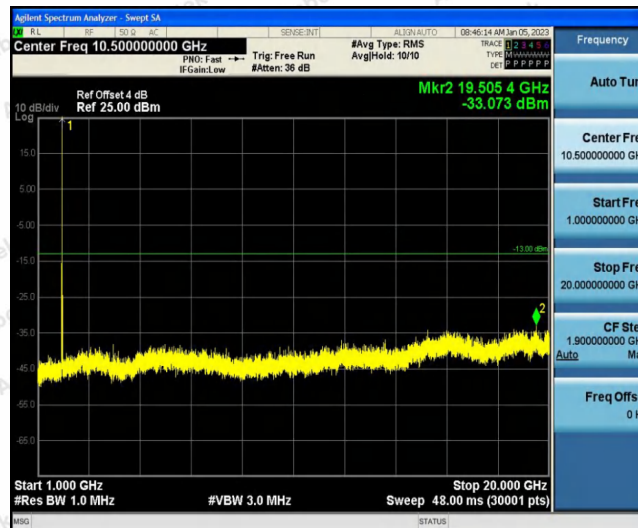

Band2-10MHz-16QAM-18650-1RB#0-Range1:30~1000MHz

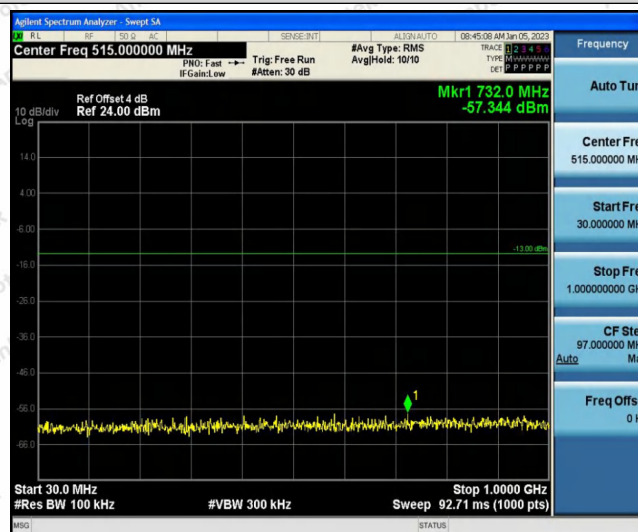

Band2-10MHz-16QAM-18650-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




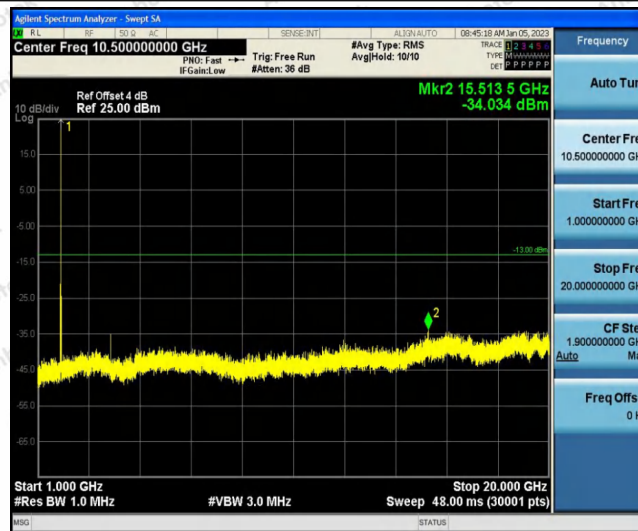

Band2-10MHz-16QAM-18900-1RB#0-Range1:30~1000MHz

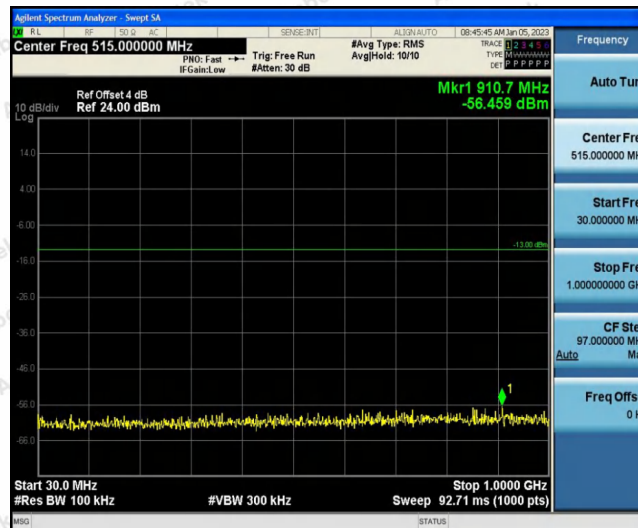

Band2-10MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz

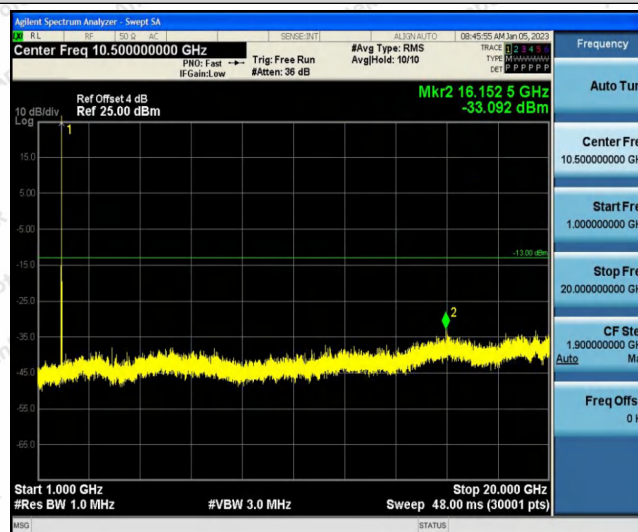

Band2-10MHz-16QAM-19150-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




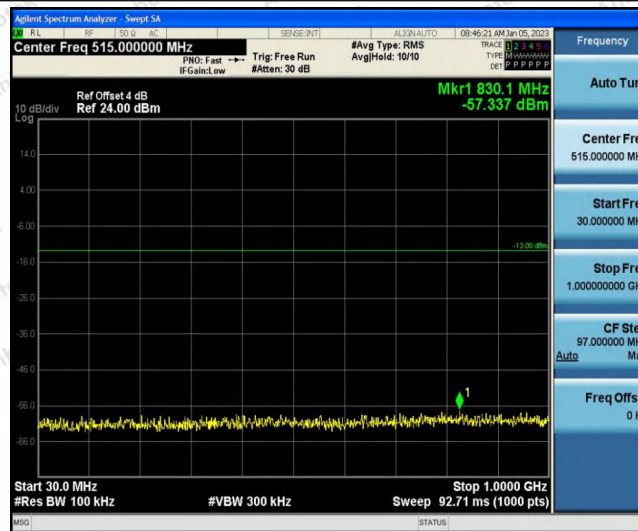

Band2-10MHz-16QAM-19150-1RB#0-Range2:1000~20000MHz

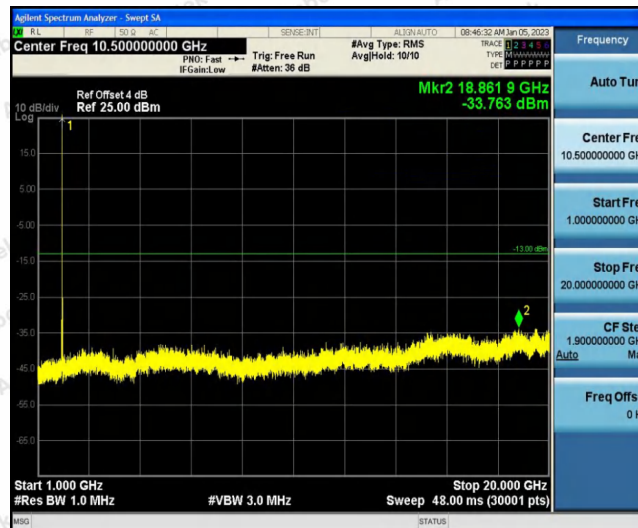

Band2-15MHz-QPSK-18675-1RB#0-Range1:30~1000MHz

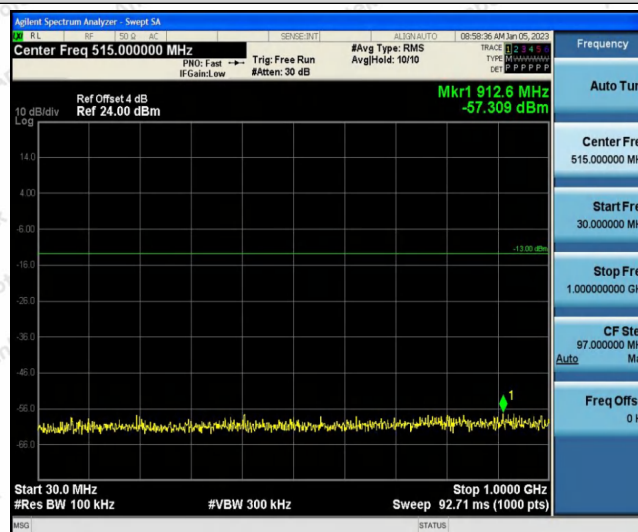

Band2-15MHz-QPSK-18675-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




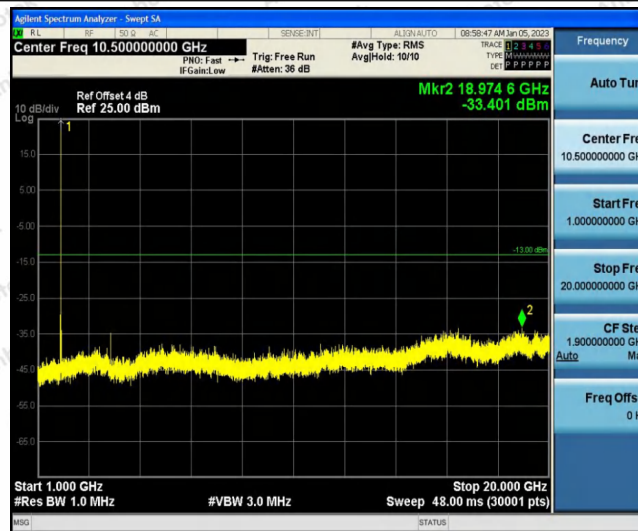

Band2-15MHz-QPSK-18900-1RB#0-Range1:30~1000MHz

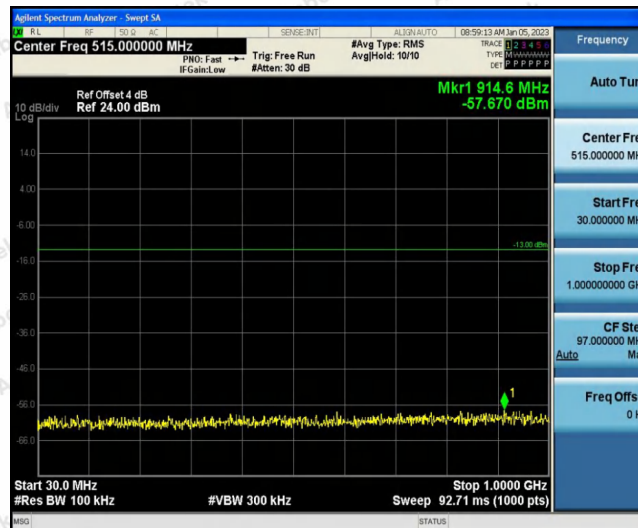

Band2-15MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz

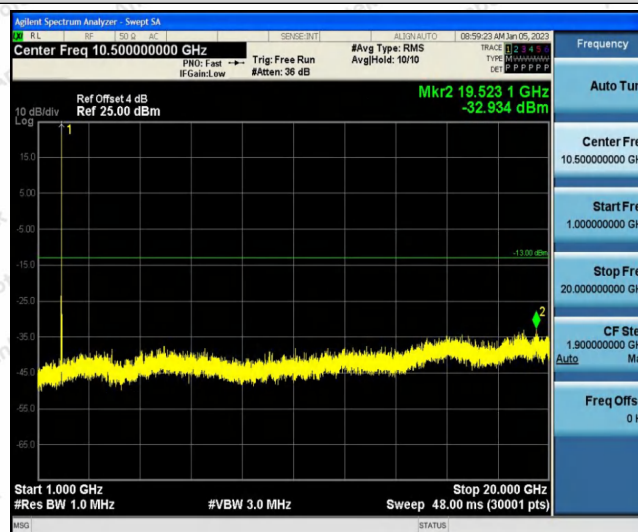

Band2-15MHz-QPSK-19125-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




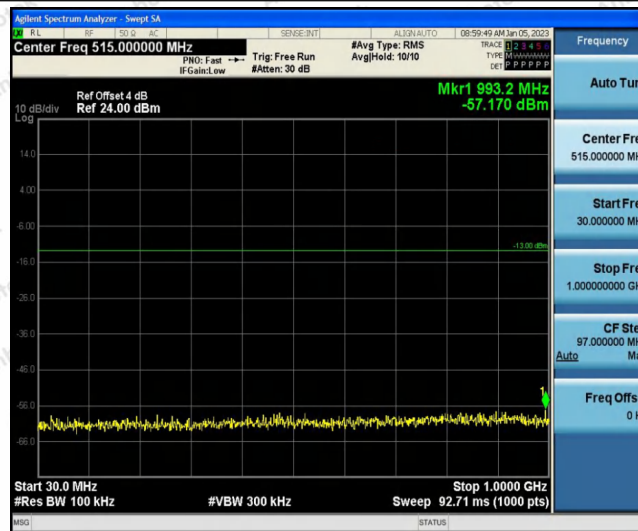

Band2-15MHz-QPSK-19125-1RB#0-Range2:1000~20000MHz

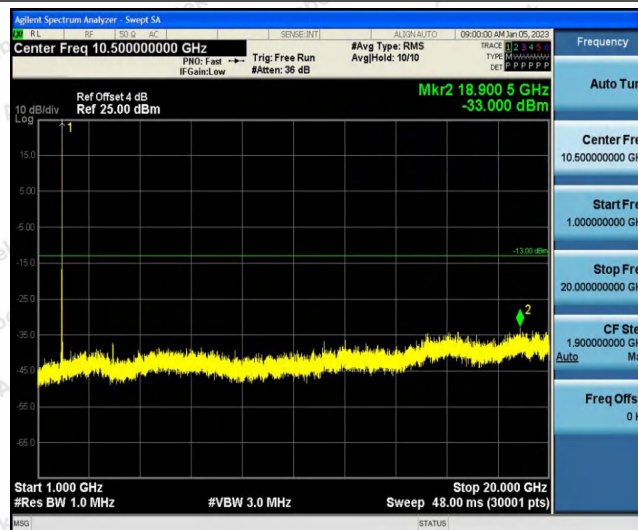

Band2-15MHz-16QAM-18675-1RB#0-Range1:30~1000MHz

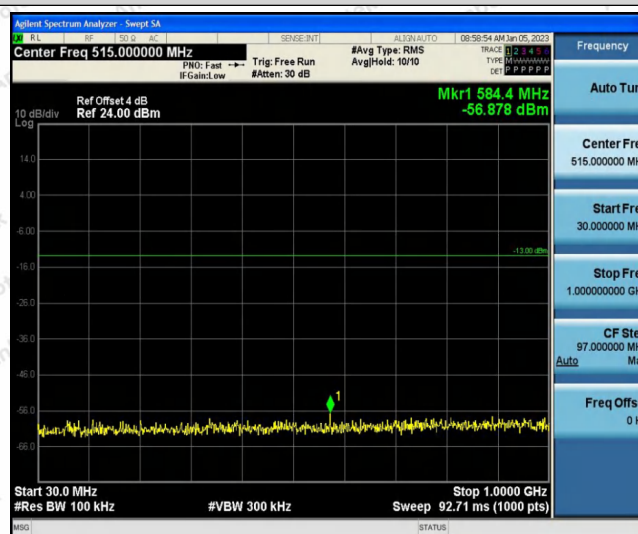

Band2-15MHz-16QAM-18675-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




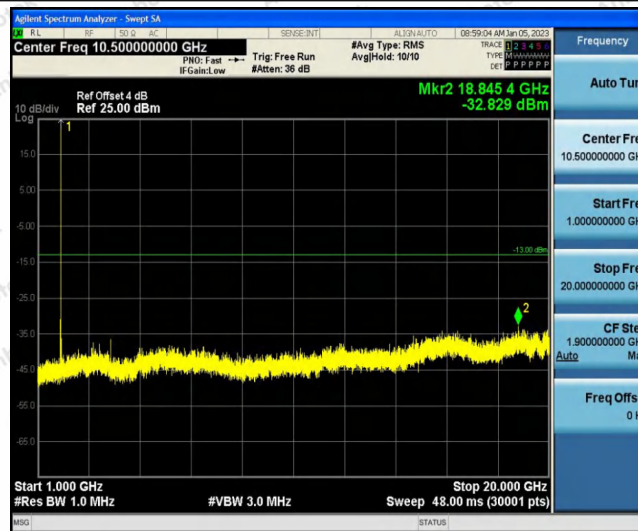

Band2-15MHz-16QAM-18900-1RB#0-Range1:30~1000MHz

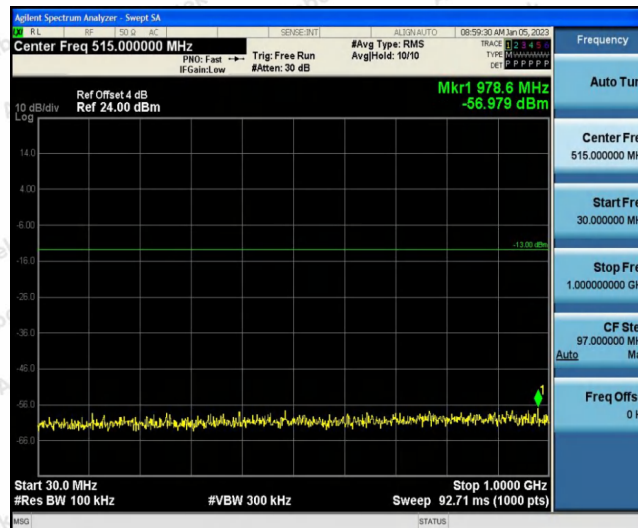

Band2-15MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz

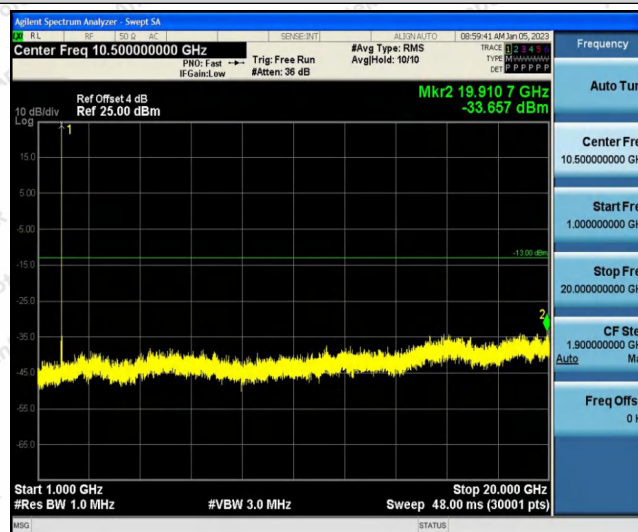

Band2-15MHz-16QAM-19125-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




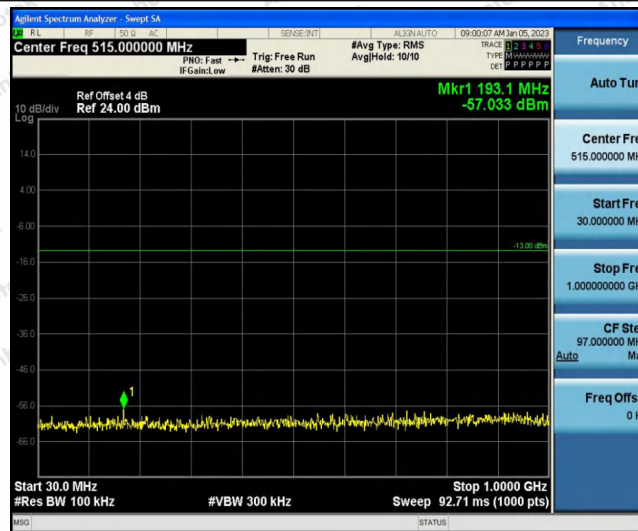

Band2-15MHz-16QAM-19125-1RB#0-Range2:1000~20000MHz

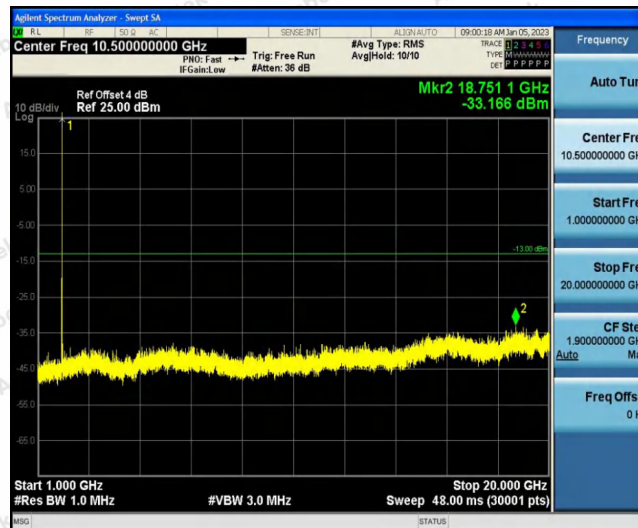

Band2-20MHz-QPSK-18700-1RB#0-Range1:30~1000MHz

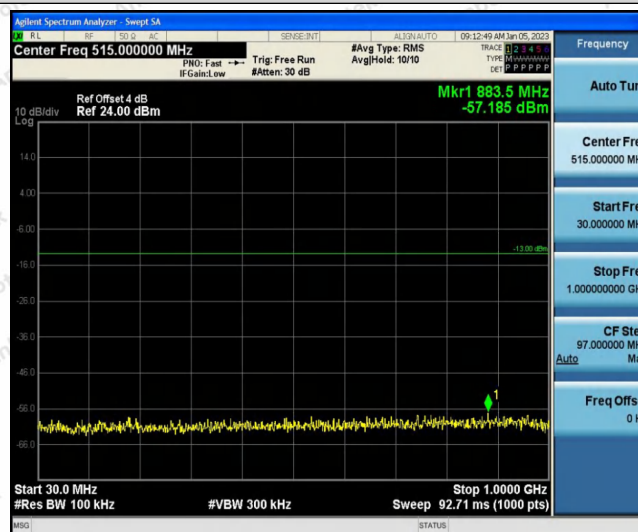

Band2-20MHz-QPSK-18700-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




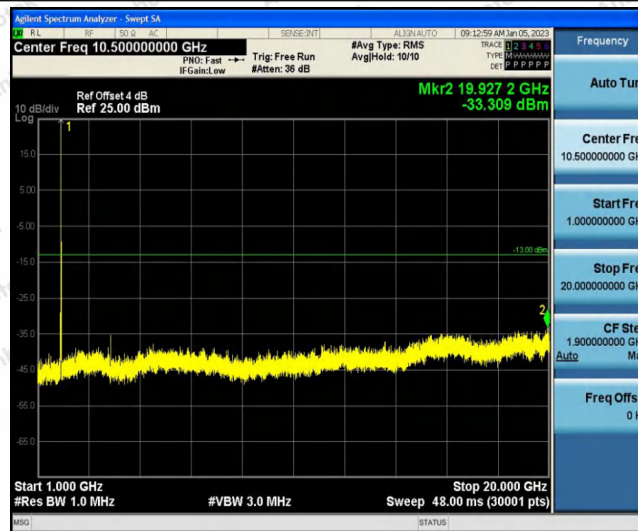

Band2-20MHz-QPSK-18900-1RB#0-Range1:30~1000MHz

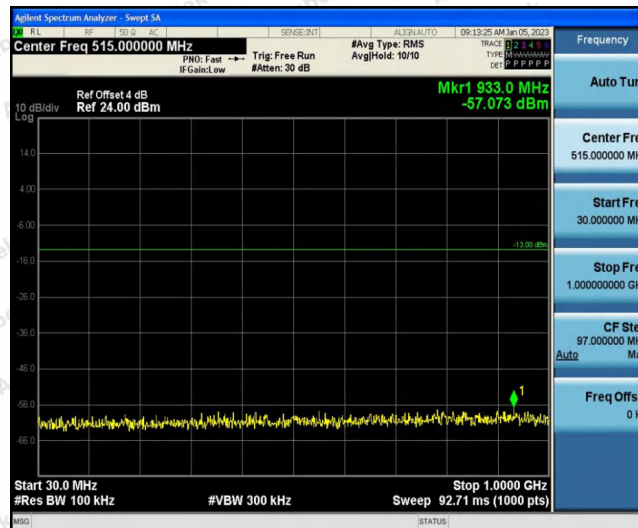

Band2-20MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz

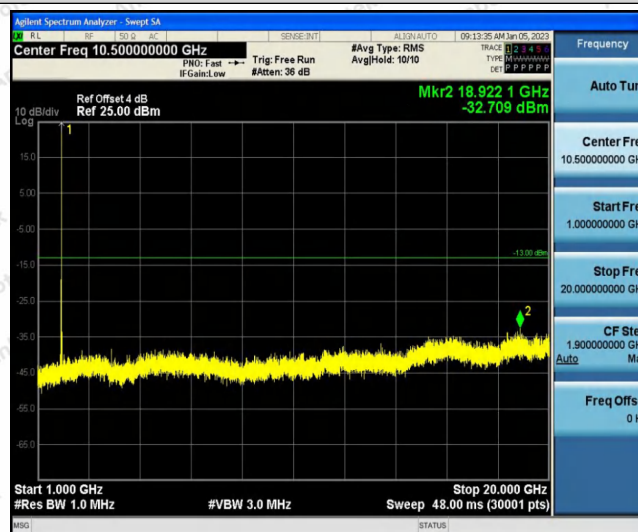

Band2-20MHz-QPSK-19100-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




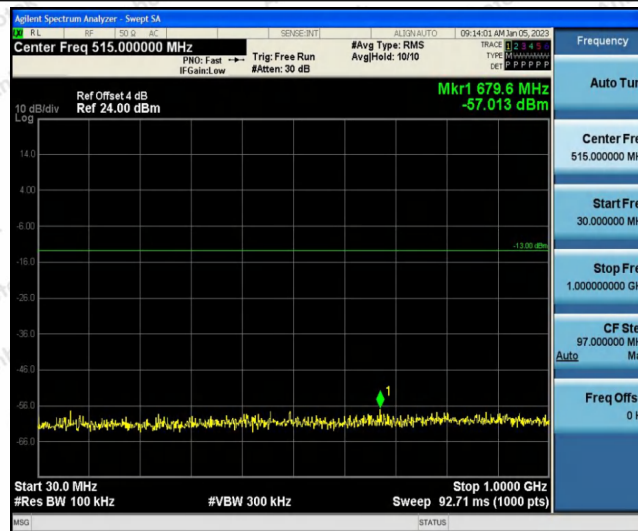

Band2-20MHz-QPSK-19100-1RB#0-Range2:1000~20000MHz

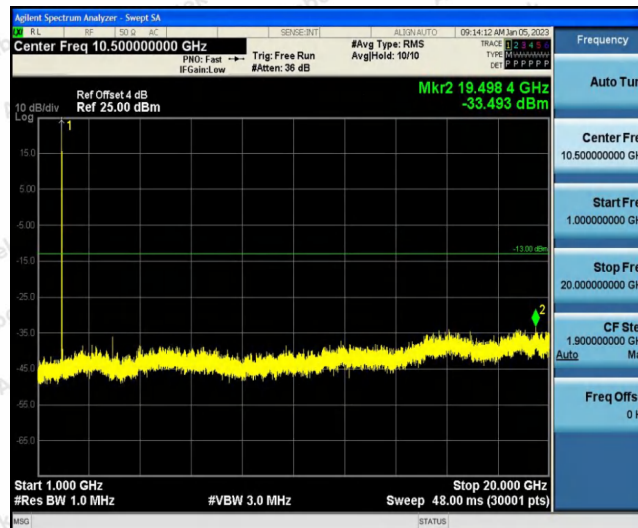

Band2-20MHz-16QAM-18700-1RB#0-Range1:30~1000MHz

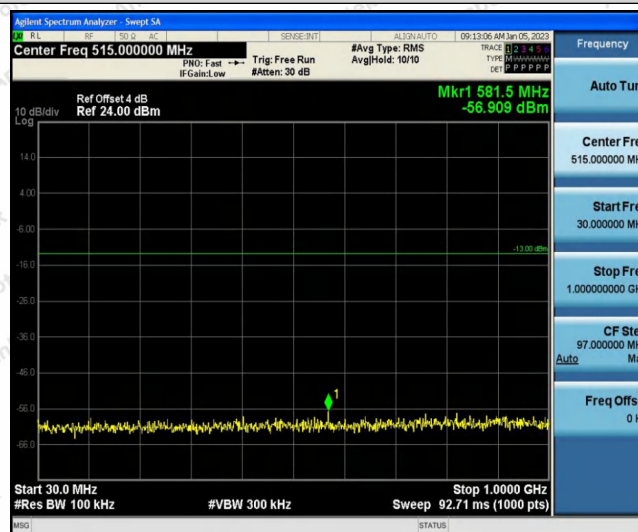

Band2-20MHz-16QAM-18700-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




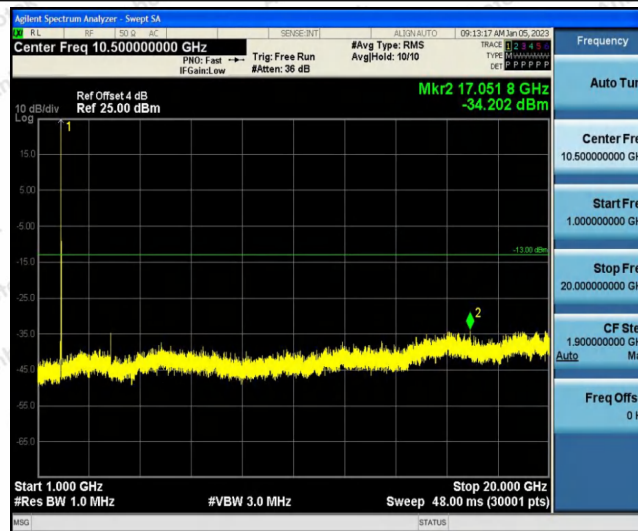

Band2-20MHz-16QAM-18900-1RB#0-Range1:30~1000MHz

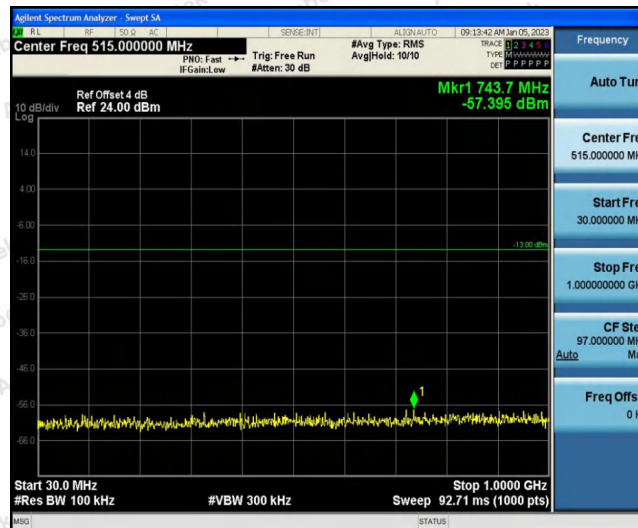

Band2-20MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz

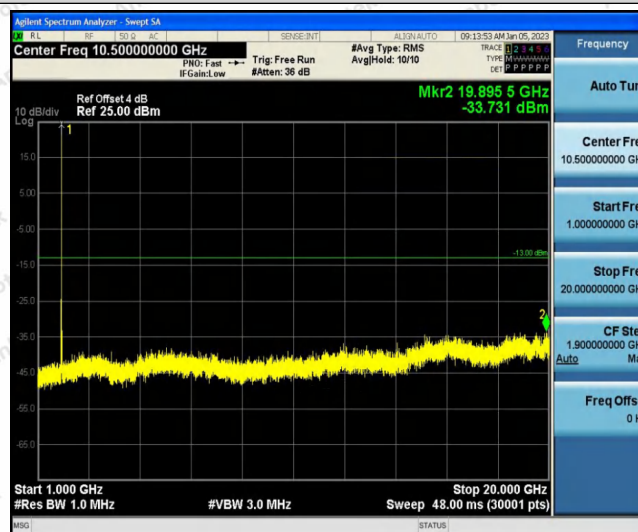

Band2-20MHz-16QAM-19100-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn



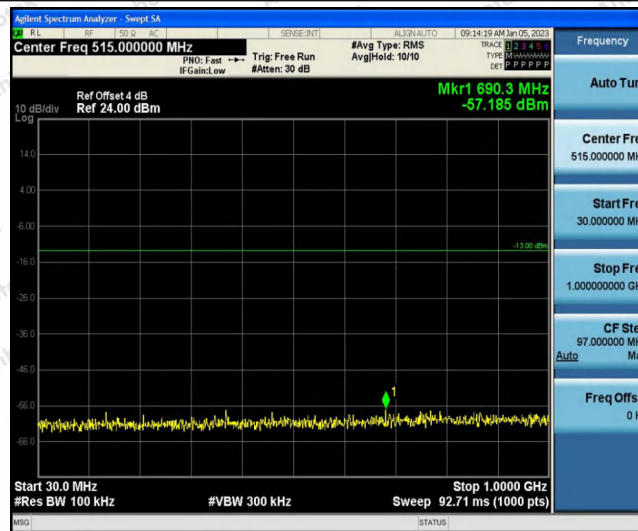

Band2-20MHz-16QAM-19100-1RB#0-Range2:1000~20000MHz

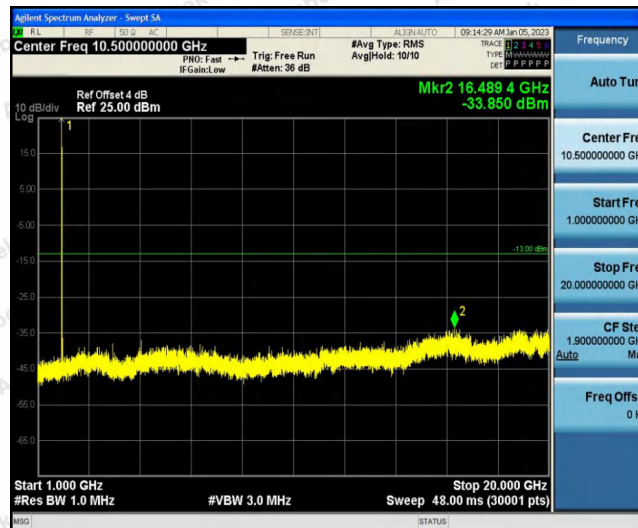

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Appendix F: Frequency stability VS Voltage measurement

Test Result

Band	Bandwidth	Modulation	Channel	RB Configure	Voltage		Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
					Voltage [Vdc]	Temperature (°C)				
Band2	1.4MHz	QPSK	18607	6RB#0	VL	NT	4.25	0.002296	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VN	NT	6.82	0.003685	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VH	NT	4.86	0.002626	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VL	NT	-18.04	-0.009596	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VN	NT	-21.14	-0.011245	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VH	NT	-18.63	-0.009910	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VL	NT	-14.38	-0.007532	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VN	NT	-14.73	-0.007715	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VH	NT	-15.62	-0.008181	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VL	NT	3.71	0.002005	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VN	NT	-2.39	-0.001291	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VH	NT	-5.78	-0.003123	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VL	NT	-8.63	-0.004590	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VN	NT	-13.42	-0.007138	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VH	NT	-9.90	-0.005266	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VL	NT	-9.23	-0.004834	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VN	NT	-9.87	-0.005169	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VH	NT	-10.23	-0.005358	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VL	NT	4.01	0.002166	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VN	NT	6.88	0.003716	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VH	NT	3.56	0.001923	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VL	NT	-4.86	-0.002585	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VN	NT	-3.82	-0.002032	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VH	NT	-3.55	-0.001888	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VL	NT	4.75	0.002489	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VN	NT	7.24	0.003794	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VH	NT	4.99	0.002615	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VL	NT	5.49	0.002965	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VN	NT	2.68	0.001447	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VH	NT	8.13	0.004391	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VL	NT	-4.05	-0.002154	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VN	NT	-3.13	-0.001665	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VH	NT	-5.21	-0.002771	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	VL	NT	7.70	0.004035	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band2	3MHz	16QAM	19185	15RB#0	VN	NT	7.57	0.003966	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	VH	NT	6.82	0.003573	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	VL	NT	-3.18	-0.001717	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	VN	NT	4.02	0.002170	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	VH	NT	3.55	0.001916	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VL	NT	-6.79	-0.003612	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VN	NT	-5.89	-0.003133	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VH	NT	-6.37	-0.003388	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VL	NT	6.92	0.003628	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VN	NT	9.08	0.004760	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VH	NT	5.51	0.002889	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VL	NT	-3.98	-0.002148	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VN	NT	-4.53	-0.002445	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VH	NT	4.02	0.002170	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VL	NT	-4.21	-0.002239	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VN	NT	-2.65	-0.001410	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VH	NT	-6.57	-0.003495	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VL	NT	2.83	0.001484	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VN	NT	4.22	0.002212	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VH	NT	2.07	0.001085	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VL	NT	-1.44	-0.000776	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VN	NT	2.52	0.001358	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VH	NT	2.19	0.001181	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VL	NT	-5.95	-0.003165	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VN	NT	-6.29	-0.003346	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VH	NT	-5.76	-0.003064	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VL	NT	3.93	0.002063	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VN	NT	2.10	0.001102	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VH	NT	4.96	0.002604	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	VL	NT	3.49	0.001881	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	VN	NT	-3.10	-0.001671	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	VH	NT	-3.50	-0.001887	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	VL	NT	-5.35	-0.002846	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	VN	NT	-4.65	-0.002473	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	VH	NT	-5.52	-0.002936	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	VL	NT	8.81	0.004625	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	VN	NT	2.96	0.001554	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	VH	NT	4.51	0.002367	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	VL	NT	-4.02	-0.002164	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	VN	NT	-6.02	-0.003241	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	VH	NT	-5.14	-0.002767	±2.5	PASS



Band2	15MHz	QPSK	18900	75RB#0	VL	NT	-6.49	-0.003452	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	VN	NT	-4.95	-0.002633	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	VH	NT	-4.56	-0.002426	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VL	NT	-6.34	-0.003332	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VN	NT	-4.23	-0.002223	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VH	NT	-6.44	-0.003385	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	VL	NT	-4.86	-0.002616	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	VN	NT	-4.82	-0.002595	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	VH	NT	-4.45	-0.002396	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	VL	NT	-4.33	-0.002303	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	VN	NT	-4.73	-0.002516	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	VH	NT	-6.59	-0.003505	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	VL	NT	-4.94	-0.002597	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	VN	NT	-4.33	-0.002276	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	VH	NT	-5.31	-0.002791	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VL	NT	5.15	0.002769	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VN	NT	4.59	0.002468	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VH	NT	3.82	0.002054	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VL	NT	-5.22	-0.002777	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VN	NT	-3.58	-0.001904	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VH	NT	-4.35	-0.002314	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VL	NT	-4.69	-0.002468	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VN	NT	-7.11	-0.003742	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VH	NT	-4.41	-0.002321	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	VL	NT	4.45	0.002392	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	VN	NT	3.66	0.001968	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	VH	NT	2.16	0.001161	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	VL	NT	-4.63	-0.002463	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	VN	NT	-5.28	-0.002809	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	VH	NT	-4.51	-0.002399	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	VL	NT	3.46	0.001821	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	VN	NT	-5.46	-0.002874	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	VH	NT	-5.34	-0.002811	±2.5	PASS



Appendix G: Frequency stability VS Temperature measurement

Test Result

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-30	-3.09	-0.001670	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-20	2.89	0.001562	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	0	-3.08	-0.001664	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	10	-5.78	-0.003123	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	20	-3.76	-0.002032	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-30	-19.93	-0.010601	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-20	-16.34	-0.008691	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	0	-14.88	-0.007915	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	10	-11.90	-0.006330	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	20	-14.48	-0.007702	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-30	-16.25	-0.008511	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-20	-15.89	-0.008322	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	0	-14.73	-0.007715	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	10	-13.73	-0.007191	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	20	-12.99	-0.006804	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-30	-4.36	-0.002356	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-20	-3.78	-0.002042	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	0	-3.42	-0.001848	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	10	3.25	0.001756	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	20	-5.62	-0.003037	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-30	-8.91	-0.004739	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-20	-9.50	-0.005053	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	0	-7.94	-0.004223	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	10	-7.57	-0.004027	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	20	-5.69	-0.003027	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-30	-9.56	-0.005007	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-20	-6.54	-0.003425	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	0	-4.76	-0.002493	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	10	-6.05	-0.003169	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	20	-7.80	-0.004085	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-30	7.67	0.004143	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-20	3.69	0.001993	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	0	6.68	0.003608	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	10	-3.03	-0.001637	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	20	4.39	0.002371	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com.cn



Band2	3MHz	QPSK	18900	15RB#0	NV	-30	2.55	0.001356	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-20	-2.50	-0.001330	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	0	-5.84	-0.003106	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	10	-6.01	-0.003197	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	20	5.34	0.002840	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-30	6.91	0.003621	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-20	8.24	0.004318	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	0	5.68	0.002976	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	10	7.62	0.003993	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	20	5.98	0.003133	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-30	-2.76	-0.001491	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-20	-3.98	-0.002150	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	0	3.10	0.001674	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	10	4.41	0.002382	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	20	3.83	0.002069	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-30	-3.81	-0.002027	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-20	-5.31	-0.002824	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	0	4.25	0.002261	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	10	4.55	0.002420	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	20	-6.81	-0.003622	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-30	6.35	0.003327	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-20	3.66	0.001918	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	0	7.93	0.004155	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	10	6.97	0.003652	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	20	7.35	0.003851	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-30	5.54	0.002991	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-20	5.95	0.003212	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	0	5.62	0.003034	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	10	4.43	0.002391	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	20	3.71	0.002003	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-30	-4.65	-0.002473	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-20	-4.88	-0.002596	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	0	-3.52	-0.001872	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	10	-4.15	-0.002207	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	20	-5.68	-0.003021	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-30	4.46	0.002338	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-20	4.52	0.002370	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	0	7.30	0.003827	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	10	4.95	0.002595	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	20	4.98	0.002611	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	-30	-2.75	-0.001484	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com.cn



Band2	5MHz	16QAM	18625	25RB#0	NV	-20	-2.13	-0.001150	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	0	4.78	0.002580	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	10	-4.32	-0.002332	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	20	-2.49	-0.001344	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-30	-4.12	-0.002191	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-20	3.40	0.001809	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	0	2.17	0.001154	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	10	-6.61	-0.003516	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	20	-4.09	-0.002176	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-30	4.46	0.002338	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-20	3.22	0.001688	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	0	-3.19	-0.001672	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	10	4.06	0.002128	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	20	4.19	0.002197	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-30	-3.72	-0.002005	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-20	-3.78	-0.002038	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	0	-5.59	-0.003013	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	10	-3.40	-0.001833	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	20	-4.38	-0.002361	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-30	-3.81	-0.002027	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-20	-5.52	-0.002936	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	0	-5.68	-0.003021	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	10	-3.10	-0.001649	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	20	-5.05	-0.002686	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-30	5.42	0.002845	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-20	5.52	0.002898	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	0	4.68	0.002457	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	10	5.12	0.002688	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	20	-4.01	-0.002105	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-30	-2.47	-0.001332	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-20	4.03	0.002173	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	0	-3.81	-0.002054	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	10	-3.72	-0.002005	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	20	-4.56	-0.002458	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-30	-5.08	-0.002702	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-20	-7.55	-0.004016	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	0	-7.05	-0.003750	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	10	-7.14	-0.003798	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	20	-5.19	-0.002761	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	-30	4.43	0.002325	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	-20	3.32	0.001743	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band2	10MHz	16QAM	19150	50RB#0	NV	0	4.16	0.002184	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	10	-4.01	-0.002105	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	20	3.13	0.001643	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-30	-3.15	-0.001696	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-20	-4.23	-0.002277	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	0	-7.28	-0.003919	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	10	-7.22	-0.003887	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	20	-6.71	-0.003612	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-30	-4.05	-0.002154	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-20	-4.22	-0.002245	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	0	-3.91	-0.002080	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	10	-3.49	-0.001856	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	20	-5.18	-0.002755	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-30	-3.99	-0.002097	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-20	-5.08	-0.002670	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	0	-5.52	-0.002901	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	10	-6.48	-0.003406	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	20	-3.16	-0.001661	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	-30	-6.18	-0.003327	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	-20	-3.92	-0.002110	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	0	-7.10	-0.003822	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	10	-4.09	-0.002202	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	20	-2.62	-0.001410	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	-30	-6.95	-0.003697	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	-20	-4.92	-0.002617	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	0	-3.59	-0.001910	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	10	-4.66	-0.002479	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	20	-3.83	-0.002037	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	-30	-4.66	-0.002449	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	-20	-3.96	-0.002081	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	0	-4.38	-0.002302	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	10	-4.92	-0.002586	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	20	-4.42	-0.002323	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-30	-4.59	-0.002468	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-20	-2.10	-0.001129	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	0	2.49	0.001339	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	10	3.99	0.002145	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	20	3.16	0.001699	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-30	2.07	0.001101	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-20	-4.59	-0.002441	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	0	-4.36	-0.002319	±2.5	PASS



Band2	20MHz	QPSK	18900	100RB#0	NV	10	-4.98	-0.002649	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	20	-4.23	-0.002250	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-30	-3.30	-0.001737	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-20	-4.08	-0.002147	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	0	-4.79	-0.002521	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	10	-4.32	-0.002274	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	20	-5.08	-0.002674	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	-30	5.16	0.002774	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	-20	-1.57	-0.000844	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	0	4.99	0.002683	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	10	4.29	0.002306	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	20	4.18	0.002247	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	-30	-7.35	-0.003910	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	-20	-2.06	-0.001096	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	0	-3.95	-0.002101	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	10	3.25	0.001729	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	20	-4.51	-0.002399	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	-30	-4.63	-0.002437	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	-20	-3.16	-0.001663	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	0	-3.10	-0.001632	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	10	-4.13	-0.002174	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	20	-4.22	-0.002221	±2.5	PASS

---END---

