




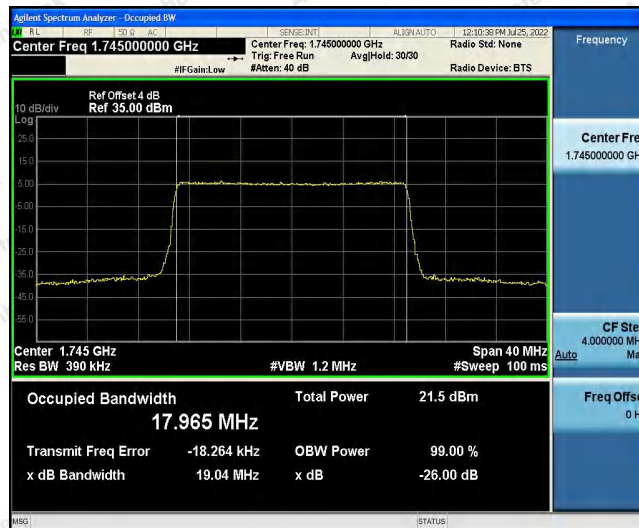


Band4-20MHz-16QAM-20050-100RB#0

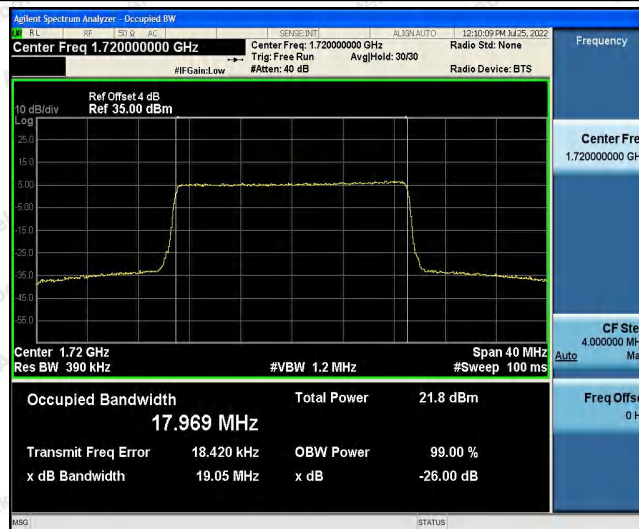

Band4-20MHz-16QAM-20175-100RB#0

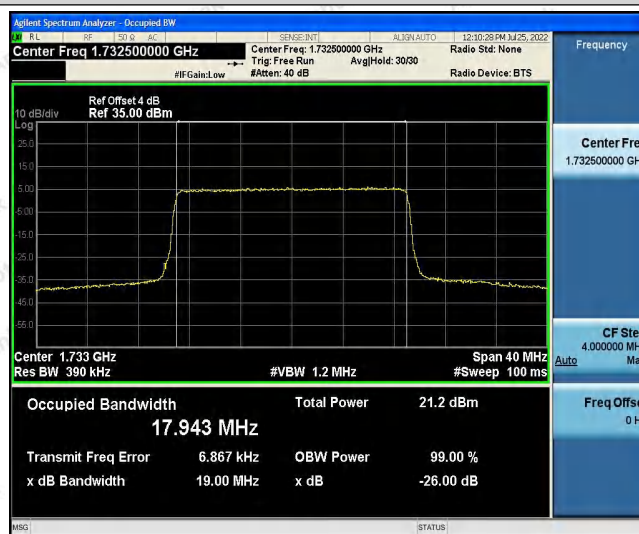

Band4-20MHz-16QAM-20300-100RB#0

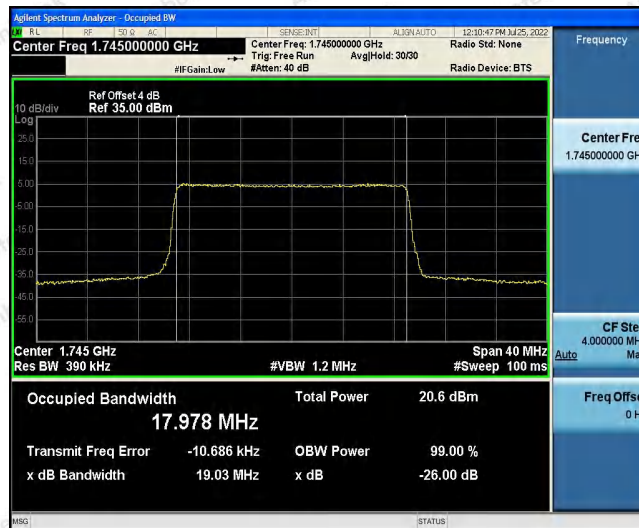


Band5-1.4MHz-QPSK-20407-6RB#0



Band5-1.4MHz-QPSK-20525-6RB#0




Band5-1.4MHz-QPSK-20643-6RB#0

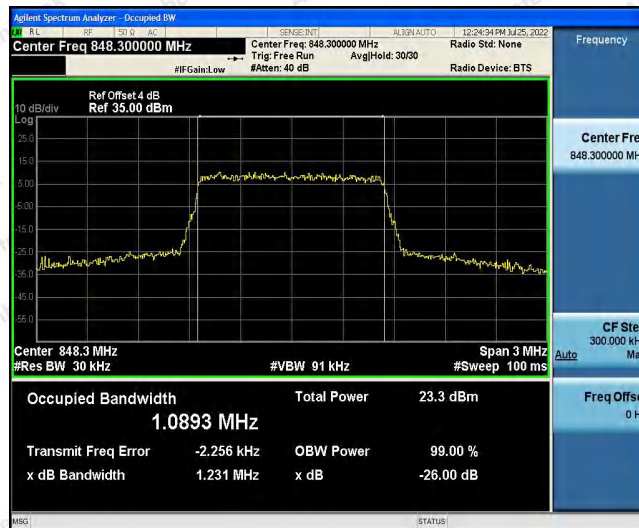

Band5-1.4MHz-16QAM-20407-6RB#0




Band5-1.4MHz-16QAM-20525-6RB#0

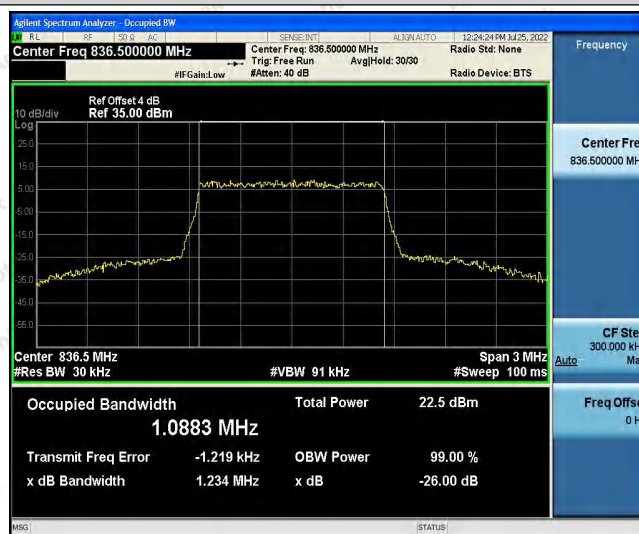


Band5-1.4MHz-16QAM-20643-6RB#0




Band5-3MHz-QPSK-20415-15RB#0

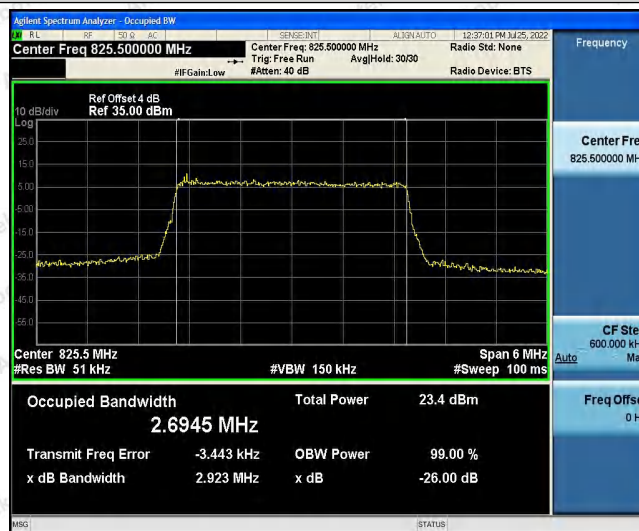


Band5-3MHz-QPSK-20525-15RB#0

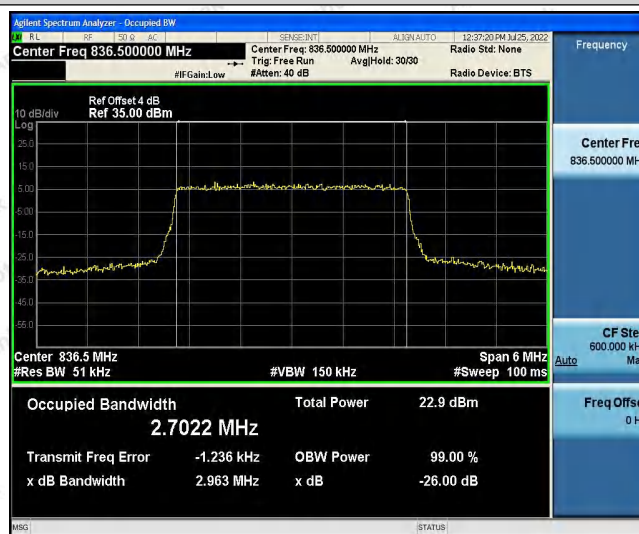


Band5-3MHz-QPSK-20635-15RB#0

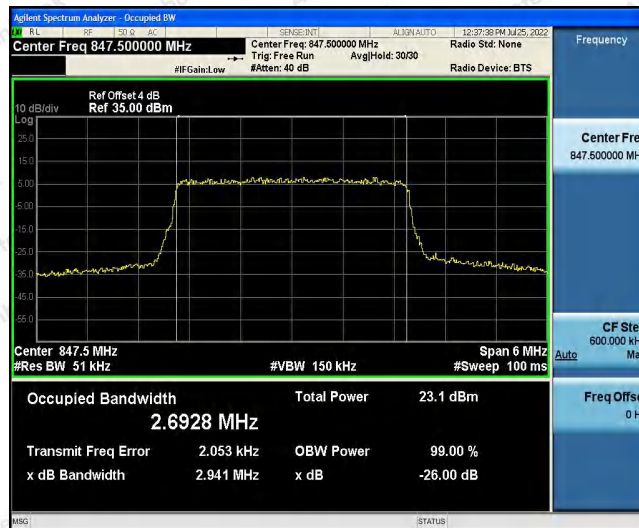


Band5-3MHz-16QAM-20415-15RB#0

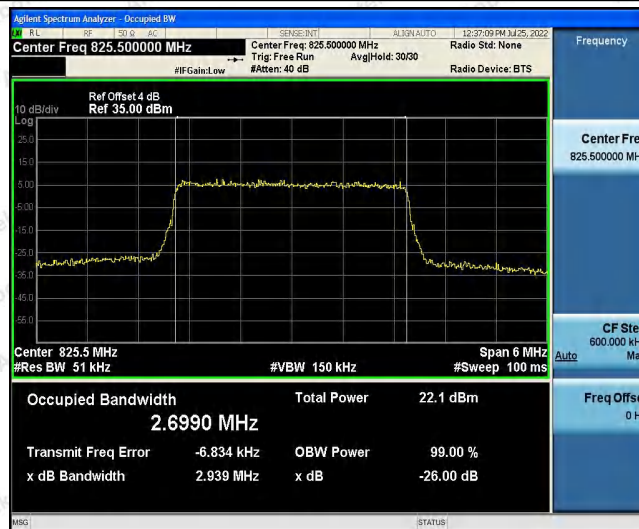

Band5-3MHz-16QAM-20525-15RB#0

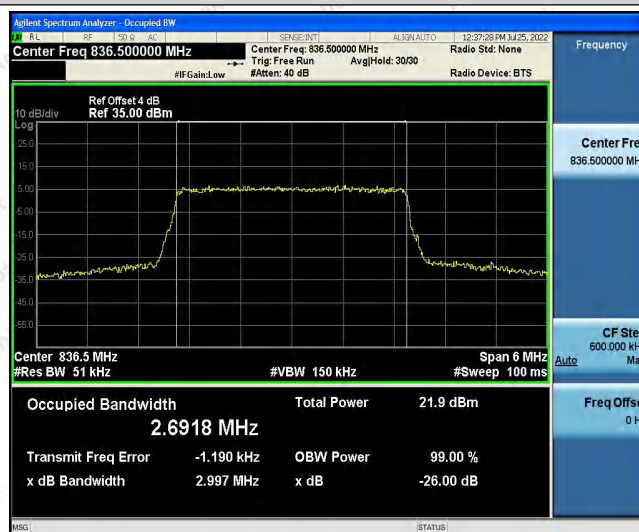

Band5-3MHz-16QAM-20635-15RB#0

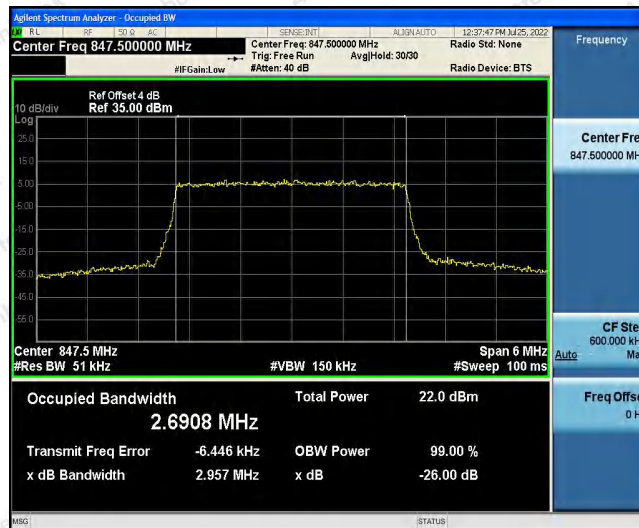


Band5-5MHz-QPSK-20425-25RB#0



Band5-5MHz-QPSK-20525-25RB#0




Band5-5MHz-QPSK-20625-25RB#0

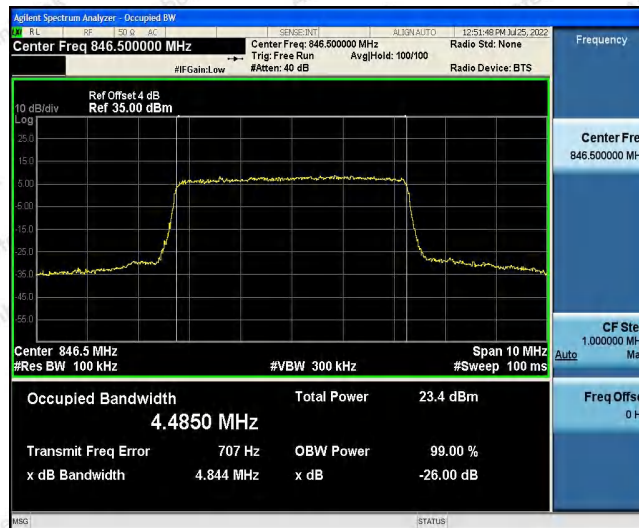


Band5-5MHz-16QAM-20425-25RB#0



Band5-5MHz-16QAM-20525-25RB#0

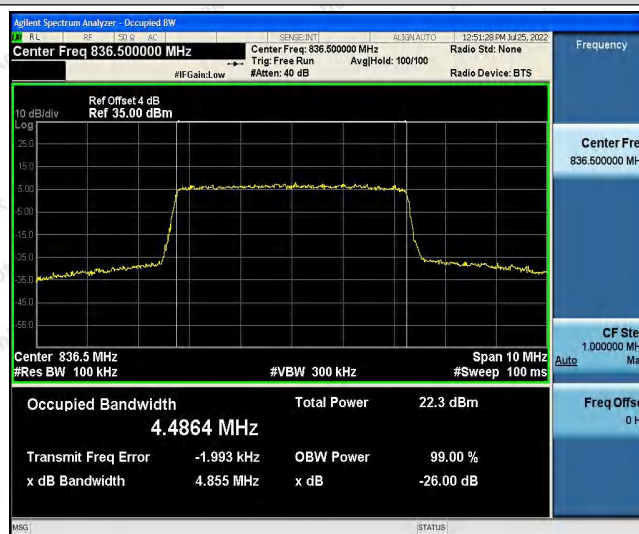

Band5-5MHz-16QAM-20625-25RB#0

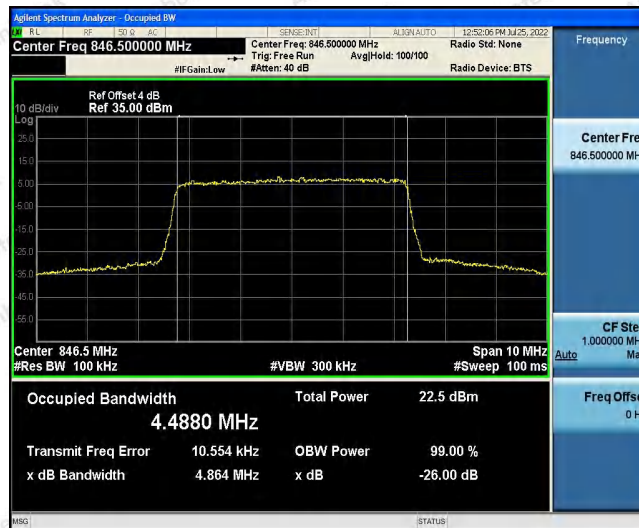

Band5-10MHz-QPSK-20450-50RB#0



Band5-10MHz-QPSK-20525-50RB#0



Band5-10MHz-QPSK-20600-50RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com



Band5-10MHz-16QAM-20450-50RB#0




Band5-10MHz-16QAM-20525-50RB#0




Band5-10MHz-16QAM-20600-50RB#0




Band7-5MHz-QPSK-20775-25RB#0

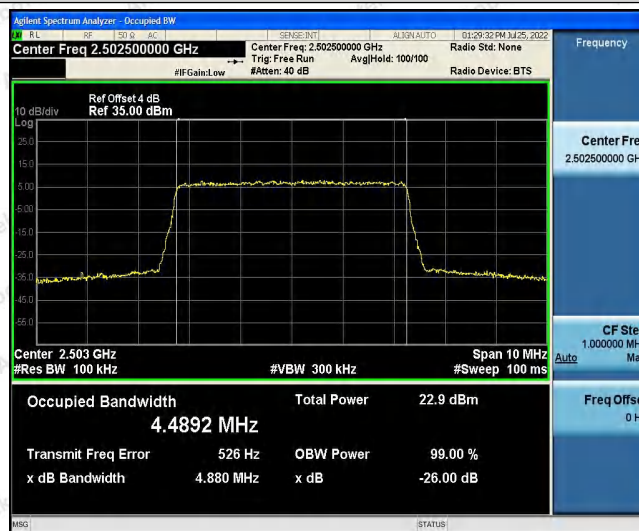


Band7-5MHz-QPSK-21100-25RB#0

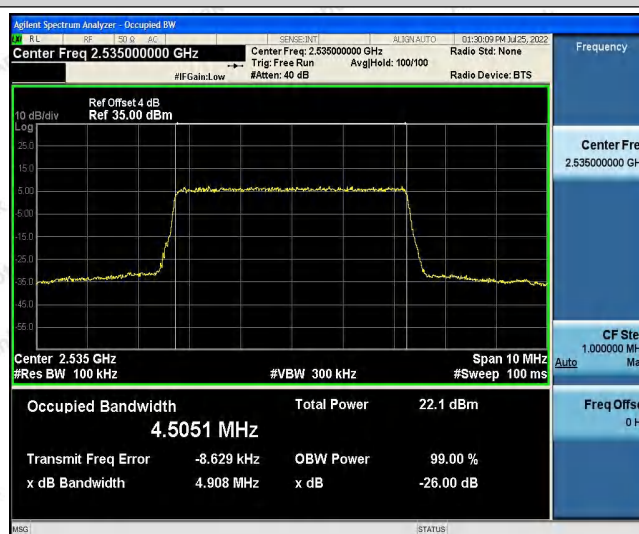


Band7-5MHz-QPSK-21425-25RB#0

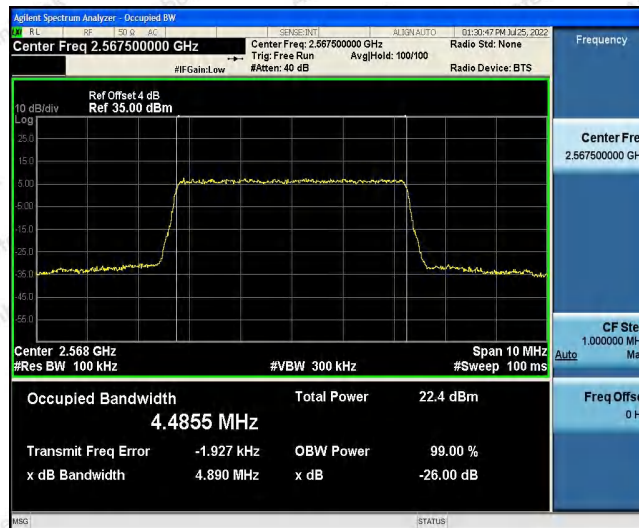


Band7-5MHz-16QAM-20775-25RB#0

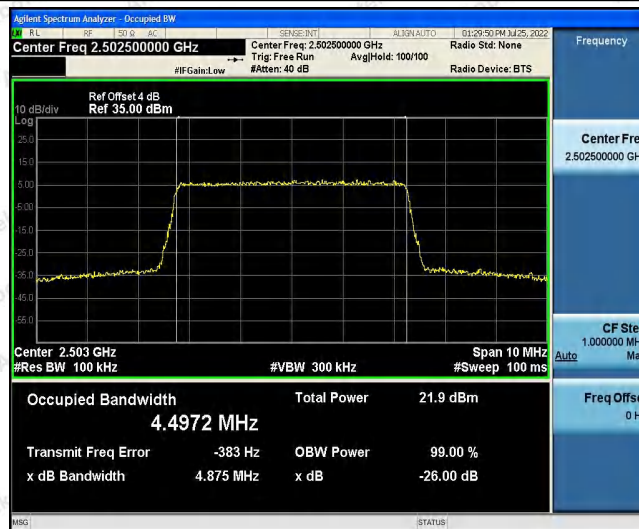


Band7-5MHz-16QAM-21100-25RB#0

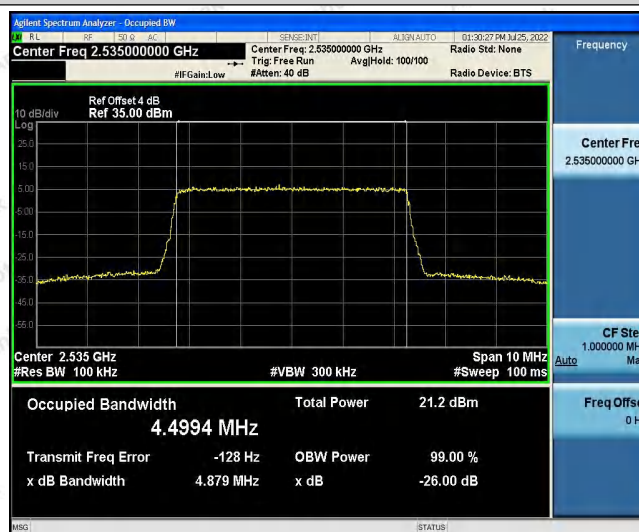


Band7-5MHz-16QAM-21425-25RB#0

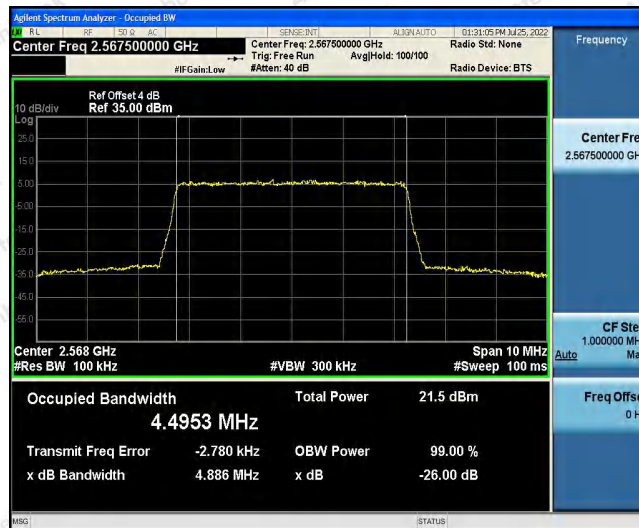


Band7-10MHz-QPSK-20800-50RB#0

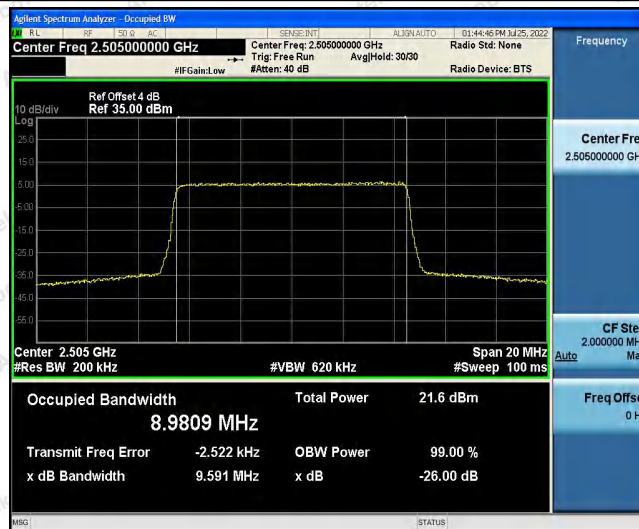


Band7-10MHz-QPSK-21100-50RB#0

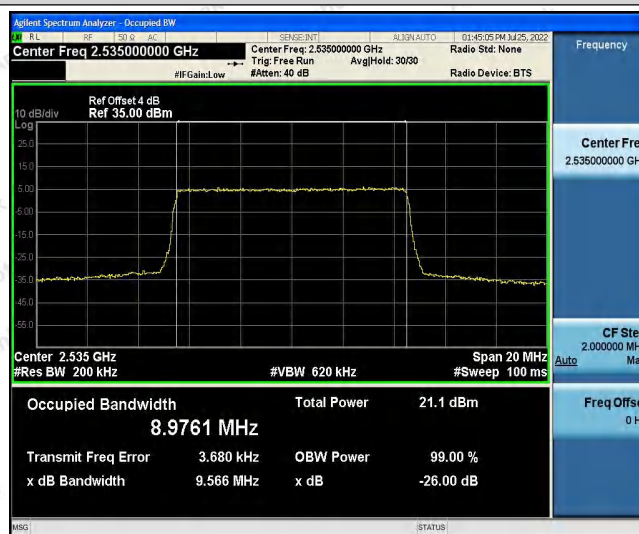


Band7-10MHz-QPSK-21400-50RB#0

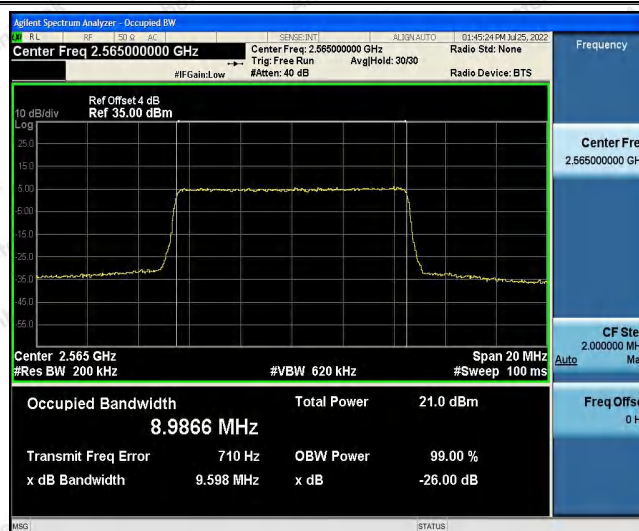

Band7-10MHz-16QAM-20800-50RB#0

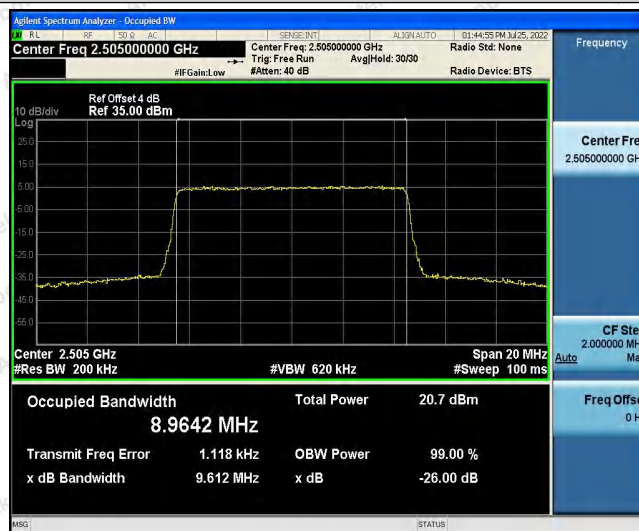

Band7-10MHz-16QAM-21100-50RB#0

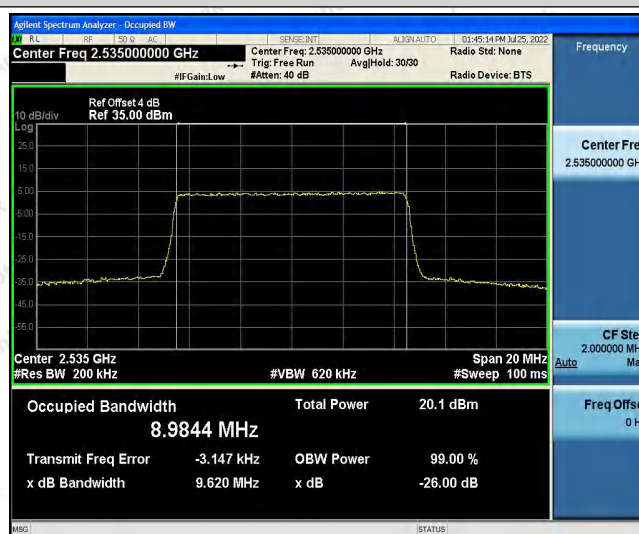

Band7-10MHz-16QAM-21400-50RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

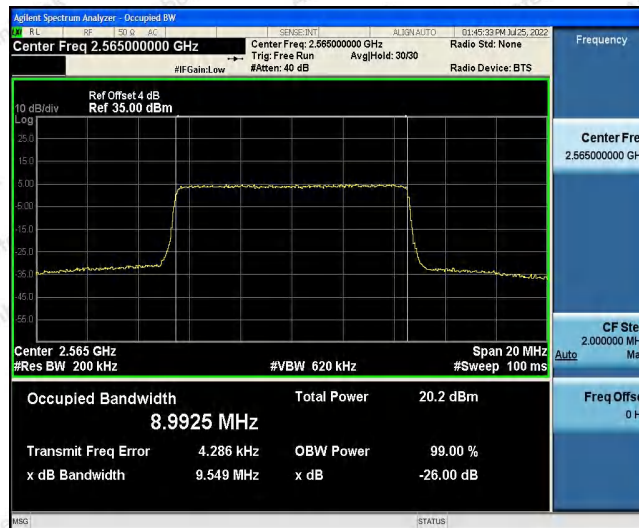


Band7-15MHz-QPSK-20825-75RB#0

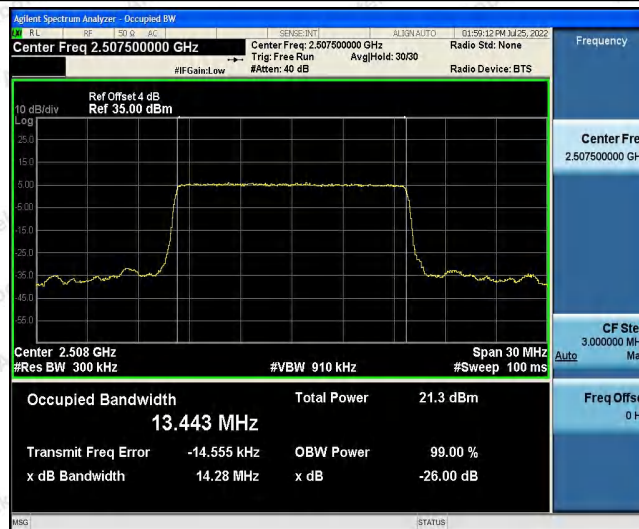


Band7-15MHz-QPSK-21100-75RB#0

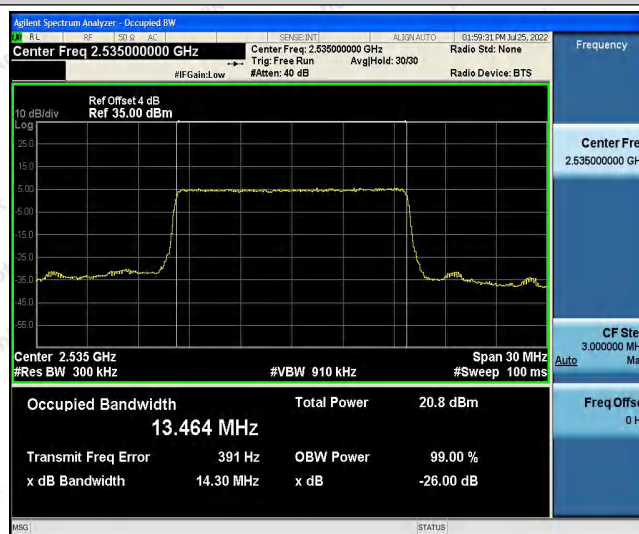


Band7-15MHz-QPSK-21375-75RB#0

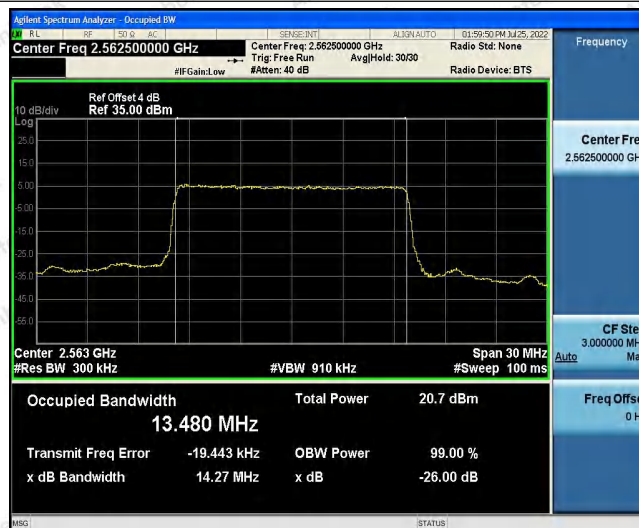


Band7-15MHz-16QAM-20825-75RB#0

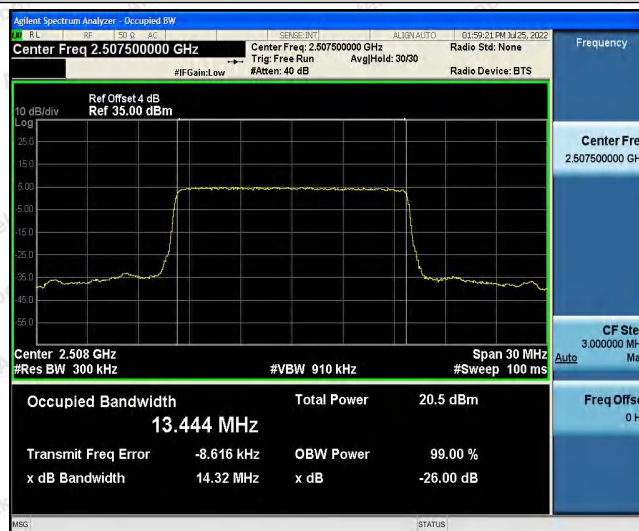


Band7-15MHz-16QAM-21100-75RB#0

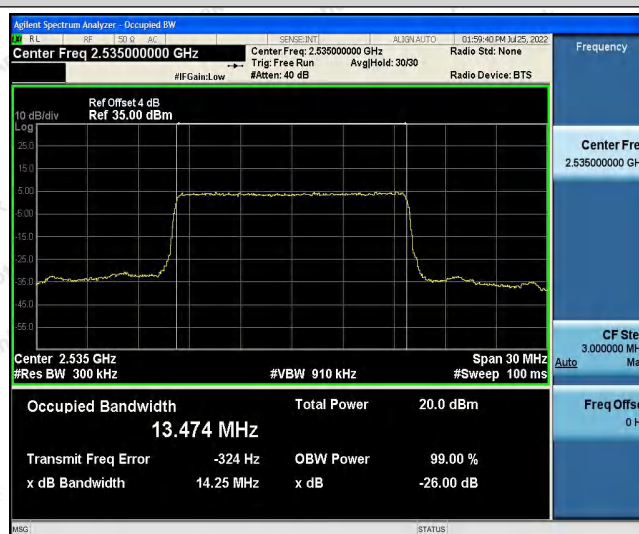


Band7-15MHz-16QAM-21375-75RB#0

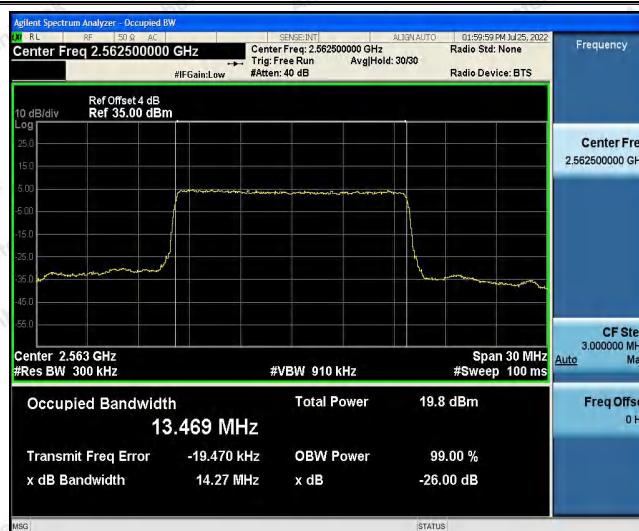

Band7-20MHz-QPSK-20850-100RB#0

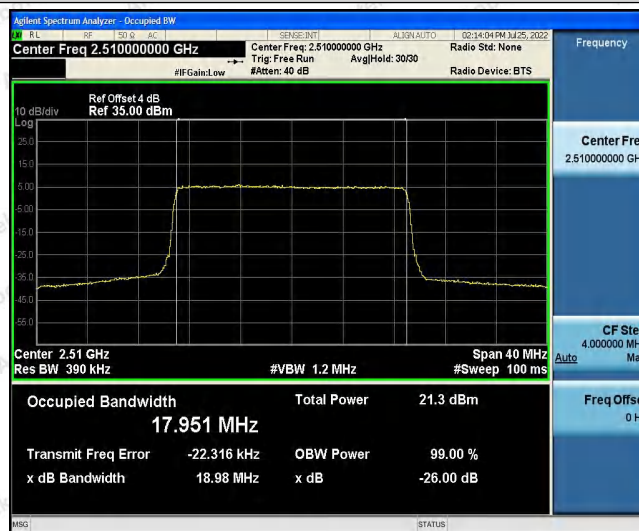

Band7-20MHz-QPSK-21100-100RB#0

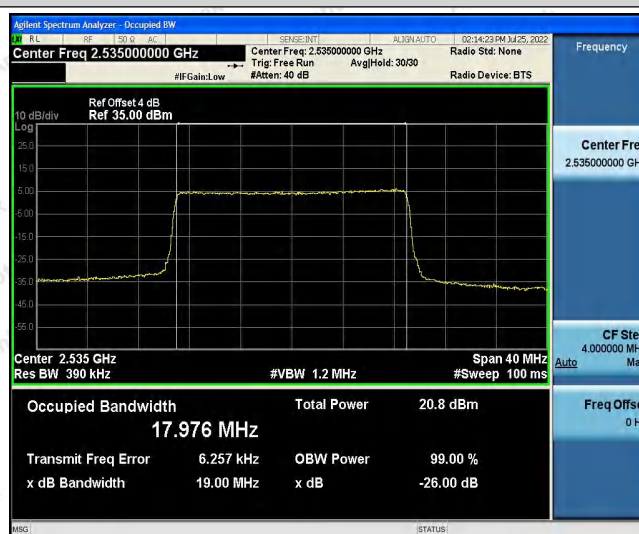

Band7-20MHz-QPSK-21350-100RB#0


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com

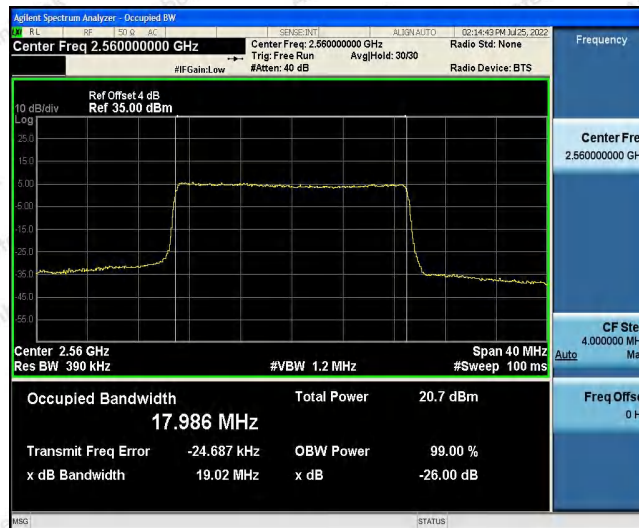


Band7-20MHz-16QAM-20850-100RB#0

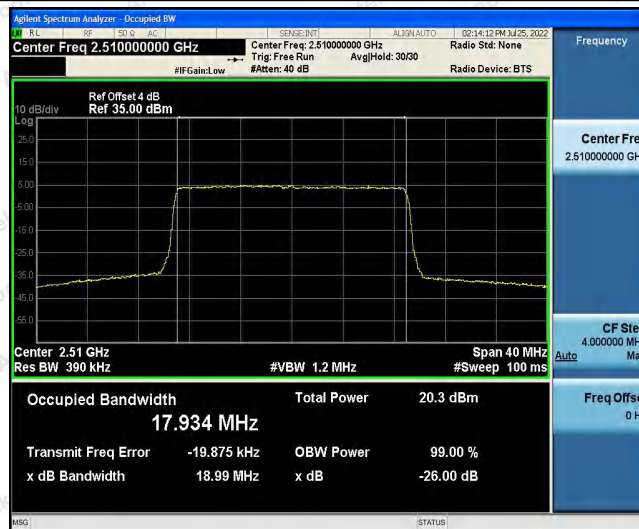


Band7-20MHz-16QAM-21100-100RB#0

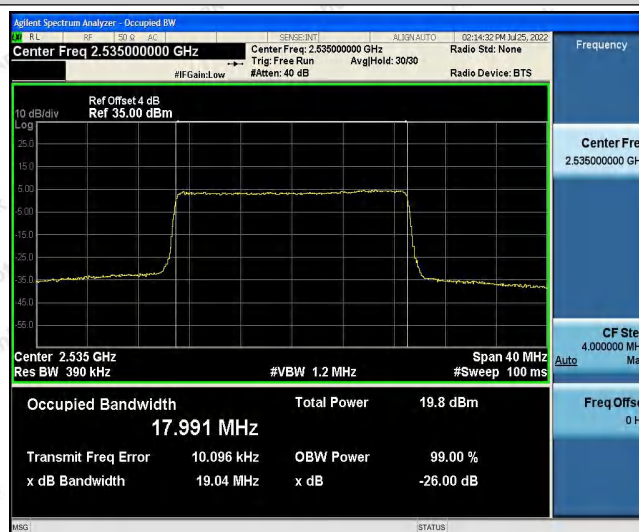


Band7-20MHz-16QAM-21350-100RB#0

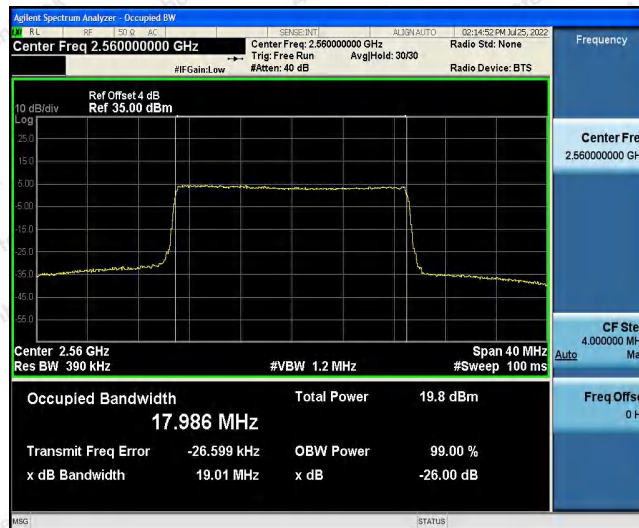


Band41-5MHz-QPSK-40265-25RB#0

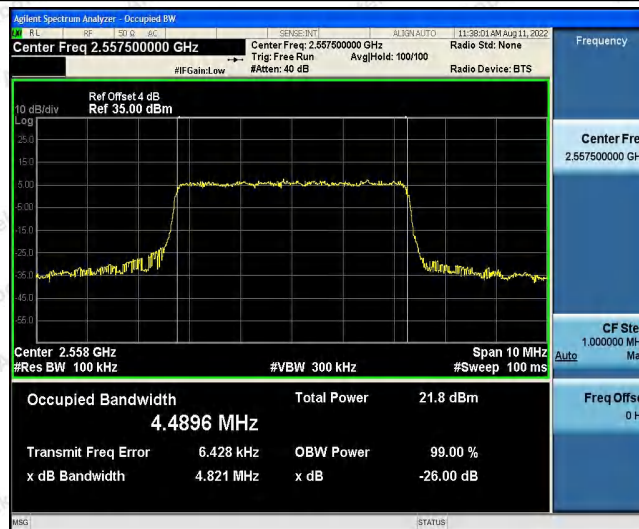


Band41-5MHz-QPSK-40690-25RB#0

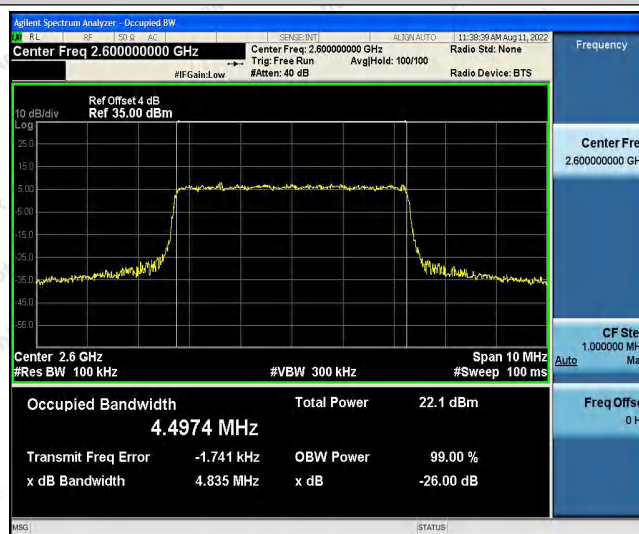


Band41-5MHz-QPSK-41215-25RB#0

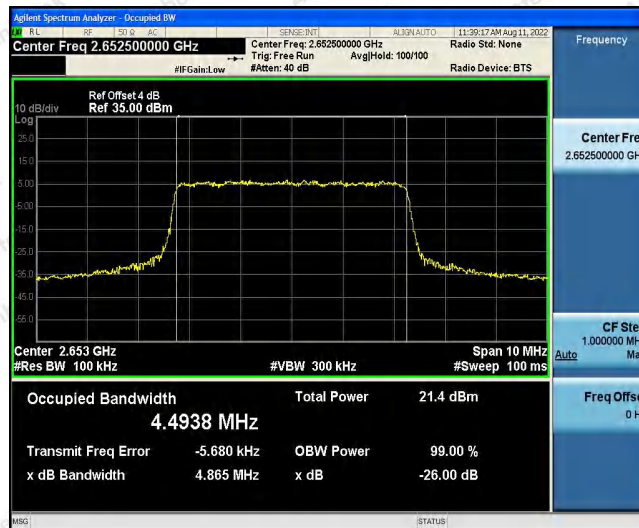


Band41-5MHz-16QAM-40265-25RB#0

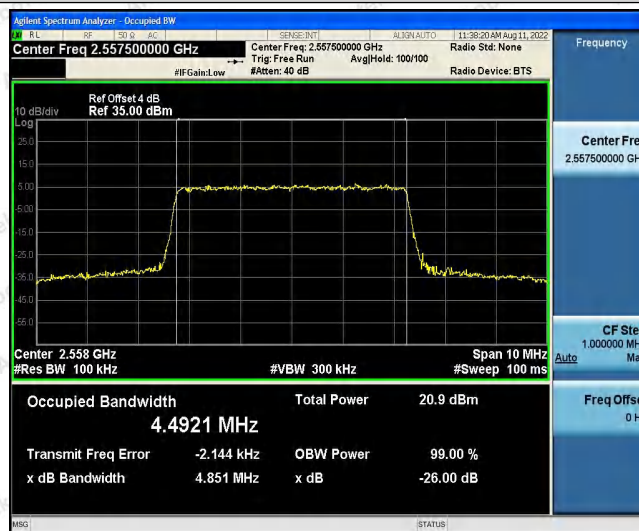


Band41-5MHz-16QAM-40690-25RB#0

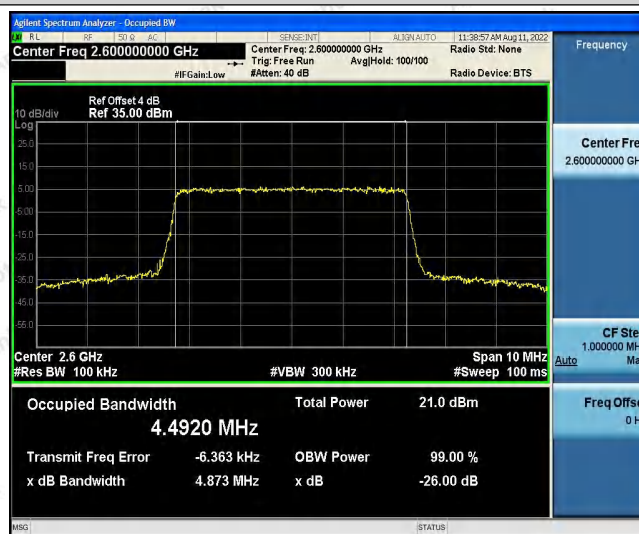


Band41-5MHz-16QAM-41215-25RB#0

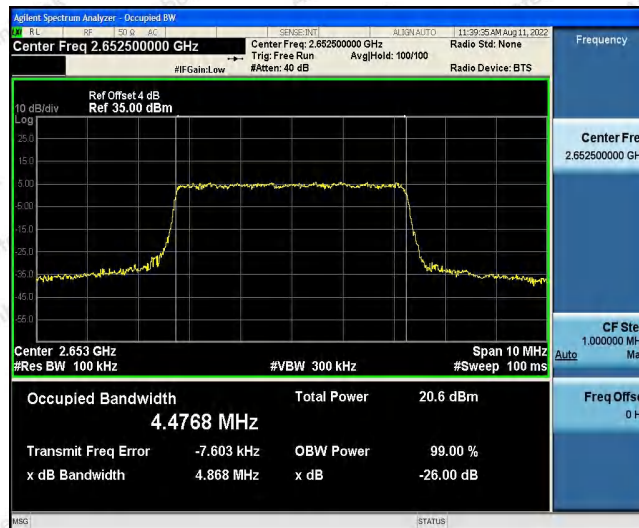


Band41-10MHz-QPSK-40290-50RB#0

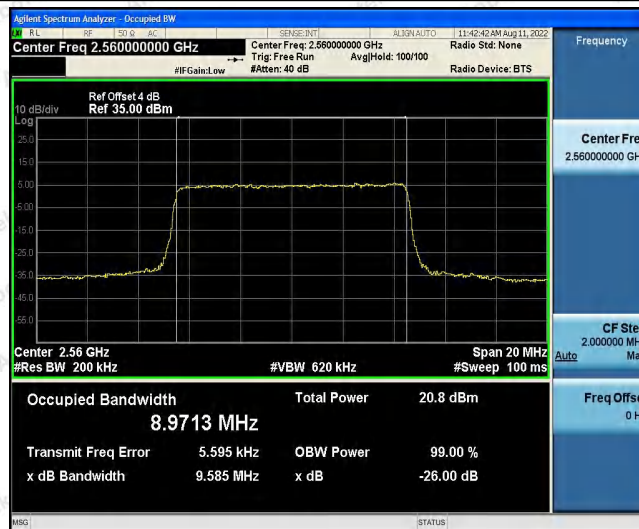


Band41-10MHz-QPSK-40690-50RB#0

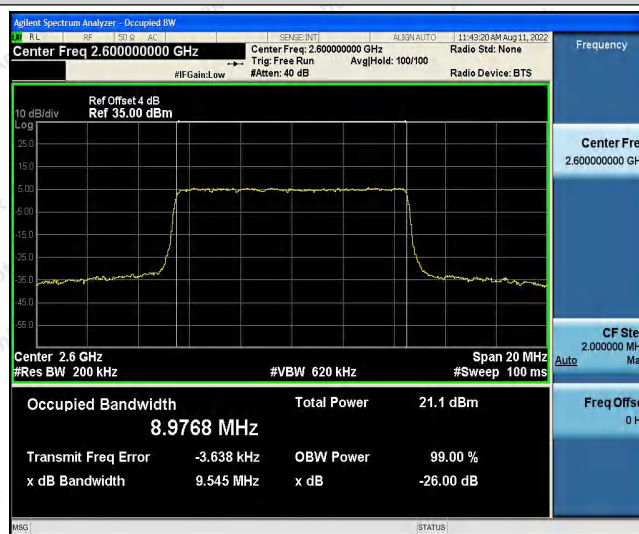


Band41-10MHz-QPSK-41190-50RB#0

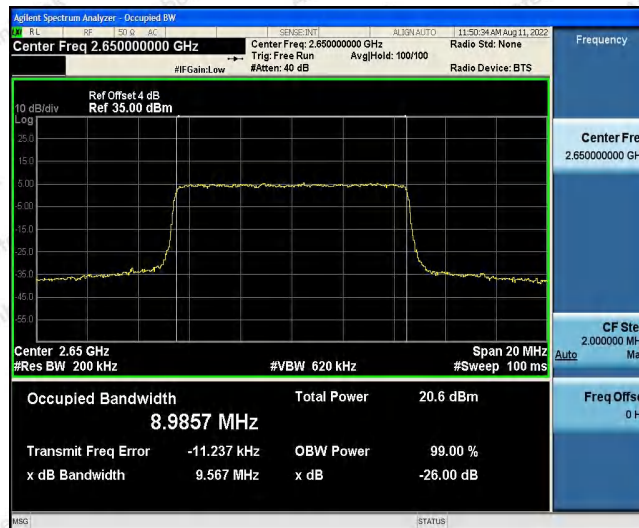


Band41-10MHz-16QAM-40290-50RB#0

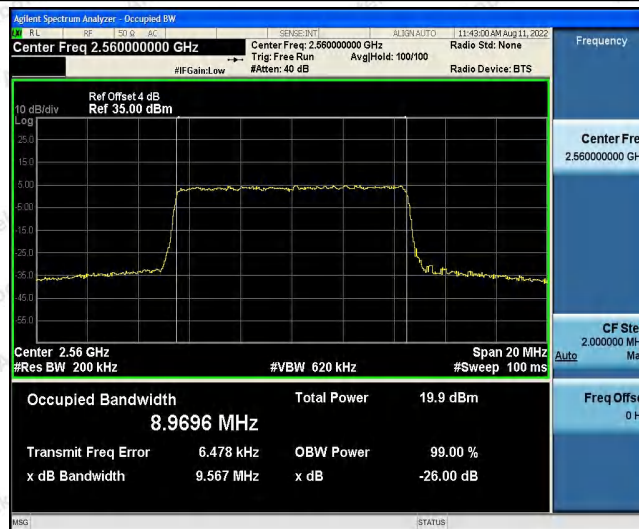


Band41-10MHz-16QAM-40690-50RB#0

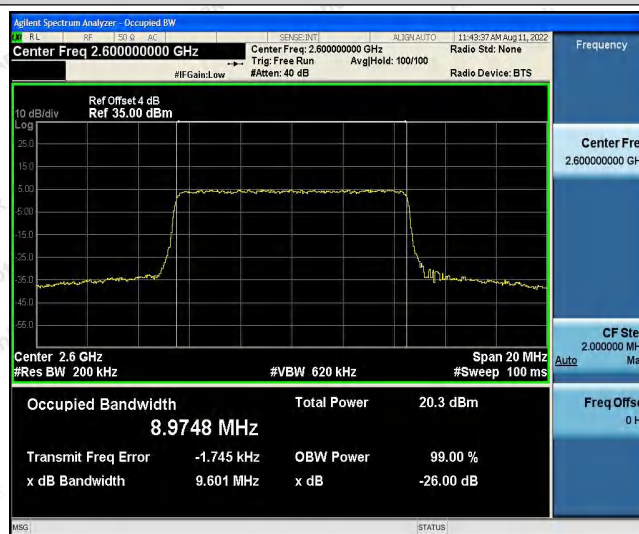

Band41-10MHz-16QAM-41190-50RB#0

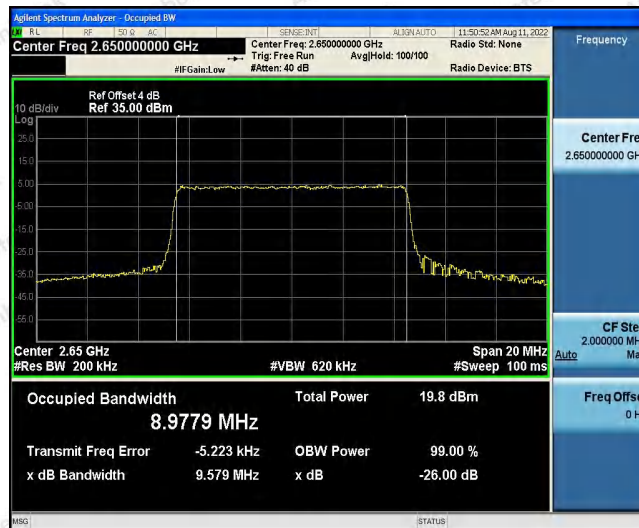


Band41-15MHz-QPSK-40315-75RB#0

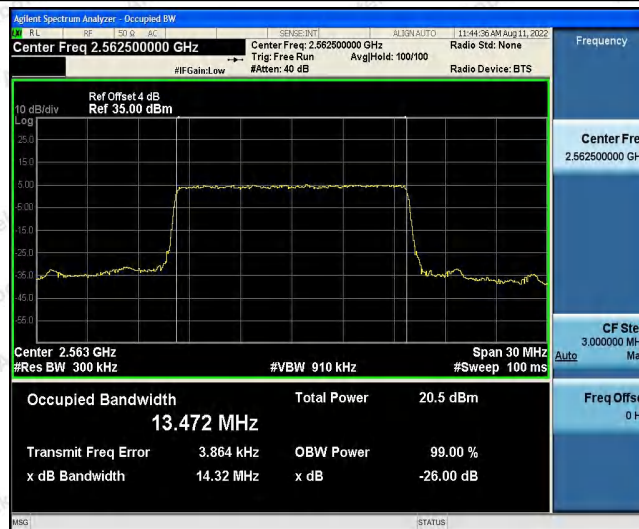


Band41-15MHz-QPSK-40690-75RB#0




Band41-15MHz-QPSK-41165-75RB#0

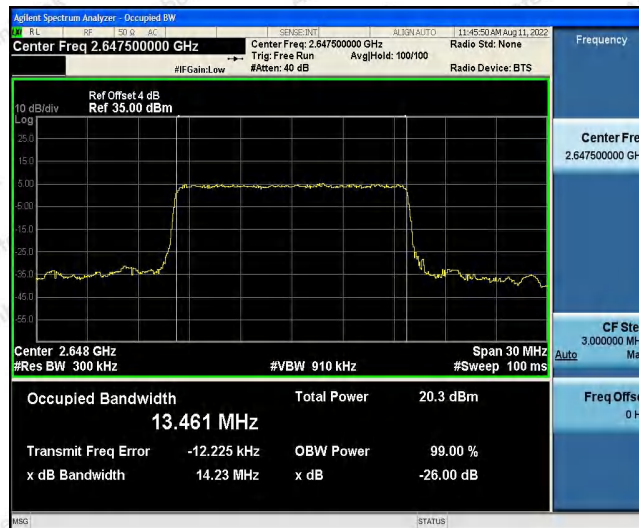


Band41-15MHz-16QAM-40315-75RB#0

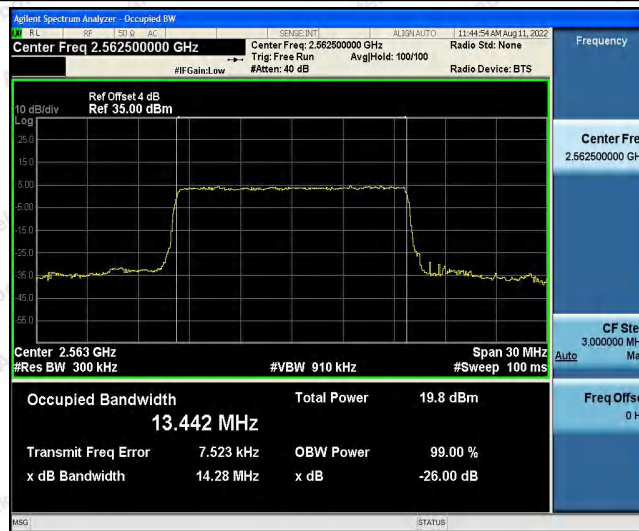


Band41-15MHz-16QAM-40690-75RB#0

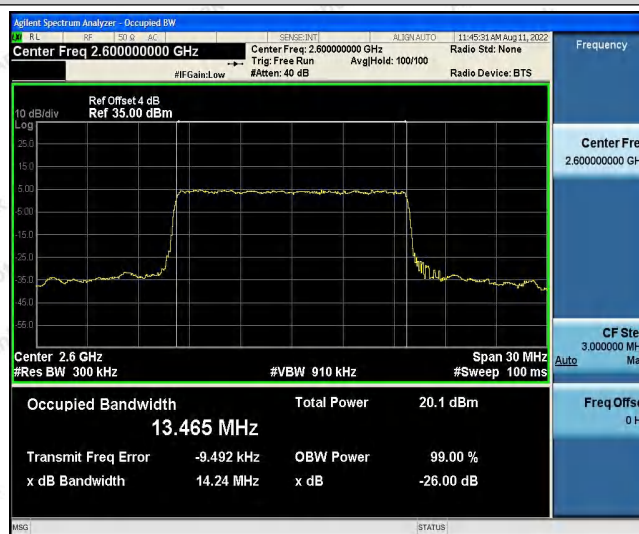


Band41-15MHz-16QAM-41165-75RB#0

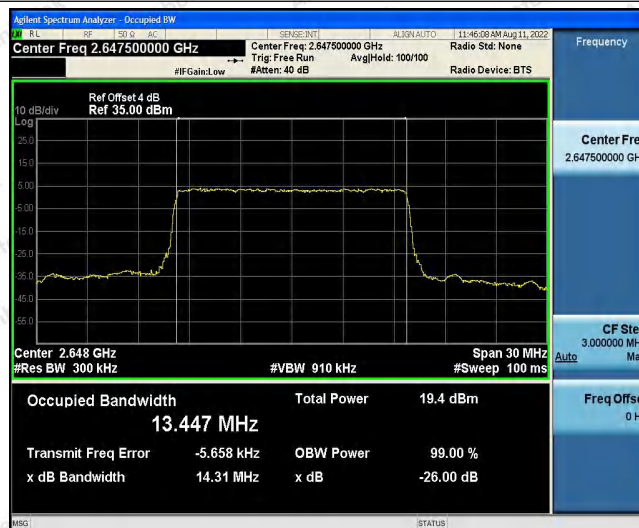


Band41-20MHz-QPSK-40340-100RB#0

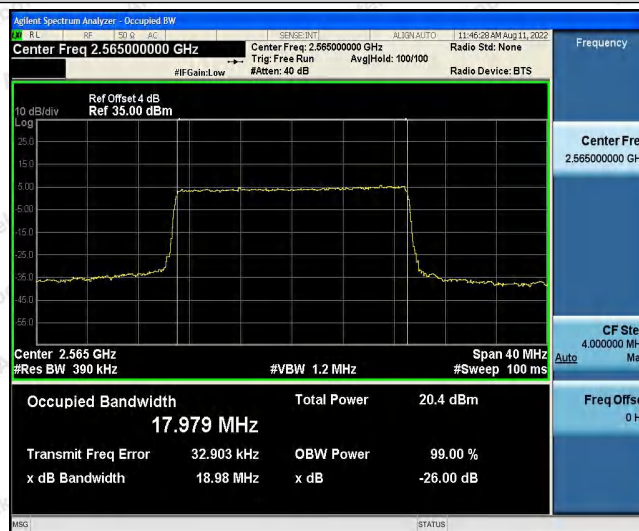


Band41-20MHz-QPSK-40690-100RB#0

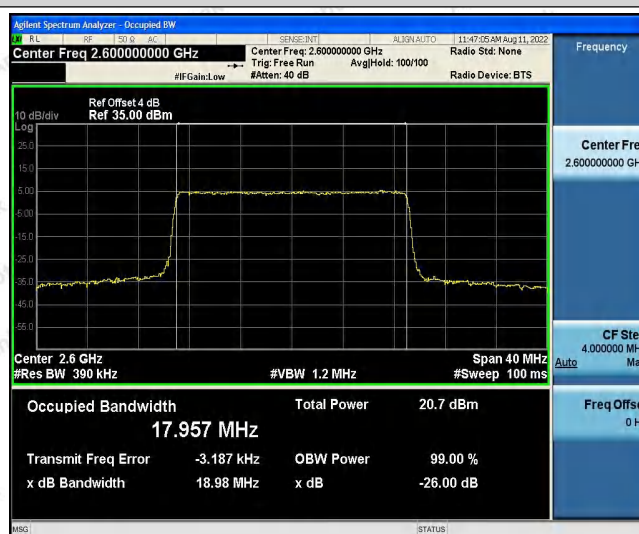


Band41-20MHz-QPSK-41140-100RB#0

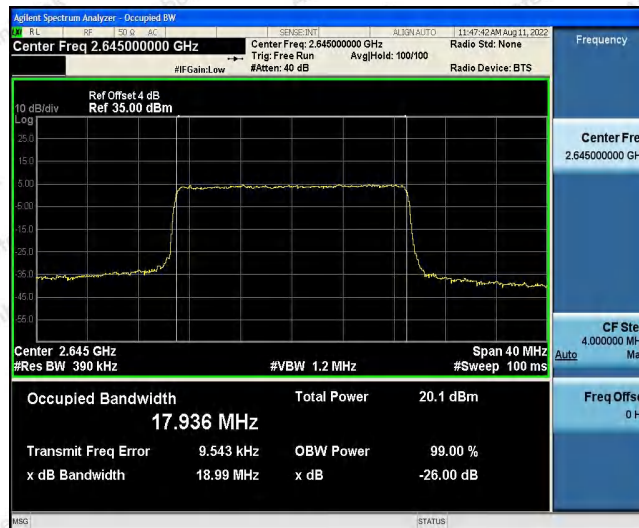


Band41-20MHz-16QAM-40340-100RB#0

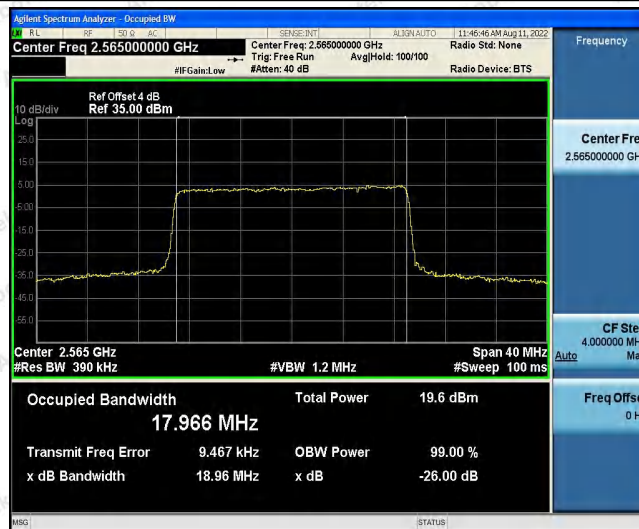

Band41-20MHz-16QAM-40690-100RB#0

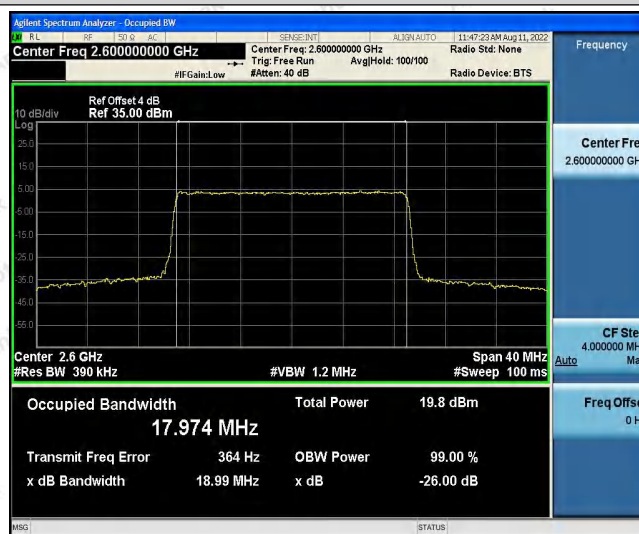

Band41-20MHz-16QAM-41140-100RB#0

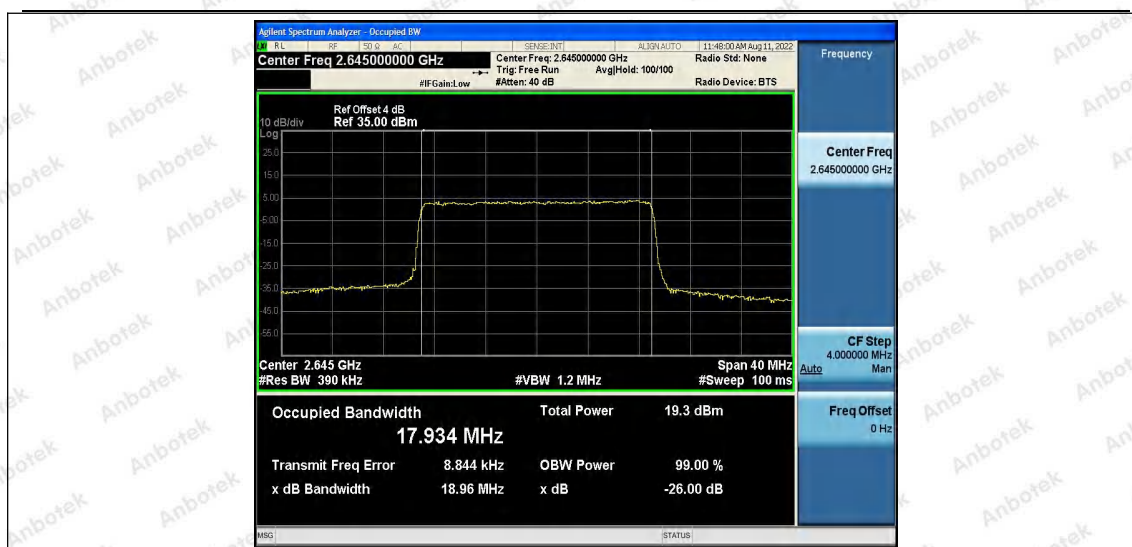**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Appendix D: Band Edge

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band2	1.4MHz	QPSK	18607	1RB#0	-19.24	PASS
Band2	1.4MHz	QPSK	18607	1RB#5	-39.42	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	-27.60	PASS
Band2	1.4MHz	QPSK	19193	1RB#0	-46.87	PASS
Band2	1.4MHz	QPSK	19193	1RB#5	-30.13	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	-37.03	PASS
Band2	1.4MHz	16QAM	18607	1RB#0	-20.67	PASS
Band2	1.4MHz	16QAM	18607	1RB#5	-38.80	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	-30.81	PASS
Band2	1.4MHz	16QAM	19193	1RB#0	-47.70	PASS
Band2	1.4MHz	16QAM	19193	1RB#5	-30.22	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	-37.68	PASS
Band2	3MHz	QPSK	18615	1RB#0	-24.44	PASS
Band2	3MHz	QPSK	18615	1RB#14	-24.04	PASS
Band2	3MHz	QPSK	18615	15RB#0	-20.03	PASS
Band2	3MHz	QPSK	19185	1RB#0	-25.36	PASS
Band2	3MHz	QPSK	19185	1RB#14	-29.48	PASS
Band2	3MHz	QPSK	19185	15RB#0	-21.74	PASS
Band2	3MHz	16QAM	18615	1RB#0	-25.74	PASS
Band2	3MHz	16QAM	18615	1RB#14	-24.12	PASS
Band2	3MHz	16QAM	18615	15RB#0	-19.22	PASS
Band2	3MHz	16QAM	19185	1RB#0	-26.72	PASS
Band2	3MHz	16QAM	19185	1RB#14	-28.87	PASS
Band2	3MHz	16QAM	19185	15RB#0	-23.22	PASS
Band2	5MHz	QPSK	18625	1RB#0	-13.97	PASS
Band2	5MHz	QPSK	18625	1RB#24	-31.27	PASS
Band2	5MHz	QPSK	18625	25RB#0	-21.74	PASS
Band2	5MHz	QPSK	19175	1RB#0	-35.25	PASS
Band2	5MHz	QPSK	19175	1RB#24	-14.91	PASS
Band2	5MHz	QPSK	19175	25RB#0	-27.18	PASS
Band2	5MHz	16QAM	18625	1RB#0	-14.30	PASS
Band2	5MHz	16QAM	18625	1RB#24	-31.73	PASS
Band2	5MHz	16QAM	18625	25RB#0	-25.34	PASS
Band2	5MHz	16QAM	19175	1RB#0	-34.89	PASS
Band2	5MHz	16QAM	19175	1RB#24	-15.43	PASS
Band2	5MHz	16QAM	19175	25RB#0	-27.44	PASS

Band2	10MHz	QPSK	18650	1RB#0	-16.91	PASS
Band2	10MHz	QPSK	18650	1RB#49	-33.66	PASS
Band2	10MHz	QPSK	18650	50RB#0	-27.90	PASS
Band2	10MHz	QPSK	19150	1RB#0	-37.85	PASS
Band2	10MHz	QPSK	19150	1RB#49	-16.82	PASS
Band2	10MHz	QPSK	19150	50RB#0	-29.76	PASS
Band2	10MHz	16QAM	18650	1RB#0	-17.58	PASS
Band2	10MHz	16QAM	18650	1RB#49	-33.91	PASS
Band2	10MHz	16QAM	18650	50RB#0	-27.48	PASS
Band2	10MHz	16QAM	19150	1RB#0	-37.64	PASS
Band2	10MHz	16QAM	19150	1RB#49	-17.38	PASS
Band2	10MHz	16QAM	19150	50RB#0	-30.06	PASS
Band2	15MHz	QPSK	18675	1RB#0	-15.26	PASS
Band2	15MHz	QPSK	18675	1RB#74	-37.52	PASS
Band2	15MHz	QPSK	18675	75RB#0	-27.71	PASS
Band2	15MHz	QPSK	19125	1RB#0	-40.04	PASS
Band2	15MHz	QPSK	19125	1RB#74	-17.26	PASS
Band2	15MHz	QPSK	19125	75RB#0	-29.86	PASS
Band2	15MHz	16QAM	18675	1RB#0	-15.96	PASS
Band2	15MHz	16QAM	18675	1RB#74	-37.87	PASS
Band2	15MHz	16QAM	18675	75RB#0	-27.91	PASS
Band2	15MHz	16QAM	19125	1RB#0	-39.39	PASS
Band2	15MHz	16QAM	19125	1RB#74	-17.12	PASS
Band2	15MHz	16QAM	19125	75RB#0	-29.30	PASS
Band2	20MHz	QPSK	18700	1RB#0	-17.45	PASS
Band2	20MHz	QPSK	18700	1RB#99	-38.82	PASS
Band2	20MHz	QPSK	18700	100RB#0	-31.10	PASS
Band2	20MHz	QPSK	19100	1RB#0	-40.03	PASS
Band2	20MHz	QPSK	19100	1RB#99	-18.53	PASS
Band2	20MHz	QPSK	19100	100RB#0	-32.61	PASS
Band2	20MHz	16QAM	18700	1RB#0	-17.80	PASS
Band2	20MHz	16QAM	18700	1RB#99	-38.64	PASS
Band2	20MHz	16QAM	18700	100RB#0	-29.77	PASS
Band2	20MHz	16QAM	19100	1RB#0	-39.54	PASS
Band2	20MHz	16QAM	19100	1RB#99	-18.29	PASS
Band2	20MHz	16QAM	19100	100RB#0	-32.37	PASS
Band4	1.4MHz	QPSK	19957	1RB#0	-18.27	PASS
Band4	1.4MHz	QPSK	19957	1RB#5	-40.21	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	-26.95	PASS
Band4	1.4MHz	QPSK	20393	1RB#0	-43.57	PASS
Band4	1.4MHz	QPSK	20393	1RB#5	-21.27	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	-31.47	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com

 Hotline
 400-003-0500
www.anbotech.com

Band4	1.4MHz	16QAM	19957	1RB#0	-22.85	PASS
Band4	1.4MHz	16QAM	19957	1RB#5	-40.98	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	-26.39	PASS
Band4	1.4MHz	16QAM	20393	1RB#0	-44.47	PASS
Band4	1.4MHz	16QAM	20393	1RB#5	-21.50	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	-30.13	PASS
Band4	3MHz	QPSK	19965	1RB#0	-22.09	PASS
Band4	3MHz	QPSK	19965	1RB#14	-22.22	PASS
Band4	3MHz	QPSK	19965	15RB#0	-17.96	PASS
Band4	3MHz	QPSK	20385	1RB#0	-24.27	PASS
Band4	3MHz	QPSK	20385	1RB#14	-26.63	PASS
Band4	3MHz	QPSK	20385	15RB#0	-21.14	PASS
Band4	3MHz	16QAM	19965	1RB#0	-23.36	PASS
Band4	3MHz	16QAM	19965	1RB#14	-24.04	PASS
Band4	3MHz	16QAM	19965	15RB#0	-17.79	PASS
Band4	3MHz	16QAM	20385	1RB#0	-26.15	PASS
Band4	3MHz	16QAM	20385	1RB#14	-29.99	PASS
Band4	3MHz	16QAM	20385	15RB#0	-20.54	PASS
Band4	5MHz	QPSK	19975	1RB#0	-13.56	PASS
Band4	5MHz	QPSK	19975	1RB#24	-30.56	PASS
Band4	5MHz	QPSK	19975	25RB#0	-23.10	PASS
Band4	5MHz	QPSK	20375	1RB#0	-33.40	PASS
Band4	5MHz	QPSK	20375	1RB#24	-14.78	PASS
Band4	5MHz	QPSK	20375	25RB#0	-25.67	PASS
Band4	5MHz	16QAM	19975	1RB#0	-13.38	PASS
Band4	5MHz	16QAM	19975	1RB#24	-31.80	PASS
Band4	5MHz	16QAM	19975	25RB#0	-23.34	PASS
Band4	5MHz	16QAM	20375	1RB#0	-33.46	PASS
Band4	5MHz	16QAM	20375	1RB#24	-15.18	PASS
Band4	5MHz	16QAM	20375	25RB#0	-26.68	PASS
Band4	10MHz	QPSK	20000	1RB#0	-15.32	PASS
Band4	10MHz	QPSK	20000	1RB#49	-33.57	PASS
Band4	10MHz	QPSK	20000	50RB#0	-27.06	PASS
Band4	10MHz	QPSK	20350	1RB#0	-36.66	PASS
Band4	10MHz	QPSK	20350	1RB#49	-17.30	PASS
Band4	10MHz	QPSK	20350	50RB#0	-28.22	PASS
Band4	10MHz	16QAM	20000	1RB#0	-15.63	PASS
Band4	10MHz	16QAM	20000	1RB#49	-33.10	PASS
Band4	10MHz	16QAM	20000	50RB#0	-26.93	PASS
Band4	10MHz	16QAM	20350	1RB#0	-37.16	PASS
Band4	10MHz	16QAM	20350	1RB#49	-16.64	PASS
Band4	10MHz	16QAM	20350	50RB#0	-28.93	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com



Hotline
 400-003-0500

www.anbotech.com

Band4	15MHz	QPSK	20025	1RB#0	-14.89	PASS
Band4	15MHz	QPSK	20025	1RB#74	-37.15	PASS
Band4	15MHz	QPSK	20025	75RB#0	-27.37	PASS
Band4	15MHz	QPSK	20325	1RB#0	-38.90	PASS
Band4	15MHz	QPSK	20325	1RB#74	-16.48	PASS
Band4	15MHz	QPSK	20325	75RB#0	-28.40	PASS
Band4	15MHz	16QAM	20025	1RB#0	-15.26	PASS
Band4	15MHz	16QAM	20025	1RB#74	-37.03	PASS
Band4	15MHz	16QAM	20025	75RB#0	-27.05	PASS
Band4	15MHz	16QAM	20325	1RB#0	-38.51	PASS
Band4	15MHz	16QAM	20325	1RB#74	-16.41	PASS
Band4	15MHz	16QAM	20325	75RB#0	-27.72	PASS
Band4	20MHz	QPSK	20050	1RB#0	-17.73	PASS
Band4	20MHz	QPSK	20050	1RB#99	-38.13	PASS
Band4	20MHz	QPSK	20050	100RB#0	-29.78	PASS
Band4	20MHz	QPSK	20300	1RB#0	-27.91	PASS
Band4	20MHz	QPSK	20300	1RB#99	-17.96	PASS
Band4	20MHz	QPSK	20300	100RB#0	-31.71	PASS
Band4	20MHz	16QAM	20050	1RB#0	-17.28	PASS
Band4	20MHz	16QAM	20050	1RB#99	-38.01	PASS
Band4	20MHz	16QAM	20050	100RB#0	-28.67	PASS
Band4	20MHz	16QAM	20300	1RB#0	-28.80	PASS
Band4	20MHz	16QAM	20300	1RB#99	-19.79	PASS
Band4	20MHz	16QAM	20300	100RB#0	-31.59	PASS
Band5	1.4MHz	QPSK	20407	1RB#0	-21.19	PASS
Band5	1.4MHz	QPSK	20407	1RB#5	-37.56	PASS
Band5	1.4MHz	QPSK	20407	6RB#0	-23.18	PASS
Band5	1.4MHz	QPSK	20643	1RB#0	-38.82	PASS
Band5	1.4MHz	QPSK	20643	1RB#5	-23.52	PASS
Band5	1.4MHz	QPSK	20643	6RB#0	-24.40	PASS
Band5	1.4MHz	16QAM	20407	1RB#0	-23.62	PASS
Band5	1.4MHz	16QAM	20407	1RB#5	-38.39	PASS
Band5	1.4MHz	16QAM	20407	6RB#0	-22.75	PASS
Band5	1.4MHz	16QAM	20643	1RB#0	-40.94	PASS
Band5	1.4MHz	16QAM	20643	1RB#5	-21.86	PASS
Band5	1.4MHz	16QAM	20643	6RB#0	-24.78	PASS
Band5	3MHz	QPSK	20415	1RB#0	-23.96	PASS
Band5	3MHz	QPSK	20415	1RB#14	-22.07	PASS
Band5	3MHz	QPSK	20415	15RB#0	-18.02	PASS
Band5	3MHz	QPSK	20635	1RB#0	-24.64	PASS
Band5	3MHz	QPSK	20635	1RB#14	-24.15	PASS
Band5	3MHz	QPSK	20635	15RB#0	-19.65	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500

www.anbotek.com

Band5	3MHz	16QAM	20415	1RB#0	-23.26	PASS
Band5	3MHz	16QAM	20415	1RB#14	-22.23	PASS
Band5	3MHz	16QAM	20415	15RB#0	-17.29	PASS
Band5	3MHz	16QAM	20635	1RB#0	-24.86	PASS
Band5	3MHz	16QAM	20635	1RB#14	-25.79	PASS
Band5	3MHz	16QAM	20635	15RB#0	-20.57	PASS
Band5	5MHz	QPSK	20425	1RB#0	-23.38	PASS
Band5	5MHz	QPSK	20425	1RB#24	-30.23	PASS
Band5	5MHz	QPSK	20425	25RB#0	-21.18	PASS
Band5	5MHz	QPSK	20625	1RB#0	-31.78	PASS
Band5	5MHz	QPSK	20625	1RB#24	-23.57	PASS
Band5	5MHz	QPSK	20625	25RB#0	-23.65	PASS
Band5	5MHz	16QAM	20425	1RB#0	-25.93	PASS
Band5	5MHz	16QAM	20425	1RB#24	-30.24	PASS
Band5	5MHz	16QAM	20425	25RB#0	-21.14	PASS
Band5	5MHz	16QAM	20625	1RB#0	-31.64	PASS
Band5	5MHz	16QAM	20625	1RB#24	-24.12	PASS
Band5	5MHz	16QAM	20625	25RB#0	-23.50	PASS
Band5	10MHz	QPSK	20450	1RB#0	-15.13	PASS
Band5	10MHz	QPSK	20450	1RB#49	-34.77	PASS
Band5	10MHz	QPSK	20450	50RB#0	-23.90	PASS
Band5	10MHz	QPSK	20600	1RB#0	-34.67	PASS
Band5	10MHz	QPSK	20600	1RB#49	-16.28	PASS
Band5	10MHz	QPSK	20600	50RB#0	-26.08	PASS
Band5	10MHz	16QAM	20450	1RB#0	-16.46	PASS
Band5	10MHz	16QAM	20450	1RB#49	-35.31	PASS
Band5	10MHz	16QAM	20450	50RB#0	-24.77	PASS
Band5	10MHz	16QAM	20600	1RB#0	-35.29	PASS
Band5	10MHz	16QAM	20600	1RB#49	-16.14	PASS
Band5	10MHz	16QAM	20600	50RB#0	-26.47	PASS
Band7	5MHz	QPSK	20775	1RB#0	-52.52,-44.70,- 44.36,-12.60	PASS
Band7	5MHz	QPSK	20775	1RB#24	-53.97,-39.91,- 39.78,-32.81	PASS
Band7	5MHz	QPSK	20775	25RB#0	-46.50,-38.51,- 35.14,-23.57	PASS
Band7	5MHz	QPSK	21425	1RB#0	-33.54,-43.88,- 53.38,-53.18	PASS
Band7	5MHz	QPSK	21425	1RB#24	-15.84,-42.12,- 53.06,-52.91	PASS
Band7	5MHz	QPSK	21425	25RB#0	-25.40,-33.11,- 43.39,-44.32	PASS
Band7	5MHz	16QAM	20775	1RB#0	-51.96,-45.31,-	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com



Hotline
400-003-0500

www.anbotech.com

					45.31,-13.53	
Band7	5MHz	16QAM	20775	1RB#24	-54.03,-36.41,- 36.41,-33.25	PASS
Band7	5MHz	16QAM	20775	25RB#0	-47.45,-41.83,- 34.61,-25.39	PASS
Band7	5MHz	16QAM	21425	1RB#0	-33.76,-42.11,- 52.94,-53.32	PASS
Band7	5MHz	16QAM	21425	1RB#24	-14.73,-42.94,- 53.24,-53.05	PASS
Band7	5MHz	16QAM	21425	25RB#0	-26.88,-33.34,- 44.29,-45.16	PASS
Band7	10MHz	QPSK	20800	1RB#0	-51.75,-44.37,- 42.03,-15.53	PASS
Band7	10MHz	QPSK	20800	1RB#49	-51.62,-35.54,- 41.95,-36.12	PASS
Band7	10MHz	QPSK	20800	50RB#0	-45.90,-37.41,- 35.21,-28.68	PASS
Band7	10MHz	QPSK	21400	1RB#0	-37.14,-41.59,- 38.65,-51.54	PASS
Band7	10MHz	QPSK	21400	1RB#49	-17.97,-43.07,- 45.11,-51.32	PASS
Band7	10MHz	QPSK	21400	50RB#0	-28.41,-33.74,- 35.83,-44.75	PASS
Band7	10MHz	16QAM	20800	1RB#0	-51.89,-46.57,- 41.28,-16.51	PASS
Band7	10MHz	16QAM	20800	1RB#49	-51.89,-34.31,- 41.02,-36.47	PASS
Band7	10MHz	16QAM	20800	50RB#0	-45.68,-37.42,- 34.54,-27.92	PASS
Band7	10MHz	16QAM	21400	1RB#0	-37.88,-42.58,- 35.66,-51.49	PASS
Band7	10MHz	16QAM	21400	1RB#49	-17.88,-42.15,- 45.32,-51.52	PASS
Band7	10MHz	16QAM	21400	50RB#0	-27.84,-33.45,- 36.08,-44.19	PASS
Band7	15MHz	QPSK	20825	1RB#0	-48.55,-41.53,- 44.00,-16.20	PASS
Band7	15MHz	QPSK	20825	1RB#74	-33.63,-39.87,- 48.71,-38.84	PASS
Band7	15MHz	QPSK	20825	75RB#0	-38.39,-34.82,- 31.76,-29.63	PASS
Band7	15MHz	QPSK	21375	1RB#0	-40.51,-49.46,- 38.59,-49.95	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com



Hotline
400-003-0500
www.anbotech.com

Band7	15MHz	QPSK	21375	1RB#74	-17.92,-45.19,- 42.19,-50.06	PASS
Band7	15MHz	QPSK	21375	75RB#0	-28.93,-31.40,- 34.68,-44.22	PASS
Band7	15MHz	16QAM	20825	1RB#0	-48.58,-42.61,- 44.30,-17.42	PASS
Band7	15MHz	16QAM	20825	1RB#74	-31.81,-39.62,- 49.41,-40.14	PASS
Band7	15MHz	16QAM	20825	75RB#0	-40.95,-36.03,- 33.11,-29.06	PASS
Band7	15MHz	16QAM	21375	1RB#0	-41.08,-49.66,- 35.39,-50.06	PASS
Band7	15MHz	16QAM	21375	1RB#74	-17.80,-45.18,- 42.53,-50.33	PASS
Band7	15MHz	16QAM	21375	75RB#0	-27.67,-33.06,- 35.47,-45.28	PASS
Band7	20MHz	QPSK	20850	1RB#0	-48.19,-39.15,- 40.31,-19.35	PASS
Band7	20MHz	QPSK	20850	1RB#99	-33.05,-35.99,- 46.05,-38.50	PASS
Band7	20MHz	QPSK	20850	100RB#0	-38.38,-35.73,- 33.34,-30.85	PASS
Band7	20MHz	QPSK	21350	1RB#0	-42.72,-47.40,- 39.11,-49.26	PASS
Band7	20MHz	QPSK	21350	1RB#99	-20.03,-43.82,- 38.80,-48.97	PASS
Band7	20MHz	QPSK	21350	100RB#0	-30.63,-34.51,- 36.53,-46.83	PASS
Band7	20MHz	16QAM	20850	1RB#0	-48.17,-39.92,- 41.95,-18.88	PASS
Band7	20MHz	16QAM	20850	1RB#99	-32.84,-35.78,- 45.76,-38.73	PASS
Band7	20MHz	16QAM	20850	100RB#0	-38.85,-36.02,- 34.27,-30.54	PASS
Band7	20MHz	16QAM	21350	1RB#0	-41.15,-47.51,- 38.12,-48.75	PASS
Band7	20MHz	16QAM	21350	1RB#99	-19.58,-31.57,- 38.74,-49.06	PASS
Band7	20MHz	16QAM	21350	100RB#0	-32.34,-35.07,- 36.62,-47.02	PASS
Band41	5MHz	QPSK	40265	1RB#0	-44.96,-43.30,- 31.60,-13.95	PASS
Band41	5MHz	QPSK	40265	1RB#24	-48.92,-48.74,-	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com



Hotline
400-003-0500

www.anbotech.com

					42.38,-33.63	
Band41	5MHz	QPSK	40265	25RB#0	-44.80,-43.48,- 34.17,-25.90	PASS
Band41	5MHz	QPSK	41215	1RB#0	-33.06,-42.11,- 46.97,-46.89	PASS
Band41	5MHz	QPSK	41215	1RB#24	-15.10,-30.49,- 42.05,-43.07	PASS
Band41	5MHz	QPSK	41215	25RB#0	-25.70,-33.29,- 42.43,-44.33	PASS
Band41	5MHz	16QAM	40265	1RB#0	-45.10,-43.54,- 32.87,-14.96	PASS
Band41	5MHz	16QAM	40265	1RB#24	-49.01,-48.68,- 39.52,-33.65	PASS
Band41	5MHz	16QAM	40265	25RB#0	-46.09,-44.16,- 33.01,-24.96	PASS
Band41	5MHz	16QAM	41215	1RB#0	-32.76,-38.69,- 46.83,-46.91	PASS
Band41	5MHz	16QAM	41215	1RB#24	-14.55,-30.10,- 41.66,-42.92	PASS
Band41	5MHz	16QAM	41215	25RB#0	-25.46,-33.37,- 44.45,-45.91	PASS
Band41	10MHz	QPSK	40290	1RB#0	-44.19,-39.08,- 27.37,-18.00	PASS
Band41	10MHz	QPSK	40290	1RB#49	-48.62,-39.21,- 42.64,-36.82	PASS
Band41	10MHz	QPSK	40290	50RB#0	-44.96,-35.33,- 33.42,-29.82	PASS
Band41	10MHz	QPSK	41190	1RB#0	-37.10,-41.67,- 42.32,-47.06	PASS
Band41	10MHz	QPSK	41190	1RB#49	-17.83,-26.40,- 36.32,-42.88	PASS
Band41	10MHz	QPSK	41190	50RB#0	-27.54,-32.93,- 37.28,-44.80	PASS
Band41	10MHz	16QAM	40290	1RB#0	-45.98,-41.12,- 29.58,-16.15	PASS
Band41	10MHz	16QAM	40290	1RB#49	-50.41,-37.52,- 40.50,-38.24	PASS
Band41	10MHz	16QAM	40290	50RB#0	-45.04,-36.91,- 33.96,-29.16	PASS
Band41	10MHz	16QAM	41190	1RB#0	-35.77,-41.00,- 37.56,-46.53	PASS
Band41	10MHz	16QAM	41190	1RB#49	-17.19,-26.07,- 36.64,-42.40	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com

 Hotline
400-003-0500
www.anbotech.com

Band41	10MHz	16QAM	41190	50RB#0	-26.26,-30.51,- 38.19,-41.94	PASS
Band41	15MHz	QPSK	40315	1RB#0	-45.25,-37.71,- 26.76,-19.38	PASS
Band41	15MHz	QPSK	40315	1RB#74	-48.89,-38.72,- 43.42,-39.74	PASS
Band41	15MHz	QPSK	40315	75RB#0	-42.80,-33.37,- 32.22,-30.59	PASS
Band41	15MHz	QPSK	41165	1RB#0	-39.40,-43.34,- 42.57,-47.67	PASS
Band41	15MHz	QPSK	41165	1RB#74	-16.78,-28.57,- 37.50,-45.29	PASS
Band41	15MHz	QPSK	41165	75RB#0	-27.48,-31.80,- 34.14,-45.01	PASS
Band41	15MHz	16QAM	40315	1RB#0	-47.26,-39.84,- 29.09,-17.37	PASS
Band41	15MHz	16QAM	40315	1RB#74	-49.42,-33.55,- 42.49,-38.80	PASS
Band41	15MHz	16QAM	40315	75RB#0	-44.06,-34.38,- 33.04,-30.76	PASS
Band41	15MHz	16QAM	41165	1RB#0	-38.34,-42.57,- 39.40,-47.78	PASS
Band41	15MHz	16QAM	41165	1RB#74	-17.35,-27.05,- 37.27,-44.87	PASS
Band41	15MHz	16QAM	41165	75RB#0	-28.54,-33.31,- 36.37,-45.76	PASS
Band41	20MHz	QPSK	40340	1RB#0	-45.07,-36.15,- 26.53,-20.09	PASS
Band41	20MHz	QPSK	40340	1RB#99	-47.89,-33.56,- 42.53,-40.61	PASS
Band41	20MHz	QPSK	40340	100RB#0	-45.54,-35.64,- 34.17,-31.40	PASS
Band41	20MHz	QPSK	41140	1RB#0	-38.79,-42.61,- 41.69,-47.64	PASS
Band41	20MHz	QPSK	41140	1RB#99	-20.02,-28.31,- 37.01,-46.22	PASS
Band41	20MHz	QPSK	41140	100RB#0	-30.60,-33.12,- 36.58,-46.10	PASS
Band41	20MHz	16QAM	40340	1RB#0	-44.47,-35.05,- 26.51,-19.29	PASS
Band41	20MHz	16QAM	40340	1RB#99	-47.88,-32.44,- 41.57,-39.16	PASS
Band41	20MHz	16QAM	40340	100RB#0	-45.65,-35.81,-	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com

 Hotline
400-003-0500
www.anbotech.com

					34.18,-32.11	
Band41	20MHz	16QAM	41140	1RB#0	-37.29,-40.38,- 36.41,-47.88	PASS
Band41	20MHz	16QAM	41140	1RB#99	-16.87,-28.29,- 37.55,-46.17	PASS
Band41	20MHz	16QAM	41140	100RB#0	-31.61,-35.01,- 37.43,-45.96	PASS

Test Graphs


Band2-1.4MHz-QPSK-18607-1RB#0

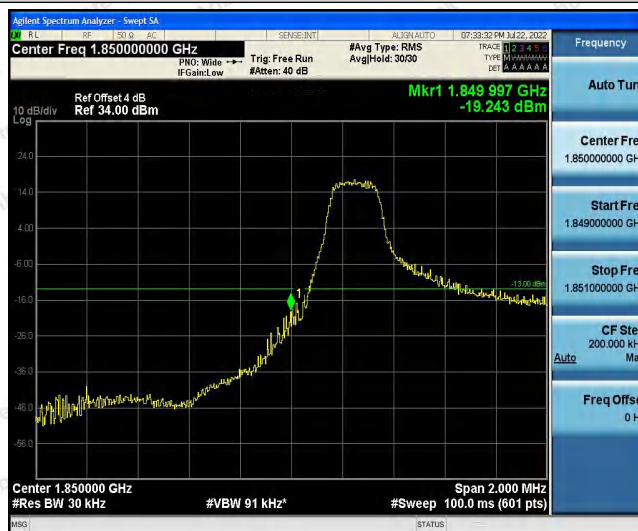

Band2-1.4MHz-QPSK-18607-1RB#5



Band2-1.4MHz-QPSK-18607-6RB#0

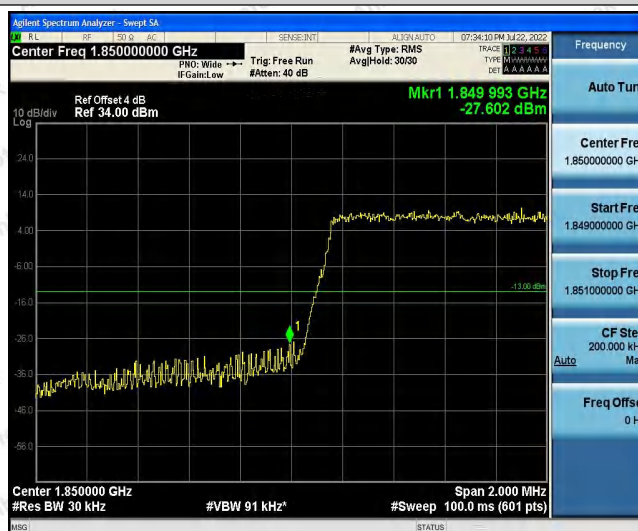

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band2-1.4MHz-QPSK-19193-1RB#0



Band2-1.4MHz-QPSK-19193-1RB#5



Band2-1.4MHz-QPSK-19193-6RB#0



Band2-1.4MHz-16QAM-18607-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500


www.anbotek.com

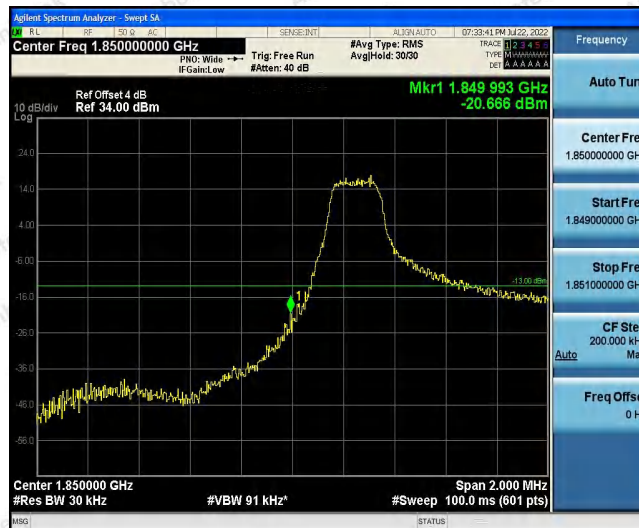

Band2-1.4MHz-16QAM-18607-1RB#5



Band2-1.4MHz-16QAM-18607-6RB#0

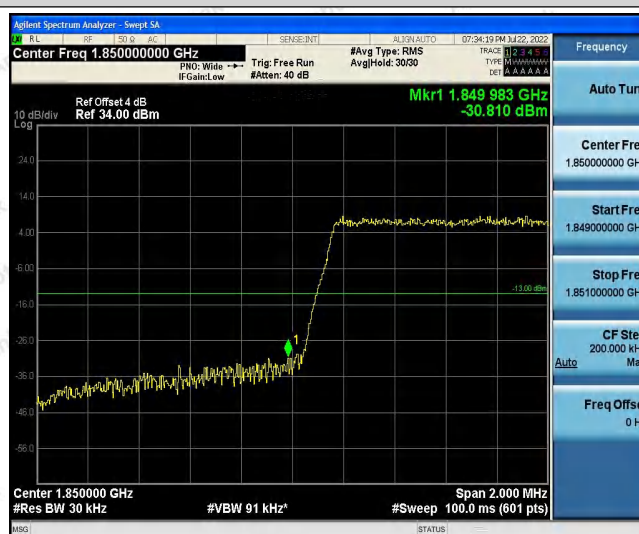

Band2-1.4MHz-16QAM-19193-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com



Band2-1.4MHz-16QAM-19193-1RB#5



Band2-1.4MHz-16QAM-19193-6RB#0



Band2-3MHz-QPSK-18615-1RB#0