






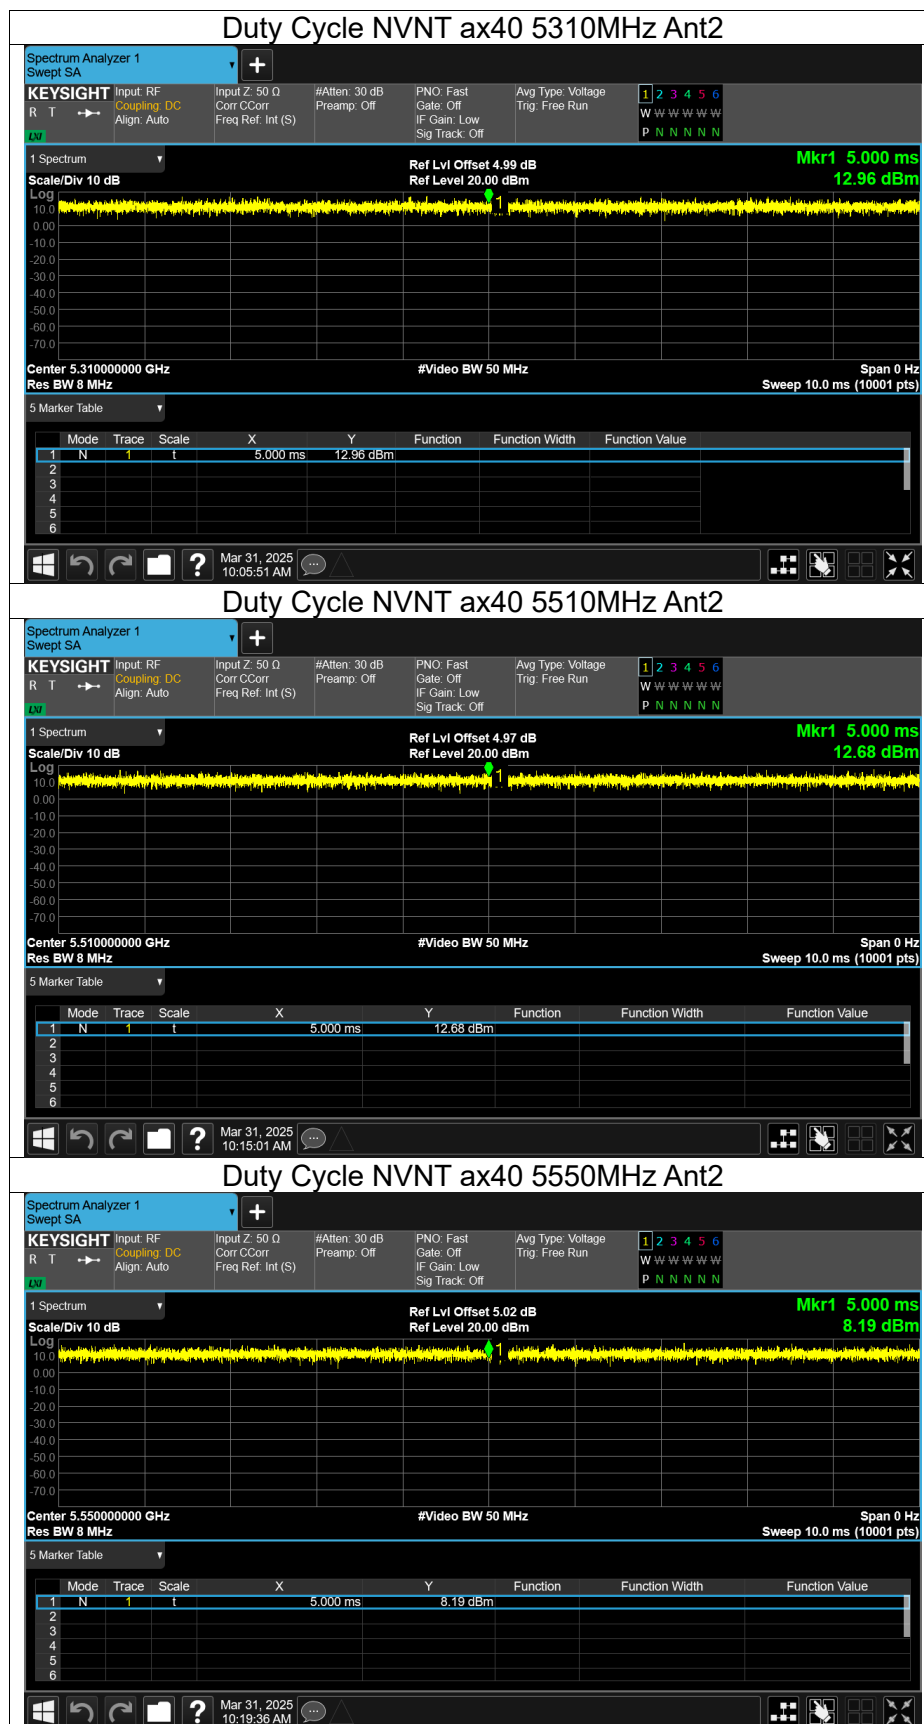


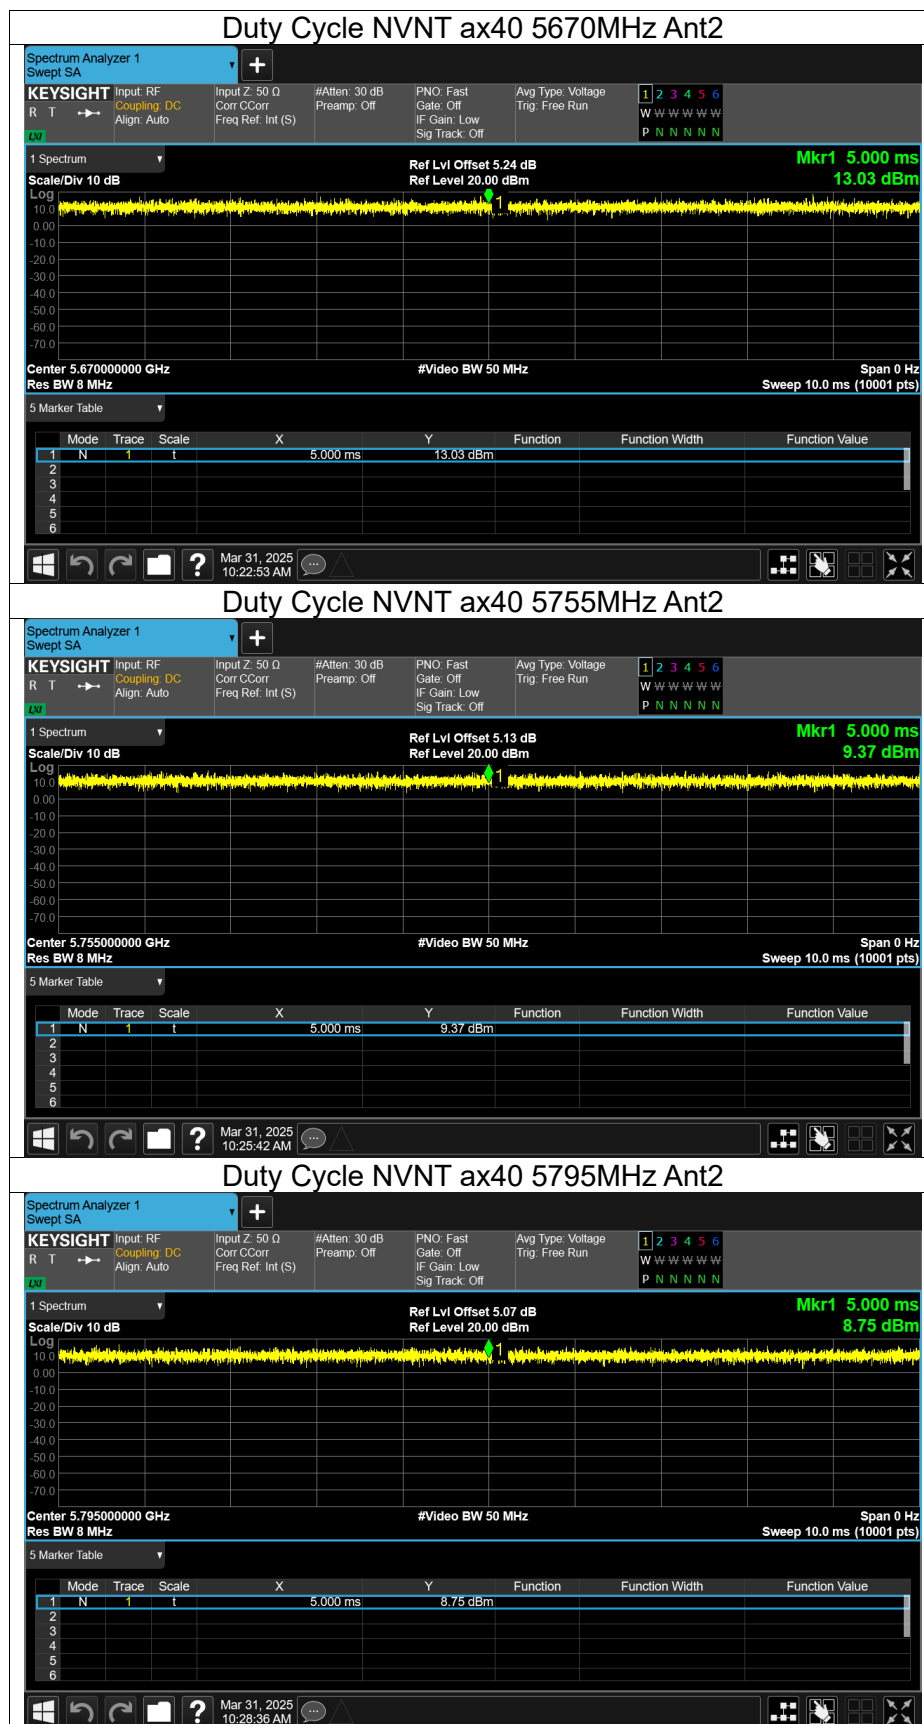


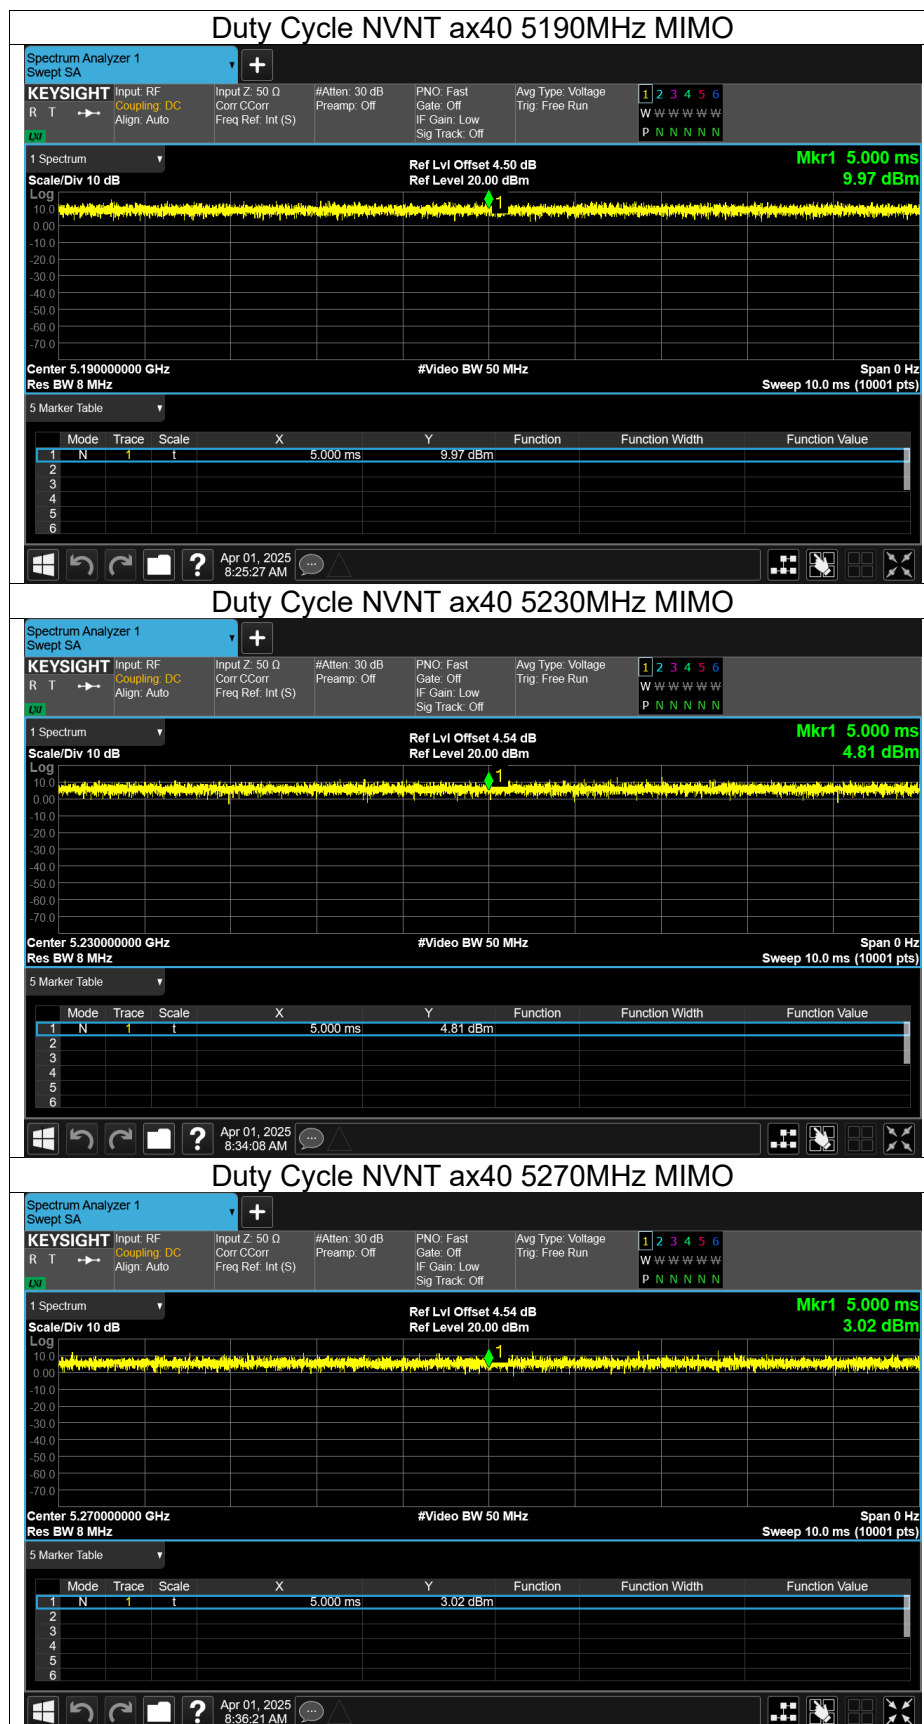


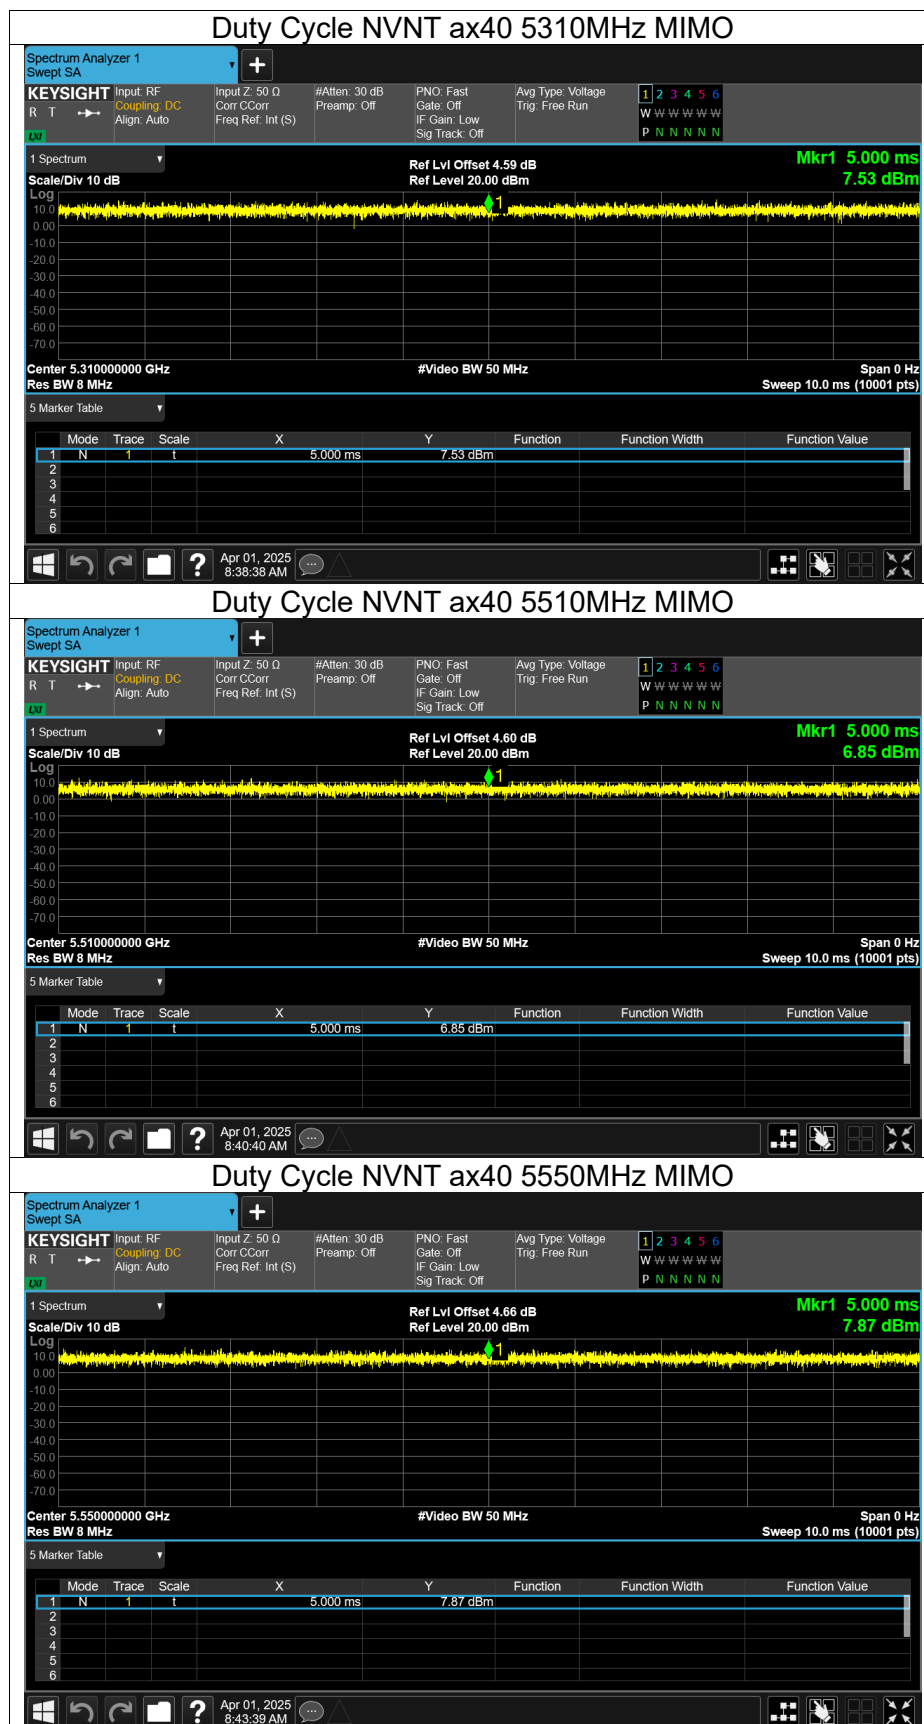


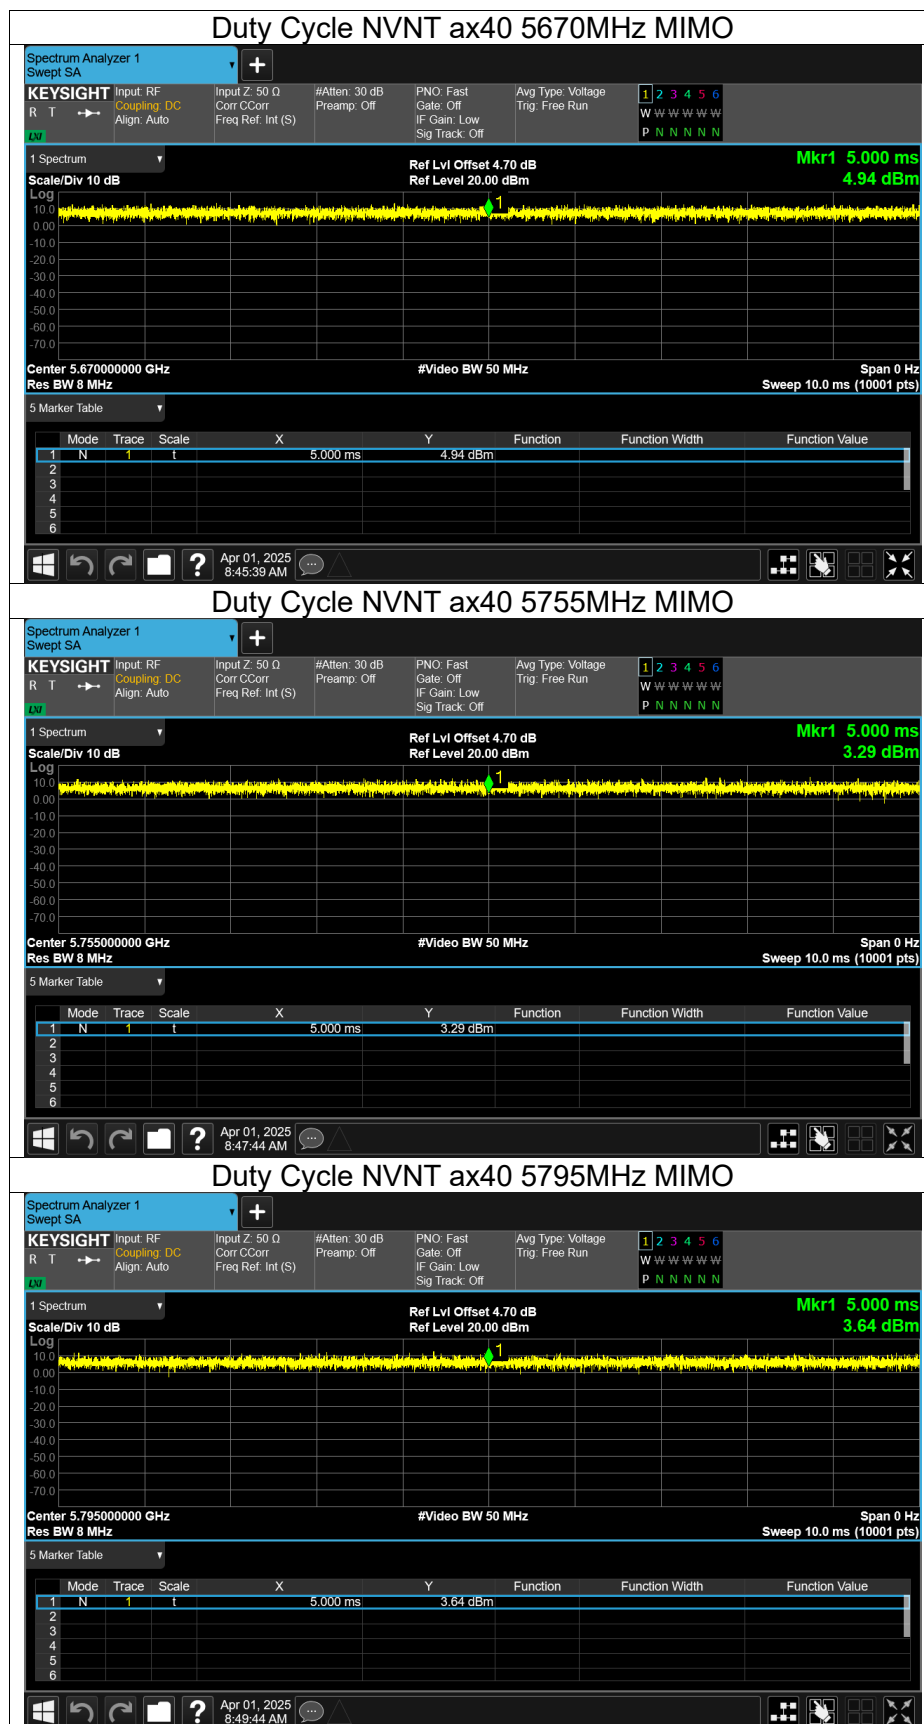


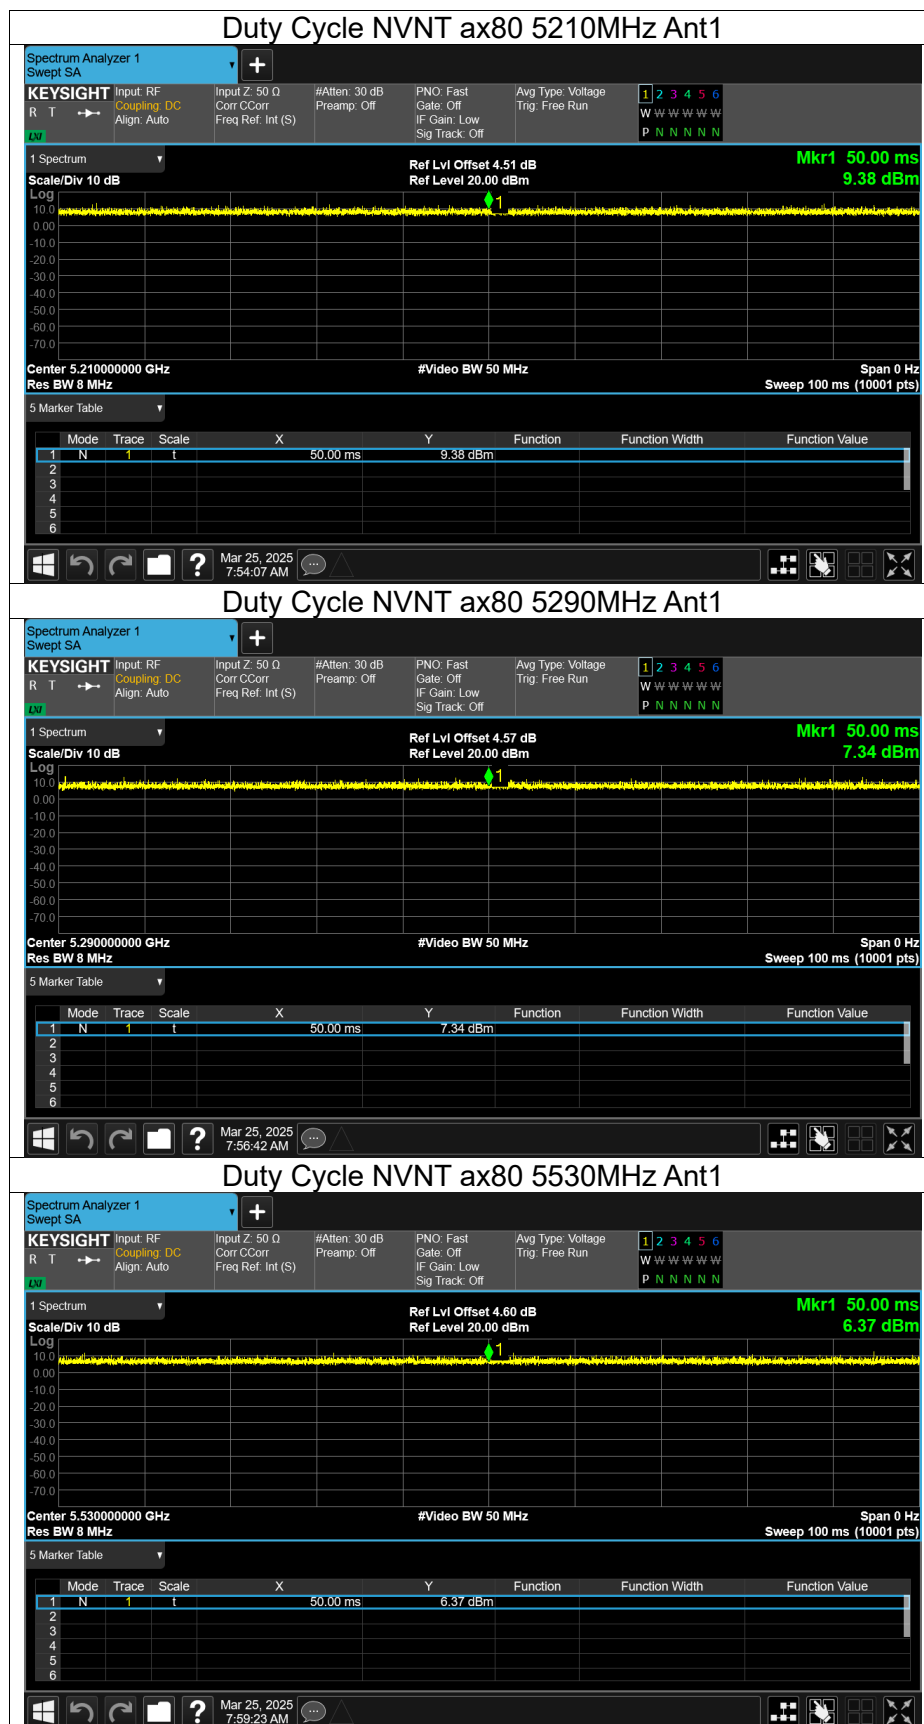

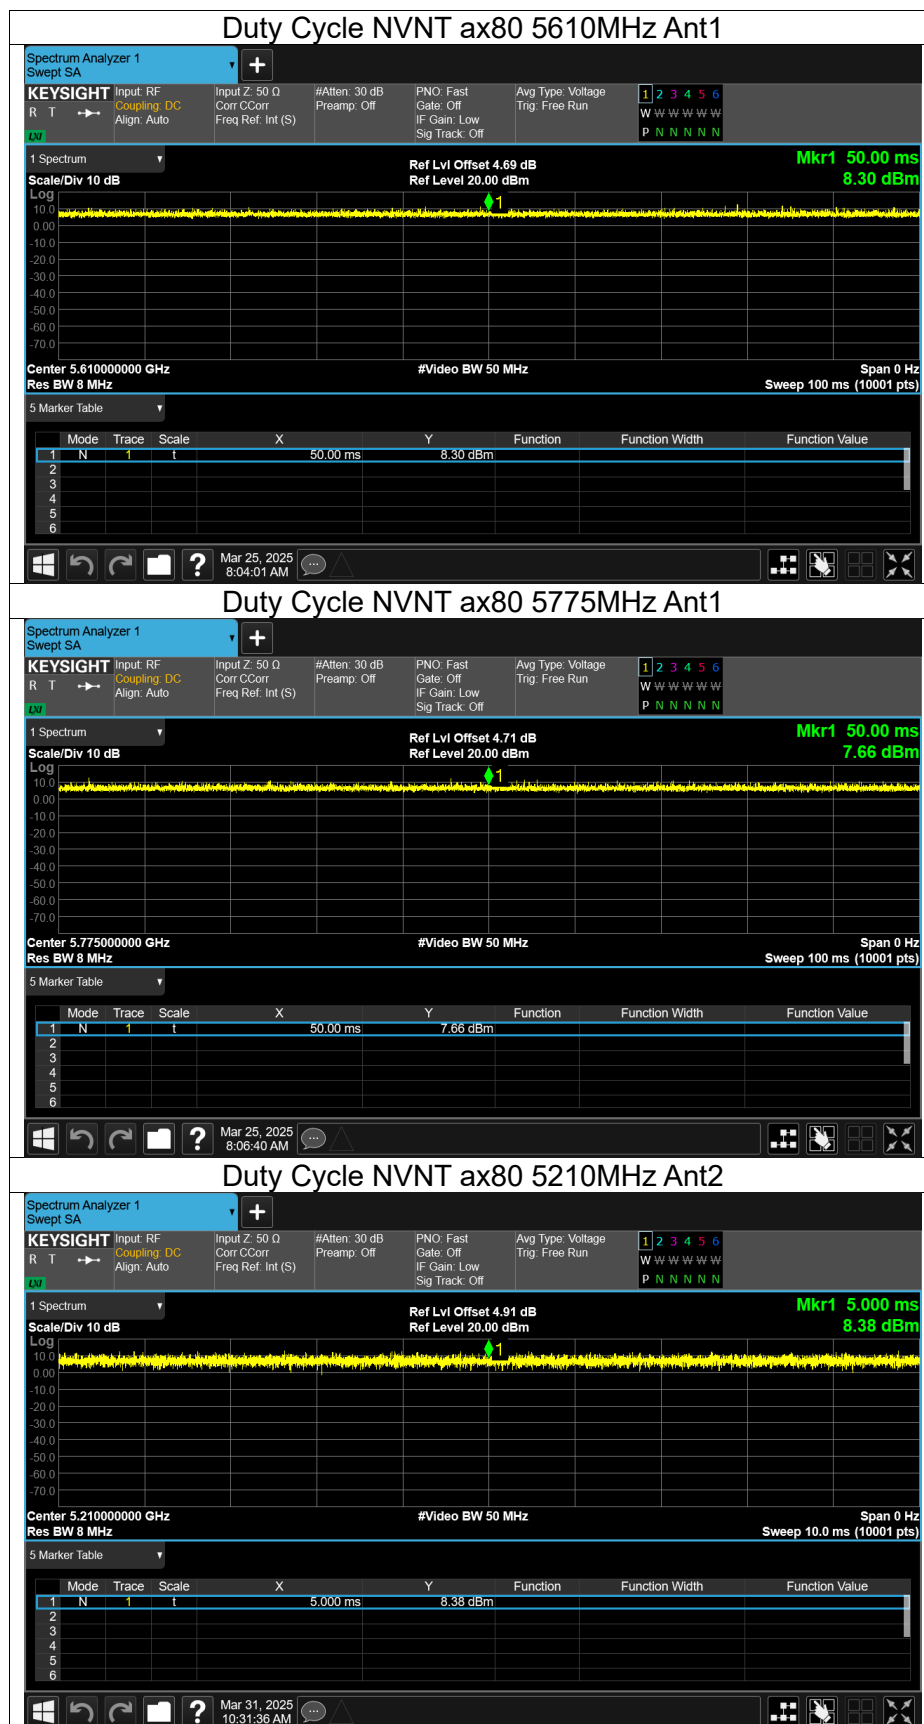

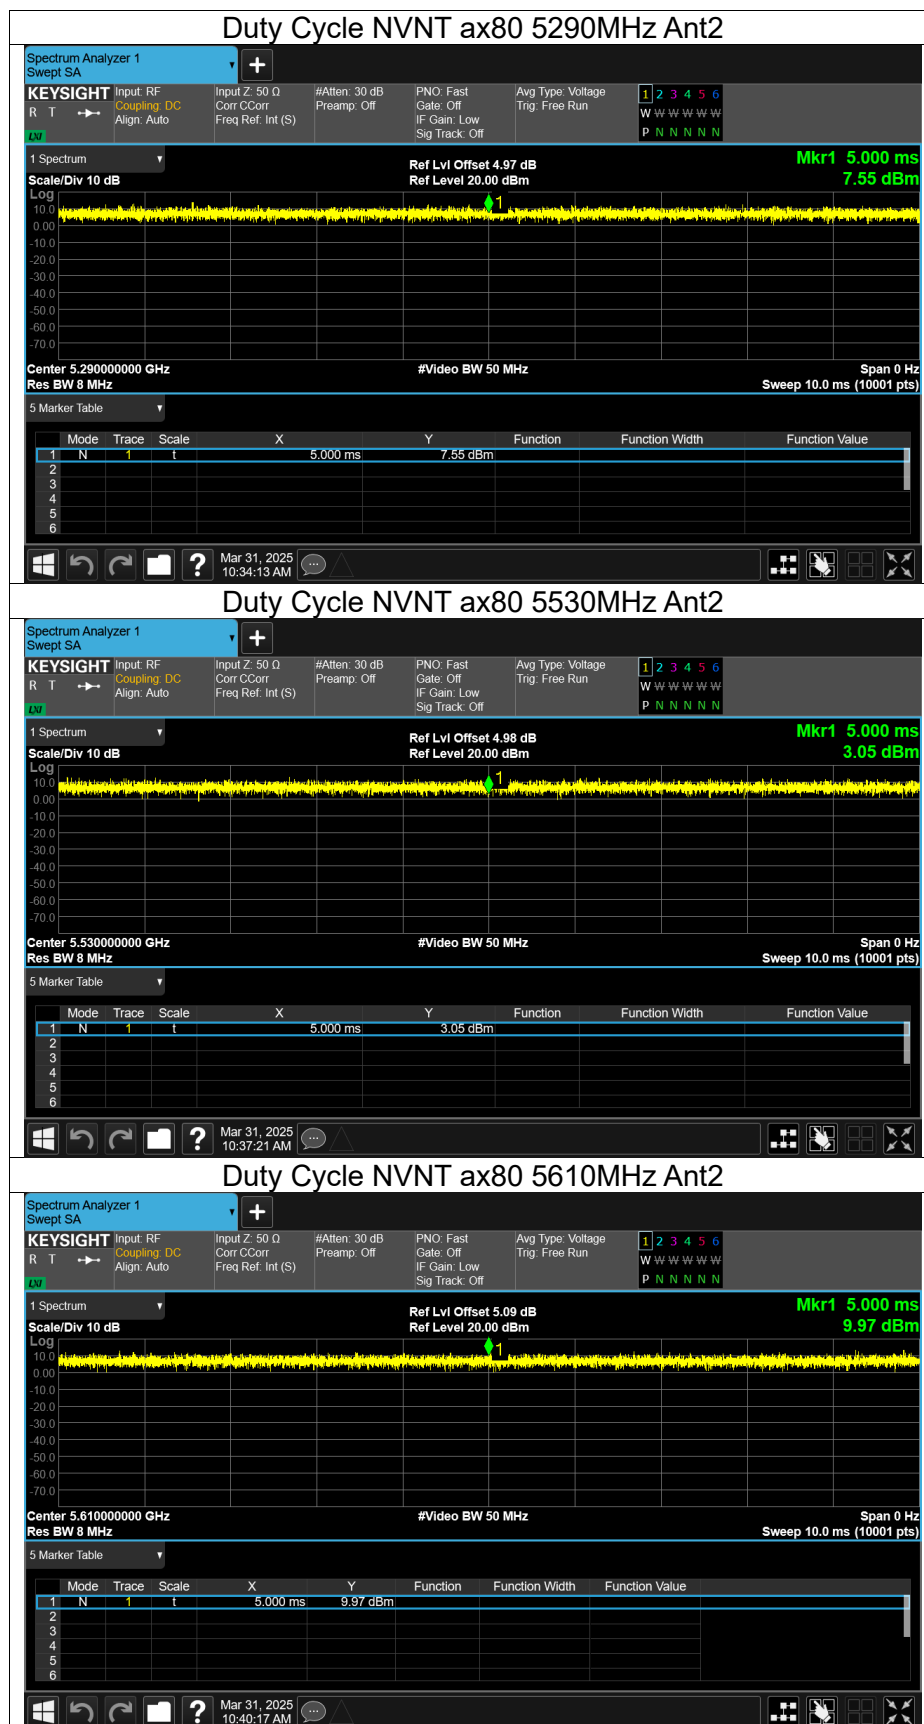

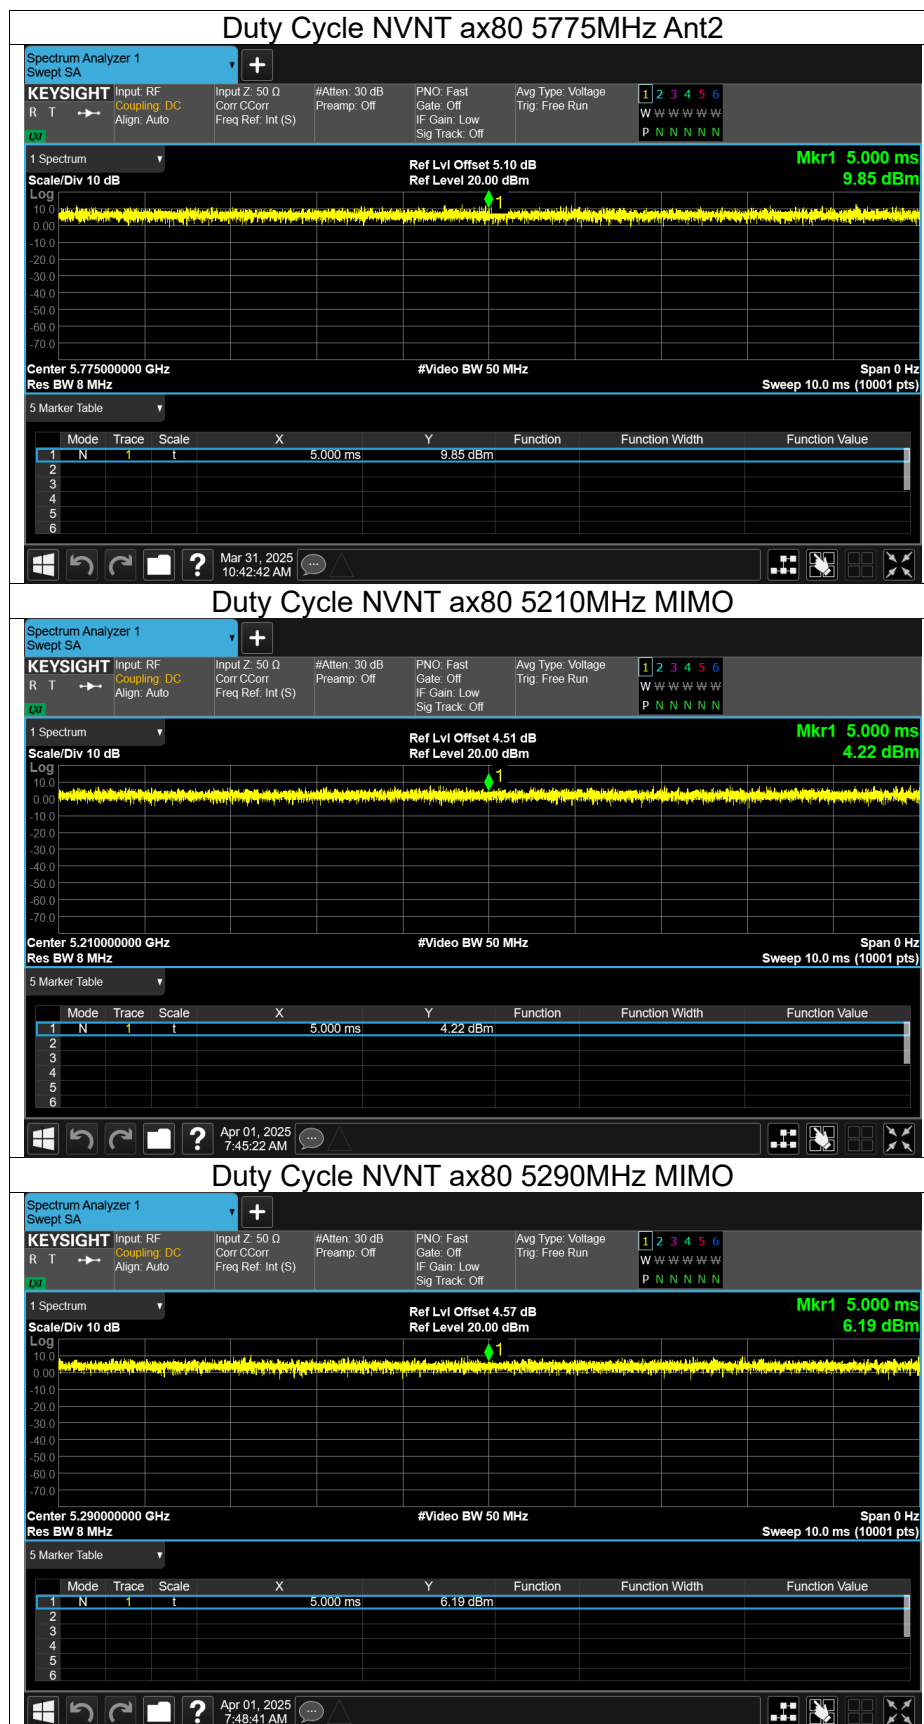

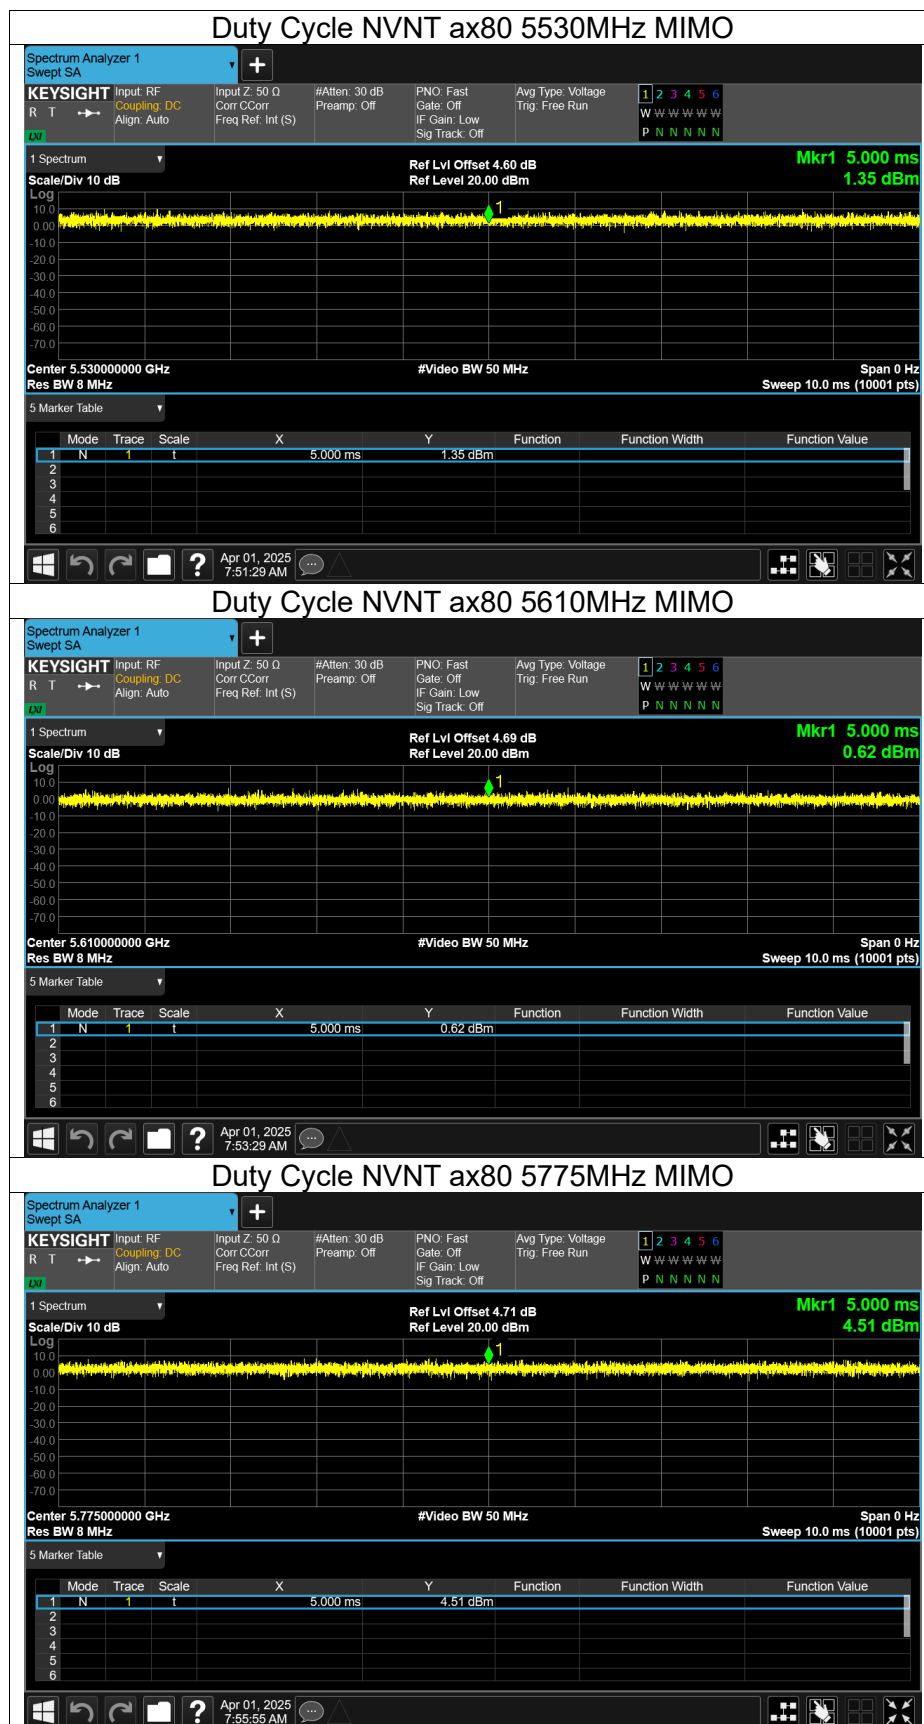



Maximum Conducted Output Power

Condition	Mode	Frequency (MHz)	Antenna	Conducted Power (dBm)	Duty Factor (dB)	Total Power (dBm)	Limit (dBm)	Verdict
NVNT	a	5180	Ant1	11.77	0	11.77	24	Pass
NVNT	a	5200	Ant1	12.35	0	12.35	24	Pass
NVNT	a	5240	Ant1	13.79	0	13.79	24	Pass
NVNT	a	5260	Ant1	11.62	0	11.62	24	Pass
NVNT	a	5300	Ant1	11.28	0	11.28	24	Pass
NVNT	a	5320	Ant1	11.28	0	11.28	24	Pass
NVNT	a	5500	Ant1	10.13	0	10.13	24	Pass
NVNT	a	5580	Ant1	9.89	0	9.89	24	Pass
NVNT	a	5700	Ant1	10.44	0	10.44	24	Pass
NVNT	a	5745	Ant1	10.34	0	10.34	30	Pass
NVNT	a	5785	Ant1	10.14	0	10.14	30	Pass
NVNT	a	5825	Ant1	10.37	0	10.37	30	Pass
NVNT	a	5180	Ant2	12.2	0	12.2	24	Pass
NVNT	a	5200	Ant2	12.56	0	12.56	24	Pass
NVNT	a	5240	Ant2	11.49	0	11.49	24	Pass
NVNT	a	5260	Ant2	12.95	0	12.95	24	Pass
NVNT	a	5300	Ant2	12.67	0	12.67	24	Pass
NVNT	a	5320	Ant2	12.8	0	12.8	24	Pass
NVNT	a	5500	Ant2	12.41	0	12.41	24	Pass
NVNT	a	5580	Ant2	12.71	0	12.71	24	Pass
NVNT	a	5700	Ant2	13.21	0	13.21	24	Pass
NVNT	a	5745	Ant2	12.77	0	12.77	30	Pass
NVNT	a	5785	Ant2	12.38	0	12.38	30	Pass
NVNT	a	5825	Ant2	12.34	0	12.34	30	Pass
NVNT	n20	5180	Ant1	10.79	0	10.79	24	Pass
NVNT	n20	5200	Ant1	11.17	0	11.17	24	Pass
NVNT	n20	5240	Ant1	11.02	0	11.02	24	Pass
NVNT	n20	5260	Ant1	10.43	0	10.43	24	Pass
NVNT	n20	5300	Ant1	10.27	0	10.27	24	Pass
NVNT	n20	5320	Ant1	10.37	0	10.37	24	Pass
NVNT	n20	5500	Ant1	9.2	0	9.2	24	Pass
NVNT	n20	5580	Ant1	8.82	0	8.82	24	Pass
NVNT	n20	5700	Ant1	9.5	0	9.5	24	Pass
NVNT	n20	5745	Ant1	9.28	0	9.28	30	Pass
NVNT	n20	5785	Ant1	9.21	0	9.21	30	Pass
NVNT	n20	5825	Ant1	9.23	0	9.23	30	Pass
NVNT	n20	5180	Ant2	11.27	0	11.27	24	Pass
NVNT	n20	5200	Ant2	11.54	0	11.54	24	Pass
NVNT	n20	5240	Ant2	11.71	0	11.71	24	Pass
NVNT	n20	5260	Ant2	11.88	0	11.88	24	Pass
NVNT	n20	5300	Ant2	11.61	0	11.61	24	Pass
NVNT	n20	5320	Ant2	11.7	0	11.7	24	Pass
NVNT	n20	5500	Ant2	11.34	0	11.34	24	Pass
NVNT	n20	5580	Ant2	11.36	0	11.36	24	Pass
NVNT	n20	5700	Ant2	11.97	0	11.97	24	Pass
NVNT	n20	5745	Ant2	11.79	0	11.79	30	Pass
NVNT	n20	5785	Ant2	9.35	0	9.35	30	Pass
NVNT	n20	5825	Ant2	11.22	0	11.22	30	Pass
NVNT	n20	5180	Ant1	9.62	0	9.62	24	Pass
NVNT	n20	5180	Ant2	7.77	0	7.77	24	Pass
NVNT	n20	5180	MIMO	11.8	0	11.8	24	Pass



NVNT	n20	5200	Ant1	9.6	0	9.6	24	Pass
NVNT	n20	5200	Ant2	7.96	0	7.96	24	Pass
NVNT	n20	5200	MIMO	11.87	0	11.87	24	Pass
NVNT	n20	5240	Ant1	7.34	0	7.34	24	Pass
NVNT	n20	5240	Ant2	5.45	0	5.45	24	Pass
NVNT	n20	5240	MIMO	9.51	0	9.51	24	Pass
NVNT	n20	5260	Ant1	4.88	0	4.88	24	Pass
NVNT	n20	5260	Ant2	7.51	0	7.51	24	Pass
NVNT	n20	5260	MIMO	9.4	0	9.4	24	Pass
NVNT	n20	5300	Ant1	9.57	0	9.57	24	Pass
NVNT	n20	5300	Ant2	7.57	0	7.57	24	Pass
NVNT	n20	5300	MIMO	11.69	0	11.69	24	Pass
NVNT	n20	5320	Ant1	8.91	0	8.91	24	Pass
NVNT	n20	5320	Ant2	7.78	0	7.78	24	Pass
NVNT	n20	5320	MIMO	11.39	0	11.39	24	Pass
NVNT	n20	5500	Ant1	5.14	0	5.14	24	Pass
NVNT	n20	5500	Ant2	8.17	0	8.17	24	Pass
NVNT	n20	5500	MIMO	9.92	0	9.92	24	Pass
NVNT	n20	5580	Ant1	5.09	0	5.09	24	Pass
NVNT	n20	5580	Ant2	8.29	0	8.29	24	Pass
NVNT	n20	5580	MIMO	9.99	0	9.99	24	Pass
NVNT	n20	5700	Ant1	4.37	0	4.37	24	Pass
NVNT	n20	5700	Ant2	8.74	0	8.74	24	Pass
NVNT	n20	5700	MIMO	10.09	0	10.09	24	Pass
NVNT	n20	5745	Ant1	6.58	0	6.58	30	Pass
NVNT	n20	5745	Ant2	8.7	0	8.7	30	Pass
NVNT	n20	5745	MIMO	10.78	0	10.78	30	Pass
NVNT	n20	5785	Ant1	7.7	0	7.7	30	Pass
NVNT	n20	5785	Ant2	8.37	0	8.37	30	Pass
NVNT	n20	5785	MIMO	11.06	0	11.06	30	Pass
NVNT	n20	5825	Ant1	3.76	0	3.76	30	Pass
NVNT	n20	5825	Ant2	8.42	0	8.42	30	Pass
NVNT	n20	5825	MIMO	9.7	0	9.7	30	Pass
NVNT	n40	5190	Ant1	11.18	0	11.18	24	Pass
NVNT	n40	5230	Ant1	11.2	0	11.2	24	Pass
NVNT	n40	5270	Ant1	10.58	0	10.58	24	Pass
NVNT	n40	5310	Ant1	10.38	0	10.38	24	Pass
NVNT	n40	5510	Ant1	9.07	0	9.07	24	Pass
NVNT	n40	5550	Ant1	9.18	0	9.18	24	Pass
NVNT	n40	5670	Ant1	9.33	0	9.33	24	Pass
NVNT	n40	5755	Ant1	9.41	0	9.41	30	Pass
NVNT	n40	5795	Ant1	9.36	0	9.36	30	Pass
NVNT	n40	5190	Ant2	11.46	0	11.46	24	Pass
NVNT	n40	5230	Ant2	11.75	0	11.75	24	Pass
NVNT	n40	5270	Ant2	11.87	0	11.87	24	Pass
NVNT	n40	5310	Ant2	11.45	0	11.45	24	Pass
NVNT	n40	5510	Ant2	10.75	0	10.75	24	Pass
NVNT	n40	5550	Ant2	10.83	0	10.83	24	Pass
NVNT	n40	5670	Ant2	11.64	0	11.64	24	Pass
NVNT	n40	5755	Ant2	11.6	0	11.6	30	Pass
NVNT	n40	5795	Ant2	11.14	0	11.14	30	Pass
NVNT	n40	5190	Ant1	9.94	0	9.94	24	Pass
NVNT	n40	5190	Ant2	8.03	0	8.03	24	Pass
NVNT	n40	5190	MIMO	12.1	0	12.1	24	Pass
NVNT	n40	5230	Ant1	7.19	0	7.19	24	Pass
NVNT	n40	5230	Ant2	8.23	0	8.23	24	Pass



NVNT	n40	5230	MIMO	10.75	0	10.75	24	Pass
NVNT	n40	5270	Ant1	6.37	0	6.37	24	Pass
NVNT	n40	5270	Ant2	7.65	0	7.65	24	Pass
NVNT	n40	5270	MIMO	10.07	0	10.07	24	Pass
NVNT	n40	5310	Ant1	9.27	0	9.27	24	Pass
NVNT	n40	5310	Ant2	7.61	0	7.61	24	Pass
NVNT	n40	5310	MIMO	11.53	0	11.53	24	Pass
NVNT	n40	5510	Ant1	5.76	0	5.76	24	Pass
NVNT	n40	5510	Ant2	7.75	0	7.75	24	Pass
NVNT	n40	5510	MIMO	9.88	0	9.88	24	Pass
NVNT	n40	5550	Ant1	7.96	0	7.96	24	Pass
NVNT	n40	5550	Ant2	7.55	0	7.55	24	Pass
NVNT	n40	5550	MIMO	10.77	0	10.77	24	Pass
NVNT	n40	5670	Ant1	7.86	0	7.86	24	Pass
NVNT	n40	5670	Ant2	8.42	0	8.42	24	Pass
NVNT	n40	5670	MIMO	11.16	0	11.16	24	Pass
NVNT	n40	5755	Ant1	7.18	0	7.18	30	Pass
NVNT	n40	5755	Ant2	8.23	0	8.23	30	Pass
NVNT	n40	5755	MIMO	10.75	0	10.75	30	Pass
NVNT	n40	5795	Ant1	7.09	0	7.09	30	Pass
NVNT	n40	5795	Ant2	8.18	0	8.18	30	Pass
NVNT	n40	5795	MIMO	10.68	0	10.68	30	Pass
NVNT	ac20	5180	Ant1	10.75	0	10.75	24	Pass
NVNT	ac20	5200	Ant1	11.15	0	11.15	24	Pass
NVNT	ac20	5240	Ant1	11.17	0	11.17	24	Pass
NVNT	ac20	5260	Ant1	10.71	0	10.71	24	Pass
NVNT	ac20	5300	Ant1	10.49	0	10.49	24	Pass
NVNT	ac20	5320	Ant1	10.38	0	10.38	24	Pass
NVNT	ac20	5500	Ant1	9.24	0	9.24	24	Pass
NVNT	ac20	5580	Ant1	9.01	0	9.01	24	Pass
NVNT	ac20	5700	Ant1	9.48	0	9.48	24	Pass
NVNT	ac20	5745	Ant1	9.52	0	9.52	30	Pass
NVNT	ac20	5785	Ant1	9.36	0	9.36	30	Pass
NVNT	ac20	5825	Ant1	9.5	0	9.5	30	Pass
NVNT	ac20	5180	Ant2	11.59	0	11.59	24	Pass
NVNT	ac20	5200	Ant2	11.55	0	11.55	24	Pass
NVNT	ac20	5240	Ant2	11.79	0	11.79	24	Pass
NVNT	ac20	5260	Ant2	11.95	0	11.95	23.99	Pass
NVNT	ac20	5300	Ant2	11.72	0	11.72	23.97	Pass
NVNT	ac20	5320	Ant2	11.5	0	11.5	23.98	Pass
NVNT	ac20	5500	Ant2	10.81	0	10.81	23.96	Pass
NVNT	ac20	5580	Ant2	11.06	0	11.06	23.98	Pass
NVNT	ac20	5700	Ant2	11.73	0	11.73	23.96	Pass
NVNT	ac20	5745	Ant2	11.66	0	11.66	30	Pass
NVNT	ac20	5785	Ant2	11.34	0	11.34	30	Pass
NVNT	ac20	5825	Ant2	11.36	0	11.36	30	Pass
NVNT	ac20	5180	Ant1	9.74	0	9.74	24	Pass
NVNT	ac20	5180	Ant2	7.66	0	7.66	24	Pass
NVNT	ac20	5180	MIMO	11.83	0	11.83	24	Pass
NVNT	ac20	5200	Ant1	9.66	0	9.66	24	Pass
NVNT	ac20	5200	Ant2	7.98	0	7.98	24	Pass
NVNT	ac20	5200	MIMO	11.91	0	11.91	24	Pass
NVNT	ac20	5240	Ant1	6.14	0	6.14	24	Pass
NVNT	ac20	5240	Ant2	8.3	0	8.3	24	Pass
NVNT	ac20	5240	MIMO	10.36	0	10.36	24	Pass
NVNT	ac20	5260	Ant1	5.02	0	5.02	24	Pass



NVNT	ac20	5260	Ant2	7.69	0	7.69	24	Pass
NVNT	ac20	5260	MIMO	9.57	0	9.57	24	Pass
NVNT	ac20	5300	Ant1	9.52	0	9.52	24	Pass
NVNT	ac20	5300	Ant2	7.67	0	7.67	24	Pass
NVNT	ac20	5300	MIMO	11.7	0	11.7	24	Pass
NVNT	ac20	5320	Ant1	8.72	0	8.72	24	Pass
NVNT	ac20	5320	Ant2	7.77	0	7.77	24	Pass
NVNT	ac20	5320	MIMO	11.28	0	11.28	24	Pass
NVNT	ac20	5500	Ant1	4.89	0	4.89	24	Pass
NVNT	ac20	5500	Ant2	7.96	0	7.96	24	Pass
NVNT	ac20	5500	MIMO	9.7	0	9.7	24	Pass
NVNT	ac20	5580	Ant1	4.84	0	4.84	24	Pass
NVNT	ac20	5580	Ant2	8.15	0	8.15	24	Pass
NVNT	ac20	5580	MIMO	9.81	0	9.81	24	Pass
NVNT	ac20	5700	Ant1	4.08	0	4.08	24	Pass
NVNT	ac20	5700	Ant2	8.8	0	8.8	24	Pass
NVNT	ac20	5700	MIMO	10.06	0	10.06	24	Pass
NVNT	ac20	5745	Ant1	6.71	0	6.71	30	Pass
NVNT	ac20	5745	Ant2	8.73	0	8.73	30	Pass
NVNT	ac20	5745	MIMO	10.85	0	10.85	30	Pass
NVNT	ac20	5785	Ant1	7.76	0	7.76	30	Pass
NVNT	ac20	5785	Ant2	8.48	0	8.48	30	Pass
NVNT	ac20	5785	MIMO	11.15	0	11.15	30	Pass
NVNT	ac20	5825	Ant1	3.71	0	3.71	30	Pass
NVNT	ac20	5825	Ant2	8.48	0	8.48	30	Pass
NVNT	ac20	5825	MIMO	9.73	0	9.73	30	Pass
NVNT	ac40	5190	Ant1	11.06	0	11.06	24	Pass
NVNT	ac40	5230	Ant1	11.16	0	11.16	24	Pass
NVNT	ac40	5270	Ant1	10.64	0	10.64	24	Pass
NVNT	ac40	5310	Ant1	10.37	0	10.37	24	Pass
NVNT	ac40	5510	Ant1	8.64	0	8.64	24	Pass
NVNT	ac40	5550	Ant1	9.17	0	9.17	24	Pass
NVNT	ac40	5670	Ant1	9.04	0	9.04	24	Pass
NVNT	ac40	5755	Ant1	9.23	0	9.23	30	Pass
NVNT	ac40	5795	Ant1	9.36	0	9.36	30	Pass
NVNT	ac40	5190	Ant2	11.47	0	11.47	24	Pass
NVNT	ac40	5230	Ant2	11.74	0	11.74	24	Pass
NVNT	ac40	5270	Ant2	11.76	0	11.76	24	Pass
NVNT	ac40	5310	Ant2	11.32	0	11.32	24	Pass
NVNT	ac40	5510	Ant2	10.46	0	10.46	24	Pass
NVNT	ac40	5550	Ant2	10.83	0	10.83	24	Pass
NVNT	ac40	5670	Ant2	11.34	0	11.34	24	Pass
NVNT	ac40	5755	Ant2	11.3	0	11.3	30	Pass
NVNT	ac40	5795	Ant2	11.14	0	11.14	30	Pass
NVNT	ac40	5190	Ant1	9.6	0	9.6	24	Pass
NVNT	ac40	5190	Ant2	7.74	0	7.74	24	Pass
NVNT	ac40	5190	MIMO	11.78	0	11.78	24	Pass
NVNT	ac40	5230	Ant1	6.7	0	6.7	24	Pass
NVNT	ac40	5230	Ant2	8.08	0	8.08	24	Pass
NVNT	ac40	5230	MIMO	10.45	0	10.45	24	Pass
NVNT	ac40	5270	Ant1	6.51	0	6.51	24	Pass
NVNT	ac40	5270	Ant2	7.53	0	7.53	24	Pass
NVNT	ac40	5270	MIMO	10.06	0	10.06	24	Pass
NVNT	ac40	5310	Ant1	9.1	0	9.1	24	Pass
NVNT	ac40	5310	Ant2	7.47	0	7.47	24	Pass
NVNT	ac40	5310	MIMO	11.37	0	11.37	24	Pass



NVNT	ac40	5510	Ant1	5.67	0	5.67	24	Pass
NVNT	ac40	5510	Ant2	7.32	0	7.32	24	Pass
NVNT	ac40	5510	MIMO	9.58	0	9.58	24	Pass
NVNT	ac40	5550	Ant1	7.78	0	7.78	24	Pass
NVNT	ac40	5550	Ant2	7.39	0	7.39	24	Pass
NVNT	ac40	5550	MIMO	10.6	0	10.6	24	Pass
NVNT	ac40	5670	Ant1	7.53	0	7.53	24	Pass
NVNT	ac40	5670	Ant2	8.15	0	8.15	24	Pass
NVNT	ac40	5670	MIMO	10.86	0	10.86	24	Pass
NVNT	ac40	5755	Ant1	7.38	0	7.38	30	Pass
NVNT	ac40	5755	Ant2	8.48	0	8.48	30	Pass
NVNT	ac40	5755	MIMO	10.98	0	10.98	30	Pass
NVNT	ac40	5795	Ant1	6.83	0	6.83	30	Pass
NVNT	ac40	5795	Ant2	8.35	0	8.35	30	Pass
NVNT	ac40	5795	MIMO	10.67	0	10.67	30	Pass
NVNT	ac80	5210	Ant1	10.86	0	10.86	24	Pass
NVNT	ac80	5290	Ant1	10.08	0	10.08	24	Pass
NVNT	ac80	5530	Ant1	8.86	0	8.86	24	Pass
NVNT	ac80	5610	Ant1	9.12	0	9.12	24	Pass
NVNT	ac80	5775	Ant1	7.27	0	7.27	30	Pass
NVNT	ac80	5210	Ant2	11.28	0	11.28	24	Pass
NVNT	ac80	5290	Ant2	11.2	0	11.2	24	Pass
NVNT	ac80	5530	Ant2	10.6	0	10.6	24	Pass
NVNT	ac80	5610	Ant2	10.87	0	10.87	24	Pass
NVNT	ac80	5775	Ant2	10.87	0	10.87	30	Pass
NVNT	ac80	5210	Ant1	7.05	0	7.05	24	Pass
NVNT	ac80	5210	Ant2	7.9	0	7.9	24	Pass
NVNT	ac80	5210	MIMO	10.51	0	10.51	24	Pass
NVNT	ac80	5290	Ant1	7.95	0	7.95	24	Pass
NVNT	ac80	5290	Ant2	7.14	0	7.14	24	Pass
NVNT	ac80	5290	MIMO	10.57	0	10.57	24	Pass
NVNT	ac80	5530	Ant1	6.8	0	6.8	24	Pass
NVNT	ac80	5530	Ant2	7.36	0	7.36	24	Pass
NVNT	ac80	5530	MIMO	10.1	0	10.1	24	Pass
NVNT	ac80	5610	Ant1	4.93	0	4.93	24	Pass
NVNT	ac80	5610	Ant2	8.53	0	8.53	24	Pass
NVNT	ac80	5610	MIMO	10.1	0	10.1	24	Pass
NVNT	ac80	5775	Ant1	6.89	0	6.89	30	Pass
NVNT	ac80	5775	Ant2	7.87	0	7.87	30	Pass
NVNT	ac80	5775	MIMO	10.42	0	10.42	30	Pass
NVNT	ax20	5180	Ant1	10.02	0	10.02	24	Pass
NVNT	ax20	5200	Ant1	10.96	0	10.96	24	Pass
NVNT	ax20	5240	Ant1	11.03	0	11.03	24	Pass
NVNT	ax20	5260	Ant1	10.3	0	10.3	24	Pass
NVNT	ax20	5300	Ant1	10.2	0	10.2	24	Pass
NVNT	ax20	5320	Ant1	10.19	0	10.19	24	Pass
NVNT	ax20	5500	Ant1	9.17	0	9.17	24	Pass
NVNT	ax20	5580	Ant1	8.94	0	8.94	24	Pass
NVNT	ax20	5700	Ant1	9.27	0	9.27	24	Pass
NVNT	ax20	5745	Ant1	9.3	0	9.3	30	Pass
NVNT	ax20	5785	Ant1	9.1	0	9.1	30	Pass
NVNT	ax20	5825	Ant1	9.74	0	9.74	30	Pass
NVNT	ax20	5180	Ant2	11.49	0	11.49	24	Pass
NVNT	ax20	5200	Ant2	11.78	0	11.78	24	Pass
NVNT	ax20	5240	Ant2	11.91	0	11.91	24	Pass
NVNT	ax20	5260	Ant2	11.9	0	11.9	24	Pass



NVNT	ax20	5300	Ant2	11.76	0	11.76	24	Pass
NVNT	ax20	5320	Ant2	11.68	0	11.68	24	Pass
NVNT	ax20	5500	Ant2	11.32	0	11.32	24	Pass
NVNT	ax20	5580	Ant2	11.49	0	11.49	24	Pass
NVNT	ax20	5700	Ant2	12.03	0	12.03	24	Pass
NVNT	ax20	5745	Ant2	11.9	0	11.9	30	Pass
NVNT	ax20	5785	Ant2	11.46	0	11.46	30	Pass
NVNT	ax20	5825	Ant2	11.47	0	11.47	30	Pass
NVNT	ax20	5180	Ant1	9.78	0	9.78	24	Pass
NVNT	ax20	5180	Ant2	7.73	0	7.73	24	Pass
NVNT	ax20	5180	MIMO	11.89	0	11.89	24	Pass
NVNT	ax20	5200	Ant1	9.78	0	9.78	24	Pass
NVNT	ax20	5200	Ant2	8.02	0	8.02	24	Pass
NVNT	ax20	5200	MIMO	12	0	12	24	Pass
NVNT	ax20	5240	Ant1	6.14	0	6.14	24	Pass
NVNT	ax20	5240	Ant2	8.26	0	8.26	24	Pass
NVNT	ax20	5240	MIMO	10.34	0	10.34	24	Pass
NVNT	ax20	5260	Ant1	5.11	0	5.11	24	Pass
NVNT	ax20	5260	Ant2	7.77	0	7.77	24	Pass
NVNT	ax20	5260	MIMO	9.65	0	9.65	24	Pass
NVNT	ax20	5300	Ant1	9.63	0	9.63	24	Pass
NVNT	ax20	5300	Ant2	7.72	0	7.72	24	Pass
NVNT	ax20	5300	MIMO	11.79	0	11.79	24	Pass
NVNT	ax20	5320	Ant1	8.84	0	8.84	24	Pass
NVNT	ax20	5320	Ant2	7.84	0	7.84	24	Pass
NVNT	ax20	5320	MIMO	11.38	0	11.38	24	Pass
NVNT	ax20	5500	Ant1	4.94	0	4.94	24	Pass
NVNT	ax20	5500	Ant2	8.05	0	8.05	24	Pass
NVNT	ax20	5500	MIMO	9.78	0	9.78	24	Pass
NVNT	ax20	5580	Ant1	4.94	0	4.94	24	Pass
NVNT	ax20	5580	Ant2	8.26	0	8.26	24	Pass
NVNT	ax20	5580	MIMO	9.92	0	9.92	24	Pass
NVNT	ax20	5700	Ant1	4.26	0	4.26	24	Pass
NVNT	ax20	5700	Ant2	8.81	0	8.81	24	Pass
NVNT	ax20	5700	MIMO	10.12	0	10.12	24	Pass
NVNT	ax20	5745	Ant1	6.87	0	6.87	30	Pass
NVNT	ax20	5745	Ant2	8.8	0	8.8	30	Pass
NVNT	ax20	5745	MIMO	10.95	0	10.95	30	Pass
NVNT	ax20	5785	Ant1	7.94	0	7.94	30	Pass
NVNT	ax20	5785	Ant2	8.43	0	8.43	30	Pass
NVNT	ax20	5785	MIMO	11.2	0	11.2	30	Pass
NVNT	ax20	5825	Ant1	3.91	0	3.91	30	Pass
NVNT	ax20	5825	Ant2	8.52	0	8.52	30	Pass
NVNT	ax20	5825	MIMO	9.81	0	9.81	30	Pass
NVNT	ax40	5190	Ant1	11.09	0	11.09	24	Pass
NVNT	ax40	5230	Ant1	10.67	0	10.67	24	Pass
NVNT	ax40	5270	Ant1	10.37	0	10.37	24	Pass
NVNT	ax40	5310	Ant1	10.28	0	10.28	24	Pass
NVNT	ax40	5510	Ant1	9.01	0	9.01	24	Pass
NVNT	ax40	5550	Ant1	9.18	0	9.18	24	Pass
NVNT	ax40	5670	Ant1	7.22	0	7.22	24	Pass
NVNT	ax40	5755	Ant1	7.79	0	7.79	30	Pass
NVNT	ax40	5795	Ant1	7.97	0	7.97	30	Pass
NVNT	ax40	5190	Ant2	11.8	0	11.8	24	Pass
NVNT	ax40	5230	Ant2	12.01	0	12.01	24	Pass
NVNT	ax40	5270	Ant2	11.88	0	11.88	24	Pass



NVNT	ax40	5310	Ant2	11.65	0	11.65	24	Pass
NVNT	ax40	5510	Ant2	10.82	0	10.82	24	Pass
NVNT	ax40	5550	Ant2	10.94	0	10.94	24	Pass
NVNT	ax40	5670	Ant2	11.59	0	11.59	24	Pass
NVNT	ax40	5755	Ant2	11.58	0	11.58	30	Pass
NVNT	ax40	5795	Ant2	11.29	0	11.29	30	Pass
NVNT	ax40	5190	Ant1	9.91	0	9.91	24	Pass
NVNT	ax40	5190	Ant2	8.04	0	8.04	24	Pass
NVNT	ax40	5190	MIMO	12.09	0	12.09	24	Pass
NVNT	ax40	5230	Ant1	7.13	0	7.13	24	Pass
NVNT	ax40	5230	Ant2	8.46	0	8.46	24	Pass
NVNT	ax40	5230	MIMO	10.86	0	10.86	24	Pass
NVNT	ax40	5270	Ant1	6.72	0	6.72	24	Pass
NVNT	ax40	5270	Ant2	7.76	0	7.76	24	Pass
NVNT	ax40	5270	MIMO	10.28	0	10.28	24	Pass
NVNT	ax40	5310	Ant1	9.3	0	9.3	24	Pass
NVNT	ax40	5310	Ant2	7.66	0	7.66	24	Pass
NVNT	ax40	5310	MIMO	11.57	0	11.57	24	Pass
NVNT	ax40	5510	Ant1	5.83	0	5.83	24	Pass
NVNT	ax40	5510	Ant2	7.57	0	7.57	24	Pass
NVNT	ax40	5510	MIMO	9.8	0	9.8	24	Pass
NVNT	ax40	5550	Ant1	7.99	0	7.99	24	Pass
NVNT	ax40	5550	Ant2	7.55	0	7.55	24	Pass
NVNT	ax40	5550	MIMO	10.79	0	10.79	24	Pass
NVNT	ax40	5670	Ant1	7.79	0	7.79	24	Pass
NVNT	ax40	5670	Ant2	8.45	0	8.45	24	Pass
NVNT	ax40	5670	MIMO	11.14	0	11.14	24	Pass
NVNT	ax40	5755	Ant1	7.33	0	7.33	30	Pass
NVNT	ax40	5755	Ant2	8.53	0	8.53	30	Pass
NVNT	ax40	5755	MIMO	10.98	0	10.98	30	Pass
NVNT	ax40	5795	Ant1	7.08	0	7.08	30	Pass
NVNT	ax40	5795	Ant2	8.39	0	8.39	30	Pass
NVNT	ax40	5795	MIMO	10.79	0	10.79	30	Pass
NVNT	ax80	5210	Ant1	10.11	0	10.11	24	Pass
NVNT	ax80	5290	Ant1	9.63	0	9.63	24	Pass
NVNT	ax80	5530	Ant1	7.96	0	7.96	24	Pass
NVNT	ax80	5610	Ant1	8.92	0	8.92	24	Pass
NVNT	ax80	5775	Ant1	9.11	0	9.11	30	Pass
NVNT	ax80	5210	Ant2	11.73	0	11.73	24	Pass
NVNT	ax80	5290	Ant2	11.57	0	11.57	24	Pass
NVNT	ax80	5530	Ant2	10.94	0	10.94	24	Pass
NVNT	ax80	5610	Ant2	11.15	0	11.15	24	Pass
NVNT	ax80	5775	Ant2	11.3	0	11.3	30	Pass
NVNT	ax80	5210	Ant1	7.02	0	7.02	24	Pass
NVNT	ax80	5210	Ant2	7.75	0	7.75	24	Pass
NVNT	ax80	5210	MIMO	10.41	0	10.41	24	Pass
NVNT	ax80	5290	Ant1	7.3	0	7.3	24	Pass
NVNT	ax80	5290	Ant2	6.71	0	6.71	24	Pass
NVNT	ax80	5290	MIMO	10.03	0	10.03	24	Pass
NVNT	ax80	5530	Ant1	5.72	0	5.72	24	Pass
NVNT	ax80	5530	Ant2	6.11	0	6.11	24	Pass
NVNT	ax80	5530	MIMO	8.93	0	8.93	24	Pass
NVNT	ax80	5610	Ant1	4.13	0	4.13	24	Pass
NVNT	ax80	5610	Ant2	6.52	0	6.52	24	Pass
NVNT	ax80	5610	MIMO	8.5	0	8.5	24	Pass
NVNT	ax80	5775	Ant1	5.9	0	5.9	30	Pass



NVNT	ax80	5775	Ant2	7.14	0	7.14	30	Pass
NVNT	ax80	5775	MIMO	9.57	0	9.57	30	Pass



-26dB Bandwidth

Condition	Mode	Frequency (MHz)	Antenna	-26 dB Bandwidth (MHz)	Verdict
NVNT	a	5180	Ant1	19.713	Pass
NVNT	a	5200	Ant1	19.862	Pass
NVNT	a	5240	Ant1	19.797	Pass
NVNT	a	5260	Ant1	19.574	Pass
NVNT	a	5300	Ant1	19.817	Pass
NVNT	a	5320	Ant1	19.74	Pass
NVNT	a	5500	Ant1	19.488	Pass
NVNT	a	5580	Ant1	19.78	Pass
NVNT	a	5700	Ant1	19.713	Pass
NVNT	a	5180	Ant2	19.783	Pass
NVNT	a	5200	Ant2	19.895	Pass
NVNT	a	5240	Ant2	19.616	Pass
NVNT	a	5260	Ant2	19.508	Pass
NVNT	a	5300	Ant2	19.475	Pass
NVNT	a	5320	Ant2	19.457	Pass
NVNT	a	5500	Ant2	19.401	Pass
NVNT	a	5580	Ant2	19.257	Pass
NVNT	a	5700	Ant2	19.456	Pass
NVNT	n20	5180	Ant1	20.167	Pass
NVNT	n20	5200	Ant1	20.287	Pass
NVNT	n20	5240	Ant1	20.16	Pass
NVNT	n20	5260	Ant1	20.093	Pass
NVNT	n20	5300	Ant1	20.019	Pass
NVNT	n20	5320	Ant1	20.159	Pass
NVNT	n20	5500	Ant1	20.186	Pass
NVNT	n20	5580	Ant1	20.108	Pass
NVNT	n20	5700	Ant1	20.172	Pass
NVNT	n20	5180	Ant2	20.126	Pass
NVNT	n20	5200	Ant2	20.023	Pass
NVNT	n20	5240	Ant2	20.101	Pass
NVNT	n20	5260	Ant2	20.165	Pass
NVNT	n20	5300	Ant2	20.412	Pass
NVNT	n20	5320	Ant2	20.127	Pass
NVNT	n20	5500	Ant2	20.075	Pass
NVNT	n20	5580	Ant2	20.157	Pass
NVNT	n20	5700	Ant2	20.083	Pass
NVNT	n40	5190	Ant1	40.813	Pass
NVNT	n40	5230	Ant1	40.583	Pass
NVNT	n40	5270	Ant1	40.385	Pass
NVNT	n40	5310	Ant1	40.502	Pass
NVNT	n40	5510	Ant1	41.075	Pass
NVNT	n40	5550	Ant1	40.724	Pass
NVNT	n40	5670	Ant1	40.832	Pass
NVNT	n40	5190	Ant2	40.653	Pass
NVNT	n40	5230	Ant2	40.828	Pass
NVNT	n40	5270	Ant2	40.145	Pass
NVNT	n40	5310	Ant2	40.046	Pass
NVNT	n40	5510	Ant2	40.08	Pass
NVNT	n40	5550	Ant2	40.63	Pass
NVNT	n40	5670	Ant2	40.532	Pass
NVNT	ac20	5180	Ant1	20.167	Pass
NVNT	ac20	5200	Ant1	20.136	Pass
NVNT	ac20	5240	Ant1	20.088	Pass



NVNT	ac20	5260	Ant1	20.313	Pass
NVNT	ac20	5300	Ant1	20.326	Pass
NVNT	ac20	5320	Ant1	20.088	Pass
NVNT	ac20	5500	Ant1	20.037	Pass
NVNT	ac20	5580	Ant1	19.828	Pass
NVNT	ac20	5700	Ant1	20.193	Pass
NVNT	ac20	5180	Ant2	20.168	Pass
NVNT	ac20	5200	Ant2	20.248	Pass
NVNT	ac20	5240	Ant2	20.232	Pass
NVNT	ac20	5260	Ant2	20.107	Pass
NVNT	ac20	5300	Ant2	20.114	Pass
NVNT	ac20	5320	Ant2	20.158	Pass
NVNT	ac20	5500	Ant2	20.266	Pass
NVNT	ac20	5580	Ant2	20.045	Pass
NVNT	ac20	5700	Ant2	20.105	Pass
NVNT	ac40	5190	Ant1	40.565	Pass
NVNT	ac40	5230	Ant1	40.477	Pass
NVNT	ac40	5270	Ant1	40.708	Pass
NVNT	ac40	5310	Ant1	40.348	Pass
NVNT	ac40	5510	Ant1	40.55	Pass
NVNT	ac40	5550	Ant1	40.745	Pass
NVNT	ac40	5670	Ant1	40.097	Pass
NVNT	ac40	5190	Ant2	40.388	Pass
NVNT	ac40	5230	Ant2	40.032	Pass
NVNT	ac40	5270	Ant2	40.276	Pass
NVNT	ac40	5310	Ant2	40.248	Pass
NVNT	ac40	5510	Ant2	40.152	Pass
NVNT	ac40	5550	Ant2	40.255	Pass
NVNT	ac40	5670	Ant2	40.45	Pass
NVNT	ac80	5210	Ant1	81.666	Pass
NVNT	ac80	5290	Ant1	81.432	Pass
NVNT	ac80	5530	Ant1	81.309	Pass
NVNT	ac80	5610	Ant1	81.346	Pass
NVNT	ac80	5210	Ant2	81.508	Pass
NVNT	ac80	5290	Ant2	81.396	Pass
NVNT	ac80	5530	Ant2	81.05	Pass
NVNT	ac80	5610	Ant2	81.189	Pass
NVNT	ax20	5180	Ant1	19.813	Pass
NVNT	ax20	5200	Ant1	19.806	Pass
NVNT	ax20	5240	Ant1	19.836	Pass
NVNT	ax20	5260	Ant1	19.867	Pass
NVNT	ax20	5300	Ant1	19.936	Pass
NVNT	ax20	5320	Ant1	19.818	Pass
NVNT	ax20	5500	Ant1	19.843	Pass
NVNT	ax20	5580	Ant1	19.948	Pass
NVNT	ax20	5700	Ant1	19.82	Pass
NVNT	ax20	5180	Ant2	19.878	Pass
NVNT	ax20	5200	Ant2	19.813	Pass
NVNT	ax20	5240	Ant2	19.858	Pass
NVNT	ax20	5260	Ant2	19.876	Pass
NVNT	ax20	5300	Ant2	19.849	Pass
NVNT	ax20	5320	Ant2	19.856	Pass
NVNT	ax20	5500	Ant2	19.887	Pass
NVNT	ax20	5580	Ant2	19.883	Pass
NVNT	ax20	5700	Ant2	19.854	Pass
NVNT	ax40	5190	Ant1	39.608	Pass



NVNT	ax40	5230	Ant1	39.755	Pass
NVNT	ax40	5270	Ant1	39.731	Pass
NVNT	ax40	5310	Ant1	39.521	Pass
NVNT	ax40	5510	Ant1	39.576	Pass
NVNT	ax40	5550	Ant1	39.561	Pass
NVNT	ax40	5670	Ant1	39.834	Pass
NVNT	ax40	5190	Ant2	39.749	Pass
NVNT	ax40	5230	Ant2	39.676	Pass
NVNT	ax40	5270	Ant2	39.599	Pass
NVNT	ax40	5310	Ant2	39.652	Pass
NVNT	ax40	5510	Ant2	39.697	Pass
NVNT	ax40	5550	Ant2	39.678	Pass
NVNT	ax40	5670	Ant2	39.544	Pass
NVNT	ax80	5210	Ant1	82.184	Pass
NVNT	ax80	5290	Ant1	82.202	Pass
NVNT	ax80	5530	Ant1	82.14	Pass
NVNT	ax80	5610	Ant1	82.176	Pass
NVNT	ax80	5210	Ant2	82.061	Pass
NVNT	ax80	5290	Ant2	82.178	Pass
NVNT	ax80	5530	Ant2	82.139	Pass
NVNT	ax80	5610	Ant2	82.295	Pass



