



Appendix N: Test Data for E-UTRA Band 41

Product Name: Data Collector

Test Model: R50

Environmental Conditions

Temperature:	23.6°C
Relative Humidity:	52.5%
ATM Pressure:	100.0 kPa
Test Engineer:	Jay Luo
Supervised by:	Nick Peng



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



N.1 Conducted Output Power Data

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	21.43	PASS
Band41	5MHz	16QAM	39675	1RB#0	21.37	PASS
Band41	5MHz	QPSK	39675	1RB#12	21.42	PASS
Band41	5MHz	16QAM	39675	1RB#12	22.62	PASS
Band41	5MHz	QPSK	39675	1RB#24	21.47	PASS
Band41	5MHz	16QAM	39675	1RB#24	21.26	PASS
Band41	5MHz	QPSK	39675	12RB#0	20.49	PASS
Band41	5MHz	16QAM	39675	12RB#0	19.71	PASS
Band41	5MHz	QPSK	39675	12RB#6	20.35	PASS
Band41	5MHz	16QAM	39675	12RB#6	19.76	PASS
Band41	5MHz	QPSK	39675	12RB#13	20.39	PASS
Band41	5MHz	16QAM	39675	12RB#13	19.75	PASS
Band41	5MHz	QPSK	39675	25RB#0	20.39	PASS
Band41	5MHz	16QAM	39675	25RB#0	19.81	PASS
Band41	5MHz	QPSK	40620	1RB#0	22.22	PASS
Band41	5MHz	16QAM	40620	1RB#0	21.62	PASS
Band41	5MHz	QPSK	40620	1RB#12	22.15	PASS
Band41	5MHz	16QAM	40620	1RB#12	21.85	PASS
Band41	5MHz	QPSK	40620	1RB#24	22.11	PASS
Band41	5MHz	16QAM	40620	1RB#24	22.13	PASS
Band41	5MHz	QPSK	40620	12RB#0	21.13	PASS
Band41	5MHz	16QAM	40620	12RB#0	20.47	PASS
Band41	5MHz	QPSK	40620	12RB#6	21.09	PASS
Band41	5MHz	16QAM	40620	12RB#6	20.47	PASS
Band41	5MHz	QPSK	40620	12RB#13	21.11	PASS
Band41	5MHz	16QAM	40620	12RB#13	20.43	PASS
Band41	5MHz	QPSK	40620	25RB#0	21.11	PASS
Band41	5MHz	16QAM	40620	25RB#0	20.51	PASS
Band41	5MHz	QPSK	41565	1RB#0	21.55	PASS
Band41	5MHz	16QAM	41565	1RB#0	21.15	PASS
Band41	5MHz	QPSK	41565	1RB#12	21.59	PASS
Band41	5MHz	16QAM	41565	1RB#12	21.36	PASS
Band41	5MHz	QPSK	41565	1RB#24	21.60	PASS
Band41	5MHz	16QAM	41565	1RB#24	21.32	PASS
Band41	5MHz	QPSK	41565	12RB#0	20.45	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Band41	5MHz	16QAM	41565	12RB#0	19.80	PASS
Band41	5MHz	QPSK	41565	12RB#6	20.46	PASS
Band41	5MHz	16QAM	41565	12RB#6	19.82	PASS
Band41	5MHz	QPSK	41565	12RB#13	20.51	PASS
Band41	5MHz	16QAM	41565	12RB#13	19.80	PASS
Band41	5MHz	QPSK	41565	25RB#0	20.45	PASS
Band41	5MHz	16QAM	41565	25RB#0	19.90	PASS
Band41	10MHz	QPSK	39700	1RB#0	22.28	PASS
Band41	10MHz	16QAM	39700	1RB#0	22.16	PASS
Band41	10MHz	QPSK	39700	1RB#24	22.23	PASS
Band41	10MHz	16QAM	39700	1RB#24	22.23	PASS
Band41	10MHz	QPSK	39700	1RB#49	22.37	PASS
Band41	10MHz	16QAM	39700	1RB#49	22.20	PASS
Band41	10MHz	QPSK	39700	25RB#0	21.14	PASS
Band41	10MHz	16QAM	39700	25RB#0	20.49	PASS
Band41	10MHz	QPSK	39700	25RB#12	21.14	PASS
Band41	10MHz	16QAM	39700	25RB#12	20.52	PASS
Band41	10MHz	QPSK	39700	25RB#25	21.21	PASS
Band41	10MHz	16QAM	39700	25RB#25	20.51	PASS
Band41	10MHz	QPSK	39700	50RB#0	21.11	PASS
Band41	10MHz	16QAM	39700	50RB#0	20.58	PASS
Band41	10MHz	QPSK	40620	1RB#0	22.36	PASS
Band41	10MHz	16QAM	40620	1RB#0	22.33	PASS
Band41	10MHz	QPSK	40620	1RB#24	22.13	PASS
Band41	10MHz	16QAM	40620	1RB#24	22.25	PASS
Band41	10MHz	QPSK	40620	1RB#49	22.37	PASS
Band41	10MHz	16QAM	40620	1RB#49	22.30	PASS
Band41	10MHz	QPSK	40620	25RB#0	21.10	PASS
Band41	10MHz	16QAM	40620	25RB#0	20.40	PASS
Band41	10MHz	QPSK	40620	25RB#12	21.09	PASS
Band41	10MHz	16QAM	40620	25RB#12	20.41	PASS
Band41	10MHz	QPSK	40620	25RB#25	21.03	PASS
Band41	10MHz	16QAM	40620	25RB#25	20.44	PASS
Band41	10MHz	QPSK	40620	50RB#0	20.95	PASS
Band41	10MHz	16QAM	40620	50RB#0	20.45	PASS
Band41	10MHz	QPSK	41540	1RB#0	21.76	PASS
Band41	10MHz	16QAM	41540	1RB#0	21.59	PASS
Band41	10MHz	QPSK	41540	1RB#24	21.78	PASS
Band41	10MHz	16QAM	41540	1RB#24	21.61	PASS
Band41	10MHz	QPSK	41540	1RB#49	21.77	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Band41	10MHz	16QAM	41540	1RB#49	21.57	PASS
Band41	10MHz	QPSK	41540	25RB#0	20.60	PASS
Band41	10MHz	16QAM	41540	25RB#0	19.80	PASS
Band41	10MHz	QPSK	41540	25RB#12	20.60	PASS
Band41	10MHz	16QAM	41540	25RB#12	19.81	PASS
Band41	10MHz	QPSK	41540	25RB#25	20.46	PASS
Band41	10MHz	16QAM	41540	25RB#25	19.78	PASS
Band41	10MHz	QPSK	41540	50RB#0	20.45	PASS
Band41	10MHz	16QAM	41540	50RB#0	19.81	PASS
Band41	15MHz	QPSK	39725	1RB#0	22.24	PASS
Band41	15MHz	16QAM	39725	1RB#0	22.23	PASS
Band41	15MHz	QPSK	39725	1RB#38	22.30	PASS
Band41	15MHz	16QAM	39725	1RB#38	22.19	PASS
Band41	15MHz	QPSK	39725	1RB#74	22.29	PASS
Band41	15MHz	16QAM	39725	1RB#74	22.22	PASS
Band41	15MHz	QPSK	39725	38RB#0	21.15	PASS
Band41	15MHz	16QAM	39725	38RB#0	21.15	PASS
Band41	15MHz	QPSK	39725	38RB#18	21.15	PASS
Band41	15MHz	16QAM	39725	38RB#18	20.92	PASS
Band41	15MHz	QPSK	39725	38RB#37	20.92	PASS
Band41	15MHz	16QAM	39725	38RB#37	20.92	PASS
Band41	15MHz	QPSK	39725	75RB#0	20.92	PASS
Band41	15MHz	16QAM	39725	75RB#0	20.30	PASS
Band41	15MHz	QPSK	40620	1RB#0	22.42	PASS
Band41	15MHz	16QAM	40620	1RB#0	22.34	PASS
Band41	15MHz	QPSK	40620	1RB#38	22.32	PASS
Band41	15MHz	16QAM	40620	1RB#38	22.29	PASS
Band41	15MHz	QPSK	40620	1RB#74	22.32	PASS
Band41	15MHz	16QAM	40620	1RB#74	22.28	PASS
Band41	15MHz	QPSK	40620	38RB#0	21.24	PASS
Band41	15MHz	16QAM	40620	38RB#0	21.29	PASS
Band41	15MHz	QPSK	40620	38RB#18	21.25	PASS
Band41	15MHz	16QAM	40620	38RB#18	21.20	PASS
Band41	15MHz	QPSK	40620	38RB#37	21.20	PASS
Band41	15MHz	16QAM	40620	38RB#37	21.15	PASS
Band41	15MHz	QPSK	40620	75RB#0	21.15	PASS
Band41	15MHz	16QAM	40620	75RB#0	20.68	PASS
Band41	15MHz	QPSK	41515	1RB#0	21.85	PASS
Band41	15MHz	16QAM	41515	1RB#0	21.66	PASS
Band41	15MHz	QPSK	41515	1RB#38	21.84	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Band41	15MHz	16QAM	41515	1RB#38	21.66	PASS
Band41	15MHz	QPSK	41515	1RB#74	21.77	PASS
Band41	15MHz	16QAM	41515	1RB#74	21.57	PASS
Band41	15MHz	QPSK	41515	38RB#0	20.67	PASS
Band41	15MHz	16QAM	41515	38RB#0	20.68	PASS
Band41	15MHz	QPSK	41515	38RB#18	20.68	PASS
Band41	15MHz	16QAM	41515	38RB#18	20.68	PASS
Band41	15MHz	QPSK	41515	38RB#37	20.68	PASS
Band41	15MHz	16QAM	41515	38RB#37	20.69	PASS
Band41	15MHz	QPSK	41515	75RB#0	20.69	PASS
Band41	15MHz	16QAM	41515	75RB#0	20.03	PASS
Band41	20MHz	QPSK	39750	1RB#0	21.79	PASS
Band41	20MHz	16QAM	39750	1RB#0	21.36	PASS
Band41	20MHz	QPSK	39750	1RB#49	21.83	PASS
Band41	20MHz	16QAM	39750	1RB#49	21.29	PASS
Band41	20MHz	QPSK	39750	1RB#99	21.94	PASS
Band41	20MHz	16QAM	39750	1RB#99	21.52	PASS
Band41	20MHz	QPSK	39750	50RB#0	20.90	PASS
Band41	20MHz	16QAM	39750	50RB#0	20.44	PASS
Band41	20MHz	QPSK	39750	50RB#25	20.87	PASS
Band41	20MHz	16QAM	39750	50RB#25	20.44	PASS
Band41	20MHz	QPSK	39750	50RB#50	20.89	PASS
Band41	20MHz	16QAM	39750	50RB#50	20.45	PASS
Band41	20MHz	QPSK	39750	100RB#0	20.96	PASS
Band41	20MHz	16QAM	39750	100RB#0	20.29	PASS
Band41	20MHz	QPSK	40620	1RB#0	22.00	PASS
Band41	20MHz	16QAM	40620	1RB#0	22.27	PASS
Band41	20MHz	QPSK	40620	1RB#49	21.89	PASS
Band41	20MHz	16QAM	40620	1RB#49	22.10	PASS
Band41	20MHz	QPSK	40620	1RB#99	21.88	PASS
Band41	20MHz	16QAM	40620	1RB#99	21.86	PASS
Band41	20MHz	QPSK	40620	50RB#0	21.29	PASS
Band41	20MHz	16QAM	40620	50RB#0	20.77	PASS
Band41	20MHz	QPSK	40620	50RB#25	21.30	PASS
Band41	20MHz	16QAM	40620	50RB#25	20.61	PASS
Band41	20MHz	QPSK	40620	50RB#50	20.99	PASS
Band41	20MHz	16QAM	40620	50RB#50	20.52	PASS
Band41	20MHz	QPSK	40620	100RB#0	21.05	PASS
Band41	20MHz	16QAM	40620	100RB#0	20.39	PASS
Band41	20MHz	QPSK	41490	1RB#0	21.50	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Band41	20MHz	16QAM	41490	1RB#0	21.70	PASS
Band41	20MHz	QPSK	41490	1RB#49	21.44	PASS
Band41	20MHz	16QAM	41490	1RB#49	21.63	PASS
Band41	20MHz	QPSK	41490	1RB#99	21.47	PASS
Band41	20MHz	16QAM	41490	1RB#99	21.62	PASS
Band41	20MHz	QPSK	41490	50RB#0	20.72	PASS
Band41	20MHz	16QAM	41490	50RB#0	20.09	PASS
Band41	20MHz	QPSK	41490	50RB#25	20.68	PASS
Band41	20MHz	16QAM	41490	50RB#25	20.09	PASS
Band41	20MHz	QPSK	41490	50RB#50	20.58	PASS
Band41	20MHz	16QAM	41490	50RB#50	20.17	PASS
Band41	20MHz	QPSK	41490	100RB#0	20.66	PASS
Band41	20MHz	16QAM	41490	100RB#0	19.93	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



N.2 Peak-to-Average Ratio(CCDF)

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dB)	Limit(dB)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	8.42	13	PASS
Band41	5MHz	16QAM	39675	1RB#0	8.97	13	PASS
Band41	5MHz	QPSK	39675	25RB#0	8.93	13	PASS
Band41	5MHz	16QAM	39675	25RB#0	9.63	13	PASS
Band41	5MHz	QPSK	40620	1RB#0	8.05	13	PASS
Band41	5MHz	16QAM	40620	1RB#0	8.49	13	PASS
Band41	5MHz	QPSK	40620	25RB#0	8.70	13	PASS
Band41	5MHz	16QAM	40620	25RB#0	9.41	13	PASS
Band41	5MHz	QPSK	41565	1RB#0	6.99	13	PASS
Band41	5MHz	16QAM	41565	1RB#0	7.47	13	PASS
Band41	5MHz	QPSK	41565	25RB#0	8.36	13	PASS
Band41	5MHz	16QAM	41565	25RB#0	9.03	13	PASS
Band41	10MHz	QPSK	39700	1RB#0	7.99	13	PASS
Band41	10MHz	16QAM	39700	1RB#0	9.06	13	PASS
Band41	10MHz	QPSK	39700	50RB#0	9.12	13	PASS
Band41	10MHz	16QAM	39700	50RB#0	9.73	13	PASS
Band41	10MHz	QPSK	40620	1RB#0	8.15	13	PASS
Band41	10MHz	16QAM	40620	1RB#0	8.69	13	PASS
Band41	10MHz	QPSK	40620	50RB#0	8.70	13	PASS
Band41	10MHz	16QAM	40620	50RB#0	9.43	13	PASS
Band41	10MHz	QPSK	41540	1RB#0	6.83	13	PASS
Band41	10MHz	16QAM	41540	1RB#0	7.65	13	PASS
Band41	10MHz	QPSK	41540	50RB#0	8.43	13	PASS
Band41	10MHz	16QAM	41540	50RB#0	9.12	13	PASS
Band41	15MHz	QPSK	39725	1RB#0	8.29	13	PASS
Band41	15MHz	16QAM	39725	1RB#0	8.89	13	PASS
Band41	15MHz	QPSK	39725	75RB#0	9.31	13	PASS
Band41	15MHz	16QAM	39725	75RB#0	9.78	13	PASS
Band41	15MHz	QPSK	40620	1RB#0	8.12	13	PASS
Band41	15MHz	16QAM	40620	1RB#0	8.82	13	PASS
Band41	15MHz	QPSK	40620	75RB#0	9.01	13	PASS
Band41	15MHz	16QAM	40620	75RB#0	9.77	13	PASS
Band41	15MHz	QPSK	41515	1RB#0	7.35	13	PASS
Band41	15MHz	16QAM	41515	1RB#0	7.84	13	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Band41	15MHz	QPSK	41515	75RB#0	8.59	13	PASS
Band41	15MHz	16QAM	41515	75RB#0	9.01	13	PASS
Band41	20MHz	QPSK	39750	1RB#0	7.80	13	PASS
Band41	20MHz	16QAM	39750	1RB#0	8.37	13	PASS
Band41	20MHz	QPSK	39750	100RB#0	9.13	13	PASS
Band41	20MHz	16QAM	39750	100RB#0	9.62	13	PASS
Band41	20MHz	QPSK	40620	1RB#0	7.93	13	PASS
Band41	20MHz	16QAM	40620	1RB#0	8.44	13	PASS
Band41	20MHz	QPSK	40620	100RB#0	8.81	13	PASS
Band41	20MHz	16QAM	40620	100RB#0	9.48	13	PASS
Band41	20MHz	QPSK	41490	1RB#0	7.75	13	PASS
Band41	20MHz	16QAM	41490	1RB#0	7.90	13	PASS
Band41	20MHz	QPSK	41490	100RB#0	8.29	13	PASS
Band41	20MHz	16QAM	41490	100RB#0	8.99	13	PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

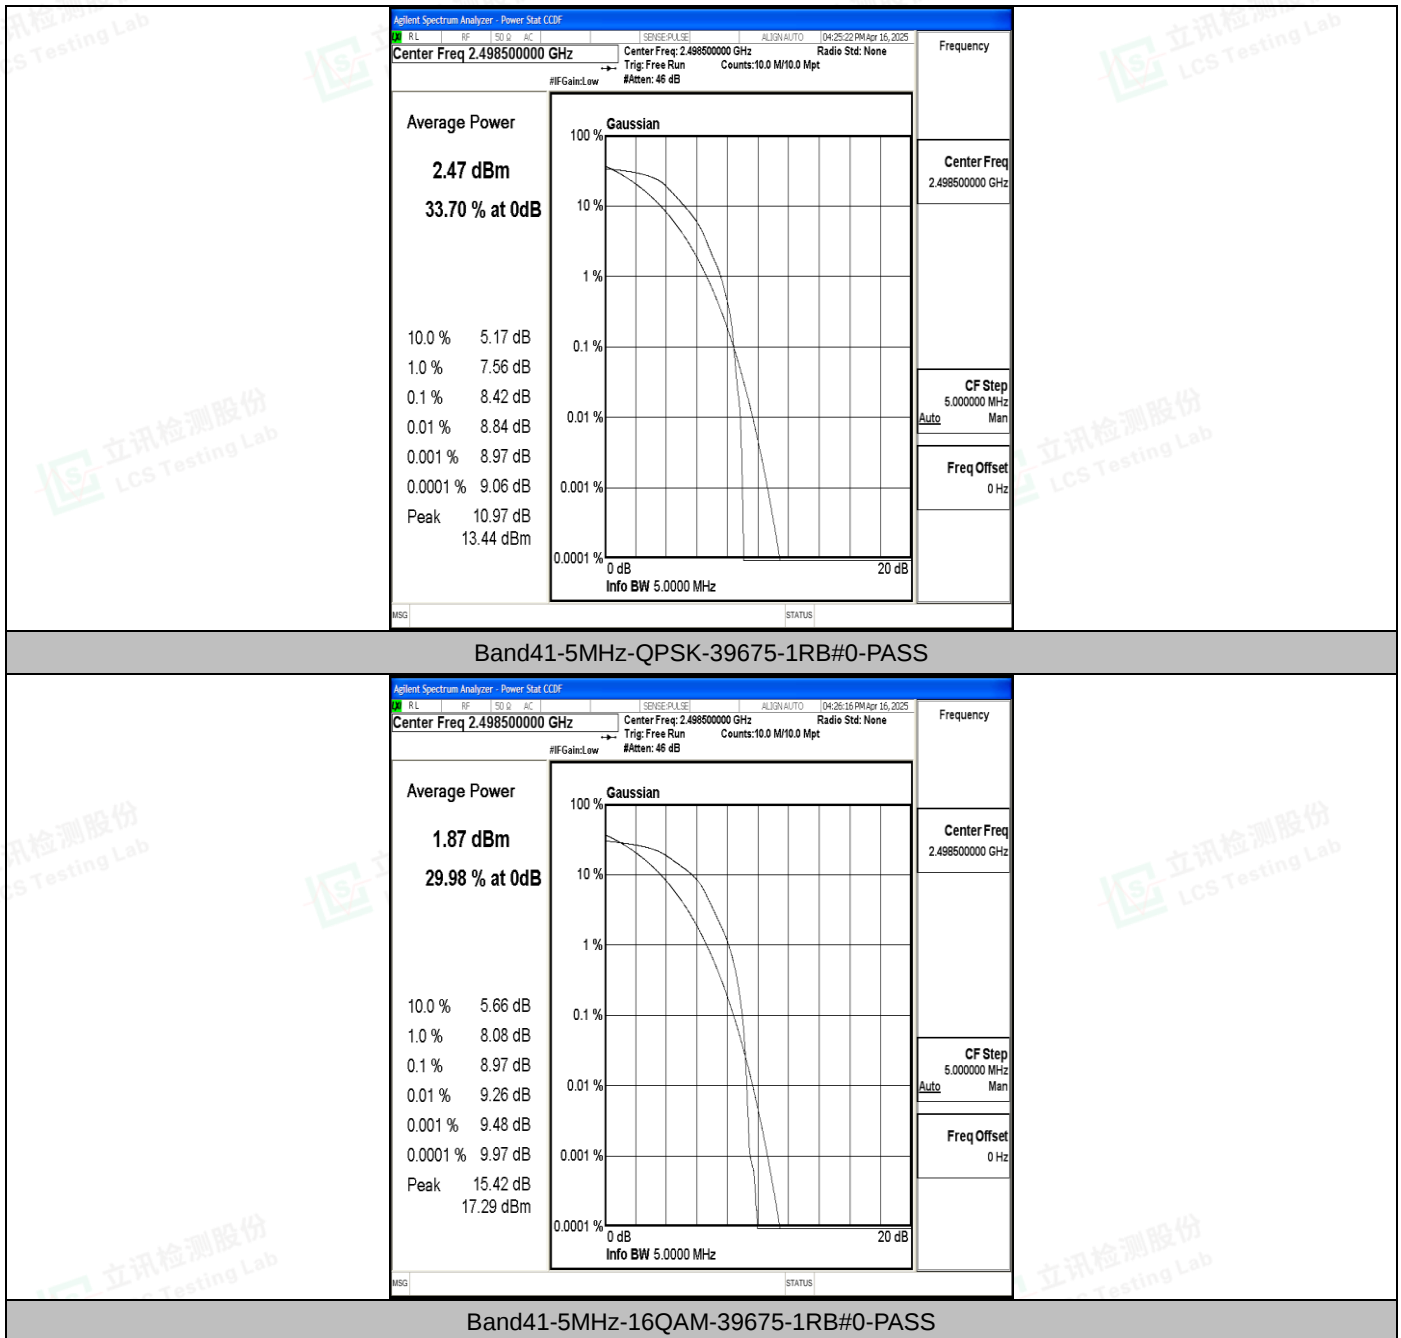

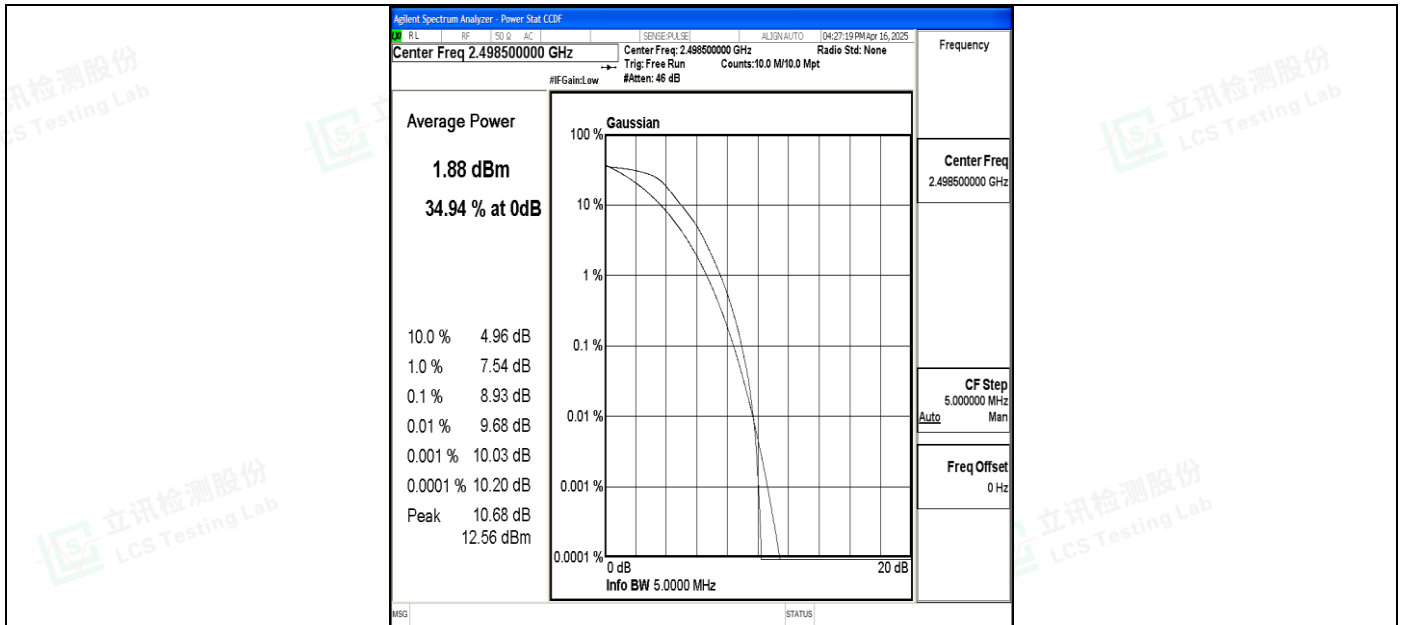


Band41-5MHz-QPSK-39675-25RB#0-PASS

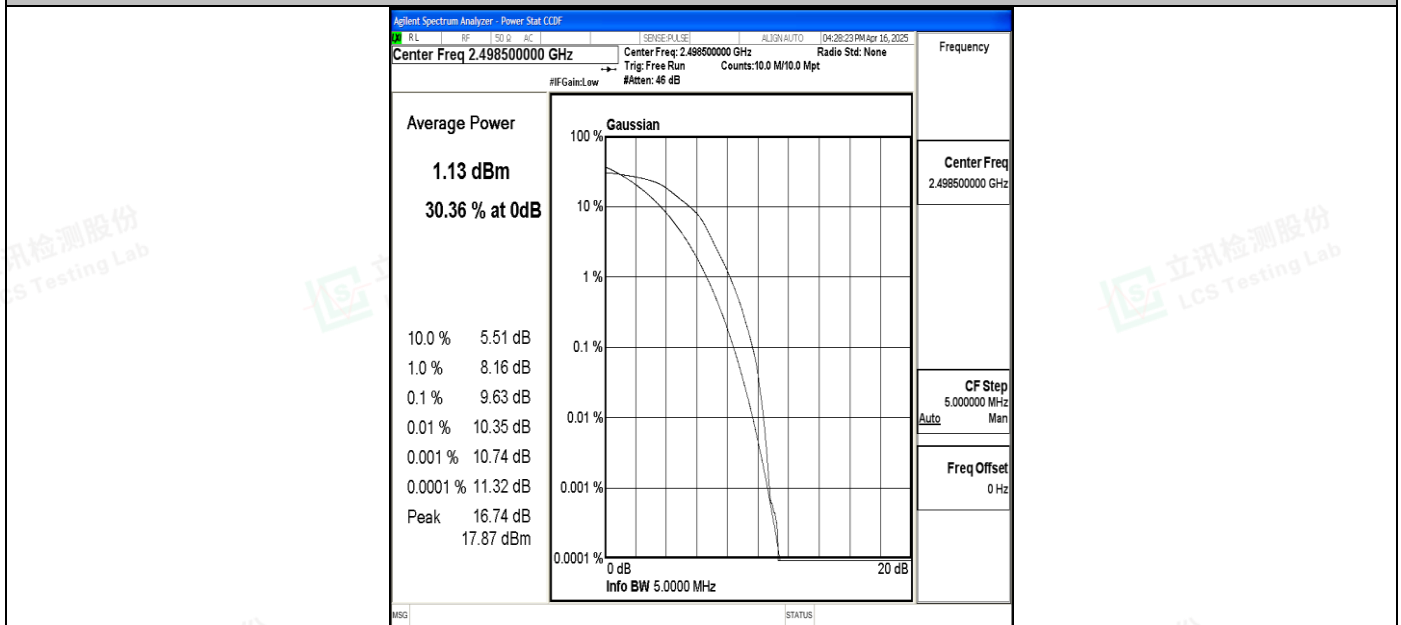


Band41-5MHz-16QAM-39675-25RB#0-PASS



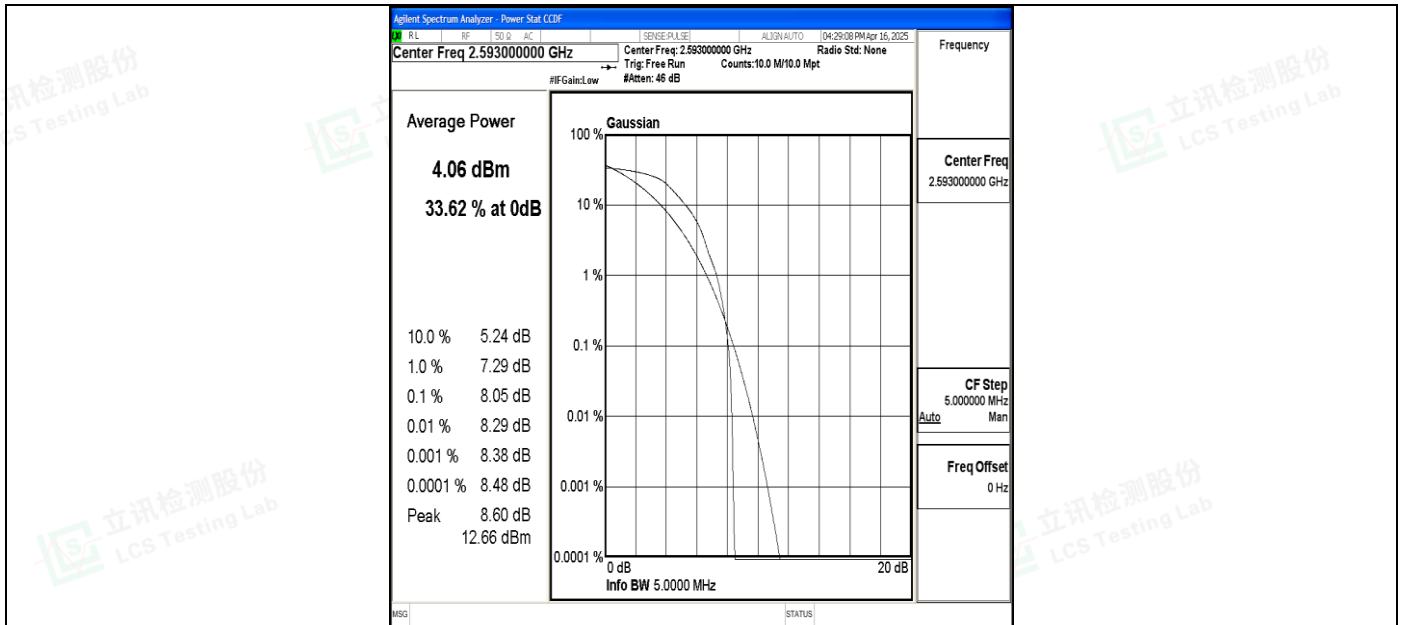


Band41-5MHz-QPSK-40620-1RB#0-PASS

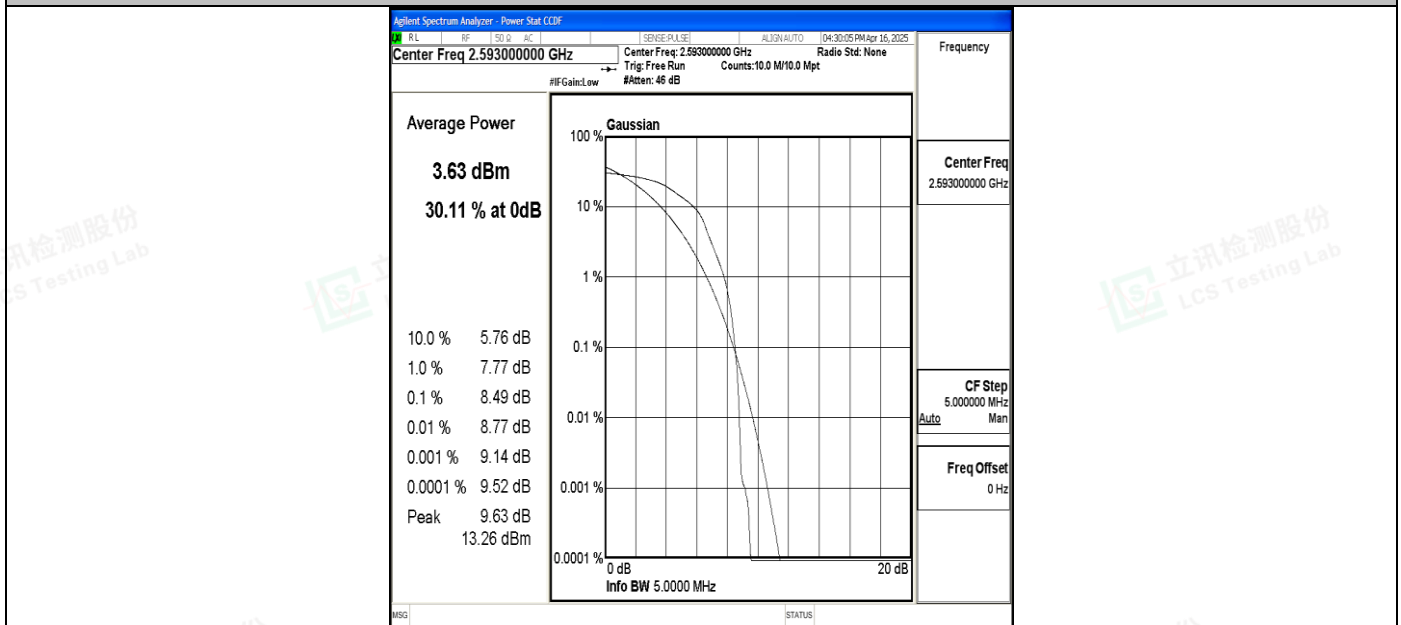


Band41-5MHz-16QAM-40620-1RB#0-PASS



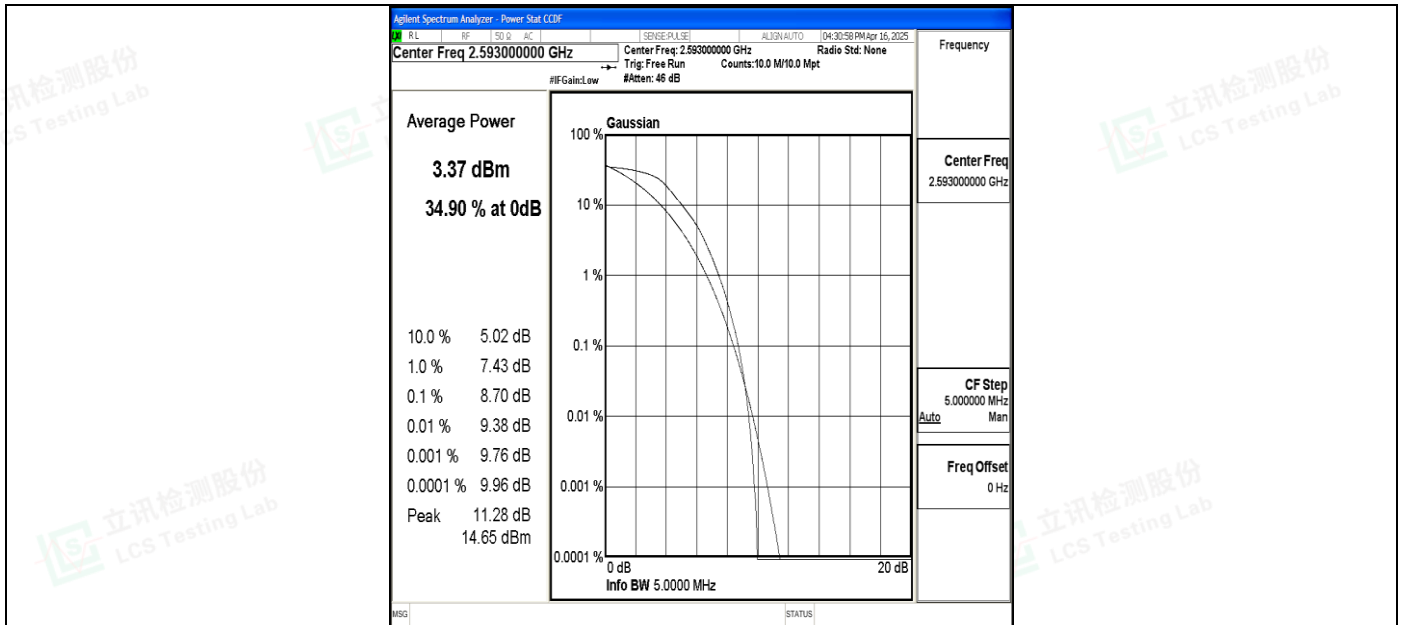


Band41-5MHz-QPSK-40620-25RB#0-PASS

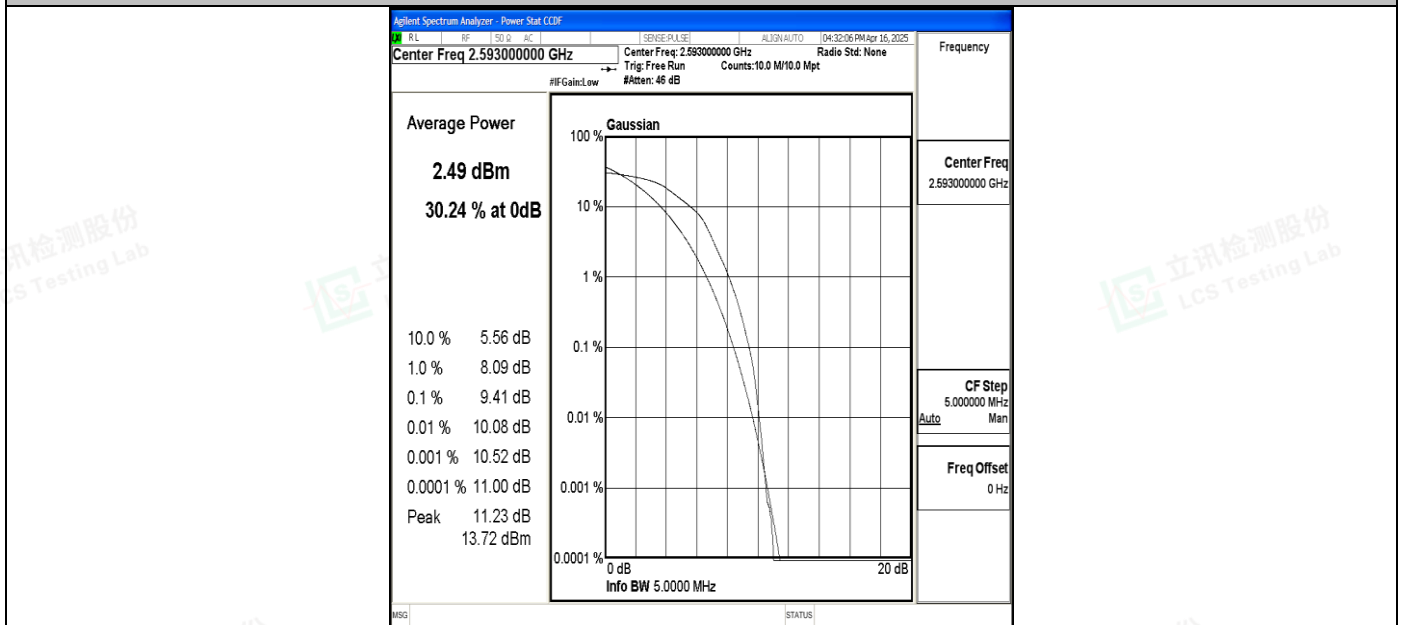


Band41-5MHz-16QAM-40620-25RB#0-PASS



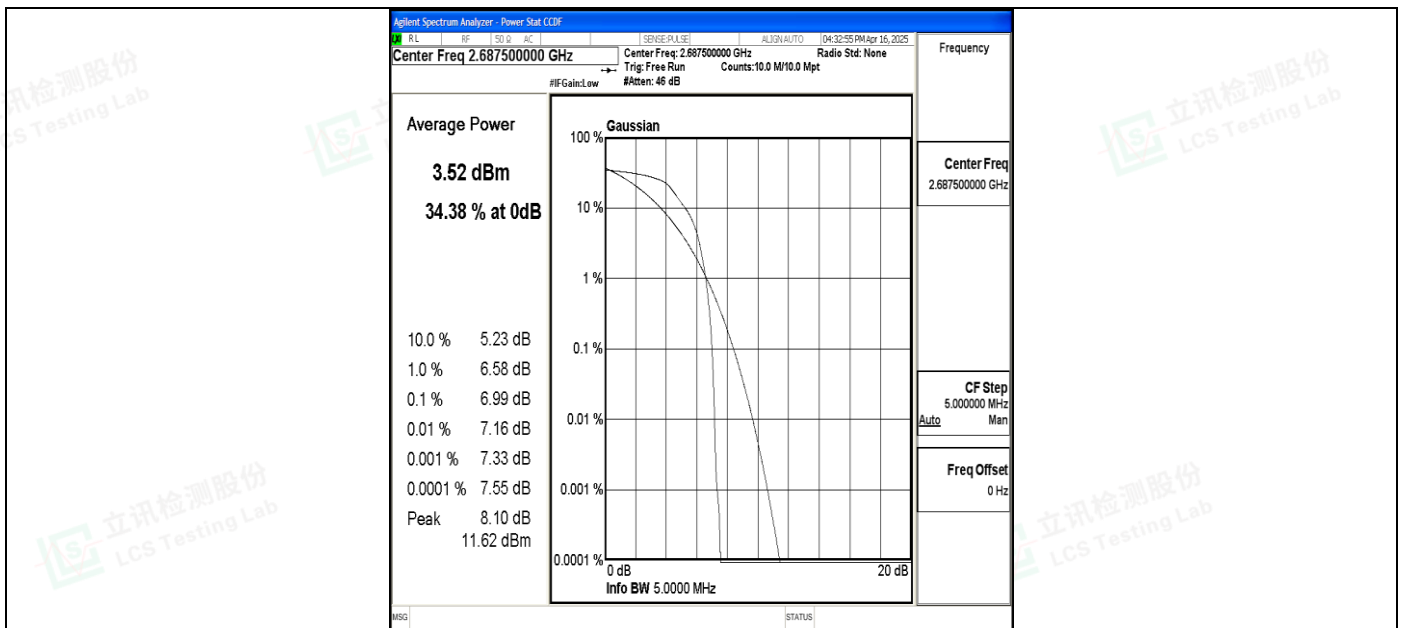


Band41-5MHz-QPSK-41565-1RB#0-PASS

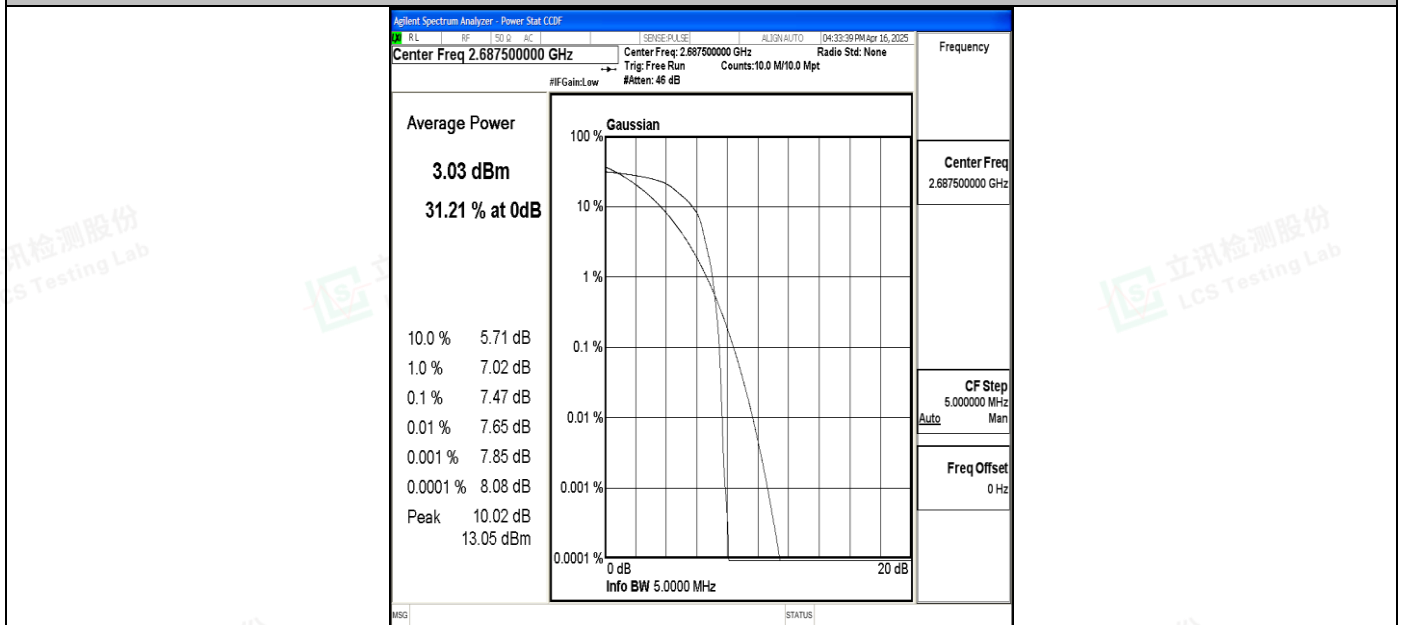


Band41-5MHz-16QAM-41565-1RB#0-PASS



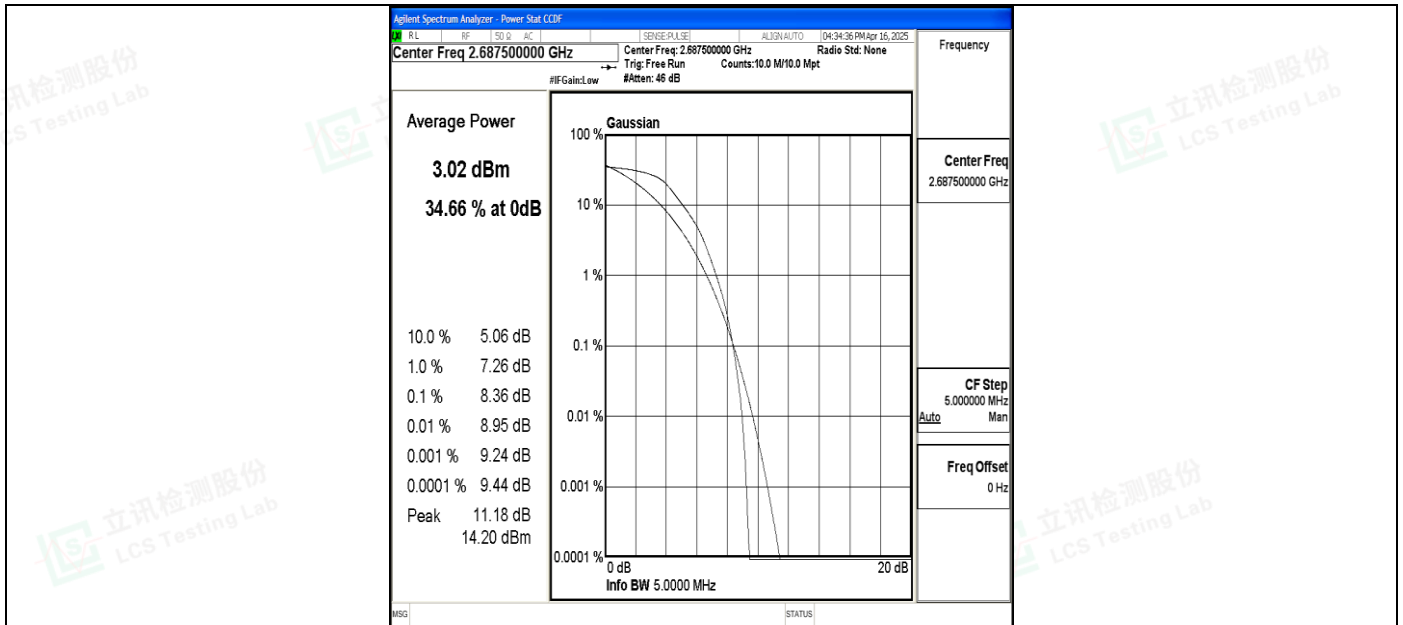


Band41-5MHz-QPSK-41565-25RB#0-PASS

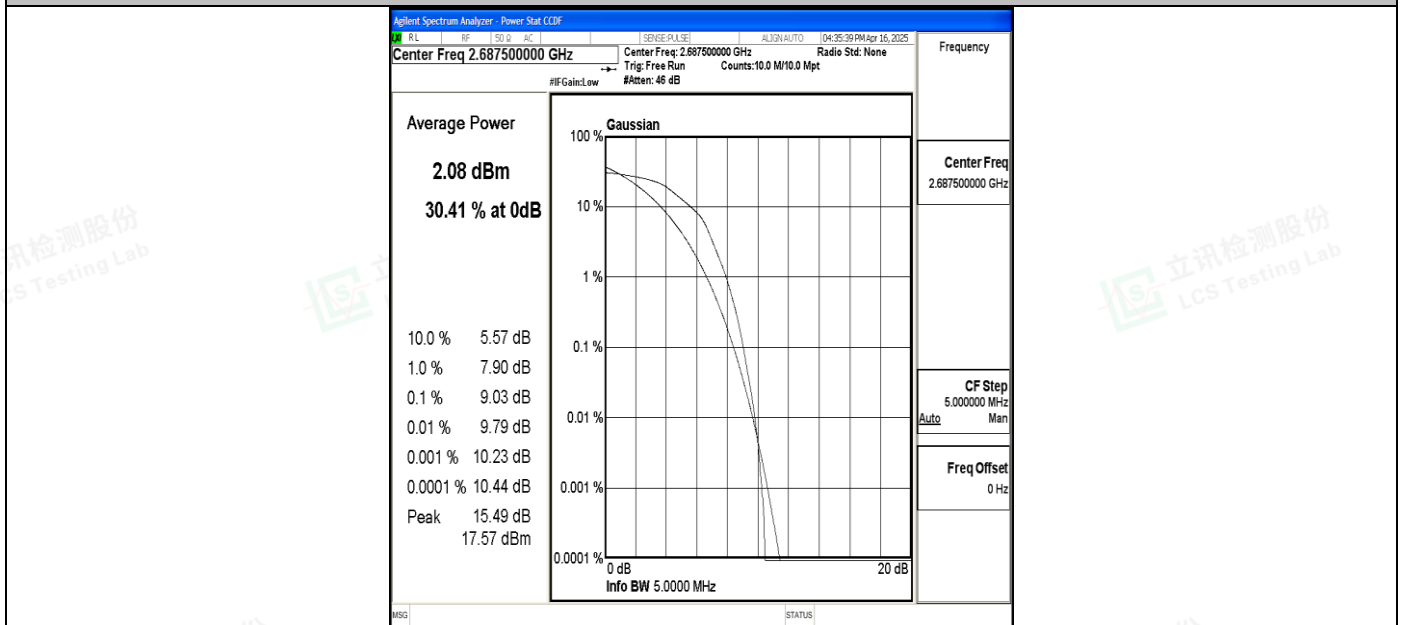


Band41-5MHz-16QAM-41565-25RB#0-PASS



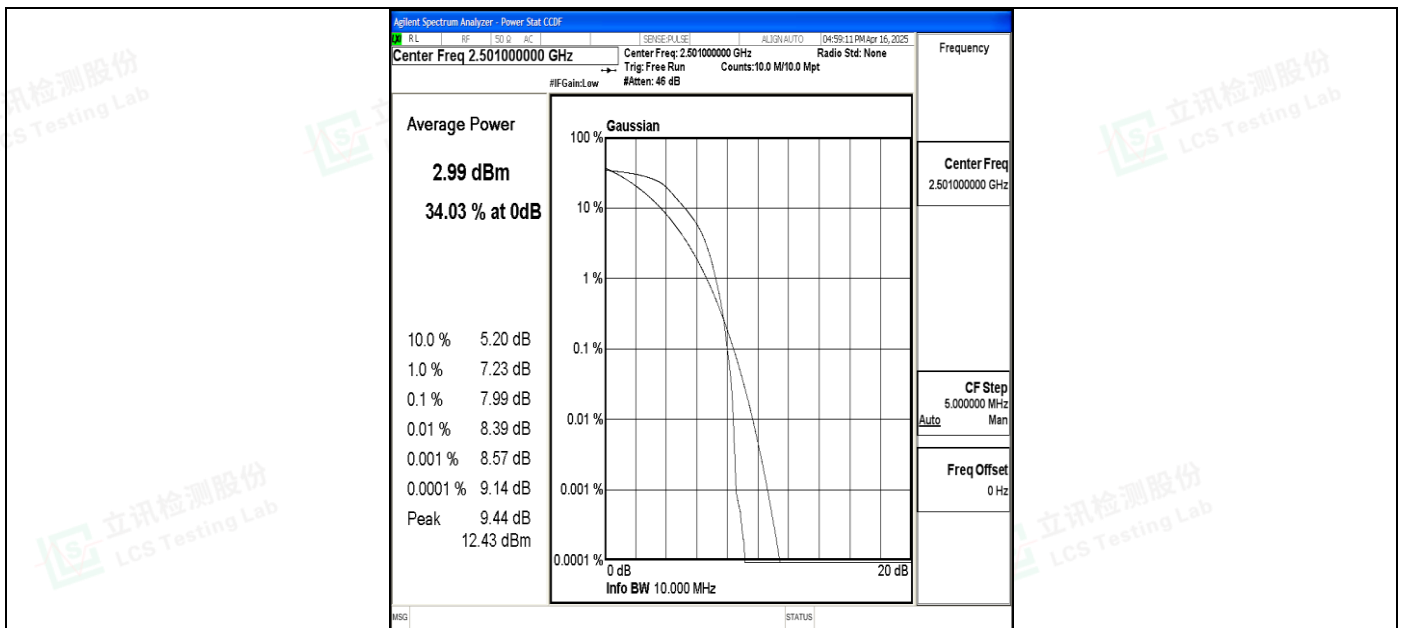


Band41-10MHz-QPSK-39700-1RB#0-PASS

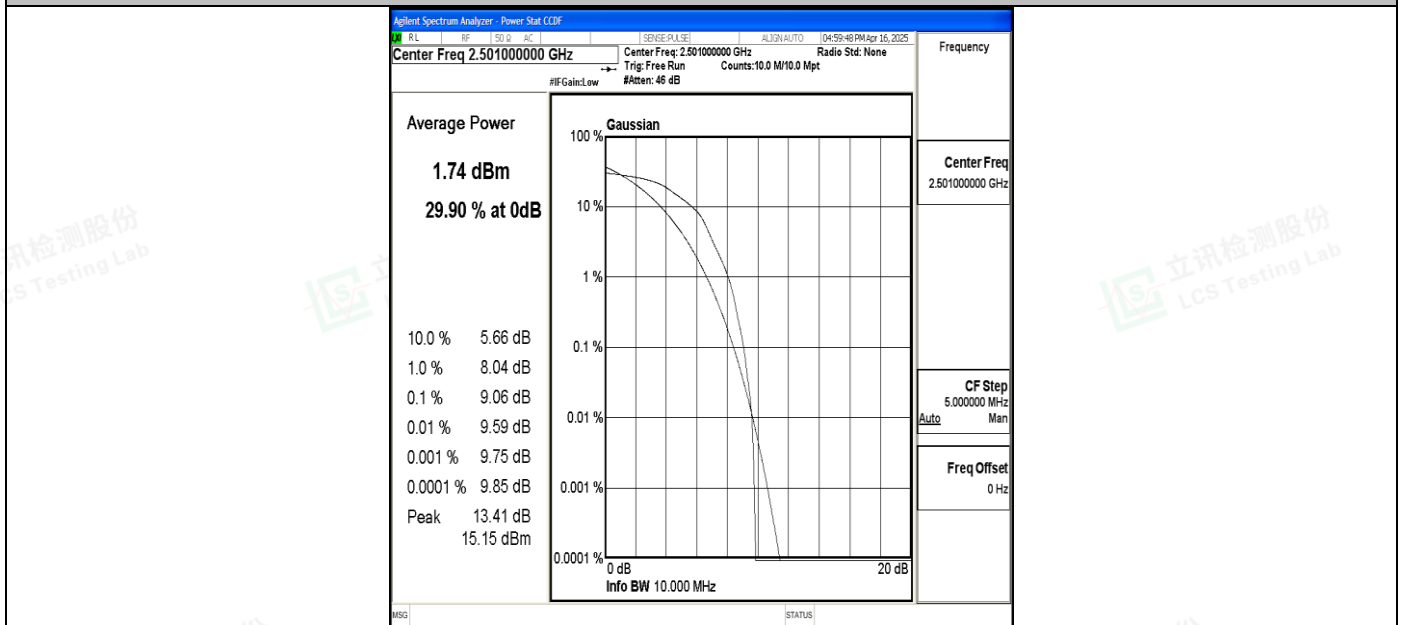


Band41-10MHz-16QAM-39700-1RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

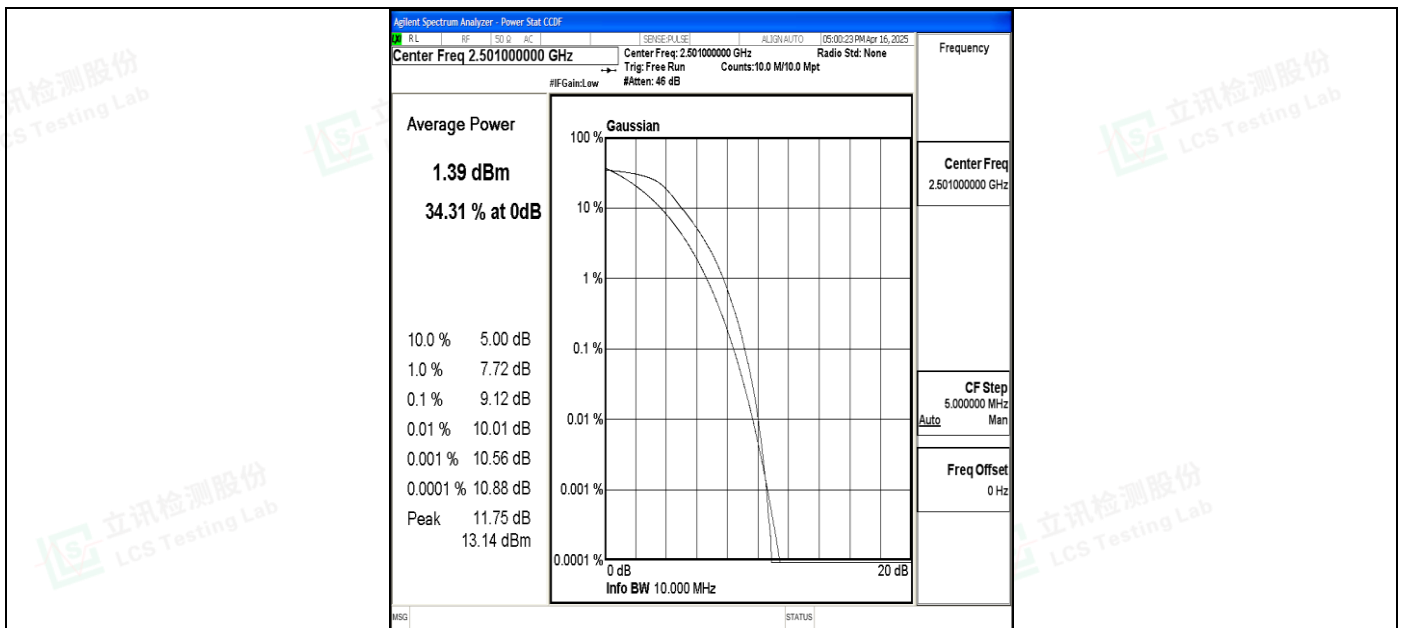


Band41-10MHz-QPSK-39700-50RB#0-PASS

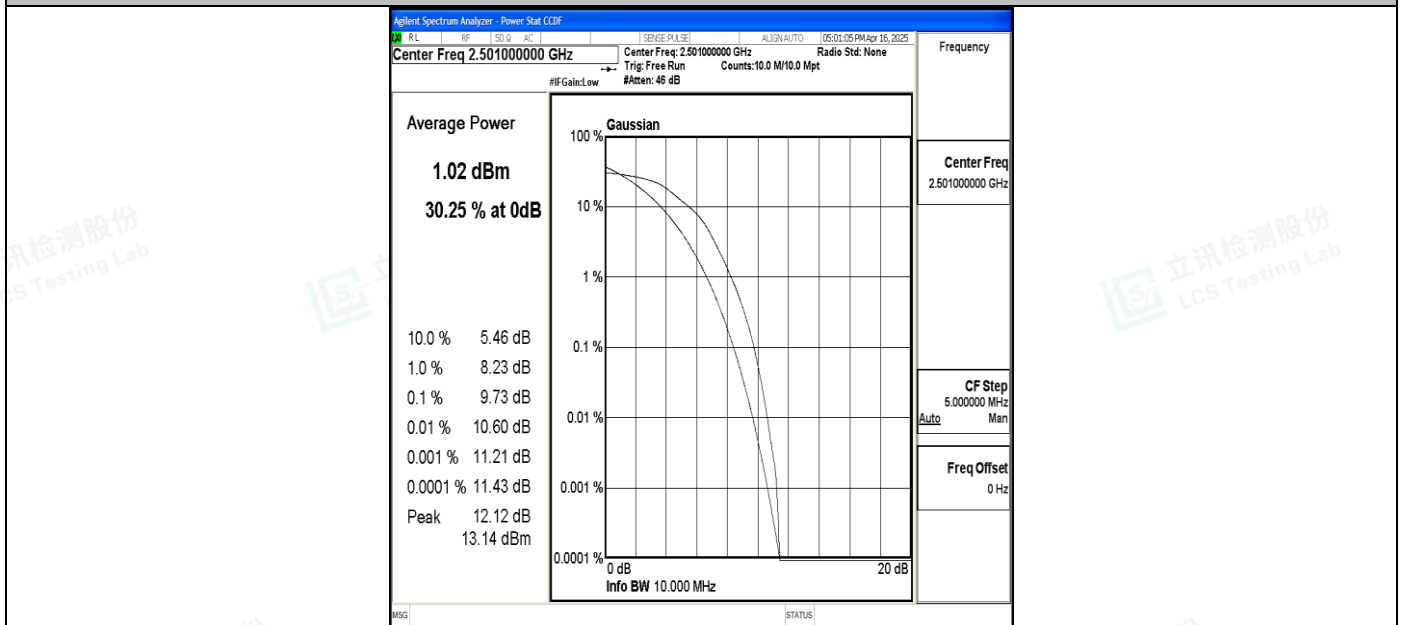


Band41-10MHz-16QAM-39700-50RB#0-PASS



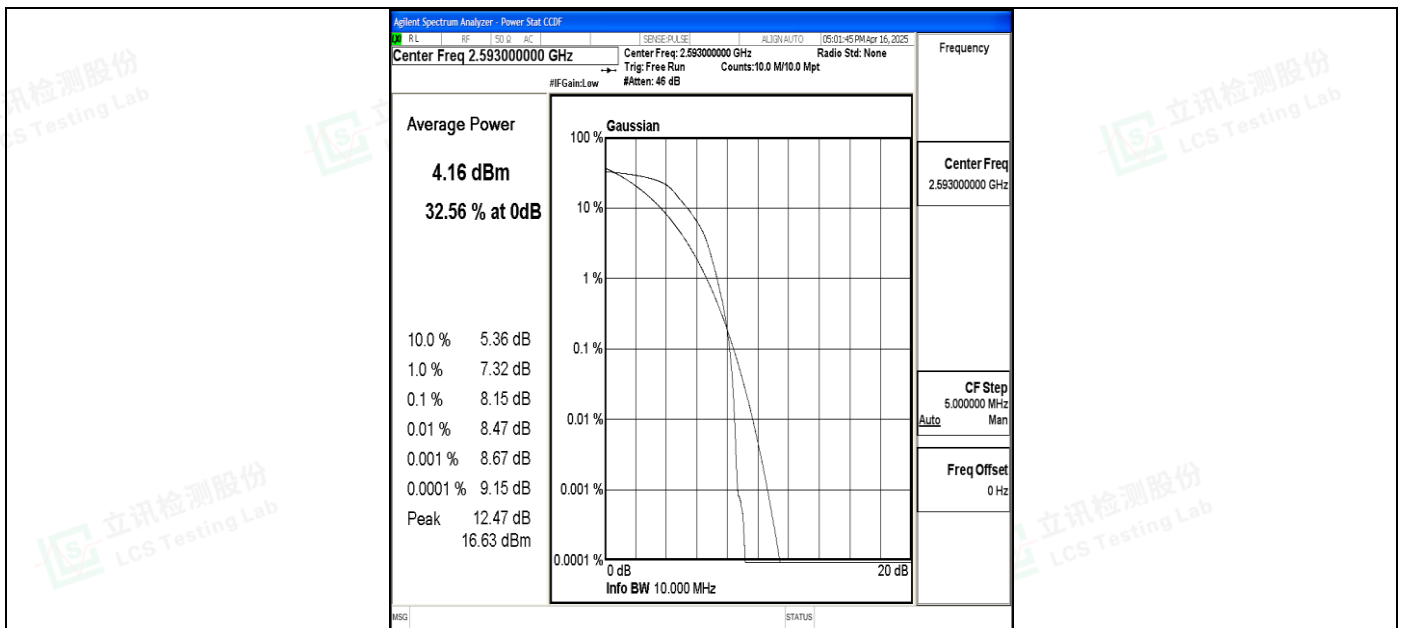


Band41-10MHz-QPSK-40620-1RB#0-PASS

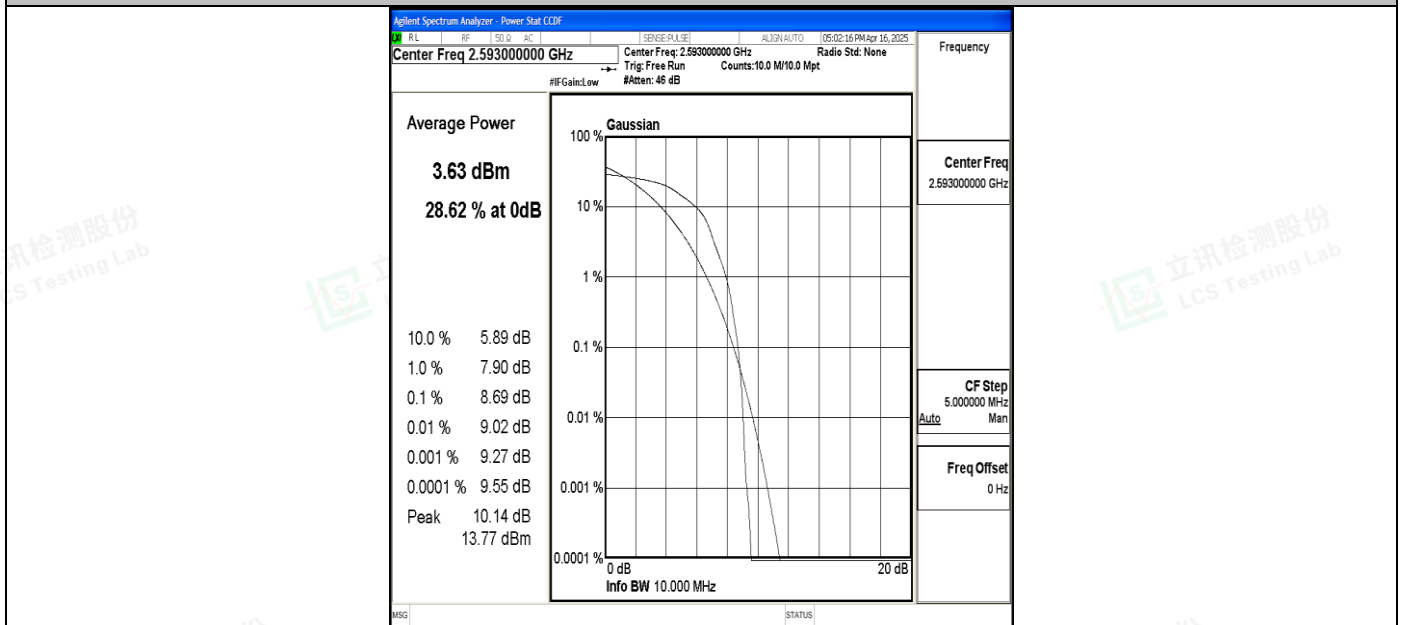


Band41-10MHz-16QAM-40620-1RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

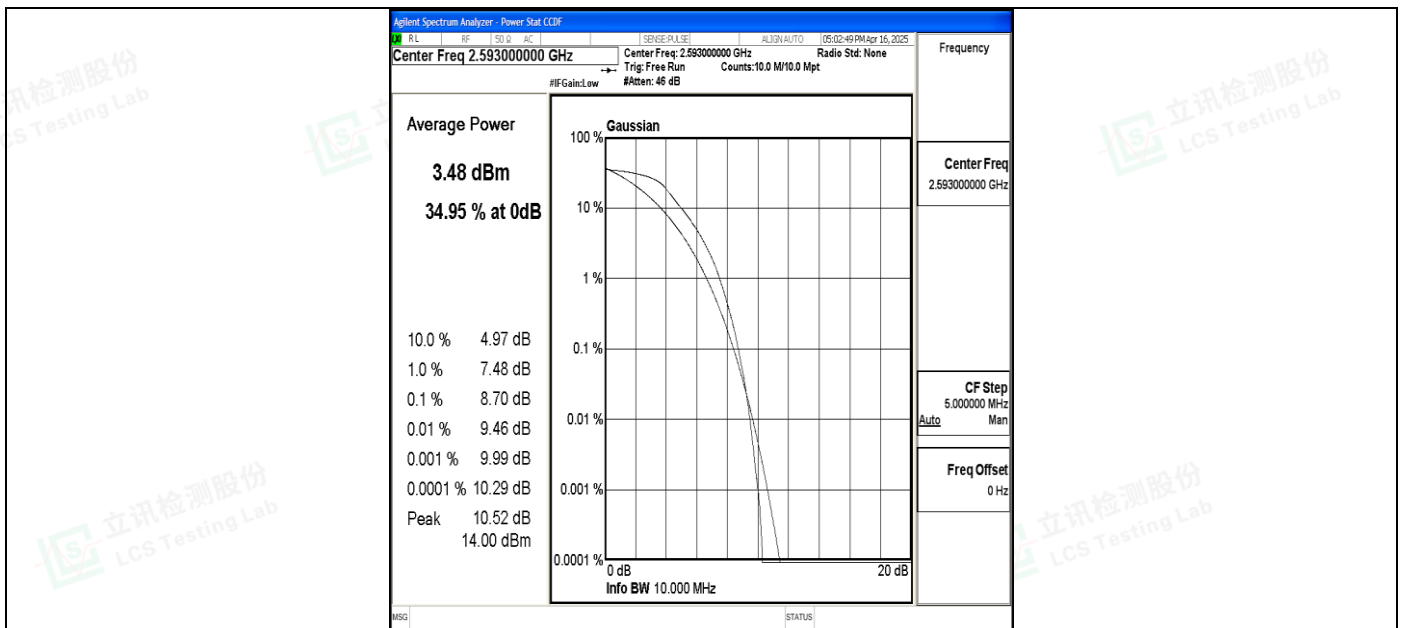


Band41-10MHz-QPSK-40620-50RB#0-PASS

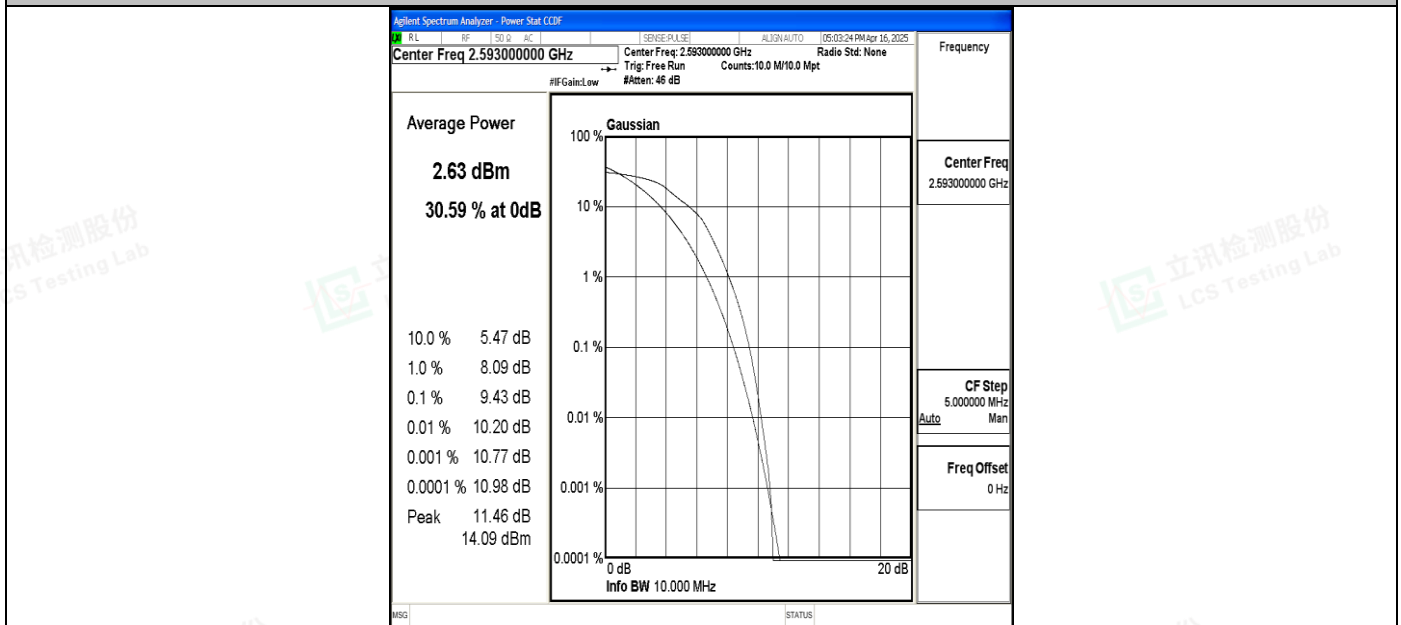


Band41-10MHz-16QAM-40620-50RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

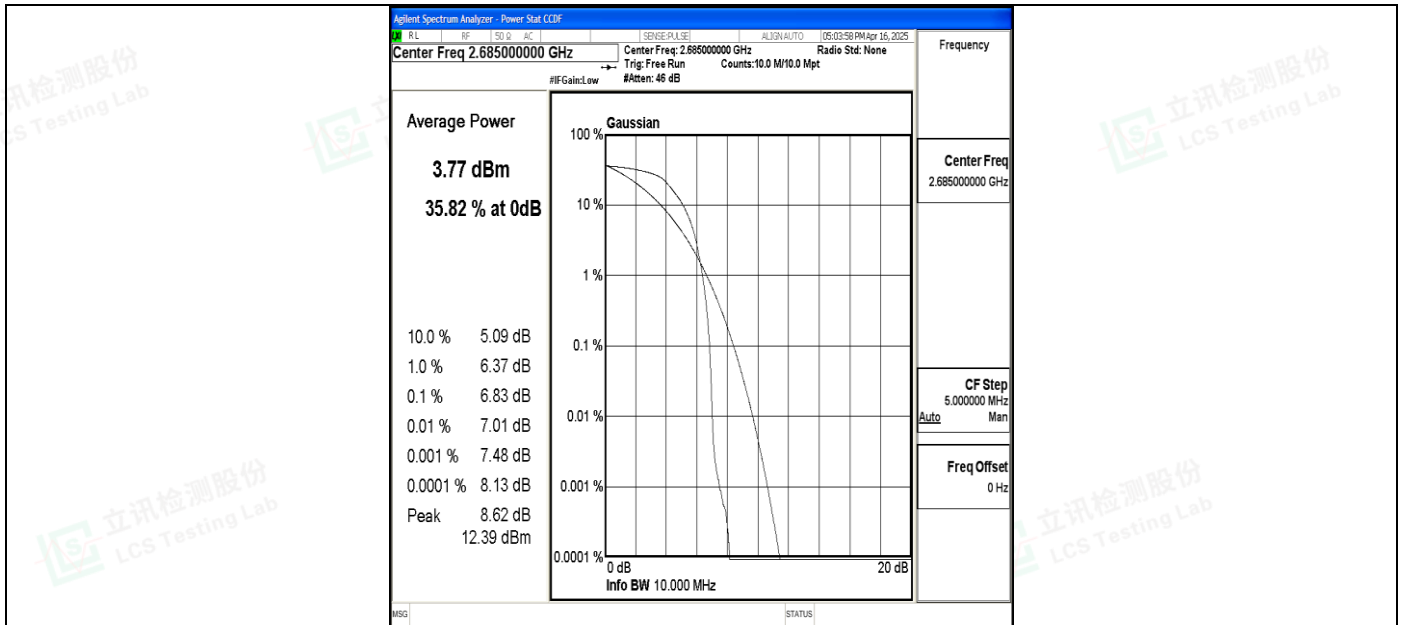


Band41-10MHz-QPSK-41540-1RB#0-PASS

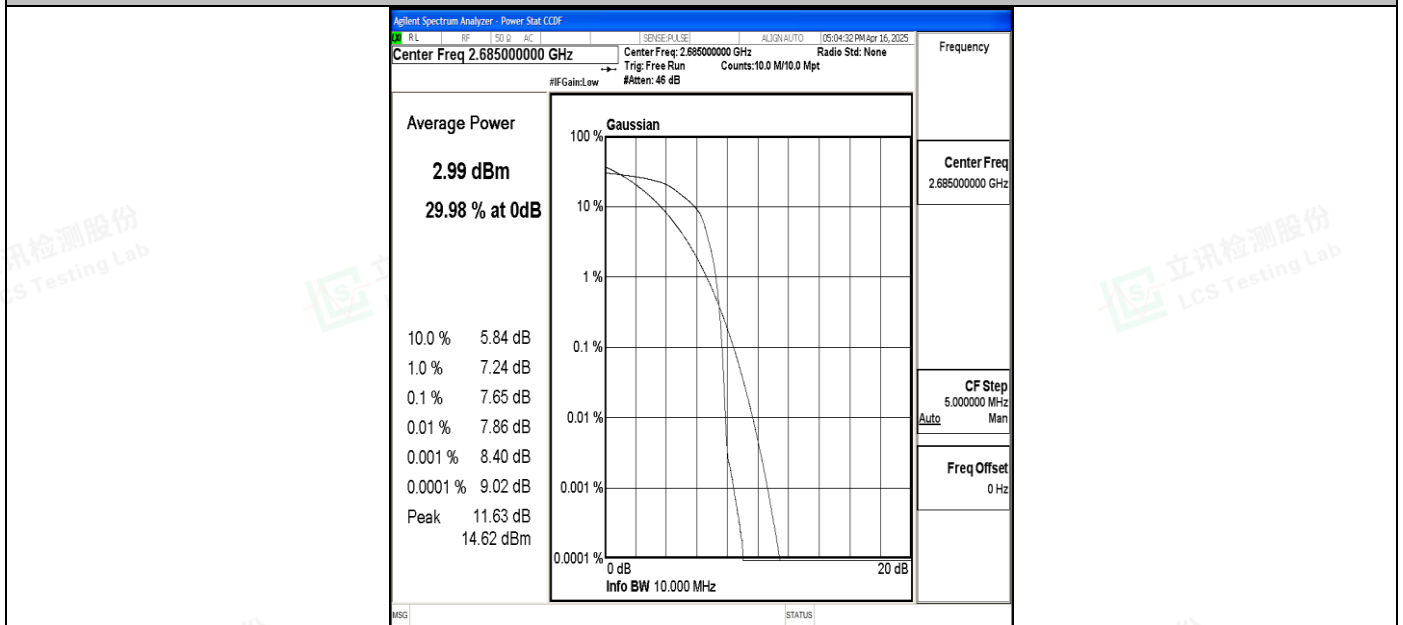


Band41-10MHz-16QAM-41540-1RB#0-PASS



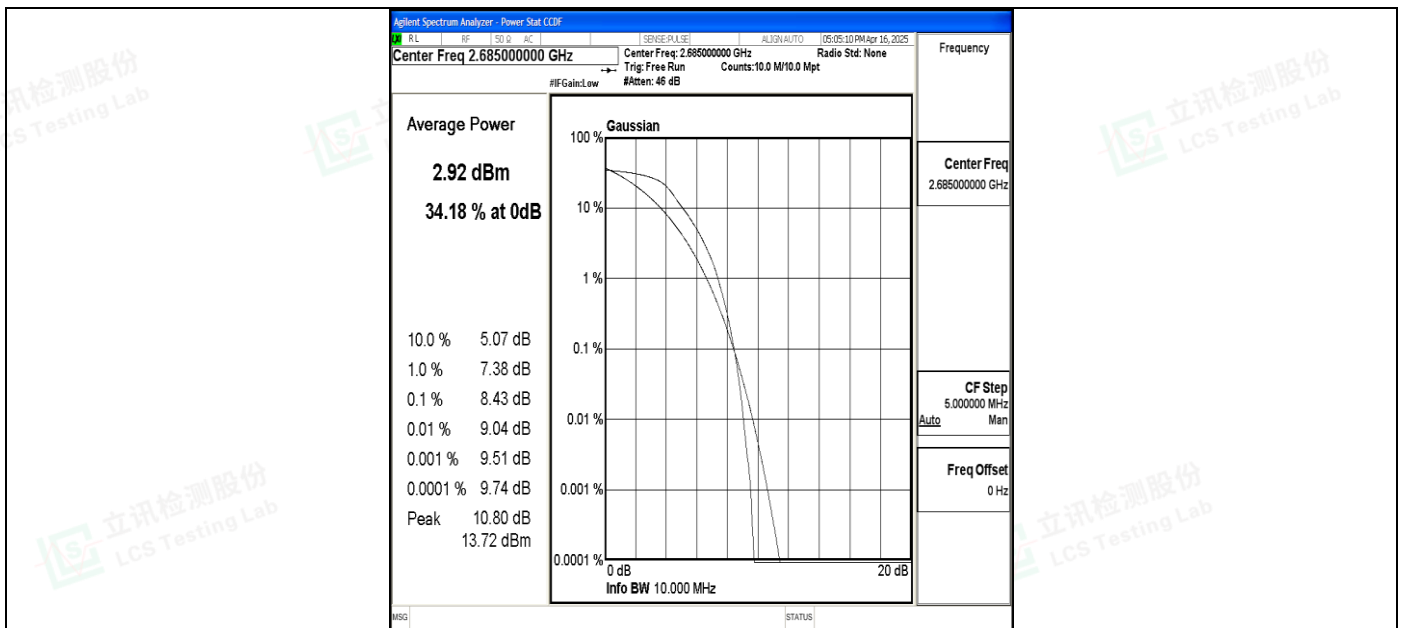


Band41-10MHz-QPSK-41540-50RB#0-PASS

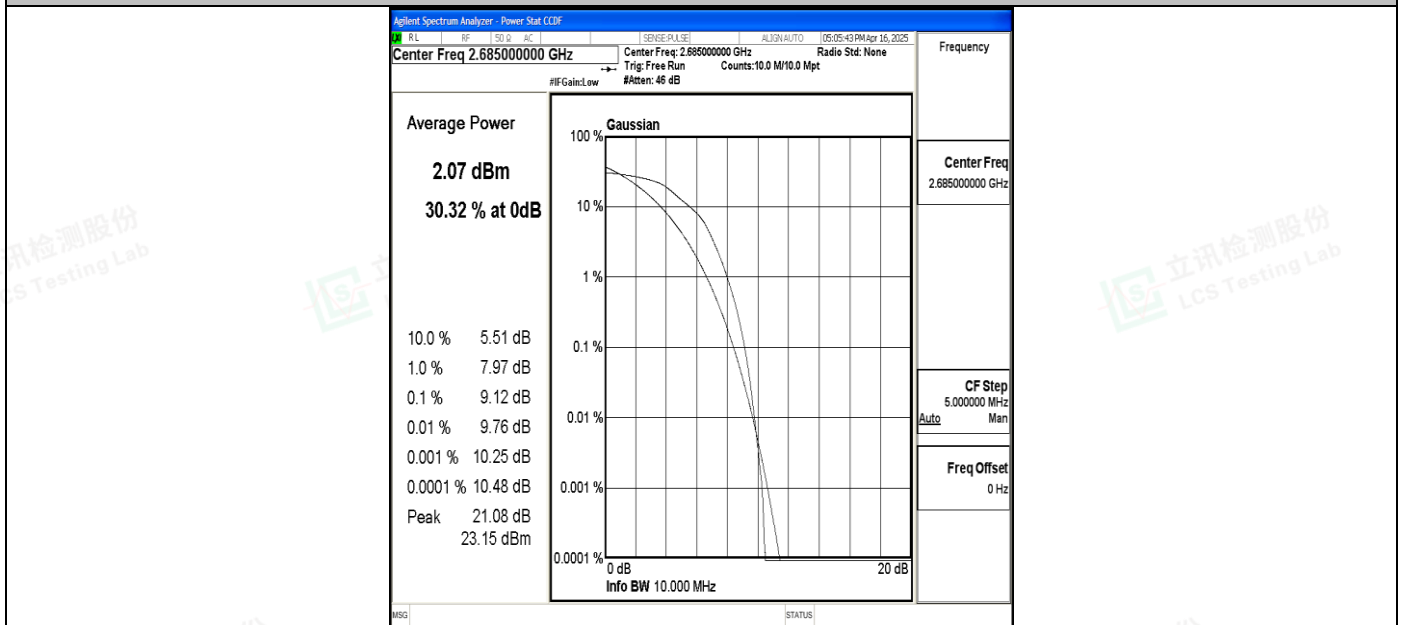


Band41-10MHz-16QAM-41540-50RB#0-PASS



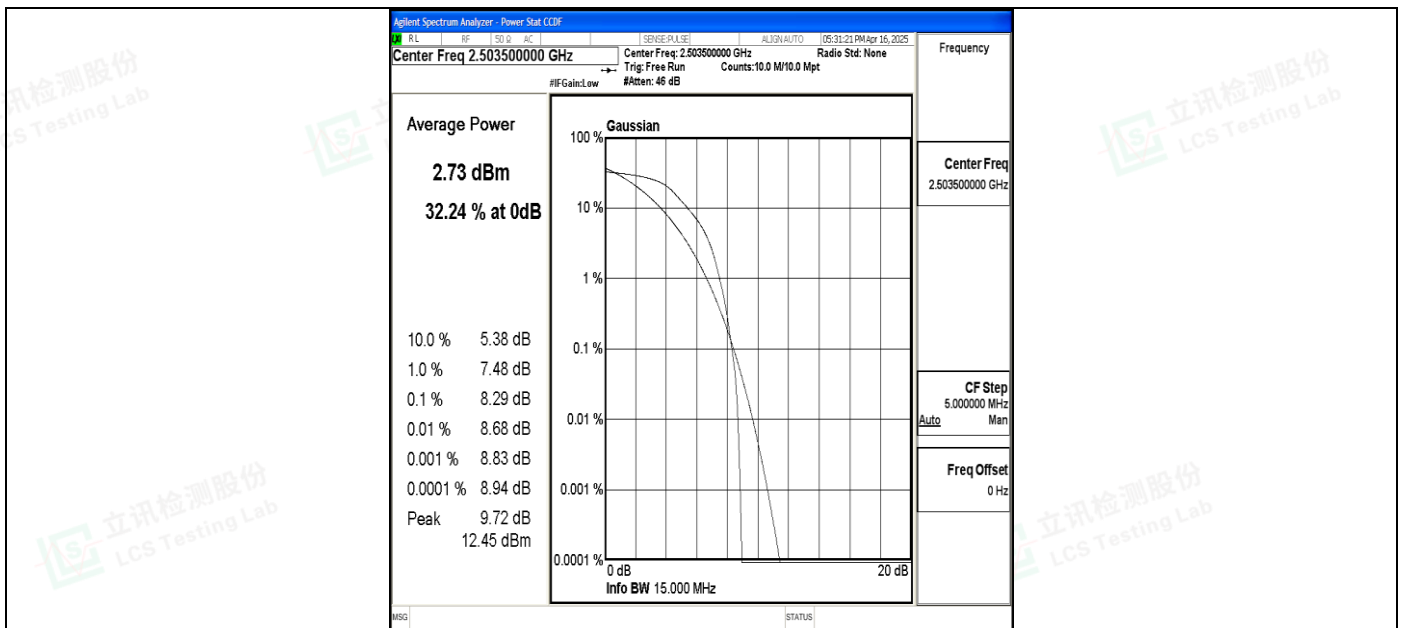


Band41-15MHz-QPSK-39725-1RB#0-PASS

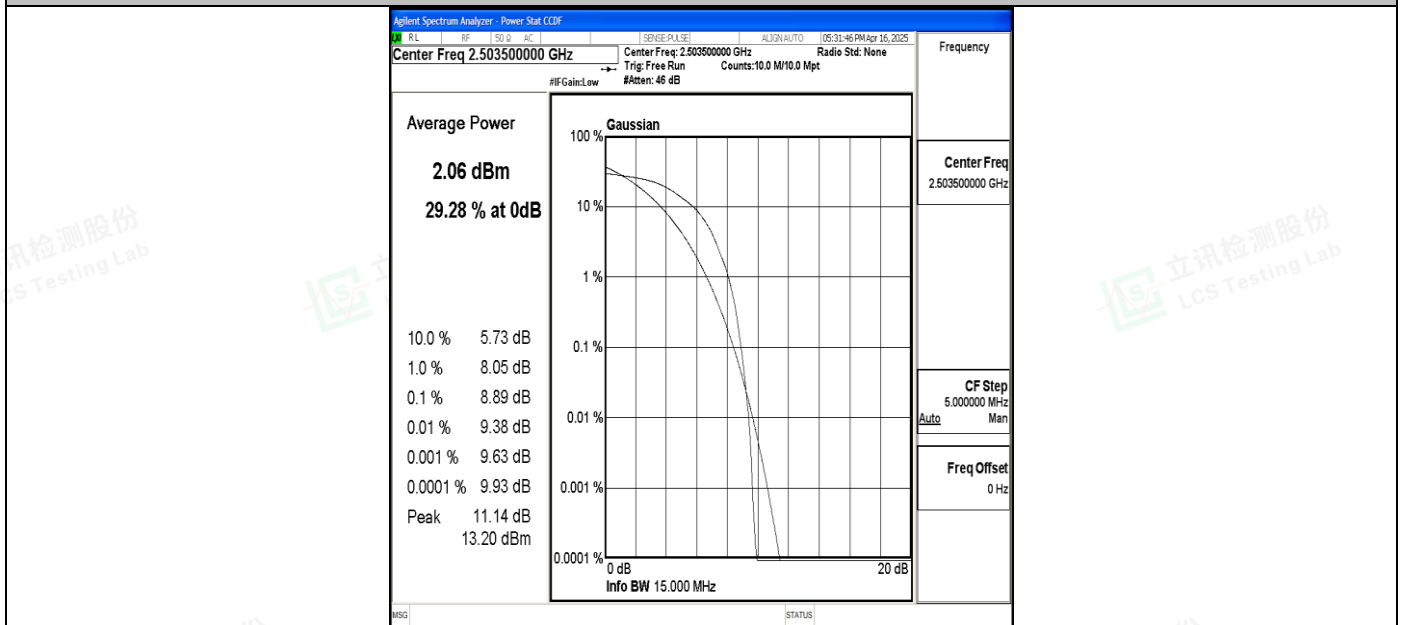


Band41-15MHz-16QAM-39725-1RB#0-PASS



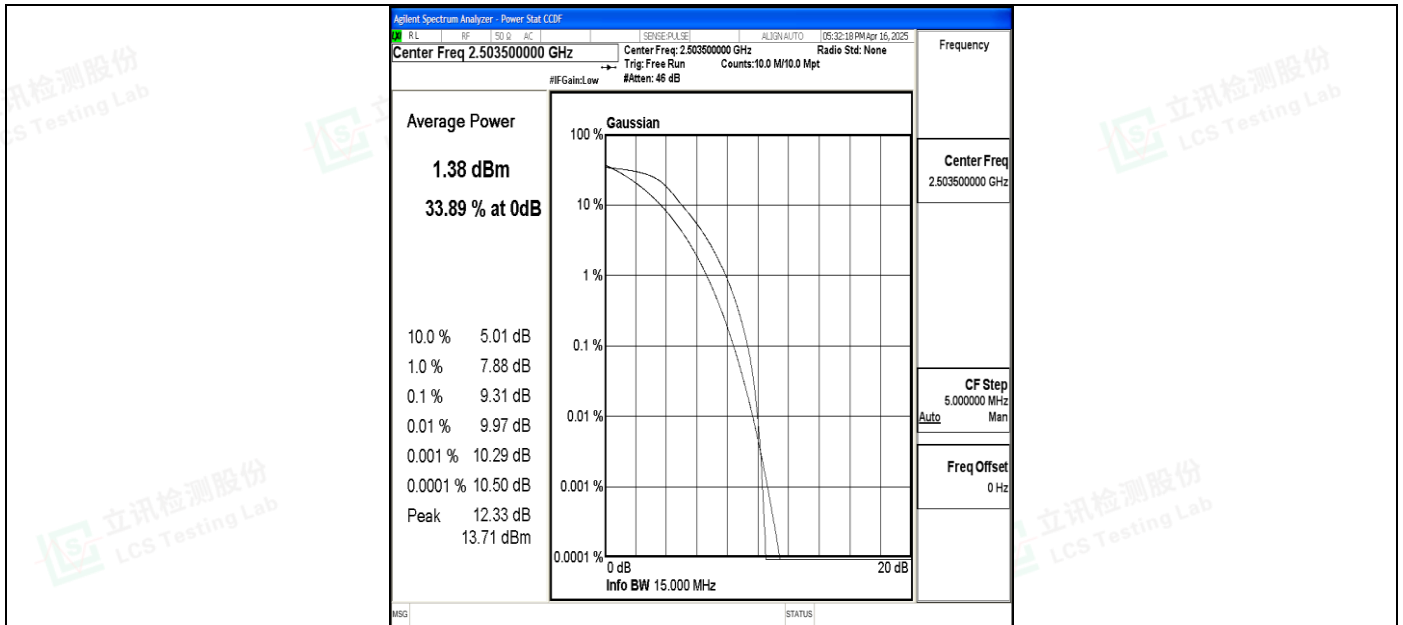


Band41-15MHz-QPSK-39725-75RB#0-PASS

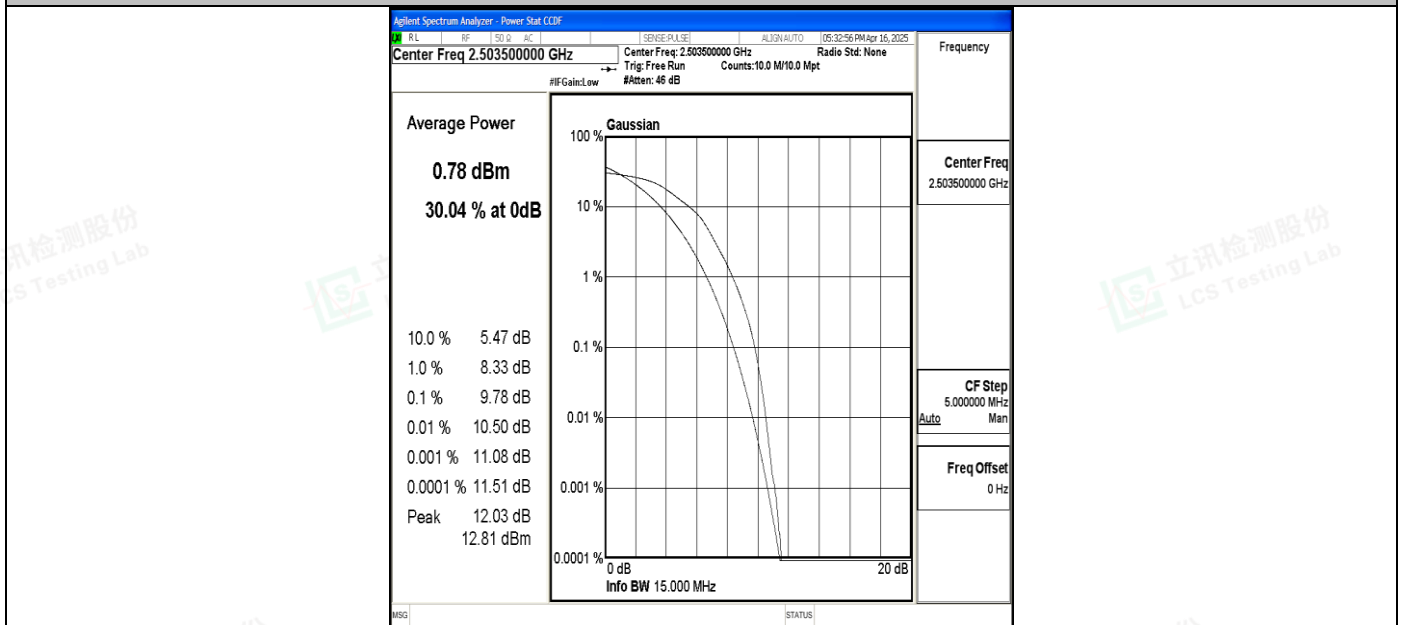


Band41-15MHz-16QAM-39725-75RB#0-PASS



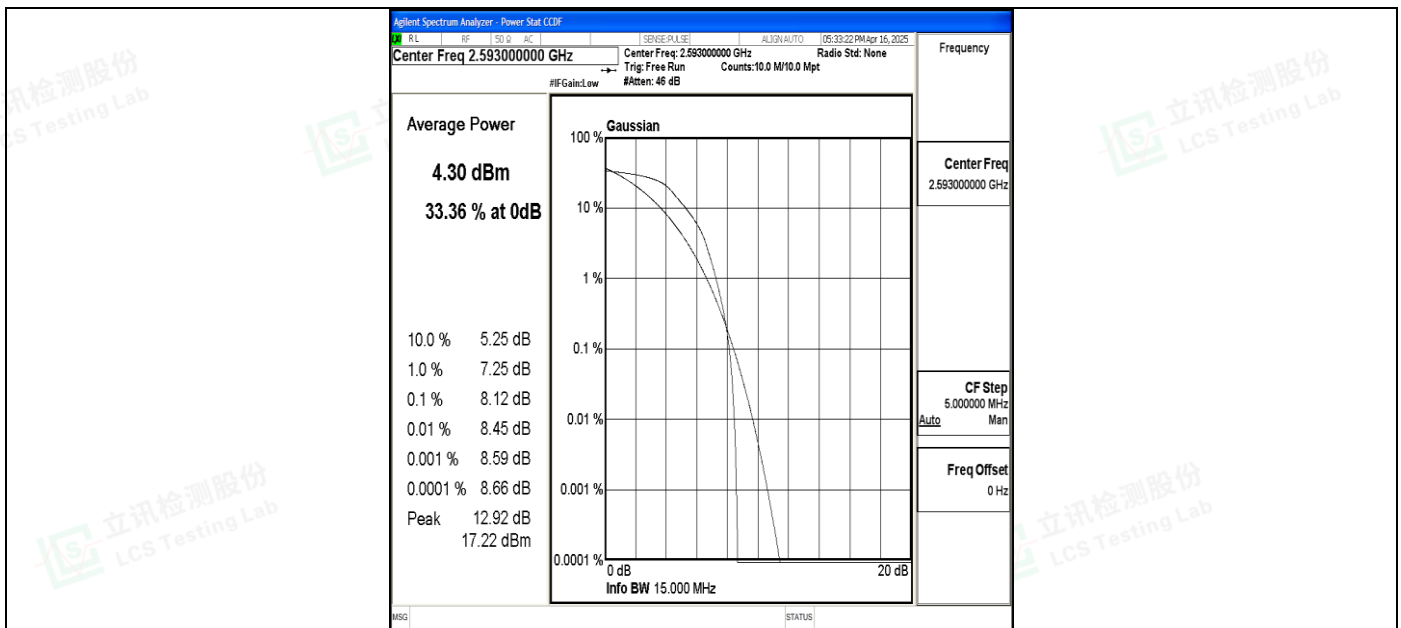


Band41-15MHz-QPSK-40620-1RB#0-PASS

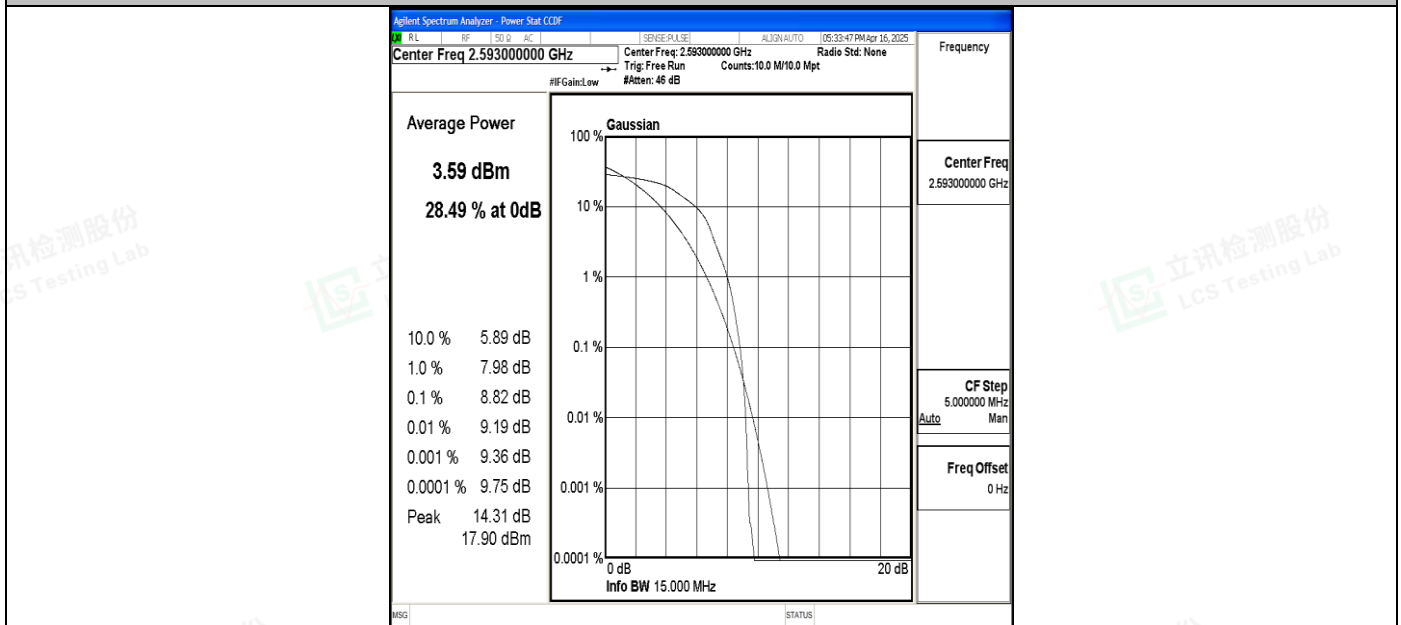


Band41-15MHz-16QAM-40620-1RB#0-PASS



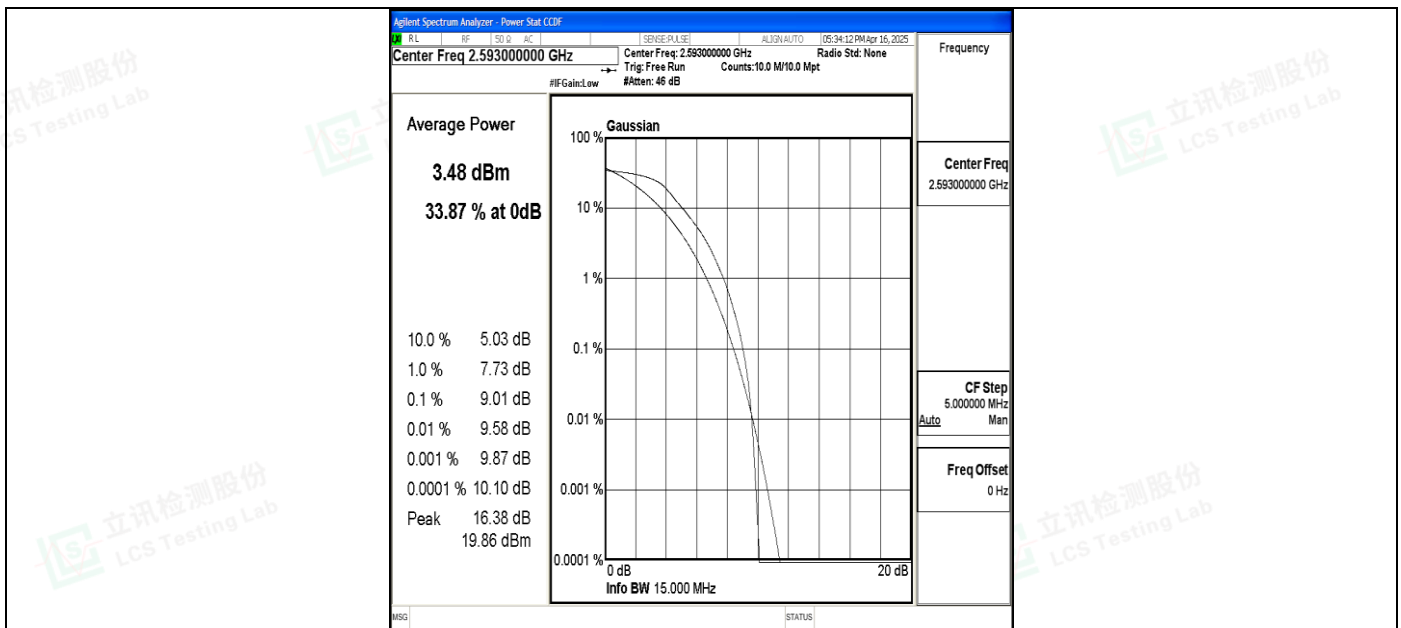


Band41-15MHz-QPSK-40620-75RB#0-PASS

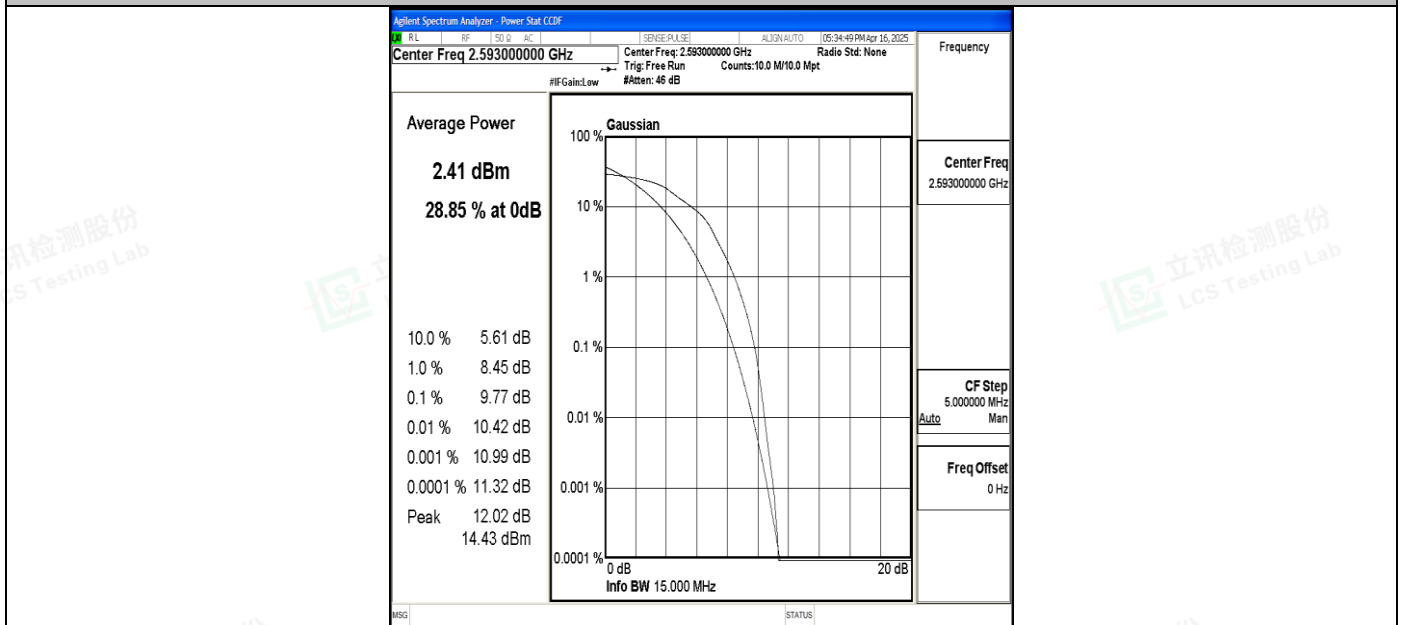


Band41-15MHz-16QAM-40620-75RB#0-PASS



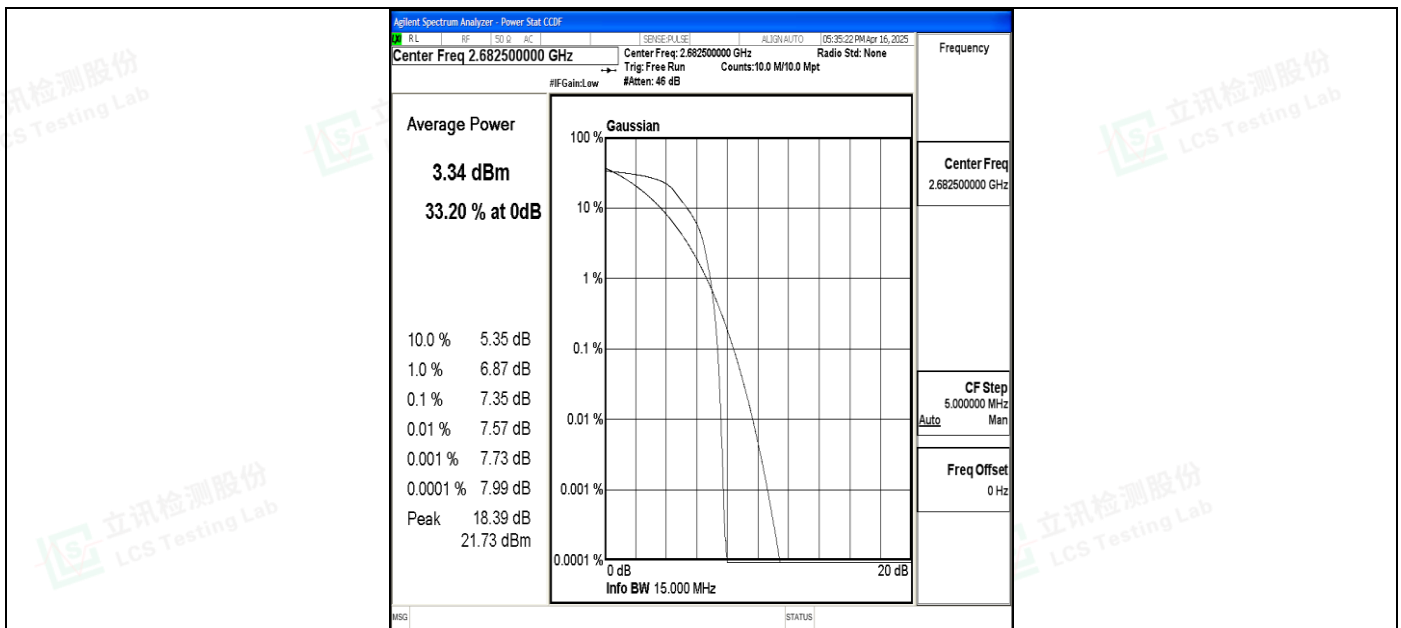


Band41-15MHz-QPSK-41515-1RB#0-PASS

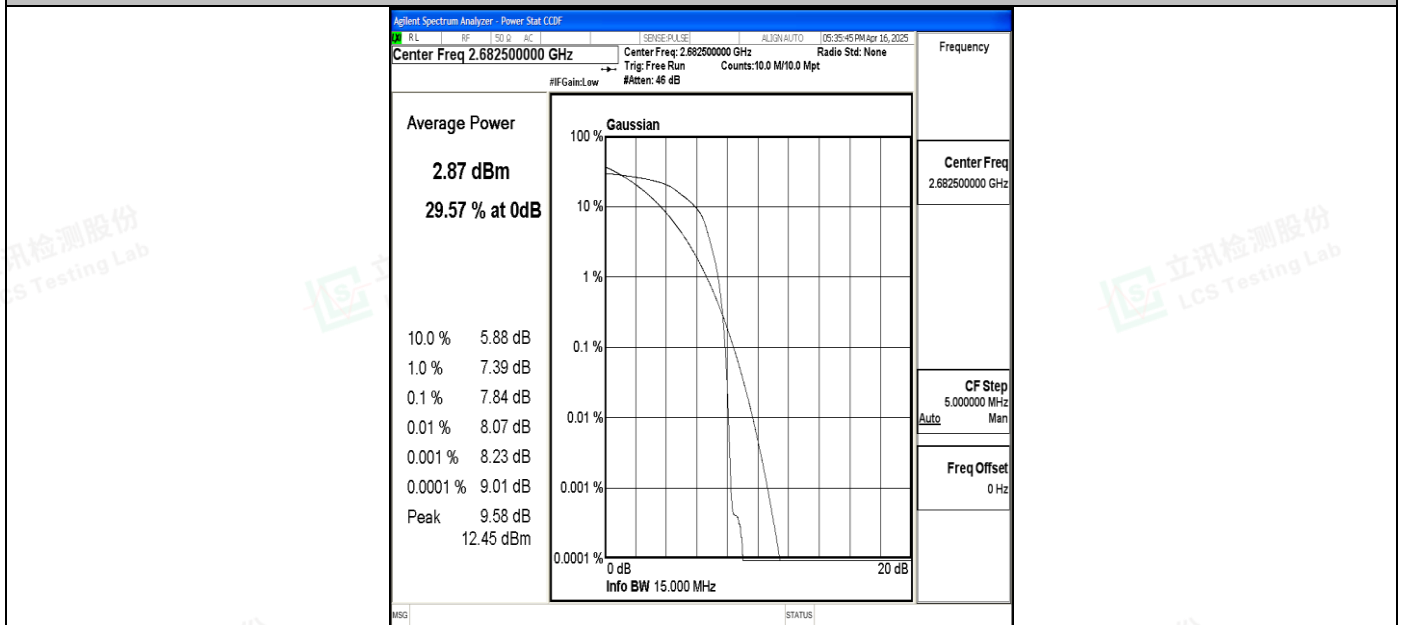


Band41-15MHz-16QAM-41515-1RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

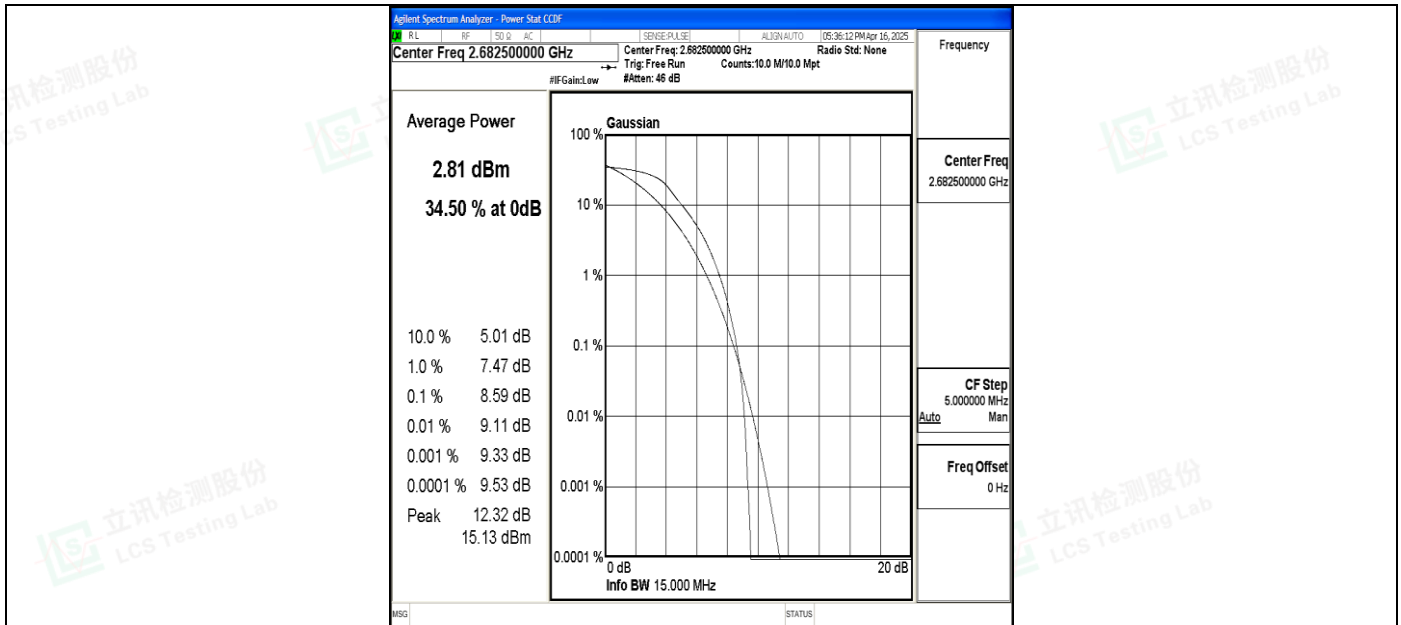


Band41-15MHz-QPSK-41515-75RB#0-PASS

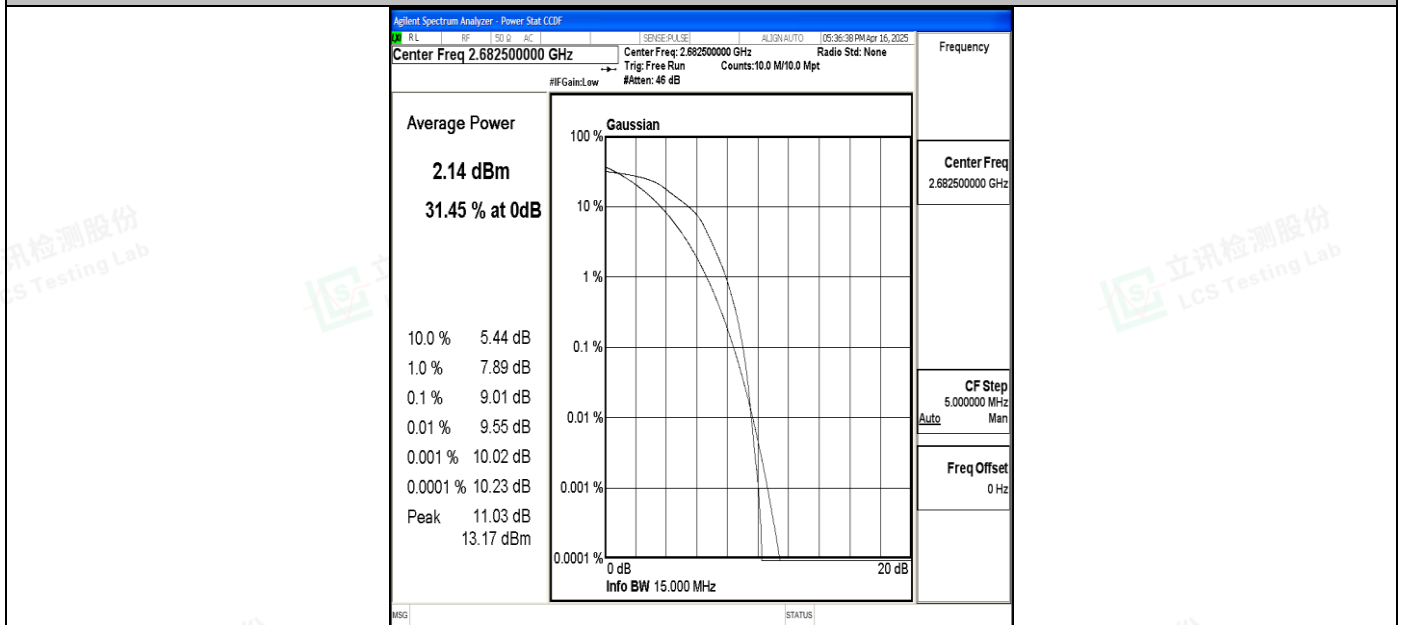


Band41-15MHz-16QAM-41515-75RB#0-PASS



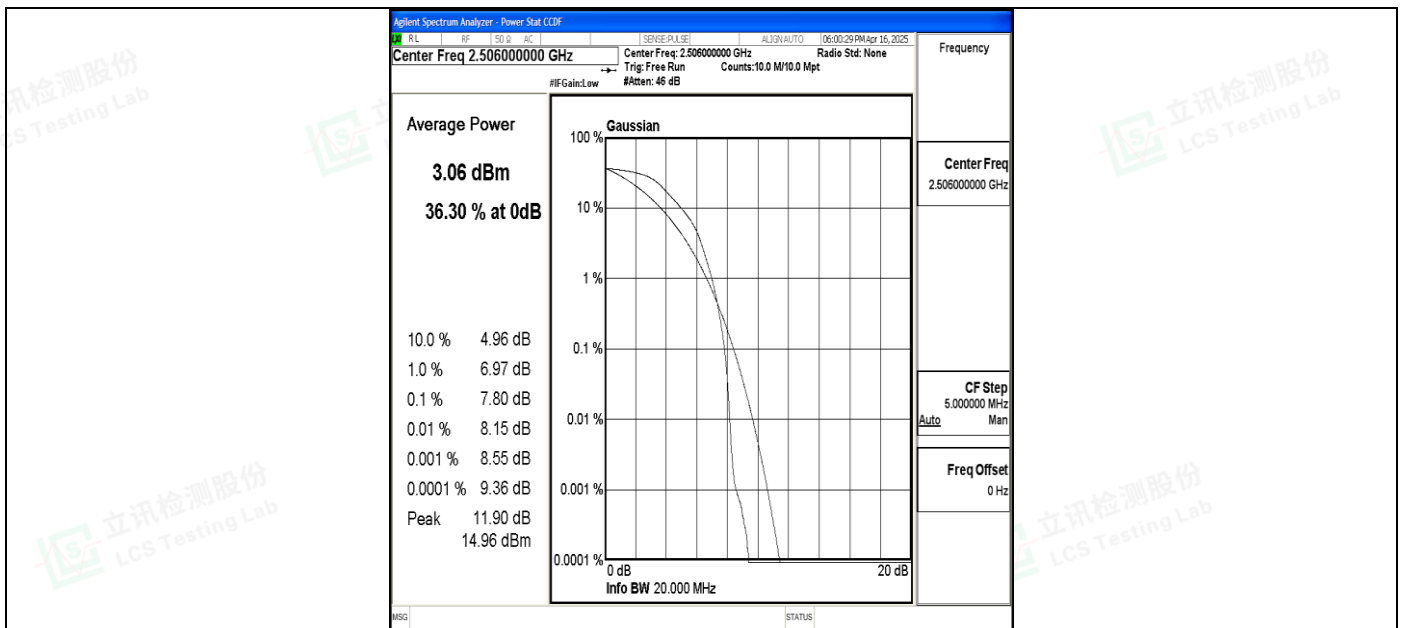


Band41-20MHz-QPSK-39750-1RB#0-PASS

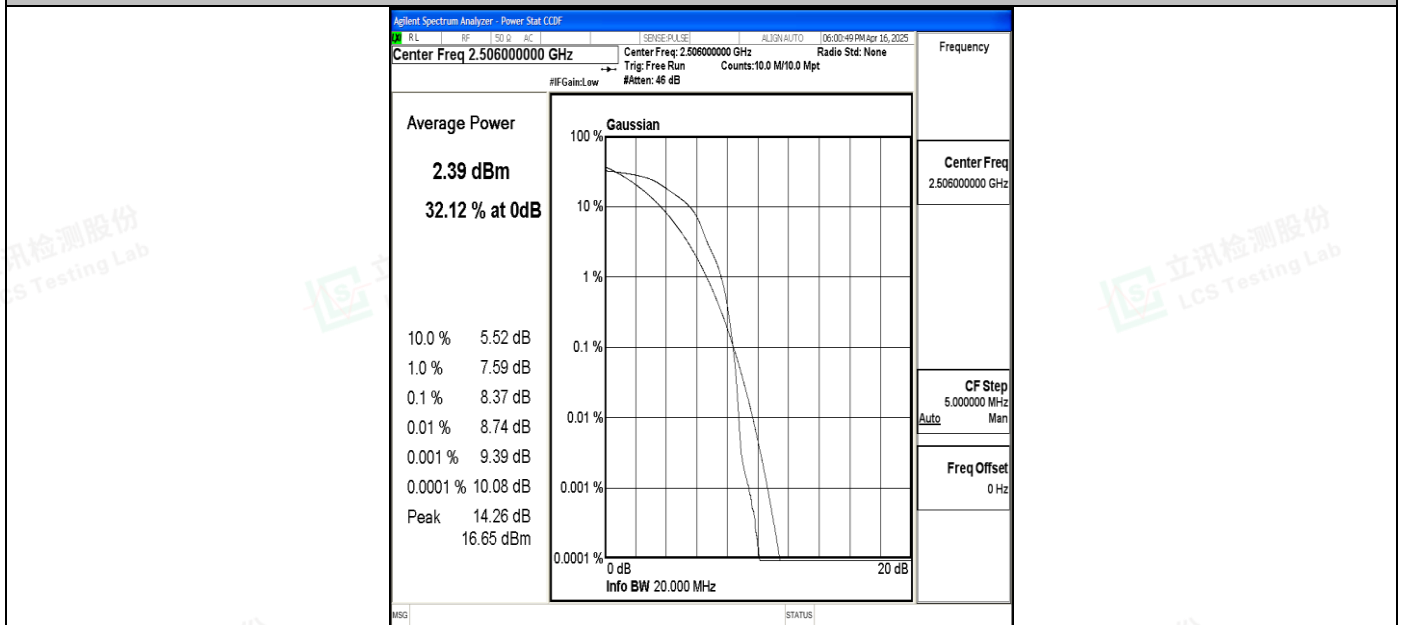


Band41-20MHz-16QAM-39750-1RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

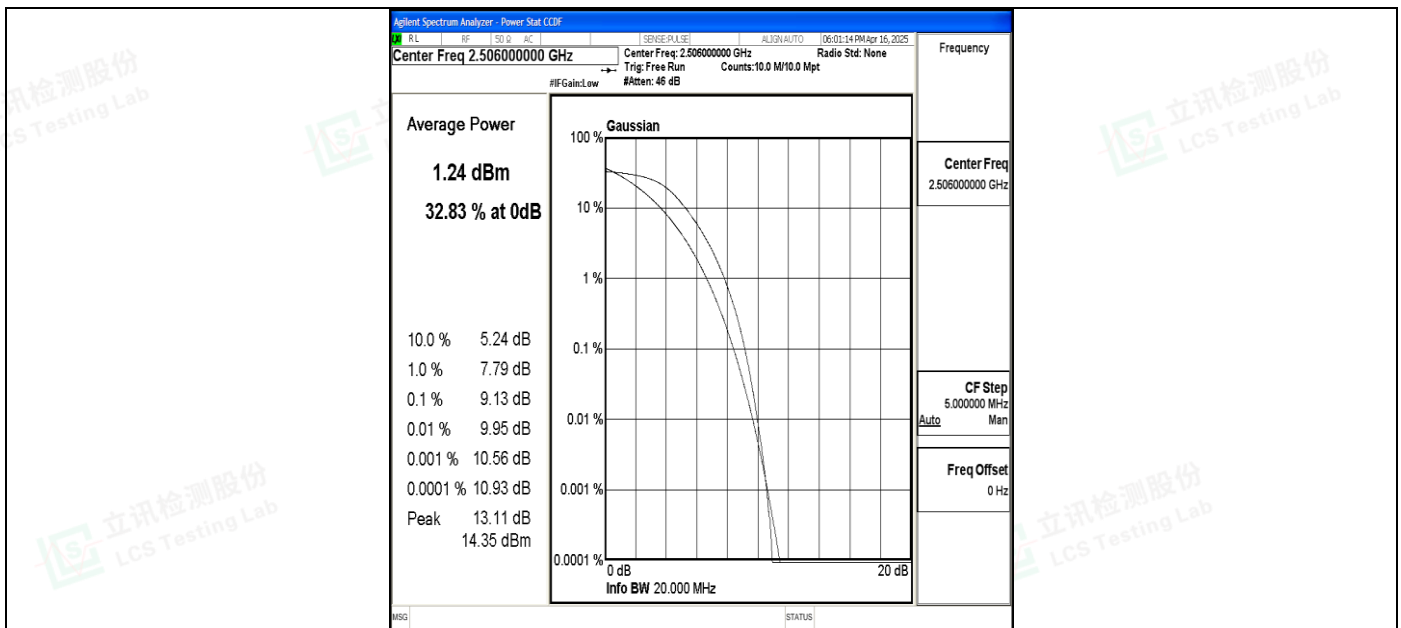


Band41-20MHz-QPSK-39750-100RB#0-PASS

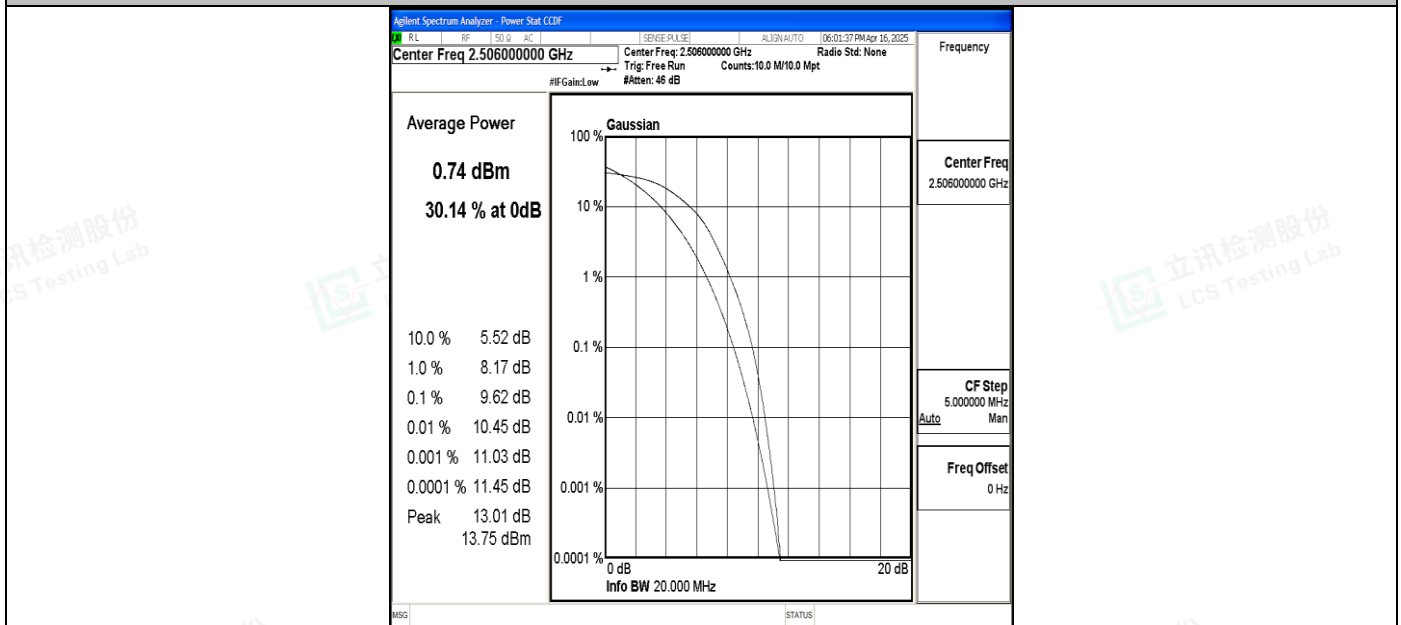


Band41-20MHz-16QAM-39750-100RB#0-PASS



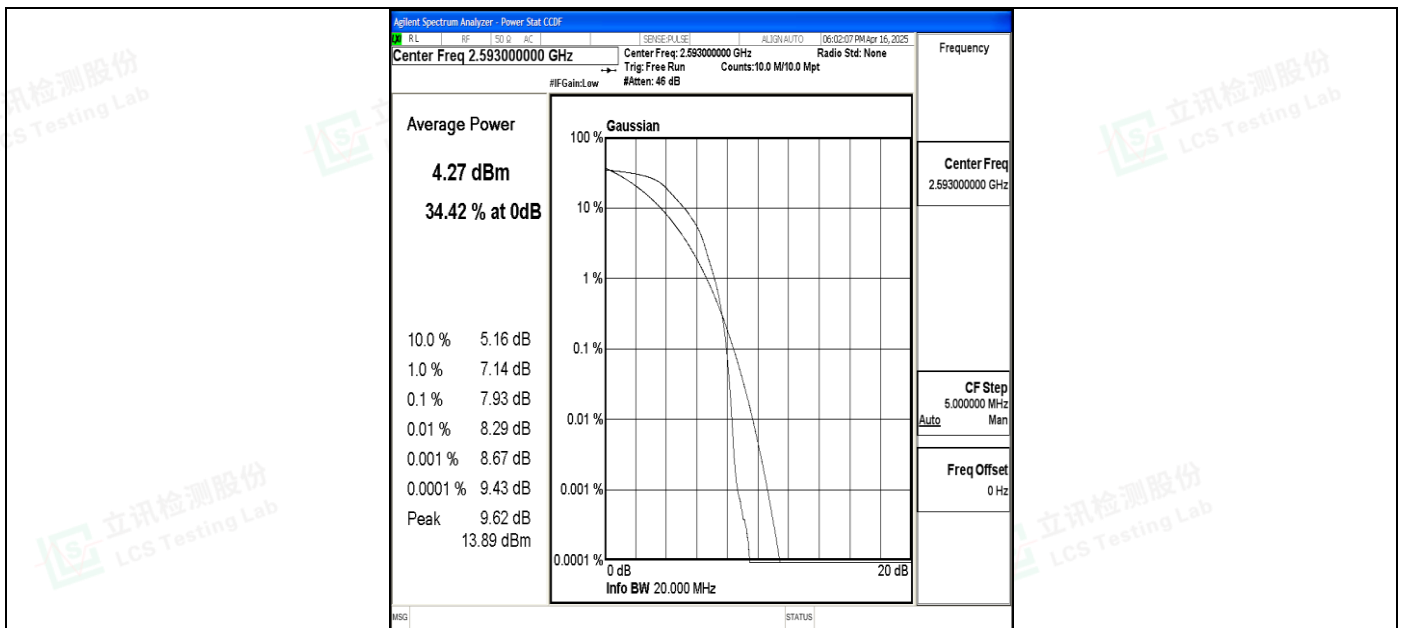


Band41-20MHz-QPSK-40620-1RB#0-PASS

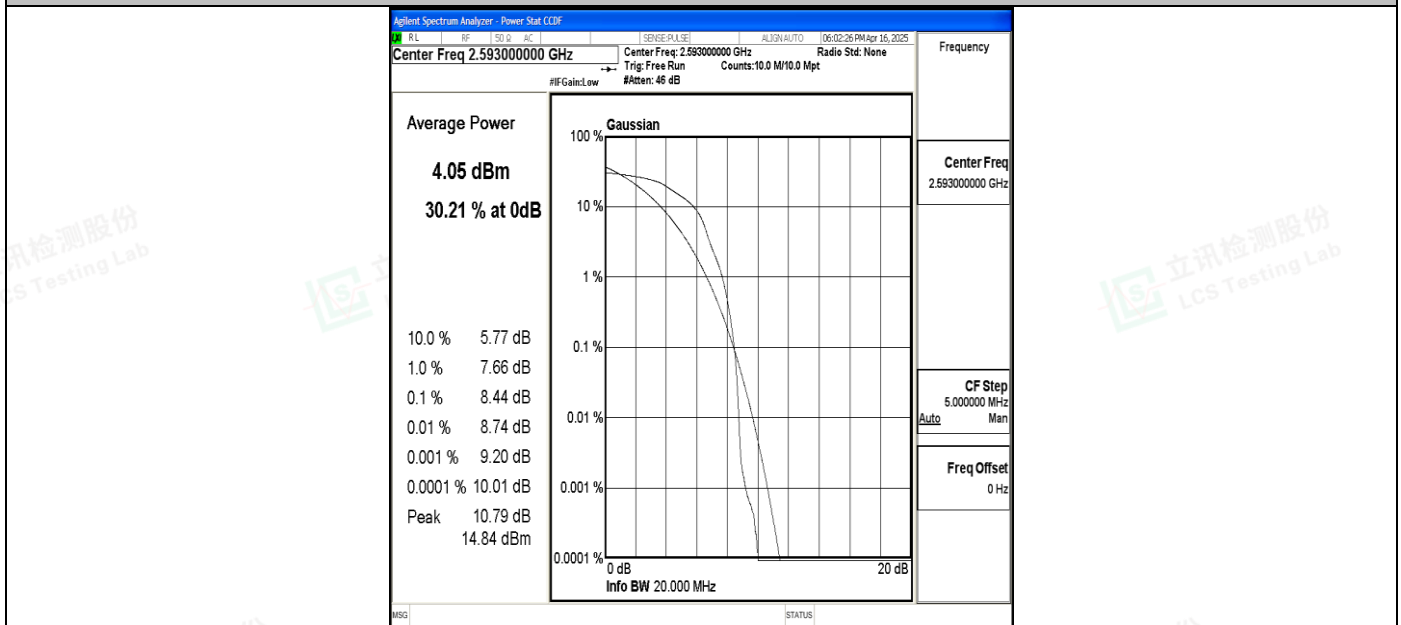


Band41-20MHz-16QAM-40620-1RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

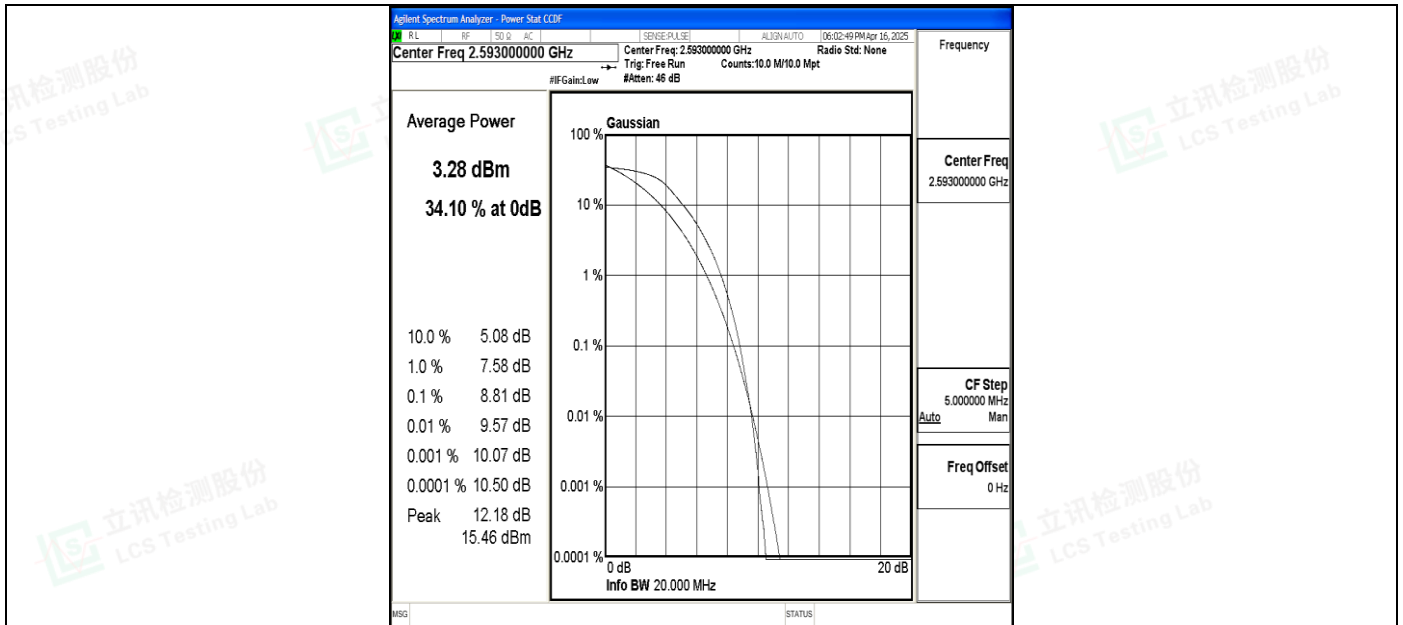


Band41-20MHz-QPSK-40620-100RB#0-PASS

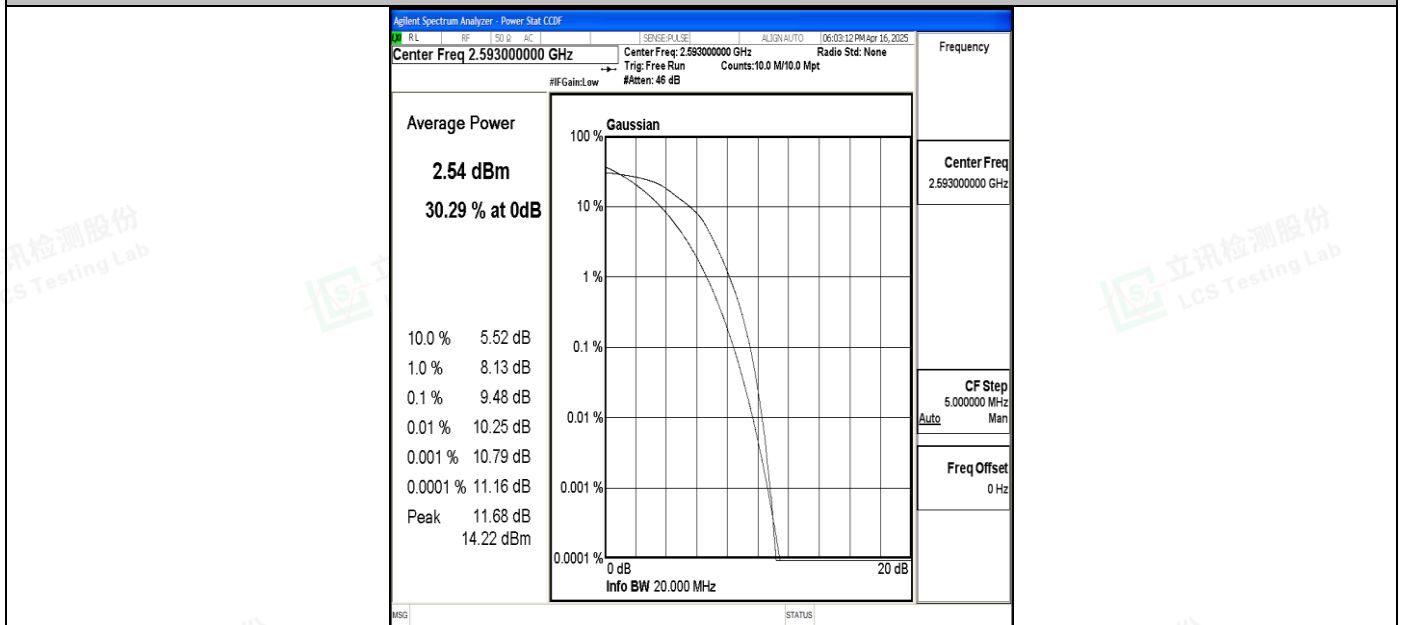


Band41-20MHz-16QAM-40620-100RB#0-PASS



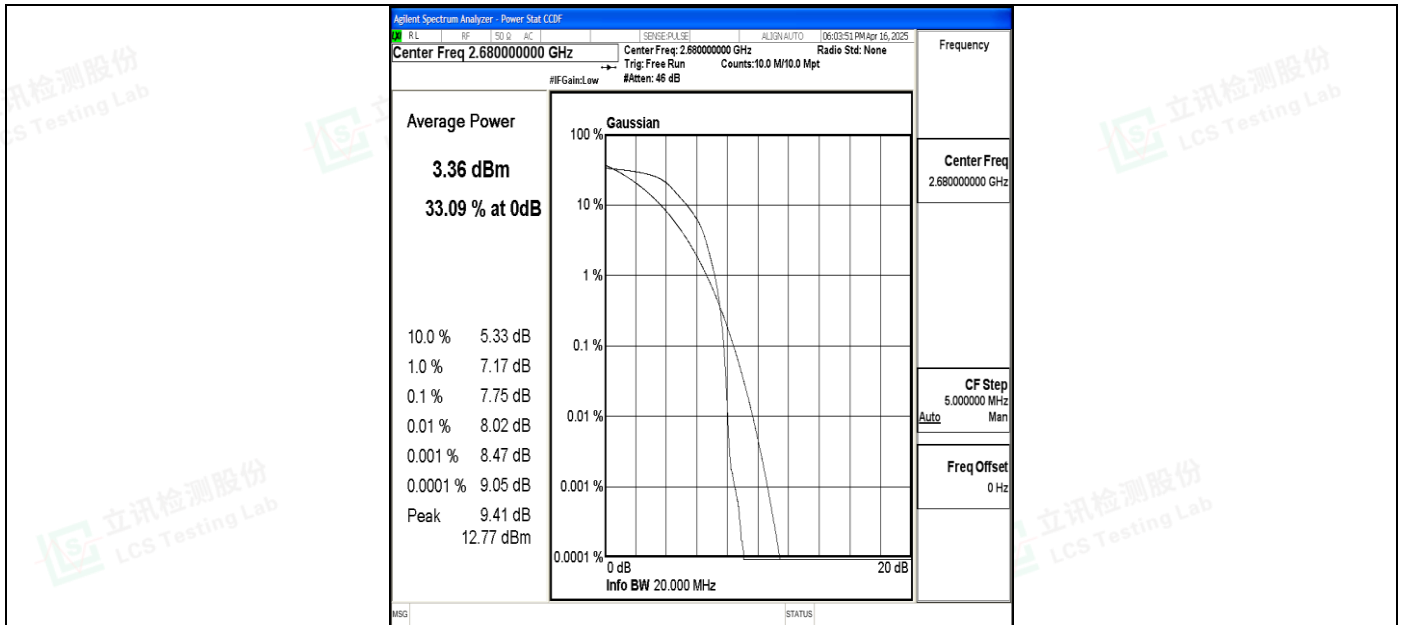


Band41-20MHz-QPSK-41490-1RB#0-PASS

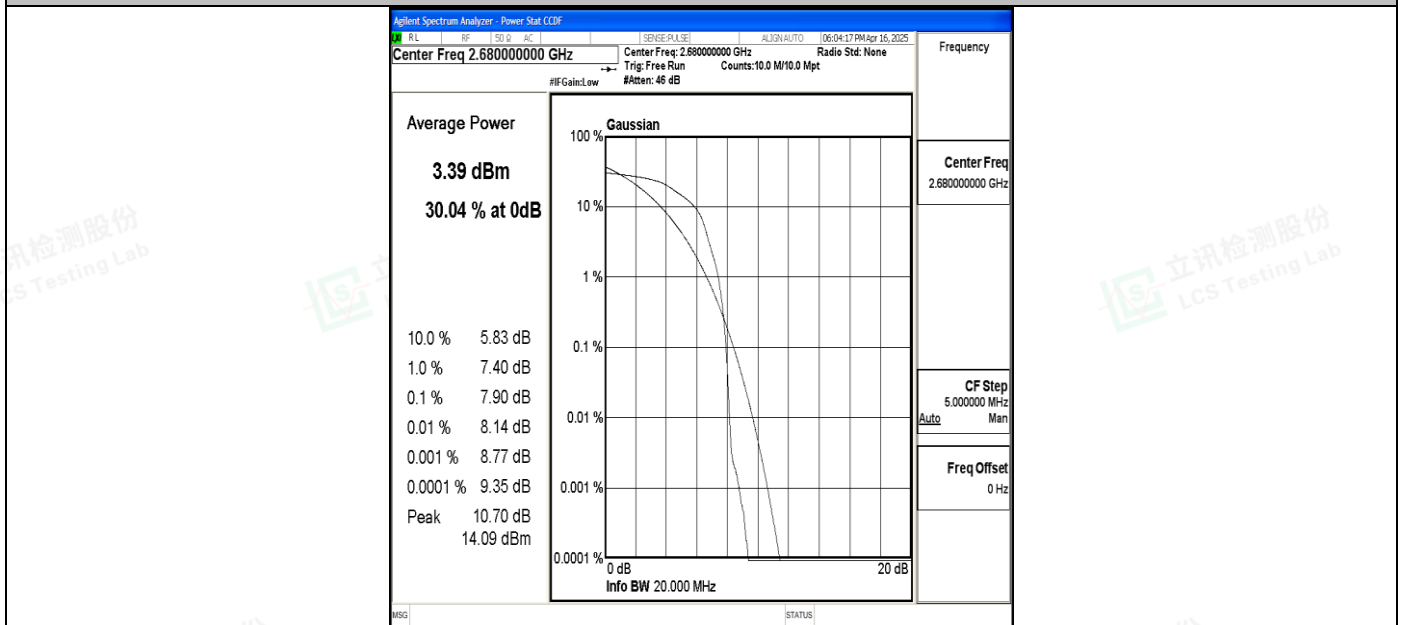


Band41-20MHz-16QAM-41490-1RB#0-PASS



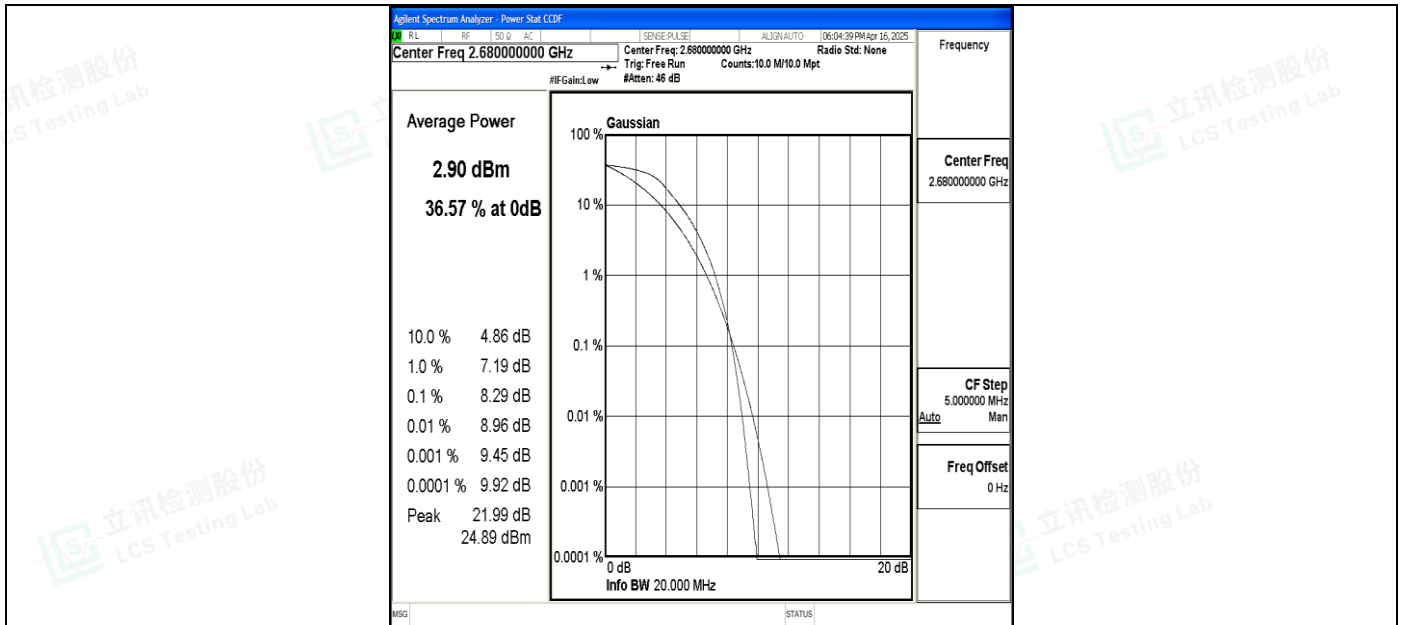

Band41-20MHz-QPSK-41490-100RB#0-PASS

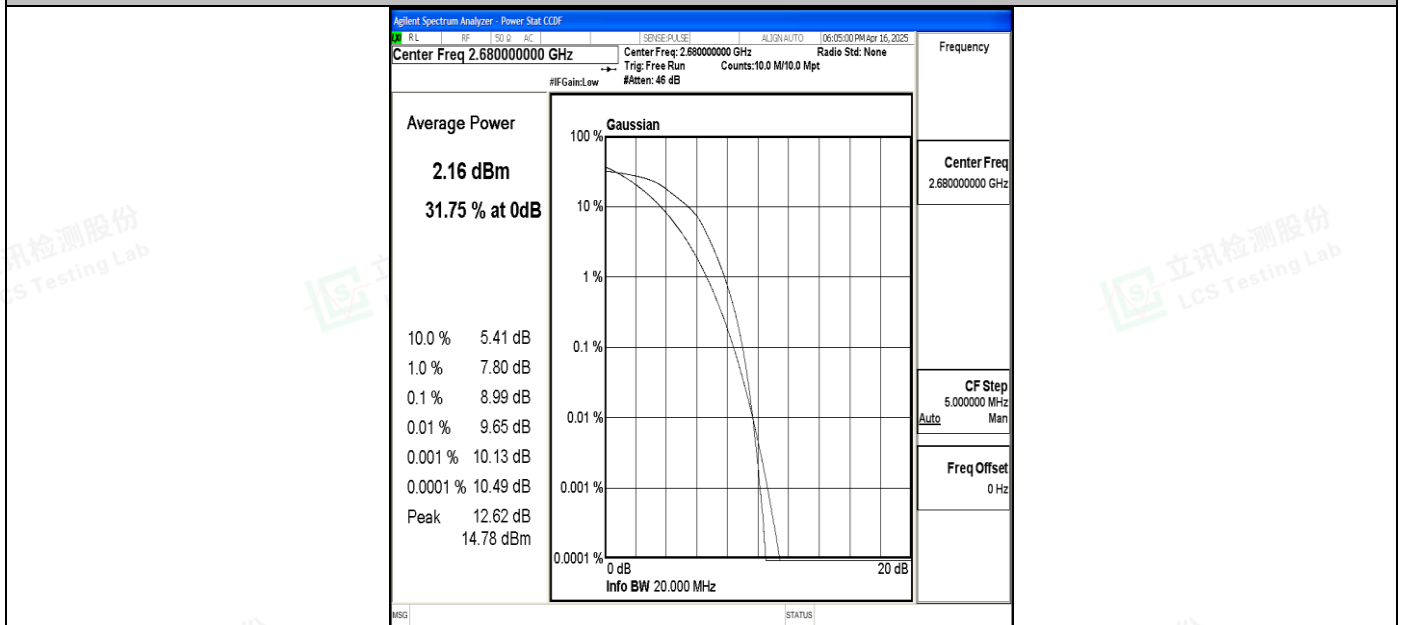

Band41-20MHz-16QAM-41490-100RB#0-PASS





N.3 26dB Bandwidth and Occupied Bandwidth

Test Result


Band	Bandwidth	Modulation	Channel	RB Configuration	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	4.5159	5.283	PASS
Band41	5MHz	16QAM	39675	25RB#0	4.5070	5.404	PASS
Band41	5MHz	QPSK	40620	25RB#0	4.5176	5.223	PASS
Band41	5MHz	16QAM	40620	25RB#0	4.5133	5.722	PASS
Band41	5MHz	QPSK	41565	25RB#0	4.5028	5.033	PASS
Band41	5MHz	16QAM	41565	25RB#0	4.5078	5.234	PASS
Band41	10MHz	QPSK	39700	50RB#0	9.0034	9.866	PASS
Band41	10MHz	16QAM	39700	50RB#0	8.9848	10.05	PASS
Band41	10MHz	QPSK	40620	50RB#0	9.0054	9.979	PASS
Band41	10MHz	16QAM	40620	50RB#0	8.9914	9.934	PASS
Band41	10MHz	QPSK	41540	50RB#0	9.0124	9.924	PASS
Band41	10MHz	16QAM	41540	50RB#0	9.0190	11.88	PASS
Band41	15MHz	QPSK	39725	75RB#0	13.524	15.64	PASS
Band41	15MHz	16QAM	39725	75RB#0	13.534	15.23	PASS
Band41	15MHz	QPSK	40620	75RB#0	13.570	16.80	PASS
Band41	15MHz	16QAM	40620	75RB#0	13.507	15.40	PASS
Band41	15MHz	QPSK	41515	75RB#0	13.569	15.58	PASS
Band41	15MHz	16QAM	41515	75RB#0	13.521	16.10	PASS
Band41	20MHz	QPSK	39750	100RB#0	18.081	19.96	PASS
Band41	20MHz	16QAM	39750	100RB#0	17.970	20.28	PASS
Band41	20MHz	QPSK	40620	100RB#0	17.938	20.06	PASS
Band41	20MHz	16QAM	40620	100RB#0	17.958	20.27	PASS
Band41	20MHz	QPSK	41490	100RB#0	18.055	19.63	PASS
Band41	20MHz	16QAM	41490	100RB#0	18.051	21.76	PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

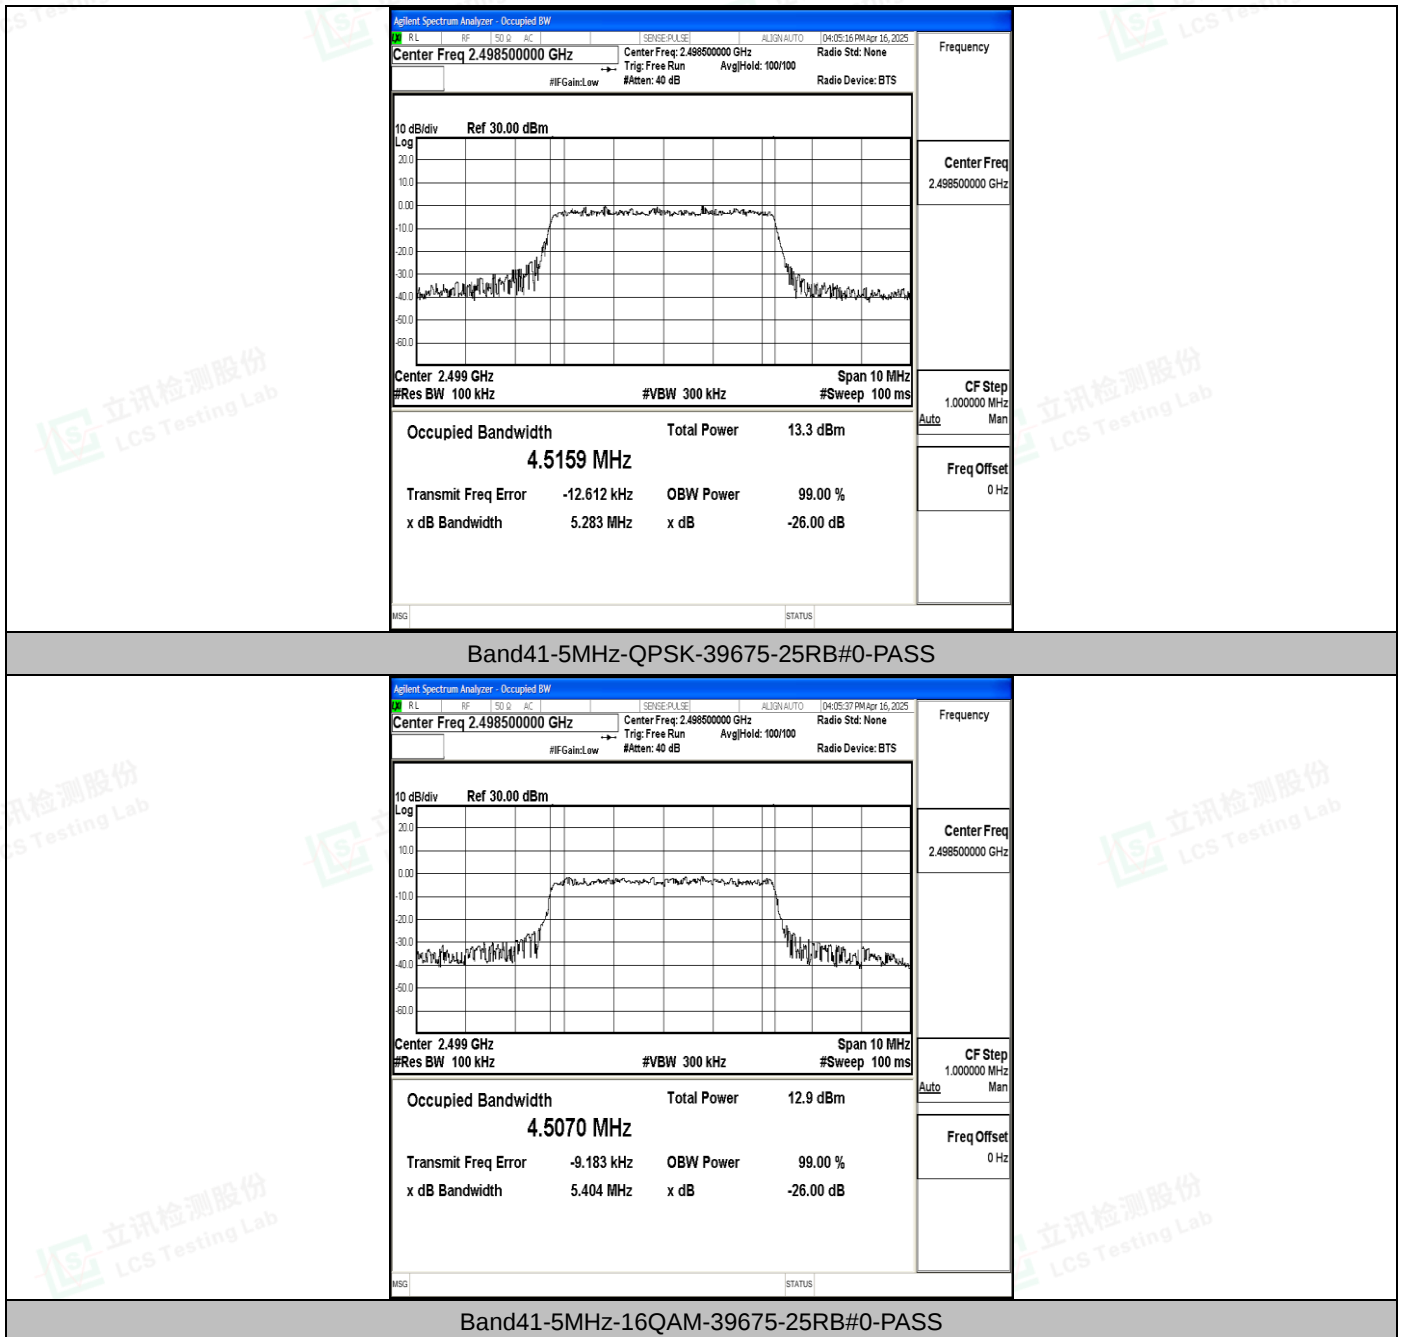

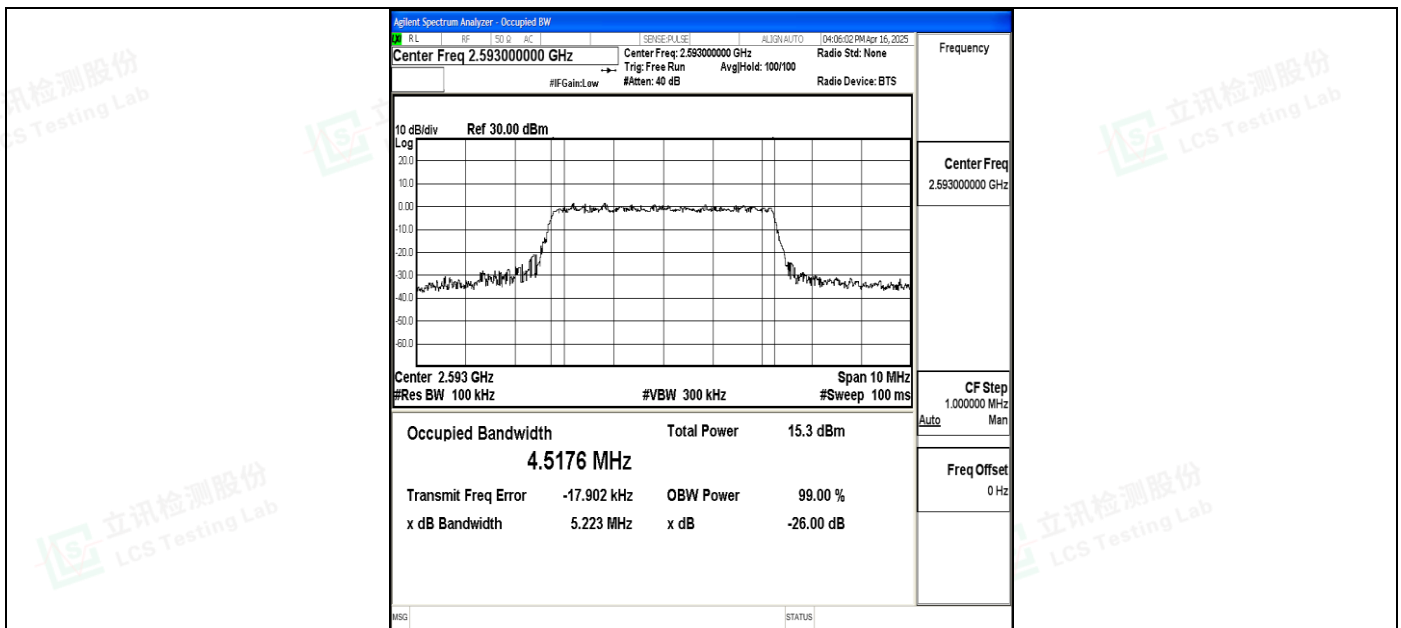


Band41-5MHz-QPSK-40620-25RB#0-PASS

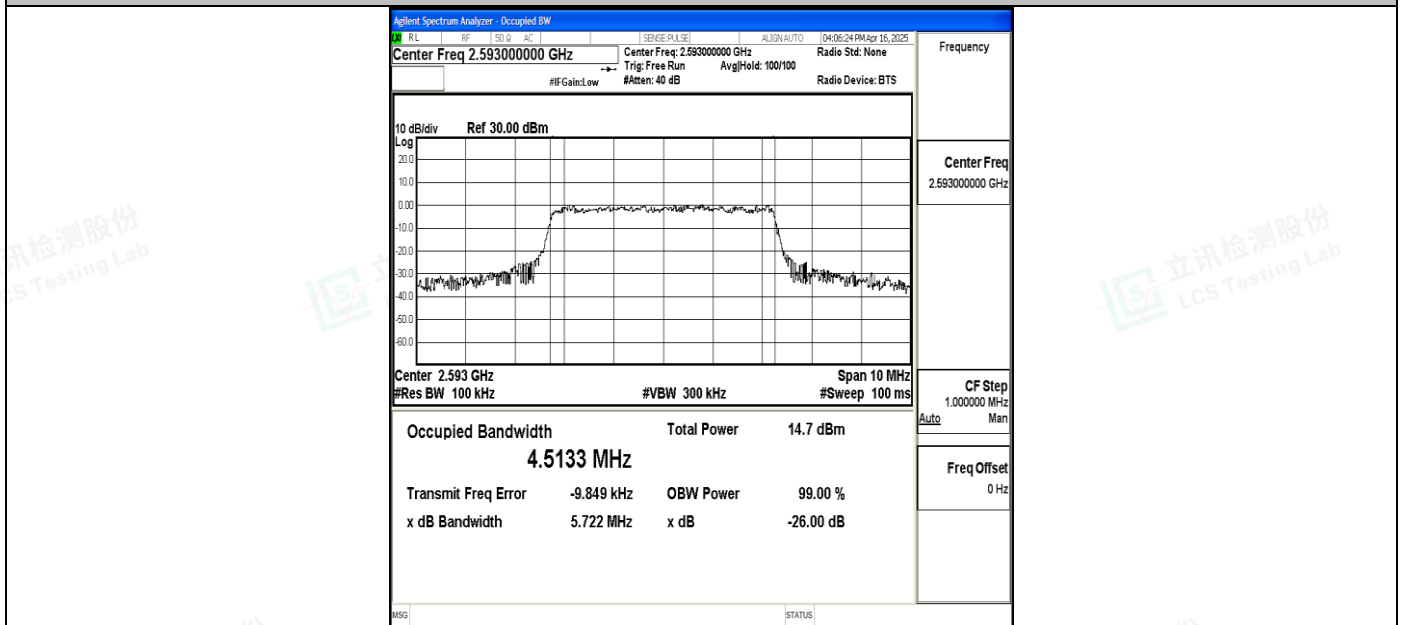


Band41-5MHz-16QAM-40620-25RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

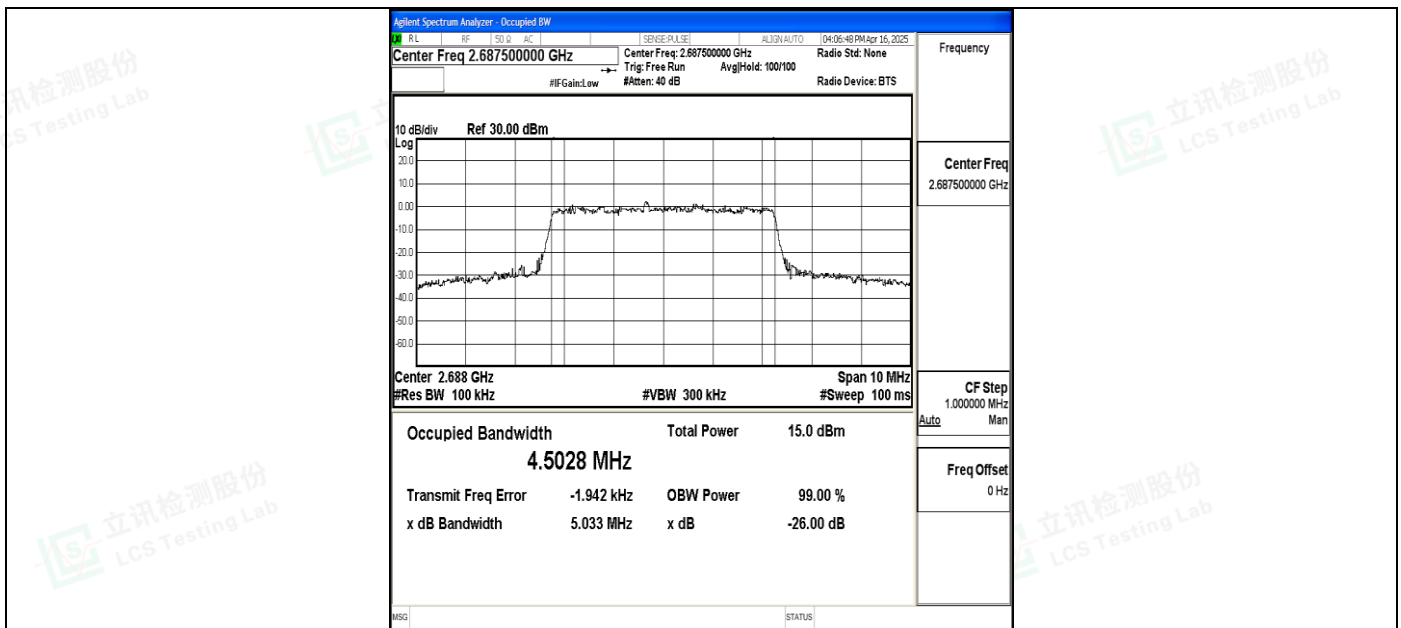


Band41-5MHz-QPSK-41565-25RB#0-PASS

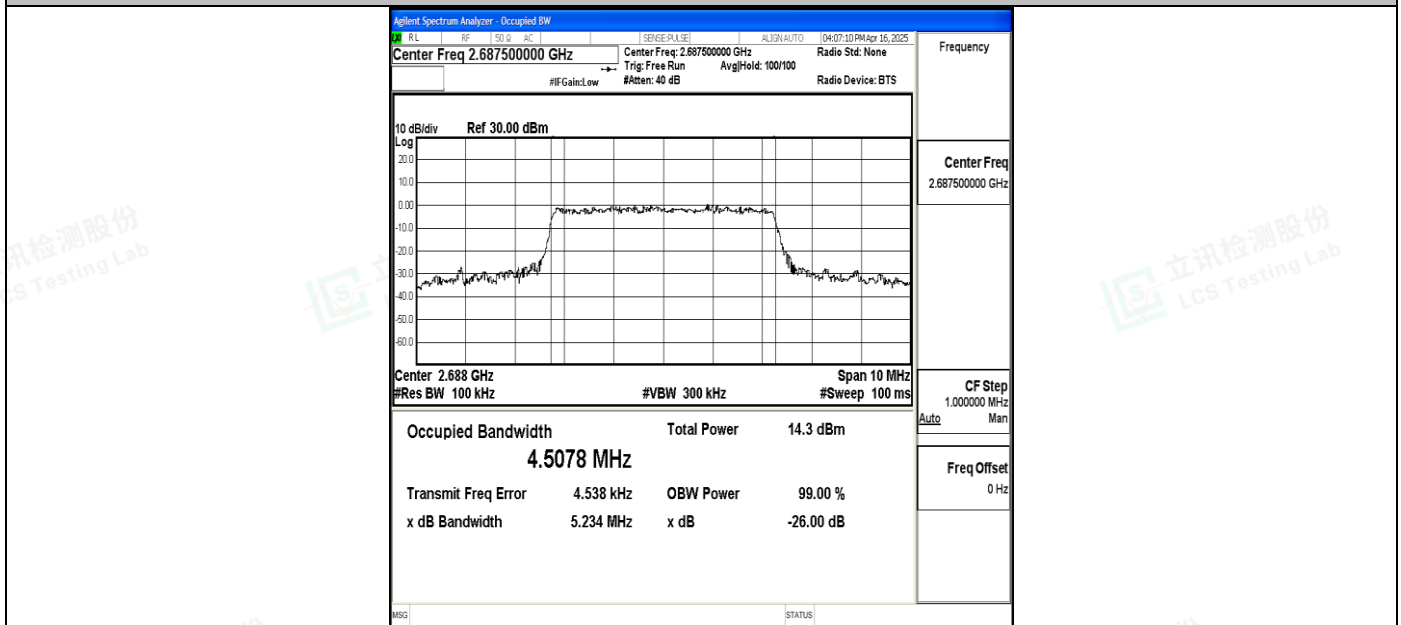


Band41-5MHz-16QAM-41565-25RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

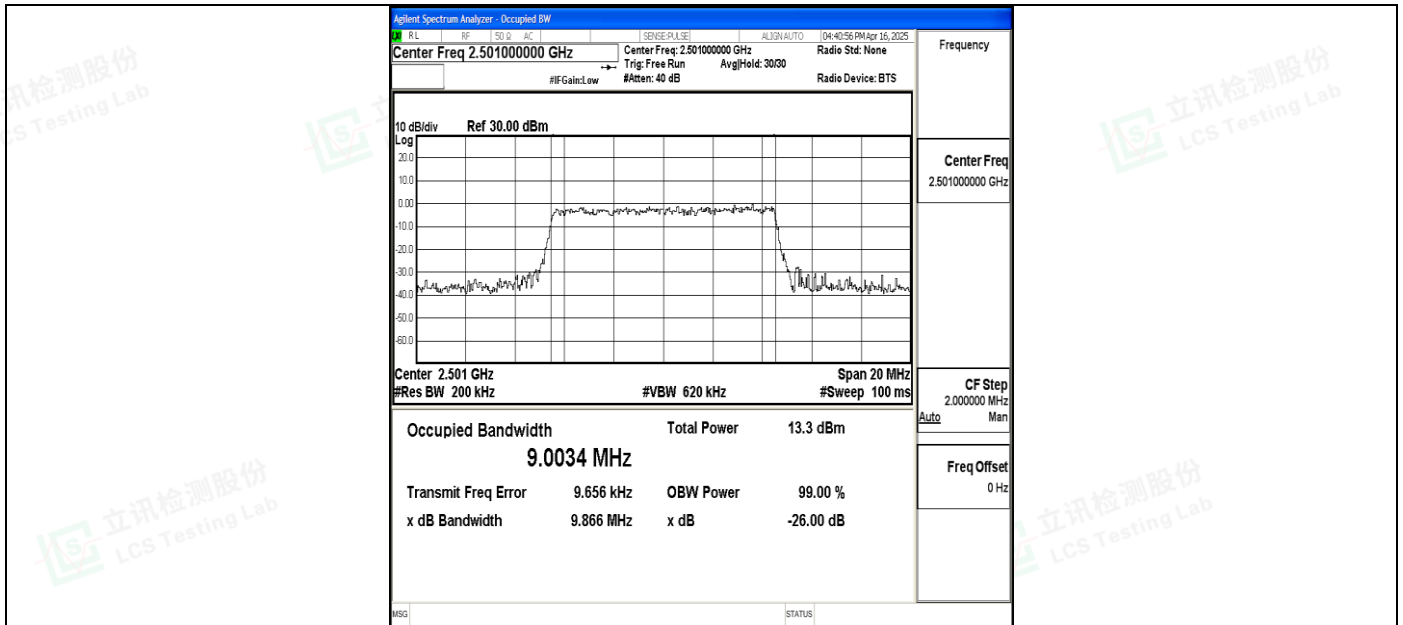


Band41-10MHz-QPSK-39700-50RB#0-PASS

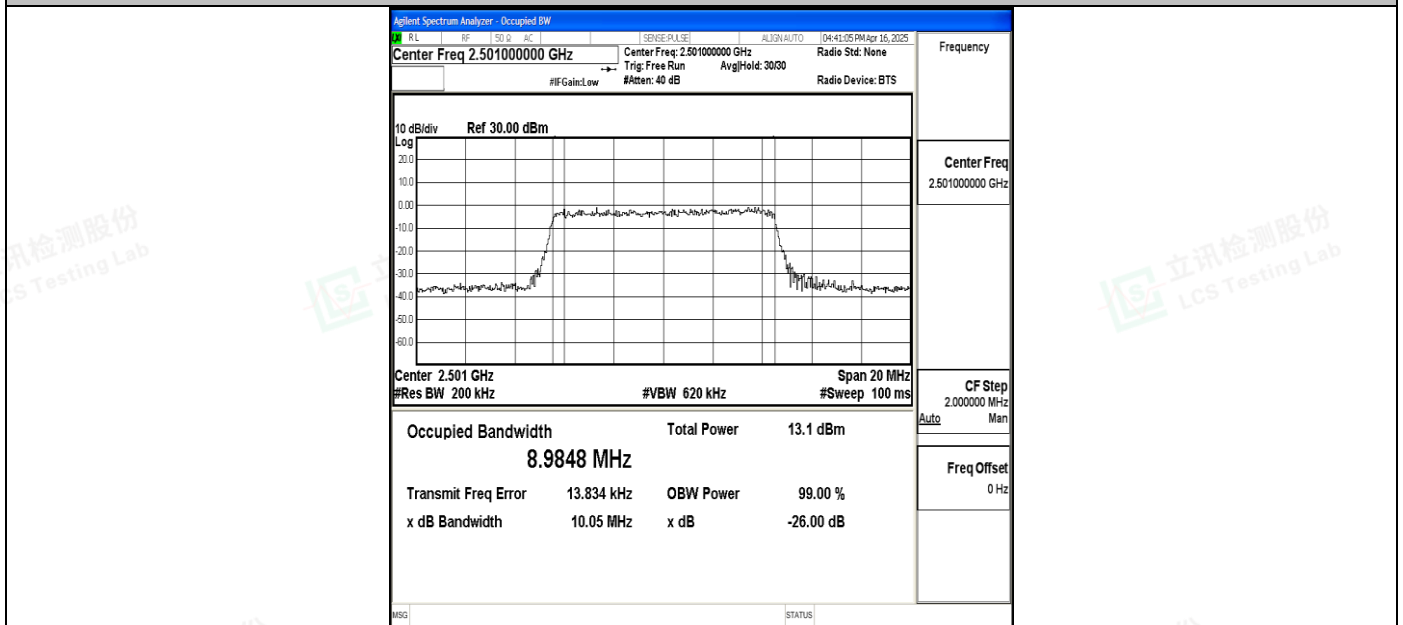


Band41-10MHz-16QAM-39700-50RB#0-PASS



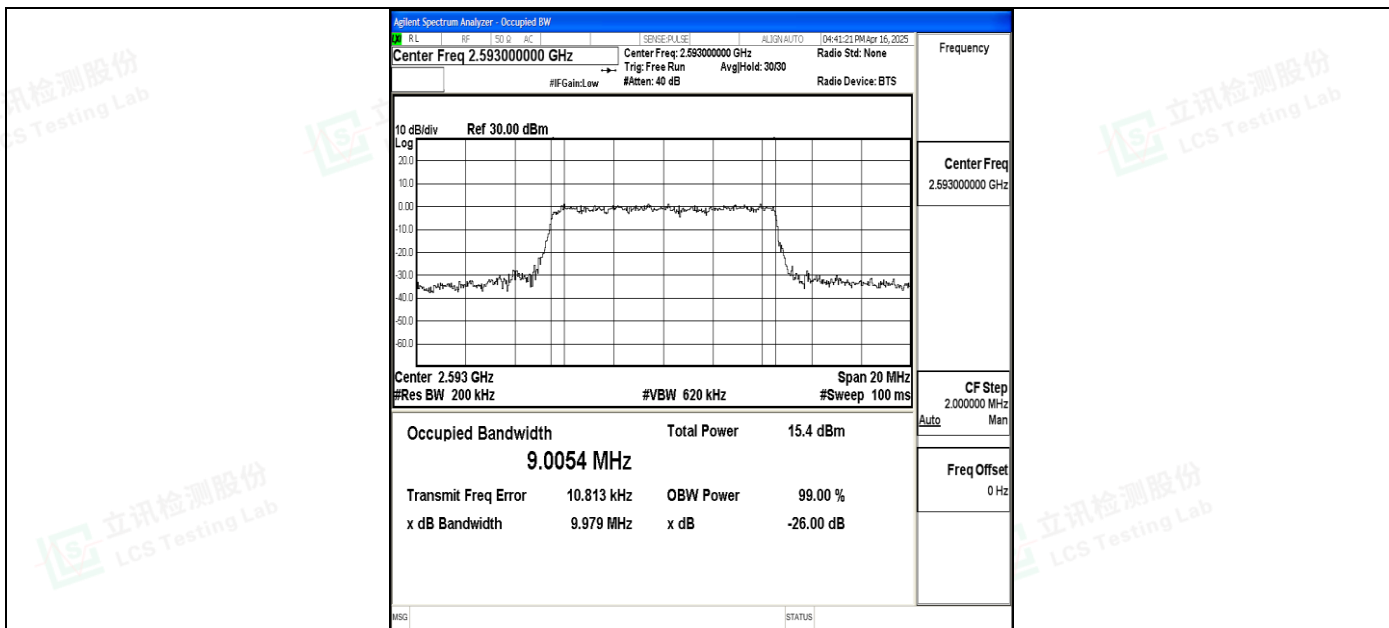


Band41-10MHz-QPSK-40620-50RB#0-PASS

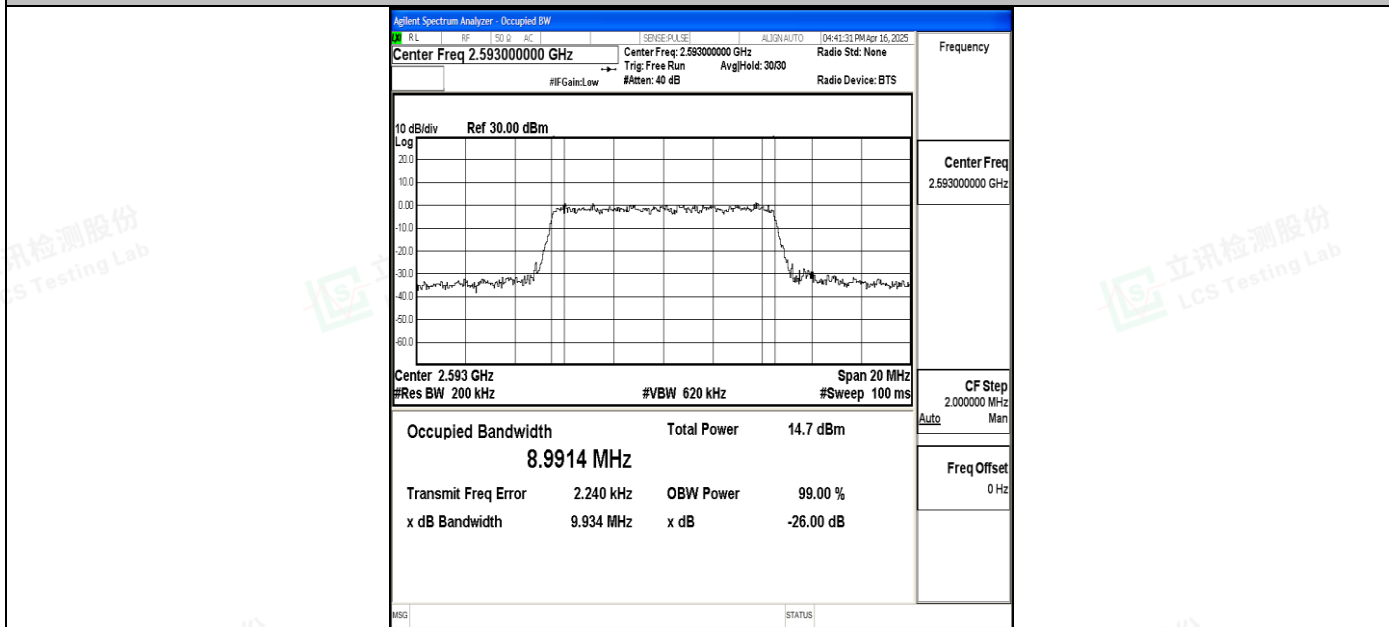


Band41-10MHz-16QAM-40620-50RB#0-PASS



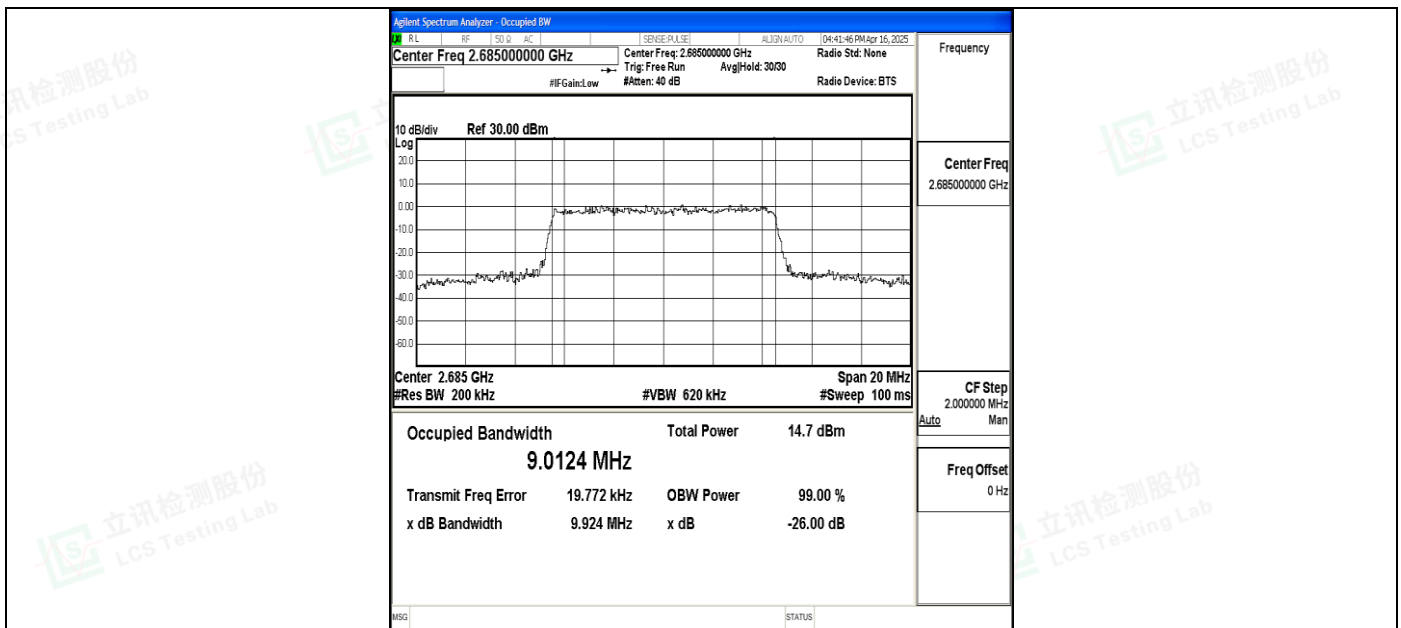


Band41-10MHz-QPSK-41540-50RB#0-PASS

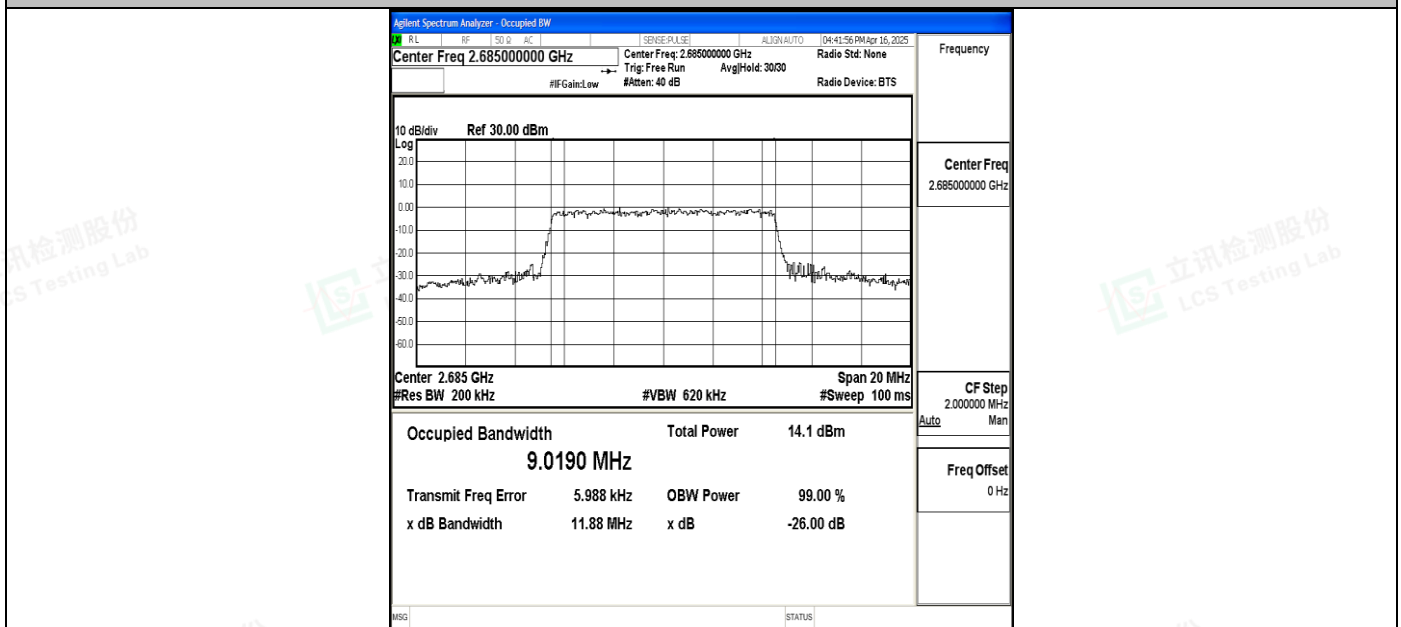


Band41-10MHz-16QAM-41540-50RB#0-PASS



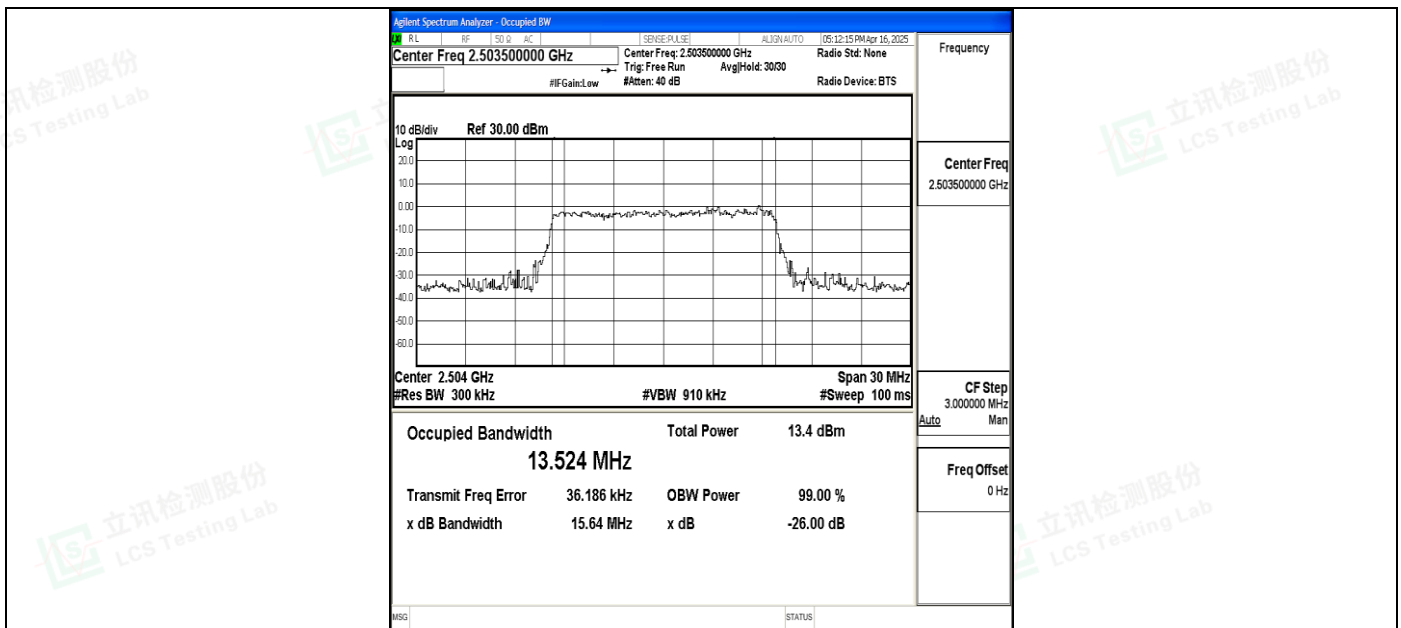


Band41-15MHz-QPSK-39725-75RB#0-PASS

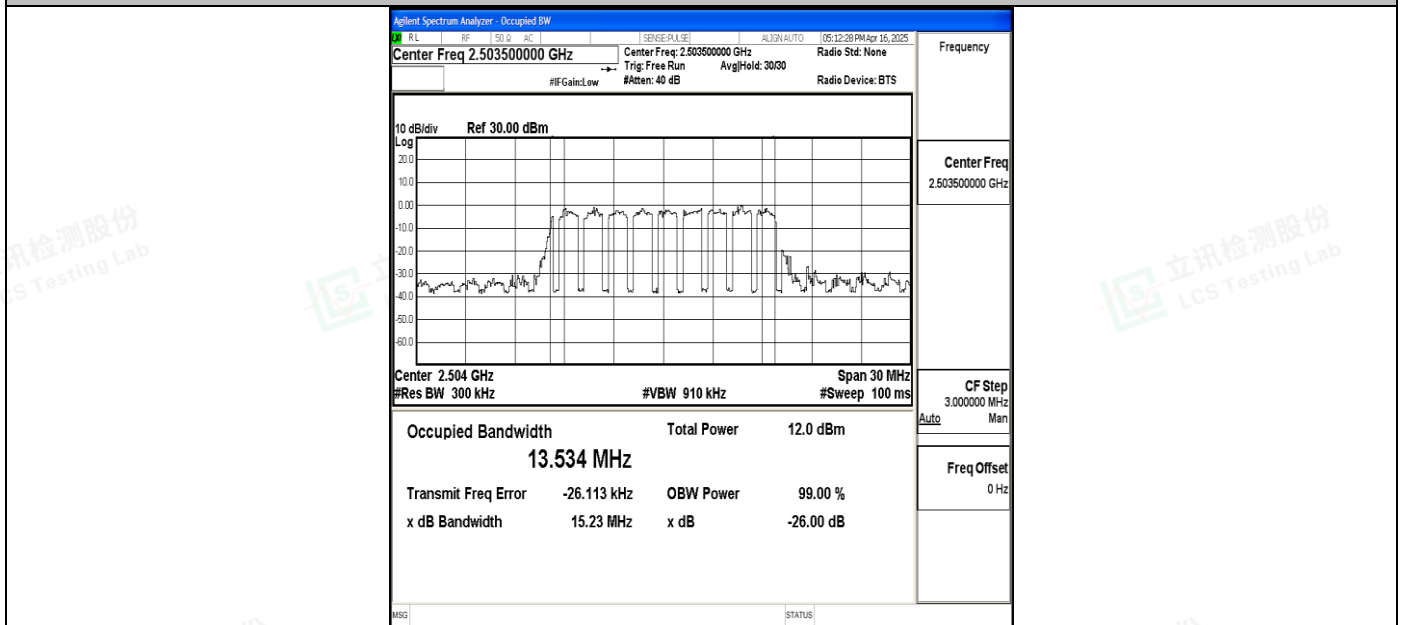


Band41-15MHz-16QAM-39725-75RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

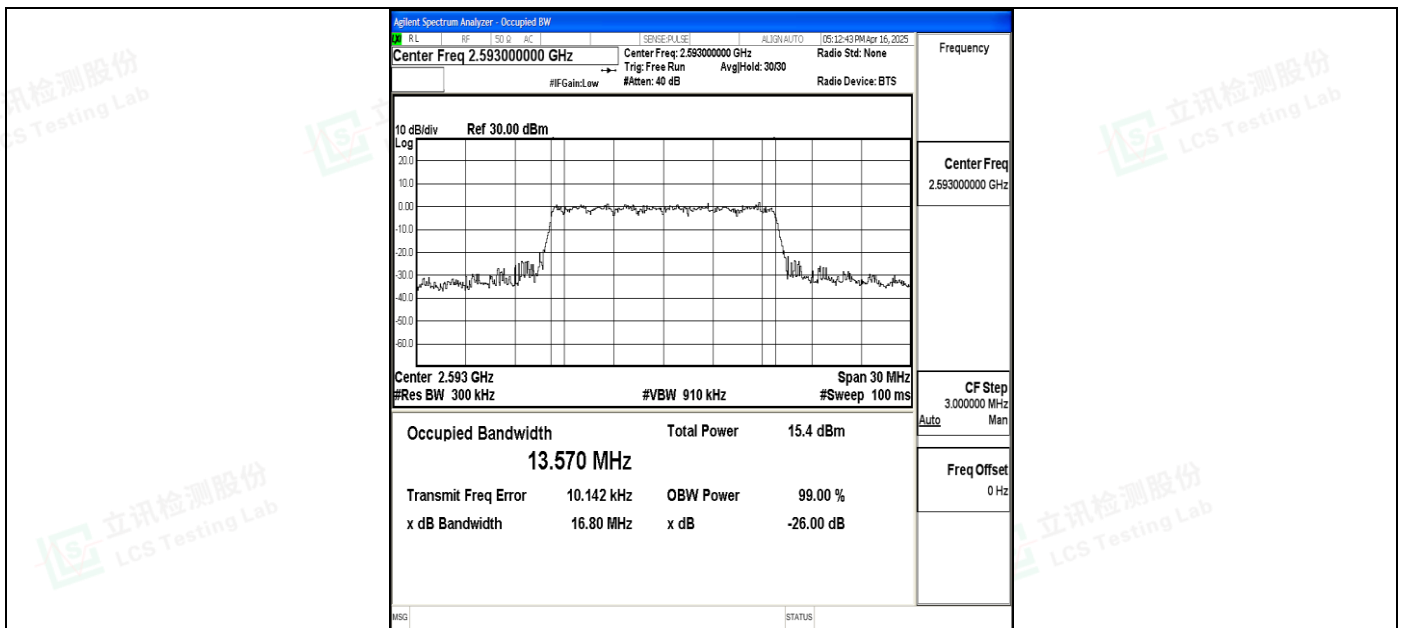


Band41-15MHz-QPSK-40620-75RB#0-PASS

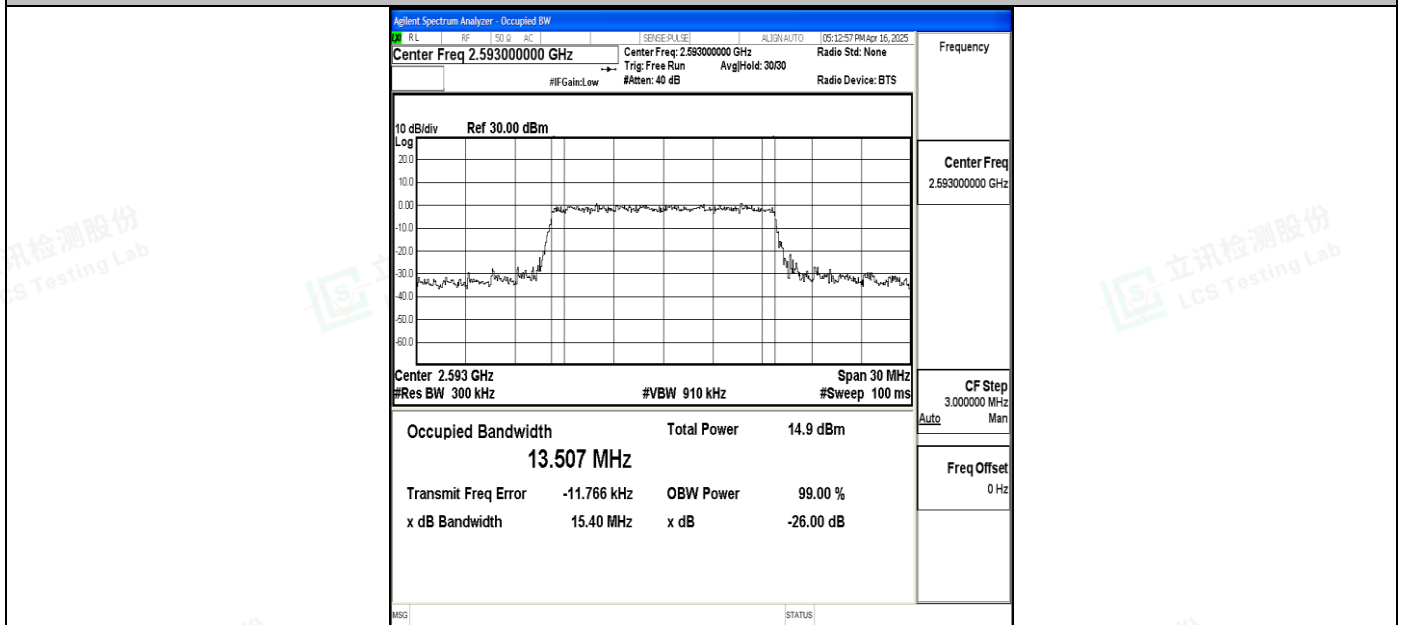


Band41-15MHz-16QAM-40620-75RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

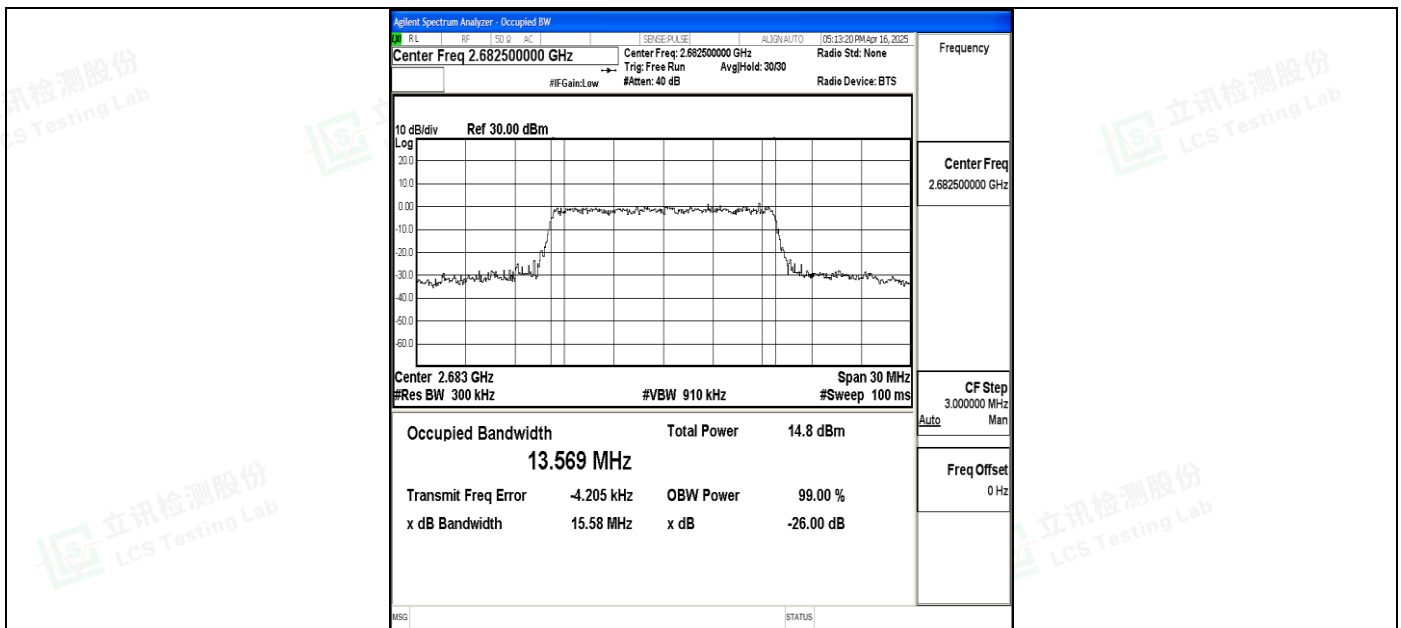


Band41-15MHz-QPSK-41515-75RB#0-PASS

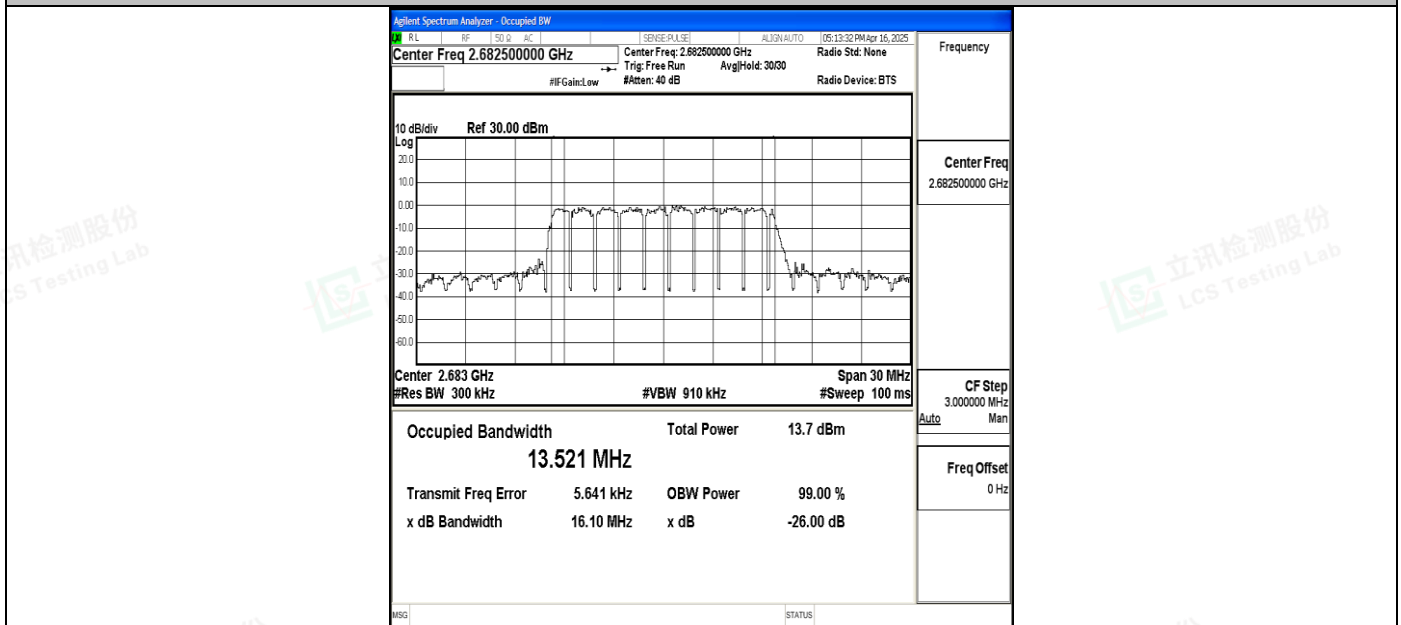


Band41-15MHz-16QAM-41515-75RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

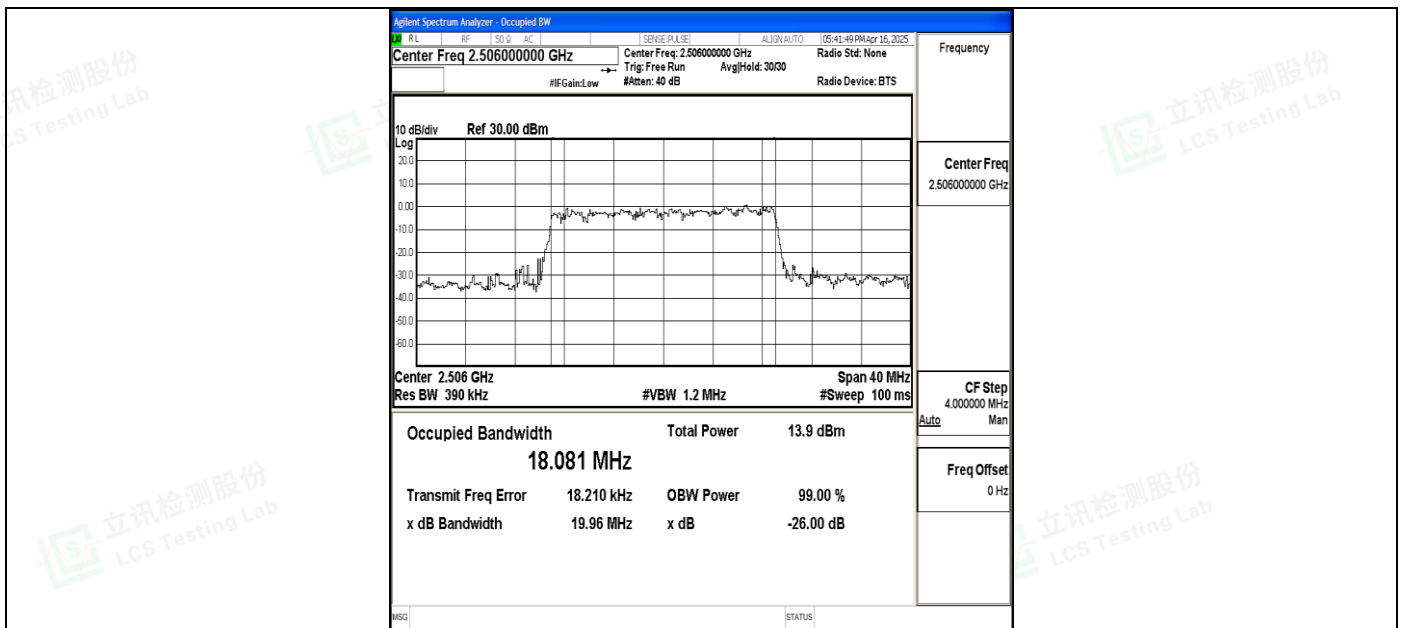


Band41-20MHz-QPSK-39750-100RB#0-PASS

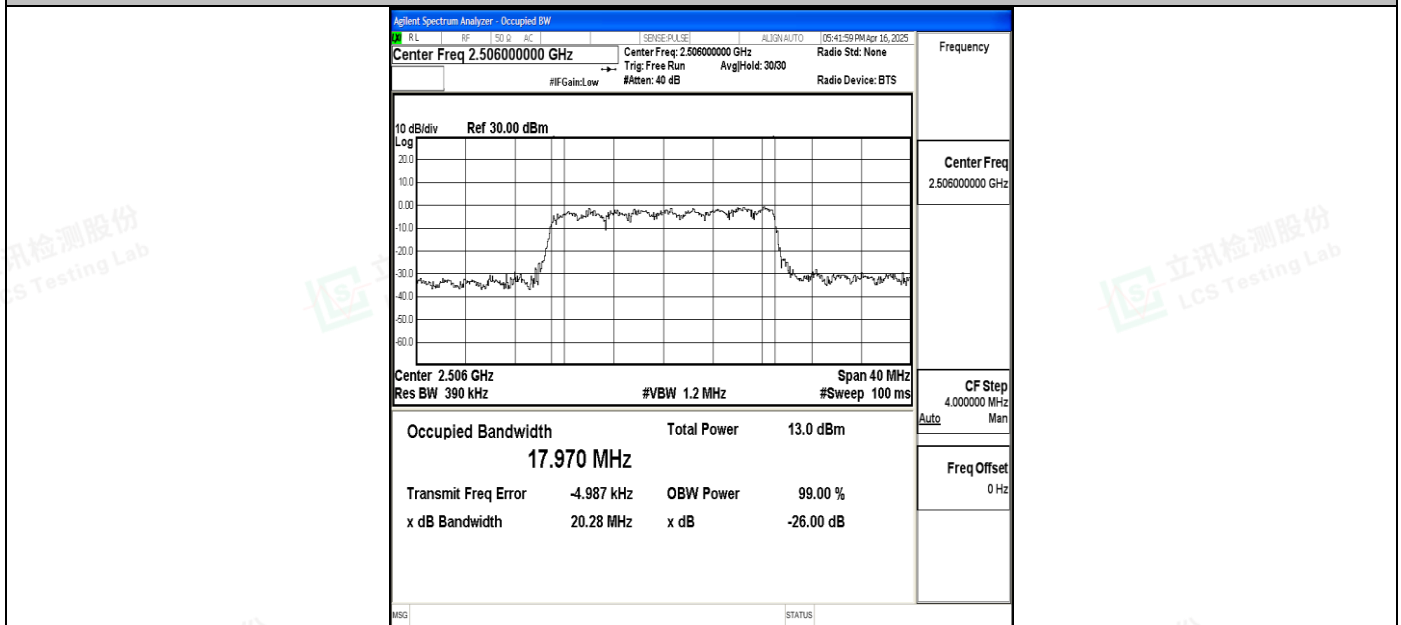


Band41-20MHz-16QAM-39750-100RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

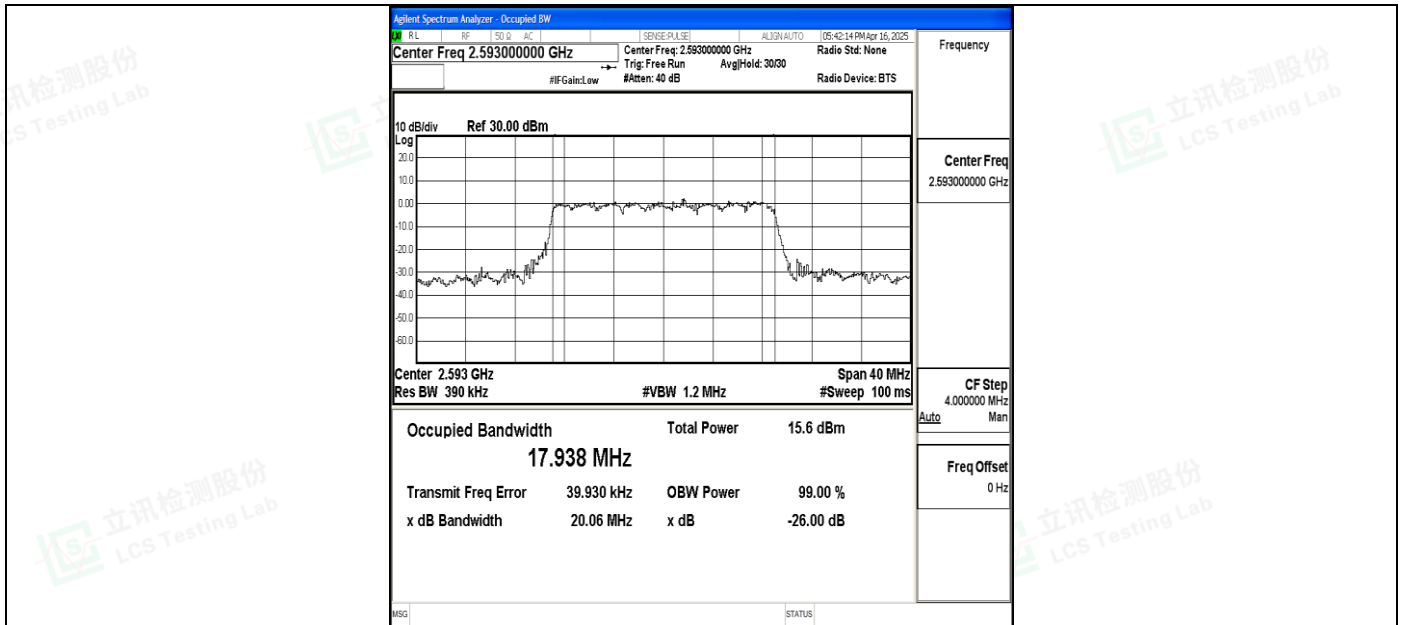


Band41-20MHz-QPSK-40620-100RB#0-PASS

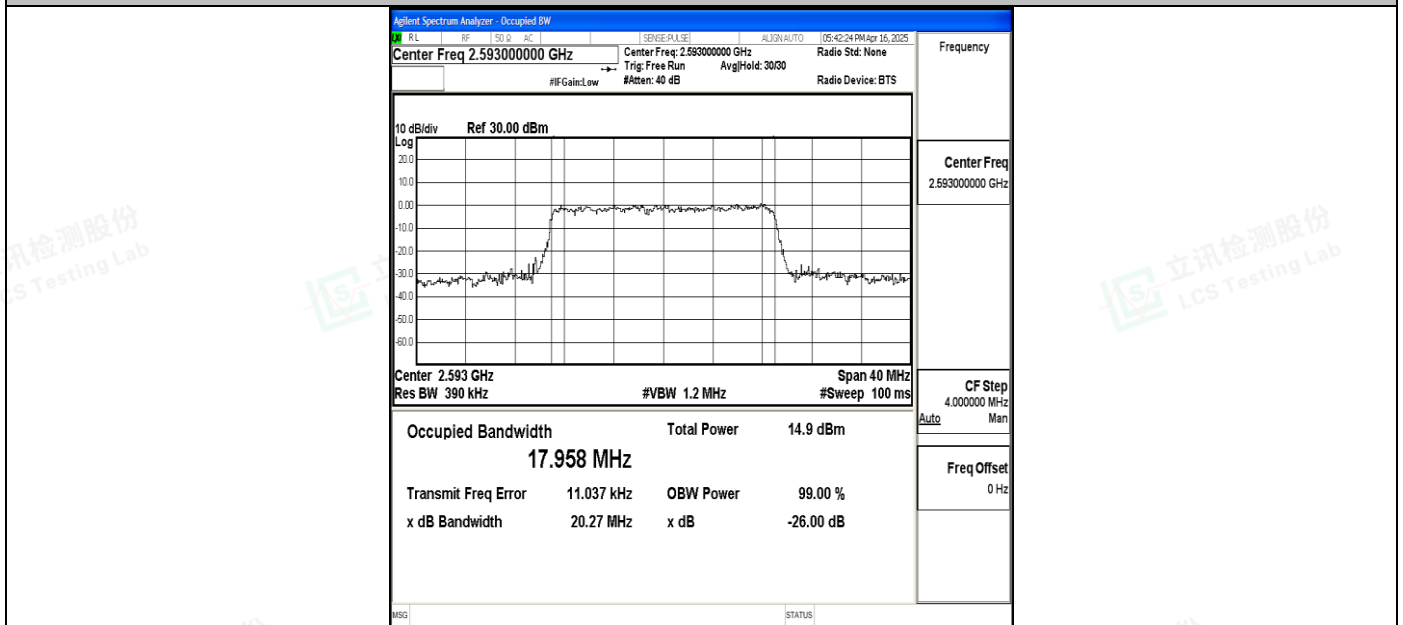


Band41-20MHz-16QAM-40620-100RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

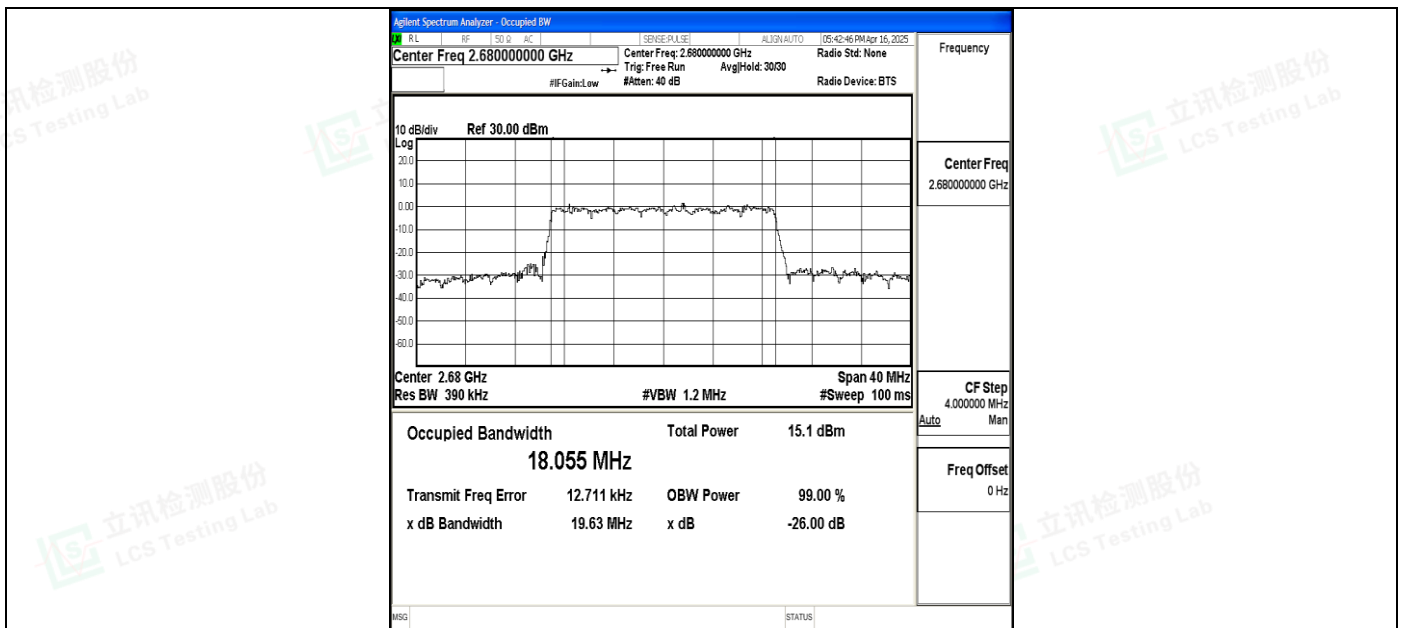

Band41-20MHz-QPSK-41490-100RB#0-PASS

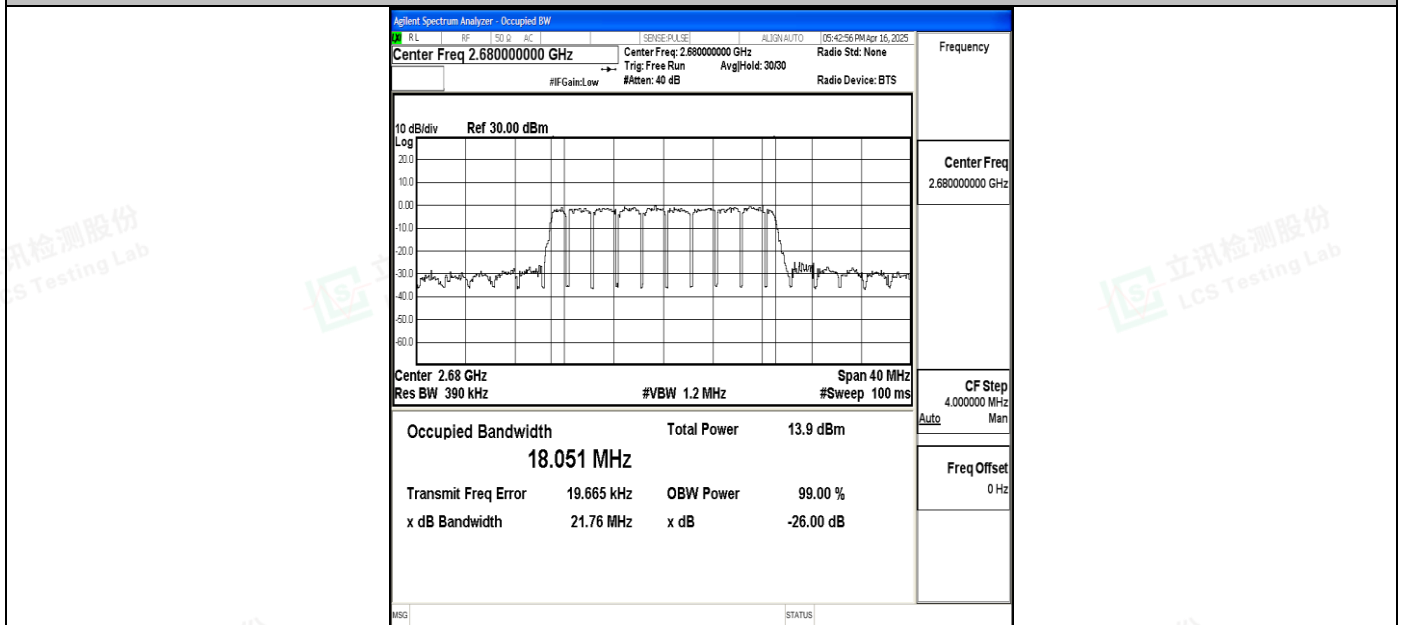

Band41-20MHz-16QAM-41490-100RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




N.4 Band Edge



Test Result


Band	Bandwidth	Modulation	Channel	RB Configuration	Peak Frequency	Result(dBm)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	2489.03	-43.27	PASS
Band41	5MHz	16QAM	39675	25RB#0	2488.07	-43.67	PASS
Band41	5MHz	QPSK	41565	25RB#0	2696.25	-39.64	PASS
Band41	5MHz	16QAM	41565	25RB#0	2696.54	-39.79	PASS
Band41	10MHz	QPSK	39700	50RB#0	2489.67	-37.27	PASS
Band41	10MHz	16QAM	39700	50RB#0	2489.51	-38.36	PASS
Band41	10MHz	QPSK	41540	50RB#0	2700.28	-37.23	PASS
Band41	10MHz	16QAM	41540	50RB#0	2700.33	-35.82	PASS
Band41	15MHz	QPSK	39725	75RB#0	2489.56	-35.73	PASS
Band41	15MHz	16QAM	39725	75RB#0	2489.20	-34.52	PASS
Band41	15MHz	QPSK	41515	75RB#0	2709.51	-34.83	PASS
Band41	15MHz	16QAM	41515	75RB#0	2709.55	-34.53	PASS
Band41	20MHz	QPSK	39750	100RB#0	2488.22	-36.22	PASS
Band41	20MHz	16QAM	39750	100RB#0	2488.08	-34.81	PASS
Band41	20MHz	QPSK	41490	100RB#0	2710.28	-34.34	PASS
Band41	20MHz	16QAM	41490	100RB#0	2712.21	-33.90	PASS

Test Graphs

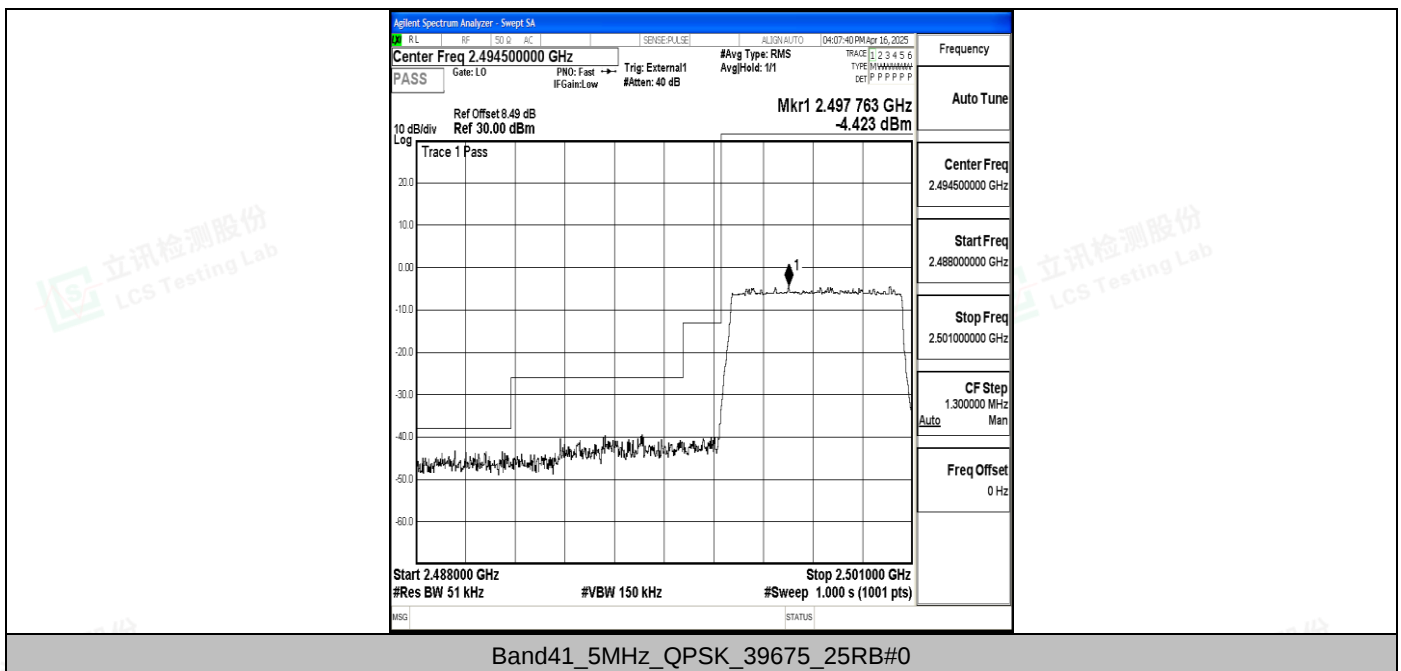


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

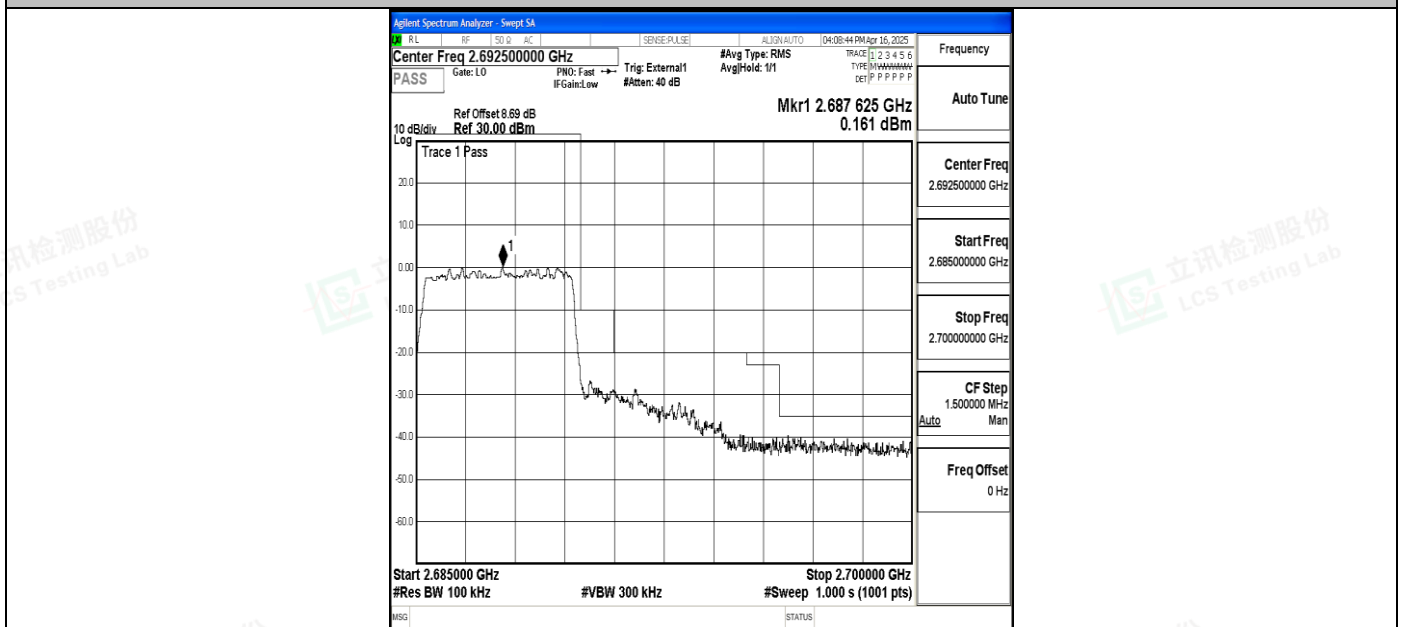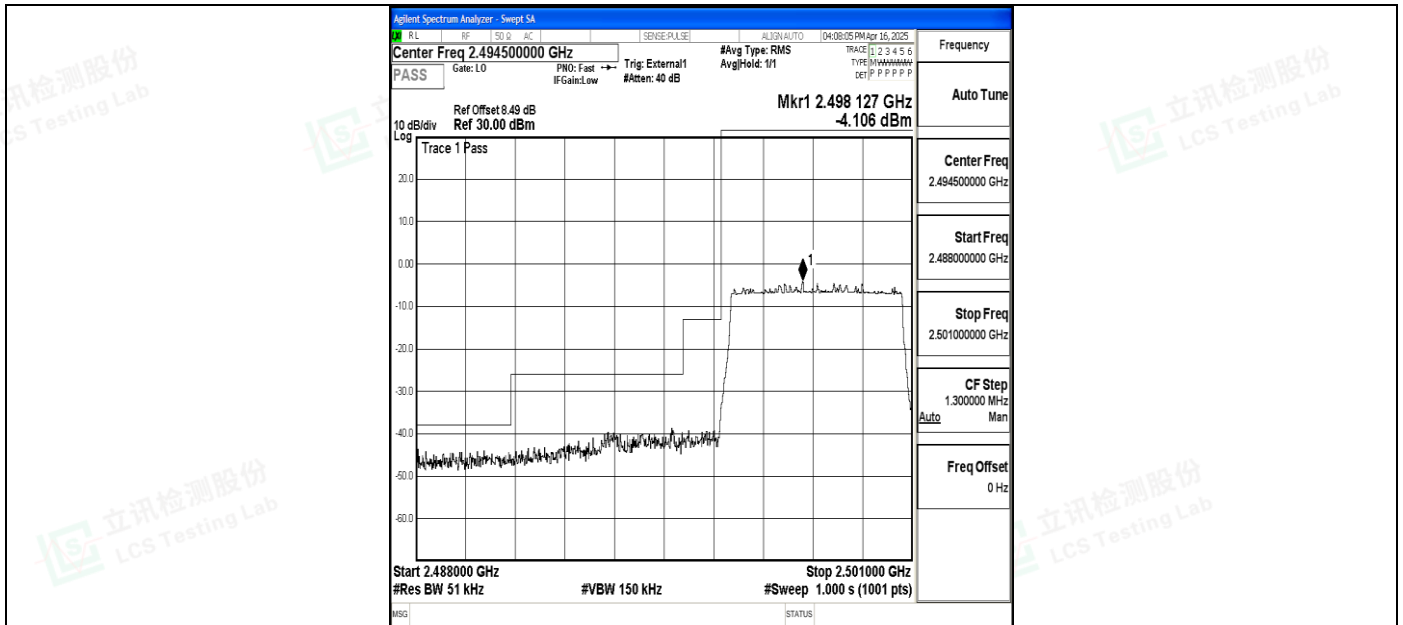

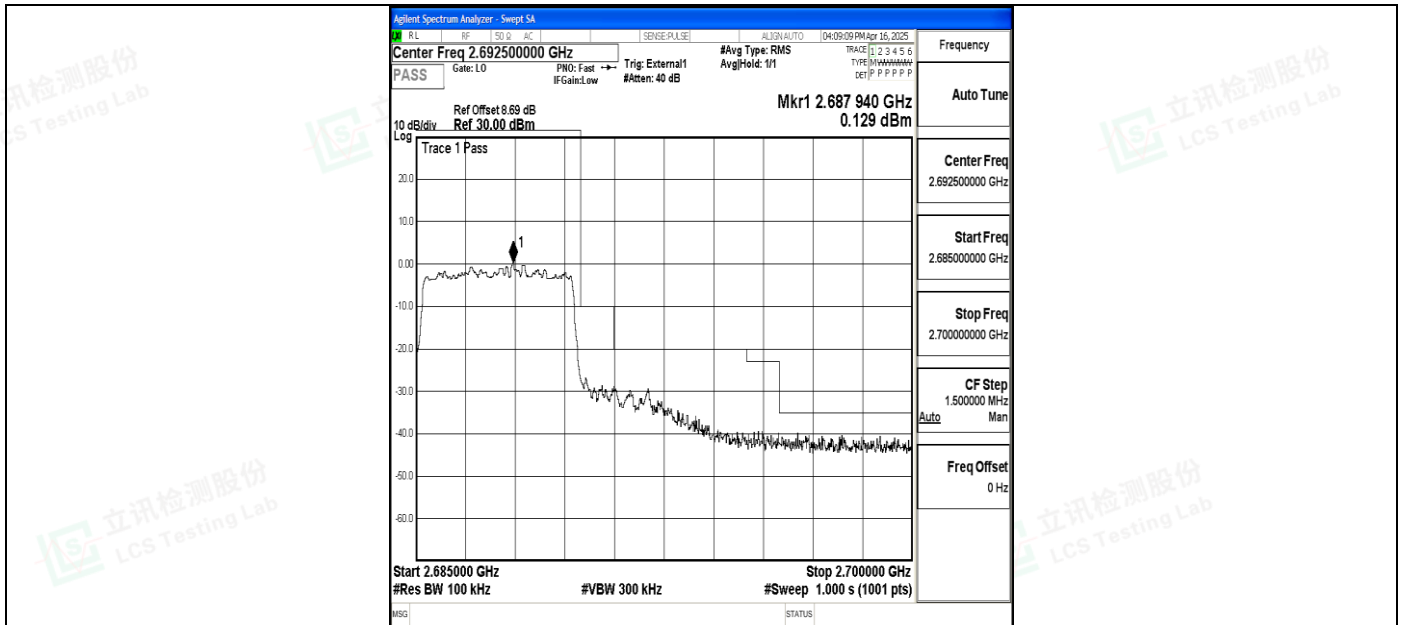


Band41_5MHz_16QAM_41565_25RB#0

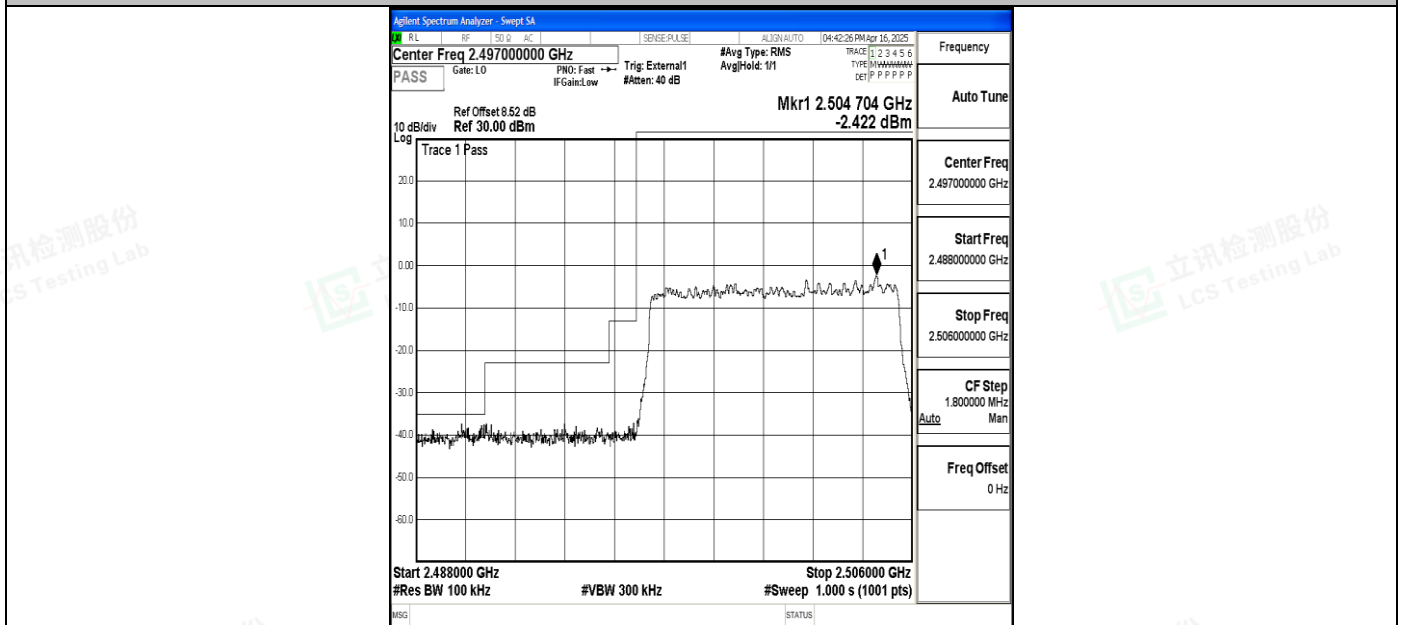


Band41_10MHz_QPSK_39700_50RB#0



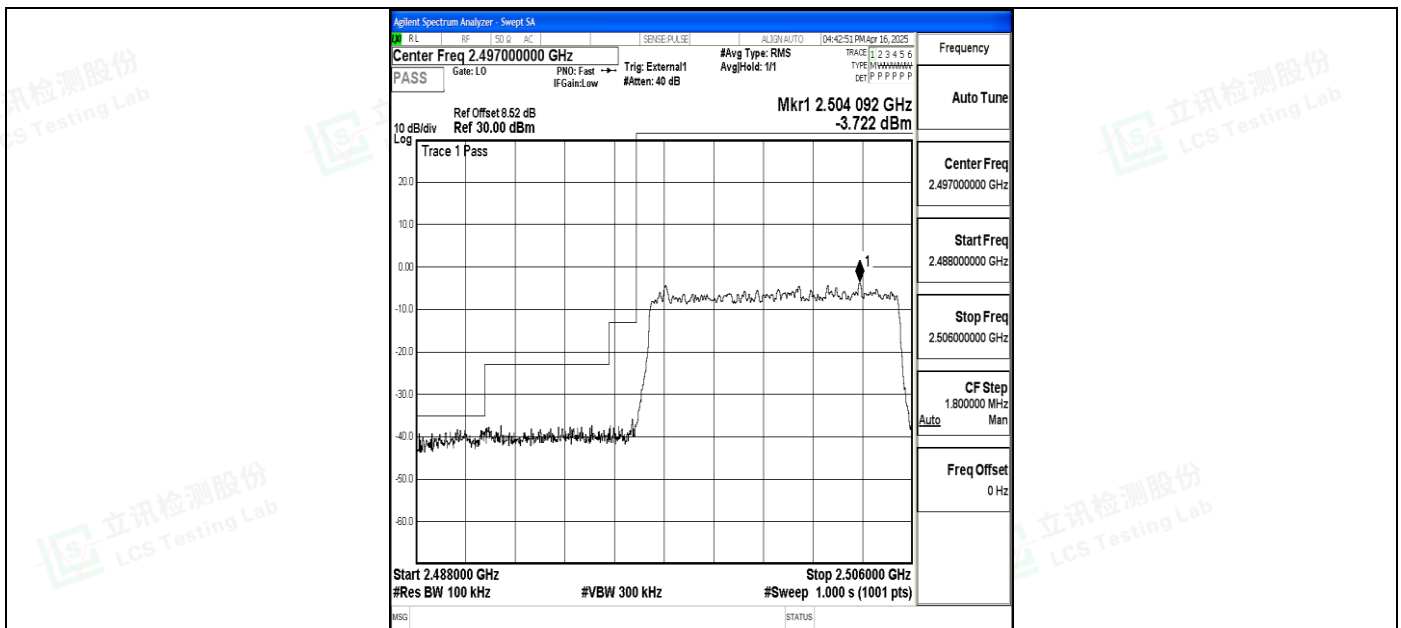


Band41_10MHz_16QAM_39700_50RB#0

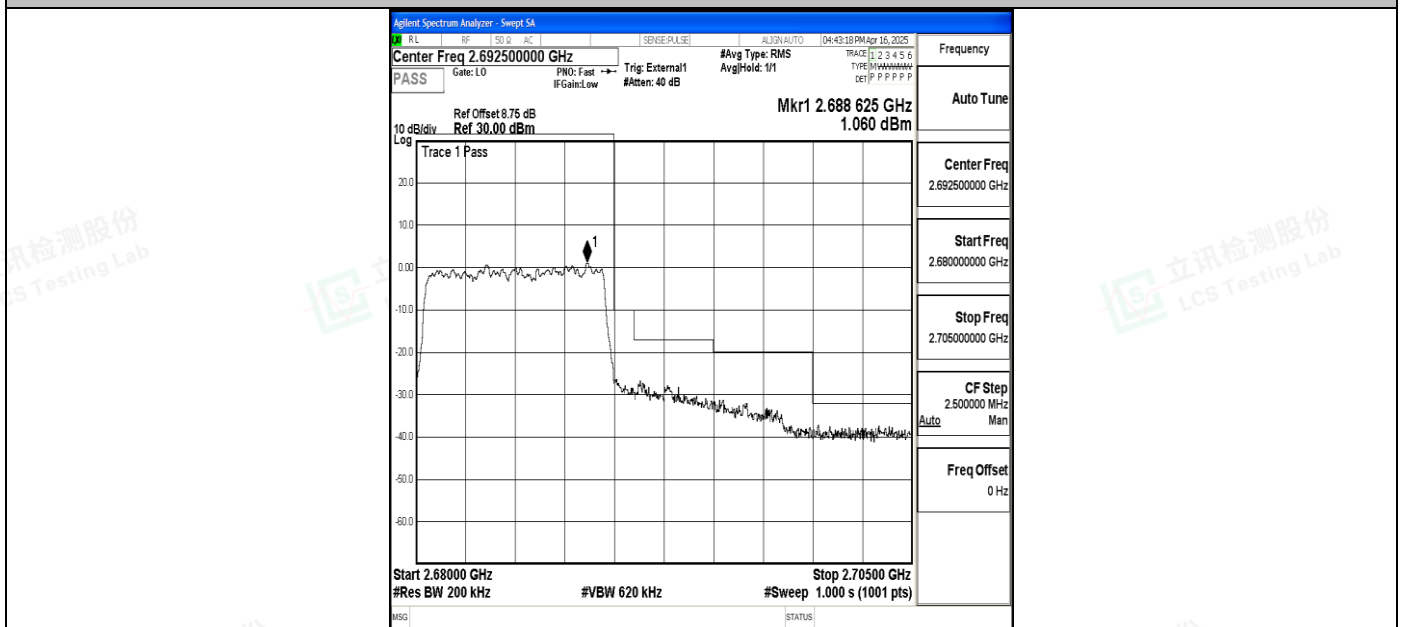


Band41_10MHz_QPSK_41540_50RB#0



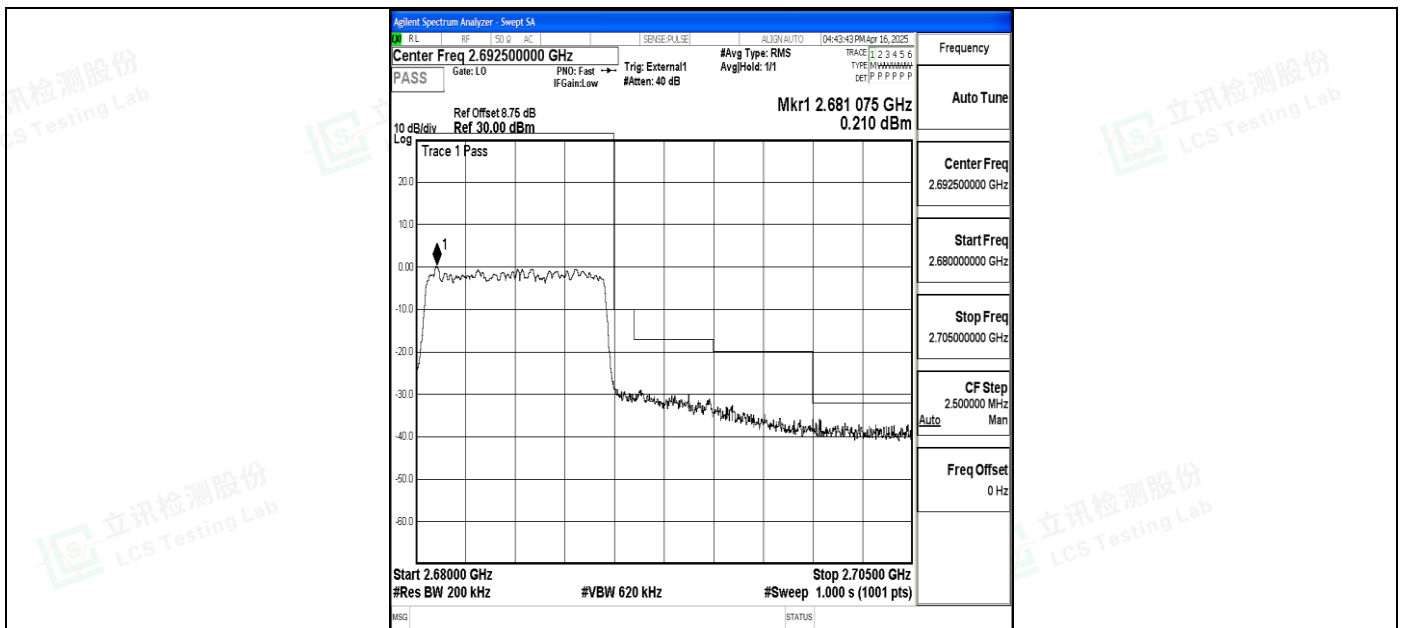


Band41_10MHz_16QAM_41540_50RB#0

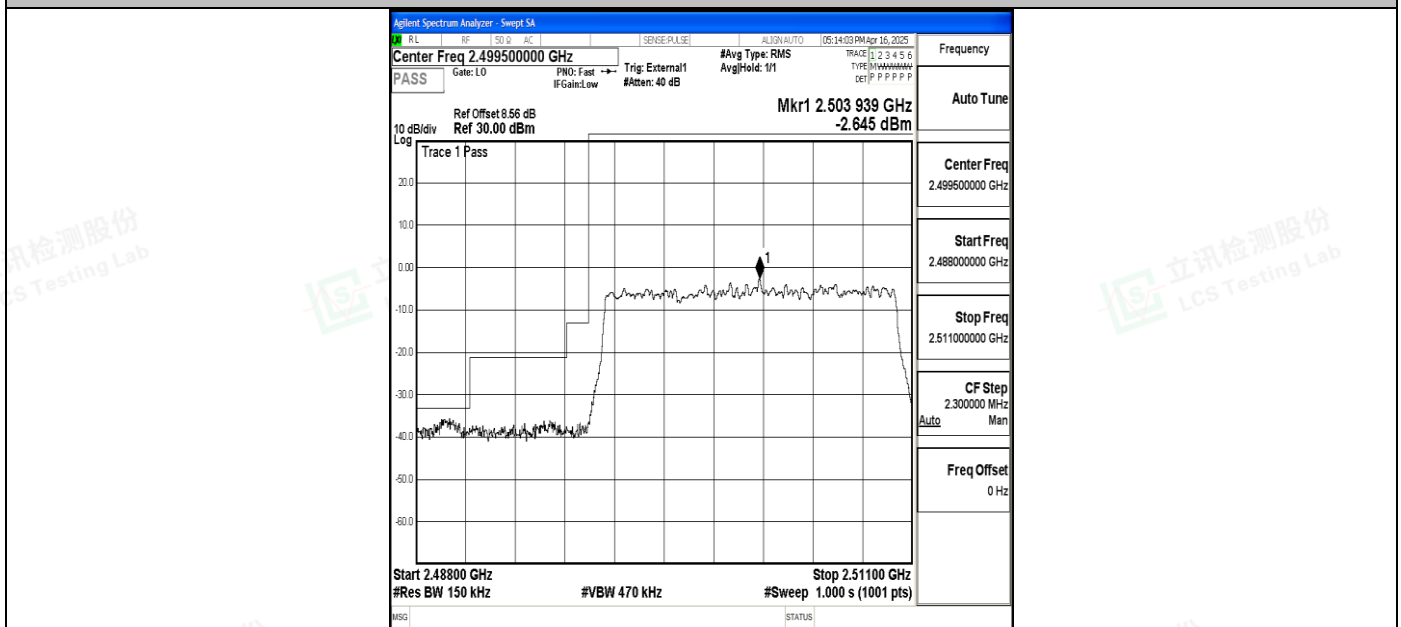


Band41_15MHz_QPSK_39725_75RB#0



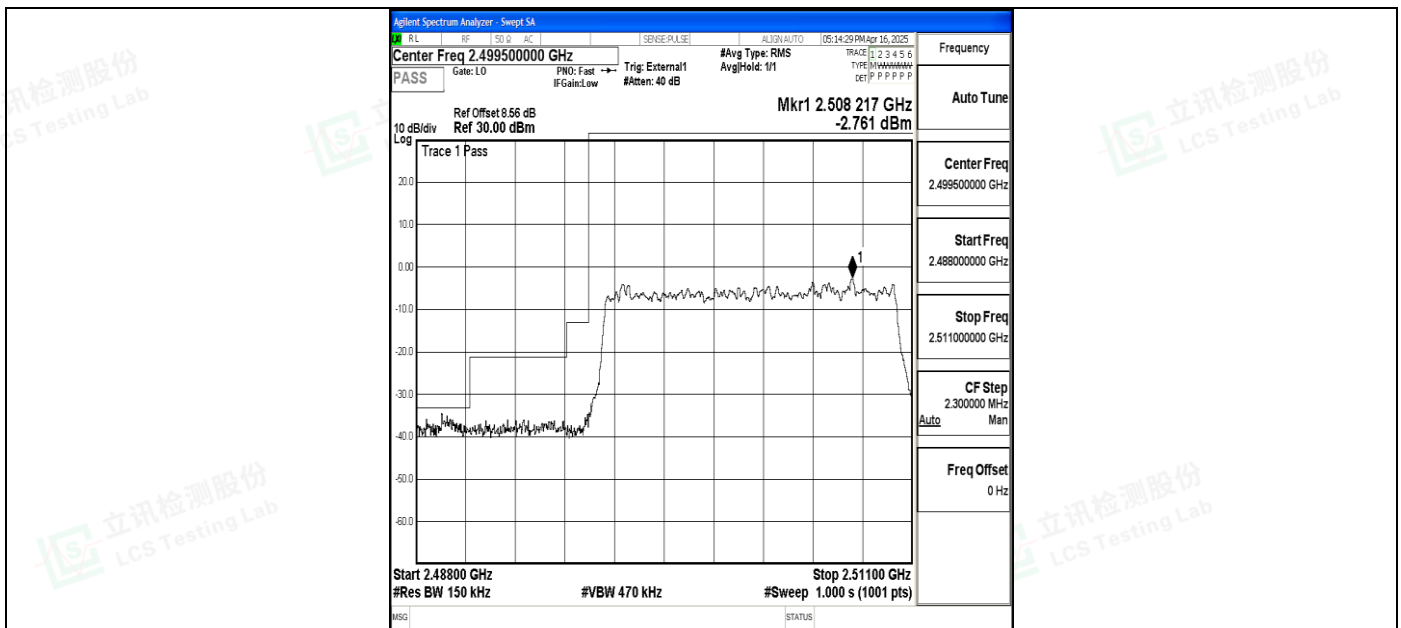


Band41_15MHz_16QAM_39725_75RB#0

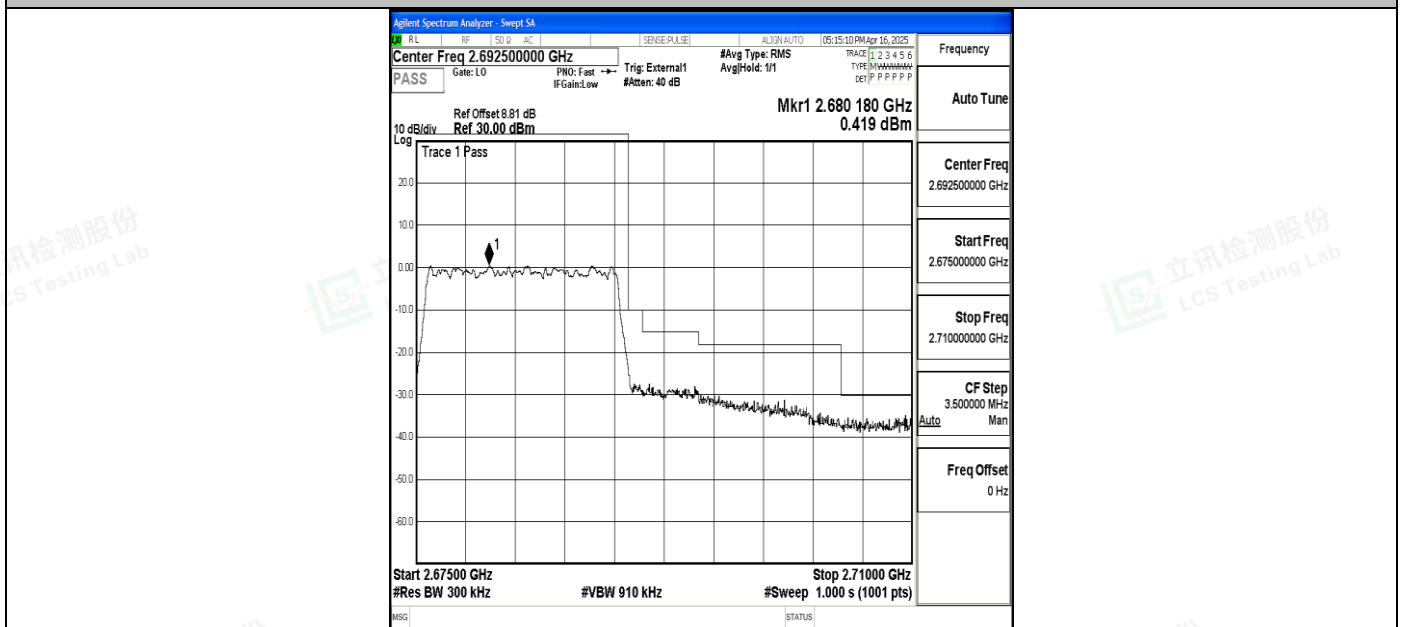


Band41_15MHz_QPSK_41515_75RB#0




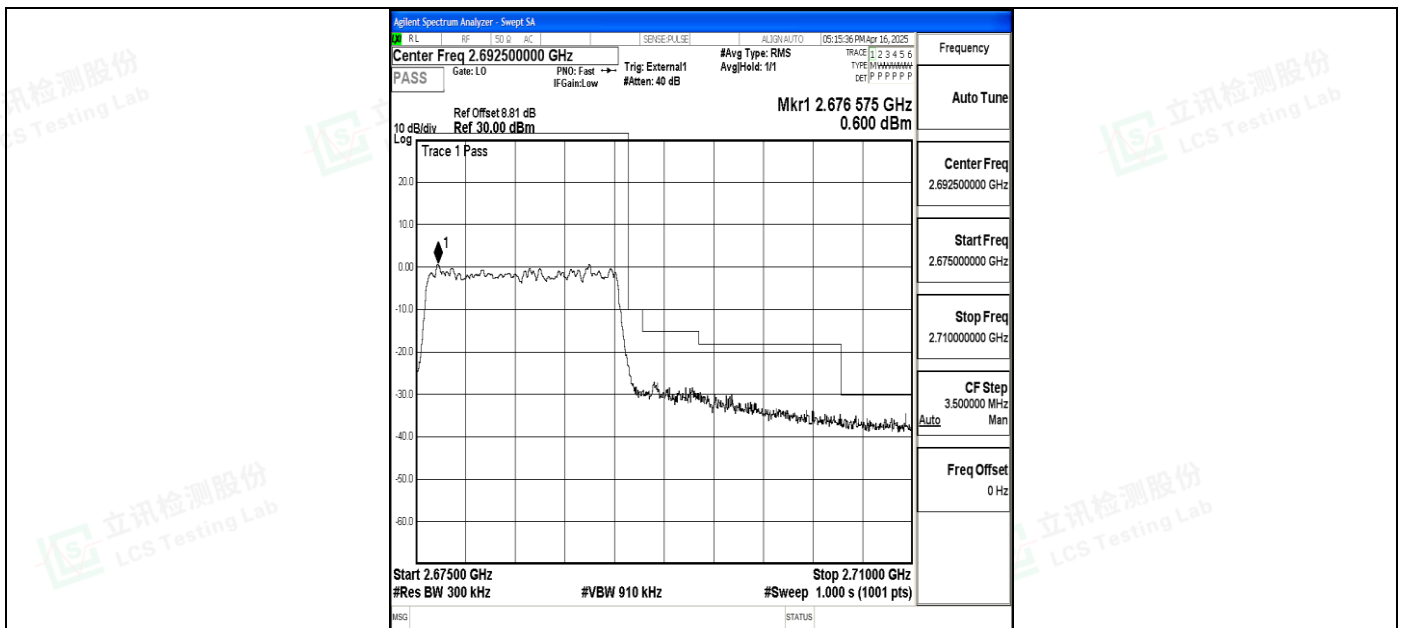



Band41_15MHz_16QAM_41515_75RB#0

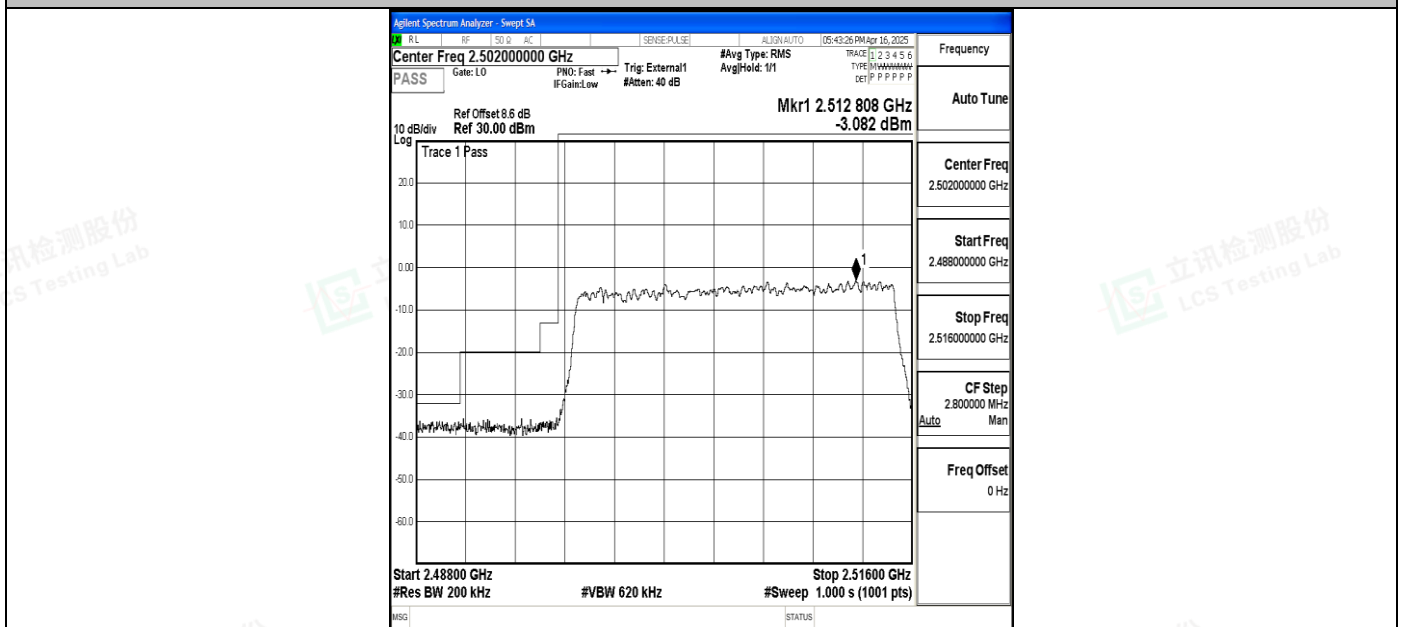

Band41_20MHz_QPSK_39750_100RB#0



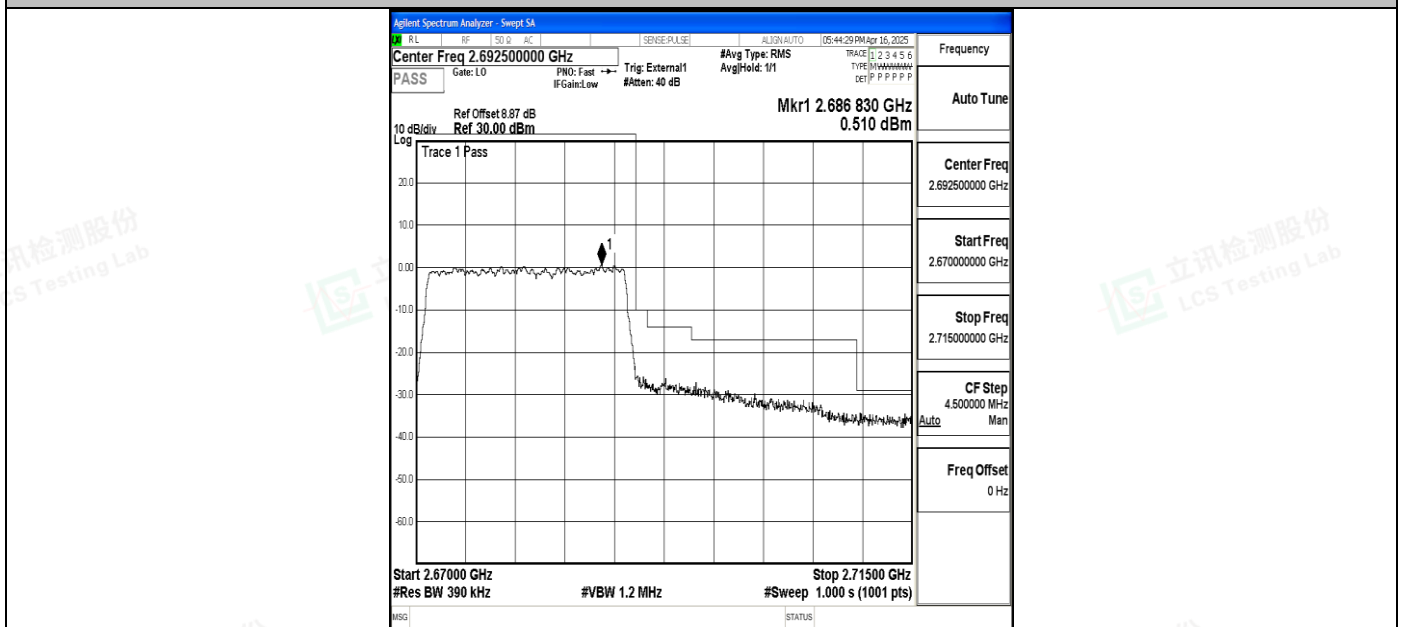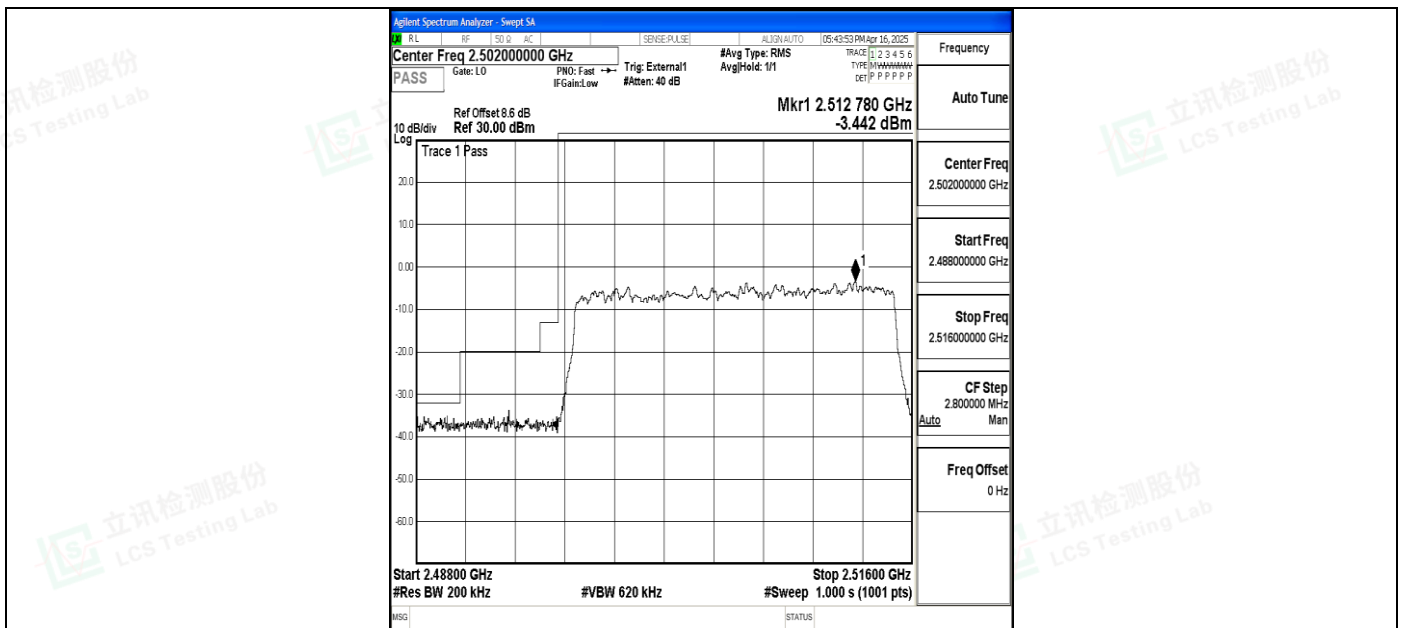

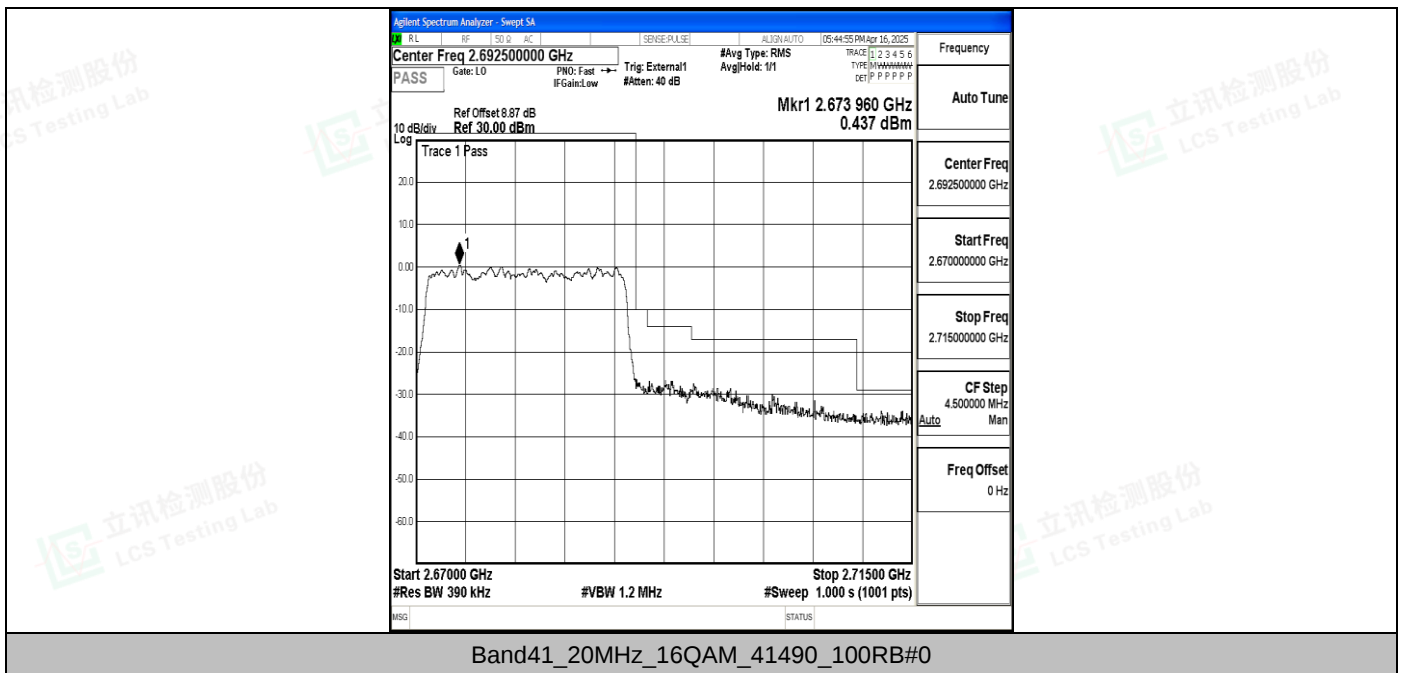

Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



N.5 Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	0.009~0.15	-63.97	PASS
Band41	5MHz	QPSK	39675	1RB#0	0.15~30	-50.59	PASS
Band41	5MHz	QPSK	39675	1RB#0	30~1000	-52.46	PASS
Band41	5MHz	QPSK	39675	1RB#0	1000~20000	-34.78	PASS
Band41	5MHz	QPSK	39675	1RB#0	20000~27000	-36.15	PASS
Band41	5MHz	16QAM	39675	1RB#0	0.009~0.15	-64.37	PASS
Band41	5MHz	16QAM	39675	1RB#0	0.15~30	-55.51	PASS
Band41	5MHz	16QAM	39675	1RB#0	30~1000	-52.84	PASS
Band41	5MHz	16QAM	39675	1RB#0	1000~20000	-34.26	PASS
Band41	5MHz	16QAM	39675	1RB#0	20000~27000	-35.77	PASS
Band41	5MHz	QPSK	40620	1RB#0	0.009~0.15	-63.34	PASS
Band41	5MHz	QPSK	40620	1RB#0	0.15~30	-50.78	PASS
Band41	5MHz	QPSK	40620	1RB#0	30~1000	-53.34	PASS
Band41	5MHz	QPSK	40620	1RB#0	1000~20000	-34.70	PASS
Band41	5MHz	QPSK	40620	1RB#0	20000~27000	-36.19	PASS
Band41	5MHz	16QAM	40620	1RB#0	0.009~0.15	-63.93	PASS
Band41	5MHz	16QAM	40620	1RB#0	0.15~30	-50.81	PASS
Band41	5MHz	16QAM	40620	1RB#0	30~1000	-52.49	PASS
Band41	5MHz	16QAM	40620	1RB#0	1000~20000	-34.36	PASS
Band41	5MHz	16QAM	40620	1RB#0	20000~27000	-35.58	PASS
Band41	5MHz	QPSK	41565	1RB#0	0.009~0.15	-63.92	PASS
Band41	5MHz	QPSK	41565	1RB#0	0.15~30	-53.79	PASS
Band41	5MHz	QPSK	41565	1RB#0	30~1000	-52.74	PASS
Band41	5MHz	QPSK	41565	1RB#0	1000~20000	-34.35	PASS
Band41	5MHz	QPSK	41565	1RB#0	20000~27000	-36.08	PASS
Band41	5MHz	16QAM	41565	1RB#0	0.009~0.15	-63.40	PASS
Band41	5MHz	16QAM	41565	1RB#0	0.15~30	-54.43	PASS
Band41	5MHz	16QAM	41565	1RB#0	30~1000	-52.73	PASS
Band41	5MHz	16QAM	41565	1RB#0	1000~20000	-34.26	PASS
Band41	5MHz	16QAM	41565	1RB#0	20000~27000	-35.51	PASS
Band41	10MHz	QPSK	39700	1RB#0	0.009~0.15	-63.38	PASS
Band41	10MHz	QPSK	39700	1RB#0	0.15~30	-53.85	PASS
Band41	10MHz	QPSK	39700	1RB#0	30~1000	-52.28	PASS
Band41	10MHz	QPSK	39700	1RB#0	1000~20000	-34.28	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Band41	10MHz	QPSK	39700	1RB#0	20000~27000	-36.47	PASS
Band41	10MHz	16QAM	39700	1RB#0	0.009~0.15	-64.96	PASS
Band41	10MHz	16QAM	39700	1RB#0	0.15~30	-55.39	PASS
Band41	10MHz	16QAM	39700	1RB#0	30~1000	-52.06	PASS
Band41	10MHz	16QAM	39700	1RB#0	1000~20000	-34.26	PASS
Band41	10MHz	16QAM	39700	1RB#0	20000~27000	-35.93	PASS
Band41	10MHz	QPSK	40620	1RB#0	0.009~0.15	-64.14	PASS
Band41	10MHz	QPSK	40620	1RB#0	0.15~30	-53.63	PASS
Band41	10MHz	QPSK	40620	1RB#0	30~1000	-52.93	PASS
Band41	10MHz	QPSK	40620	1RB#0	1000~20000	-34.08	PASS
Band41	10MHz	QPSK	40620	1RB#0	20000~27000	-35.65	PASS
Band41	10MHz	16QAM	40620	1RB#0	0.009~0.15	-64.10	PASS
Band41	10MHz	16QAM	40620	1RB#0	0.15~30	-52.54	PASS
Band41	10MHz	16QAM	40620	1RB#0	30~1000	-53.13	PASS
Band41	10MHz	16QAM	40620	1RB#0	1000~20000	-34.07	PASS
Band41	10MHz	16QAM	40620	1RB#0	20000~27000	-35.75	PASS
Band41	10MHz	QPSK	41540	1RB#0	0.009~0.15	-63.45	PASS
Band41	10MHz	QPSK	41540	1RB#0	0.15~30	-53.50	PASS
Band41	10MHz	QPSK	41540	1RB#0	30~1000	-52.92	PASS
Band41	10MHz	QPSK	41540	1RB#0	1000~20000	-34.61	PASS
Band41	10MHz	QPSK	41540	1RB#0	20000~27000	-36.39	PASS
Band41	10MHz	16QAM	41540	1RB#0	0.009~0.15	-65.05	PASS
Band41	10MHz	16QAM	41540	1RB#0	0.15~30	-52.43	PASS
Band41	10MHz	16QAM	41540	1RB#0	30~1000	-40.73	PASS
Band41	10MHz	16QAM	41540	1RB#0	1000~20000	-33.52	PASS
Band41	10MHz	16QAM	41540	1RB#0	20000~27000	-35.48	PASS
Band41	15MHz	QPSK	39725	1RB#0	0.009~0.15	-64.16	PASS
Band41	15MHz	QPSK	39725	1RB#0	0.15~30	-54.25	PASS
Band41	15MHz	QPSK	39725	1RB#0	30~1000	-52.92	PASS
Band41	15MHz	QPSK	39725	1RB#0	1000~20000	-34.06	PASS
Band41	15MHz	QPSK	39725	1RB#0	20000~27000	-36.07	PASS
Band41	15MHz	16QAM	39725	1RB#0	0.009~0.15	-64.89	PASS
Band41	15MHz	16QAM	39725	1RB#0	0.15~30	-56.56	PASS
Band41	15MHz	16QAM	39725	1RB#0	30~1000	-52.82	PASS
Band41	15MHz	16QAM	39725	1RB#0	1000~20000	-34.75	PASS
Band41	15MHz	16QAM	39725	1RB#0	20000~27000	-35.94	PASS
Band41	15MHz	QPSK	40620	1RB#0	0.009~0.15	-64.86	PASS
Band41	15MHz	QPSK	40620	1RB#0	0.15~30	-51.16	PASS
Band41	15MHz	QPSK	40620	1RB#0	30~1000	-52.43	PASS
Band41	15MHz	QPSK	40620	1RB#0	1000~20000	-34.45	PASS






Band41	15MHz	QPSK	40620	1RB#0	20000~27000	-36.52	PASS
Band41	15MHz	16QAM	40620	1RB#0	0.009~0.15	-64.31	PASS
Band41	15MHz	16QAM	40620	1RB#0	0.15~30	-54.26	PASS
Band41	15MHz	16QAM	40620	1RB#0	30~1000	-53.32	PASS
Band41	15MHz	16QAM	40620	1RB#0	1000~20000	-34.80	PASS
Band41	15MHz	16QAM	40620	1RB#0	20000~27000	-36.12	PASS
Band41	15MHz	QPSK	41515	1RB#0	0.009~0.15	-65.82	PASS
Band41	15MHz	QPSK	41515	1RB#0	0.15~30	-53.29	PASS
Band41	15MHz	QPSK	41515	1RB#0	30~1000	-52.94	PASS
Band41	15MHz	QPSK	41515	1RB#0	1000~20000	-34.23	PASS
Band41	15MHz	QPSK	41515	1RB#0	20000~27000	-35.37	PASS
Band41	15MHz	16QAM	41515	1RB#0	0.009~0.15	-63.11	PASS
Band41	15MHz	16QAM	41515	1RB#0	0.15~30	-51.59	PASS
Band41	15MHz	16QAM	41515	1RB#0	30~1000	-52.22	PASS
Band41	15MHz	16QAM	41515	1RB#0	1000~20000	-33.71	PASS
Band41	15MHz	16QAM	41515	1RB#0	20000~27000	-36.37	PASS
Band41	20MHz	QPSK	39750	1RB#0	0.009~0.15	-64.67	PASS
Band41	20MHz	QPSK	39750	1RB#0	0.15~30	-52.62	PASS
Band41	20MHz	QPSK	39750	1RB#0	30~1000	-53.26	PASS
Band41	20MHz	QPSK	39750	1RB#0	1000~20000	-33.60	PASS
Band41	20MHz	QPSK	39750	1RB#0	20000~27000	-35.93	PASS
Band41	20MHz	16QAM	39750	1RB#0	0.009~0.15	-66.30	PASS
Band41	20MHz	16QAM	39750	1RB#0	0.15~30	-53.81	PASS
Band41	20MHz	16QAM	39750	1RB#0	30~1000	-52.74	PASS
Band41	20MHz	16QAM	39750	1RB#0	1000~20000	-35.00	PASS
Band41	20MHz	16QAM	39750	1RB#0	20000~27000	-36.49	PASS
Band41	20MHz	QPSK	40620	1RB#0	0.009~0.15	-64.38	PASS
Band41	20MHz	QPSK	40620	1RB#0	0.15~30	-51.42	PASS
Band41	20MHz	QPSK	40620	1RB#0	30~1000	-52.91	PASS
Band41	20MHz	QPSK	40620	1RB#0	1000~20000	-33.33	PASS
Band41	20MHz	QPSK	40620	1RB#0	20000~27000	-35.76	PASS
Band41	20MHz	16QAM	40620	1RB#0	0.009~0.15	-63.30	PASS
Band41	20MHz	16QAM	40620	1RB#0	0.15~30	-54.69	PASS
Band41	20MHz	16QAM	40620	1RB#0	30~1000	-52.73	PASS
Band41	20MHz	16QAM	40620	1RB#0	1000~20000	-34.54	PASS
Band41	20MHz	16QAM	40620	1RB#0	20000~27000	-36.32	PASS
Band41	20MHz	QPSK	41490	1RB#0	0.009~0.15	-65.73	PASS
Band41	20MHz	QPSK	41490	1RB#0	0.15~30	-54.41	PASS
Band41	20MHz	QPSK	41490	1RB#0	30~1000	-52.70	PASS
Band41	20MHz	QPSK	41490	1RB#0	1000~20000	-34.56	PASS






Band41	20MHz	QPSK	41490	1RB#0	20000~27000	-36.16	PASS
Band41	20MHz	16QAM	41490	1RB#0	0.009~0.15	-63.48	PASS
Band41	20MHz	16QAM	41490	1RB#0	0.15~30	-51.40	PASS
Band41	20MHz	16QAM	41490	1RB#0	30~1000	-52.37	PASS
Band41	20MHz	16QAM	41490	1RB#0	1000~20000	-29.77	PASS
Band41	20MHz	16QAM	41490	1RB#0	20000~27000	-35.93	PASS

Test Graphs

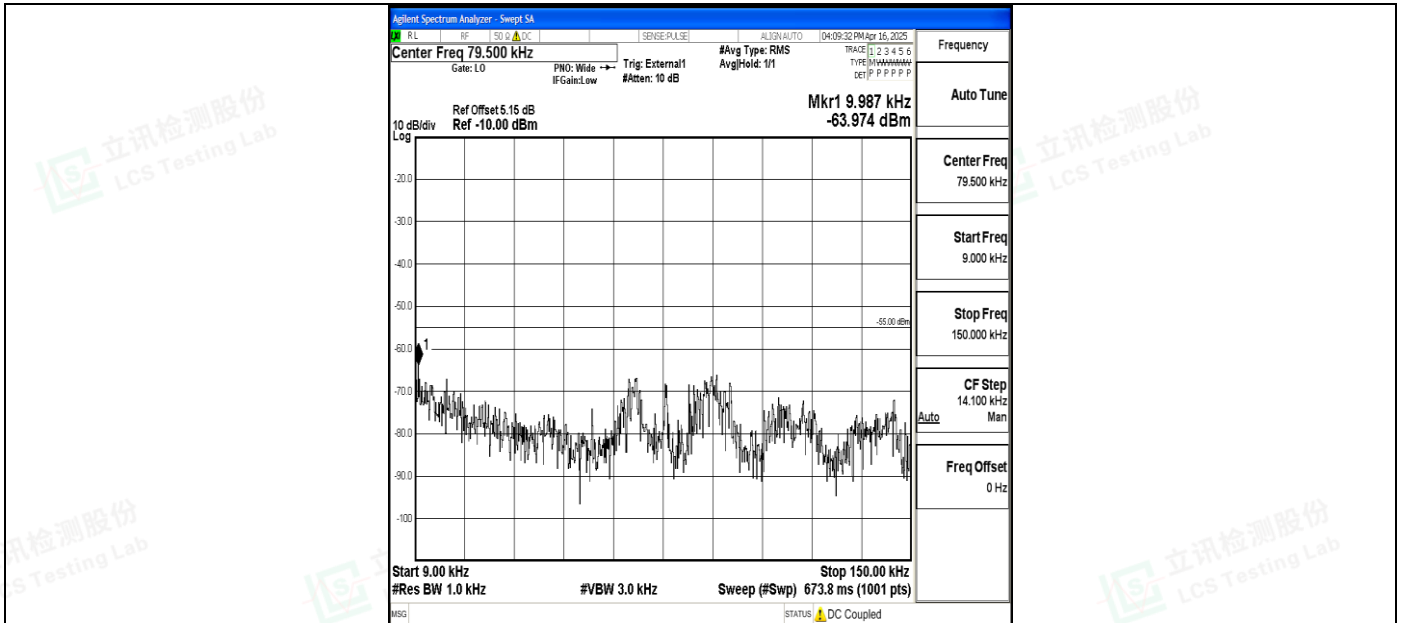

Band41_5MHz_QPSK_39675_1RB#0_0.009~0.15_0.009~0.15

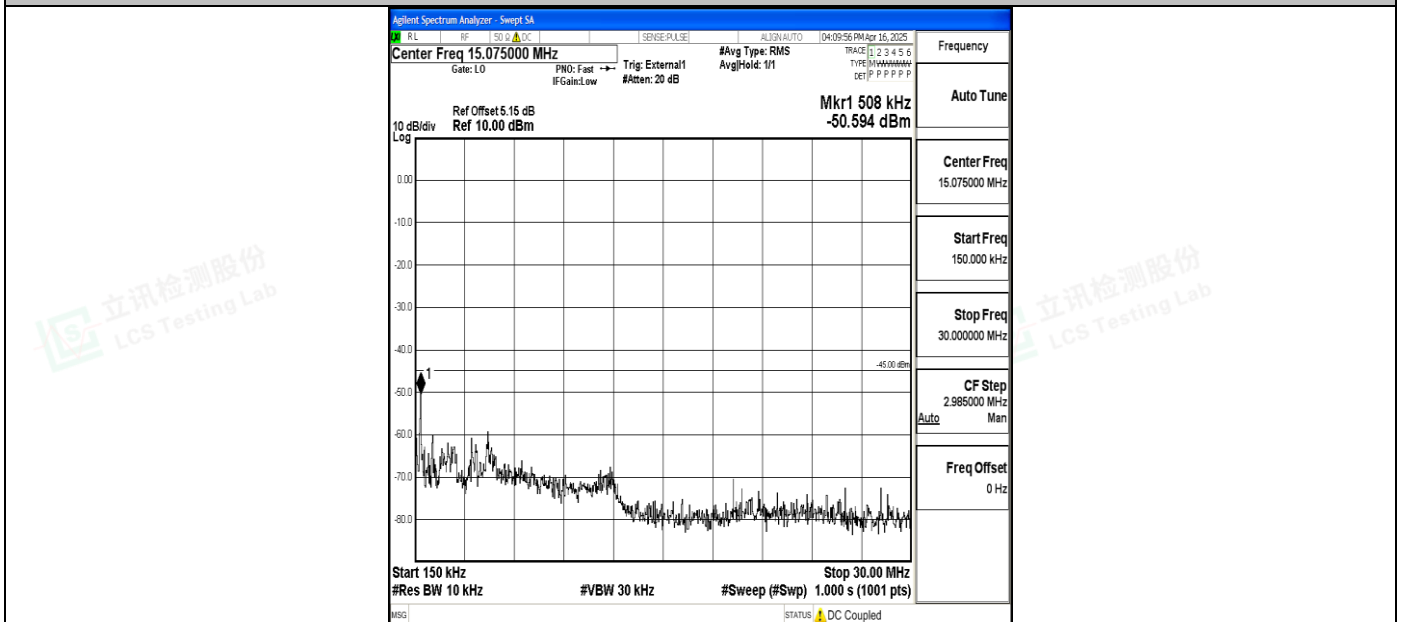

Band41_5MHz_QPSK_39675_1RB#0_0.15~30_0.15~30



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity