




Appendix M Test Data for E-UTRA Band 41

Product Name: GNSS Receiver

Test Model: T300 Plus

Environmental Conditions

Temperature:	23.5℃
Relative Humidity:	52.2%
ATM Pressure:	100.0 kPa
Test Engineer:	 Monkey Li
Supervised by:	 Li Huan



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



M.1 Effective (Isotropic) Radiated Power Output Data

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	22.26	PASS
Band41	5MHz	QPSK	39675	1RB#12	22.43	PASS
Band41	5MHz	QPSK	39675	1RB#24	22.25	PASS
Band41	5MHz	QPSK	39675	12RB#0	21.35	PASS
Band41	5MHz	QPSK	39675	12RB#6	21.33	PASS
Band41	5MHz	QPSK	39675	12RB#13	21.51	PASS
Band41	5MHz	QPSK	39675	25RB#0	21.42	PASS
Band41	5MHz	QPSK	40620	1RB#0	22.36	PASS
Band41	5MHz	QPSK	40620	1RB#12	22.53	PASS
Band41	5MHz	QPSK	40620	1RB#24	22.37	PASS
Band41	5MHz	QPSK	40620	12RB#0	21.60	PASS
Band41	5MHz	QPSK	40620	12RB#6	21.58	PASS
Band41	5MHz	QPSK	40620	12RB#13	21.54	PASS
Band41	5MHz	QPSK	40620	25RB#0	21.49	PASS
Band41	5MHz	QPSK	41565	1RB#0	23.02	PASS
Band41	5MHz	QPSK	41565	1RB#12	23.09	PASS
Band41	5MHz	QPSK	41565	1RB#24	22.95	PASS
Band41	5MHz	QPSK	41565	12RB#0	22.03	PASS
Band41	5MHz	QPSK	41565	12RB#6	22.11	PASS
Band41	5MHz	QPSK	41565	12RB#13	22.03	PASS
Band41	5MHz	QPSK	41565	25RB#0	21.98	PASS
Band41	5MHz	16QAM	39675	1RB#0	20.97	PASS
Band41	5MHz	16QAM	39675	1RB#12	20.98	PASS
Band41	5MHz	16QAM	39675	1RB#24	21.20	PASS
Band41	5MHz	16QAM	39675	12RB#0	20.34	PASS
Band41	5MHz	16QAM	39675	12RB#6	20.33	PASS
Band41	5MHz	16QAM	39675	12RB#13	20.41	PASS
Band41	5MHz	16QAM	39675	25RB#0	20.44	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Band41	5MHz	16QAM	40620	1RB#0	21.24	PASS
Band41	5MHz	16QAM	40620	1RB#12	21.28	PASS
Band41	5MHz	16QAM	40620	1RB#24	21.13	PASS
Band41	5MHz	16QAM	40620	12RB#0	20.50	PASS
Band41	5MHz	16QAM	40620	12RB#6	20.47	PASS
Band41	5MHz	16QAM	40620	12RB#13	20.55	PASS
Band41	5MHz	16QAM	40620	25RB#0	20.52	PASS
Band41	5MHz	16QAM	41565	1RB#0	21.75	PASS
Band41	5MHz	16QAM	41565	1RB#12	21.71	PASS
Band41	5MHz	16QAM	41565	1RB#24	21.81	PASS
Band41	5MHz	16QAM	41565	12RB#0	21.06	PASS
Band41	5MHz	16QAM	41565	12RB#6	21.04	PASS
Band41	5MHz	16QAM	41565	12RB#13	20.97	PASS
Band41	5MHz	16QAM	41565	25RB#0	21.13	PASS
Band41	10MHz	QPSK	39700	1RB#0	22.09	PASS
Band41	10MHz	QPSK	39700	1RB#24	22.22	PASS
Band41	10MHz	QPSK	39700	1RB#49	22.24	PASS
Band41	10MHz	QPSK	39700	25RB#0	21.43	PASS
Band41	10MHz	QPSK	39700	25RB#12	21.42	PASS
Band41	10MHz	QPSK	39700	25RB#25	21.42	PASS
Band41	10MHz	QPSK	39700	50RB#0	21.51	PASS
Band41	10MHz	QPSK	40620	1RB#0	22.17	PASS
Band41	10MHz	QPSK	40620	1RB#24	22.38	PASS
Band41	10MHz	QPSK	40620	1RB#49	22.19	PASS
Band41	10MHz	QPSK	40620	25RB#0	21.54	PASS
Band41	10MHz	QPSK	40620	25RB#12	21.52	PASS
Band41	10MHz	QPSK	40620	25RB#25	21.55	PASS
Band41	10MHz	QPSK	40620	50RB#0	21.57	PASS
Band41	10MHz	QPSK	41540	1RB#0	22.90	PASS
Band41	10MHz	QPSK	41540	1RB#24	23.12	PASS
Band41	10MHz	QPSK	41540	1RB#49	22.92	PASS
Band41	10MHz	QPSK	41540	25RB#0	22.23	PASS
Band41	10MHz	QPSK	41540	25RB#12	22.21	PASS
Band41	10MHz	QPSK	41540	25RB#25	22.07	PASS
Band41	10MHz	QPSK	41540	50RB#0	22.17	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	10MHz	16QAM	39700	1RB#0	21.08	PASS
Band41	10MHz	16QAM	39700	1RB#24	21.48	PASS
Band41	10MHz	16QAM	39700	1RB#49	21.26	PASS
Band41	10MHz	16QAM	39700	25RB#0	20.30	PASS
Band41	10MHz	16QAM	39700	25RB#12	20.39	PASS
Band41	10MHz	16QAM	39700	25RB#25	20.21	PASS
Band41	10MHz	16QAM	39700	50RB#0	20.33	PASS
Band41	10MHz	16QAM	40620	1RB#0	21.29	PASS
Band41	10MHz	16QAM	40620	1RB#24	21.49	PASS
Band41	10MHz	16QAM	40620	1RB#49	21.24	PASS
Band41	10MHz	16QAM	40620	25RB#0	20.42	PASS
Band41	10MHz	16QAM	40620	25RB#12	20.40	PASS
Band41	10MHz	16QAM	40620	25RB#25	20.45	PASS
Band41	10MHz	16QAM	40620	50RB#0	20.58	PASS
Band41	10MHz	16QAM	41540	1RB#0	21.94	PASS
Band41	10MHz	16QAM	41540	1RB#24	21.99	PASS
Band41	10MHz	16QAM	41540	1RB#49	21.89	PASS
Band41	10MHz	16QAM	41540	25RB#0	21.14	PASS
Band41	10MHz	16QAM	41540	25RB#12	21.22	PASS
Band41	10MHz	16QAM	41540	25RB#25	20.96	PASS
Band41	10MHz	16QAM	41540	50RB#0	21.24	PASS
Band41	15MHz	QPSK	39725	1RB#0	21.96	PASS
Band41	15MHz	QPSK	39725	1RB#38	22.41	PASS
Band41	15MHz	QPSK	39725	1RB#74	22.47	PASS
Band41	15MHz	QPSK	39725	38RB#0	21.00	PASS
Band41	15MHz	QPSK	39725	38RB#18	21.71	PASS
Band41	15MHz	QPSK	39725	38RB#37	21.81	PASS
Band41	15MHz	QPSK	39725	75RB#0	21.38	PASS
Band41	15MHz	QPSK	40620	1RB#0	22.28	PASS
Band41	15MHz	QPSK	40620	1RB#38	22.43	PASS
Band41	15MHz	QPSK	40620	1RB#74	22.49	PASS
Band41	15MHz	QPSK	40620	38RB#0	21.89	PASS
Band41	15MHz	QPSK	40620	38RB#18	22.04	PASS
Band41	15MHz	QPSK	40620	38RB#37	21.33	PASS
Band41	15MHz	QPSK	40620	75RB#0	21.52	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	15MHz	QPSK	41515	1RB#0	22.96	PASS
Band41	15MHz	QPSK	41515	1RB#38	22.97	PASS
Band41	15MHz	QPSK	41515	1RB#74	23.05	PASS
Band41	15MHz	QPSK	41515	38RB#0	21.90	PASS
Band41	15MHz	QPSK	41515	38RB#18	21.91	PASS
Band41	15MHz	QPSK	41515	38RB#37	21.76	PASS
Band41	15MHz	QPSK	41515	75RB#0	22.11	PASS
Band41	15MHz	16QAM	39725	1RB#0	21.56	PASS
Band41	15MHz	16QAM	39725	1RB#38	21.70	PASS
Band41	15MHz	16QAM	39725	1RB#74	21.35	PASS
Band41	15MHz	16QAM	39725	38RB#0	21.52	PASS
Band41	15MHz	16QAM	39725	38RB#18	22.19	PASS
Band41	15MHz	16QAM	39725	38RB#37	21.87	PASS
Band41	15MHz	16QAM	39725	75RB#0	20.42	PASS
Band41	15MHz	16QAM	40620	1RB#0	21.15	PASS
Band41	15MHz	16QAM	40620	1RB#38	22.36	PASS
Band41	15MHz	16QAM	40620	1RB#74	21.83	PASS
Band41	15MHz	16QAM	40620	38RB#0	21.80	PASS
Band41	15MHz	16QAM	40620	38RB#18	21.97	PASS
Band41	15MHz	16QAM	40620	38RB#37	21.77	PASS
Band41	15MHz	16QAM	40620	75RB#0	20.57	PASS
Band41	15MHz	16QAM	41515	1RB#0	21.96	PASS
Band41	15MHz	16QAM	41515	1RB#38	22.51	PASS
Band41	15MHz	16QAM	41515	1RB#74	21.87	PASS
Band41	15MHz	16QAM	41515	38RB#0	21.96	PASS
Band41	15MHz	16QAM	41515	38RB#18	21.92	PASS
Band41	15MHz	16QAM	41515	38RB#37	22.42	PASS
Band41	15MHz	16QAM	41515	75RB#0	21.13	PASS
Band41	20MHz	QPSK	39750	1RB#0	22.03	PASS
Band41	20MHz	QPSK	39750	1RB#49	22.25	PASS
Band41	20MHz	QPSK	39750	1RB#99	22.06	PASS
Band41	20MHz	QPSK	39750	50RB#0	21.35	PASS
Band41	20MHz	QPSK	39750	50RB#25	21.32	PASS
Band41	20MHz	QPSK	39750	50RB#50	21.44	PASS
Band41	20MHz	QPSK	39750	100RB#0	21.43	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	20MHz	QPSK	40620	1RB#0	22.31	PASS
Band41	20MHz	QPSK	40620	1RB#49	22.70	PASS
Band41	20MHz	QPSK	40620	1RB#99	22.12	PASS
Band41	20MHz	QPSK	40620	50RB#0	21.50	PASS
Band41	20MHz	QPSK	40620	50RB#25	21.51	PASS
Band41	20MHz	QPSK	40620	50RB#50	21.50	PASS
Band41	20MHz	QPSK	40620	100RB#0	21.50	PASS
Band41	20MHz	QPSK	41490	1RB#0	22.90	PASS
Band41	20MHz	QPSK	41490	1RB#49	23.08	PASS
Band41	20MHz	QPSK	41490	1RB#99	22.78	PASS
Band41	20MHz	QPSK	41490	50RB#0	22.19	PASS
Band41	20MHz	QPSK	41490	50RB#25	22.16	PASS
Band41	20MHz	QPSK	41490	50RB#50	22.17	PASS
Band41	20MHz	QPSK	41490	100RB#0	22.19	PASS
Band41	20MHz	16QAM	39750	1RB#0	20.93	PASS
Band41	20MHz	16QAM	39750	1RB#49	21.26	PASS
Band41	20MHz	16QAM	39750	1RB#99	21.66	PASS
Band41	20MHz	16QAM	39750	50RB#0	20.42	PASS
Band41	20MHz	16QAM	39750	50RB#25	20.41	PASS
Band41	20MHz	16QAM	39750	50RB#50	20.42	PASS
Band41	20MHz	16QAM	39750	100RB#0	20.36	PASS
Band41	20MHz	16QAM	40620	1RB#0	21.82	PASS
Band41	20MHz	16QAM	40620	1RB#49	21.70	PASS
Band41	20MHz	16QAM	40620	1RB#99	21.74	PASS
Band41	20MHz	16QAM	40620	50RB#0	20.56	PASS
Band41	20MHz	16QAM	40620	50RB#25	20.60	PASS
Band41	20MHz	16QAM	40620	50RB#50	20.60	PASS
Band41	20MHz	16QAM	40620	100RB#0	20.56	PASS
Band41	20MHz	16QAM	41490	1RB#0	21.73	PASS
Band41	20MHz	16QAM	41490	1RB#49	21.98	PASS
Band41	20MHz	16QAM	41490	1RB#99	22.24	PASS
Band41	20MHz	16QAM	41490	50RB#0	21.30	PASS
Band41	20MHz	16QAM	41490	50RB#25	21.28	PASS
Band41	20MHz	16QAM	41490	50RB#50	21.26	PASS
Band41	20MHz	16QAM	41490	100RB#0	21.10	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



M.2 Peak-to-Average Ratio(CCDF)

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dB)	Limit(dB)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	4.86	13	PASS
Band41	5MHz	QPSK	39675	25RB#0	5.17	13	PASS
Band41	5MHz	QPSK	40620	1RB#0	4.92	13	PASS
Band41	5MHz	QPSK	40620	25RB#0	5.11	13	PASS
Band41	5MHz	QPSK	41565	1RB#0	4.80	13	PASS
Band41	5MHz	QPSK	41565	25RB#0	5.18	13	PASS
Band41	5MHz	16QAM	39675	1RB#0	6.13	13	PASS
Band41	5MHz	16QAM	39675	25RB#0	6.05	13	PASS
Band41	5MHz	16QAM	40620	1RB#0	5.86	13	PASS
Band41	5MHz	16QAM	40620	25RB#0	6.00	13	PASS
Band41	5MHz	16QAM	41565	1RB#0	6.14	13	PASS
Band41	5MHz	16QAM	41565	25RB#0	6.26	13	PASS
Band41	10MHz	QPSK	39700	1RB#0	4.66	13	PASS
Band41	10MHz	QPSK	39700	50RB#0	5.09	13	PASS
Band41	10MHz	QPSK	40620	1RB#0	5.17	13	PASS
Band41	10MHz	QPSK	40620	50RB#0	5.05	13	PASS
Band41	10MHz	QPSK	41540	1RB#0	5.10	13	PASS
Band41	10MHz	QPSK	41540	50RB#0	5.08	13	PASS
Band41	10MHz	16QAM	39700	1RB#0	5.95	13	PASS
Band41	10MHz	16QAM	39700	50RB#0	5.95	13	PASS
Band41	10MHz	16QAM	40620	1RB#0	5.80	13	PASS
Band41	10MHz	16QAM	40620	50RB#0	5.91	13	PASS
Band41	10MHz	16QAM	41540	1RB#0	5.88	13	PASS
Band41	10MHz	16QAM	41540	50RB#0	5.96	13	PASS
Band41	15MHz	QPSK	39725	1RB#0	4.89	13	PASS
Band41	15MHz	QPSK	39725	75RB#0	5.29	13	PASS
Band41	15MHz	QPSK	40620	1RB#0	4.76	13	PASS
Band41	15MHz	QPSK	40620	75RB#0	5.23	13	PASS
Band41	15MHz	QPSK	41515	1RB#0	5.12	13	PASS
Band41	15MHz	QPSK	41515	75RB#0	5.25	13	PASS
Band41	15MHz	16QAM	39725	1RB#0	5.95	13	PASS
Band41	15MHz	16QAM	39725	75RB#0	6.03	13	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Band41	15MHz	16QAM	40620	1RB#0	5.98	13	PASS
Band41	15MHz	16QAM	40620	75RB#0	5.99	13	PASS
Band41	15MHz	16QAM	41515	1RB#0	6.00	13	PASS
Band41	15MHz	16QAM	41515	75RB#0	6.00	13	PASS
Band41	20MHz	QPSK	39750	1RB#0	4.93	13	PASS
Band41	20MHz	QPSK	39750	100RB#0	5.09	13	PASS
Band41	20MHz	QPSK	40620	1RB#0	4.67	13	PASS
Band41	20MHz	QPSK	40620	100RB#0	5.02	13	PASS
Band41	20MHz	QPSK	41490	1RB#0	4.93	13	PASS
Band41	20MHz	QPSK	41490	100RB#0	5.06	13	PASS
Band41	20MHz	16QAM	39750	1RB#0	5.84	13	PASS
Band41	20MHz	16QAM	39750	100RB#0	5.93	13	PASS
Band41	20MHz	16QAM	40620	1RB#0	5.80	13	PASS
Band41	20MHz	16QAM	40620	100RB#0	5.93	13	PASS
Band41	20MHz	16QAM	41490	1RB#0	5.78	13	PASS
Band41	20MHz	16QAM	41490	100RB#0	5.92	13	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen,
518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



立讯检测股份
LCS Testing Lab


Test Graphs

立讯检测股份
LCS Testing Lab


立讯检测股份
LCS Testing Lab

立讯检测股份
LCS Testing Lab

Band41-5MHz-QPSK-39675-1RB#0

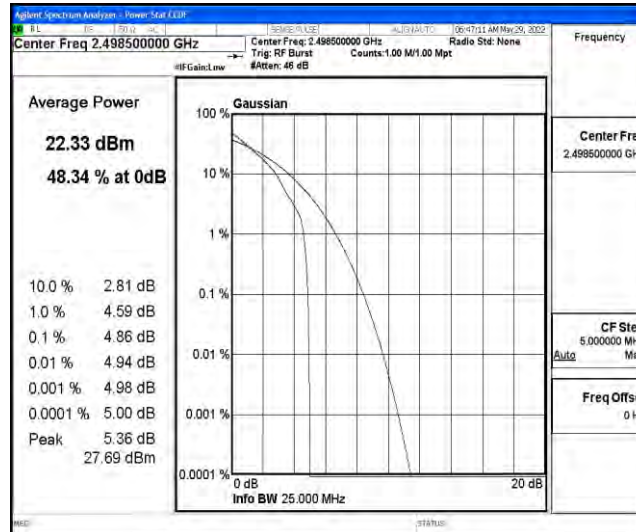

Band41-5MHz-QPSK-39675-25RB#0

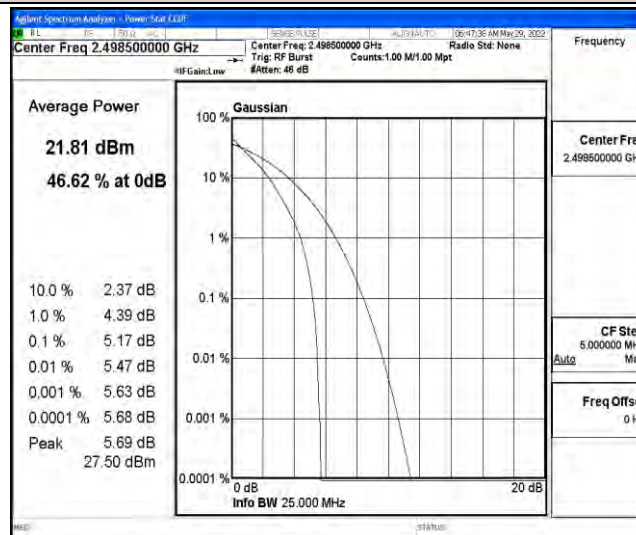

Band41-5MHz-QPSK-40620-1RB#0

立讯检测股份
LCS Testing Lab


立讯检测股份
LCS Testing Lab

立讯检测股份
LCS Testing Lab


立讯检测股份
LCS Testing Lab




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

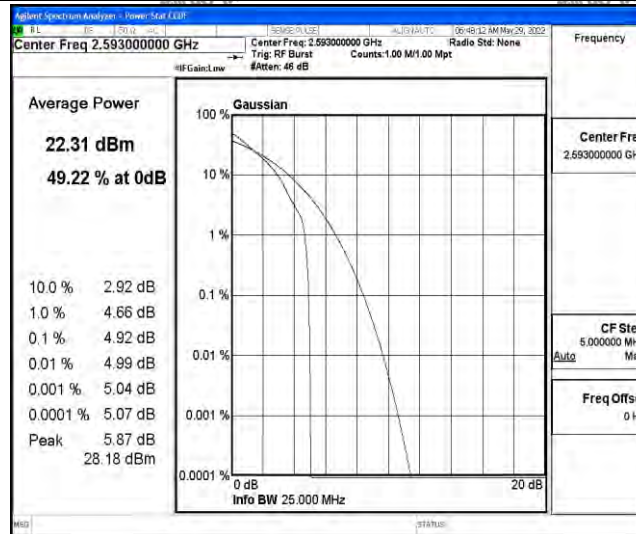

Band41-5MHz-QPSK-40620-25RB#0

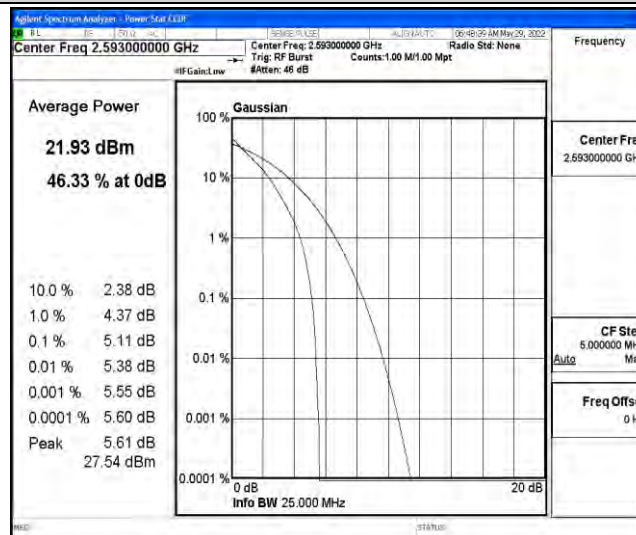


Band41-5MHz-QPSK-41565-1RB#0

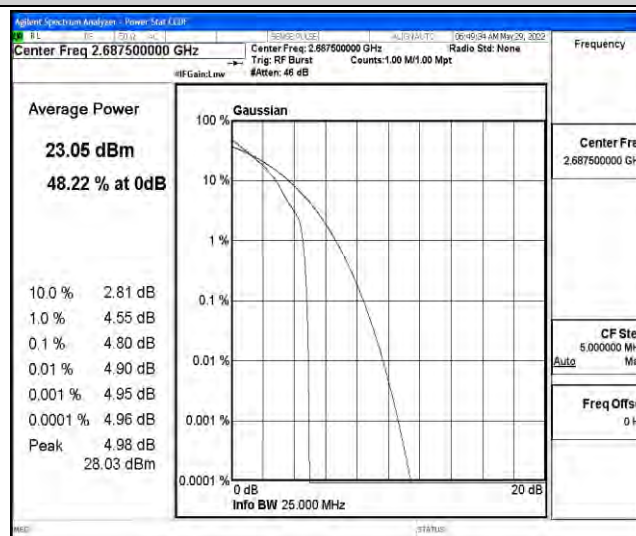




Band41-5MHz-QPSK-41565-25RB#0

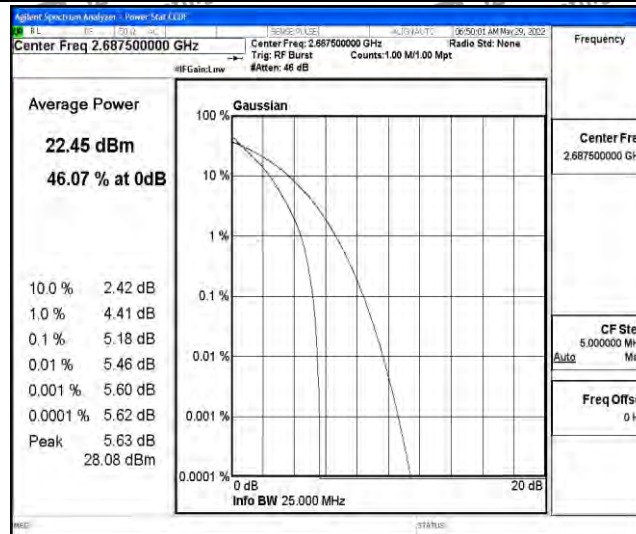


Band41-5MHz-16QAM-39675-1RB#0

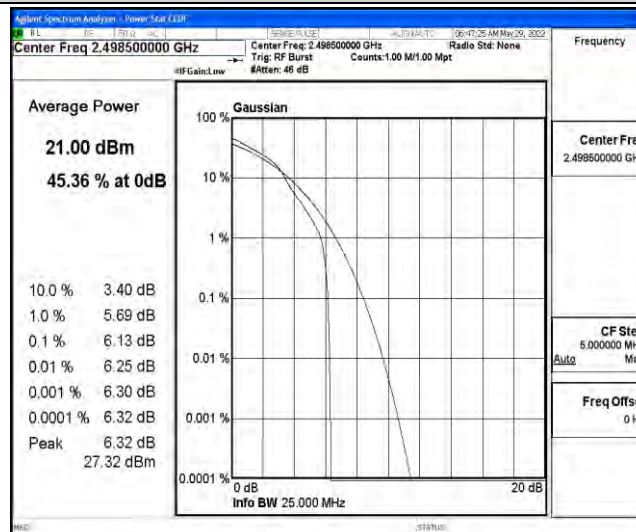


Band41-5MHz-16QAM-39675-25RB#0




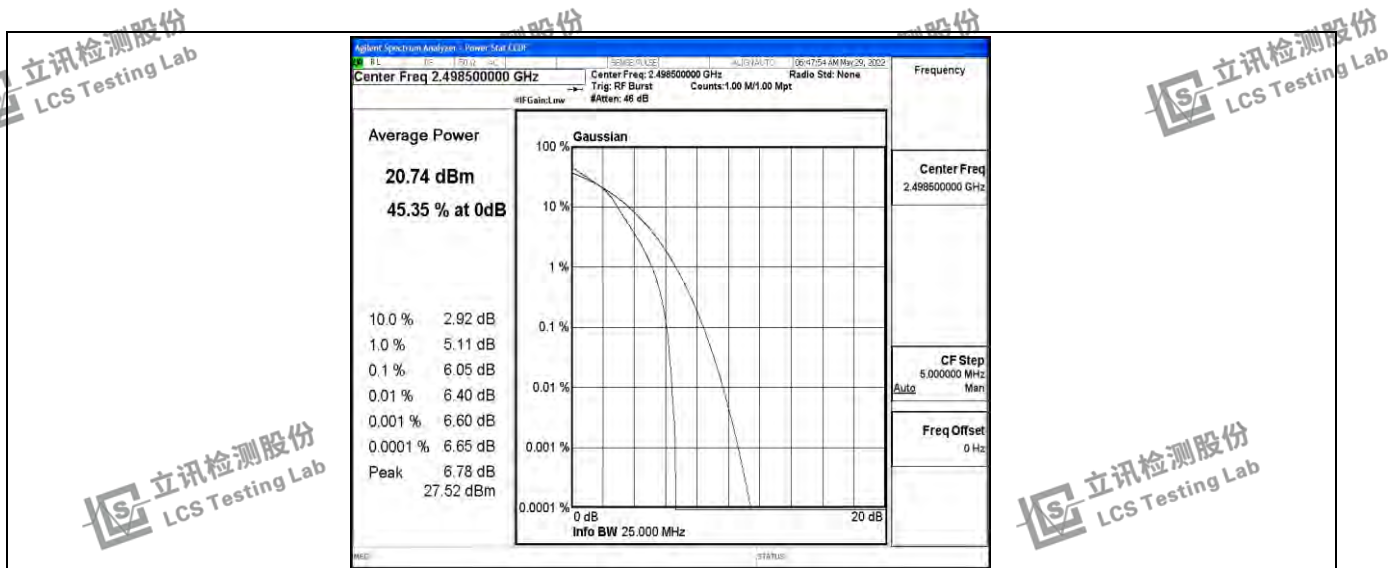

Band41-5MHz-16QAM-40620-1RB#0

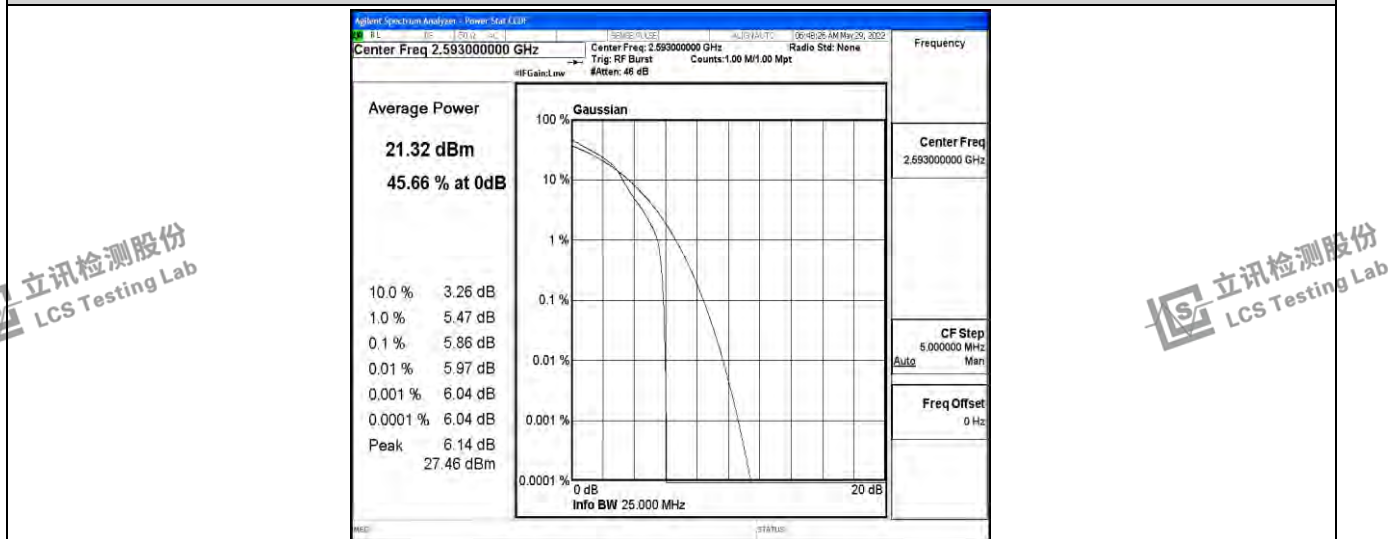


Band41-5MHz-16QAM-40620-25RB#0

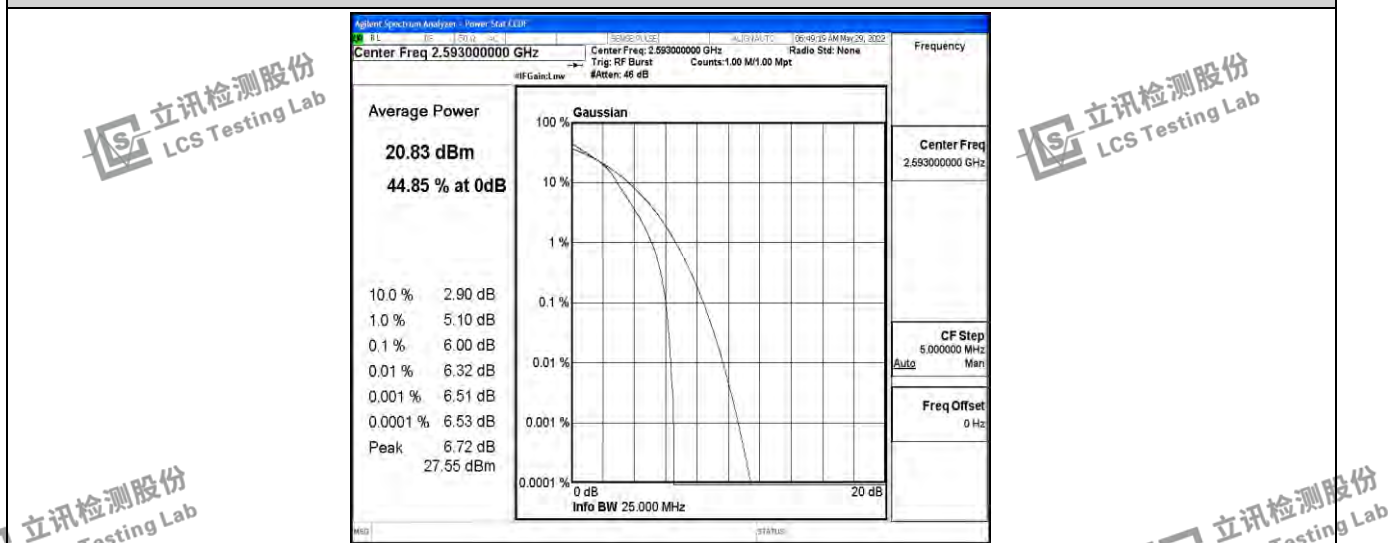




Band41-5MHz-16QAM-41565-1RB#0

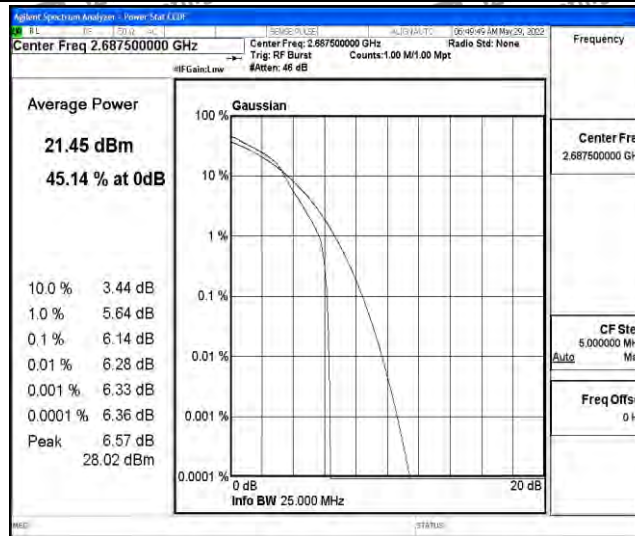


Band41-5MHz-16QAM-41565-25RB#0

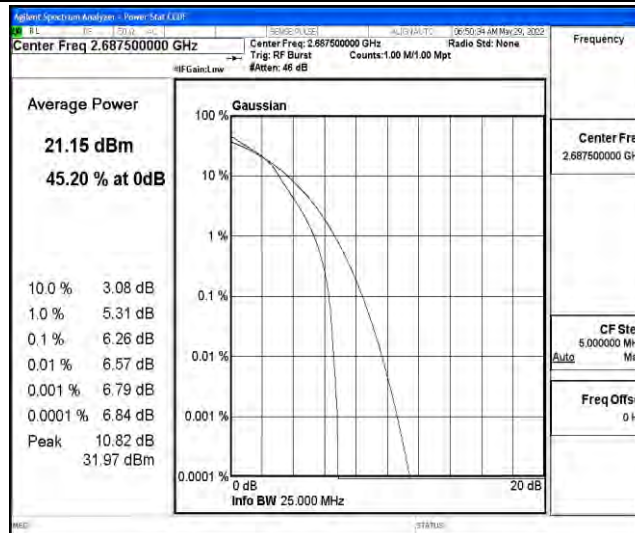


Band41-10MHz-QPSK-39700-1RB#0




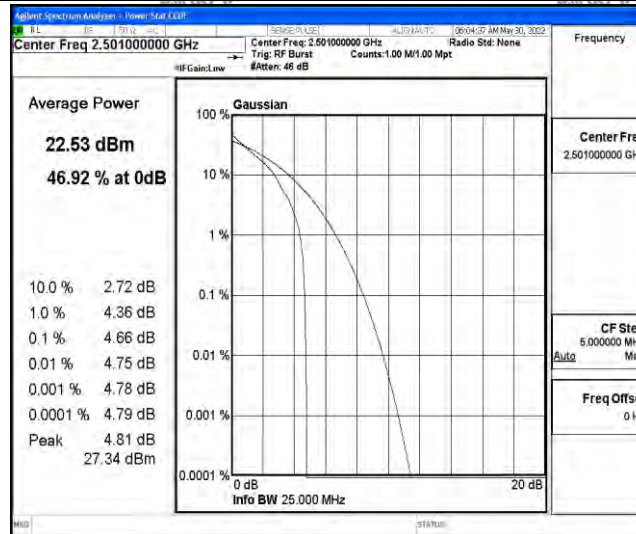

Band41-10MHz-QPSK-39700-50RB#0

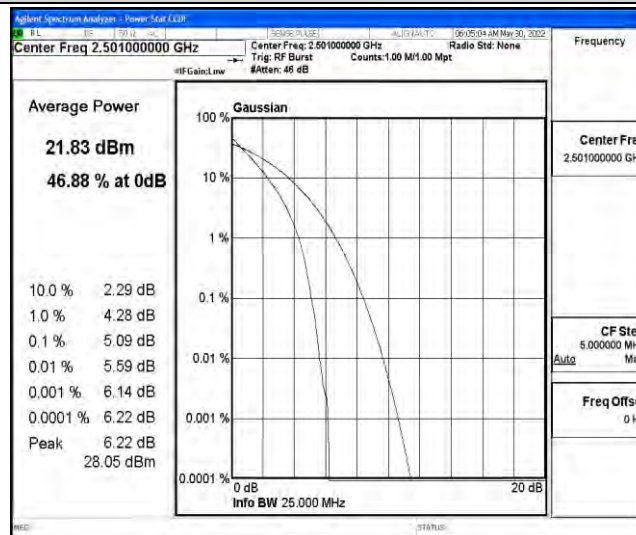


Band41-10MHz-QPSK-40620-1RB#0

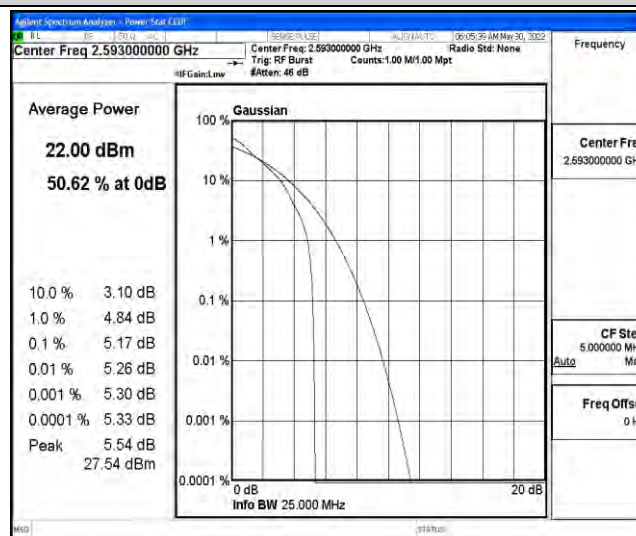




Band41-10MHz-QPSK-40620-50RB#0

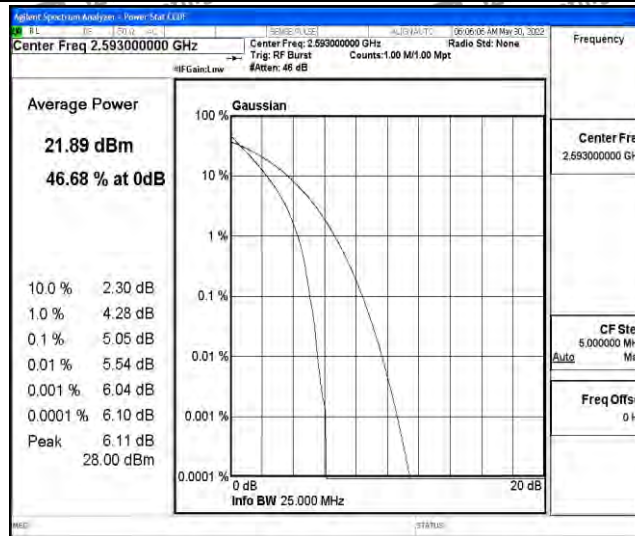


Band41-10MHz-QPSK-41540-1RB#0

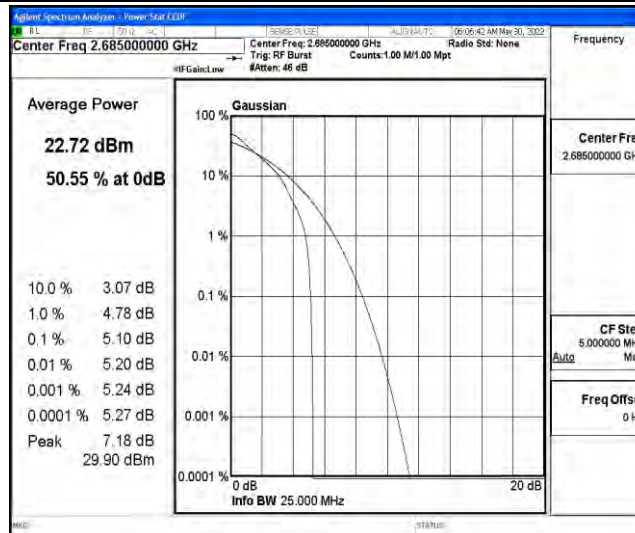


Band41-10MHz-QPSK-41540-50RB#0




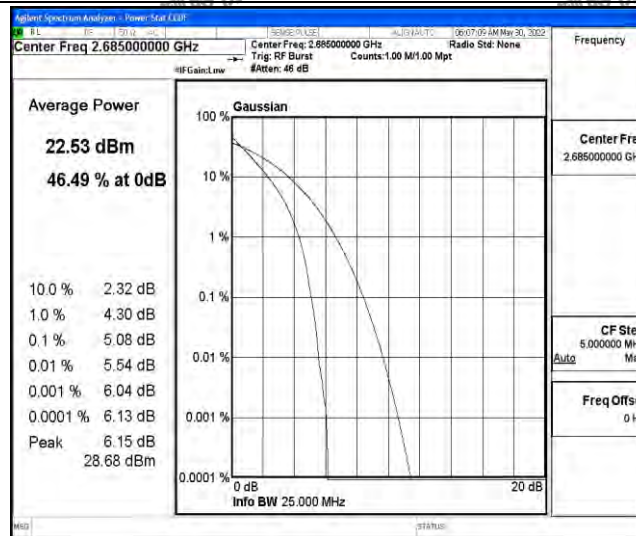

Band41-10MHz-16QAM-39700-1RB#0

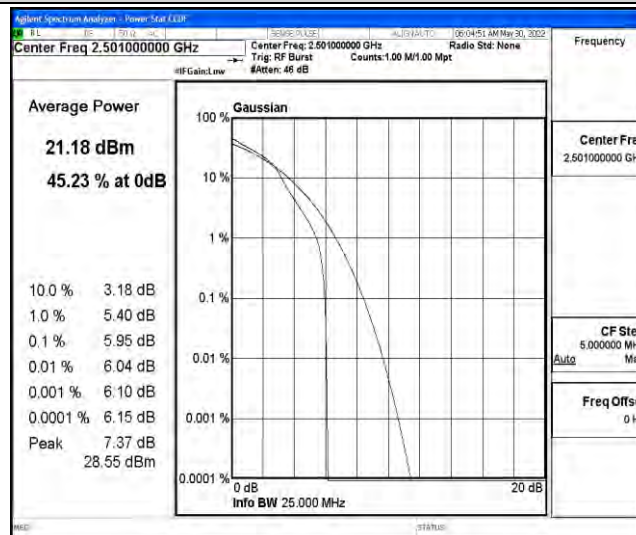


Band41-10MHz-16QAM-39700-50RB#0

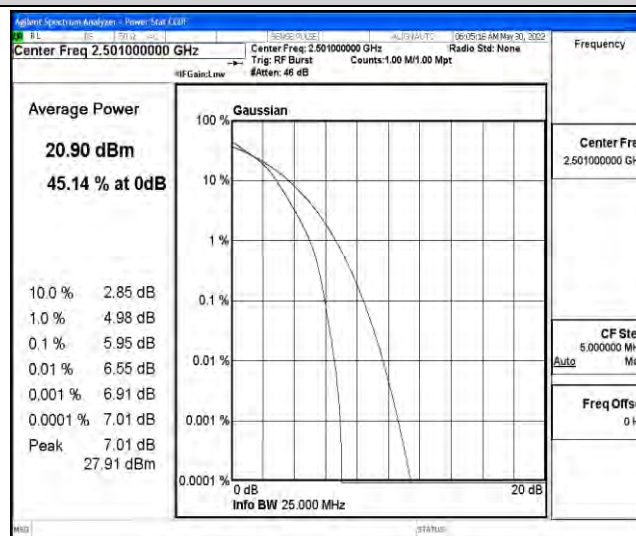




Band41-10MHz-16QAM-40620-1RB#0

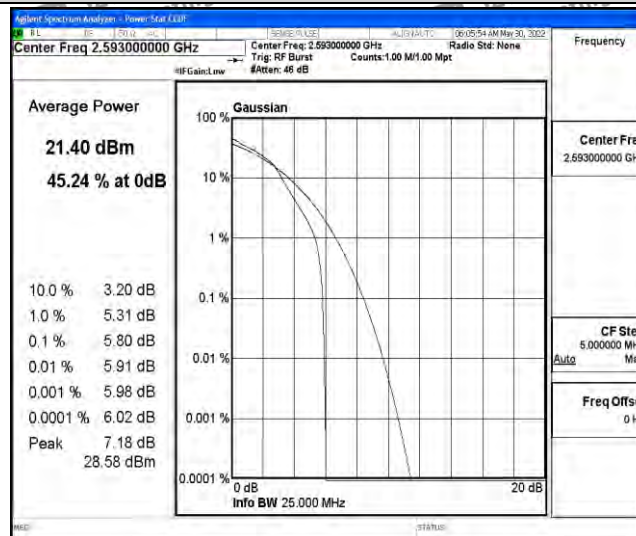


Band41-10MHz-16QAM-40620-50RB#0

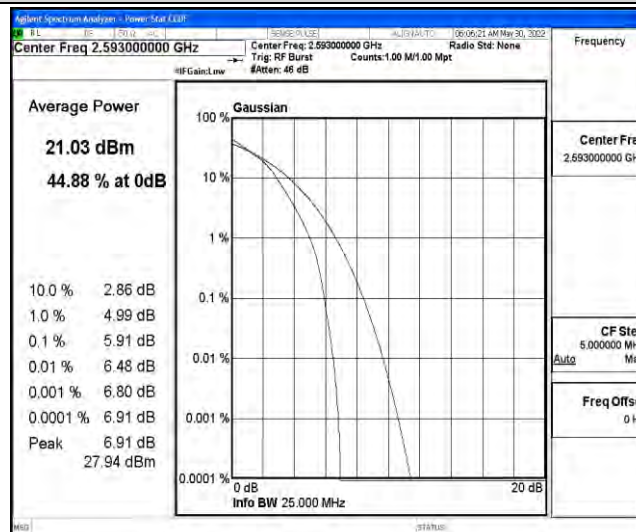


Band41-10MHz-16QAM-41540-1RB#0




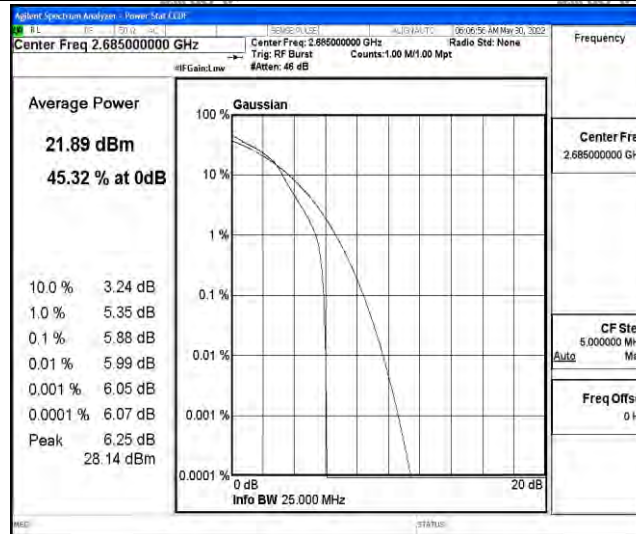

Band41-10MHz-16QAM-41540-50RB#0

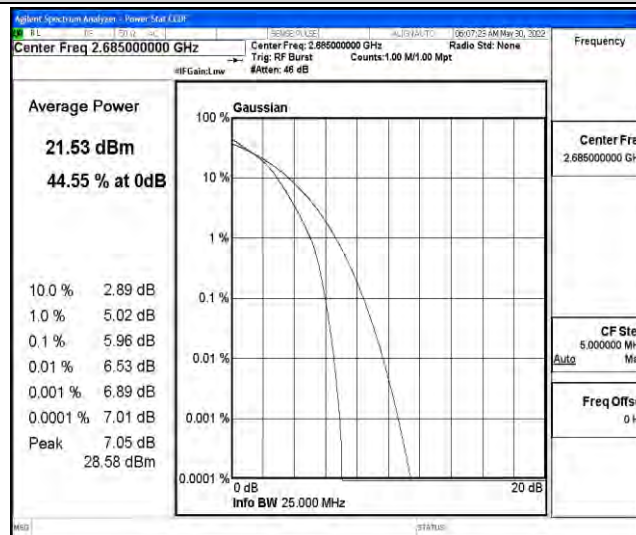


Band41-15MHz-QPSK-39725-1RB#0

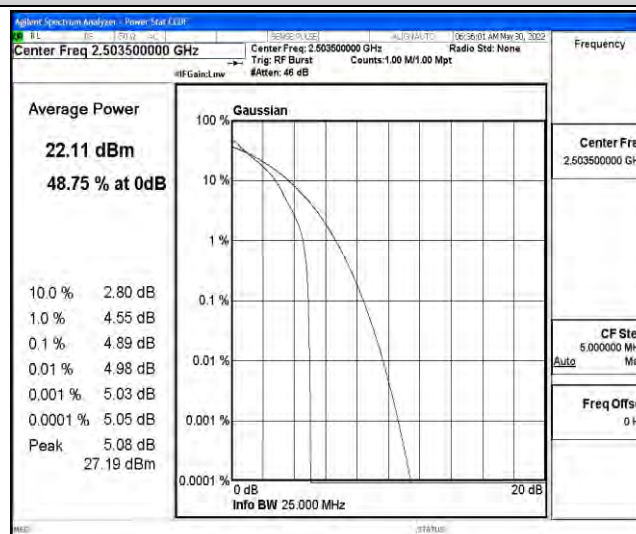




Band41-15MHz-QPSK-39725-75RB#0

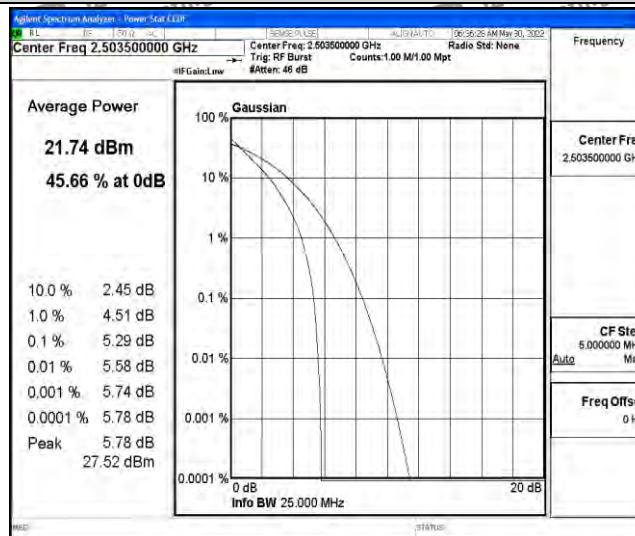


Band41-15MHz-QPSK-40620-1RB#0

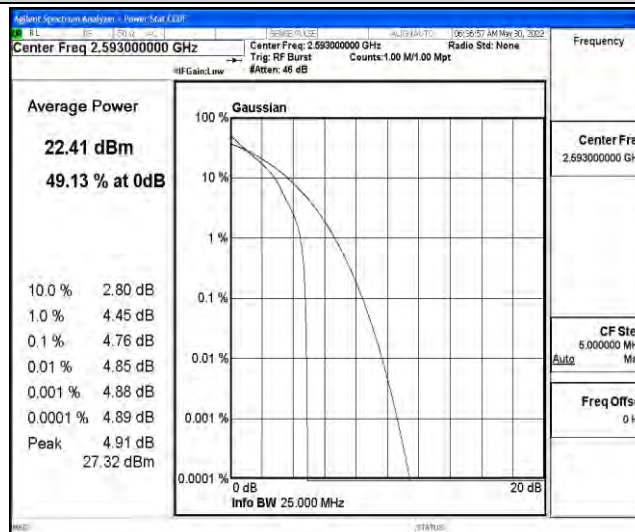


Band41-15MHz-QPSK-40620-75RB#0




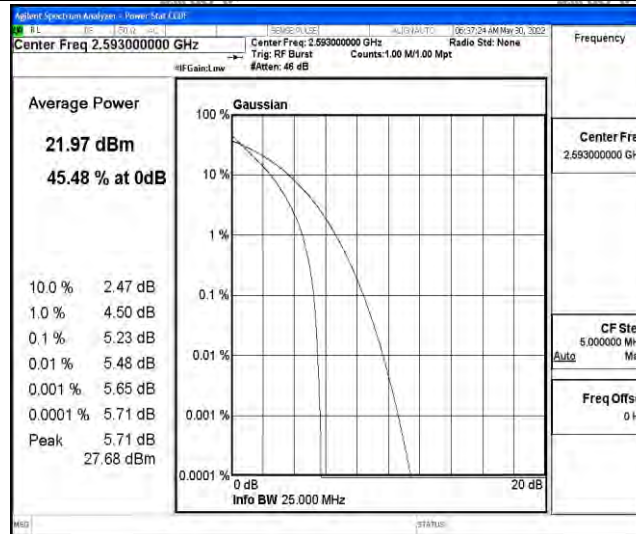

Band41-15MHz-QPSK-41515-1RB#0

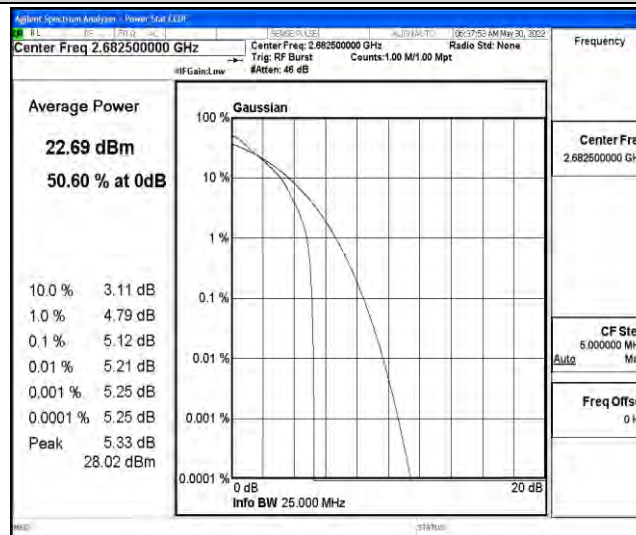


Band41-15MHz-QPSK-41515-75RB#0

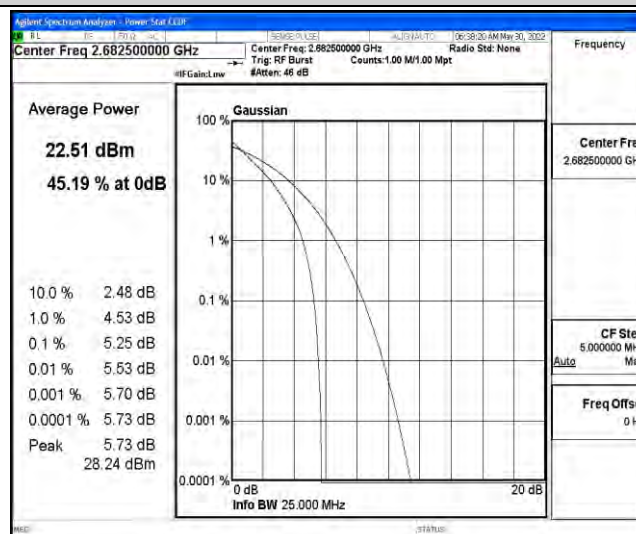




Band41-15MHz-16QAM-39725-1RB#0

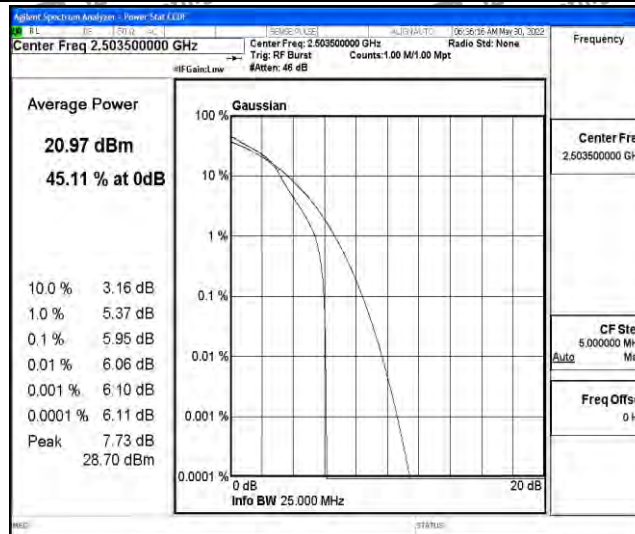


Band41-15MHz-16QAM-39725-75RB#0

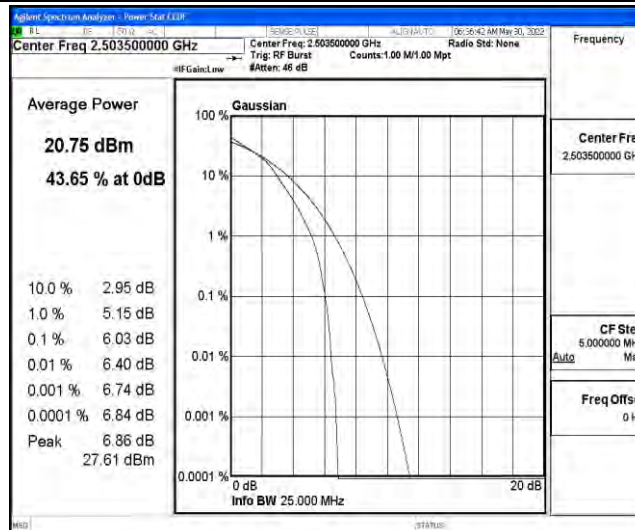


Band41-15MHz-16QAM-40620-1RB#0




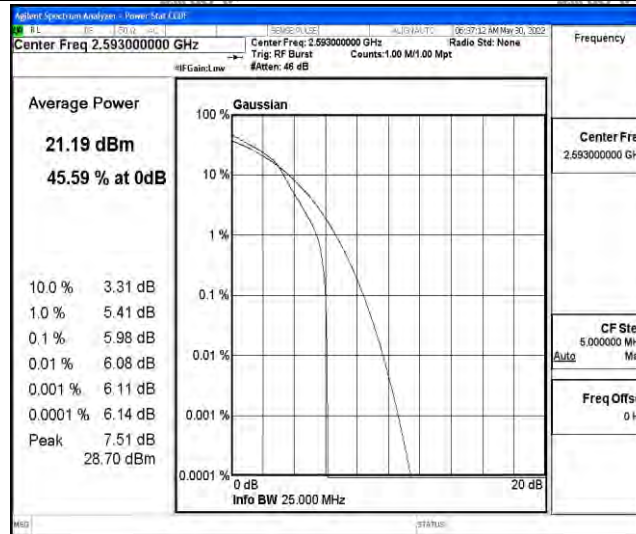

Band41-15MHz-16QAM-40620-75RB#0

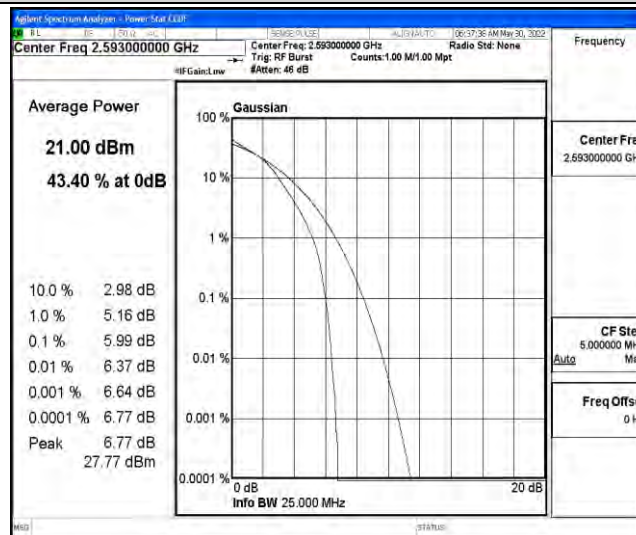


Band41-15MHz-16QAM-41515-1RB#0

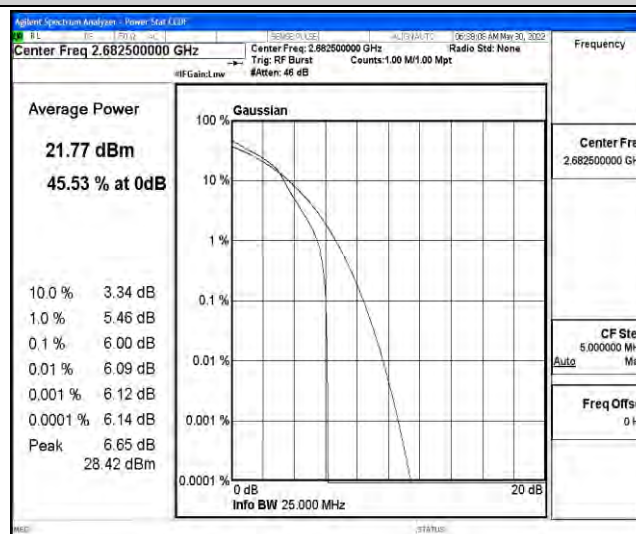




Band41-15MHz-16QAM-41515-75RB#0

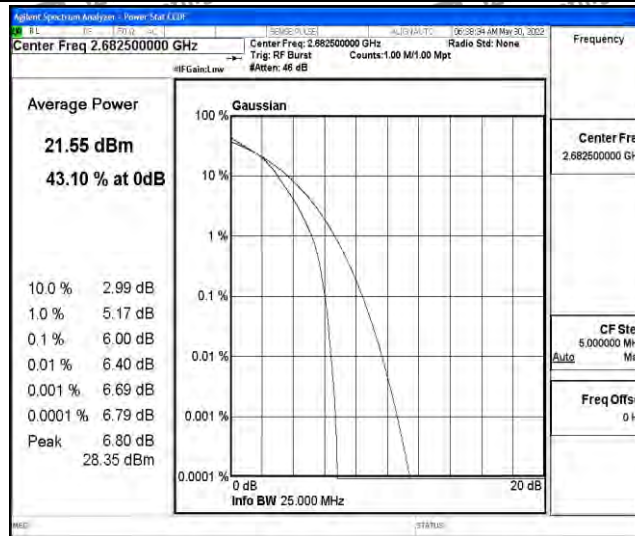


Band41-20MHz-QPSK-39750-1RB#0

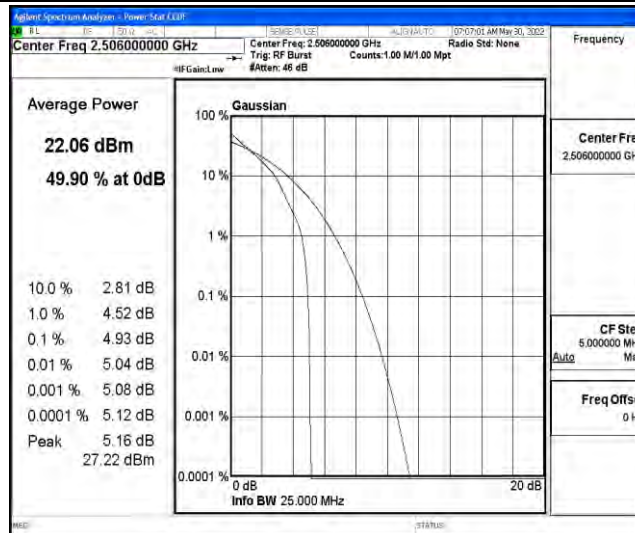


Band41-20MHz-QPSK-39750-100RB#0




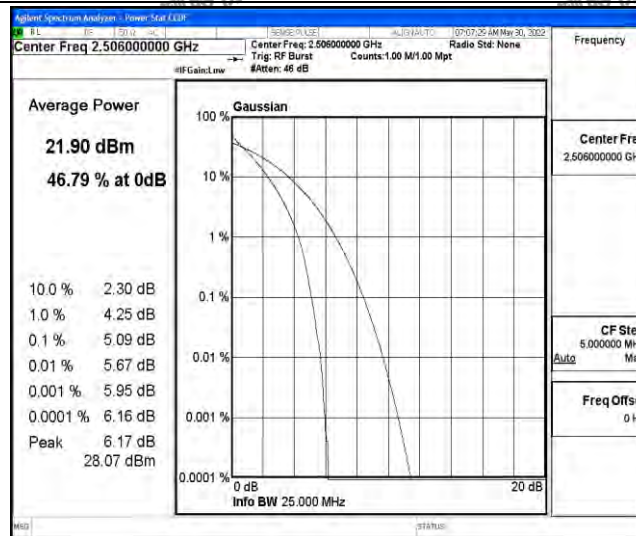

Band41-20MHz-QPSK-40620-1RB#0

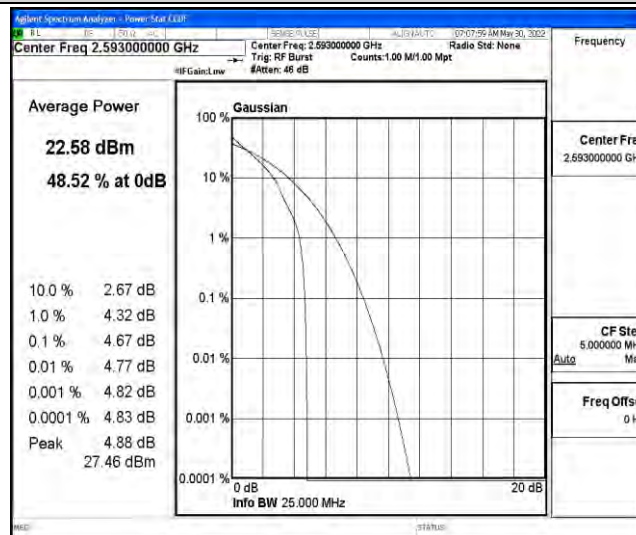


Band41-20MHz-QPSK-40620-100RB#0

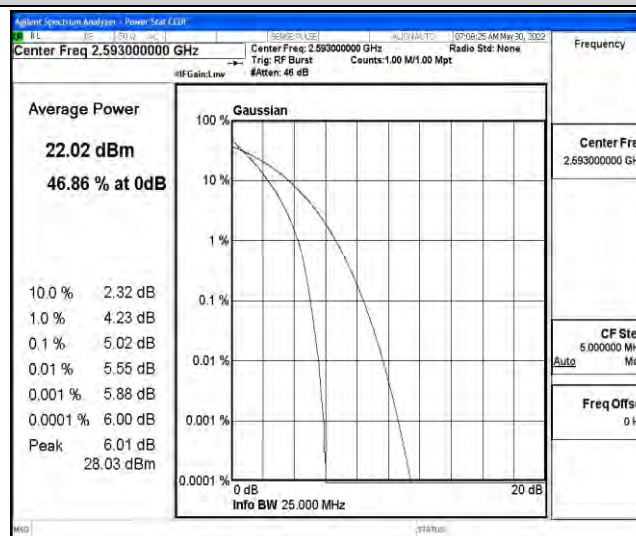




Band41-20MHz-QPSK-41490-1RB#0

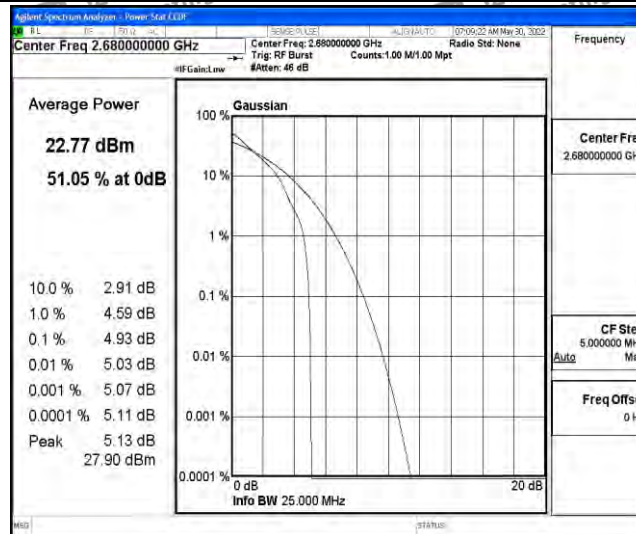


Band41-20MHz-QPSK-41490-100RB#0

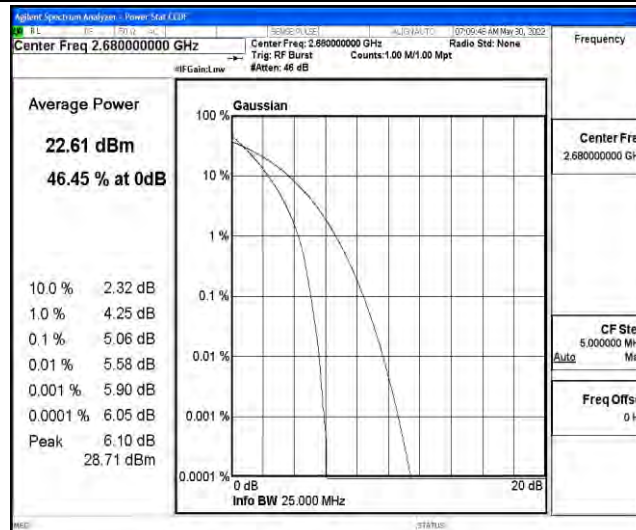


Band41-20MHz-16QAM-39750-1RB#0




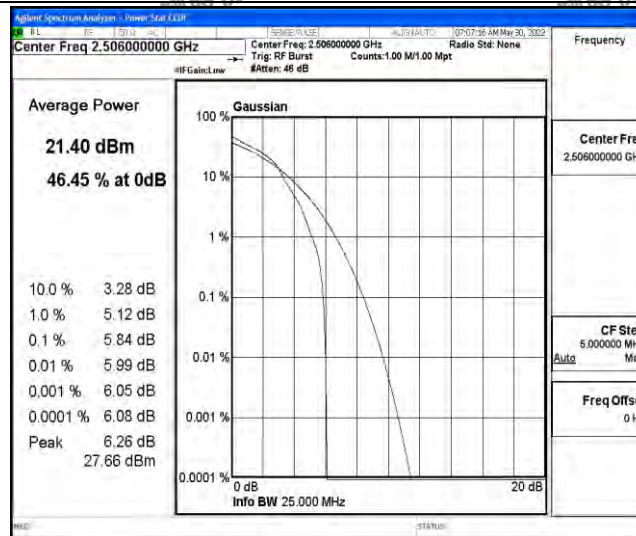

Band41-20MHz-16QAM-39750-100RB#0

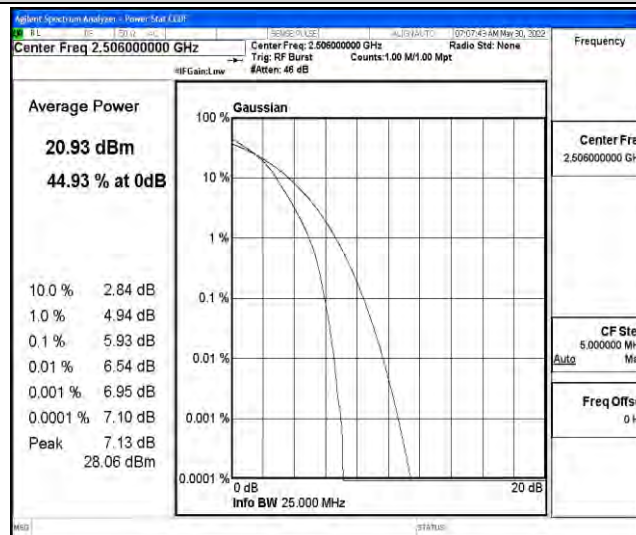


Band41-20MHz-16QAM-40620-1RB#0

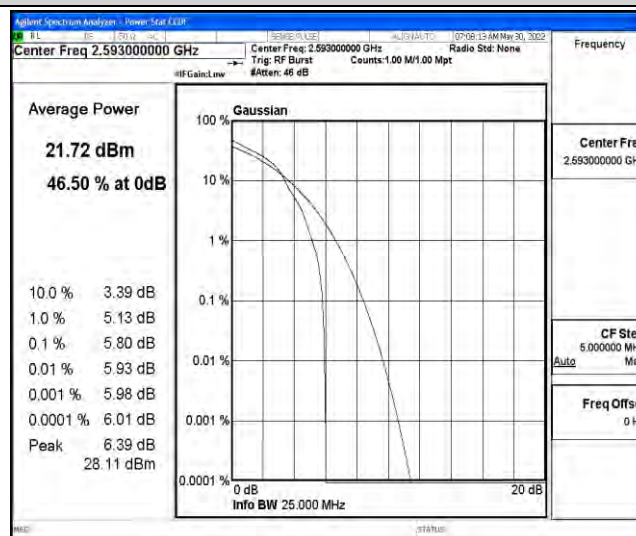




Band41-20MHz-16QAM-40620-100RB#0

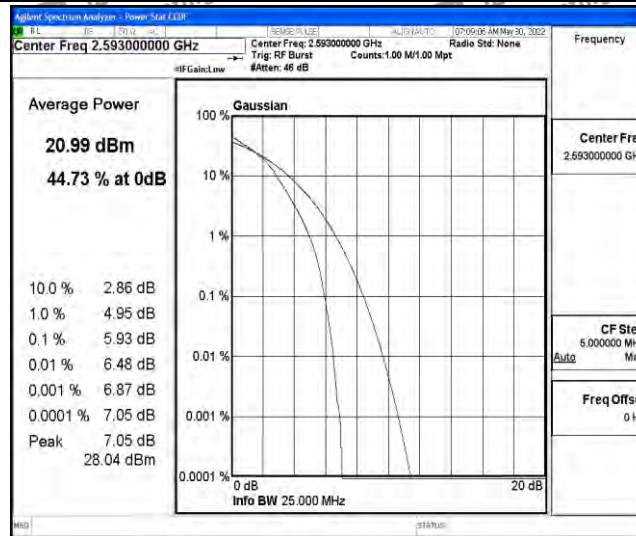


Band41-20MHz-16QAM-41490-1RB#0

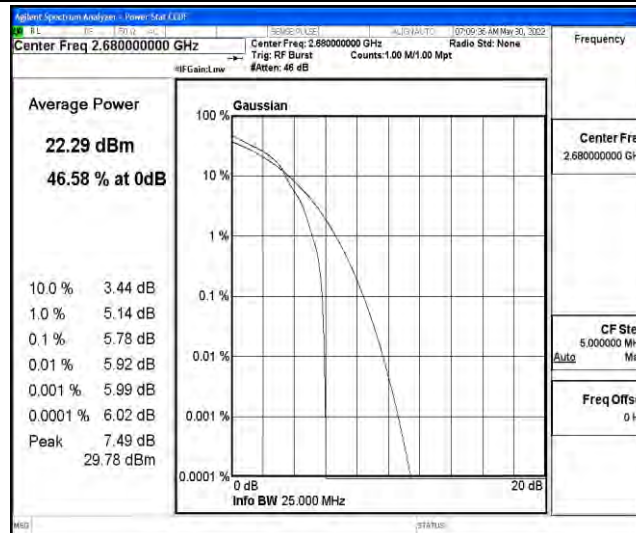

Band41-20MHz-16QAM-41490-100RB#0



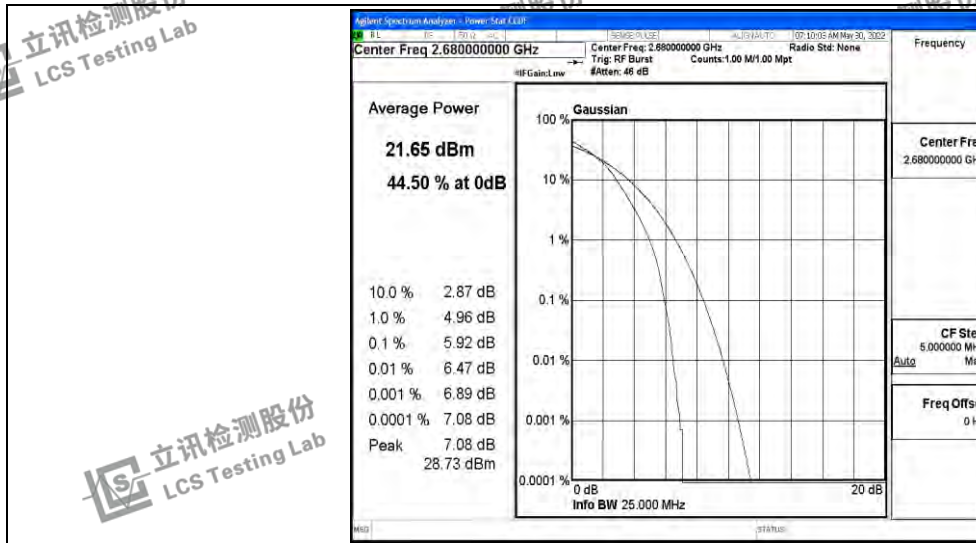



M.3 26dB Bandwidth and Occupied Bandwidth

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	4.4984	4.981	PASS
Band41	5MHz	QPSK	40620	25RB#0	4.5048	5.012	PASS
Band41	5MHz	QPSK	41565	25RB#0	4.4941	5.032	PASS
Band41	5MHz	16QAM	39675	25RB#0	4.5032	5.041	PASS
Band41	5MHz	16QAM	40620	25RB#0	4.4950	5.065	PASS
Band41	5MHz	16QAM	41565	25RB#0	4.4961	5.066	PASS
Band41	10MHz	QPSK	39700	50RB#0	8.9846	10.79	PASS
Band41	10MHz	QPSK	40620	50RB#0	8.9592	10.84	PASS
Band41	10MHz	QPSK	41540	50RB#0	8.9672	10.47	PASS
Band41	10MHz	16QAM	39700	50RB#0	8.9789	9.871	PASS
Band41	10MHz	16QAM	40620	50RB#0	8.9626	9.900	PASS
Band41	10MHz	16QAM	41540	50RB#0	8.9363	9.823	PASS
Band41	15MHz	QPSK	39725	75RB#0	13.380	16.35	PASS
Band41	15MHz	QPSK	40620	75RB#0	13.465	16.47	PASS
Band41	15MHz	QPSK	41515	75RB#0	13.453	15.01	PASS
Band41	15MHz	16QAM	39725	75RB#0	13.481	16.03	PASS
Band41	15MHz	16QAM	40620	75RB#0	13.388	15.54	PASS
Band41	15MHz	16QAM	41515	75RB#0	13.481	15.95	PASS
Band41	20MHz	QPSK	39750	100RB#0	17.888	19.37	PASS
Band41	20MHz	QPSK	40620	100RB#0	17.845	19.37	PASS
Band41	20MHz	QPSK	41490	100RB#0	17.847	19.33	PASS
Band41	20MHz	16QAM	39750	100RB#0	17.926	19.39	PASS
Band41	20MHz	16QAM	40620	100RB#0	17.914	19.21	PASS
Band41	20MHz	16QAM	41490	100RB#0	17.848	19.52	PASS






立讯检测股份
LCS Testing Lab
Test Graphs

立讯检测股份
LCS Testing Lab


立讯检测股份
LCS Testing Lab

立讯检测股份
LCS Testing Lab

Band41-5MHz-QPSK-39675-25RB#0

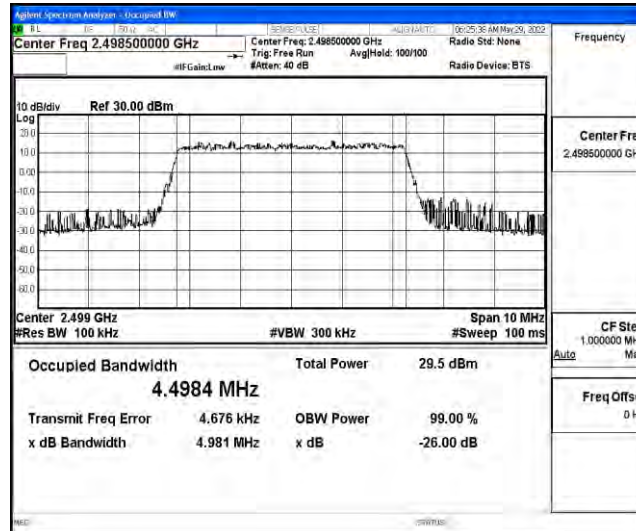


Band41-5MHz-QPSK-40620-25RB#0

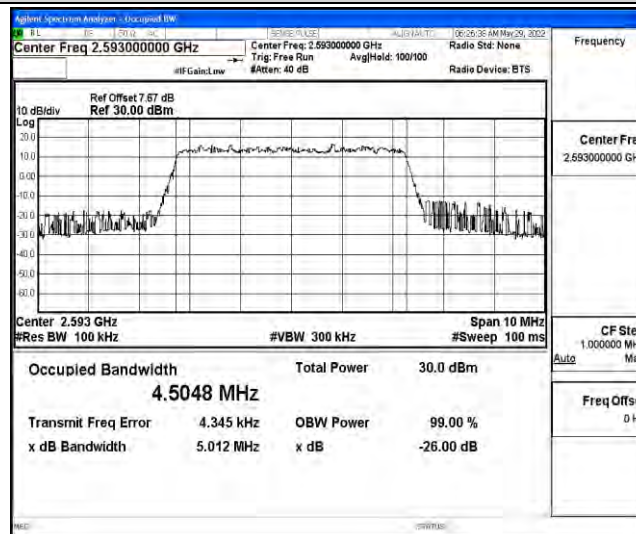


Band41-5MHz-QPSK-41565-25RB#0




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

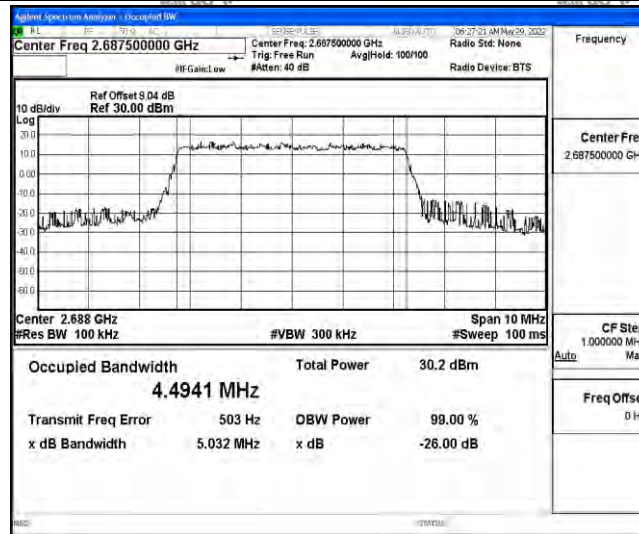

Band41-5MHz-16QAM-39675-25RB#0

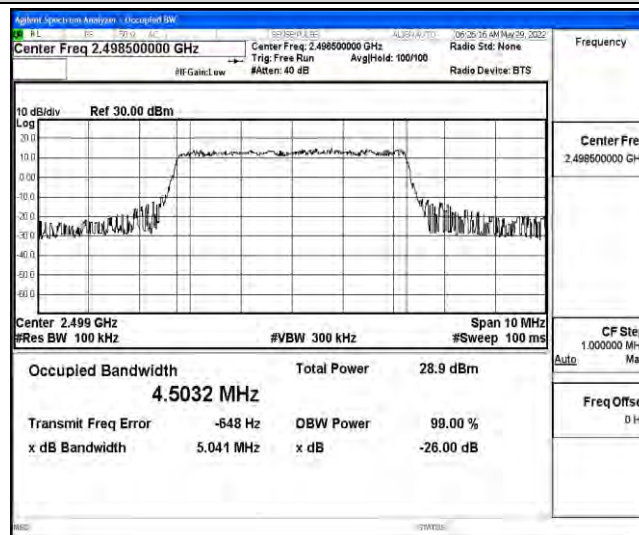


Band41-5MHz-16QAM-40620-25RB#0

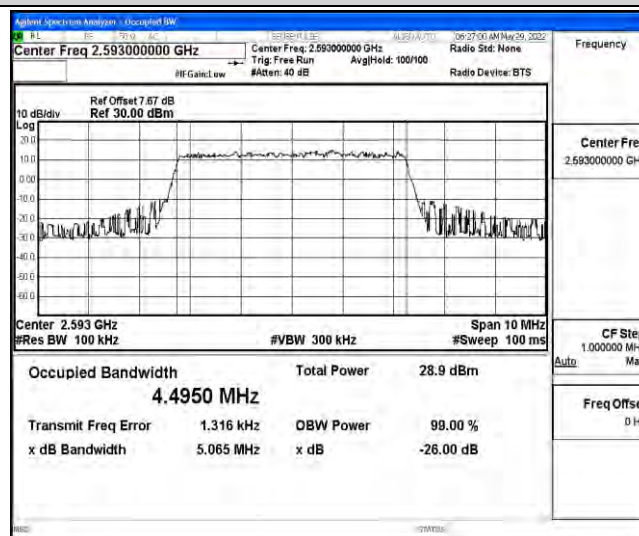




Band41-5MHz-16QAM-41565-25RB#0

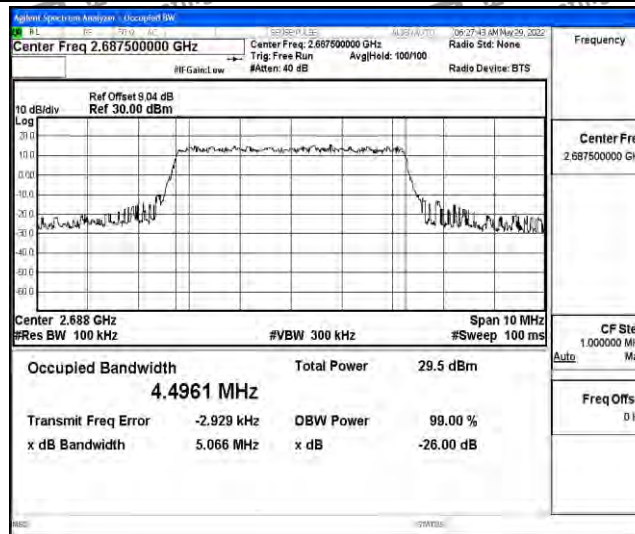


Band41-10MHz-QPSK-39700-50RB#0

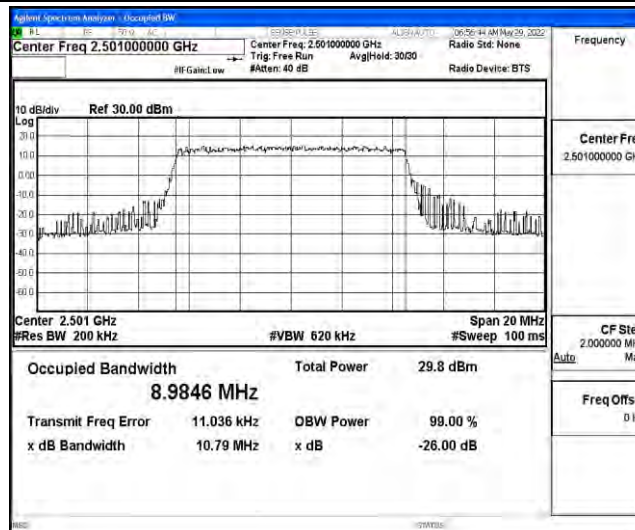


Band41-10MHz-QPSK-40620-50RB#0




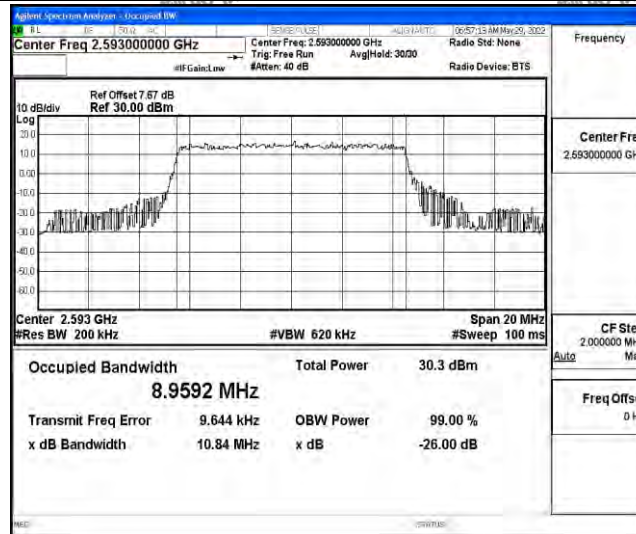

Band41-10MHz-QPSK-41540-50RB#0

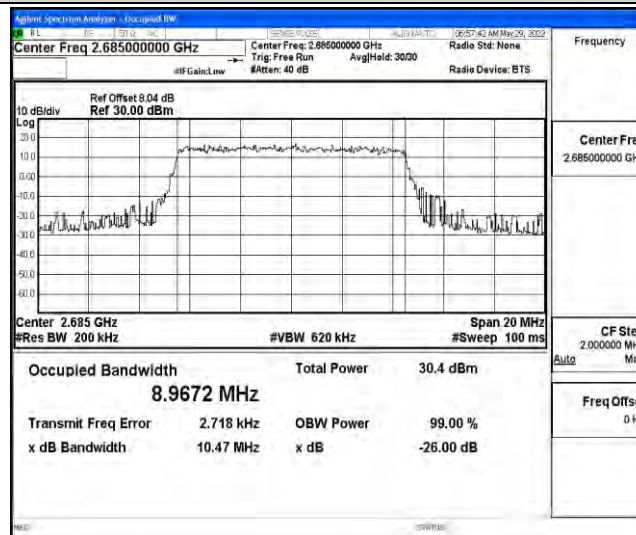


Band41-10MHz-16QAM-39700-50RB#0

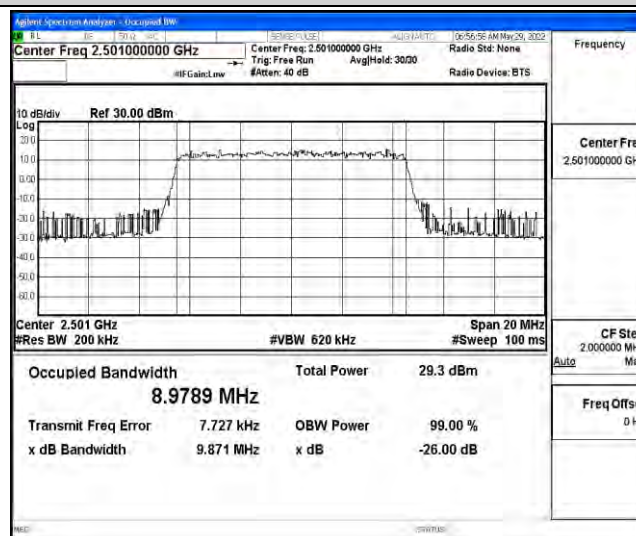




Band41-10MHz-16QAM-40620-50RB#0

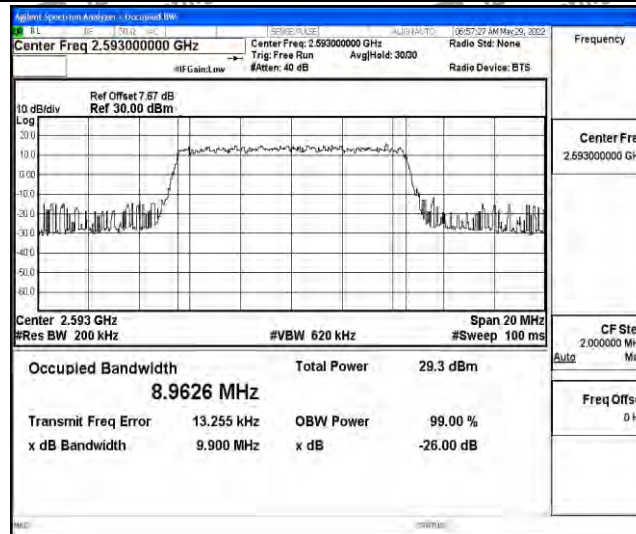


Band41-10MHz-16QAM-41540-50RB#0

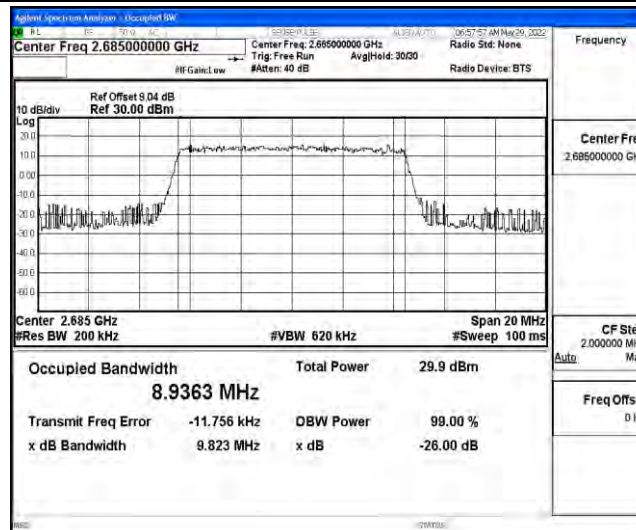


Band41-15MHz-QPSK-39725-75RB#0




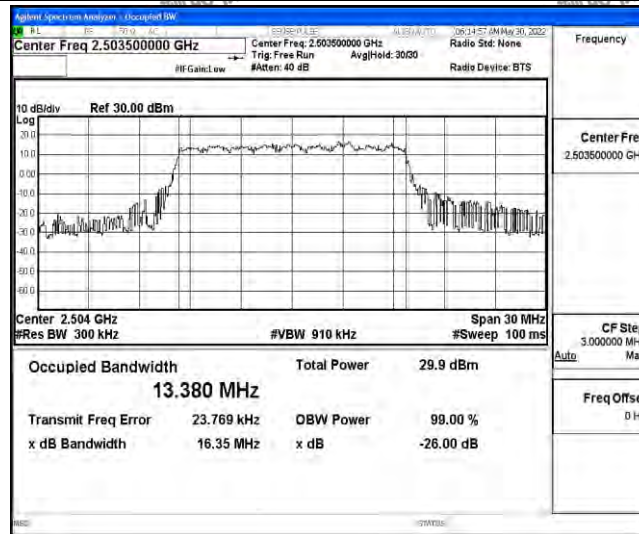

Band41-15MHz-QPSK-40620-75RB#0

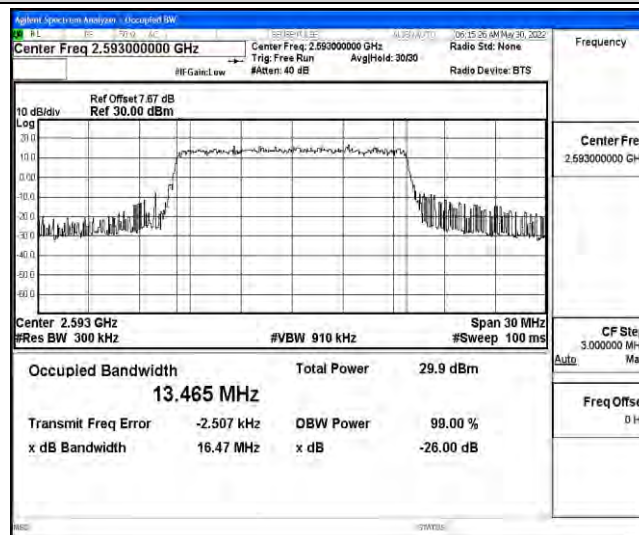


Band41-15MHz-QPSK-41515-75RB#0

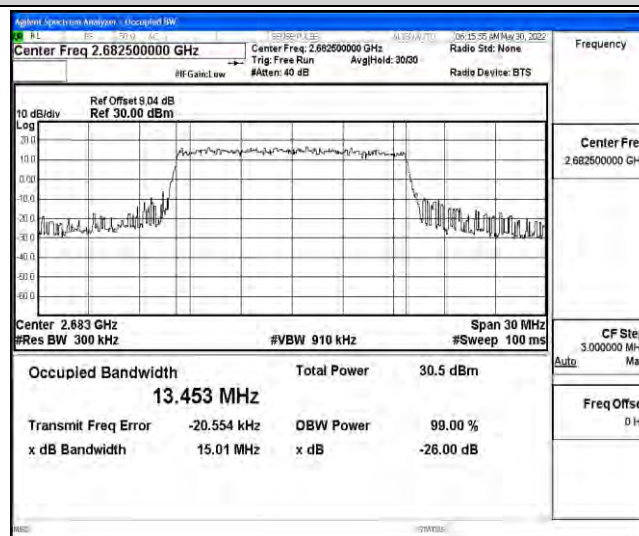




Band41-15MHz-16QAM-39725-75RB#0

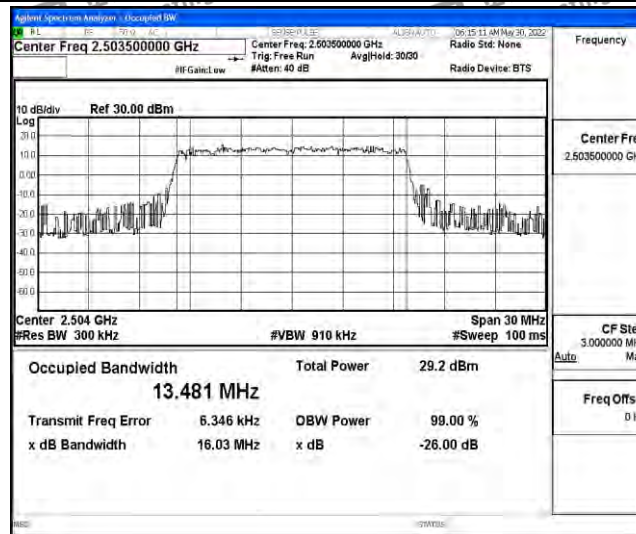


Band41-15MHz-16QAM-40620-75RB#0

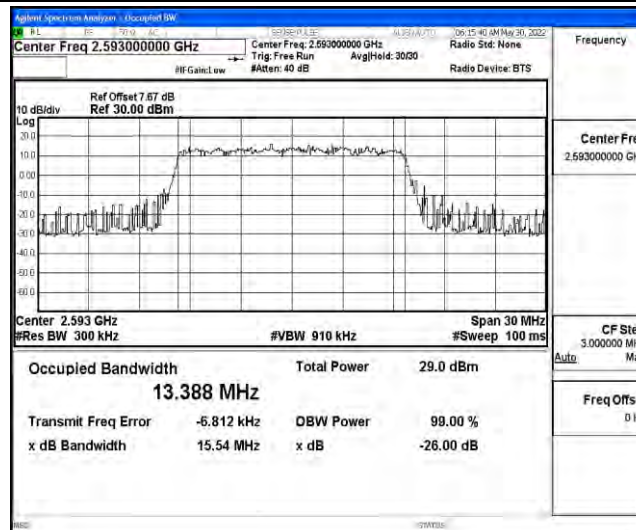


Band41-15MHz-16QAM-41515-75RB#0




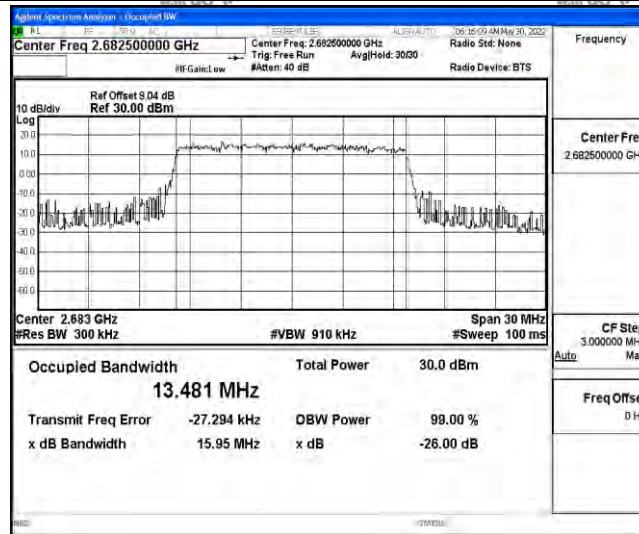

Band41-20MHz-QPSK-39750-100RB#0

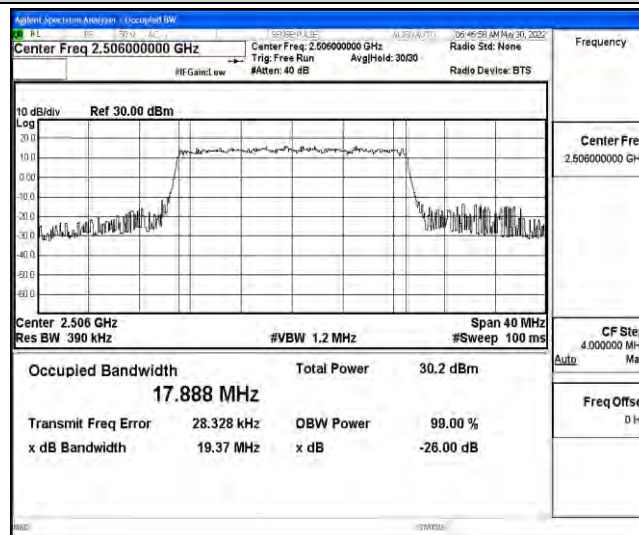


Band41-20MHz-QPSK-40620-100RB#0

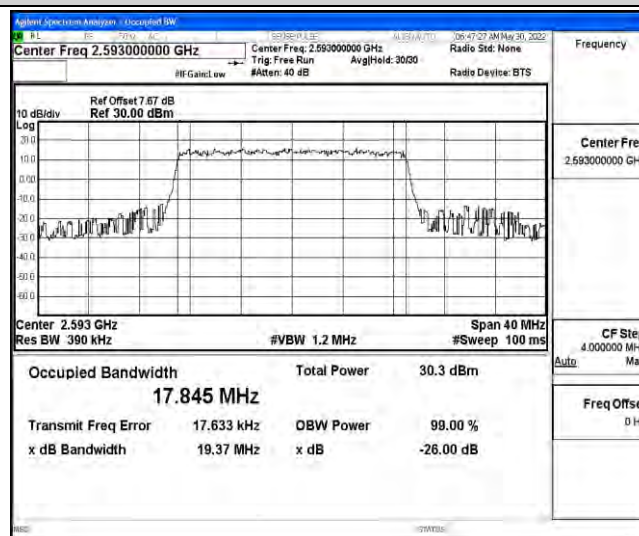




Band41-20MHz-QPSK-41490-100RB#0

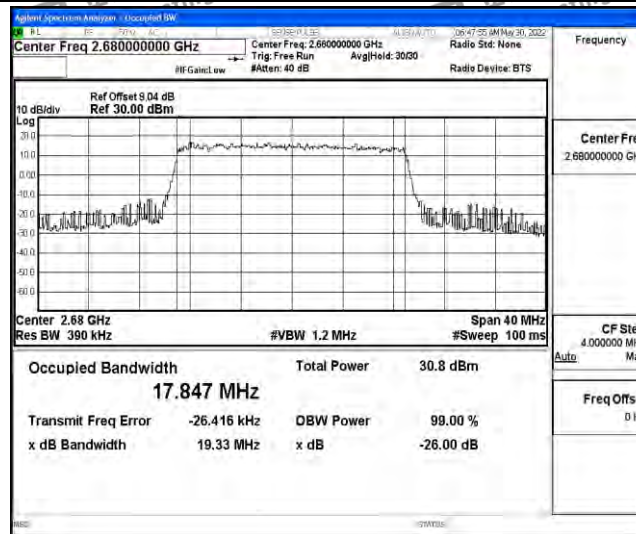


Band41-20MHz-16QAM-39750-100RB#0

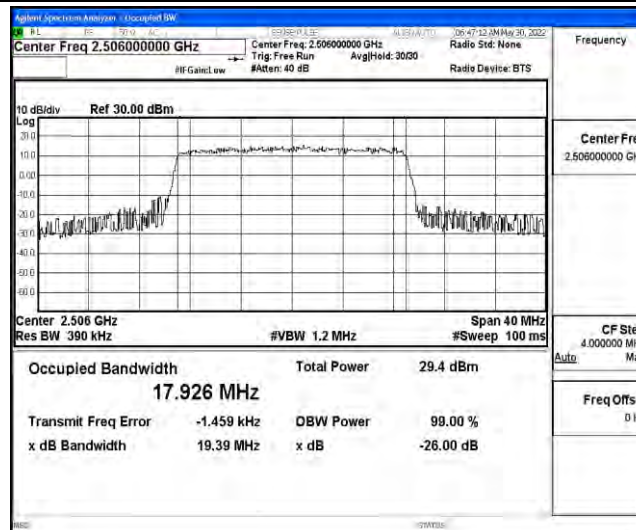


Band41-20MHz-16QAM-40620-100RB#0



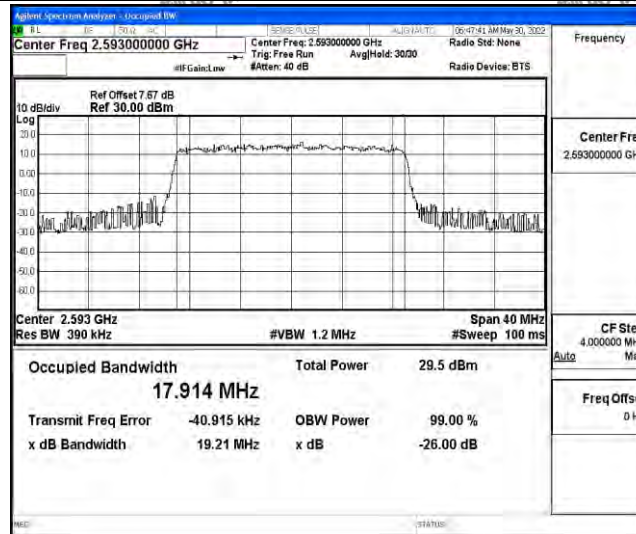

Band41-20MHz-16QAM-41490-100RB#0

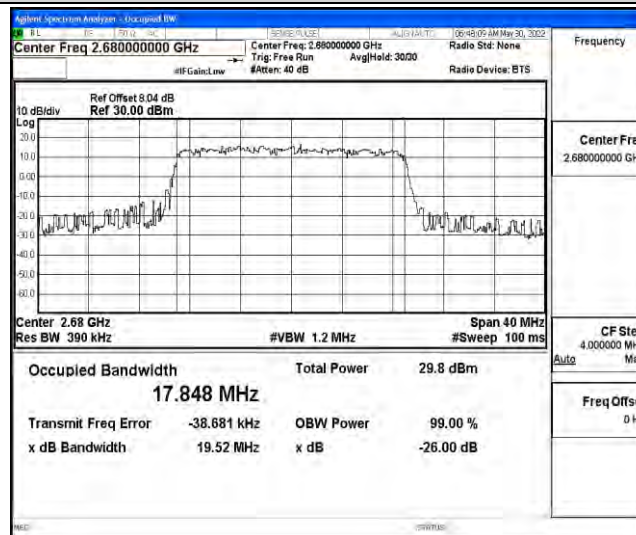



M.4 Band Edge

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	-47.97,-39.38,-29.89	PASS
Band41	5MHz	QPSK	41565	25RB#0	-29.21,-36.45,-45.46,-45.61	PASS
Band41	5MHz	16QAM	39675	25RB#0	-48.94,-40.82,-29.38	PASS
Band41	5MHz	16QAM	41565	25RB#0	-31.03,-37.71,-45.15,-46.33	PASS
Band41	10MHz	QPSK	39700	50RB#0	-47.08,-38.06,-32.95	PASS
Band41	10MHz	QPSK	41540	50RB#0	-31.20,-36.71,-41.20,-45.64	PASS
Band41	10MHz	16QAM	39700	50RB#0	-47.47,-38.64,-35.61	PASS
Band41	10MHz	16QAM	41540	50RB#0	-33.20,-37.30,-41.38,-44.11	PASS
Band41	15MHz	QPSK	39725	75RB#0	-46.70,-37.24,-32.67	PASS
Band41	15MHz	QPSK	41515	75RB#0	-30.88,-34.03,-39.23,-44.41	PASS
Band41	15MHz	16QAM	39725	75RB#0	-46.61,-36.96,-35.16	PASS
Band41	15MHz	16QAM	41515	75RB#0	-35.06,-35.30,-39.22,-44.47	PASS
Band41	20MHz	QPSK	39750	100RB#0	-46.24,-37.97,-35.28	PASS
Band41	20MHz	QPSK	41490	100RB#0	-34.23,-37.11,-39.48,-44.73	PASS
Band41	20MHz	16QAM	39750	100RB#0	-46.31,-38.18,-37.38	PASS
Band41	20MHz	16QAM	41490	100RB#0	-35.66,-36.64,-38.78,-44.50	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




立讯检测股份
LCS Testing Lab
Test Graphs

立讯检测股份
LCS Testing Lab


立讯检测股份
LCS Testing Lab

立讯检测股份
LCS Testing Lab

Band41-5MHz-QPSK-39675-25RB#0

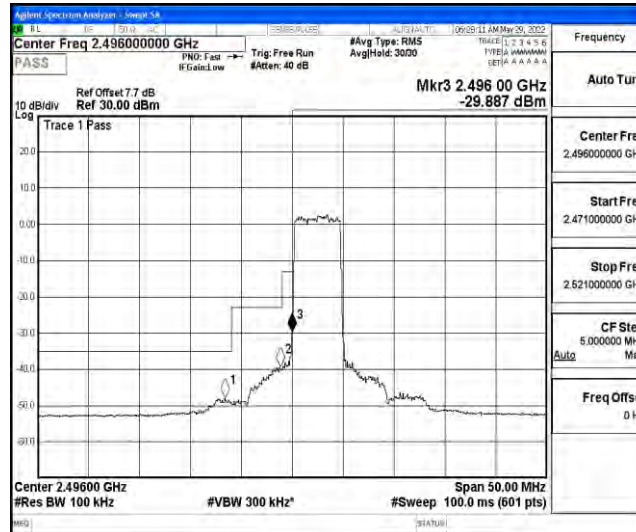

Band41-5MHz-QPSK-41565-25RB#0

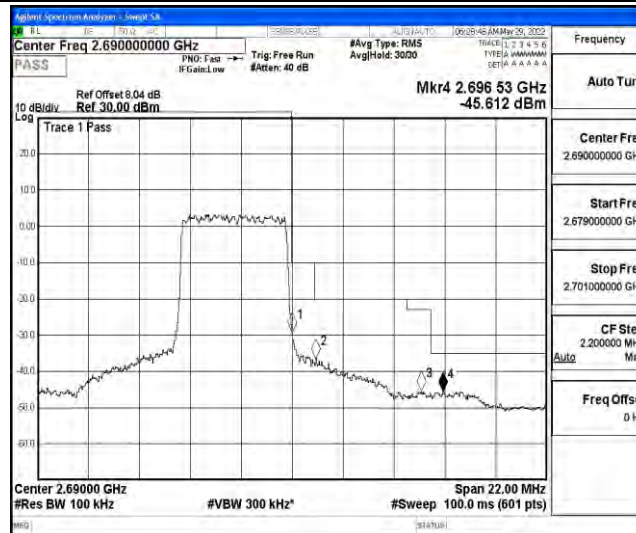

Band41-5MHz-16QAM-39675-25RB#0

立讯检测股份
LCS Testing Lab


立讯检测股份
LCS Testing Lab

立讯检测股份
LCS Testing Lab


立讯检测股份
LCS Testing Lab




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

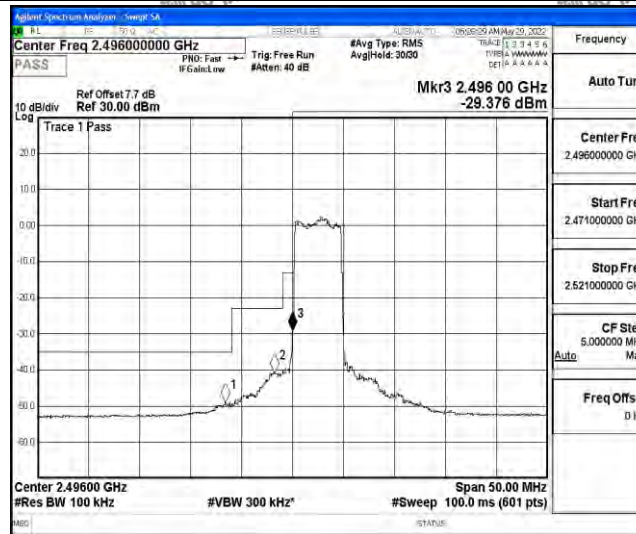

Band41-5MHz-16QAM-41565-25RB#0

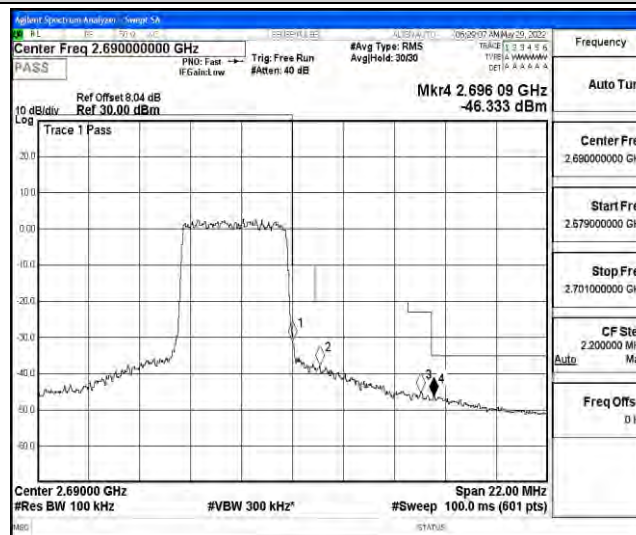


Band41-10MHz-QPSK-39700-50RB#0

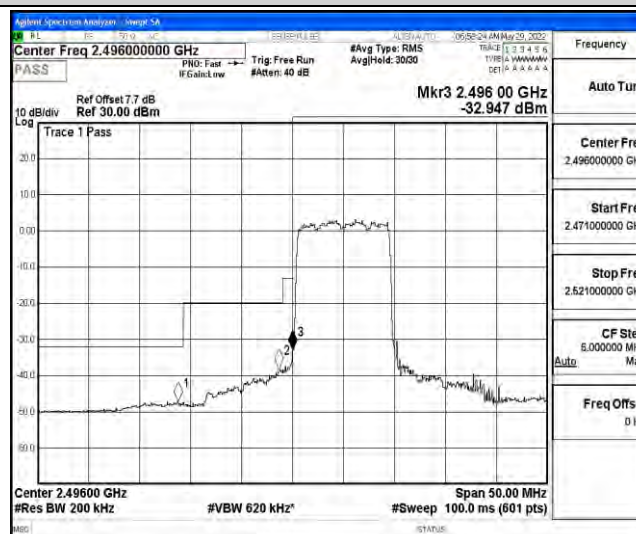


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Band41-10MHz-QPSK-41540-50RB#0

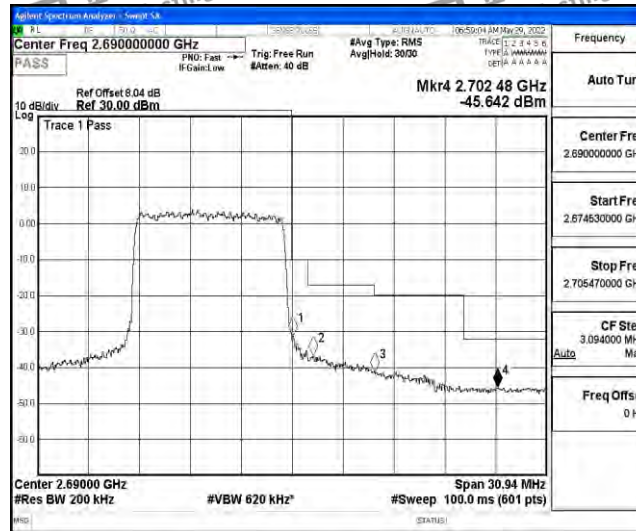


Band41-10MHz-16QAM-39700-50RB#0

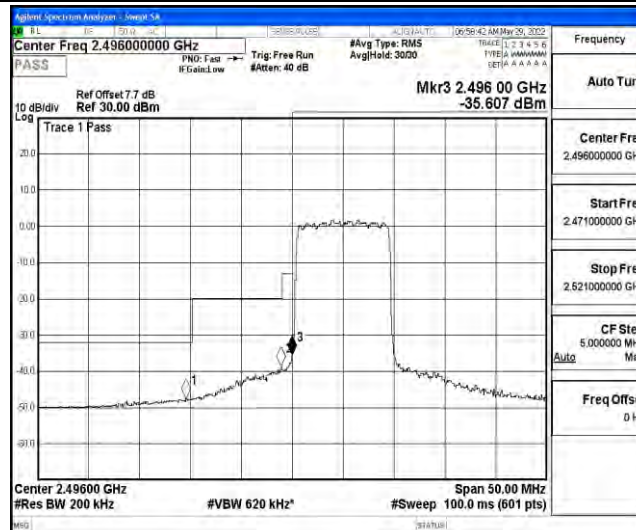

Band41-10MHz-16QAM-41540-50RB#0



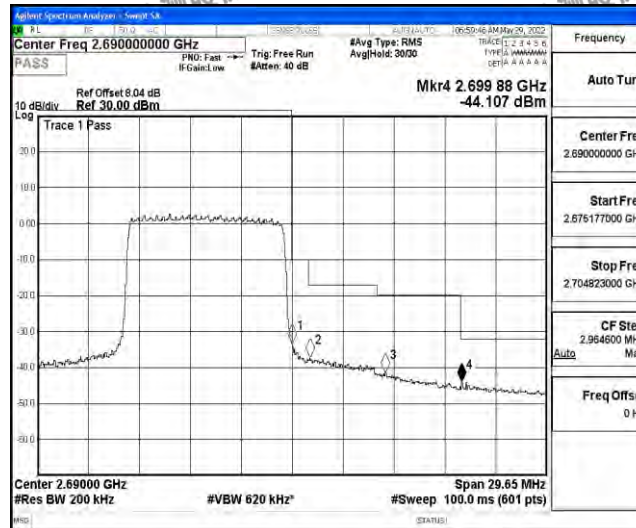

Band41-15MHz-QPSK-39725-75RB#0



Band41-15MHz-QPSK-41515-75RB#0






Band41-15MHz-16QAM-39725-75RB#0




Band41-15MHz-16QAM-41515-75RB#0

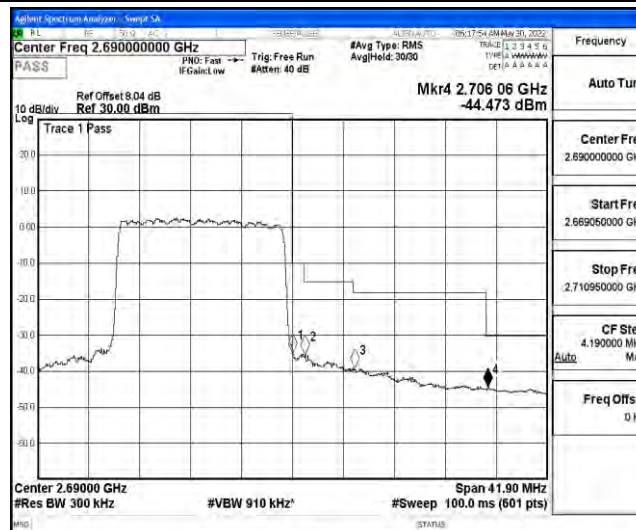


Band41-20MHz-QPSK-39750-100RB#0




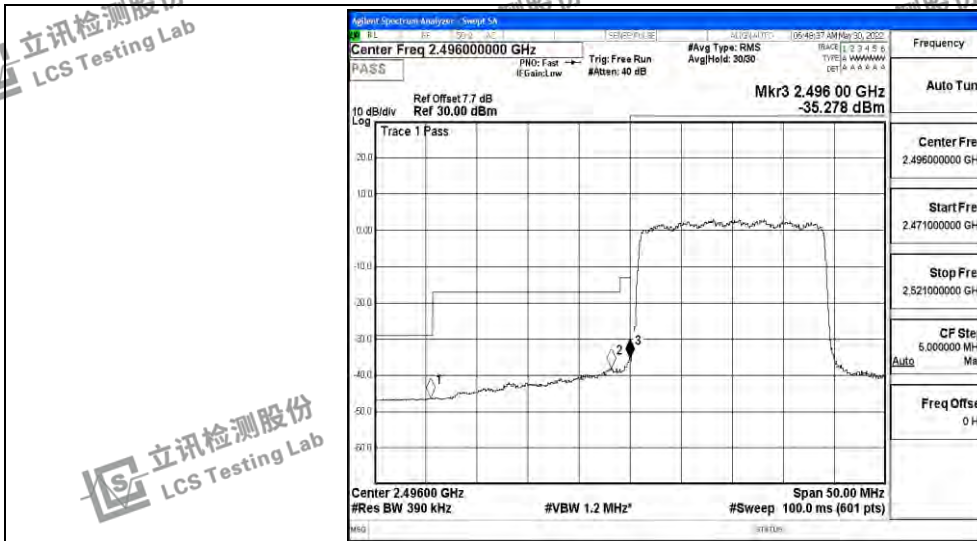

Band41-20MHz-QPSK-41490-100RB#0

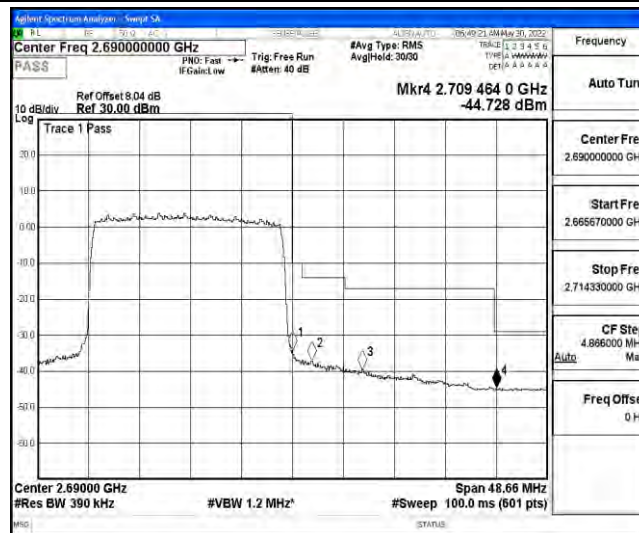


Band41-20MHz-16QAM-39750-100RB#0

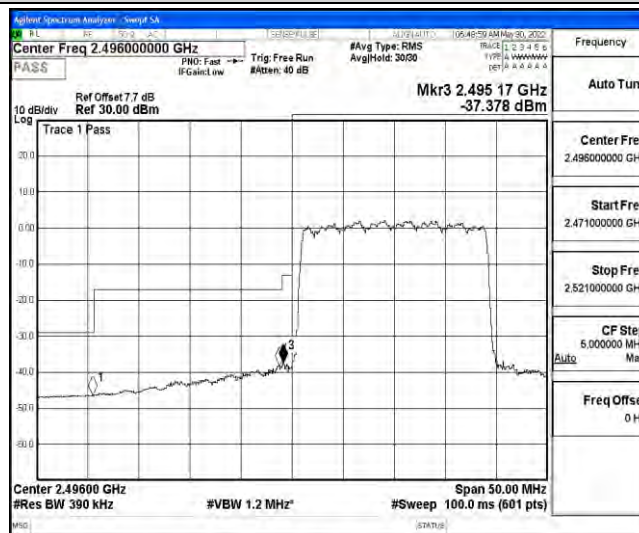



Band41-20MHz-16QAM-41490-100RB#0

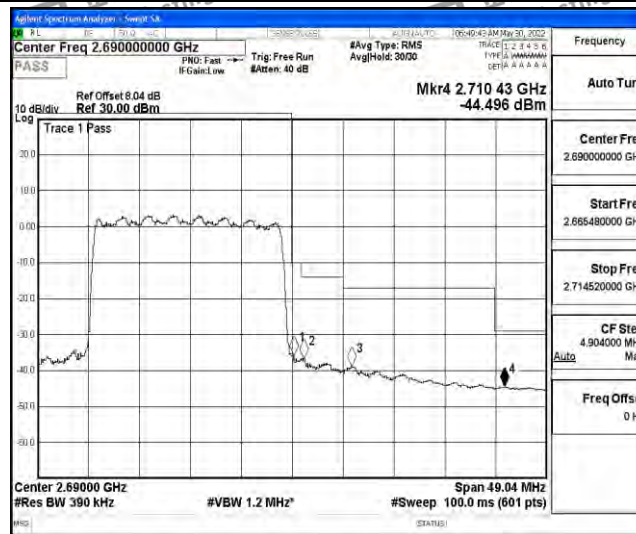



M.5 Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	Range1:0.009~0.15MHz	-65.34	PASS
Band41	5MHz	QPSK	39675	1RB#0	Range2:0.15~30MHz	-52.27	PASS
Band41	5MHz	QPSK	39675	1RB#0	Range3:30~1000MHz	-41.33	PASS
Band41	5MHz	QPSK	39675	1RB#0	Range4:1000~10000MHz	-45.15	PASS
Band41	5MHz	QPSK	39675	1RB#0	Range5:10000~20000MHz	-49.2	PASS
Band41	5MHz	QPSK	39675	1RB#0	Range6:20000~26500MHz	-36.97	PASS
Band41	5MHz	QPSK	40620	1RB#0	Range1:0.009~0.15MHz	-66.01	PASS
Band41	5MHz	QPSK	40620	1RB#0	Range2:0.15~30MHz	-51.73	PASS
Band41	5MHz	QPSK	40620	1RB#0	Range3:30~1000MHz	-41.73	PASS
Band41	5MHz	QPSK	40620	1RB#0	Range4:1000~10000MHz	-44.99	PASS
Band41	5MHz	QPSK	40620	1RB#0	Range5:10000~20000MHz	-49.24	PASS
Band41	5MHz	QPSK	40620	1RB#0	Range6:20000~26500MHz	-37.19	PASS
Band41	5MHz	QPSK	41565	1RB#0	Range1:0.009~0.15MHz	-65.06	PASS
Band41	5MHz	QPSK	41565	1RB#0	Range2:0.15~30MHz	-52.21	PASS
Band41	5MHz	QPSK	41565	1RB#0	Range3:30~1000MHz	-41.16	PASS
Band41	5MHz	QPSK	41565	1RB#0	Range4:1000~10000MHz	-45.03	PASS
Band41	5MHz	QPSK	41565	1RB#0	Range5:10000~20000MHz	-49.17	PASS
Band41	5MHz	QPSK	41565	1RB#0	Range6:20000~26500MHz	-37.18	PASS
Band41	5MHz	16QAM	39675	1RB#0	Range1:0.009~0.15MHz	-65.13	PASS
Band41	5MHz	16QAM	39675	1RB#0	Range2:0.15~30MHz	-52.49	PASS
Band41	5MHz	16QAM	39675	1RB#0	Range3:30~1000MHz	-42.07	PASS
Band41	5MHz	16QAM	39675	1RB#0	Range4:1000~10000MHz	-45.13	PASS
Band41	5MHz	16QAM	39675	1RB#0	Range5:10000~20000MHz	-49.18	PASS
Band41	5MHz	16QAM	39675	1RB#0	Range6:20000~26500MHz	-37.12	PASS
Band41	5MHz	16QAM	40620	1RB#0	Range1:0.009~0.15MHz	-65.71	PASS
Band41	5MHz	16QAM	40620	1RB#0	Range2:0.15~30MHz	-51.27	PASS
Band41	5MHz	16QAM	40620	1RB#0	Range3:30~1000MHz	-41.99	PASS
Band41	5MHz	16QAM	40620	1RB#0	Range4:1000~10000MHz	-44.92	PASS
Band41	5MHz	16QAM	40620	1RB#0	Range5:10000~20000MHz	-49.24	PASS
Band41	5MHz	16QAM	40620	1RB#0	Range6:20000~26500MHz	-37.18	PASS
Band41	5MHz	16QAM	41565	1RB#0	Range1:0.009~0.15MHz	-63.69	PASS
Band41	5MHz	16QAM	41565	1RB#0	Range2:0.15~30MHz	-52.77	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Band41	5MHz	16QAM	41565	1RB#0	Range3:30~1000MHz	-41.25	PASS
Band41	5MHz	16QAM	41565	1RB#0	Range4:1000~10000MHz	-44.98	PASS
Band41	5MHz	16QAM	41565	1RB#0	Range5:10000~20000MHz	-49.21	PASS
Band41	5MHz	16QAM	41565	1RB#0	Range6:20000~26500MHz	-37.12	PASS
Band41	10MHz	QPSK	39700	1RB#0	Range1:0.009~0.15MHz	-65.73	PASS
Band41	10MHz	QPSK	39700	1RB#0	Range2:0.15~30MHz	-52.75	PASS
Band41	10MHz	QPSK	39700	1RB#0	Range3:30~1000MHz	-40.43	PASS
Band41	10MHz	QPSK	39700	1RB#0	Range4:1000~10000MHz	-44.97	PASS
Band41	10MHz	QPSK	39700	1RB#0	Range5:10000~20000MHz	-49.16	PASS
Band41	10MHz	QPSK	39700	1RB#0	Range6:20000~26500MHz	-36.95	PASS
Band41	10MHz	QPSK	40620	1RB#0	Range1:0.009~0.15MHz	-65.41	PASS
Band41	10MHz	QPSK	40620	1RB#0	Range2:0.15~30MHz	-51.15	PASS
Band41	10MHz	QPSK	40620	1RB#0	Range3:30~1000MHz	-42.25	PASS
Band41	10MHz	QPSK	40620	1RB#0	Range4:1000~10000MHz	-44.79	PASS
Band41	10MHz	QPSK	40620	1RB#0	Range5:10000~20000MHz	-49.15	PASS
Band41	10MHz	QPSK	40620	1RB#0	Range6:20000~26500MHz	-36.99	PASS
Band41	10MHz	QPSK	41540	1RB#0	Range1:0.009~0.15MHz	-64.95	PASS
Band41	10MHz	QPSK	41540	1RB#0	Range2:0.15~30MHz	-50.66	PASS
Band41	10MHz	QPSK	41540	1RB#0	Range3:30~1000MHz	-42.16	PASS
Band41	10MHz	QPSK	41540	1RB#0	Range4:1000~10000MHz	-44.97	PASS
Band41	10MHz	QPSK	41540	1RB#0	Range5:10000~20000MHz	-49.18	PASS
Band41	10MHz	QPSK	41540	1RB#0	Range6:20000~26500MHz	-37.07	PASS
Band41	10MHz	16QAM	39700	1RB#0	Range1:0.009~0.15MHz	-66.17	PASS
Band41	10MHz	16QAM	39700	1RB#0	Range2:0.15~30MHz	-51.39	PASS
Band41	10MHz	16QAM	39700	1RB#0	Range3:30~1000MHz	-41.34	PASS
Band41	10MHz	16QAM	39700	1RB#0	Range4:1000~10000MHz	-45.02	PASS
Band41	10MHz	16QAM	39700	1RB#0	Range5:10000~20000MHz	-49.22	PASS
Band41	10MHz	16QAM	39700	1RB#0	Range6:20000~26500MHz	-36.91	PASS
Band41	10MHz	16QAM	40620	1RB#0	Range1:0.009~0.15MHz	-65.98	PASS
Band41	10MHz	16QAM	40620	1RB#0	Range2:0.15~30MHz	-51.5	PASS
Band41	10MHz	16QAM	40620	1RB#0	Range3:30~1000MHz	-41.51	PASS
Band41	10MHz	16QAM	40620	1RB#0	Range4:1000~10000MHz	-44.97	PASS
Band41	10MHz	16QAM	40620	1RB#0	Range5:10000~20000MHz	-49.24	PASS
Band41	10MHz	16QAM	40620	1RB#0	Range6:20000~26500MHz	-36.98	PASS
Band41	10MHz	16QAM	41540	1RB#0	Range1:0.009~0.15MHz	-64.67	PASS
Band41	10MHz	16QAM	41540	1RB#0	Range2:0.15~30MHz	-51.57	PASS
Band41	10MHz	16QAM	41540	1RB#0	Range3:30~1000MHz	-41.99	PASS
Band41	10MHz	16QAM	41540	1RB#0	Range4:1000~10000MHz	-44.92	PASS
Band41	10MHz	16QAM	41540	1RB#0	Range5:10000~20000MHz	-49.18	PASS
Band41	10MHz	16QAM	41540	1RB#0	Range6:20000~26500MHz	-37.13	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	15MHz	QPSK	39725	1RB#0	Range1:0.009~0.15MHz	-64.43	PASS
Band41	15MHz	QPSK	39725	1RB#0	Range2:0.15~30MHz	-50.93	PASS
Band41	15MHz	QPSK	39725	1RB#0	Range3:30~1000MHz	-40.69	PASS
Band41	15MHz	QPSK	39725	1RB#0	Range4:1000~10000MHz	-44.85	PASS
Band41	15MHz	QPSK	39725	1RB#0	Range5:10000~20000MHz	-49.15	PASS
Band41	15MHz	QPSK	39725	1RB#0	Range6:20000~26500MHz	-36.95	PASS
Band41	15MHz	QPSK	40620	1RB#0	Range1:0.009~0.15MHz	-66.01	PASS
Band41	15MHz	QPSK	40620	1RB#0	Range2:0.15~30MHz	-49.42	PASS
Band41	15MHz	QPSK	40620	1RB#0	Range3:30~1000MHz	-42	PASS
Band41	15MHz	QPSK	40620	1RB#0	Range4:1000~10000MHz	-44.95	PASS
Band41	15MHz	QPSK	40620	1RB#0	Range5:10000~20000MHz	-49.07	PASS
Band41	15MHz	QPSK	40620	1RB#0	Range6:20000~26500MHz	-37.1	PASS
Band41	15MHz	QPSK	41515	1RB#0	Range1:0.009~0.15MHz	-65.01	PASS
Band41	15MHz	QPSK	41515	1RB#0	Range2:0.15~30MHz	-50.93	PASS
Band41	15MHz	QPSK	41515	1RB#0	Range3:30~1000MHz	-42.14	PASS
Band41	15MHz	QPSK	41515	1RB#0	Range4:1000~10000MHz	-44.97	PASS
Band41	15MHz	QPSK	41515	1RB#0	Range5:10000~20000MHz	-49.28	PASS
Band41	15MHz	QPSK	41515	1RB#0	Range6:20000~26500MHz	-37.04	PASS
Band41	15MHz	16QAM	39725	1RB#0	Range1:0.009~0.15MHz	-65.48	PASS
Band41	15MHz	16QAM	39725	1RB#0	Range2:0.15~30MHz	-51.67	PASS
Band41	15MHz	16QAM	39725	1RB#0	Range3:30~1000MHz	-42.34	PASS
Band41	15MHz	16QAM	39725	1RB#0	Range4:1000~10000MHz	-44.98	PASS
Band41	15MHz	16QAM	39725	1RB#0	Range5:10000~20000MHz	-49.2	PASS
Band41	15MHz	16QAM	39725	1RB#0	Range6:20000~26500MHz	-37.05	PASS
Band41	15MHz	QPSK	40620	1RB#0	Range1:0.009~0.15MHz	-64.89	PASS
Band41	15MHz	QPSK	40620	1RB#0	Range2:0.15~30MHz	-49.5	PASS
Band41	15MHz	QPSK	40620	1RB#0	Range3:30~1000MHz	-42.02	PASS
Band41	15MHz	QPSK	40620	1RB#0	Range4:1000~10000MHz	-45.08	PASS
Band41	15MHz	QPSK	40620	1RB#0	Range5:10000~20000MHz	-49.11	PASS
Band41	15MHz	QPSK	40620	1RB#0	Range6:20000~26500MHz	-37.03	PASS
Band41	15MHz	16QAM	41515	1RB#0	Range1:0.009~0.15MHz	-65.25	PASS
Band41	15MHz	16QAM	41515	1RB#0	Range2:0.15~30MHz	-49.11	PASS
Band41	15MHz	16QAM	41515	1RB#0	Range3:30~1000MHz	-41.46	PASS
Band41	15MHz	16QAM	41515	1RB#0	Range4:1000~10000MHz	-44.95	PASS
Band41	15MHz	16QAM	41515	1RB#0	Range5:10000~20000MHz	-49.07	PASS
Band41	15MHz	16QAM	41515	1RB#0	Range6:20000~26500MHz	-37.02	PASS
Band41	20MHz	QPSK	39750	1RB#0	Range1:0.009~0.15MHz	-63.85	PASS
Band41	20MHz	QPSK	39750	1RB#0	Range2:0.15~30MHz	-51.48	PASS
Band41	20MHz	QPSK	39750	1RB#0	Range3:30~1000MHz	-41.53	PASS
Band41	20MHz	QPSK	39750	1RB#0	Range4:1000~10000MHz	-44.96	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	20MHz	QPSK	39750	1RB#0	Range5:10000~20000MHz	-49.18	PASS
Band41	20MHz	QPSK	39750	1RB#0	Range6:20000~26500MHz	-37	PASS
Band41	20MHz	QPSK	40620	1RB#0	Range1:0.009~0.15MHz	-64.94	PASS
Band41	20MHz	QPSK	40620	1RB#0	Range2:0.15~30MHz	-50.25	PASS
Band41	20MHz	QPSK	40620	1RB#0	Range3:30~1000MHz	-42.13	PASS
Band41	20MHz	QPSK	40620	1RB#0	Range4:1000~10000MHz	-44.92	PASS
Band41	20MHz	QPSK	40620	1RB#0	Range5:10000~20000MHz	-49.22	PASS
Band41	20MHz	QPSK	40620	1RB#0	Range6:20000~26500MHz	-37.14	PASS
Band41	20MHz	QPSK	41490	1RB#0	Range1:0.009~0.15MHz	-66.67	PASS
Band41	20MHz	QPSK	41490	1RB#0	Range2:0.15~30MHz	-51.58	PASS
Band41	20MHz	QPSK	41490	1RB#0	Range3:30~1000MHz	-40.93	PASS
Band41	20MHz	QPSK	41490	1RB#0	Range4:1000~10000MHz	-44.78	PASS
Band41	20MHz	QPSK	41490	1RB#0	Range5:10000~20000MHz	-49.08	PASS
Band41	20MHz	QPSK	41490	1RB#0	Range6:20000~26500MHz	-37.15	PASS
Band41	20MHz	16QAM	39750	1RB#0	Range1:0.009~0.15MHz	-65.42	PASS
Band41	20MHz	16QAM	39750	1RB#0	Range2:0.15~30MHz	-50.64	PASS
Band41	20MHz	16QAM	39750	1RB#0	Range3:30~1000MHz	-42.26	PASS
Band41	20MHz	16QAM	39750	1RB#0	Range4:1000~10000MHz	-44.88	PASS
Band41	20MHz	16QAM	39750	1RB#0	Range5:10000~20000MHz	-49.16	PASS
Band41	20MHz	16QAM	39750	1RB#0	Range6:20000~26500MHz	-36.9	PASS
Band41	20MHz	16QAM	40620	1RB#0	Range1:0.009~0.15MHz	-65.21	PASS
Band41	20MHz	16QAM	40620	1RB#0	Range2:0.15~30MHz	-50.79	PASS
Band41	20MHz	16QAM	40620	1RB#0	Range3:30~1000MHz	-40.85	PASS
Band41	20MHz	16QAM	40620	1RB#0	Range4:1000~10000MHz	-44.83	PASS
Band41	20MHz	16QAM	40620	1RB#0	Range5:10000~20000MHz	-49.14	PASS
Band41	20MHz	16QAM	40620	1RB#0	Range6:20000~26500MHz	-36.94	PASS
Band41	20MHz	16QAM	41490	1RB#0	Range1:0.009~0.15MHz	-64.81	PASS
Band41	20MHz	16QAM	41490	1RB#0	Range2:0.15~30MHz	-50.92	PASS
Band41	20MHz	16QAM	41490	1RB#0	Range3:30~1000MHz	-42.23	PASS
Band41	20MHz	16QAM	41490	1RB#0	Range4:1000~10000MHz	-44.89	PASS
Band41	20MHz	16QAM	41490	1RB#0	Range5:10000~20000MHz	-49.12	PASS
Band41	20MHz	16QAM	41490	1RB#0	Range6:20000~26500MHz	-37.08	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




立讯检测股份
LCS Testing Lab
Test Graphs

立讯检测股份
LCS Testing Lab


立讯检测股份
LCS Testing Lab

立讯检测股份
LCS Testing Lab

Band41-5MHz-QPSK-39675-1RB#0-Range1:0.009~0.15MHz

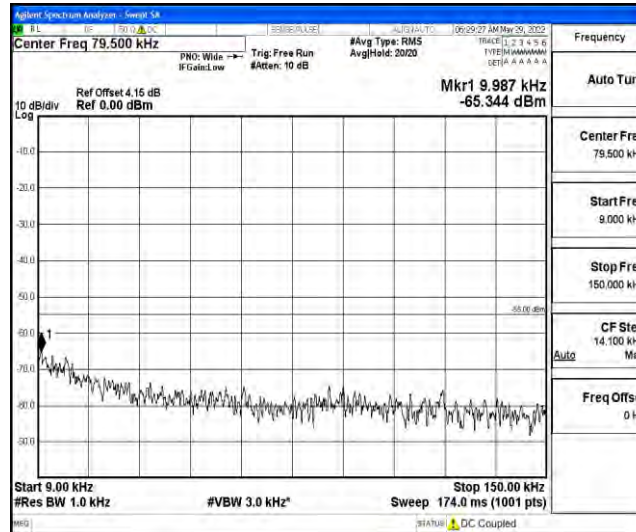


Band41-5MHz-QPSK-39675-1RB#0-Range2:0.15~30MHz

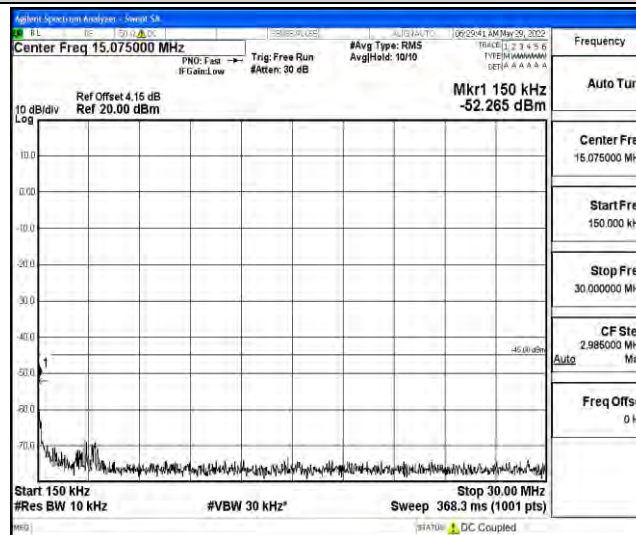


Band41-5MHz-QPSK-39675-1RB#0-Range3:30~1000MHz




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

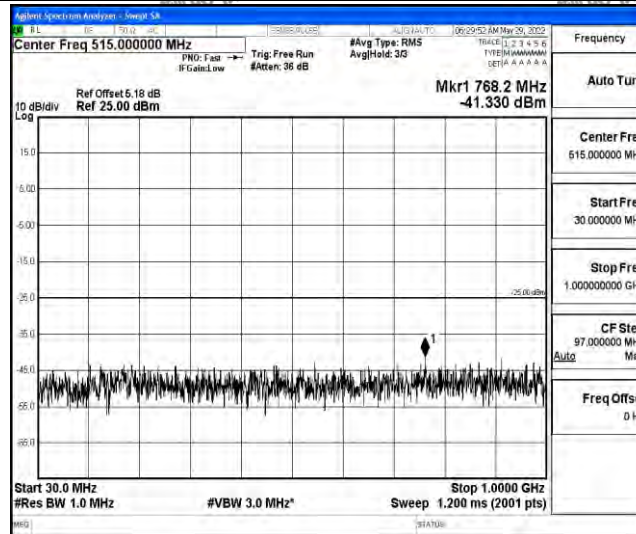

Band41-5MHz-QPSK-39675-1RB#0-Range4:1000~10000MHz

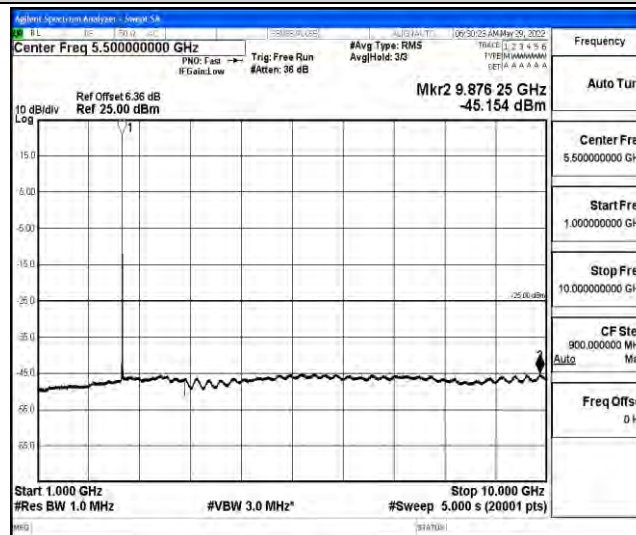


Band41-5MHz-QPSK-39675-1RB#0-Range5:10000~20000MHz

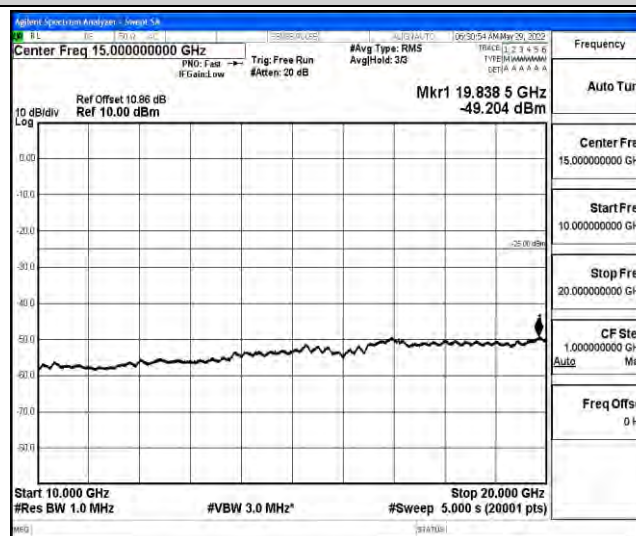




Band41-5MHz-QPSK-39675-1RB#0-Range6:20000~26500MHz

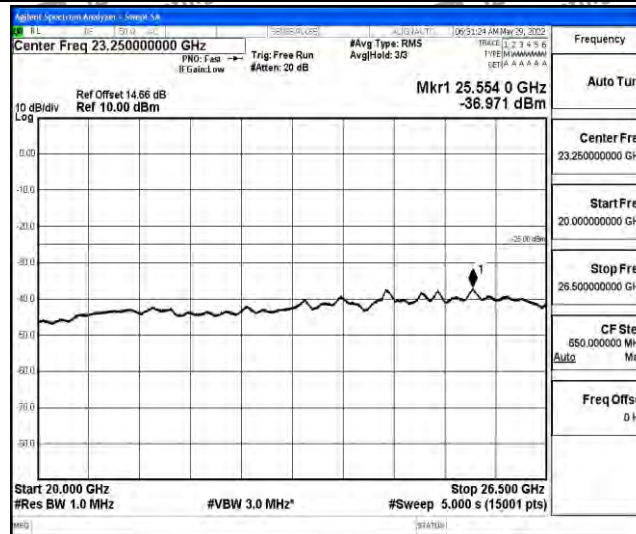


Band41-5MHz-QPSK-40620-1RB#0-Range1:0.009~0.15MHz

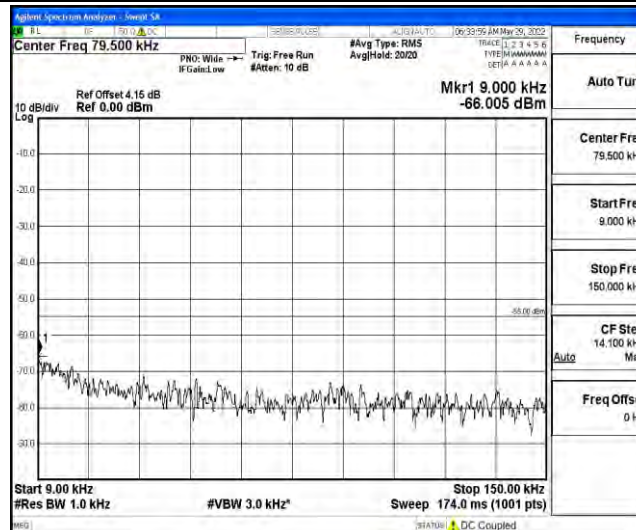


Band41-5MHz-QPSK-40620-1RB#0-Range2:0.15~30MHz




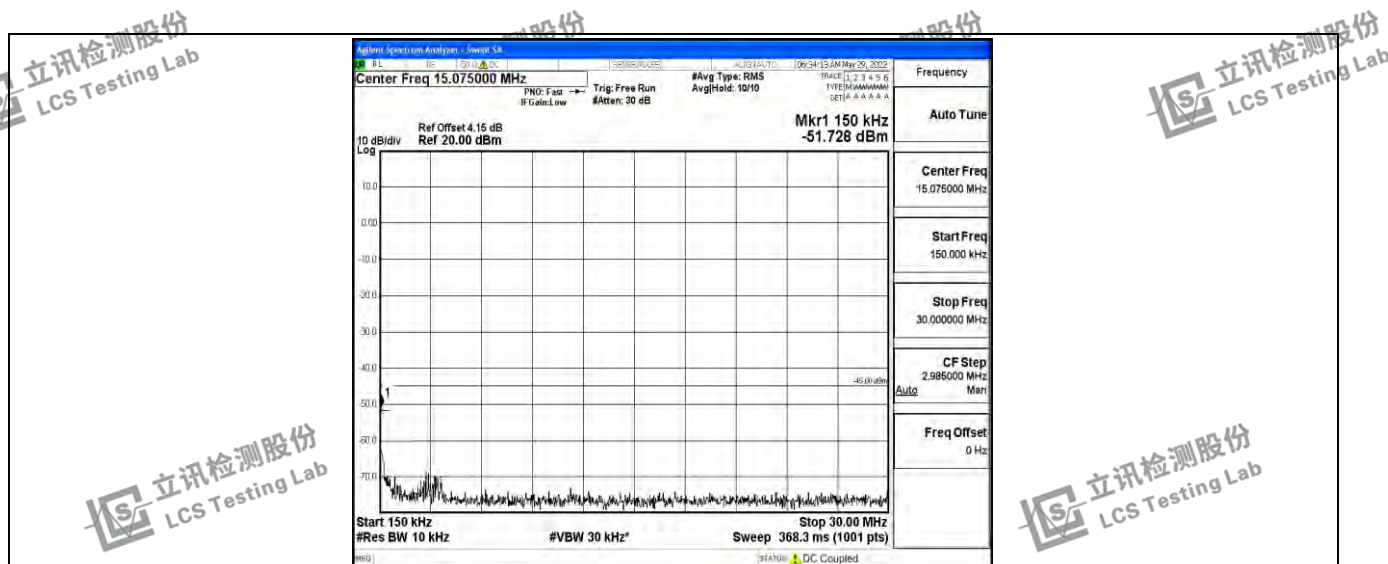

Band41-5MHz-QPSK-40620-1RB#0-Range3:30~1000MHz

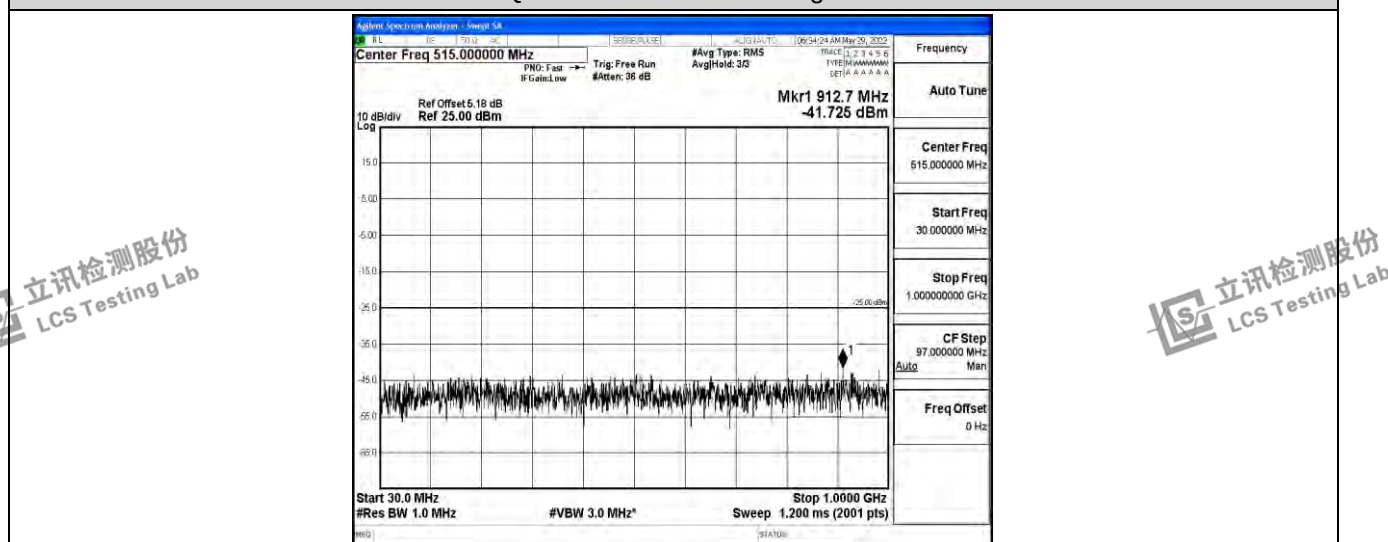


Band41-5MHz-QPSK-40620-1RB#0-Range4:1000~10000MHz

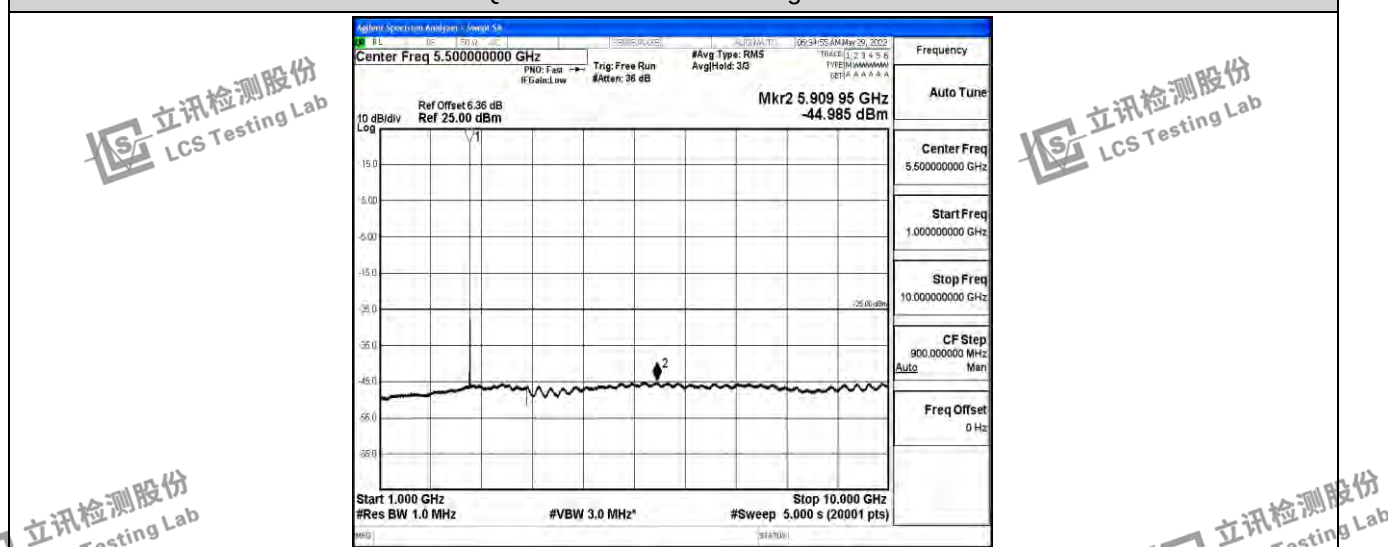


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen,
518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Band41-5MHz-QPSK-40620-1RB#0-Range5:10000~20000MHz

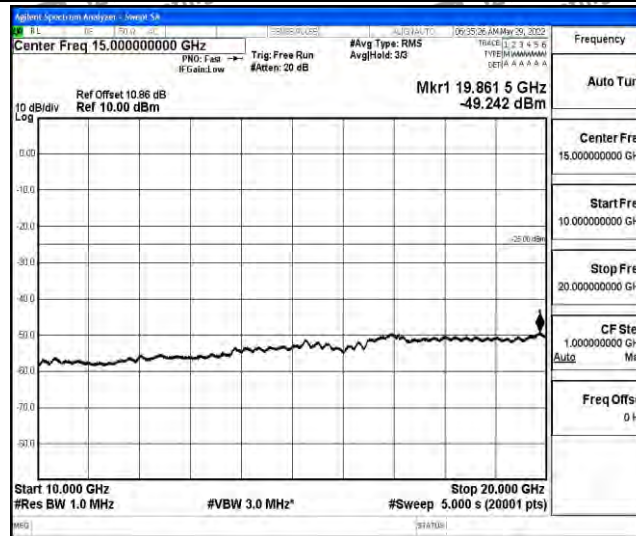


Band41-5MHz-QPSK-40620-1RB#0-Range6:20000~26500MHz

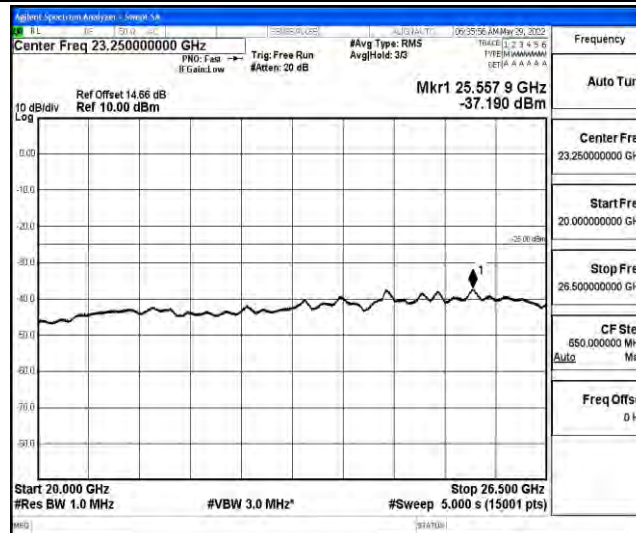


Band41-5MHz-QPSK-41565-1RB#0-Range1:0.009~0.15MHz




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

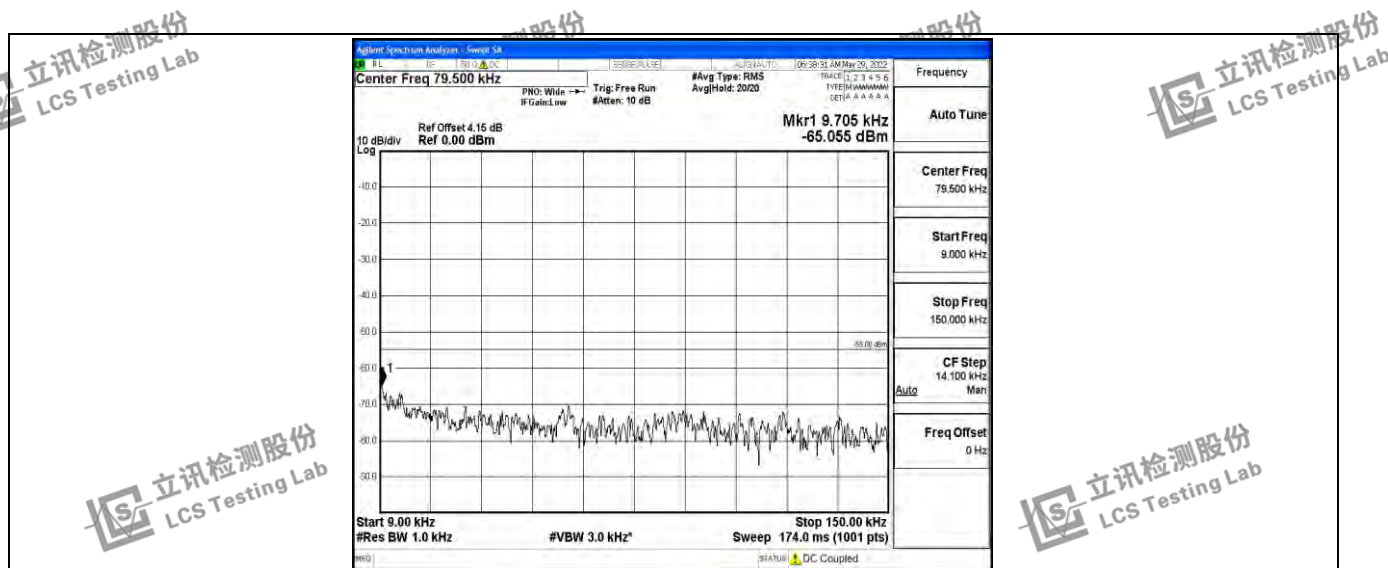

Band41-5MHz-QPSK-41565-1RB#0-Range2:0.15~30MHz

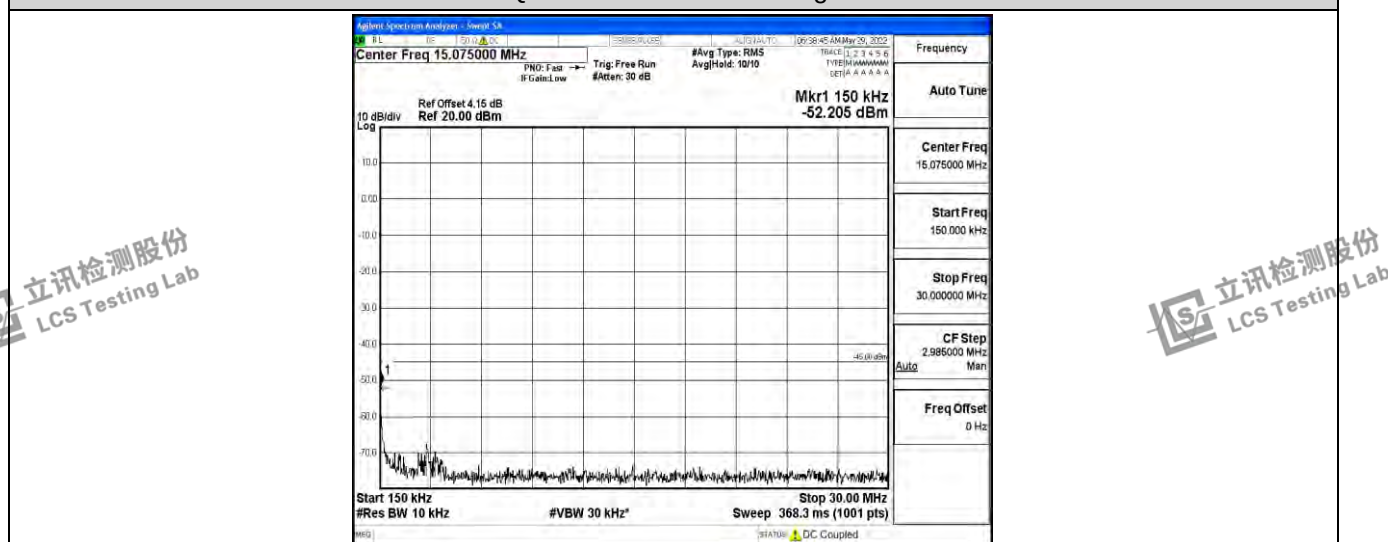


Band41-5MHz-QPSK-41565-1RB#0-Range3:30~1000MHz

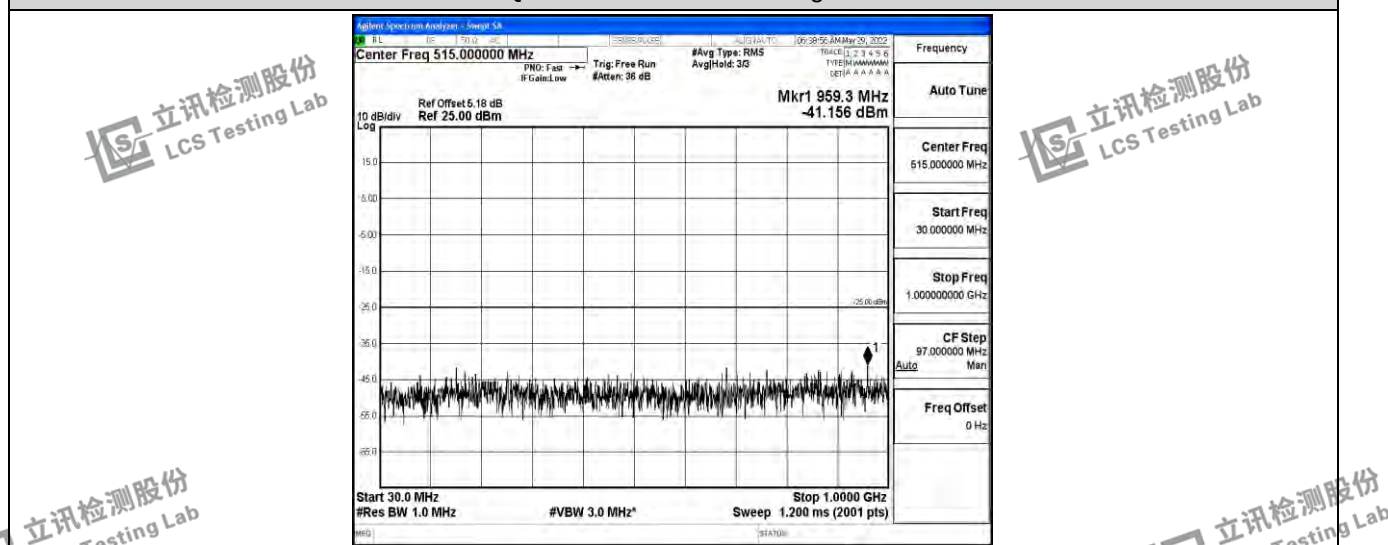


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen,
518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Band41-5MHz-QPSK-41565-1RB#0-Range4:1000~10000MHz

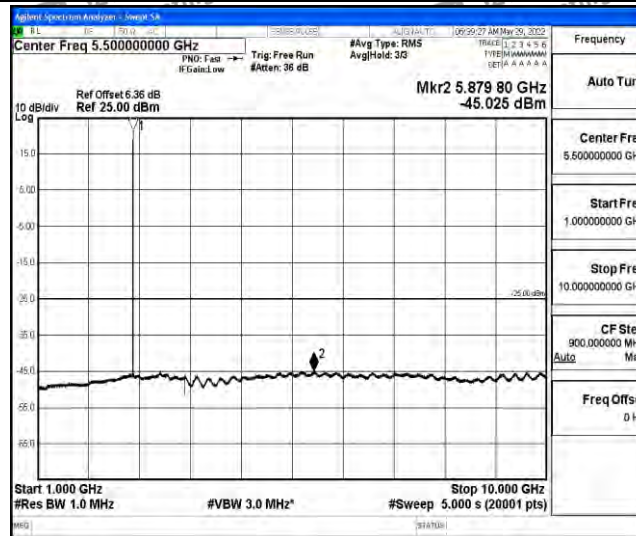


Band41-5MHz-QPSK-41565-1RB#0-Range5:10000~20000MHz

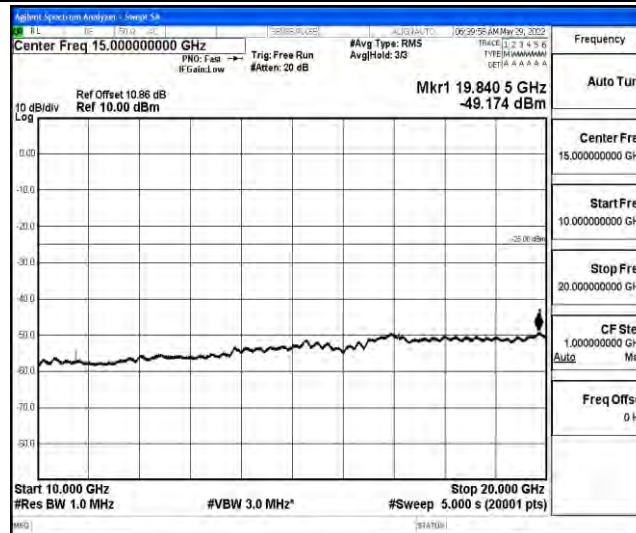


Band41-5MHz-QPSK-41565-1RB#0-Range6:20000~26500MHz




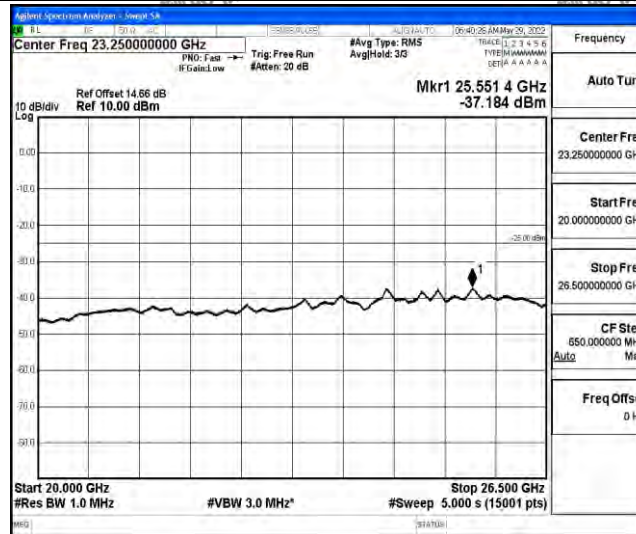

Band41-5MHz-16QAM-39675-1RB#0-Range1:0.009~0.15MHz

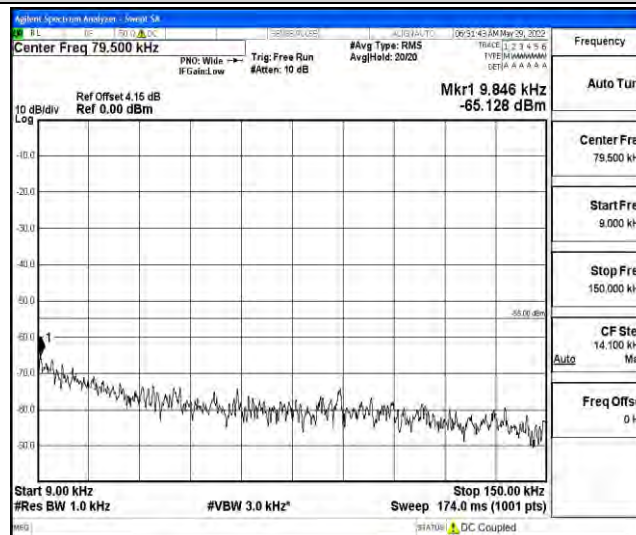


Band41-5MHz-16QAM-39675-1RB#0-Range2:0.15~30MHz

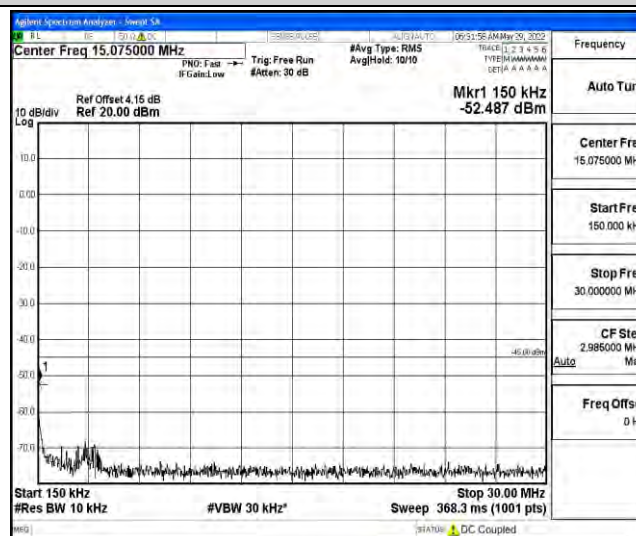




Band41-5MHz-16QAM-39675-1RB#0-Range3:30~1000MHz

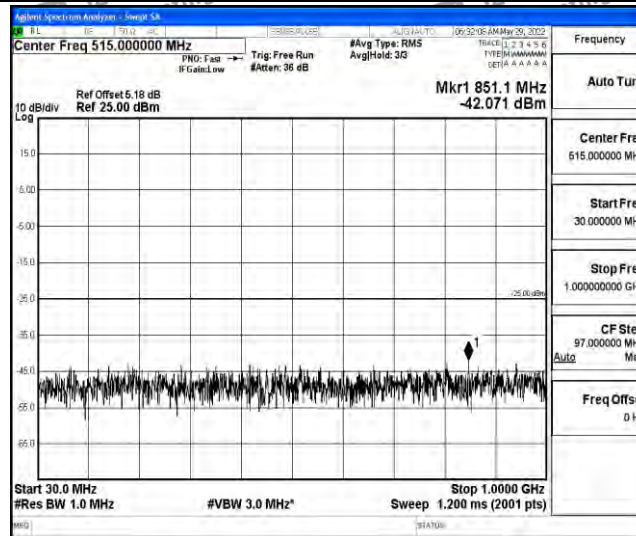


Band41-5MHz-16QAM-39675-1RB#0-Range4:1000~10000MHz

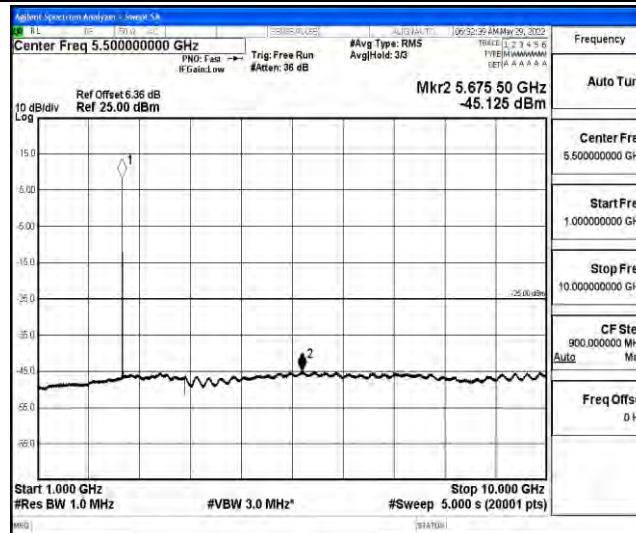


Band41-5MHz-16QAM-39675-1RB#0-Range5:10000~20000MHz




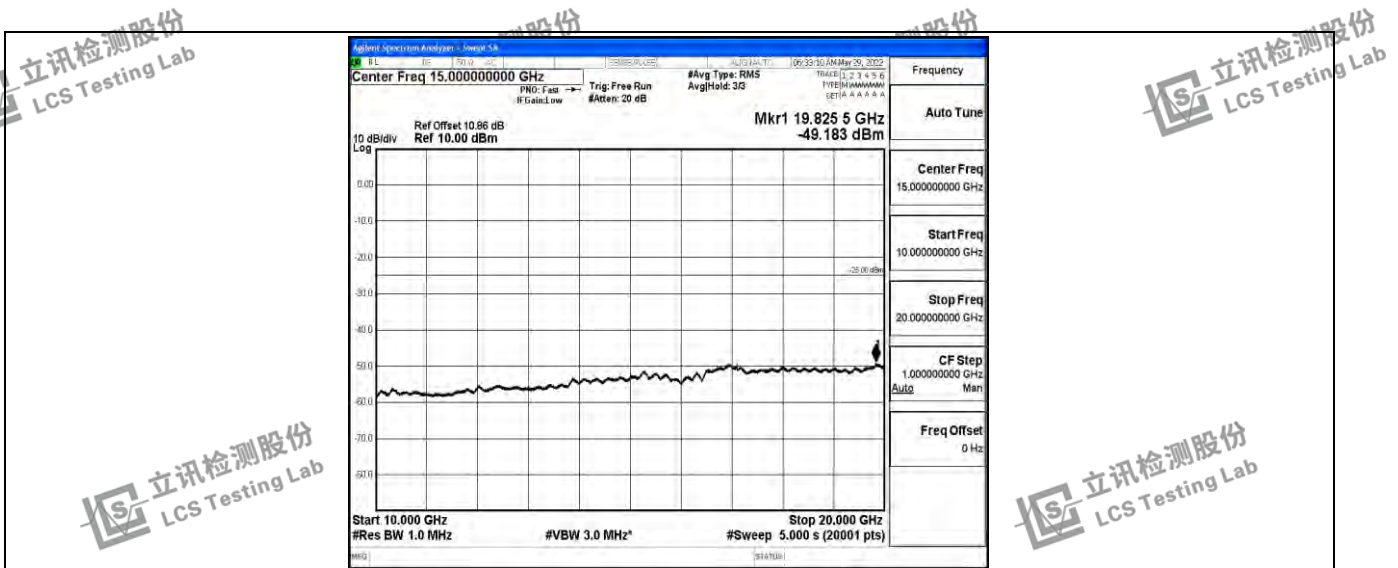

Band41-5MHz-16QAM-39675-1RB#0-Range6:20000~26500MHz

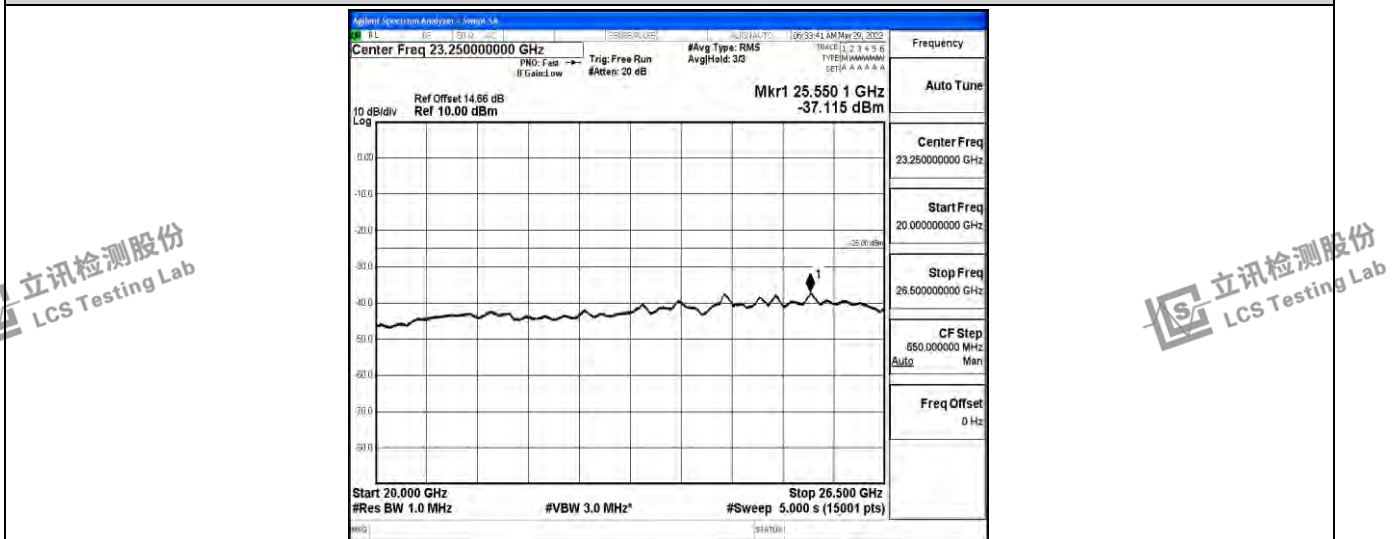


Band41-5MHz-16QAM-40620-1RB#0-Range1:0.009~0.15MHz

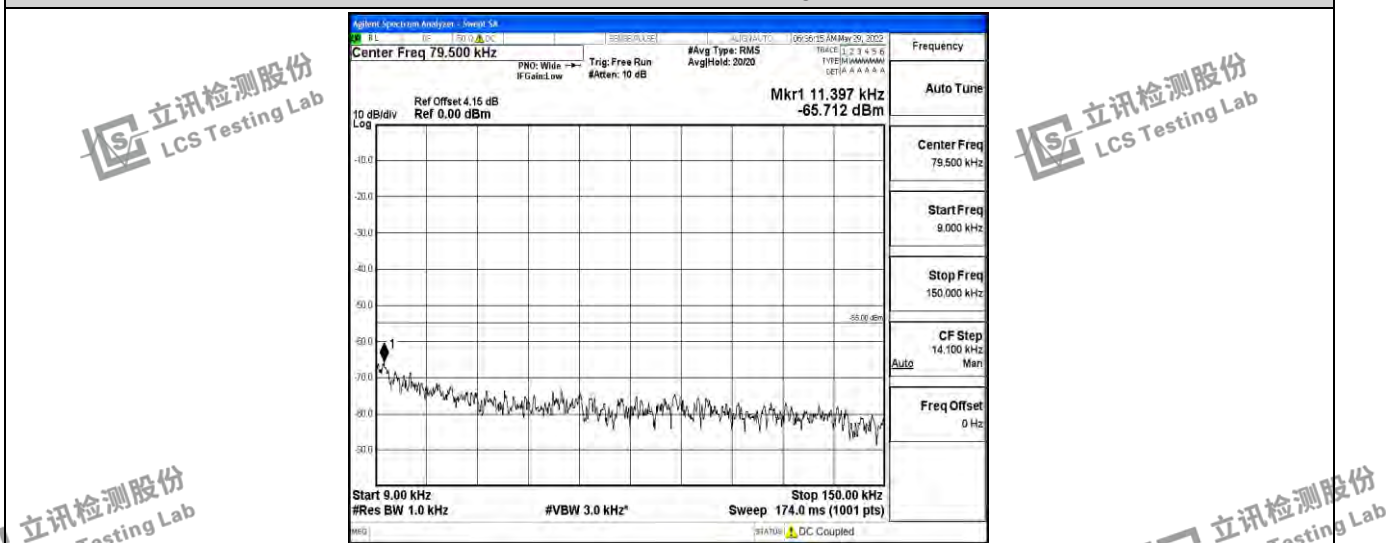




Band41-5MHz-16QAM-40620-1RB#0-Range2:0.15~30MHz

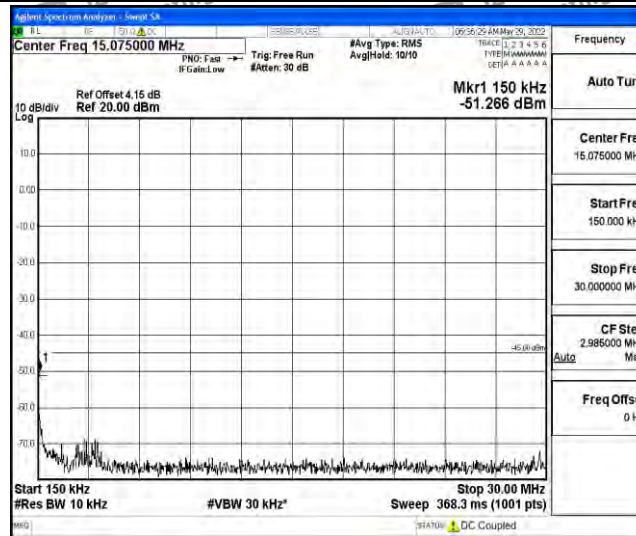


Band41-5MHz-16QAM-40620-1RB#0-Range3:30~1000MHz

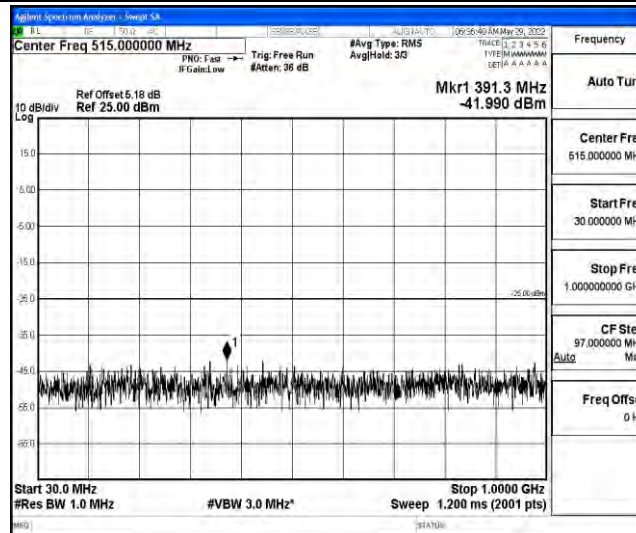


Band41-5MHz-16QAM-40620-1RB#0-Range4:1000~10000MHz




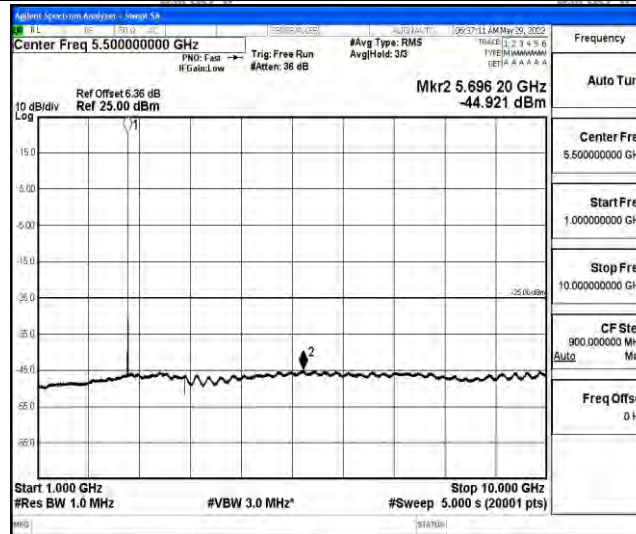

Band41-5MHz-16QAM-40620-1RB#0-Range5:10000~20000MHz

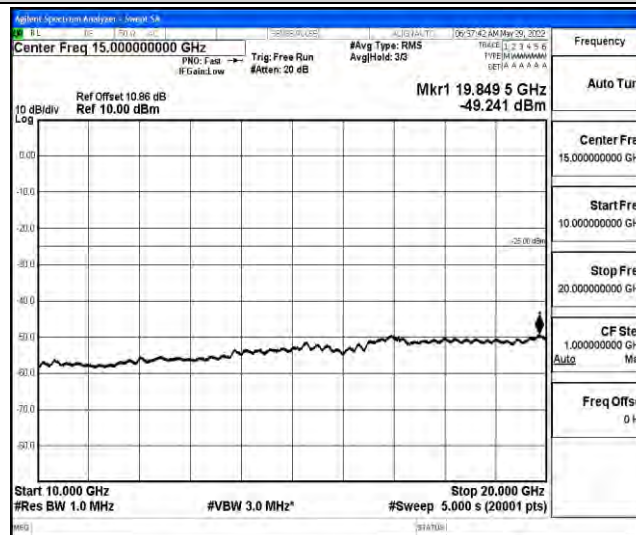


Band41-5MHz-16QAM-40620-1RB#0-Range6:20000~26500MHz

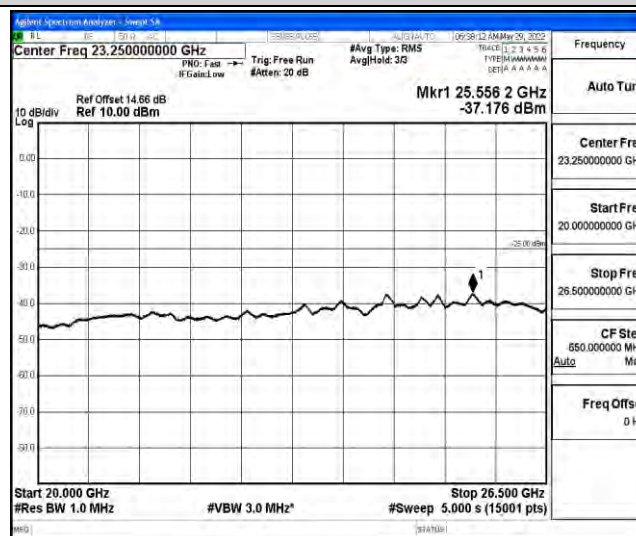




Band41-5MHz-16QAM-41565-1RB#0-Range1:0.009~0.15MHz

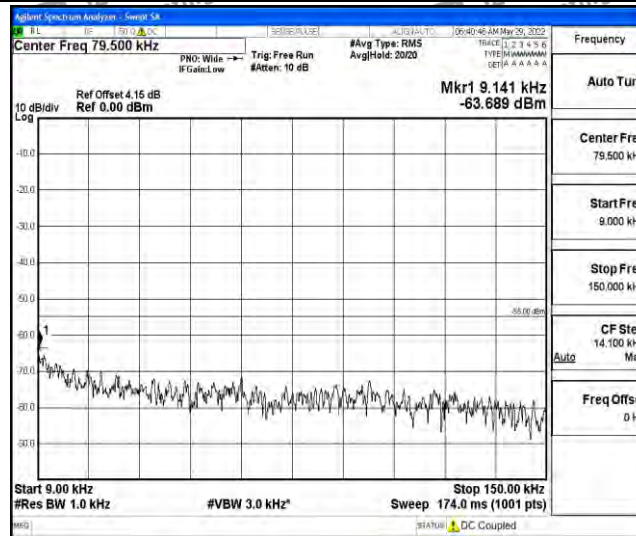


Band41-5MHz-16QAM-41565-1RB#0-Range2:0.15~30MHz

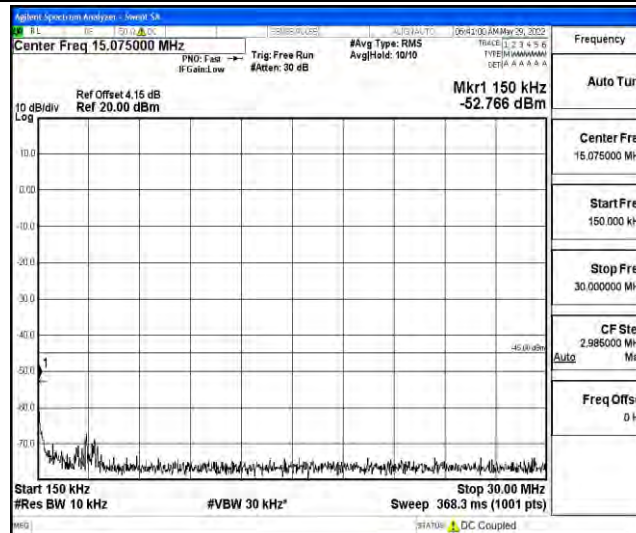


Band41-5MHz-16QAM-41565-1RB#0-Range3:30~1000MHz




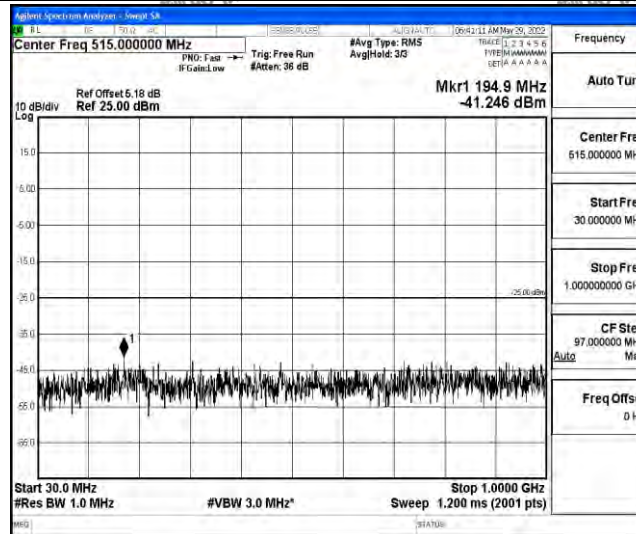

Band41-5MHz-16QAM-41565-1RB#0-Range4:1000~10000MHz

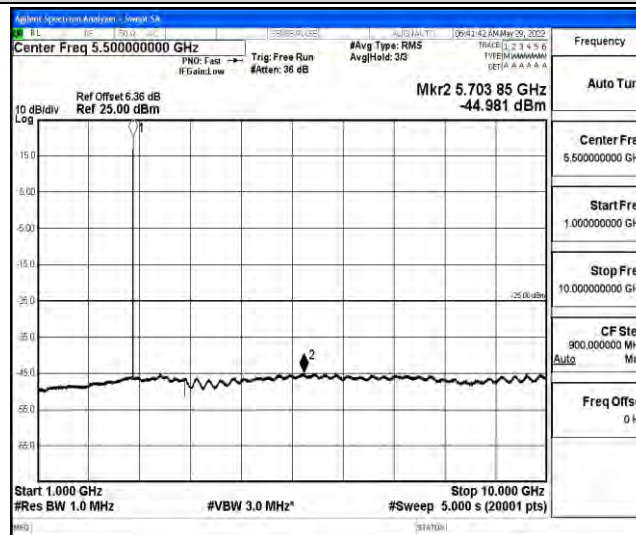


Band41-5MHz-16QAM-41565-1RB#0-Range5:10000~20000MHz

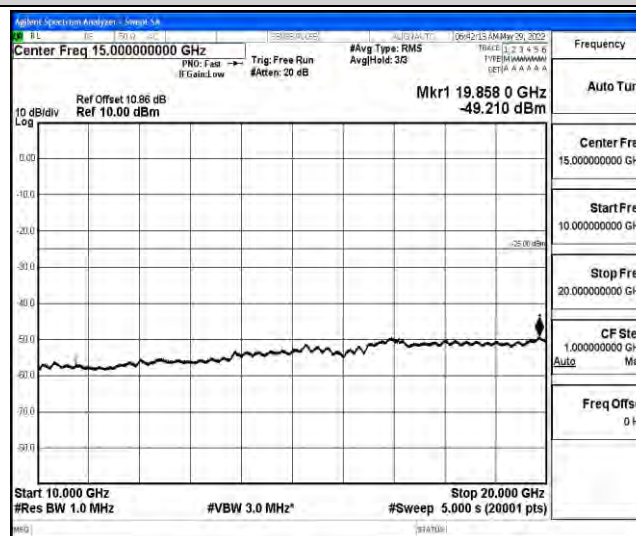


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Band41-5MHz-16QAM-41565-1RB#0-Range6:20000~26500MHz

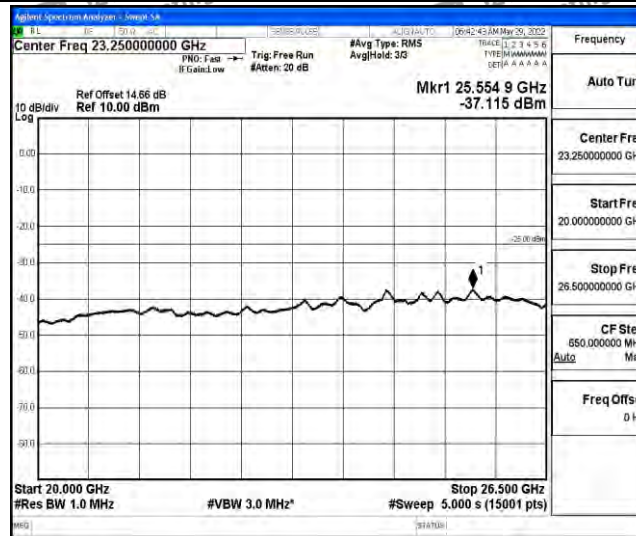


Band41-10MHz-QPSK-39700-1RB#0-Range1:0.009~0.15MHz

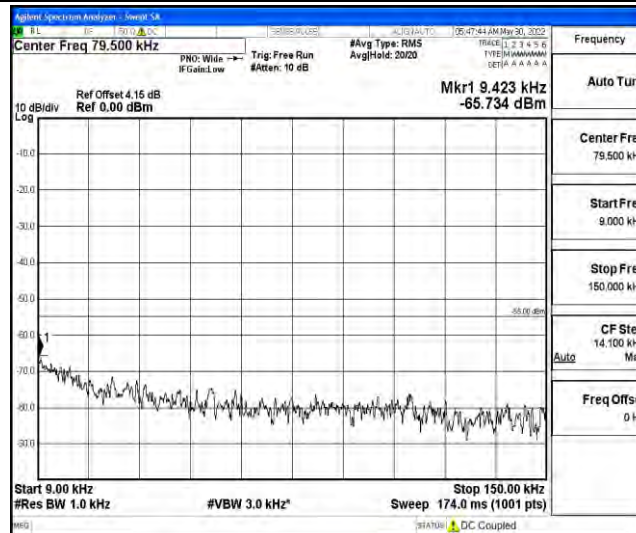


Band41-10MHz-QPSK-39700-1RB#0-Range2:0.15~30MHz




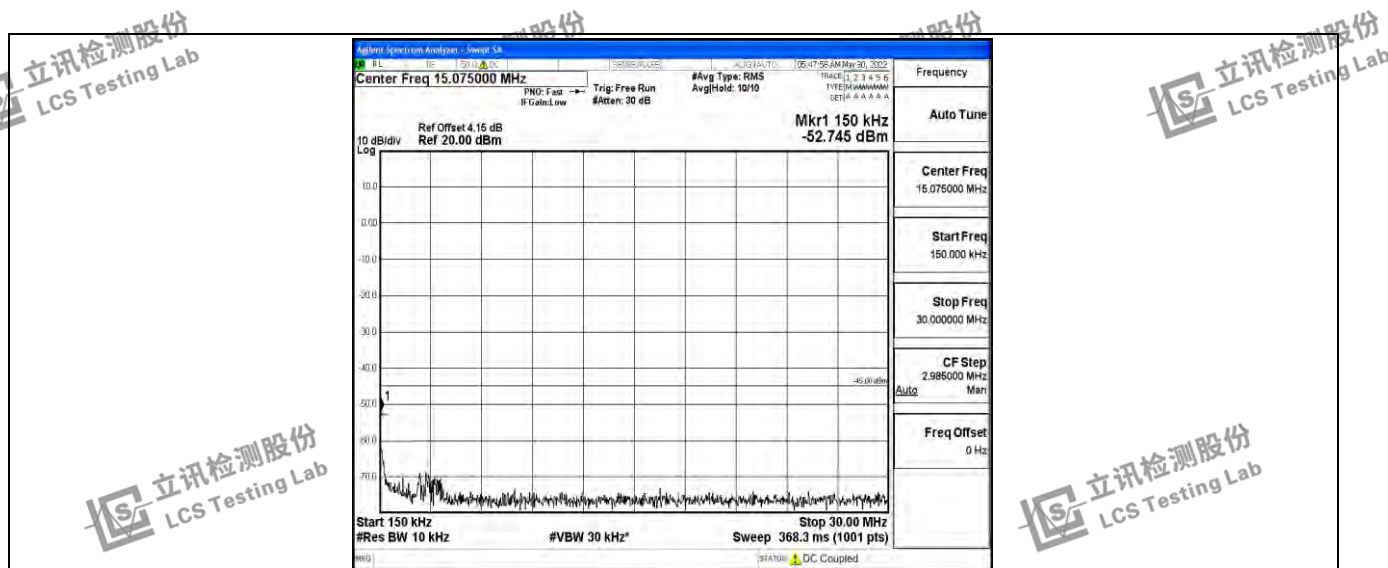

Band41-10MHz-QPSK-39700-1RB#0-Range3:30~1000MHz

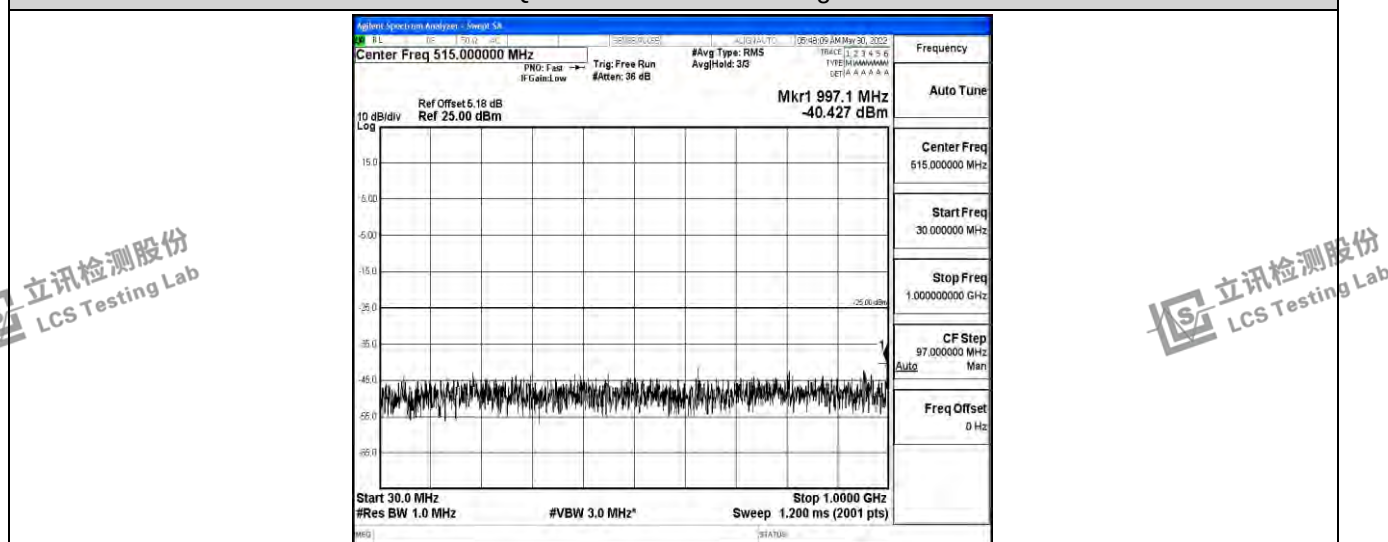


Band41-10MHz-QPSK-39700-1RB#0-Range4:1000~10000MHz

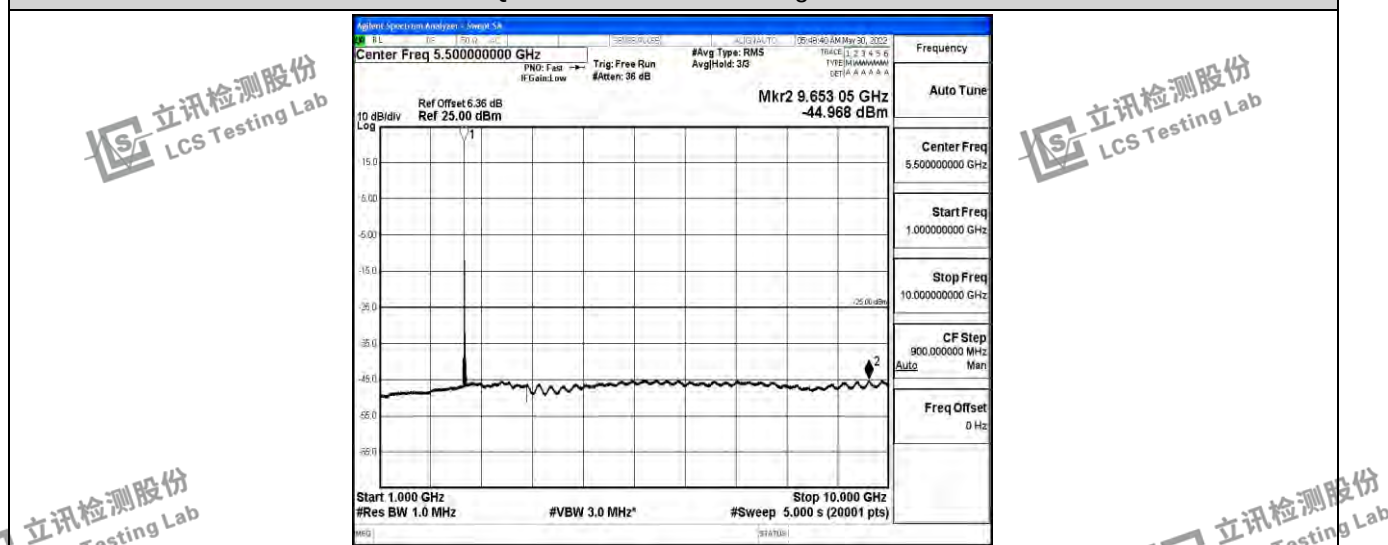


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen,
518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

Band41-10MHz-QPSK-39700-1RB#0-Range5:10000~20000MHz

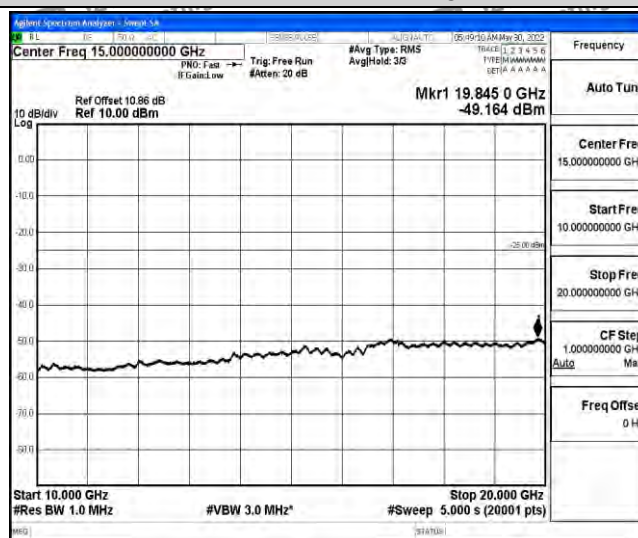


Band1-10MHz-QPSK-39700-1RB#0-Range6:20000~26500MHz

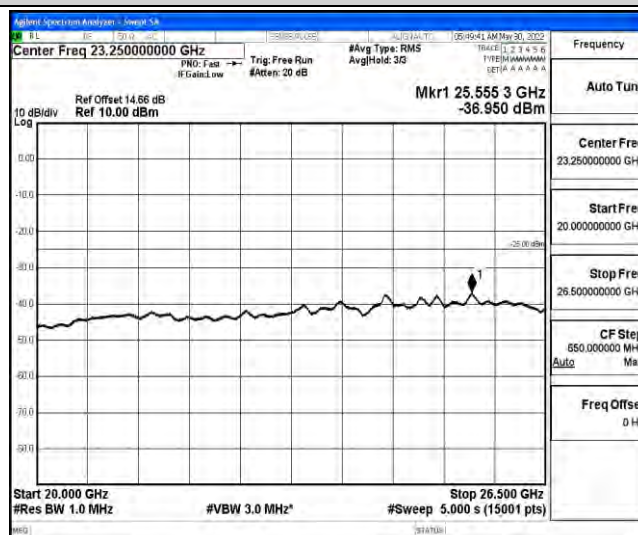


Band41-10MHz-QPSK-40620-1RB#0-Range1:0.009~0.15MHz




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen,
518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

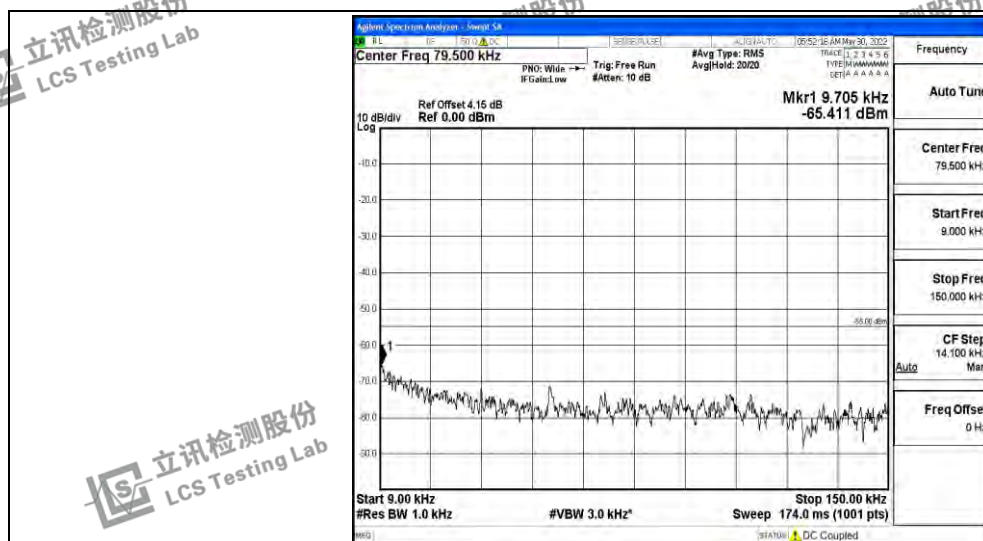

Band41-10MHz-QPSK-40620-1RB#0-Range2:0.15~30MHz

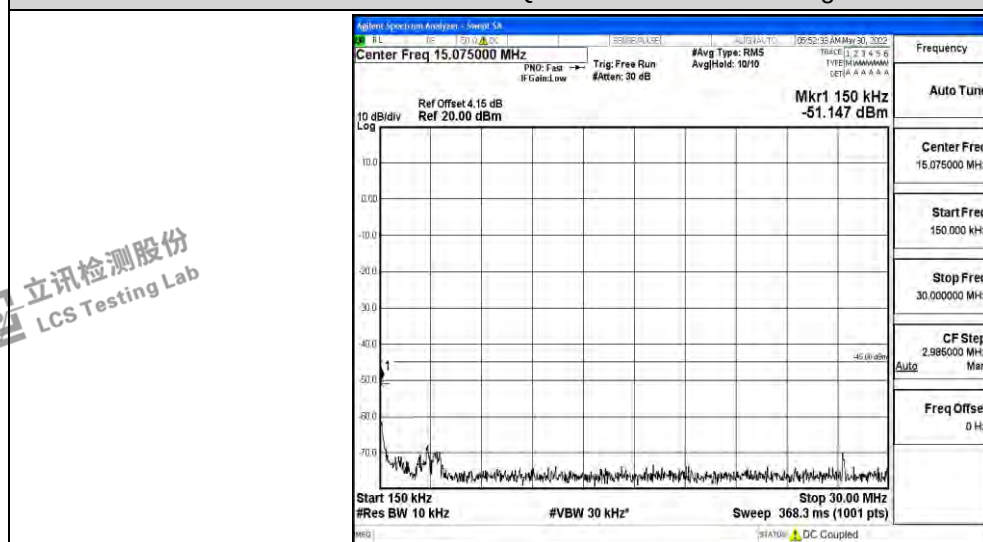


Band41-10MHz-QPSK-40620-1RB#0-Range3:30~1000MHz

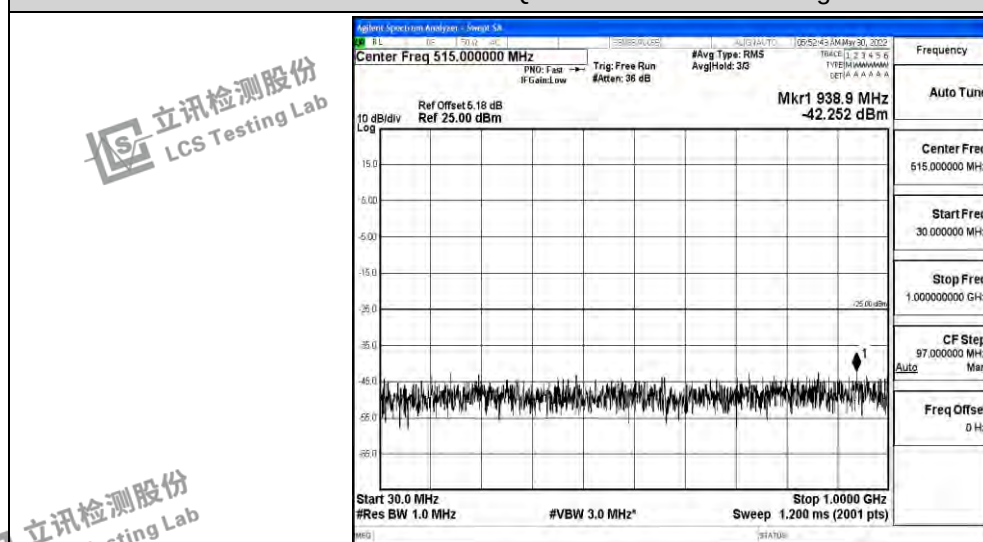


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen,
518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Band41-10MHz-QPSK-40620-1RB#0-Range4:1000~10000MHz

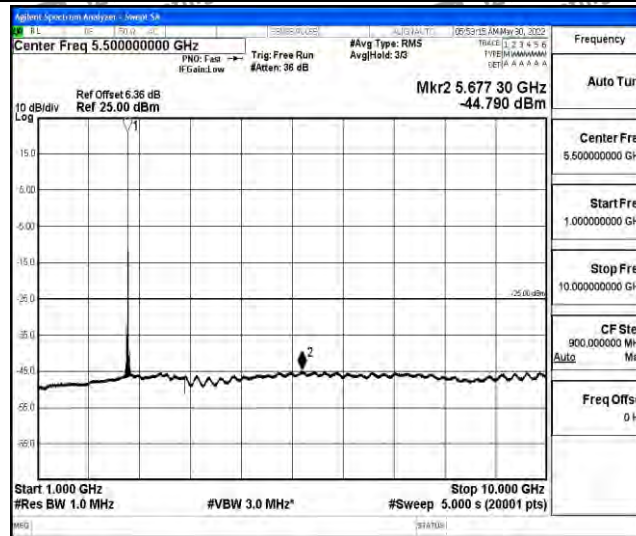

Band41-10MHz-QPSK-40620-1RB#0-Range5:10000~20000MHz

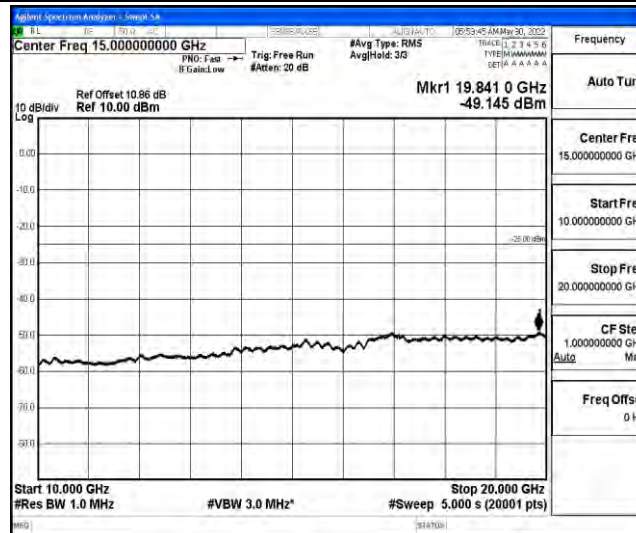


Band41-10MHz-QPSK-40620-1RB#0-Range6:20000~26500MHz






Band41-10MHz-QPSK-41540-1RB#0-Range1:0.009~0.15MHz

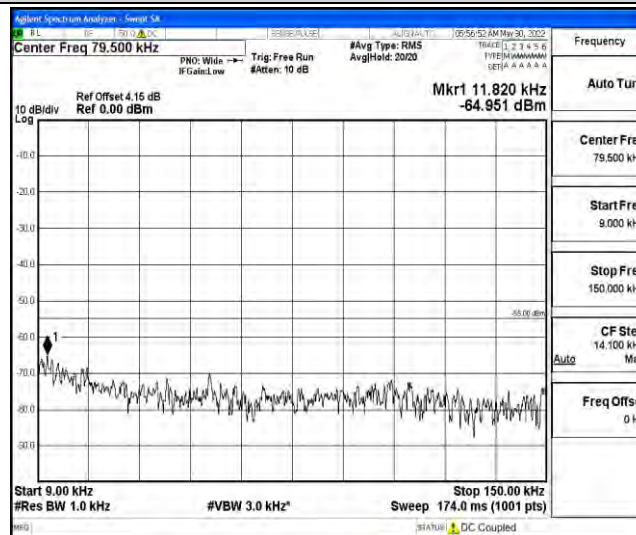


Band41-10MHz-QPSK-41540-1RB#0-Range2:0.15~30MHz

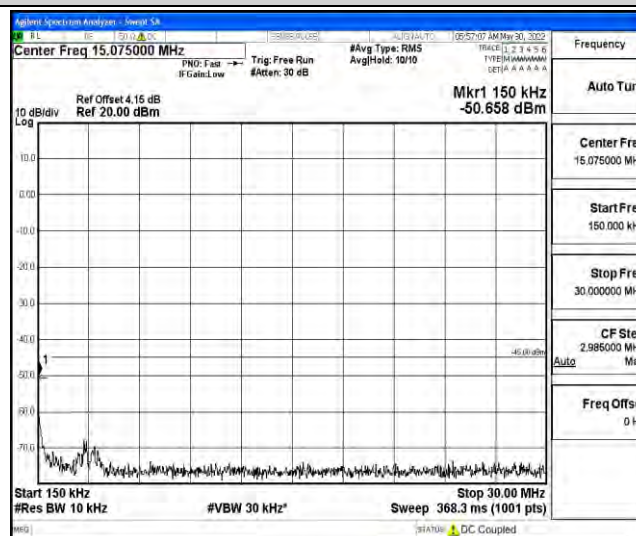




Band41-10MHz-QPSK-41540-1RB#0-Range3:30~1000MHz

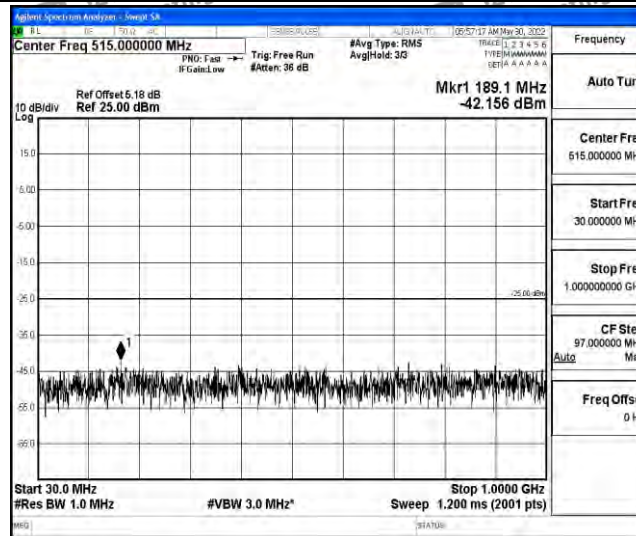


Band41-10MHz-QPSK-41540-1RB#0-Range4:1000~10000MHz

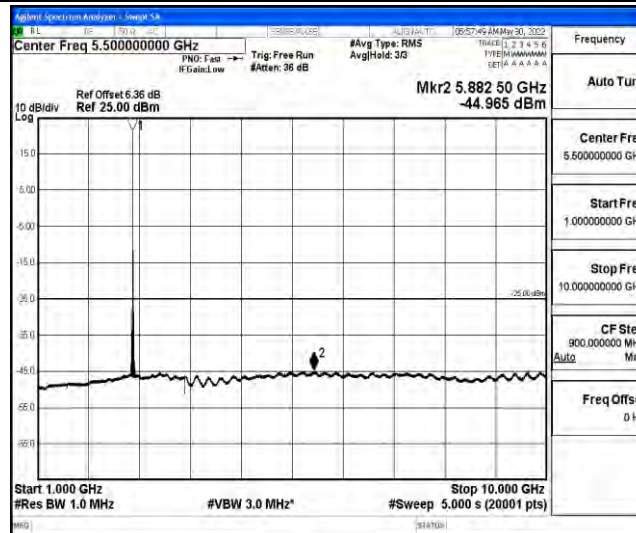


Band41-10MHz-QPSK-41540-1RB#0-Range5:10000~20000MHz




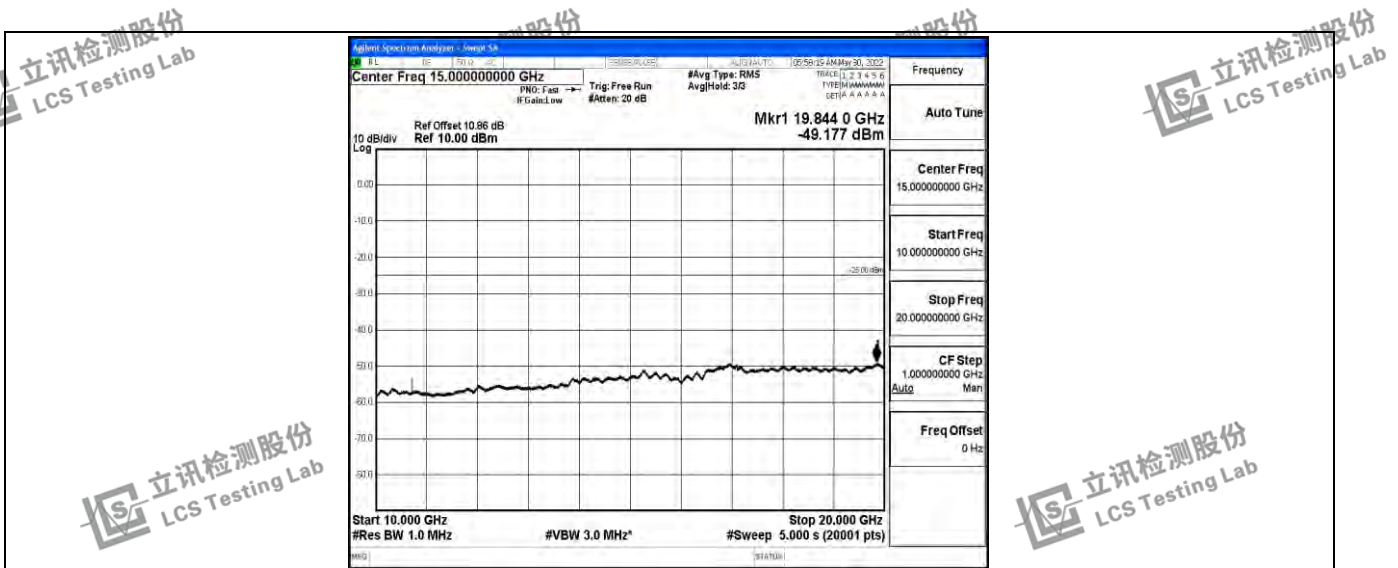

Band41-10MHz-QPSK-41540-1RB#0-Range6:20000~26500MHz

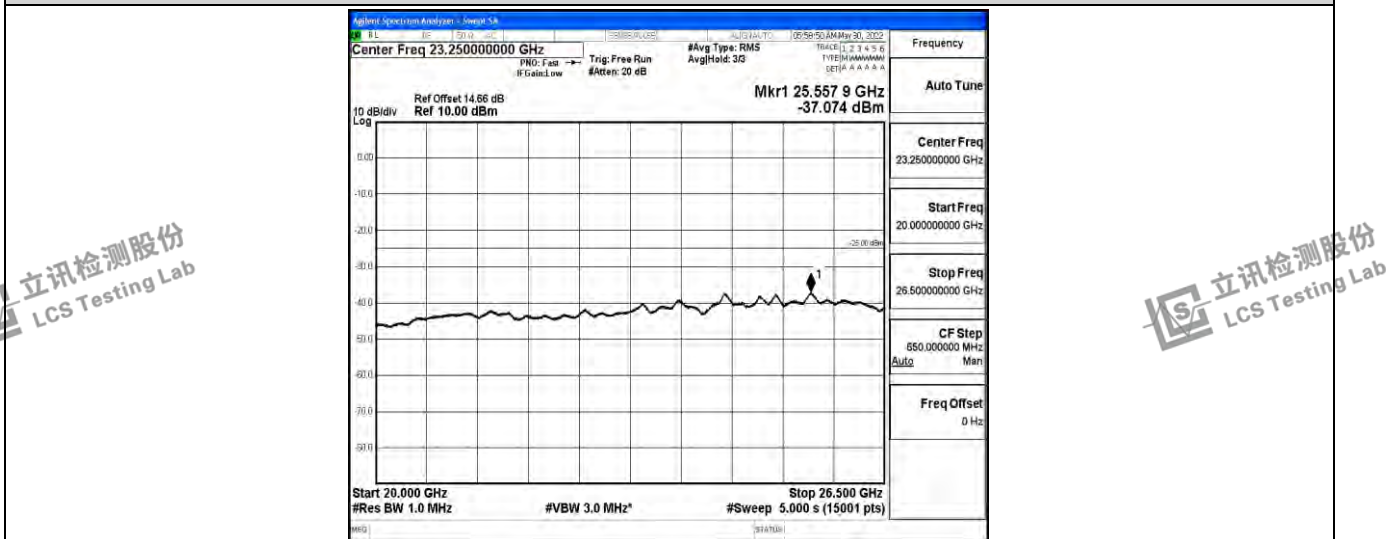


Band41-10MHz-16QAM-39700-1RB#0-Range1:0.009~0.15MHz

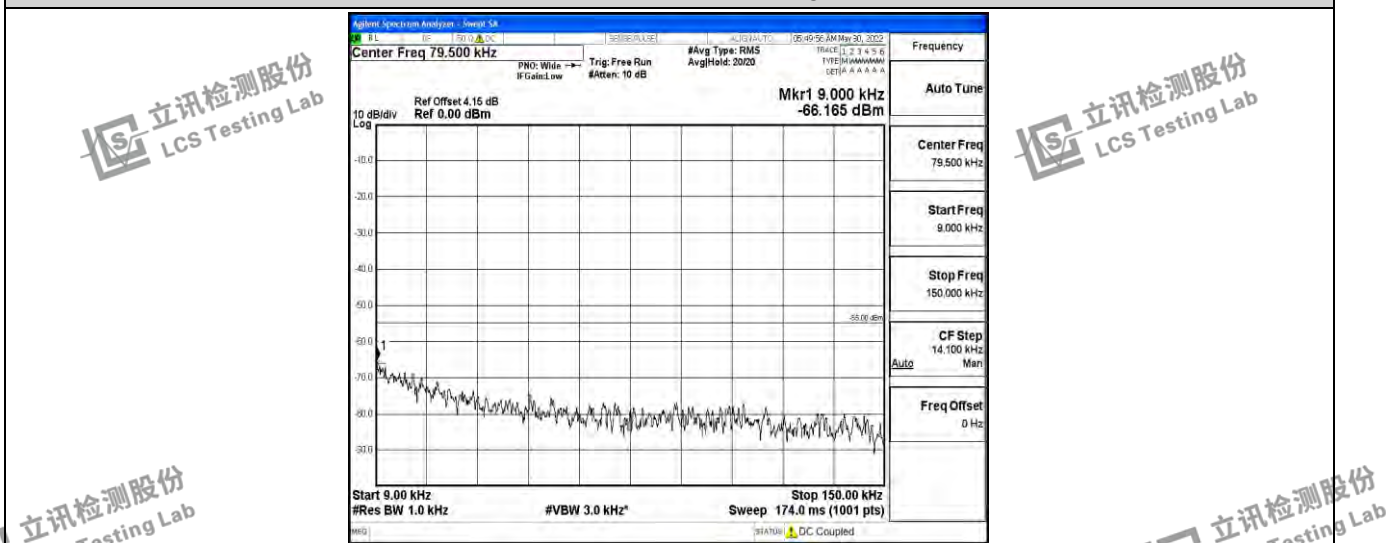




Band41-10MHz-16QAM-39700-1RB#0-Range2:0.15~30MHz

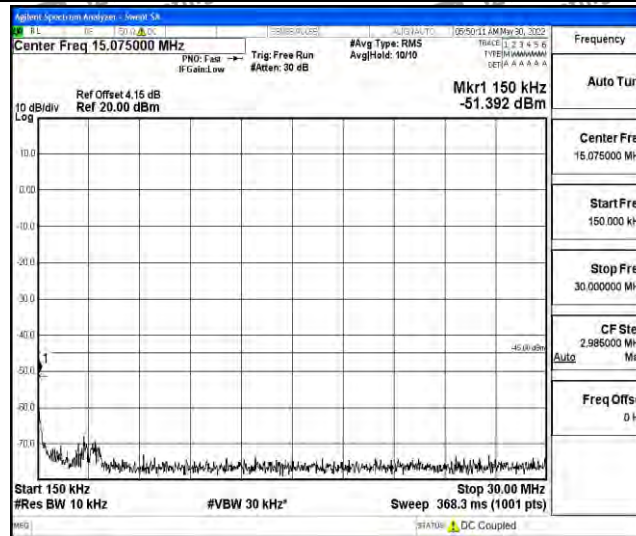


Band41-10MHz-16QAM-39700-1RB#0-Range3:30~1000MHz

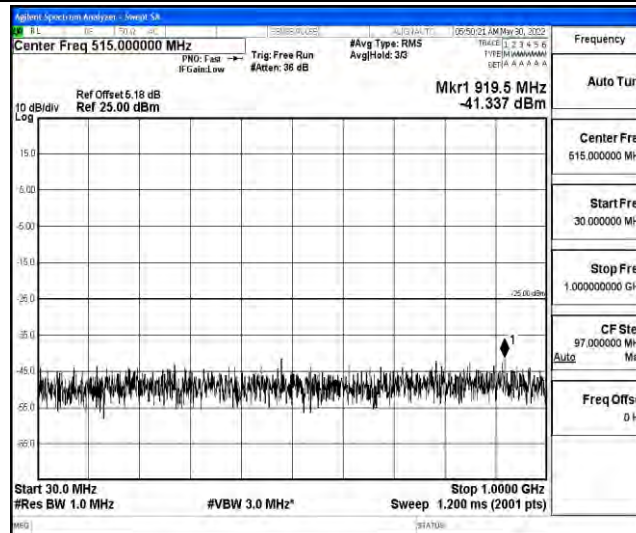


Band41-10MHz-16QAM-39700-1RB#0-Range4:1000~10000MHz




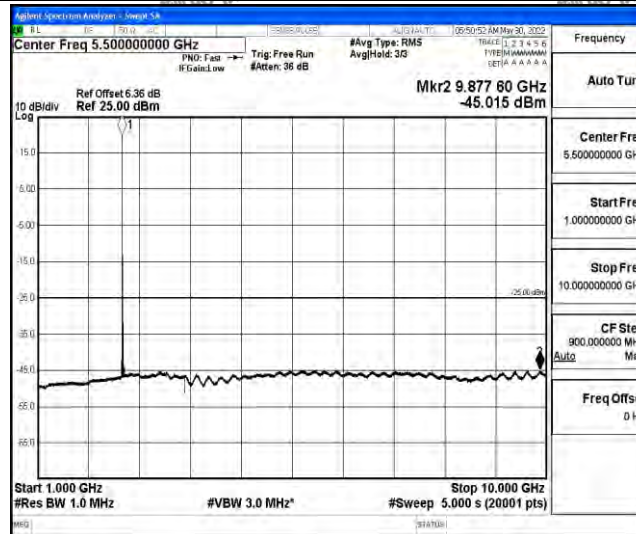

Band41-10MHz-16QAM-39700-1RB#0-Range5:10000~20000MHz

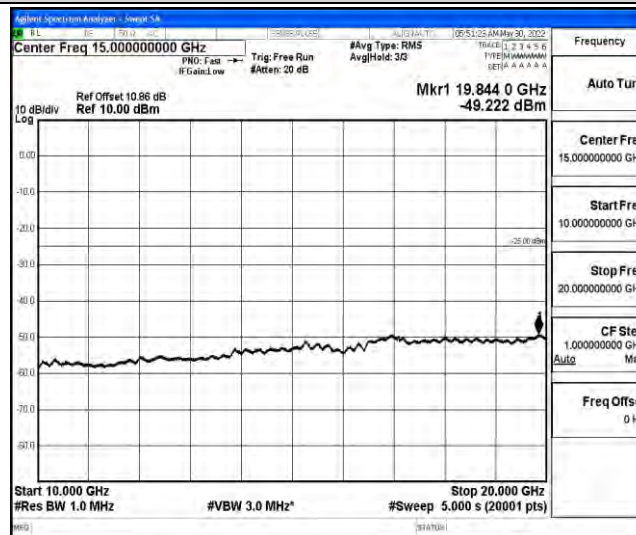


Band41-10MHz-16QAM-39700-1RB#0-Range6:20000~26500MHz

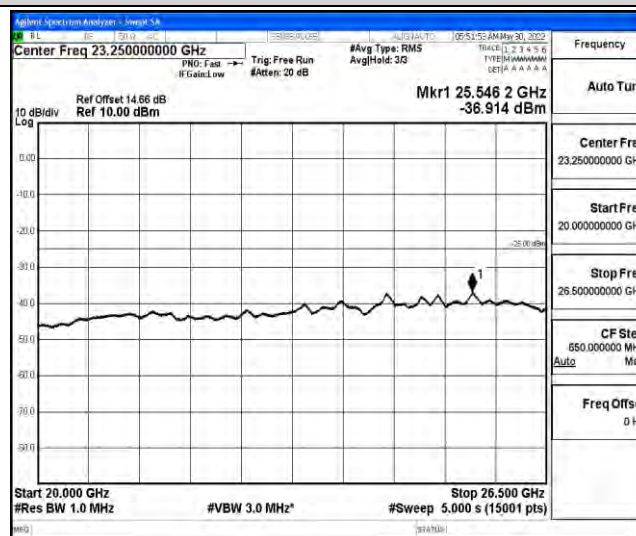




Band41-10MHz-16QAM-40620-1RB#0-Range1:0.009~0.15MHz

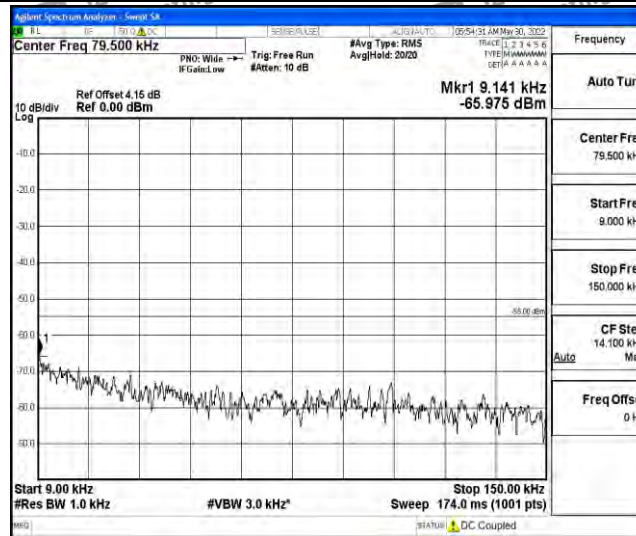


Band41-10MHz-16QAM-40620-1RB#0-Range2:0.15~30MHz

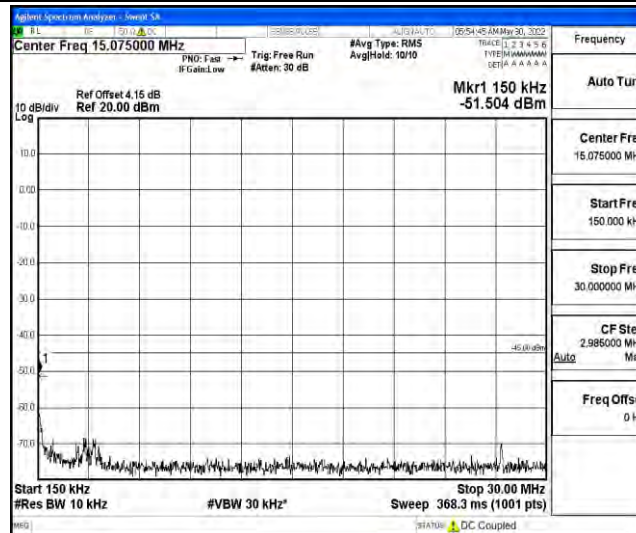


Band41-10MHz-16QAM-40620-1RB#0-Range3:30~1000MHz




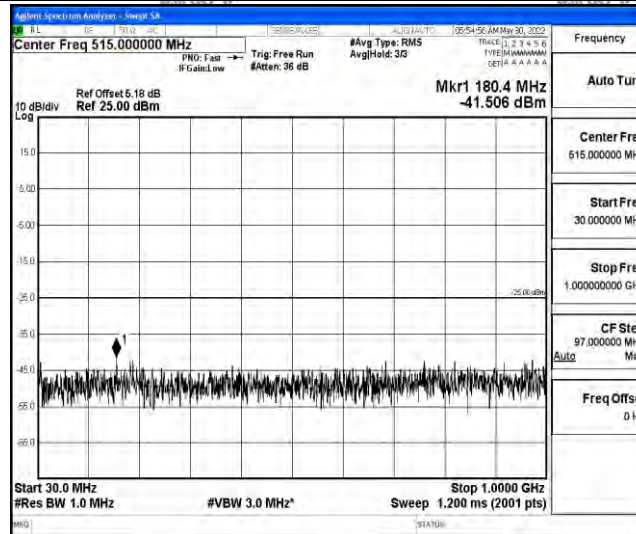

Band41-10MHz-16QAM-40620-1RB#0-Range4:1000~10000MHz

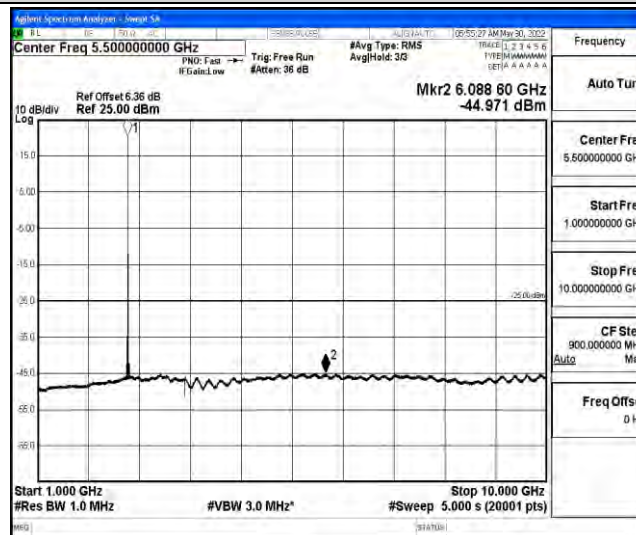


Band41-10MHz-16QAM-40620-1RB#0-Range5:10000~20000MHz

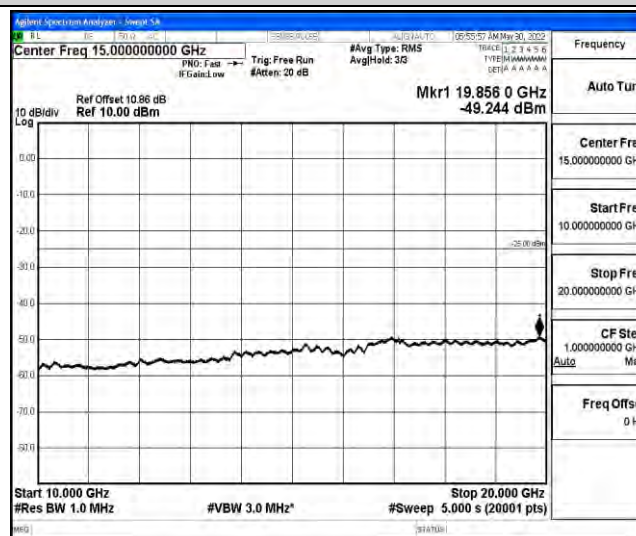


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Band41-10MHz-16QAM-40620-1RB#0-Range6:20000~26500MHz

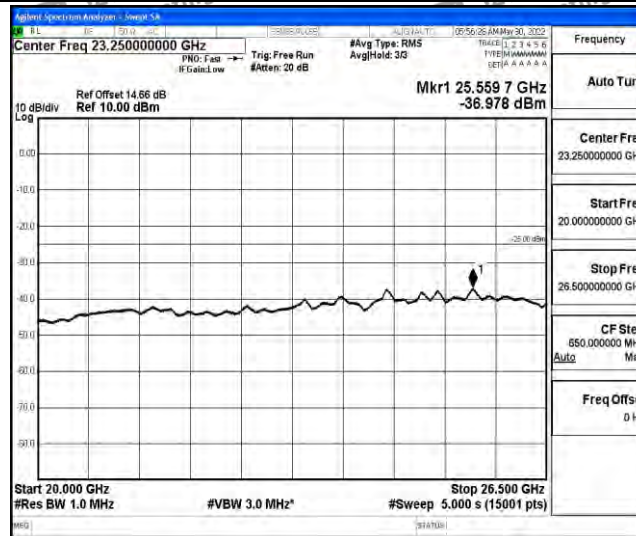


Band41-10MHz-16QAM-41540-1RB#0-Range1:0.009~0.15MHz

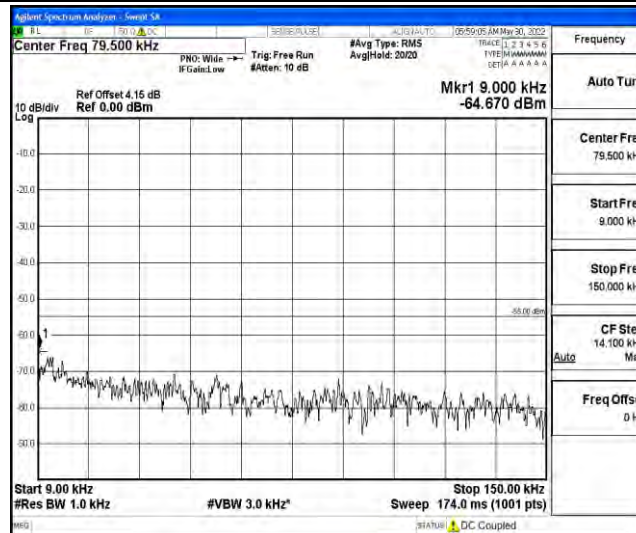


Band41-10MHz-16QAM-41540-1RB#0-Range2:0.15~30MHz




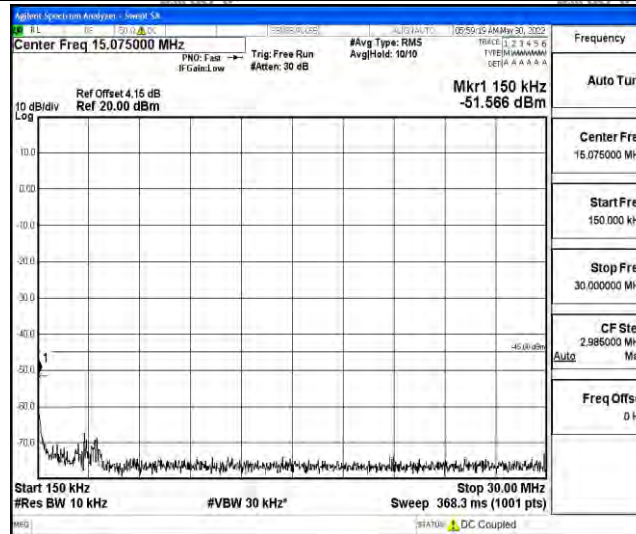

Band41-10MHz-16QAM-41540-1RB#0-Range3:30~1000MHz

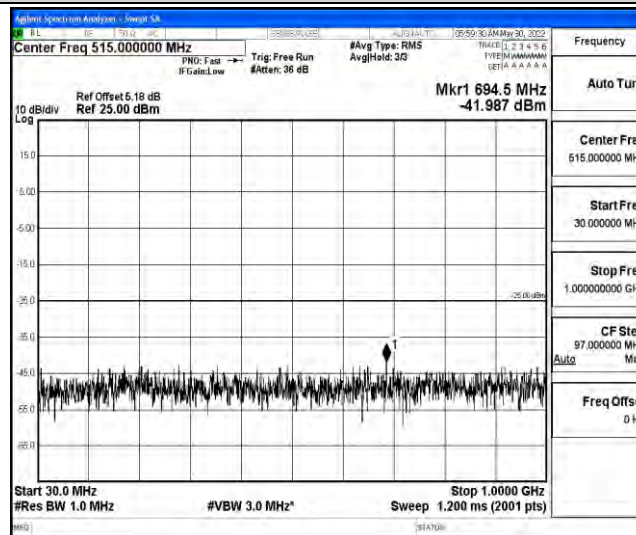


Band41-10MHz-16QAM-41540-1RB#0-Range4:1000~10000MHz

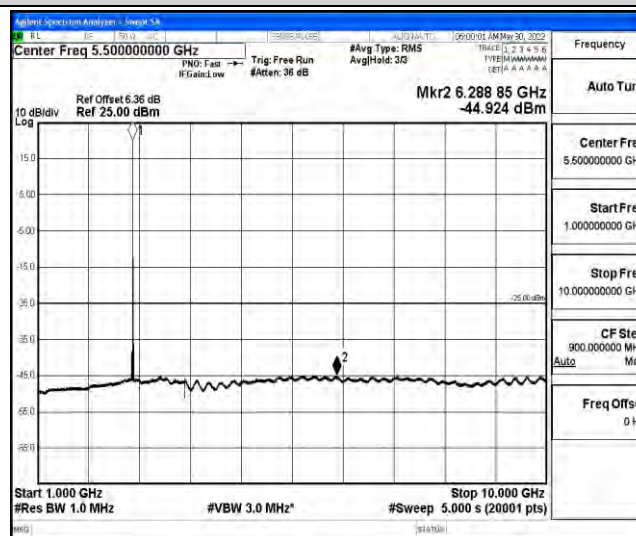


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Band41-10MHz-16QAM-41540-1RB#0-Range5:10000~20000MHz

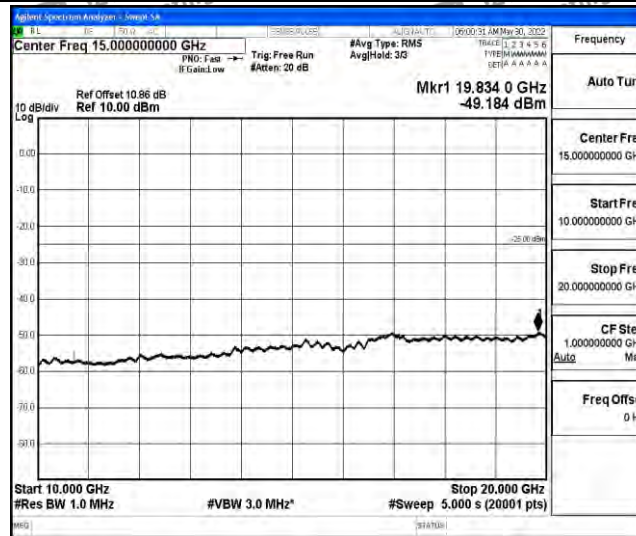


Band41-10MHz-16QAM-41540-1RB#0-Range6:20000~26500MHz

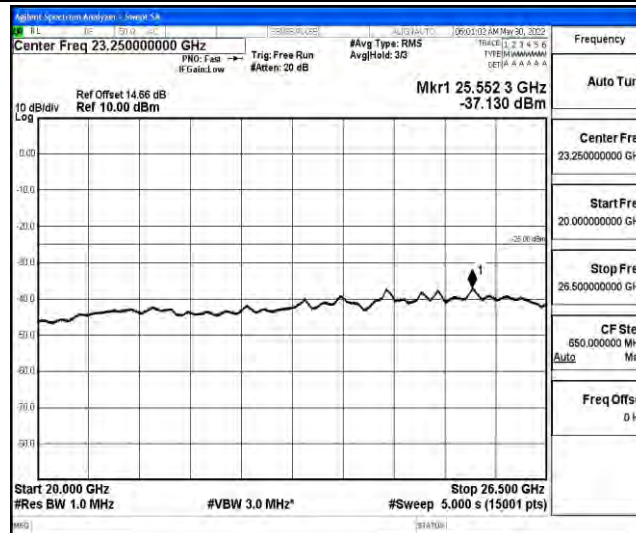


Band41-15MHz-QPSK-39725-1RB#0-Range1:0.009~0.15MHz




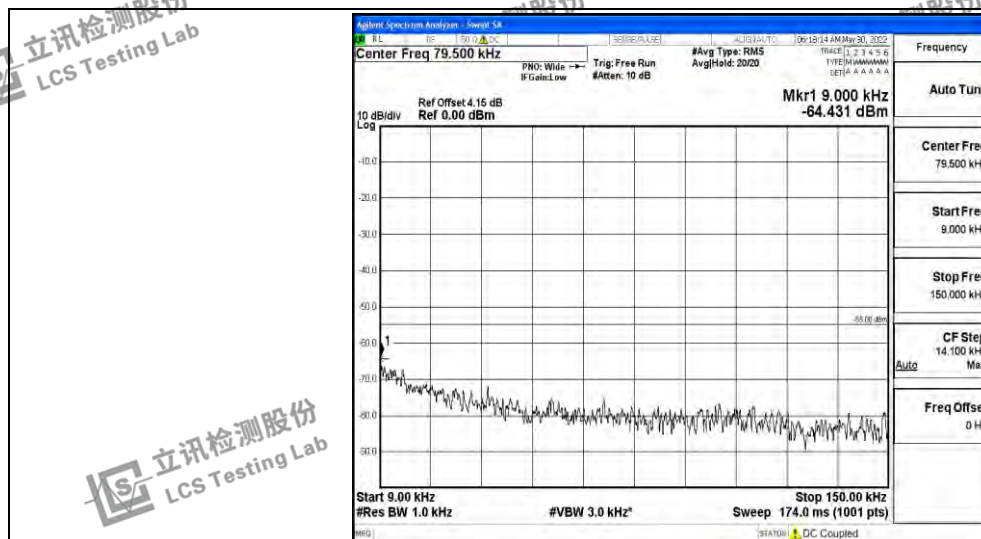

Band41-15MHz-QPSK-39725-1RB#0-Range2:0.15~30MHz

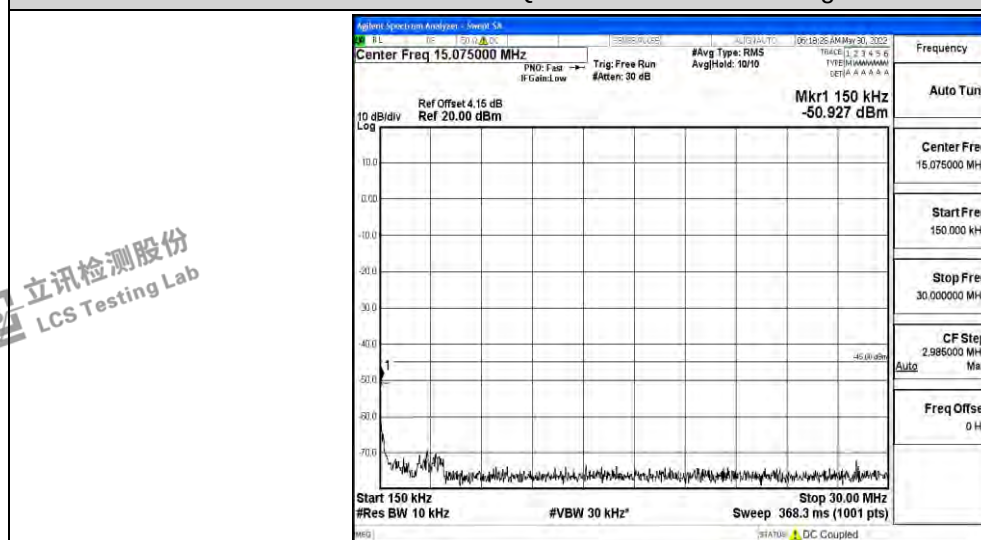


Band41-15MHz-QPSK-39725-1RB#0-Range3:30~1000MHz

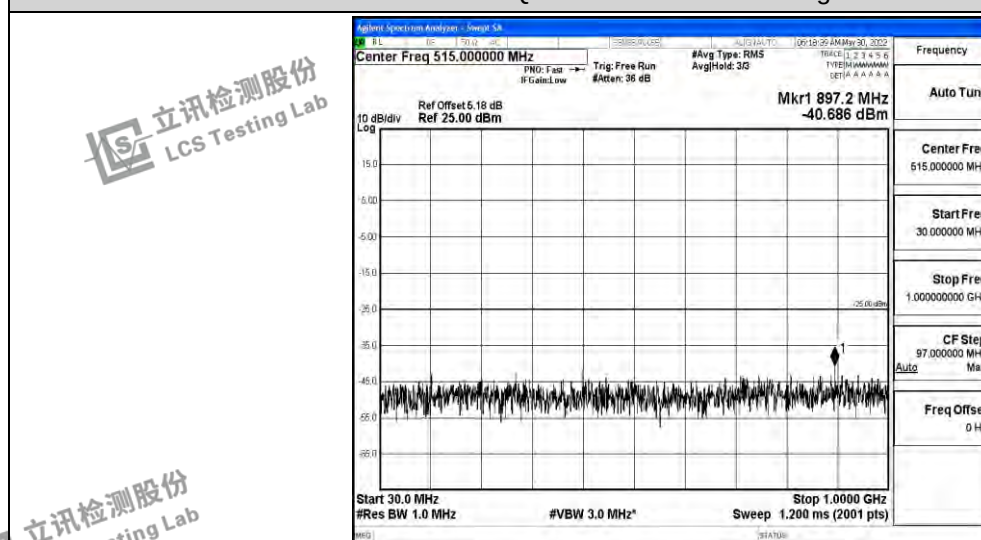


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen,
518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Band41-15MHz-QPSK-39725-1RB#0-Range4:1000~10000MHz

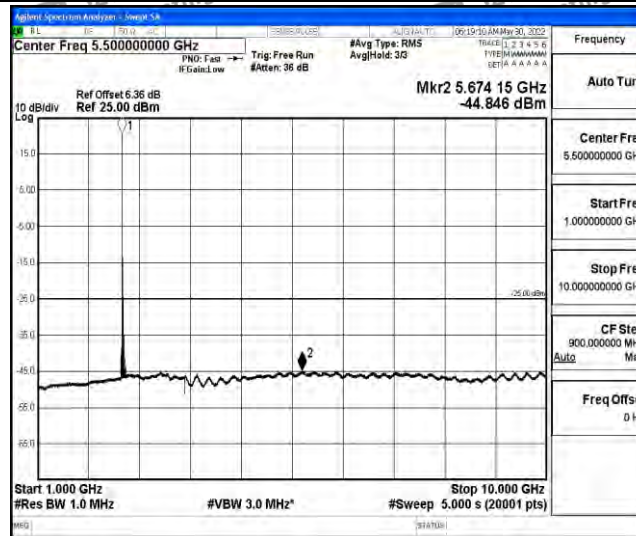


Band41-15MHz-QPSK-39725-1RB#0-Range5:10000~20000MHz

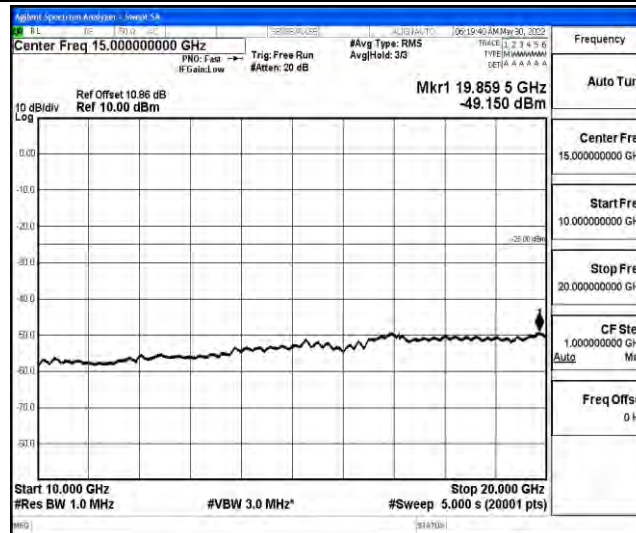


Band41-15MHz-QPSK-39725-1RB#0-Range6:20000~26500MHz




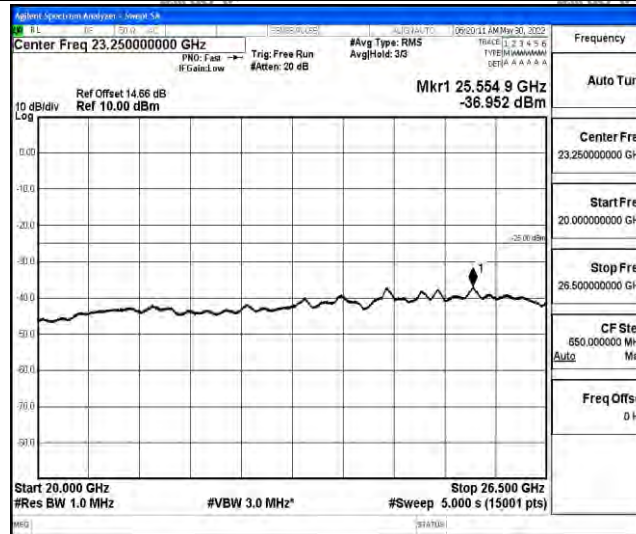

Band41-15MHz-QPSK-40620-1RB#0-Range1:0.009~0.15MHz

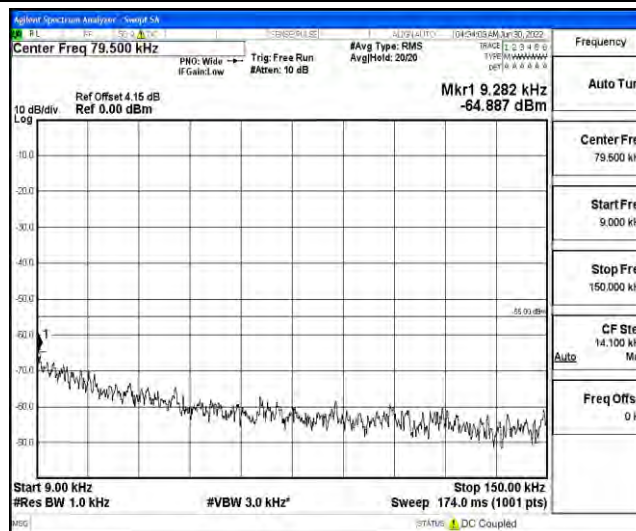


Band41-15MHz-QPSK-40620-1RB#0-Range2:0.15~30MHz

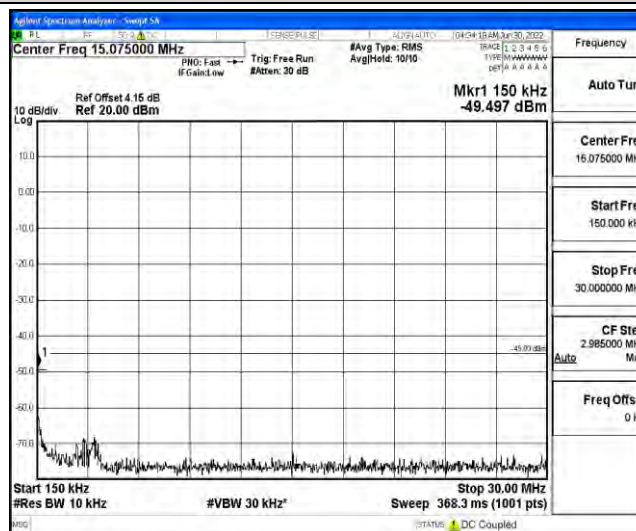




Band41-15MHz-QPSK-40620-1RB#0-Range3:30~1000MHz

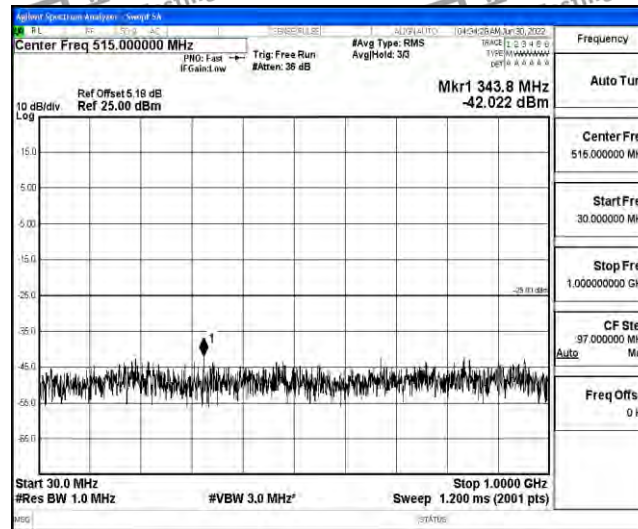


Band41-15MHz-QPSK-40620-1RB#0-Range4:1000~10000MHz

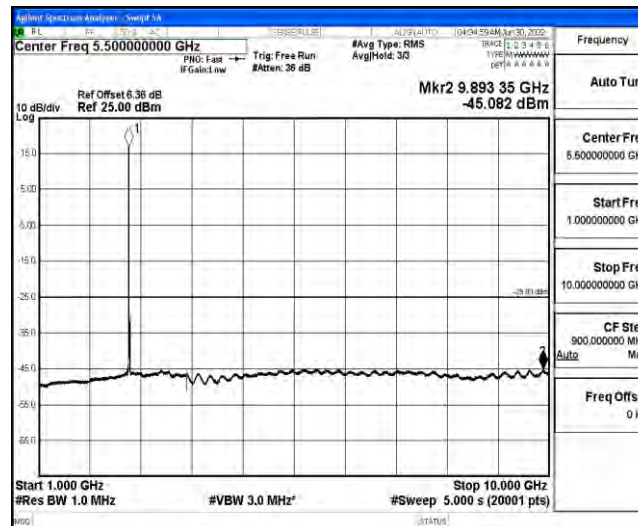


Band41-15MHz-QPSK-40620-1RB#0-Range5:10000~20000MHz




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

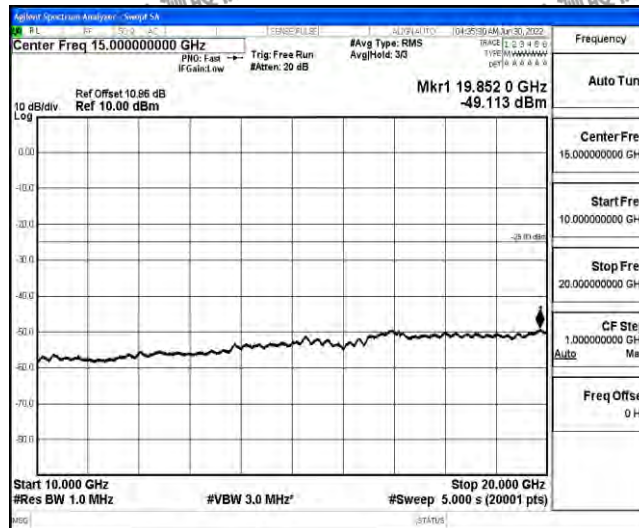

Band41-15MHz-QPSK-40620-1RB#0-Range6:20000~26500MHz

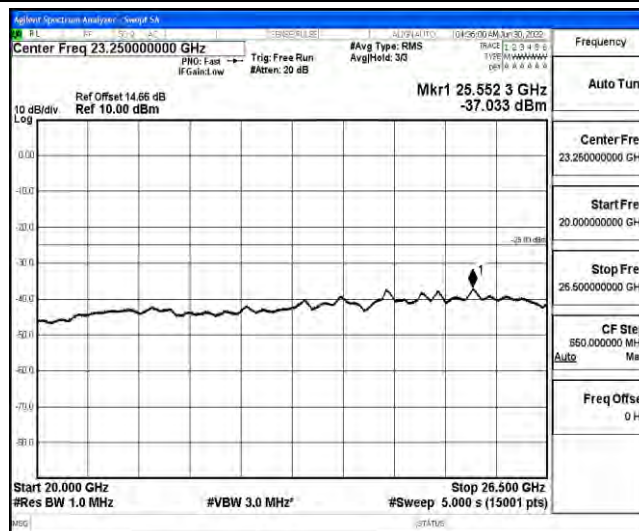


Band41-15MHz-QPSK-41515-1RB#0-Range1:0.009~0.15MHz

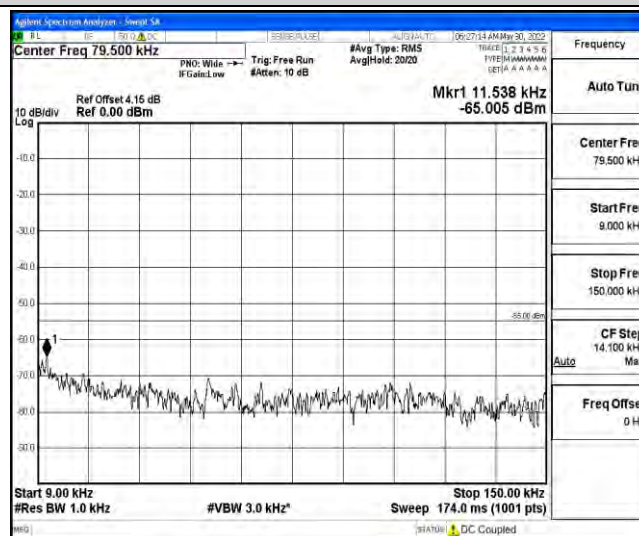




Band41-15MHz-QPSK-41515-1RB#0-Range2:0.15~30MHz

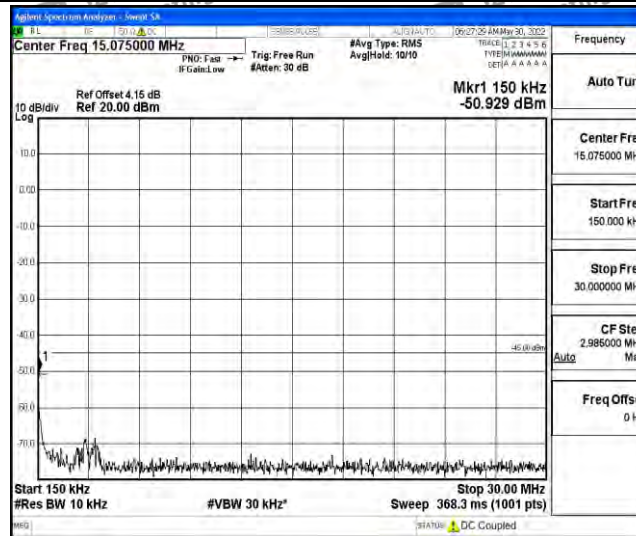


Band41-15MHz-QPSK-41515-1RB#0-Range3:30~1000MHz

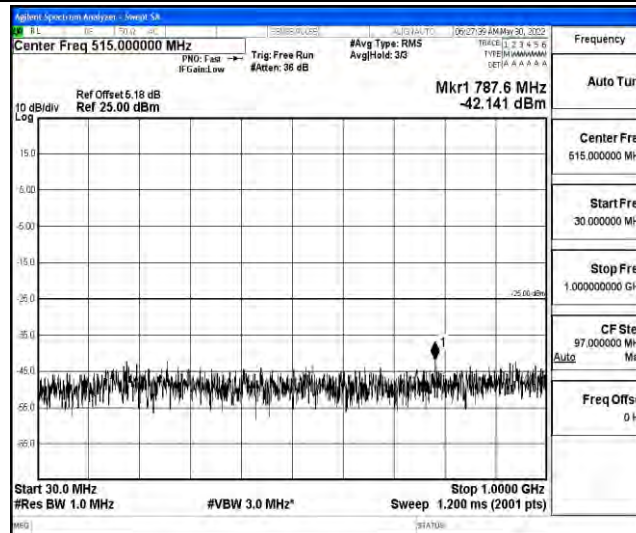


Band41-15MHz-QPSK-41515-1RB#0-Range4:1000~10000MHz




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

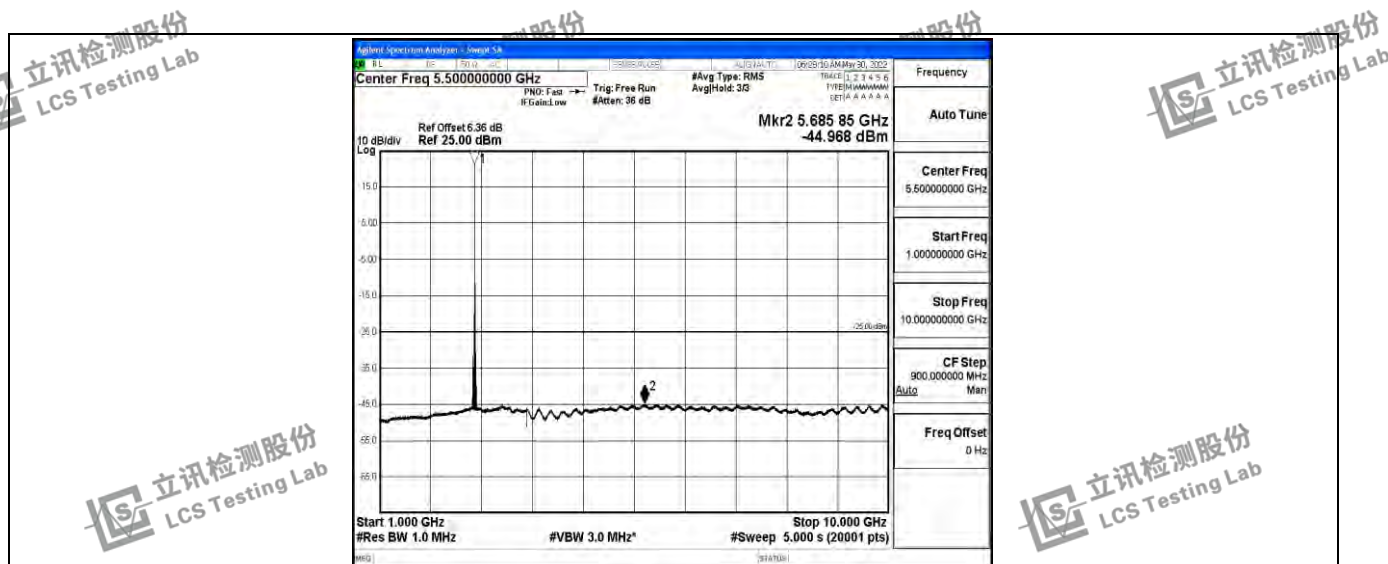

Band1-15MHz-QPSK-41515-1RB#0-Range5:10000~20000MHz

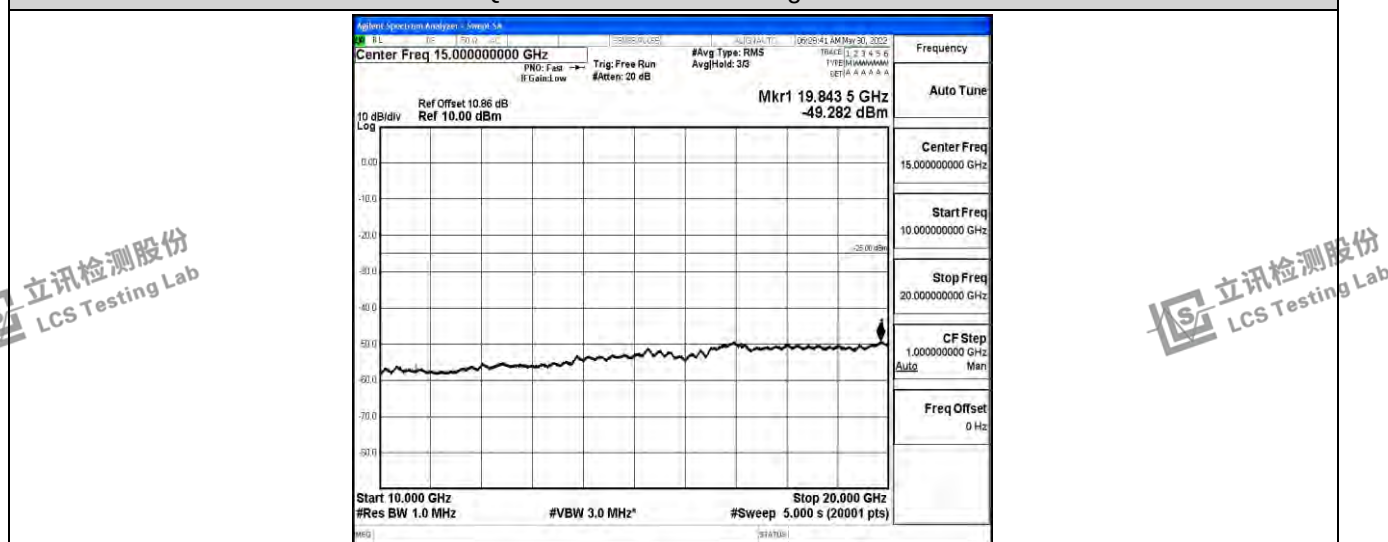


Band41-15MHz-QPSK-41515-1RB#0-Range6:20000~26500MHz

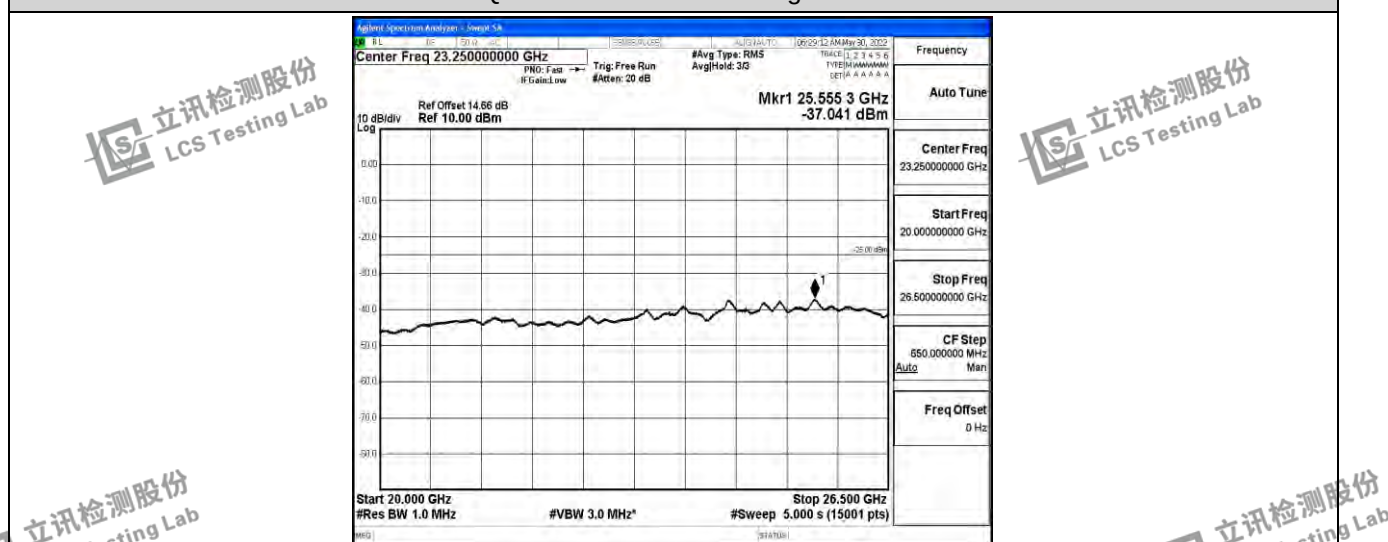


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen,
518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Band41-15MHz-16QAM-39725-1RB#0-Range1:0.009~0.15MHz

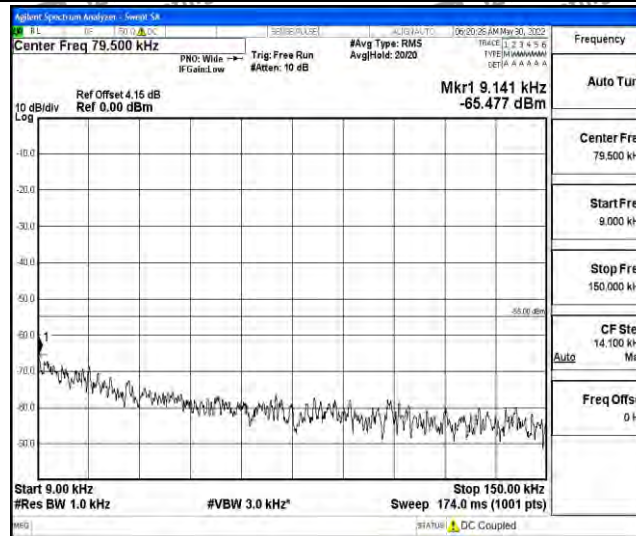


Band41-15MHz-16QAM-39725-1RB#0-Range2:0.15~30MHz

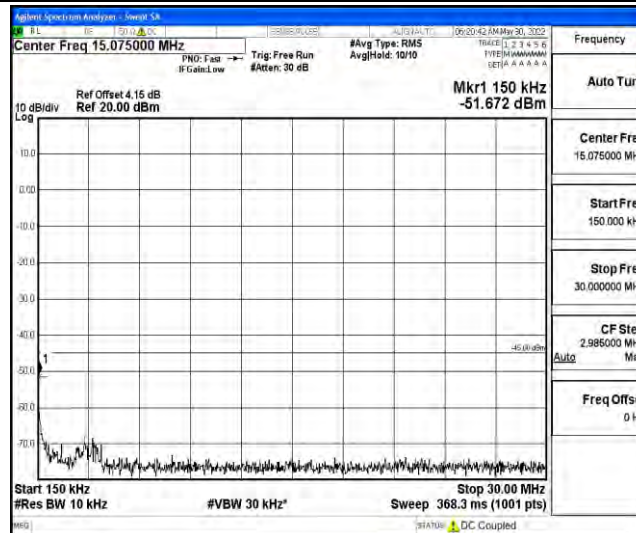


Band41-15MHz-16QAM-39725-1RB#0-Range3:30~1000MHz




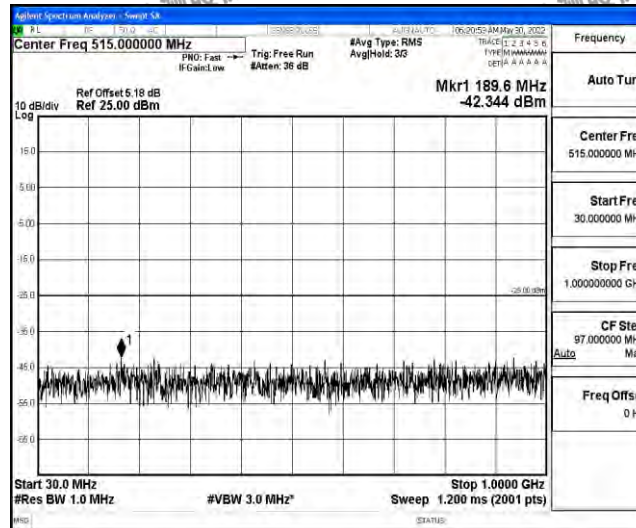

Band41-15MHz-16QAM-39725-1RB#0-Range4:1000~10000MHz

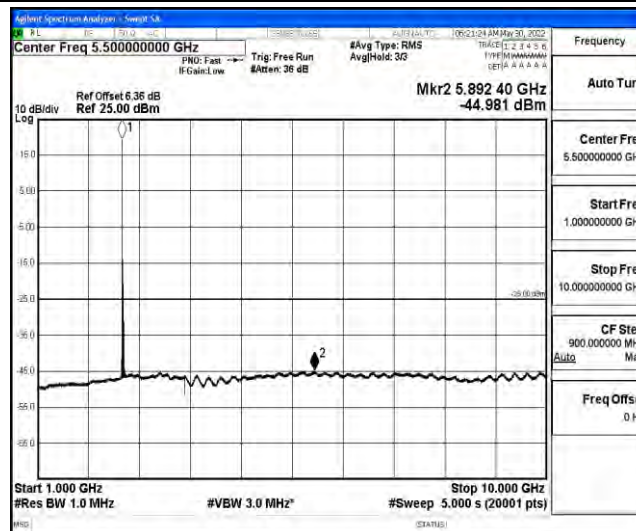

Band41-15MHz-16QAM-39725-1RB#0-Range5:10000~20000MHz

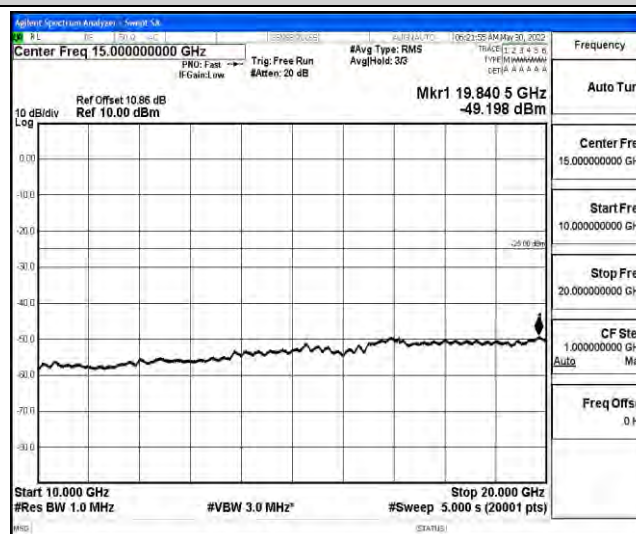




Band41-15MHz-16QAM-39725-1RB#0-Range6:20000~26500MHz




Band41-15MHz-16QAM-40620-1RB#0-Range1:0.009~0.15MHz

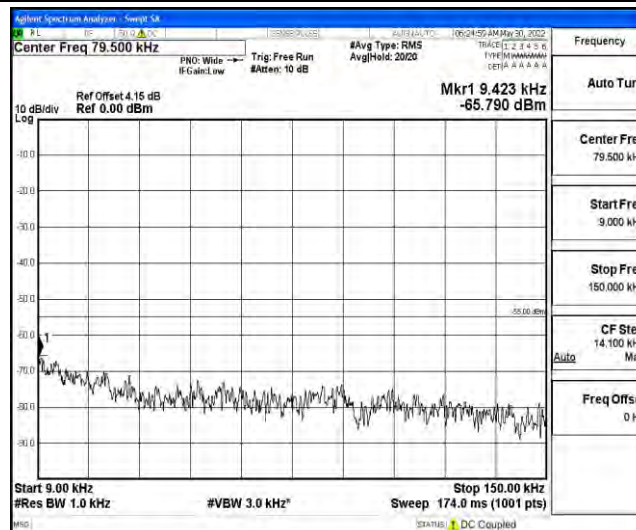


Band41-15MHz-16QAM-40620-1RB#0-Range2:0.15~30MHz




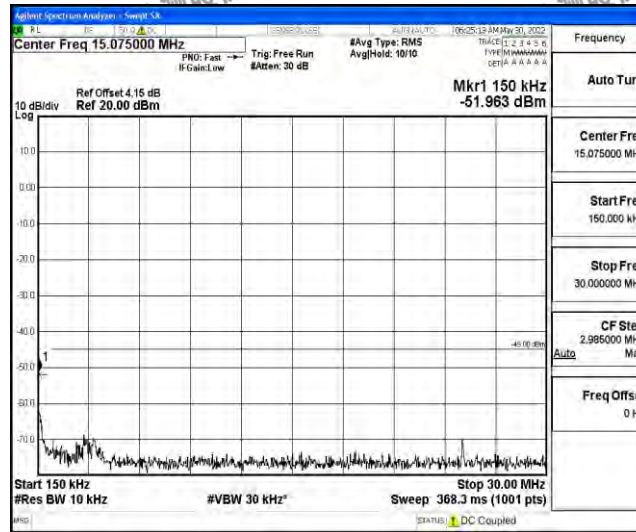

Band41-15MHz-16QAM-40620-1RB#0-Range3:30~1000MHz

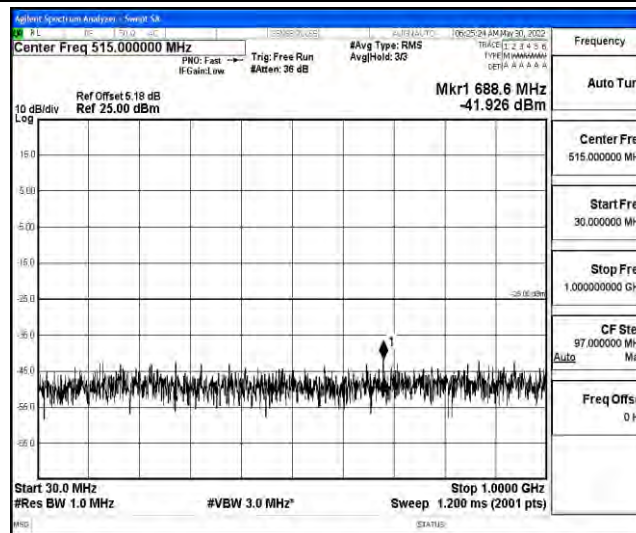


Band41-15MHz-16QAM-40620-1RB#0-Range4:1000~10000MHz

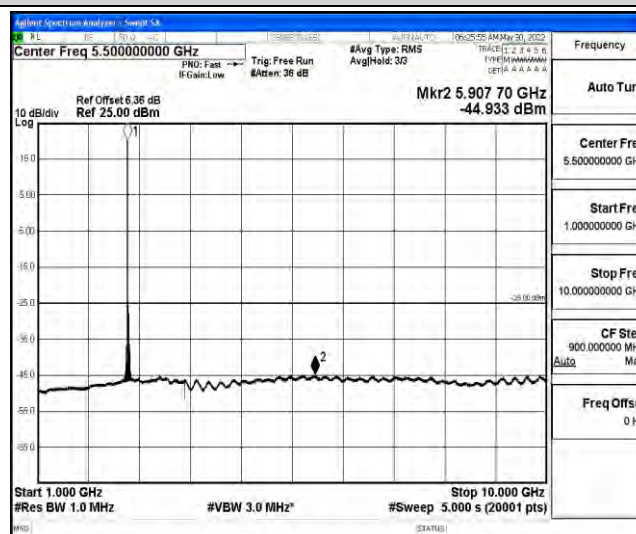




Band41-15MHz-16QAM-40620-1RB#0-Range5:10000~20000MHz

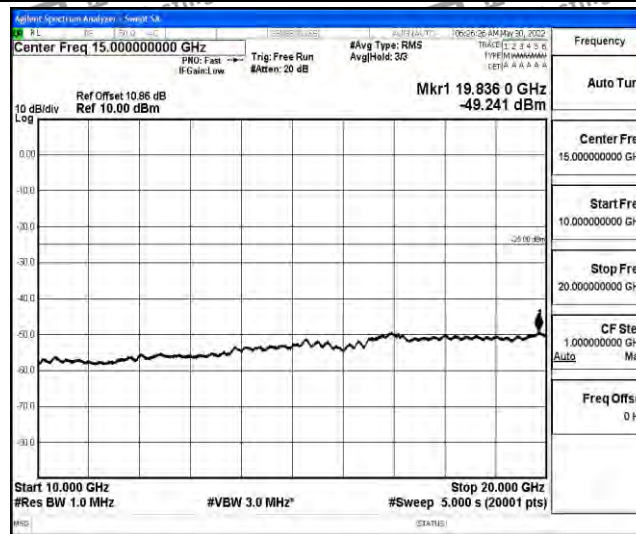


Band41-15MHz-16QAM-40620-1RB#0-Range6:20000~26500MHz

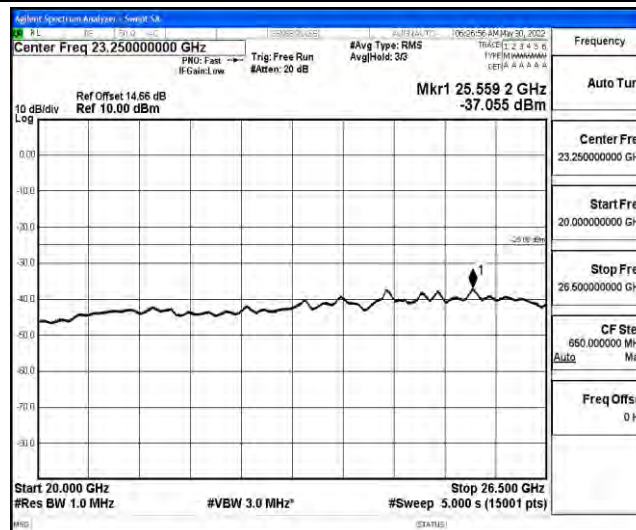


Band41-15MHz-16QAM-41515-1RB#0-Range1:0.009~0.15MHz




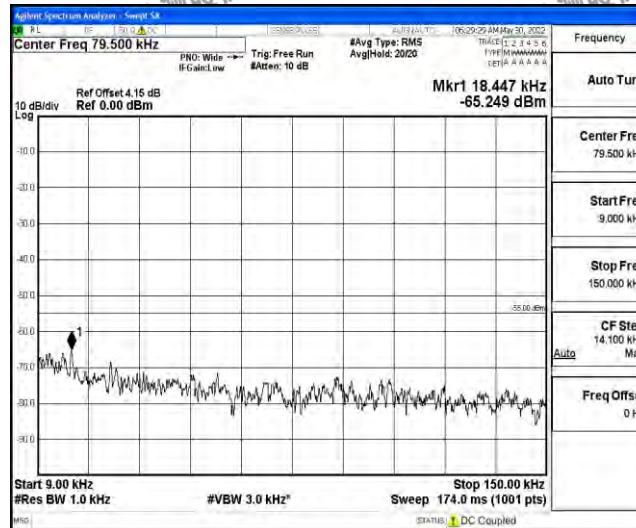

Band41-15MHz-16QAM-41515-1RB#0-Range2:0.15~30MHz

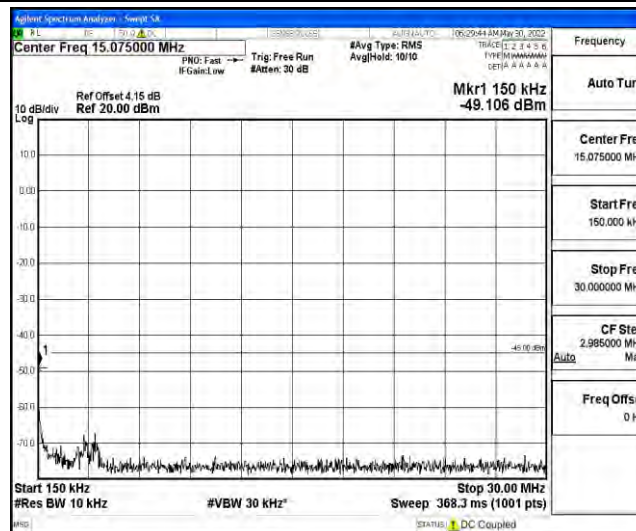


Band41-15MHz-16QAM-41515-1RB#0-Range3:30~1000MHz

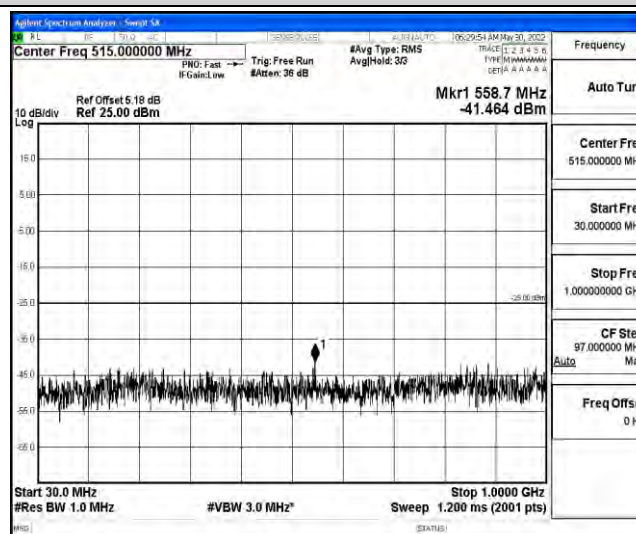


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Band41-15MHz-16QAM-41515-1RB#0-Range4:1000~10000MHz

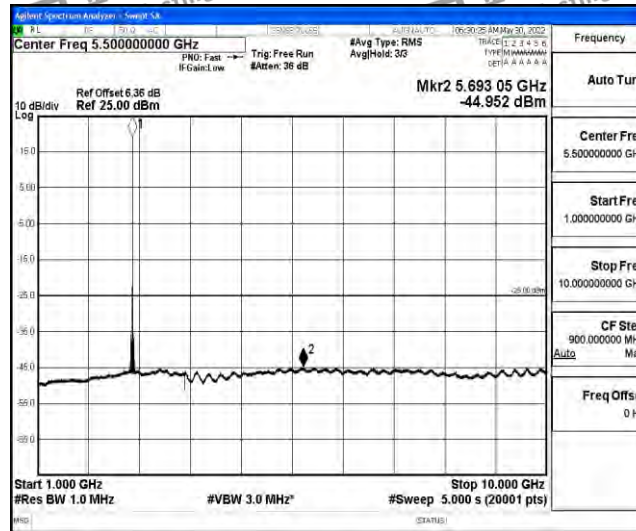

Band41-15MHz-16QAM-41515-1RB#0-Range5:10000~20000MHz

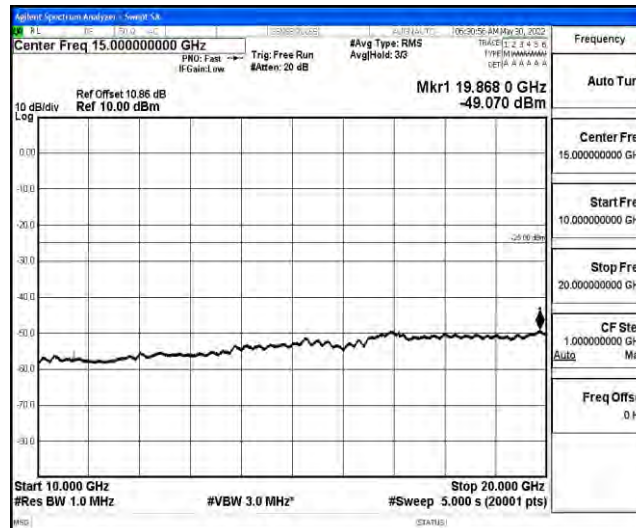


Band41-15MHz-16QAM-41515-1RB#0-Range6:20000~26500MHz






Band41-20MHz-QPSK-39750-1RB#0-Range1:0.009~0.15MHz

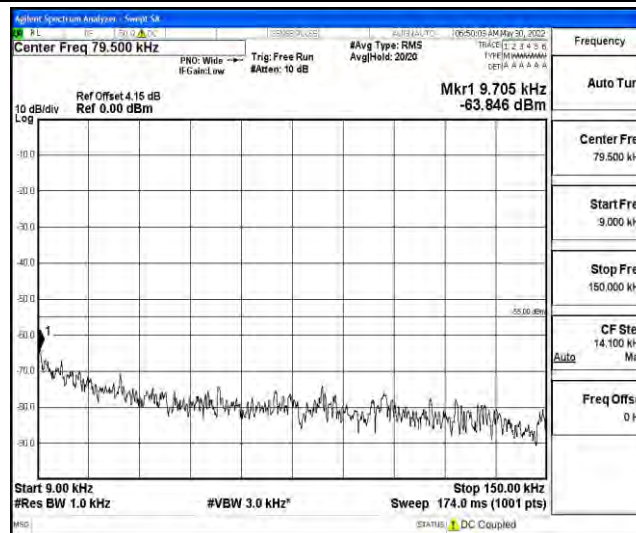


Band41-20MHz-QPSK-39750-1RB#0-Range2:0.15~30MHz

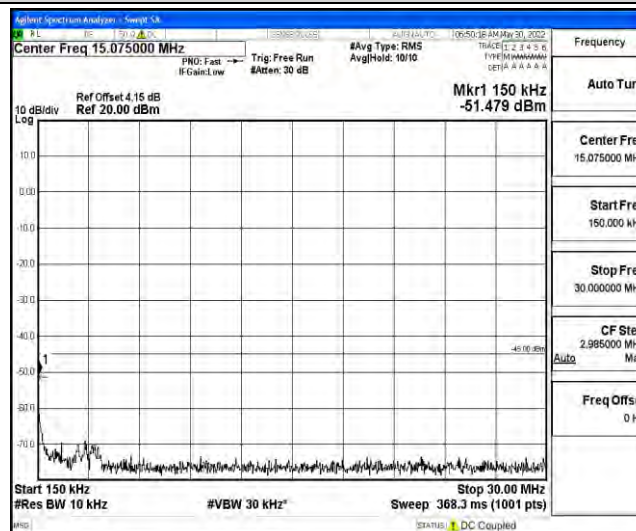




Band41-20MHz-QPSK-39750-1RB#0-Range3:30~1000MHz

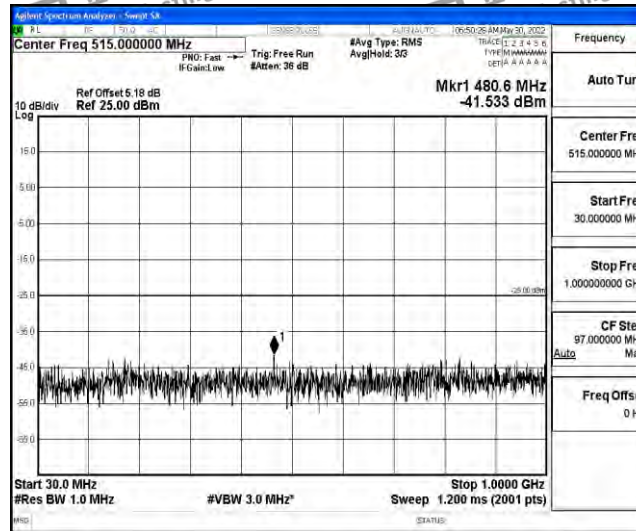


Band41-20MHz-QPSK-39750-1RB#0-Range4:1000~10000MHz

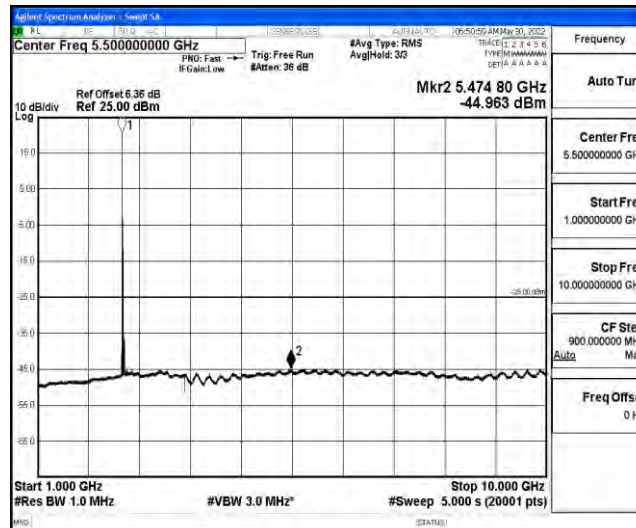


Band41-20MHz-QPSK-39750-1RB#0-Range5:10000~20000MHz




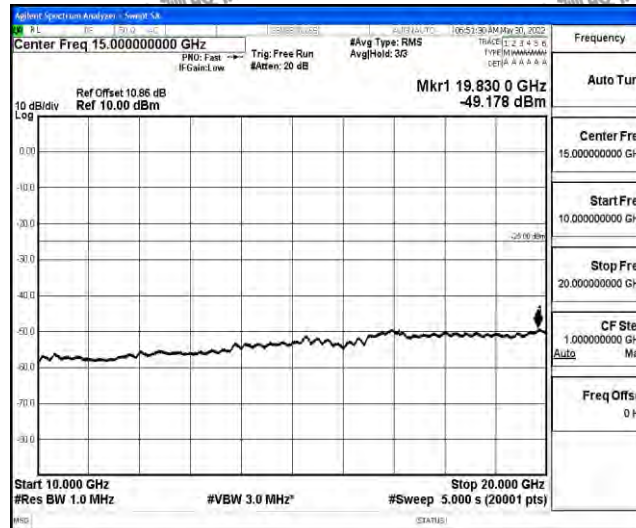

Band41-20MHz-QPSK-39750-1RB#0-Range6:20000~26500MHz

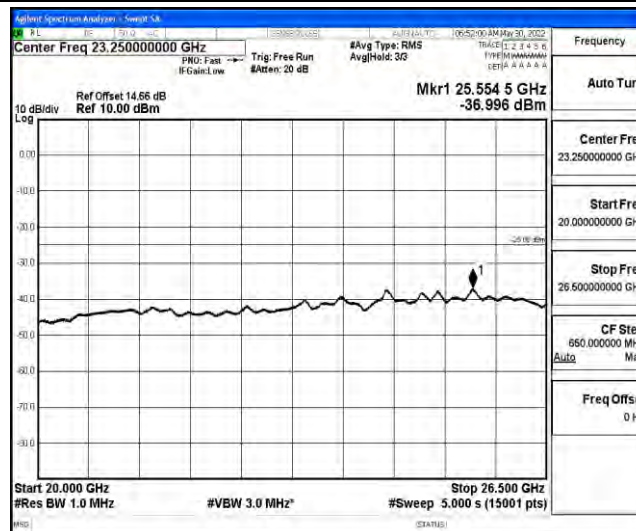


Band41-20MHz-QPSK-40620-1RB#0-Range1:0.009~0.15MHz

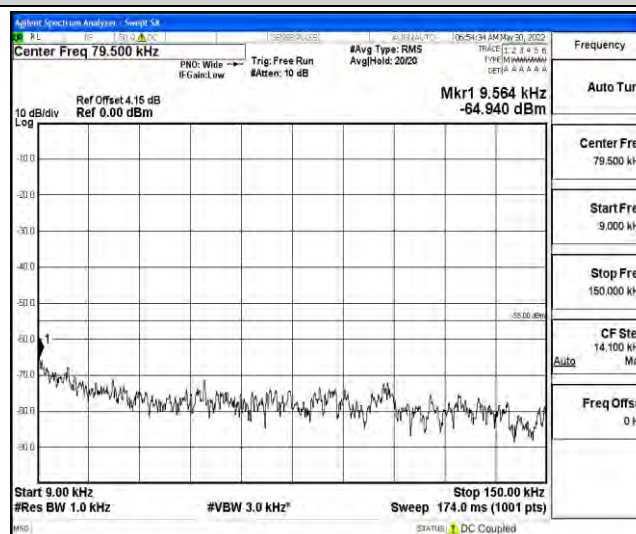




Band41-20MHz-QPSK-40620-1RB#0-Range2:0.15~30MHz

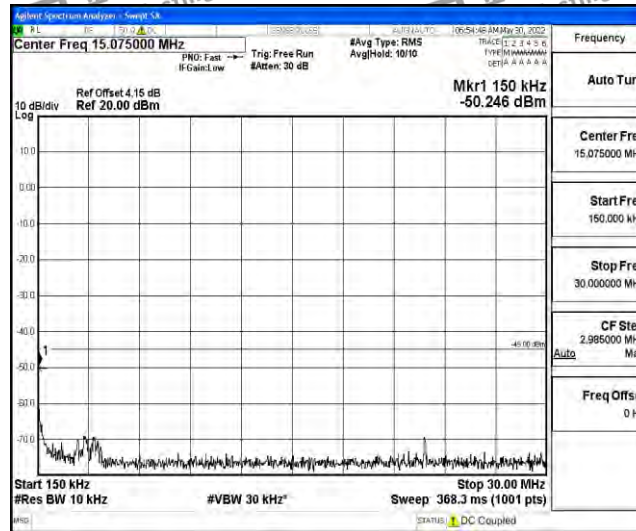


Band41-20MHz-QPSK-40620-1RB#0-Range3:30~1000MHz

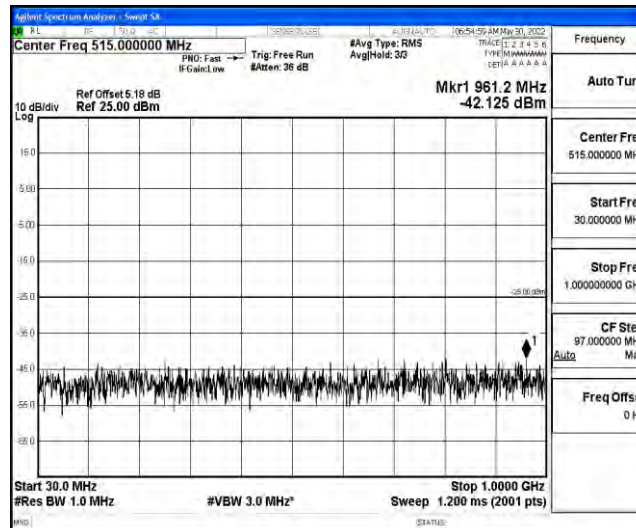


Band41-20MHz-QPSK-40620-1RB#0-Range4:1000~10000MHz




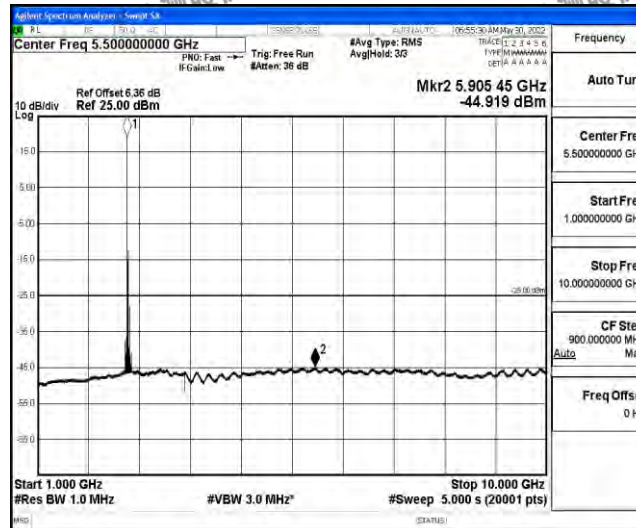

Band41-20MHz-QPSK-40620-1RB#0-Range5:10000~20000MHz

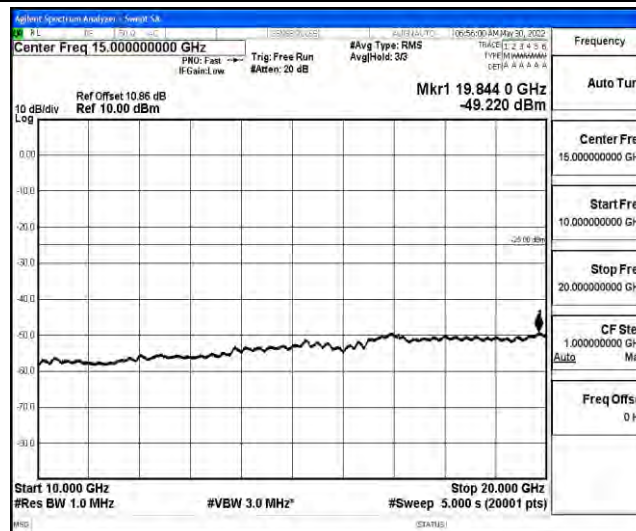

Band41-20MHz-QPSK-40620-1RB#0-Range6:20000~26500MHz

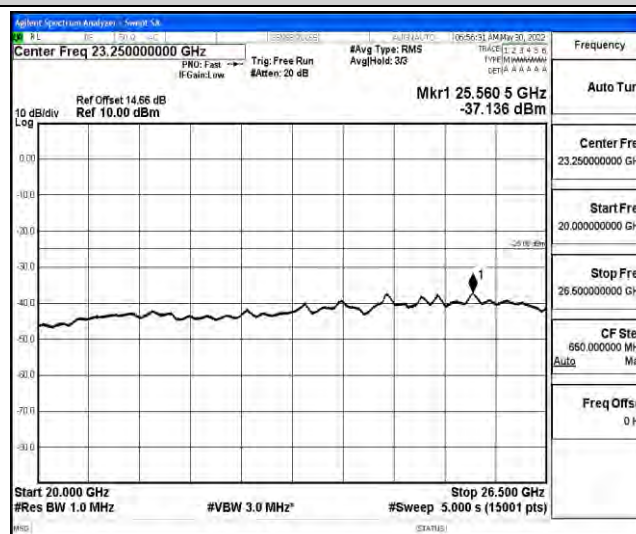




Band41-20MHz-QPSK-41490-1RB#0-Range1:0.009~0.15MHz




Band41-20MHz-QPSK-41490-1RB#0-Range2:0.15~30MHz

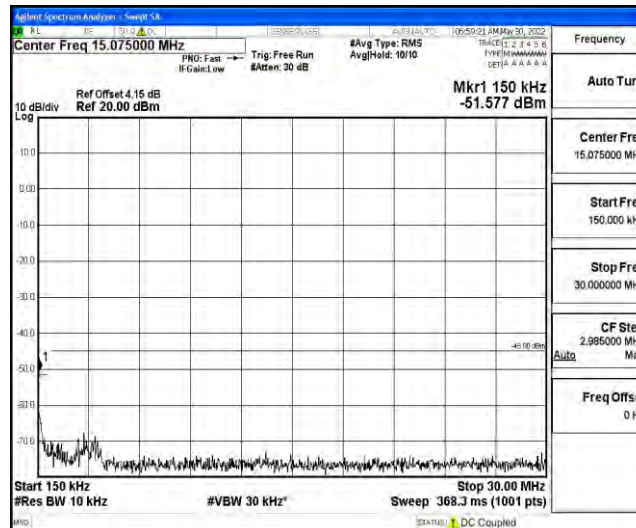


Band41-20MHz-QPSK-41490-1RB#0-Range3:30~1000MHz




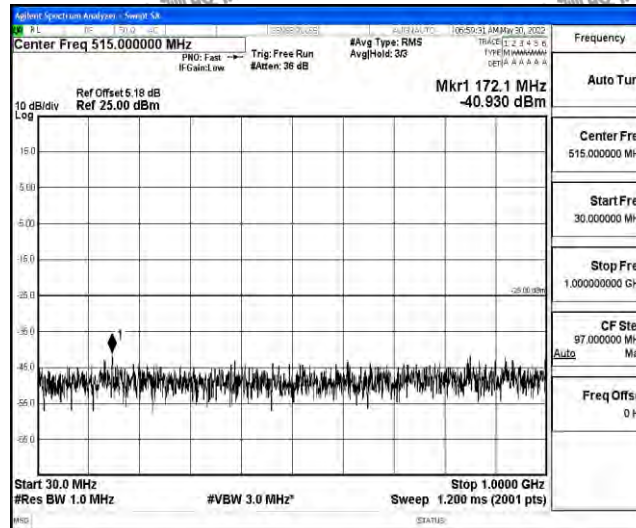

Band41-20MHz-QPSK-41490-1RB#0-Range4:1000~10000MHz

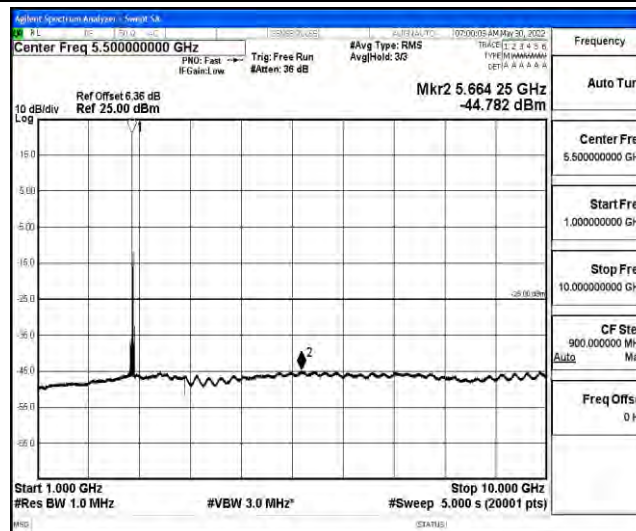

Band41-20MHz-QPSK-41490-1RB#0-Range5:10000~20000MHz

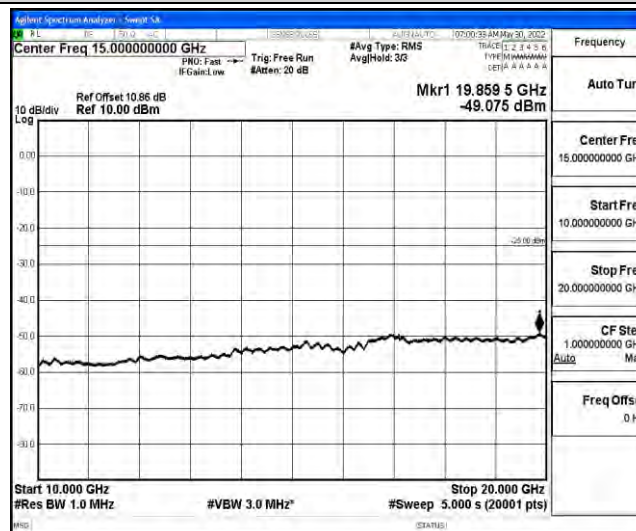




Band41-20MHz-QPSK-41490-1RB#0-Range6:20000~26500MHz




Band41-20MHz-16QAM-39750-1RB#0-Range1:0.009~0.15MHz

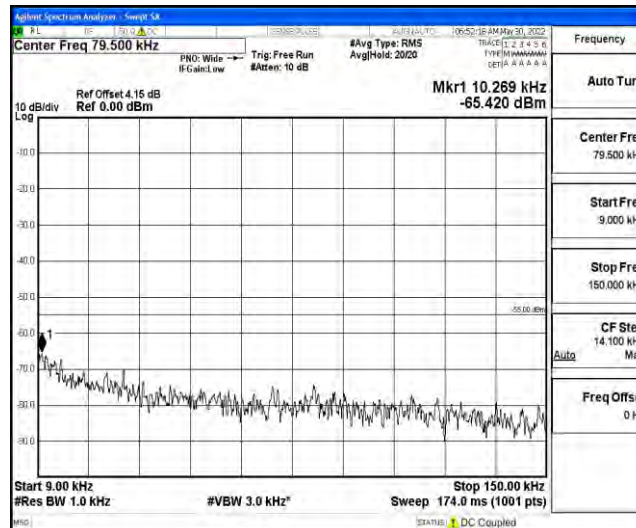


Band41-20MHz-16QAM-39750-1RB#0-Range2:0.15~30MHz




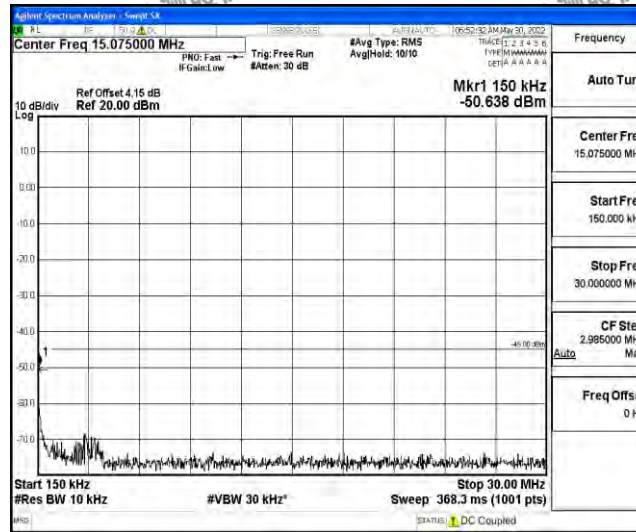

Band41-20MHz-16QAM-39750-1RB#0-Range3:30~1000MHz

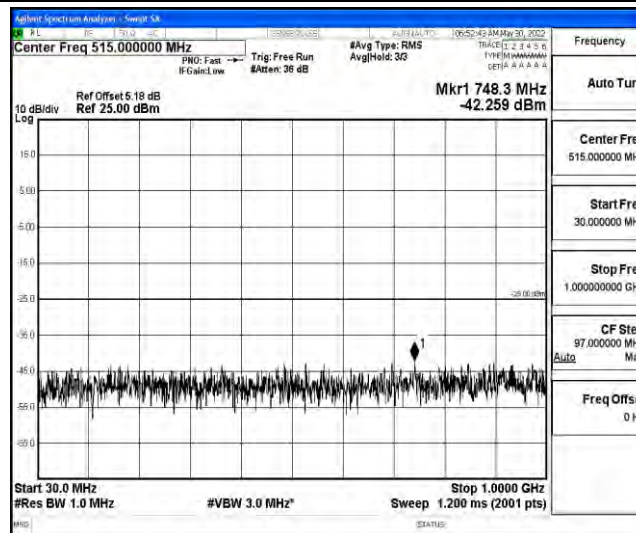


Band41-20MHz-16QAM-39750-1RB#0-Range4:1000~10000MHz

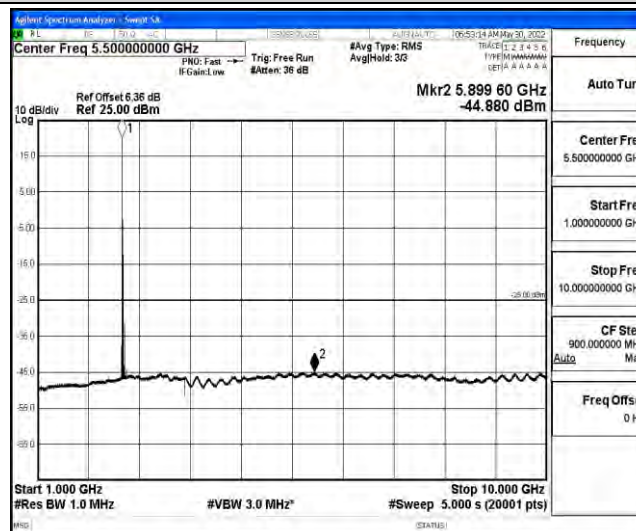




Band41-20MHz-16QAM-39750-1RB#0-Range5:10000~20000MHz

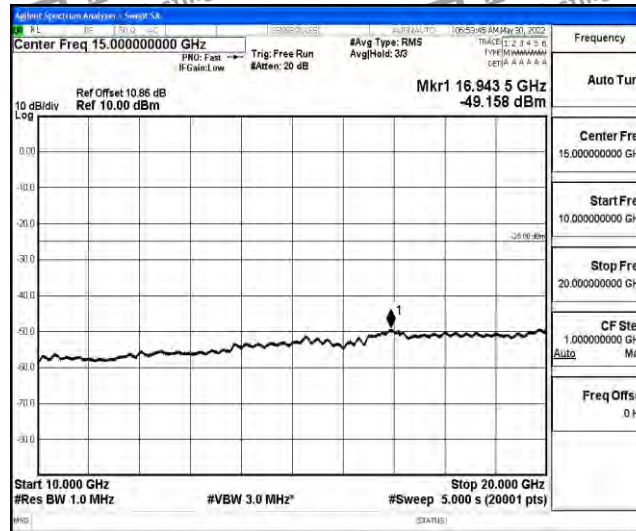


Band41-20MHz-16QAM-39750-1RB#0-Range6:20000~26500MHz

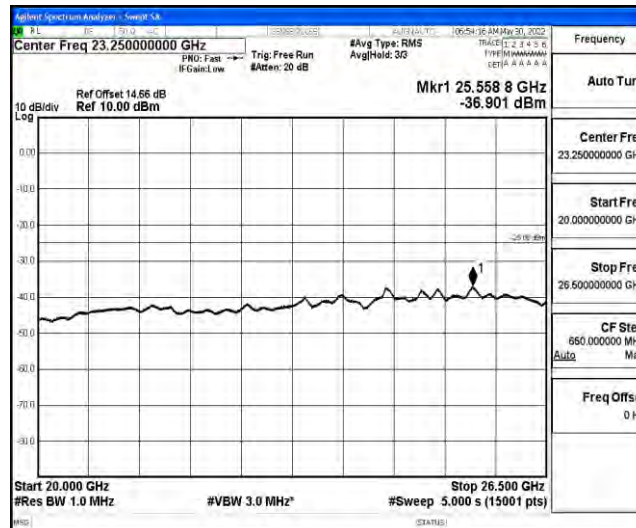


Band41-20MHz-16QAM-40620-1RB#0-Range1:0.009~0.15MHz




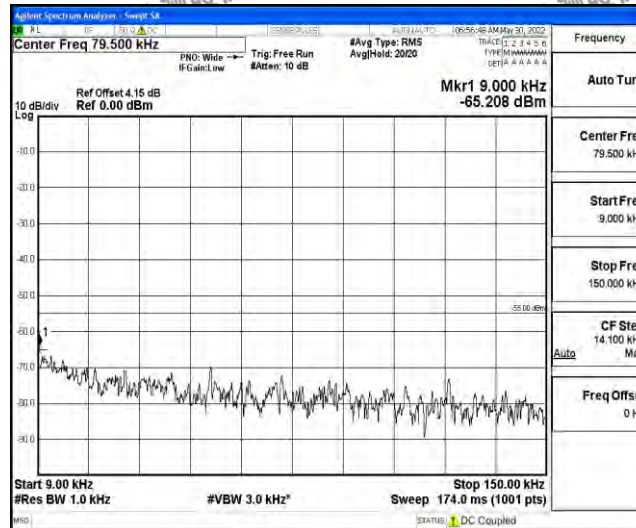

Band41-20MHz-16QAM-40620-1RB#0-Range2:0.15~30MHz

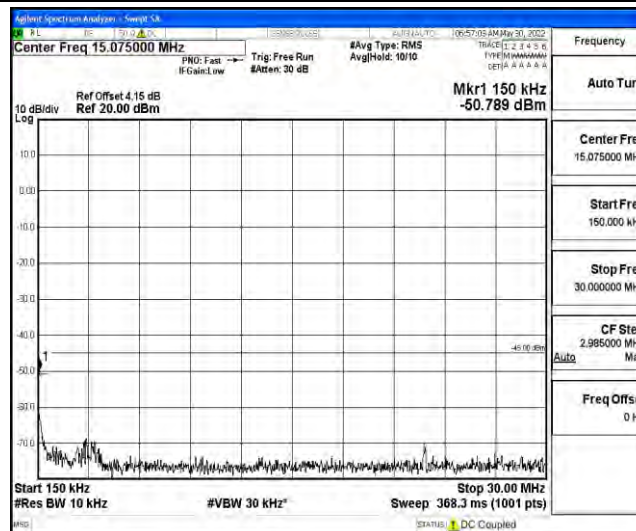


Band41-20MHz-16QAM-40620-1RB#0-Range3:30~1000MHz

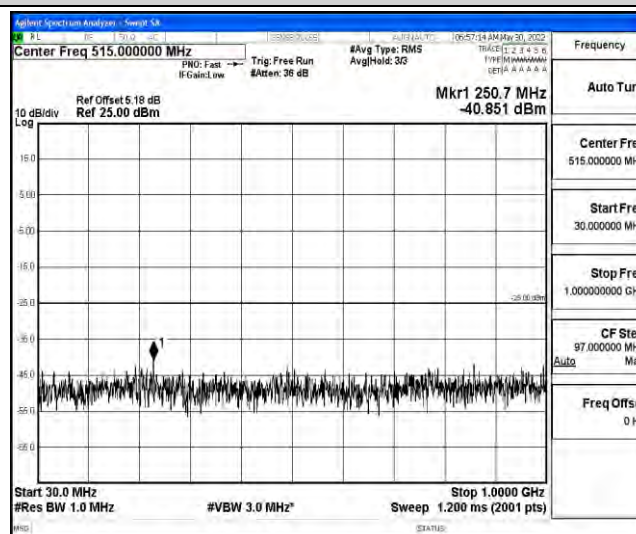




Band41-20MHz-16QAM-40620-1RB#0-Range4:1000~10000MHz

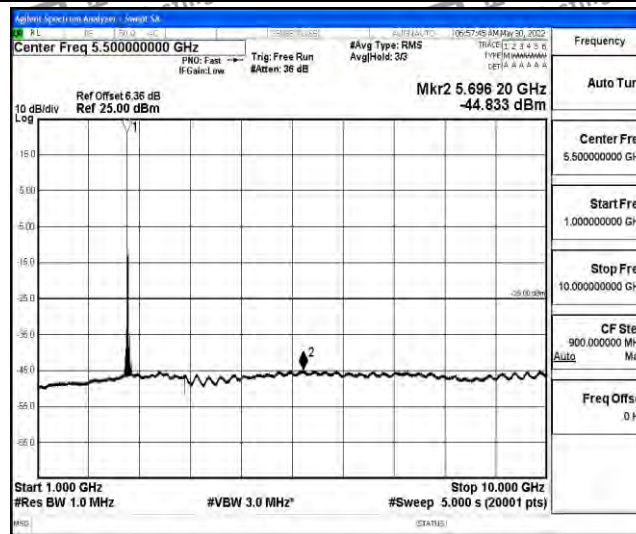

Band41-20MHz-16QAM-40620-1RB#0-Range5:10000~20000MHz

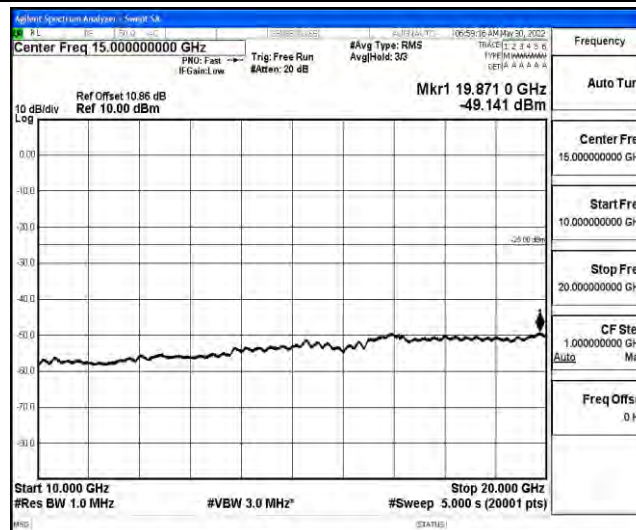


Band41-20MHz-16QAM-40620-1RB#0-Range6:20000~26500MHz






Band41-20MHz-16QAM-41490-1RB#0-Range1:0.009~0.15MHz

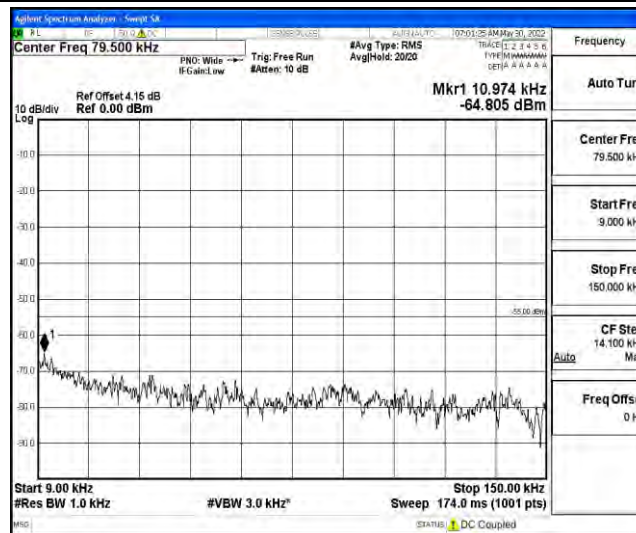


Band41-20MHz-16QAM-41490-1RB#0-Range2:0.15~30MHz

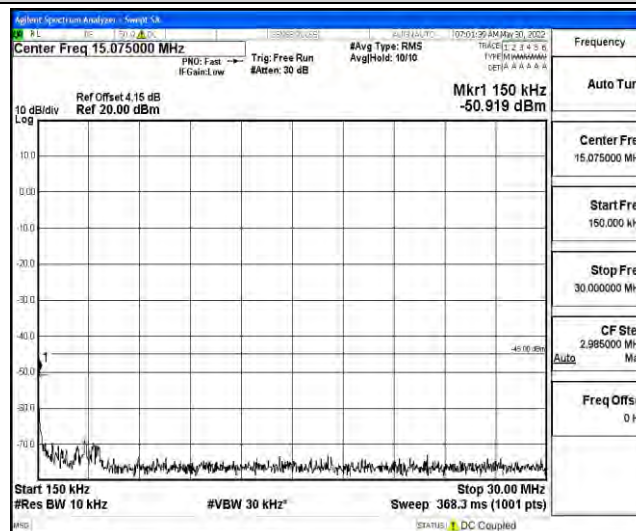




Band41-20MHz-16QAM-41490-1RB#0-Range3:30~1000MHz

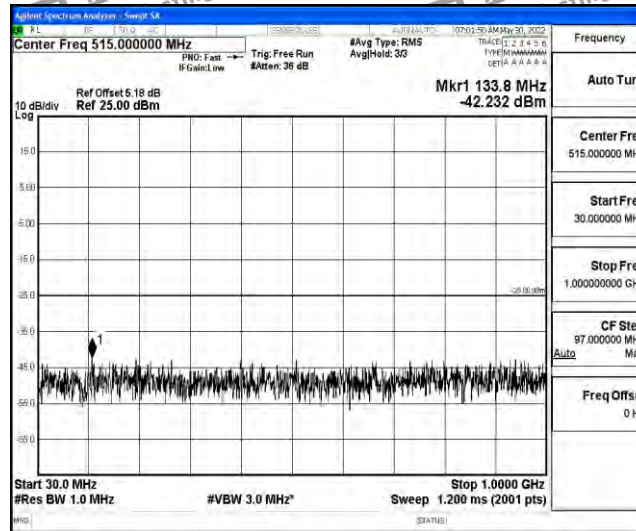


Band41-20MHz-16QAM-41490-1RB#0-Range4:1000~10000MHz

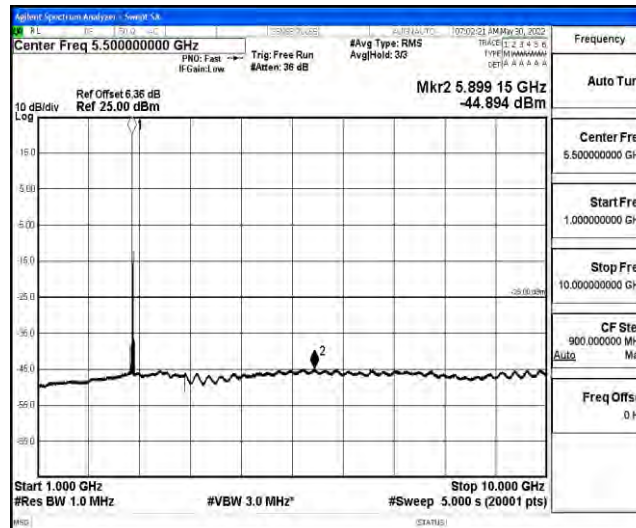

Band41-20MHz-16QAM-41490-1RB#0-Range5:10000~20000MHz



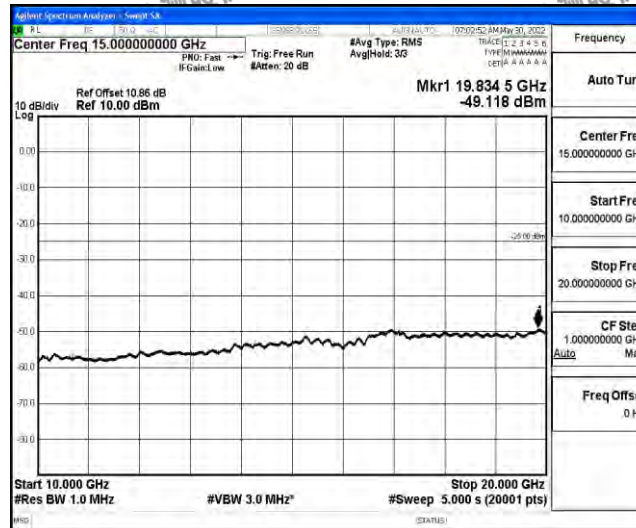

Band41-20MHz-16QAM-41490-1RB#0-Range6:20000~26500MHz

