

Appendix Test Data

Report No.:	1812C40114912506	Test Sample No.:	1-2-2
Start Test Date:	2024.10.25	Finish Test Date:	2024.10.31
Test Engineer:	Joker Huang	Auditor:	Justin Feng
Temperature:	24.3℃	Relative Humidity:	57 %
Pressure:	101 kPa		

Appendix A: Conducted Output Power

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band2	1.4MHz	QPSK	18607	1RB#0	23.65	PASS
Band2	1.4MHz	16QAM	18607	1RB#0	22.57	PASS
Band2	1.4MHz	QPSK	18607	1RB#2	23.75	PASS
Band2	1.4MHz	16QAM	18607	1RB#2	22.90	PASS
Band2	1.4MHz	QPSK	18607	1RB#5	23.87	PASS
Band2	1.4MHz	16QAM	18607	1RB#5	22.74	PASS
Band2	1.4MHz	QPSK	18607	3RB#0	23.87	PASS
Band2	1.4MHz	16QAM	18607	3RB#0	22.89	PASS
Band2	1.4MHz	QPSK	18607	3RB#1	23.86	PASS
Band2	1.4MHz	16QAM	18607	3RB#1	22.89	PASS
Band2	1.4MHz	QPSK	18607	3RB#3	23.84	PASS
Band2	1.4MHz	16QAM	18607	3RB#3	22.94	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	23.08	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	22.07	PASS
Band2	1.4MHz	QPSK	18900	1RB#0	24.05	PASS
Band2	1.4MHz	16QAM	18900	1RB#0	22.93	PASS
Band2	1.4MHz	QPSK	18900	1RB#2	24.07	PASS
Band2	1.4MHz	16QAM	18900	1RB#2	23.16	PASS
Band2	1.4MHz	QPSK	18900	1RB#5	23.99	PASS
Band2	1.4MHz	16QAM	18900	1RB#5	23.00	PASS
Band2	1.4MHz	QPSK	18900	3RB#0	23.93	PASS



Band2	1.4MHz	16QAM	18900	3RB#0	23.07	PASS
Band2	1.4MHz	QPSK	18900	3RB#1	23.95	PASS
Band2	1.4MHz	16QAM	18900	3RB#1	22.90	PASS
Band2	1.4MHz	QPSK	18900	3RB#3	23.90	PASS
Band2	1.4MHz	16QAM	18900	3RB#3	22.89	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	23.13	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	22.15	PASS
Band2	1.4MHz	QPSK	19193	1RB#0	24.04	PASS
Band2	1.4MHz	16QAM	19193	1RB#0	23.26	PASS
Band2	1.4MHz	QPSK	19193	1RB#2	24.21	PASS
Band2	1.4MHz	16QAM	19193	1RB#2	23.13	PASS
Band2	1.4MHz	QPSK	19193	1RB#5	23.77	PASS
Band2	1.4MHz	16QAM	19193	1RB#5	22.81	PASS
Band2	1.4MHz	QPSK	19193	3RB#0	23.72	PASS
Band2	1.4MHz	16QAM	19193	3RB#0	22.69	PASS
Band2	1.4MHz	QPSK	19193	3RB#1	23.74	PASS
Band2	1.4MHz	16QAM	19193	3RB#1	22.64	PASS
Band2	1.4MHz	QPSK	19193	3RB#3	23.68	PASS
Band2	1.4MHz	16QAM	19193	3RB#3	22.45	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	22.71	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	21.54	PASS
Band2	3MHz	QPSK	18615	1RB#0	23.37	PASS
Band2	3MHz	16QAM	18615	1RB#0	22.62	PASS
Band2	3MHz	QPSK	18615	1RB#8	23.26	PASS
Band2	3MHz	16QAM	18615	1RB#8	22.14	PASS
Band2	3MHz	QPSK	18615	1RB#14	23.18	PASS
Band2	3MHz	16QAM	18615	1RB#14	22.14	PASS
Band2	3MHz	QPSK	18615	8RB#0	22.02	PASS
Band2	3MHz	16QAM	18615	8RB#0	21.19	PASS
Band2	3MHz	QPSK	18615	8RB#4	22.12	PASS
Band2	3MHz	16QAM	18615	8RB#4	21.17	PASS
Band2	3MHz	QPSK	18615	8RB#7	22.07	PASS
Band2	3MHz	16QAM	18615	8RB#7	21.12	PASS
Band2	3MHz	QPSK	18615	15RB#0	21.91	PASS
Band2	3MHz	16QAM	18615	15RB#0	21.04	PASS
Band2	3MHz	QPSK	18900	1RB#0	23.27	PASS
Band2	3MHz	16QAM	18900	1RB#0	22.36	PASS
Band2	3MHz	QPSK	18900	1RB#8	23.28	PASS
Band2	3MHz	16QAM	18900	1RB#8	22.36	PASS
Band2	3MHz	QPSK	18900	1RB#14	23.15	PASS
Band2	3MHz	16QAM	18900	1RB#14	22.45	PASS
Band2	3MHz	QPSK	18900	8RB#0	22.06	PASS



Band2	3MHz	16QAM	18900	8RB#0	21.14	PASS
Band2	3MHz	QPSK	18900	8RB#4	22.08	PASS
Band2	3MHz	16QAM	18900	8RB#4	21.14	PASS
Band2	3MHz	QPSK	18900	8RB#7	22.06	PASS
Band2	3MHz	16QAM	18900	8RB#7	21.13	PASS
Band2	3MHz	QPSK	18900	15RB#0	22.12	PASS
Band2	3MHz	16QAM	18900	15RB#0	21.04	PASS
Band2	3MHz	QPSK	19185	1RB#0	23.47	PASS
Band2	3MHz	16QAM	19185	1RB#0	22.24	PASS
Band2	3MHz	QPSK	19185	1RB#8	23.09	PASS
Band2	3MHz	16QAM	19185	1RB#8	22.35	PASS
Band2	3MHz	QPSK	19185	1RB#14	23.15	PASS
Band2	3MHz	16QAM	19185	1RB#14	22.26	PASS
Band2	3MHz	QPSK	19185	8RB#0	22.10	PASS
Band2	3MHz	16QAM	19185	8RB#0	21.03	PASS
Band2	3MHz	QPSK	19185	8RB#4	22.11	PASS
Band2	3MHz	16QAM	19185	8RB#4	21.15	PASS
Band2	3MHz	QPSK	19185	8RB#7	22.12	PASS
Band2	3MHz	16QAM	19185	8RB#7	21.07	PASS
Band2	3MHz	QPSK	19185	15RB#0	22.10	PASS
Band2	3MHz	16QAM	19185	15RB#0	20.82	PASS
Band2	5MHz	QPSK	18625	1RB#0	23.50	PASS
Band2	5MHz	16QAM	18625	1RB#0	22.11	PASS
Band2	5MHz	QPSK	18625	1RB#12	23.36	PASS
Band2	5MHz	16QAM	18625	1RB#12	22.17	PASS
Band2	5MHz	QPSK	18625	1RB#24	23.22	PASS
Band2	5MHz	16QAM	18625	1RB#24	21.91	PASS
Band2	5MHz	QPSK	18625	12RB#0	22.21	PASS
Band2	5MHz	16QAM	18625	12RB#0	21.16	PASS
Band2	5MHz	QPSK	18625	12RB#6	22.20	PASS
Band2	5MHz	16QAM	18625	12RB#6	21.13	PASS
Band2	5MHz	QPSK	18625	12RB#13	21.91	PASS
Band2	5MHz	16QAM	18625	12RB#13	20.93	PASS
Band2	5MHz	QPSK	18625	25RB#0	22.00	PASS
Band2	5MHz	16QAM	18625	25RB#0	21.14	PASS
Band2	5MHz	QPSK	18900	1RB#0	23.36	PASS
Band2	5MHz	16QAM	18900	1RB#0	21.81	PASS
Band2	5MHz	QPSK	18900	1RB#12	23.21	PASS
Band2	5MHz	16QAM	18900	1RB#12	22.80	PASS
Band2	5MHz	QPSK	18900	1RB#24	24.17	PASS
Band2	5MHz	16QAM	18900	1RB#24	23.13	PASS
Band2	5MHz	QPSK	18900	12RB#0	23.08	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com



Band2	5MHz	16QAM	18900	12RB#0	21.82	PASS
Band2	5MHz	QPSK	18900	12RB#6	22.94	PASS
Band2	5MHz	16QAM	18900	12RB#6	22.06	PASS
Band2	5MHz	QPSK	18900	12RB#13	23.06	PASS
Band2	5MHz	16QAM	18900	12RB#13	21.79	PASS
Band2	5MHz	QPSK	18900	25RB#0	22.80	PASS
Band2	5MHz	16QAM	18900	25RB#0	21.95	PASS
Band2	5MHz	QPSK	19175	1RB#0	24.18	PASS
Band2	5MHz	16QAM	19175	1RB#0	22.70	PASS
Band2	5MHz	QPSK	19175	1RB#12	23.84	PASS
Band2	5MHz	16QAM	19175	1RB#12	22.93	PASS
Band2	5MHz	QPSK	19175	1RB#24	23.64	PASS
Band2	5MHz	16QAM	19175	1RB#24	22.86	PASS
Band2	5MHz	QPSK	19175	12RB#0	22.72	PASS
Band2	5MHz	16QAM	19175	12RB#0	21.63	PASS
Band2	5MHz	QPSK	19175	12RB#6	22.72	PASS
Band2	5MHz	16QAM	19175	12RB#6	21.73	PASS
Band2	5MHz	QPSK	19175	12RB#13	22.64	PASS
Band2	5MHz	16QAM	19175	12RB#13	21.45	PASS
Band2	5MHz	QPSK	19175	25RB#0	22.45	PASS
Band2	5MHz	16QAM	19175	25RB#0	21.49	PASS
Band2	10MHz	QPSK	18650	1RB#0	23.15	PASS
Band2	10MHz	16QAM	18650	1RB#0	21.95	PASS
Band2	10MHz	QPSK	18650	1RB#24	23.03	PASS
Band2	10MHz	16QAM	18650	1RB#24	22.02	PASS
Band2	10MHz	QPSK	18650	1RB#49	22.82	PASS
Band2	10MHz	16QAM	18650	1RB#49	21.72	PASS
Band2	10MHz	QPSK	18650	25RB#0	21.96	PASS
Band2	10MHz	16QAM	18650	25RB#0	20.98	PASS
Band2	10MHz	QPSK	18650	25RB#12	21.77	PASS
Band2	10MHz	16QAM	18650	25RB#12	20.78	PASS
Band2	10MHz	QPSK	18650	25RB#25	21.61	PASS
Band2	10MHz	16QAM	18650	25RB#25	20.52	PASS
Band2	10MHz	QPSK	18650	50RB#0	21.69	PASS
Band2	10MHz	16QAM	18650	50RB#0	20.51	PASS
Band2	10MHz	QPSK	18900	1RB#0	22.80	PASS
Band2	10MHz	16QAM	18900	1RB#0	21.59	PASS
Band2	10MHz	QPSK	18900	1RB#24	22.85	PASS
Band2	10MHz	16QAM	18900	1RB#24	21.94	PASS
Band2	10MHz	QPSK	18900	1RB#49	22.77	PASS
Band2	10MHz	16QAM	18900	1RB#49	21.74	PASS
Band2	10MHz	QPSK	18900	25RB#0	21.76	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China

Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com



Band2	10MHz	16QAM	18900	25RB#0	20.61	PASS
Band2	10MHz	QPSK	18900	25RB#12	21.61	PASS
Band2	10MHz	16QAM	18900	25RB#12	20.62	PASS
Band2	10MHz	QPSK	18900	25RB#25	21.74	PASS
Band2	10MHz	16QAM	18900	25RB#25	20.79	PASS
Band2	10MHz	QPSK	18900	50RB#0	21.69	PASS
Band2	10MHz	16QAM	18900	50RB#0	20.59	PASS
Band2	10MHz	QPSK	19150	1RB#0	22.98	PASS
Band2	10MHz	16QAM	19150	1RB#0	22.14	PASS
Band2	10MHz	QPSK	19150	1RB#24	23.39	PASS
Band2	10MHz	16QAM	19150	1RB#24	21.91	PASS
Band2	10MHz	QPSK	19150	1RB#49	22.70	PASS
Band2	10MHz	16QAM	19150	1RB#49	22.14	PASS
Band2	10MHz	QPSK	19150	25RB#0	21.91	PASS
Band2	10MHz	16QAM	19150	25RB#0	20.99	PASS
Band2	10MHz	QPSK	19150	25RB#12	21.86	PASS
Band2	10MHz	16QAM	19150	25RB#12	20.91	PASS
Band2	10MHz	QPSK	19150	25RB#25	21.79	PASS
Band2	10MHz	16QAM	19150	25RB#25	20.93	PASS
Band2	10MHz	QPSK	19150	50RB#0	21.80	PASS
Band2	10MHz	16QAM	19150	50RB#0	20.72	PASS
Band2	15MHz	QPSK	18675	1RB#0	22.77	PASS
Band2	15MHz	16QAM	18675	1RB#0	21.66	PASS
Band2	15MHz	QPSK	18675	1RB#38	22.54	PASS
Band2	15MHz	16QAM	18675	1RB#38	21.42	PASS
Band2	15MHz	QPSK	18675	1RB#74	22.53	PASS
Band2	15MHz	16QAM	18675	1RB#74	21.63	PASS
Band2	15MHz	QPSK	18675	38RB#0	21.66	PASS
Band2	15MHz	16QAM	18675	38RB#0	21.42	PASS
Band2	15MHz	QPSK	18675	38RB#18	21.44	PASS
Band2	15MHz	16QAM	18675	38RB#18	21.41	PASS
Band2	15MHz	QPSK	18675	38RB#37	20.89	PASS
Band2	15MHz	16QAM	18675	38RB#37	20.89	PASS
Band2	15MHz	QPSK	18675	75RB#0	21.54	PASS
Band2	15MHz	16QAM	18675	75RB#0	20.59	PASS
Band2	15MHz	QPSK	18900	1RB#0	22.64	PASS
Band2	15MHz	16QAM	18900	1RB#0	21.69	PASS
Band2	15MHz	QPSK	18900	1RB#38	22.91	PASS
Band2	15MHz	16QAM	18900	1RB#38	21.73	PASS
Band2	15MHz	QPSK	18900	1RB#74	22.81	PASS
Band2	15MHz	16QAM	18900	1RB#74	21.85	PASS
Band2	15MHz	QPSK	18900	38RB#0	21.63	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com



Band2	15MHz	16QAM	18900	38RB#0	21.65	PASS
Band2	15MHz	QPSK	18900	38RB#18	21.70	PASS
Band2	15MHz	16QAM	18900	38RB#18	21.70	PASS
Band2	15MHz	QPSK	18900	38RB#37	21.21	PASS
Band2	15MHz	16QAM	18900	38RB#37	21.19	PASS
Band2	15MHz	QPSK	18900	75RB#0	21.78	PASS
Band2	15MHz	16QAM	18900	75RB#0	20.60	PASS
Band2	15MHz	QPSK	19125	1RB#0	22.89	PASS
Band2	15MHz	16QAM	19125	1RB#0	21.94	PASS
Band2	15MHz	QPSK	19125	1RB#38	23.00	PASS
Band2	15MHz	16QAM	19125	1RB#38	21.99	PASS
Band2	15MHz	QPSK	19125	1RB#74	22.78	PASS
Band2	15MHz	16QAM	19125	1RB#74	21.80	PASS
Band2	15MHz	QPSK	19125	38RB#0	21.76	PASS
Band2	15MHz	16QAM	19125	38RB#0	21.77	PASS
Band2	15MHz	QPSK	19125	38RB#18	21.86	PASS
Band2	15MHz	16QAM	19125	38RB#18	21.86	PASS
Band2	15MHz	QPSK	19125	38RB#37	20.91	PASS
Band2	15MHz	16QAM	19125	38RB#37	20.90	PASS
Band2	15MHz	QPSK	19125	75RB#0	21.94	PASS
Band2	15MHz	16QAM	19125	75RB#0	20.98	PASS
Band2	20MHz	QPSK	18700	1RB#0	22.66	PASS
Band2	20MHz	16QAM	18700	1RB#0	21.95	PASS
Band2	20MHz	QPSK	18700	1RB#49	22.95	PASS
Band2	20MHz	16QAM	18700	1RB#49	22.16	PASS
Band2	20MHz	QPSK	18700	1RB#99	22.62	PASS
Band2	20MHz	16QAM	18700	1RB#99	21.79	PASS
Band2	20MHz	QPSK	18700	50RB#0	21.64	PASS
Band2	20MHz	16QAM	18700	50RB#0	20.76	PASS
Band2	20MHz	QPSK	18700	50RB#25	21.72	PASS
Band2	20MHz	16QAM	18700	50RB#25	20.74	PASS
Band2	20MHz	QPSK	18700	50RB#50	21.57	PASS
Band2	20MHz	16QAM	18700	50RB#50	20.60	PASS
Band2	20MHz	QPSK	18700	100RB#0	21.64	PASS
Band2	20MHz	16QAM	18700	100RB#0	20.65	PASS
Band2	20MHz	QPSK	18900	1RB#0	22.72	PASS
Band2	20MHz	16QAM	18900	1RB#0	22.03	PASS
Band2	20MHz	QPSK	18900	1RB#49	23.27	PASS
Band2	20MHz	16QAM	18900	1RB#49	22.31	PASS
Band2	20MHz	QPSK	18900	1RB#99	22.92	PASS
Band2	20MHz	16QAM	18900	1RB#99	22.20	PASS
Band2	20MHz	QPSK	18900	50RB#0	21.82	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com



Band2	20MHz	16QAM	18900	50RB#0	20.79	PASS
Band2	20MHz	QPSK	18900	50RB#25	21.69	PASS
Band2	20MHz	16QAM	18900	50RB#25	20.71	PASS
Band2	20MHz	QPSK	18900	50RB#50	21.93	PASS
Band2	20MHz	16QAM	18900	50RB#50	20.94	PASS
Band2	20MHz	QPSK	18900	100RB#0	21.89	PASS
Band2	20MHz	16QAM	18900	100RB#0	20.89	PASS
Band2	20MHz	QPSK	19100	1RB#0	23.19	PASS
Band2	20MHz	16QAM	19100	1RB#0	22.41	PASS
Band2	20MHz	QPSK	19100	1RB#49	23.32	PASS
Band2	20MHz	16QAM	19100	1RB#49	22.55	PASS
Band2	20MHz	QPSK	19100	1RB#99	22.99	PASS
Band2	20MHz	16QAM	19100	1RB#99	22.45	PASS
Band2	20MHz	QPSK	19100	50RB#0	22.09	PASS
Band2	20MHz	16QAM	19100	50RB#0	21.06	PASS
Band2	20MHz	QPSK	19100	50RB#25	22.02	PASS
Band2	20MHz	16QAM	19100	50RB#25	21.07	PASS
Band2	20MHz	QPSK	19100	50RB#50	22.10	PASS
Band2	20MHz	16QAM	19100	50RB#50	21.06	PASS
Band2	20MHz	QPSK	19100	100RB#0	22.10	PASS
Band2	20MHz	16QAM	19100	100RB#0	21.08	PASS



Appendix B: Peak-to-Average Ratio(CCDF)

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dB)	Limit(dB)	Verdict
Band2	1.4MHz	QPSK	18607	1RB#0	8.33	13	PASS
Band2	1.4MHz	16QAM	18607	1RB#0	8.32	13	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	8.33	13	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	6.07	13	PASS
Band2	1.4MHz	QPSK	18900	1RB#0	4.51	13	PASS
Band2	1.4MHz	16QAM	18900	1RB#0	5.45	13	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	5.17	13	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	6.06	13	PASS
Band2	1.4MHz	QPSK	19193	1RB#0	4.48	13	PASS
Band2	1.4MHz	16QAM	19193	1RB#0	5.48	13	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	5.15	13	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	5.98	13	PASS
Band2	3MHz	QPSK	18615	1RB#0	4.67	13	PASS
Band2	3MHz	16QAM	18615	1RB#0	5.53	13	PASS
Band2	3MHz	QPSK	18615	15RB#0	5.29	13	PASS
Band2	3MHz	16QAM	18615	15RB#0	9.53	13	PASS
Band2	3MHz	QPSK	18900	1RB#0	8.34	13	PASS
Band2	3MHz	16QAM	18900	1RB#0	8.35	13	PASS
Band2	3MHz	QPSK	18900	15RB#0	8.35	13	PASS
Band2	3MHz	16QAM	18900	15RB#0	6.14	13	PASS
Band2	3MHz	QPSK	19185	1RB#0	4.57	13	PASS
Band2	3MHz	16QAM	19185	1RB#0	5.43	13	PASS
Band2	3MHz	QPSK	19185	15RB#0	5.17	13	PASS
Band2	3MHz	16QAM	19185	15RB#0	6.07	13	PASS
Band2	5MHz	QPSK	18625	1RB#0	4.63	13	PASS
Band2	5MHz	16QAM	18625	1RB#0	5.37	13	PASS
Band2	5MHz	QPSK	18625	25RB#0	5.23	13	PASS
Band2	5MHz	16QAM	18625	25RB#0	6.07	13	PASS
Band2	5MHz	QPSK	18900	1RB#0	4.56	13	PASS
Band2	5MHz	16QAM	18900	1RB#0	5.55	13	PASS
Band2	5MHz	QPSK	18900	25RB#0	5.27	13	PASS
Band2	5MHz	16QAM	18900	25RB#0	6.06	13	PASS
Band2	5MHz	QPSK	19175	1RB#0	4.58	13	PASS
Band2	5MHz	16QAM	19175	1RB#0	5.72	13	PASS
Band2	5MHz	QPSK	19175	25RB#0	5.16	13	PASS
Band2	5MHz	16QAM	19175	25RB#0	6.01	13	PASS
Band2	10MHz	QPSK	18650	1RB#0	4.56	13	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com





Band2	10MHz	16QAM	18650	1RB#0	5.45	13	PASS
Band2	10MHz	QPSK	18650	50RB#0	5.21	13	PASS
Band2	10MHz	16QAM	18650	50RB#0	6.06	13	PASS
Band2	10MHz	QPSK	18900	1RB#0	4.40	13	PASS
Band2	10MHz	16QAM	18900	1RB#0	5.29	13	PASS
Band2	10MHz	QPSK	18900	50RB#0	5.17	13	PASS
Band2	10MHz	16QAM	18900	50RB#0	6.01	13	PASS
Band2	10MHz	QPSK	19150	1RB#0	4.66	13	PASS
Band2	10MHz	16QAM	19150	1RB#0	5.42	13	PASS
Band2	10MHz	QPSK	19150	50RB#0	5.09	13	PASS
Band2	10MHz	16QAM	19150	50RB#0	5.95	13	PASS
Band2	15MHz	QPSK	18675	1RB#0	4.49	13	PASS
Band2	15MHz	16QAM	18675	1RB#0	5.40	13	PASS
Band2	15MHz	QPSK	18675	75RB#0	5.39	13	PASS
Band2	15MHz	16QAM	18675	75RB#0	6.11	13	PASS
Band2	15MHz	QPSK	18900	1RB#0	4.38	13	PASS
Band2	15MHz	16QAM	18900	1RB#0	5.20	13	PASS
Band2	15MHz	QPSK	18900	75RB#0	5.23	13	PASS
Band2	15MHz	16QAM	18900	75RB#0	6.00	13	PASS
Band2	15MHz	QPSK	19125	1RB#0	4.54	13	PASS
Band2	15MHz	16QAM	19125	1RB#0	5.44	13	PASS
Band2	15MHz	QPSK	19125	75RB#0	5.20	13	PASS
Band2	15MHz	16QAM	19125	75RB#0	5.96	13	PASS
Band2	20MHz	QPSK	18700	1RB#0	4.50	13	PASS
Band2	20MHz	16QAM	18700	1RB#0	5.43	13	PASS
Band2	20MHz	QPSK	18700	100RB#0	5.23	13	PASS
Band2	20MHz	16QAM	18700	100RB#0	6.03	13	PASS
Band2	20MHz	QPSK	18900	1RB#0	4.31	13	PASS
Band2	20MHz	16QAM	18900	1RB#0	5.34	13	PASS
Band2	20MHz	QPSK	18900	100RB#0	5.04	13	PASS
Band2	20MHz	16QAM	18900	100RB#0	5.89	13	PASS
Band2	20MHz	QPSK	19100	1RB#0	4.60	13	PASS
Band2	20MHz	16QAM	19100	1RB#0	5.36	13	PASS
Band2	20MHz	QPSK	19100	100RB#0	5.05	13	PASS
Band2	20MHz	16QAM	19100	100RB#0	5.93	13	PASS





Test Graphs

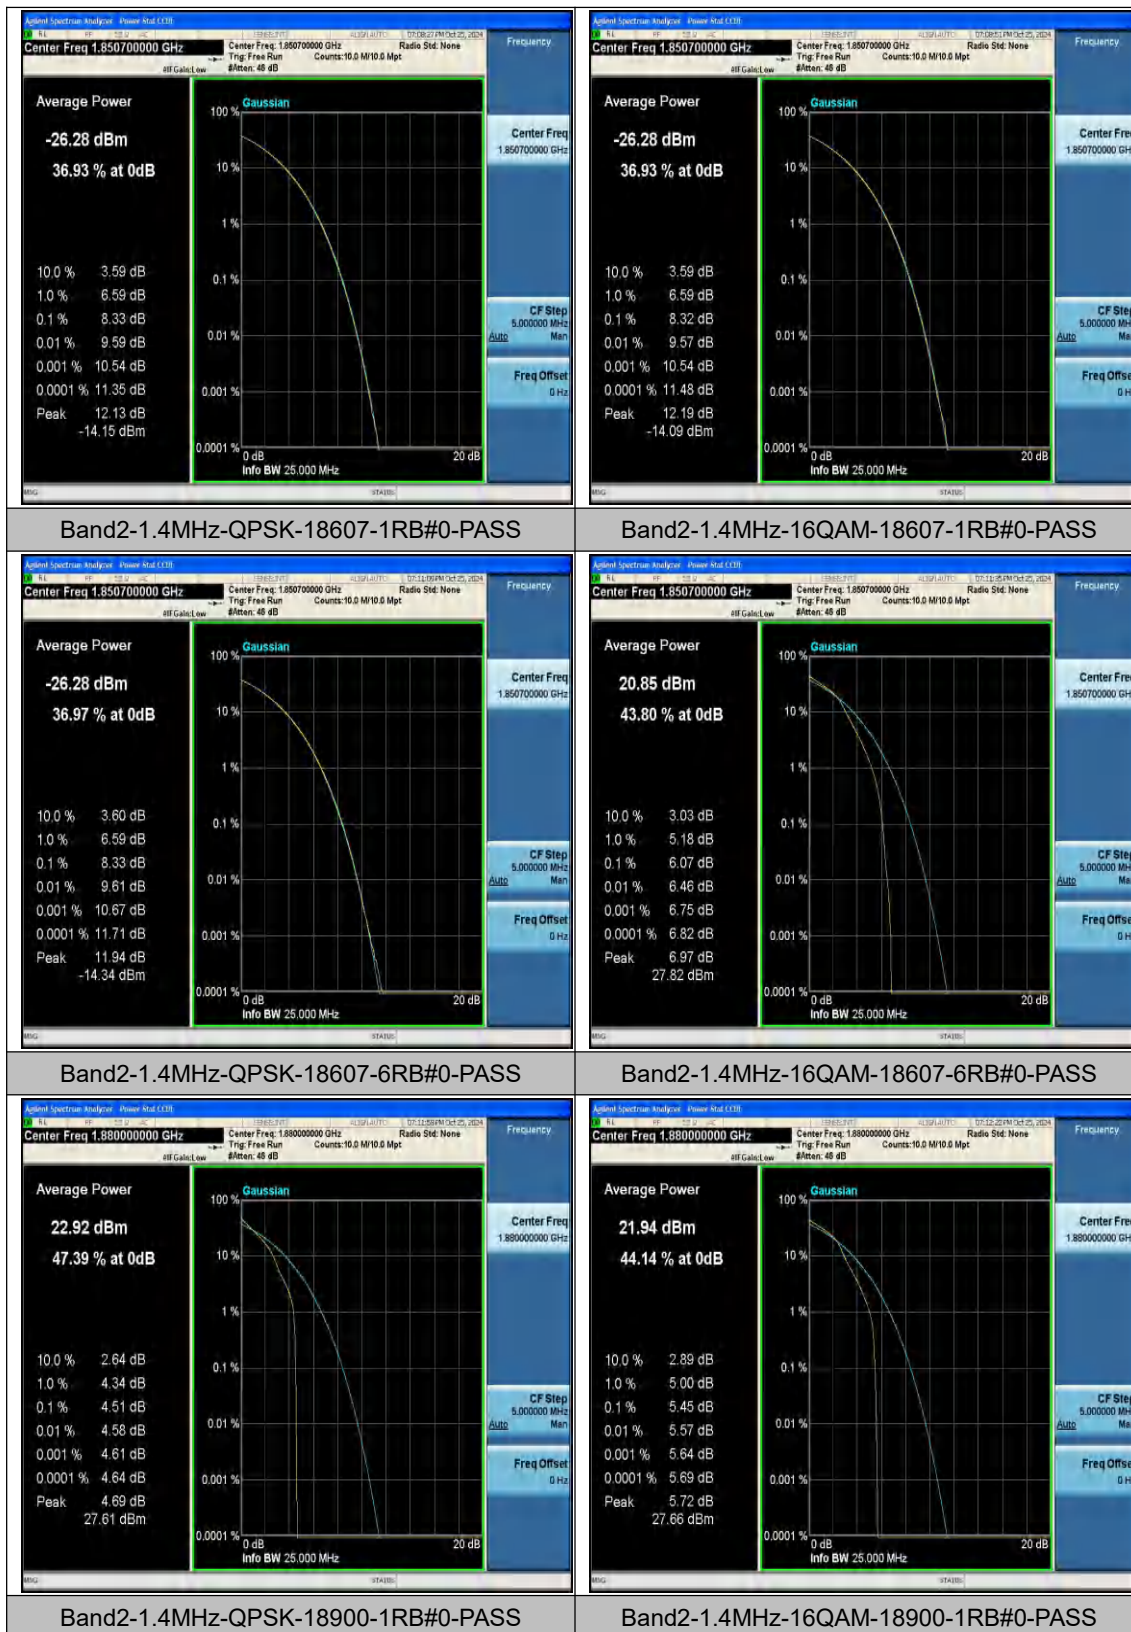


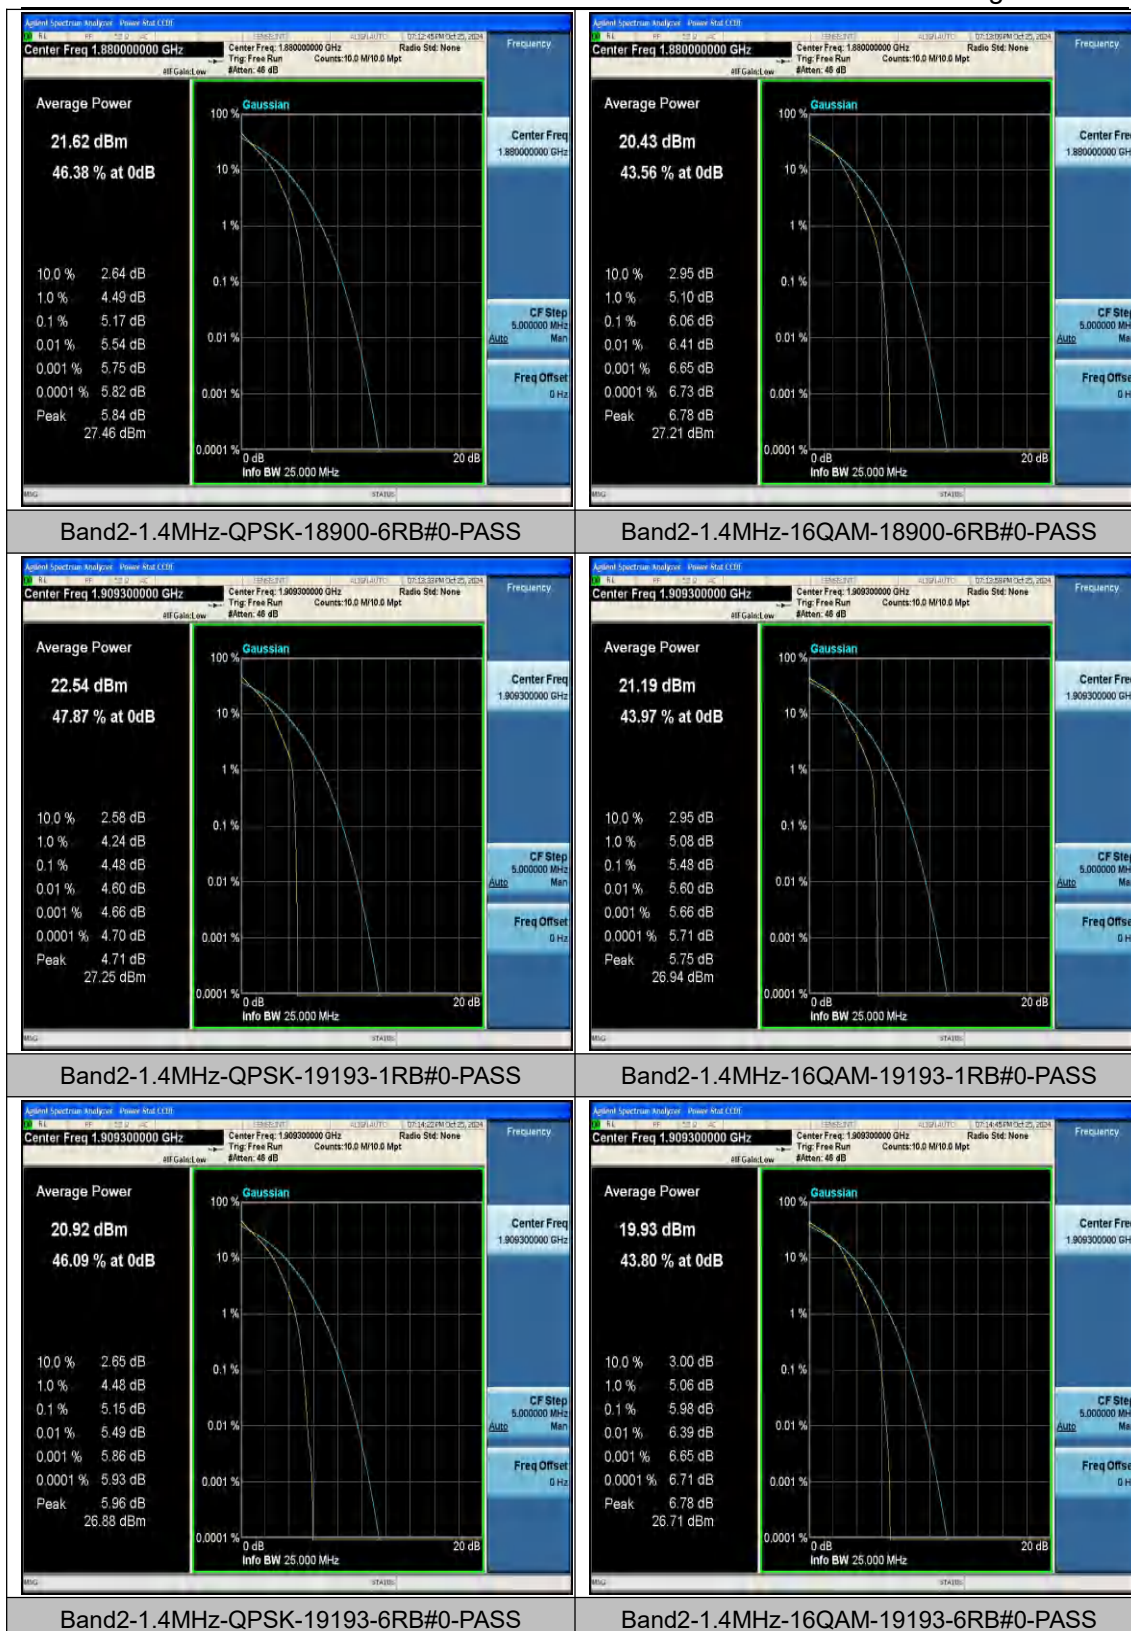


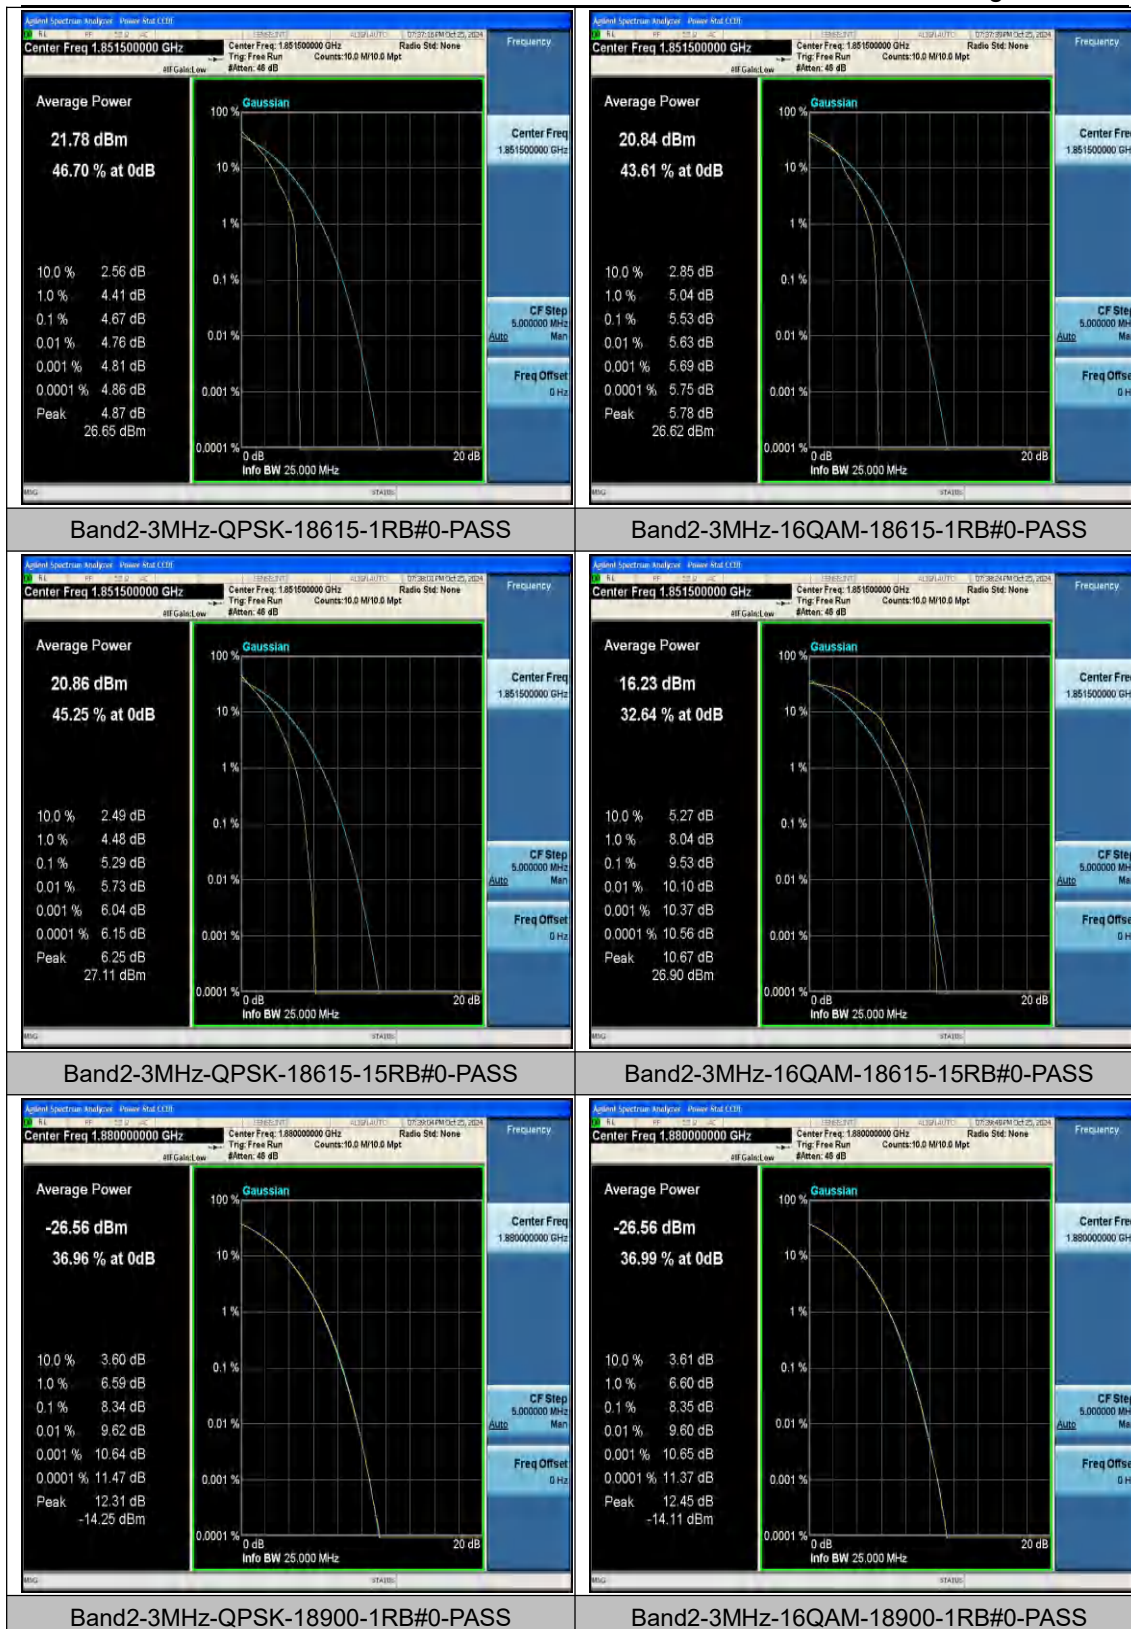


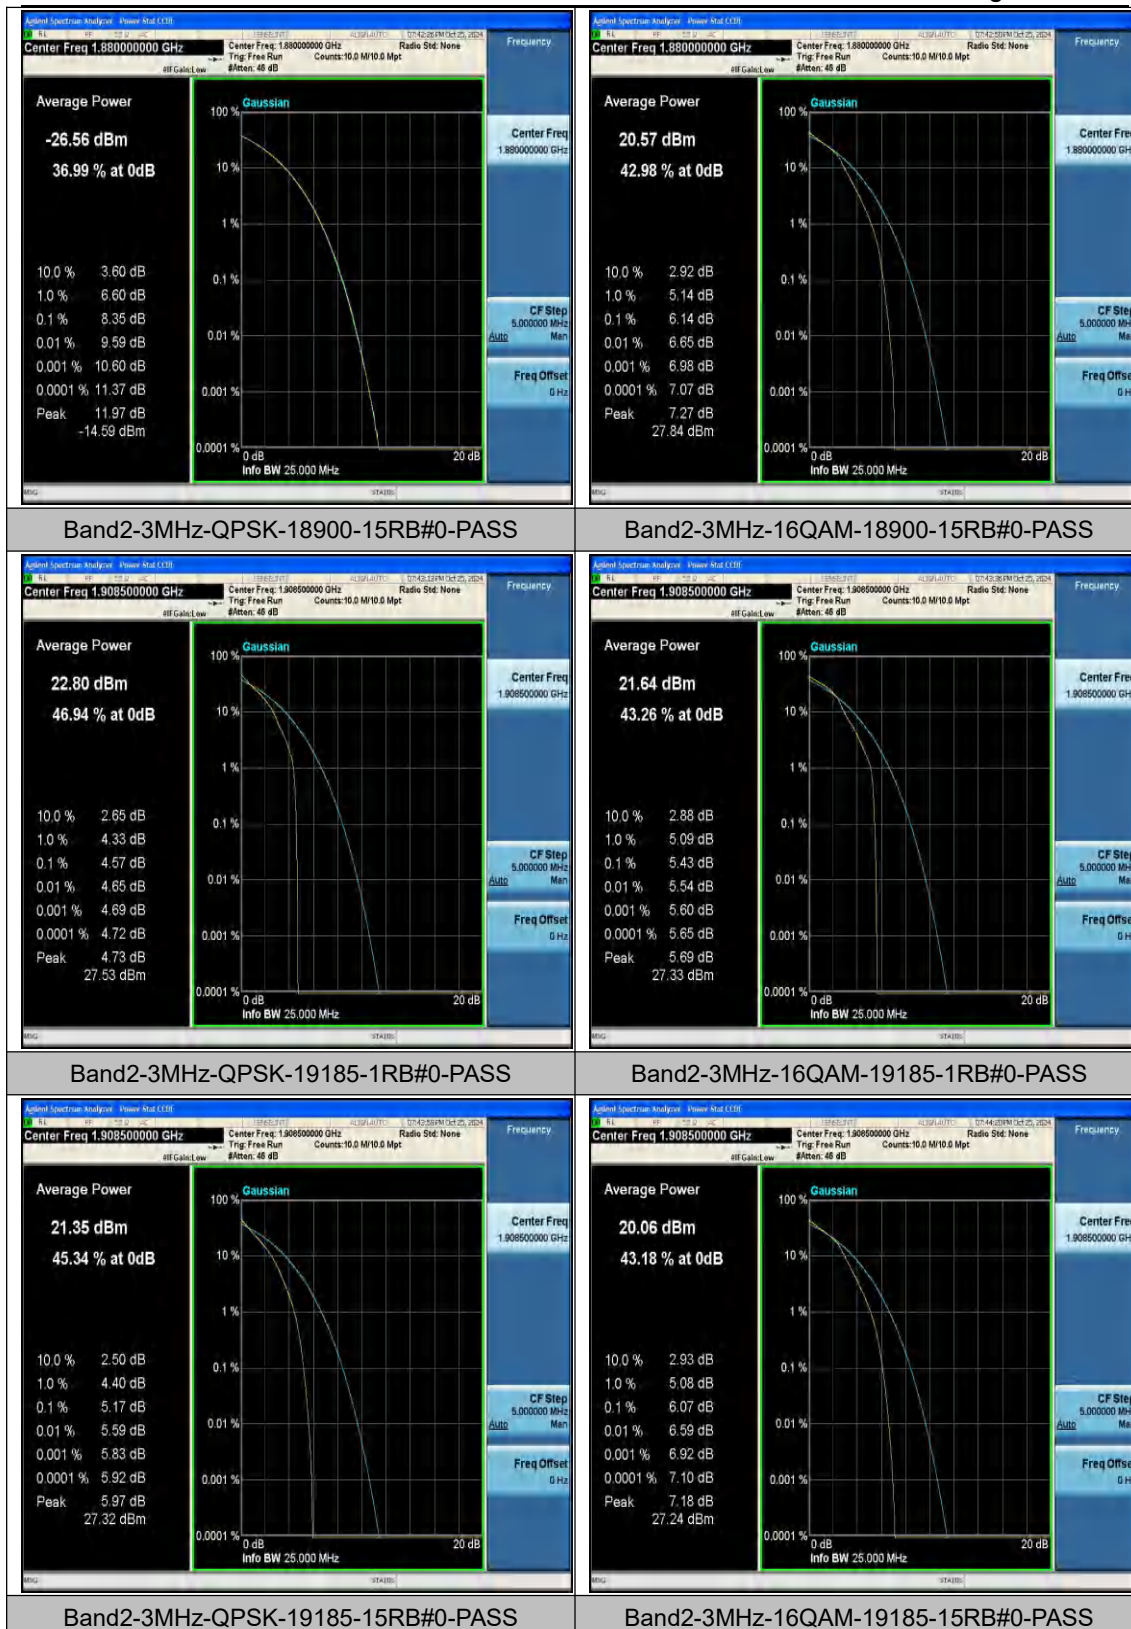


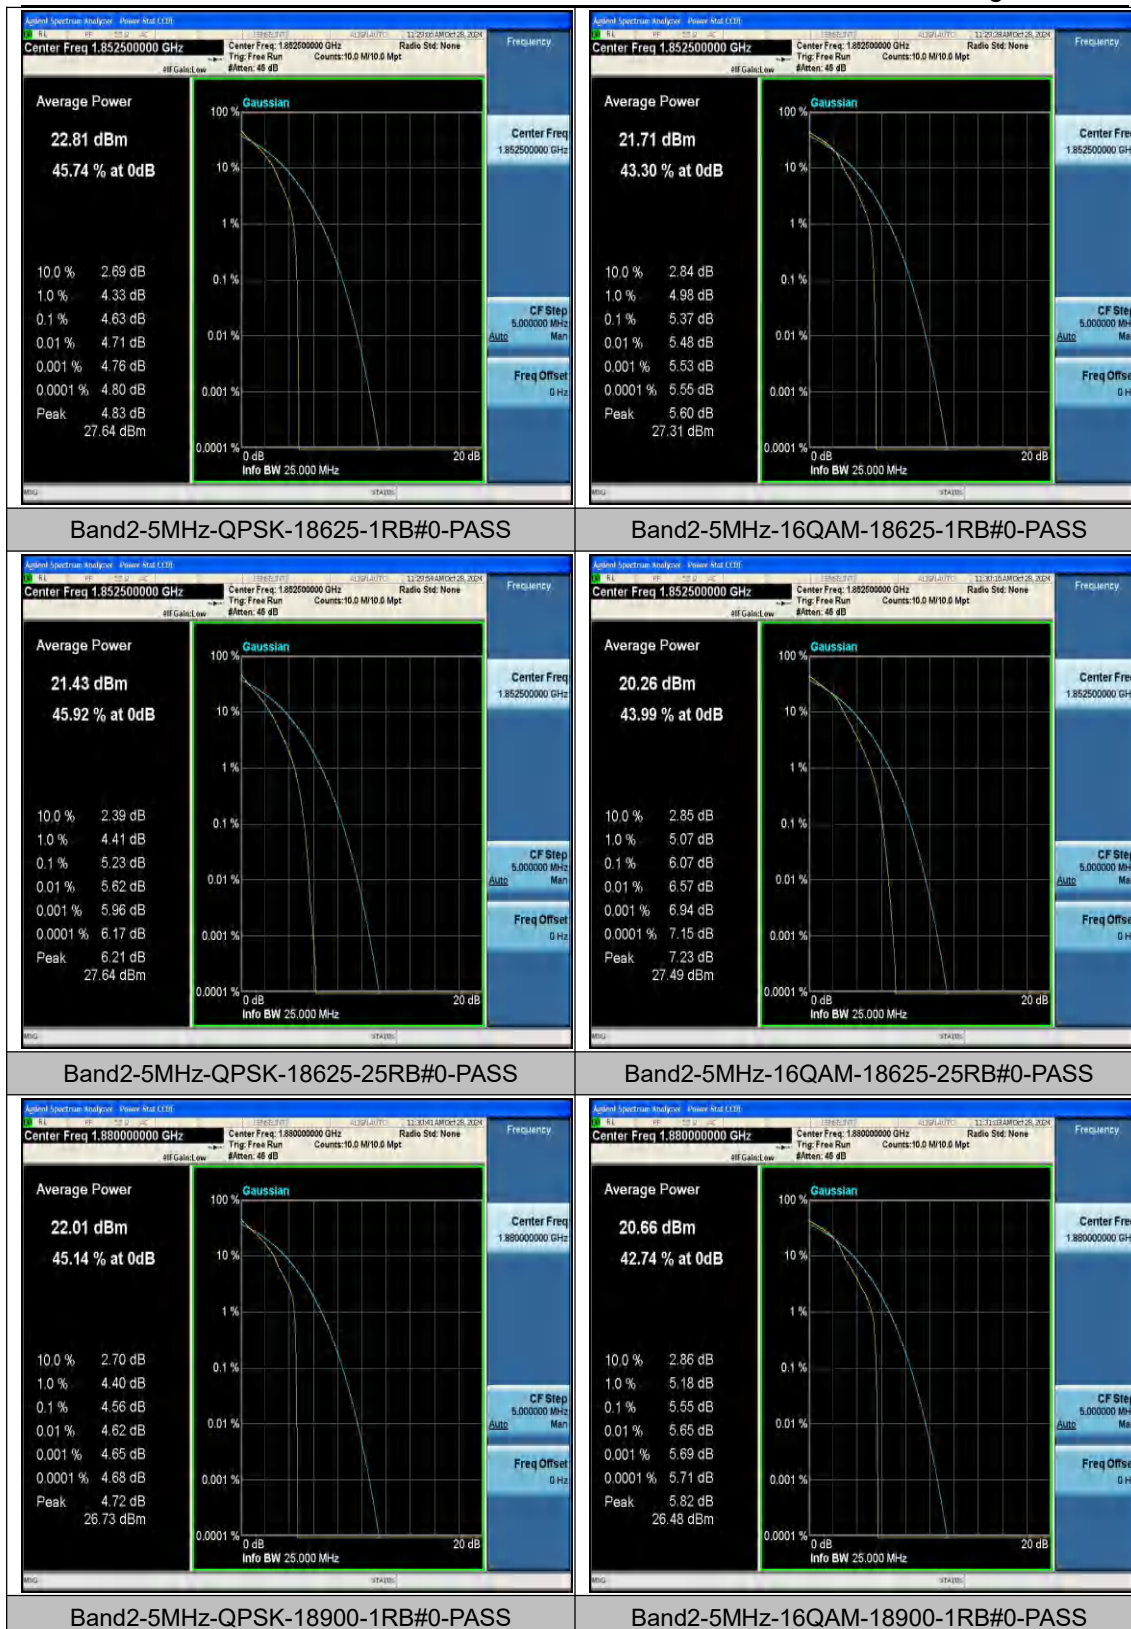


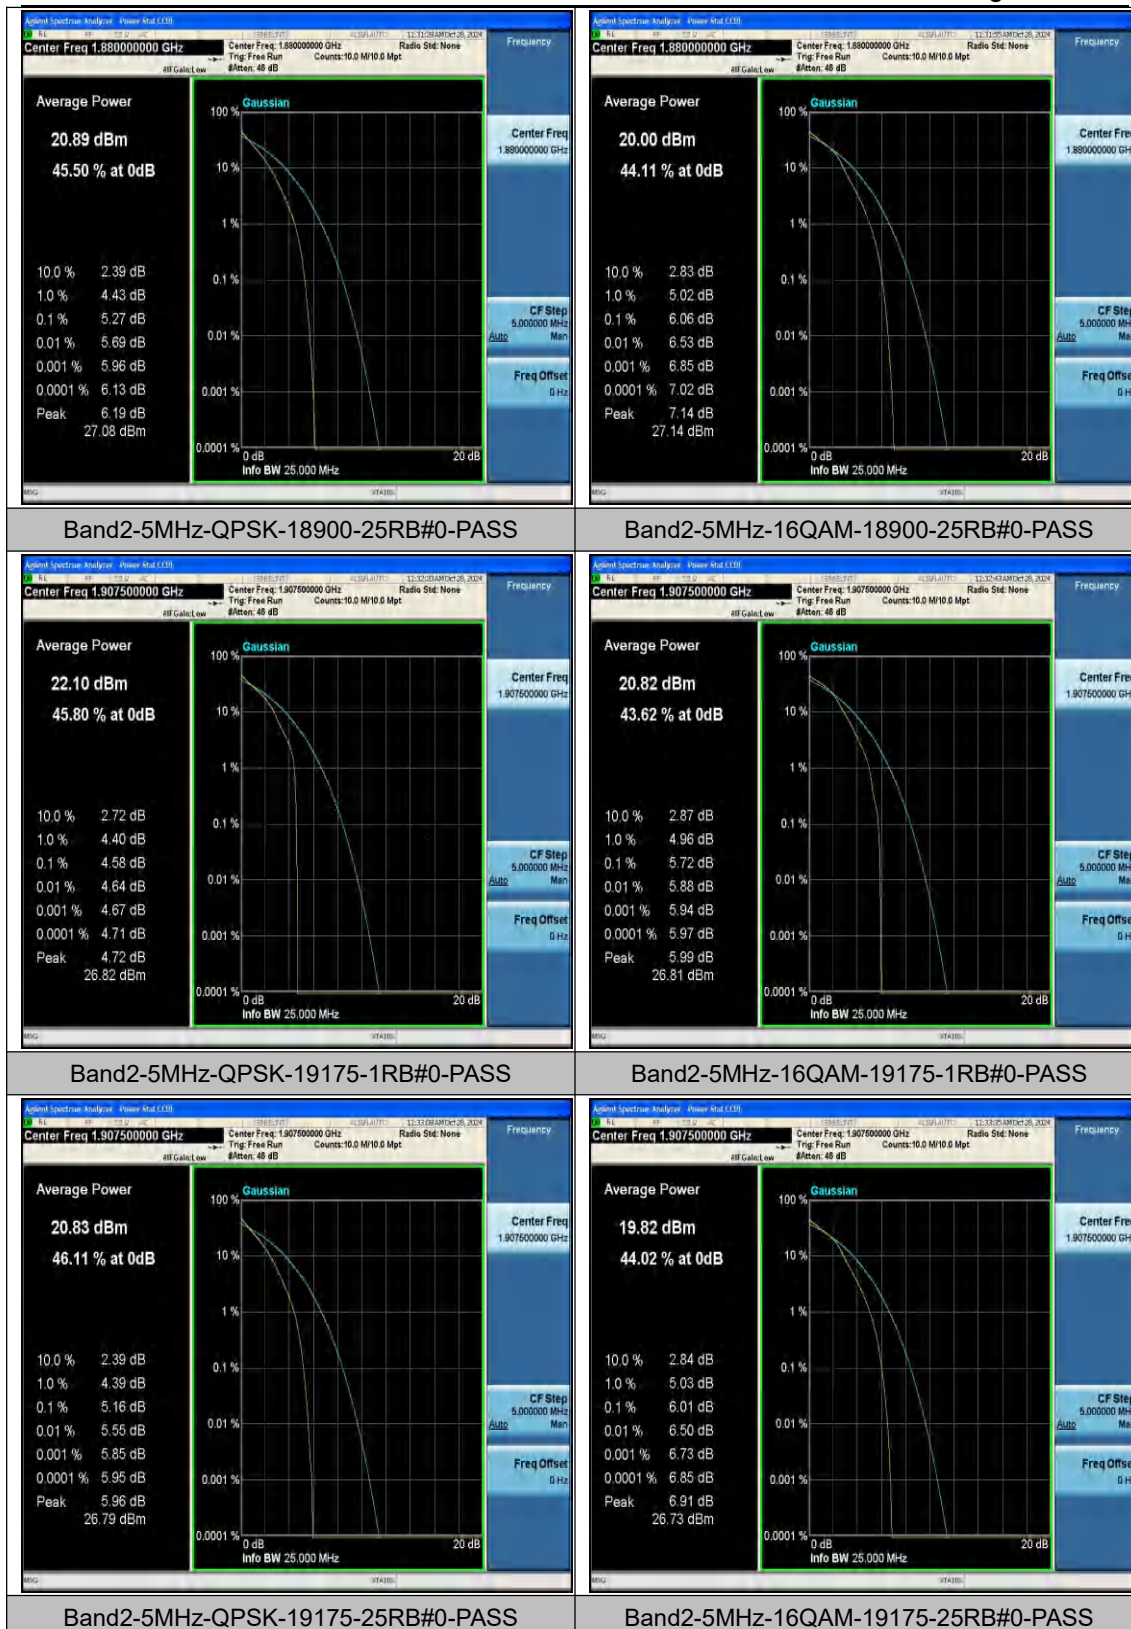


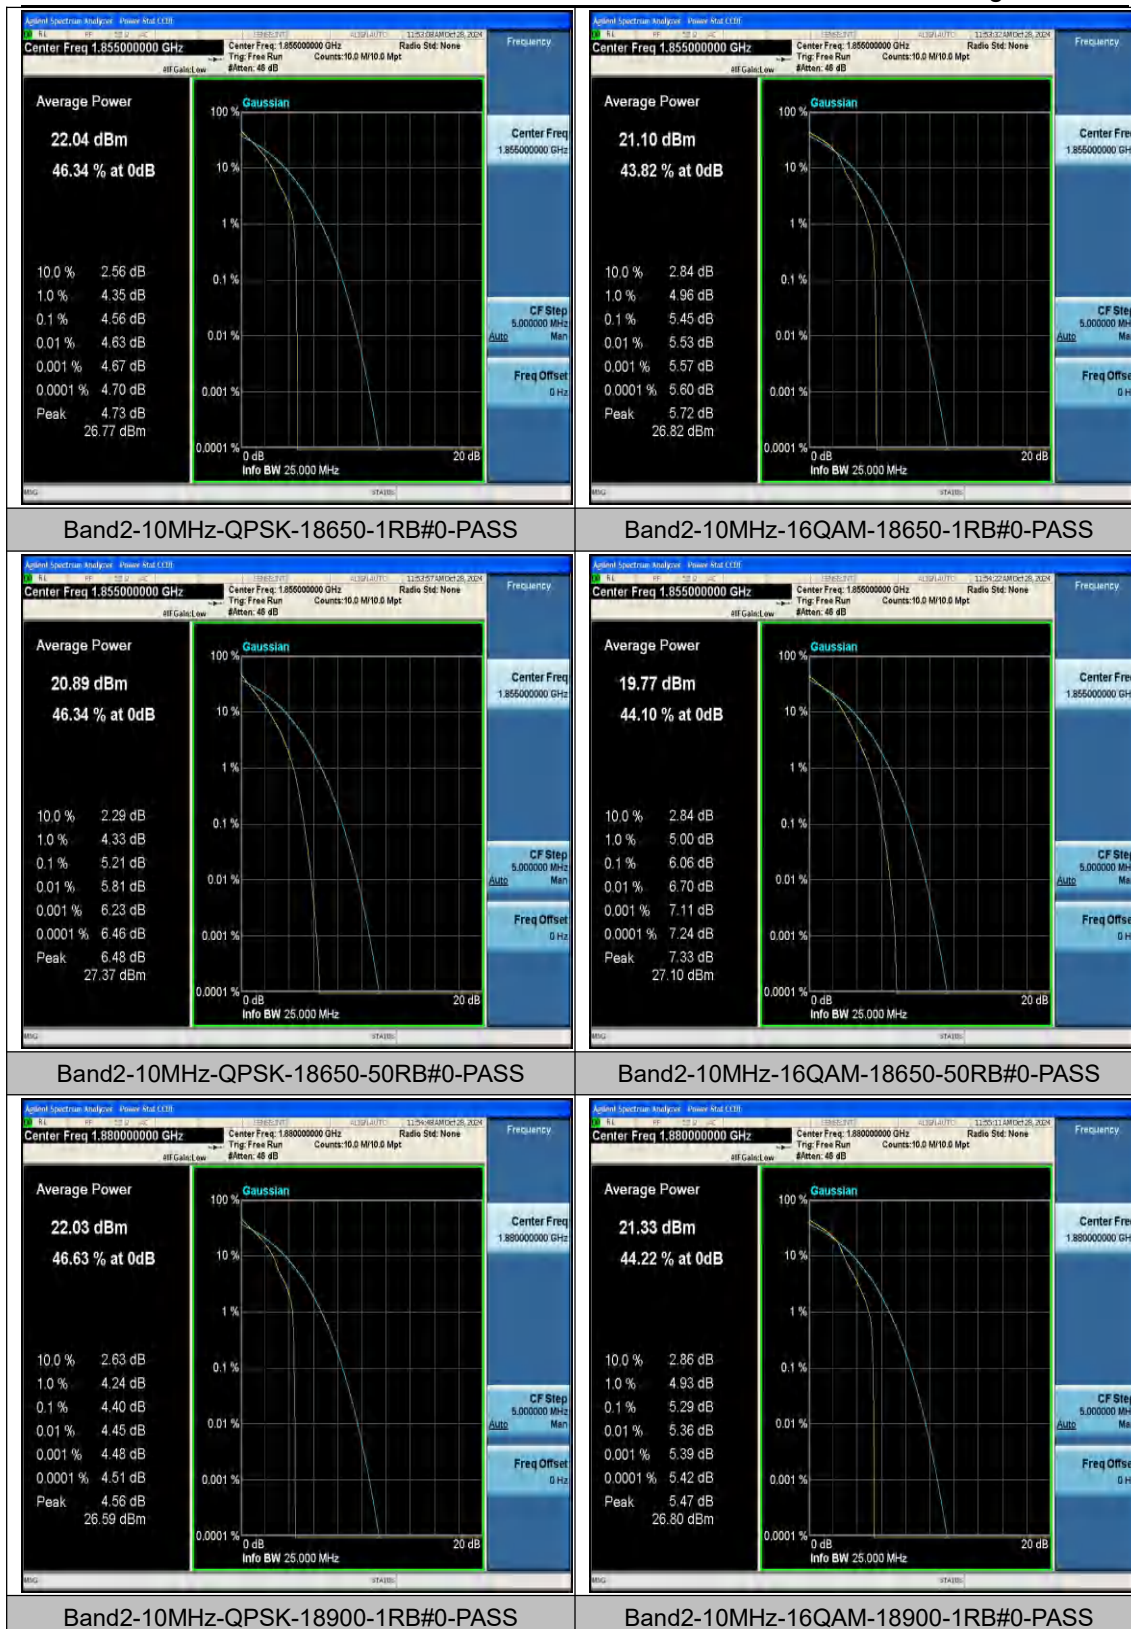


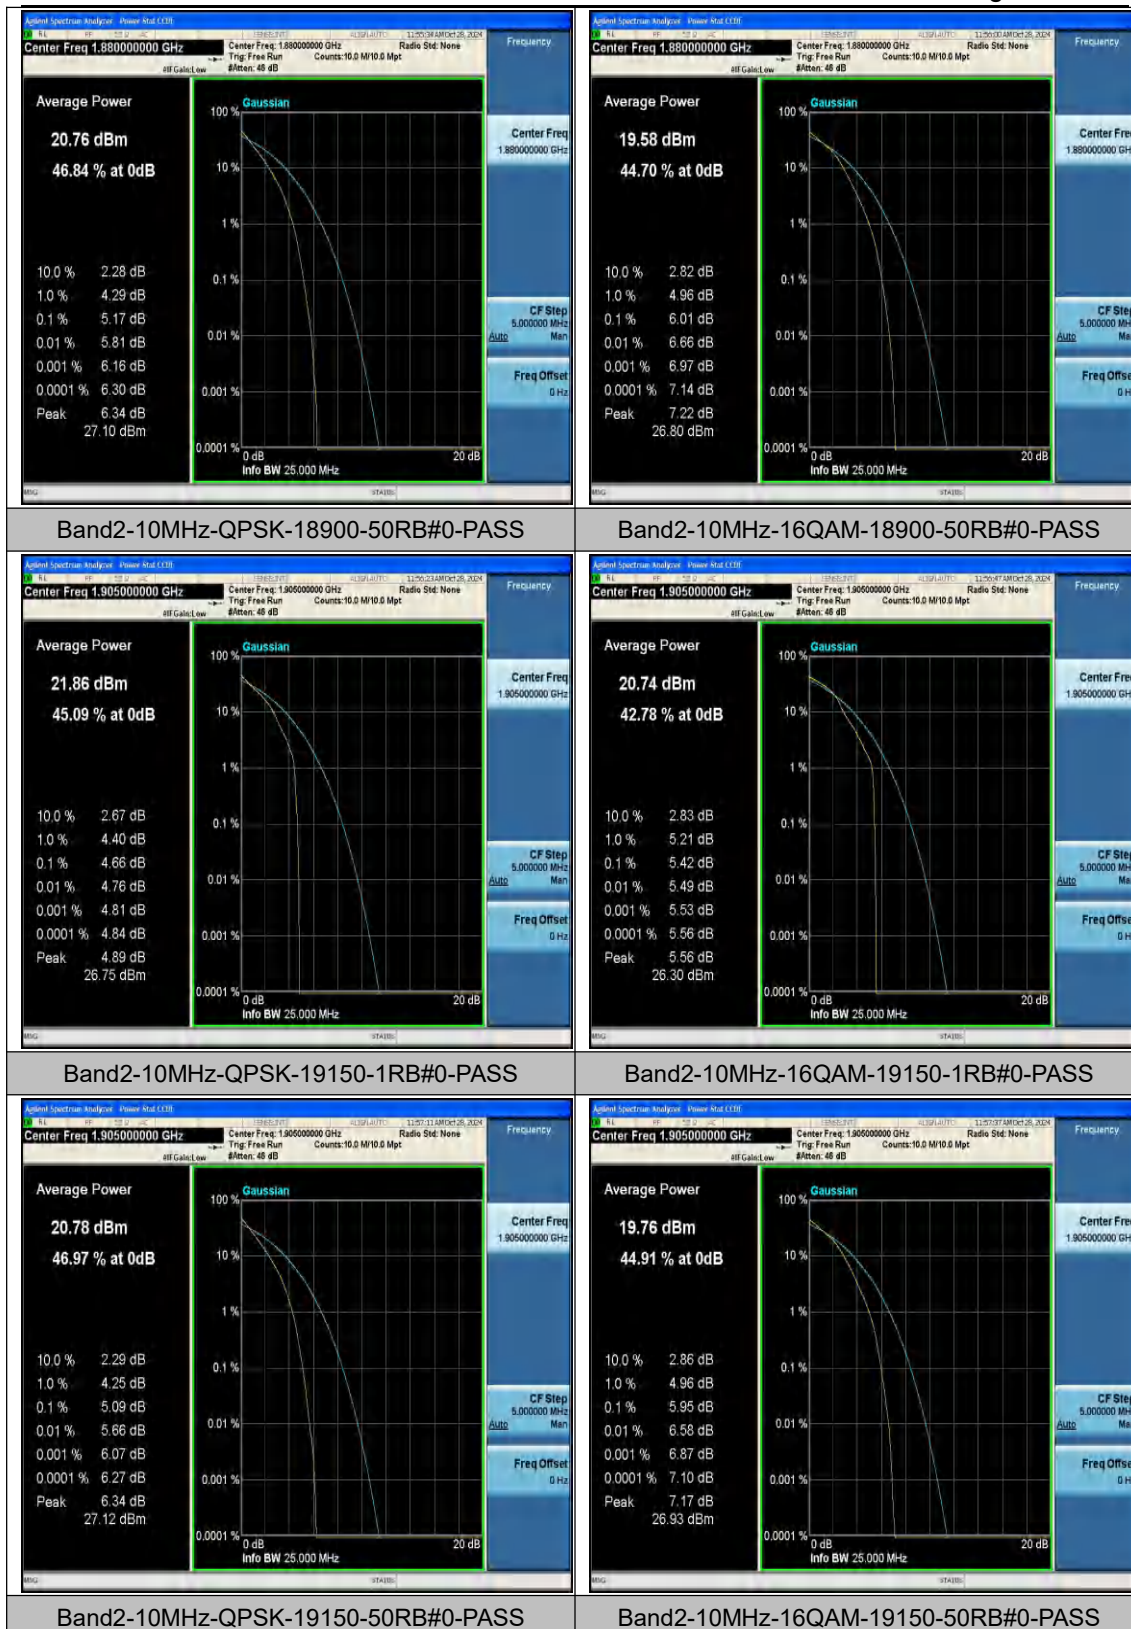

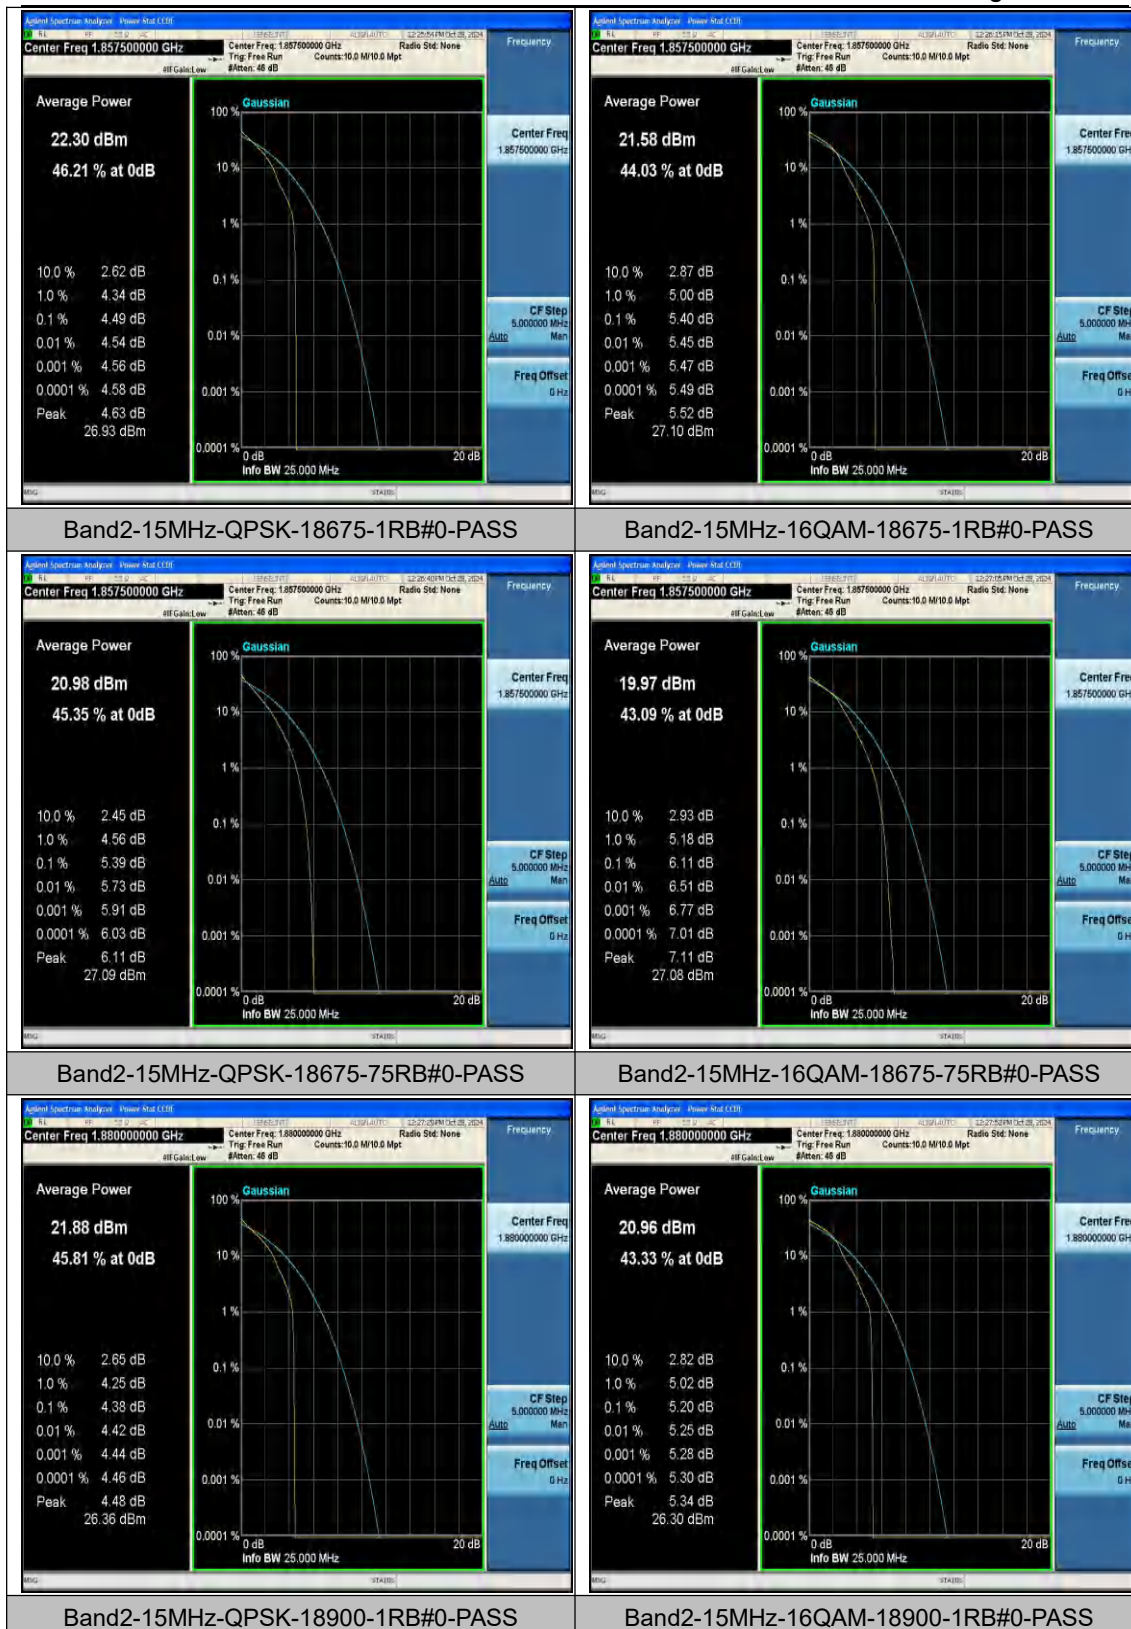

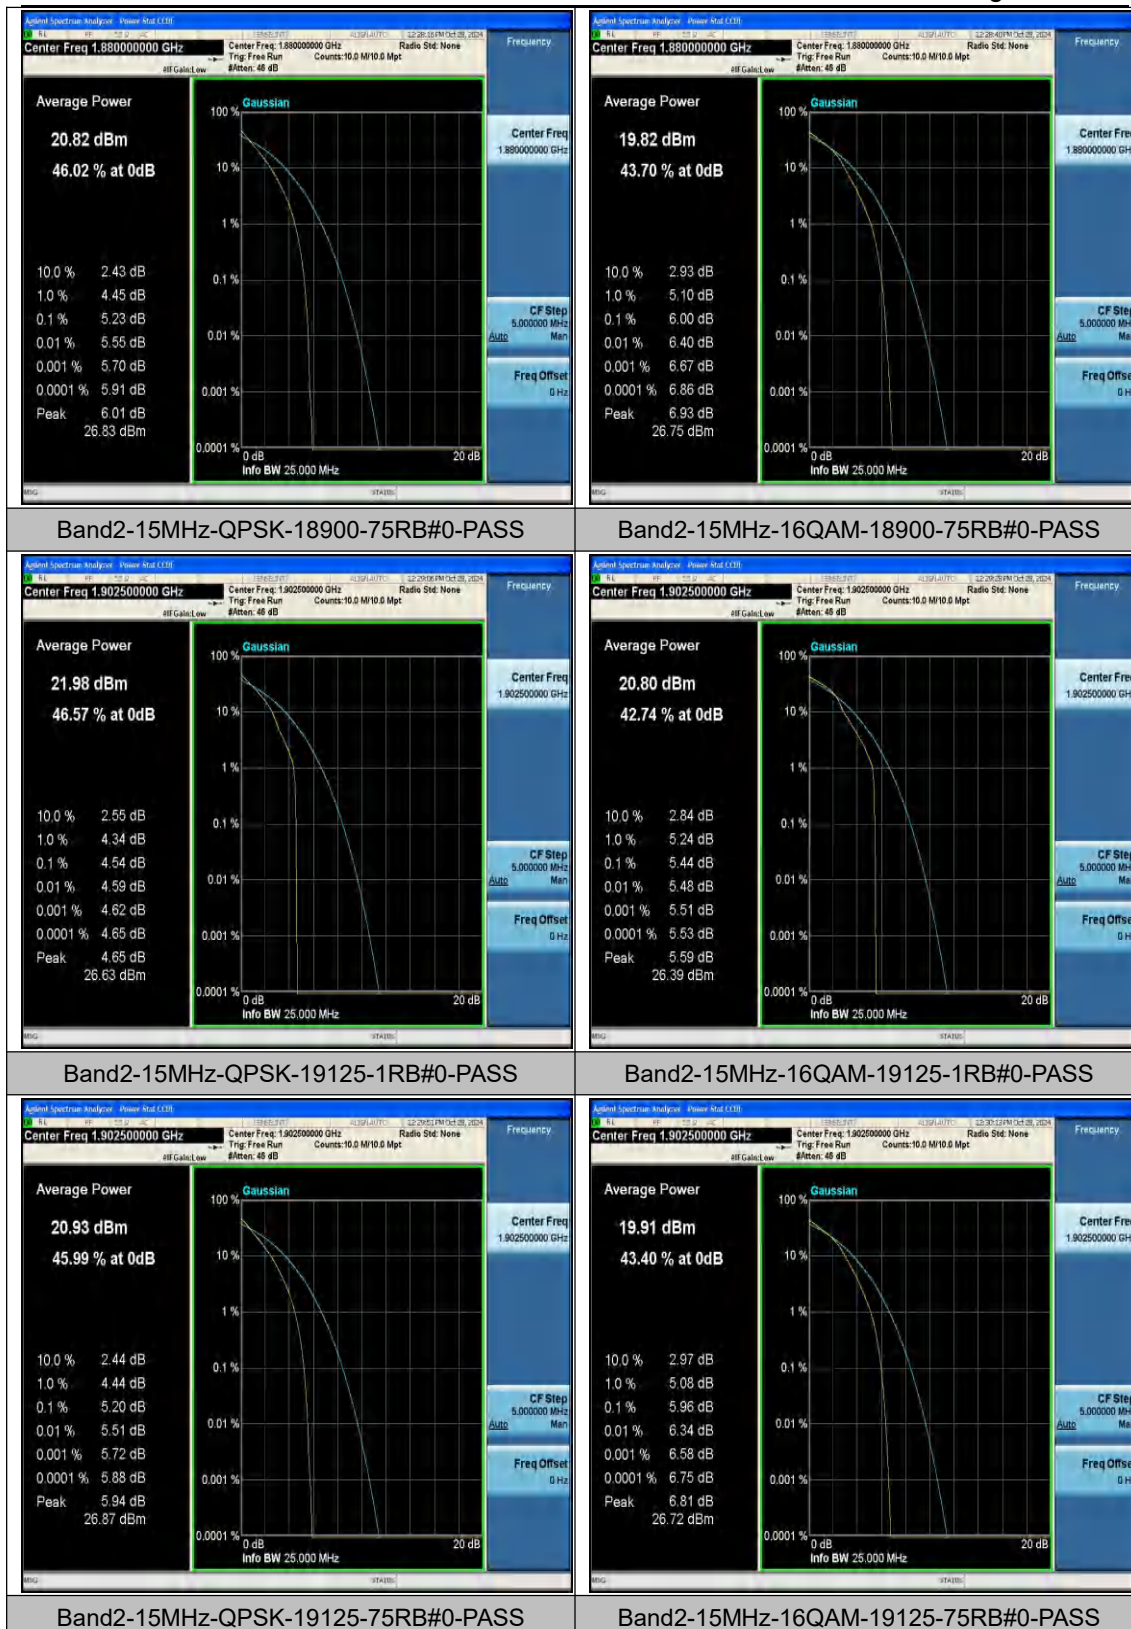

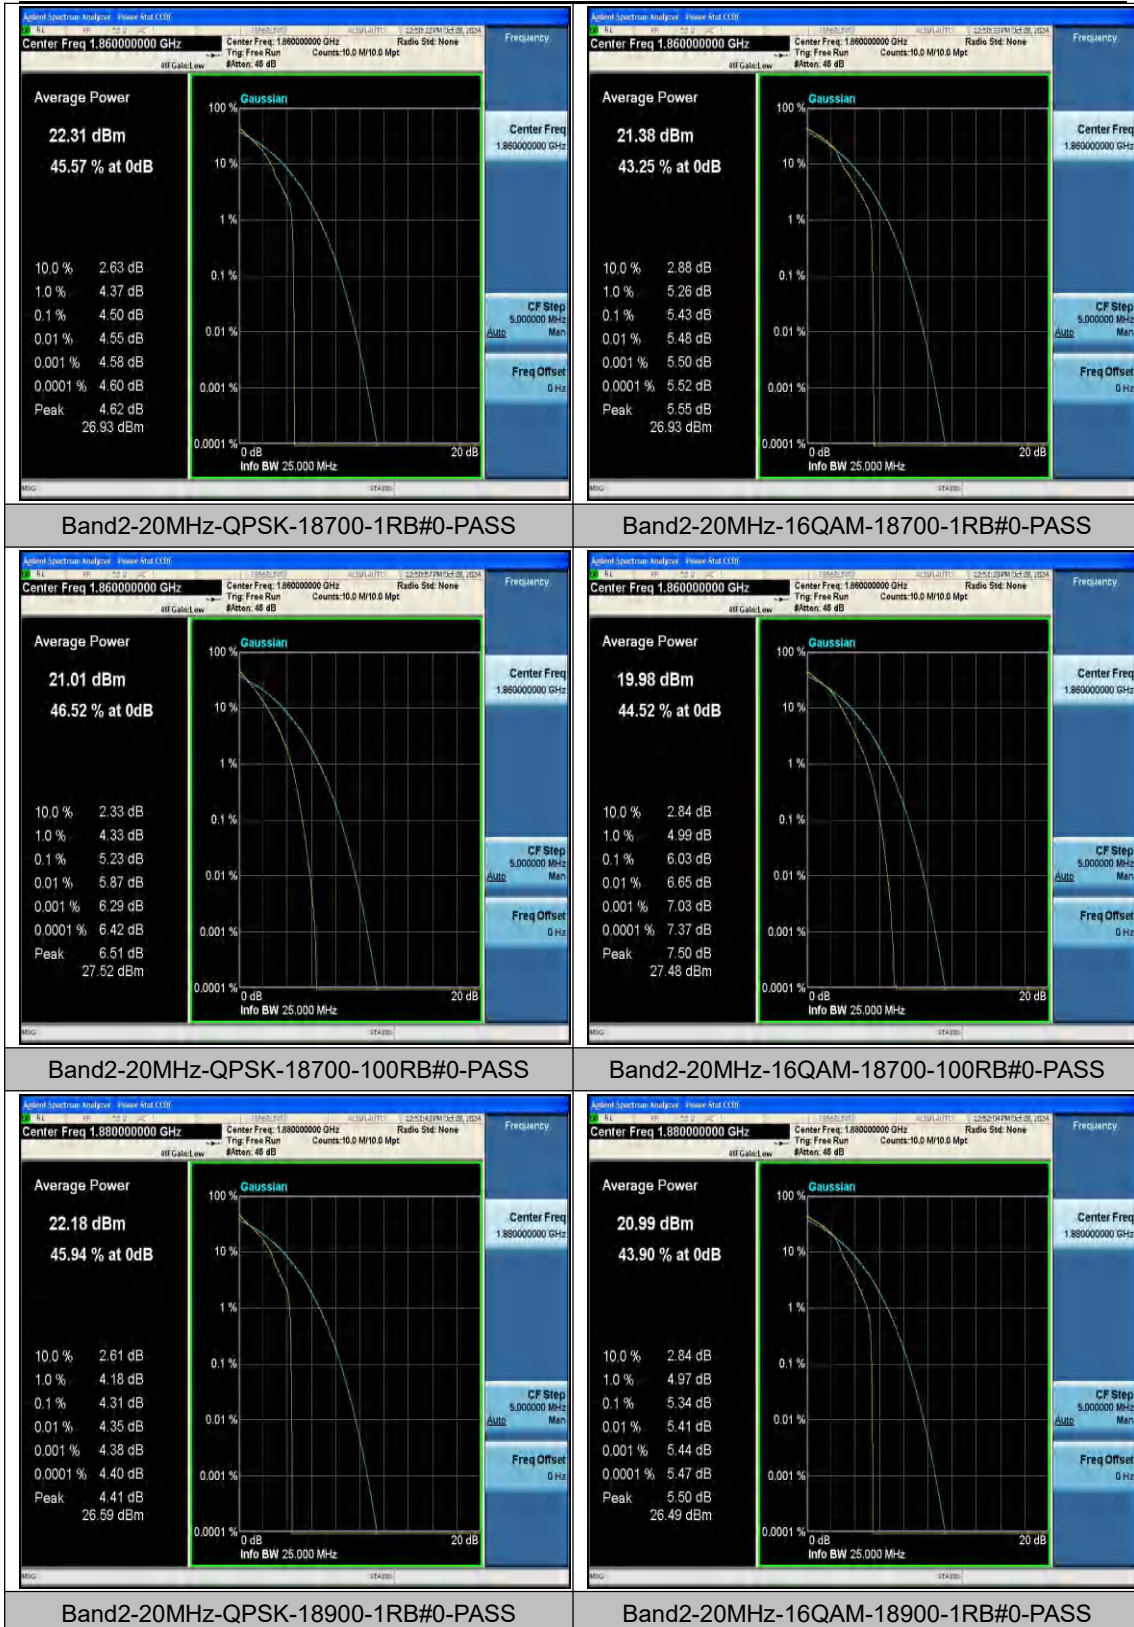

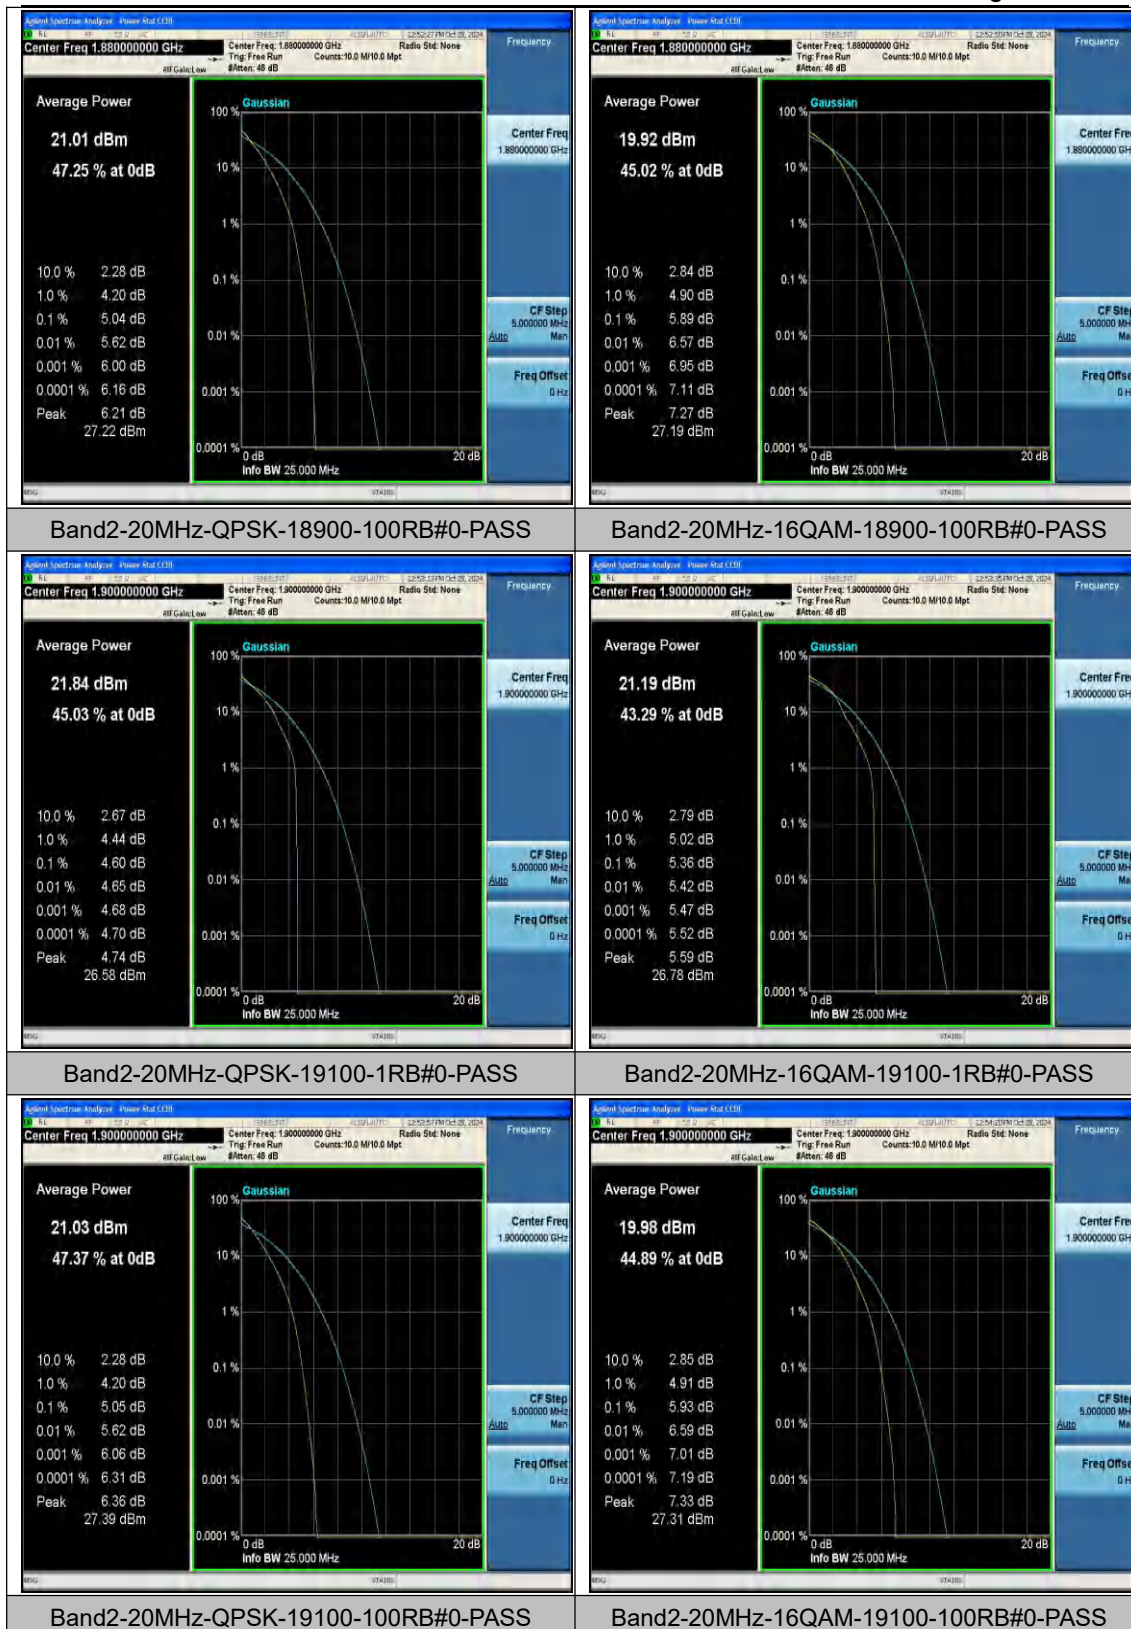

Appendix C: 26dB Bandwidth and Occupied Bandwidth

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band2	1.4MHz	QPSK	18607	6RB#0	1.0948	1.305	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	1.0859	1.277	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	1.0906	1.294	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	1.1016	1.316	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	1.0952	1.317	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	1.0890	1.292	PASS
Band2	3MHz	QPSK	18615	15RB#0	2.6966	2.966	PASS
Band2	3MHz	16QAM	18615	15RB#0	2.6954	2.985	PASS
Band2	3MHz	QPSK	18900	15RB#0	2.6940	2.968	PASS
Band2	3MHz	16QAM	18900	15RB#0	2.6947	2.970	PASS
Band2	3MHz	QPSK	19185	15RB#0	2.7059	2.963	PASS
Band2	3MHz	16QAM	19185	15RB#0	2.6973	2.959	PASS
Band2	5MHz	QPSK	18625	25RB#0	4.5097	5.038	PASS
Band2	5MHz	16QAM	18625	25RB#0	4.5018	5.006	PASS
Band2	5MHz	QPSK	18900	25RB#0	4.5194	5.020	PASS
Band2	5MHz	16QAM	18900	25RB#0	4.5030	5.021	PASS
Band2	5MHz	QPSK	19175	25RB#0	4.5021	4.991	PASS
Band2	5MHz	16QAM	19175	25RB#0	4.5160	5.043	PASS
Band2	10MHz	QPSK	18650	50RB#0	8.9664	9.854	PASS
Band2	10MHz	16QAM	18650	50RB#0	8.9652	9.866	PASS
Band2	10MHz	QPSK	18900	50RB#0	8.9724	9.967	PASS
Band2	10MHz	16QAM	18900	50RB#0	8.9491	9.849	PASS
Band2	10MHz	QPSK	19150	50RB#0	8.9675	9.862	PASS
Band2	10MHz	16QAM	19150	50RB#0	8.9513	9.905	PASS
Band2	15MHz	QPSK	18675	75RB#0	13.422	14.81	PASS
Band2	15MHz	16QAM	18675	75RB#0	13.460	14.71	PASS
Band2	15MHz	QPSK	18900	75RB#0	13.428	14.67	PASS
Band2	15MHz	16QAM	18900	75RB#0	13.433	14.69	PASS
Band2	15MHz	QPSK	19125	75RB#0	13.418	14.67	PASS
Band2	15MHz	16QAM	19125	75RB#0	13.439	14.62	PASS
Band2	20MHz	QPSK	18700	100RB#0	17.961	19.42	PASS
Band2	20MHz	16QAM	18700	100RB#0	17.919	19.65	PASS
Band2	20MHz	QPSK	18900	100RB#0	17.893	19.36	PASS
Band2	20MHz	16QAM	18900	100RB#0	17.939	19.34	PASS
Band2	20MHz	QPSK	19100	100RB#0	17.872	19.59	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com



Band2	20MHz	16QAM	19100	100RB#0	17.867	19.34	PASS
-------	-------	-------	-------	---------	--------	-------	------


Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com

 Hotline
400-003-0500
www.anbotek.com




Test Graphs

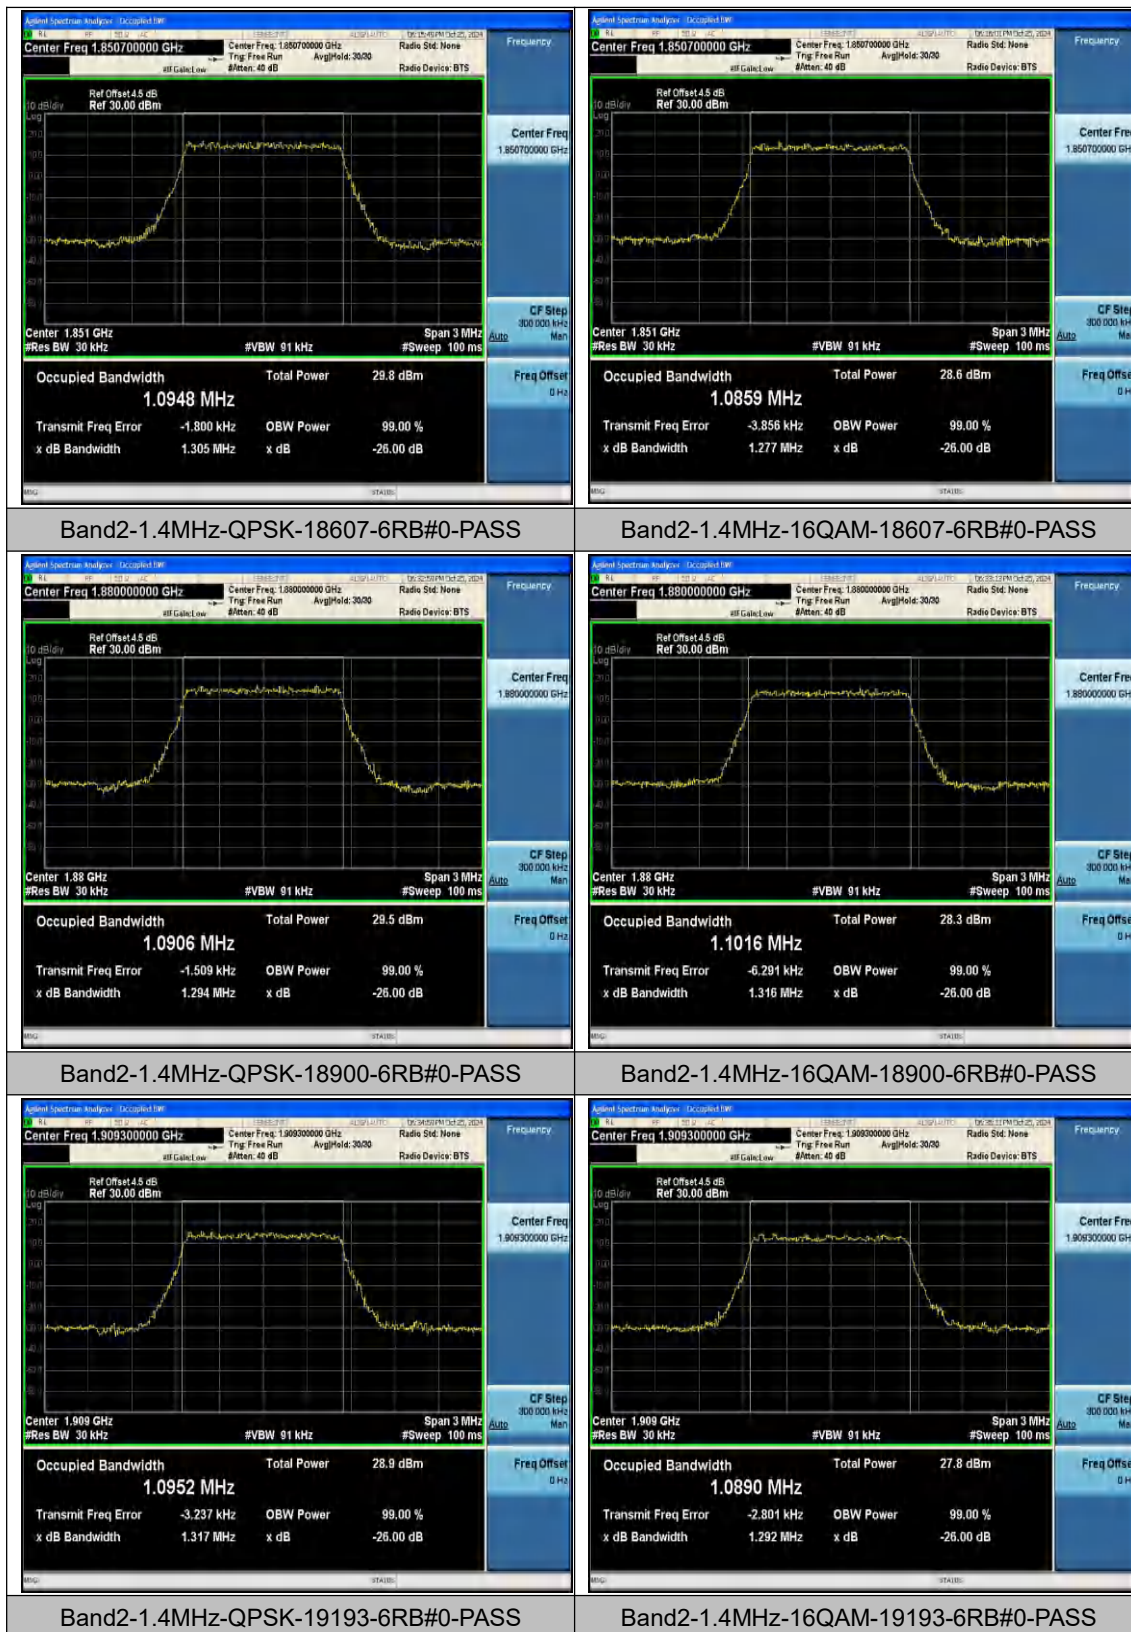

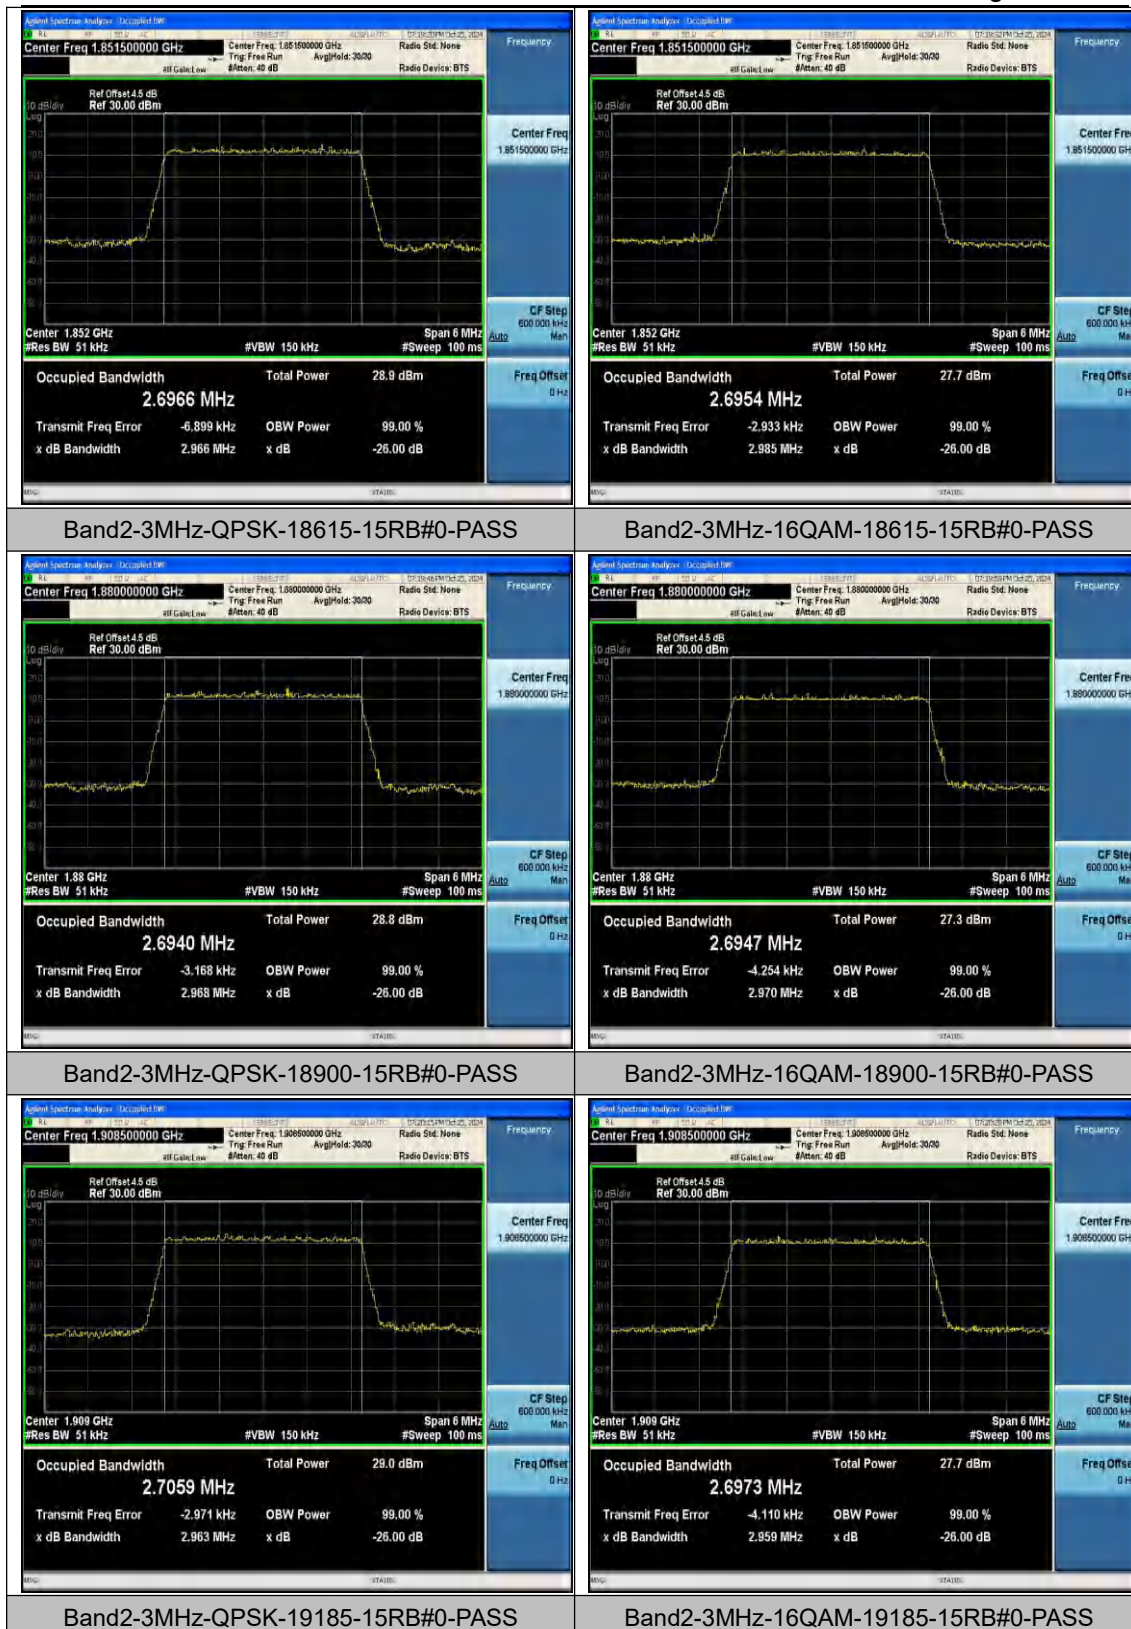



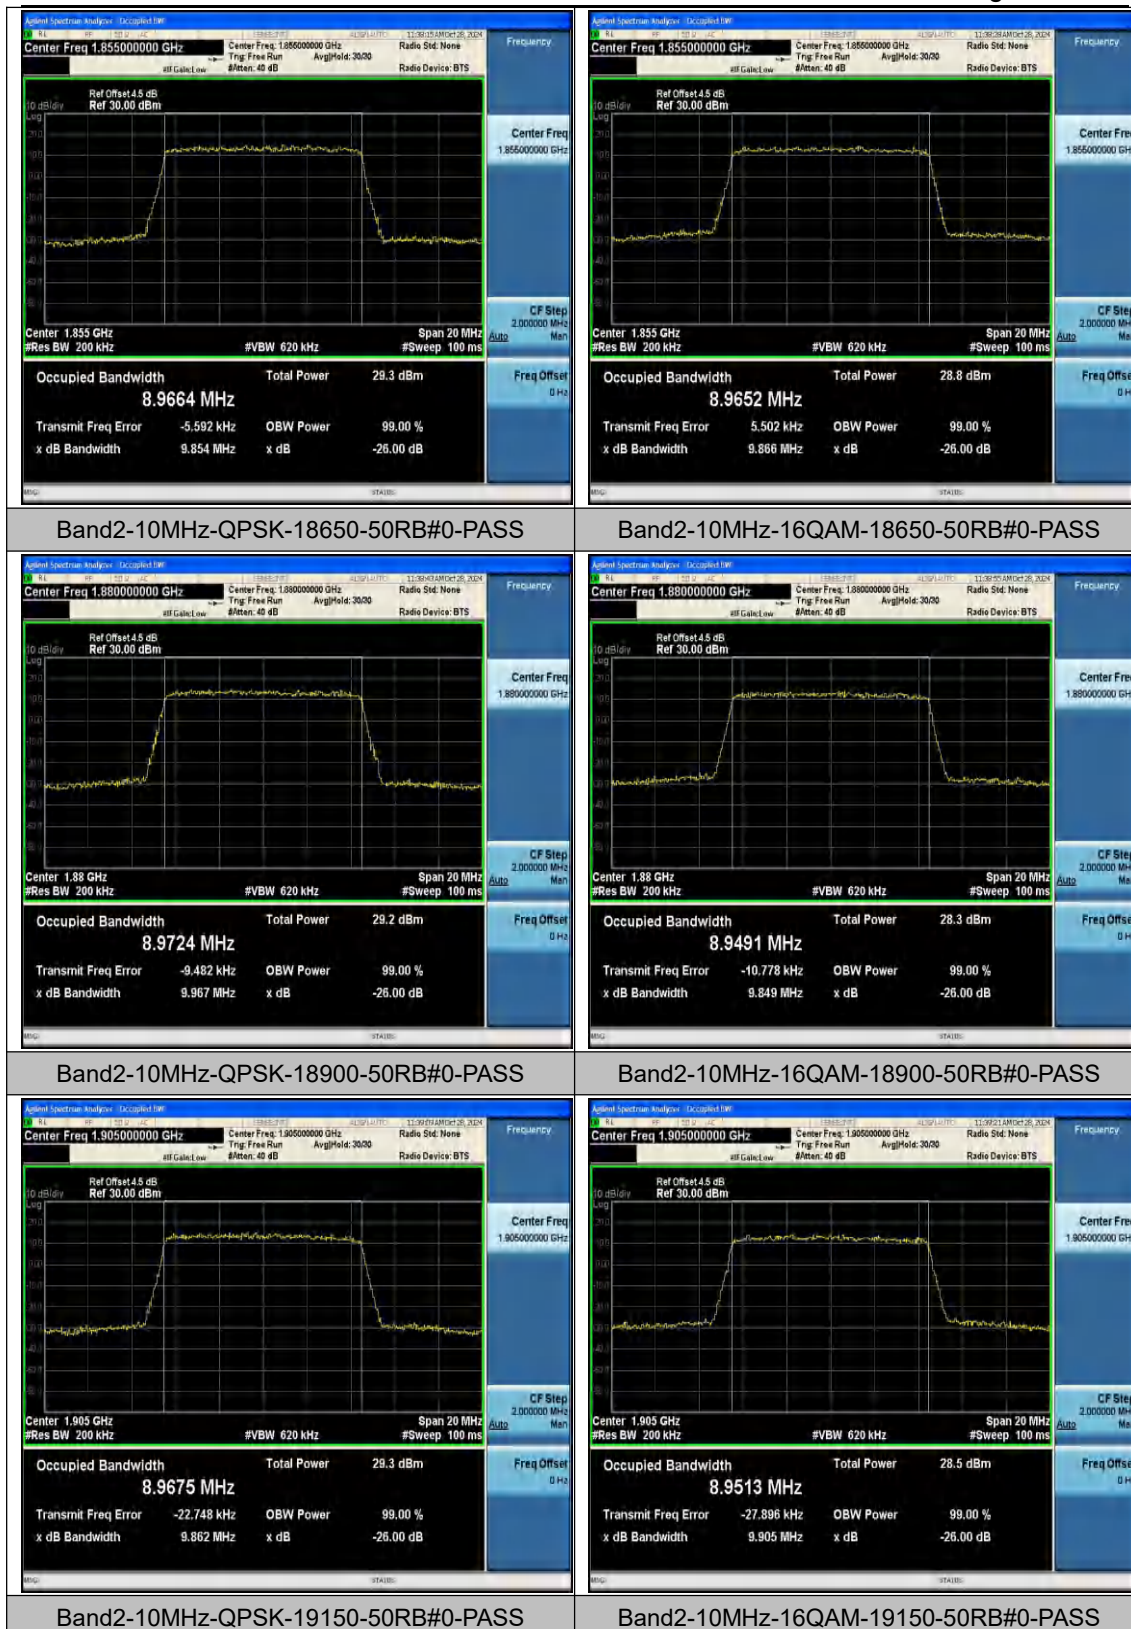





Appendix D: Band Edge

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band2	1.4MHz	QPSK	18607	1RB#0	-26.64	PASS
Band2	1.4MHz	16QAM	18607	1RB#0	-28.66	PASS
Band2	1.4MHz	QPSK	18607	1RB#5	-40.49	PASS
Band2	1.4MHz	16QAM	18607	1RB#5	-40.23	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	-32.75	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	-34.58	PASS
Band2	1.4MHz	QPSK	19193	1RB#0	-40.38	PASS
Band2	1.4MHz	16QAM	19193	1RB#0	-41.23	PASS
Band2	1.4MHz	QPSK	19193	1RB#5	-28.11	PASS
Band2	1.4MHz	16QAM	19193	1RB#5	-29.69	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	-33.95	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	-34.27	PASS
Band2	3MHz	QPSK	18615	1RB#0	-23.25	PASS
Band2	3MHz	16QAM	18615	1RB#0	-23.12	PASS
Band2	3MHz	QPSK	18615	1RB#14	-45.12	PASS
Band2	3MHz	16QAM	18615	1RB#14	-44.42	PASS
Band2	3MHz	QPSK	18615	15RB#0	-27.52	PASS
Band2	3MHz	16QAM	18615	15RB#0	-30.06	PASS
Band2	3MHz	QPSK	19185	1RB#0	-45.35	PASS
Band2	3MHz	16QAM	19185	1RB#0	-47.21	PASS
Band2	3MHz	QPSK	19185	1RB#14	-21.33	PASS
Band2	3MHz	16QAM	19185	1RB#14	-23.10	PASS
Band2	3MHz	QPSK	19185	15RB#0	-29.31	PASS
Band2	3MHz	16QAM	19185	15RB#0	-30.78	PASS
Band2	5MHz	QPSK	18625	1RB#0	-22.57	PASS
Band2	5MHz	16QAM	18625	1RB#0	-24.39	PASS
Band2	5MHz	QPSK	18625	1RB#24	-55.56	PASS
Band2	5MHz	16QAM	18625	1RB#24	-55.83	PASS
Band2	5MHz	QPSK	18625	25RB#0	-30.22	PASS
Band2	5MHz	16QAM	18625	25RB#0	-31.24	PASS
Band2	5MHz	QPSK	19175	1RB#0	-55.62	PASS
Band2	5MHz	16QAM	19175	1RB#0	-56.69	PASS
Band2	5MHz	QPSK	19175	1RB#24	-23.25	PASS
Band2	5MHz	16QAM	19175	1RB#24	-24.53	PASS
Band2	5MHz	QPSK	19175	25RB#0	-30.82	PASS
Band2	5MHz	16QAM	19175	25RB#0	-31.80	PASS
Band2	10MHz	QPSK	18650	1RB#0	-33.16	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com



Band2	10MHz	16QAM	18650	1RB#0	-34.63	PASS
Band2	10MHz	QPSK	18650	1RB#49	-51.72	PASS
Band2	10MHz	16QAM	18650	1RB#49	-51.93	PASS
Band2	10MHz	QPSK	18650	50RB#0	-34.65	PASS
Band2	10MHz	16QAM	18650	50RB#0	-34.84	PASS
Band2	10MHz	QPSK	19150	1RB#0	-54.04	PASS
Band2	10MHz	16QAM	19150	1RB#0	-53.23	PASS
Band2	10MHz	QPSK	19150	1RB#49	-32.93	PASS
Band2	10MHz	16QAM	19150	1RB#49	-31.75	PASS
Band2	10MHz	QPSK	19150	50RB#0	-35.86	PASS
Band2	10MHz	16QAM	19150	50RB#0	-36.00	PASS
Band2	15MHz	QPSK	18675	1RB#0	-29.51	PASS
Band2	15MHz	16QAM	18675	1RB#0	-30.55	PASS
Band2	15MHz	QPSK	18675	1RB#74	-51.18	PASS
Band2	15MHz	16QAM	18675	1RB#74	-51.68	PASS
Band2	15MHz	QPSK	18675	75RB#0	-36.60	PASS
Band2	15MHz	16QAM	18675	75RB#0	-36.50	PASS
Band2	15MHz	QPSK	19125	1RB#0	-50.18	PASS
Band2	15MHz	16QAM	19125	1RB#0	-49.89	PASS
Band2	15MHz	QPSK	19125	1RB#74	-30.96	PASS
Band2	15MHz	16QAM	19125	1RB#74	-31.47	PASS
Band2	15MHz	QPSK	19125	75RB#0	-36.09	PASS
Band2	15MHz	16QAM	19125	75RB#0	-36.65	PASS
Band2	20MHz	QPSK	18700	1RB#0	-34.70	PASS
Band2	20MHz	16QAM	18700	1RB#0	-33.73	PASS
Band2	20MHz	QPSK	18700	1RB#99	-53.50	PASS
Band2	20MHz	16QAM	18700	1RB#99	-53.97	PASS
Band2	20MHz	QPSK	18700	100RB#0	-38.06	PASS
Band2	20MHz	16QAM	18700	100RB#0	-37.47	PASS
Band2	20MHz	QPSK	19100	1RB#0	-53.56	PASS
Band2	20MHz	16QAM	19100	1RB#0	-53.77	PASS
Band2	20MHz	QPSK	19100	1RB#99	-32.46	PASS
Band2	20MHz	16QAM	19100	1RB#99	-34.27	PASS
Band2	20MHz	QPSK	19100	100RB#0	-37.65	PASS
Band2	20MHz	16QAM	19100	100RB#0	-37.20	PASS



Test Graphs

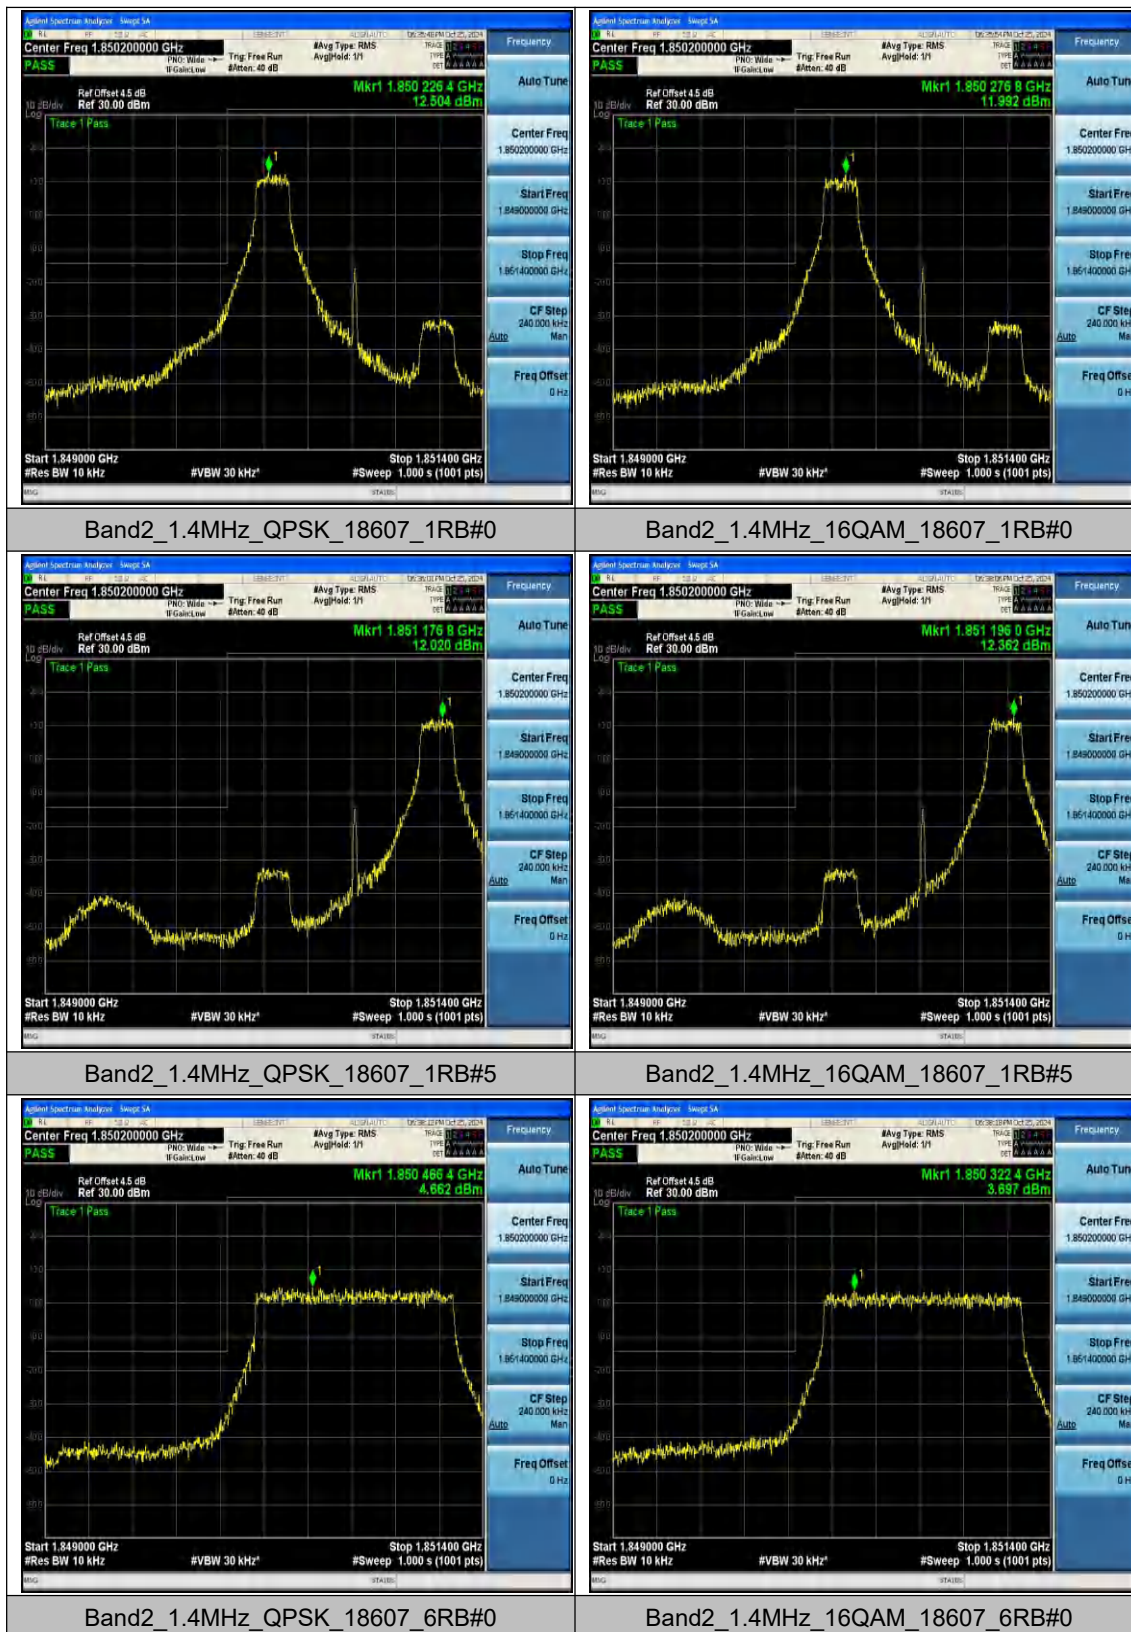


Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com





Hotline
400-003-0500
www.anbotek.com




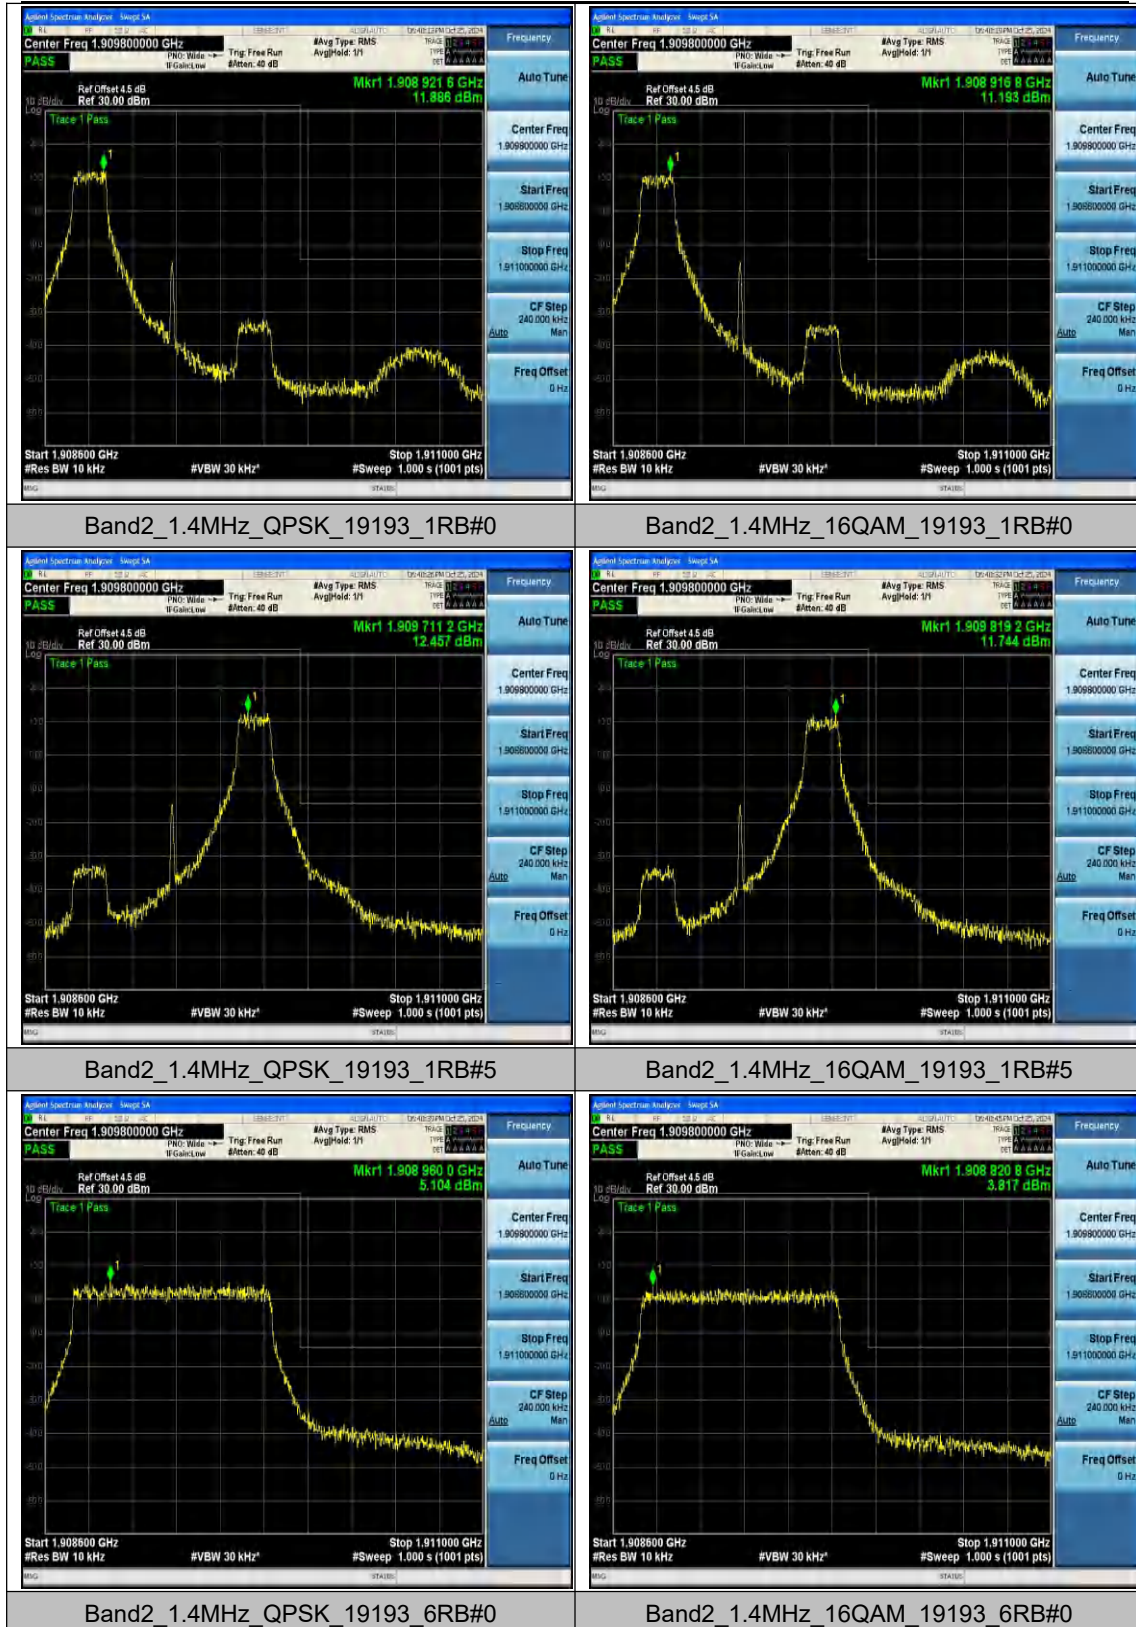


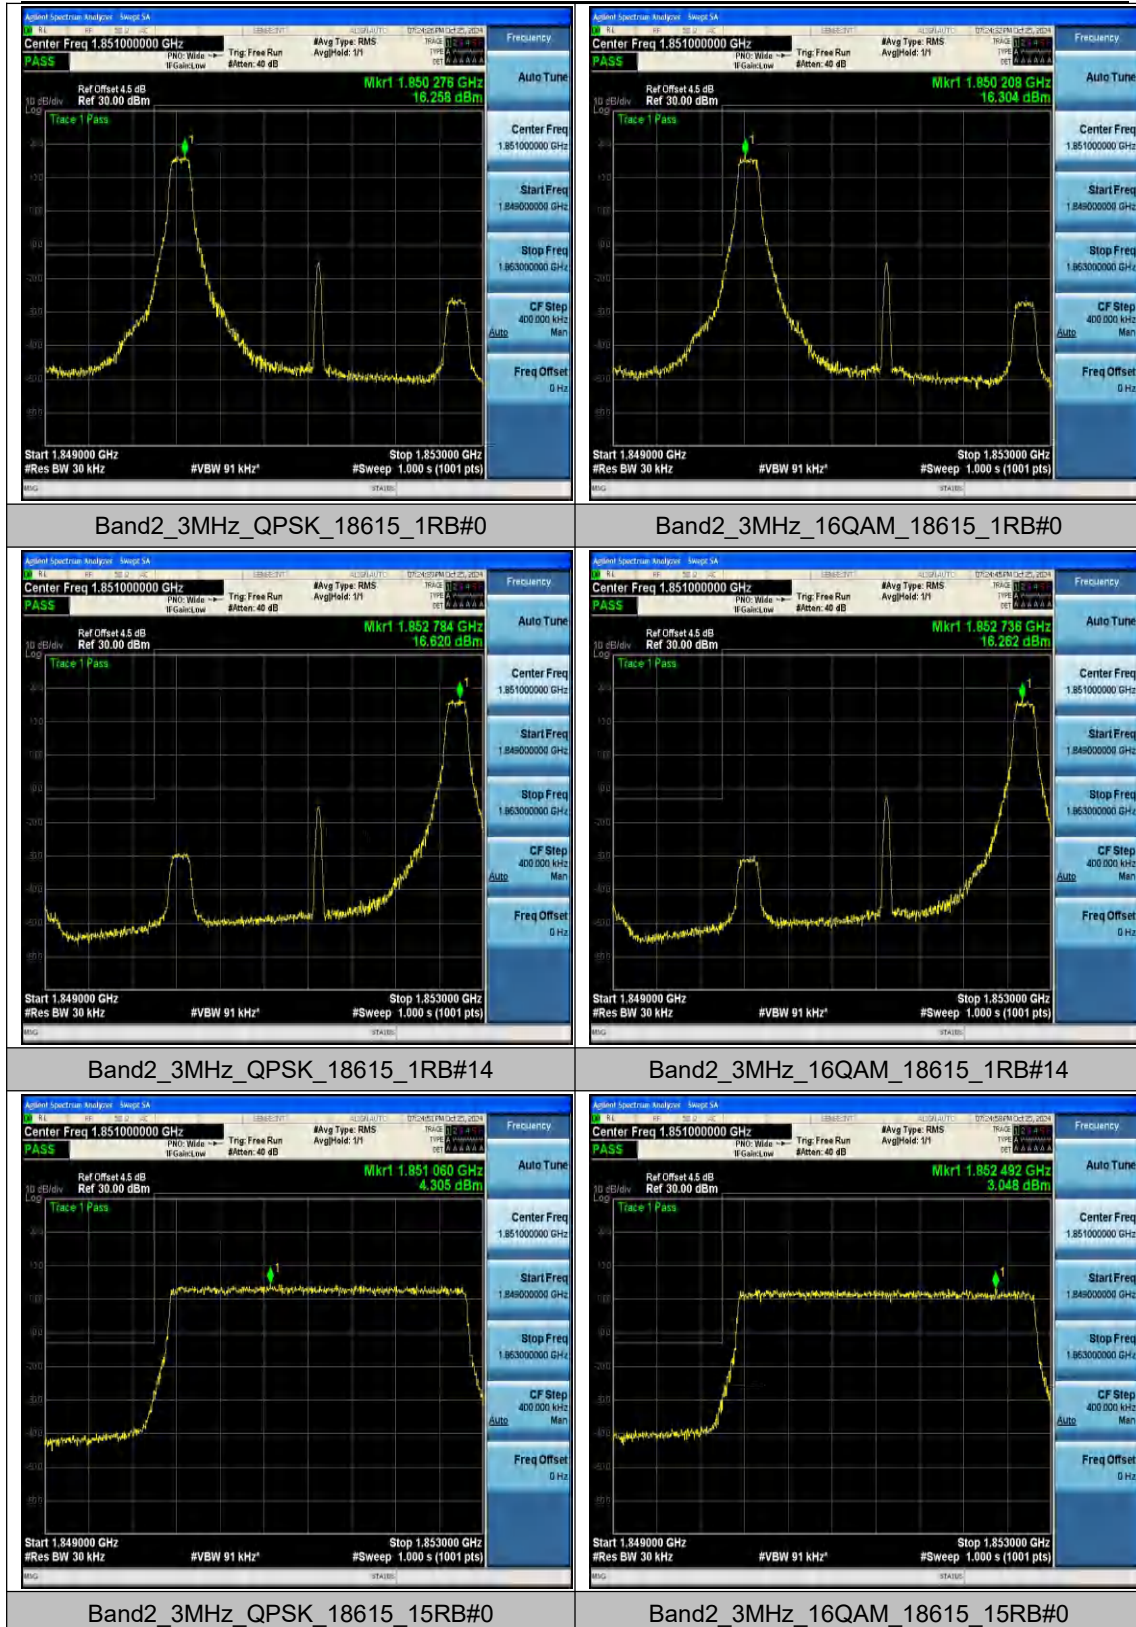


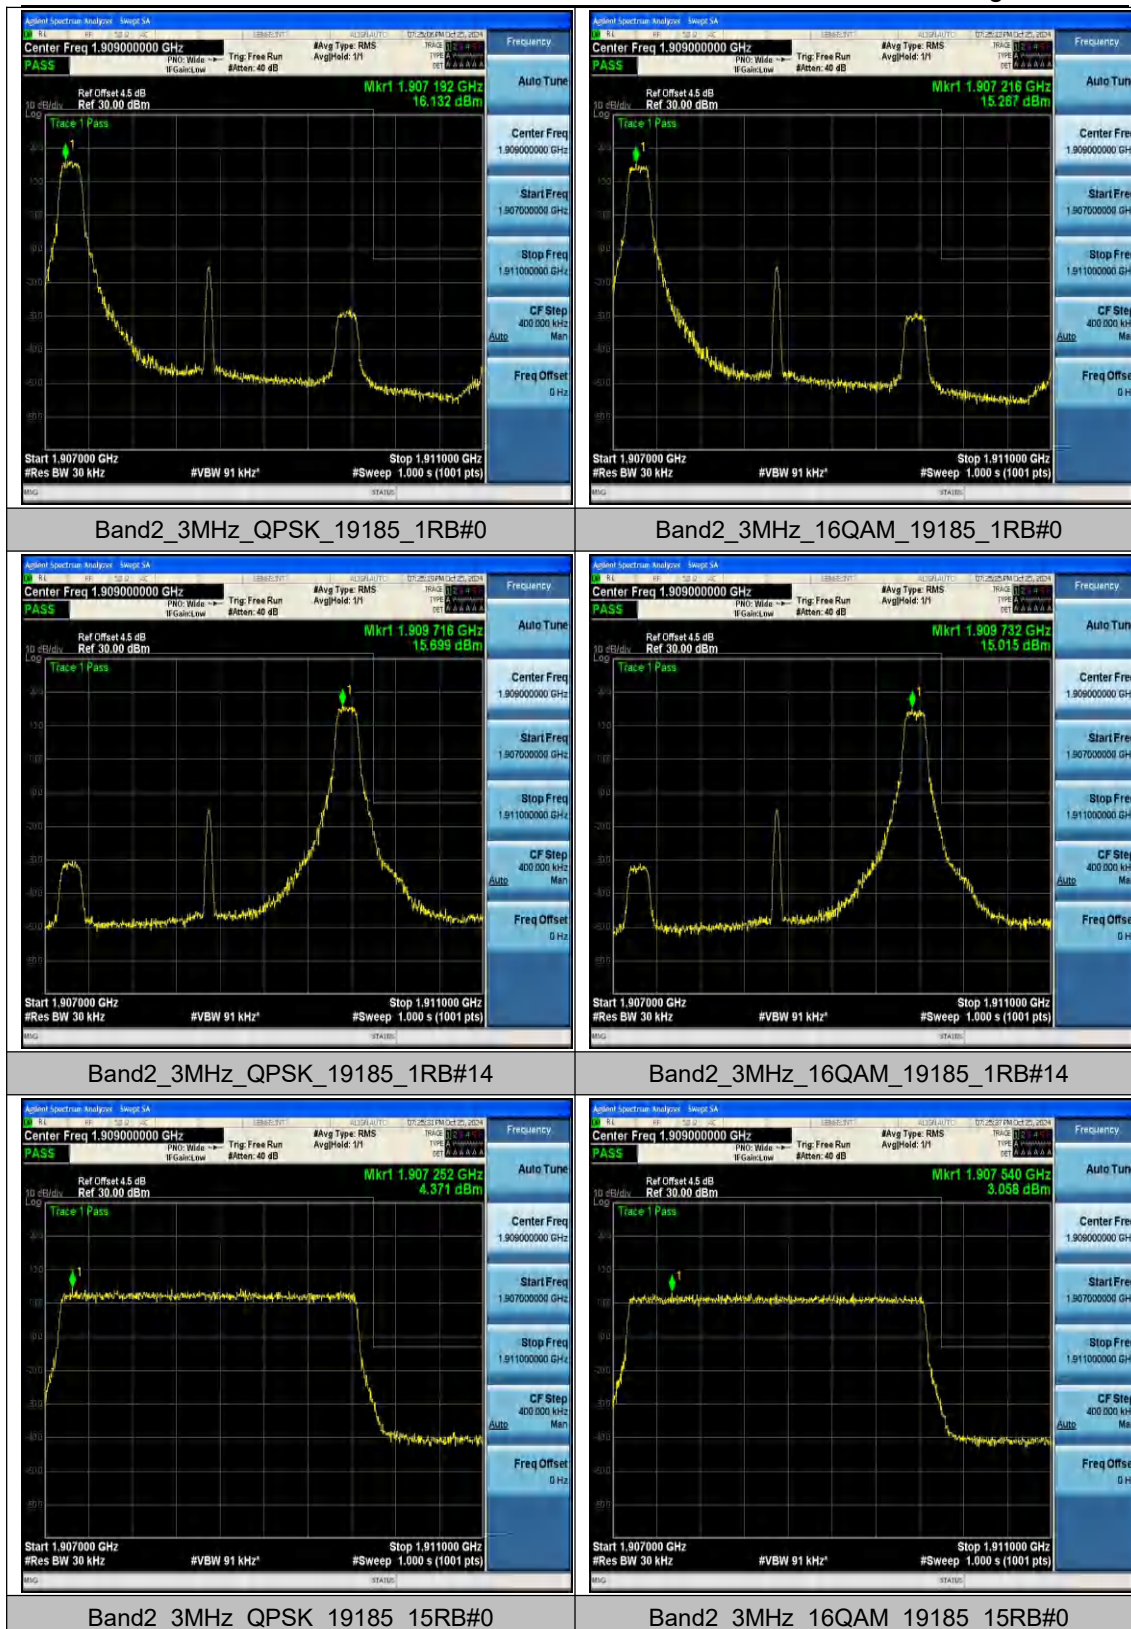


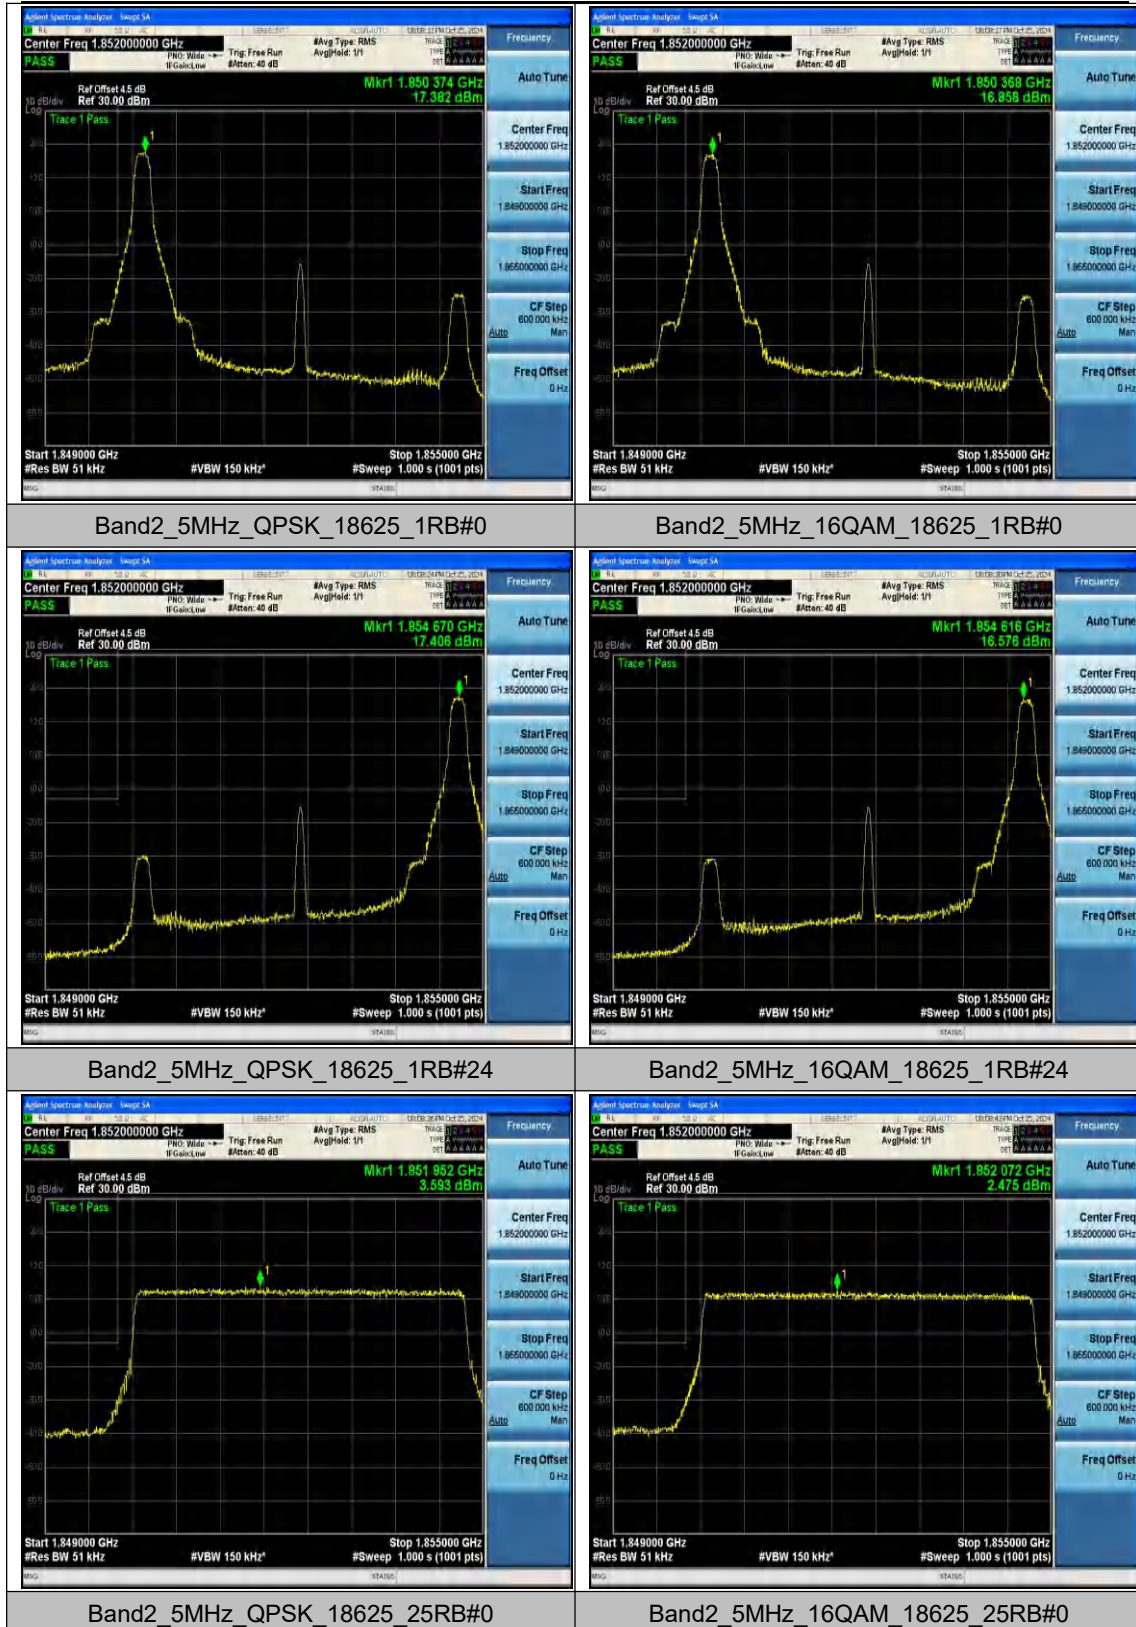


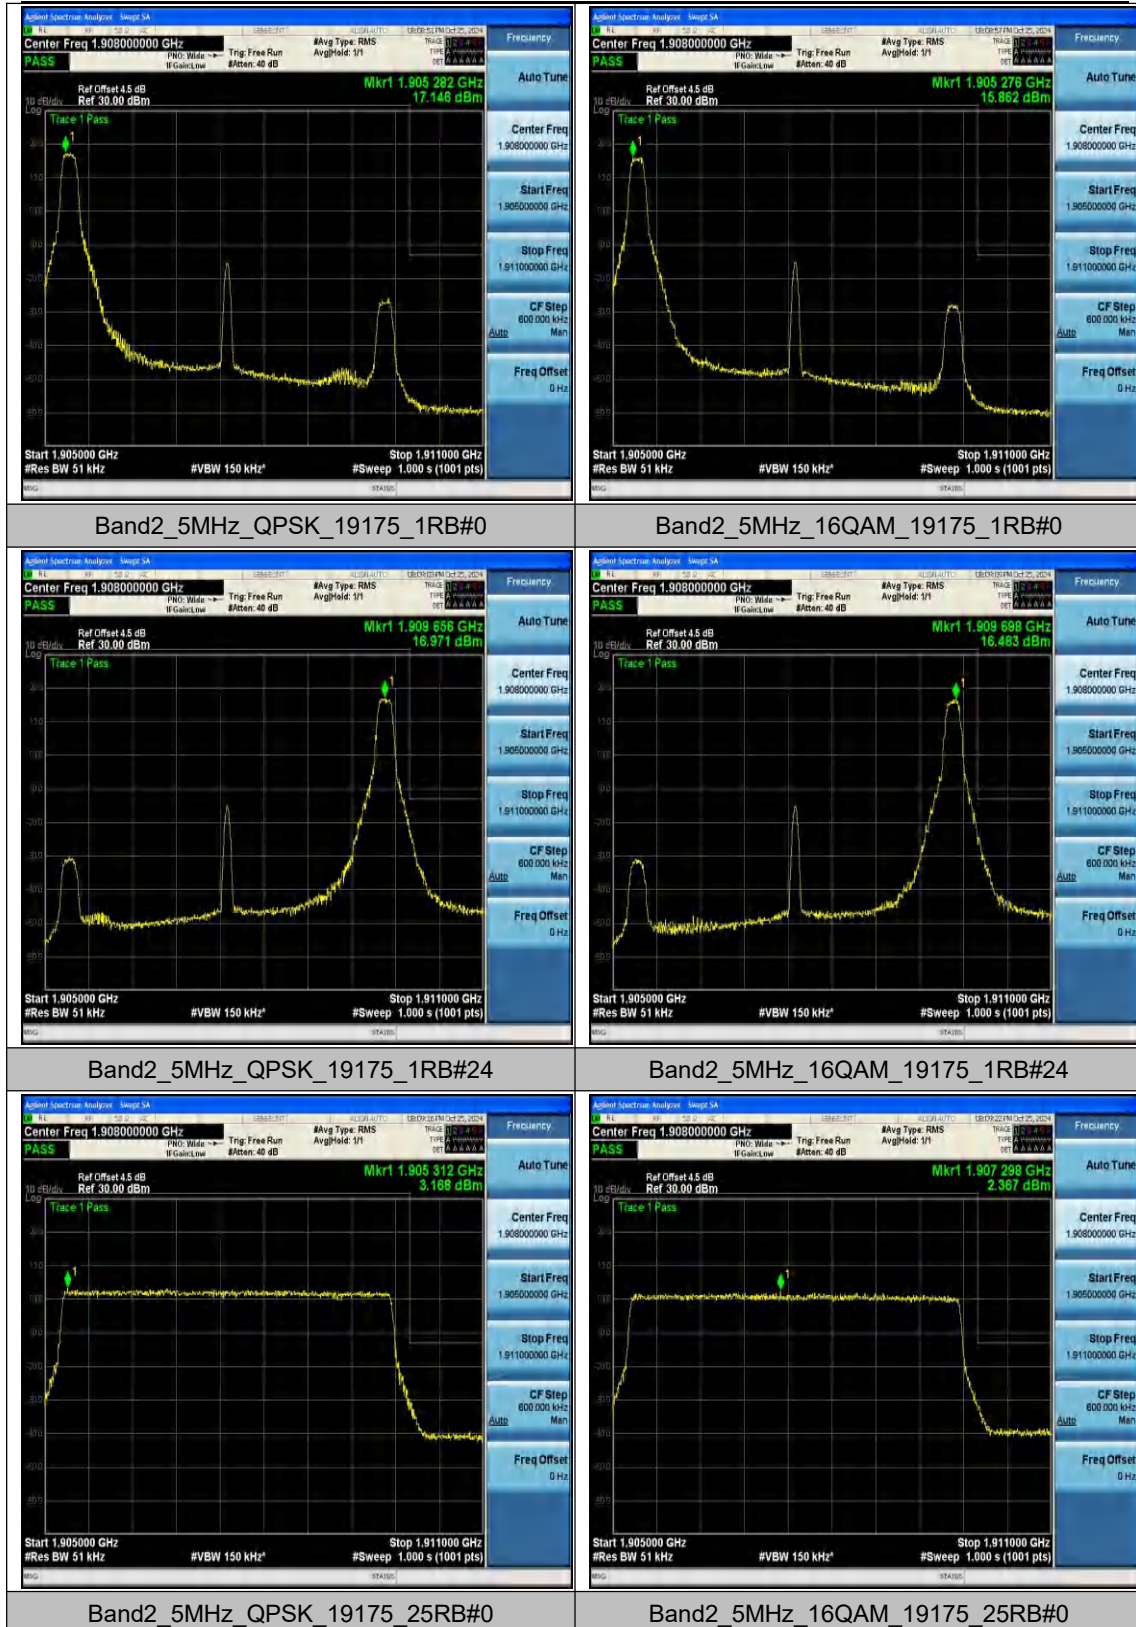


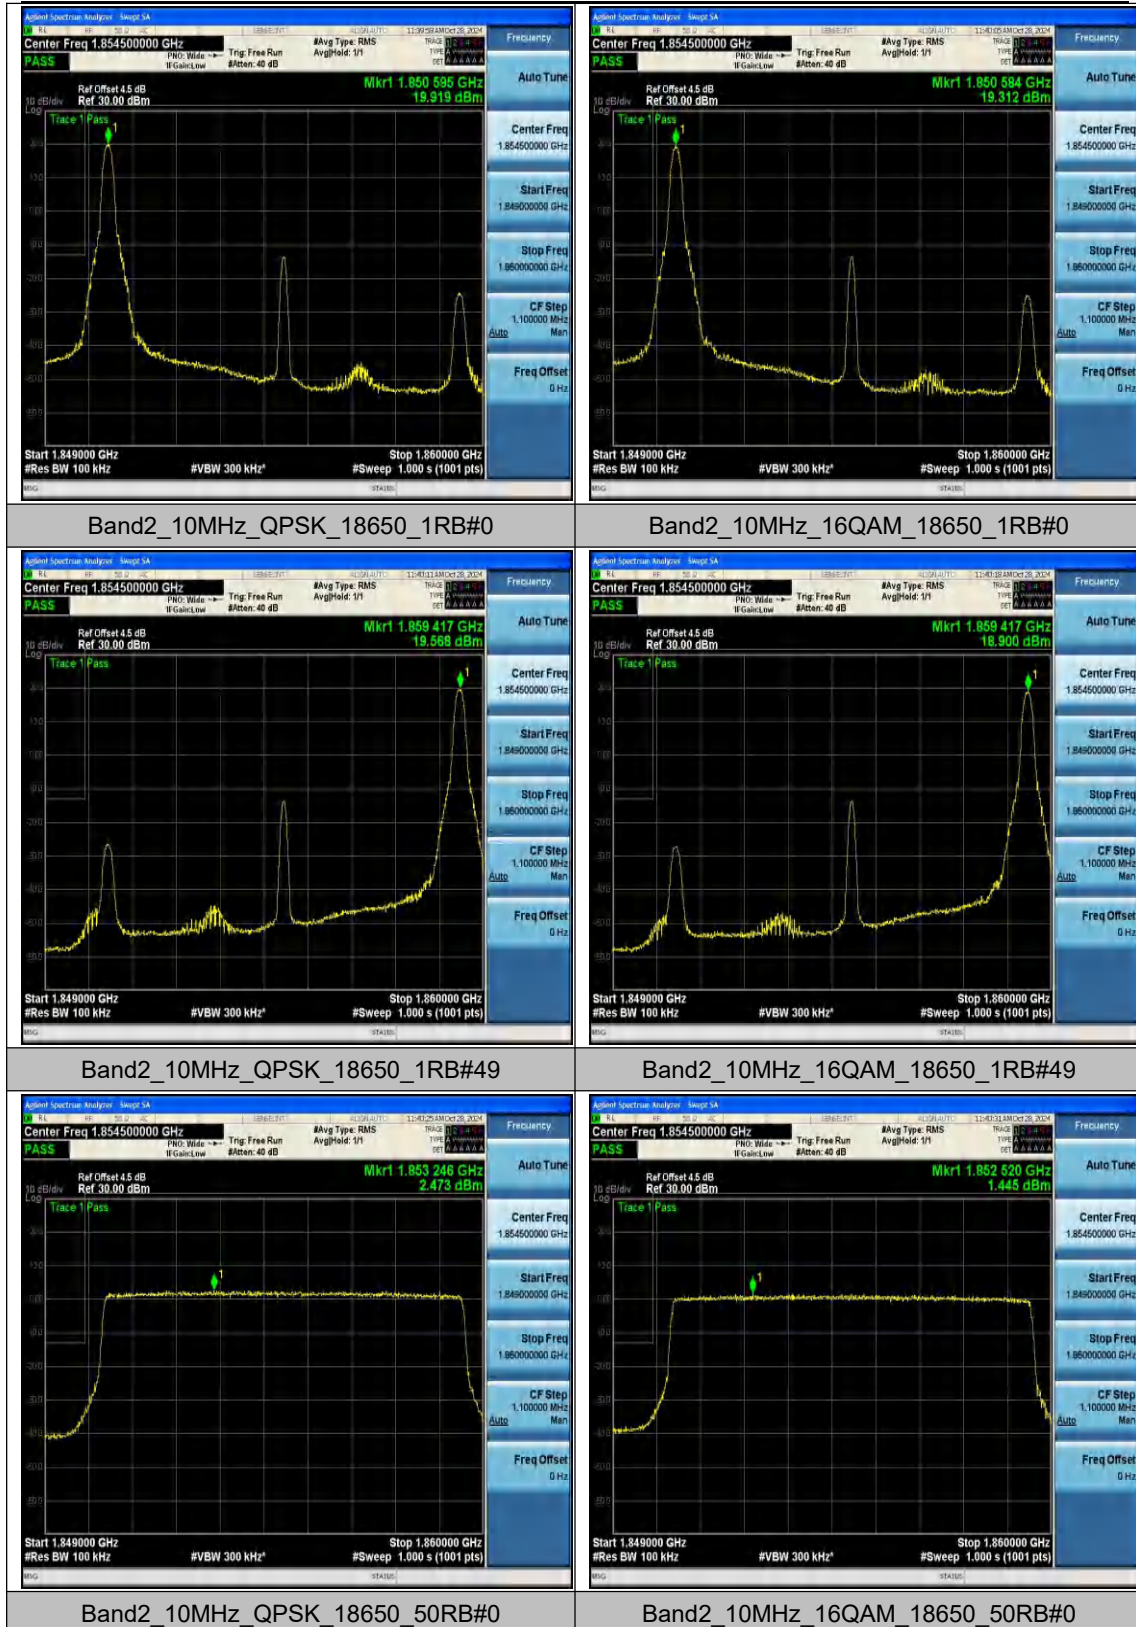


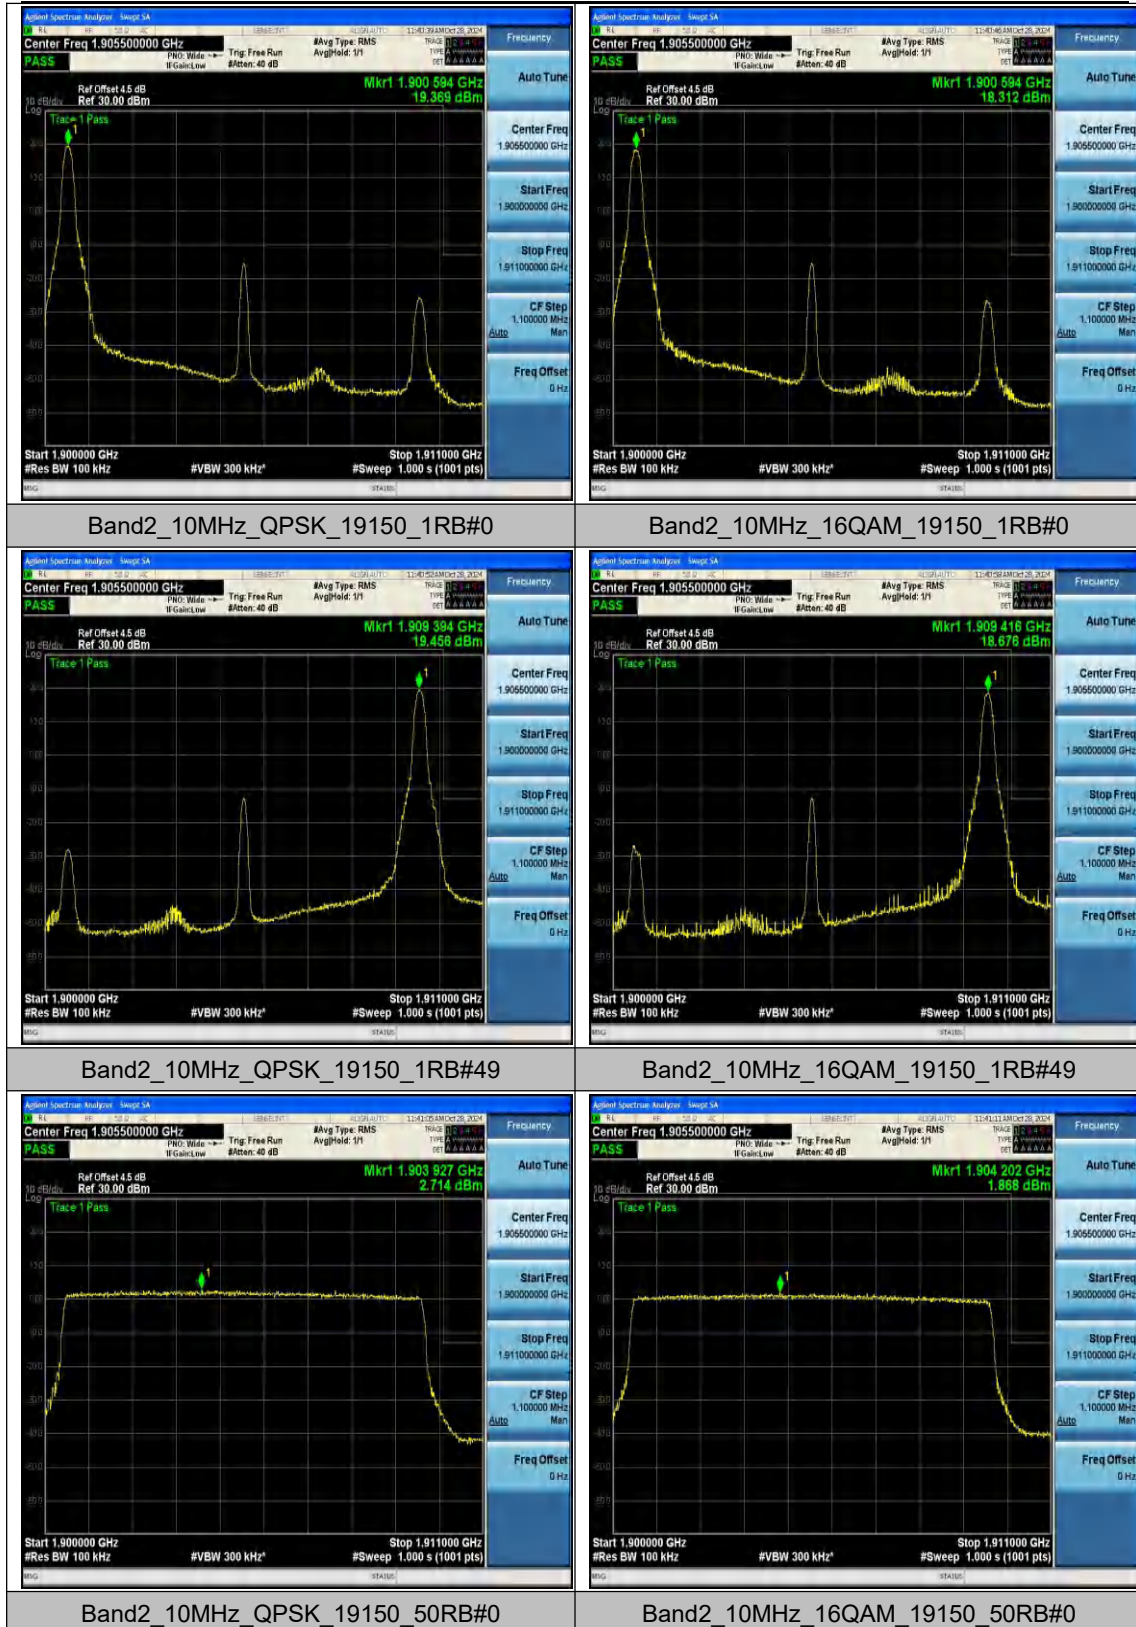

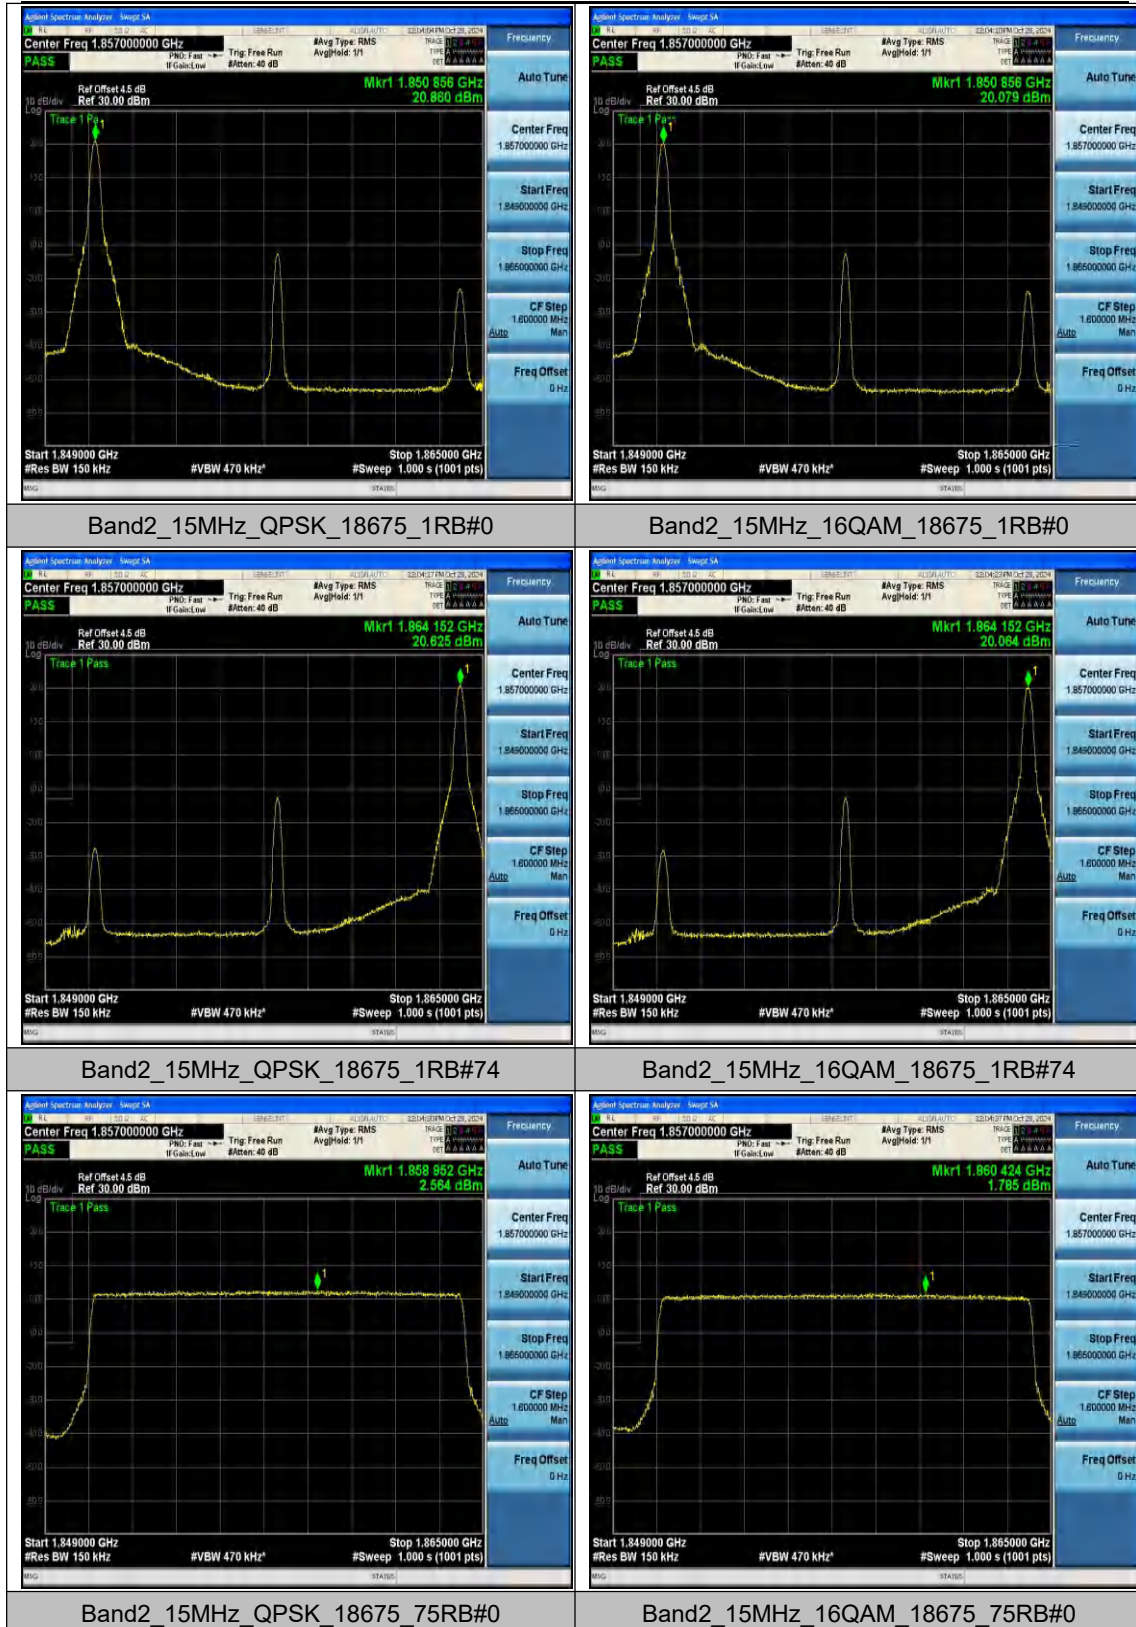

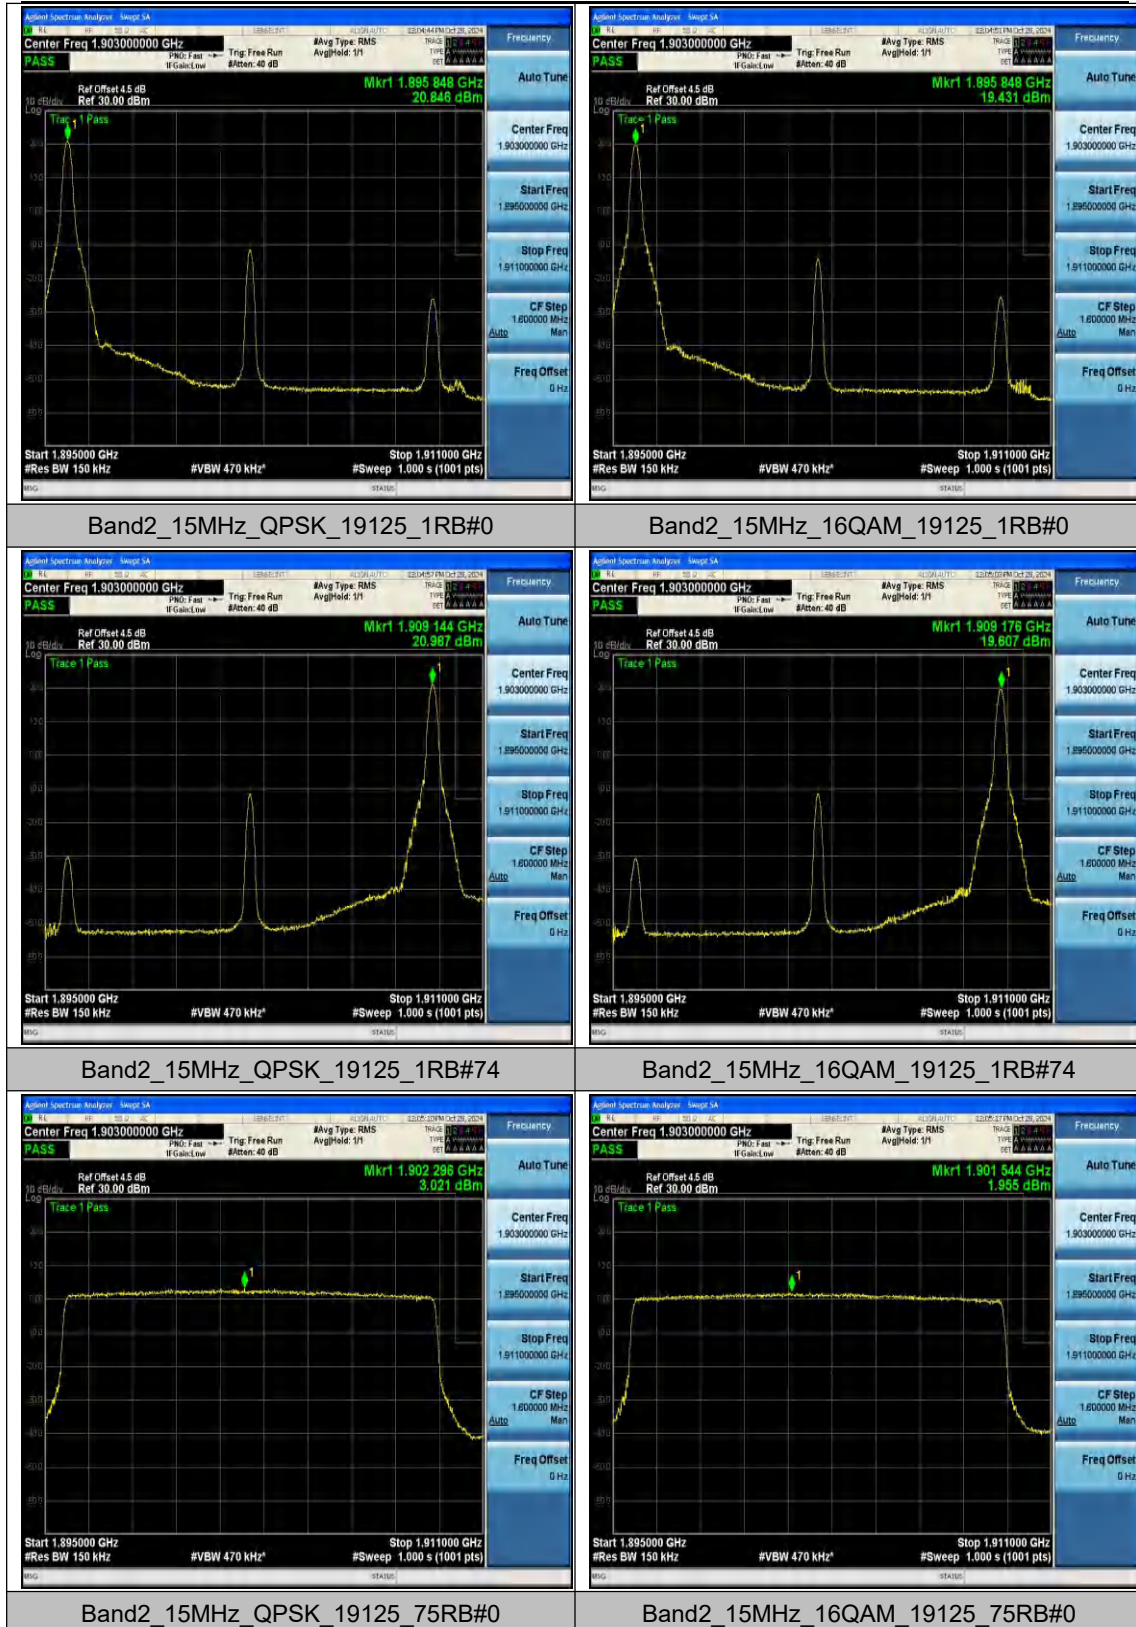

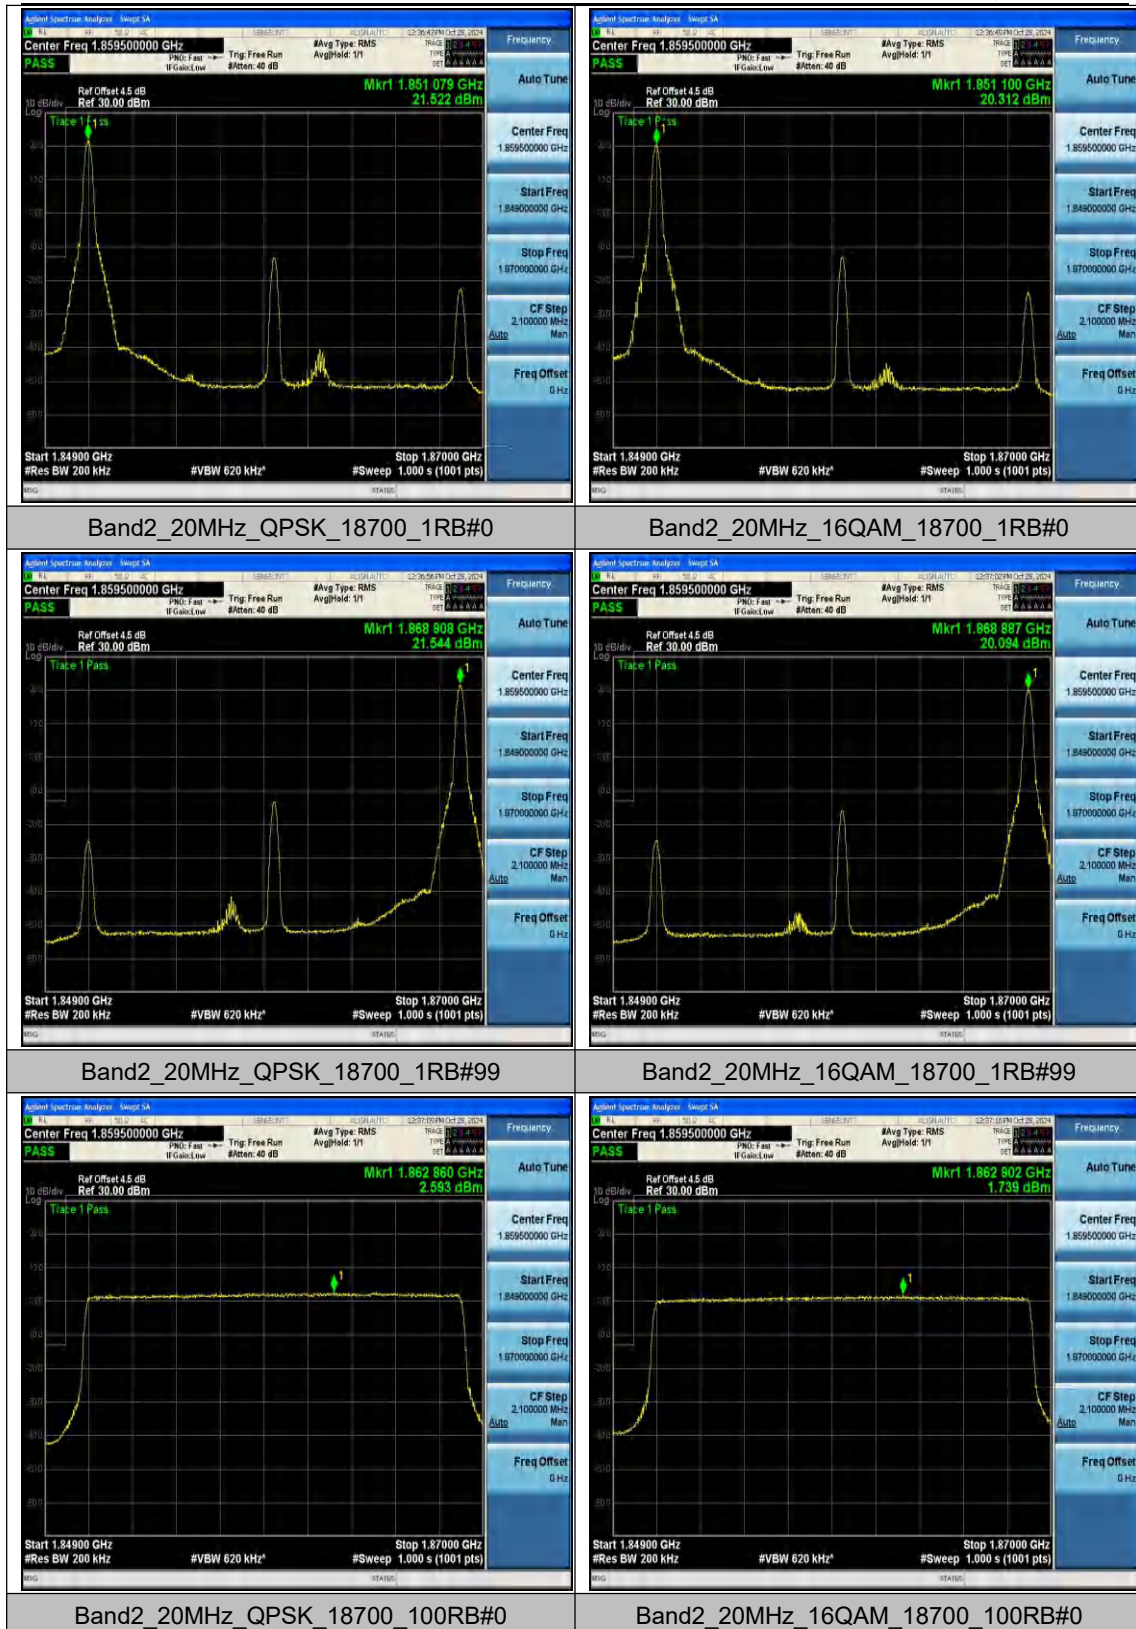

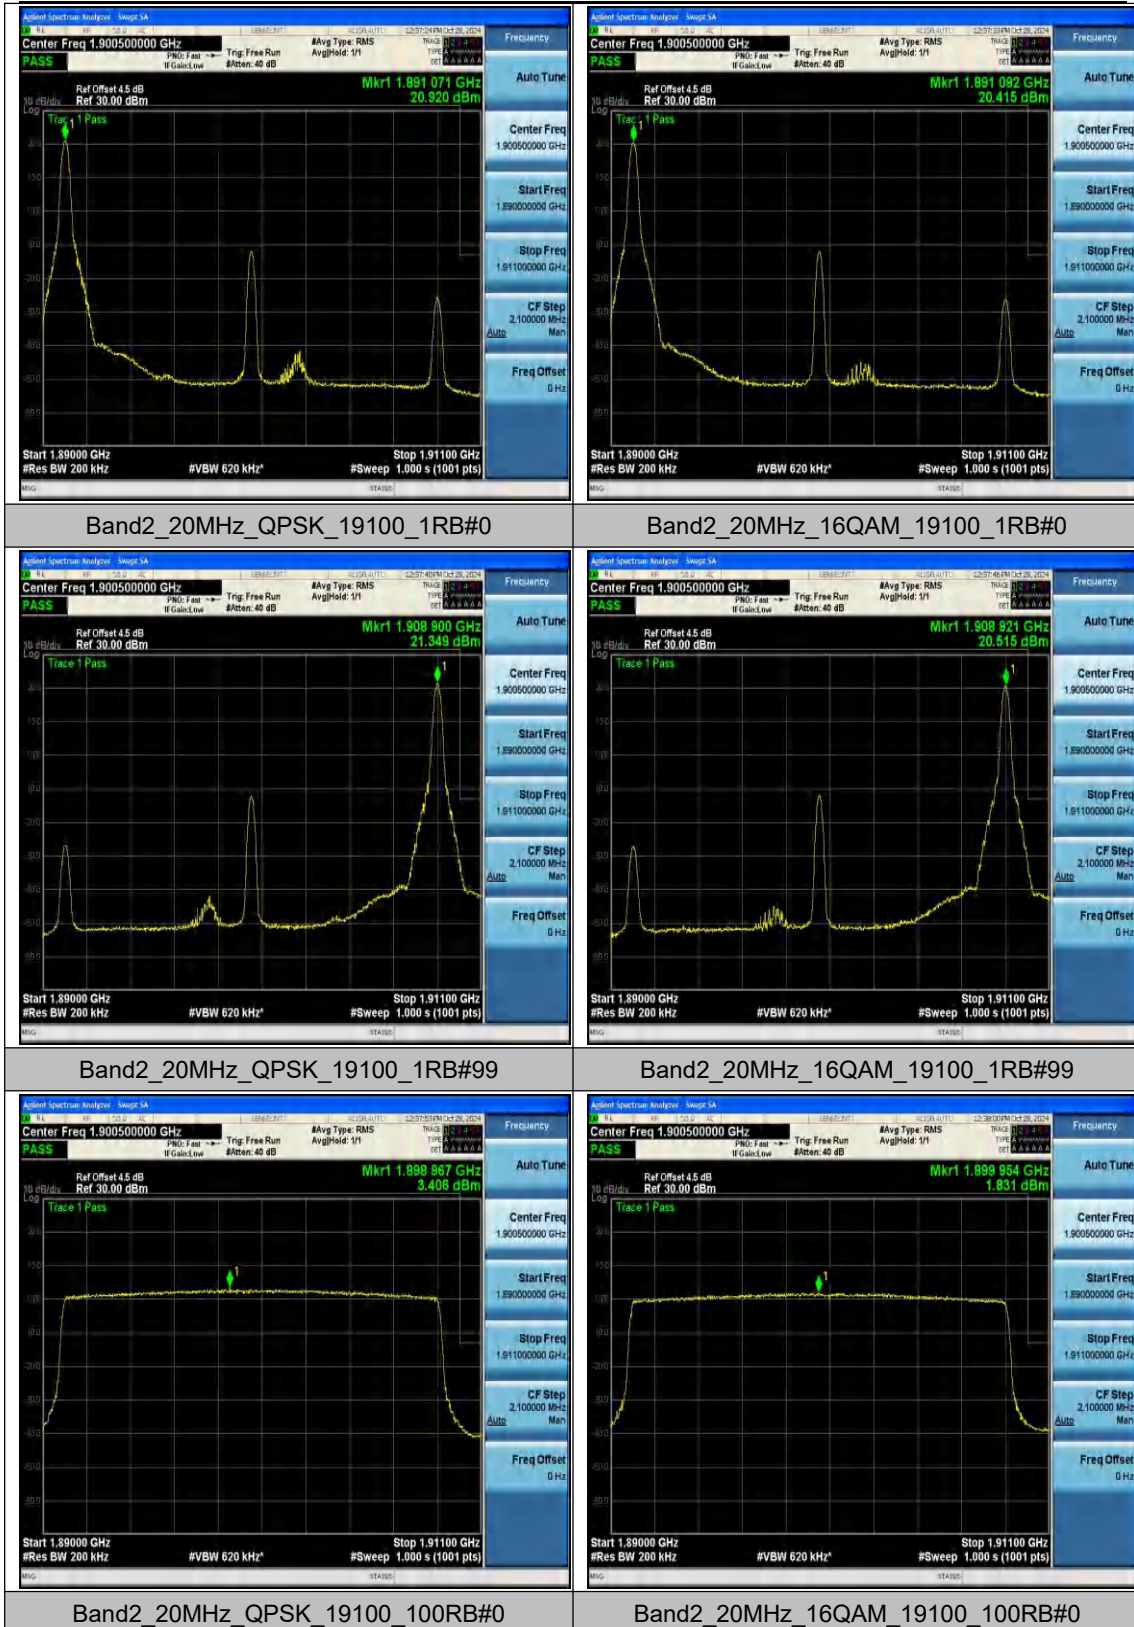

Appendix E: Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band2	1.4MHz	QPSK	18607	1RB#0	0.009~0.15	-57.49	PASS
Band2	1.4MHz	QPSK	18607	1RB#0	0.15~30	-55.90	PASS
Band2	1.4MHz	QPSK	18607	1RB#0	30~1000	-65.87	PASS
Band2	1.4MHz	QPSK	18607	1RB#0	1000~3000	-36.69	PASS
Band2	1.4MHz	QPSK	18607	1RB#0	3000~20000	-47.76	PASS
Band2	1.4MHz	16QAM	18607	1RB#0	0.009~0.15	-57.86	PASS
Band2	1.4MHz	16QAM	18607	1RB#0	0.15~30	-56.32	PASS
Band2	1.4MHz	16QAM	18607	1RB#0	30~1000	-66.21	PASS
Band2	1.4MHz	16QAM	18607	1RB#0	1000~3000	-35.72	PASS
Band2	1.4MHz	16QAM	18607	1RB#0	3000~20000	-47.50	PASS
Band2	1.4MHz	QPSK	18900	1RB#0	0.009~0.15	-56.96	PASS
Band2	1.4MHz	QPSK	18900	1RB#0	0.15~30	-55.56	PASS
Band2	1.4MHz	QPSK	18900	1RB#0	30~1000	-66.41	PASS
Band2	1.4MHz	QPSK	18900	1RB#0	1000~3000	-37.12	PASS
Band2	1.4MHz	QPSK	18900	1RB#0	3000~20000	-47.06	PASS
Band2	1.4MHz	16QAM	18900	1RB#0	0.009~0.15	-55.16	PASS
Band2	1.4MHz	16QAM	18900	1RB#0	0.15~30	-55.65	PASS
Band2	1.4MHz	16QAM	18900	1RB#0	30~1000	-65.98	PASS
Band2	1.4MHz	16QAM	18900	1RB#0	1000~3000	-37.53	PASS
Band2	1.4MHz	16QAM	18900	1RB#0	3000~20000	-47.51	PASS
Band2	1.4MHz	QPSK	19193	1RB#0	0.009~0.15	-56.88	PASS
Band2	1.4MHz	QPSK	19193	1RB#0	0.15~30	-56.70	PASS
Band2	1.4MHz	QPSK	19193	1RB#0	30~1000	-66.14	PASS
Band2	1.4MHz	QPSK	19193	1RB#0	1000~3000	-36.97	PASS
Band2	1.4MHz	QPSK	19193	1RB#0	3000~20000	-47.50	PASS
Band2	1.4MHz	16QAM	19193	1RB#0	0.009~0.15	-59.44	PASS
Band2	1.4MHz	16QAM	19193	1RB#0	0.15~30	-54.24	PASS
Band2	1.4MHz	16QAM	19193	1RB#0	30~1000	-66.15	PASS
Band2	1.4MHz	16QAM	19193	1RB#0	1000~3000	-35.64	PASS
Band2	1.4MHz	16QAM	19193	1RB#0	3000~20000	-47.48	PASS
Band2	3MHz	QPSK	18615	1RB#0	0.009~0.15	-58.60	PASS
Band2	3MHz	QPSK	18615	1RB#0	0.15~30	-54.73	PASS
Band2	3MHz	QPSK	18615	1RB#0	30~1000	-66.34	PASS
Band2	3MHz	QPSK	18615	1RB#0	1000~3000	-51.85	PASS
Band2	3MHz	QPSK	18615	1RB#0	3000~20000	-47.83	PASS
Band2	3MHz	16QAM	18615	1RB#0	0.009~0.15	-57.77	PASS
Band2	3MHz	16QAM	18615	1RB#0	0.15~30	-57.55	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com



Hotline
400-003-0500
www.anbotech.com



Band2	3MHz	16QAM	18615	1RB#0	30~1000	-66.33	PASS
Band2	3MHz	16QAM	18615	1RB#0	1000~3000	-52.22	PASS
Band2	3MHz	16QAM	18615	1RB#0	3000~20000	-47.49	PASS
Band2	3MHz	QPSK	18900	1RB#0	0.009~0.15	-57.07	PASS
Band2	3MHz	QPSK	18900	1RB#0	0.15~30	-55.60	PASS
Band2	3MHz	QPSK	18900	1RB#0	30~1000	-66.22	PASS
Band2	3MHz	QPSK	18900	1RB#0	1000~3000	-52.14	PASS
Band2	3MHz	QPSK	18900	1RB#0	3000~20000	-47.33	PASS
Band2	3MHz	16QAM	18900	1RB#0	0.009~0.15	-59.87	PASS
Band2	3MHz	16QAM	18900	1RB#0	0.15~30	-57.03	PASS
Band2	3MHz	16QAM	18900	1RB#0	30~1000	-66.08	PASS
Band2	3MHz	16QAM	18900	1RB#0	1000~3000	-45.80	PASS
Band2	3MHz	16QAM	18900	1RB#0	3000~20000	-47.25	PASS
Band2	3MHz	QPSK	19185	1RB#0	0.009~0.15	-57.53	PASS
Band2	3MHz	QPSK	19185	1RB#0	0.15~30	-55.63	PASS
Band2	3MHz	QPSK	19185	1RB#0	30~1000	-66.24	PASS
Band2	3MHz	QPSK	19185	1RB#0	1000~3000	-51.22	PASS
Band2	3MHz	QPSK	19185	1RB#0	3000~20000	-47.55	PASS
Band2	3MHz	16QAM	19185	1RB#0	0.009~0.15	-58.67	PASS
Band2	3MHz	16QAM	19185	1RB#0	0.15~30	-57.31	PASS
Band2	3MHz	16QAM	19185	1RB#0	30~1000	-66.28	PASS
Band2	3MHz	16QAM	19185	1RB#0	1000~3000	-52.41	PASS
Band2	3MHz	16QAM	19185	1RB#0	3000~20000	-47.52	PASS
Band2	5MHz	QPSK	18625	1RB#0	0.009~0.15	-55.83	PASS
Band2	5MHz	QPSK	18625	1RB#0	0.15~30	-55.10	PASS
Band2	5MHz	QPSK	18625	1RB#0	30~1000	-66.41	PASS
Band2	5MHz	QPSK	18625	1RB#0	1000~3000	-46.09	PASS
Band2	5MHz	QPSK	18625	1RB#0	3000~20000	-47.63	PASS
Band2	5MHz	16QAM	18625	1RB#0	0.009~0.15	-57.17	PASS
Band2	5MHz	16QAM	18625	1RB#0	0.15~30	-56.83	PASS
Band2	5MHz	16QAM	18625	1RB#0	30~1000	-66.49	PASS
Band2	5MHz	16QAM	18625	1RB#0	1000~3000	-50.68	PASS
Band2	5MHz	16QAM	18625	1RB#0	3000~20000	-47.23	PASS
Band2	5MHz	QPSK	18900	1RB#0	0.009~0.15	-57.63	PASS
Band2	5MHz	QPSK	18900	1RB#0	0.15~30	-55.87	PASS
Band2	5MHz	QPSK	18900	1RB#0	30~1000	-66.06	PASS
Band2	5MHz	QPSK	18900	1RB#0	1000~3000	-52.57	PASS
Band2	5MHz	QPSK	18900	1RB#0	3000~20000	-47.24	PASS
Band2	5MHz	16QAM	18900	1RB#0	0.009~0.15	-59.50	PASS
Band2	5MHz	16QAM	18900	1RB#0	0.15~30	-55.47	PASS
Band2	5MHz	16QAM	18900	1RB#0	30~1000	-66.24	PASS
Band2	5MHz	16QAM	18900	1RB#0	1000~3000	-39.61	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com



Band2	5MHz	16QAM	18900	1RB#0	3000~20000	-47.41	PASS
Band2	5MHz	QPSK	19175	1RB#0	0.009~0.15	-56.43	PASS
Band2	5MHz	QPSK	19175	1RB#0	0.15~30	-56.79	PASS
Band2	5MHz	QPSK	19175	1RB#0	30~1000	-66.01	PASS
Band2	5MHz	QPSK	19175	1RB#0	1000~3000	-52.43	PASS
Band2	5MHz	QPSK	19175	1RB#0	3000~20000	-47.73	PASS
Band2	5MHz	16QAM	19175	1RB#0	0.009~0.15	-56.72	PASS
Band2	5MHz	16QAM	19175	1RB#0	0.15~30	-57.61	PASS
Band2	5MHz	16QAM	19175	1RB#0	30~1000	-66.48	PASS
Band2	5MHz	16QAM	19175	1RB#0	1000~3000	-52.46	PASS
Band2	5MHz	16QAM	19175	1RB#0	3000~20000	-47.72	PASS
Band2	10MHz	QPSK	18650	1RB#0	0.009~0.15	-56.73	PASS
Band2	10MHz	QPSK	18650	1RB#0	0.15~30	-54.58	PASS
Band2	10MHz	QPSK	18650	1RB#0	30~1000	-65.90	PASS
Band2	10MHz	QPSK	18650	1RB#0	1000~3000	-52.49	PASS
Band2	10MHz	QPSK	18650	1RB#0	3000~20000	-47.62	PASS
Band2	10MHz	16QAM	18650	1RB#0	0.009~0.15	-60.04	PASS
Band2	10MHz	16QAM	18650	1RB#0	0.15~30	-57.81	PASS
Band2	10MHz	16QAM	18650	1RB#0	30~1000	-65.92	PASS
Band2	10MHz	16QAM	18650	1RB#0	1000~3000	-52.12	PASS
Band2	10MHz	16QAM	18650	1RB#0	3000~20000	-47.83	PASS
Band2	10MHz	QPSK	18900	1RB#0	0.009~0.15	-55.66	PASS
Band2	10MHz	QPSK	18900	1RB#0	0.15~30	-55.28	PASS
Band2	10MHz	QPSK	18900	1RB#0	30~1000	-66.21	PASS
Band2	10MHz	QPSK	18900	1RB#0	1000~3000	-52.24	PASS
Band2	10MHz	QPSK	18900	1RB#0	3000~20000	-47.65	PASS
Band2	10MHz	16QAM	18900	1RB#0	0.009~0.15	-57.28	PASS
Band2	10MHz	16QAM	18900	1RB#0	0.15~30	-57.42	PASS
Band2	10MHz	16QAM	18900	1RB#0	30~1000	-65.77	PASS
Band2	10MHz	16QAM	18900	1RB#0	1000~3000	-52.56	PASS
Band2	10MHz	16QAM	18900	1RB#0	3000~20000	-47.81	PASS
Band2	10MHz	QPSK	19150	1RB#0	0.009~0.15	-57.13	PASS
Band2	10MHz	QPSK	19150	1RB#0	0.15~30	-57.65	PASS
Band2	10MHz	QPSK	19150	1RB#0	30~1000	-66.17	PASS
Band2	10MHz	QPSK	19150	1RB#0	1000~3000	-52.26	PASS
Band2	10MHz	QPSK	19150	1RB#0	3000~20000	-47.29	PASS
Band2	10MHz	16QAM	19150	1RB#0	0.009~0.15	-56.66	PASS
Band2	10MHz	16QAM	19150	1RB#0	0.15~30	-56.54	PASS
Band2	10MHz	16QAM	19150	1RB#0	30~1000	-66.39	PASS
Band2	10MHz	16QAM	19150	1RB#0	1000~3000	-52.54	PASS
Band2	10MHz	16QAM	19150	1RB#0	3000~20000	-47.54	PASS
Band2	15MHz	QPSK	18675	1RB#0	0.009~0.15	-56.78	PASS



Band2	15MHz	QPSK	18675	1RB#0	0.15~30	-54.49	PASS
Band2	15MHz	QPSK	18675	1RB#0	30~1000	-66.15	PASS
Band2	15MHz	QPSK	18675	1RB#0	1000~3000	-50.86	PASS
Band2	15MHz	QPSK	18675	1RB#0	3000~20000	-47.73	PASS
Band2	15MHz	16QAM	18675	1RB#0	0.009~0.15	-56.20	PASS
Band2	15MHz	16QAM	18675	1RB#0	0.15~30	-56.84	PASS
Band2	15MHz	16QAM	18675	1RB#0	30~1000	-66.52	PASS
Band2	15MHz	16QAM	18675	1RB#0	1000~3000	-52.31	PASS
Band2	15MHz	16QAM	18675	1RB#0	3000~20000	-47.57	PASS
Band2	15MHz	QPSK	18900	1RB#0	0.009~0.15	-57.16	PASS
Band2	15MHz	QPSK	18900	1RB#0	0.15~30	-56.23	PASS
Band2	15MHz	QPSK	18900	1RB#0	30~1000	-65.78	PASS
Band2	15MHz	QPSK	18900	1RB#0	1000~3000	-52.48	PASS
Band2	15MHz	QPSK	18900	1RB#0	3000~20000	-47.90	PASS
Band2	15MHz	16QAM	18900	1RB#0	0.009~0.15	-56.38	PASS
Band2	15MHz	16QAM	18900	1RB#0	0.15~30	-54.90	PASS
Band2	15MHz	16QAM	18900	1RB#0	30~1000	-66.07	PASS
Band2	15MHz	16QAM	18900	1RB#0	1000~3000	-50.14	PASS
Band2	15MHz	16QAM	18900	1RB#0	3000~20000	-47.62	PASS
Band2	15MHz	QPSK	19125	1RB#0	0.009~0.15	-60.55	PASS
Band2	15MHz	QPSK	19125	1RB#0	0.15~30	-56.60	PASS
Band2	15MHz	QPSK	19125	1RB#0	30~1000	-66.32	PASS
Band2	15MHz	QPSK	19125	1RB#0	1000~3000	-52.44	PASS
Band2	15MHz	QPSK	19125	1RB#0	3000~20000	-47.72	PASS
Band2	15MHz	16QAM	19125	1RB#0	0.009~0.15	-58.13	PASS
Band2	15MHz	16QAM	19125	1RB#0	0.15~30	-56.47	PASS
Band2	15MHz	16QAM	19125	1RB#0	30~1000	-66.07	PASS
Band2	15MHz	16QAM	19125	1RB#0	1000~3000	-52.52	PASS
Band2	15MHz	16QAM	19125	1RB#0	3000~20000	-47.49	PASS
Band2	20MHz	QPSK	18700	1RB#0	0.009~0.15	-55.57	PASS
Band2	20MHz	QPSK	18700	1RB#0	0.15~30	-56.31	PASS
Band2	20MHz	QPSK	18700	1RB#0	30~1000	-66.19	PASS
Band2	20MHz	QPSK	18700	1RB#0	1000~3000	-52.25	PASS
Band2	20MHz	QPSK	18700	1RB#0	3000~20000	-47.31	PASS
Band2	20MHz	16QAM	18700	1RB#0	0.009~0.15	-54.60	PASS
Band2	20MHz	16QAM	18700	1RB#0	0.15~30	-55.79	PASS
Band2	20MHz	16QAM	18700	1RB#0	30~1000	-66.39	PASS
Band2	20MHz	16QAM	18700	1RB#0	1000~3000	-52.01	PASS
Band2	20MHz	16QAM	18700	1RB#0	3000~20000	-47.63	PASS
Band2	20MHz	QPSK	18900	1RB#0	0.009~0.15	-54.50	PASS
Band2	20MHz	QPSK	18900	1RB#0	0.15~30	-58.28	PASS
Band2	20MHz	QPSK	18900	1RB#0	30~1000	-66.21	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China

Tel: (86) 0755-26066440 Email: service@anbotek.com




Hotline
400-003-0500


www.anbotek.com





Band2	20MHz	QPSK	18900	1RB#0	1000~3000	-52.33	PASS
Band2	20MHz	QPSK	18900	1RB#0	3000~20000	-47.31	PASS
Band2	20MHz	16QAM	18900	1RB#0	0.009~0.15	-55.69	PASS
Band2	20MHz	16QAM	18900	1RB#0	0.15~30	-54.90	PASS
Band2	20MHz	16QAM	18900	1RB#0	30~1000	-66.05	PASS
Band2	20MHz	16QAM	18900	1RB#0	1000~3000	-52.50	PASS
Band2	20MHz	16QAM	18900	1RB#0	3000~20000	-47.50	PASS
Band2	20MHz	QPSK	19100	1RB#0	0.009~0.15	-57.48	PASS
Band2	20MHz	QPSK	19100	1RB#0	0.15~30	-55.18	PASS
Band2	20MHz	QPSK	19100	1RB#0	30~1000	-66.18	PASS
Band2	20MHz	QPSK	19100	1RB#0	1000~3000	-52.03	PASS
Band2	20MHz	QPSK	19100	1RB#0	3000~20000	-47.19	PASS
Band2	20MHz	16QAM	19100	1RB#0	0.009~0.15	-57.01	PASS
Band2	20MHz	16QAM	19100	1RB#0	0.15~30	-54.59	PASS
Band2	20MHz	16QAM	19100	1RB#0	30~1000	-66.18	PASS
Band2	20MHz	16QAM	19100	1RB#0	1000~3000	-52.07	PASS
Band2	20MHz	16QAM	19100	1RB#0	3000~20000	-47.39	PASS


Test Graphs

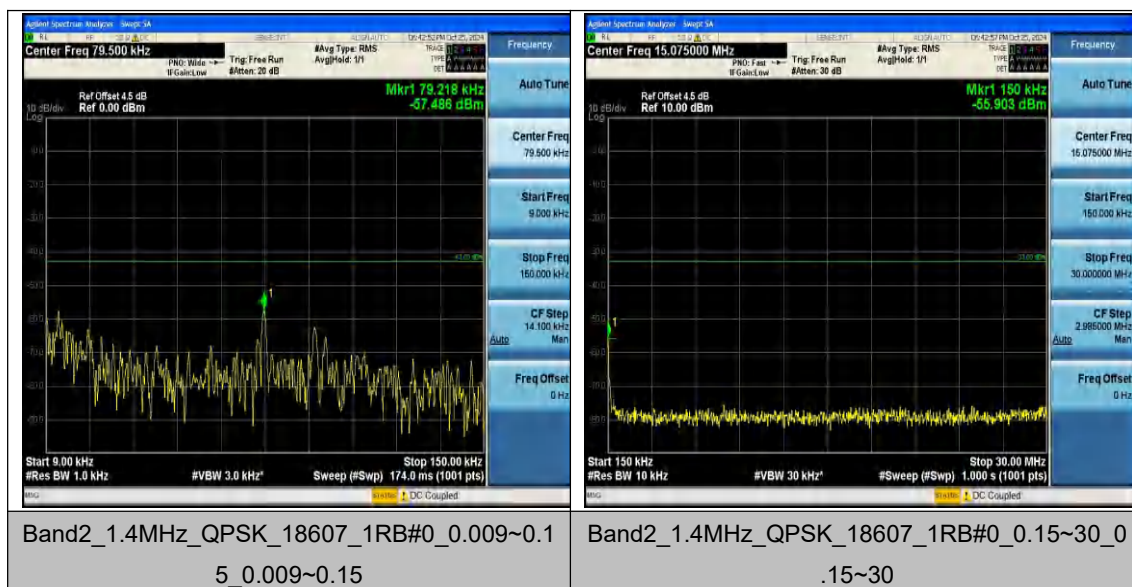


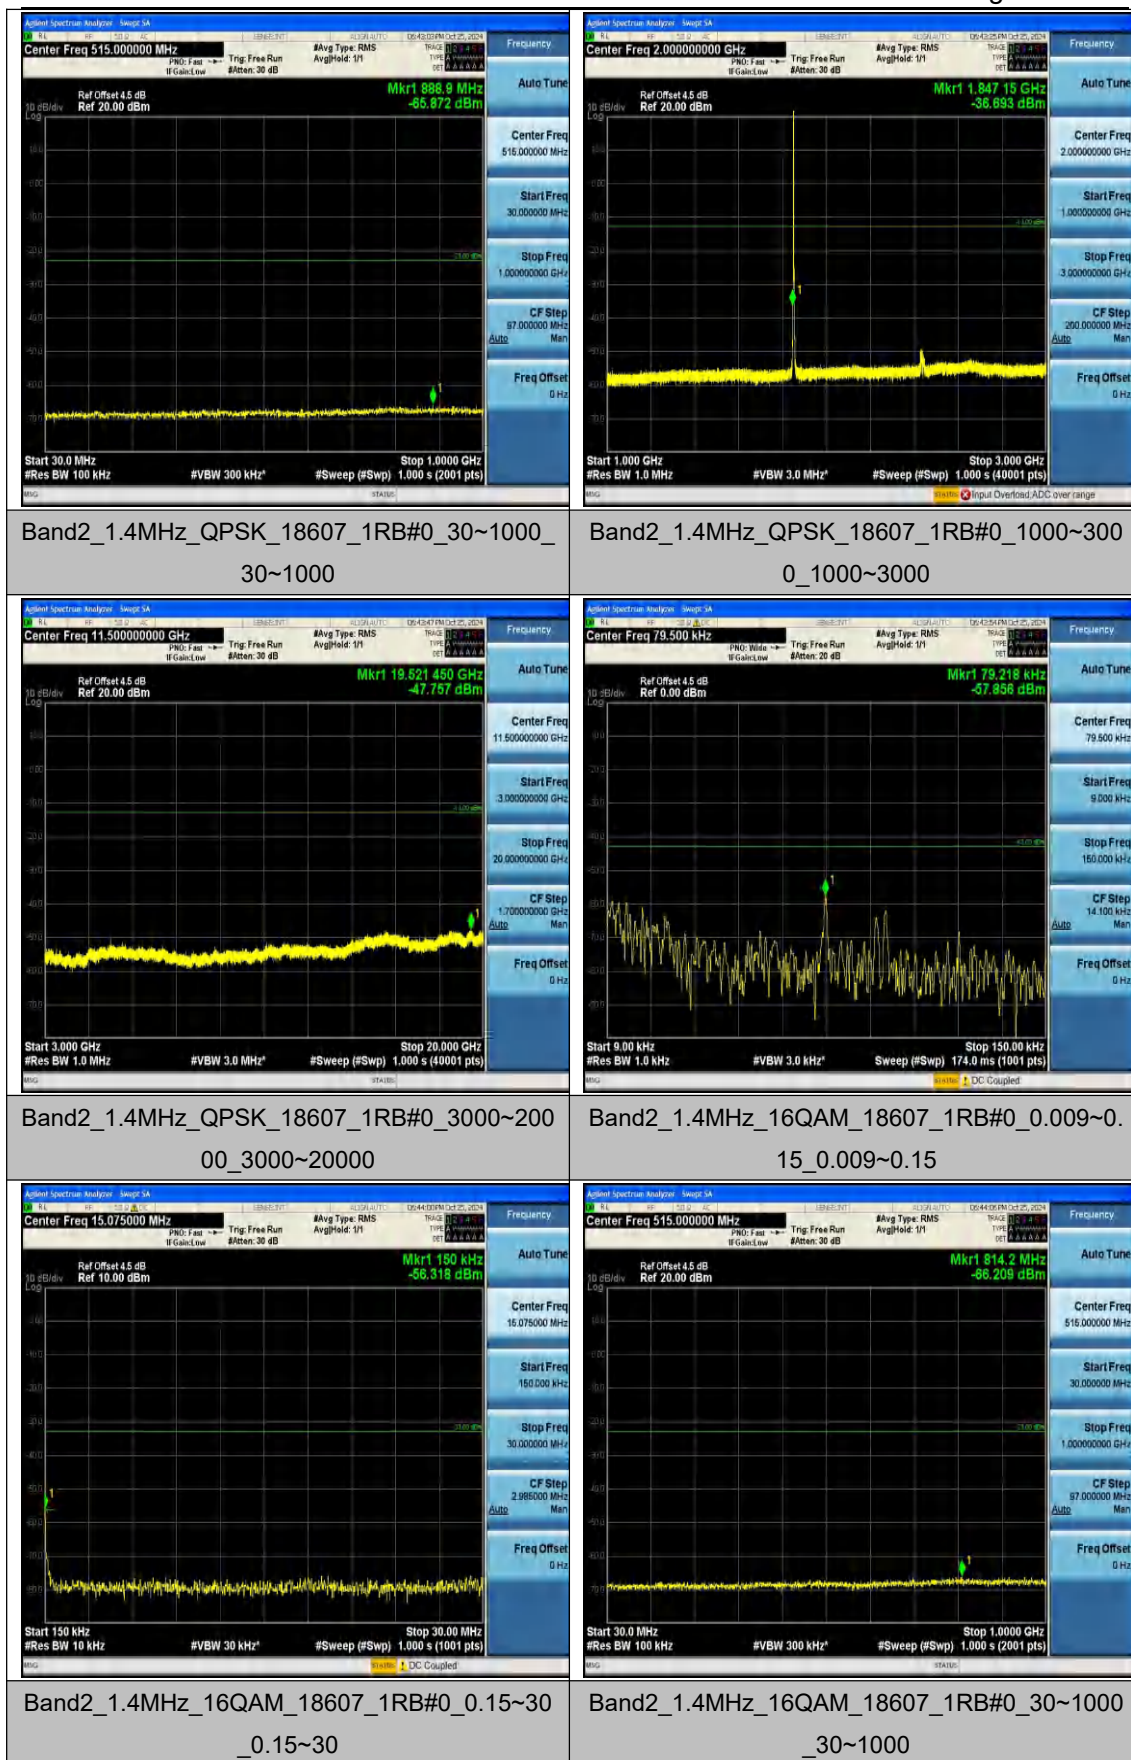


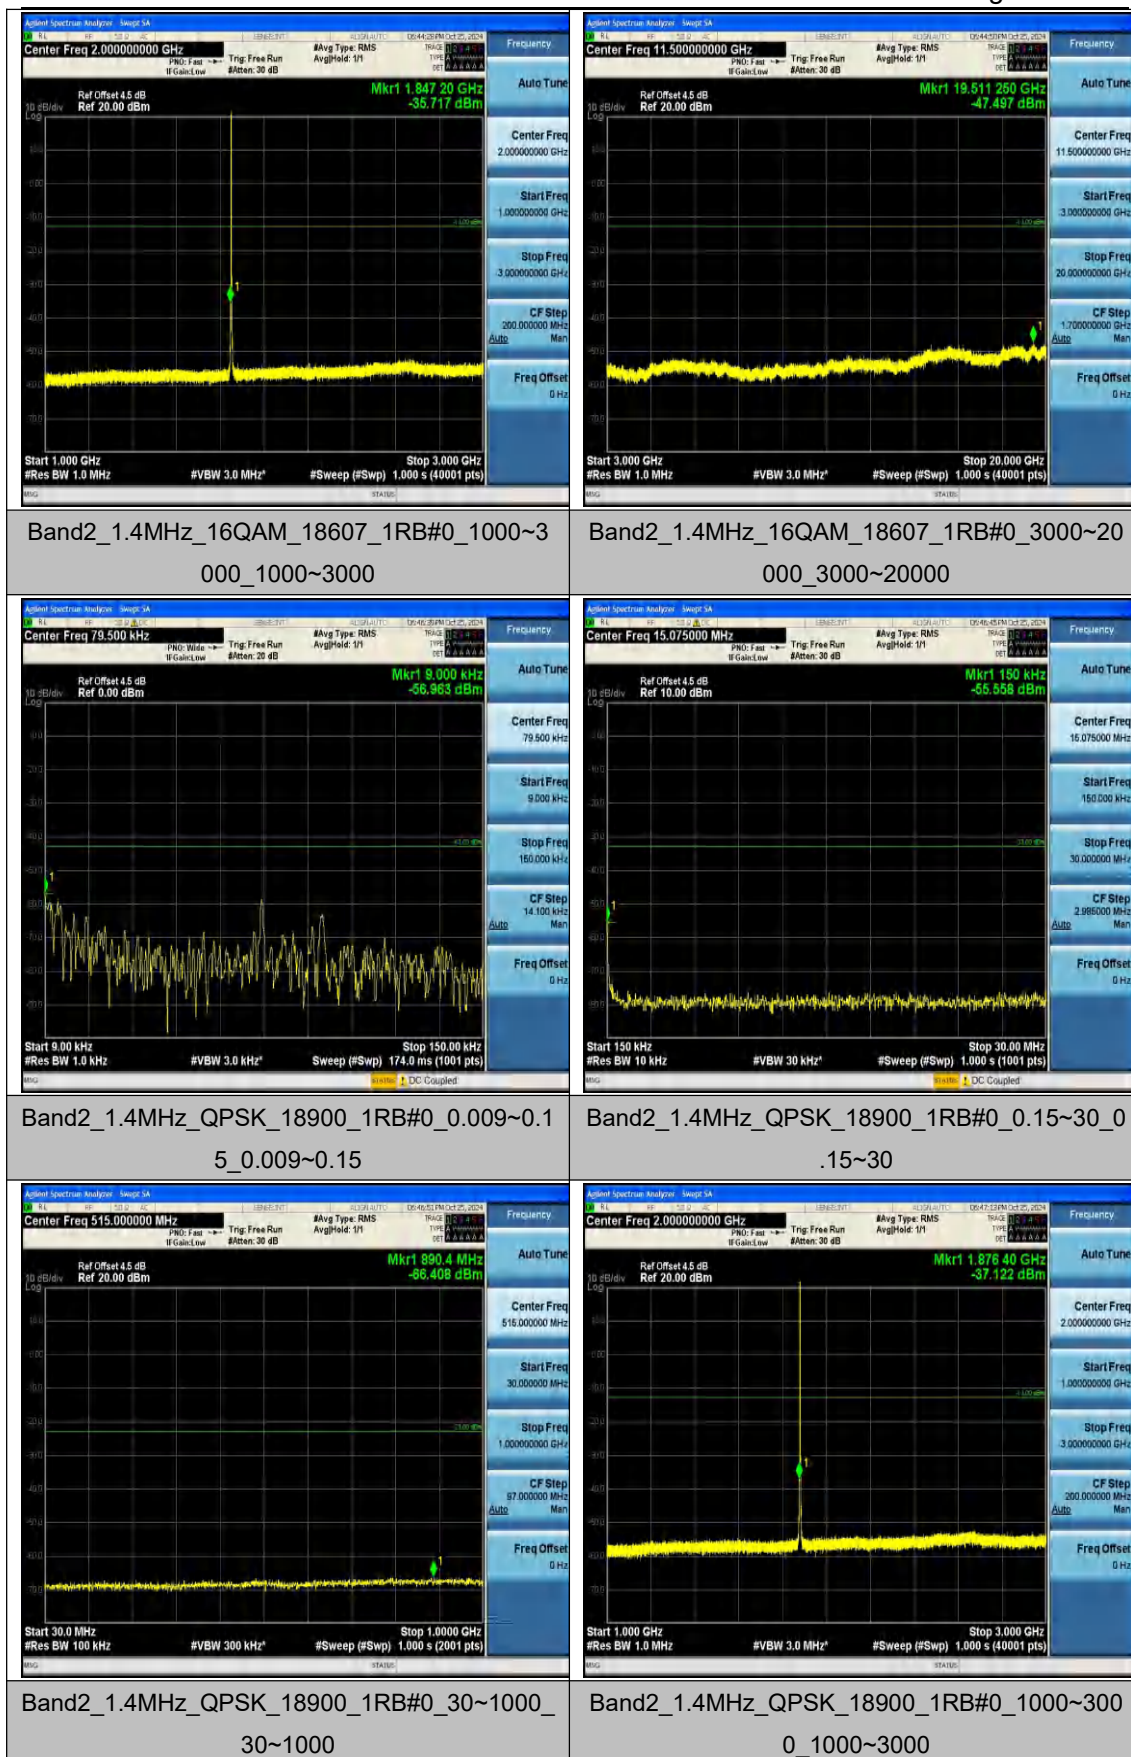


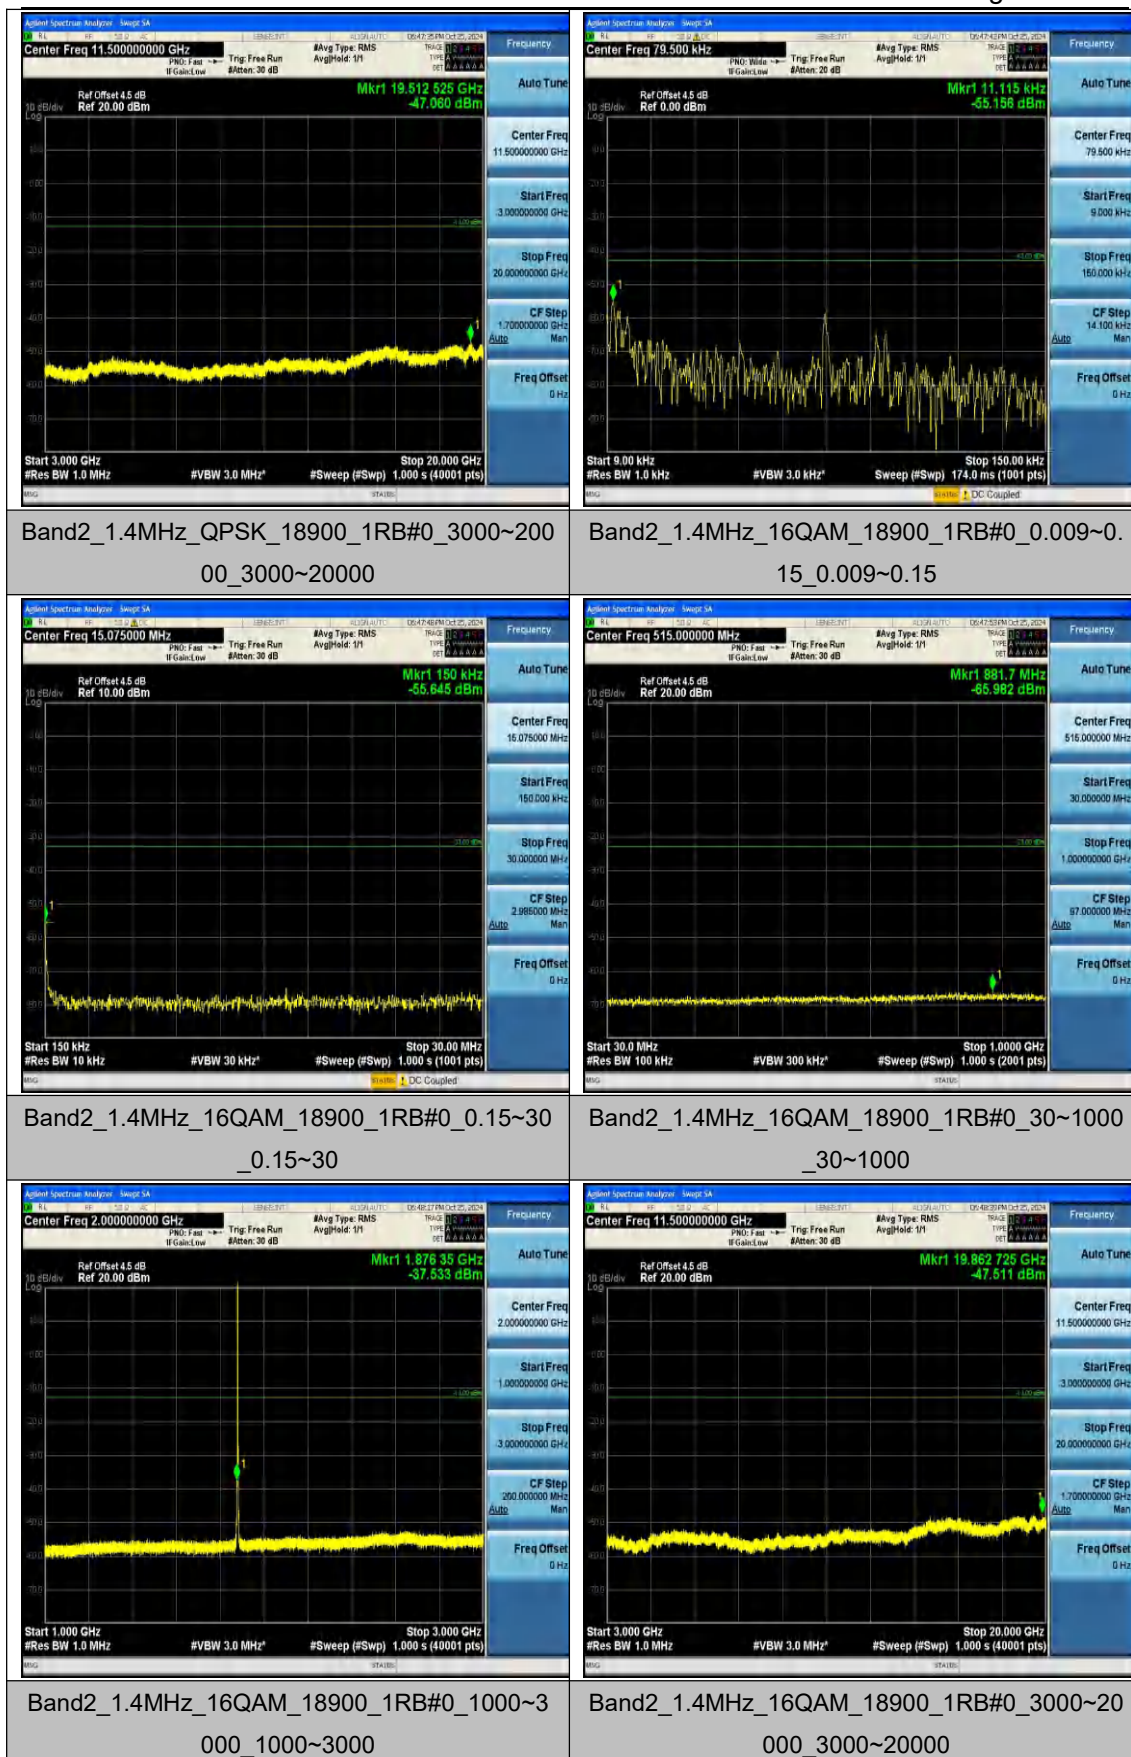

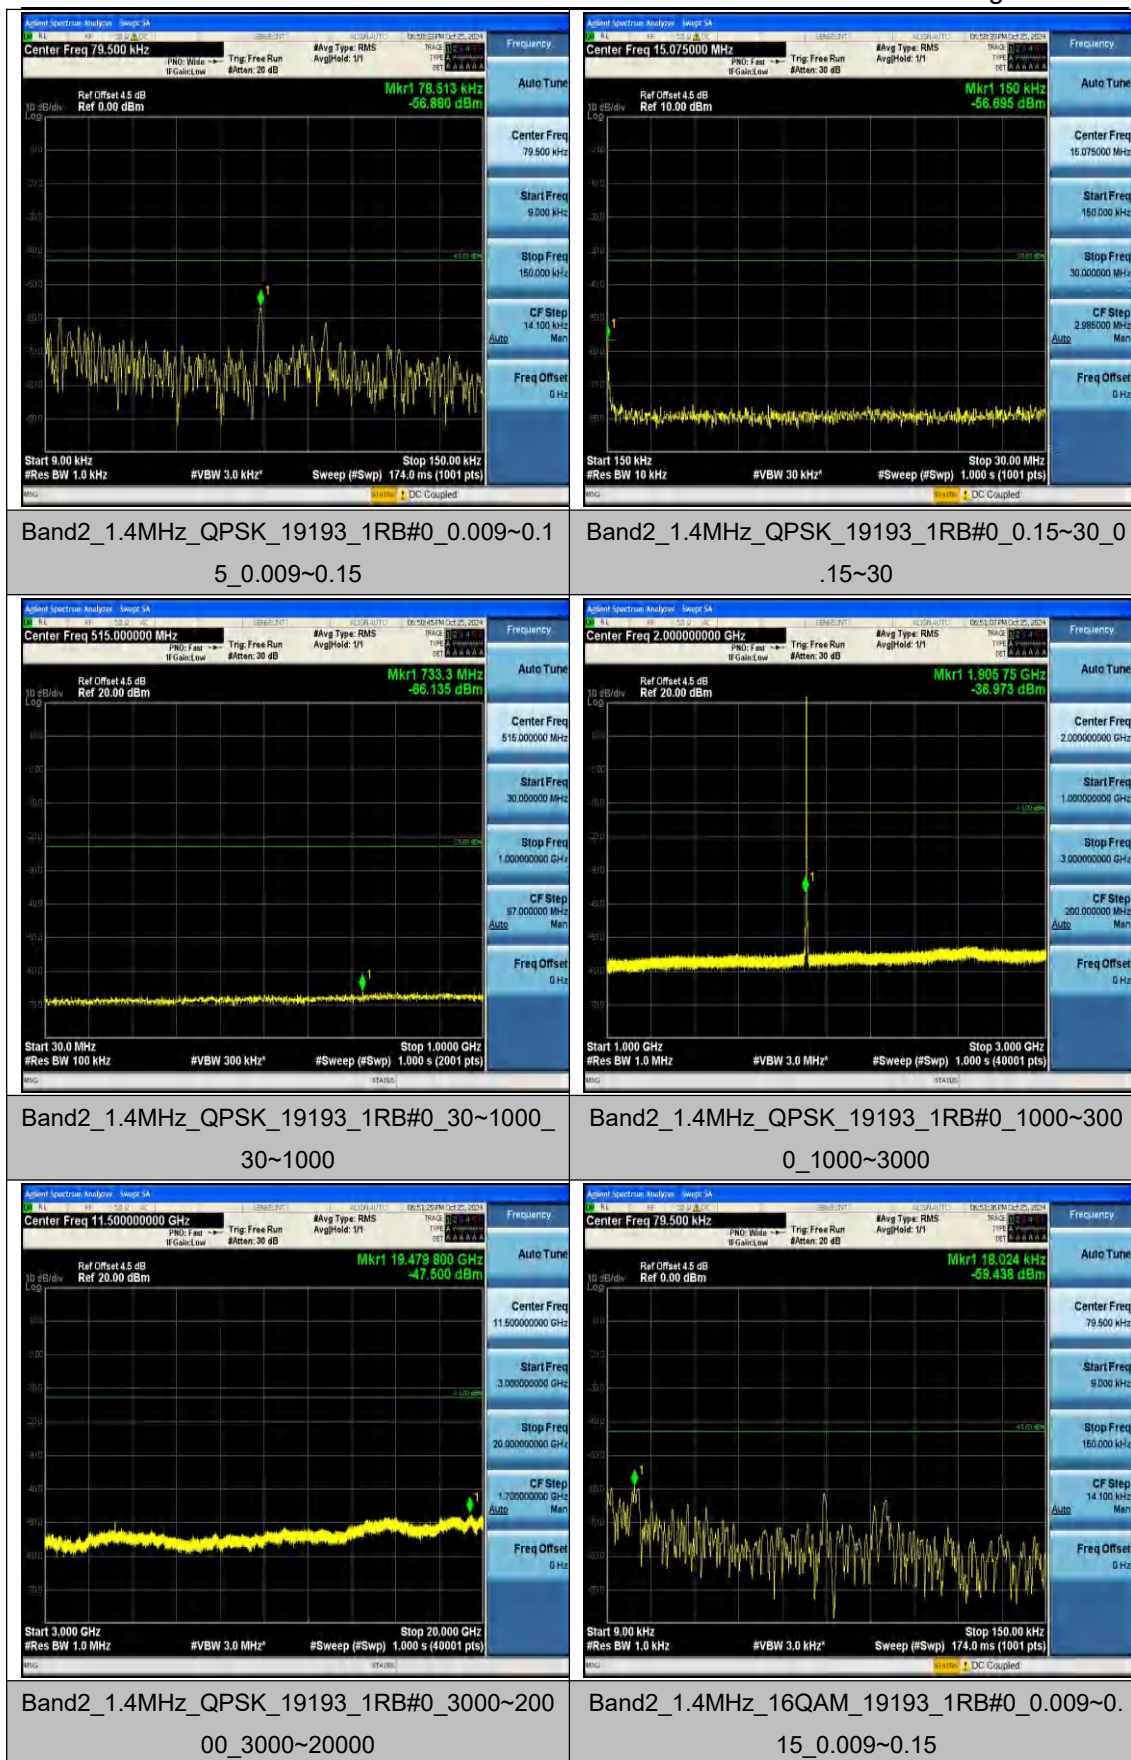

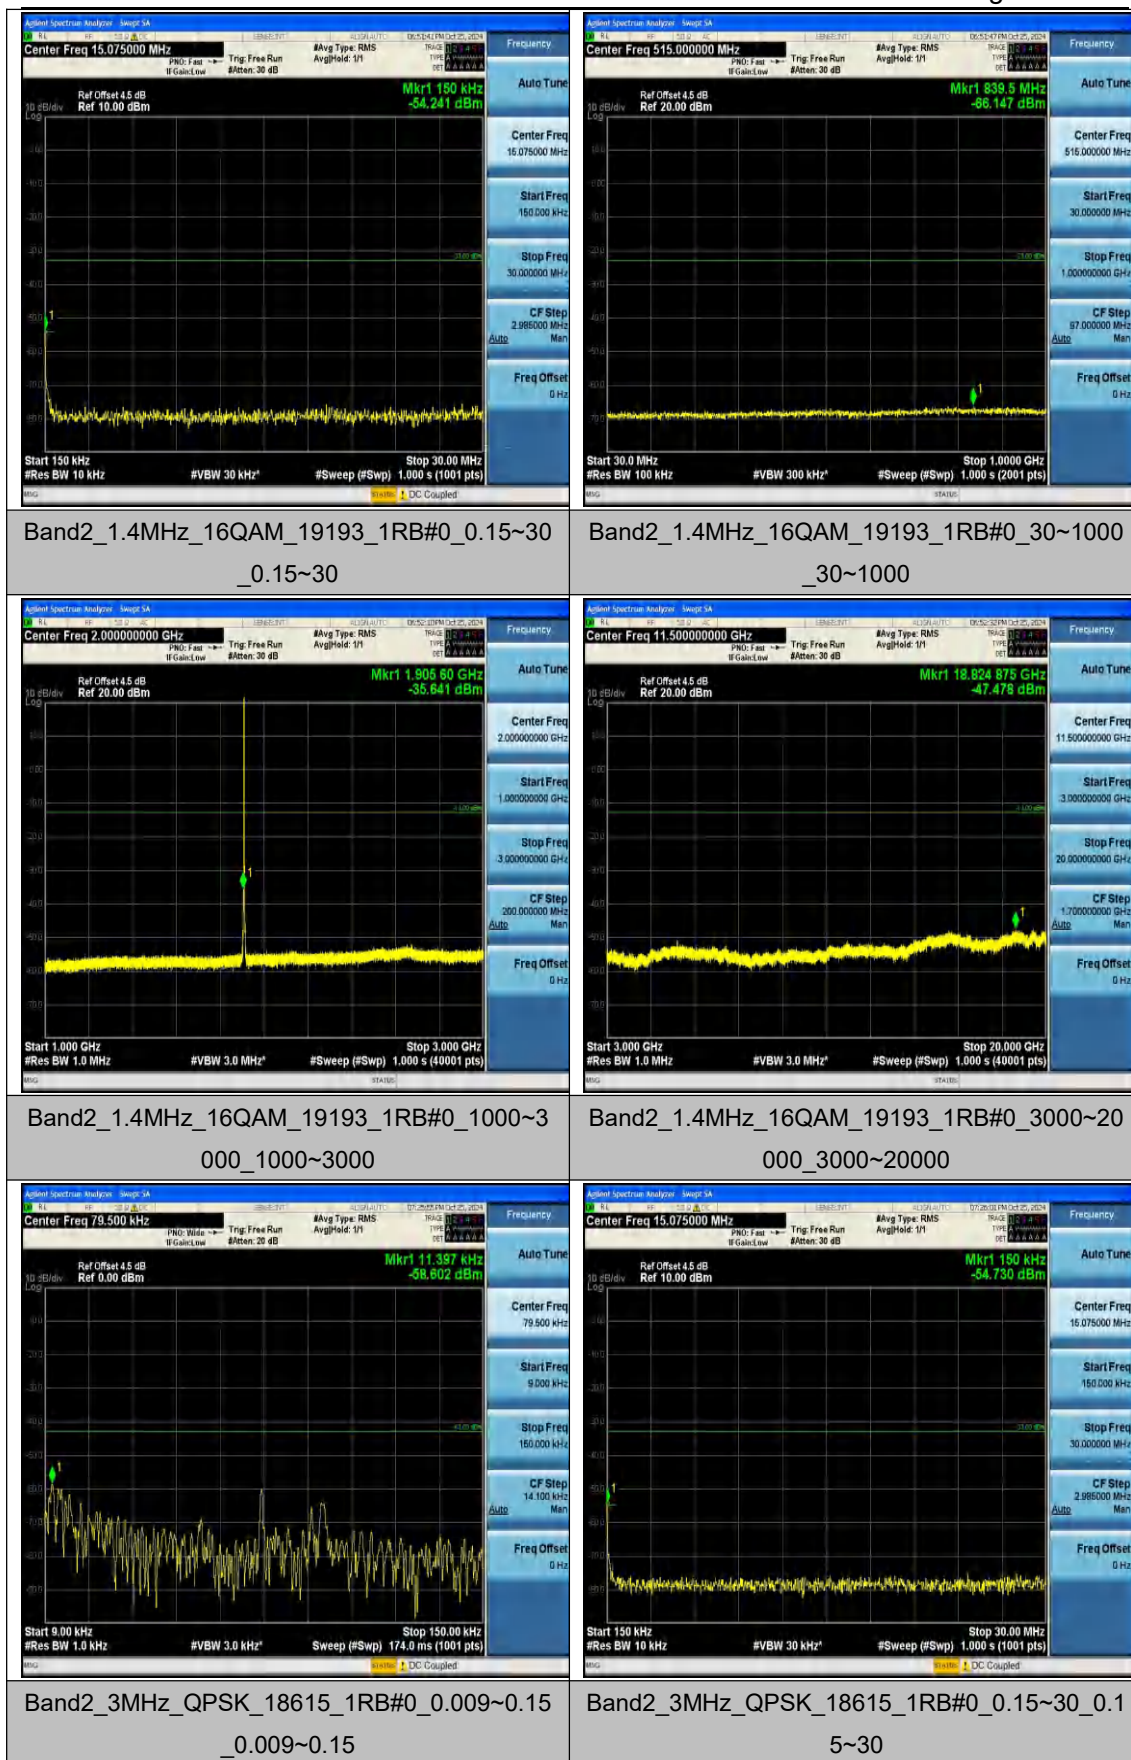

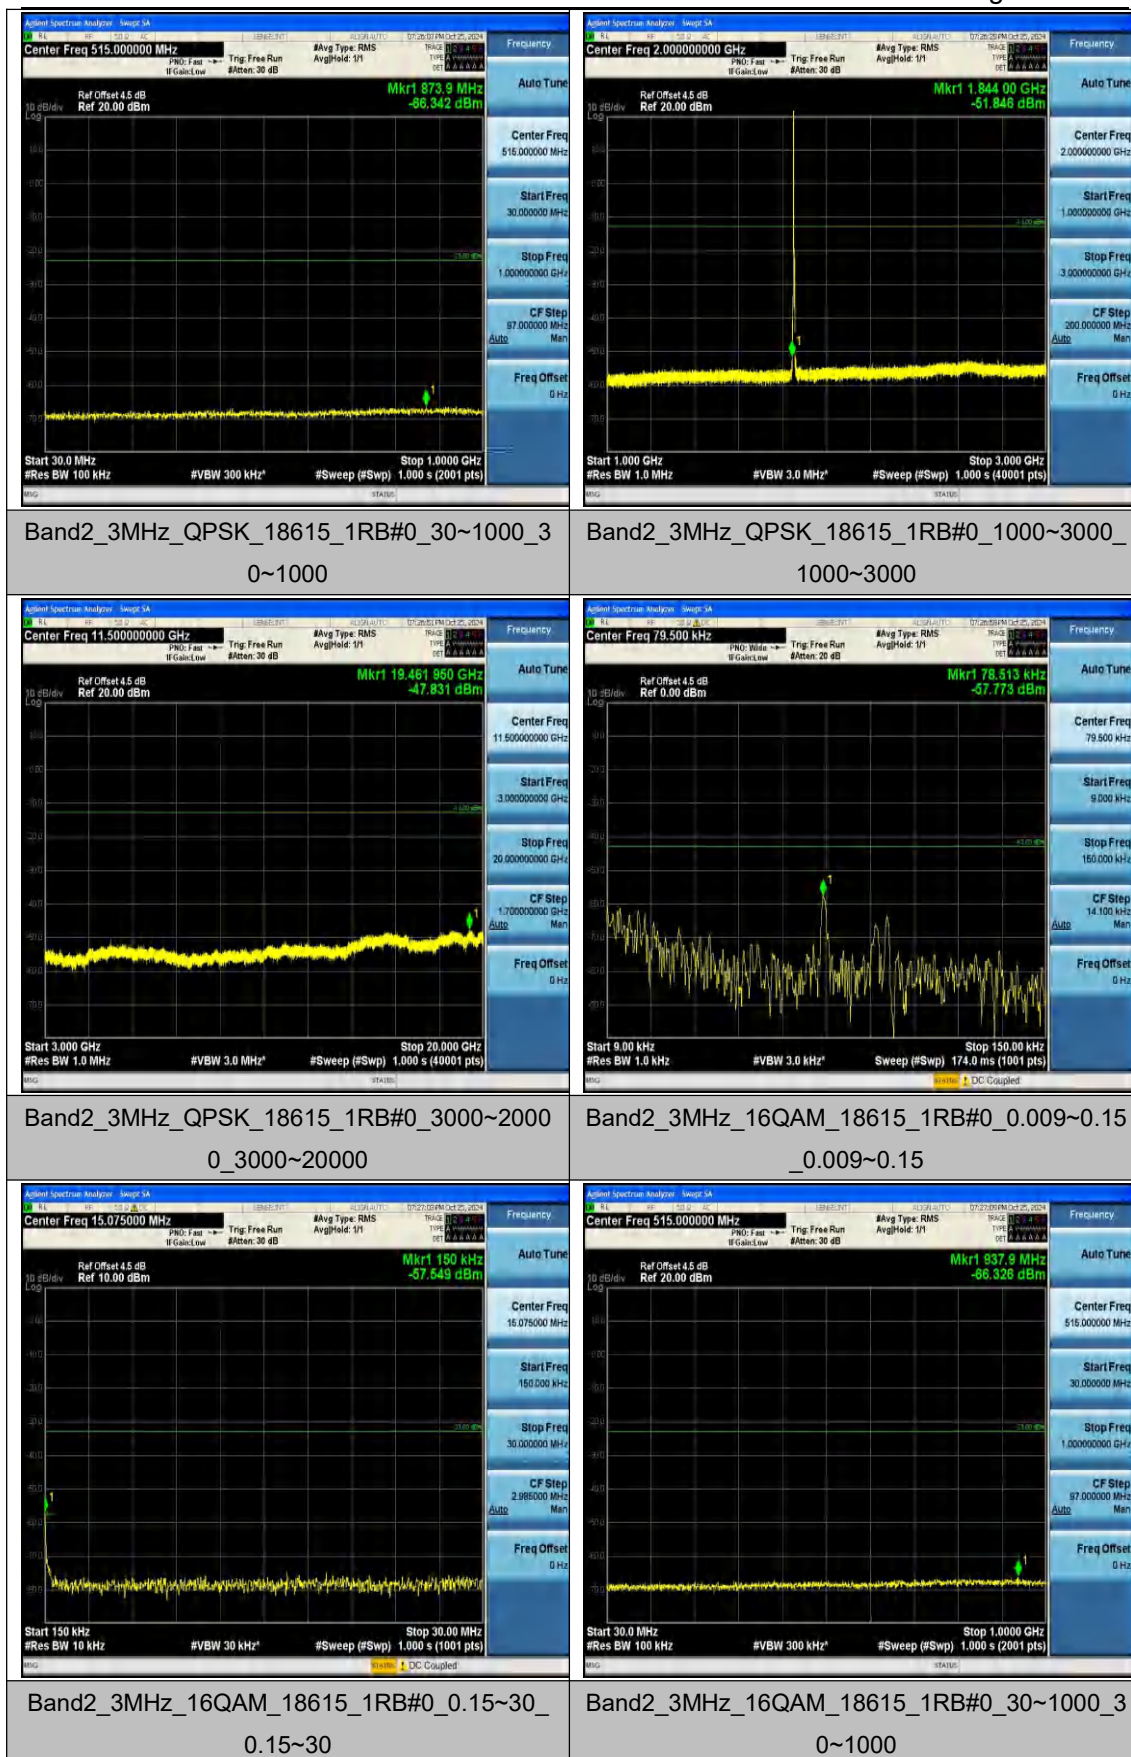

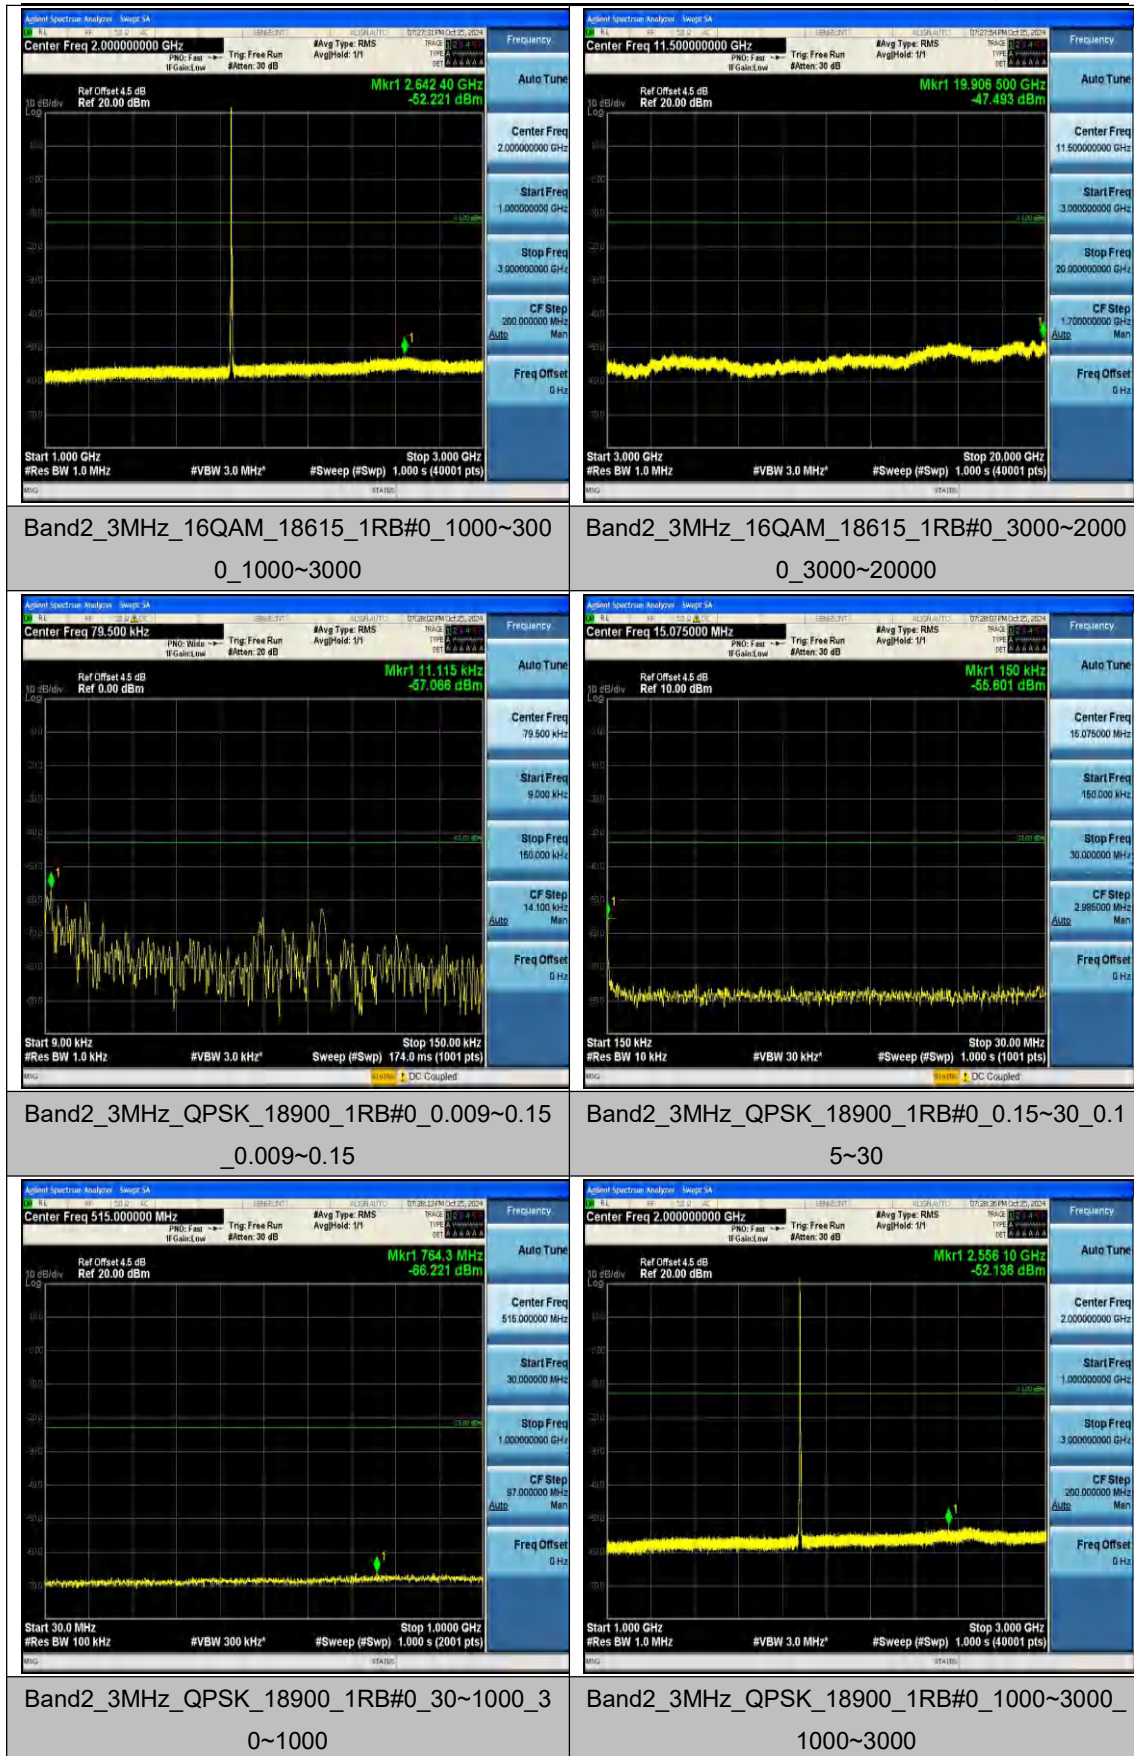



Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com




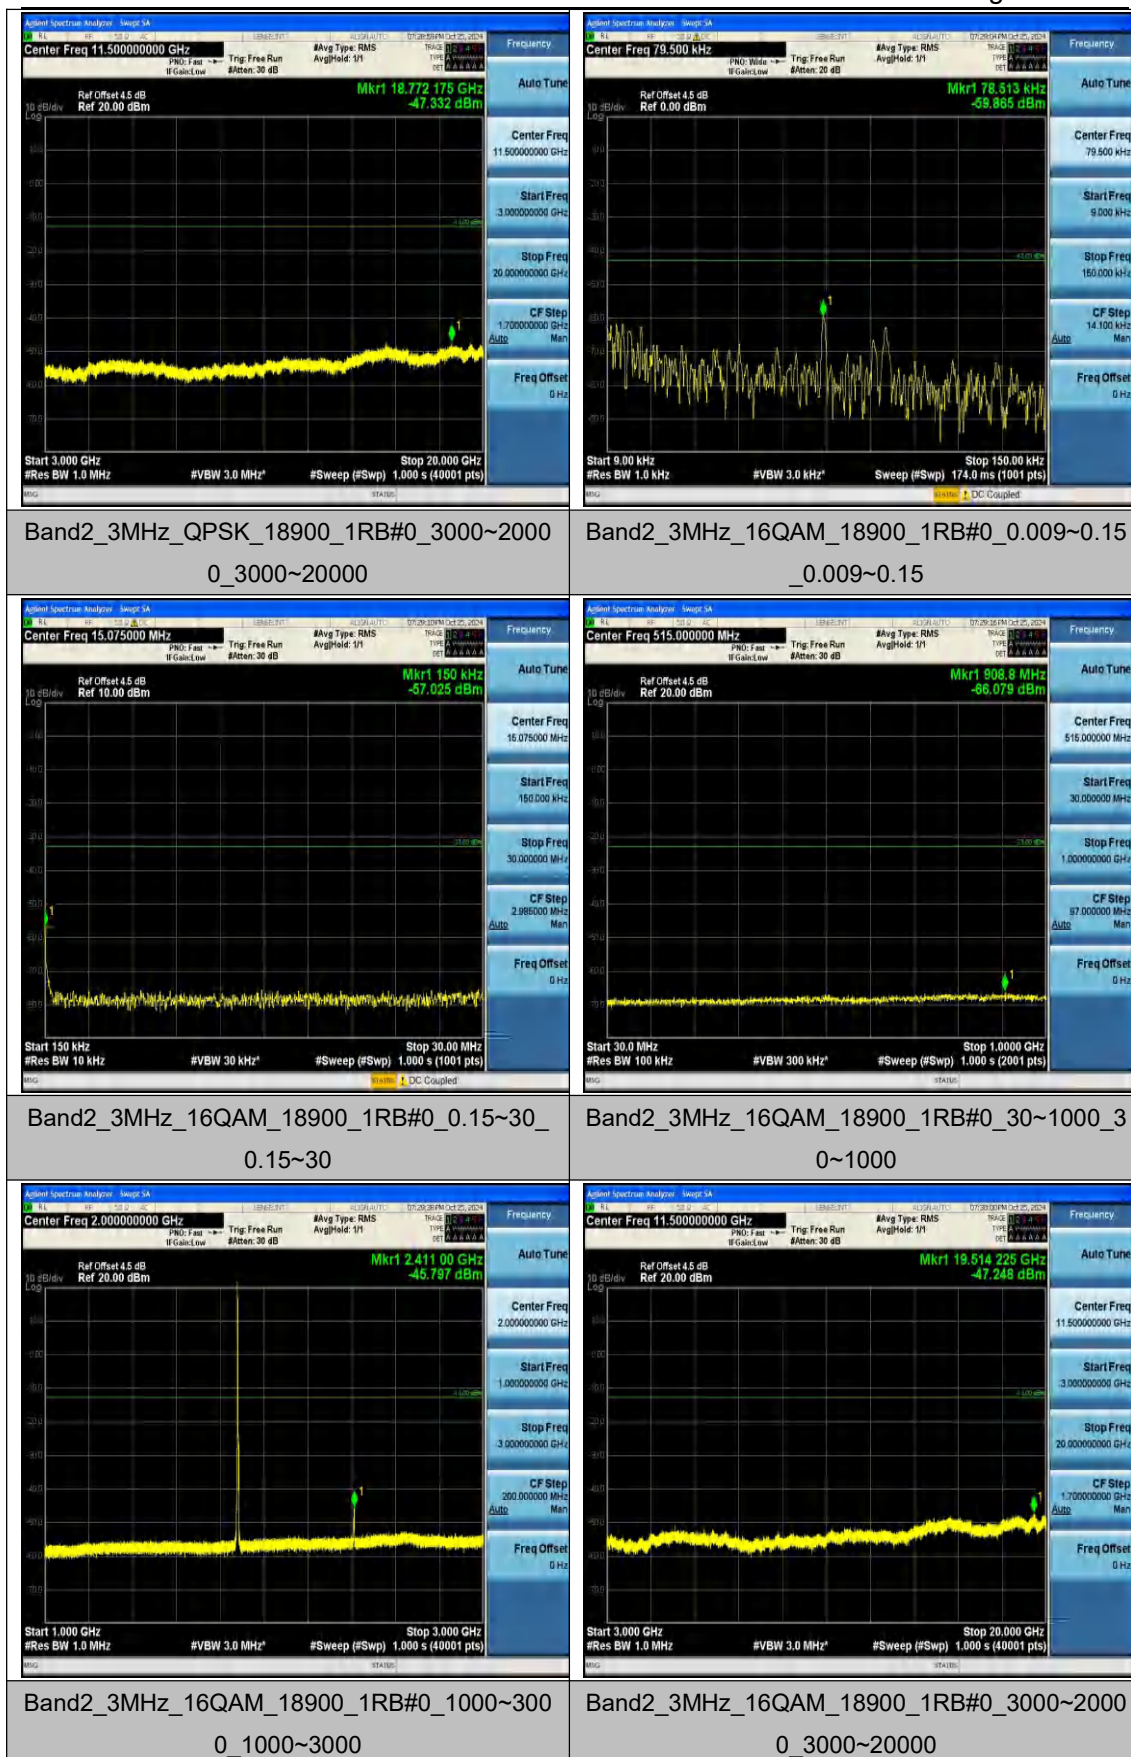

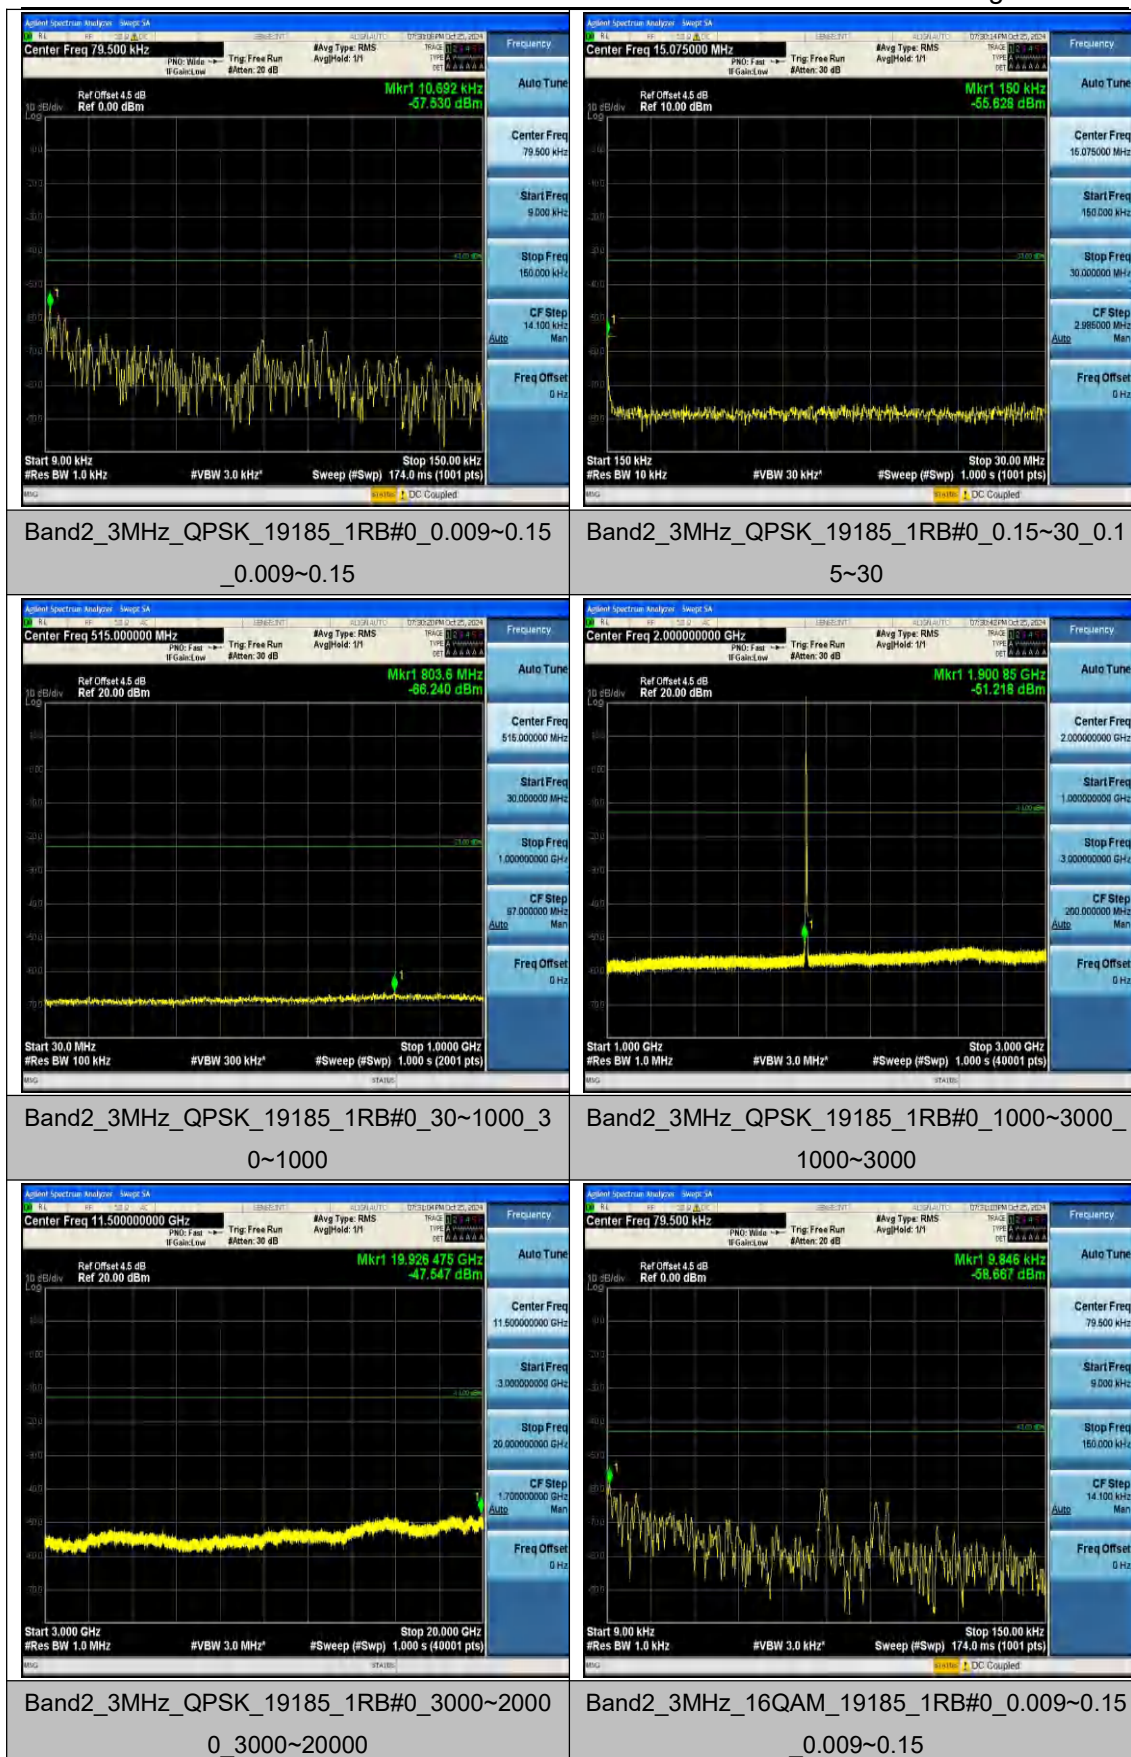

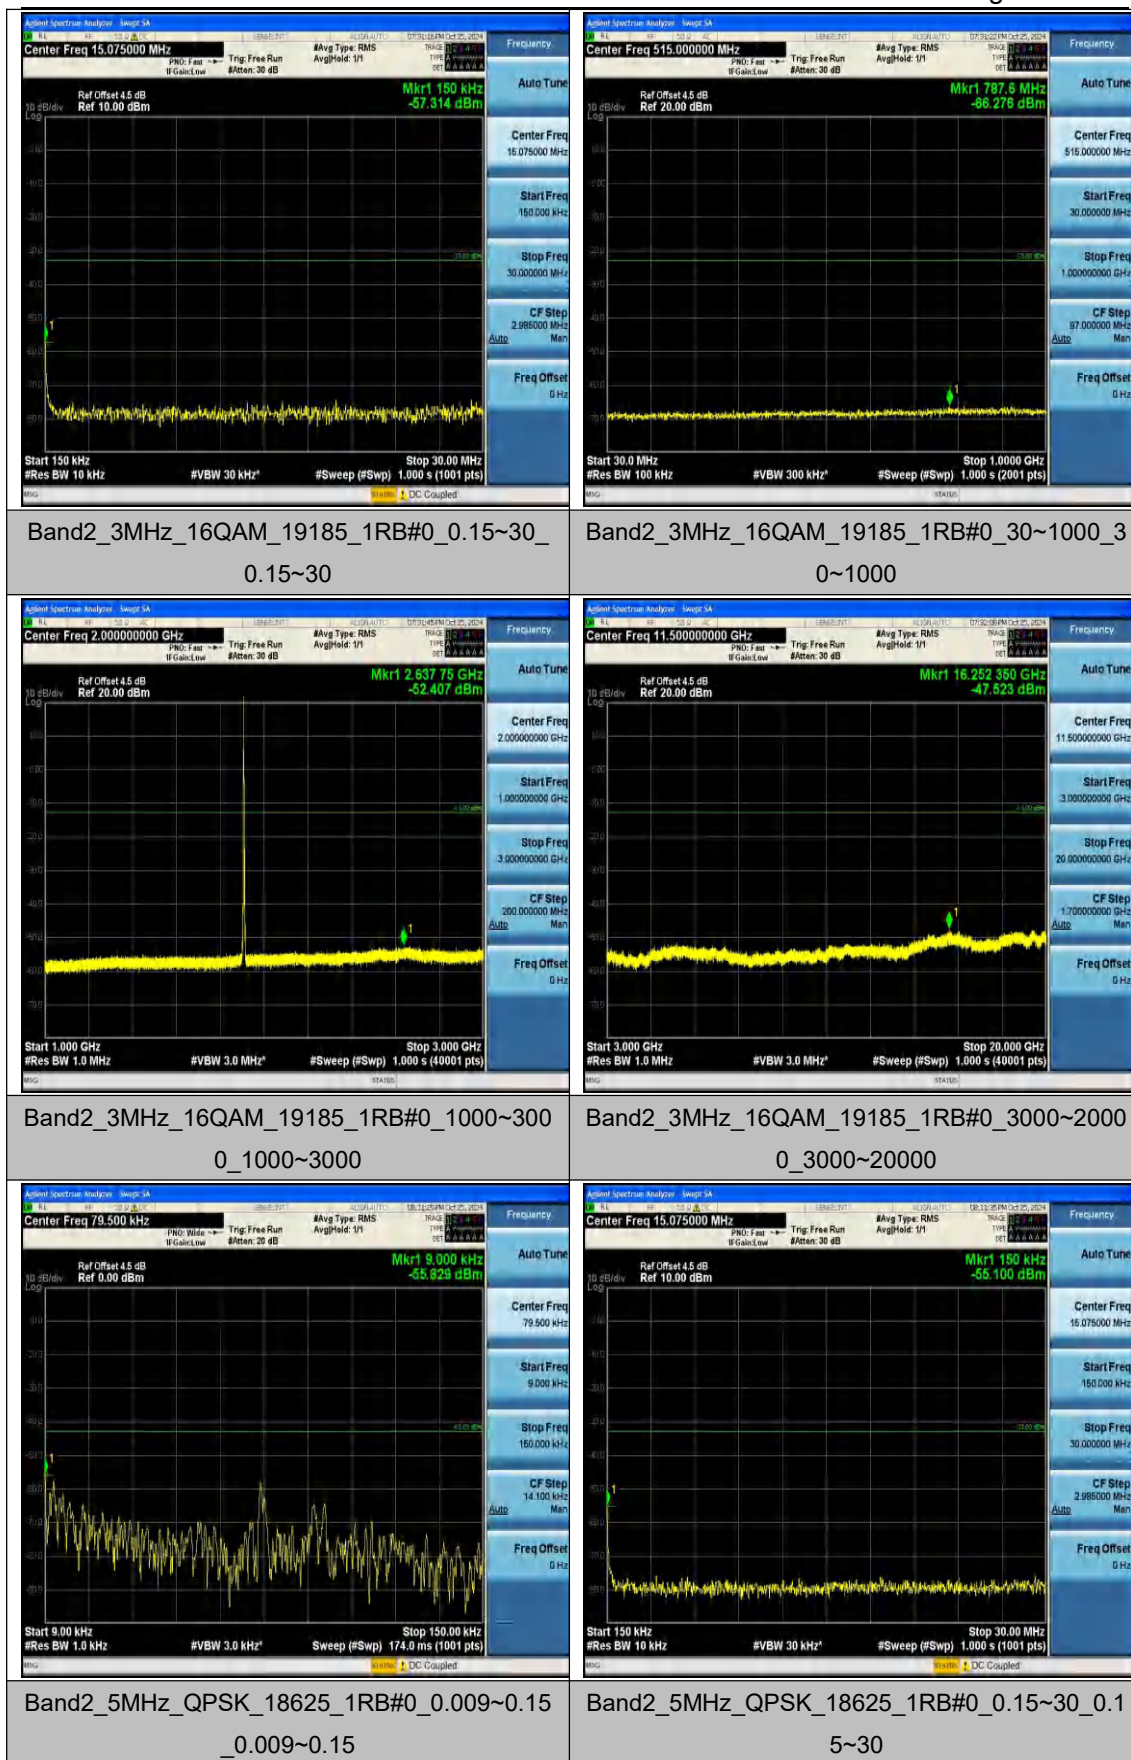

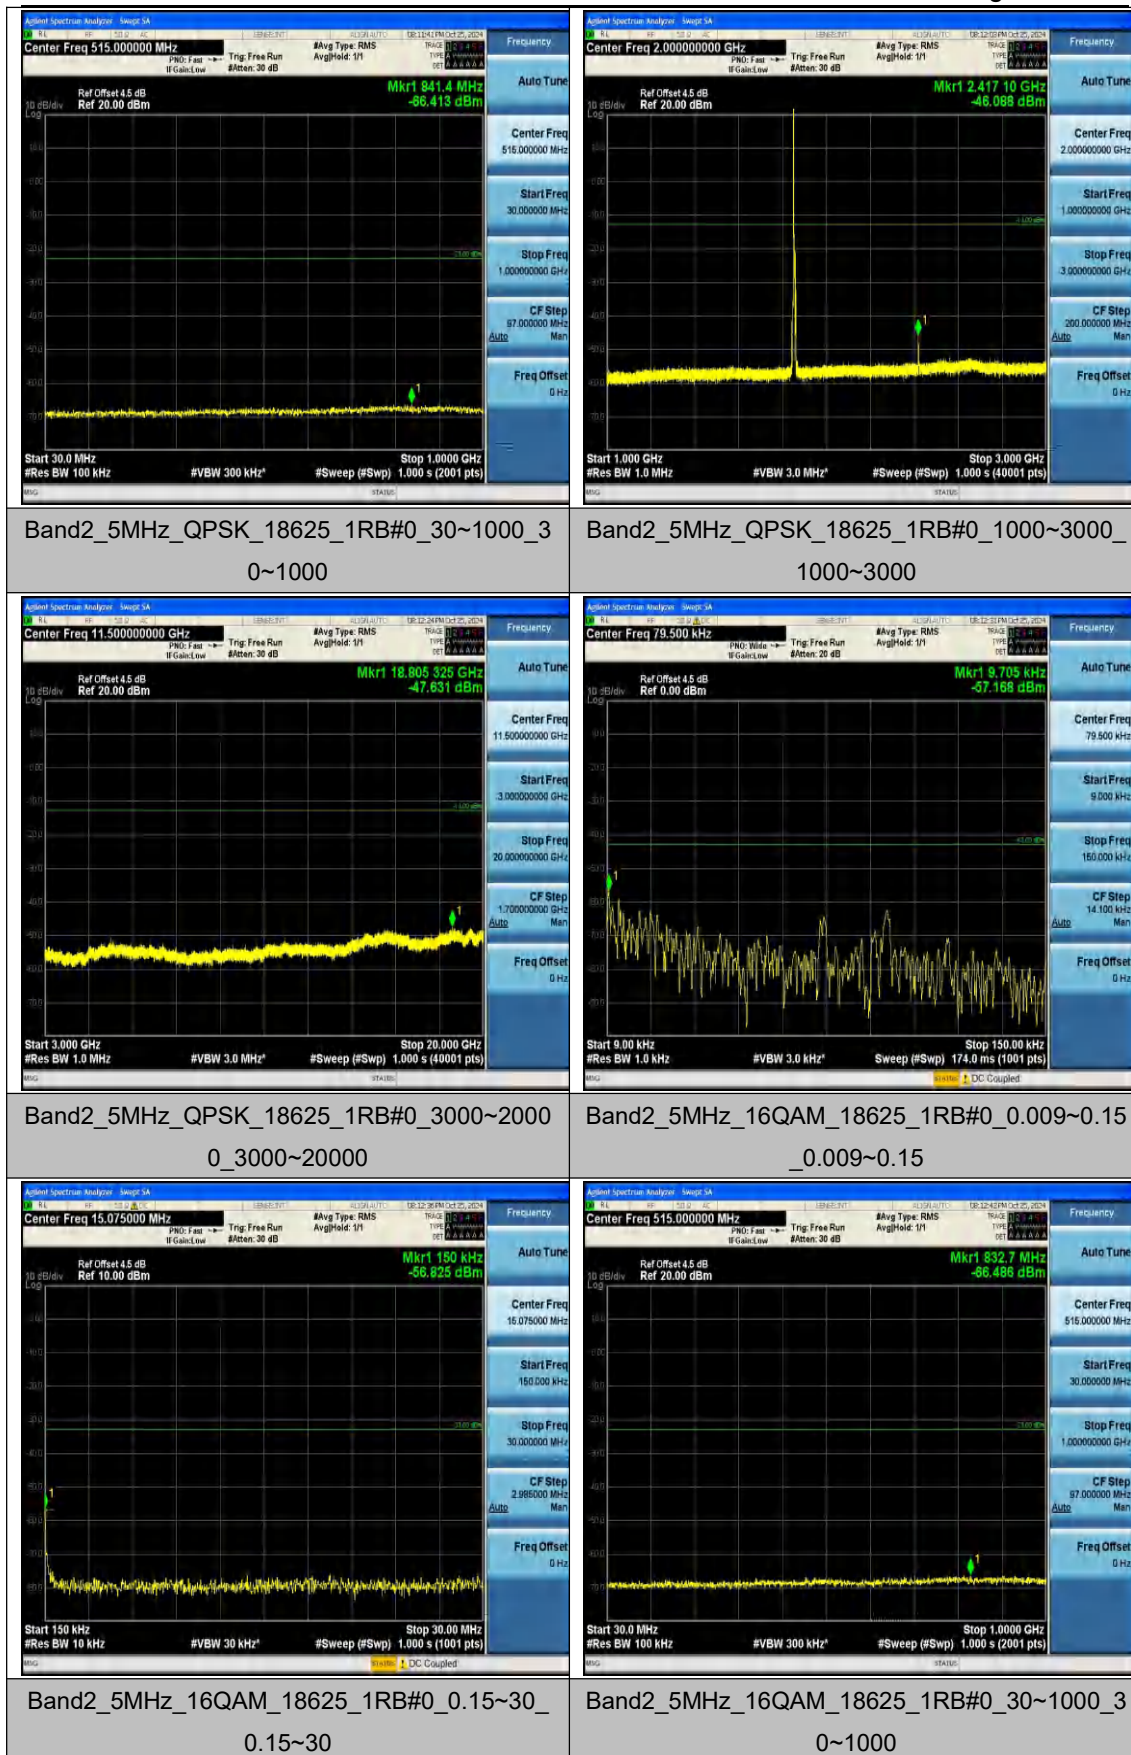

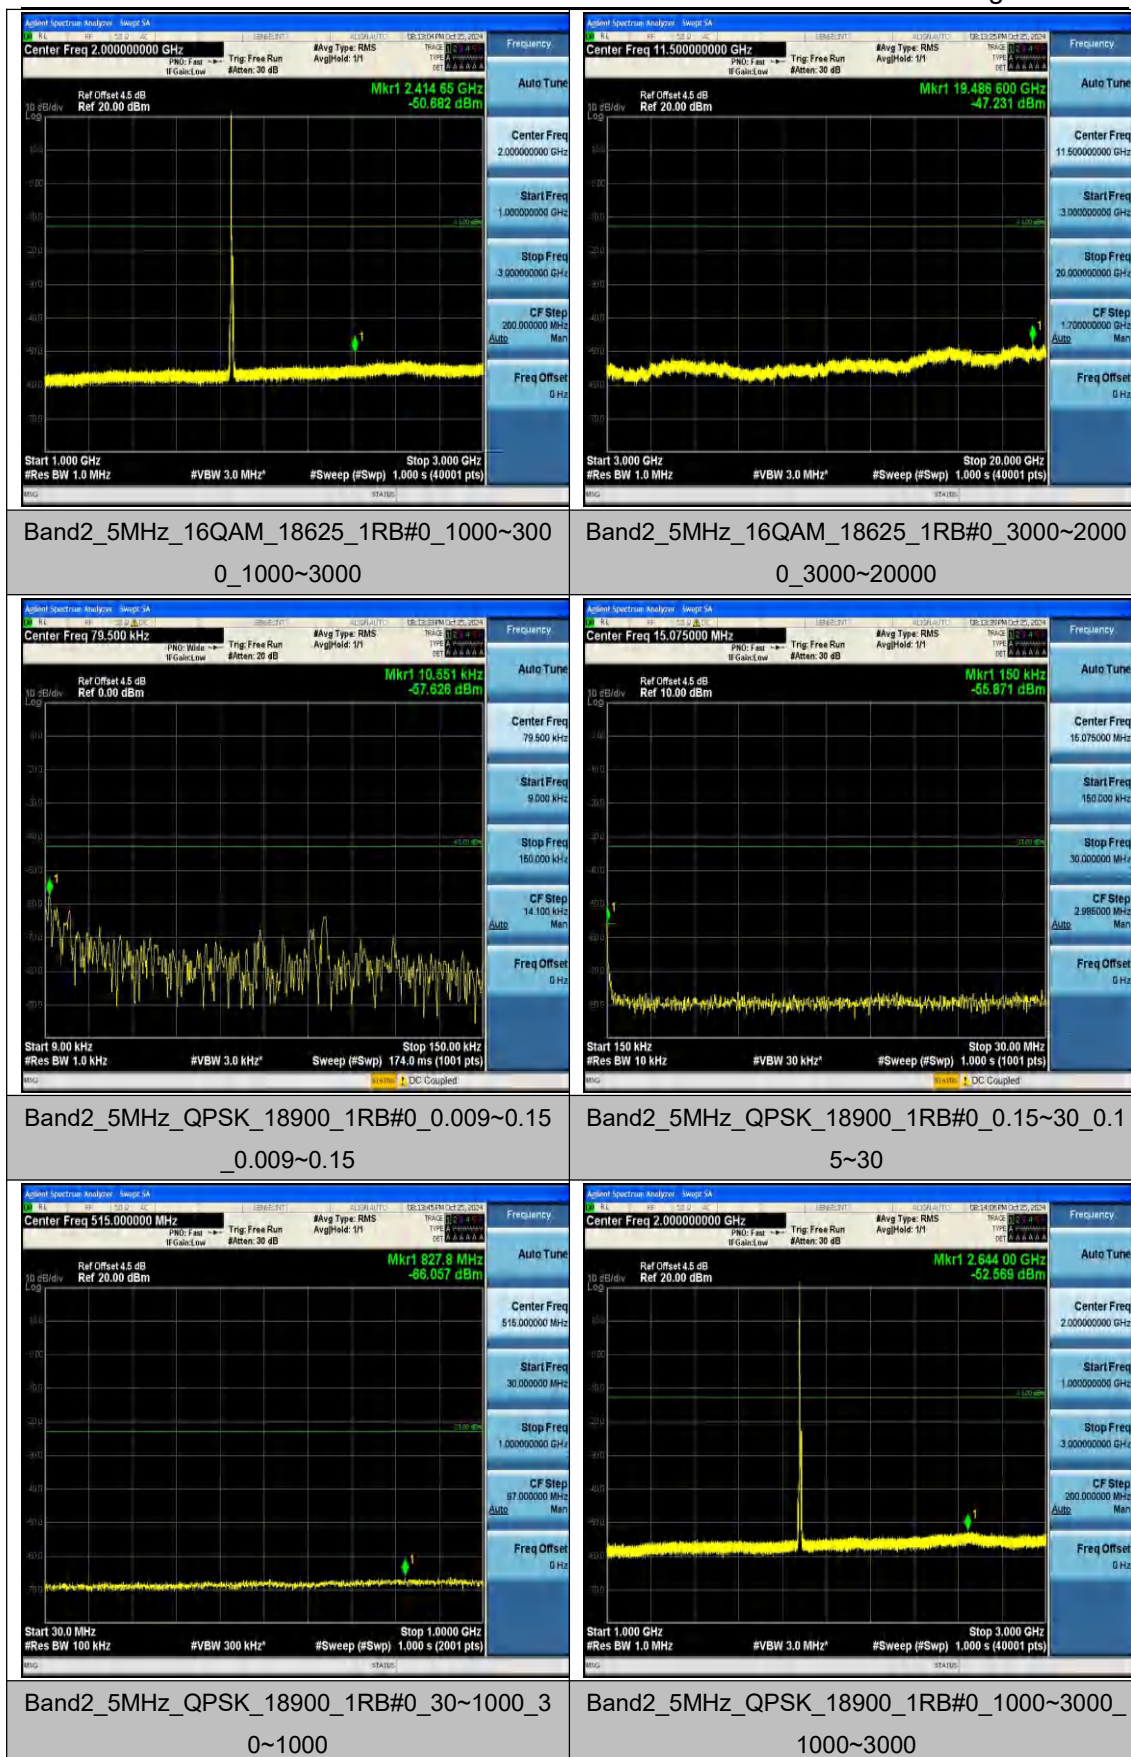


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com



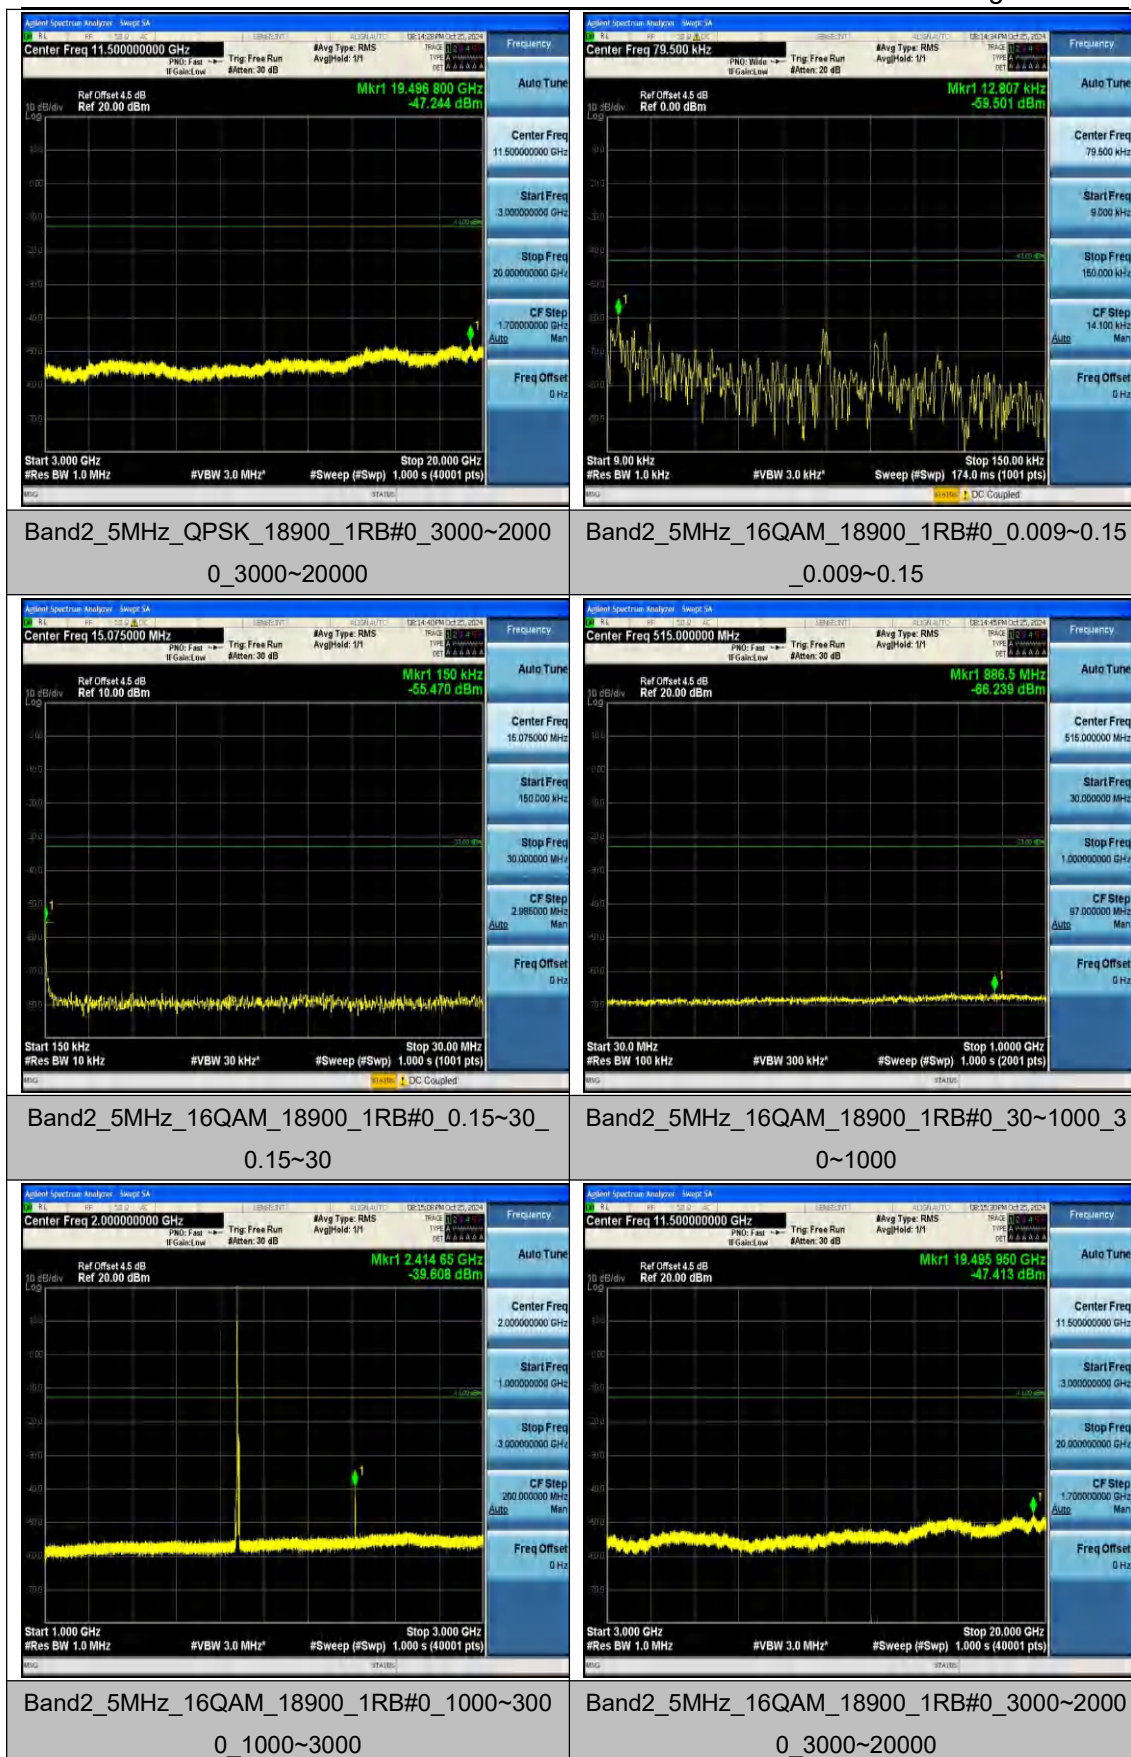



Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline 400-003-0500
www.anbotek.com



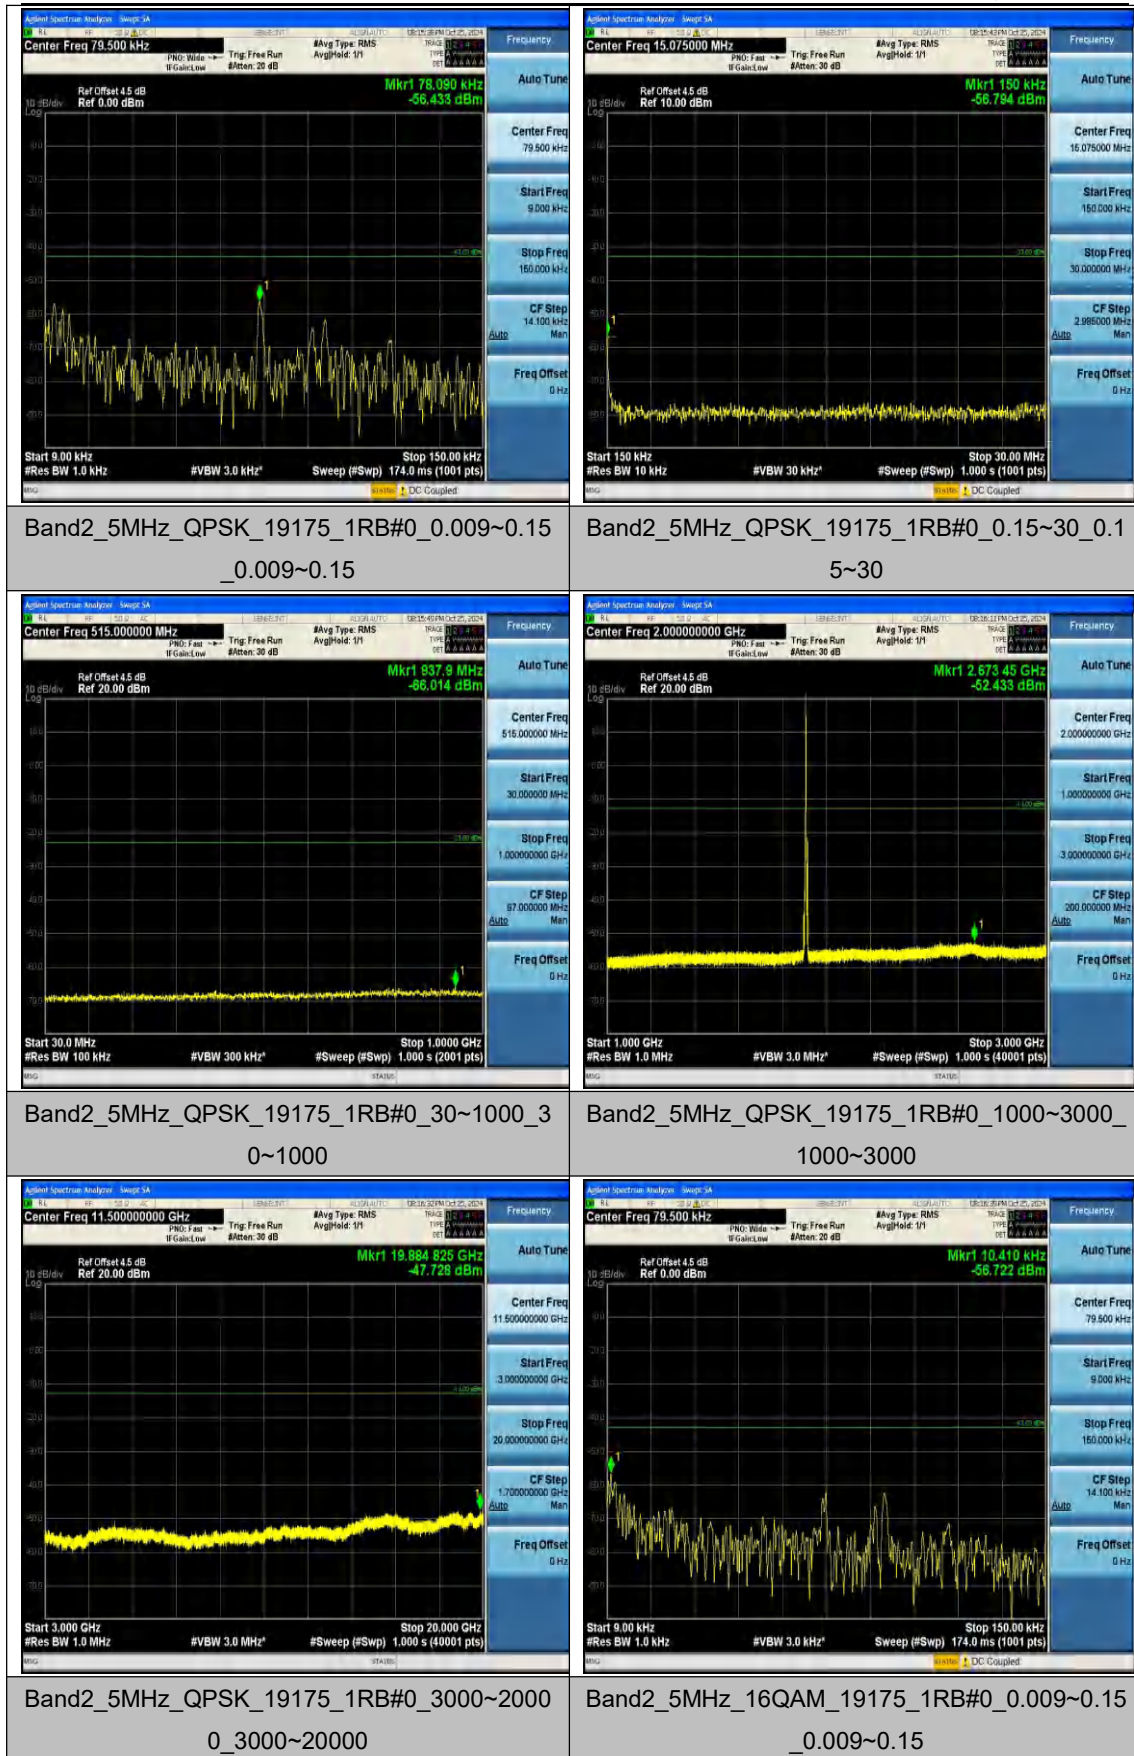

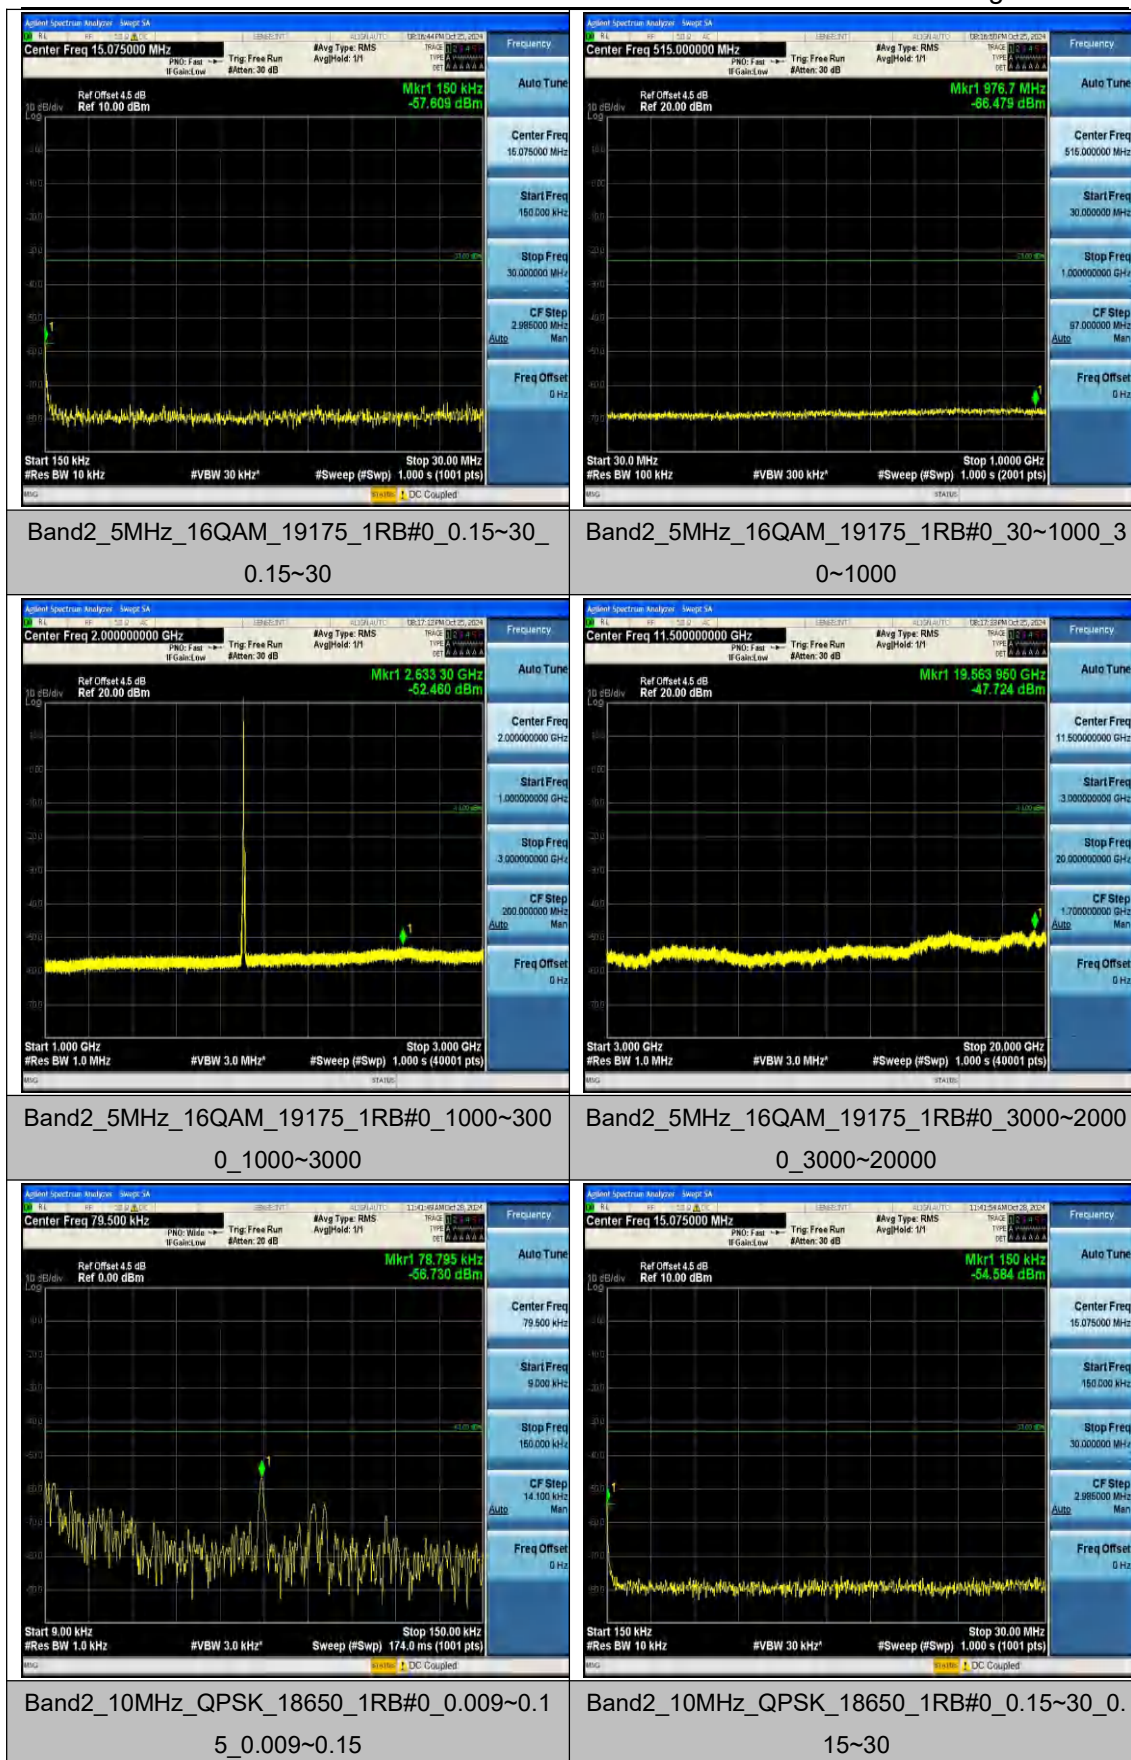


Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com



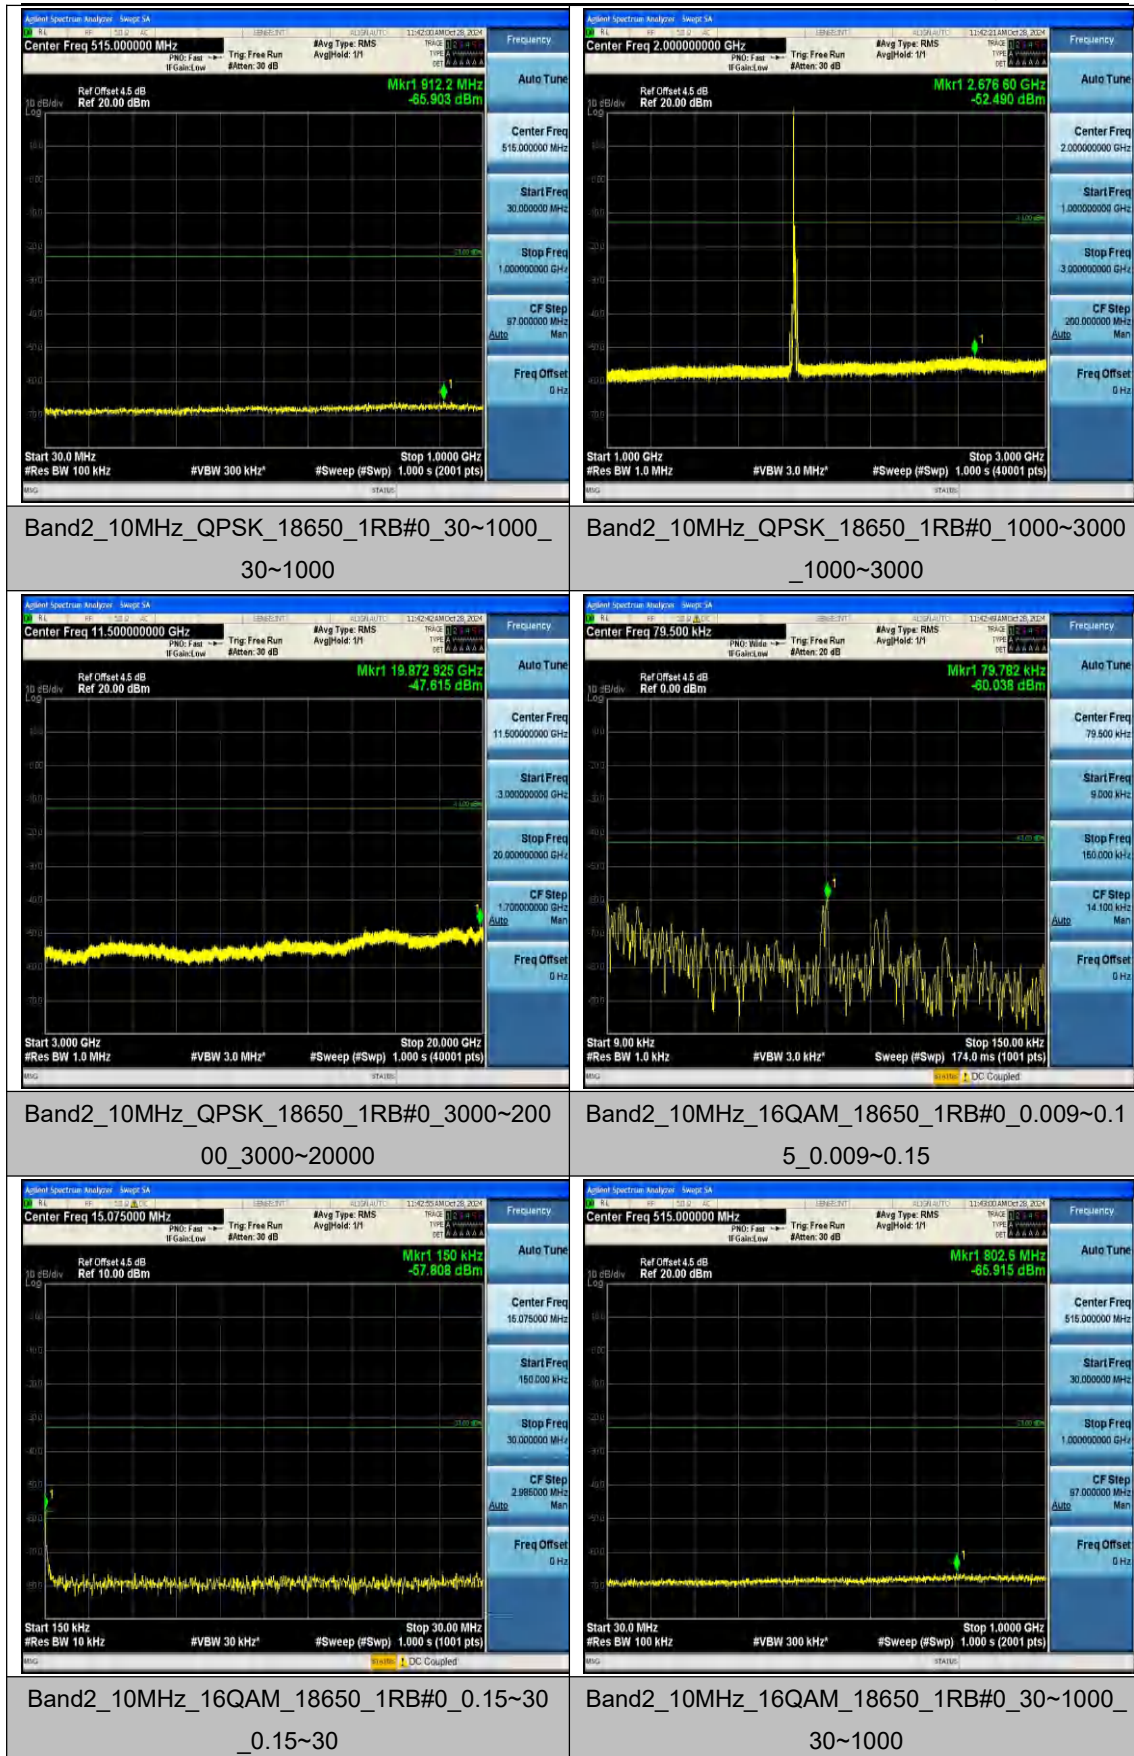

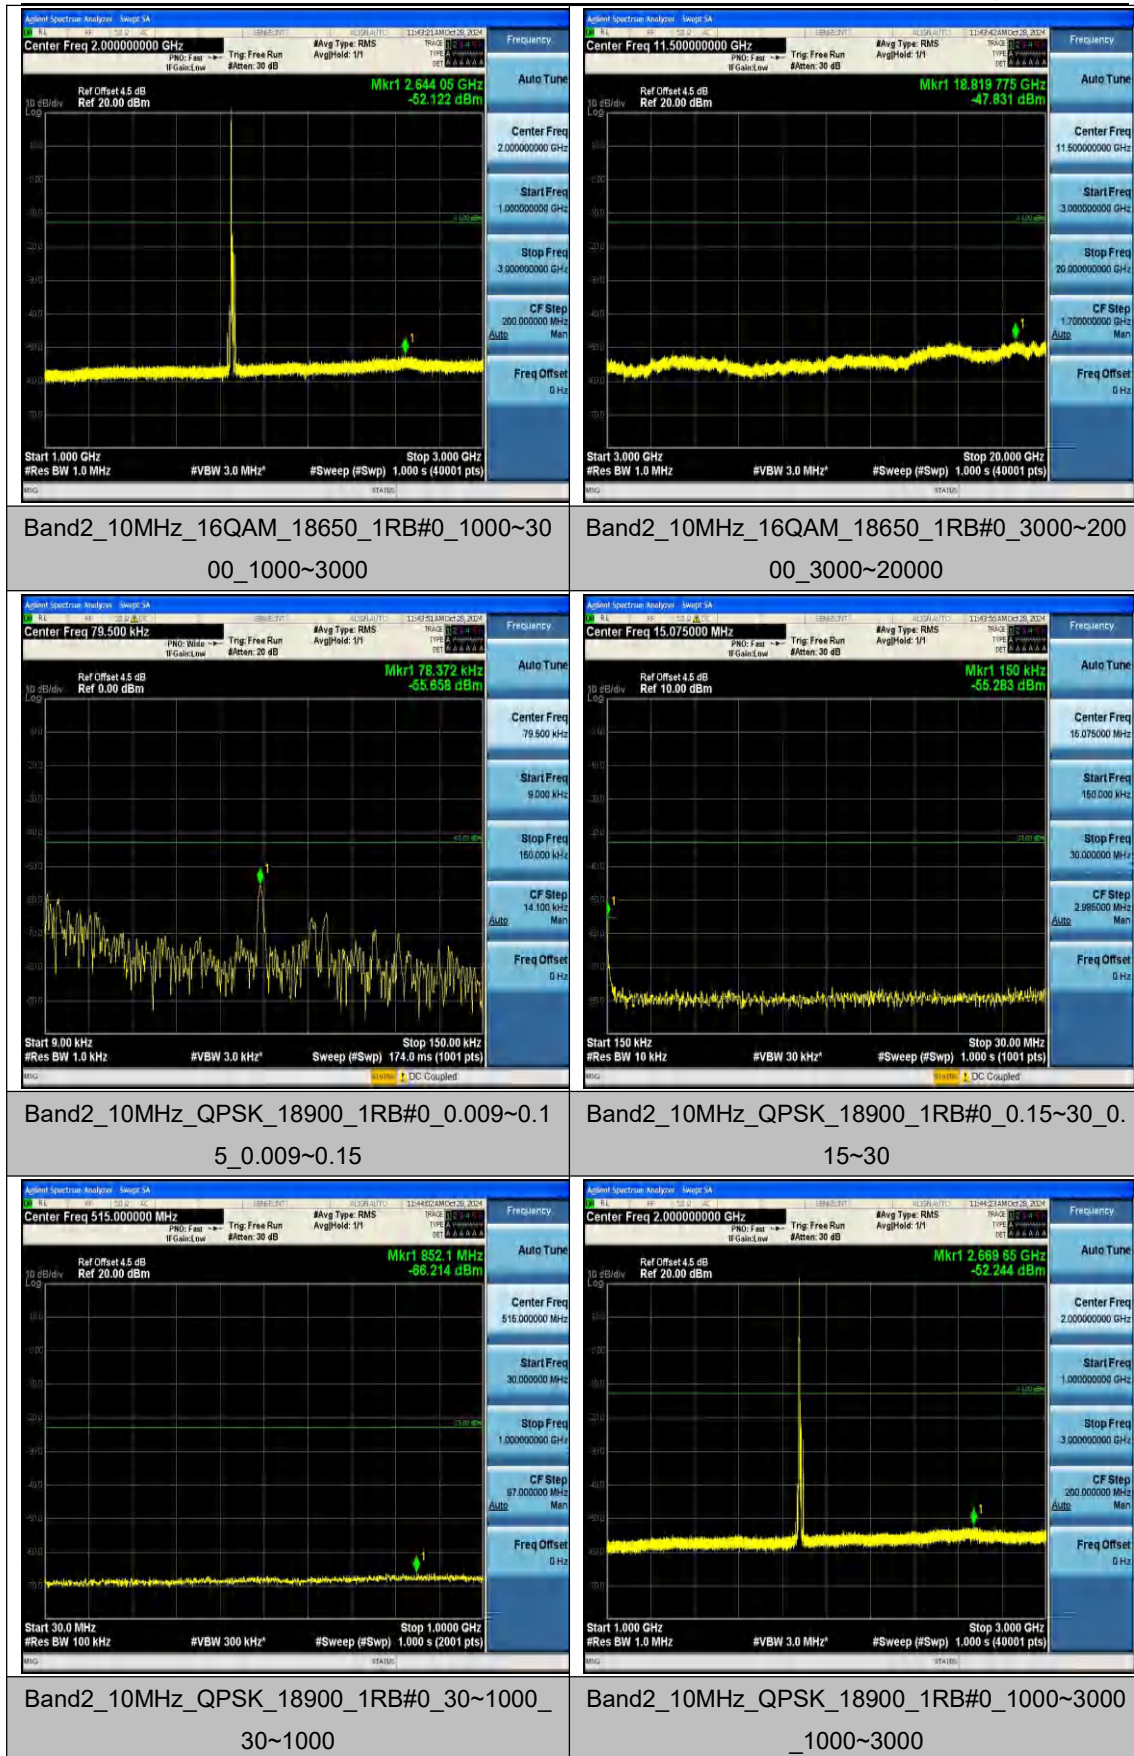


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com



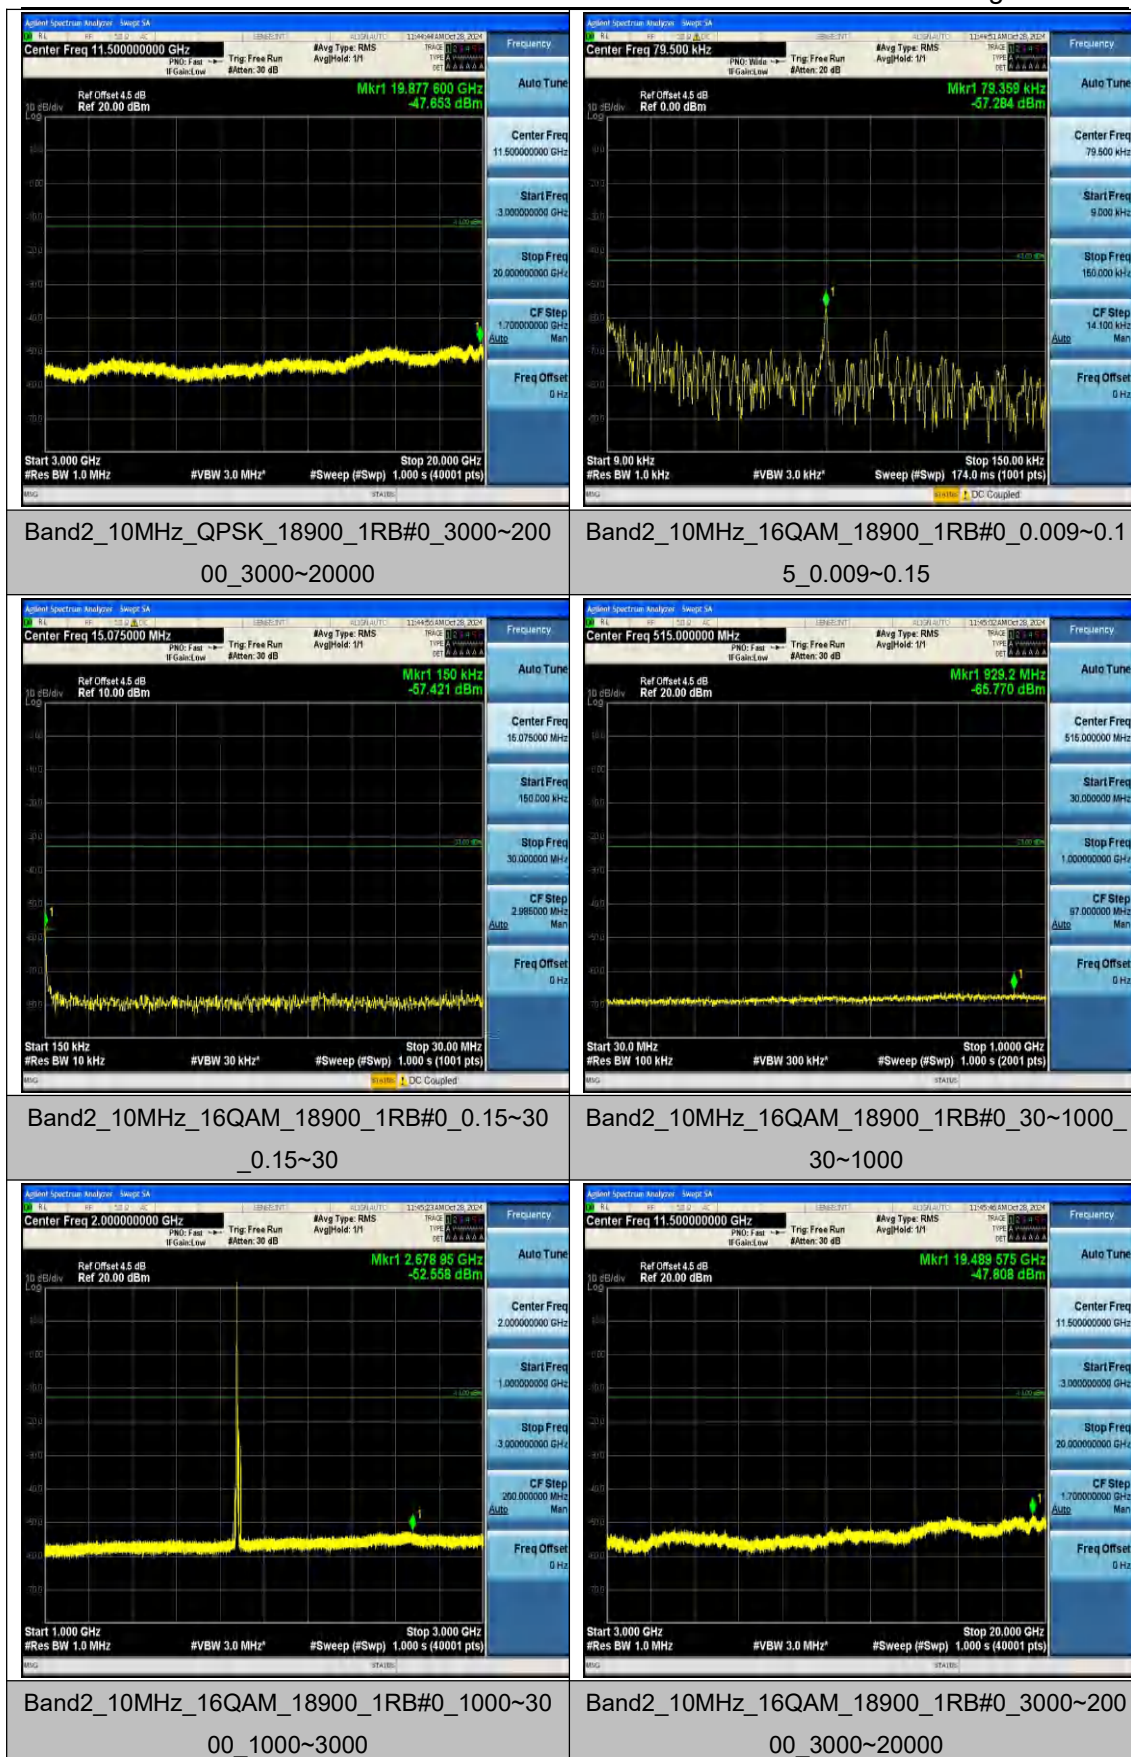



Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline 400-003-0500
www.anbotek.com



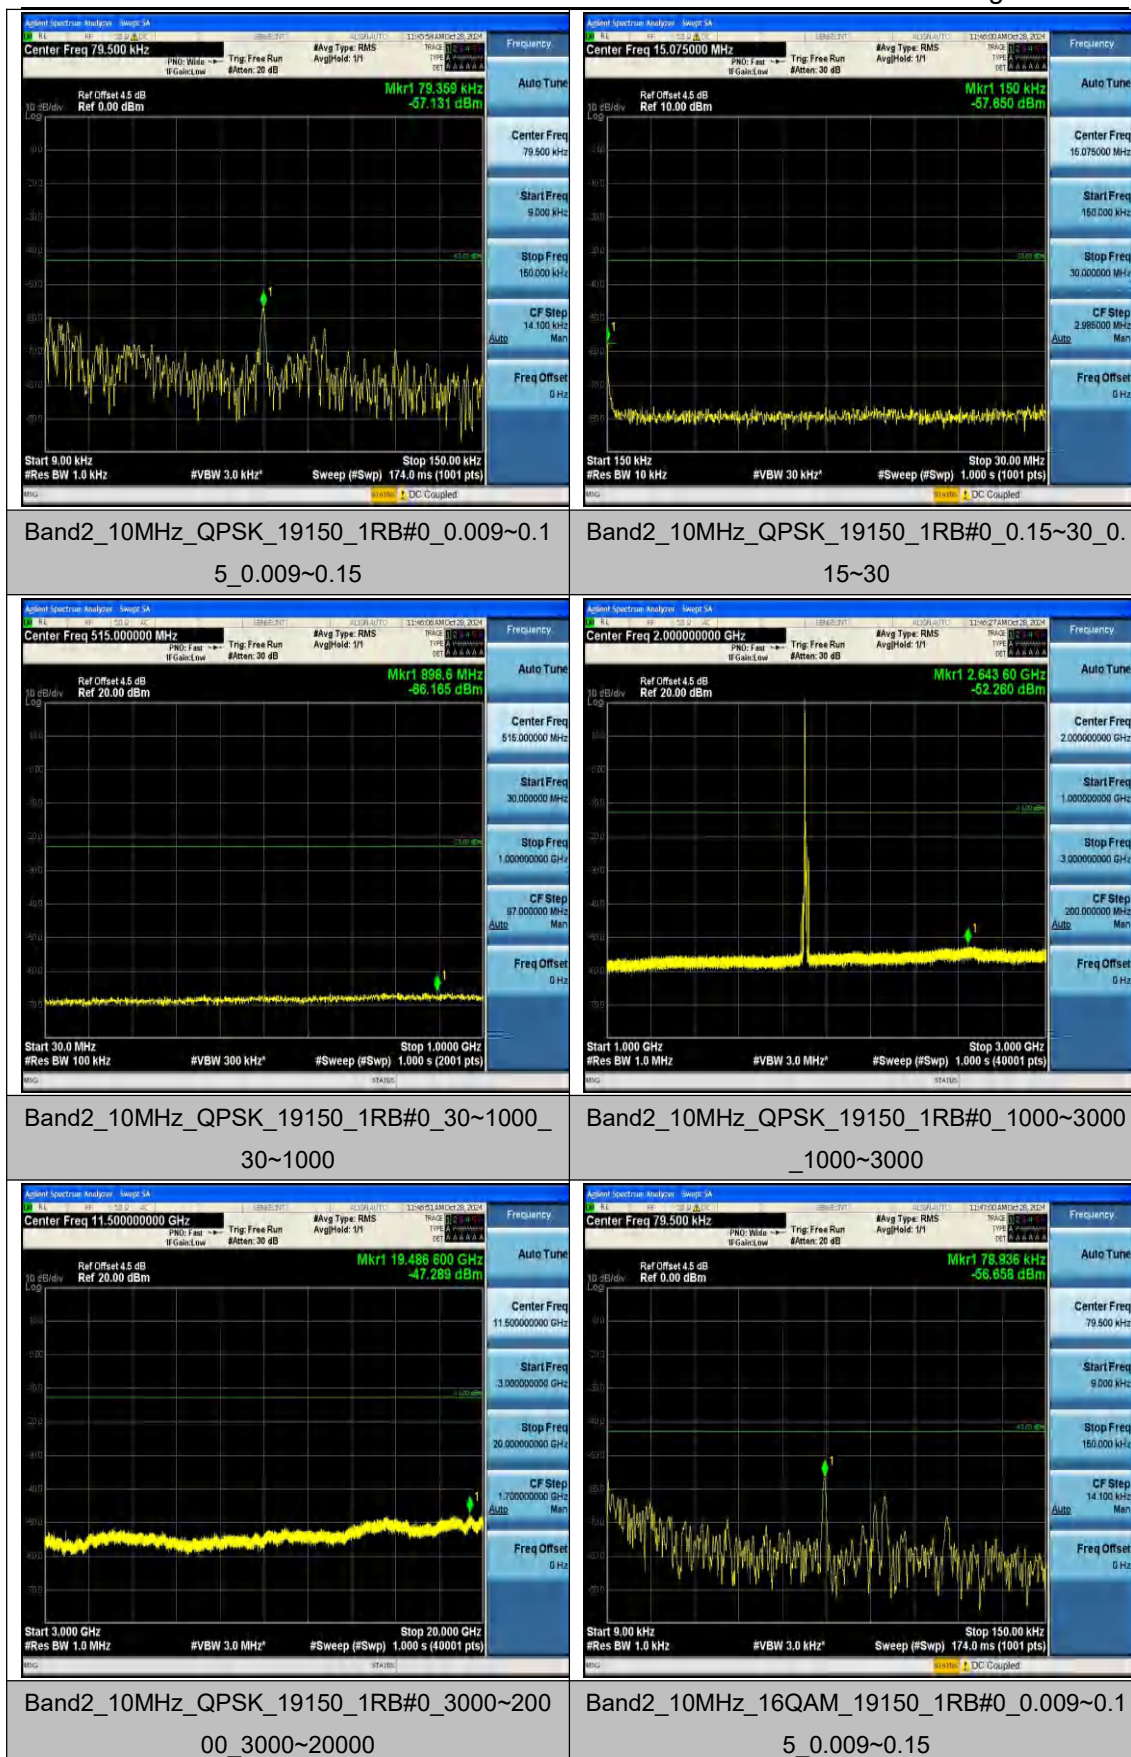

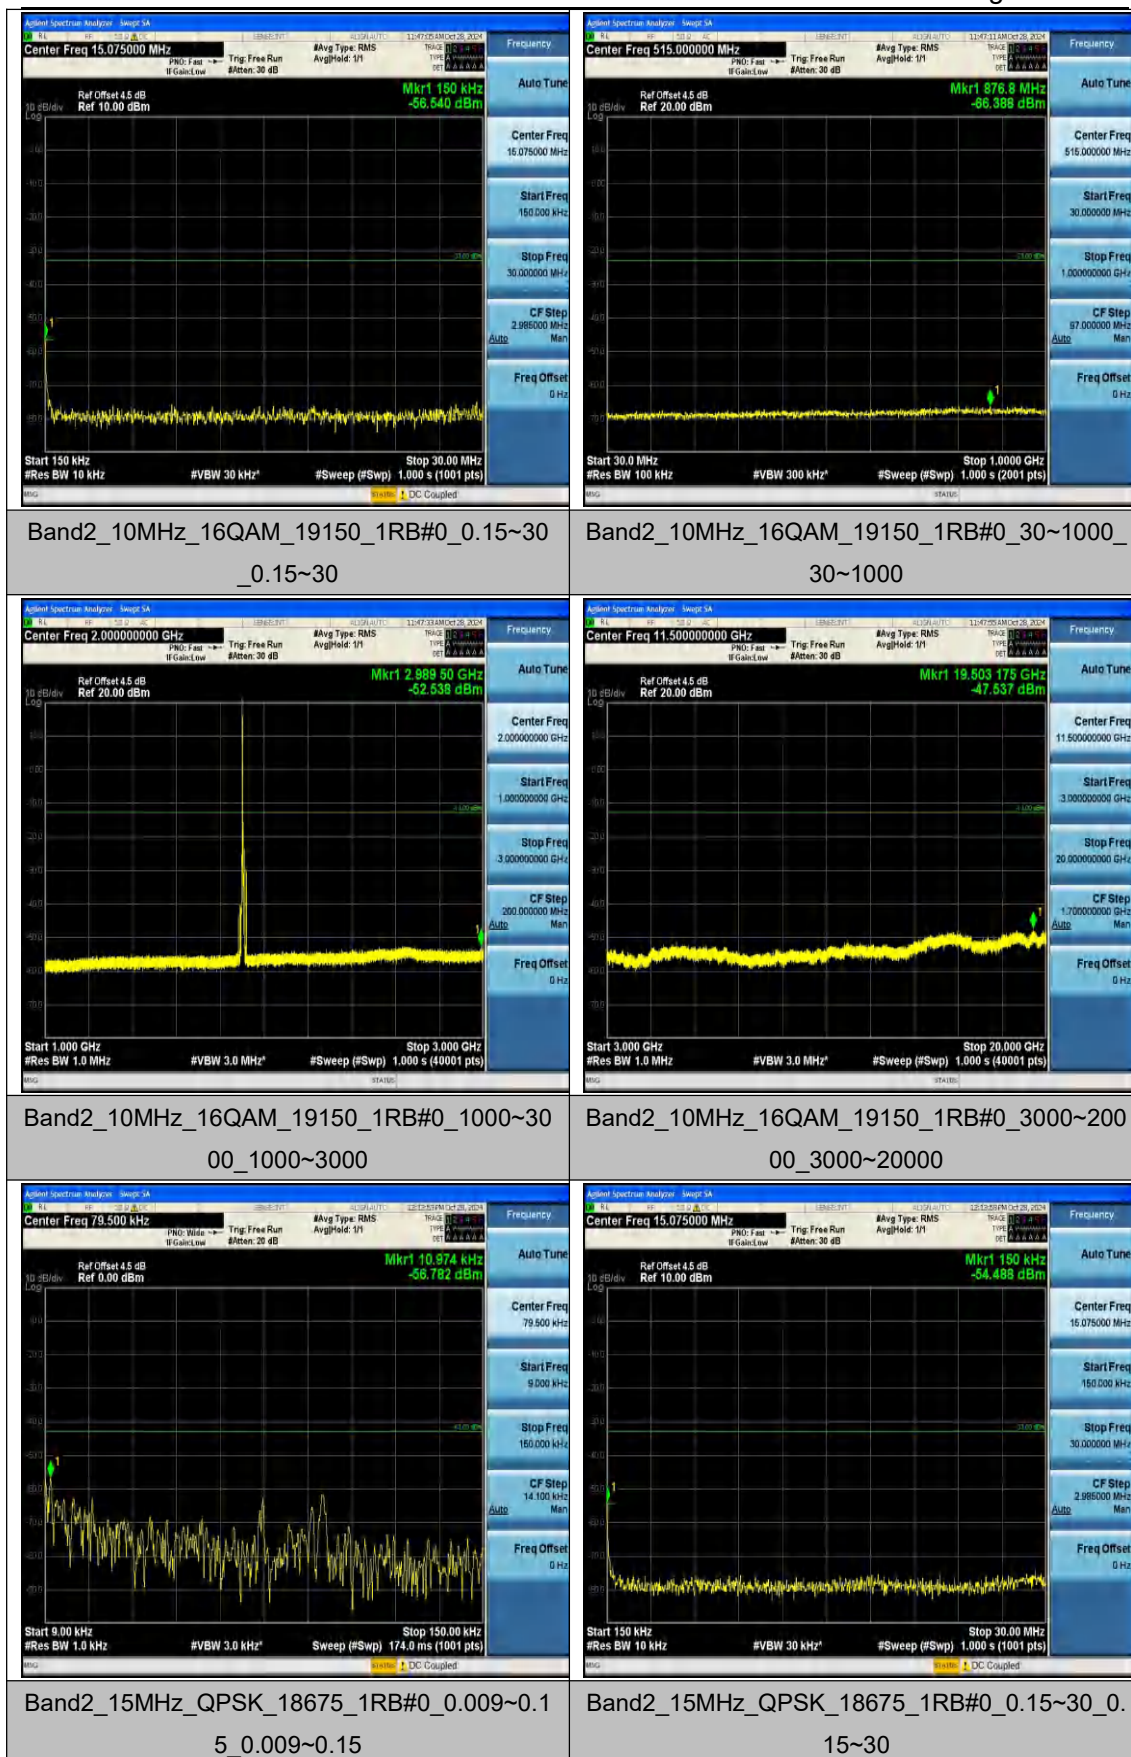

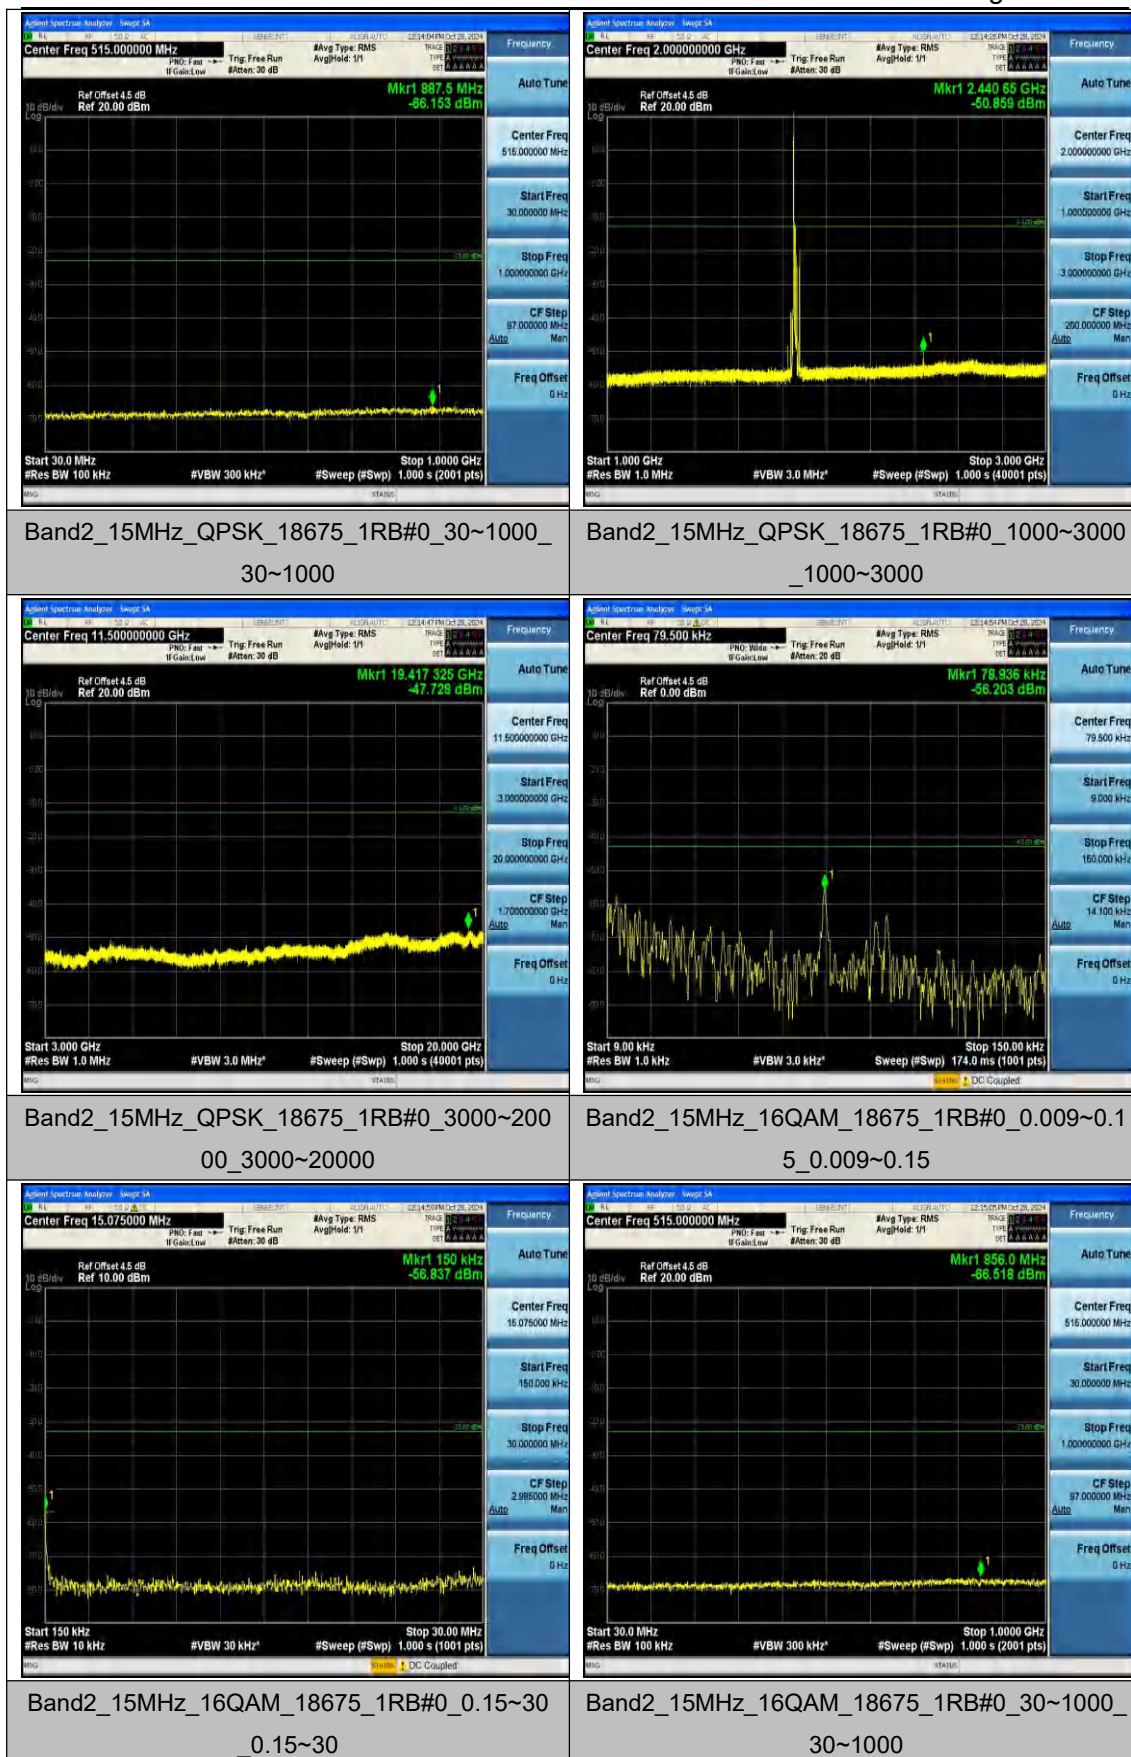

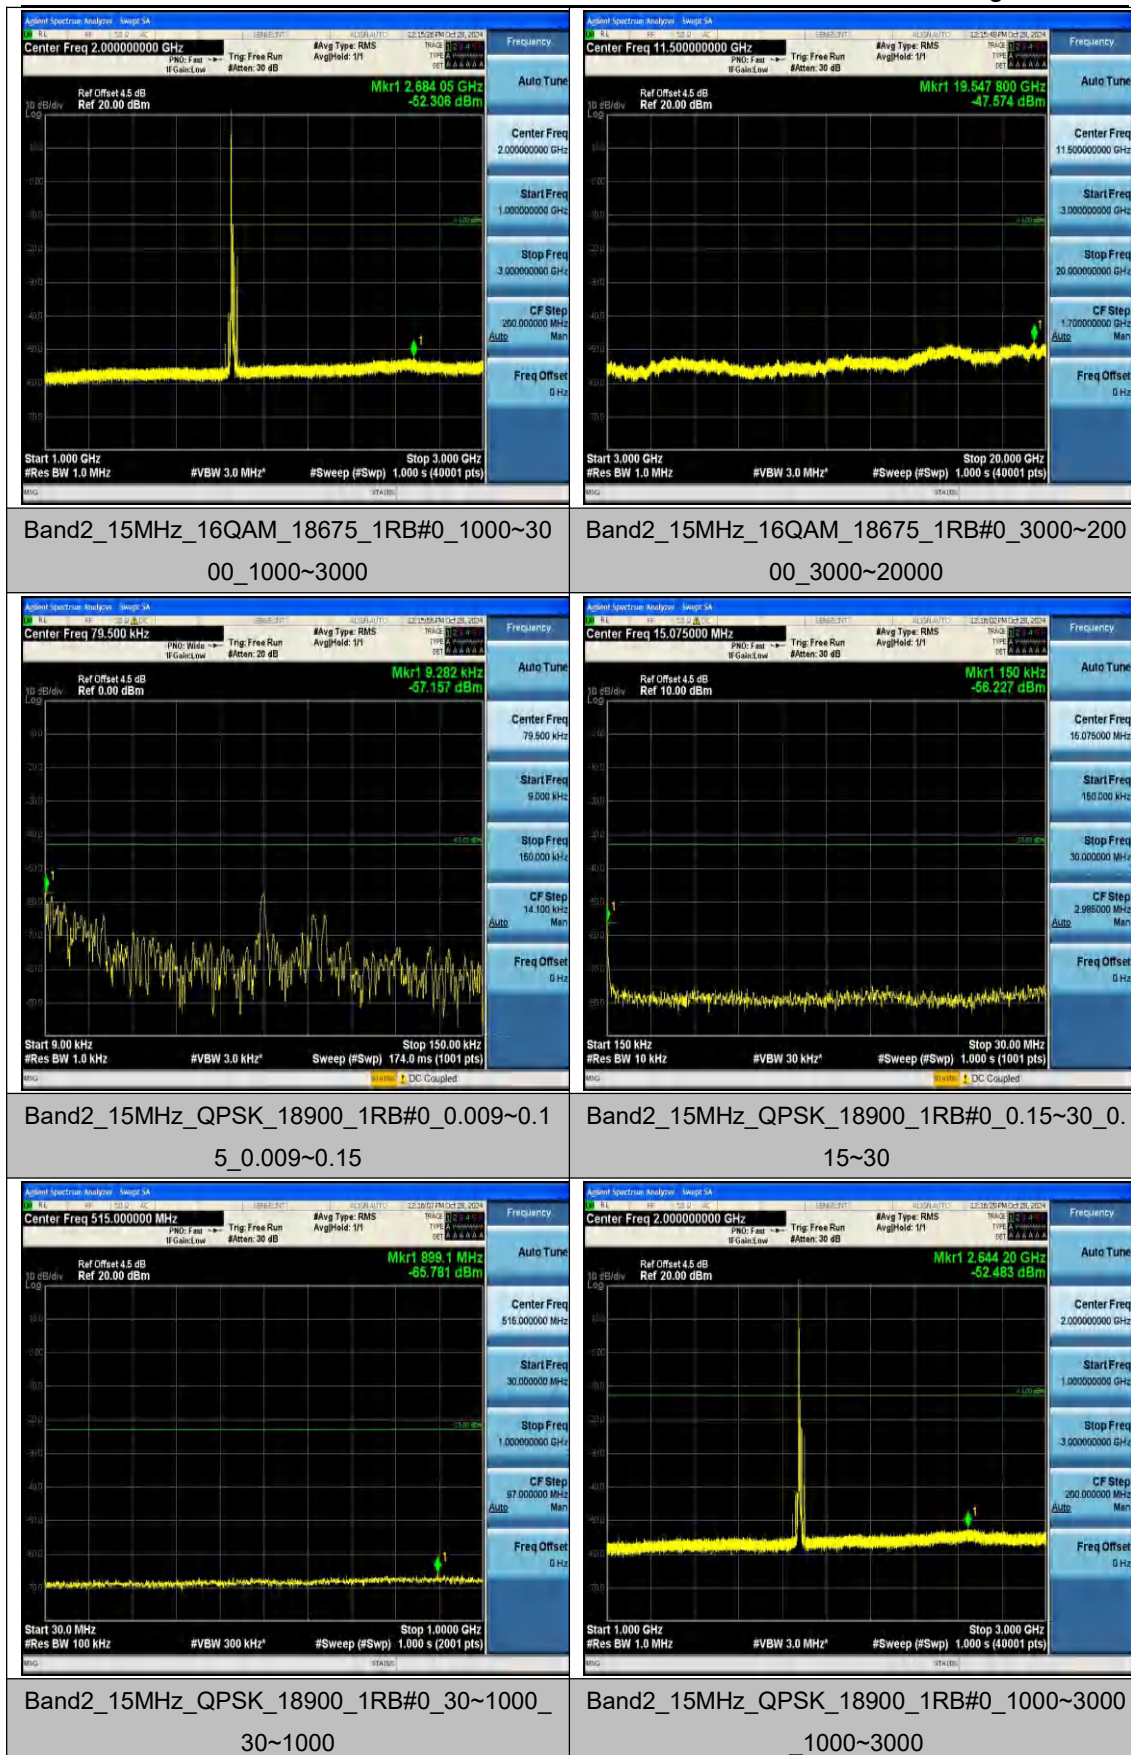



Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com



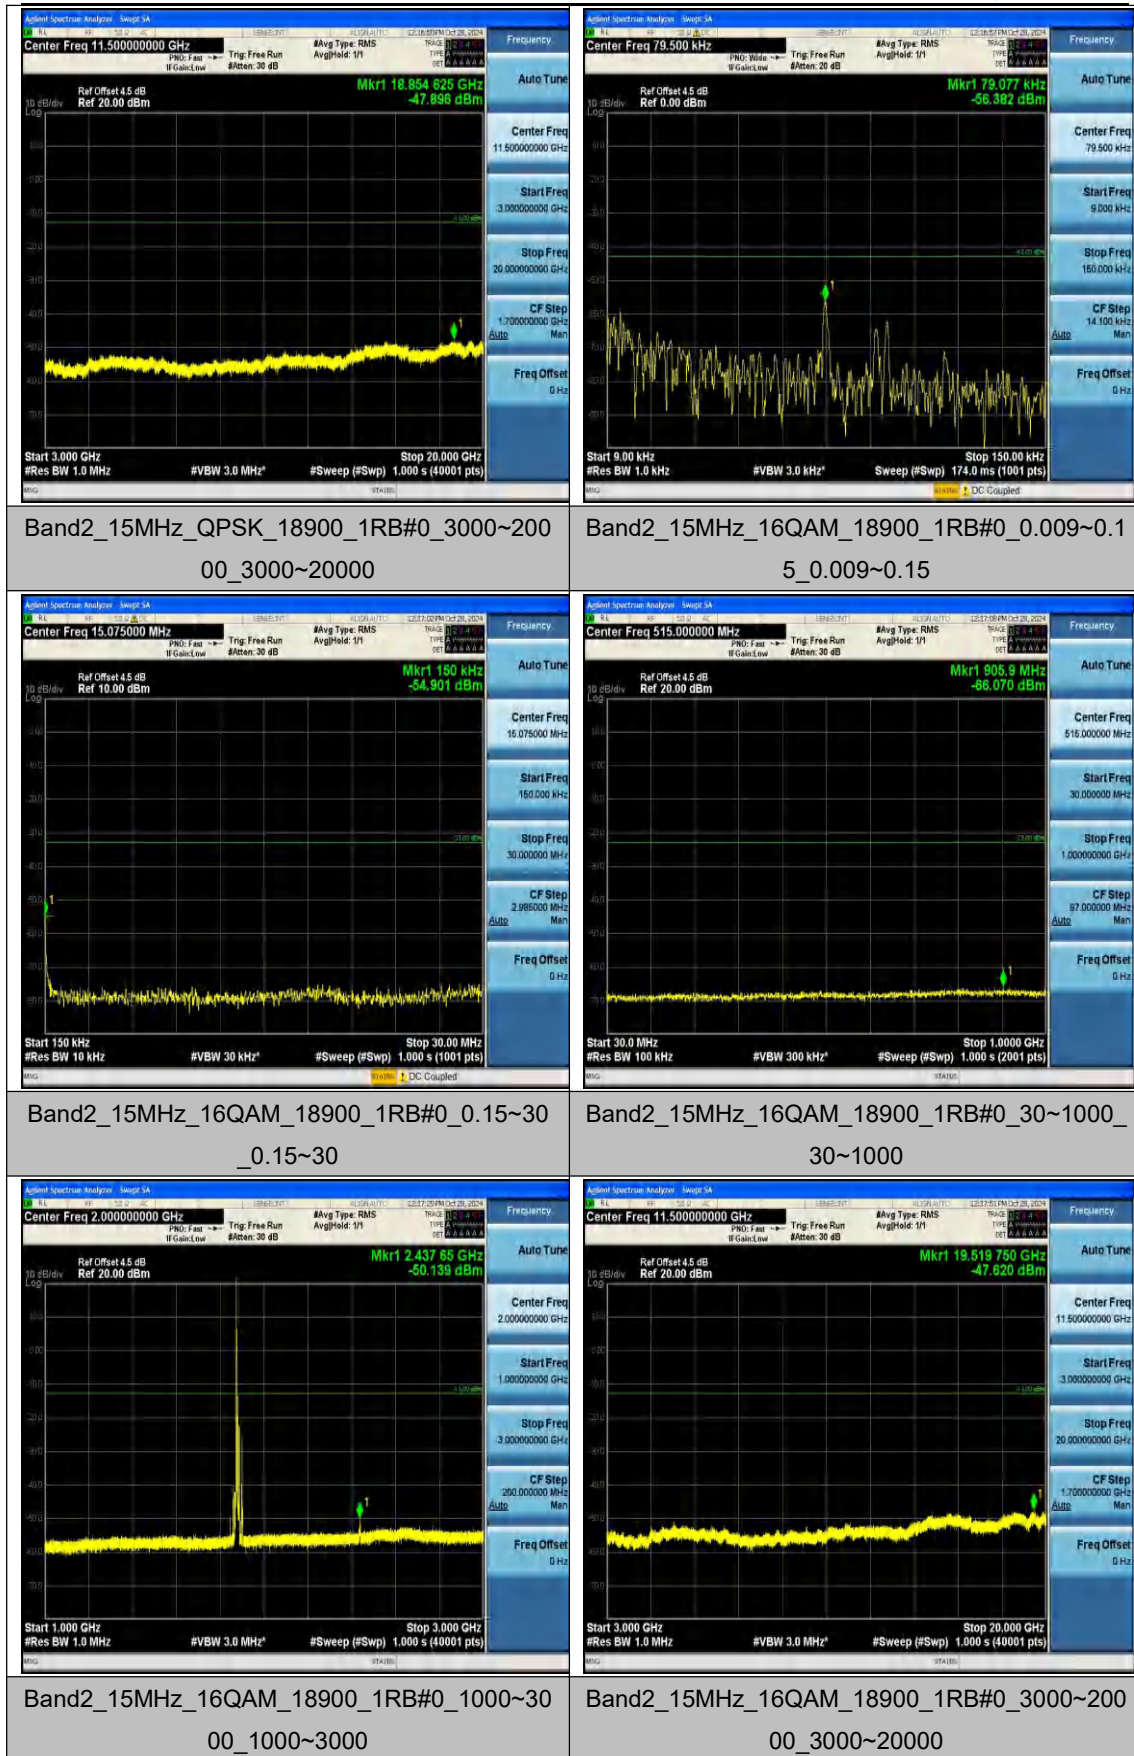

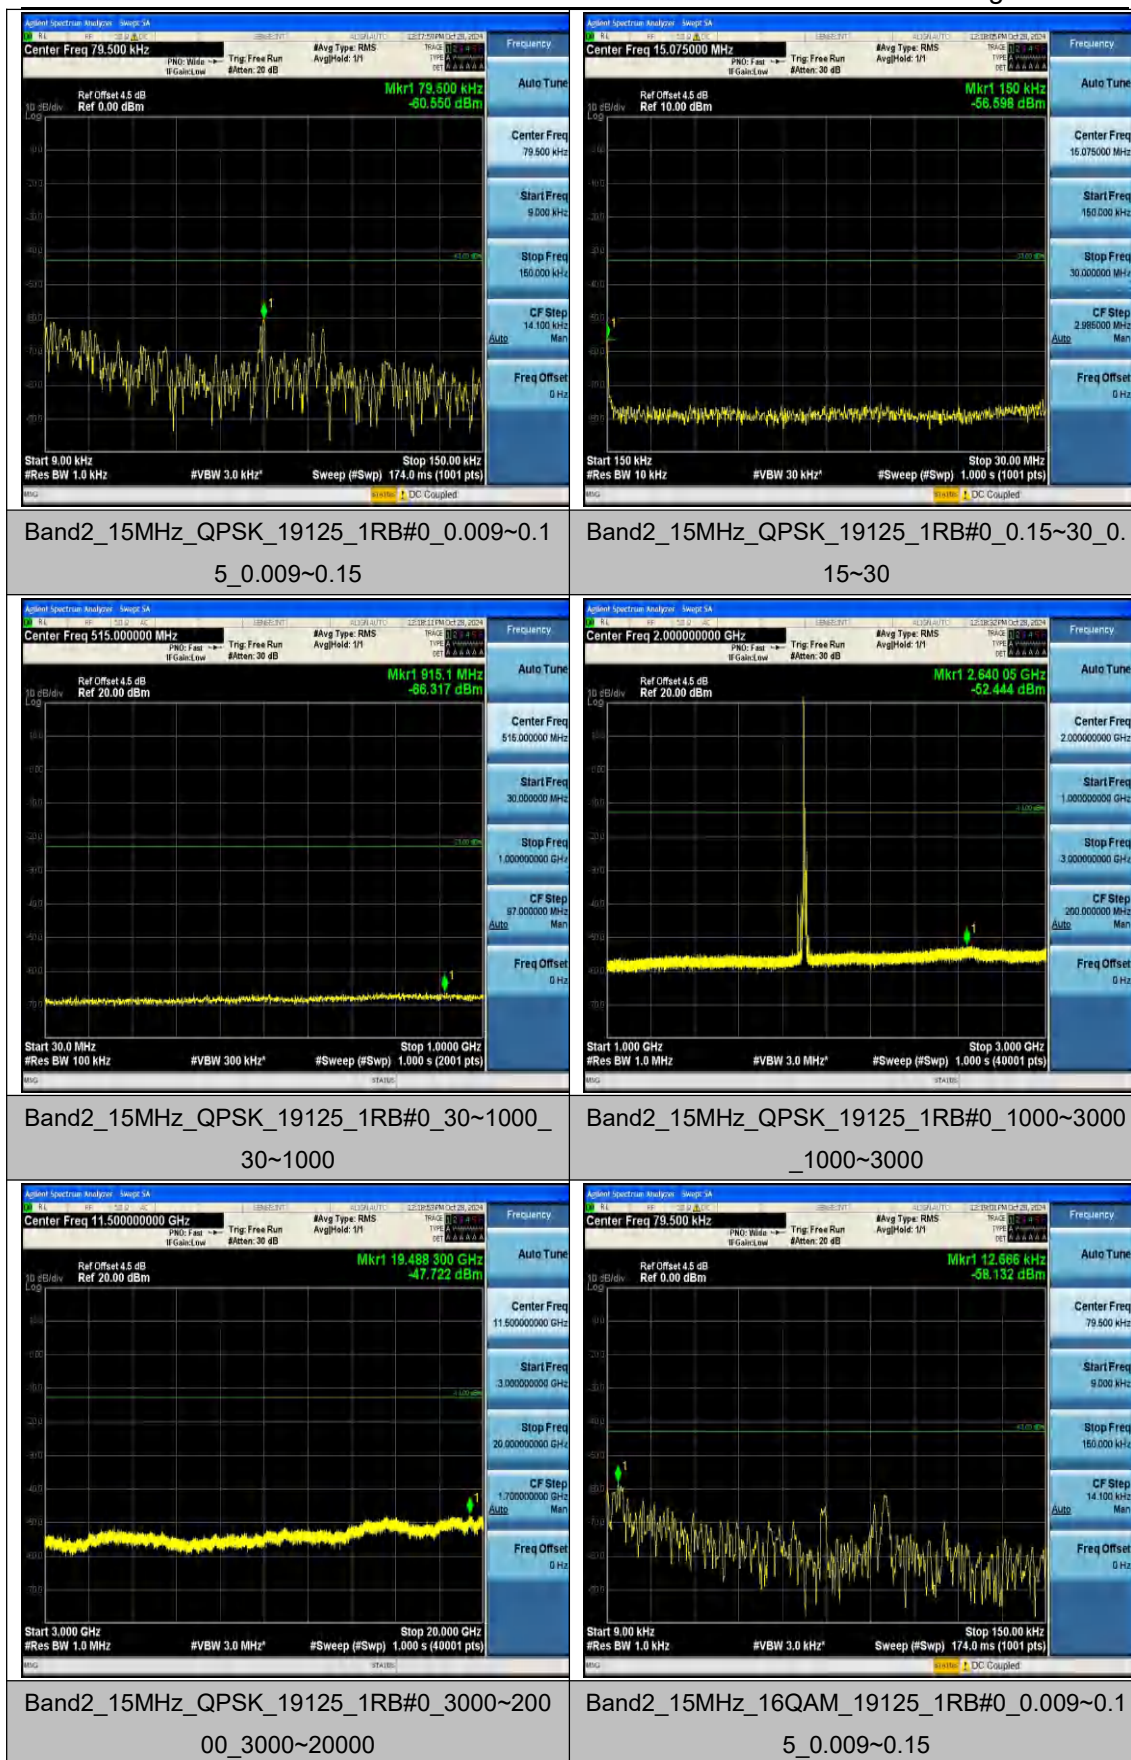

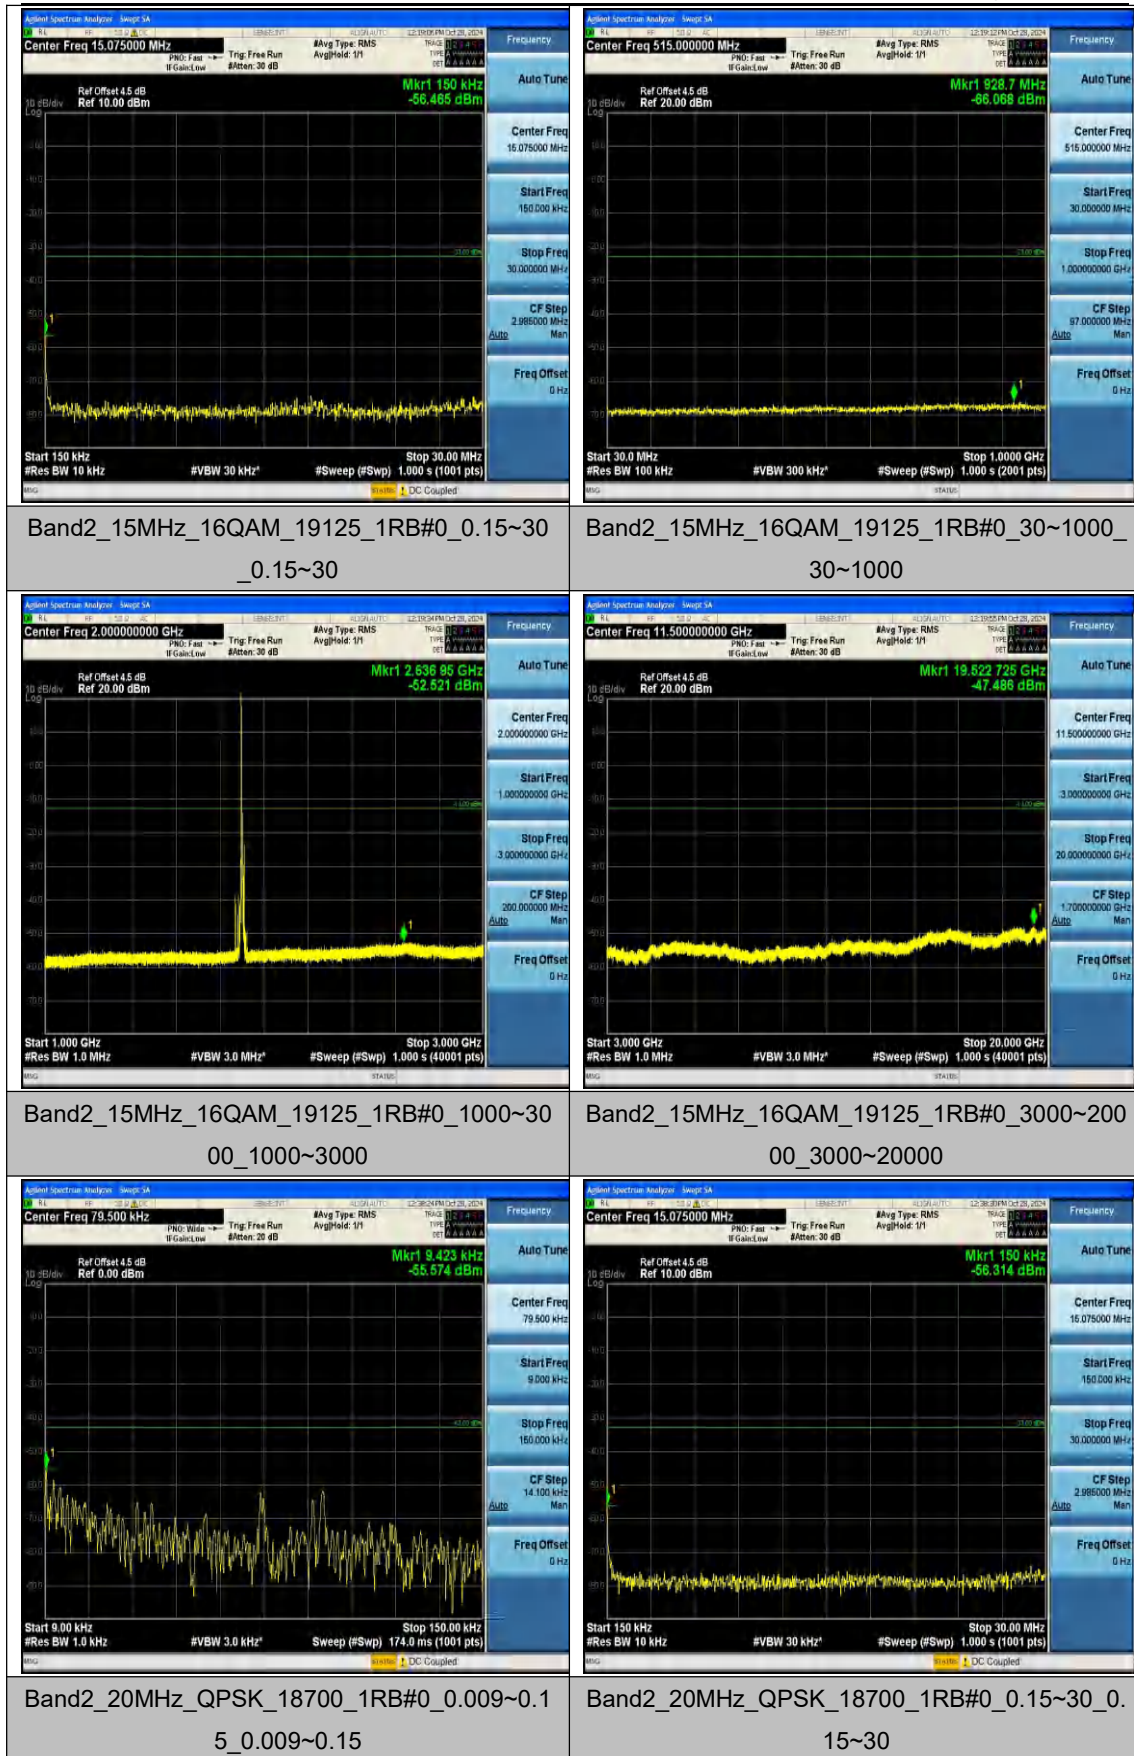

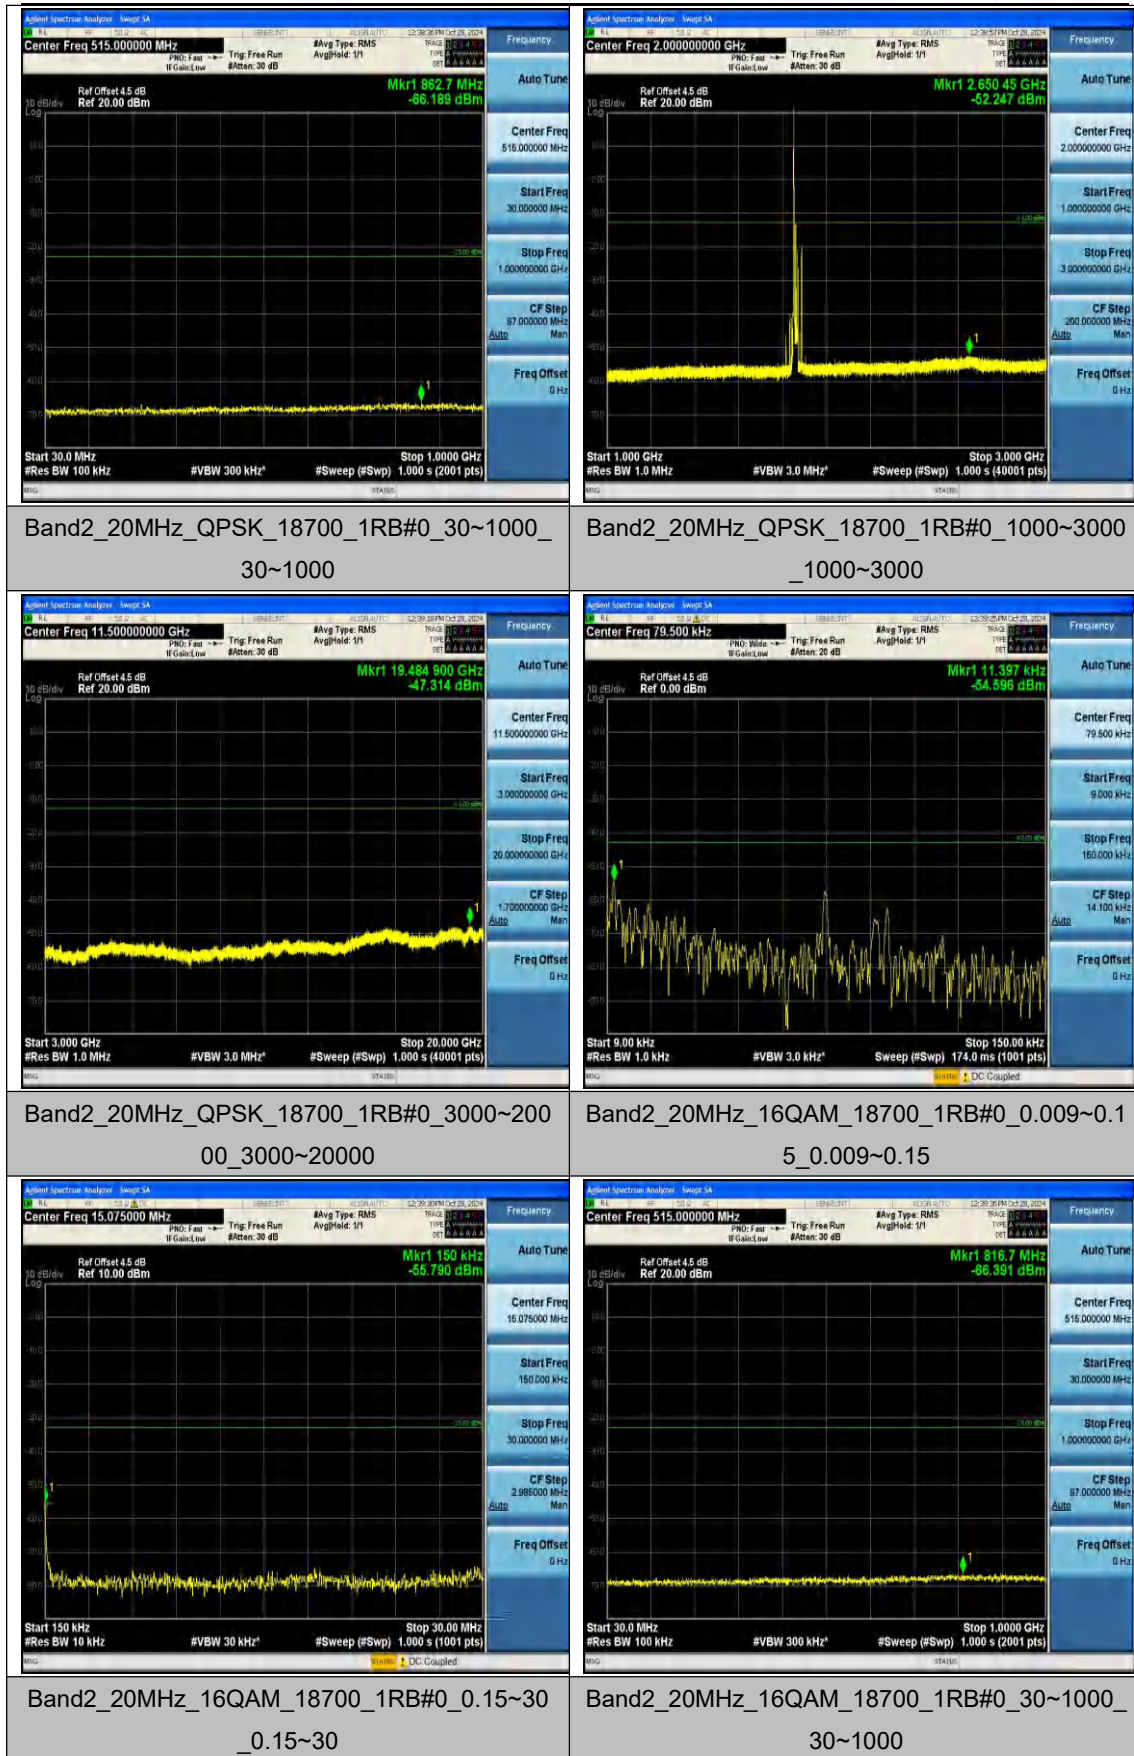



Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com



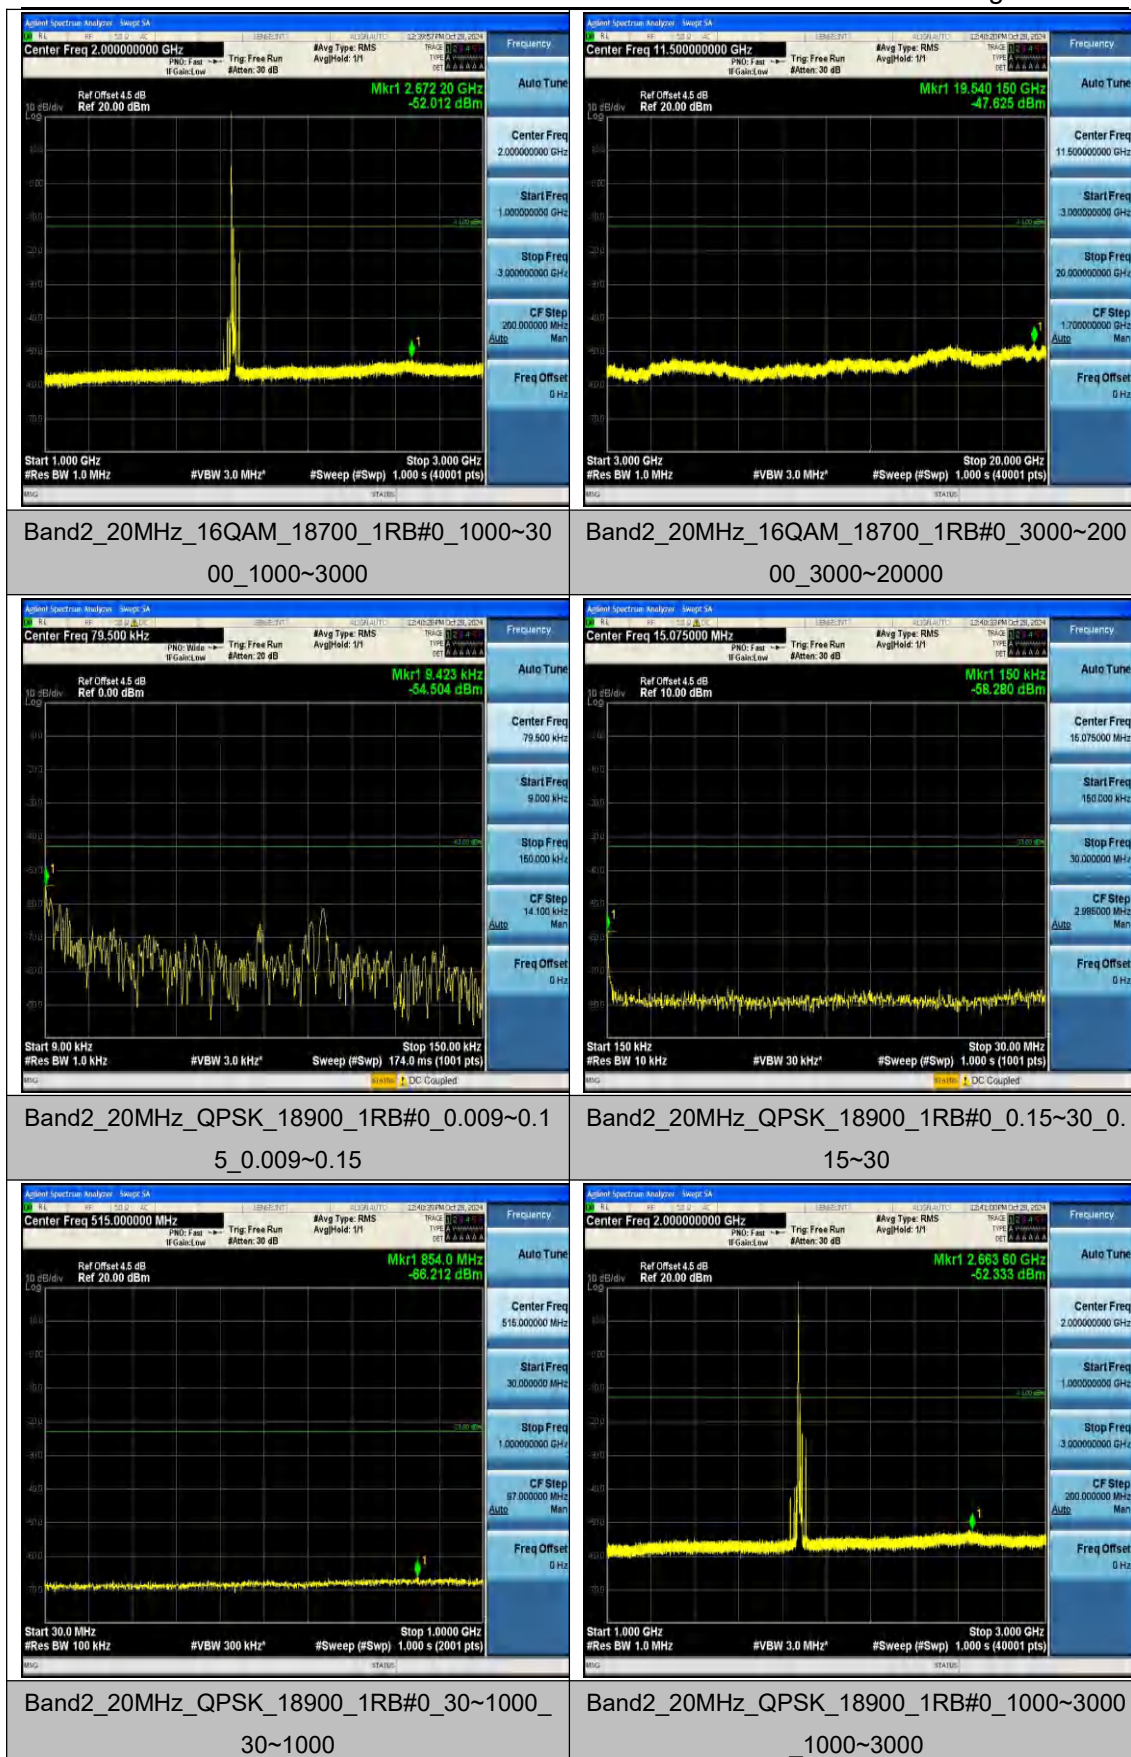

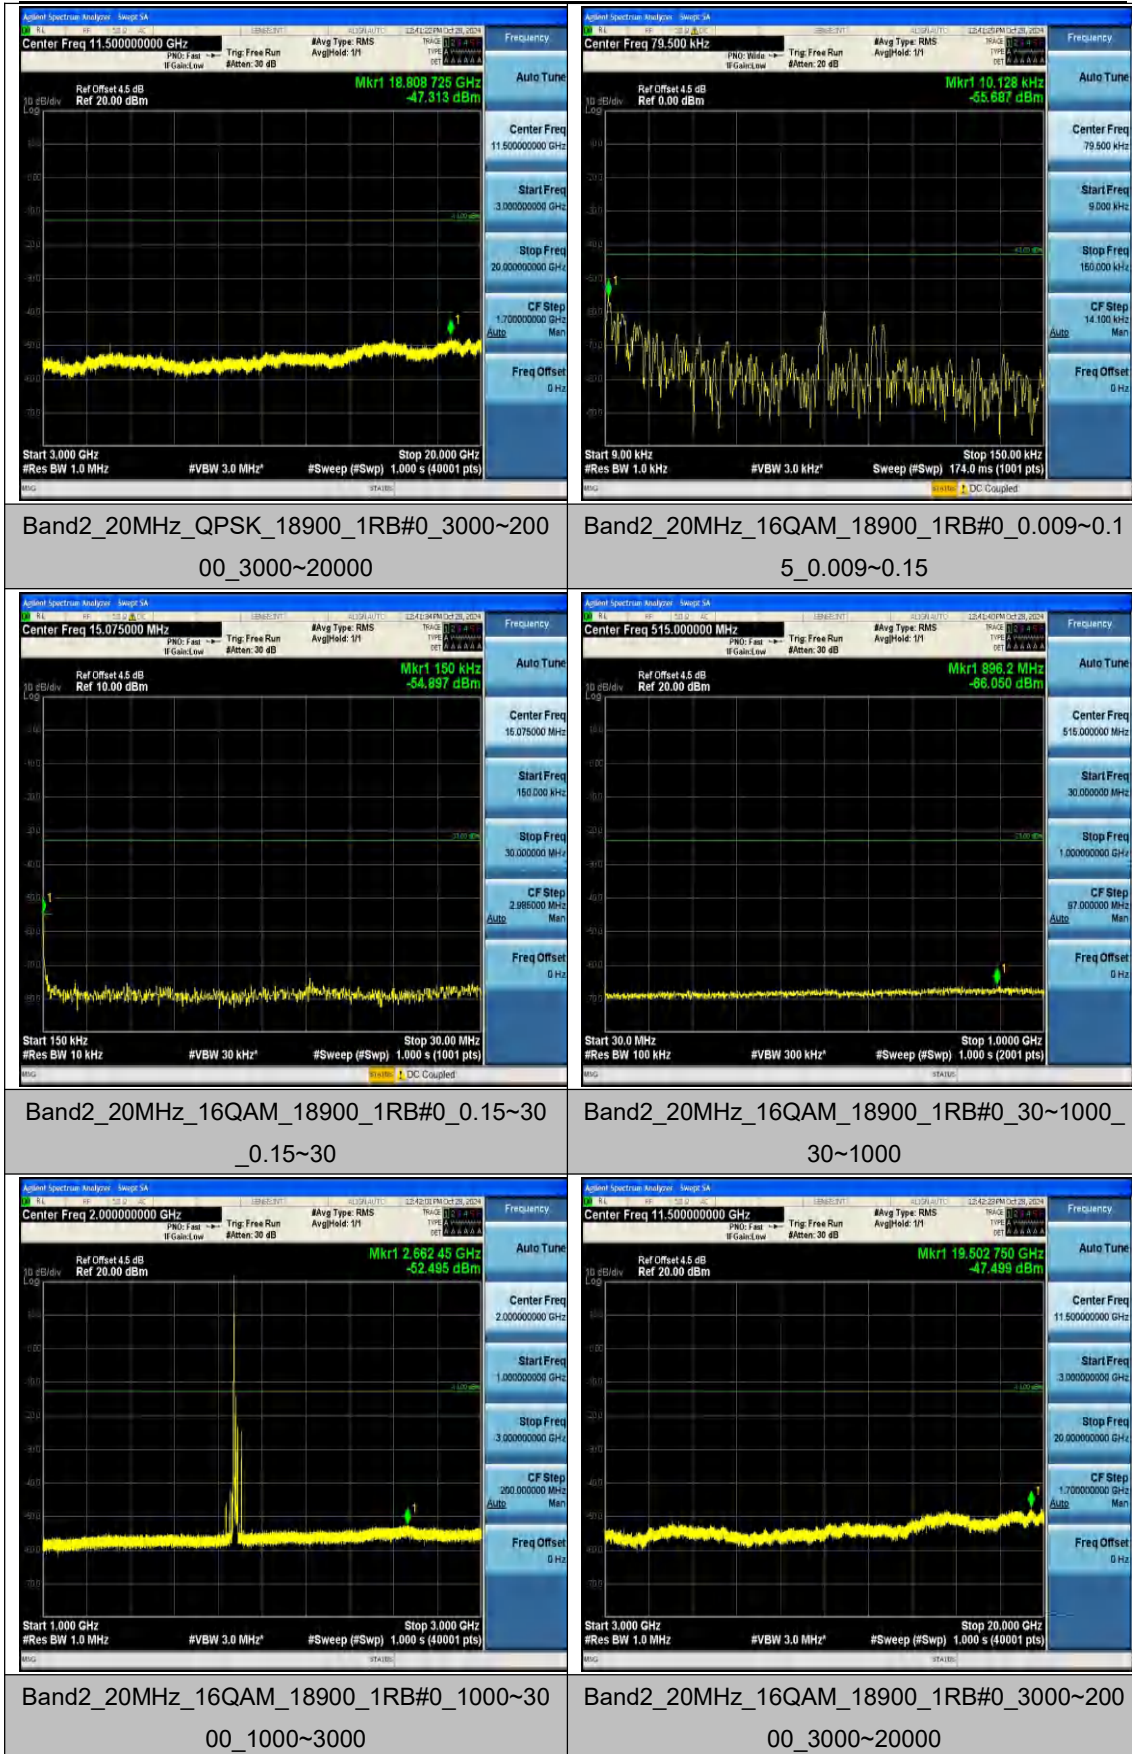



Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline 400-003-0500
www.anbotek.com



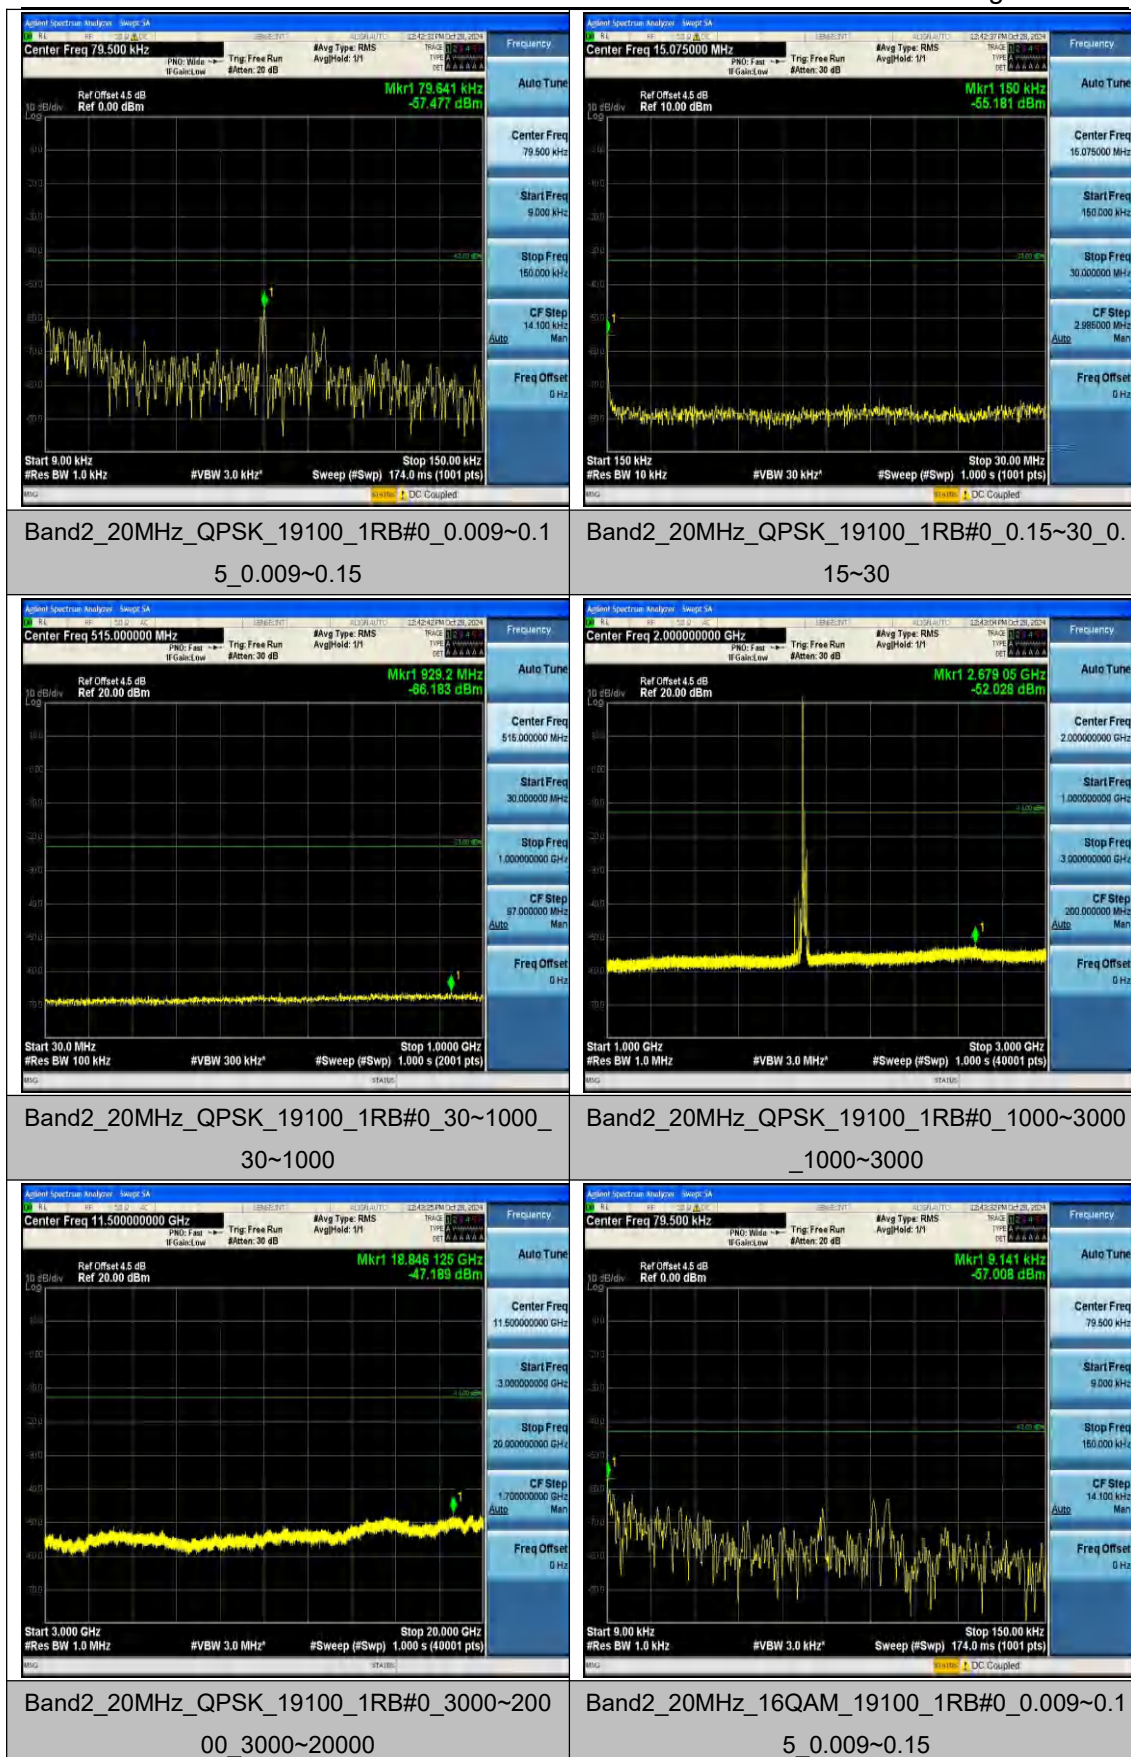

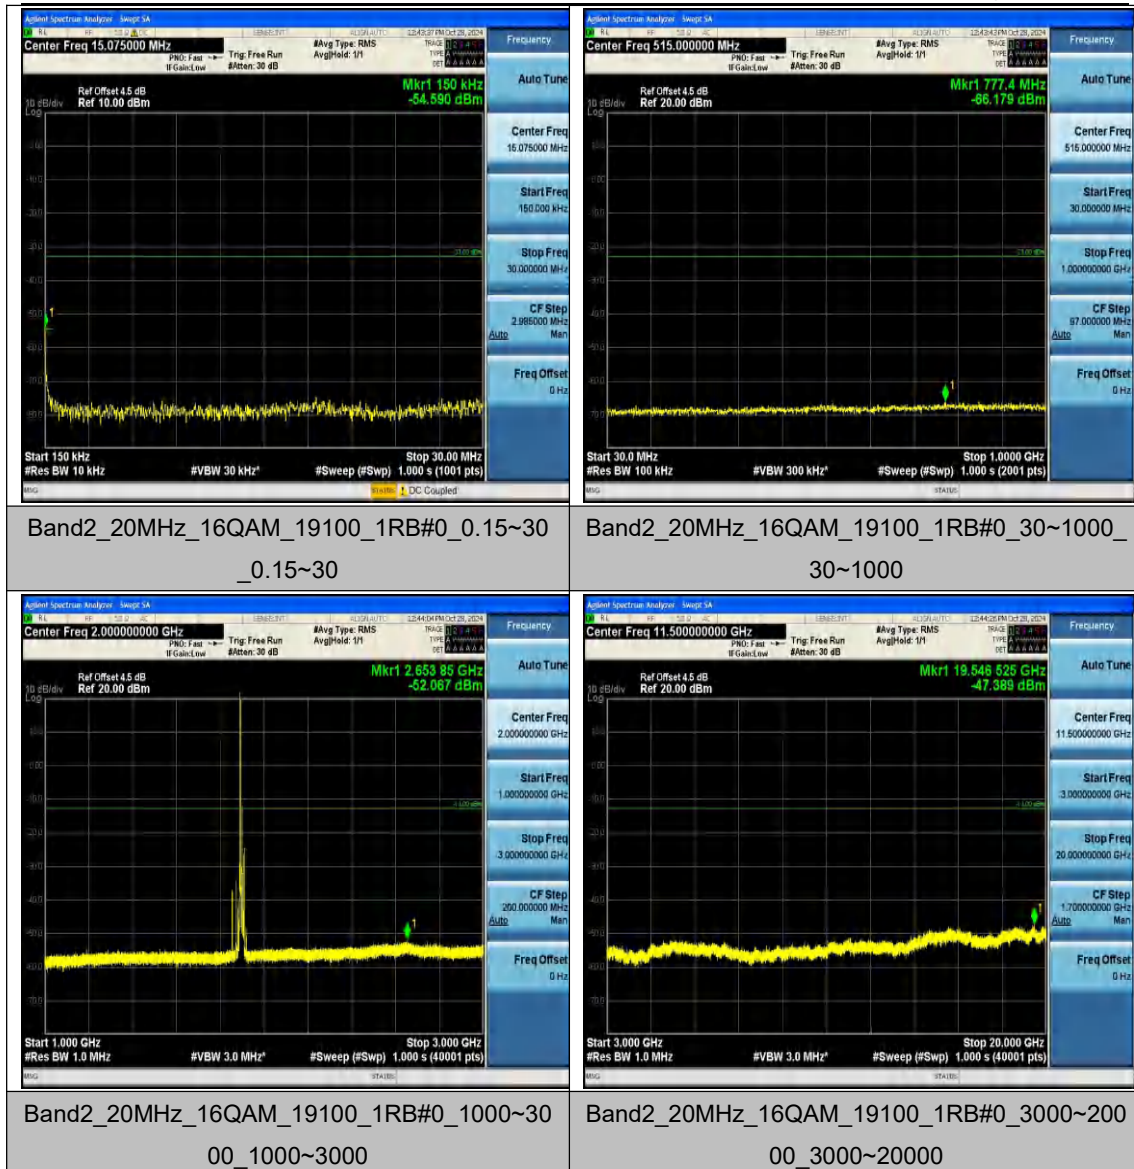

Appendix F: Frequency stability VS Voltage measurement

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage		Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
					Voltage [Vdc]	Temperature (°C)				
Band2	1.4MHz	QPSK	18607	6RB#0	VN	NT	-6.71	-0.003626	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VL	NT	-7.07	-0.003820	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VH	NT	-4.75	-0.002567	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VN	NT	-4.61	-0.002491	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VL	NT	-3.75	-0.002026	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VH	NT	-6.82	-0.003685	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VN	NT	-7.91	-0.004207	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VL	NT	-6.74	-0.003585	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VH	NT	-7.65	-0.004069	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VN	NT	-6.45	-0.003431	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VL	NT	-7.38	-0.003926	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VH	NT	-6.77	-0.003601	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VN	NT	2.47	0.001294	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VL	NT	-5.21	-0.002729	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VH	NT	-7.94	-0.004159	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VN	NT	-5.39	-0.002823	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VL	NT	3.65	0.001912	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VH	NT	0.00	0.000000	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VN	NT	-7.05	-0.003808	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VL	NT	-6.22	-0.003359	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VH	NT	-5.05	-0.002728	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VN	NT	-5.35	-0.002890	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VL	NT	-7.07	-0.003819	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VH	NT	-2.89	-0.001561	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VN	NT	-9.67	-0.005144	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VL	NT	-9.46	-0.005032	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VH	NT	-5.56	-0.002957	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VN	NT	-6.02	-0.003202	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VL	NT	-6.42	-0.003415	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VH	NT	-5.98	-0.003181	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VN	NT	3.89	0.002038	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VL	NT	-2.52	-0.001320	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VH	NT	4.02	0.002106	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	VN	NT	-4.59	-0.002405	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	VL	NT	3.92	0.002054	±2.5	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com



Hotline
400-003-0500
www.anbotech.com



Band2	3MHz	16QAM	19185	15RB#0	VH	NT	2.93	0.001535	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	VN	NT	-4.73	-0.002553	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	VL	NT	-4.46	-0.002408	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	VH	NT	-5.66	-0.003055	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VN	NT	-5.79	-0.003126	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VL	NT	-5.49	-0.002964	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VH	NT	-5.89	-0.003179	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VN	NT	-6.19	-0.003293	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VL	NT	-10.06	-0.005351	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VH	NT	-7.77	-0.004133	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VN	NT	-7.00	-0.003723	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VL	NT	-6.31	-0.003356	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VH	NT	-8.04	-0.004277	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VN	NT	3.39	0.001777	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VL	NT	3.08	0.001615	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VH	NT	-4.18	-0.002191	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VN	NT	-3.36	-0.001761	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VL	NT	-3.81	-0.001997	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VH	NT	-4.95	-0.002595	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VN	NT	-9.74	-0.005251	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VL	NT	-4.42	-0.002383	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VH	NT	-4.26	-0.002296	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	VN	NT	-5.75	-0.003100	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	VL	NT	-7.21	-0.003887	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	VH	NT	-6.01	-0.003240	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VN	NT	-6.65	-0.003537	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VL	NT	-5.76	-0.003064	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VH	NT	-6.68	-0.003553	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	VN	NT	-6.47	-0.003441	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	VL	NT	-6.42	-0.003415	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	VH	NT	-7.50	-0.003989	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VN	NT	1.66	0.000871	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VL	NT	-3.89	-0.002042	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VH	NT	3.38	0.001774	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	VN	NT	-5.62	-0.002950	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	VL	NT	3.23	0.001696	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	VH	NT	-1.90	-0.000997	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	VN	NT	-7.00	-0.003769	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	VL	NT	-6.08	-0.003273	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	VH	NT	-6.27	-0.003376	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	VN	NT	-5.87	-0.003160	±2.5	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China

Tel: (86) 0755-26066440 Email: service@anbotech.com



Hotline
400-003-0500

www.anbotech.com



Band2	15MHz	16QAM	18675	75RB#0	VL	NT	-5.06	-0.002724	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	VH	NT	-9.66	-0.005201	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	VN	NT	-5.18	-0.002755	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	VL	NT	-6.97	-0.003707	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	VH	NT	-6.88	-0.003660	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	VN	NT	-6.49	-0.003452	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	VL	NT	-6.69	-0.003559	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	VH	NT	-8.35	-0.004441	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VN	NT	-9.27	-0.004873	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VL	NT	-6.04	-0.003175	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VH	NT	-8.67	-0.004557	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	VN	NT	-4.75	-0.002497	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	VL	NT	-5.34	-0.002807	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	VH	NT	-5.39	-0.002833	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VN	NT	-5.68	-0.003054	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VL	NT	6.71	0.003608	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VH	NT	4.53	0.002435	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	VN	NT	3.32	0.001785	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	VL	NT	3.56	0.001914	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	VH	NT	5.08	0.002731	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VN	NT	-7.05	-0.003750	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VL	NT	-5.36	-0.002851	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VH	NT	-7.27	-0.003867	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	VN	NT	-7.15	-0.003803	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	VL	NT	-5.76	-0.003064	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	VH	NT	-7.74	-0.004117	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VN	NT	-5.35	-0.002816	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VL	NT	-6.41	-0.003374	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VH	NT	-7.05	-0.003711	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	VN	NT	-6.75	-0.003553	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	VL	NT	-4.25	-0.002237	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	VH	NT	-5.02	-0.002642	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86)0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com



Appendix G: Frequency stability VS Temperature

measurement

Test Result

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-30	-5.08	-0.002745	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-20	-4.99	-0.002696	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-10	-8.25	-0.004458	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	0	-3.53	-0.001907	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	10	-3.59	-0.001940	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	20	-3.02	-0.001632	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	30	-4.29	-0.002318	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	40	-3.99	-0.002156	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	50	-4.82	-0.002604	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-30	-4.55	-0.002459	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-20	-5.06	-0.002734	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-10	-4.99	-0.002696	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	0	-5.98	-0.003231	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	10	-6.18	-0.003339	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	20	-3.78	-0.002042	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	30	-6.72	-0.003631	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	40	-8.65	-0.004674	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	50	-5.89	-0.003183	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-30	-8.04	-0.004277	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-20	-6.74	-0.003585	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-10	-8.91	-0.004739	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	0	-7.27	-0.003867	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	10	-6.04	-0.003213	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	20	-9.56	-0.005085	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	30	-6.79	-0.003612	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	40	-7.15	-0.003803	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	50	-7.38	-0.003926	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-30	-11.30	-0.006011	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-20	-8.60	-0.004574	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-10	-7.91	-0.004207	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	0	-6.97	-0.003707	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	10	-5.89	-0.003133	±2.5	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com



Hotline
400-003-0500
www.anbotech.com



Band2	1.4MHz	16QAM	18900	6RB#0	NV	20	-6.02	-0.003202	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	30	-11.12	-0.005915	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	40	-7.48	-0.003979	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	50	-4.75	-0.002527	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-30	-5.46	-0.002860	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-20	4.69	0.002456	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-10	-3.82	-0.002001	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	0	-4.63	-0.002425	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	10	-5.52	-0.002891	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	20	-3.18	-0.001666	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	30	5.54	0.002902	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	40	5.35	0.002802	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	50	-5.97	-0.003127	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-30	0.00	0.000000	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-20	0.00	0.000000	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-10	0.00	0.000000	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	0	0.00	0.000000	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	10	0.00	0.000000	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	20	0.00	0.000000	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	30	0.00	0.000000	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	40	0.00	0.000000	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	50	0.00	0.000000	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-30	-6.31	-0.003408	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-20	-6.19	-0.003343	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-10	-5.94	-0.003208	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	0	-8.47	-0.004575	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	10	-3.76	-0.002031	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	20	-7.31	-0.003948	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	30	-4.98	-0.002690	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	40	-6.57	-0.003548	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	50	-7.85	-0.004240	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-30	-4.79	-0.002587	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-20	-6.32	-0.003413	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-10	-6.59	-0.003559	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	0	-6.64	-0.003586	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	10	-5.58	-0.003014	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	20	-6.82	-0.003683	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	30	-6.37	-0.003440	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	40	-2.95	-0.001593	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	50	-3.60	-0.001944	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-30	-6.32	-0.003362	±2.5	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China

Tel: (86) 0755-26066440 Email: service@anbotech.com



Hotline
400-003-0500

www.anbotech.com



Band2	3MHz	QPSK	18900	15RB#0	NV	-20	-6.11	-0.003250	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-10	-6.84	-0.003638	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	0	-6.77	-0.003601	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	10	-7.68	-0.004085	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	20	-5.39	-0.002867	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	30	-6.21	-0.003303	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	40	-9.58	-0.005096	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	50	-6.74	-0.003585	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-30	-6.22	-0.003309	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-20	-6.21	-0.003303	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-10	-7.05	-0.003750	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	0	-4.42	-0.002351	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	10	-9.33	-0.004963	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	20	-9.54	-0.005074	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	30	-5.46	-0.002904	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	40	-6.34	-0.003372	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	50	-5.29	-0.002814	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-30	2.69	0.001409	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-20	4.75	0.002489	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-10	-2.32	-0.001216	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	0	4.23	0.002216	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	10	-3.93	-0.002059	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	20	-4.86	-0.002547	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	30	6.48	0.003395	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	40	3.66	0.001918	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	50	-5.11	-0.002677	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-30	-2.15	-0.001127	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-20	-4.72	-0.002473	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-10	-5.15	-0.002698	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	0	3.62	0.001897	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	10	5.28	0.002767	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	20	4.55	0.002384	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	30	3.83	0.002007	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	40	2.59	0.001357	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	50	-5.45	-0.002856	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-30	-3.65	-0.001970	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-20	-5.51	-0.002974	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-10	-4.82	-0.002602	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	0	-5.74	-0.003099	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	10	-4.98	-0.002688	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	20	-6.42	-0.003466	±2.5	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com



Hotline
400-003-0500
www.anbotech.com



Band2	5MHz	QPSK	18625	25RB#0	NV	30	-5.25	-0.002834	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	40	-4.66	-0.002516	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	50	-4.23	-0.002283	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	-30	-4.35	-0.002348	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	-20	-8.17	-0.004410	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	-10	-6.52	-0.003520	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	0	-4.96	-0.002677	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	10	-8.87	-0.004788	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	20	-5.81	-0.003136	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	30	-6.95	-0.003752	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	40	-9.94	-0.005366	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	50	-8.10	-0.004372	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-30	-8.30	-0.004415	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-20	-8.18	-0.004351	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-10	-6.12	-0.003255	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	0	-6.21	-0.003303	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	10	-7.70	-0.004096	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	20	-5.97	-0.003176	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	30	-5.68	-0.003021	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	40	-5.89	-0.003133	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	50	-7.87	-0.004186	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-30	-6.79	-0.003612	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-20	-9.51	-0.005059	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-10	-8.57	-0.004559	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	0	-7.41	-0.003941	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	10	-7.15	-0.003803	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	20	-7.68	-0.004085	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	30	-5.24	-0.002787	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	40	-6.82	-0.003628	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	50	-4.36	-0.002319	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-30	2.17	0.001138	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-20	-4.85	-0.002543	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-10	6.55	0.003434	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	0	-4.32	-0.002265	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	10	-3.46	-0.001814	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	20	4.66	0.002443	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	30	-5.87	-0.003077	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	40	-3.55	-0.001861	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	50	-5.05	-0.002647	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-30	2.62	0.001374	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-20	-3.36	-0.001761	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China

Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500

www.anbotek.com



Band2	5MHz	16QAM	19175	25RB#0	NV	-10	-6.87	-0.003602	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	0	4.43	0.002322	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	10	-4.18	-0.002191	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	20	-5.09	-0.002668	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	30	-2.23	-0.001169	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	40	-2.79	-0.001463	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	50	4.82	0.002527	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-30	-6.48	-0.003493	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-20	-6.94	-0.003741	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-10	-6.55	-0.003531	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	0	-7.64	-0.004119	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	10	-5.49	-0.002960	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	20	-5.15	-0.002776	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	30	-6.67	-0.003596	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	40	-7.58	-0.004086	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	50	-3.49	-0.001881	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-30	-5.41	-0.002916	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-20	-6.17	-0.003326	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-10	-5.68	-0.003062	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	0	-7.95	-0.004286	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	10	-6.11	-0.003294	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	20	-4.73	-0.002550	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	30	-5.61	-0.003024	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	40	-7.04	-0.003795	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	50	-6.51	-0.003509	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-30	-6.52	-0.003468	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-20	-5.45	-0.002899	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-10	-6.68	-0.003553	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	0	-6.75	-0.003590	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	10	-4.73	-0.002516	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	20	-5.16	-0.002745	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	30	-5.46	-0.002904	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	40	-6.74	-0.003585	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	50	-8.50	-0.004521	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-30	-6.88	-0.003660	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-20	-8.30	-0.004415	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-10	-5.08	-0.002702	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	0	-6.67	-0.003548	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	10	-7.60	-0.004043	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	20	-6.22	-0.003309	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	30	-7.97	-0.004239	±2.5	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com



Hotline
400-003-0500
www.anbotech.com



Band2	10MHz	16QAM	18900	50RB#0	NV	40	-4.98	-0.002649	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	50	-7.44	-0.003957	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-30	3.59	0.001885	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-20	2.82	0.001480	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-10	-3.00	-0.001575	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	0	5.14	0.002698	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	10	2.23	0.001171	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	20	-3.05	-0.001601	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	30	4.29	0.002252	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	40	-4.65	-0.002441	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	50	3.62	0.001900	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	-30	-3.06	-0.001606	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	-20	4.69	0.002462	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	-10	3.95	0.002073	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	0	5.21	0.002735	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	10	4.86	0.002551	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	20	6.64	0.003486	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	30	-2.07	-0.001087	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	40	3.55	0.001864	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	50	3.36	0.001764	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-30	-6.17	-0.003322	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-20	-5.88	-0.003166	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-10	-5.62	-0.003026	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	0	-6.64	-0.003575	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	10	-4.71	-0.002536	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	20	-6.55	-0.003526	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	30	-6.11	-0.003289	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	40	-6.54	-0.003521	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	50	-3.69	-0.001987	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	-30	-6.22	-0.003349	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	-20	-4.35	-0.002342	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	-10	-4.59	-0.002471	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	0	-5.42	-0.002918	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	10	-6.55	-0.003526	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	20	-5.68	-0.003058	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	30	-5.26	-0.002832	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	40	-4.99	-0.002686	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	50	-6.57	-0.003537	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-30	-5.61	-0.002984	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-20	-6.01	-0.003197	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-10	-7.61	-0.004048	±2.5	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China

Tel: (86) 0755-26066440 Email: service@anbotech.com



Hotline
400-003-0500

www.anbotech.com



Band2	15MHz	QPSK	18900	75RB#0	NV	0	-9.78	-0.005202	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	10	-7.44	-0.003957	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	20	-7.38	-0.003926	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	30	-9.03	-0.004803	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	40	-4.25	-0.002261	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	50	-7.97	-0.004239	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	-30	-7.10	-0.003777	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	-20	-6.65	-0.003537	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	-10	-9.18	-0.004883	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	0	-6.18	-0.003287	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	10	-6.61	-0.003516	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	20	-5.71	-0.003037	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	30	-7.02	-0.003734	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	40	-6.18	-0.003287	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	50	-6.90	-0.003670	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-30	-4.94	-0.002597	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-20	-6.67	-0.003506	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-10	-7.04	-0.003700	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	0	-7.61	-0.004000	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	10	-5.99	-0.003148	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	20	-6.44	-0.003385	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	30	-6.82	-0.003585	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	40	-7.00	-0.003679	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	50	-5.74	-0.003017	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	-30	-5.68	-0.002986	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	-20	-6.24	-0.003280	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	-10	-5.84	-0.003070	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	0	-5.05	-0.002654	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	10	-9.70	-0.005099	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	20	-7.85	-0.004126	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	30	-6.21	-0.003264	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	40	-4.88	-0.002565	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	50	-7.34	-0.003858	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-30	4.59	0.002468	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-20	7.97	0.004285	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-10	6.45	0.003468	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	0	4.75	0.002554	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	10	3.09	0.001661	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	20	4.23	0.002274	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	30	3.85	0.002070	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	40	4.43	0.002382	±2.5	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com



Hotline
400-003-0500
www.anbotech.com



Band2	20MHz	QPSK	18700	100RB#0	NV	50	-3.55	-0.001909	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	-30	7.72	0.004151	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	-20	6.02	0.003237	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	-10	4.23	0.002274	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	0	3.19	0.001715	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	10	3.60	0.001935	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	20	4.09	0.002199	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	30	5.78	0.003108	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	40	5.19	0.002790	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	50	5.04	0.002710	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-30	-2.98	-0.001585	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-20	-6.81	-0.003622	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-10	-5.39	-0.002867	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	0	-5.12	-0.002723	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	10	-8.28	-0.004404	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	20	-6.09	-0.003239	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	30	-4.71	-0.002505	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	40	-7.35	-0.003910	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	50	-5.69	-0.003027	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	-30	-3.40	-0.001809	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	-20	-5.92	-0.003149	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	-10	-6.49	-0.003452	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	0	-6.21	-0.003303	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	10	-6.62	-0.003521	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	20	-5.54	-0.002947	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	30	-5.85	-0.003112	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	40	-5.45	-0.002899	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	50	-6.31	-0.003356	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-30	-6.47	-0.003405	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-20	-6.91	-0.003637	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-10	-5.42	-0.002853	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	0	-5.18	-0.002726	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	10	-4.94	-0.002600	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	20	-3.66	-0.001926	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	30	-5.61	-0.002953	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	40	-5.26	-0.002768	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	50	-7.61	-0.004005	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	-30	-5.69	-0.002995	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	-20	-5.31	-0.002795	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	-10	-5.71	-0.003005	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	0	-5.68	-0.002989	±2.5	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86)0755-26066440 Email: service@anbotech.com



Hotline
400-003-0500
www.anbotech.com



Band2	20MHz	16QAM	19100	100RB#0	NV	10	-4.61	-0.002426	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	20	-6.69	-0.003521	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	30	-4.72	-0.002484	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	40	-5.75	-0.003026	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	50	-6.45	-0.003395	±2.5	PASS

---END---

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

