



Band2	3MHz	QPSK	18900	1RB#0	1000~3000	-28.24	PASS
Band2	3MHz	QPSK	18900	1RB#0	3000~20000	-32.93	PASS
Band2	3MHz	16QAM	18900	1RB#0	0.009~0.15	-56.49	PASS
Band2	3MHz	16QAM	18900	1RB#0	0.15~30	-51.90	PASS
Band2	3MHz	16QAM	18900	1RB#0	30~1000	-62.29	PASS
Band2	3MHz	16QAM	18900	1RB#0	1000~3000	-28.59	PASS
Band2	3MHz	16QAM	18900	1RB#0	3000~20000	-32.97	PASS
Band2	3MHz	QPSK	19185	1RB#0	0.009~0.15	-58.18	PASS
Band2	3MHz	QPSK	19185	1RB#0	0.15~30	-52.72	PASS
Band2	3MHz	QPSK	19185	1RB#0	30~1000	-62.22	PASS
Band2	3MHz	QPSK	19185	1RB#0	1000~3000	-27.22	PASS
Band2	3MHz	QPSK	19185	1RB#0	3000~20000	-33.34	PASS
Band2	3MHz	16QAM	19185	1RB#0	0.009~0.15	-58.59	PASS
Band2	3MHz	16QAM	19185	1RB#0	0.15~30	-50.66	PASS
Band2	3MHz	16QAM	19185	1RB#0	30~1000	-62.30	PASS
Band2	3MHz	16QAM	19185	1RB#0	1000~3000	-27.05	PASS
Band2	3MHz	16QAM	19185	1RB#0	3000~20000	-33.03	PASS
Band2	5MHz	QPSK	18625	1RB#0	0.009~0.15	-57.53	PASS
Band2	5MHz	QPSK	18625	1RB#0	0.15~30	-52.05	PASS
Band2	5MHz	QPSK	18625	1RB#0	30~1000	-62.11	PASS
Band2	5MHz	QPSK	18625	1RB#0	1000~3000	-38.68	PASS
Band2	5MHz	QPSK	18625	1RB#0	3000~20000	-33.18	PASS
Band2	5MHz	16QAM	18625	1RB#0	0.009~0.15	-58.52	PASS
Band2	5MHz	16QAM	18625	1RB#0	0.15~30	-52.25	PASS
Band2	5MHz	16QAM	18625	1RB#0	30~1000	-62.12	PASS
Band2	5MHz	16QAM	18625	1RB#0	1000~3000	-40.20	PASS
Band2	5MHz	16QAM	18625	1RB#0	3000~20000	-33.41	PASS
Band2	5MHz	QPSK	18900	1RB#0	0.009~0.15	-55.03	PASS
Band2	5MHz	QPSK	18900	1RB#0	0.15~30	-53.18	PASS
Band2	5MHz	QPSK	18900	1RB#0	30~1000	-62.08	PASS
Band2	5MHz	QPSK	18900	1RB#0	1000~3000	-39.86	PASS
Band2	5MHz	QPSK	18900	1RB#0	3000~20000	-33.28	PASS
Band2	5MHz	16QAM	18900	1RB#0	0.009~0.15	-56.34	PASS
Band2	5MHz	16QAM	18900	1RB#0	0.15~30	-53.32	PASS
Band2	5MHz	16QAM	18900	1RB#0	30~1000	-62.24	PASS
Band2	5MHz	16QAM	18900	1RB#0	1000~3000	-39.91	PASS
Band2	5MHz	16QAM	18900	1RB#0	3000~20000	-33.45	PASS
Band2	5MHz	QPSK	19175	1RB#0	0.009~0.15	-57.63	PASS
Band2	5MHz	QPSK	19175	1RB#0	0.15~30	-53.23	PASS
Band2	5MHz	QPSK	19175	1RB#0	30~1000	-62.19	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band2	5MHz	QPSK	19175	1RB#0	1000~3000	-36.64	PASS
Band2	5MHz	QPSK	19175	1RB#0	3000~20000	-33.10	PASS
Band2	5MHz	16QAM	19175	1RB#0	0.009~0.15	-56.42	PASS
Band2	5MHz	16QAM	19175	1RB#0	0.15~30	-52.67	PASS
Band2	5MHz	16QAM	19175	1RB#0	30~1000	-62.24	PASS
Band2	5MHz	16QAM	19175	1RB#0	1000~3000	-36.12	PASS
Band2	5MHz	16QAM	19175	1RB#0	3000~20000	-33.06	PASS
Band2	10MHz	QPSK	18650	1RB#0	0.009~0.15	-53.57	PASS
Band2	10MHz	QPSK	18650	1RB#0	0.15~30	-54.06	PASS
Band2	10MHz	QPSK	18650	1RB#0	30~1000	-62.09	PASS
Band2	10MHz	QPSK	18650	1RB#0	1000~3000	-47.77	PASS
Band2	10MHz	QPSK	18650	1RB#0	3000~20000	-33.44	PASS
Band2	10MHz	16QAM	18650	1RB#0	0.009~0.15	-58.10	PASS
Band2	10MHz	16QAM	18650	1RB#0	0.15~30	-51.49	PASS
Band2	10MHz	16QAM	18650	1RB#0	30~1000	-62.10	PASS
Band2	10MHz	16QAM	18650	1RB#0	1000~3000	-45.03	PASS
Band2	10MHz	16QAM	18650	1RB#0	3000~20000	-32.94	PASS
Band2	10MHz	QPSK	18900	1RB#0	0.009~0.15	-57.71	PASS
Band2	10MHz	QPSK	18900	1RB#0	0.15~30	-54.31	PASS
Band2	10MHz	QPSK	18900	1RB#0	30~1000	-62.02	PASS
Band2	10MHz	QPSK	18900	1RB#0	1000~3000	-48.14	PASS
Band2	10MHz	QPSK	18900	1RB#0	3000~20000	-33.40	PASS
Band2	10MHz	16QAM	18900	1RB#0	0.009~0.15	-58.66	PASS
Band2	10MHz	16QAM	18900	1RB#0	0.15~30	-53.22	PASS
Band2	10MHz	16QAM	18900	1RB#0	30~1000	-62.29	PASS
Band2	10MHz	16QAM	18900	1RB#0	1000~3000	-47.90	PASS
Band2	10MHz	16QAM	18900	1RB#0	3000~20000	-33.47	PASS
Band2	10MHz	QPSK	19150	1RB#0	0.009~0.15	-56.83	PASS
Band2	10MHz	QPSK	19150	1RB#0	0.15~30	-51.76	PASS
Band2	10MHz	QPSK	19150	1RB#0	1000~3000	-47.53	PASS
Band2	10MHz	QPSK	19150	1RB#0	3000~20000	-33.45	PASS
Band2	10MHz	16QAM	19150	1RB#0	0.009~0.15	-56.90	PASS
Band2	10MHz	16QAM	19150	1RB#0	0.15~30	-53.94	PASS
Band2	10MHz	16QAM	19150	1RB#0	30~1000	-62.38	PASS
Band2	10MHz	16QAM	19150	1RB#0	1000~3000	-47.79	PASS
Band2	10MHz	16QAM	19150	1RB#0	3000~20000	-33.06	PASS
Band2	1.4MHz	QPSK	18607	1RB#0	3000~20000	-32.90	PASS
Band2	1.4MHz	16QAM	18607	1RB#0	1000~3000	-27.52	PASS
Band2	1.4MHz	16QAM	18607	1RB#0	3000~20000	-33.36	PASS
Band2	1.4MHz	QPSK	18900	1RB#0	0.009~0.15	-54.40	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band2	1.4MHz	QPSK	18900	1RB#0	0.15~30	-52.92	PASS
Band2	1.4MHz	QPSK	18900	1RB#0	30~1000	-62.26	PASS
Band2	3MHz	QPSK	18615	1RB#0	0.009~0.15	-57.76	PASS
Band2	3MHz	QPSK	18615	1RB#0	0.15~30	-53.16	PASS
Band2	15MHz	QPSK	18675	1RB#0	0.009~0.15	-57.13	PASS
Band2	15MHz	QPSK	18675	1RB#0	0.15~30	-53.29	PASS
Band2	15MHz	QPSK	18675	1RB#0	30~1000	-62.02	PASS
Band2	15MHz	QPSK	18675	1RB#0	1000~3000	-47.77	PASS
Band2	15MHz	QPSK	18675	1RB#0	3000~20000	-32.53	PASS
Band2	15MHz	16QAM	18675	1RB#0	0.009~0.15	-60.05	PASS
Band2	15MHz	16QAM	18675	1RB#0	0.15~30	-52.13	PASS
Band2	15MHz	16QAM	18675	1RB#0	30~1000	-61.97	PASS
Band2	15MHz	16QAM	18675	1RB#0	1000~3000	-47.60	PASS
Band2	15MHz	16QAM	18675	1RB#0	3000~20000	-32.69	PASS
Band2	15MHz	QPSK	18900	1RB#0	0.009~0.15	-56.34	PASS
Band2	15MHz	QPSK	18900	1RB#0	0.15~30	-51.27	PASS
Band2	15MHz	QPSK	18900	1RB#0	30~1000	-62.24	PASS
Band2	15MHz	QPSK	18900	1RB#0	1000~3000	-44.98	PASS
Band2	15MHz	QPSK	18900	1RB#0	3000~20000	-33.00	PASS
Band2	15MHz	16QAM	18900	1RB#0	0.009~0.15	-55.90	PASS
Band2	15MHz	16QAM	18900	1RB#0	0.15~30	-50.90	PASS
Band2	15MHz	16QAM	18900	1RB#0	30~1000	-62.25	PASS
Band2	15MHz	16QAM	18900	1RB#0	1000~3000	-47.53	PASS
Band2	15MHz	16QAM	18900	1RB#0	3000~20000	-33.10	PASS
Band2	15MHz	QPSK	19125	1RB#0	0.009~0.15	-55.82	PASS
Band2	15MHz	QPSK	19125	1RB#0	0.15~30	-53.47	PASS
Band2	15MHz	QPSK	19125	1RB#0	30~1000	-62.35	PASS
Band2	15MHz	QPSK	19125	1RB#0	1000~3000	-47.99	PASS
Band2	15MHz	QPSK	19125	1RB#0	3000~20000	-33.30	PASS
Band2	15MHz	16QAM	19125	1RB#0	0.009~0.15	-59.31	PASS
Band2	15MHz	16QAM	19125	1RB#0	0.15~30	-51.10	PASS
Band2	15MHz	16QAM	19125	1RB#0	30~1000	-62.29	PASS
Band2	15MHz	16QAM	19125	1RB#0	1000~3000	-47.95	PASS
Band2	15MHz	16QAM	19125	1RB#0	3000~20000	-32.92	PASS
Band2	20MHz	QPSK	18700	1RB#0	0.009~0.15	-59.10	PASS
Band2	20MHz	QPSK	18700	1RB#0	0.15~30	-53.19	PASS
Band2	20MHz	QPSK	18700	1RB#0	30~1000	-62.11	PASS
Band2	20MHz	QPSK	18700	1RB#0	1000~3000	-42.27	PASS
Band2	20MHz	QPSK	18700	1RB#0	3000~20000	-32.93	PASS
Band2	20MHz	16QAM	18700	1RB#0	0.009~0.15	-55.89	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity





Band2	20MHz	16QAM	18700	1RB#0	30~1000	-62.12	PASS
Band2	20MHz	16QAM	18700	1RB#0	1000~3000	-42.47	PASS
Band2	20MHz	16QAM	18700	1RB#0	3000~20000	-33.10	PASS
Band2	20MHz	QPSK	18900	1RB#0	0.009~0.15	-57.09	PASS
Band2	20MHz	QPSK	18900	1RB#0	0.15~30	-52.07	PASS
Band2	20MHz	QPSK	18900	1RB#0	30~1000	-62.23	PASS
Band2	20MHz	QPSK	18900	1RB#0	1000~3000	-47.92	PASS
Band2	20MHz	QPSK	18900	1RB#0	3000~20000	-32.95	PASS
Band2	20MHz	16QAM	18900	1RB#0	0.009~0.15	-57.50	PASS
Band2	20MHz	16QAM	18900	1RB#0	0.15~30	-51.27	PASS
Band2	20MHz	16QAM	18900	1RB#0	30~1000	-62.13	PASS
Band2	20MHz	16QAM	18900	1RB#0	1000~3000	-47.73	PASS
Band2	20MHz	16QAM	18900	1RB#0	3000~20000	-32.47	PASS
Band2	20MHz	QPSK	19100	1RB#0	0.009~0.15	-56.44	PASS
Band2	20MHz	QPSK	19100	1RB#0	0.15~30	-53.23	PASS
Band2	20MHz	QPSK	19100	1RB#0	30~1000	-61.91	PASS
Band2	20MHz	QPSK	19100	1RB#0	1000~3000	-47.66	PASS
Band2	10MHz	QPSK	19150	1RB#0	30~1000	-62.23	PASS
Band2	20MHz	16QAM	18700	1RB#0	0.15~30	-51.93	PASS
Band2	20MHz	QPSK	19100	1RB#0	3000~20000	-33.00	PASS
Band2	20MHz	16QAM	19100	1RB#0	0.009~0.15	-58.09	PASS
Band2	20MHz	16QAM	19100	1RB#0	0.15~30	-52.04	PASS
Band2	20MHz	16QAM	19100	1RB#0	30~1000	-62.44	PASS
Band2	20MHz	16QAM	19100	1RB#0	1000~3000	-47.74	PASS
Band2	20MHz	16QAM	19100	1RB#0	3000~20000	-33.18	PASS







Test Graphs

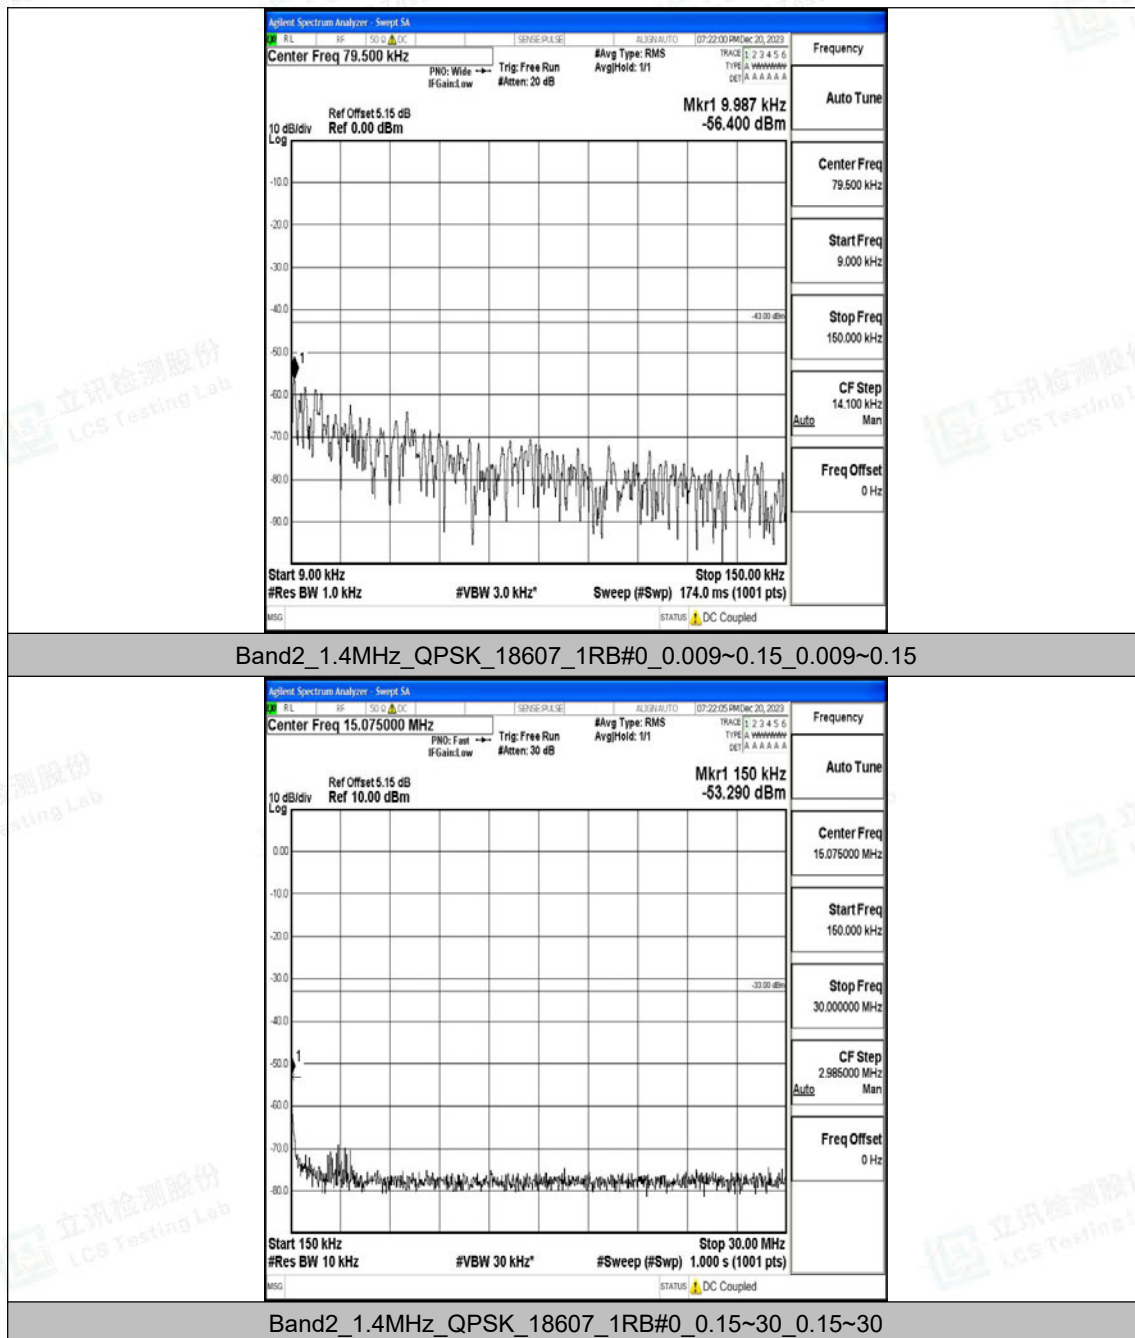

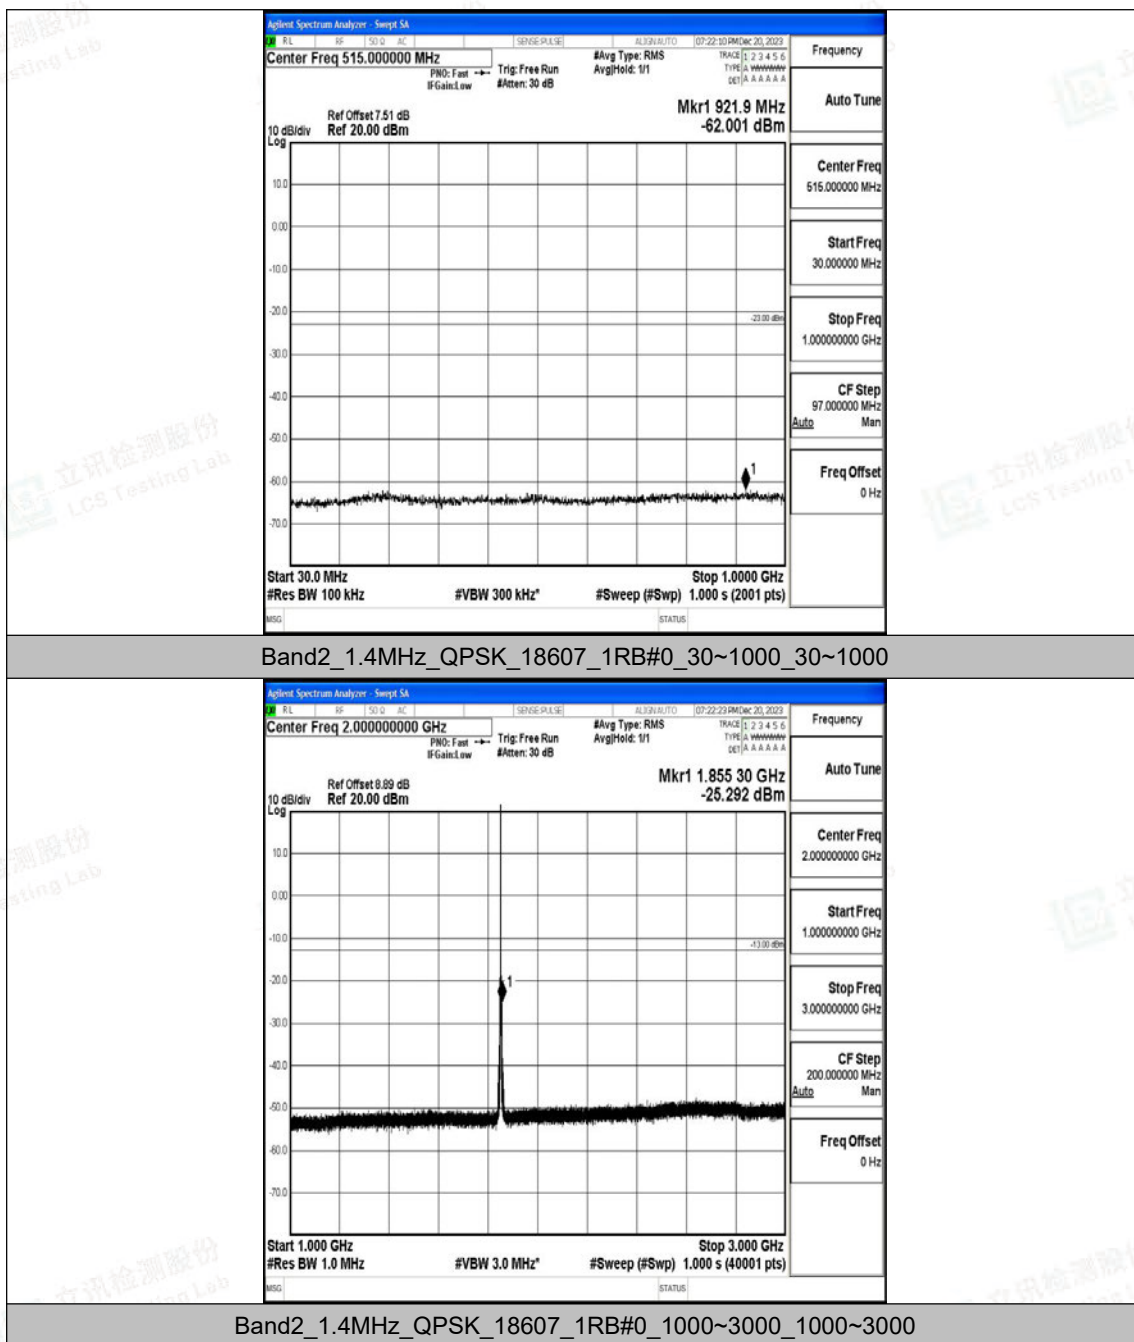

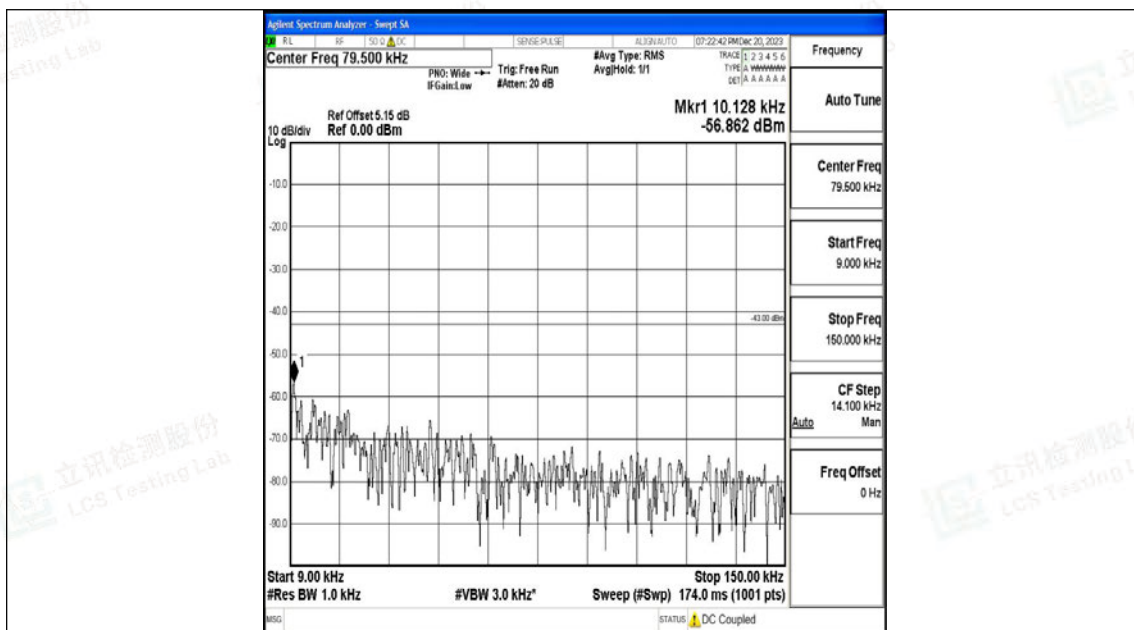

Band2_1.4MHz_16QAM_18607_1RB#0_0.009~0.15_0.009~0.15

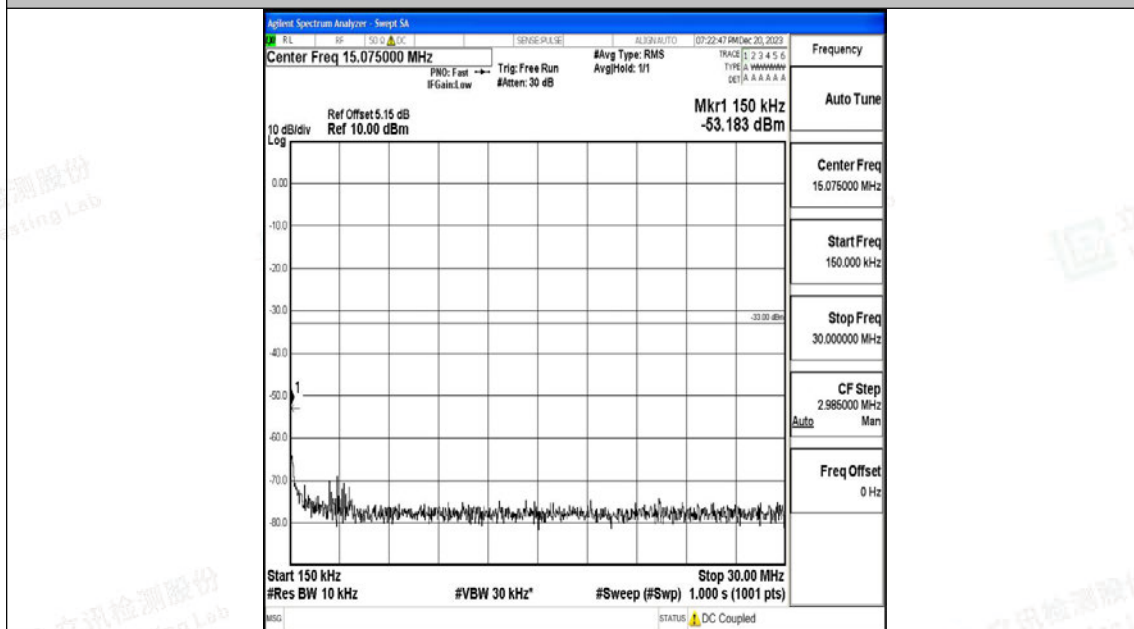

Band2_1.4MHz_16QAM_18607_1RB#0_0.15~30_0.15~30




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

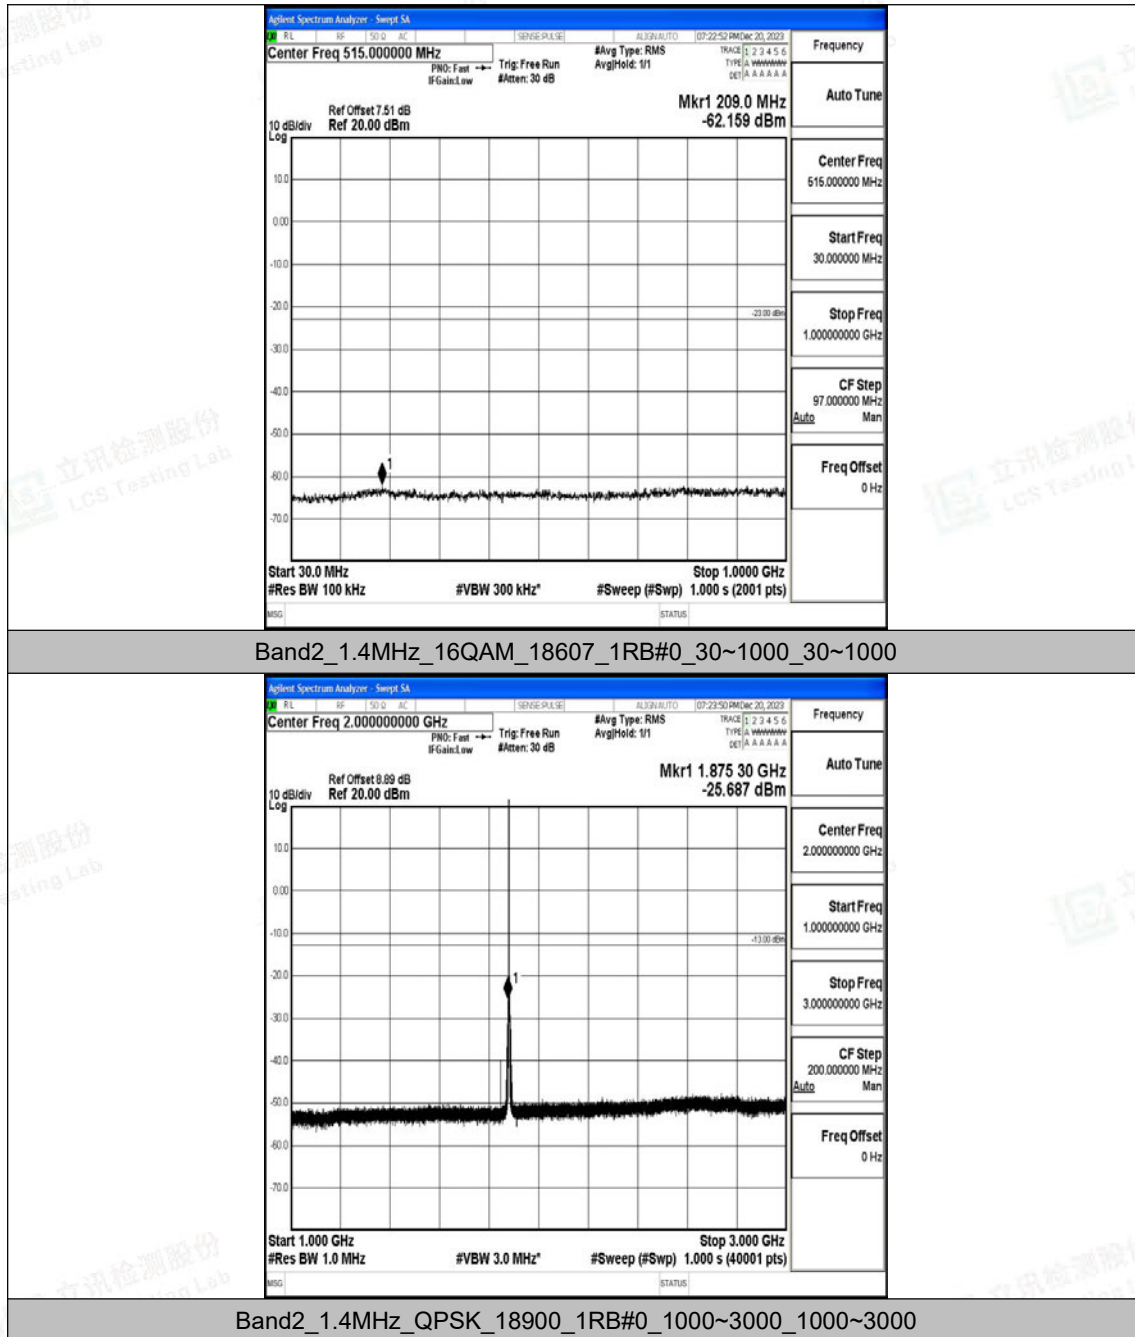


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

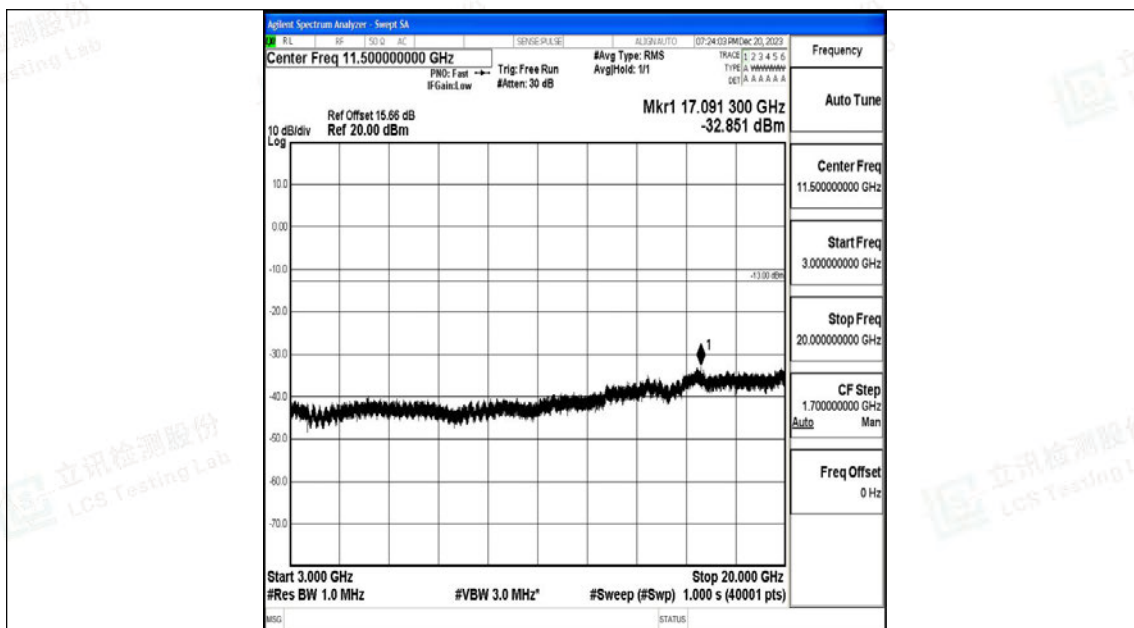


Band2_1.4MHz_QPSK_18900_1RB#0_3000~20000_3000~20000

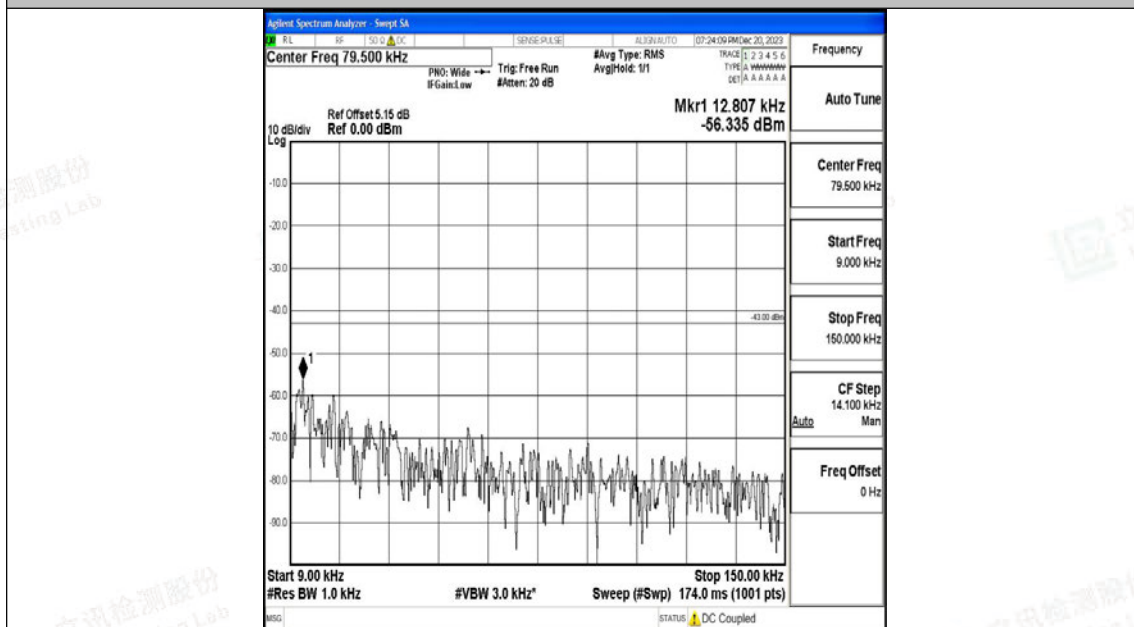

Band2_1.4MHz_16QAM_18900_1RB#0_0.009~0.15_0.009~0.15



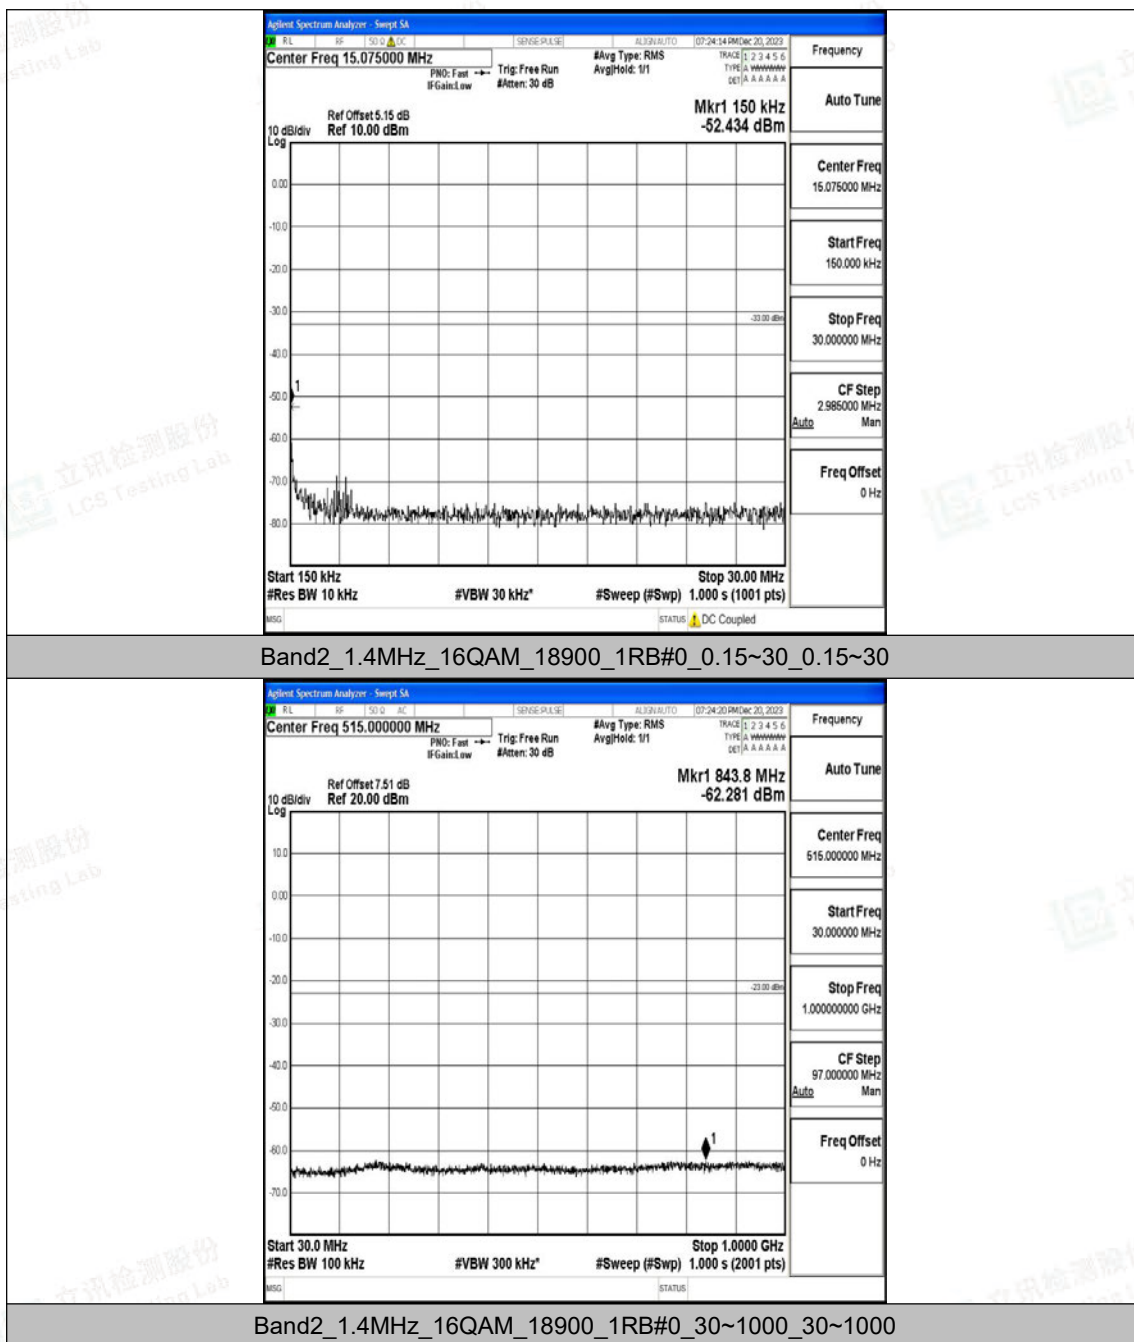



Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

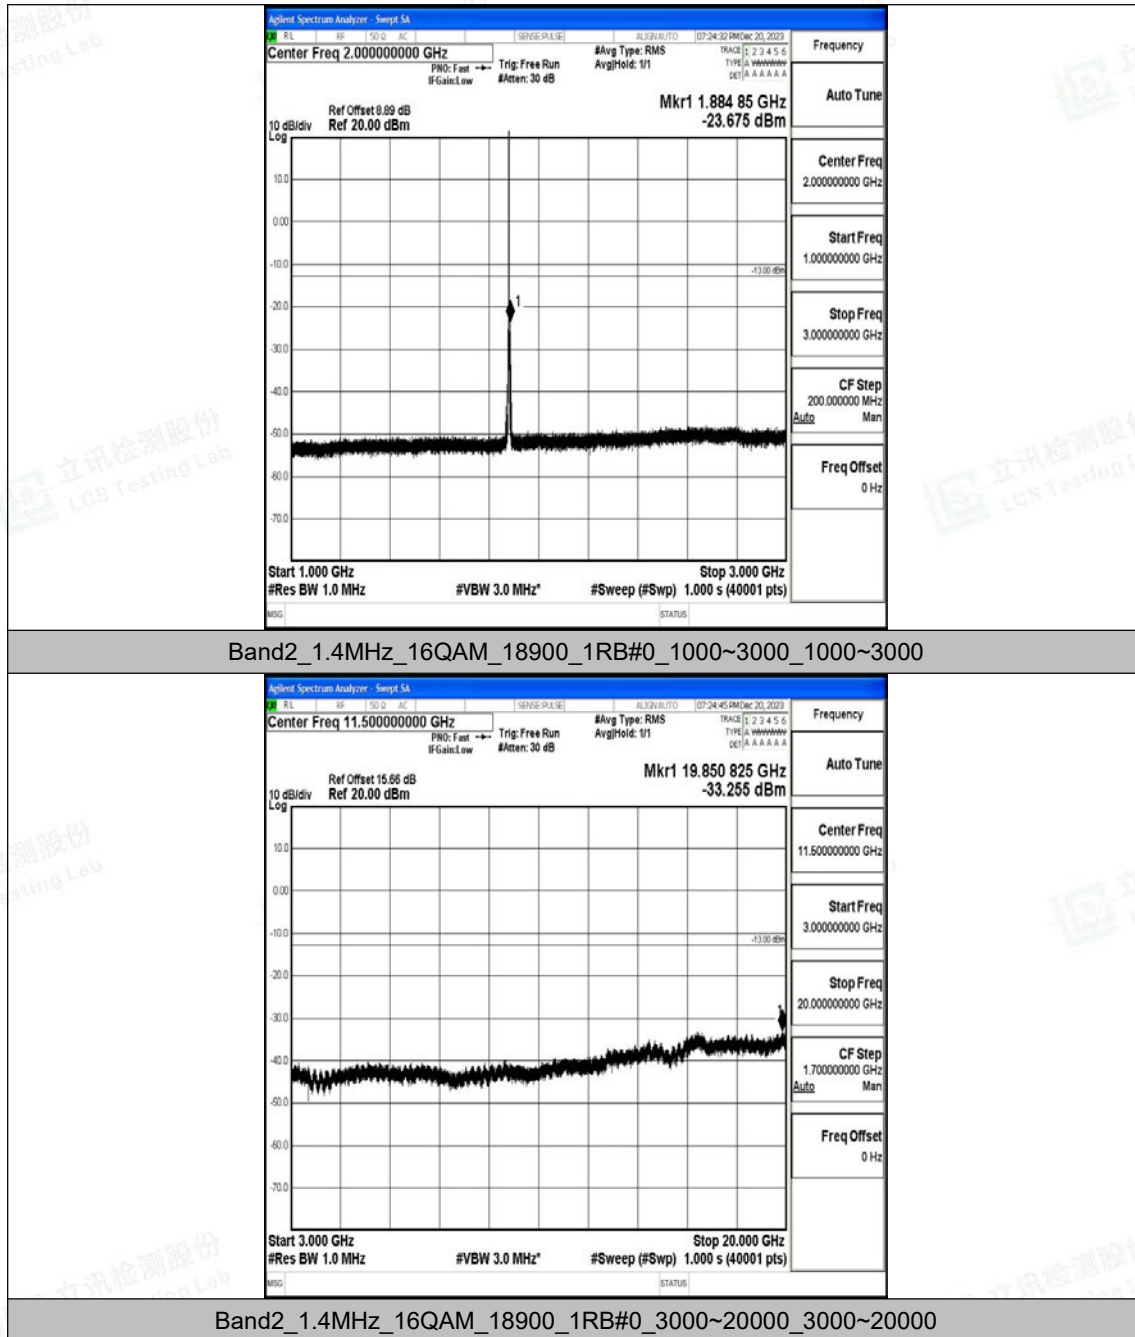


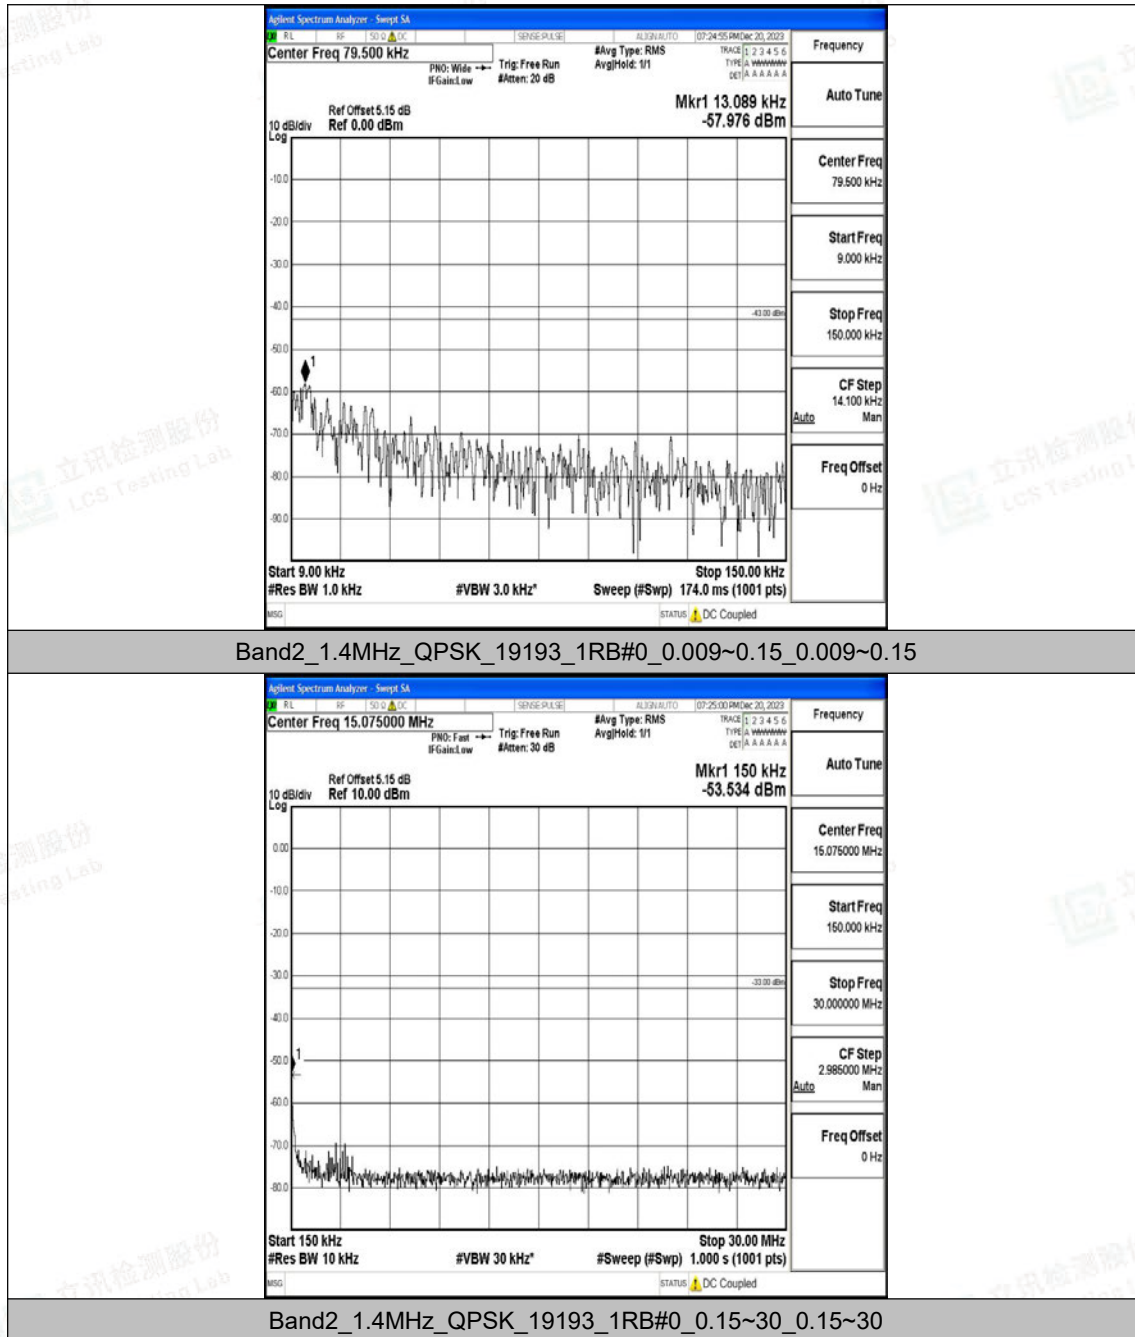

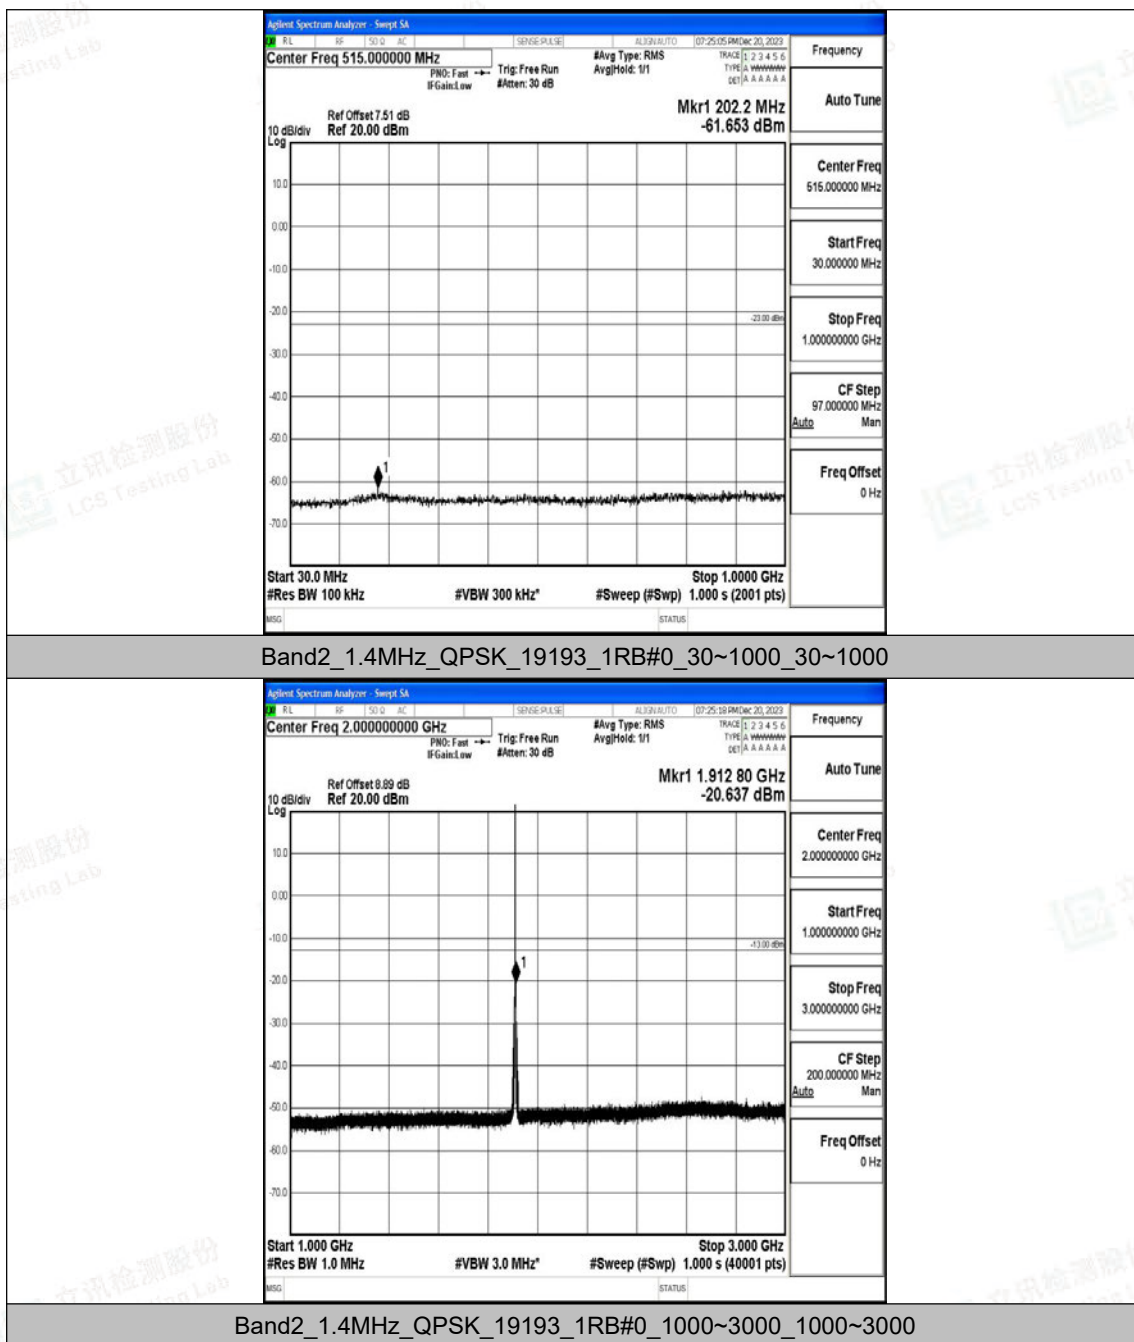

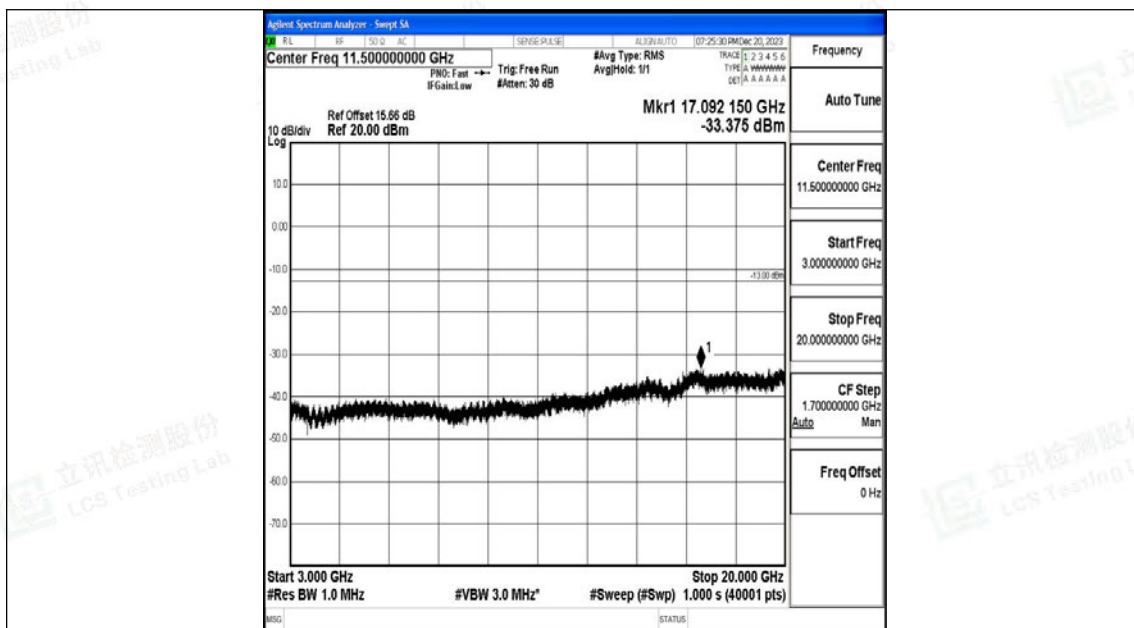



Band2_1.4MHz_QPSK_19193_1RB#0_3000~20000_3000~20000

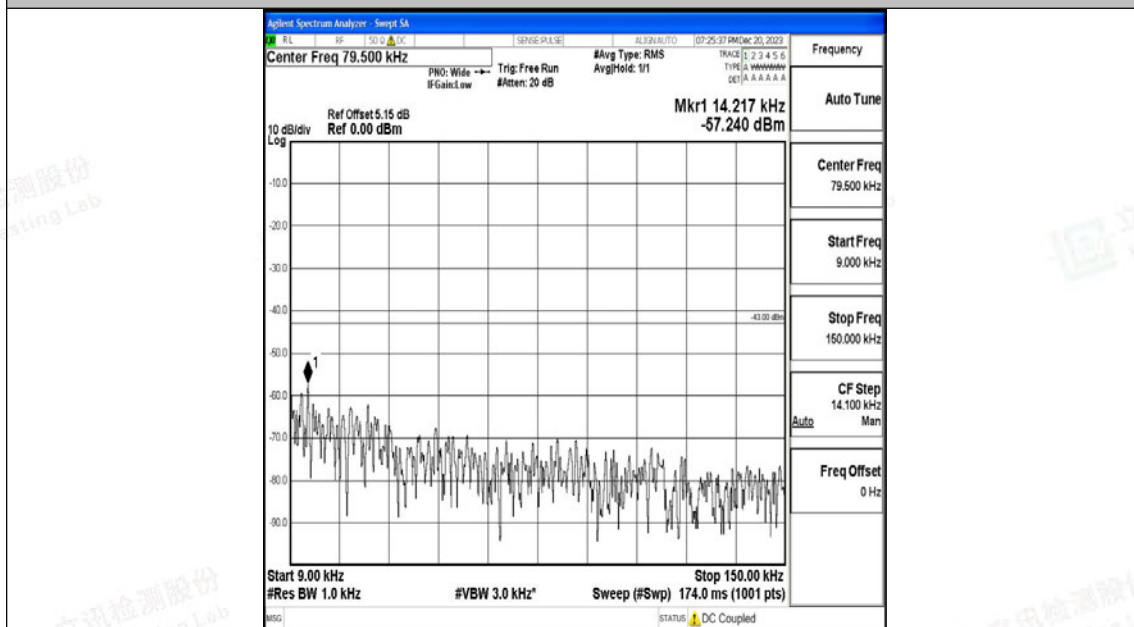


Band2_1.4MHz_16QAM_19193_1RB#0_0.009~0.15_0.009~0.15



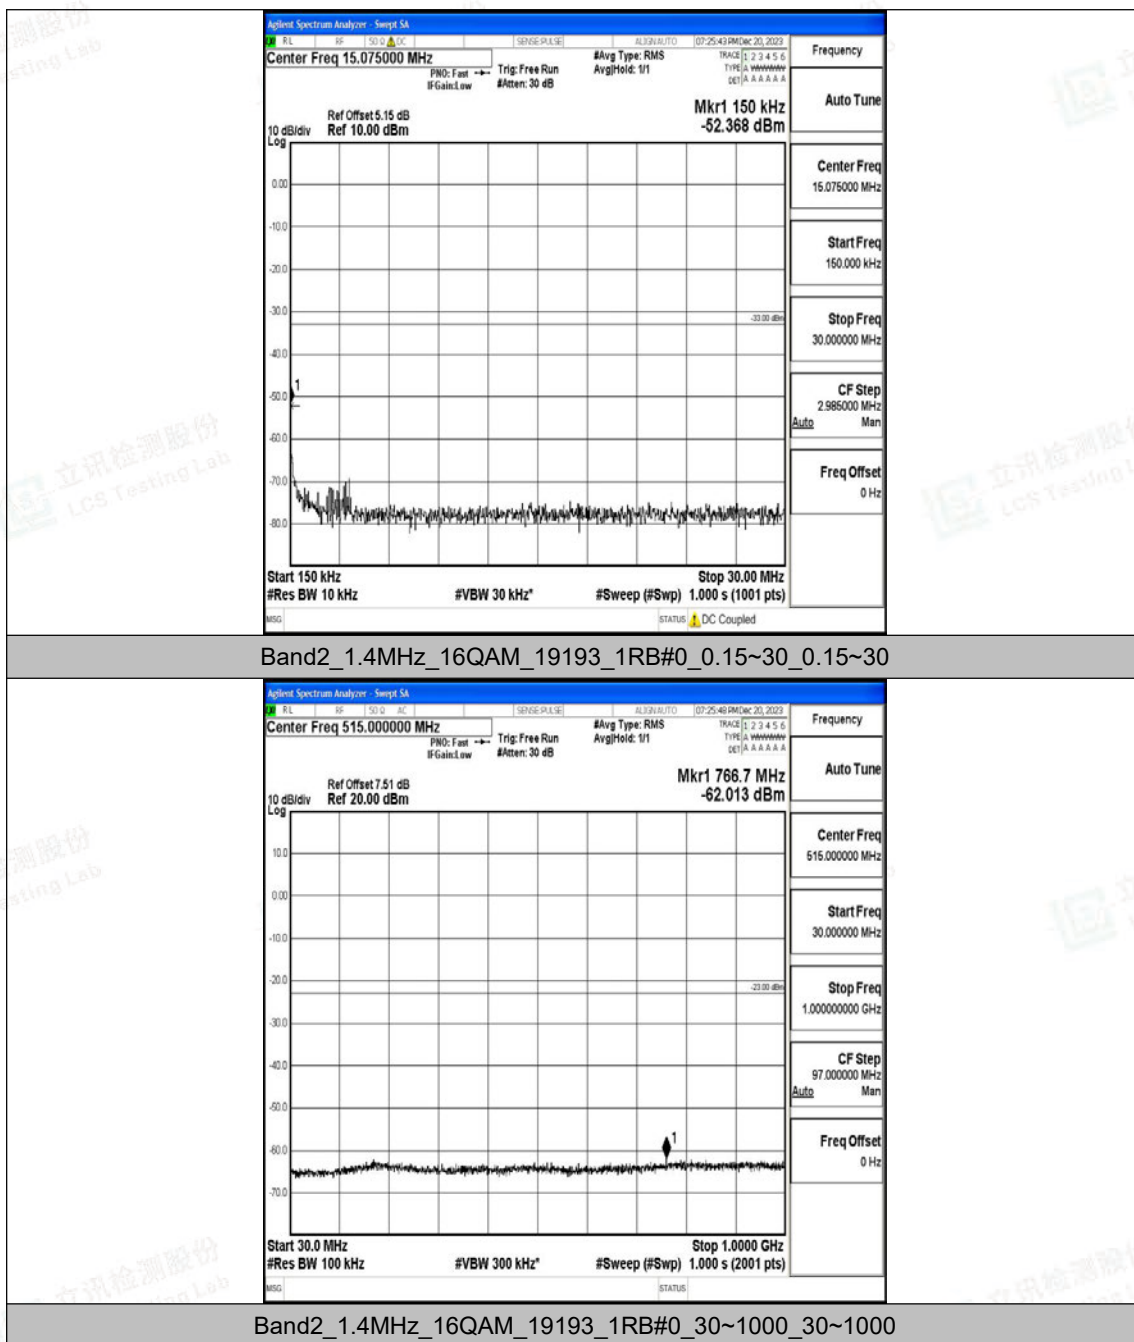

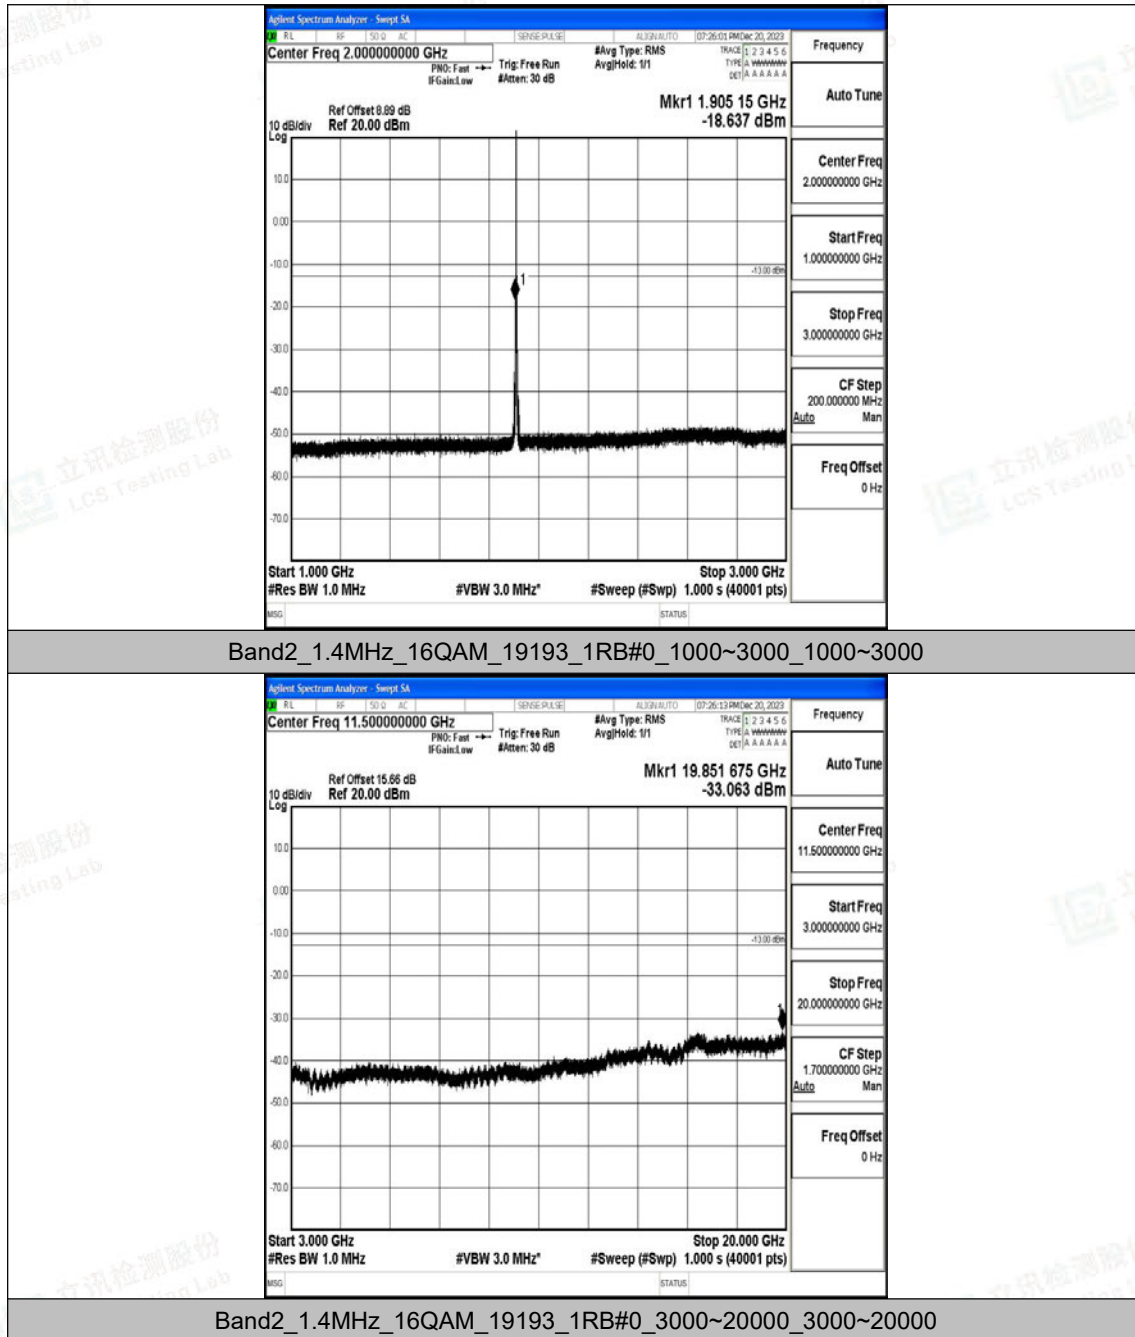

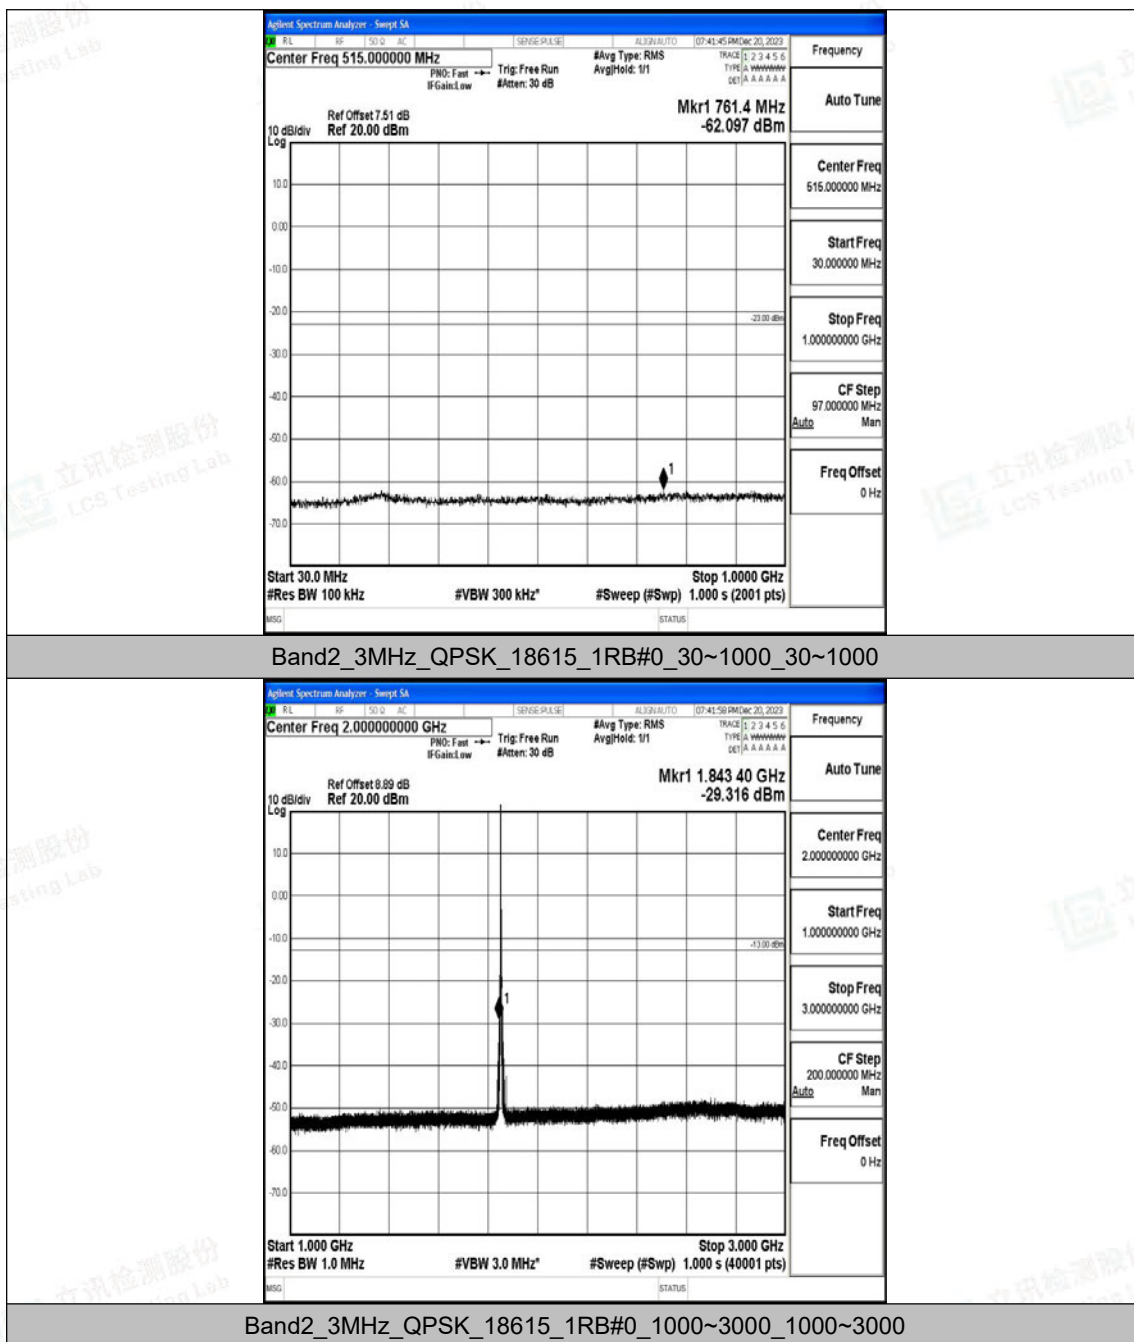



Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

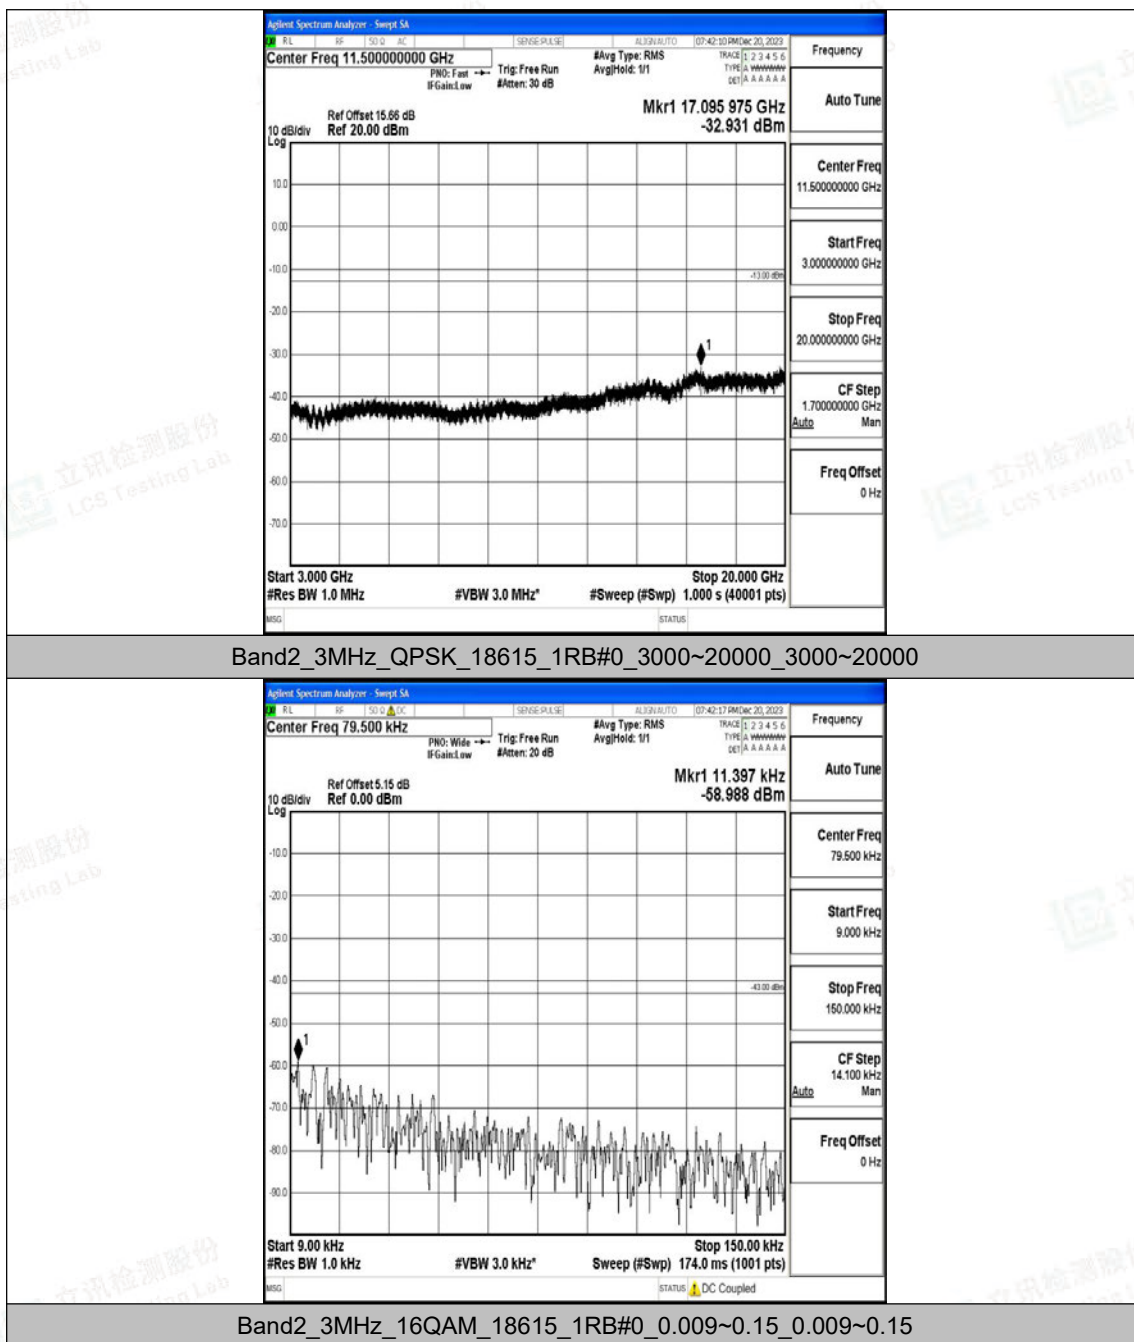


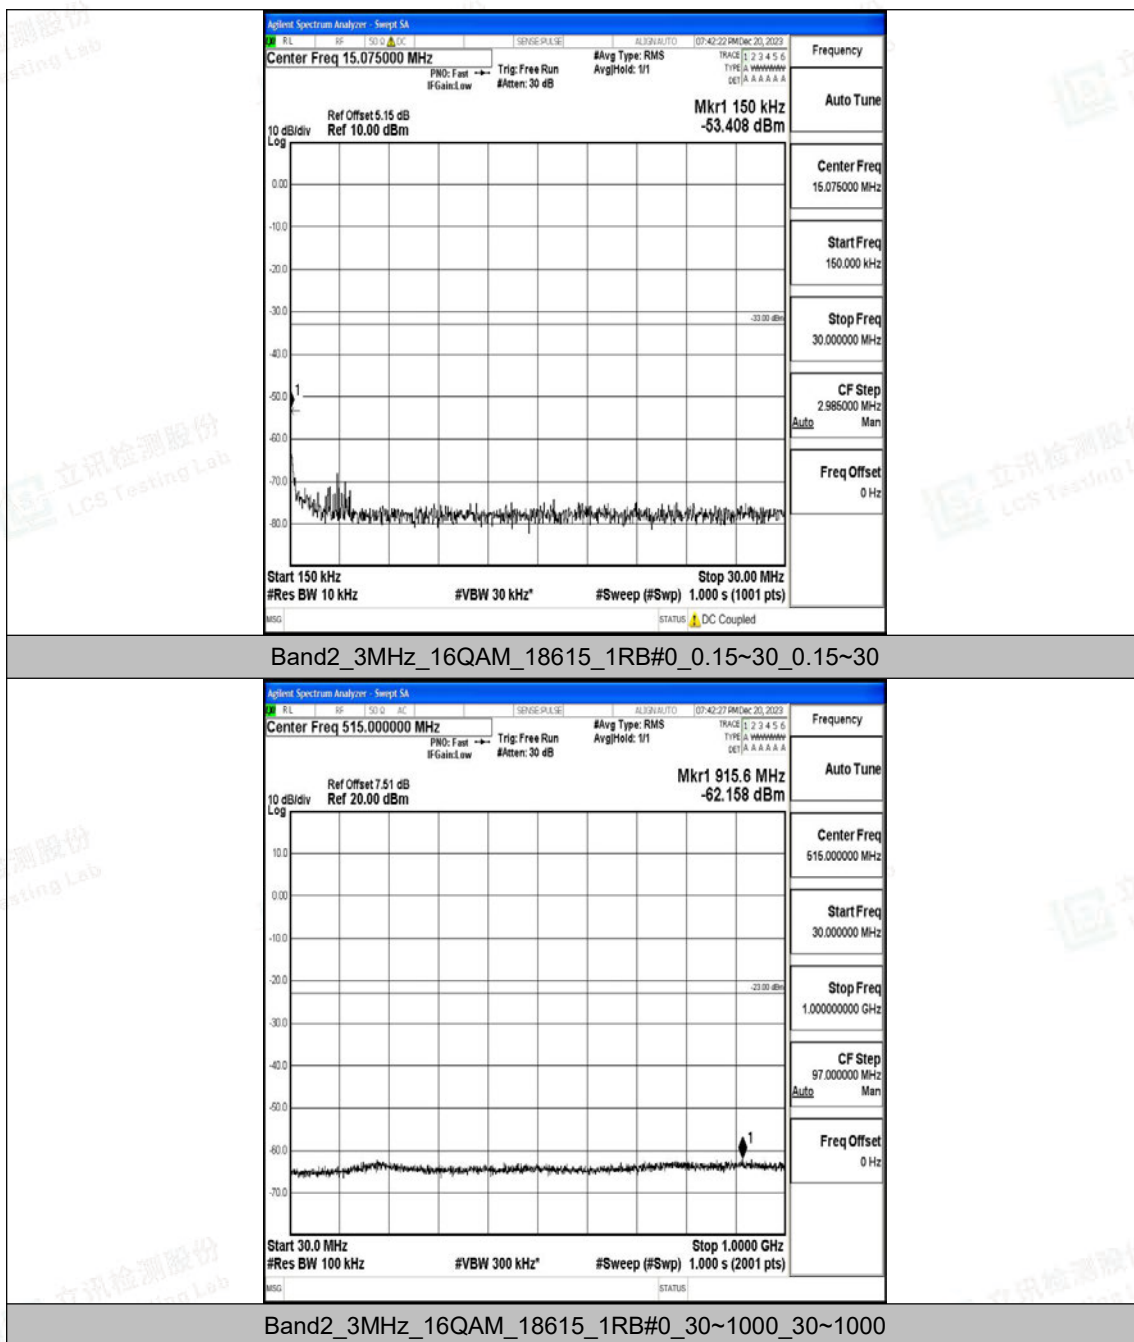

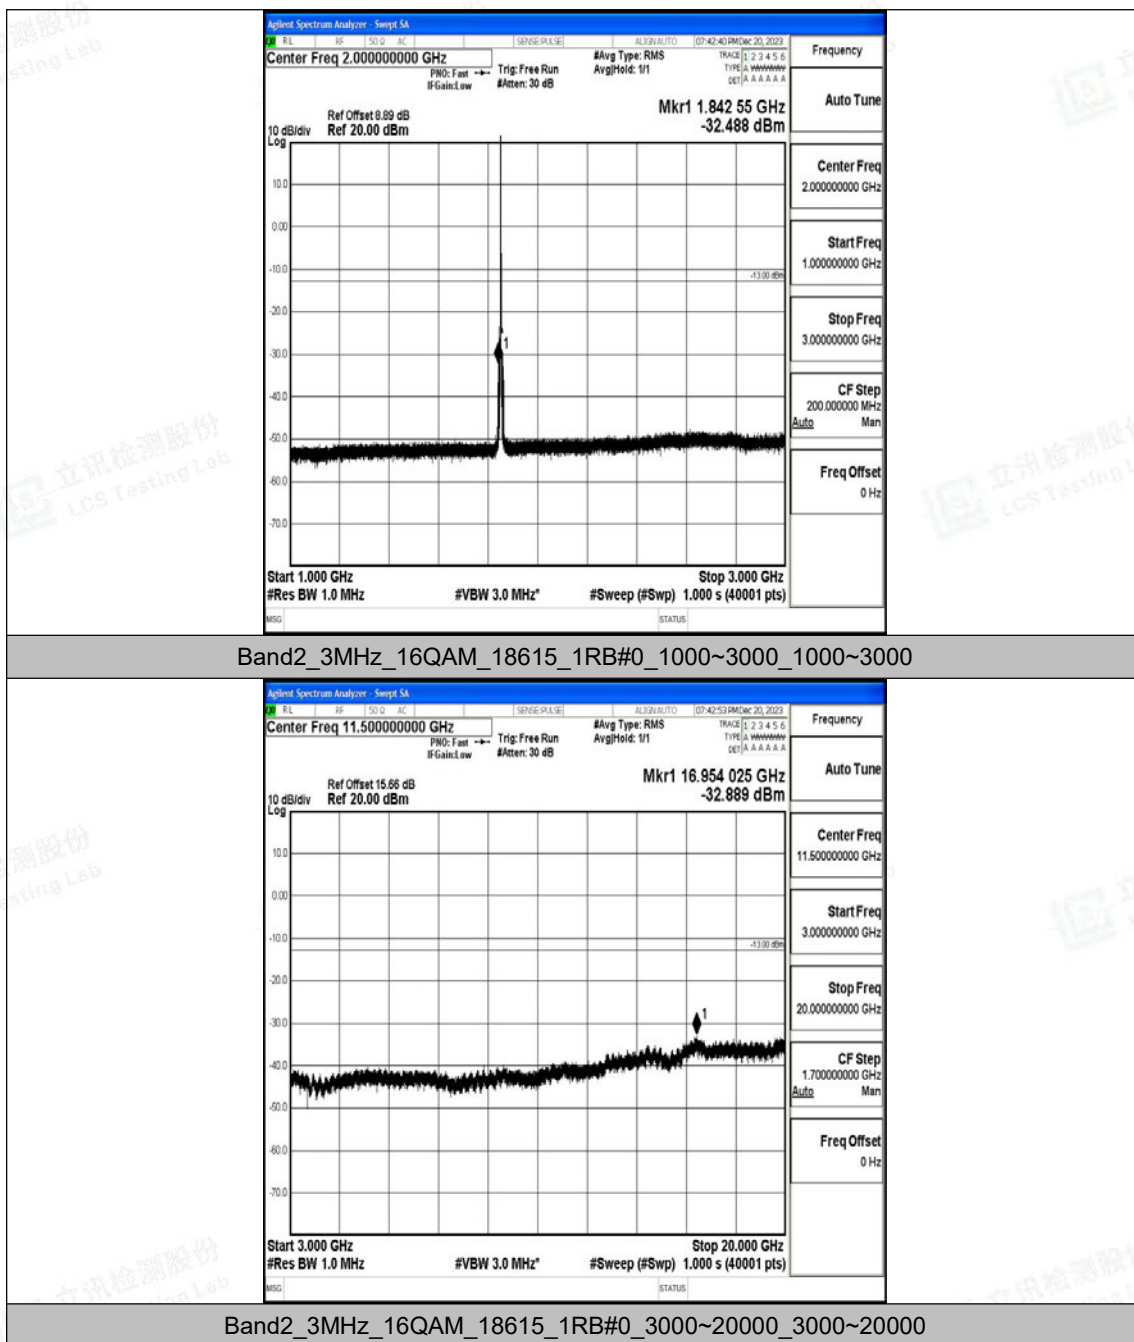

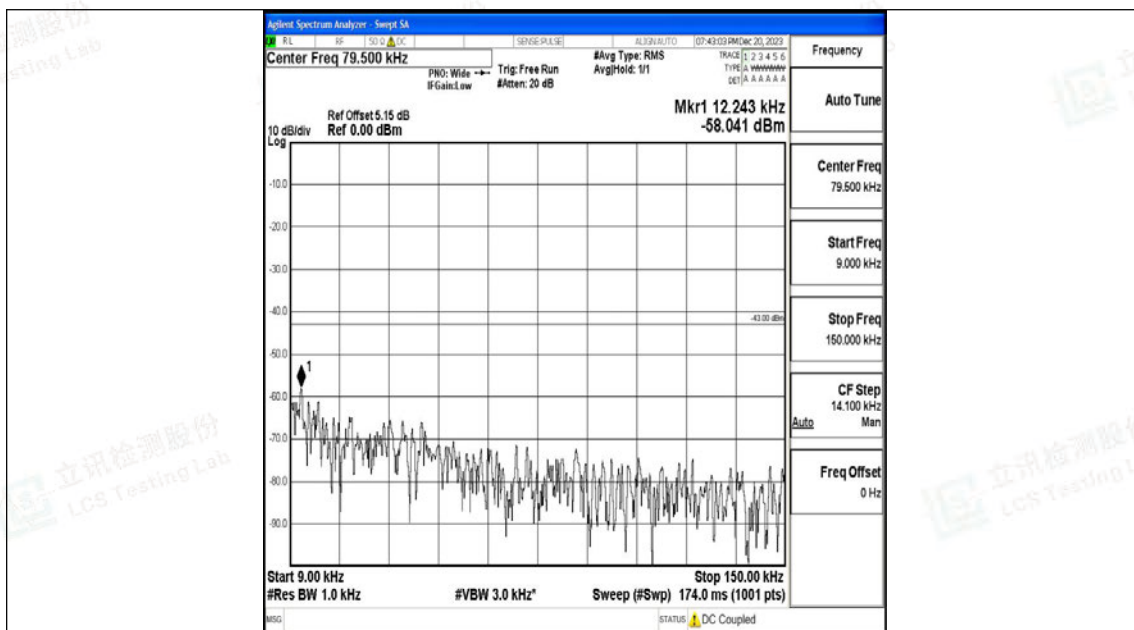


Band2_3MHz_QPSK_18900_1RB#0_0.009~0.15_0.009~0.15

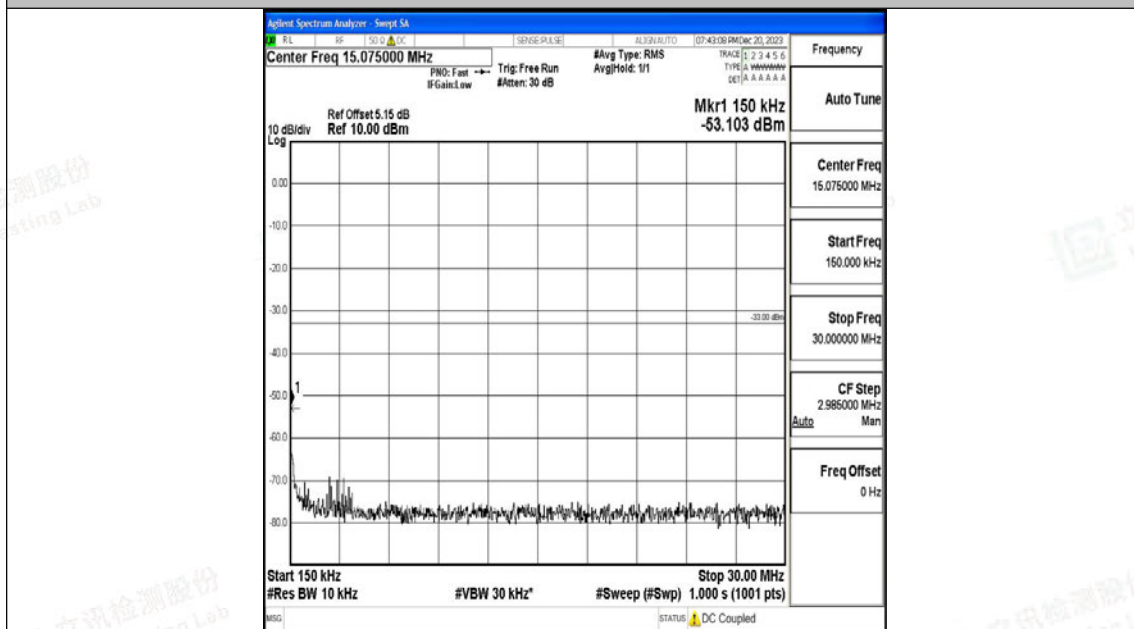

Band2_3MHz_QPSK_18900_1RB#0_0.15~30_0.15~30



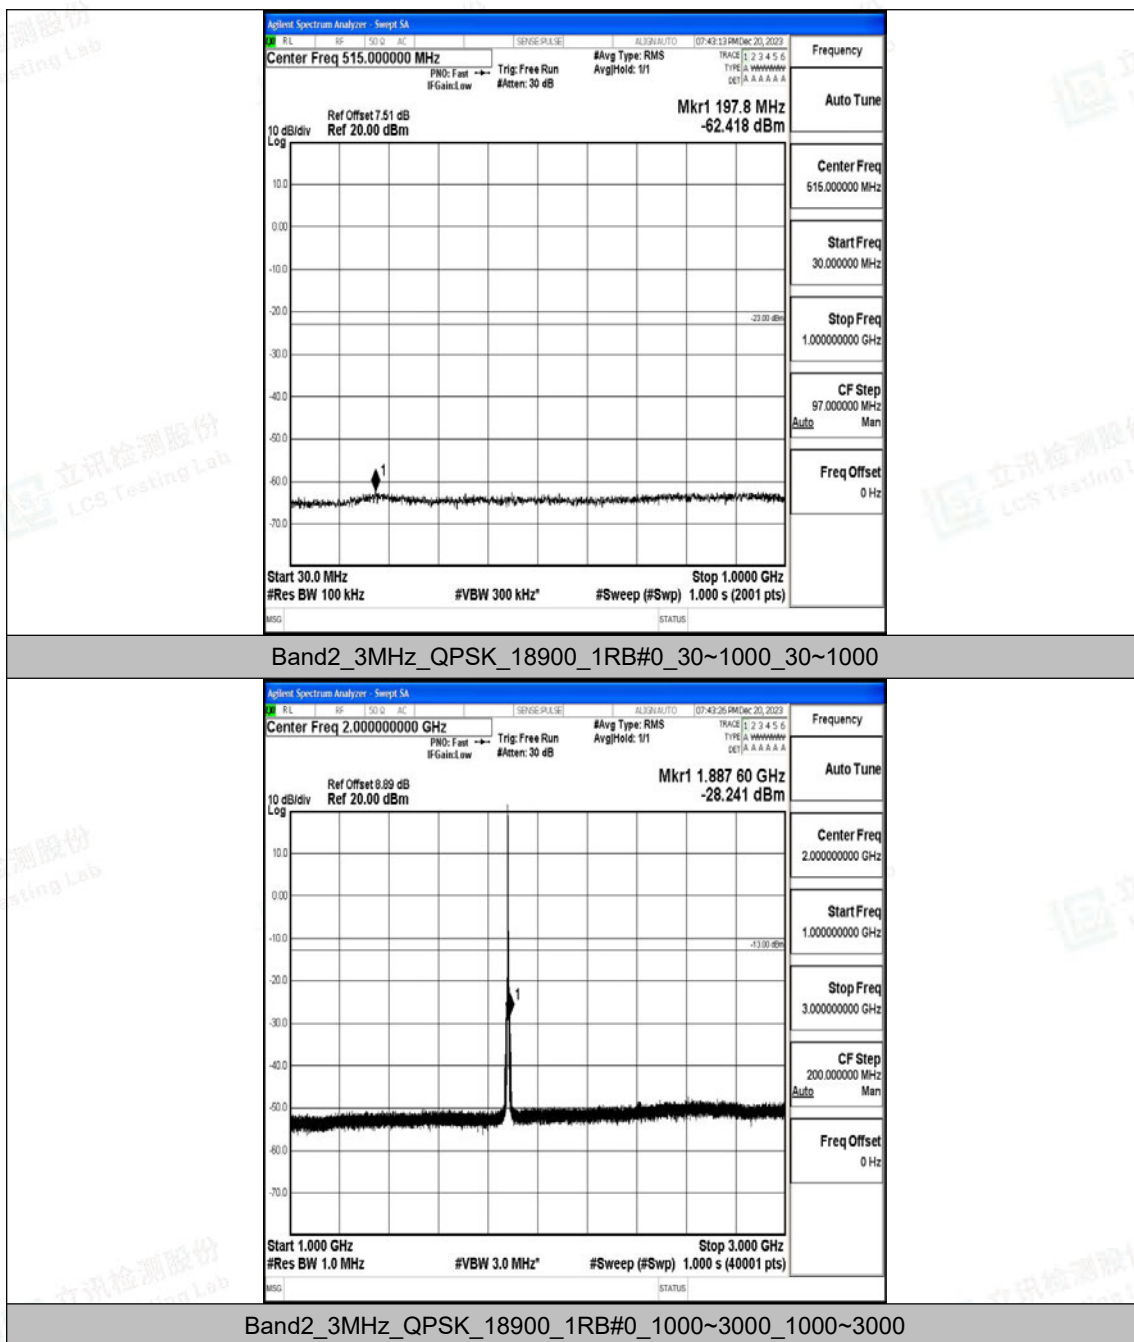



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

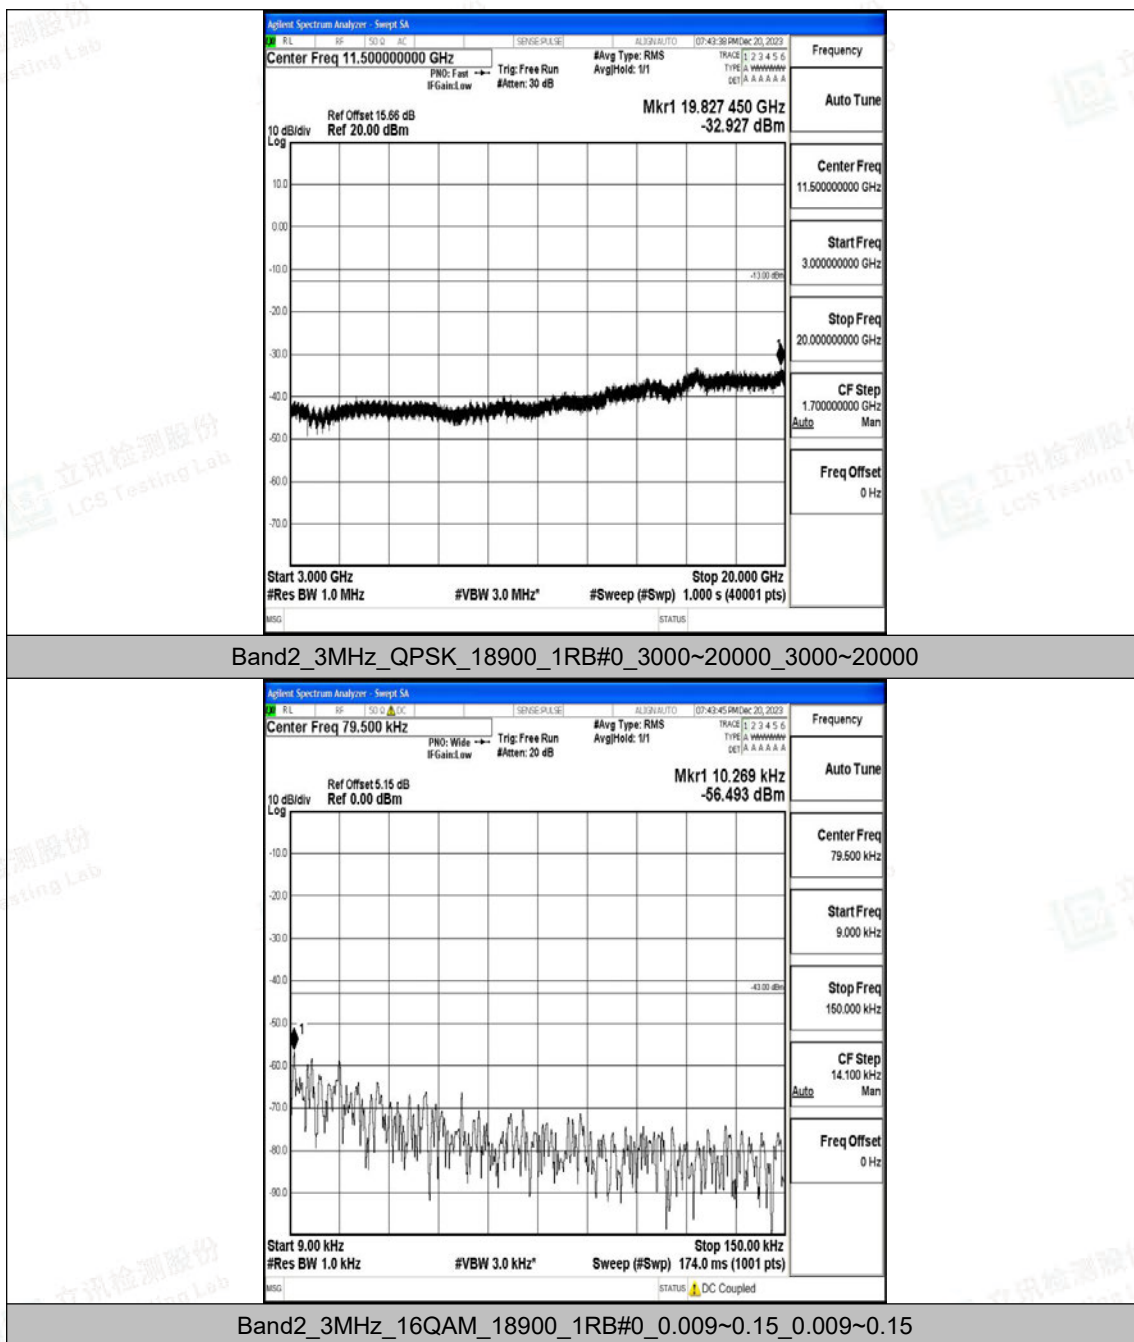

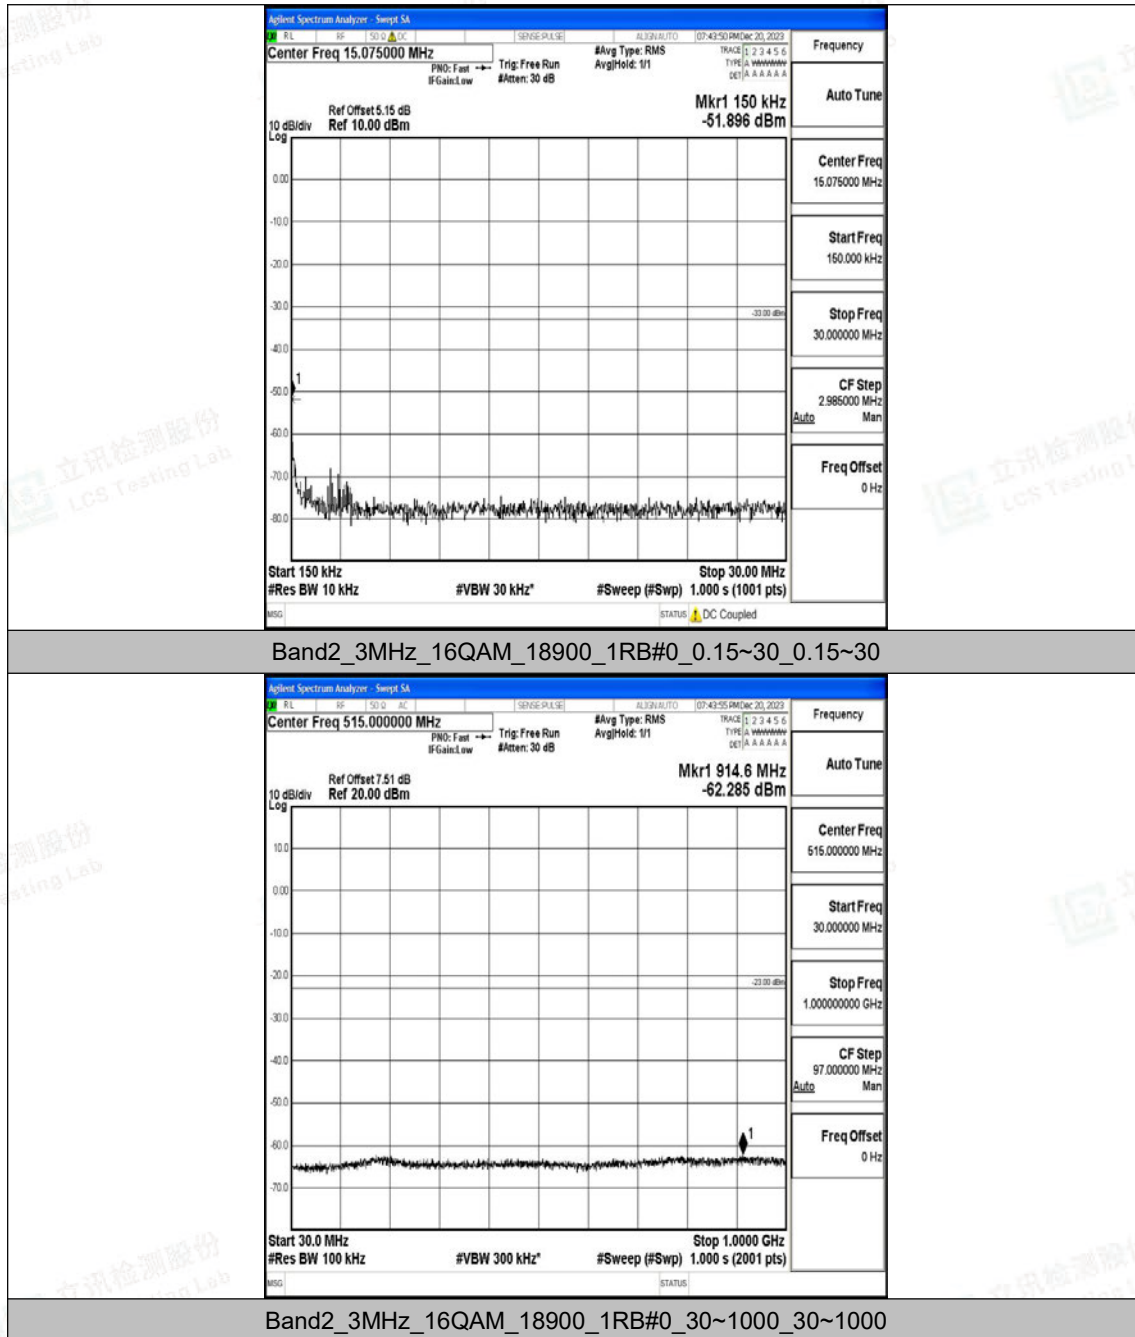



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

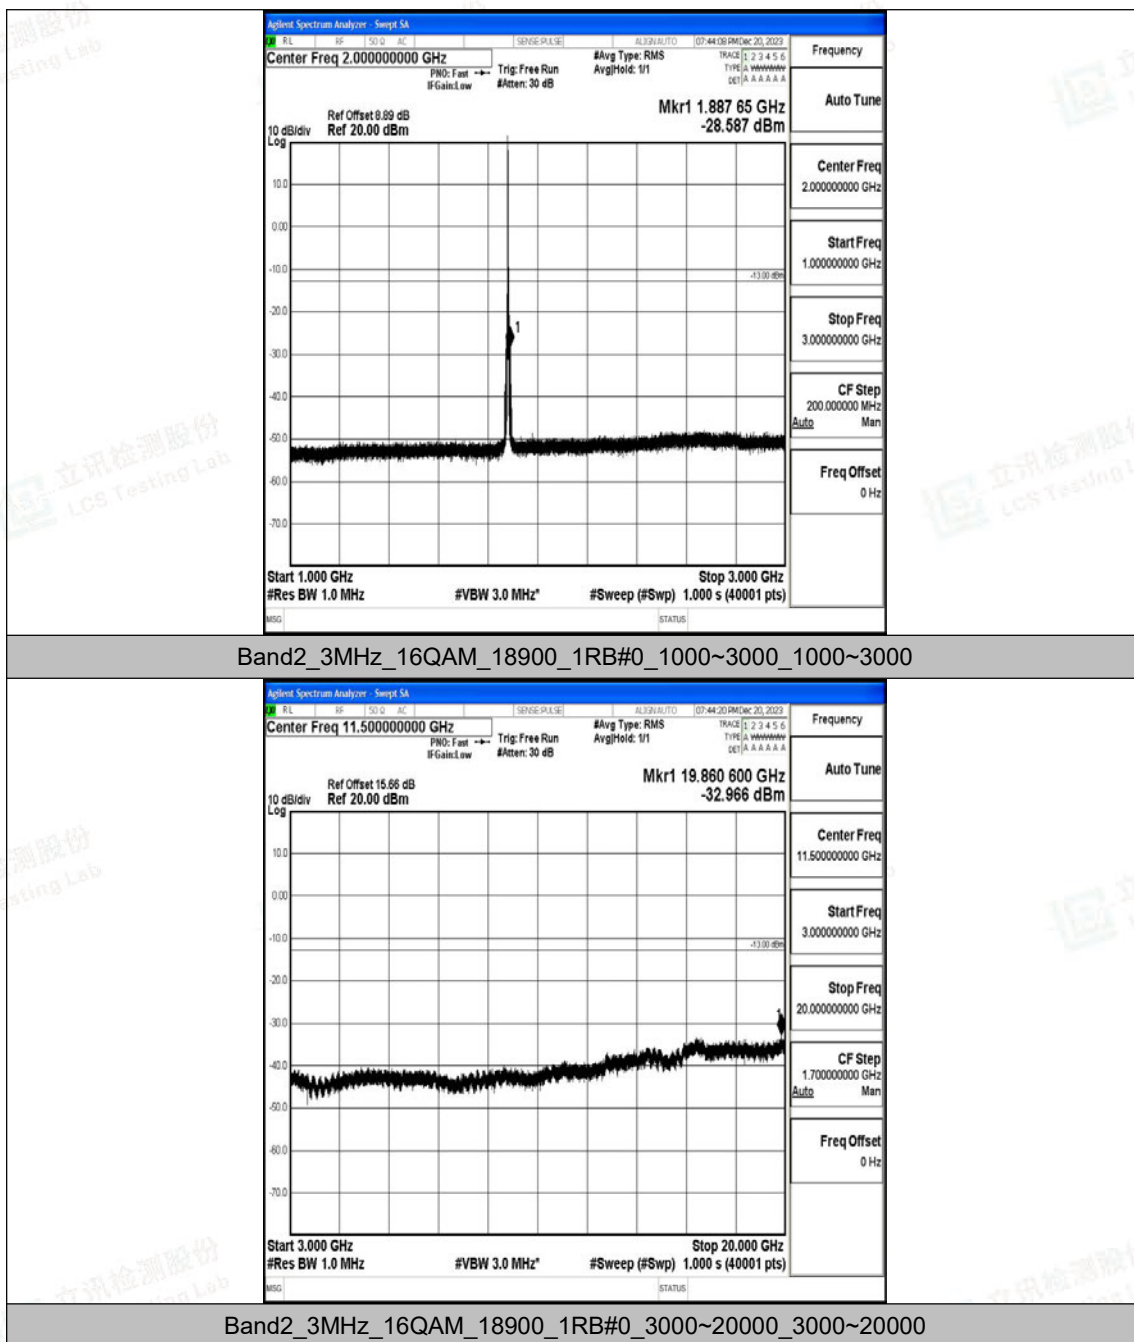

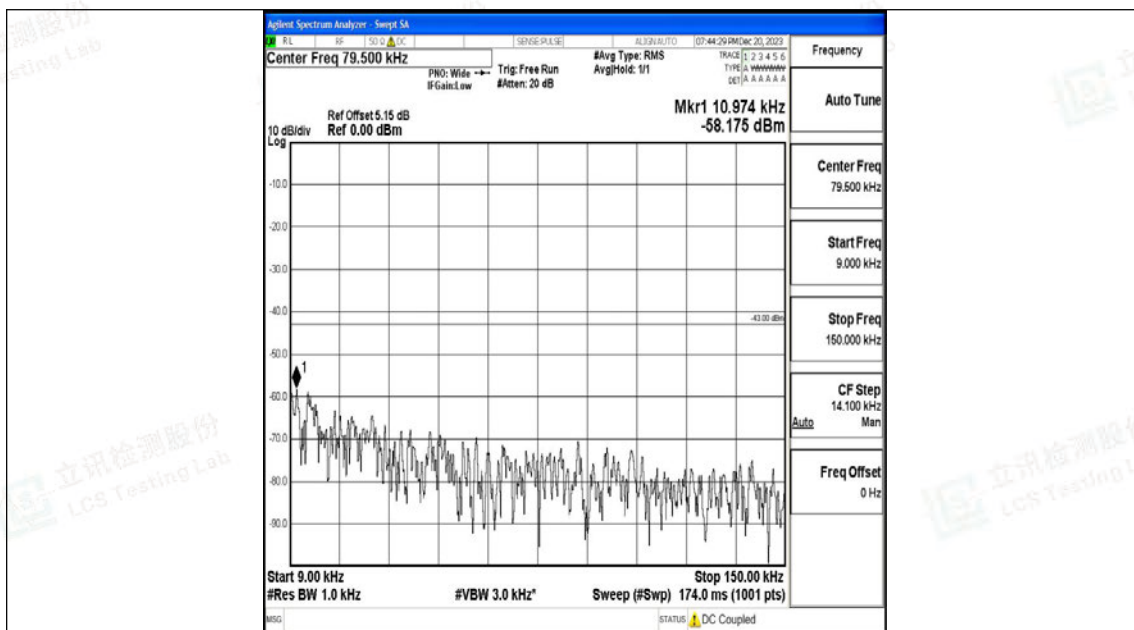



Band2_3MHz_QPSK_19185_1RB#0_0.009~0.15_0.009~0.15

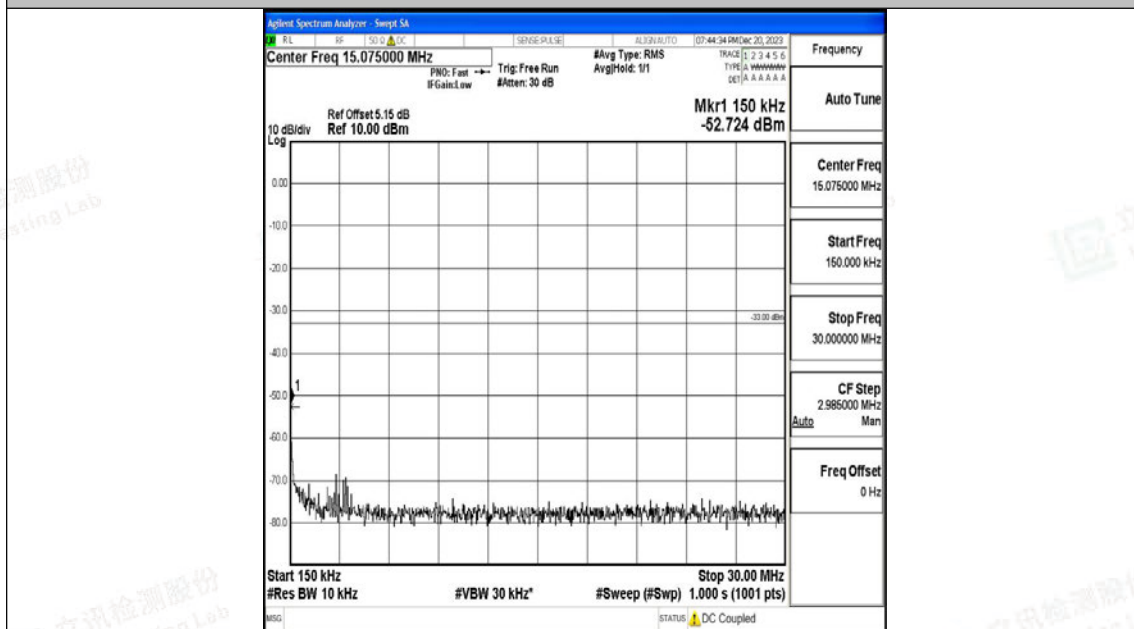



Band2_3MHz_QPSK_19185_1RB#0_0.15~30_0.15~30




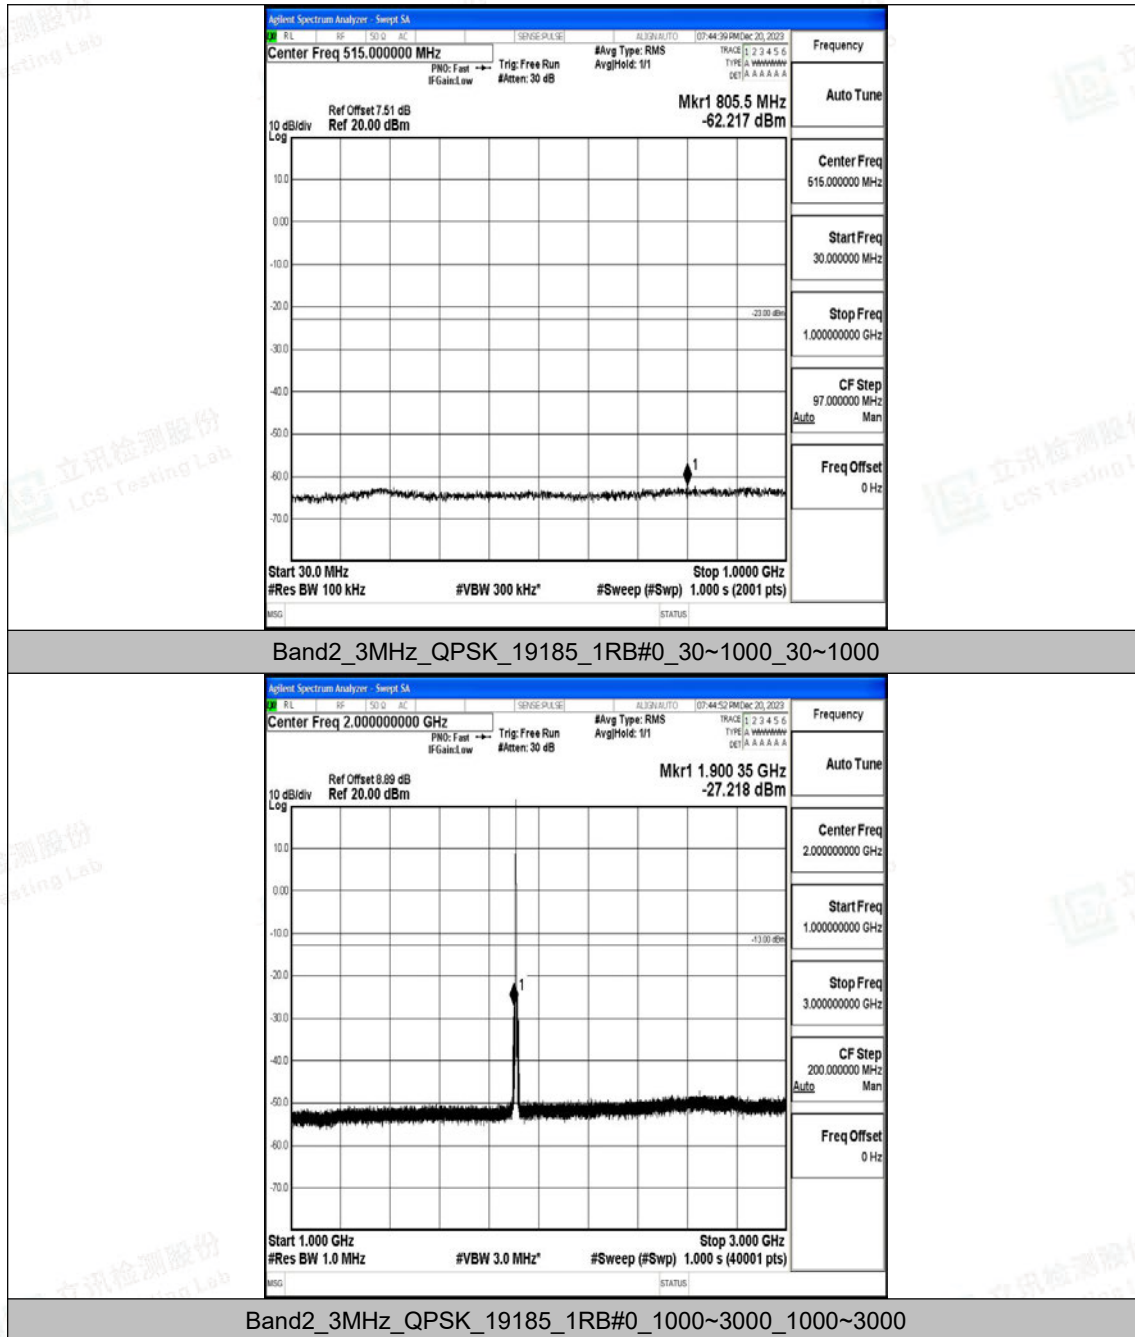

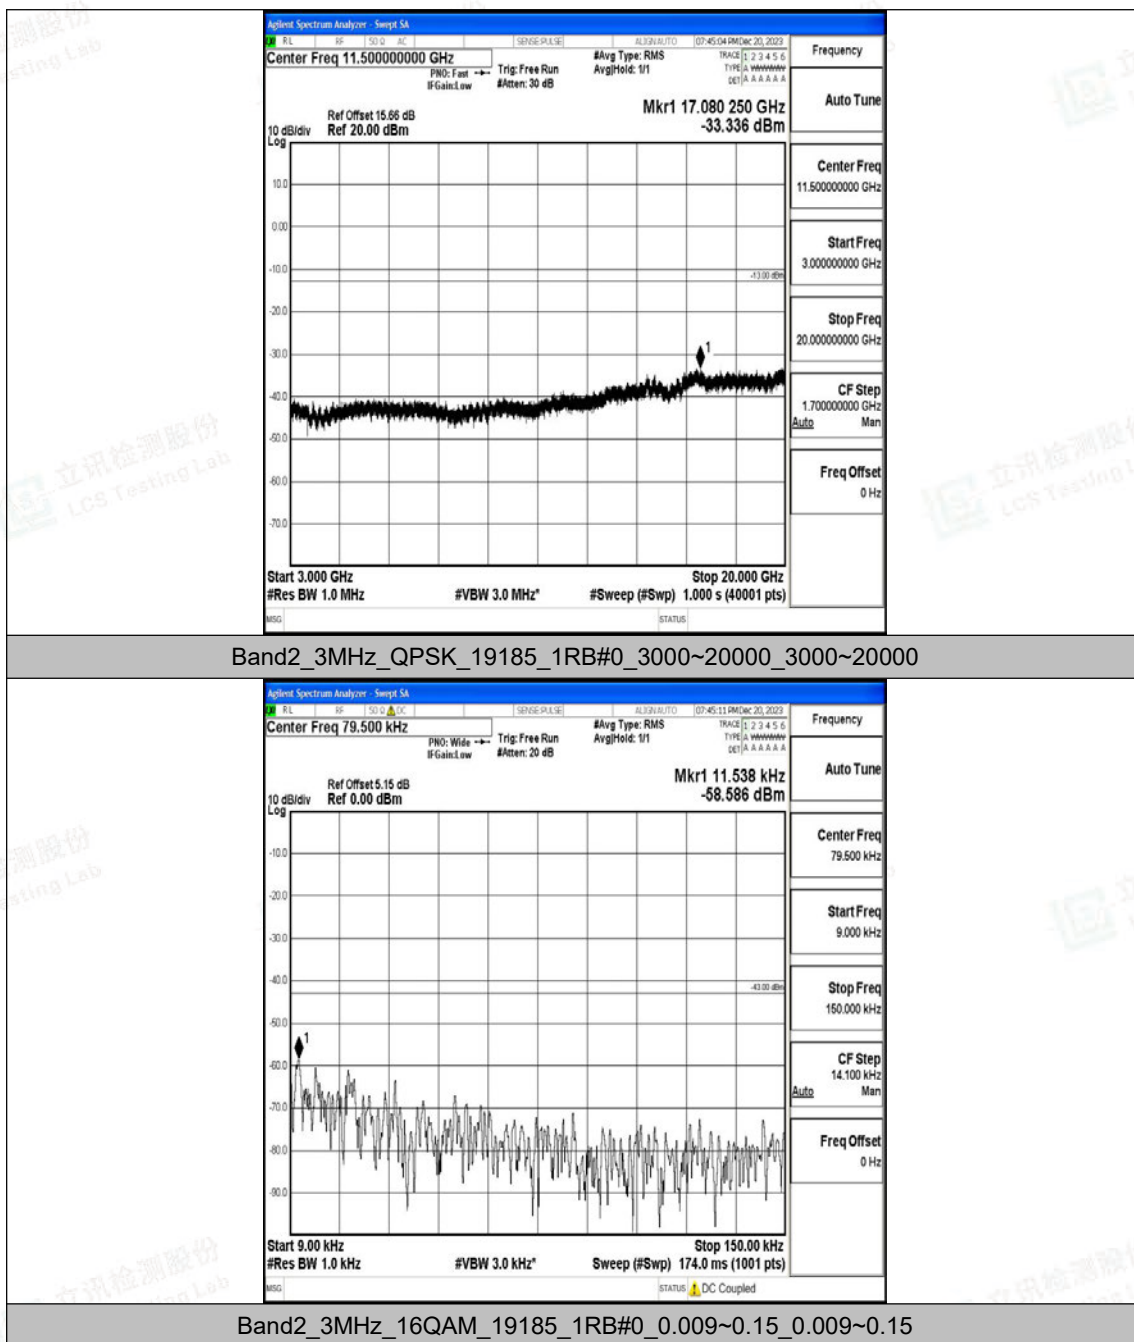


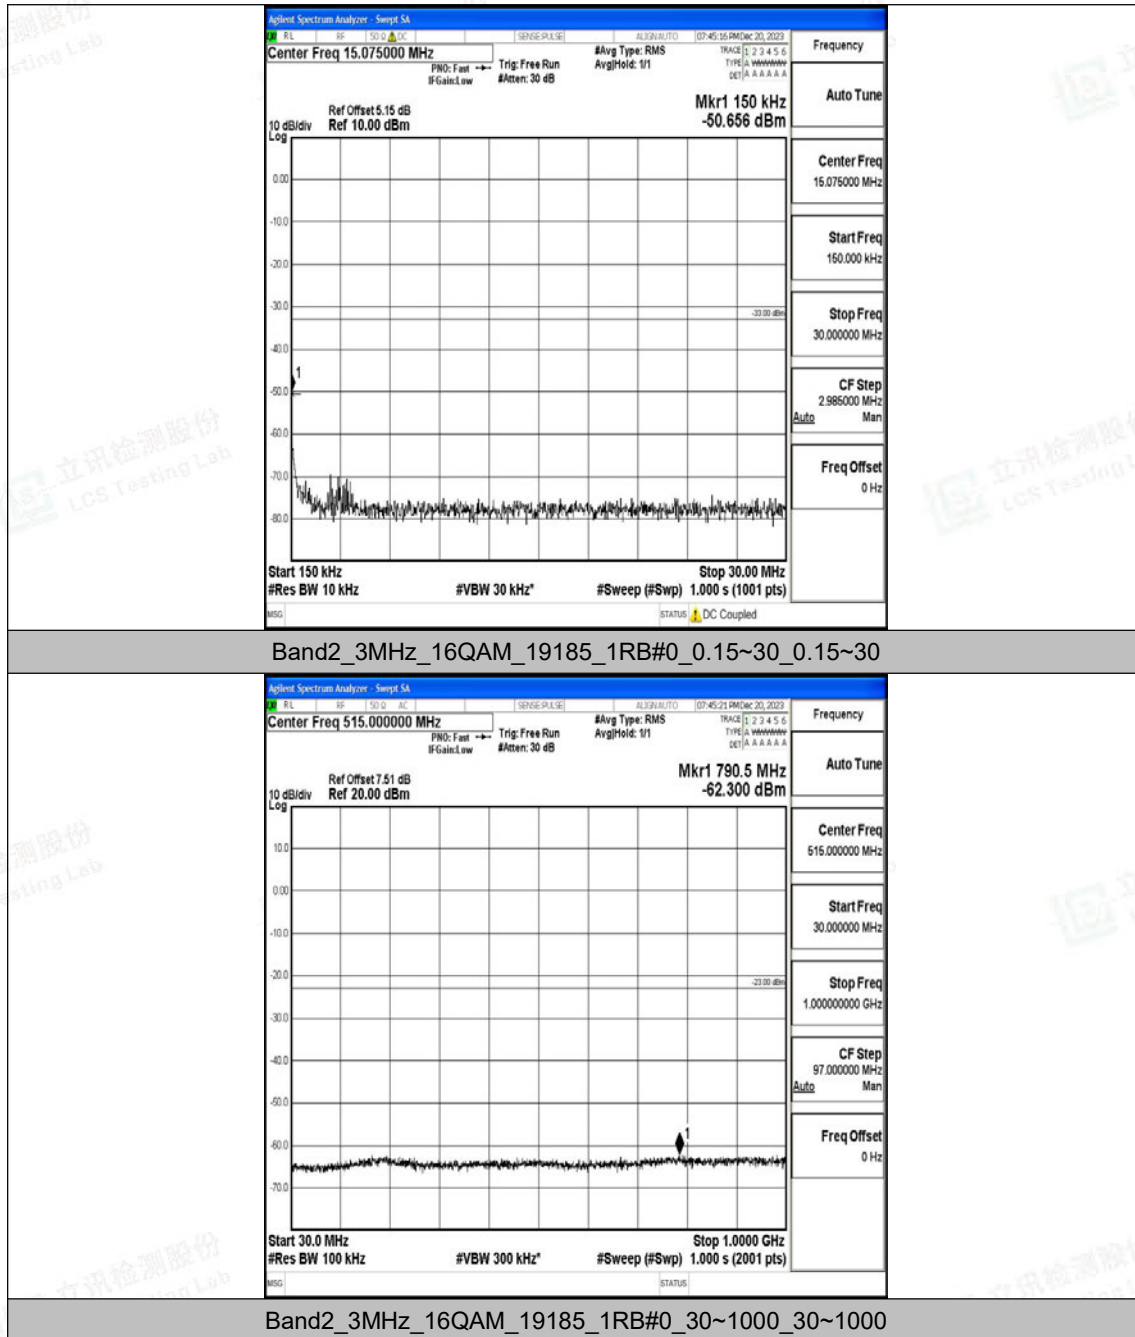

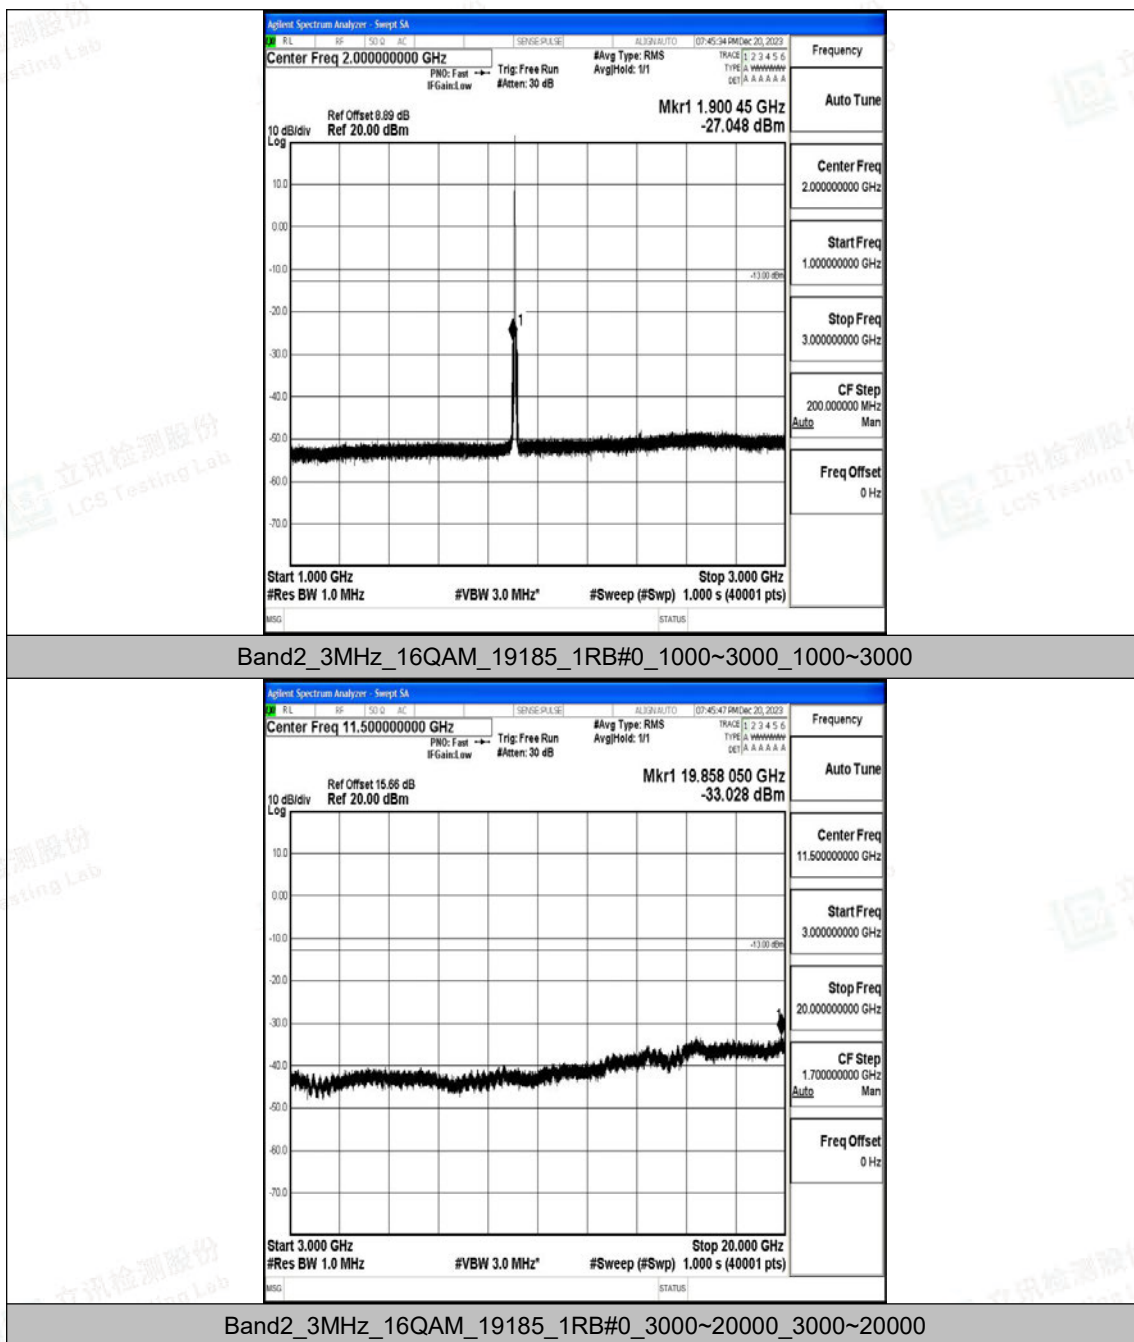

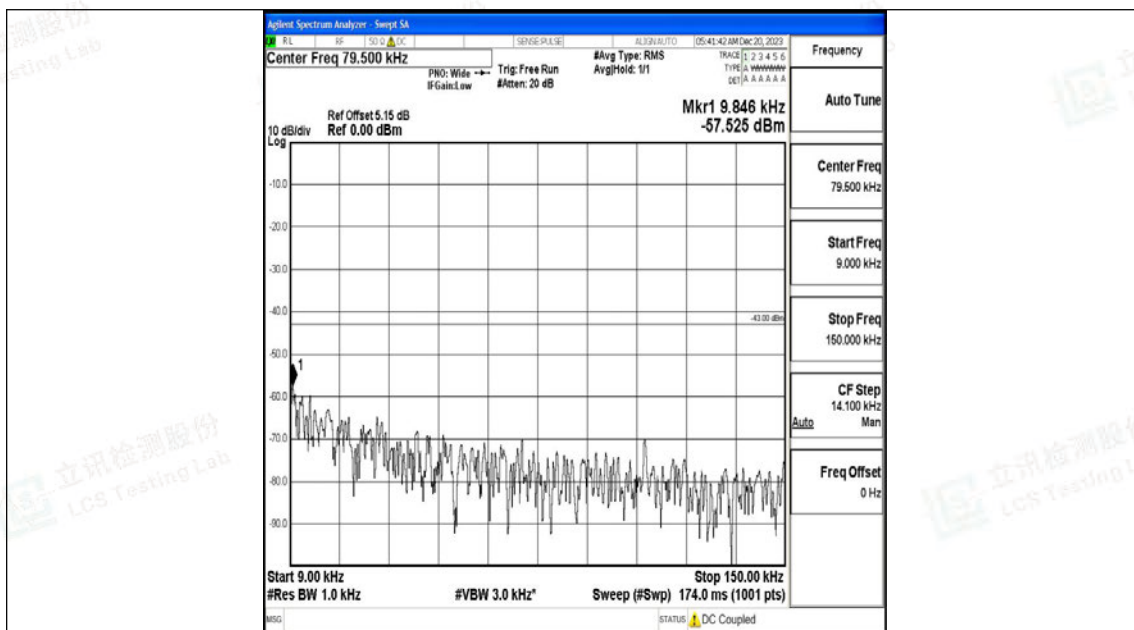

Band2_5MHz_QPSK_18625_1RB#0_0.009~0.15_0.009~0.15

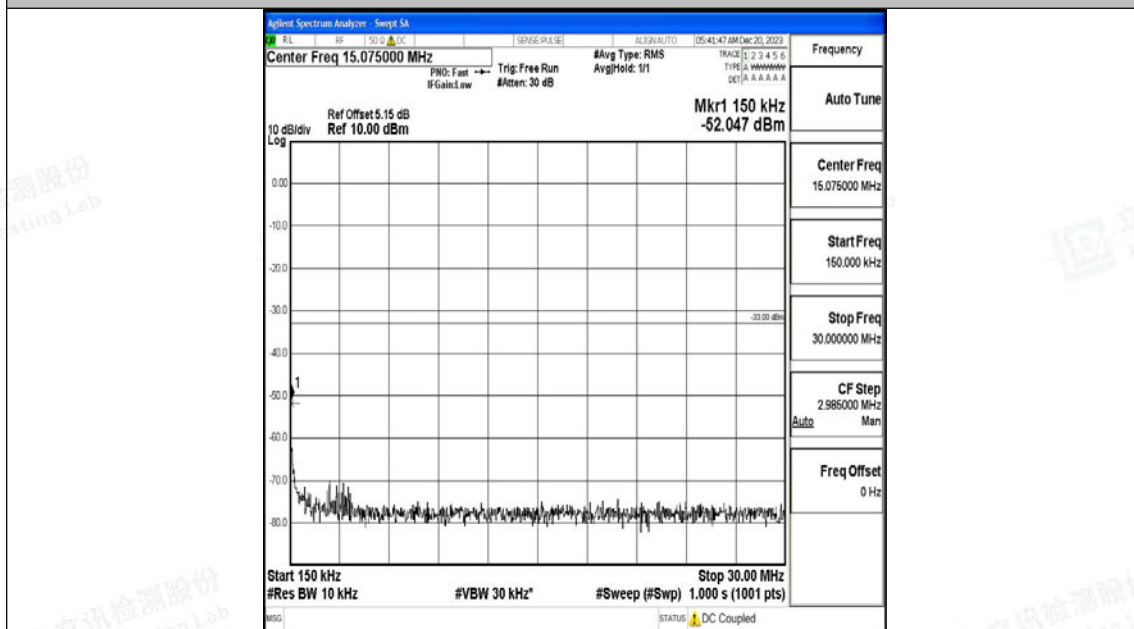

Band2_5MHz_QPSK_18625_1RB#0_0.15~30_0.15~30





Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

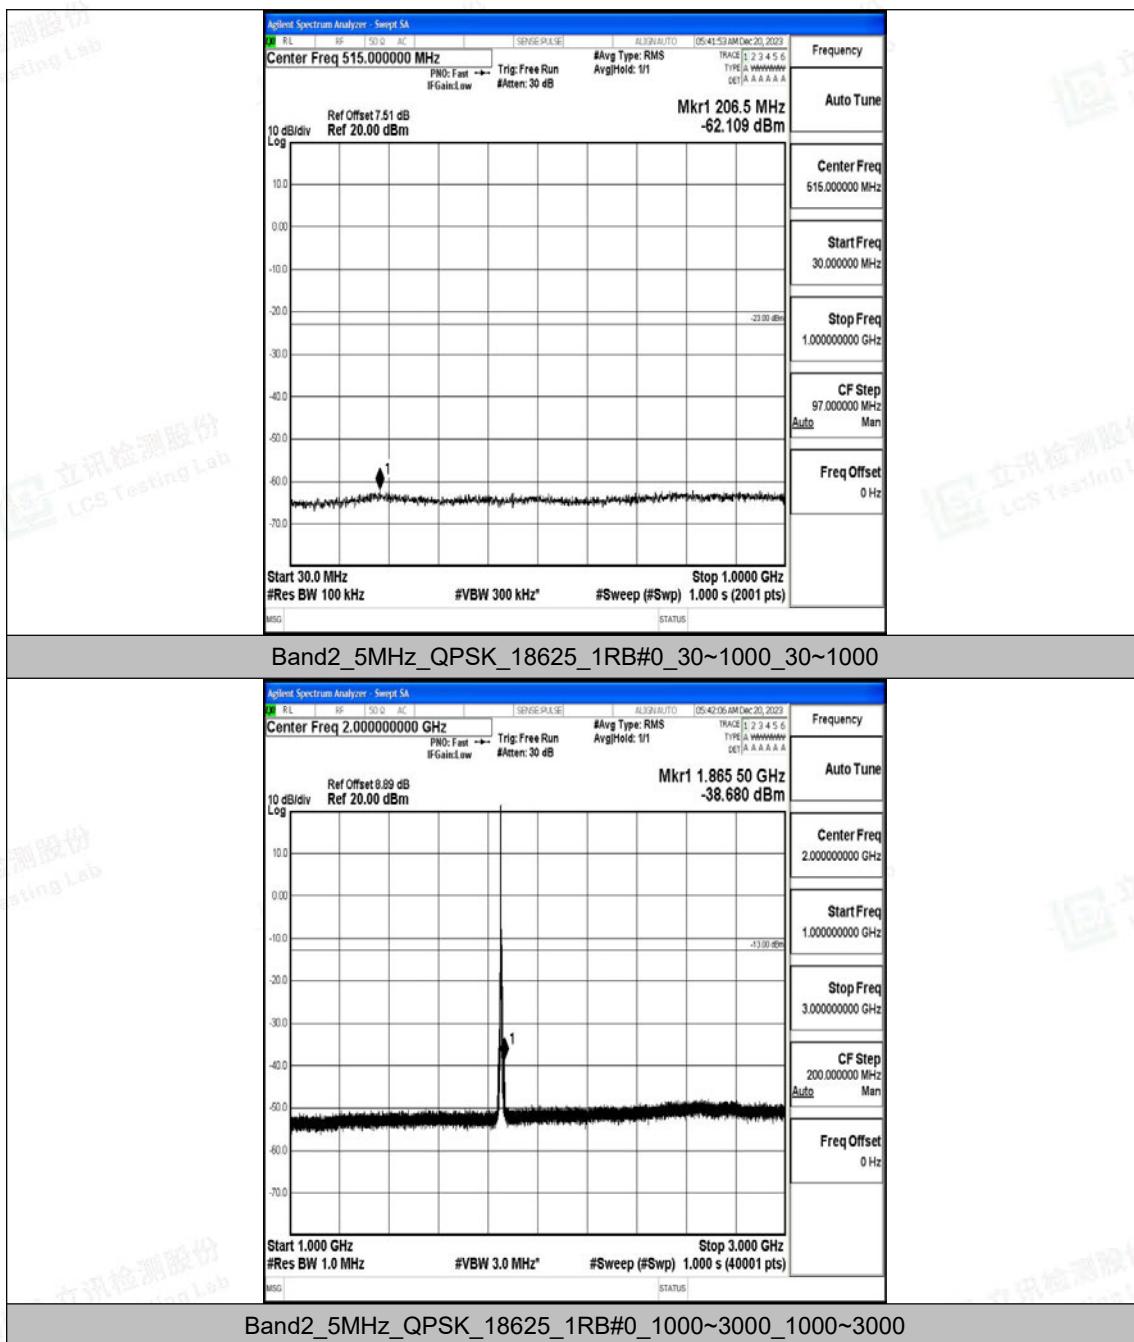

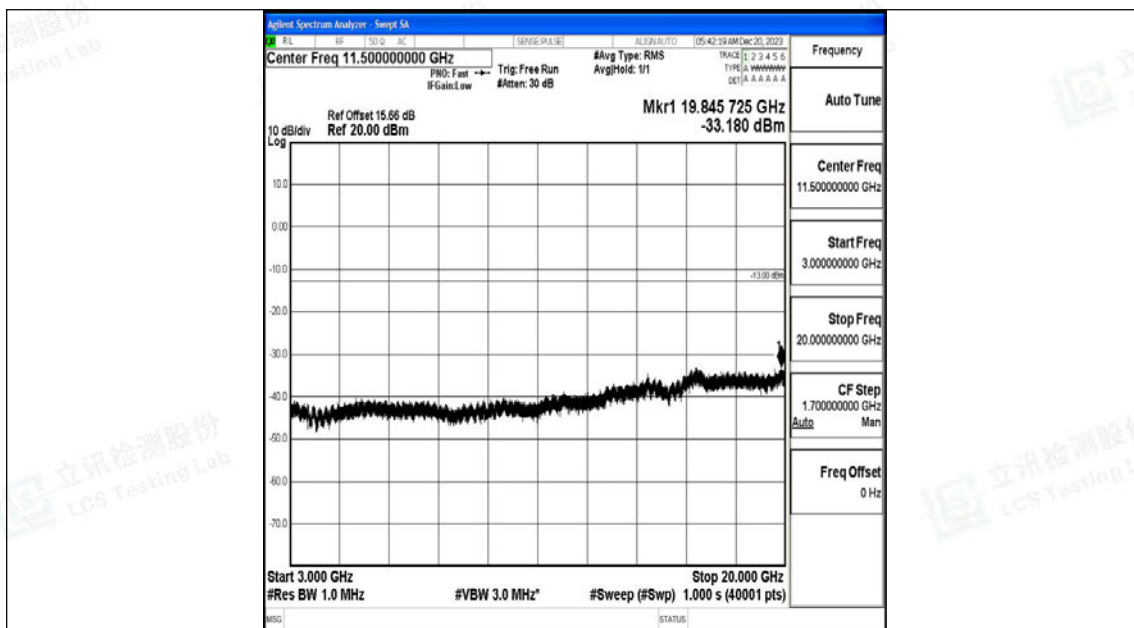


Band2_5MHz_QPSK_18625_1RB#0_3000~20000_3000~20000

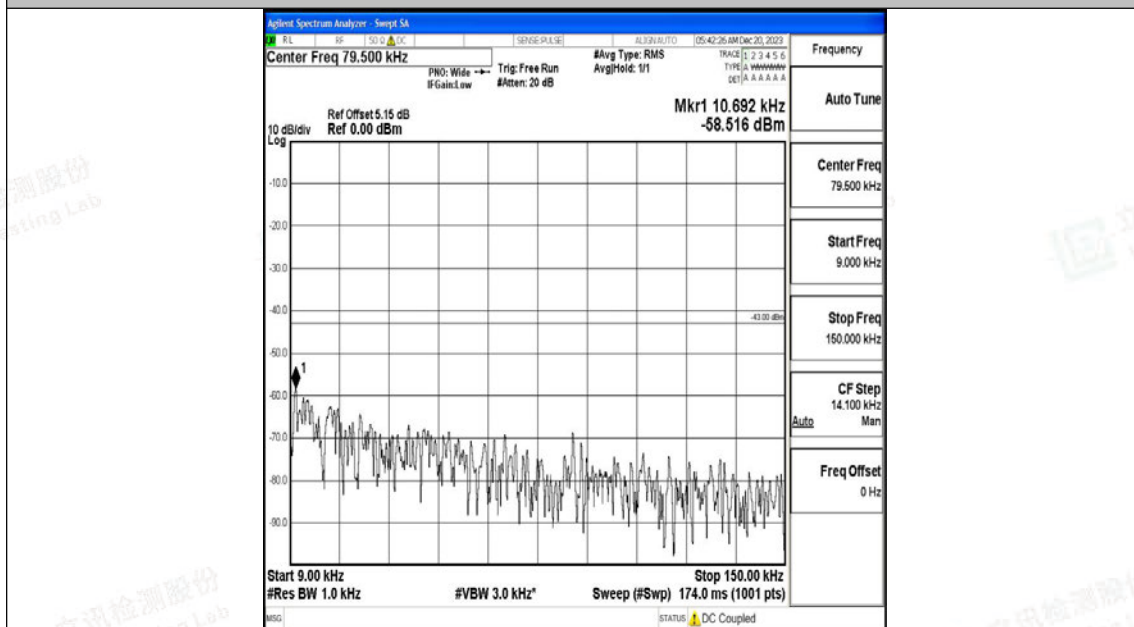

Band2_5MHz_16QAM_18625_1RB#0_0.009~0.15_0.009~0.15



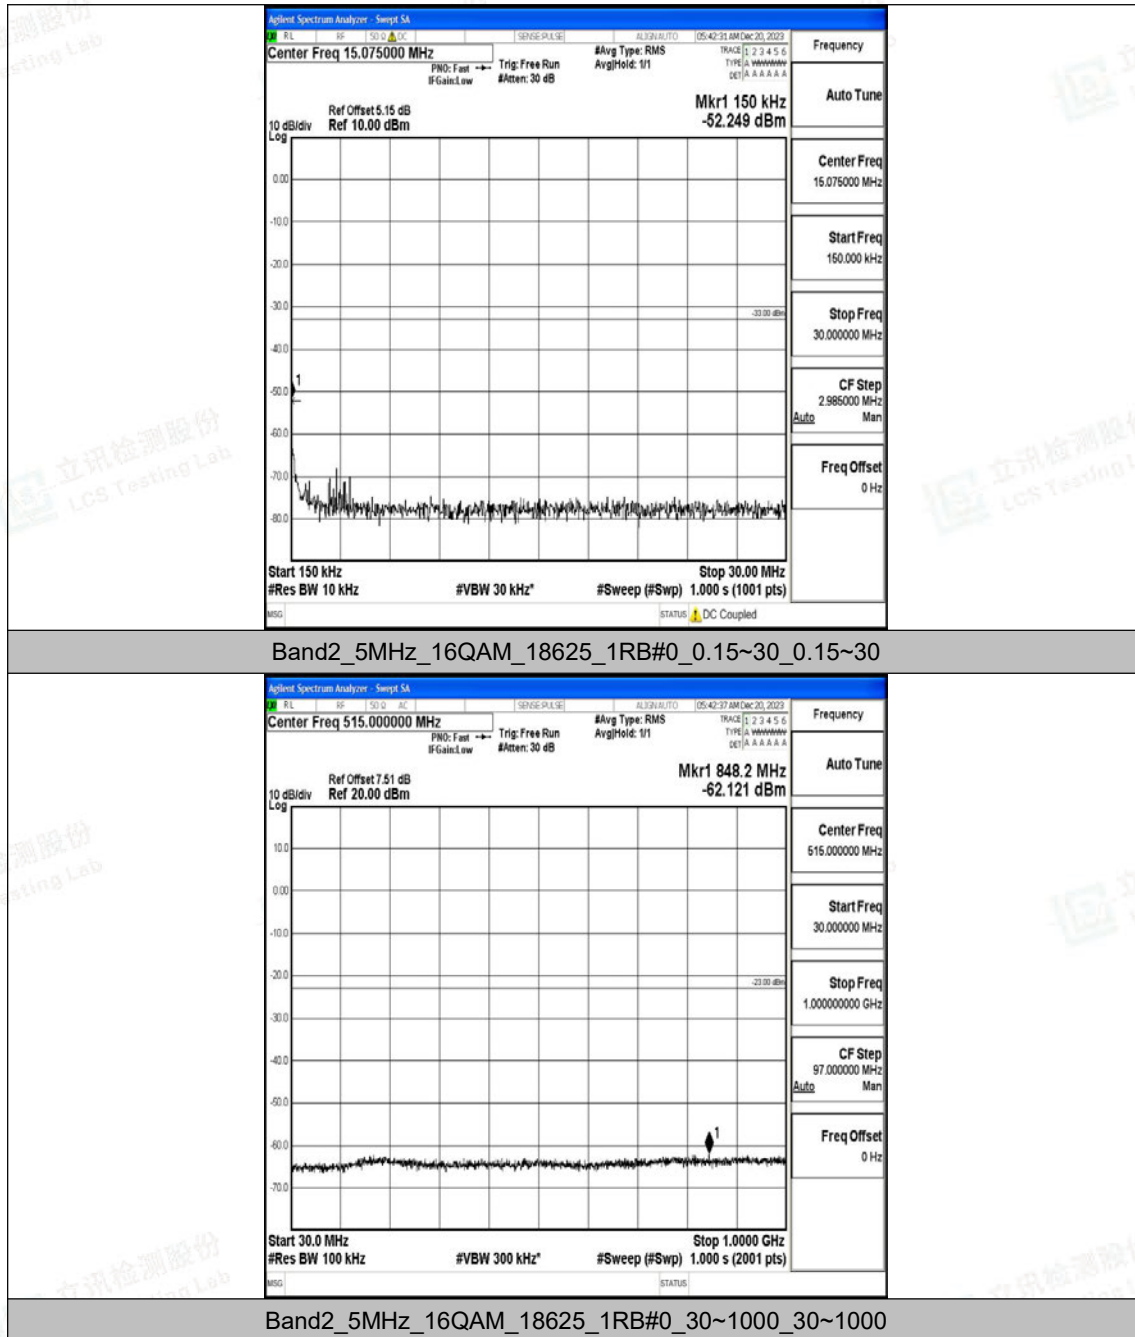


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

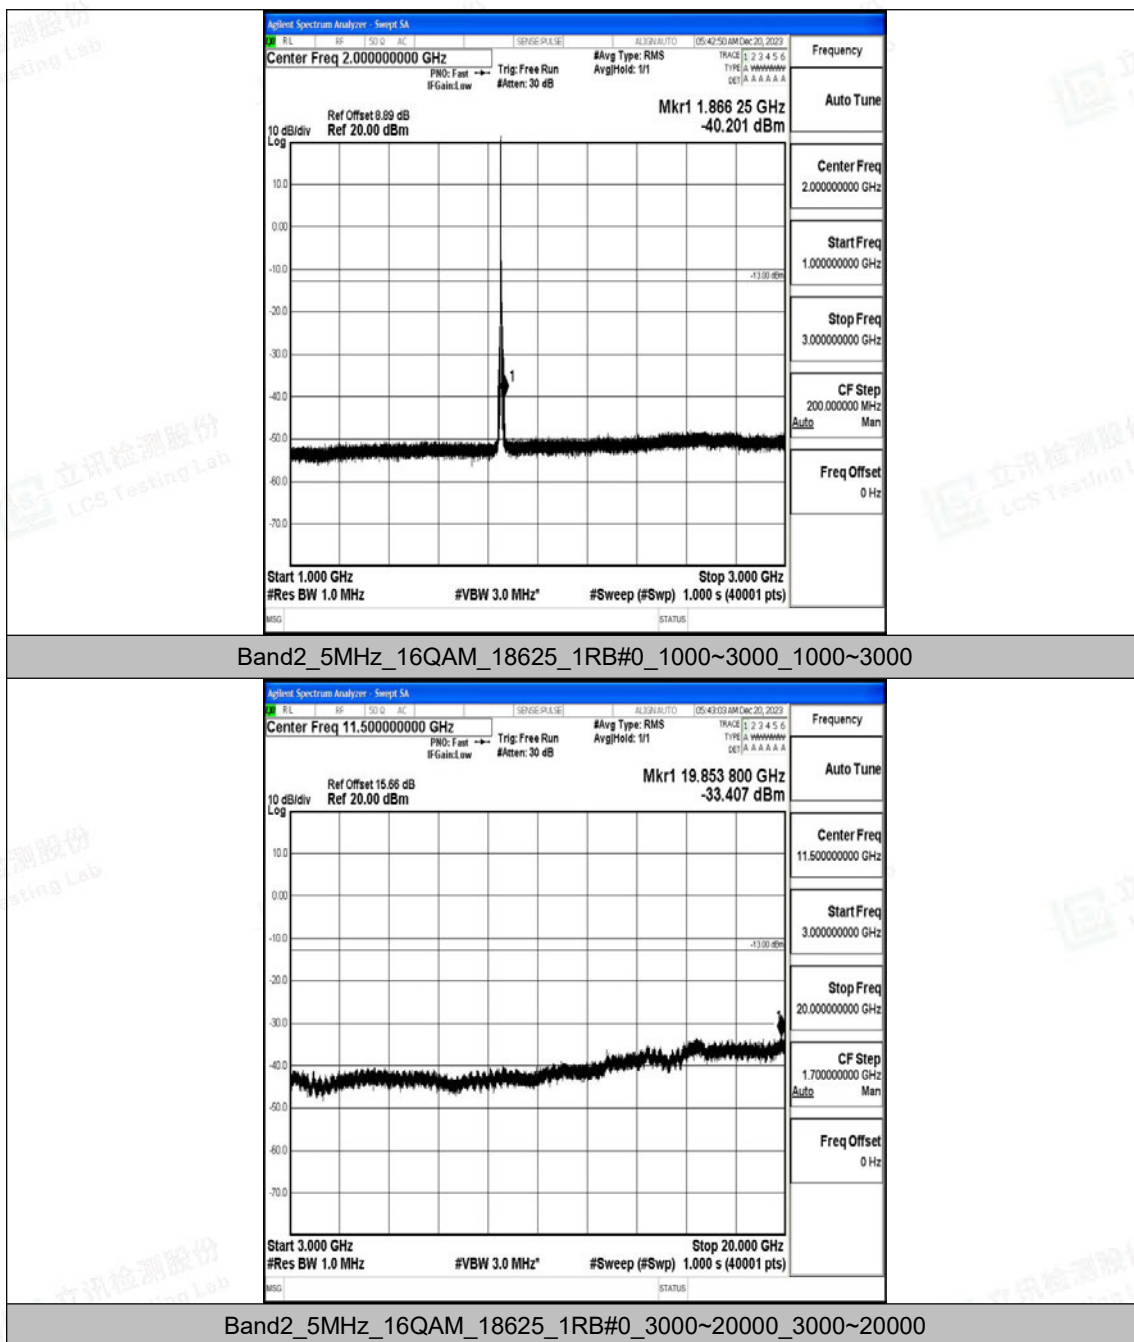


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

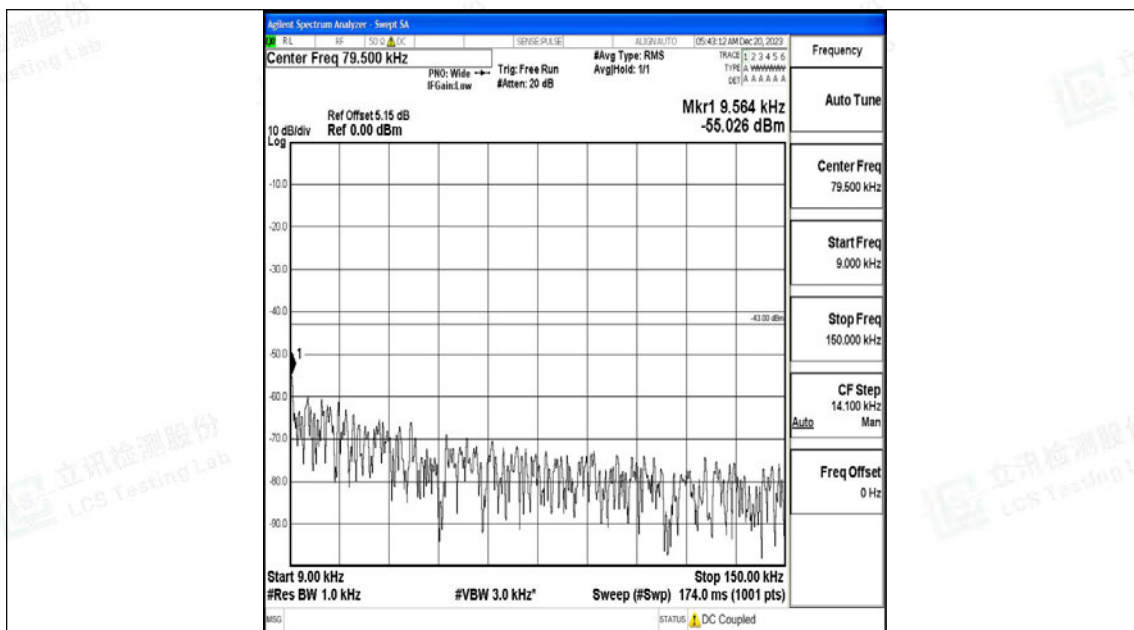

Band2_5MHz_QPSK_18900_1RB#0_0.009~0.15_0.009~0.15

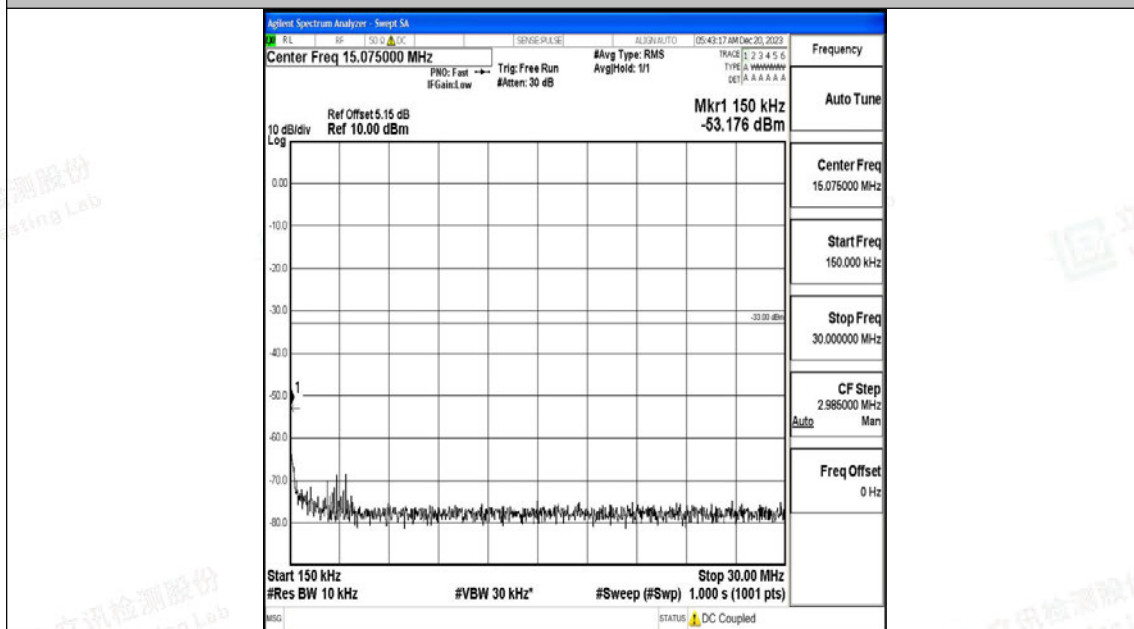

Band2_5MHz_QPSK_18900_1RB#0_0.15~30_0.15~30





Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

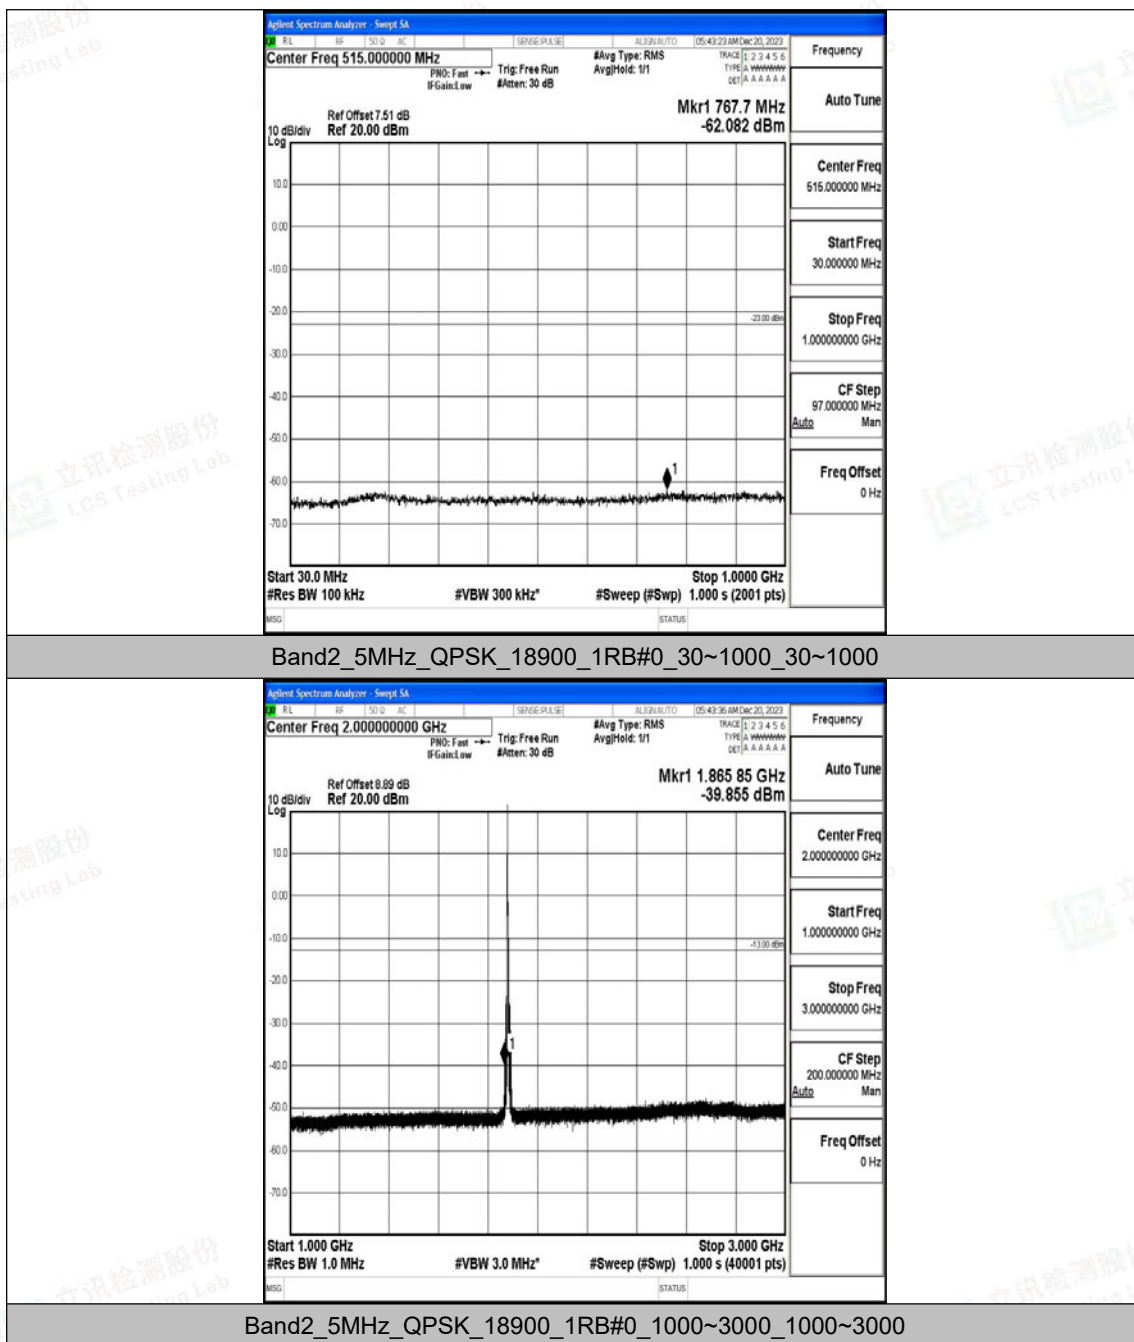

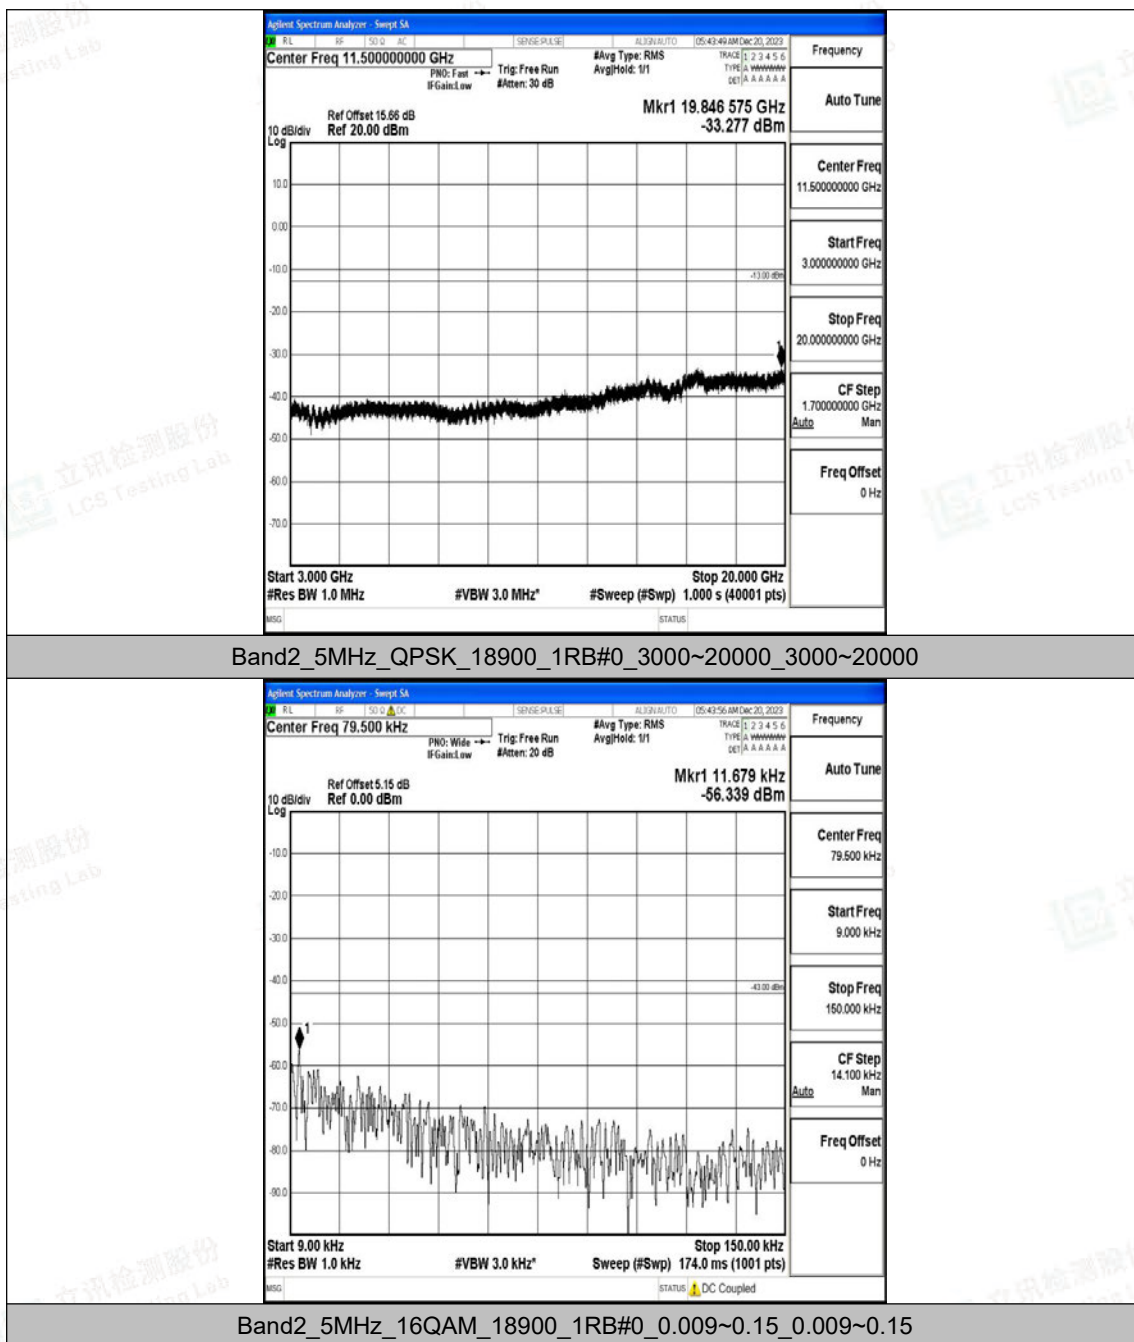

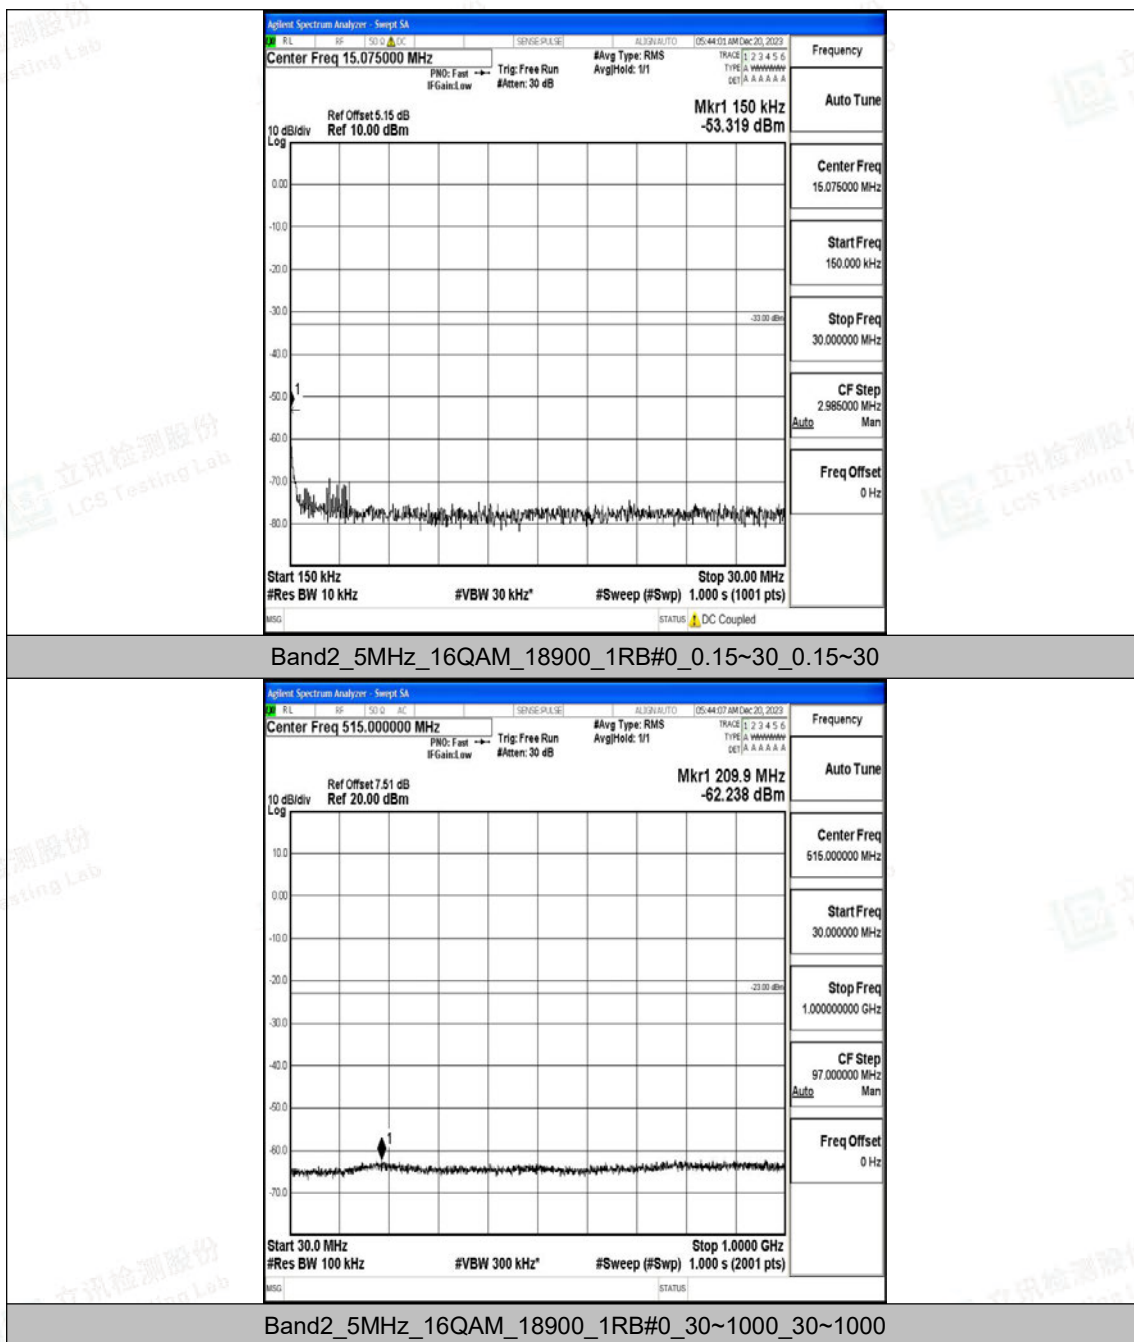



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

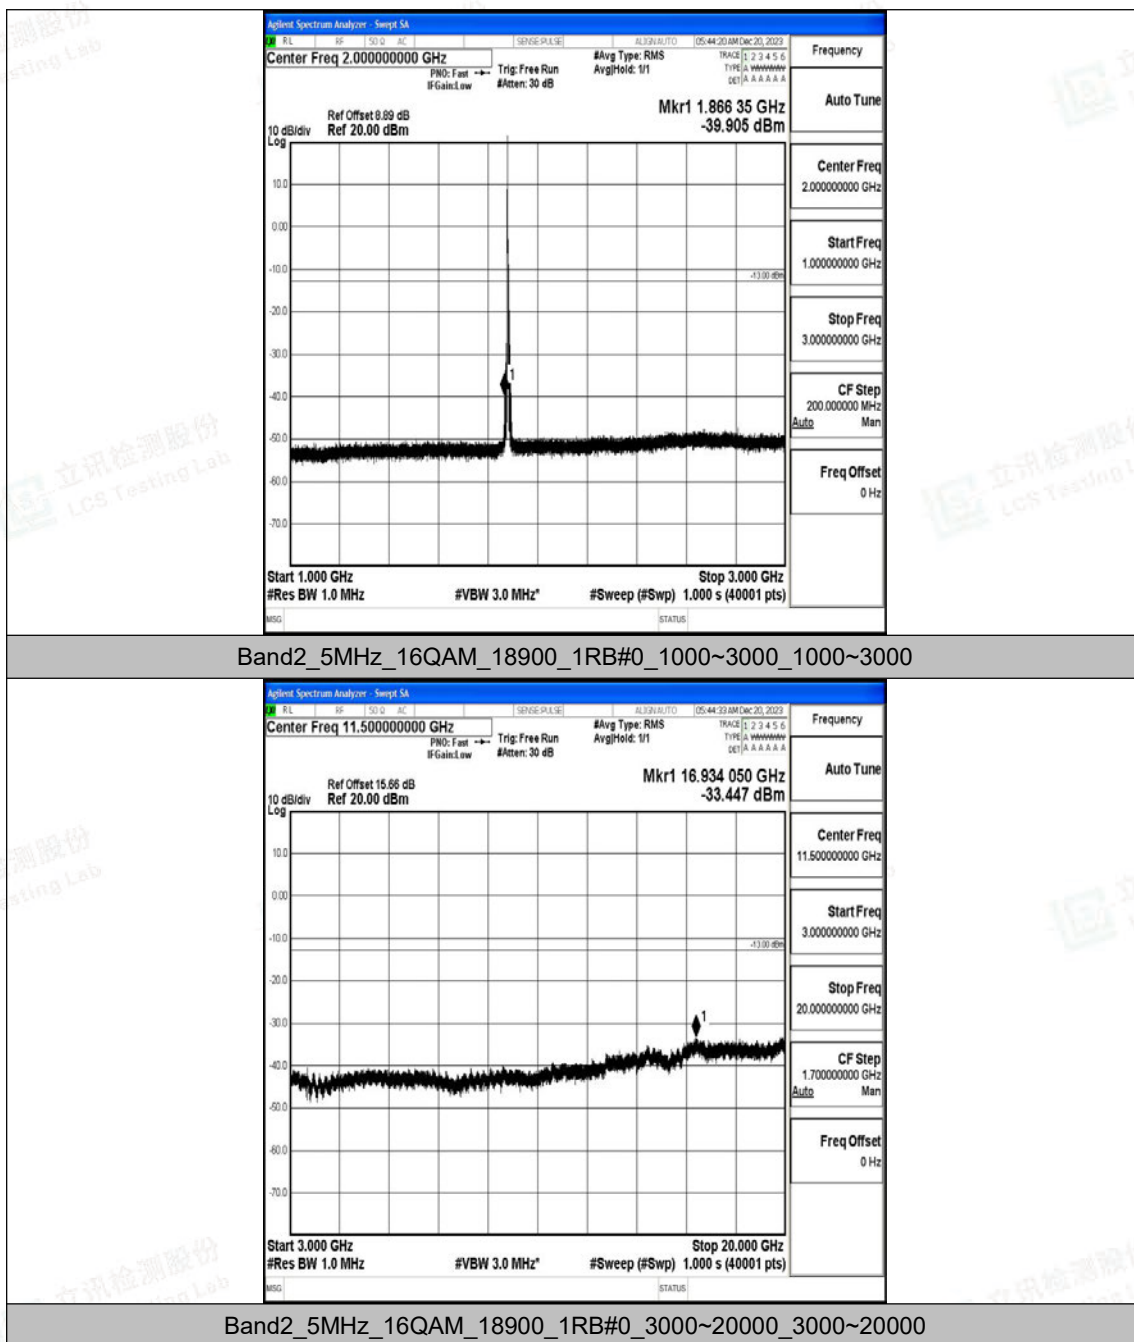

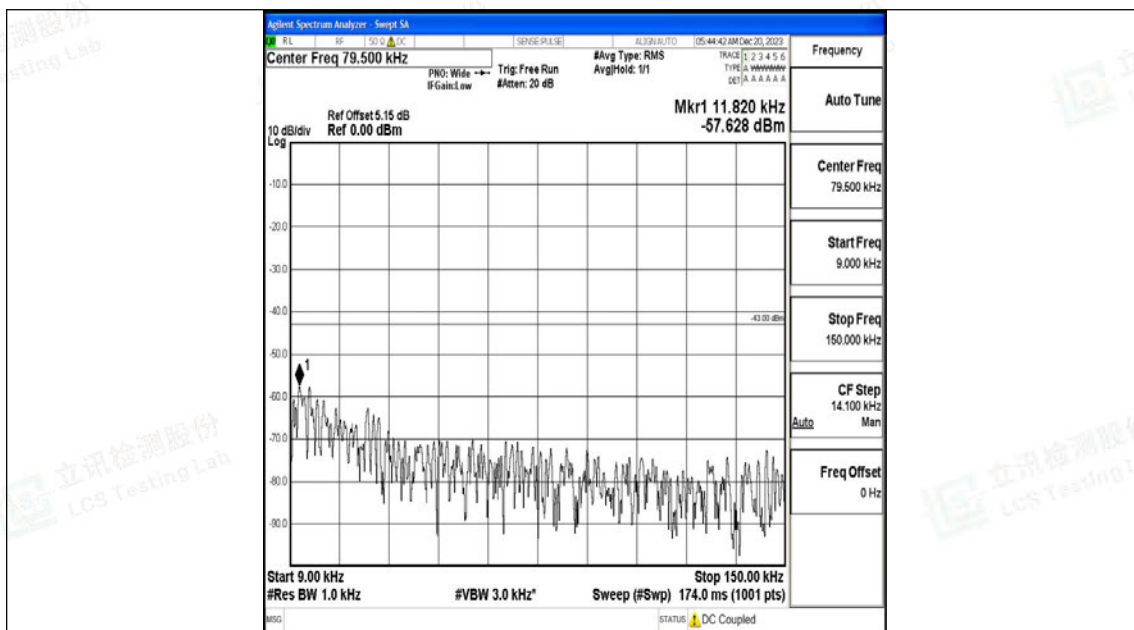



Band2_5MHz_QPSK_19175_1RB#0_0.009~0.15_0.009~0.15

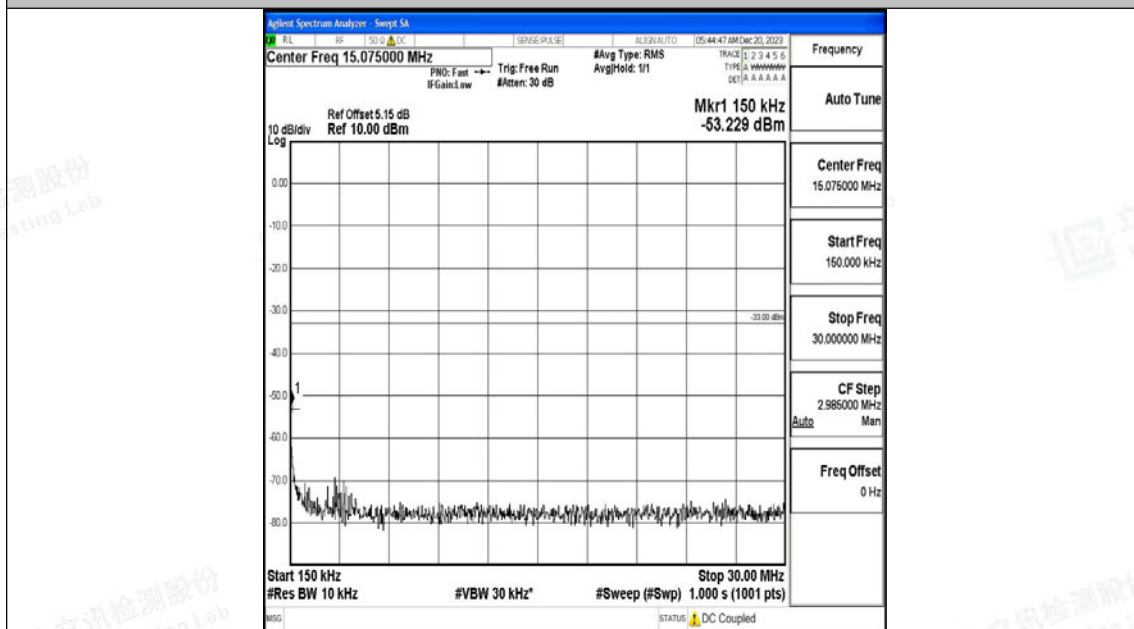


Band2_5MHz_QPSK_19175_1RB#0_0.15~30_0.15~30



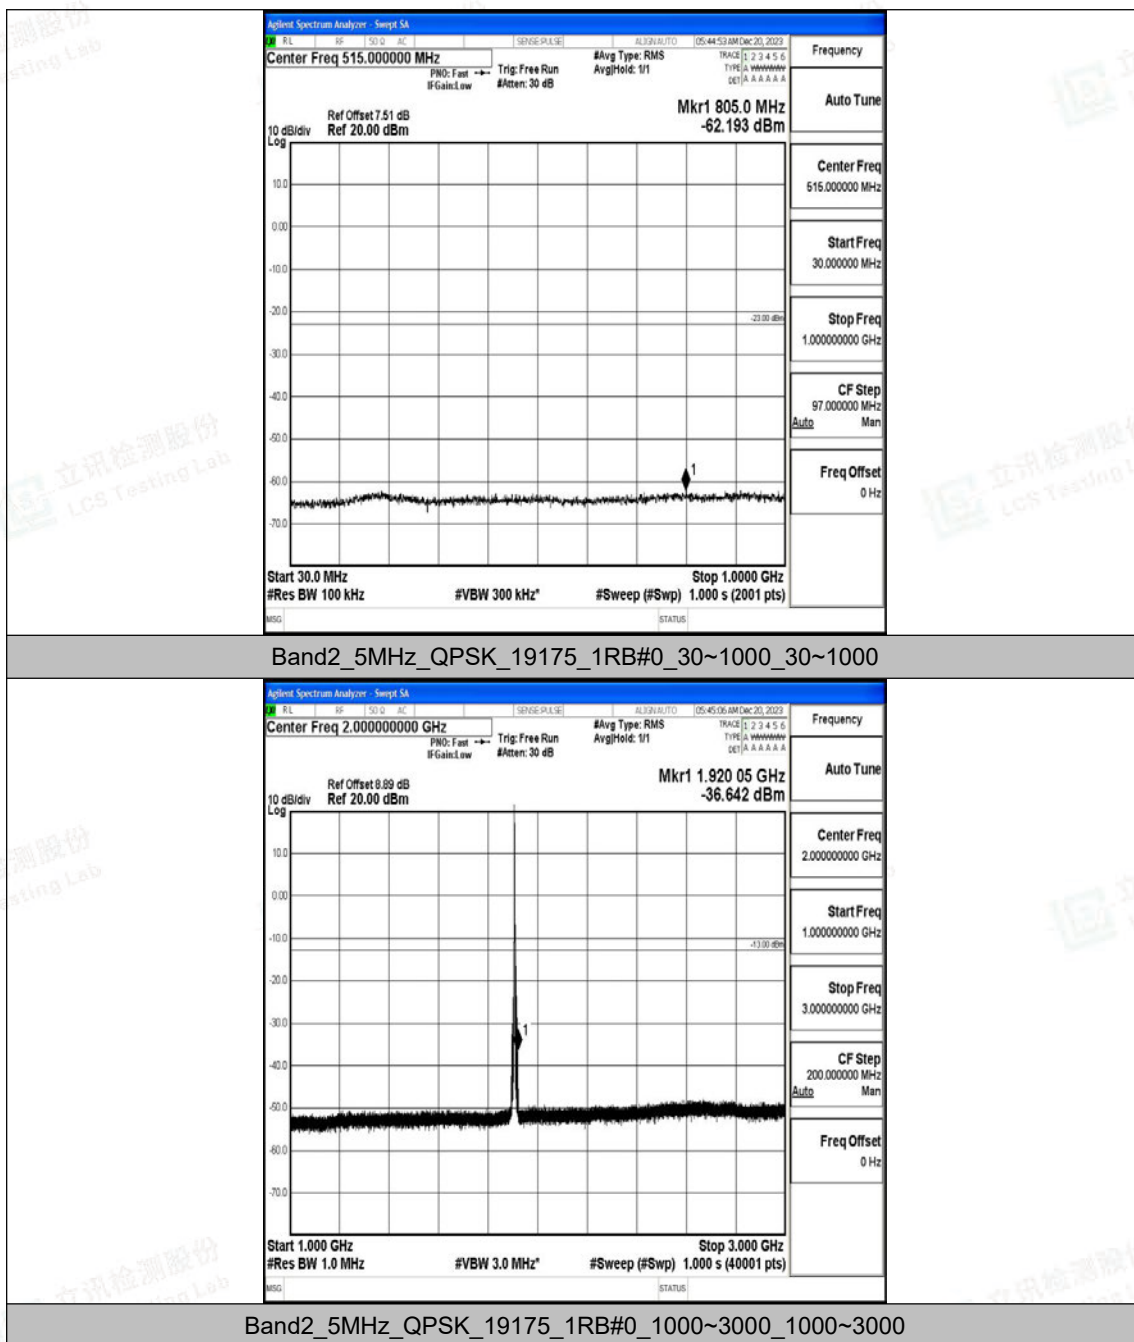

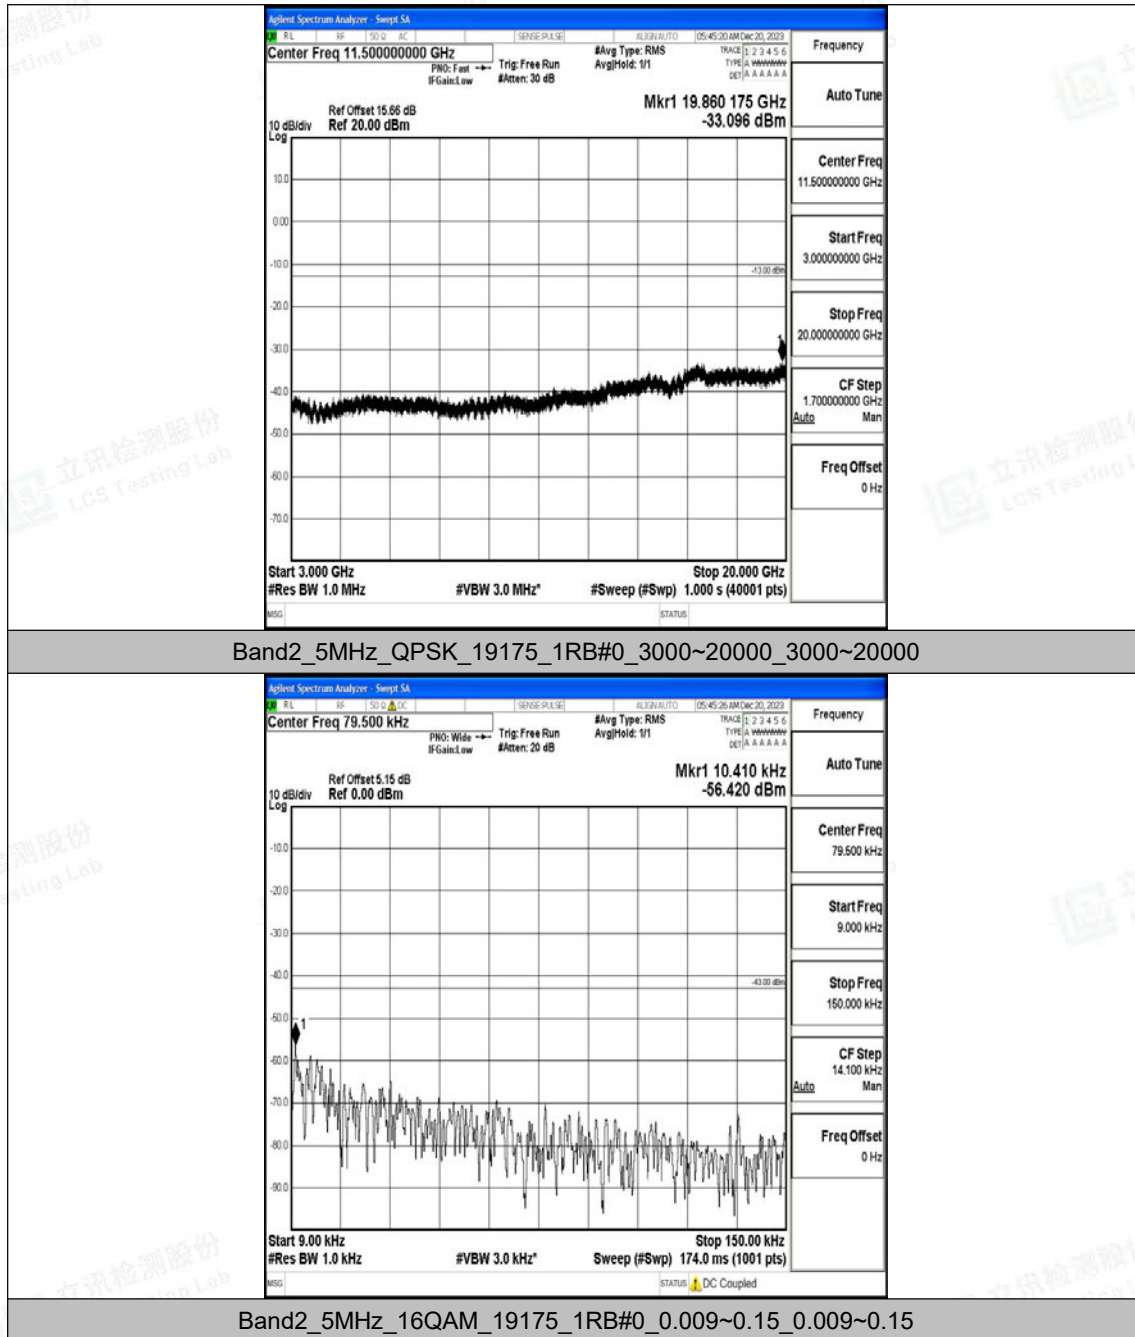

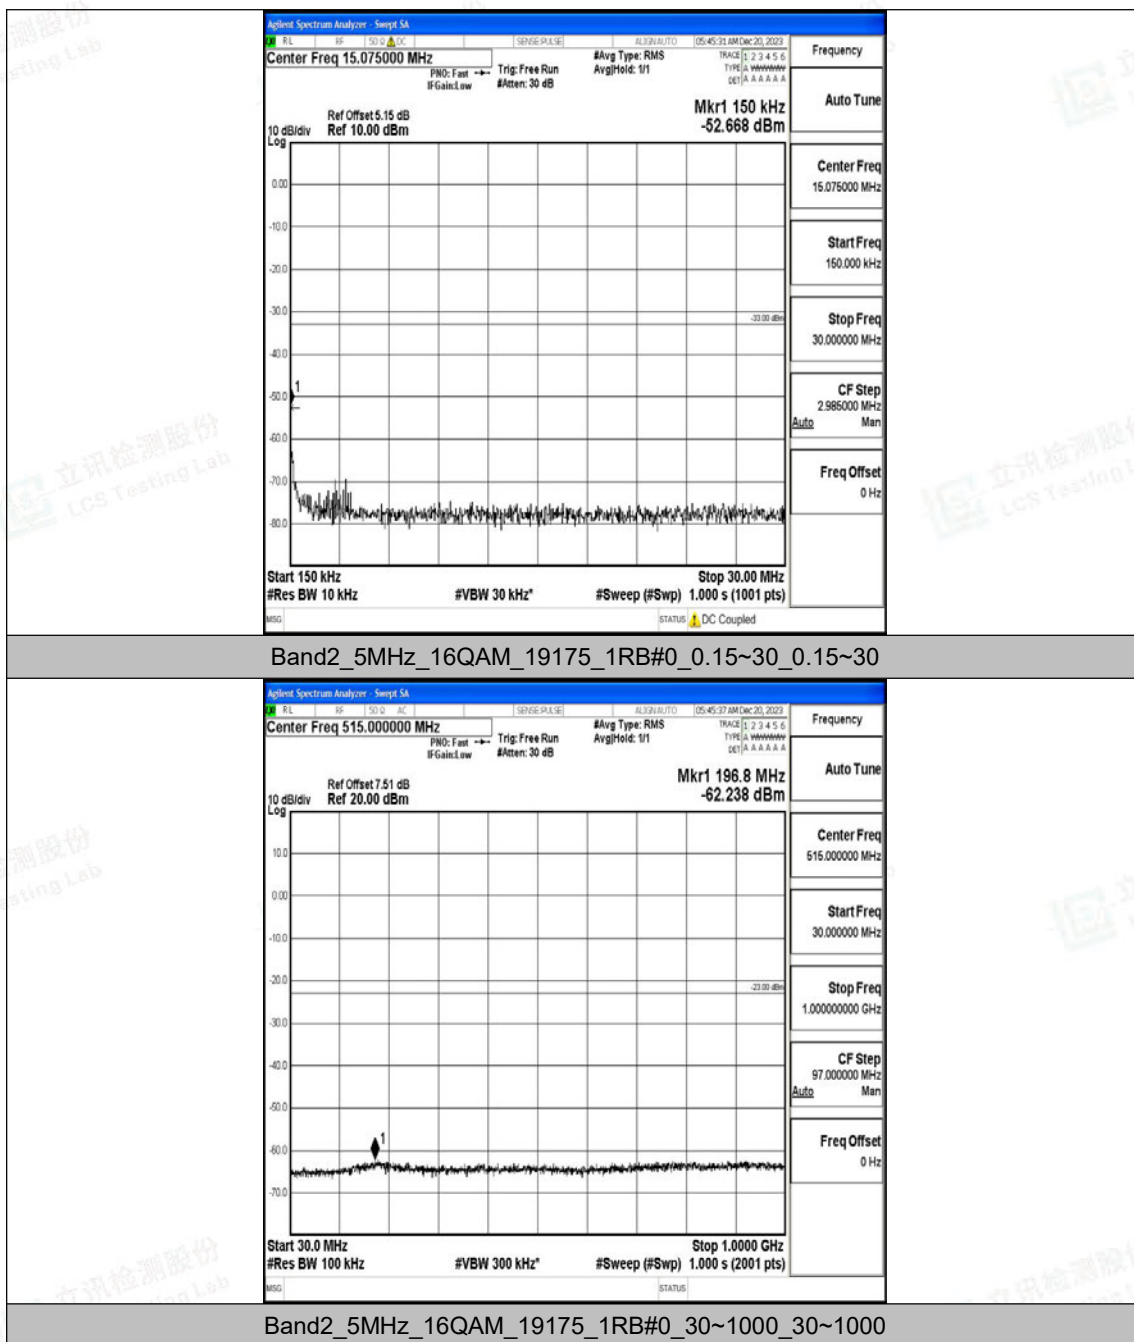



Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

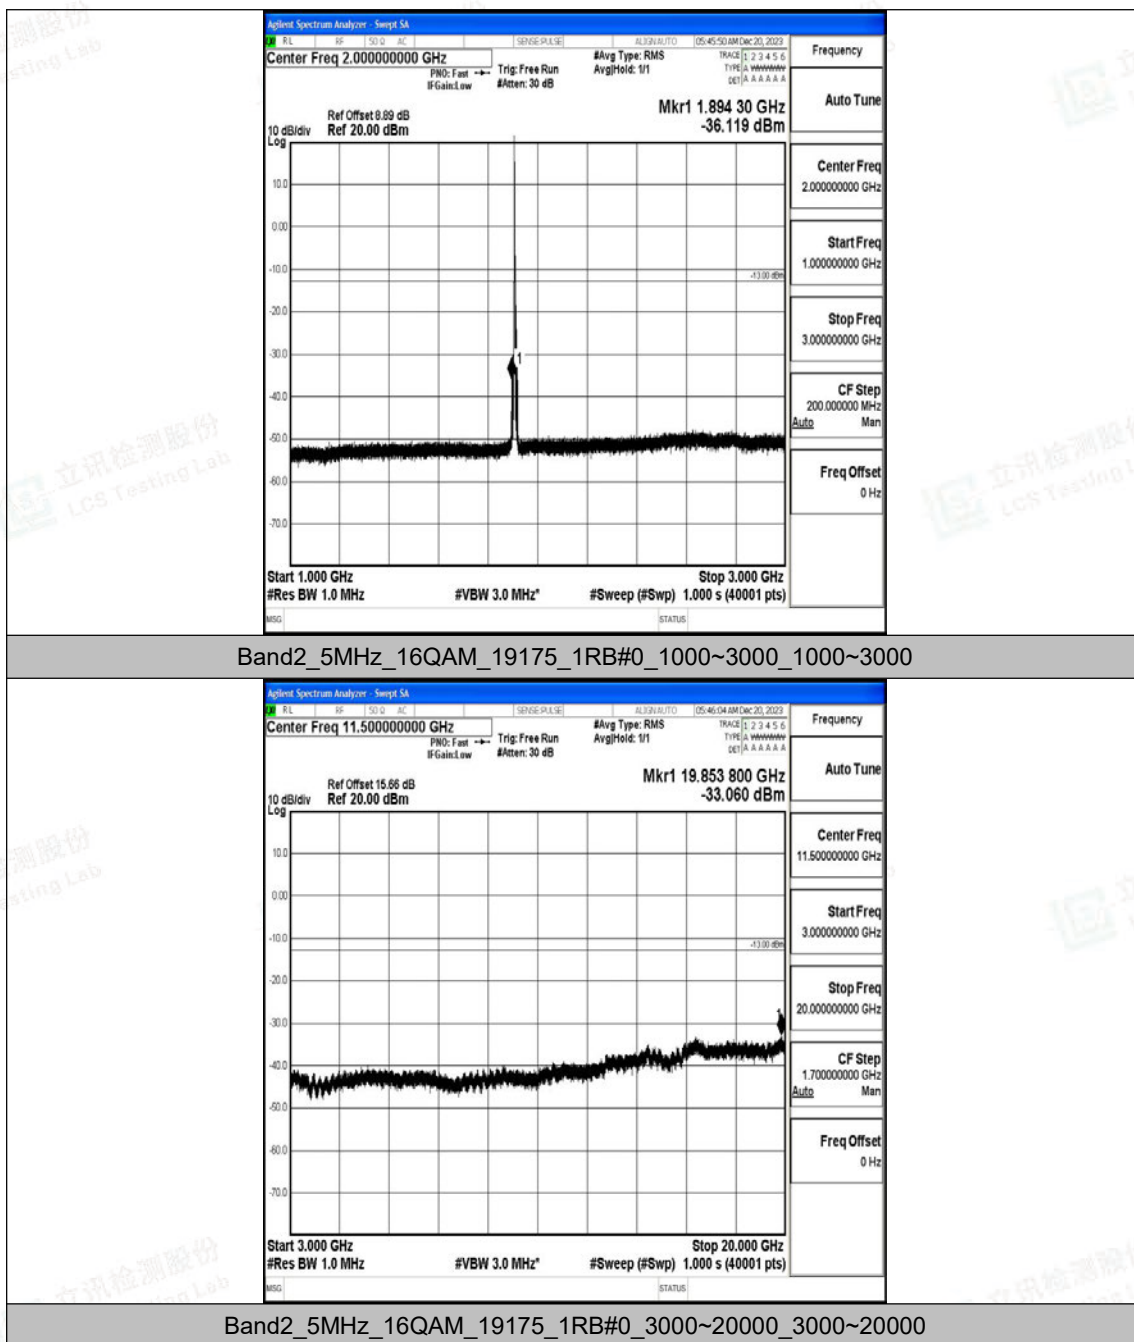


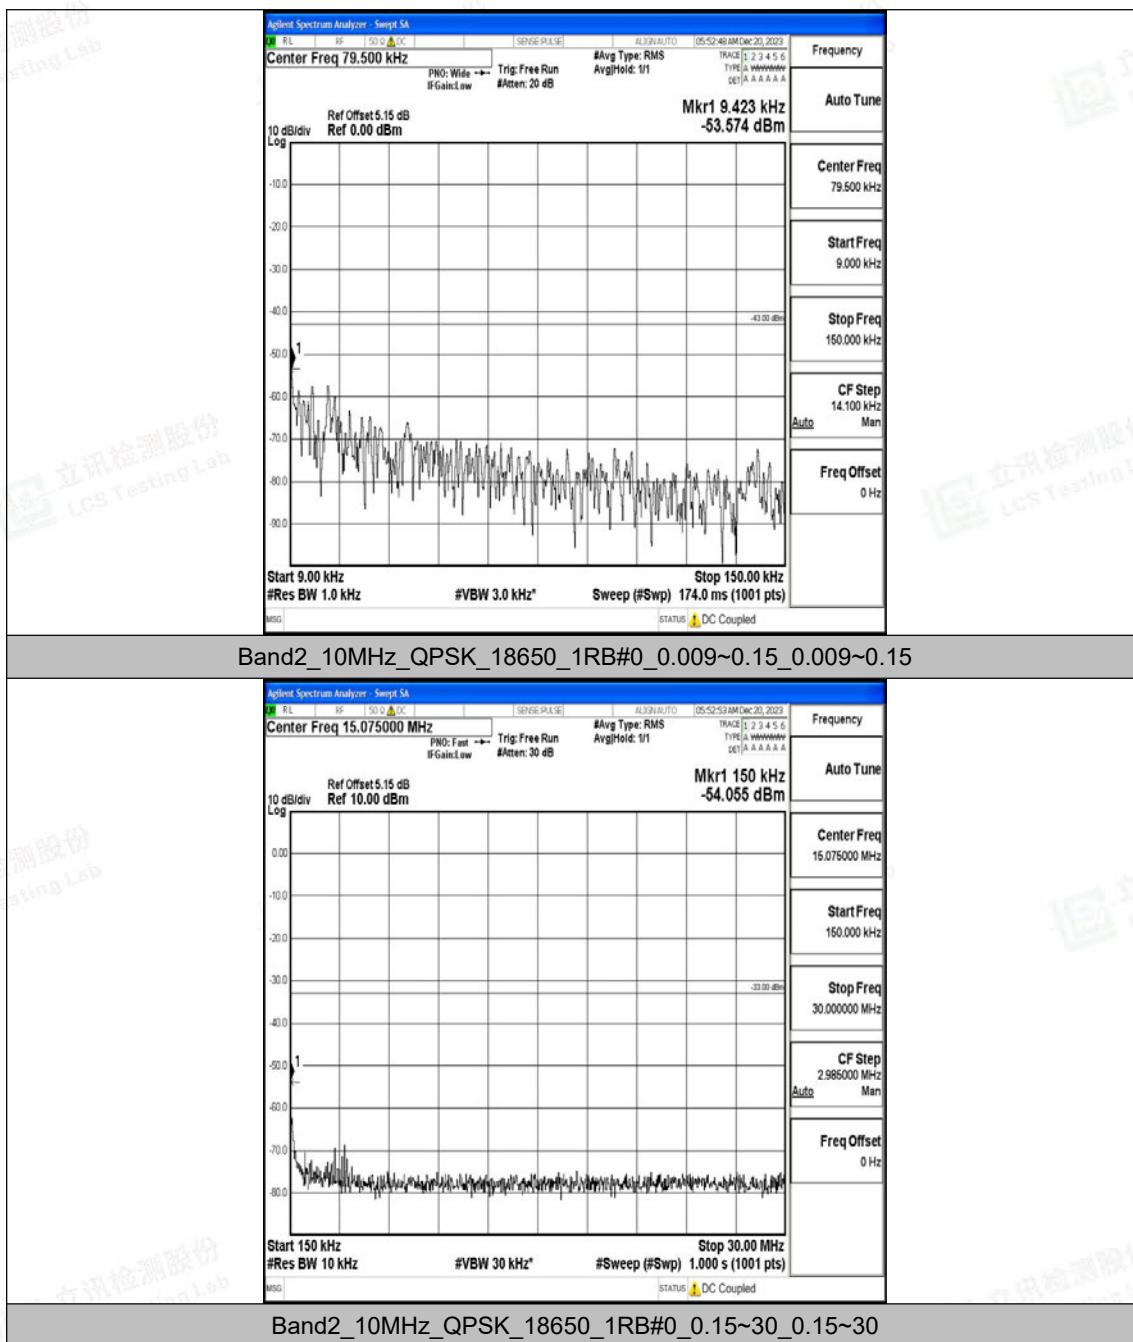

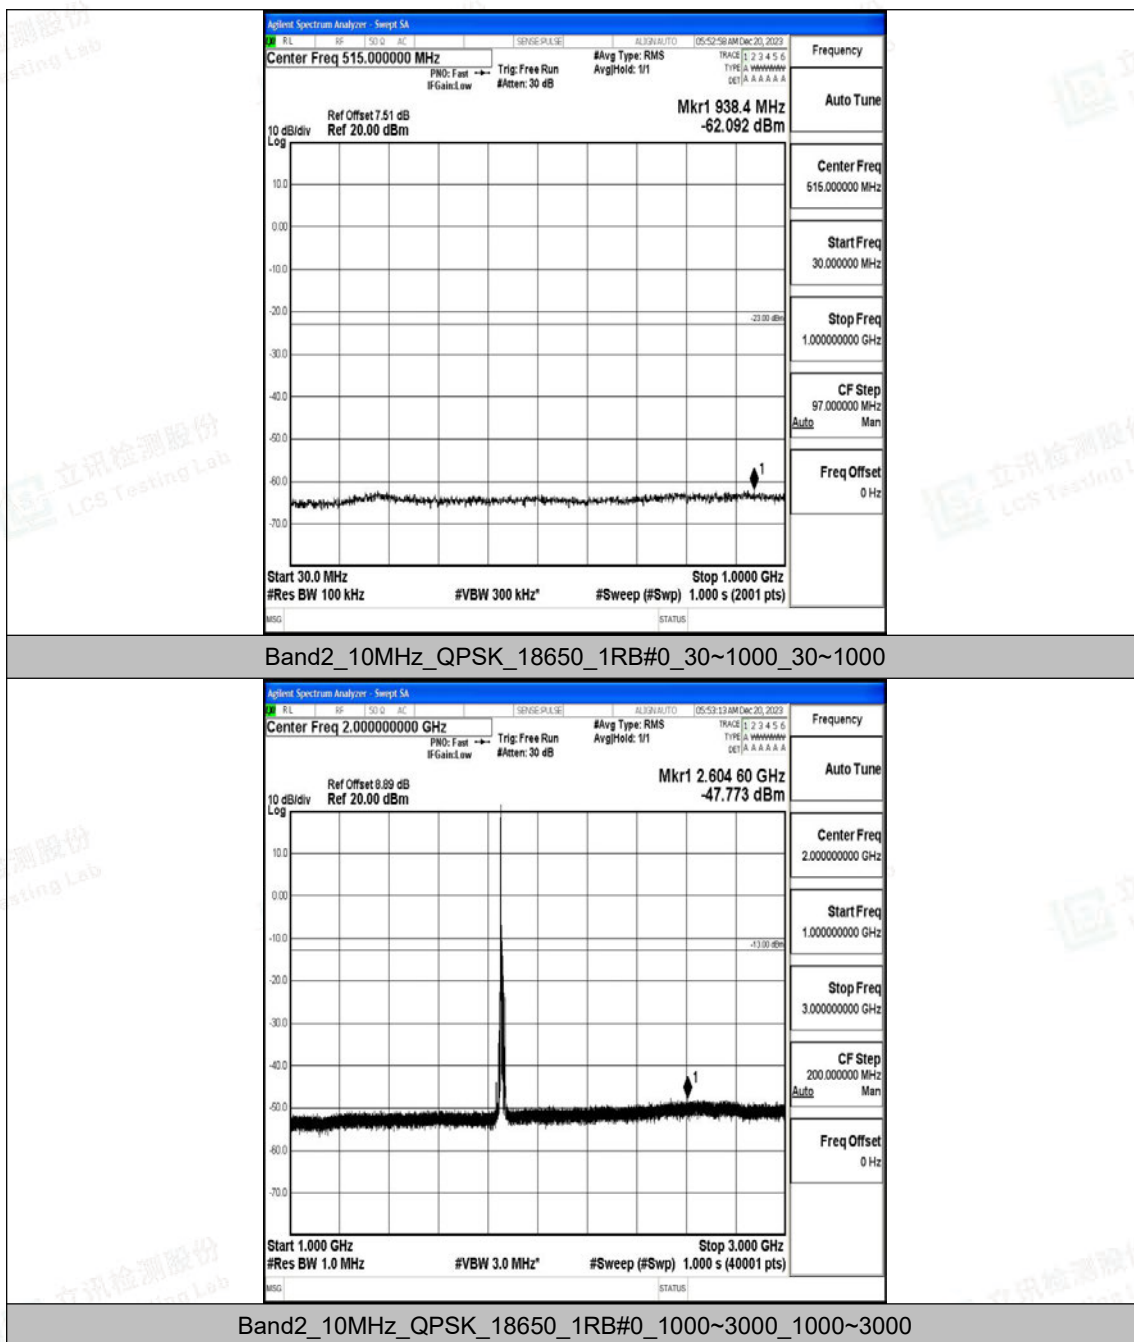

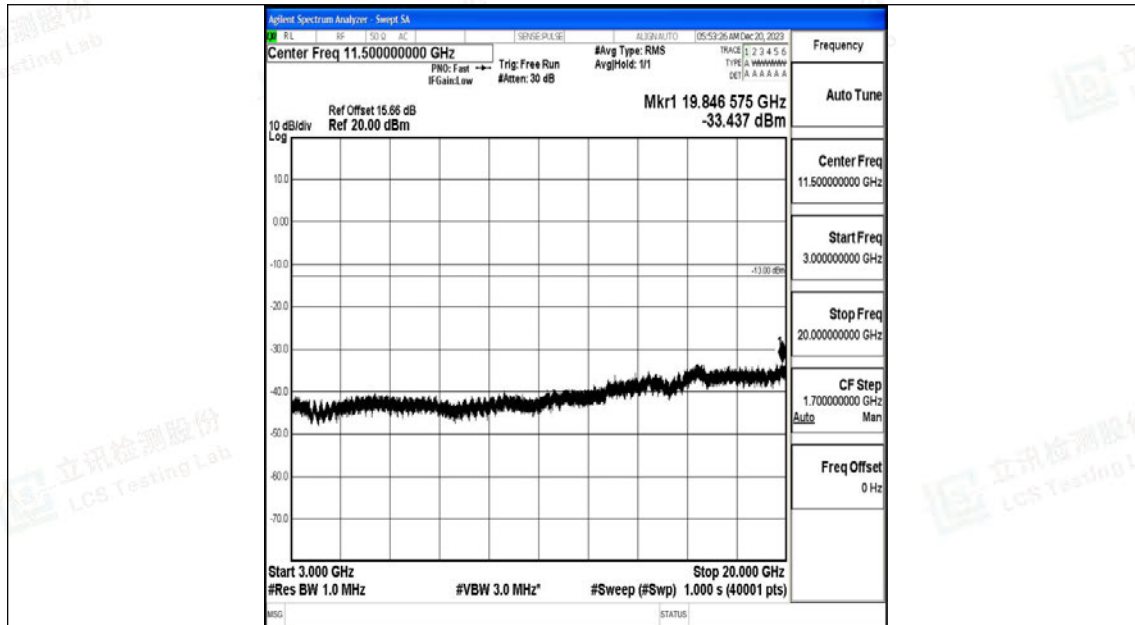

Band2_10MHz_QPSK_18650_1RB#0_3000~20000_3000~20000

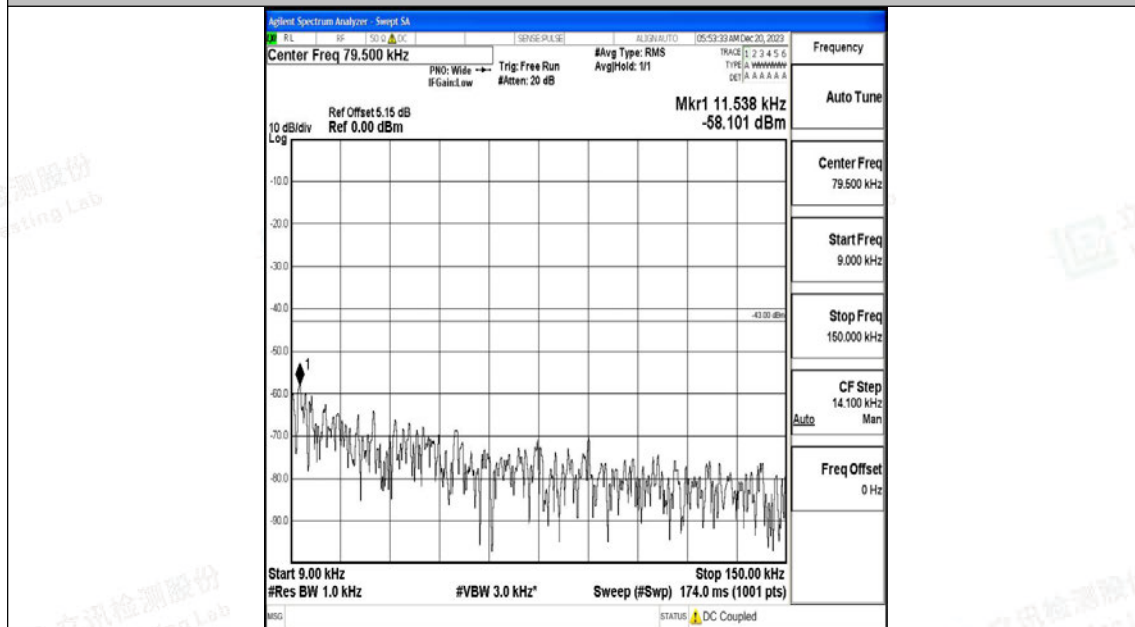

Band2_10MHz_16QAM_18650_1RB#0_0.009~0.15_0.009~0.15

