



Appendix B

NR Band N41



CONTENT

Page

1	EFFECTIVE (ISOTROPIC) RADIATED POWER OUTPUT DATA.....	3
2	PEAK-TO-AVERAGE RATIO	31
2.1	TEST RESULTS	31
2.2	TEST PLOTS.....	31
3	MODULATION CHARACTERISTICS	33
3.1	TEST PLOTS.....	33
3.1.1	Test Band = N41	33
4	OCCUPIED BANDWIDTH & 26DB EMISSION BANDWIDTH	36
4.1	TEST RESULTS	36
4.2	TEST PLOTS.....	37
5	BAND EDGES COMPLIANCE	74
5.1	TEST PLOTS.....	74
6	SPURIOUS EMISSION AT ANTENNA TERMINAL	107
6.1	TEST PLOTS.....	107
7	FIELD STRENGTH OF SPURIOUS RADIATION	111
7.1	TEST BAND = N41(ANT5)	111
7.1.1	Test Mode = 100MHz _TM1.....	111
8	FREQUENCY STABILITY.....	113
8.1	FREQUENCY ERROR VS. VOLTAGE	113
8.2	FREQUENCY ERROR VS. TEMPERATURE	113



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.
Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

SGS-CSTC Standards Technical Services Co., Ltd.
Shenzhen Branch (Inspection & Testing Services Laboratory)

No.1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgsgroup.com.cn
 中国·深圳·科技园中区M-10栋一号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com



1 Effective (Isotropic) Radiated Power Output Data

Ant5:

NR Band	Bandwidth	SCS	Modulation	Channel	RB Config	Conducted Power(dBm)	EIRP (dBm)	Limit (dBm)	Verdict
N41	20MHz	30KHz	TM1	501204	Inner Full	25.16	23.96	33.00	PASS
N41	20MHz	30KHz	TM1	501204	Inner 1RB Left	24.70	23.50	33.00	PASS
N41	20MHz	30KHz	TM1	501204	Inner 1RB Right	24.86	23.66	33.00	PASS
N41	20MHz	30KHz	TM1	518598	Inner Full	24.53	23.33	33.00	PASS
N41	20MHz	30KHz	TM1	518598	Inner 1RB Left	24.52	23.32	33.00	PASS
N41	20MHz	30KHz	TM1	518598	Inner 1RB Right	24.74	23.54	33.00	PASS
N41	20MHz	30KHz	TM1	535998	Inner Full	24.06	22.86	33.00	PASS
N41	20MHz	30KHz	TM1	535998	Inner 1RB Left	24.10	22.90	33.00	PASS
N41	20MHz	30KHz	TM1	535998	Inner 1RB Right	22.63	21.43	33.00	PASS
N41	20MHz	30KHz	TM2	501204	Inner Full	25.14	23.94	33.00	PASS
N41	20MHz	30KHz	TM2	501204	Inner 1RB Left	24.68	23.48	33.00	PASS
N41	20MHz	30KHz	TM2	501204	Inner 1RB Right	24.85	23.65	33.00	PASS
N41	20MHz	30KHz	TM2	518598	Inner Full	24.56	23.36	33.00	PASS
N41	20MHz	30KHz	TM2	518598	Inner 1RB Left	24.44	23.24	33.00	PASS
N41	20MHz	30KHz	TM2	518598	Inner 1RB Right	24.78	23.58	33.00	PASS
N41	20MHz	30KHz	TM2	535998	Inner Full	23.76	22.56	33.00	PASS
N41	20MHz	30KHz	TM2	535998	Inner 1RB Left	23.73	22.53	33.00	PASS
N41	20MHz	30KHz	TM2	535998	Inner 1RB Right	23.23	22.03	33.00	PASS
N41	20MHz	30KHz	TM3	501204	Inner Full	24.04	22.84	33.00	PASS
N41	20MHz	30KHz	TM3	501204	Inner 1RB Left	23.61	22.41	33.00	PASS
N41	20MHz	30KHz	TM3	501204	Inner 1RB Right	23.86	22.66	33.00	PASS
N41	20MHz	30KHz	TM3	518598	Inner Full	23.54	22.34	33.00	PASS
N41	20MHz	30KHz	TM3	518598	Inner 1RB Left	23.46	22.26	33.00	PASS
N41	20MHz	30KHz	TM3	518598	Inner 1RB Right	23.74	22.54	33.00	PASS
N41	20MHz	30KHz	TM3	535998	Inner Full	22.96	21.76	33.00	PASS
N41	20MHz	30KHz	TM3	535998	Inner 1RB Left	22.56	21.36	33.00	PASS
N41	20MHz	30KHz	TM3	535998	Inner 1RB Right	22.10	20.90	33.00	PASS
N41	20MHz	30KHz	TM4	501204	Inner Full	22.54	21.34	33.00	PASS
N41	20MHz	30KHz	TM4	501204	Inner 1RB Left	22.21	21.01	33.00	PASS
N41	20MHz	30KHz	TM4	501204	Inner 1RB Right	22.30	21.10	33.00	PASS
N41	20MHz	30KHz	TM4	518598	Inner Full	22.06	20.86	33.00	PASS
N41	20MHz	30KHz	TM4	518598	Inner 1RB Left	22.03	20.83	33.00	PASS
N41	20MHz	30KHz	TM4	518598	Inner 1RB Right	22.30	21.10	33.00	PASS
N41	20MHz	30KHz	TM4	535998	Inner Full	21.45	20.25	33.00	PASS
N41	20MHz	30KHz	TM4	535998	Inner 1RB Left	22.09	20.89	33.00	PASS
N41	20MHz	30KHz	TM4	535998	Inner 1RB Right	21.55	20.35	33.00	PASS
N41	20MHz	30KHz	TM5	501204	Inner Full	20.55	19.35	33.00	PASS
N41	20MHz	30KHz	TM5	501204	Inner 1RB Left	20.34	19.14	33.00	PASS
N41	20MHz	30KHz	TM5	501204	Inner 1RB Right	20.40	19.20	33.00	PASS
N41	20MHz	30KHz	TM5	518598	Inner Full	20.06	18.86	33.00	PASS



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

SGS-CSTC Standards Technical Services Co., Ltd.
Shenzhen Branch (Inspection & Testing Services Laboratory)

No. 1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgsgroup.com.cn
中国·深圳·科技园中区M-10栋一号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com



N41	20MHz	30KHz	TM5	518598	Inner 1RB Left	20.43	19.23	33.00	PASS
N41	20MHz	30KHz	TM5	518598	Inner 1RB Right	20.19	18.99	33.00	PASS
N41	20MHz	30KHz	TM5	535998	Inner Full	19.99	18.79	33.00	PASS
N41	20MHz	30KHz	TM5	535998	Inner 1RB Left	20.22	19.02	33.00	PASS
N41	20MHz	30KHz	TM5	535998	Inner 1RB Right	20.35	19.15	33.00	PASS
N41	20MHz	30KHz	TM6	501204	Inner Full	25.05	23.85	33.00	PASS
N41	20MHz	30KHz	TM6	501204	Inner 1RB Left	24.64	23.44	33.00	PASS
N41	20MHz	30KHz	TM6	501204	Inner 1RB Right	24.90	23.70	33.00	PASS
N41	20MHz	30KHz	TM6	518598	Inner Full	24.51	23.31	33.00	PASS
N41	20MHz	30KHz	TM6	518598	Inner 1RB Left	24.51	23.31	33.00	PASS
N41	20MHz	30KHz	TM6	518598	Inner 1RB Right	24.77	23.57	33.00	PASS
N41	20MHz	30KHz	TM6	535998	Inner Full	23.98	22.78	33.00	PASS
N41	20MHz	30KHz	TM6	535998	Inner 1RB Left	23.69	22.49	33.00	PASS
N41	20MHz	30KHz	TM6	535998	Inner 1RB Right	23.24	22.04	33.00	PASS
N41	20MHz	30KHz	TM7	501204	Inner Full	24.01	22.81	33.00	PASS
N41	20MHz	30KHz	TM7	501204	Inner 1RB Left	23.62	22.42	33.00	PASS
N41	20MHz	30KHz	TM7	501204	Inner 1RB Right	23.89	22.69	33.00	PASS
N41	20MHz	30KHz	TM7	518598	Inner Full	23.55	22.35	33.00	PASS
N41	20MHz	30KHz	TM7	518598	Inner 1RB Left	23.49	22.29	33.00	PASS
N41	20MHz	30KHz	TM7	518598	Inner 1RB Right	23.78	22.58	33.00	PASS
N41	20MHz	30KHz	TM7	535998	Inner Full	22.93	21.73	33.00	PASS
N41	20MHz	30KHz	TM7	535998	Inner 1RB Left	22.47	21.27	33.00	PASS
N41	20MHz	30KHz	TM7	535998	Inner 1RB Right	21.95	20.75	33.00	PASS
N41	20MHz	30KHz	TM8	501204	Inner Full	22.54	21.34	33.00	PASS
N41	20MHz	30KHz	TM8	501204	Inner 1RB Left	22.40	21.20	33.00	PASS
N41	20MHz	30KHz	TM8	501204	Inner 1RB Right	22.56	21.36	33.00	PASS
N41	20MHz	30KHz	TM8	518598	Inner Full	22.02	20.82	33.00	PASS
N41	20MHz	30KHz	TM8	518598	Inner 1RB Left	21.95	20.75	33.00	PASS
N41	20MHz	30KHz	TM8	518598	Inner 1RB Right	22.31	21.11	33.00	PASS
N41	20MHz	30KHz	TM8	535998	Inner Full	21.30	20.10	33.00	PASS
N41	20MHz	30KHz	TM8	535998	Inner 1RB Left	22.12	20.92	33.00	PASS
N41	20MHz	30KHz	TM8	535998	Inner 1RB Right	21.49	20.29	33.00	PASS
N41	20MHz	30KHz	TM9	501204	Inner Full	20.58	19.38	33.00	PASS
N41	20MHz	30KHz	TM9	501204	Inner 1RB Left	20.27	19.07	33.00	PASS
N41	20MHz	30KHz	TM9	501204	Inner 1RB Right	20.45	19.25	33.00	PASS
N41	20MHz	30KHz	TM9	518598	Inner Full	20.05	18.85	33.00	PASS
N41	20MHz	30KHz	TM9	518598	Inner 1RB Left	19.93	18.73	33.00	PASS
N41	20MHz	30KHz	TM9	518598	Inner 1RB Right	20.34	19.14	33.00	PASS
N41	20MHz	30KHz	TM9	535998	Inner Full	17.69	16.49	33.00	PASS
N41	20MHz	30KHz	TM9	535998	Inner 1RB Left	17.35	16.15	33.00	PASS
N41	20MHz	30KHz	TM9	535998	Inner 1RB Right	17.15	15.95	33.00	PASS
N41	30MHz	30KHz	TM1	502200	Inner Full	24.34	23.14	33.00	PASS
N41	30MHz	30KHz	TM1	502200	Inner 1RB Left	24.37	23.17	33.00	PASS
N41	30MHz	30KHz	TM1	502200	Inner 1RB Right	24.42	23.22	33.00	PASS
N41	30MHz	30KHz	TM1	518598	Inner Full	24.82	23.62	33.00	PASS
N41	30MHz	30KHz	TM1	518598	Inner 1RB Left	24.45	23.25	33.00	PASS
N41	30MHz	30KHz	TM1	518598	Inner 1RB Right	24.84	23.64	33.00	PASS
N41	30MHz	30KHz	TM1	534996	Inner Full	24.97	23.77	33.00	PASS



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

SGS-CSTC Standards Technical Services Co., Ltd.
Shenzhen Branch (Inspection & Testing Laboratory)

No. 1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgsgroup.com.cn
中国·深圳·科技园中区M-10栋一号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com



N41	30MHz	30KHz	TM1	534996	Inner 1RB Left	24.57	23.37	33.00	PASS
N41	30MHz	30KHz	TM1	534996	Inner 1RB Right	24.65	23.45	33.00	PASS
N41	30MHz	30KHz	TM2	502200	Inner Full	23.34	22.14	33.00	PASS
N41	30MHz	30KHz	TM2	502200	Inner 1RB Left	23.28	22.08	33.00	PASS
N41	30MHz	30KHz	TM2	502200	Inner 1RB Right	23.35	22.15	33.00	PASS
N41	30MHz	30KHz	TM2	518598	Inner Full	23.79	22.59	33.00	PASS
N41	30MHz	30KHz	TM2	518598	Inner 1RB Left	23.35	22.15	33.00	PASS
N41	30MHz	30KHz	TM2	518598	Inner 1RB Right	23.80	22.60	33.00	PASS
N41	30MHz	30KHz	TM2	534996	Inner Full	23.91	22.71	33.00	PASS
N41	30MHz	30KHz	TM2	534996	Inner 1RB Left	23.49	22.29	33.00	PASS
N41	30MHz	30KHz	TM2	534996	Inner 1RB Right	23.62	22.42	33.00	PASS
N41	30MHz	30KHz	TM3	502200	Inner Full	22.37	21.17	33.00	PASS
N41	30MHz	30KHz	TM3	502200	Inner 1RB Left	22.62	21.42	33.00	PASS
N41	30MHz	30KHz	TM3	502200	Inner 1RB Right	22.32	21.12	33.00	PASS
N41	30MHz	30KHz	TM3	518598	Inner Full	22.79	21.59	33.00	PASS
N41	30MHz	30KHz	TM3	518598	Inner 1RB Left	22.70	21.50	33.00	PASS
N41	30MHz	30KHz	TM3	518598	Inner 1RB Right	22.89	21.69	33.00	PASS
N41	30MHz	30KHz	TM3	534996	Inner Full	22.85	21.65	33.00	PASS
N41	30MHz	30KHz	TM3	534996	Inner 1RB Left	22.60	21.40	33.00	PASS
N41	30MHz	30KHz	TM3	534996	Inner 1RB Right	22.99	21.79	33.00	PASS
N41	30MHz	30KHz	TM4	502200	Inner Full	20.84	19.64	33.00	PASS
N41	30MHz	30KHz	TM4	502200	Inner 1RB Left	20.53	19.33	33.00	PASS
N41	30MHz	30KHz	TM4	502200	Inner 1RB Right	20.73	19.53	33.00	PASS
N41	30MHz	30KHz	TM4	518598	Inner Full	20.27	19.07	33.00	PASS
N41	30MHz	30KHz	TM4	518598	Inner 1RB Left	19.47	18.27	33.00	PASS
N41	30MHz	30KHz	TM4	518598	Inner 1RB Right	20.04	18.84	33.00	PASS
N41	30MHz	30KHz	TM4	534996	Inner Full	20.37	19.17	33.00	PASS
N41	30MHz	30KHz	TM4	534996	Inner 1RB Left	19.84	18.64	33.00	PASS
N41	30MHz	30KHz	TM4	534996	Inner 1RB Right	19.84	18.64	33.00	PASS
N41	30MHz	30KHz	TM5	502200	Inner Full	17.95	16.75	33.00	PASS
N41	30MHz	30KHz	TM5	502200	Inner 1RB Left	17.94	16.74	33.00	PASS
N41	30MHz	30KHz	TM5	502200	Inner 1RB Right	18.22	17.02	33.00	PASS
N41	30MHz	30KHz	TM5	518598	Inner Full	18.40	17.20	33.00	PASS
N41	30MHz	30KHz	TM5	518598	Inner 1RB Left	18.31	17.11	33.00	PASS
N41	30MHz	30KHz	TM5	518598	Inner 1RB Right	18.83	17.63	33.00	PASS
N41	30MHz	30KHz	TM5	534996	Inner Full	18.54	17.34	33.00	PASS
N41	30MHz	30KHz	TM5	534996	Inner 1RB Left	18.58	17.38	33.00	PASS
N41	30MHz	30KHz	TM5	534996	Inner 1RB Right	18.38	17.18	33.00	PASS
N41	30MHz	30KHz	TM6	502200	Inner Full	24.34	23.14	33.00	PASS
N41	30MHz	30KHz	TM6	502200	Inner 1RB Left	24.29	23.09	33.00	PASS
N41	30MHz	30KHz	TM6	502200	Inner 1RB Right	24.36	23.16	33.00	PASS
N41	30MHz	30KHz	TM6	518598	Inner Full	24.84	23.64	33.00	PASS
N41	30MHz	30KHz	TM6	518598	Inner 1RB Left	24.31	23.11	33.00	PASS
N41	30MHz	30KHz	TM6	518598	Inner 1RB Right	24.81	23.61	33.00	PASS
N41	30MHz	30KHz	TM6	534996	Inner Full	24.98	23.78	33.00	PASS
N41	30MHz	30KHz	TM6	534996	Inner 1RB Left	24.49	23.29	33.00	PASS
N41	30MHz	30KHz	TM6	534996	Inner 1RB Right	24.54	23.34	33.00	PASS
N41	30MHz	30KHz	TM7	502200	Inner Full	23.39	22.19	33.00	PASS



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

SGS-CSTC Standards Technical Services Co., Ltd.
Shenzhen Branch (Not a Testing Laboratory)

No. 1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgsgroup.com.cn
中国·深圳·科技园中区M-10栋一号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com



N41	30MHz	30KHz	TM7	502200	Inner 1RB Left	23.70	22.50	33.00	PASS
N41	30MHz	30KHz	TM7	502200	Inner 1RB Right	23.32	22.12	33.00	PASS
N41	30MHz	30KHz	TM7	518598	Inner Full	23.79	22.59	33.00	PASS
N41	30MHz	30KHz	TM7	518598	Inner 1RB Left	23.44	22.24	33.00	PASS
N41	30MHz	30KHz	TM7	518598	Inner 1RB Right	23.21	22.01	33.00	PASS
N41	30MHz	30KHz	TM7	534996	Inner Full	23.90	22.70	33.00	PASS
N41	30MHz	30KHz	TM7	534996	Inner 1RB Left	23.93	22.73	33.00	PASS
N41	30MHz	30KHz	TM7	534996	Inner 1RB Right	22.63	21.43	33.00	PASS
N41	30MHz	30KHz	TM8	502200	Inner Full	20.81	19.61	33.00	PASS
N41	30MHz	30KHz	TM8	502200	Inner 1RB Left	20.70	19.50	33.00	PASS
N41	30MHz	30KHz	TM8	502200	Inner 1RB Right	20.71	19.51	33.00	PASS
N41	30MHz	30KHz	TM8	518598	Inner Full	20.29	19.09	33.00	PASS
N41	30MHz	30KHz	TM8	518598	Inner 1RB Left	19.61	18.41	33.00	PASS
N41	30MHz	30KHz	TM8	518598	Inner 1RB Right	19.99	18.79	33.00	PASS
N41	30MHz	30KHz	TM8	534996	Inner Full	20.34	19.14	33.00	PASS
N41	30MHz	30KHz	TM8	534996	Inner 1RB Left	19.76	18.56	33.00	PASS
N41	30MHz	30KHz	TM8	534996	Inner 1RB Right	19.92	18.72	33.00	PASS
N41	30MHz	30KHz	TM9	502200	Inner Full	18.03	16.83	33.00	PASS
N41	30MHz	30KHz	TM9	502200	Inner 1RB Left	17.95	16.75	33.00	PASS
N41	30MHz	30KHz	TM9	502200	Inner 1RB Right	17.97	16.77	33.00	PASS
N41	30MHz	30KHz	TM9	518598	Inner Full	18.39	17.19	33.00	PASS
N41	30MHz	30KHz	TM9	518598	Inner 1RB Left	18.31	17.11	33.00	PASS
N41	30MHz	30KHz	TM9	518598	Inner 1RB Right	18.84	17.64	33.00	PASS
N41	30MHz	30KHz	TM9	534996	Inner Full	18.53	17.33	33.00	PASS
N41	30MHz	30KHz	TM9	534996	Inner 1RB Left	18.24	17.04	33.00	PASS
N41	30MHz	30KHz	TM9	534996	Inner 1RB Right	18.67	17.47	33.00	PASS
N41	40MHz	30KHz	TM1	503202	Inner Full	24.94	23.74	33.00	PASS
N41	40MHz	30KHz	TM1	503202	Inner 1RB Left	24.76	23.56	33.00	PASS
N41	40MHz	30KHz	TM1	503202	Inner 1RB Right	25.09	23.89	33.00	PASS
N41	40MHz	30KHz	TM1	518598	Inner Full	24.65	23.45	33.00	PASS
N41	40MHz	30KHz	TM1	518598	Inner 1RB Left	25.12	23.92	33.00	PASS
N41	40MHz	30KHz	TM1	518598	Inner 1RB Right	24.91	23.71	33.00	PASS
N41	40MHz	30KHz	TM1	534000	Inner Full	24.75	23.55	33.00	PASS
N41	40MHz	30KHz	TM1	534000	Inner 1RB Left	23.06	21.86	33.00	PASS
N41	40MHz	30KHz	TM1	534000	Inner 1RB Right	22.94	21.74	33.00	PASS
N41	40MHz	30KHz	TM2	503202	Inner Full	24.92	23.72	33.00	PASS
N41	40MHz	30KHz	TM2	503202	Inner 1RB Left	24.74	23.54	33.00	PASS
N41	40MHz	30KHz	TM2	503202	Inner 1RB Right	25.08	23.88	33.00	PASS
N41	40MHz	30KHz	TM2	518598	Inner Full	24.55	23.35	33.00	PASS
N41	40MHz	30KHz	TM2	518598	Inner 1RB Left	25.13	23.93	33.00	PASS
N41	40MHz	30KHz	TM2	518598	Inner 1RB Right	24.89	23.69	33.00	PASS
N41	40MHz	30KHz	TM2	534000	Inner Full	24.86	23.66	33.00	PASS
N41	40MHz	30KHz	TM2	534000	Inner 1RB Left	23.94	22.74	33.00	PASS
N41	40MHz	30KHz	TM2	534000	Inner 1RB Right	23.58	22.38	33.00	PASS
N41	40MHz	30KHz	TM3	503202	Inner Full	23.92	22.72	33.00	PASS
N41	40MHz	30KHz	TM3	503202	Inner 1RB Left	23.65	22.45	33.00	PASS
N41	40MHz	30KHz	TM3	503202	Inner 1RB Right	24.09	22.89	33.00	PASS
N41	40MHz	30KHz	TM3	518598	Inner Full	20.77	19.57	33.00	PASS



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

SGS-CSTC Standards Technical Services Co., Ltd.
Shenzhen Branch (Technical Services Laboratory)

No. 1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgsgroup.com.cn
中国·深圳·科技园中区M-10栋一号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com



N41	40MHz	30KHz	TM3	518598	Inner 1RB Left	23.99	22.79	33.00	PASS
N41	40MHz	30KHz	TM3	518598	Inner 1RB Right	23.89	22.69	33.00	PASS
N41	40MHz	30KHz	TM3	534000	Inner Full	23.85	22.65	33.00	PASS
N41	40MHz	30KHz	TM3	534000	Inner 1RB Left	22.53	21.33	33.00	PASS
N41	40MHz	30KHz	TM3	534000	Inner 1RB Right	22.36	21.16	33.00	PASS
N41	40MHz	30KHz	TM4	503202	Inner Full	22.47	21.27	33.00	PASS
N41	40MHz	30KHz	TM4	503202	Inner 1RB Left	22.51	21.31	33.00	PASS
N41	40MHz	30KHz	TM4	503202	Inner 1RB Right	22.51	21.31	33.00	PASS
N41	40MHz	30KHz	TM4	518598	Inner Full	22.07	20.87	33.00	PASS
N41	40MHz	30KHz	TM4	518598	Inner 1RB Left	22.50	21.30	33.00	PASS
N41	40MHz	30KHz	TM4	518598	Inner 1RB Right	22.42	21.22	33.00	PASS
N41	40MHz	30KHz	TM4	534000	Inner Full	22.31	21.11	33.00	PASS
N41	40MHz	30KHz	TM4	534000	Inner 1RB Left	21.60	20.40	33.00	PASS
N41	40MHz	30KHz	TM4	534000	Inner 1RB Right	21.35	20.15	33.00	PASS
N41	40MHz	30KHz	TM5	503202	Inner Full	20.50	19.30	33.00	PASS
N41	40MHz	30KHz	TM5	503202	Inner 1RB Left	20.55	19.35	33.00	PASS
N41	40MHz	30KHz	TM5	503202	Inner 1RB Right	20.55	19.35	33.00	PASS
N41	40MHz	30KHz	TM5	518598	Inner Full	20.07	18.87	33.00	PASS
N41	40MHz	30KHz	TM5	518598	Inner 1RB Left	20.70	19.50	33.00	PASS
N41	40MHz	30KHz	TM5	518598	Inner 1RB Right	20.37	19.17	33.00	PASS
N41	40MHz	30KHz	TM5	534000	Inner Full	20.48	19.28	33.00	PASS
N41	40MHz	30KHz	TM5	534000	Inner 1RB Left	20.19	18.99	33.00	PASS
N41	40MHz	30KHz	TM5	534000	Inner 1RB Right	19.96	18.76	33.00	PASS
N41	40MHz	30KHz	TM6	503202	Inner Full	23.39	22.19	33.00	PASS
N41	40MHz	30KHz	TM6	503202	Inner 1RB Left	23.00	21.80	33.00	PASS
N41	40MHz	30KHz	TM6	503202	Inner 1RB Right	23.59	22.39	33.00	PASS
N41	40MHz	30KHz	TM6	518598	Inner Full	23.15	21.95	33.00	PASS
N41	40MHz	30KHz	TM6	518598	Inner 1RB Left	23.58	22.38	33.00	PASS
N41	40MHz	30KHz	TM6	518598	Inner 1RB Right	23.26	22.06	33.00	PASS
N41	40MHz	30KHz	TM6	534000	Inner Full	22.63	21.43	33.00	PASS
N41	40MHz	30KHz	TM6	534000	Inner 1RB Left	21.93	20.73	33.00	PASS
N41	40MHz	30KHz	TM6	534000	Inner 1RB Right	21.68	20.48	33.00	PASS
N41	40MHz	30KHz	TM7	503202	Inner Full	22.92	21.72	33.00	PASS
N41	40MHz	30KHz	TM7	503202	Inner 1RB Left	22.57	21.37	33.00	PASS
N41	40MHz	30KHz	TM7	503202	Inner 1RB Right	23.13	21.93	33.00	PASS
N41	40MHz	30KHz	TM7	518598	Inner Full	22.57	21.37	33.00	PASS
N41	40MHz	30KHz	TM7	518598	Inner 1RB Left	23.17	21.97	33.00	PASS
N41	40MHz	30KHz	TM7	518598	Inner 1RB Right	22.85	21.65	33.00	PASS
N41	40MHz	30KHz	TM7	534000	Inner Full	22.53	21.33	33.00	PASS
N41	40MHz	30KHz	TM7	534000	Inner 1RB Left	21.55	20.35	33.00	PASS
N41	40MHz	30KHz	TM7	534000	Inner 1RB Right	21.32	20.12	33.00	PASS
N41	40MHz	30KHz	TM8	503202	Inner Full	21.42	20.22	33.00	PASS
N41	40MHz	30KHz	TM8	503202	Inner 1RB Left	21.49	20.29	33.00	PASS
N41	40MHz	30KHz	TM8	503202	Inner 1RB Right	21.70	20.50	33.00	PASS
N41	40MHz	30KHz	TM8	518598	Inner Full	21.06	19.86	33.00	PASS
N41	40MHz	30KHz	TM8	518598	Inner 1RB Left	21.51	20.31	33.00	PASS
N41	40MHz	30KHz	TM8	518598	Inner 1RB Right	21.43	20.23	33.00	PASS
N41	40MHz	30KHz	TM8	534000	Inner Full	21.26	20.06	33.00	PASS



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

SGS-CSTC Standards Technical Services Co., Ltd.
Shenzhen Branch (Not a Testing Laboratory)

No. 1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgsgroup.com.cn
中国·深圳·科技园中区M-10栋一号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com



N41	40MHz	30KHz	TM8	534000	Inner 1RB Left	20.35	19.15	33.00	PASS
N41	40MHz	30KHz	TM8	534000	Inner 1RB Right	20.43	19.23	33.00	PASS
N41	40MHz	30KHz	TM9	503202	Inner Full	18.43	17.23	33.00	PASS
N41	40MHz	30KHz	TM9	503202	Inner 1RB Left	18.68	17.48	33.00	PASS
N41	40MHz	30KHz	TM9	503202	Inner 1RB Right	18.59	17.39	33.00	PASS
N41	40MHz	30KHz	TM9	518598	Inner Full	18.08	16.88	33.00	PASS
N41	40MHz	30KHz	TM9	518598	Inner 1RB Left	18.73	17.53	33.00	PASS
N41	40MHz	30KHz	TM9	518598	Inner 1RB Right	18.49	17.29	33.00	PASS
N41	40MHz	30KHz	TM9	534000	Inner Full	18.20	17.00	33.00	PASS
N41	40MHz	30KHz	TM9	534000	Inner 1RB Left	17.37	16.17	33.00	PASS
N41	40MHz	30KHz	TM9	534000	Inner 1RB Right	17.49	16.29	33.00	PASS
N41	50MHz	30KHz	TM1	504204	Inner Full	24.89	23.69	33.00	PASS
N41	50MHz	30KHz	TM1	504204	Inner 1RB Left	24.89	23.69	33.00	PASS
N41	50MHz	30KHz	TM1	504204	Inner 1RB Right	24.98	23.78	33.00	PASS
N41	50MHz	30KHz	TM1	518598	Inner Full	24.60	23.40	33.00	PASS
N41	50MHz	30KHz	TM1	518598	Inner 1RB Left	24.13	22.93	33.00	PASS
N41	50MHz	30KHz	TM1	518598	Inner 1RB Right	24.57	23.37	33.00	PASS
N41	50MHz	30KHz	TM1	532998	Inner Full	24.82	23.62	33.00	PASS
N41	50MHz	30KHz	TM1	532998	Inner 1RB Left	24.67	23.47	33.00	PASS
N41	50MHz	30KHz	TM1	532998	Inner 1RB Right	23.75	22.55	33.00	PASS
N41	50MHz	30KHz	TM2	504204	Inner Full	24.91	23.71	33.00	PASS
N41	50MHz	30KHz	TM2	504204	Inner 1RB Left	24.89	23.69	33.00	PASS
N41	50MHz	30KHz	TM2	504204	Inner 1RB Right	24.94	23.74	33.00	PASS
N41	50MHz	30KHz	TM2	518598	Inner Full	24.67	23.47	33.00	PASS
N41	50MHz	30KHz	TM2	518598	Inner 1RB Left	24.99	23.79	33.00	PASS
N41	50MHz	30KHz	TM2	518598	Inner 1RB Right	24.57	23.37	33.00	PASS
N41	50MHz	30KHz	TM2	532998	Inner Full	24.82	23.62	33.00	PASS
N41	50MHz	30KHz	TM2	532998	Inner 1RB Left	23.97	22.77	33.00	PASS
N41	50MHz	30KHz	TM2	532998	Inner 1RB Right	23.55	22.35	33.00	PASS
N41	50MHz	30KHz	TM3	504204	Inner Full	23.88	22.68	33.00	PASS
N41	50MHz	30KHz	TM3	504204	Inner 1RB Left	23.78	22.58	33.00	PASS
N41	50MHz	30KHz	TM3	504204	Inner 1RB Right	23.95	22.75	33.00	PASS
N41	50MHz	30KHz	TM3	518598	Inner Full	23.60	22.40	33.00	PASS
N41	50MHz	30KHz	TM3	518598	Inner 1RB Left	23.93	22.73	33.00	PASS
N41	50MHz	30KHz	TM3	518598	Inner 1RB Right	23.50	22.30	33.00	PASS
N41	50MHz	30KHz	TM3	532998	Inner Full	23.74	22.54	33.00	PASS
N41	50MHz	30KHz	TM3	532998	Inner 1RB Left	23.13	21.93	33.00	PASS
N41	50MHz	30KHz	TM3	532998	Inner 1RB Right	22.76	21.56	33.00	PASS
N41	50MHz	30KHz	TM4	504204	Inner Full	22.39	21.19	33.00	PASS
N41	50MHz	30KHz	TM4	504204	Inner 1RB Left	22.33	21.13	33.00	PASS
N41	50MHz	30KHz	TM4	504204	Inner 1RB Right	22.48	21.28	33.00	PASS
N41	50MHz	30KHz	TM4	518598	Inner Full	22.10	20.90	33.00	PASS
N41	50MHz	30KHz	TM4	518598	Inner 1RB Left	22.47	21.27	33.00	PASS
N41	50MHz	30KHz	TM4	518598	Inner 1RB Right	22.10	20.90	33.00	PASS
N41	50MHz	30KHz	TM4	532998	Inner Full	22.36	21.16	33.00	PASS
N41	50MHz	30KHz	TM4	532998	Inner 1RB Left	22.19	20.99	33.00	PASS
N41	50MHz	30KHz	TM4	532998	Inner 1RB Right	21.77	20.57	33.00	PASS
N41	50MHz	30KHz	TM5	504204	Inner Full	20.80	19.60	33.00	PASS



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

SGS-CSTC Standards Technical Services Co., Ltd.
Shenzhen Branch (SGS-CSTC) Laboratory

No. 1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgsgroup.com.cn
中国·深圳·科技园中区M-10栋一号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com



N41	50MHz	30KHz	TM5	504204	Inner 1RB Left	20.37	19.17	33.00	PASS
N41	50MHz	30KHz	TM5	504204	Inner 1RB Right	20.53	19.33	33.00	PASS
N41	50MHz	30KHz	TM5	518598	Inner Full	20.08	18.88	33.00	PASS
N41	50MHz	30KHz	TM5	518598	Inner 1RB Left	20.46	19.26	33.00	PASS
N41	50MHz	30KHz	TM5	518598	Inner 1RB Right	20.11	18.91	33.00	PASS
N41	50MHz	30KHz	TM5	532998	Inner Full	20.36	19.16	33.00	PASS
N41	50MHz	30KHz	TM5	532998	Inner 1RB Left	20.49	19.29	33.00	PASS
N41	50MHz	30KHz	TM5	532998	Inner 1RB Right	19.90	18.70	33.00	PASS
N41	50MHz	30KHz	TM6	504204	Inner Full	23.35	22.15	33.00	PASS
N41	50MHz	30KHz	TM6	504204	Inner 1RB Left	23.15	21.95	33.00	PASS
N41	50MHz	30KHz	TM6	504204	Inner 1RB Right	23.57	22.37	33.00	PASS
N41	50MHz	30KHz	TM6	518598	Inner Full	20.26	19.06	33.00	PASS
N41	50MHz	30KHz	TM6	518598	Inner 1RB Left	23.49	22.29	33.00	PASS
N41	50MHz	30KHz	TM6	518598	Inner 1RB Right	23.08	21.88	33.00	PASS
N41	50MHz	30KHz	TM6	532998	Inner Full	22.82	21.62	33.00	PASS
N41	50MHz	30KHz	TM6	532998	Inner 1RB Left	22.36	21.16	33.00	PASS
N41	50MHz	30KHz	TM6	532998	Inner 1RB Right	22.02	20.82	33.00	PASS
N41	50MHz	30KHz	TM7	504204	Inner Full	22.89	21.69	33.00	PASS
N41	50MHz	30KHz	TM7	504204	Inner 1RB Left	22.81	21.61	33.00	PASS
N41	50MHz	30KHz	TM7	504204	Inner 1RB Right	23.04	21.84	33.00	PASS
N41	50MHz	30KHz	TM7	518598	Inner Full	22.60	21.40	33.00	PASS
N41	50MHz	30KHz	TM7	518598	Inner 1RB Left	23.01	21.81	33.00	PASS
N41	50MHz	30KHz	TM7	518598	Inner 1RB Right	22.50	21.30	33.00	PASS
N41	50MHz	30KHz	TM7	532998	Inner Full	22.58	21.38	33.00	PASS
N41	50MHz	30KHz	TM7	532998	Inner 1RB Left	21.87	20.67	33.00	PASS
N41	50MHz	30KHz	TM7	532998	Inner 1RB Right	21.67	20.47	33.00	PASS
N41	50MHz	30KHz	TM8	504204	Inner Full	21.41	20.21	33.00	PASS
N41	50MHz	30KHz	TM8	504204	Inner 1RB Left	21.39	20.19	33.00	PASS
N41	50MHz	30KHz	TM8	504204	Inner 1RB Right	21.52	20.32	33.00	PASS
N41	50MHz	30KHz	TM8	518598	Inner Full	21.11	19.91	33.00	PASS
N41	50MHz	30KHz	TM8	518598	Inner 1RB Left	21.53	20.33	33.00	PASS
N41	50MHz	30KHz	TM8	518598	Inner 1RB Right	21.19	19.99	33.00	PASS
N41	50MHz	30KHz	TM8	532998	Inner Full	21.35	20.15	33.00	PASS
N41	50MHz	30KHz	TM8	532998	Inner 1RB Left	21.03	19.83	33.00	PASS
N41	50MHz	30KHz	TM8	532998	Inner 1RB Right	20.79	19.59	33.00	PASS
N41	50MHz	30KHz	TM9	504204	Inner Full	18.40	17.20	33.00	PASS
N41	50MHz	30KHz	TM9	504204	Inner 1RB Left	18.35	17.15	33.00	PASS
N41	50MHz	30KHz	TM9	504204	Inner 1RB Right	18.50	17.30	33.00	PASS
N41	50MHz	30KHz	TM9	518598	Inner Full	18.76	17.56	33.00	PASS
N41	50MHz	30KHz	TM9	518598	Inner 1RB Left	18.51	17.31	33.00	PASS
N41	50MHz	30KHz	TM9	518598	Inner 1RB Right	18.03	16.83	33.00	PASS
N41	50MHz	30KHz	TM9	532998	Inner Full	12.77	11.57	33.00	PASS
N41	50MHz	30KHz	TM9	532998	Inner 1RB Left	18.02	16.82	33.00	PASS
N41	50MHz	30KHz	TM9	532998	Inner 1RB Right	18.04	16.84	33.00	PASS
N41	60MHz	30KHz	TM1	505200	Inner Full	24.90	23.70	33.00	PASS
N41	60MHz	30KHz	TM1	505200	Inner 1RB Left	24.77	23.57	33.00	PASS
N41	60MHz	30KHz	TM1	505200	Inner 1RB Right	24.63	23.43	33.00	PASS
N41	60MHz	30KHz	TM1	518598	Inner Full	24.74	23.54	33.00	PASS



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com



N41	60MHz	30KHz	TM1	518598	Inner 1RB Left	24.43	23.23	33.00	PASS
N41	60MHz	30KHz	TM1	518598	Inner 1RB Right	23.97	22.77	33.00	PASS
N41	60MHz	30KHz	TM1	531996	Inner Full	24.81	23.61	33.00	PASS
N41	60MHz	30KHz	TM1	531996	Inner 1RB Left	24.45	23.25	33.00	PASS
N41	60MHz	30KHz	TM1	531996	Inner 1RB Right	23.73	22.53	33.00	PASS
N41	60MHz	30KHz	TM2	505200	Inner Full	24.91	23.71	33.00	PASS
N41	60MHz	30KHz	TM2	505200	Inner 1RB Left	24.77	23.57	33.00	PASS
N41	60MHz	30KHz	TM2	505200	Inner 1RB Right	24.71	23.51	33.00	PASS
N41	60MHz	30KHz	TM2	518598	Inner Full	24.73	23.53	33.00	PASS
N41	60MHz	30KHz	TM2	518598	Inner 1RB Left	24.85	23.65	33.00	PASS
N41	60MHz	30KHz	TM2	518598	Inner 1RB Right	24.32	23.12	33.00	PASS
N41	60MHz	30KHz	TM2	531996	Inner Full	24.83	23.63	33.00	PASS
N41	60MHz	30KHz	TM2	531996	Inner 1RB Left	23.35	22.15	33.00	PASS
N41	60MHz	30KHz	TM2	531996	Inner 1RB Right	23.78	22.58	33.00	PASS
N41	60MHz	30KHz	TM3	505200	Inner Full	23.87	22.67	33.00	PASS
N41	60MHz	30KHz	TM3	505200	Inner 1RB Left	23.76	22.56	33.00	PASS
N41	60MHz	30KHz	TM3	505200	Inner 1RB Right	23.60	22.40	33.00	PASS
N41	60MHz	30KHz	TM3	518598	Inner Full	23.61	22.41	33.00	PASS
N41	60MHz	30KHz	TM3	518598	Inner 1RB Left	23.85	22.65	33.00	PASS
N41	60MHz	30KHz	TM3	518598	Inner 1RB Right	23.31	22.11	33.00	PASS
N41	60MHz	30KHz	TM3	531996	Inner Full	23.80	22.60	33.00	PASS
N41	60MHz	30KHz	TM3	531996	Inner 1RB Left	22.13	20.93	33.00	PASS
N41	60MHz	30KHz	TM3	531996	Inner 1RB Right	22.56	21.36	33.00	PASS
N41	60MHz	30KHz	TM4	505200	Inner Full	22.38	21.18	33.00	PASS
N41	60MHz	30KHz	TM4	505200	Inner 1RB Left	22.41	21.21	33.00	PASS
N41	60MHz	30KHz	TM4	505200	Inner 1RB Right	22.08	20.88	33.00	PASS
N41	60MHz	30KHz	TM4	518598	Inner Full	22.15	20.95	33.00	PASS
N41	60MHz	30KHz	TM4	518598	Inner 1RB Left	22.30	21.10	33.00	PASS
N41	60MHz	30KHz	TM4	518598	Inner 1RB Right	21.92	20.72	33.00	PASS
N41	60MHz	30KHz	TM4	531996	Inner Full	22.26	21.06	33.00	PASS
N41	60MHz	30KHz	TM4	531996	Inner 1RB Left	21.15	19.95	33.00	PASS
N41	60MHz	30KHz	TM4	531996	Inner 1RB Right	21.67	20.47	33.00	PASS
N41	60MHz	30KHz	TM5	505200	Inner Full	20.93	19.73	33.00	PASS
N41	60MHz	30KHz	TM5	505200	Inner 1RB Left	20.51	19.31	33.00	PASS
N41	60MHz	30KHz	TM5	505200	Inner 1RB Right	20.18	18.98	33.00	PASS
N41	60MHz	30KHz	TM5	518598	Inner Full	20.17	18.97	33.00	PASS
N41	60MHz	30KHz	TM5	518598	Inner 1RB Left	20.48	19.28	33.00	PASS
N41	60MHz	30KHz	TM5	518598	Inner 1RB Right	20.09	18.89	33.00	PASS
N41	60MHz	30KHz	TM5	531996	Inner Full	20.24	19.04	33.00	PASS
N41	60MHz	30KHz	TM5	531996	Inner 1RB Left	19.96	18.76	33.00	PASS
N41	60MHz	30KHz	TM5	531996	Inner 1RB Right	19.96	18.76	33.00	PASS
N41	60MHz	30KHz	TM6	505200	Inner Full	24.87	23.67	33.00	PASS
N41	60MHz	30KHz	TM6	505200	Inner 1RB Left	24.77	23.57	33.00	PASS
N41	60MHz	30KHz	TM6	505200	Inner 1RB Right	24.71	23.51	33.00	PASS
N41	60MHz	30KHz	TM6	518598	Inner Full	24.66	23.46	33.00	PASS
N41	60MHz	30KHz	TM6	518598	Inner 1RB Left	24.93	23.73	33.00	PASS
N41	60MHz	30KHz	TM6	518598	Inner 1RB Right	24.30	23.10	33.00	PASS
N41	60MHz	30KHz	TM6	531996	Inner Full	24.78	23.58	33.00	PASS



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com



N41	60MHz	30KHz	TM6	531996	Inner 1RB Left	23.32	22.12	33.00	PASS
N41	60MHz	30KHz	TM6	531996	Inner 1RB Right	23.72	22.52	33.00	PASS
N41	60MHz	30KHz	TM7	505200	Inner Full	23.88	22.68	33.00	PASS
N41	60MHz	30KHz	TM7	505200	Inner 1RB Left	23.71	22.51	33.00	PASS
N41	60MHz	30KHz	TM7	505200	Inner 1RB Right	23.61	22.41	33.00	PASS
N41	60MHz	30KHz	TM7	518598	Inner Full	23.65	22.45	33.00	PASS
N41	60MHz	30KHz	TM7	518598	Inner 1RB Left	23.82	22.62	33.00	PASS
N41	60MHz	30KHz	TM7	518598	Inner 1RB Right	23.34	22.14	33.00	PASS
N41	60MHz	30KHz	TM7	531996	Inner Full	23.76	22.56	33.00	PASS
N41	60MHz	30KHz	TM7	531996	Inner 1RB Left	22.16	20.96	33.00	PASS
N41	60MHz	30KHz	TM7	531996	Inner 1RB Right	22.67	21.47	33.00	PASS
N41	60MHz	30KHz	TM8	505200	Inner Full	21.91	20.71	33.00	PASS
N41	60MHz	30KHz	TM8	505200	Inner 1RB Left	21.51	20.31	33.00	PASS
N41	60MHz	30KHz	TM8	505200	Inner 1RB Right	21.17	19.97	33.00	PASS
N41	60MHz	30KHz	TM8	518598	Inner Full	22.17	20.97	33.00	PASS
N41	60MHz	30KHz	TM8	518598	Inner 1RB Left	22.42	21.22	33.00	PASS
N41	60MHz	30KHz	TM8	518598	Inner 1RB Right	22.16	20.96	33.00	PASS
N41	60MHz	30KHz	TM8	531996	Inner Full	22.24	21.04	33.00	PASS
N41	60MHz	30KHz	TM8	531996	Inner 1RB Left	21.14	19.94	33.00	PASS
N41	60MHz	30KHz	TM8	531996	Inner 1RB Right	21.67	20.47	33.00	PASS
N41	60MHz	30KHz	TM9	505200	Inner Full	18.40	17.20	33.00	PASS
N41	60MHz	30KHz	TM9	505200	Inner 1RB Left	18.57	17.37	33.00	PASS
N41	60MHz	30KHz	TM9	505200	Inner 1RB Right	18.07	16.87	33.00	PASS
N41	60MHz	30KHz	TM9	518598	Inner Full	20.22	19.02	33.00	PASS
N41	60MHz	30KHz	TM9	518598	Inner 1RB Left	20.33	19.13	33.00	PASS
N41	60MHz	30KHz	TM9	518598	Inner 1RB Right	20.12	18.92	33.00	PASS
N41	60MHz	30KHz	TM9	531996	Inner Full	20.27	19.07	33.00	PASS
N41	60MHz	30KHz	TM9	531996	Inner 1RB Left	19.84	18.64	33.00	PASS
N41	60MHz	30KHz	TM9	531996	Inner 1RB Right	20.02	18.82	33.00	PASS
N41	80MHz	30KHz	TM1	507204	Inner Full	24.47	23.27	33.00	PASS
N41	80MHz	30KHz	TM1	507204	Inner 1RB Left	24.42	23.22	33.00	PASS
N41	80MHz	30KHz	TM1	507204	Inner 1RB Right	24.34	23.14	33.00	PASS
N41	80MHz	30KHz	TM1	518598	Inner Full	24.46	23.26	33.00	PASS
N41	80MHz	30KHz	TM1	518598	Inner 1RB Left	24.87	23.67	33.00	PASS
N41	80MHz	30KHz	TM1	518598	Inner 1RB Right	24.46	23.26	33.00	PASS
N41	80MHz	30KHz	TM1	529998	Inner Full	24.53	23.33	33.00	PASS
N41	80MHz	30KHz	TM1	529998	Inner 1RB Left	24.56	23.36	33.00	PASS
N41	80MHz	30KHz	TM1	529998	Inner 1RB Right	24.31	23.11	33.00	PASS
N41	80MHz	30KHz	TM2	507204	Inner Full	24.49	23.29	33.00	PASS
N41	80MHz	30KHz	TM2	507204	Inner 1RB Left	24.50	23.30	33.00	PASS
N41	80MHz	30KHz	TM2	507204	Inner 1RB Right	24.36	23.16	33.00	PASS
N41	80MHz	30KHz	TM2	518598	Inner Full	24.51	23.31	33.00	PASS
N41	80MHz	30KHz	TM2	518598	Inner 1RB Left	24.55	23.35	33.00	PASS
N41	80MHz	30KHz	TM2	518598	Inner 1RB Right	24.40	23.20	33.00	PASS
N41	80MHz	30KHz	TM2	529998	Inner Full	24.51	23.31	33.00	PASS
N41	80MHz	30KHz	TM2	529998	Inner 1RB Left	24.52	23.32	33.00	PASS
N41	80MHz	30KHz	TM2	529998	Inner 1RB Right	24.21	23.01	33.00	PASS
N41	80MHz	30KHz	TM3	507204	Inner Full	23.59	22.39	33.00	PASS



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

SGS-CSTC Standards Technical Services Co., Ltd.
Shenzhen Branch (Not a Testing Laboratory)

No. 1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgsgroup.com.cn
中国·深圳·科技园中区M-10栋一号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com



N41	80MHz	30KHz	TM3	507204	Inner 1RB Left	23.50	22.30	33.00	PASS
N41	80MHz	30KHz	TM3	507204	Inner 1RB Right	23.46	22.26	33.00	PASS
N41	80MHz	30KHz	TM3	518598	Inner Full	23.39	22.19	33.00	PASS
N41	80MHz	30KHz	TM3	518598	Inner 1RB Left	23.49	22.29	33.00	PASS
N41	80MHz	30KHz	TM3	518598	Inner 1RB Right	23.45	22.25	33.00	PASS
N41	80MHz	30KHz	TM3	529998	Inner Full	23.52	22.32	33.00	PASS
N41	80MHz	30KHz	TM3	529998	Inner 1RB Left	23.56	22.36	33.00	PASS
N41	80MHz	30KHz	TM3	529998	Inner 1RB Right	23.24	22.04	33.00	PASS
N41	80MHz	30KHz	TM4	507204	Inner Full	21.91	20.71	33.00	PASS
N41	80MHz	30KHz	TM4	507204	Inner 1RB Left	21.86	20.66	33.00	PASS
N41	80MHz	30KHz	TM4	507204	Inner 1RB Right	22.09	20.89	33.00	PASS
N41	80MHz	30KHz	TM4	518598	Inner Full	21.94	20.74	33.00	PASS
N41	80MHz	30KHz	TM4	518598	Inner 1RB Left	21.93	20.73	33.00	PASS
N41	80MHz	30KHz	TM4	518598	Inner 1RB Right	22.00	20.80	33.00	PASS
N41	80MHz	30KHz	TM4	529998	Inner Full	22.05	20.85	33.00	PASS
N41	80MHz	30KHz	TM4	529998	Inner 1RB Left	21.93	20.73	33.00	PASS
N41	80MHz	30KHz	TM4	529998	Inner 1RB Right	21.42	20.22	33.00	PASS
N41	80MHz	30KHz	TM5	507204	Inner Full	19.99	18.79	33.00	PASS
N41	80MHz	30KHz	TM5	507204	Inner 1RB Left	20.10	18.90	33.00	PASS
N41	80MHz	30KHz	TM5	507204	Inner 1RB Right	19.92	18.72	33.00	PASS
N41	80MHz	30KHz	TM5	518598	Inner Full	19.89	18.69	33.00	PASS
N41	80MHz	30KHz	TM5	518598	Inner 1RB Left	19.95	18.75	33.00	PASS
N41	80MHz	30KHz	TM5	518598	Inner 1RB Right	20.02	18.82	33.00	PASS
N41	80MHz	30KHz	TM5	529998	Inner Full	19.95	18.75	33.00	PASS
N41	80MHz	30KHz	TM5	529998	Inner 1RB Left	19.93	18.73	33.00	PASS
N41	80MHz	30KHz	TM5	529998	Inner 1RB Right	19.75	18.55	33.00	PASS
N41	80MHz	30KHz	TM6	507204	Inner Full	23.04	21.84	33.00	PASS
N41	80MHz	30KHz	TM6	507204	Inner 1RB Left	22.92	21.72	33.00	PASS
N41	80MHz	30KHz	TM6	507204	Inner 1RB Right	23.10	21.90	33.00	PASS
N41	80MHz	30KHz	TM6	518598	Inner Full	23.10	21.90	33.00	PASS
N41	80MHz	30KHz	TM6	518598	Inner 1RB Left	23.00	21.80	33.00	PASS
N41	80MHz	30KHz	TM6	518598	Inner 1RB Right	23.20	22.00	33.00	PASS
N41	80MHz	30KHz	TM6	529998	Inner Full	22.87	21.67	33.00	PASS
N41	80MHz	30KHz	TM6	529998	Inner 1RB Left	22.95	21.75	33.00	PASS
N41	80MHz	30KHz	TM6	529998	Inner 1RB Right	22.86	21.66	33.00	PASS
N41	80MHz	30KHz	TM7	507204	Inner Full	22.45	21.25	33.00	PASS
N41	80MHz	30KHz	TM7	507204	Inner 1RB Left	22.41	21.21	33.00	PASS
N41	80MHz	30KHz	TM7	507204	Inner 1RB Right	22.66	21.46	33.00	PASS
N41	80MHz	30KHz	TM7	518598	Inner Full	22.38	21.18	33.00	PASS
N41	80MHz	30KHz	TM7	518598	Inner 1RB Left	22.55	21.35	33.00	PASS
N41	80MHz	30KHz	TM7	518598	Inner 1RB Right	22.52	21.32	33.00	PASS
N41	80MHz	30KHz	TM7	529998	Inner Full	22.52	21.32	33.00	PASS
N41	80MHz	30KHz	TM7	529998	Inner 1RB Left	22.42	21.22	33.00	PASS
N41	80MHz	30KHz	TM7	529998	Inner 1RB Right	22.30	21.10	33.00	PASS
N41	80MHz	30KHz	TM8	507204	Inner Full	20.93	19.73	33.00	PASS
N41	80MHz	30KHz	TM8	507204	Inner 1RB Left	20.99	19.79	33.00	PASS
N41	80MHz	30KHz	TM8	507204	Inner 1RB Right	20.92	19.72	33.00	PASS
N41	80MHz	30KHz	TM8	518598	Inner Full	20.91	19.71	33.00	PASS



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

SGS-CSTC Standards Technical Services Co., Ltd.
Shenzhen Branch (Not a Testing Laboratory)

No. 1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgsgroup.com.cn
中国·深圳·科技园中区M-10栋一号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com



N41	80MHz	30KHz	TM8	518598	Inner 1RB Left	21.06	19.86	33.00	PASS
N41	80MHz	30KHz	TM8	518598	Inner 1RB Right	21.13	19.93	33.00	PASS
N41	80MHz	30KHz	TM8	529998	Inner Full	21.06	19.86	33.00	PASS
N41	80MHz	30KHz	TM8	529998	Inner 1RB Left	21.12	19.92	33.00	PASS
N41	80MHz	30KHz	TM8	529998	Inner 1RB Right	20.70	19.50	33.00	PASS
N41	80MHz	30KHz	TM9	507204	Inner Full	17.93	16.73	33.00	PASS
N41	80MHz	30KHz	TM9	507204	Inner 1RB Left	18.00	16.80	33.00	PASS
N41	80MHz	30KHz	TM9	507204	Inner 1RB Right	17.25	16.05	33.00	PASS
N41	80MHz	30KHz	TM9	518598	Inner Full	17.90	16.70	33.00	PASS
N41	80MHz	30KHz	TM9	518598	Inner 1RB Left	18.08	16.88	33.00	PASS
N41	80MHz	30KHz	TM9	518598	Inner 1RB Right	18.03	16.83	33.00	PASS
N41	80MHz	30KHz	TM9	529998	Inner Full	18.02	16.82	33.00	PASS
N41	80MHz	30KHz	TM9	529998	Inner 1RB Left	18.48	17.28	33.00	PASS
N41	80MHz	30KHz	TM9	529998	Inner 1RB Right	17.82	16.62	33.00	PASS
N41	90MHz	30KHz	TM1	508200	Inner Full	24.46	23.26	33.00	PASS
N41	90MHz	30KHz	TM1	508200	Inner 1RB Left	24.68	23.48	33.00	PASS
N41	90MHz	30KHz	TM1	508200	Inner 1RB Right	24.07	22.87	33.00	PASS
N41	90MHz	30KHz	TM1	518598	Inner Full	24.50	23.30	33.00	PASS
N41	90MHz	30KHz	TM1	518598	Inner 1RB Left	23.82	22.62	33.00	PASS
N41	90MHz	30KHz	TM1	518598	Inner 1RB Right	24.6	23.40	33.00	PASS
N41	90MHz	30KHz	TM1	528996	Inner Full	24.42	23.22	33.00	PASS
N41	90MHz	30KHz	TM1	528996	Inner 1RB Left	24.95	23.75	33.00	PASS
N41	90MHz	30KHz	TM1	528996	Inner 1RB Right	24.40	23.20	33.00	PASS
N41	90MHz	30KHz	TM2	508200	Inner Full	24.47	23.27	33.00	PASS
N41	90MHz	30KHz	TM2	508200	Inner 1RB Left	24.57	23.37	33.00	PASS
N41	90MHz	30KHz	TM2	508200	Inner 1RB Right	23.96	22.76	33.00	PASS
N41	90MHz	30KHz	TM2	518598	Inner Full	24.46	23.26	33.00	PASS
N41	90MHz	30KHz	TM2	518598	Inner 1RB Left	24.76	23.56	33.00	PASS
N41	90MHz	30KHz	TM2	518598	Inner 1RB Right	24.64	23.44	33.00	PASS
N41	90MHz	30KHz	TM2	528996	Inner Full	24.42	23.22	33.00	PASS
N41	90MHz	30KHz	TM2	528996	Inner 1RB Left	24.70	23.50	33.00	PASS
N41	90MHz	30KHz	TM2	528996	Inner 1RB Right	24.26	23.06	33.00	PASS
N41	90MHz	30KHz	TM3	508200	Inner Full	23.47	22.27	33.00	PASS
N41	90MHz	30KHz	TM3	508200	Inner 1RB Left	23.47	22.27	33.00	PASS
N41	90MHz	30KHz	TM3	508200	Inner 1RB Right	22.95	21.75	33.00	PASS
N41	90MHz	30KHz	TM3	518598	Inner Full	23.43	22.23	33.00	PASS
N41	90MHz	30KHz	TM3	518598	Inner 1RB Left	23.76	22.56	33.00	PASS
N41	90MHz	30KHz	TM3	518598	Inner 1RB Right	23.67	22.47	33.00	PASS
N41	90MHz	30KHz	TM3	528996	Inner Full	23.44	22.24	33.00	PASS
N41	90MHz	30KHz	TM3	528996	Inner 1RB Left	23.68	22.48	33.00	PASS
N41	90MHz	30KHz	TM3	528996	Inner 1RB Right	23.21	22.01	33.00	PASS
N41	90MHz	30KHz	TM4	508200	Inner Full	21.98	20.78	33.00	PASS
N41	90MHz	30KHz	TM4	508200	Inner 1RB Left	22.05	20.85	33.00	PASS
N41	90MHz	30KHz	TM4	508200	Inner 1RB Right	21.62	20.42	33.00	PASS
N41	90MHz	30KHz	TM4	518598	Inner Full	21.91	20.71	33.00	PASS
N41	90MHz	30KHz	TM4	518598	Inner 1RB Left	22.21	21.01	33.00	PASS
N41	90MHz	30KHz	TM4	518598	Inner 1RB Right	22.18	20.98	33.00	PASS
N41	90MHz	30KHz	TM4	528996	Inner Full	21.97	20.77	33.00	PASS



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

SGS-CSTC Standards Technical Services Co., Ltd.
Shenzhen Branch (Not a Testing Laboratory)

No. 1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgsgroup.com.cn
中国·深圳·科技园中区M-10栋一号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com



N41	90MHz	30KHz	TM4	528996	Inner 1RB Left	22.19	20.99	33.00	PASS
N41	90MHz	30KHz	TM4	528996	Inner 1RB Right	21.57	20.37	33.00	PASS
N41	90MHz	30KHz	TM5	508200	Inner Full	19.90	18.70	33.00	PASS
N41	90MHz	30KHz	TM5	508200	Inner 1RB Left	20.12	18.92	33.00	PASS
N41	90MHz	30KHz	TM5	508200	Inner 1RB Right	19.46	18.26	33.00	PASS
N41	90MHz	30KHz	TM5	518598	Inner Full	20.71	19.51	33.00	PASS
N41	90MHz	30KHz	TM5	518598	Inner 1RB Left	20.18	18.98	33.00	PASS
N41	90MHz	30KHz	TM5	518598	Inner 1RB Right	20.07	18.87	33.00	PASS
N41	90MHz	30KHz	TM5	528996	Inner Full	20.55	19.35	33.00	PASS
N41	90MHz	30KHz	TM5	528996	Inner 1RB Left	20.32	19.12	33.00	PASS
N41	90MHz	30KHz	TM5	528996	Inner 1RB Right	19.83	18.63	33.00	PASS
N41	90MHz	30KHz	TM6	508200	Inner Full	15.34	14.14	33.00	PASS
N41	90MHz	30KHz	TM6	508200	Inner 1RB Left	23.21	22.01	33.00	PASS
N41	90MHz	30KHz	TM6	508200	Inner 1RB Right	22.59	21.39	33.00	PASS
N41	90MHz	30KHz	TM6	518598	Inner Full	22.86	21.66	33.00	PASS
N41	90MHz	30KHz	TM6	518598	Inner 1RB Left	23.15	21.95	33.00	PASS
N41	90MHz	30KHz	TM6	518598	Inner 1RB Right	23.26	22.06	33.00	PASS
N41	90MHz	30KHz	TM6	528996	Inner Full	23.66	22.46	33.00	PASS
N41	90MHz	30KHz	TM6	528996	Inner 1RB Left	23.28	22.08	33.00	PASS
N41	90MHz	30KHz	TM6	528996	Inner 1RB Right	22.90	21.70	33.00	PASS
N41	90MHz	30KHz	TM7	508200	Inner Full	22.45	21.25	33.00	PASS
N41	90MHz	30KHz	TM7	508200	Inner 1RB Left	22.56	21.36	33.00	PASS
N41	90MHz	30KHz	TM7	508200	Inner 1RB Right	22.04	20.84	33.00	PASS
N41	90MHz	30KHz	TM7	518598	Inner Full	22.39	21.19	33.00	PASS
N41	90MHz	30KHz	TM7	518598	Inner 1RB Left	22.73	21.53	33.00	PASS
N41	90MHz	30KHz	TM7	518598	Inner 1RB Right	22.71	21.51	33.00	PASS
N41	90MHz	30KHz	TM7	528996	Inner Full	22.42	21.22	33.00	PASS
N41	90MHz	30KHz	TM7	528996	Inner 1RB Left	22.62	21.42	33.00	PASS
N41	90MHz	30KHz	TM7	528996	Inner 1RB Right	22.21	21.01	33.00	PASS
N41	90MHz	30KHz	TM8	508200	Inner Full	20.95	19.75	33.00	PASS
N41	90MHz	30KHz	TM8	508200	Inner 1RB Left	21.00	19.80	33.00	PASS
N41	90MHz	30KHz	TM8	508200	Inner 1RB Right	20.53	19.33	33.00	PASS
N41	90MHz	30KHz	TM8	518598	Inner Full	20.90	19.70	33.00	PASS
N41	90MHz	30KHz	TM8	518598	Inner 1RB Left	21.03	19.83	33.00	PASS
N41	90MHz	30KHz	TM8	518598	Inner 1RB Right	20.99	19.79	33.00	PASS
N41	90MHz	30KHz	TM8	528996	Inner Full	20.96	19.76	33.00	PASS
N41	90MHz	30KHz	TM8	528996	Inner 1RB Left	21.14	19.94	33.00	PASS
N41	90MHz	30KHz	TM8	528996	Inner 1RB Right	20.83	19.63	33.00	PASS
N41	90MHz	30KHz	TM9	508200	Inner Full	17.97	16.77	33.00	PASS
N41	90MHz	30KHz	TM9	508200	Inner 1RB Left	17.46	16.26	33.00	PASS
N41	90MHz	30KHz	TM9	508200	Inner 1RB Right	17.61	16.41	33.00	PASS
N41	90MHz	30KHz	TM9	518598	Inner Full	17.89	16.69	33.00	PASS
N41	90MHz	30KHz	TM9	518598	Inner 1RB Left	17.63	16.43	33.00	PASS
N41	90MHz	30KHz	TM9	518598	Inner 1RB Right	18.24	17.04	33.00	PASS
N41	90MHz	30KHz	TM9	528996	Inner Full	17.93	16.73	33.00	PASS
N41	90MHz	30KHz	TM9	528996	Inner 1RB Left	17.14	15.94	33.00	PASS
N41	90MHz	30KHz	TM9	528996	Inner 1RB Right	17.83	16.63	33.00	PASS
N41	100MHz	30KHz	TM1	509202	Inner Full	24.51	23.31	33.00	PASS



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

SGS-CSTC Standards Technical Services Co., Ltd.
Shenzhen Branch (Technical Services Laboratory)

No. 1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgsgroup.com.cn
中国·深圳·科技园中区M-10栋一号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com



N41	100MHZ	30KHZ	TM1	509202	Inner 1RB Left	24.57	23.37	33.00	PASS
N41	100MHZ	30KHZ	TM1	509202	Inner 1RB Right	24.03	22.83	33.00	PASS
N41	100MHZ	30KHZ	TM1	518598	Inner Full	24.40	23.20	33.00	PASS
N41	100MHZ	30KHZ	TM1	518598	Inner 1RB Left	24.64	23.44	33.00	PASS
N41	100MHZ	30KHZ	TM1	518598	Inner 1RB Right	24.46	23.26	33.00	PASS
N41	100MHZ	30KHZ	TM1	528000	Inner Full	24.43	23.23	33.00	PASS
N41	100MHZ	30KHZ	TM1	528000	Inner 1RB Left	24.54	23.34	33.00	PASS
N41	100MHZ	30KHZ	TM1	528000	Inner 1RB Right	24.28	23.08	33.00	PASS
N41	100MHZ	30KHZ	TM2	509202	Inner Full	24.40	23.20	33.00	PASS
N41	100MHZ	30KHZ	TM2	509202	Inner 1RB Left	24.52	23.32	33.00	PASS
N41	100MHZ	30KHZ	TM2	509202	Inner 1RB Right	24.02	22.82	33.00	PASS
N41	100MHZ	30KHZ	TM2	518598	Inner Full	24.41	23.21	33.00	PASS
N41	100MHZ	30KHZ	TM2	518598	Inner 1RB Left	24.85	23.65	33.00	PASS
N41	100MHZ	30KHZ	TM2	518598	Inner 1RB Right	24.54	23.34	33.00	PASS
N41	100MHZ	30KHZ	TM2	528000	Inner Full	24.46	23.26	33.00	PASS
N41	100MHZ	30KHZ	TM2	528000	Inner 1RB Left	24.28	23.08	33.00	PASS
N41	100MHZ	30KHZ	TM2	528000	Inner 1RB Right	24.23	23.03	33.00	PASS
N41	100MHZ	30KHZ	TM3	509202	Inner Full	23.42	22.22	33.00	PASS
N41	100MHZ	30KHZ	TM3	509202	Inner 1RB Left	22.89	21.69	33.00	PASS
N41	100MHZ	30KHZ	TM3	509202	Inner 1RB Right	22.96	21.76	33.00	PASS
N41	100MHZ	30KHZ	TM3	518598	Inner Full	23.35	22.15	33.00	PASS
N41	100MHZ	30KHZ	TM3	518598	Inner 1RB Left	23.78	22.58	33.00	PASS
N41	100MHZ	30KHZ	TM3	518598	Inner 1RB Right	23.37	22.17	33.00	PASS
N41	100MHZ	30KHZ	TM3	528000	Inner Full	23.45	22.25	33.00	PASS
N41	100MHZ	30KHZ	TM3	528000	Inner 1RB Left	23.29	22.09	33.00	PASS
N41	100MHZ	30KHZ	TM3	528000	Inner 1RB Right	23.32	22.12	33.00	PASS
N41	100MHZ	30KHZ	TM4	509202	Inner Full	21.95	20.75	33.00	PASS
N41	100MHZ	30KHZ	TM4	509202	Inner 1RB Left	21.58	20.38	33.00	PASS
N41	100MHZ	30KHZ	TM4	509202	Inner 1RB Right	21.40	20.20	33.00	PASS
N41	100MHZ	30KHZ	TM4	518598	Inner Full	21.88	20.68	33.00	PASS
N41	100MHZ	30KHZ	TM4	518598	Inner 1RB Left	22.30	21.10	33.00	PASS
N41	100MHZ	30KHZ	TM4	518598	Inner 1RB Right	21.86	20.66	33.00	PASS
N41	100MHZ	30KHZ	TM4	528000	Inner Full	21.94	20.74	33.00	PASS
N41	100MHZ	30KHZ	TM4	528000	Inner 1RB Left	21.79	20.59	33.00	PASS
N41	100MHZ	30KHZ	TM4	528000	Inner 1RB Right	21.25	20.05	33.00	PASS
N41	100MHZ	30KHZ	TM5	509202	Inner Full	19.98	18.78	33.00	PASS
N41	100MHZ	30KHZ	TM5	509202	Inner 1RB Left	19.98	18.78	33.00	PASS
N41	100MHZ	30KHZ	TM5	509202	Inner 1RB Right	19.44	18.24	33.00	PASS
N41	100MHZ	30KHZ	TM5	518598	Inner Full	19.86	18.66	33.00	PASS
N41	100MHZ	30KHZ	TM5	518598	Inner 1RB Left	20.25	19.05	33.00	PASS
N41	100MHZ	30KHZ	TM5	518598	Inner 1RB Right	20.19	18.99	33.00	PASS
N41	100MHZ	30KHZ	TM5	528000	Inner Full	19.89	18.69	33.00	PASS
N41	100MHZ	30KHZ	TM5	528000	Inner 1RB Left	20.05	18.85	33.00	PASS
N41	100MHZ	30KHZ	TM5	528000	Inner 1RB Right	19.68	18.48	33.00	PASS
N41	100MHZ	30KHZ	TM6	509202	Inner Full	19.75	18.55	33.00	PASS
N41	100MHZ	30KHZ	TM6	509202	Inner 1RB Left	23.18	21.98	33.00	PASS
N41	100MHZ	30KHZ	TM6	509202	Inner 1RB Right	22.63	21.43	33.00	PASS
N41	100MHZ	30KHZ	TM6	518598	Inner Full	22.19	20.99	33.00	PASS



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

SGS-CSTC Standards Technical Services Co., Ltd.
Shenzhen Branch Inspection & Testing Laboratory

No. 1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgsgroup.com.cn
中国·深圳·科技园中区M-10栋一号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com



N41	100MHz	30KHz	TM6	518598	Inner 1RB Left	23.34	22.14	33.00	PASS
N41	100MHz	30KHz	TM6	518598	Inner 1RB Right	23.16	21.96	33.00	PASS
N41	100MHz	30KHz	TM6	528000	Inner Full	22.94	21.74	33.00	PASS
N41	100MHz	30KHz	TM6	528000	Inner 1RB Left	22.84	21.64	33.00	PASS
N41	100MHz	30KHz	TM6	528000	Inner 1RB Right	22.95	21.75	33.00	PASS
N41	100MHz	30KHz	TM7	509202	Inner Full	22.42	21.22	33.00	PASS
N41	100MHz	30KHz	TM7	509202	Inner 1RB Left	22.37	21.17	33.00	PASS
N41	100MHz	30KHz	TM7	509202	Inner 1RB Right	22.01	20.81	33.00	PASS
N41	100MHz	30KHz	TM7	518598	Inner Full	22.41	21.21	33.00	PASS
N41	100MHz	30KHz	TM7	518598	Inner 1RB Left	22.83	21.63	33.00	PASS
N41	100MHz	30KHz	TM7	518598	Inner 1RB Right	22.60	21.40	33.00	PASS
N41	100MHz	30KHz	TM7	528000	Inner Full	22.45	21.25	33.00	PASS
N41	100MHz	30KHz	TM7	528000	Inner 1RB Left	22.25	21.05	33.00	PASS
N41	100MHz	30KHz	TM7	528000	Inner 1RB Right	22.20	21.00	33.00	PASS
N41	100MHz	30KHz	TM8	509202	Inner Full	20.87	19.67	33.00	PASS
N41	100MHz	30KHz	TM8	509202	Inner 1RB Left	20.87	19.67	33.00	PASS
N41	100MHz	30KHz	TM8	509202	Inner 1RB Right	20.39	19.19	33.00	PASS
N41	100MHz	30KHz	TM8	518598	Inner Full	20.92	19.72	33.00	PASS
N41	100MHz	30KHz	TM8	518598	Inner 1RB Left	21.33	20.13	33.00	PASS
N41	100MHz	30KHz	TM8	518598	Inner 1RB Right	21.01	19.81	33.00	PASS
N41	100MHz	30KHz	TM8	528000	Inner Full	20.91	19.71	33.00	PASS
N41	100MHz	30KHz	TM8	528000	Inner 1RB Left	20.74	19.54	33.00	PASS
N41	100MHz	30KHz	TM8	528000	Inner 1RB Right	20.74	19.54	33.00	PASS
N41	100MHz	30KHz	TM9	509202	Inner Full	17.90	16.70	33.00	PASS
N41	100MHz	30KHz	TM9	509202	Inner 1RB Left	17.50	16.30	33.00	PASS
N41	100MHz	30KHz	TM9	509202	Inner 1RB Right	17.64	16.44	33.00	PASS
N41	100MHz	30KHz	TM9	518598	Inner Full	17.98	16.78	33.00	PASS
N41	100MHz	30KHz	TM9	518598	Inner 1RB Left	17.74	16.54	33.00	PASS
N41	100MHz	30KHz	TM9	518598	Inner 1RB Right	18.01	16.81	33.00	PASS
N41	100MHz	30KHz	TM9	528000	Inner Full	17.95	16.75	33.00	PASS
N41	100MHz	30KHz	TM9	528000	Inner 1RB Left	17.66	16.46	33.00	PASS
N41	100MHz	30KHz	TM9	528000	Inner 1RB Right	17.71	16.51	33.00	PASS

Ant1:

NR Band	Bandwidth	SCS	Modulation	Channel	RB Config	Conducted Power(dBm)	EIRP (dBm)	Limit (dBm)	Verdict
N41	20MHz	30KHz	TM1	501204	Inner Full	25.18	23.18	33.00	PASS
N41	20MHz	30KHz	TM1	501204	Inner 1RB Left	24.47	22.47	33.00	PASS
N41	20MHz	30KHz	TM1	501204	Inner 1RB Right	24.95	22.95	33.00	PASS
N41	20MHz	30KHz	TM1	518598	Inner Full	24.76	22.76	33.00	PASS
N41	20MHz	30KHz	TM1	518598	Inner 1RB Left	24.74	22.74	33.00	PASS
N41	20MHz	30KHz	TM1	518598	Inner 1RB Right	24.61	22.61	33.00	PASS
N41	20MHz	30KHz	TM1	535998	Inner Full	23.57	21.57	33.00	PASS
N41	20MHz	30KHz	TM1	535998	Inner 1RB Left	23.53	21.53	33.00	PASS
N41	20MHz	30KHz	TM1	535998	Inner 1RB Right	23.25	21.25	33.00	PASS



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

SGS-CSTC Standards Technical Services Co., Ltd.
Shenzhen Branch (Inspection & Testing Services Laboratory)

No. 1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgsgroup.com.cn
中国·深圳·科技园中区M-10栋一号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com



N41	20MHz	30KHz	TM2	501204	Inner Full	25.06	23.06	33.00	PASS
N41	20MHz	30KHz	TM2	501204	Inner 1RB Left	24.46	22.46	33.00	PASS
N41	20MHz	30KHz	TM2	501204	Inner 1RB Right	24.97	22.97	33.00	PASS
N41	20MHz	30KHz	TM2	518598	Inner Full	24.75	22.75	33.00	PASS
N41	20MHz	30KHz	TM2	518598	Inner 1RB Left	24.39	22.39	33.00	PASS
N41	20MHz	30KHz	TM2	518598	Inner 1RB Right	24.45	22.45	33.00	PASS
N41	20MHz	30KHz	TM2	535998	Inner Full	23.81	21.81	33.00	PASS
N41	20MHz	30KHz	TM2	535998	Inner 1RB Left	23.50	21.50	33.00	PASS
N41	20MHz	30KHz	TM2	535998	Inner 1RB Right	23.24	21.24	33.00	PASS
N41	20MHz	30KHz	TM3	501204	Inner Full	24.01	22.01	33.00	PASS
N41	20MHz	30KHz	TM3	501204	Inner 1RB Left	23.45	21.45	33.00	PASS
N41	20MHz	30KHz	TM3	501204	Inner 1RB Right	23.99	21.99	33.00	PASS
N41	20MHz	30KHz	TM3	518598	Inner Full	23.79	21.79	33.00	PASS
N41	20MHz	30KHz	TM3	518598	Inner 1RB Left	23.73	21.73	33.00	PASS
N41	20MHz	30KHz	TM3	518598	Inner 1RB Right	23.51	21.51	33.00	PASS
N41	20MHz	30KHz	TM3	535998	Inner Full	22.69	20.69	33.00	PASS
N41	20MHz	30KHz	TM3	535998	Inner 1RB Left	22.34	20.34	33.00	PASS
N41	20MHz	30KHz	TM3	535998	Inner 1RB Right	22.07	20.07	33.00	PASS
N41	20MHz	30KHz	TM4	501204	Inner Full	22.88	20.88	33.00	PASS
N41	20MHz	30KHz	TM4	501204	Inner 1RB Left	22.48	20.48	33.00	PASS
N41	20MHz	30KHz	TM4	501204	Inner 1RB Right	22.42	20.42	33.00	PASS
N41	20MHz	30KHz	TM4	518598	Inner Full	22.27	20.27	33.00	PASS
N41	20MHz	30KHz	TM4	518598	Inner 1RB Left	22.19	20.19	33.00	PASS
N41	20MHz	30KHz	TM4	518598	Inner 1RB Right	22.15	20.15	33.00	PASS
N41	20MHz	30KHz	TM4	535998	Inner Full	21.44	19.44	33.00	PASS
N41	20MHz	30KHz	TM4	535998	Inner 1RB Left	21.88	19.88	33.00	PASS
N41	20MHz	30KHz	TM4	535998	Inner 1RB Right	21.66	19.66	33.00	PASS
N41	20MHz	30KHz	TM5	501204	Inner Full	20.57	18.57	33.00	PASS
N41	20MHz	30KHz	TM5	501204	Inner 1RB Left	20.07	18.07	33.00	PASS
N41	20MHz	30KHz	TM5	501204	Inner 1RB Right	20.42	18.42	33.00	PASS
N41	20MHz	30KHz	TM5	518598	Inner Full	20.31	18.31	33.00	PASS
N41	20MHz	30KHz	TM5	518598	Inner 1RB Left	20.18	18.18	33.00	PASS
N41	20MHz	30KHz	TM5	518598	Inner 1RB Right	20.19	18.19	33.00	PASS
N41	20MHz	30KHz	TM5	535998	Inner Full	19.93	17.93	33.00	PASS
N41	20MHz	30KHz	TM5	535998	Inner 1RB Left	19.96	17.96	33.00	PASS
N41	20MHz	30KHz	TM5	535998	Inner 1RB Right	19.81	17.81	33.00	PASS
N41	20MHz	30KHz	TM6	501204	Inner Full	23.43	21.43	33.00	PASS
N41	20MHz	30KHz	TM6	501204	Inner 1RB Left	22.72	20.72	33.00	PASS
N41	20MHz	30KHz	TM6	501204	Inner 1RB Right	23.42	21.42	33.00	PASS
N41	20MHz	30KHz	TM6	518598	Inner Full	23.29	21.29	33.00	PASS
N41	20MHz	30KHz	TM6	518598	Inner 1RB Left	23.18	21.18	33.00	PASS
N41	20MHz	30KHz	TM6	518598	Inner 1RB Right	23.10	21.10	33.00	PASS
N41	20MHz	30KHz	TM6	535998	Inner Full	21.37	19.37	33.00	PASS
N41	20MHz	30KHz	TM6	535998	Inner 1RB Left	21.82	19.82	33.00	PASS
N41	20MHz	30KHz	TM6	535998	Inner 1RB Right	21.60	19.60	33.00	PASS
N41	20MHz	30KHz	TM7	501204	Inner Full	23.09	21.09	33.00	PASS
N41	20MHz	30KHz	TM7	501204	Inner 1RB Left	22.24	20.24	33.00	PASS
N41	20MHz	30KHz	TM7	501204	Inner 1RB Right	23.05	21.05	33.00	PASS



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com



SGS-CSTC Standards Technical Services Co., Ltd. Shenzhen Branch

Report No.: AR/2020/C000207

Page: 18 of 114

N41	20MHz	30KHz	TM7	518598	Inner Full	22.77	20.77	33.00	PASS
N41	20MHz	30KHz	TM7	518598	Inner 1RB Left	22.72	20.72	33.00	PASS
N41	20MHz	30KHz	TM7	518598	Inner 1RB Right	22.63	20.63	33.00	PASS
N41	20MHz	30KHz	TM7	535998	Inner Full	21.50	19.50	33.00	PASS
N41	20MHz	30KHz	TM7	535998	Inner 1RB Left	21.42	19.42	33.00	PASS
N41	20MHz	30KHz	TM7	535998	Inner 1RB Right	21.13	19.13	33.00	PASS
N41	20MHz	30KHz	TM8	501204	Inner Full	21.56	19.56	33.00	PASS
N41	20MHz	30KHz	TM8	501204	Inner 1RB Left	21.37	19.37	33.00	PASS
N41	20MHz	30KHz	TM8	501204	Inner 1RB Right	21.58	19.58	33.00	PASS
N41	20MHz	30KHz	TM8	518598	Inner Full	21.31	19.31	33.00	PASS
N41	20MHz	30KHz	TM8	518598	Inner 1RB Left	21.30	19.30	33.00	PASS
N41	20MHz	30KHz	TM8	518598	Inner 1RB Right	21.25	19.25	33.00	PASS
N41	20MHz	30KHz	TM8	535998	Inner Full	20.17	18.17	33.00	PASS
N41	20MHz	30KHz	TM8	535998	Inner 1RB Left	20.39	18.39	33.00	PASS
N41	20MHz	30KHz	TM8	535998	Inner 1RB Right	20.30	18.30	33.00	PASS
N41	20MHz	30KHz	TM9	501204	Inner Full	20.91	18.91	33.00	PASS
N41	20MHz	30KHz	TM9	501204	Inner 1RB Left	18.58	16.58	33.00	PASS
N41	20MHz	30KHz	TM9	501204	Inner 1RB Right	18.54	16.54	33.00	PASS
N41	20MHz	30KHz	TM9	518598	Inner Full	18.26	16.26	33.00	PASS
N41	20MHz	30KHz	TM9	518598	Inner 1RB Left	18.30	16.30	33.00	PASS
N41	20MHz	30KHz	TM9	518598	Inner 1RB Right	18.26	16.26	33.00	PASS
N41	20MHz	30KHz	TM9	535998	Inner Full	17.37	15.37	33.00	PASS
N41	20MHz	30KHz	TM9	535998	Inner 1RB Left	17.34	15.34	33.00	PASS
N41	20MHz	30KHz	TM9	535998	Inner 1RB Right	16.93	14.93	33.00	PASS
N41	30MHz	30KHz	TM1	502200	Inner Full	24.74	22.74	33.00	PASS
N41	30MHz	30KHz	TM1	502200	Inner 1RB Left	24.66	22.66	33.00	PASS
N41	30MHz	30KHz	TM1	502200	Inner 1RB Right	25.00	23.00	33.00	PASS
N41	30MHz	30KHz	TM1	518598	Inner Full	24.75	22.75	33.00	PASS
N41	30MHz	30KHz	TM1	518598	Inner 1RB Left	25.12	23.12	33.00	PASS
N41	30MHz	30KHz	TM1	518598	Inner 1RB Right	24.91	22.91	33.00	PASS
N41	30MHz	30KHz	TM1	534996	Inner Full	24.75	22.75	33.00	PASS
N41	30MHz	30KHz	TM1	534996	Inner 1RB Left	23.16	21.16	33.00	PASS
N41	30MHz	30KHz	TM1	534996	Inner 1RB Right	22.74	20.74	33.00	PASS
N41	30MHz	30KHz	TM2	502200	Inner Full	24.92	22.92	33.00	PASS
N41	30MHz	30KHz	TM2	502200	Inner 1RB Left	24.74	22.74	33.00	PASS
N41	30MHz	30KHz	TM2	502200	Inner 1RB Right	24.88	22.88	33.00	PASS
N41	30MHz	30KHz	TM2	518598	Inner Full	24.75	22.75	33.00	PASS
N41	30MHz	30KHz	TM2	518598	Inner 1RB Left	25.03	23.03	33.00	PASS
N41	30MHz	30KHz	TM2	518598	Inner 1RB Right	24.79	22.79	33.00	PASS
N41	30MHz	30KHz	TM2	534996	Inner Full	24.86	22.86	33.00	PASS
N41	30MHz	30KHz	TM2	534996	Inner 1RB Left	23.64	21.64	33.00	PASS
N41	30MHz	30KHz	TM2	534996	Inner 1RB Right	23.58	21.58	33.00	PASS
N41	30MHz	30KHz	TM3	502200	Inner Full	23.82	21.82	33.00	PASS
N41	30MHz	30KHz	TM3	502200	Inner 1RB Left	23.65	21.65	33.00	PASS
N41	30MHz	30KHz	TM3	502200	Inner 1RB Right	23.29	21.29	33.00	PASS
N41	30MHz	30KHz	TM3	518598	Inner Full	20.77	18.77	33.00	PASS
N41	30MHz	30KHz	TM3	518598	Inner 1RB Left	23.49	21.49	33.00	PASS
N41	30MHz	30KHz	TM3	518598	Inner 1RB Right	23.24	21.24	33.00	PASS



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

SGS-CSTC Standards Technical Services Co., Ltd.
Shenzhen Branch (Technical Services Laboratory)

No. 1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgsgroup.com.cn
中国·深圳·科技园中区M-10栋一号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com



N41	30MHz	30KHz	TM3	534996	Inner Full	23.25	21.25	33.00	PASS
N41	30MHz	30KHz	TM3	534996	Inner 1RB Left	22.53	20.53	33.00	PASS
N41	30MHz	30KHz	TM3	534996	Inner 1RB Right	22.26	20.26	33.00	PASS
N41	30MHz	30KHz	TM4	502200	Inner Full	22.47	20.47	33.00	PASS
N41	30MHz	30KHz	TM4	502200	Inner 1RB Left	22.50	20.50	33.00	PASS
N41	30MHz	30KHz	TM4	502200	Inner 1RB Right	22.41	20.41	33.00	PASS
N41	30MHz	30KHz	TM4	518598	Inner Full	22.14	20.14	33.00	PASS
N41	30MHz	30KHz	TM4	518598	Inner 1RB Left	22.52	20.52	33.00	PASS
N41	30MHz	30KHz	TM4	518598	Inner 1RB Right	22.32	20.32	33.00	PASS
N41	30MHz	30KHz	TM4	534996	Inner Full	22.21	20.21	33.00	PASS
N41	30MHz	30KHz	TM4	534996	Inner 1RB Left	21.63	19.63	33.00	PASS
N41	30MHz	30KHz	TM4	534996	Inner 1RB Right	21.35	19.35	33.00	PASS
N41	30MHz	30KHz	TM5	502200	Inner Full	20.50	18.50	33.00	PASS
N41	30MHz	30KHz	TM5	502200	Inner 1RB Left	20.35	18.35	33.00	PASS
N41	30MHz	30KHz	TM5	502200	Inner 1RB Right	20.22	18.22	33.00	PASS
N41	30MHz	30KHz	TM5	518598	Inner Full	20.07	18.07	33.00	PASS
N41	30MHz	30KHz	TM5	518598	Inner 1RB Left	20.70	18.70	33.00	PASS
N41	30MHz	30KHz	TM5	518598	Inner 1RB Right	20.37	18.37	33.00	PASS
N41	30MHz	30KHz	TM5	534996	Inner Full	20.48	18.48	33.00	PASS
N41	30MHz	30KHz	TM5	534996	Inner 1RB Left	20.19	18.19	33.00	PASS
N41	30MHz	30KHz	TM5	534996	Inner 1RB Right	19.86	17.86	33.00	PASS
N41	30MHz	30KHz	TM6	502200	Inner Full	23.39	21.39	33.00	PASS
N41	30MHz	30KHz	TM6	502200	Inner 1RB Left	23.00	21.00	33.00	PASS
N41	30MHz	30KHz	TM6	502200	Inner 1RB Right	23.58	21.58	33.00	PASS
N41	30MHz	30KHz	TM6	518598	Inner Full	23.75	21.75	33.00	PASS
N41	30MHz	30KHz	TM6	518598	Inner 1RB Left	23.58	21.58	33.00	PASS
N41	30MHz	30KHz	TM6	518598	Inner 1RB Right	23.86	21.86	33.00	PASS
N41	30MHz	30KHz	TM6	534996	Inner Full	22.63	20.63	33.00	PASS
N41	30MHz	30KHz	TM6	534996	Inner 1RB Left	21.93	19.93	33.00	PASS
N41	30MHz	30KHz	TM6	534996	Inner 1RB Right	21.68	19.68	33.00	PASS
N41	30MHz	30KHz	TM7	502200	Inner Full	22.72	20.72	33.00	PASS
N41	30MHz	30KHz	TM7	502200	Inner 1RB Left	22.56	20.56	33.00	PASS
N41	30MHz	30KHz	TM7	502200	Inner 1RB Right	23.12	21.12	33.00	PASS
N41	30MHz	30KHz	TM7	518598	Inner Full	22.52	20.52	33.00	PASS
N41	30MHz	30KHz	TM7	518598	Inner 1RB Left	23.47	21.47	33.00	PASS
N41	30MHz	30KHz	TM7	518598	Inner 1RB Right	22.85	20.85	33.00	PASS
N41	30MHz	30KHz	TM7	534996	Inner Full	22.53	20.53	33.00	PASS
N41	30MHz	30KHz	TM7	534996	Inner 1RB Left	21.45	19.45	33.00	PASS
N41	30MHz	30KHz	TM7	534996	Inner 1RB Right	21.31	19.31	33.00	PASS
N41	30MHz	30KHz	TM8	502200	Inner Full	21.42	19.42	33.00	PASS
N41	30MHz	30KHz	TM8	502200	Inner 1RB Left	21.59	19.59	33.00	PASS
N41	30MHz	30KHz	TM8	502200	Inner 1RB Right	21.34	19.34	33.00	PASS
N41	30MHz	30KHz	TM8	518598	Inner Full	21.06	19.06	33.00	PASS
N41	30MHz	30KHz	TM8	518598	Inner 1RB Left	21.51	19.51	33.00	PASS
N41	30MHz	30KHz	TM8	518598	Inner 1RB Right	21.23	19.23	33.00	PASS
N41	30MHz	30KHz	TM8	534996	Inner Full	21.26	19.26	33.00	PASS
N41	30MHz	30KHz	TM8	534996	Inner 1RB Left	20.31	18.31	33.00	PASS
N41	30MHz	30KHz	TM8	534996	Inner 1RB Right	20.23	18.23	33.00	PASS



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

SGS-CSTC Standards Technical Services Co., Ltd.
Shenzhen Branch (Technical Services Laboratory)

No. 1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgs.com
中国·深圳·科技园中区M-10栋一号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com



N41	30MHz	30KHz	TM9	502200	Inner Full	18.43	16.43	33.00	PASS
N41	30MHz	30KHz	TM9	502200	Inner 1RB Left	18.68	16.68	33.00	PASS
N41	30MHz	30KHz	TM9	502200	Inner 1RB Right	18.57	16.57	33.00	PASS
N41	30MHz	30KHz	TM9	518598	Inner Full	18.18	16.18	33.00	PASS
N41	30MHz	30KHz	TM9	518598	Inner 1RB Left	18.73	16.73	33.00	PASS
N41	30MHz	30KHz	TM9	518598	Inner 1RB Right	18.49	16.49	33.00	PASS
N41	30MHz	30KHz	TM9	534996	Inner Full	18.20	16.20	33.00	PASS
N41	30MHz	30KHz	TM9	534996	Inner 1RB Left	17.35	15.35	33.00	PASS
N41	30MHz	30KHz	TM9	534996	Inner 1RB Right	17.66	15.66	33.00	PASS
N41	40MHz	30KHz	TM1	503202	Inner Full	25.02	23.02	33.00	PASS
N41	40MHz	30KHz	TM1	503202	Inner 1RB Left	24.23	22.23	33.00	PASS
N41	40MHz	30KHz	TM1	503202	Inner 1RB Right	24.91	22.91	33.00	PASS
N41	40MHz	30KHz	TM1	518598	Inner Full	24.85	22.85	33.00	PASS
N41	40MHz	30KHz	TM1	518598	Inner 1RB Left	25.03	23.03	33.00	PASS
N41	40MHz	30KHz	TM1	518598	Inner 1RB Right	24.57	22.57	33.00	PASS
N41	40MHz	30KHz	TM1	534000	Inner Full	24.09	22.09	33.00	PASS
N41	40MHz	30KHz	TM1	534000	Inner 1RB Left	24.21	22.21	33.00	PASS
N41	40MHz	30KHz	TM1	534000	Inner 1RB Right	24.13	22.13	33.00	PASS
N41	40MHz	30KHz	TM2	503202	Inner Full	25.01	23.01	33.00	PASS
N41	40MHz	30KHz	TM2	503202	Inner 1RB Left	24.34	22.34	33.00	PASS
N41	40MHz	30KHz	TM2	503202	Inner 1RB Right	24.93	22.93	33.00	PASS
N41	40MHz	30KHz	TM2	518598	Inner Full	24.89	22.89	33.00	PASS
N41	40MHz	30KHz	TM2	518598	Inner 1RB Left	25.03	23.03	33.00	PASS
N41	40MHz	30KHz	TM2	518598	Inner 1RB Right	24.62	22.62	33.00	PASS
N41	40MHz	30KHz	TM2	534000	Inner Full	24.12	22.12	33.00	PASS
N41	40MHz	30KHz	TM2	534000	Inner 1RB Left	24.07	22.07	33.00	PASS
N41	40MHz	30KHz	TM2	534000	Inner 1RB Right	22.76	20.76	33.00	PASS
N41	40MHz	30KHz	TM3	503202	Inner Full	24.03	22.03	33.00	PASS
N41	40MHz	30KHz	TM3	503202	Inner 1RB Left	23.17	21.17	33.00	PASS
N41	40MHz	30KHz	TM3	503202	Inner 1RB Right	23.84	21.84	33.00	PASS
N41	40MHz	30KHz	TM3	518598	Inner Full	23.87	21.87	33.00	PASS
N41	40MHz	30KHz	TM3	518598	Inner 1RB Left	24.06	22.06	33.00	PASS
N41	40MHz	30KHz	TM3	518598	Inner 1RB Right	23.58	21.58	33.00	PASS
N41	40MHz	30KHz	TM3	534000	Inner Full	23.07	21.07	33.00	PASS
N41	40MHz	30KHz	TM3	534000	Inner 1RB Left	22.59	20.59	33.00	PASS
N41	40MHz	30KHz	TM3	534000	Inner 1RB Right	21.05	19.05	33.00	PASS
N41	40MHz	30KHz	TM4	503202	Inner Full	22.55	20.55	33.00	PASS
N41	40MHz	30KHz	TM4	503202	Inner 1RB Left	22.09	20.09	33.00	PASS
N41	40MHz	30KHz	TM4	503202	Inner 1RB Right	22.62	20.62	33.00	PASS
N41	40MHz	30KHz	TM4	518598	Inner Full	22.37	20.37	33.00	PASS
N41	40MHz	30KHz	TM4	518598	Inner 1RB Left	22.33	20.33	33.00	PASS
N41	40MHz	30KHz	TM4	518598	Inner 1RB Right	22.40	20.40	33.00	PASS
N41	40MHz	30KHz	TM4	534000	Inner Full	21.36	19.36	33.00	PASS
N41	40MHz	30KHz	TM4	534000	Inner 1RB Left	21.71	19.71	33.00	PASS
N41	40MHz	30KHz	TM4	534000	Inner 1RB Right	20.24	18.24	33.00	PASS
N41	40MHz	30KHz	TM5	503202	Inner Full	20.88	18.88	33.00	PASS
N41	40MHz	30KHz	TM5	503202	Inner 1RB Left	20.48	18.48	33.00	PASS
N41	40MHz	30KHz	TM5	503202	Inner 1RB Right	20.72	18.72	33.00	PASS



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

SGS-CSTC Standards Technical Services Co., Ltd.
Shenzhen Branch (Technical Services Laboratory)

No. 1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgsgroup.com.cn
中国·深圳·科技园中区M-10栋一号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com



N41	40MHz	30KHz	TM5	518598	Inner Full	20.36	18.36	33.00	PASS
N41	40MHz	30KHz	TM5	518598	Inner 1RB Left	20.61	18.61	33.00	PASS
N41	40MHz	30KHz	TM5	518598	Inner 1RB Right	20.37	18.37	33.00	PASS
N41	40MHz	30KHz	TM5	534000	Inner Full	19.85	17.85	33.00	PASS
N41	40MHz	30KHz	TM5	534000	Inner 1RB Left	20.16	18.16	33.00	PASS
N41	40MHz	30KHz	TM5	534000	Inner 1RB Right	20.04	18.04	33.00	PASS
N41	40MHz	30KHz	TM6	503202	Inner Full	23.25	21.25	33.00	PASS
N41	40MHz	30KHz	TM6	503202	Inner 1RB Left	22.52	20.52	33.00	PASS
N41	40MHz	30KHz	TM6	503202	Inner 1RB Right	23.31	21.31	33.00	PASS
N41	40MHz	30KHz	TM6	518598	Inner Full	23.34	21.34	33.00	PASS
N41	40MHz	30KHz	TM6	518598	Inner 1RB Left	23.51	21.51	33.00	PASS
N41	40MHz	30KHz	TM6	518598	Inner 1RB Right	23.01	21.01	33.00	PASS
N41	40MHz	30KHz	TM6	534000	Inner Full	22.16	20.16	33.00	PASS
N41	40MHz	30KHz	TM6	534000	Inner 1RB Left	22.30	20.30	33.00	PASS
N41	40MHz	30KHz	TM6	534000	Inner 1RB Right	20.94	18.94	33.00	PASS
N41	40MHz	30KHz	TM7	503202	Inner Full	22.90	20.90	33.00	PASS
N41	40MHz	30KHz	TM7	503202	Inner 1RB Left	22.09	20.09	33.00	PASS
N41	40MHz	30KHz	TM7	503202	Inner 1RB Right	22.96	20.96	33.00	PASS
N41	40MHz	30KHz	TM7	518598	Inner Full	22.84	20.84	33.00	PASS
N41	40MHz	30KHz	TM7	518598	Inner 1RB Left	22.87	20.87	33.00	PASS
N41	40MHz	30KHz	TM7	518598	Inner 1RB Right	22.49	20.49	33.00	PASS
N41	40MHz	30KHz	TM7	534000	Inner Full	21.88	19.88	33.00	PASS
N41	40MHz	30KHz	TM7	534000	Inner 1RB Left	21.86	19.86	33.00	PASS
N41	40MHz	30KHz	TM7	534000	Inner 1RB Right	20.33	18.33	33.00	PASS
N41	40MHz	30KHz	TM8	503202	Inner Full	21.54	19.54	33.00	PASS
N41	40MHz	30KHz	TM8	503202	Inner 1RB Left	20.95	18.95	33.00	PASS
N41	40MHz	30KHz	TM8	503202	Inner 1RB Right	21.80	19.80	33.00	PASS
N41	40MHz	30KHz	TM8	518598	Inner Full	21.37	19.37	33.00	PASS
N41	40MHz	30KHz	TM8	518598	Inner 1RB Left	21.39	19.39	33.00	PASS
N41	40MHz	30KHz	TM8	518598	Inner 1RB Right	21.53	19.53	33.00	PASS
N41	40MHz	30KHz	TM8	534000	Inner Full	17.61	15.61	33.00	PASS
N41	40MHz	30KHz	TM8	534000	Inner 1RB Left	20.69	18.69	33.00	PASS
N41	40MHz	30KHz	TM8	534000	Inner 1RB Right	19.16	17.16	33.00	PASS
N41	40MHz	30KHz	TM9	503202	Inner Full	18.15	16.15	33.00	PASS
N41	40MHz	30KHz	TM9	503202	Inner 1RB Left	18.83	16.83	33.00	PASS
N41	40MHz	30KHz	TM9	503202	Inner 1RB Right	18.65	16.65	33.00	PASS
N41	40MHz	30KHz	TM9	518598	Inner Full	18.10	16.10	33.00	PASS
N41	40MHz	30KHz	TM9	518598	Inner 1RB Left	18.58	16.58	33.00	PASS
N41	40MHz	30KHz	TM9	518598	Inner 1RB Right	18.51	16.51	33.00	PASS
N41	40MHz	30KHz	TM9	534000	Inner Full	18.99	16.99	33.00	PASS
N41	40MHz	30KHz	TM9	534000	Inner 1RB Left	18.22	16.22	33.00	PASS
N41	40MHz	30KHz	TM9	534000	Inner 1RB Right	18.87	16.87	33.00	PASS
N41	50MHz	30KHz	TM1	504204	Inner Full	25.08	23.08	33.00	PASS
N41	50MHz	30KHz	TM1	504204	Inner 1RB Left	24.51	22.51	33.00	PASS
N41	50MHz	30KHz	TM1	504204	Inner 1RB Right	24.94	22.94	33.00	PASS
N41	50MHz	30KHz	TM1	518598	Inner Full	24.85	22.85	33.00	PASS
N41	50MHz	30KHz	TM1	518598	Inner 1RB Left	24.99	22.99	33.00	PASS
N41	50MHz	30KHz	TM1	518598	Inner 1RB Right	24.67	22.67	33.00	PASS



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

SGS-CSTC Standards Technical Services Co., Ltd.
Shenzhen Branch (Not a Testing Laboratory)

No. 1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgs.com
中国·深圳·科技园中区M-10栋一号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com



N41	50MHz	30KHz	TM1	532998	Inner Full	24.01	22.01	33.00	PASS
N41	50MHz	30KHz	TM1	532998	Inner 1RB Left	23.42	21.42	33.00	PASS
N41	50MHz	30KHz	TM1	532998	Inner 1RB Right	22.94	20.94	33.00	PASS
N41	50MHz	30KHz	TM2	504204	Inner Full	24.97	22.97	33.00	PASS
N41	50MHz	30KHz	TM2	504204	Inner 1RB Left	24.45	22.45	33.00	PASS
N41	50MHz	30KHz	TM2	504204	Inner 1RB Right	24.93	22.93	33.00	PASS
N41	50MHz	30KHz	TM2	518598	Inner Full	24.86	22.86	33.00	PASS
N41	50MHz	30KHz	TM2	518598	Inner 1RB Left	24.95	22.95	33.00	PASS
N41	50MHz	30KHz	TM2	518598	Inner 1RB Right	24.71	22.71	33.00	PASS
N41	50MHz	30KHz	TM2	532998	Inner Full	24.06	22.06	33.00	PASS
N41	50MHz	30KHz	TM2	532998	Inner 1RB Left	23.65	21.65	33.00	PASS
N41	50MHz	30KHz	TM2	532998	Inner 1RB Right	22.96	20.96	33.00	PASS
N41	50MHz	30KHz	TM3	504204	Inner Full	24.04	22.04	33.00	PASS
N41	50MHz	30KHz	TM3	504204	Inner 1RB Left	23.41	21.41	33.00	PASS
N41	50MHz	30KHz	TM3	504204	Inner 1RB Right	23.98	21.98	33.00	PASS
N41	50MHz	30KHz	TM3	518598	Inner Full	23.86	21.86	33.00	PASS
N41	50MHz	30KHz	TM3	518598	Inner 1RB Left	23.87	21.87	33.00	PASS
N41	50MHz	30KHz	TM3	518598	Inner 1RB Right	23.65	21.65	33.00	PASS
N41	50MHz	30KHz	TM3	532998	Inner Full	23.08	21.08	33.00	PASS
N41	50MHz	30KHz	TM3	532998	Inner 1RB Left	22.19	20.19	33.00	PASS
N41	50MHz	30KHz	TM3	532998	Inner 1RB Right	21.73	19.73	33.00	PASS
N41	50MHz	30KHz	TM4	504204	Inner Full	22.72	20.72	33.00	PASS
N41	50MHz	30KHz	TM4	504204	Inner 1RB Left	22.38	20.38	33.00	PASS
N41	50MHz	30KHz	TM4	504204	Inner 1RB Right	22.57	20.57	33.00	PASS
N41	50MHz	30KHz	TM4	518598	Inner Full	22.41	20.41	33.00	PASS
N41	50MHz	30KHz	TM4	518598	Inner 1RB Left	22.52	20.52	33.00	PASS
N41	50MHz	30KHz	TM4	518598	Inner 1RB Right	22.23	20.23	33.00	PASS
N41	50MHz	30KHz	TM4	532998	Inner Full	22.11	20.11	33.00	PASS
N41	50MHz	30KHz	TM4	532998	Inner 1RB Left	20.94	18.94	33.00	PASS
N41	50MHz	30KHz	TM4	532998	Inner 1RB Right	20.78	18.78	33.00	PASS
N41	50MHz	30KHz	TM5	504204	Inner Full	20.83	18.83	33.00	PASS
N41	50MHz	30KHz	TM5	504204	Inner 1RB Left	20.61	18.61	33.00	PASS
N41	50MHz	30KHz	TM5	504204	Inner 1RB Right	20.39	18.39	33.00	PASS
N41	50MHz	30KHz	TM5	518598	Inner Full	20.40	18.40	33.00	PASS
N41	50MHz	30KHz	TM5	518598	Inner 1RB Left	20.44	18.44	33.00	PASS
N41	50MHz	30KHz	TM5	518598	Inner 1RB Right	20.17	18.17	33.00	PASS
N41	50MHz	30KHz	TM5	532998	Inner Full	20.07	18.07	33.00	PASS
N41	50MHz	30KHz	TM5	532998	Inner 1RB Left	20.19	18.19	33.00	PASS
N41	50MHz	30KHz	TM5	532998	Inner 1RB Right	20.02	18.02	33.00	PASS
N41	50MHz	30KHz	TM6	504204	Inner Full	23.23	21.23	33.00	PASS
N41	50MHz	30KHz	TM6	504204	Inner 1RB Left	22.70	20.70	33.00	PASS
N41	50MHz	30KHz	TM6	504204	Inner 1RB Right	23.45	21.45	33.00	PASS
N41	50MHz	30KHz	TM6	518598	Inner Full	23.32	21.32	33.00	PASS
N41	50MHz	30KHz	TM6	518598	Inner 1RB Left	23.31	21.31	33.00	PASS
N41	50MHz	30KHz	TM6	518598	Inner 1RB Right	23.23	21.23	33.00	PASS
N41	50MHz	30KHz	TM6	532998	Inner Full	22.24	20.24	33.00	PASS
N41	50MHz	30KHz	TM6	532998	Inner 1RB Left	21.84	19.84	33.00	PASS
N41	50MHz	30KHz	TM6	532998	Inner 1RB Right	21.26	19.26	33.00	PASS



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

SGS-CSTC Standards Technical Services Co., Ltd.
Shenzhen Branch (SGS-CSTC Laboratory)

No. 1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgs.com
中国·深圳·科技园中区M-10栋一号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com



N41	50MHz	30KHz	TM7	504204	Inner Full	22.90	20.90	33.00	PASS
N41	50MHz	30KHz	TM7	504204	Inner 1RB Left	22.14	20.14	33.00	PASS
N41	50MHz	30KHz	TM7	504204	Inner 1RB Right	23.01	21.01	33.00	PASS
N41	50MHz	30KHz	TM7	518598	Inner Full	22.82	20.82	33.00	PASS
N41	50MHz	30KHz	TM7	518598	Inner 1RB Left	22.87	20.87	33.00	PASS
N41	50MHz	30KHz	TM7	518598	Inner 1RB Right	22.64	20.64	33.00	PASS
N41	50MHz	30KHz	TM7	532998	Inner Full	21.91	19.91	33.00	PASS
N41	50MHz	30KHz	TM7	532998	Inner 1RB Left	21.43	19.43	33.00	PASS
N41	50MHz	30KHz	TM7	532998	Inner 1RB Right	20.90	18.90	33.00	PASS
N41	50MHz	30KHz	TM8	504204	Inner Full	21.61	19.61	33.00	PASS
N41	50MHz	30KHz	TM8	504204	Inner 1RB Left	21.21	19.21	33.00	PASS
N41	50MHz	30KHz	TM8	504204	Inner 1RB Right	21.45	19.45	33.00	PASS
N41	50MHz	30KHz	TM8	518598	Inner Full	21.35	19.35	33.00	PASS
N41	50MHz	30KHz	TM8	518598	Inner 1RB Left	21.51	19.51	33.00	PASS
N41	50MHz	30KHz	TM8	518598	Inner 1RB Right	21.44	19.44	33.00	PASS
N41	50MHz	30KHz	TM8	532998	Inner Full	21.01	19.01	33.00	PASS
N41	50MHz	30KHz	TM8	532998	Inner 1RB Left	20.25	18.25	33.00	PASS
N41	50MHz	30KHz	TM8	532998	Inner 1RB Right	19.95	17.95	33.00	PASS
N41	50MHz	30KHz	TM9	504204	Inner Full	19.06	17.06	33.00	PASS
N41	50MHz	30KHz	TM9	504204	Inner 1RB Left	18.79	16.79	33.00	PASS
N41	50MHz	30KHz	TM9	504204	Inner 1RB Right	18.44	16.44	33.00	PASS
N41	50MHz	30KHz	TM9	518598	Inner Full	12.07	10.07	33.00	PASS
N41	50MHz	30KHz	TM9	518598	Inner 1RB Left	18.53	16.53	33.00	PASS
N41	50MHz	30KHz	TM9	518598	Inner 1RB Right	18.13	16.13	33.00	PASS
N41	50MHz	30KHz	TM9	532998	Inner Full	18.09	16.09	33.00	PASS
N41	50MHz	30KHz	TM9	532998	Inner 1RB Left	18.18	16.18	33.00	PASS
N41	50MHz	30KHz	TM9	532998	Inner 1RB Right	18.08	16.08	33.00	PASS
N41	60MHz	30KHz	TM1	505200	Inner Full	25.07	23.07	33.00	PASS
N41	60MHz	30KHz	TM1	505200	Inner 1RB Left	24.31	22.31	33.00	PASS
N41	60MHz	30KHz	TM1	505200	Inner 1RB Right	25.09	23.09	33.00	PASS
N41	60MHz	30KHz	TM1	518598	Inner Full	24.86	22.86	33.00	PASS
N41	60MHz	30KHz	TM1	518598	Inner 1RB Left	25.01	23.01	33.00	PASS
N41	60MHz	30KHz	TM1	518598	Inner 1RB Right	24.70	22.70	33.00	PASS
N41	60MHz	30KHz	TM1	531996	Inner Full	24.30	22.30	33.00	PASS
N41	60MHz	30KHz	TM1	531996	Inner 1RB Left	23.23	21.23	33.00	PASS
N41	60MHz	30KHz	TM1	531996	Inner 1RB Right	23.05	21.05	33.00	PASS
N41	60MHz	30KHz	TM2	505200	Inner Full	25.00	23.00	33.00	PASS
N41	60MHz	30KHz	TM2	505200	Inner 1RB Left	24.31	22.31	33.00	PASS
N41	60MHz	30KHz	TM2	505200	Inner 1RB Right	24.96	22.96	33.00	PASS
N41	60MHz	30KHz	TM2	518598	Inner Full	24.85	22.85	33.00	PASS
N41	60MHz	30KHz	TM2	518598	Inner 1RB Left	25.02	23.02	33.00	PASS
N41	60MHz	30KHz	TM2	518598	Inner 1RB Right	24.67	22.67	33.00	PASS
N41	60MHz	30KHz	TM2	531996	Inner Full	24.39	22.39	33.00	PASS
N41	60MHz	30KHz	TM2	531996	Inner 1RB Left	24.19	22.19	33.00	PASS
N41	60MHz	30KHz	TM2	531996	Inner 1RB Right	24.41	22.41	33.00	PASS
N41	60MHz	30KHz	TM3	505200	Inner Full	24.02	22.02	33.00	PASS
N41	60MHz	30KHz	TM3	505200	Inner 1RB Left	23.27	21.27	33.00	PASS
N41	60MHz	30KHz	TM3	505200	Inner 1RB Right	23.98	21.98	33.00	PASS



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com



N41	60MHz	30KHz	TM3	518598	Inner Full	23.83	21.83	33.00	PASS
N41	60MHz	30KHz	TM3	518598	Inner 1RB Left	24.05	22.05	33.00	PASS
N41	60MHz	30KHz	TM3	518598	Inner 1RB Right	23.64	21.64	33.00	PASS
N41	60MHz	30KHz	TM3	531996	Inner Full	23.05	21.05	33.00	PASS
N41	60MHz	30KHz	TM3	531996	Inner 1RB Left	21.29	19.29	33.00	PASS
N41	60MHz	30KHz	TM3	531996	Inner 1RB Right	21.99	19.99	33.00	PASS
N41	60MHz	30KHz	TM4	505200	Inner Full	22.54	20.54	33.00	PASS
N41	60MHz	30KHz	TM4	505200	Inner 1RB Left	22.16	20.16	33.00	PASS
N41	60MHz	30KHz	TM4	505200	Inner 1RB Right	22.45	20.45	33.00	PASS
N41	60MHz	30KHz	TM4	518598	Inner Full	22.28	20.28	33.00	PASS
N41	60MHz	30KHz	TM4	518598	Inner 1RB Left	22.54	20.54	33.00	PASS
N41	60MHz	30KHz	TM4	518598	Inner 1RB Right	22.22	20.22	33.00	PASS
N41	60MHz	30KHz	TM4	531996	Inner Full	21.82	19.82	33.00	PASS
N41	60MHz	30KHz	TM4	531996	Inner 1RB Left	20.37	18.37	33.00	PASS
N41	60MHz	30KHz	TM4	531996	Inner 1RB Right	21.20	19.20	33.00	PASS
N41	60MHz	30KHz	TM5	505200	Inner Full	20.87	18.87	33.00	PASS
N41	60MHz	30KHz	TM5	505200	Inner 1RB Left	20.70	18.70	33.00	PASS
N41	60MHz	30KHz	TM5	505200	Inner 1RB Right	20.58	18.58	33.00	PASS
N41	60MHz	30KHz	TM5	518598	Inner Full	20.28	18.28	33.00	PASS
N41	60MHz	30KHz	TM5	518598	Inner 1RB Left	20.60	18.60	33.00	PASS
N41	60MHz	30KHz	TM5	518598	Inner 1RB Right	20.20	18.20	33.00	PASS
N41	60MHz	30KHz	TM5	531996	Inner Full	20.15	18.15	33.00	PASS
N41	60MHz	30KHz	TM5	531996	Inner 1RB Left	18.49	16.49	33.00	PASS
N41	60MHz	30KHz	TM5	531996	Inner 1RB Right	19.28	17.28	33.00	PASS
N41	60MHz	30KHz	TM6	505200	Inner Full	25.03	23.03	33.00	PASS
N41	60MHz	30KHz	TM6	505200	Inner 1RB Left	24.42	22.42	33.00	PASS
N41	60MHz	30KHz	TM6	505200	Inner 1RB Right	24.98	22.98	33.00	PASS
N41	60MHz	30KHz	TM6	518598	Inner Full	24.75	22.75	33.00	PASS
N41	60MHz	30KHz	TM6	518598	Inner 1RB Left	25.07	23.07	33.00	PASS
N41	60MHz	30KHz	TM6	518598	Inner 1RB Right	24.72	22.72	33.00	PASS
N41	60MHz	30KHz	TM6	531996	Inner Full	24.42	22.42	33.00	PASS
N41	60MHz	30KHz	TM6	531996	Inner 1RB Left	22.60	20.60	33.00	PASS
N41	60MHz	30KHz	TM6	531996	Inner 1RB Right	23.15	21.15	33.00	PASS
N41	60MHz	30KHz	TM7	505200	Inner Full	24.02	22.02	33.00	PASS
N41	60MHz	30KHz	TM7	505200	Inner 1RB Left	23.31	21.31	33.00	PASS
N41	60MHz	30KHz	TM7	505200	Inner 1RB Right	24.06	22.06	33.00	PASS
N41	60MHz	30KHz	TM7	518598	Inner Full	23.75	21.75	33.00	PASS
N41	60MHz	30KHz	TM7	518598	Inner 1RB Left	24.08	22.08	33.00	PASS
N41	60MHz	30KHz	TM7	518598	Inner 1RB Right	23.68	21.68	33.00	PASS
N41	60MHz	30KHz	TM7	531996	Inner Full	23.23	21.23	33.00	PASS
N41	60MHz	30KHz	TM7	531996	Inner 1RB Left	21.20	19.20	33.00	PASS
N41	60MHz	30KHz	TM7	531996	Inner 1RB Right	21.93	19.93	33.00	PASS
N41	60MHz	30KHz	TM8	505200	Inner Full	21.92	19.92	33.00	PASS
N41	60MHz	30KHz	TM8	505200	Inner 1RB Left	21.58	19.58	33.00	PASS
N41	60MHz	30KHz	TM8	505200	Inner 1RB Right	21.58	19.58	33.00	PASS
N41	60MHz	30KHz	TM8	518598	Inner Full	22.31	20.31	33.00	PASS
N41	60MHz	30KHz	TM8	518598	Inner 1RB Left	22.56	20.56	33.00	PASS
N41	60MHz	30KHz	TM8	518598	Inner 1RB Right	22.22	20.22	33.00	PASS



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

SGS-CSTC Standards Technical Services Co., Ltd.
Shenzhen Branch (Not a Testing Laboratory)

No. 1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgsgroup.com.cn
中国·深圳·科技园中区M-10栋一号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com



N41	60MHz	30KHz	TM8	531996	Inner Full	21.69	19.69	33.00	PASS
N41	60MHz	30KHz	TM8	531996	Inner 1RB Left	20.20	18.20	33.00	PASS
N41	60MHz	30KHz	TM8	531996	Inner 1RB Right	20.83	18.83	33.00	PASS
N41	60MHz	30KHz	TM9	505200	Inner Full	18.63	16.63	33.00	PASS
N41	60MHz	30KHz	TM9	505200	Inner 1RB Left	18.88	16.88	33.00	PASS
N41	60MHz	30KHz	TM9	505200	Inner 1RB Right	18.56	16.56	33.00	PASS
N41	60MHz	30KHz	TM9	518598	Inner Full	20.31	18.31	33.00	PASS
N41	60MHz	30KHz	TM9	518598	Inner 1RB Left	20.63	18.63	33.00	PASS
N41	60MHz	30KHz	TM9	518598	Inner 1RB Right	20.26	18.26	33.00	PASS
N41	60MHz	30KHz	TM9	531996	Inner Full	20.17	18.17	33.00	PASS
N41	60MHz	30KHz	TM9	531996	Inner 1RB Left	18.69	16.69	33.00	PASS
N41	60MHz	30KHz	TM9	531996	Inner 1RB Right	19.24	17.24	33.00	PASS
N41	80MHz	30KHz	TM1	507204	Inner Full	24.64	22.64	33.00	PASS
N41	80MHz	30KHz	TM1	507204	Inner 1RB Left	24.84	22.84	33.00	PASS
N41	80MHz	30KHz	TM1	507204	Inner 1RB Right	24.51	22.51	33.00	PASS
N41	80MHz	30KHz	TM1	518598	Inner Full	24.51	22.51	33.00	PASS
N41	80MHz	30KHz	TM1	518598	Inner 1RB Left	24.81	22.81	33.00	PASS
N41	80MHz	30KHz	TM1	518598	Inner 1RB Right	24.15	22.15	33.00	PASS
N41	80MHz	30KHz	TM1	529998	Inner Full	24.27	22.27	33.00	PASS
N41	80MHz	30KHz	TM1	529998	Inner 1RB Left	24.51	22.51	33.00	PASS
N41	80MHz	30KHz	TM1	529998	Inner 1RB Right	24.26	22.26	33.00	PASS
N41	80MHz	30KHz	TM2	507204	Inner Full	24.66	22.66	33.00	PASS
N41	80MHz	30KHz	TM2	507204	Inner 1RB Left	24.77	22.77	33.00	PASS
N41	80MHz	30KHz	TM2	507204	Inner 1RB Right	24.41	22.41	33.00	PASS
N41	80MHz	30KHz	TM2	518598	Inner Full	24.54	22.54	33.00	PASS
N41	80MHz	30KHz	TM2	518598	Inner 1RB Left	24.82	22.82	33.00	PASS
N41	80MHz	30KHz	TM2	518598	Inner 1RB Right	24.17	22.17	33.00	PASS
N41	80MHz	30KHz	TM2	529998	Inner Full	24.33	22.33	33.00	PASS
N41	80MHz	30KHz	TM2	529998	Inner 1RB Left	23.84	21.84	33.00	PASS
N41	80MHz	30KHz	TM2	529998	Inner 1RB Right	24.15	22.15	33.00	PASS
N41	80MHz	30KHz	TM3	507204	Inner Full	23.63	21.63	33.00	PASS
N41	80MHz	30KHz	TM3	507204	Inner 1RB Left	23.72	21.72	33.00	PASS
N41	80MHz	30KHz	TM3	507204	Inner 1RB Right	23.38	21.38	33.00	PASS
N41	80MHz	30KHz	TM3	518598	Inner Full	23.41	21.41	33.00	PASS
N41	80MHz	30KHz	TM3	518598	Inner 1RB Left	23.86	21.86	33.00	PASS
N41	80MHz	30KHz	TM3	518598	Inner 1RB Right	23.15	21.15	33.00	PASS
N41	80MHz	30KHz	TM3	529998	Inner Full	23.30	21.30	33.00	PASS
N41	80MHz	30KHz	TM3	529998	Inner 1RB Left	23.44	21.44	33.00	PASS
N41	80MHz	30KHz	TM3	529998	Inner 1RB Right	23.29	21.29	33.00	PASS
N41	80MHz	30KHz	TM4	507204	Inner Full	22.18	20.18	33.00	PASS
N41	80MHz	30KHz	TM4	507204	Inner 1RB Left	22.15	20.15	33.00	PASS
N41	80MHz	30KHz	TM4	507204	Inner 1RB Right	21.95	19.95	33.00	PASS
N41	80MHz	30KHz	TM4	518598	Inner Full	21.94	19.94	33.00	PASS
N41	80MHz	30KHz	TM4	518598	Inner 1RB Left	22.31	20.31	33.00	PASS
N41	80MHz	30KHz	TM4	518598	Inner 1RB Right	21.65	19.65	33.00	PASS
N41	80MHz	30KHz	TM4	529998	Inner Full	21.85	19.85	33.00	PASS
N41	80MHz	30KHz	TM4	529998	Inner 1RB Left	22.00	20.00	33.00	PASS
N41	80MHz	30KHz	TM4	529998	Inner 1RB Right	21.60	19.60	33.00	PASS



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

SGS-CSTC Standards Technical Services Co., Ltd.
Shenzhen Branch (Not a Testing Laboratory)

No. 1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgs.com
中国·深圳·科技园中区M-10栋一号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com



N41	80MHz	30KHz	TM5	507204	Inner Full	20.15	18.15	33.00	PASS
N41	80MHz	30KHz	TM5	507204	Inner 1RB Left	20.27	18.27	33.00	PASS
N41	80MHz	30KHz	TM5	507204	Inner 1RB Right	19.92	17.92	33.00	PASS
N41	80MHz	30KHz	TM5	518598	Inner Full	19.95	17.95	33.00	PASS
N41	80MHz	30KHz	TM5	518598	Inner 1RB Left	19.95	17.95	33.00	PASS
N41	80MHz	30KHz	TM5	518598	Inner 1RB Right	19.64	17.64	33.00	PASS
N41	80MHz	30KHz	TM5	529998	Inner Full	19.80	17.80	33.00	PASS
N41	80MHz	30KHz	TM5	529998	Inner 1RB Left	19.88	17.88	33.00	PASS
N41	80MHz	30KHz	TM5	529998	Inner 1RB Right	19.10	17.10	33.00	PASS
N41	80MHz	30KHz	TM6	507204	Inner Full	23.13	21.13	33.00	PASS
N41	80MHz	30KHz	TM6	507204	Inner 1RB Left	23.16	21.16	33.00	PASS
N41	80MHz	30KHz	TM6	507204	Inner 1RB Right	23.14	21.14	33.00	PASS
N41	80MHz	30KHz	TM6	518598	Inner Full	23.00	21.00	33.00	PASS
N41	80MHz	30KHz	TM6	518598	Inner 1RB Left	23.31	21.31	33.00	PASS
N41	80MHz	30KHz	TM6	518598	Inner 1RB Right	22.86	20.86	33.00	PASS
N41	80MHz	30KHz	TM6	529998	Inner Full	22.78	20.78	33.00	PASS
N41	80MHz	30KHz	TM6	529998	Inner 1RB Left	23.00	21.00	33.00	PASS
N41	80MHz	30KHz	TM6	529998	Inner 1RB Right	22.99	20.99	33.00	PASS
N41	80MHz	30KHz	TM7	507204	Inner Full	22.63	20.63	33.00	PASS
N41	80MHz	30KHz	TM7	507204	Inner 1RB Left	22.95	20.95	33.00	PASS
N41	80MHz	30KHz	TM7	507204	Inner 1RB Right	22.63	20.63	33.00	PASS
N41	80MHz	30KHz	TM7	518598	Inner Full	22.51	20.51	33.00	PASS
N41	80MHz	30KHz	TM7	518598	Inner 1RB Left	22.85	20.85	33.00	PASS
N41	80MHz	30KHz	TM7	518598	Inner 1RB Right	22.26	20.26	33.00	PASS
N41	80MHz	30KHz	TM7	529998	Inner Full	22.30	20.30	33.00	PASS
N41	80MHz	30KHz	TM7	529998	Inner 1RB Left	22.45	20.45	33.00	PASS
N41	80MHz	30KHz	TM7	529998	Inner 1RB Right	22.18	20.18	33.00	PASS
N41	80MHz	30KHz	TM8	507204	Inner Full	21.15	19.15	33.00	PASS
N41	80MHz	30KHz	TM8	507204	Inner 1RB Left	21.14	19.14	33.00	PASS
N41	80MHz	30KHz	TM8	507204	Inner 1RB Right	21.01	19.01	33.00	PASS
N41	80MHz	30KHz	TM8	518598	Inner Full	20.96	18.96	33.00	PASS
N41	80MHz	30KHz	TM8	518598	Inner 1RB Left	20.49	18.49	33.00	PASS
N41	80MHz	30KHz	TM8	518598	Inner 1RB Right	20.64	18.64	33.00	PASS
N41	80MHz	30KHz	TM8	529998	Inner Full	20.82	18.82	33.00	PASS
N41	80MHz	30KHz	TM8	529998	Inner 1RB Left	21.02	19.02	33.00	PASS
N41	80MHz	30KHz	TM8	529998	Inner 1RB Right	20.69	18.69	33.00	PASS
N41	80MHz	30KHz	TM9	507204	Inner Full	18.17	16.17	33.00	PASS
N41	80MHz	30KHz	TM9	507204	Inner 1RB Left	18.02	16.02	33.00	PASS
N41	80MHz	30KHz	TM9	507204	Inner 1RB Right	18.23	16.23	33.00	PASS
N41	80MHz	30KHz	TM9	518598	Inner Full	17.98	15.98	33.00	PASS
N41	80MHz	30KHz	TM9	518598	Inner 1RB Left	18.35	16.35	33.00	PASS
N41	80MHz	30KHz	TM9	518598	Inner 1RB Right	17.81	15.81	33.00	PASS
N41	80MHz	30KHz	TM9	529998	Inner Full	17.82	15.82	33.00	PASS
N41	80MHz	30KHz	TM9	529998	Inner 1RB Left	17.98	15.98	33.00	PASS
N41	80MHz	30KHz	TM9	529998	Inner 1RB Right	17.63	15.63	33.00	PASS
N41	90MHz	30KHz	TM1	508200	Inner Full	24.73	22.73	33.00	PASS
N41	90MHz	30KHz	TM1	508200	Inner 1RB Left	24.94	22.94	33.00	PASS
N41	90MHz	30KHz	TM1	508200	Inner 1RB Right	24.54	22.54	33.00	PASS



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com



N41	90MHz	30KHz	TM1	518598	Inner Full	24.51	22.51	33.00	PASS
N41	90MHz	30KHz	TM1	518598	Inner 1RB Left	24.89	22.89	33.00	PASS
N41	90MHz	30KHz	TM1	518598	Inner 1RB Right	24.13	22.13	33.00	PASS
N41	90MHz	30KHz	TM1	528996	Inner Full	24.26	22.26	33.00	PASS
N41	90MHz	30KHz	TM1	528996	Inner 1RB Left	24.74	22.74	33.00	PASS
N41	90MHz	30KHz	TM1	528996	Inner 1RB Right	24.32	22.32	33.00	PASS
N41	90MHz	30KHz	TM2	508200	Inner Full	24.63	22.63	33.00	PASS
N41	90MHz	30KHz	TM2	508200	Inner 1RB Left	24.85	22.85	33.00	PASS
N41	90MHz	30KHz	TM2	508200	Inner 1RB Right	24.50	22.50	33.00	PASS
N41	90MHz	30KHz	TM2	518598	Inner Full	24.74	22.74	33.00	PASS
N41	90MHz	30KHz	TM2	518598	Inner 1RB Left	24.39	22.39	33.00	PASS
N41	90MHz	30KHz	TM2	518598	Inner 1RB Right	24.13	22.13	33.00	PASS
N41	90MHz	30KHz	TM2	528996	Inner Full	24.56	22.56	33.00	PASS
N41	90MHz	30KHz	TM2	528996	Inner 1RB Left	24.64	22.64	33.00	PASS
N41	90MHz	30KHz	TM2	528996	Inner 1RB Right	24.09	22.09	33.00	PASS
N41	90MHz	30KHz	TM3	508200	Inner Full	23.63	21.63	33.00	PASS
N41	90MHz	30KHz	TM3	508200	Inner 1RB Left	23.49	21.49	33.00	PASS
N41	90MHz	30KHz	TM3	508200	Inner 1RB Right	23.52	21.52	33.00	PASS
N41	90MHz	30KHz	TM3	518598	Inner Full	23.55	21.55	33.00	PASS
N41	90MHz	30KHz	TM3	518598	Inner 1RB Left	23.77	21.77	33.00	PASS
N41	90MHz	30KHz	TM3	518598	Inner 1RB Right	23.09	21.09	33.00	PASS
N41	90MHz	30KHz	TM3	528996	Inner Full	23.20	21.20	33.00	PASS
N41	90MHz	30KHz	TM3	528996	Inner 1RB Left	23.71	21.71	33.00	PASS
N41	90MHz	30KHz	TM3	528996	Inner 1RB Right	20.41	18.41	33.00	PASS
N41	90MHz	30KHz	TM4	508200	Inner Full	21.94	19.94	33.00	PASS
N41	90MHz	30KHz	TM4	508200	Inner 1RB Left	22.38	20.38	33.00	PASS
N41	90MHz	30KHz	TM4	508200	Inner 1RB Right	21.99	19.99	33.00	PASS
N41	90MHz	30KHz	TM4	518598	Inner Full	22.03	20.03	33.00	PASS
N41	90MHz	30KHz	TM4	518598	Inner 1RB Left	22.43	20.43	33.00	PASS
N41	90MHz	30KHz	TM4	518598	Inner 1RB Right	21.67	19.67	33.00	PASS
N41	90MHz	30KHz	TM4	528996	Inner Full	21.78	19.78	33.00	PASS
N41	90MHz	30KHz	TM4	528996	Inner 1RB Left	22.15	20.15	33.00	PASS
N41	90MHz	30KHz	TM4	528996	Inner 1RB Right	21.51	19.51	33.00	PASS
N41	90MHz	30KHz	TM5	508200	Inner Full	20.14	18.14	33.00	PASS
N41	90MHz	30KHz	TM5	508200	Inner 1RB Left	21.04	19.04	33.00	PASS
N41	90MHz	30KHz	TM5	508200	Inner 1RB Right	20.03	18.03	33.00	PASS
N41	90MHz	30KHz	TM5	518598	Inner Full	20.01	18.01	33.00	PASS
N41	90MHz	30KHz	TM5	518598	Inner 1RB Left	20.30	18.30	33.00	PASS
N41	90MHz	30KHz	TM5	518598	Inner 1RB Right	19.68	17.68	33.00	PASS
N41	90MHz	30KHz	TM5	528996	Inner Full	19.72	17.72	33.00	PASS
N41	90MHz	30KHz	TM5	528996	Inner 1RB Left	20.01	18.01	33.00	PASS
N41	90MHz	30KHz	TM5	528996	Inner 1RB Right	19.70	17.70	33.00	PASS
N41	90MHz	30KHz	TM6	508200	Inner Full	23.13	21.13	33.00	PASS
N41	90MHz	30KHz	TM6	508200	Inner 1RB Left	23.31	21.31	33.00	PASS
N41	90MHz	30KHz	TM6	508200	Inner 1RB Right	23.05	21.05	33.00	PASS
N41	90MHz	30KHz	TM6	518598	Inner Full	23.02	21.02	33.00	PASS
N41	90MHz	30KHz	TM6	518598	Inner 1RB Left	23.28	21.28	33.00	PASS
N41	90MHz	30KHz	TM6	518598	Inner 1RB Right	22.64	20.64	33.00	PASS



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com



N41	90MHz	30KHz	TM6	528996	Inner Full	22.85	20.85	33.00	PASS
N41	90MHz	30KHz	TM6	528996	Inner 1RB Left	23.17	21.17	33.00	PASS
N41	90MHz	30KHz	TM6	528996	Inner 1RB Right	22.83	20.83	33.00	PASS
N41	90MHz	30KHz	TM7	508200	Inner Full	22.65	20.65	33.00	PASS
N41	90MHz	30KHz	TM7	508200	Inner 1RB Left	22.74	20.74	33.00	PASS
N41	90MHz	30KHz	TM7	508200	Inner 1RB Right	22.40	20.40	33.00	PASS
N41	90MHz	30KHz	TM7	518598	Inner Full	22.53	20.53	33.00	PASS
N41	90MHz	30KHz	TM7	518598	Inner 1RB Left	22.87	20.87	33.00	PASS
N41	90MHz	30KHz	TM7	518598	Inner 1RB Right	22.13	20.13	33.00	PASS
N41	90MHz	30KHz	TM7	528996	Inner Full	22.24	20.24	33.00	PASS
N41	90MHz	30KHz	TM7	528996	Inner 1RB Left	22.72	20.72	33.00	PASS
N41	90MHz	30KHz	TM7	528996	Inner 1RB Right	22.19	20.19	33.00	PASS
N41	90MHz	30KHz	TM8	508200	Inner Full	21.13	19.13	33.00	PASS
N41	90MHz	30KHz	TM8	508200	Inner 1RB Left	21.24	19.24	33.00	PASS
N41	90MHz	30KHz	TM8	508200	Inner 1RB Right	20.92	18.92	33.00	PASS
N41	90MHz	30KHz	TM8	518598	Inner Full	21.02	19.02	33.00	PASS
N41	90MHz	30KHz	TM8	518598	Inner 1RB Left	21.40	19.40	33.00	PASS
N41	90MHz	30KHz	TM8	518598	Inner 1RB Right	20.76	18.76	33.00	PASS
N41	90MHz	30KHz	TM8	528996	Inner Full	20.76	18.76	33.00	PASS
N41	90MHz	30KHz	TM8	528996	Inner 1RB Left	21.27	19.27	33.00	PASS
N41	90MHz	30KHz	TM8	528996	Inner 1RB Right	20.73	18.73	33.00	PASS
N41	90MHz	30KHz	TM9	508200	Inner Full	18.16	16.16	33.00	PASS
N41	90MHz	30KHz	TM9	508200	Inner 1RB Left	18.40	16.40	33.00	PASS
N41	90MHz	30KHz	TM9	508200	Inner 1RB Right	17.99	15.99	33.00	PASS
N41	90MHz	30KHz	TM9	518598	Inner Full	18.01	16.01	33.00	PASS
N41	90MHz	30KHz	TM9	518598	Inner 1RB Left	18.46	16.46	33.00	PASS
N41	90MHz	30KHz	TM9	518598	Inner 1RB Right	17.80	15.80	33.00	PASS
N41	90MHz	30KHz	TM9	528996	Inner Full	17.77	15.77	33.00	PASS
N41	90MHz	30KHz	TM9	528996	Inner 1RB Left	18.36	16.36	33.00	PASS
N41	90MHz	30KHz	TM9	528996	Inner 1RB Right	17.73	15.73	33.00	PASS
N41	100MHz	30KHz	TM1	509202	Inner Full	24.68	22.68	33.00	PASS
N41	100MHz	30KHz	TM1	509202	Inner 1RB Left	24.76	22.76	33.00	PASS
N41	100MHz	30KHz	TM1	509202	Inner 1RB Right	24.46	22.46	33.00	PASS
N41	100MHz	30KHz	TM1	518598	Inner Full	24.53	22.53	33.00	PASS
N41	100MHz	30KHz	TM1	518598	Inner 1RB Left	24.78	22.78	33.00	PASS
N41	100MHz	30KHz	TM1	518598	Inner 1RB Right	24.00	22.00	33.00	PASS
N41	100MHz	30KHz	TM1	528000	Inner Full	24.29	22.29	33.00	PASS
N41	100MHz	30KHz	TM1	528000	Inner 1RB Left	24.76	22.76	33.00	PASS
N41	100MHz	30KHz	TM1	528000	Inner 1RB Right	24.32	22.32	33.00	PASS
N41	100MHz	30KHz	TM2	509202	Inner Full	24.61	22.61	33.00	PASS
N41	100MHz	30KHz	TM2	509202	Inner 1RB Left	24.74	22.74	33.00	PASS
N41	100MHz	30KHz	TM2	509202	Inner 1RB Right	24.35	22.35	33.00	PASS
N41	100MHz	30KHz	TM2	518598	Inner Full	24.56	22.56	33.00	PASS
N41	100MHz	30KHz	TM2	518598	Inner 1RB Left	24.82	22.82	33.00	PASS
N41	100MHz	30KHz	TM2	518598	Inner 1RB Right	24.06	22.06	33.00	PASS
N41	100MHz	30KHz	TM2	528000	Inner Full	24.33	22.33	33.00	PASS
N41	100MHz	30KHz	TM2	528000	Inner 1RB Left	24.40	22.40	33.00	PASS
N41	100MHz	30KHz	TM2	528000	Inner 1RB Right	24.23	22.23	33.00	PASS



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

SGS-CSTC Standards Technical Services Co., Ltd.
Shenzhen Branch (Not a Testing Laboratory)

No. 1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgsgroup.com.cn
中国·深圳·科技园中区M-10栋一号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com



N41	100MHZ	30KHZ	TM3	509202	Inner Full	23.58	21.58	33.00	PASS
N41	100MHZ	30KHZ	TM3	509202	Inner 1RB Left	23.61	21.61	33.00	PASS
N41	100MHZ	30KHZ	TM3	509202	Inner 1RB Right	23.40	21.40	33.00	PASS
N41	100MHZ	30KHZ	TM3	518598	Inner Full	23.49	21.49	33.00	PASS
N41	100MHZ	30KHZ	TM3	518598	Inner 1RB Left	23.88	21.88	33.00	PASS
N41	100MHZ	30KHZ	TM3	518598	Inner 1RB Right	23.03	21.03	33.00	PASS
N41	100MHZ	30KHZ	TM3	528000	Inner Full	23.29	21.29	33.00	PASS
N41	100MHZ	30KHZ	TM3	528000	Inner 1RB Left	23.76	21.76	33.00	PASS
N41	100MHZ	30KHZ	TM3	528000	Inner 1RB Right	23.13	21.13	33.00	PASS
N41	100MHZ	30KHZ	TM4	509202	Inner Full	22.04	20.04	33.00	PASS
N41	100MHZ	30KHZ	TM4	509202	Inner 1RB Left	21.92	19.92	33.00	PASS
N41	100MHZ	30KHZ	TM4	509202	Inner 1RB Right	21.83	19.83	33.00	PASS
N41	100MHZ	30KHZ	TM4	518598	Inner Full	22.00	20.00	33.00	PASS
N41	100MHZ	30KHZ	TM4	518598	Inner 1RB Left	21.88	19.88	33.00	PASS
N41	100MHZ	30KHZ	TM4	518598	Inner 1RB Right	21.51	19.51	33.00	PASS
N41	100MHZ	30KHZ	TM4	528000	Inner Full	21.78	19.78	33.00	PASS
N41	100MHZ	30KHZ	TM4	528000	Inner 1RB Left	22.21	20.21	33.00	PASS
N41	100MHZ	30KHZ	TM4	528000	Inner 1RB Right	21.82	19.82	33.00	PASS
N41	100MHZ	30KHZ	TM5	509202	Inner Full	20.09	18.09	33.00	PASS
N41	100MHZ	30KHZ	TM5	509202	Inner 1RB Left	20.83	18.83	33.00	PASS
N41	100MHZ	30KHZ	TM5	509202	Inner 1RB Right	19.73	17.73	33.00	PASS
N41	100MHZ	30KHZ	TM5	518598	Inner Full	19.63	17.63	33.00	PASS
N41	100MHZ	30KHZ	TM5	518598	Inner 1RB Left	19.48	17.48	33.00	PASS
N41	100MHZ	30KHZ	TM5	518598	Inner 1RB Right	19.73	17.73	33.00	PASS
N41	100MHZ	30KHZ	TM5	528000	Inner Full	19.83	17.83	33.00	PASS
N41	100MHZ	30KHZ	TM5	528000	Inner 1RB Left	17.36	15.36	33.00	PASS
N41	100MHZ	30KHZ	TM5	528000	Inner 1RB Right	17.59	15.59	33.00	PASS
N41	100MHZ	30KHZ	TM6	509202	Inner Full	23.16	21.16	33.00	PASS
N41	100MHZ	30KHZ	TM6	509202	Inner 1RB Left	23.13	21.13	33.00	PASS
N41	100MHZ	30KHZ	TM6	509202	Inner 1RB Right	22.89	20.89	33.00	PASS
N41	100MHZ	30KHZ	TM6	518598	Inner Full	23.04	21.04	33.00	PASS
N41	100MHZ	30KHZ	TM6	518598	Inner 1RB Left	23.29	21.29	33.00	PASS
N41	100MHZ	30KHZ	TM6	518598	Inner 1RB Right	22.66	20.66	33.00	PASS
N41	100MHZ	30KHZ	TM6	528000	Inner Full	22.79	20.79	33.00	PASS
N41	100MHZ	30KHZ	TM6	528000	Inner 1RB Left	23.11	21.11	33.00	PASS
N41	100MHZ	30KHZ	TM6	528000	Inner 1RB Right	22.83	20.83	33.00	PASS
N41	100MHZ	30KHZ	TM7	509202	Inner Full	22.62	20.62	33.00	PASS
N41	100MHZ	30KHZ	TM7	509202	Inner 1RB Left	22.69	20.69	33.00	PASS
N41	100MHZ	30KHZ	TM7	509202	Inner 1RB Right	22.45	20.45	33.00	PASS
N41	100MHZ	30KHZ	TM7	518598	Inner Full	22.55	20.55	33.00	PASS
N41	100MHZ	30KHZ	TM7	518598	Inner 1RB Left	22.64	20.64	33.00	PASS
N41	100MHZ	30KHZ	TM7	518598	Inner 1RB Right	22.08	20.08	33.00	PASS
N41	100MHZ	30KHZ	TM7	528000	Inner Full	22.31	20.31	33.00	PASS
N41	100MHZ	30KHZ	TM7	528000	Inner 1RB Left	22.68	20.68	33.00	PASS
N41	100MHZ	30KHZ	TM7	528000	Inner 1RB Right	22.34	20.34	33.00	PASS
N41	100MHZ	30KHZ	TM8	509202	Inner Full	21.11	19.11	33.00	PASS
N41	100MHZ	30KHZ	TM8	509202	Inner 1RB Left	21.28	19.28	33.00	PASS
N41	100MHZ	30KHZ	TM8	509202	Inner 1RB Right	20.93	18.93	33.00	PASS



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

SGS-CSTC Standards Technical Services Co., Ltd.
Shenzhen Branch (SGS-CSTC Laboratory)

No. 1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgsgroup.com.cn
中国·深圳·科技园中区M-10栋一号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com



N41	100MHz	30KHz	TM8	518598	Inner Full	21.08	19.08	33.00	PASS
N41	100MHz	30KHz	TM8	518598	Inner 1RB Left	20.13	18.13	33.00	PASS
N41	100MHz	30KHz	TM8	518598	Inner 1RB Right	20.43	18.43	33.00	PASS
N41	100MHz	30KHz	TM8	528000	Inner Full	20.80	18.80	33.00	PASS
N41	100MHz	30KHz	TM8	528000	Inner 1RB Left	21.20	19.20	33.00	PASS
N41	100MHz	30KHz	TM8	528000	Inner 1RB Right	20.76	18.76	33.00	PASS
N41	100MHz	30KHz	TM9	509202	Inner Full	18.14	16.14	33.00	PASS
N41	100MHz	30KHz	TM9	509202	Inner 1RB Left	18.34	16.34	33.00	PASS
N41	100MHz	30KHz	TM9	509202	Inner 1RB Right	17.91	15.91	33.00	PASS
N41	100MHz	30KHz	TM9	518598	Inner Full	17.98	15.98	33.00	PASS
N41	100MHz	30KHz	TM9	518598	Inner 1RB Left	18.27	16.27	33.00	PASS
N41	100MHz	30KHz	TM9	518598	Inner 1RB Right	17.44	15.44	33.00	PASS
N41	100MHz	30KHz	TM9	528000	Inner Full	17.81	15.81	33.00	PASS
N41	100MHz	30KHz	TM9	528000	Inner 1RB Left	18.06	16.06	33.00	PASS
N41	100MHz	30KHz	TM9	528000	Inner 1RB Right	17.75	15.75	33.00	PASS

Note:

a: For getting the EIRP (Efficient Isotropic Radiated Power) in substitution method, the following formula should be taken to calculate it,

$EIRP [dBm] = \text{Conducted Power [dBm]} + \text{Gain [dBi]}$

$ERP [dBm] = \text{Conducted Power [dBm]} + \text{Gain [dBi]} - 2.15$



SGS-CSTC Standards Technical Services Co., Ltd.
Shenzhen Branch (Internal Use Only) Laboratory

Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.
Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

No.1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgsgroup.com.cn
中国·深圳·科技园中区M-10栋一号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com


2 Peak-to-Average Ratio

2.1 Test Results

NR Band	Bandwidth	SCS	Modulation	Channel	RB Config	Result (dB)	Limit (dBm)	Verdict
N41	100MHz	30KHz	TM1	518598	Outer Full	4.12	13	PASS
N41	100MHz	30KHz	TM6	518598	Outer Full	6.76	13	PASS

2.2 Test Plots



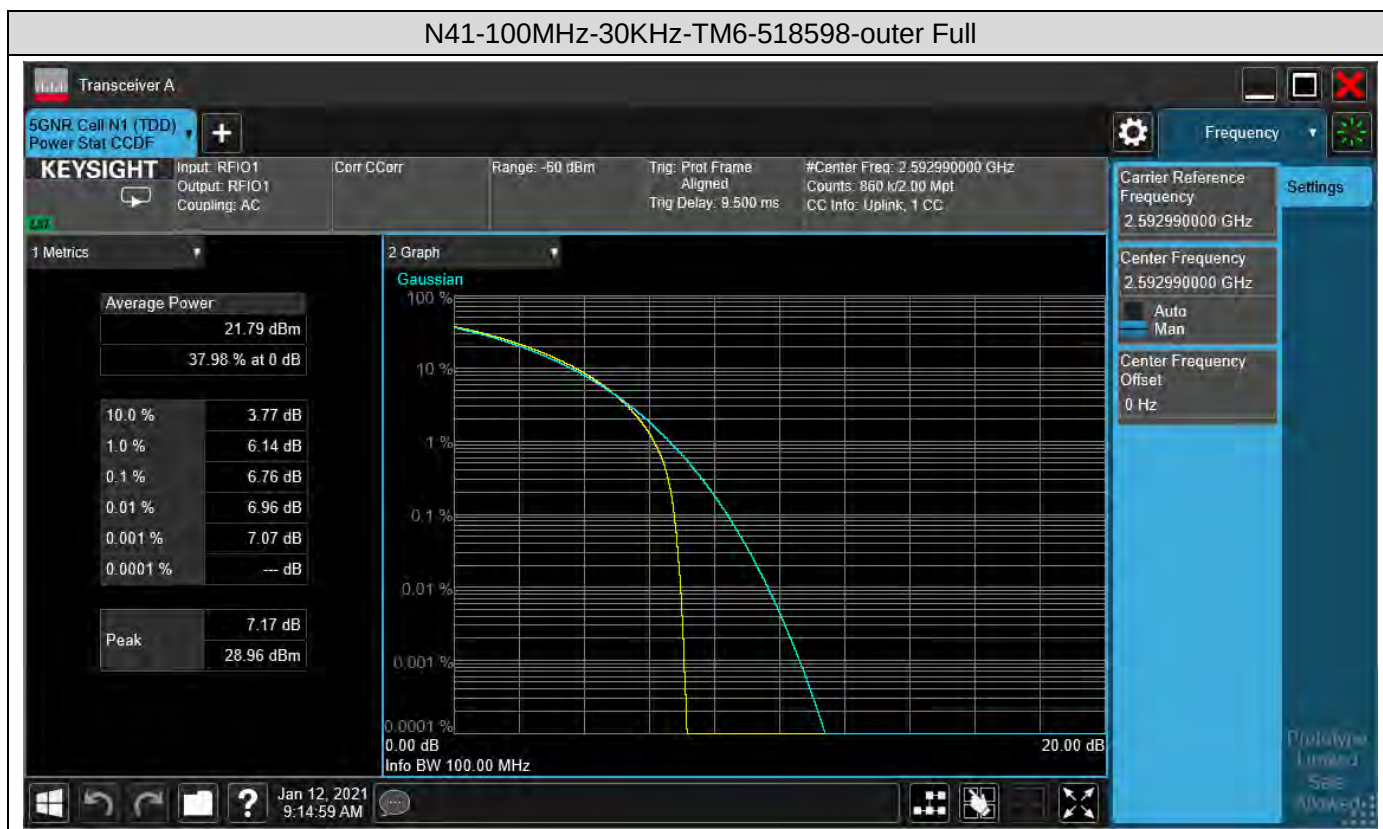

REMARK:

All antenna and all modulation had been tested, but only the worst case data displayed in this report


3 Modulation Characteristics

3.1 Test Plots

3.1.1 Test Band = N41


3.1.1.1 Test Mode = TM1 100MHz

3.1.1.1.1 Test Channel = MCH

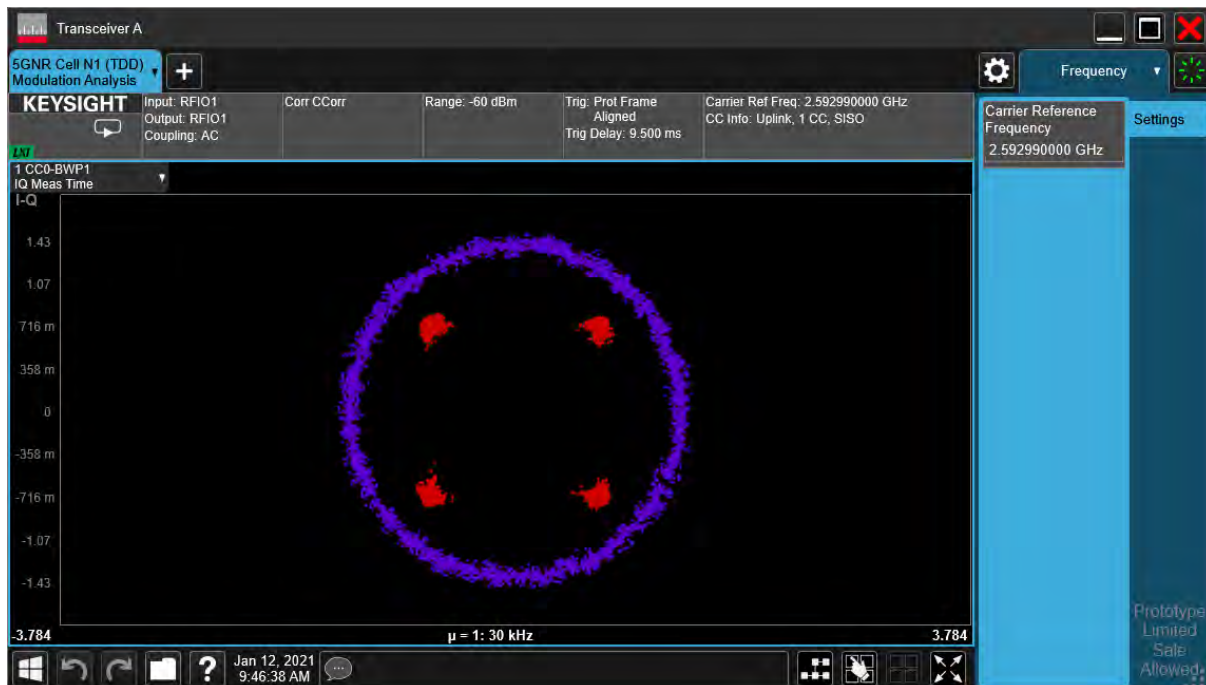


3.1.1.2 Test Mode = TM2 100MHz

3.1.1.2.1 Test Channel = MCH

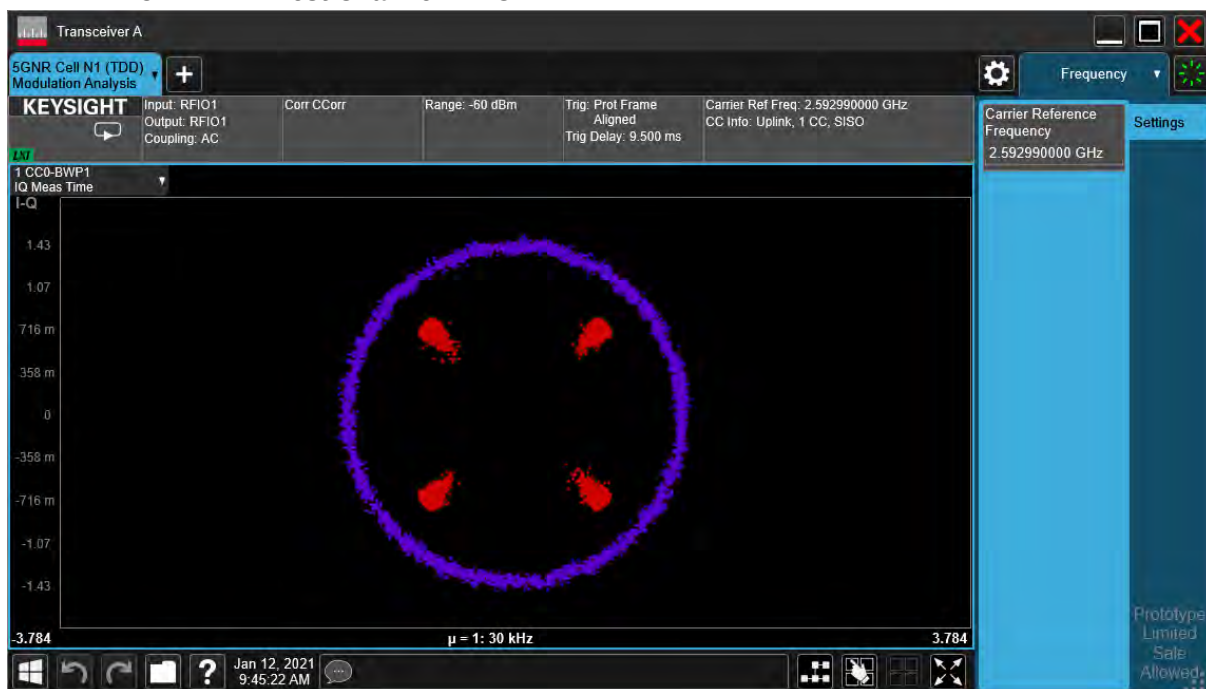


3.1.1.3 Test Mode = TM3 100MHz

3.1.1.3.1 Test Channel = MCH

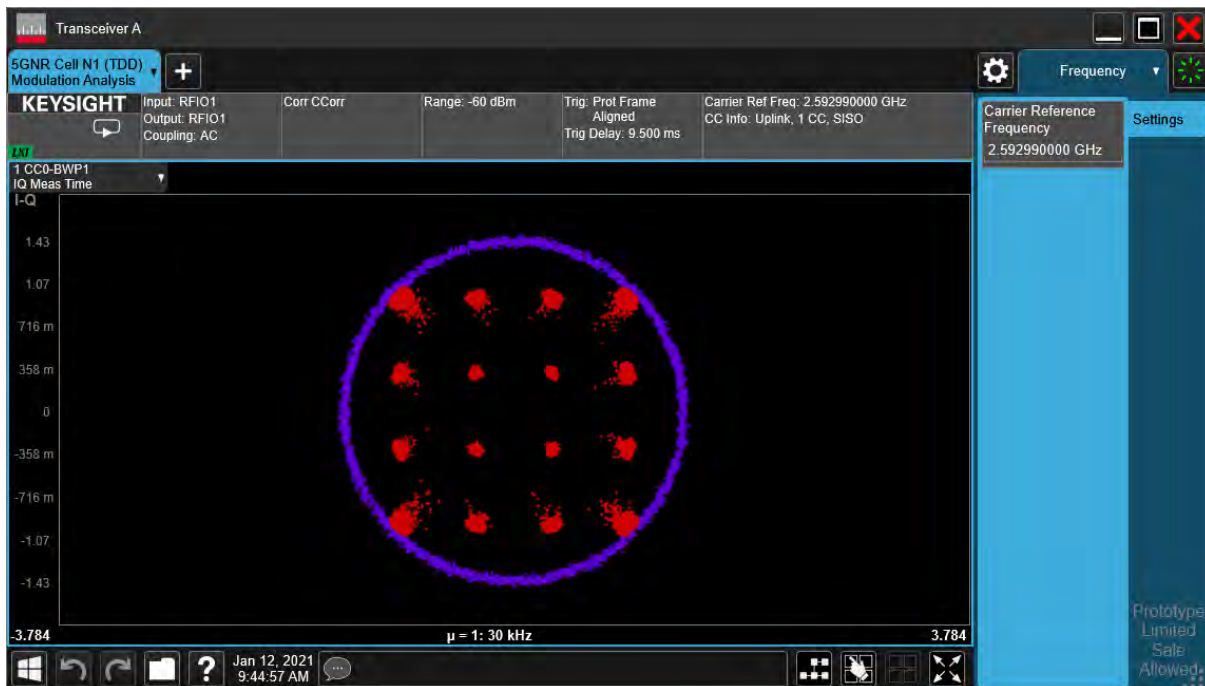

3.1.1.4 Test Mode = TM4 100MHz

3.1.1.4.1 Test Channel = MCH

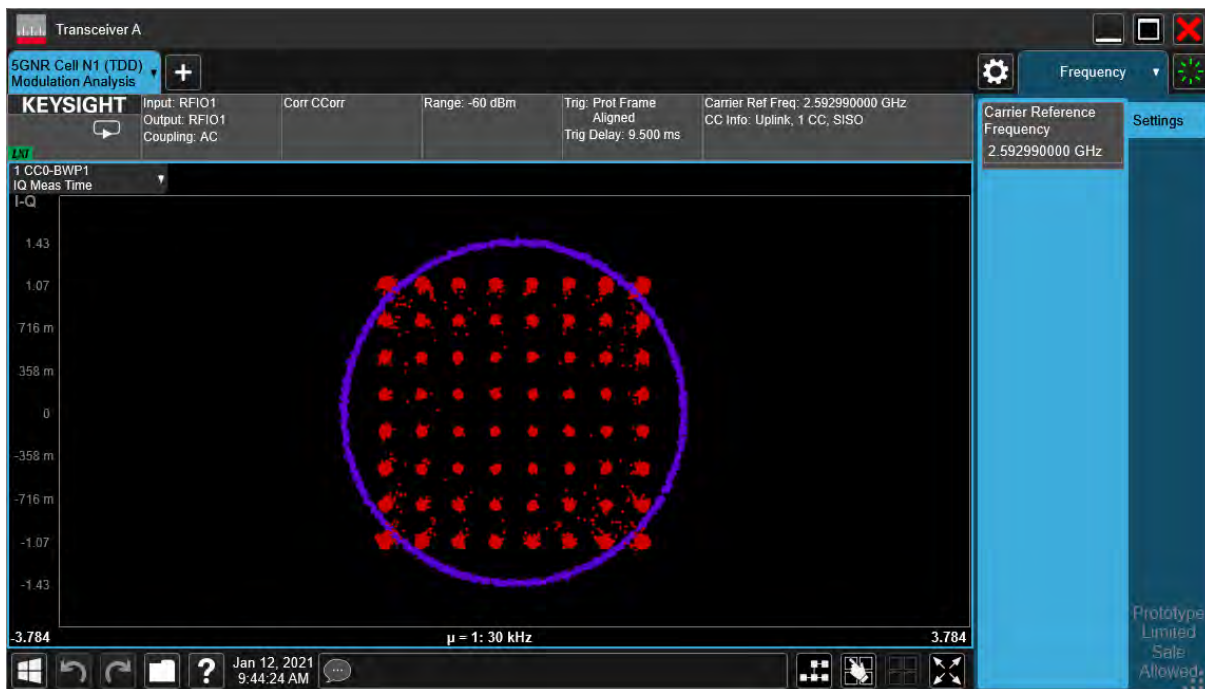

SGS-CSTC Standards Technical Services Co., Ltd.
Shenzhen Branch (South China) EEC Laboratory.


Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of its mandate. It is not intended to constitute an offer of insurance or any other financial product. The Company does not accept any transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

For sample(s) of testing/inspection report and certificate, please contact us at telephone: (86-755) 8307 1443,
or email: CN.Doccheck@sgs.com

No. 1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgs.com.cn
中国·深圳·科技园中区M-10栋一号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com


3.1.1.5 Test Mode = TM5 100MHz

3.1.1.5.1 Test Channel = MCH

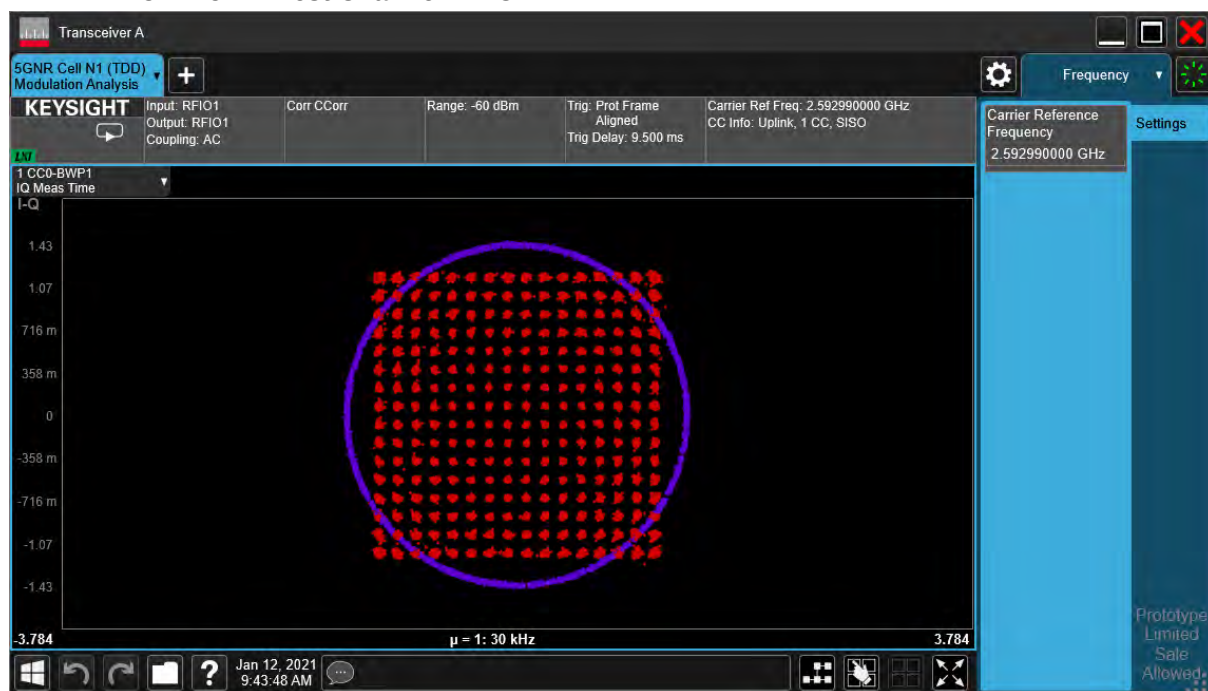

3.1.1.6 Test Mode = TM6 100MHz

3.1.1.6.1 Test Channel = MCH

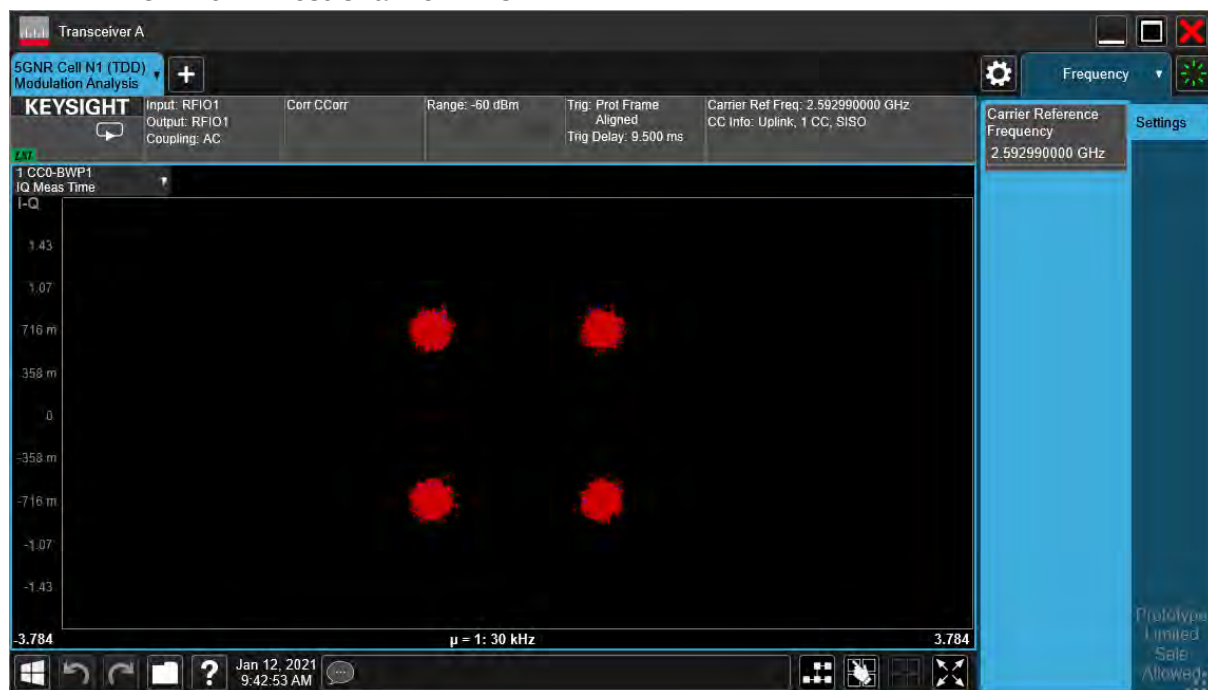

REMARK:

All antenna and all modulation had been tested, but only the worst case data displayed in this report



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.
Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

SGS-CSTC Standards Technical Services Co., Ltd.
 Shenzhen Branch (SGS-CSTC) Laboratory

No.1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgsgroup.com.cn
 中国·深圳·科技园中区M-10栋一号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com

4 Occupied Bandwidth & 26dB Emission Bandwidth

4.1 Test Results

NR Band	Bandwidth	SCS	Modulation	Channel	RB Config	OBW (MHz)	EBW (MHz)	Verdict
N41	20MHz	30KHz	TM1	518598	Outer Full	17.78	18.93	PASS
N41	20MHz	30KHz	TM2	518598	Outer Full	17.77	18.93	PASS
N41	20MHz	30KHz	TM3	518598	Outer Full	17.84	19.07	PASS
N41	20MHz	30KHz	TM4	518598	Outer Full	17.78	19.16	PASS
N41	20MHz	30KHz	TM5	518598	Outer Full	17.80	18.97	PASS
N41	20MHz	30KHz	TM6	518598	Outer Full	18.18	19.54	PASS
N41	20MHz	30KHz	TM7	518598	Outer Full	18.25	19.46	PASS
N41	20MHz	30KHz	TM8	518598	Outer Full	18.20	19.50	PASS
N41	20MHz	30KHz	TM9	518598	Outer Full	18.20	19.54	PASS
N41	30MHz	30KHz	TM1	518598	Outer Full	26.72	28.11	PASS
N41	30MHz	30KHz	TM2	518598	Outer Full	26.77	28.08	PASS
N41	30MHz	30KHz	TM3	518598	Outer Full	26.73	28.15	PASS
N41	30MHz	30KHz	TM4	518598	Outer Full	26.73	27.99	PASS
N41	30MHz	30KHz	TM5	518598	Outer Full	26.74	28.05	PASS
N41	30MHz	30KHz	TM6	518598	Outer Full	27.78	29.15	PASS
N41	30MHz	30KHz	TM7	518598	Outer Full	27.80	29.41	PASS
N41	30MHz	30KHz	TM8	518598	Outer Full	27.79	29.20	PASS
N41	30MHz	30KHz	TM9	518598	Outer Full	27.78	29.04	PASS
N41	40MHz	30KHz	TM1	518598	Outer Full	35.66	37.08	PASS
N41	40MHz	30KHz	TM2	518598	Outer Full	35.77	37.19	PASS
N41	40MHz	30KHz	TM3	518598	Outer Full	35.73	37.16	PASS
N41	40MHz	30KHz	TM4	518598	Outer Full	35.75	37.31	PASS
N41	40MHz	30KHz	TM5	518598	Outer Full	35.64	37.25	PASS
N41	40MHz	30KHz	TM6	518598	Outer Full	37.75	39.44	PASS
N41	40MHz	30KHz	TM7	518598	Outer Full	37.76	39.37	PASS
N41	40MHz	30KHz	TM8	518598	Outer Full	37.77	39.53	PASS
N41	40MHz	30KHz	TM9	518598	Outer Full	37.77	39.23	PASS
N41	50MHz	30KHz	TM1	518598	Outer Full	45.66	47.26	PASS
N41	50MHz	30KHz	TM2	518598	Outer Full	45.64	47.42	PASS
N41	50MHz	30KHz	TM3	518598	Outer Full	45.80	47.52	PASS
N41	50MHz	30KHz	TM4	518598	Outer Full	45.78	47.40	PASS
N41	50MHz	30KHz	TM5	518598	Outer Full	45.69	47.51	PASS
N41	50MHz	30KHz	TM6	518598	Outer Full	47.41	49.16	PASS
N41	50MHz	30KHz	TM7	518598	Outer Full	47.40	49.33	PASS
N41	50MHz	30KHz	TM8	518598	Outer Full	47.47	49.32	PASS
N41	50MHz	30KHz	TM9	518598	Outer Full	47.48	49.29	PASS
N41	60MHz	30KHz	TM1	518598	Outer Full	57.74	59.72	PASS
N41	60MHz	30KHz	TM2	518598	Outer Full	57.81	59.93	PASS
N41	60MHz	30KHz	TM3	518598	Outer Full	57.75	60.03	PASS



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

SGS-CSTC Standards Technical Services Co., Ltd.
Shenzhen Branch (Technical Services Laboratory)

No. 1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgsgroup.com.cn
中国·深圳·科技园中区M-10栋一号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com

N41	60MHz	30KHz	TM4	518598	Outer Full	57.74	59.87	PASS
N41	60MHz	30KHz	TM5	518598	Outer Full	57.72	59.86	PASS
N41	60MHz	30KHz	TM6	518598	Outer Full	57.71	60.04	PASS
N41	60MHz	30KHz	TM7	518598	Outer Full	57.75	59.96	PASS
N41	60MHz	30KHz	TM8	518598	Outer Full	57.78	59.94	PASS
N41	60MHz	30KHz	TM9	518598	Outer Full	57.73	59.96	PASS
N41	80MHz	30KHz	TM1	518598	Outer Full	76.99	79.65	PASS
N41	80MHz	30KHz	TM2	518598	Outer Full	77.01	79.61	PASS
N41	80MHz	30KHz	TM3	518598	Outer Full	77.04	79.73	PASS
N41	80MHz	30KHz	TM4	518598	Outer Full	77.01	79.58	PASS
N41	80MHz	30KHz	TM5	518598	Outer Full	77.13	79.74	PASS
N41	80MHz	30KHz	TM6	518598	Outer Full	77.46	80.05	PASS
N41	80MHz	30KHz	TM7	518598	Outer Full	77.36	80.07	PASS
N41	80MHz	30KHz	TM8	518598	Outer Full	77.31	80.03	PASS
N41	80MHz	30KHz	TM9	518598	Outer Full	77.26	79.99	PASS
N41	90MHz	30KHz	TM1	518598	Outer Full	86.65	89.45	PASS
N41	90MHz	30KHz	TM2	518598	Outer Full	86.59	89.45	PASS
N41	90MHz	30KHz	TM3	518598	Outer Full	86.48	89.53	PASS
N41	90MHz	30KHz	TM4	518598	Outer Full	86.59	89.56	PASS
N41	90MHz	30KHz	TM5	518598	Outer Full	86.72	89.61	PASS
N41	90MHz	30KHz	TM6	518598	Outer Full	87.32	90.23	PASS
N41	90MHz	30KHz	TM7	518598	Outer Full	87.11	90.24	PASS
N41	90MHz	30KHz	TM8	518598	Outer Full	87.34	90.24	PASS
N41	90MHz	30KHz	TM9	518598	Outer Full	87.24	90.18	PASS
N41	100MHz	30KHz	TM1	518598	Outer Full	96.11	99.41	PASS
N41	100MHz	30KHz	TM2	518598	Outer Full	96.32	99.41	PASS
N41	100MHz	30KHz	TM3	518598	Outer Full	96.13	99.46	PASS
N41	100MHz	30KHz	TM4	518598	Outer Full	96.09	99.37	PASS
N41	100MHz	30KHz	TM5	518598	Outer Full	96.22	99.43	PASS
N41	100MHz	30KHz	TM6	518598	Outer Full	97.10	100.40	PASS
N41	100MHz	30KHz	TM7	518598	Outer Full	97.27	100.40	PASS
N41	100MHz	30KHz	TM8	518598	Outer Full	97.11	100.50	PASS
N41	100MHz	30KHz	TM9	518598	Outer Full	97.26	100.60	PASS

4.2 Test Plots




SGS-CSTC Standards Technical Services Co., Ltd.
Shenzhen Branch (SGS-CSTC Laboratory)


Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.
Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

No. 1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgsgroup.com.cn
中国·深圳·科技园中区M-10栋一号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com

OBW&EBW N41 30KHz TM1 20MHz 518598 Outer Full

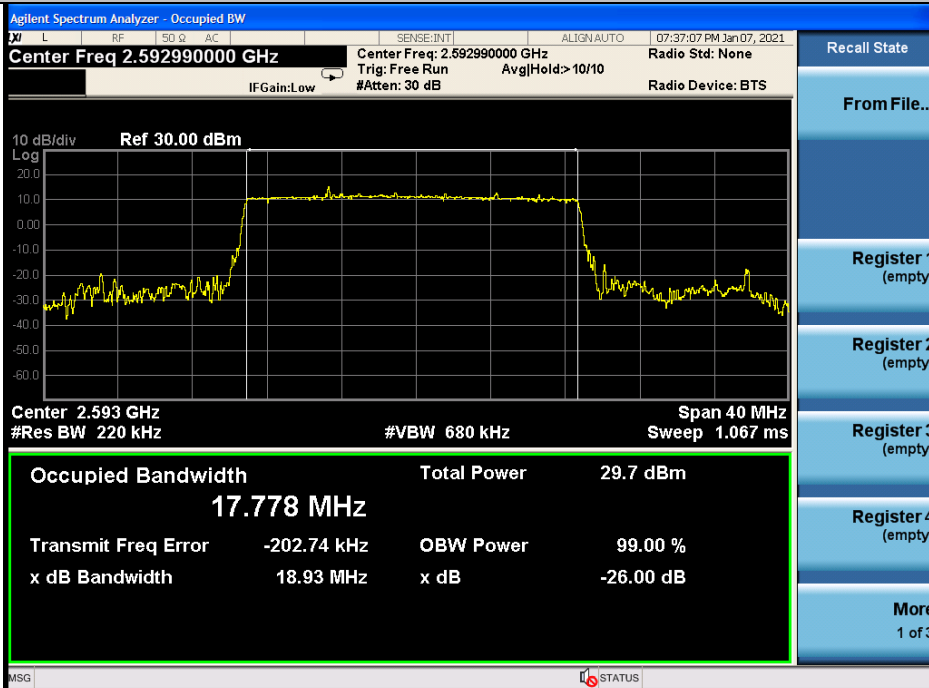

OBW&EBW N41 30KHz TM2 20MHz 518598 Outer Full

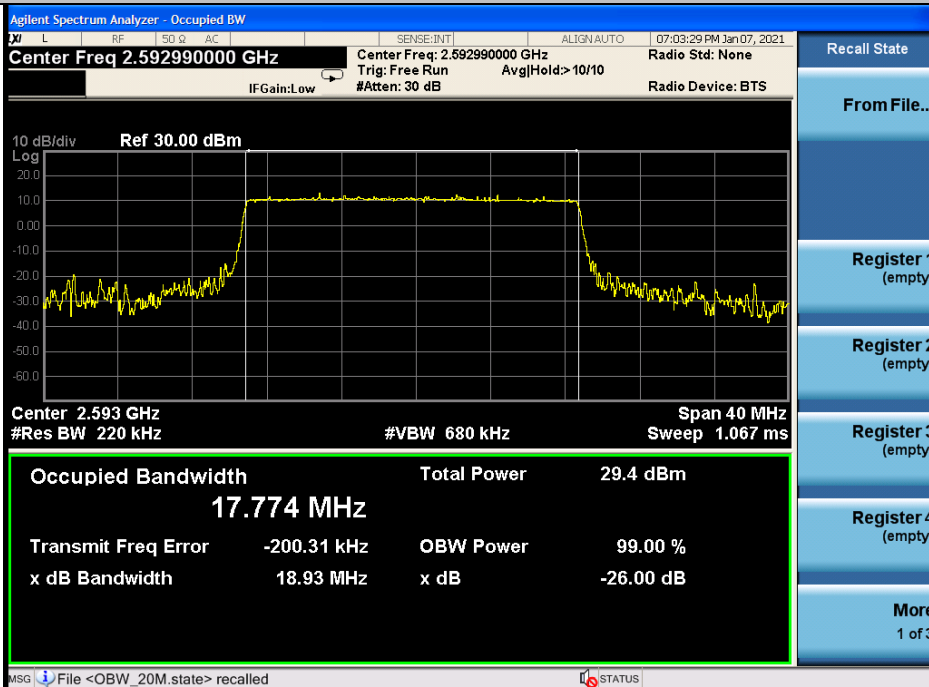


Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com


SGS-CSTC Standards Technical Services Co., Ltd.
Shenzhen Branch (Inspection & Testing Laboratory)

No. 1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgs.com
中国·深圳·科技园中区M-10栋一号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com


OBW&EBW N41 30KHz TM3 20MHz 518598 Outer Full

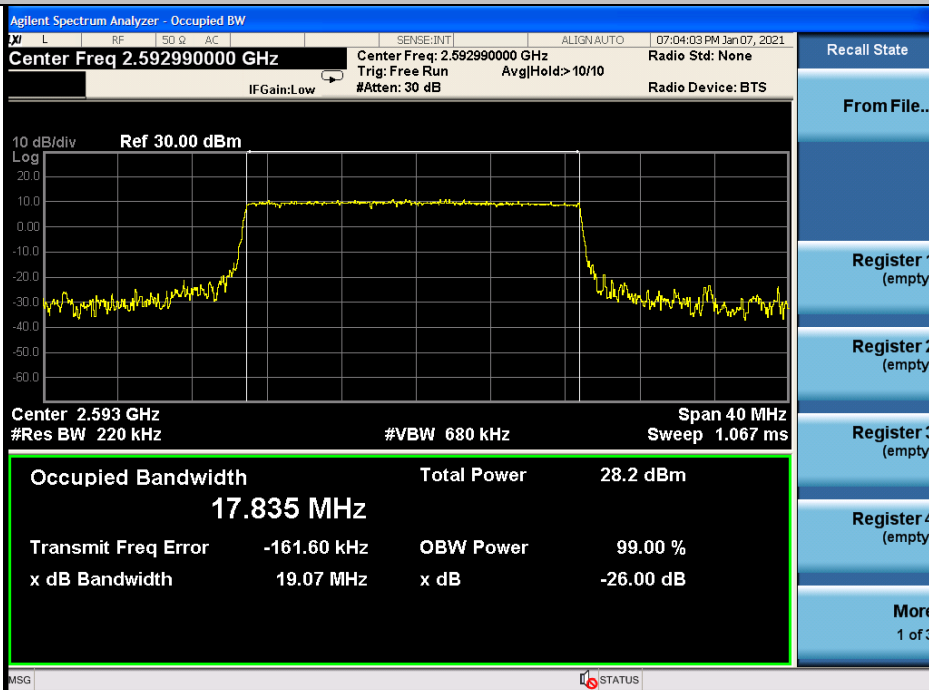


OBW&EBW N41 30KHz TM4 20MHz 518598 Outer Full

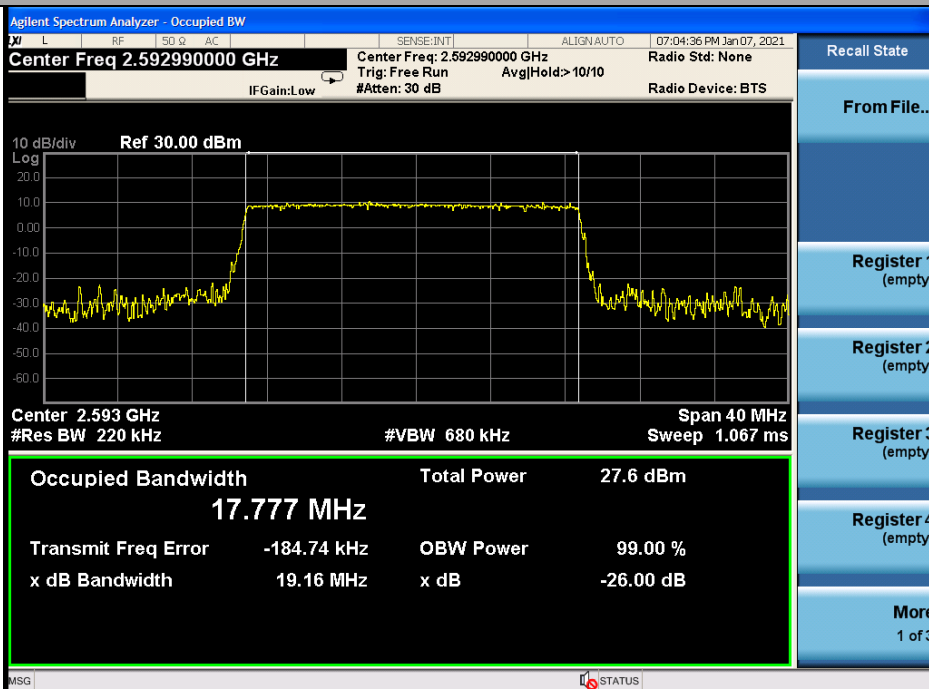

OBW&EBW N41 30KHz TM5 20MHz 518598 Outer Full

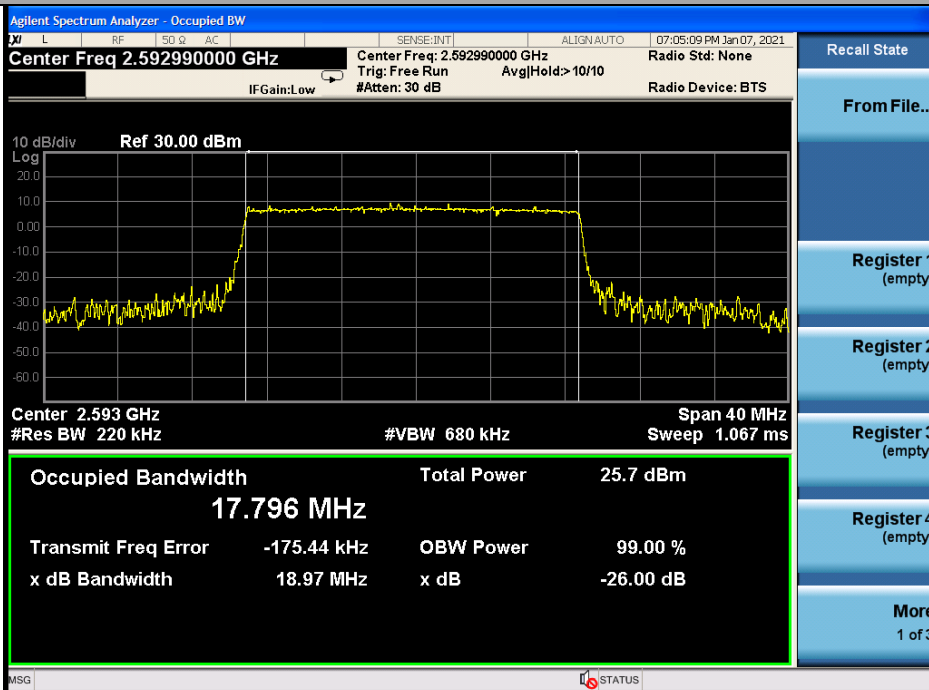

OBW&EBW N41 30KHz TM6 20MHz 518598 Outer Full

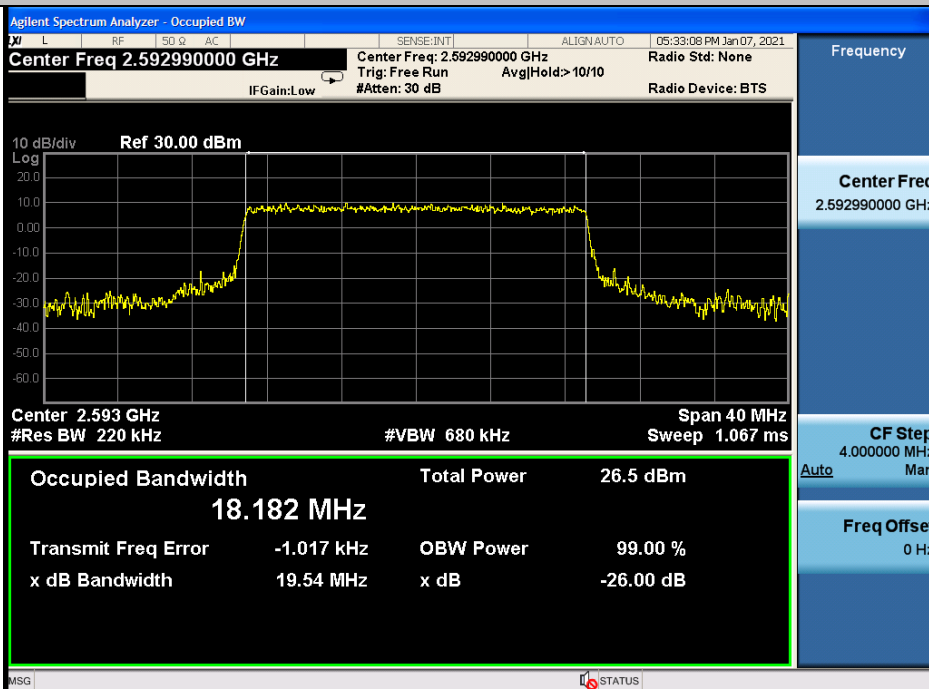


Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com


SGS-CSTC Standards Technical Services Co., Ltd.
Shenzhen Branch (Internal Use Only) Laboratory

No. 1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgs.com
中国·深圳·科技园中区M-10栋一号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com


OBW&EBW N41 30KHz TM7 20MHz 518598 Outer Full

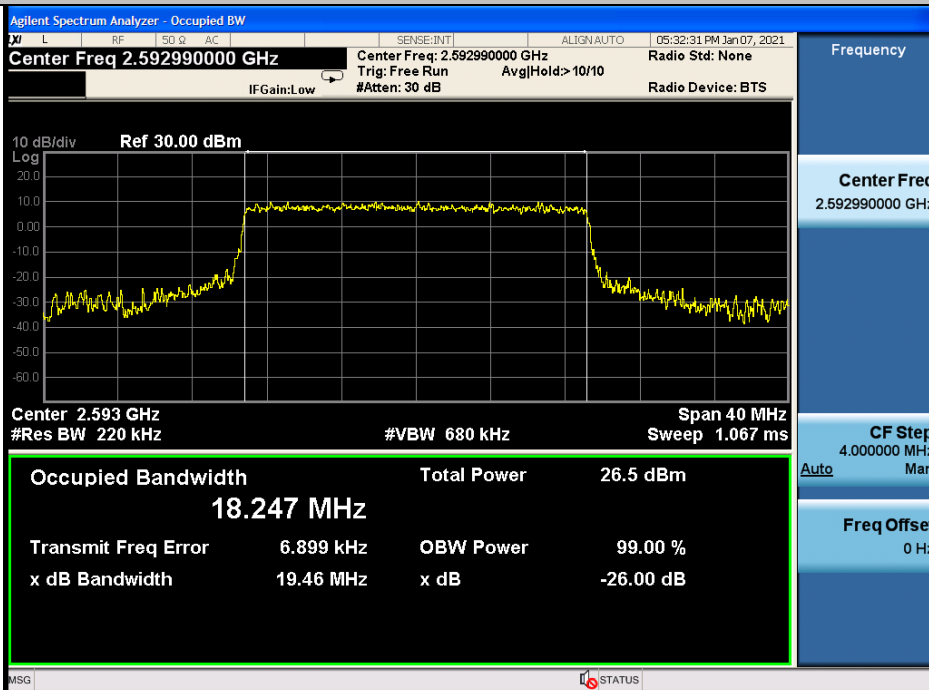


OBW&EBW N41 30KHz TM8 20MHz 518598 Outer Full

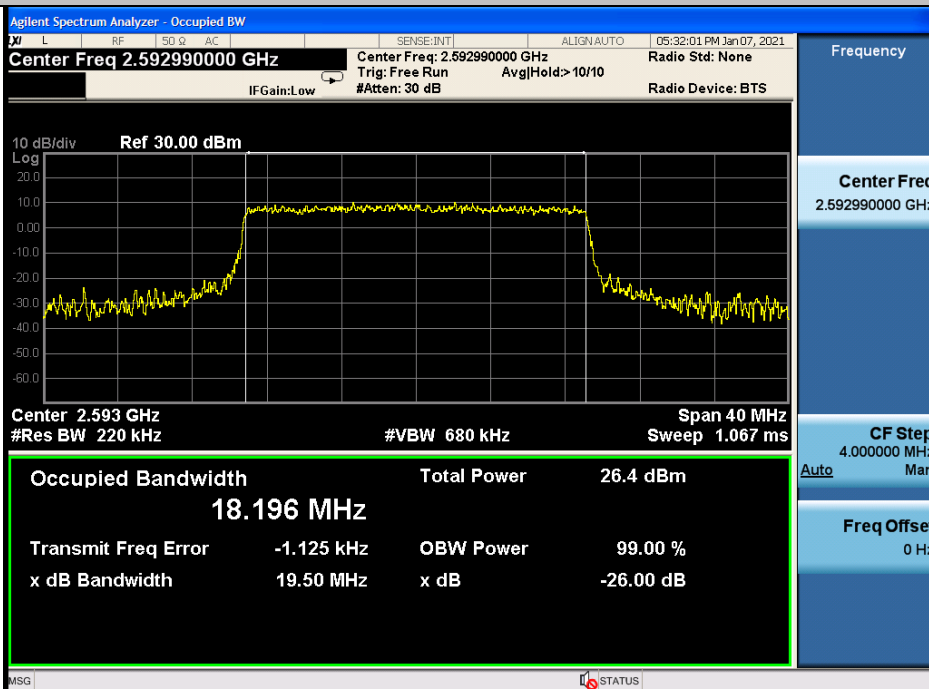


OBW&EBW N41 30KHz TM9 20MHz 518598 Outer Full

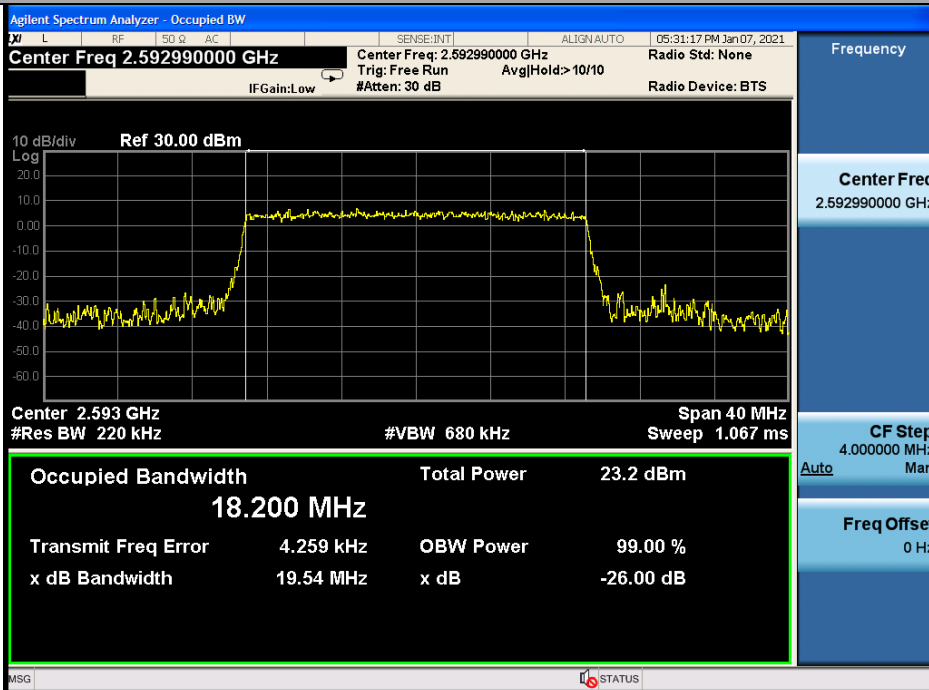


OBW&EBW N41 30KHz TM1 30MHz 518598 Outer Full

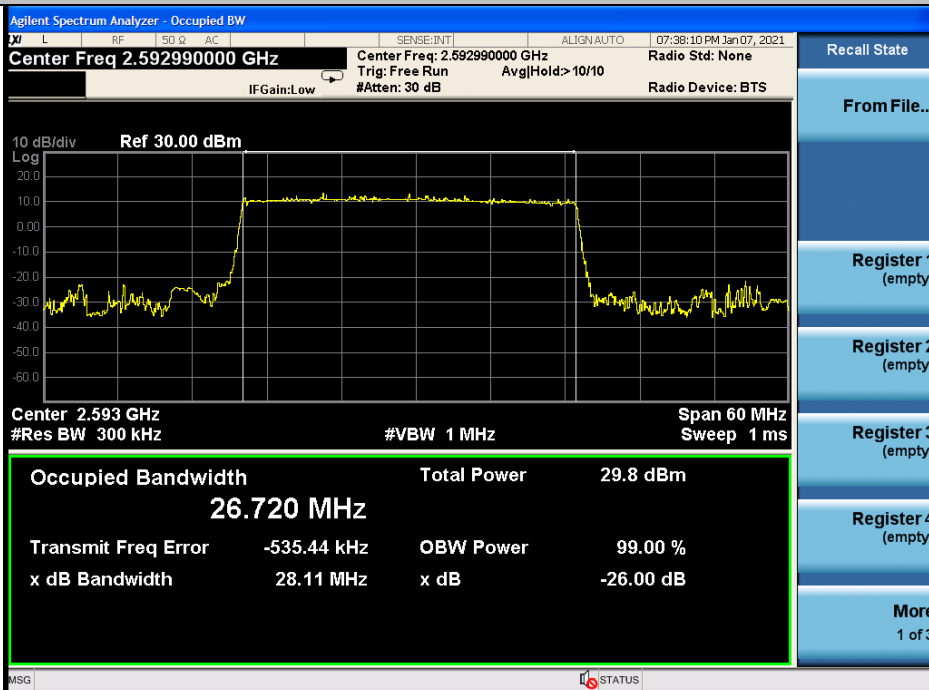


OBW&EBW N41 30KHz TM2 30MHz 518598 Outer Full

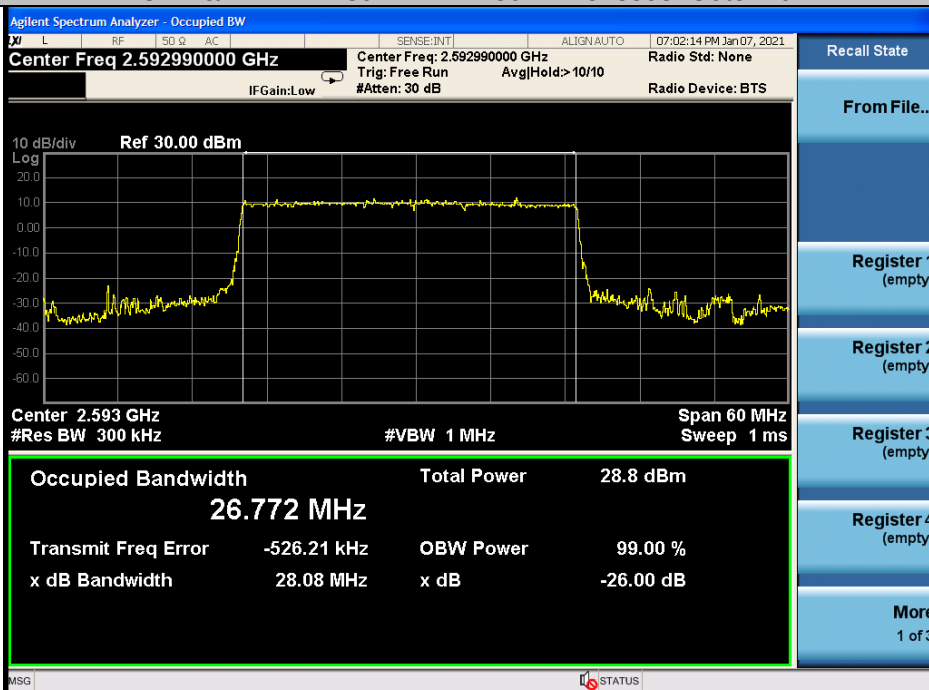


OBW&EBW N41 30KHz TM3 30MHz 518598 Outer Full

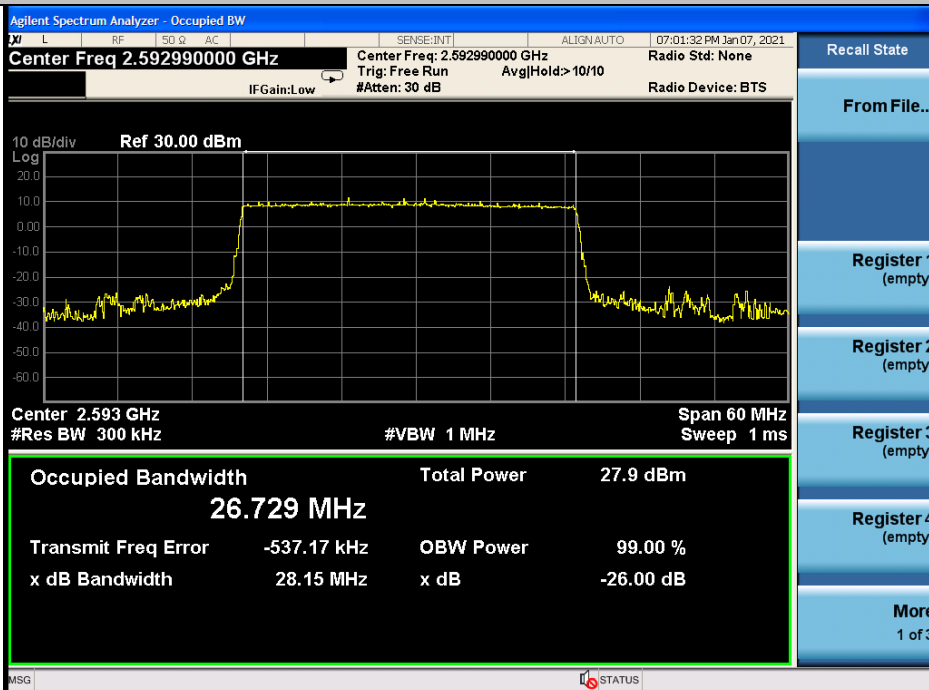


OBW&EBW N41 30KHz TM4 30MHz 518598 Outer Full

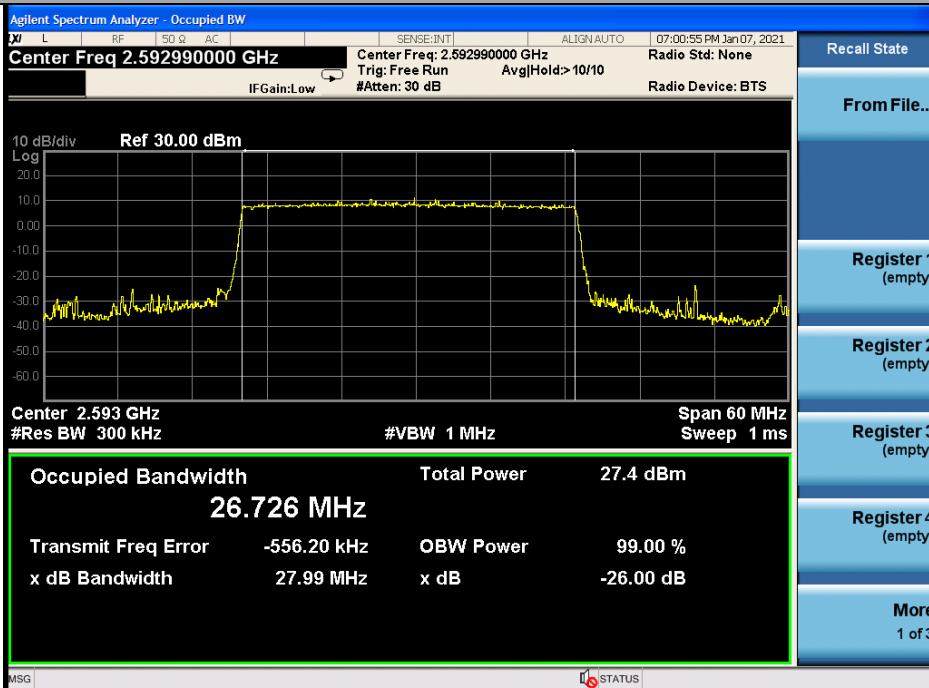


OBW&EBW N41 30KHz TM5 30MHz 518598 Outer Full

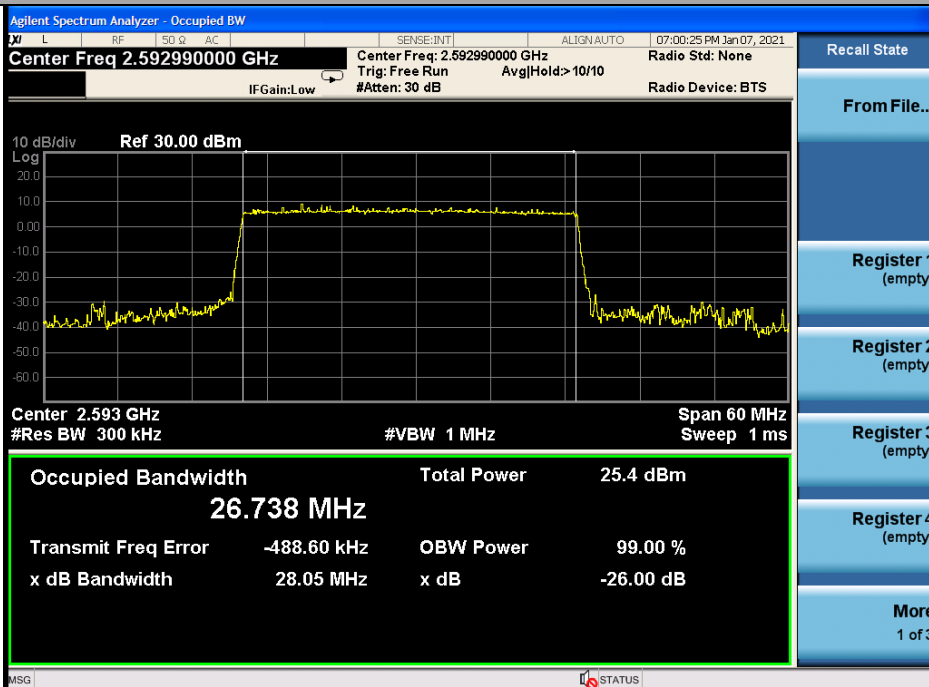

OBW&EBW N41 30KHz TM6 30MHz 518598 Outer Full

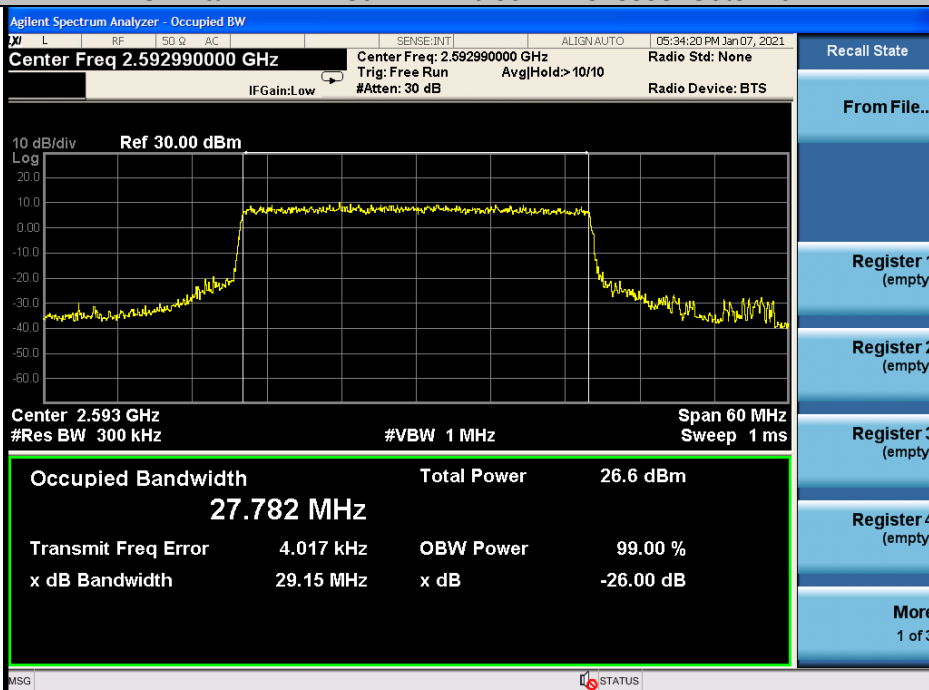

OBW&EBW N41 30KHz TM7 30MHz 518598 Outer Full

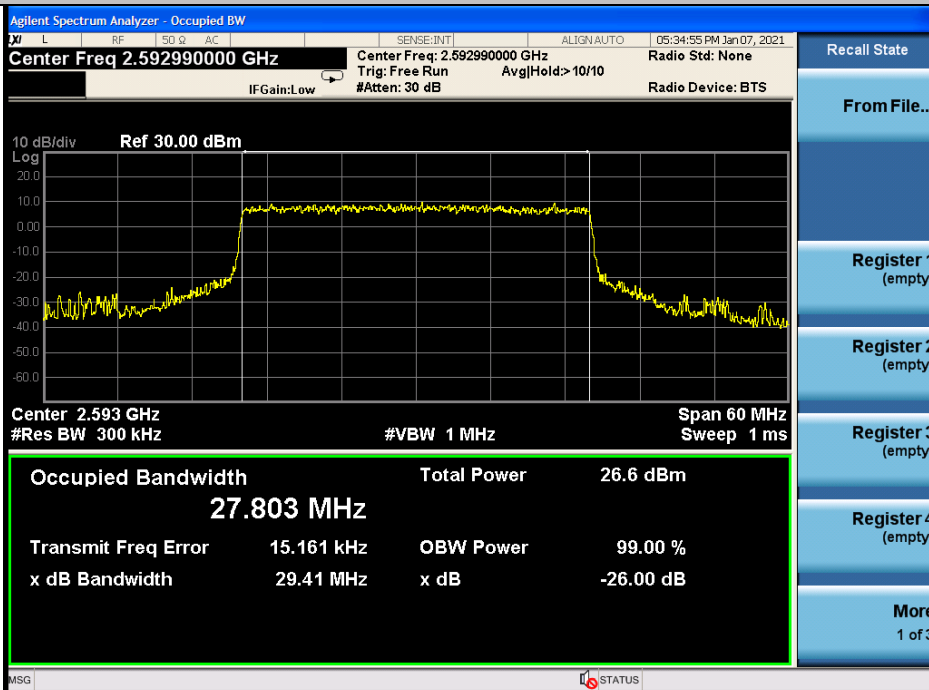


Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com


SGS-CSTC Standards Technical Services Co., Ltd.
 Shenzhen Branch (Inspection & Testing Services)

No. 1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgsgroup.com.cn
 中国·深圳·科技园中区M-10栋一号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com

OBW&EBW N41 30KHz TM8 30MHz 518598 Outer Full

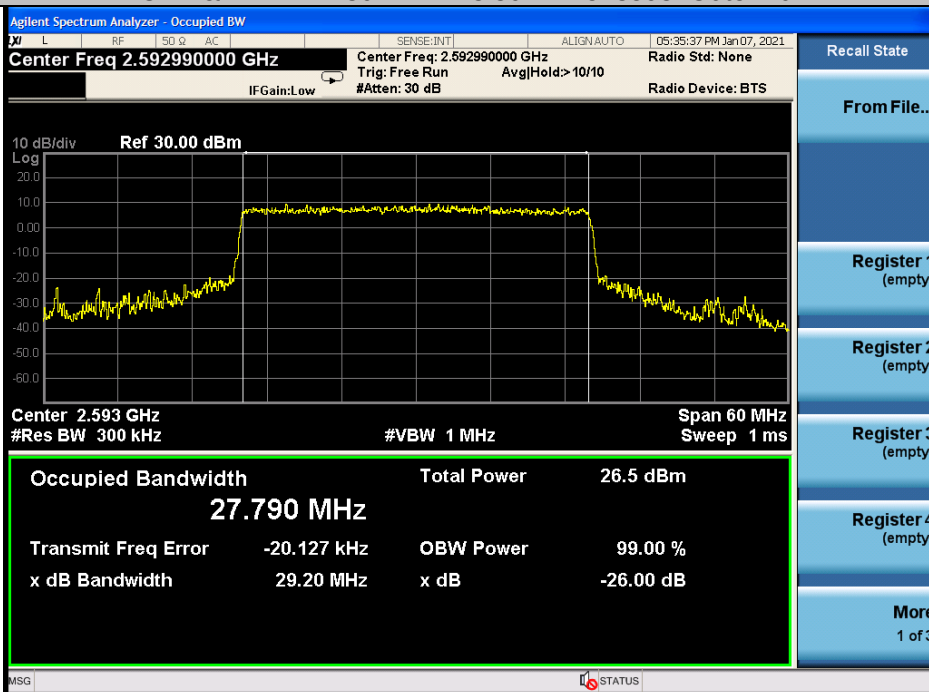

OBW&EBW N41 30KHz TM9 30MHz 518598 Outer Full

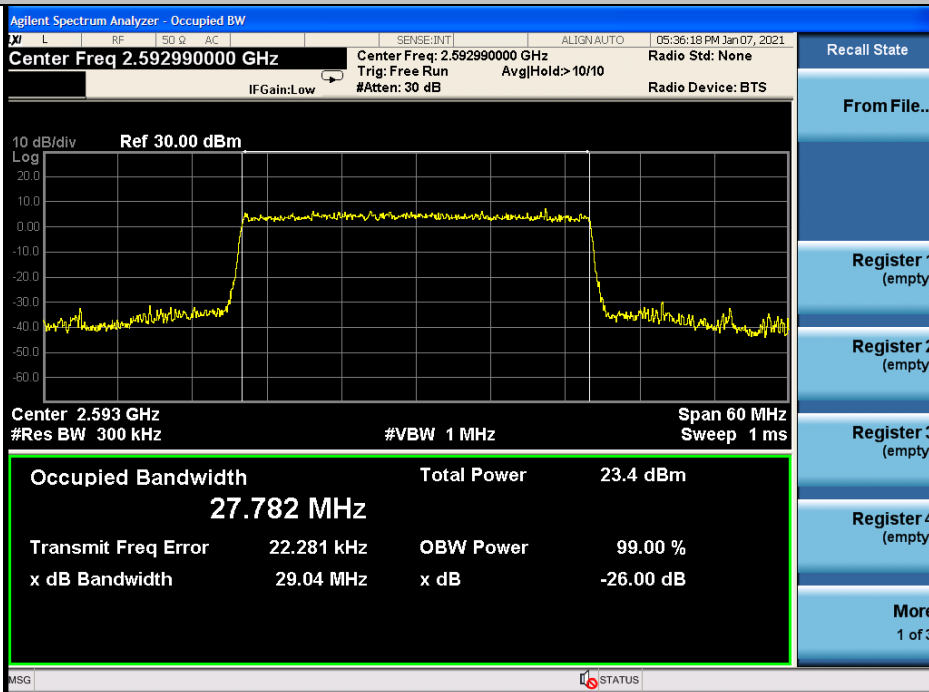


Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com


SGS-CSTC Standards Technical Services Co., Ltd.
 Shenzhen Branch (Internal Use Only) Laboratory

No. 1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgsgroup.com.cn
 中国·深圳·科技园中区M-10栋一号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com


OBW&EBW N41 30KHz TM1 40MHz 518598 Outer Full

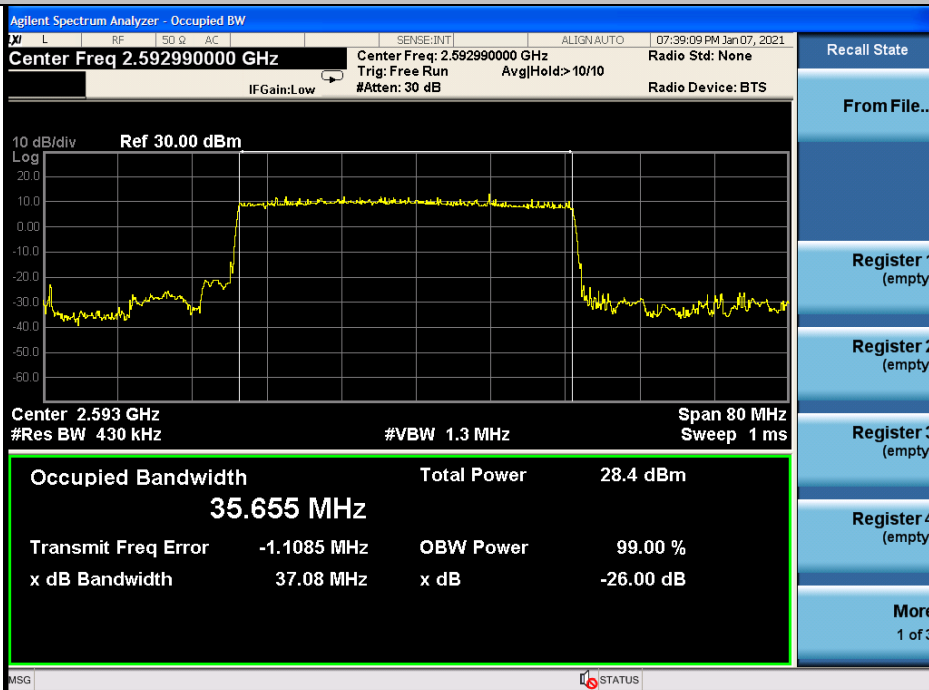


OBW&EBW N41 30KHz TM2 40MHz 518598 Outer Full

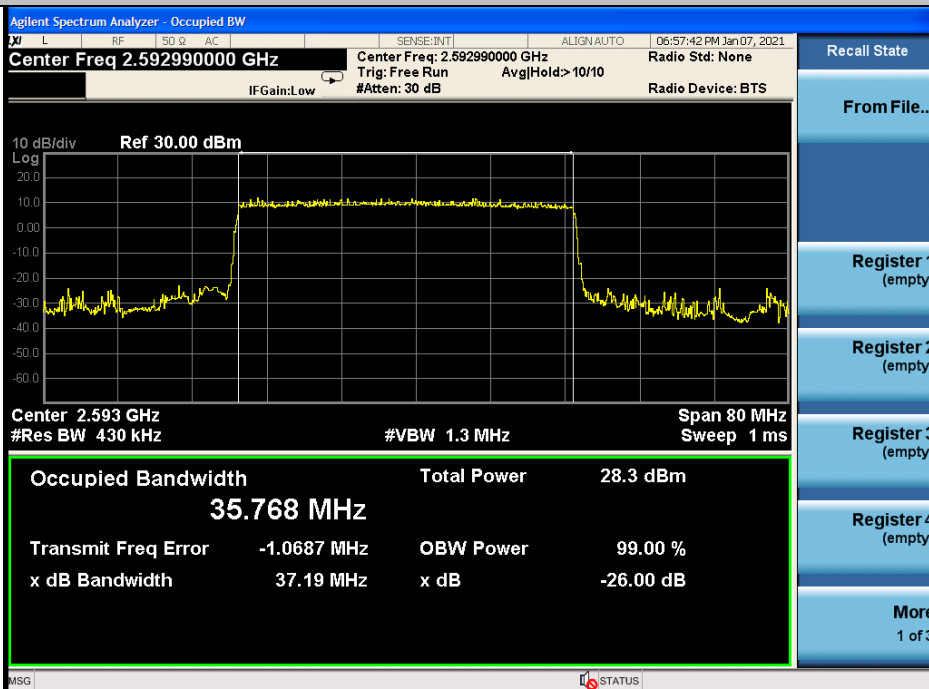

OBW&EBW N41 30KHz TM3 40MHz 518598 Outer Full

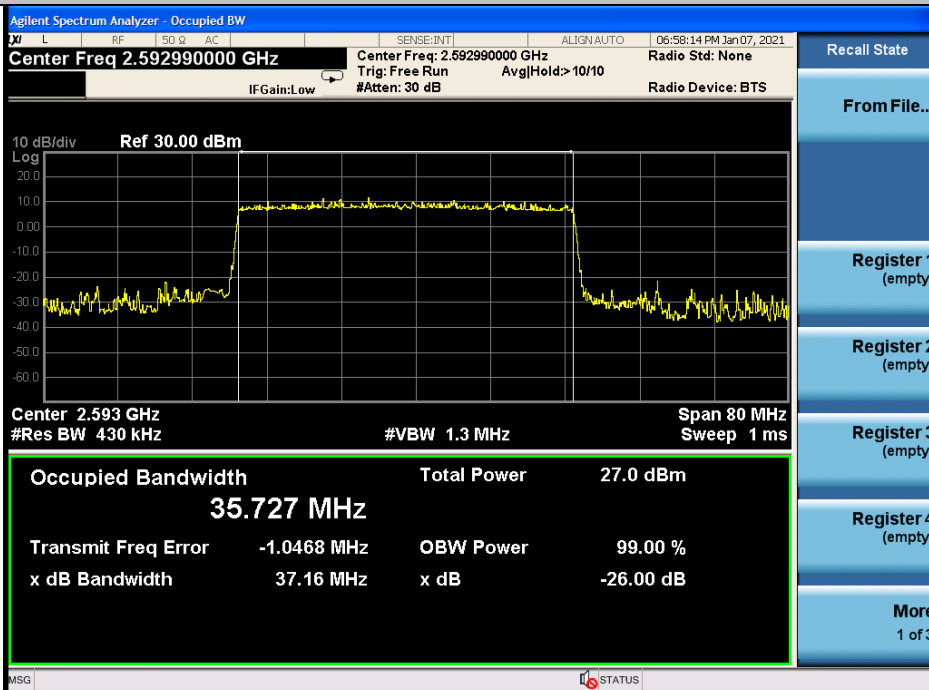

OBW&EBW N41 30KHz TM4 40MHz 518598 Outer Full

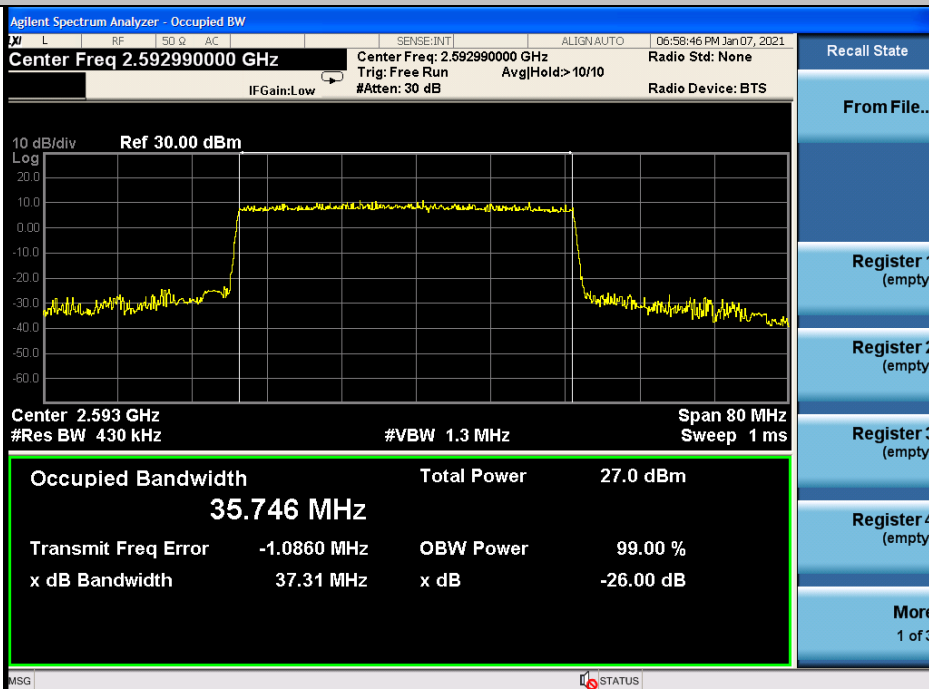


Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

SGS-CSTC Standards Technical Services Co., Ltd.
 Shenzhen Branch (Technical Services Laboratory)

No. 1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgsgroup.com.cn
 中国·深圳·科技园中区M-10栋一号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com

OBW&EBW N41 30KHz TM5 40MHz 518598 Outer Full

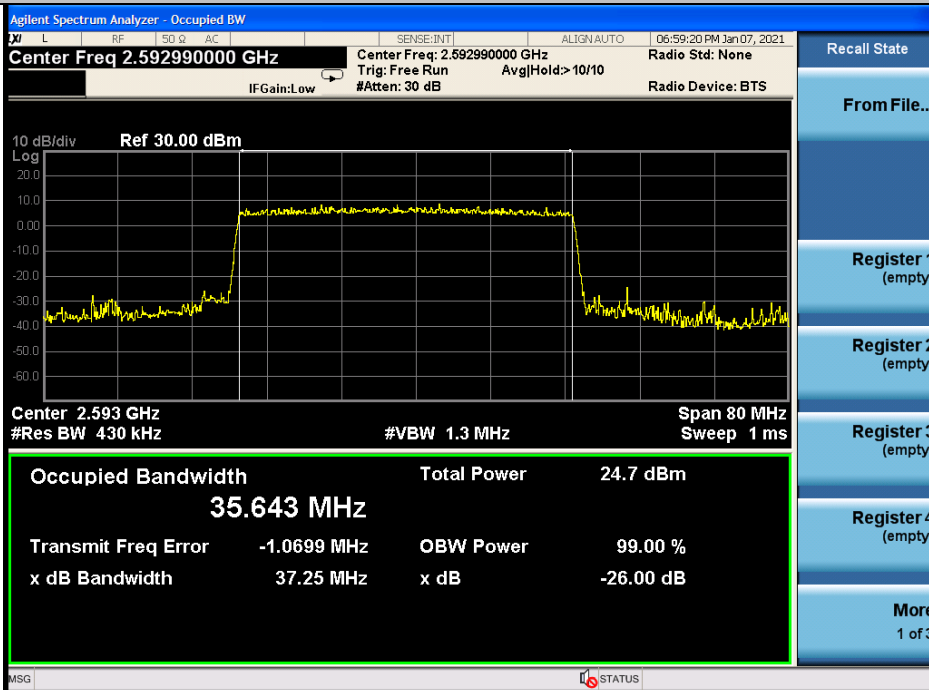

OBW&EBW N41 30KHz TM6 40MHz 518598 Outer Full

