



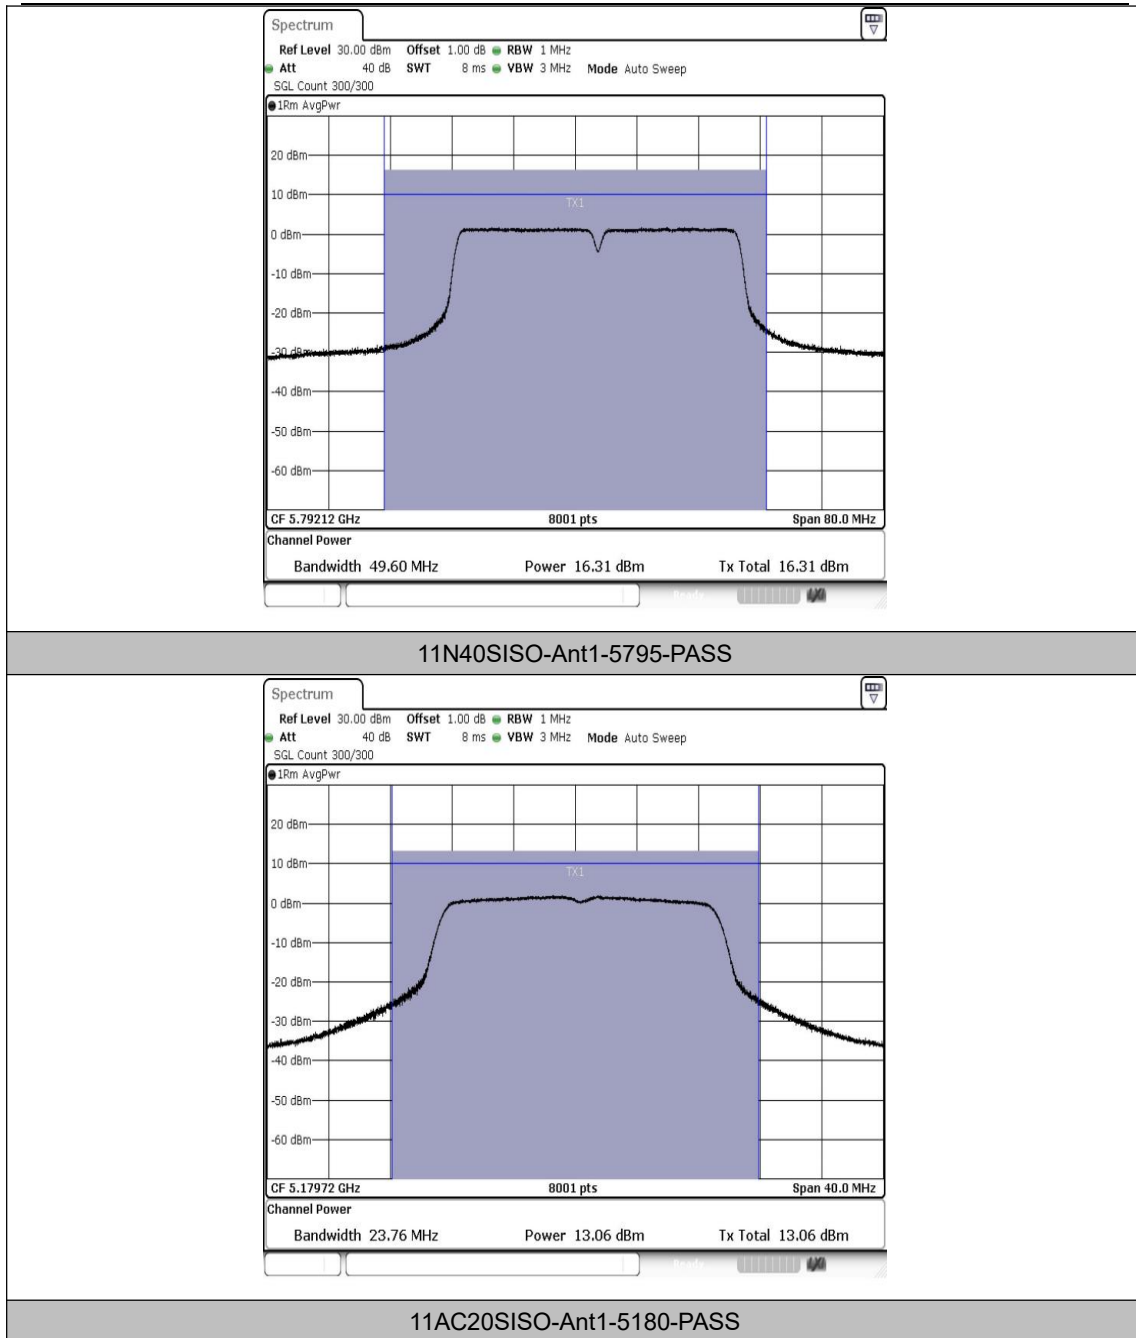


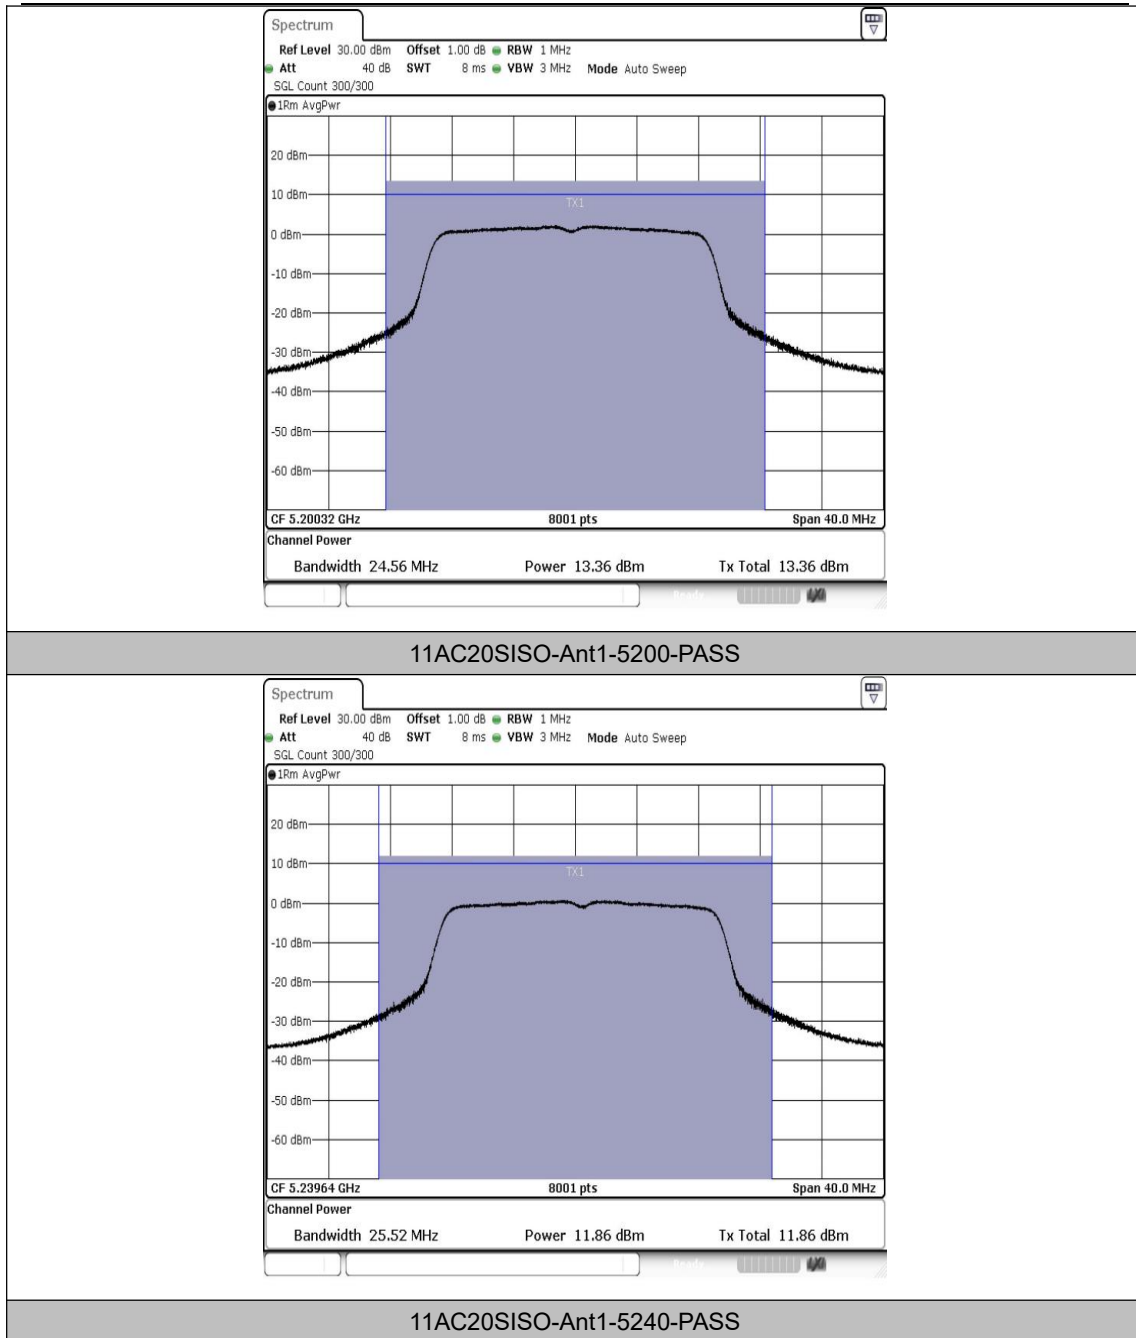

**Shenzhen Anbotek Compliance Laboratory Limited**

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,  
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel:(86)0755-26066440 Email:service@anbotek.com


Hotline  
400-003-0500  
www.anbotek.com

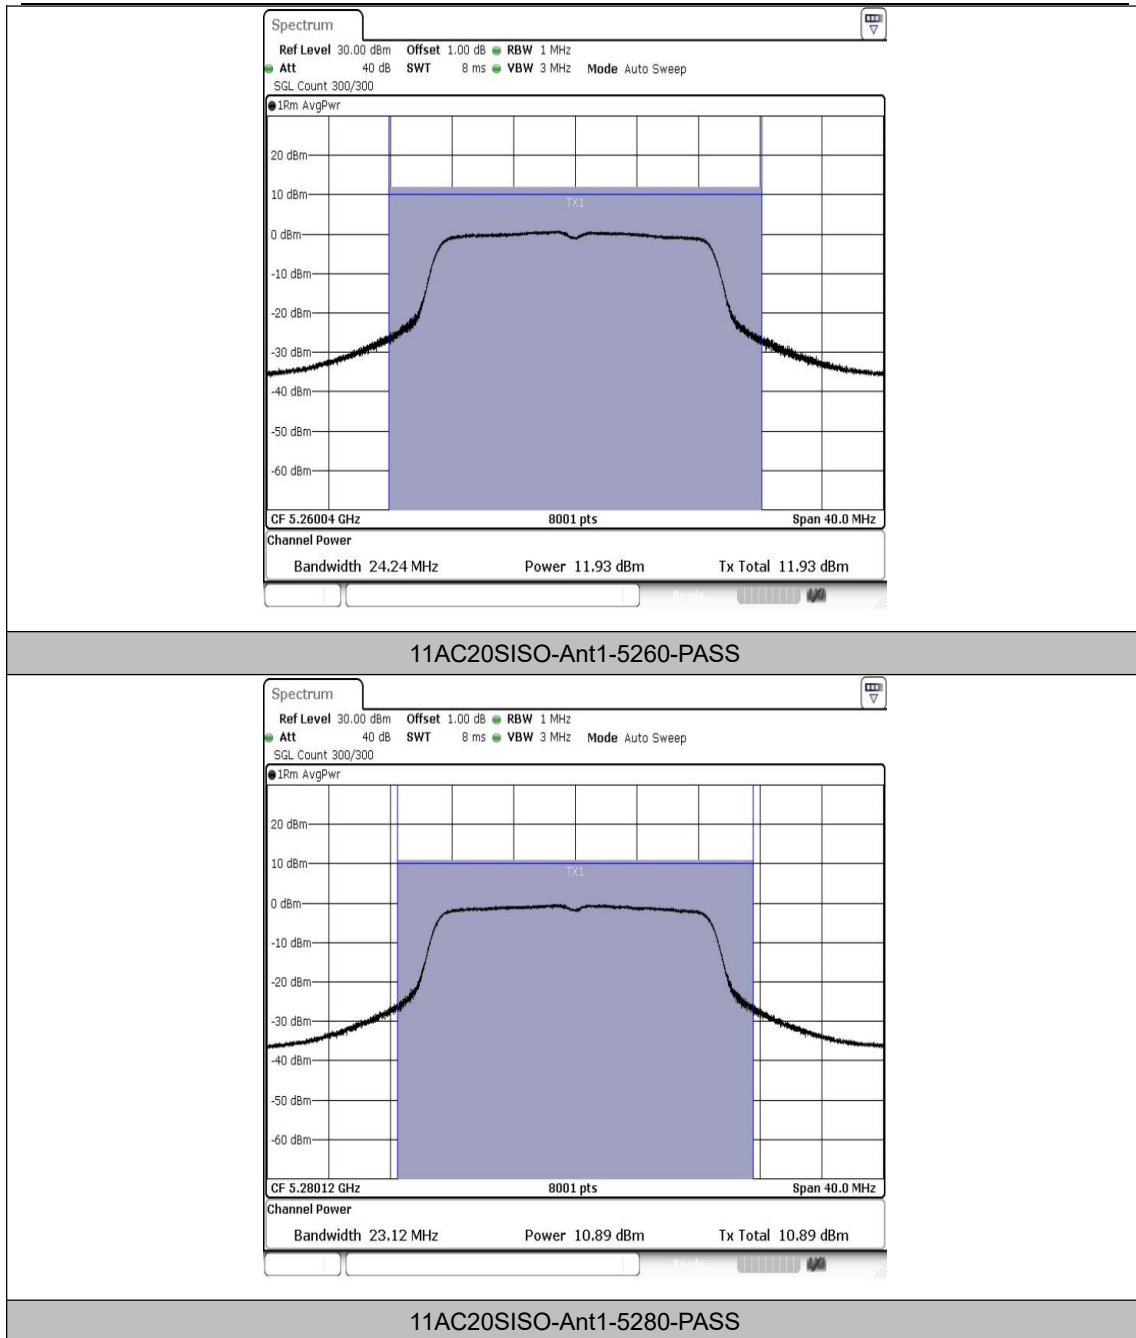


**Shenzhen Anbotek Compliance Laboratory Limited**

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,  
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel:(86)0755-26066440 Email:service@anbotek.com

 Hotline  
400-003-0500  
www.anbotek.com

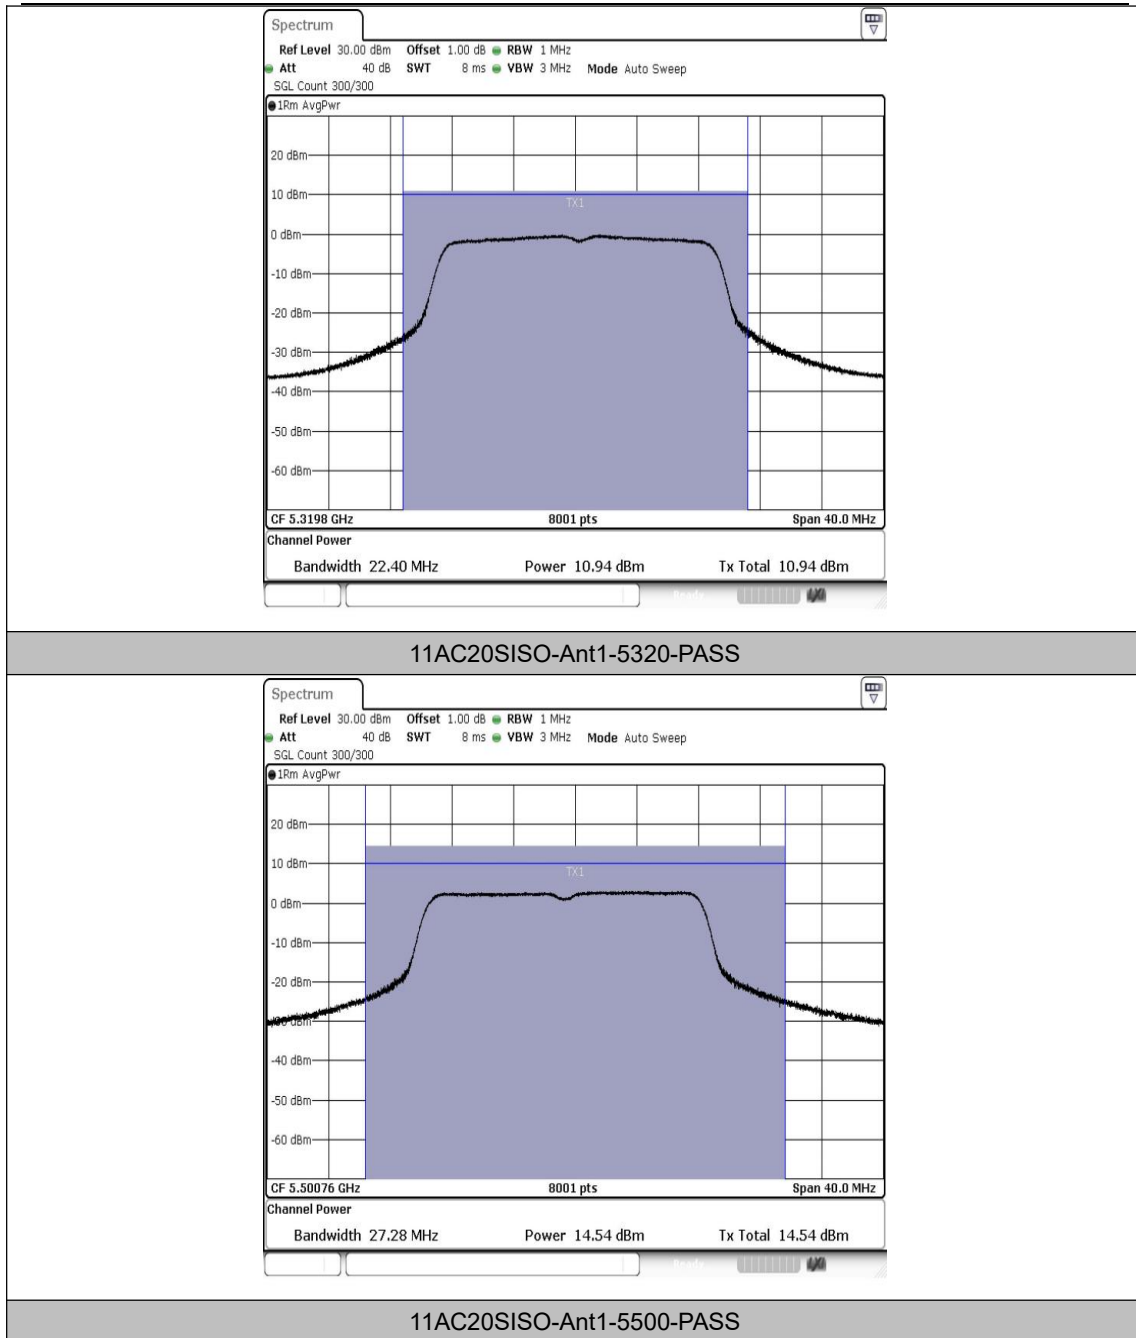


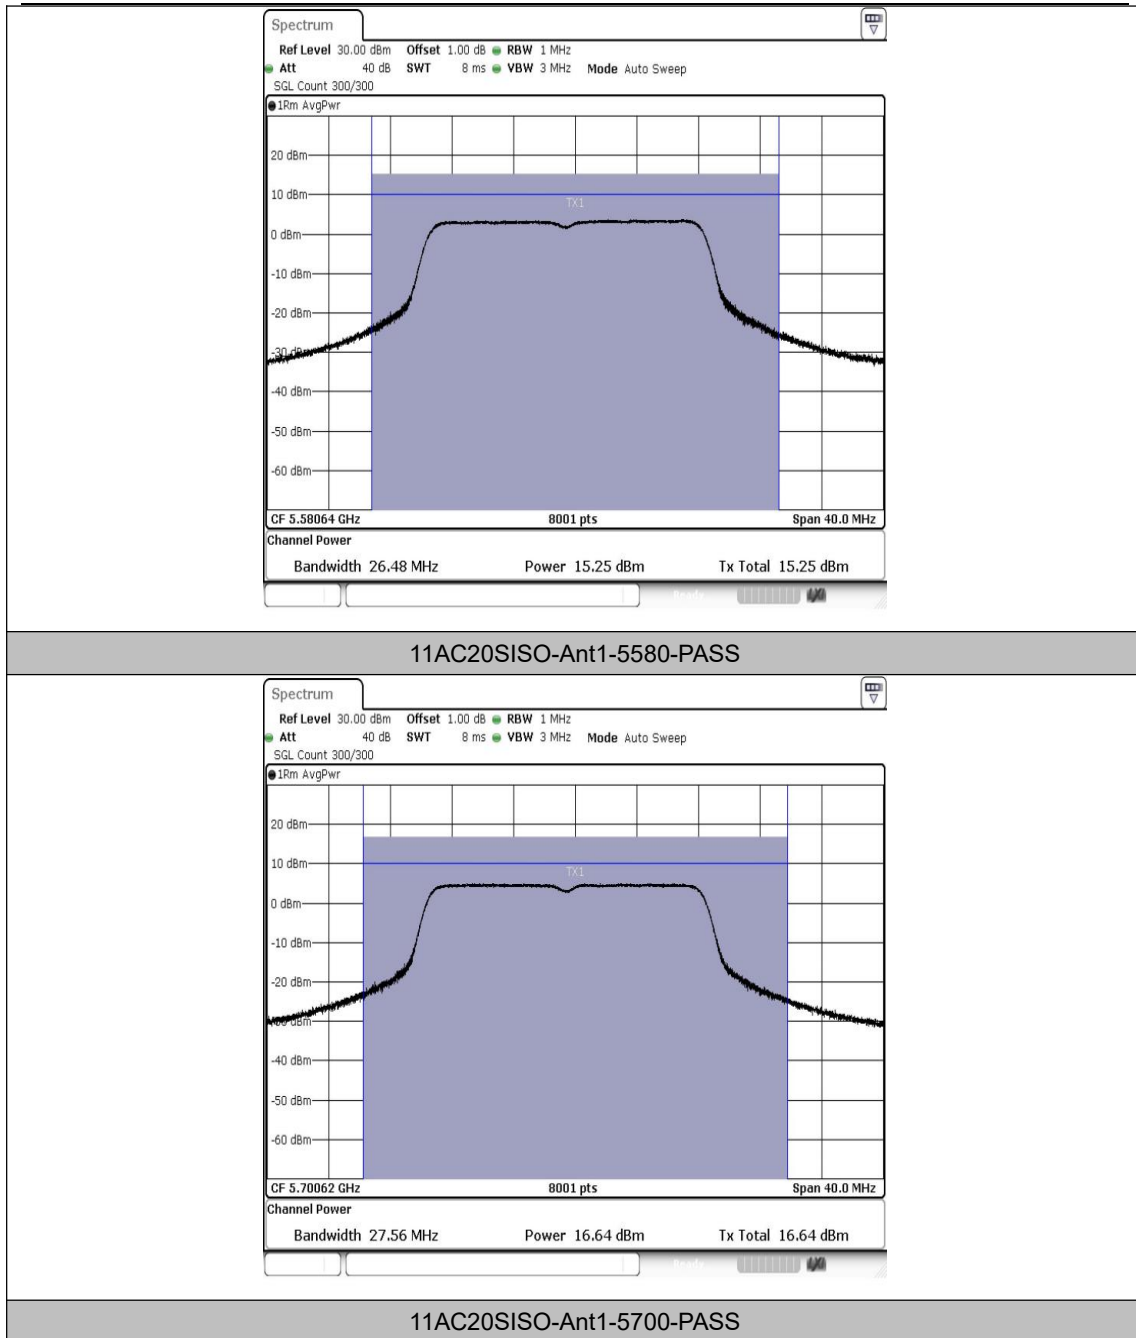


**Shenzhen Anbotek Compliance Laboratory Limited**

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,  
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel:(86)0755-26066440 Email:service@anbotek.com

 Hotline  
400-003-0500  
www.anbotek.com

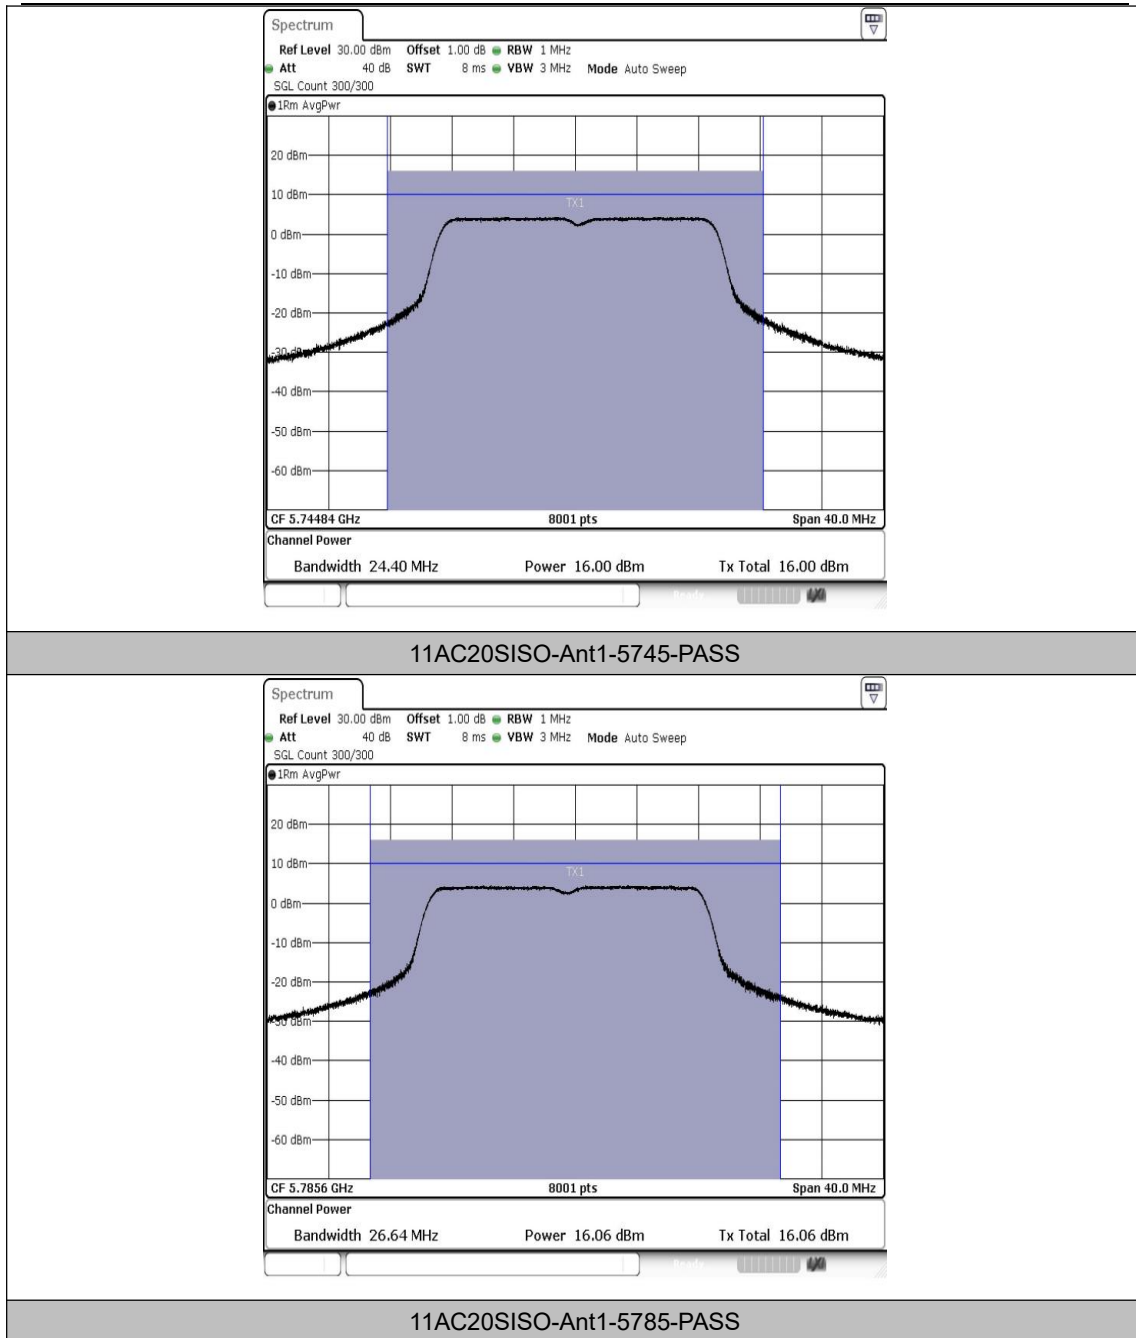


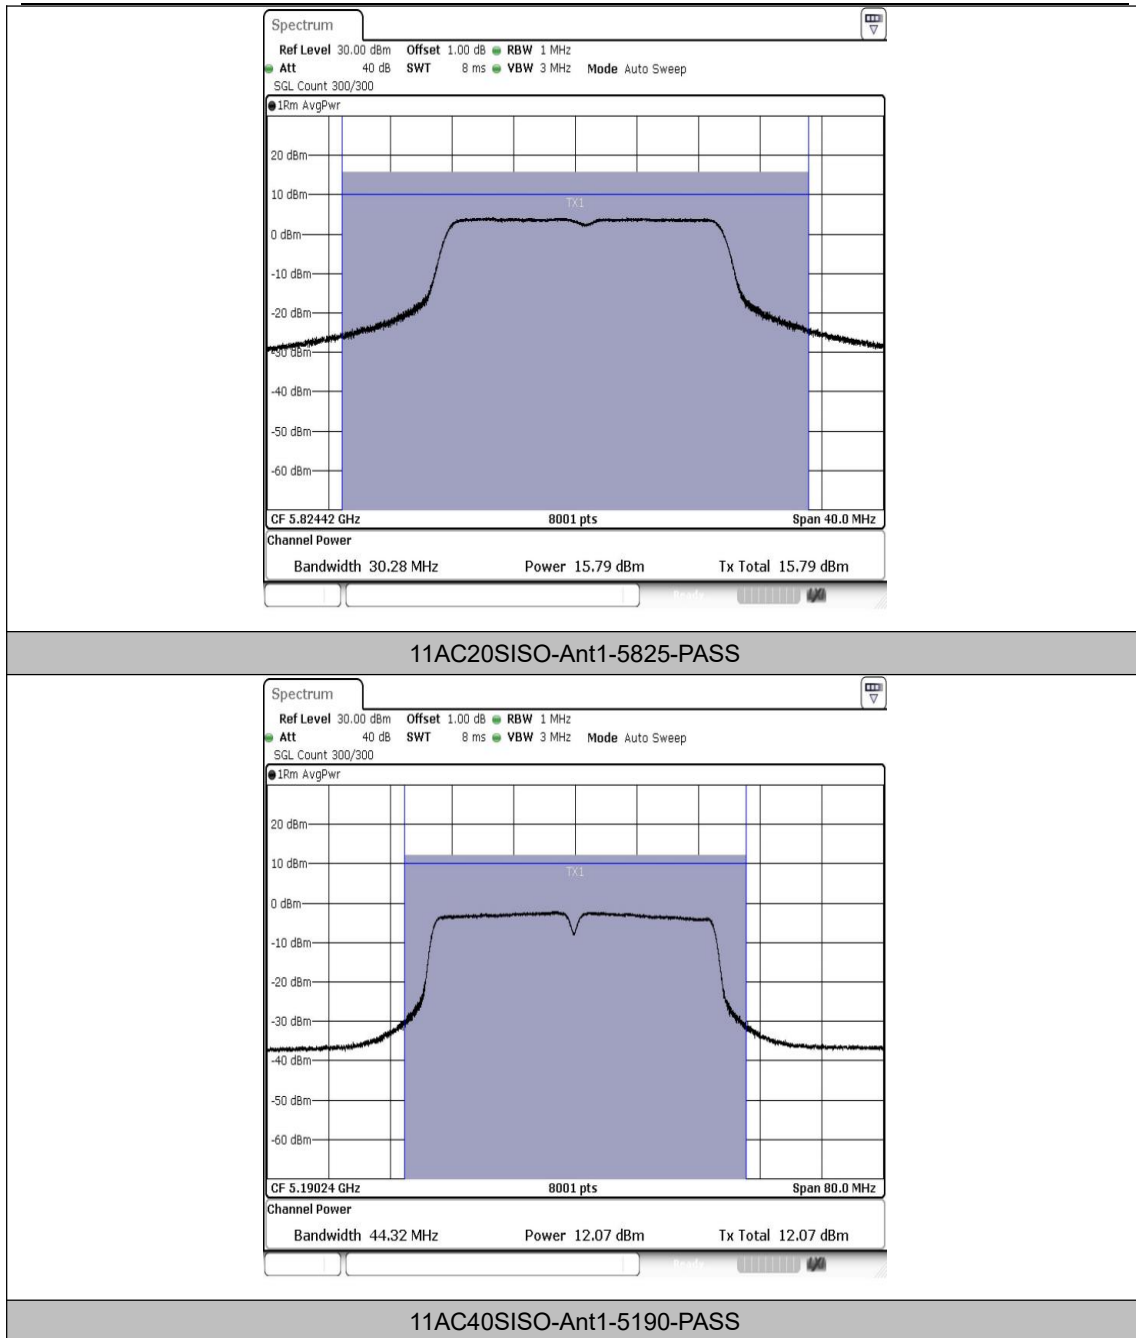

**Shenzhen Anbotek Compliance Laboratory Limited**

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,  
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: (86) 0755-26066440 Email: service@anbotek.com


 Hotline  
400-003-0500  
www.anbotek.com

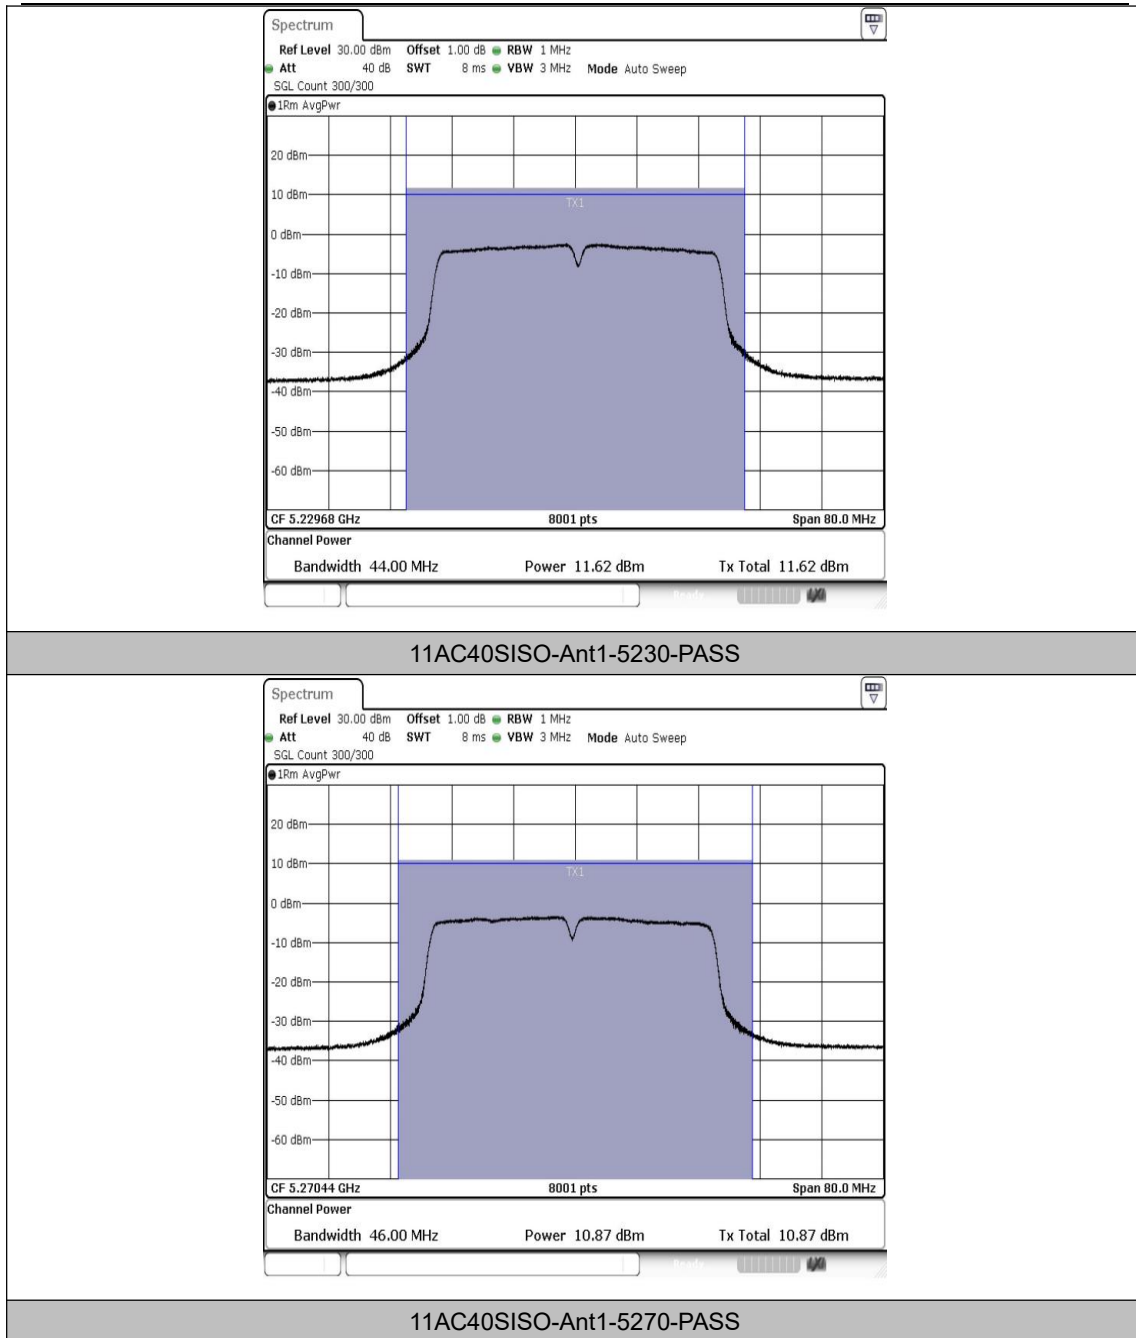

**Shenzhen Anbotech Compliance Laboratory Limited**

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,  
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel:(86)0755-26066440 Email:service@anbotech.com


 Hotline  
400-003-0500  
www.anbotech.com

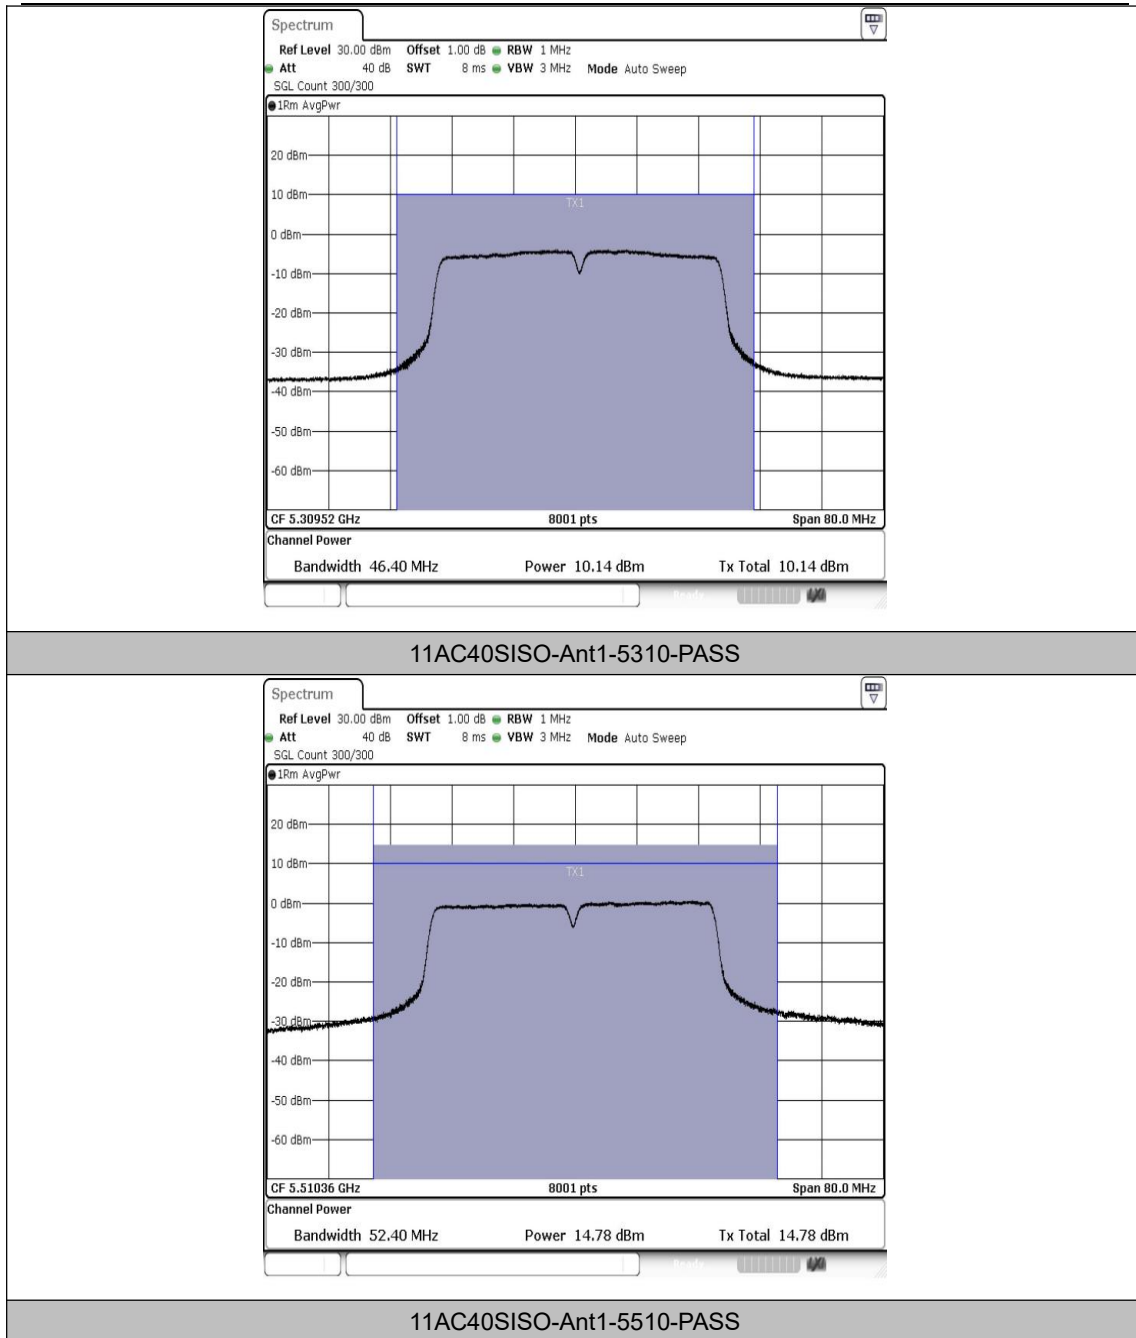

**Shenzhen Anbotek Compliance Laboratory Limited**

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,  
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: (86) 0755-26066440 Email: service@anbotek.com


 Hotline  
400-003-0500  
www.anbotek.com

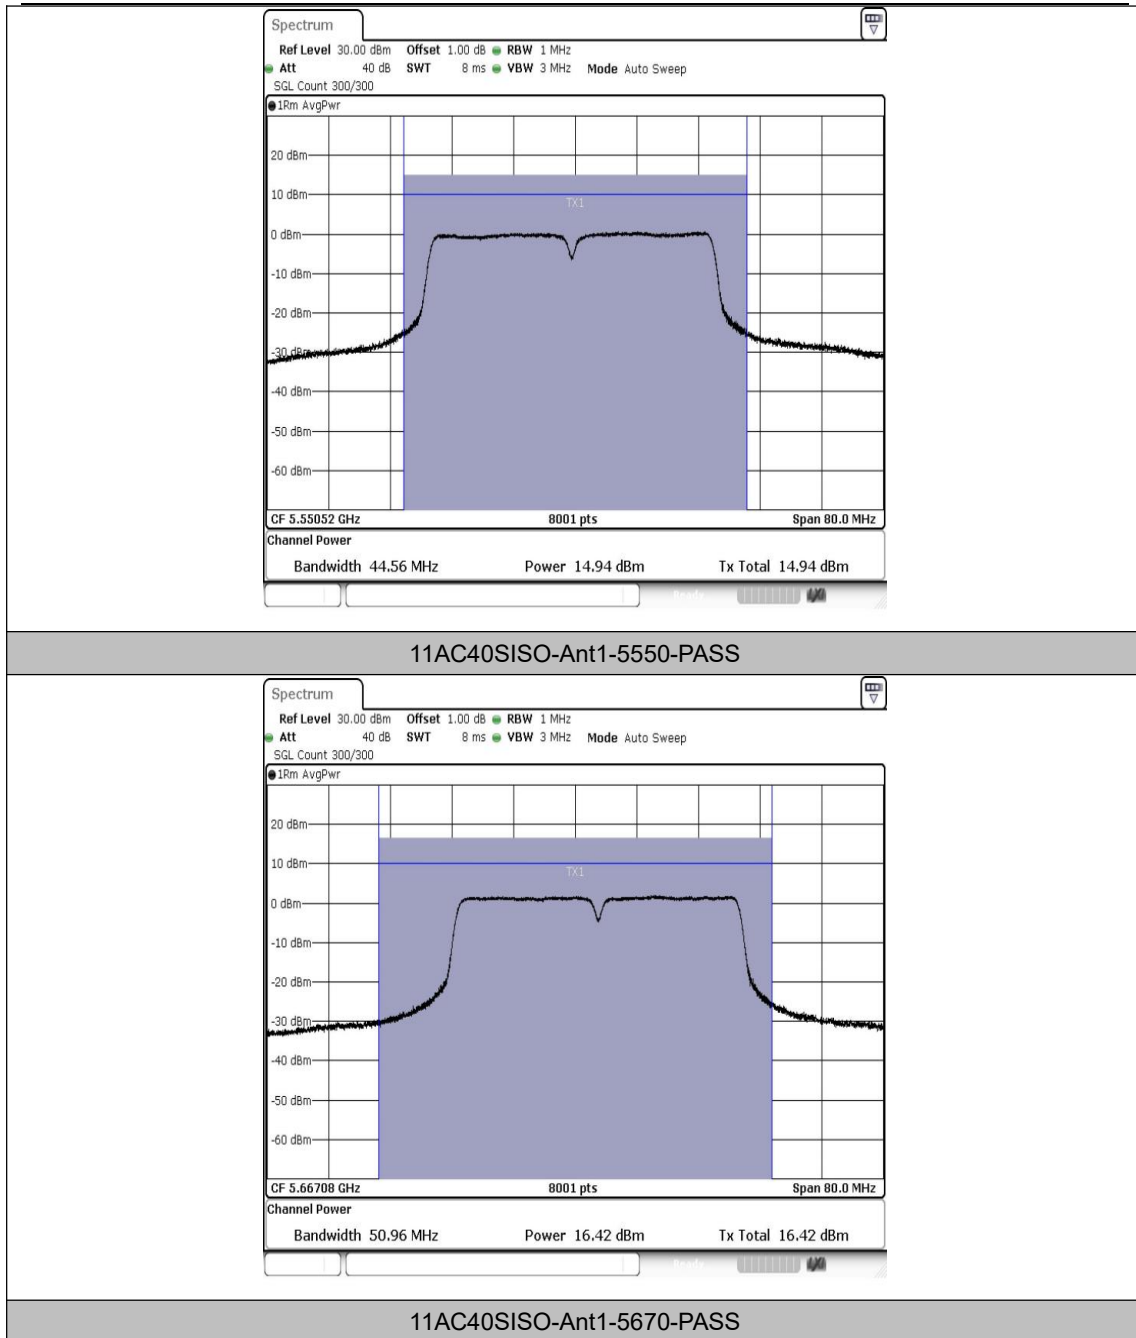



**Shenzhen Anbotek Compliance Laboratory Limited**

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,  
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline  
400-003-0500  
www.anbotek.com

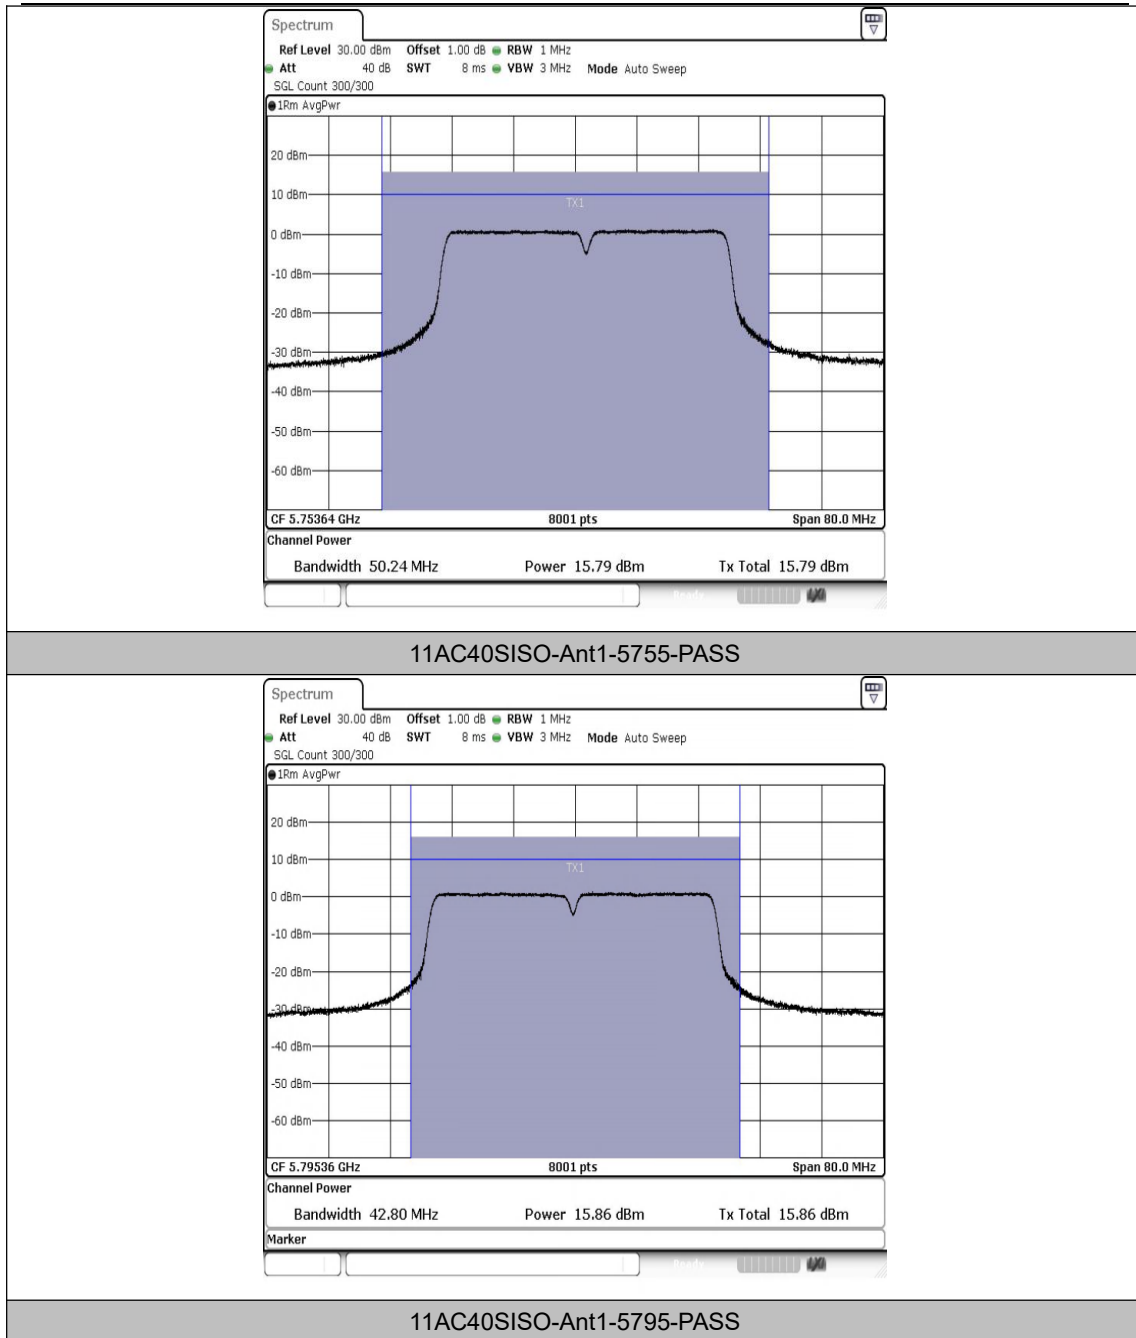

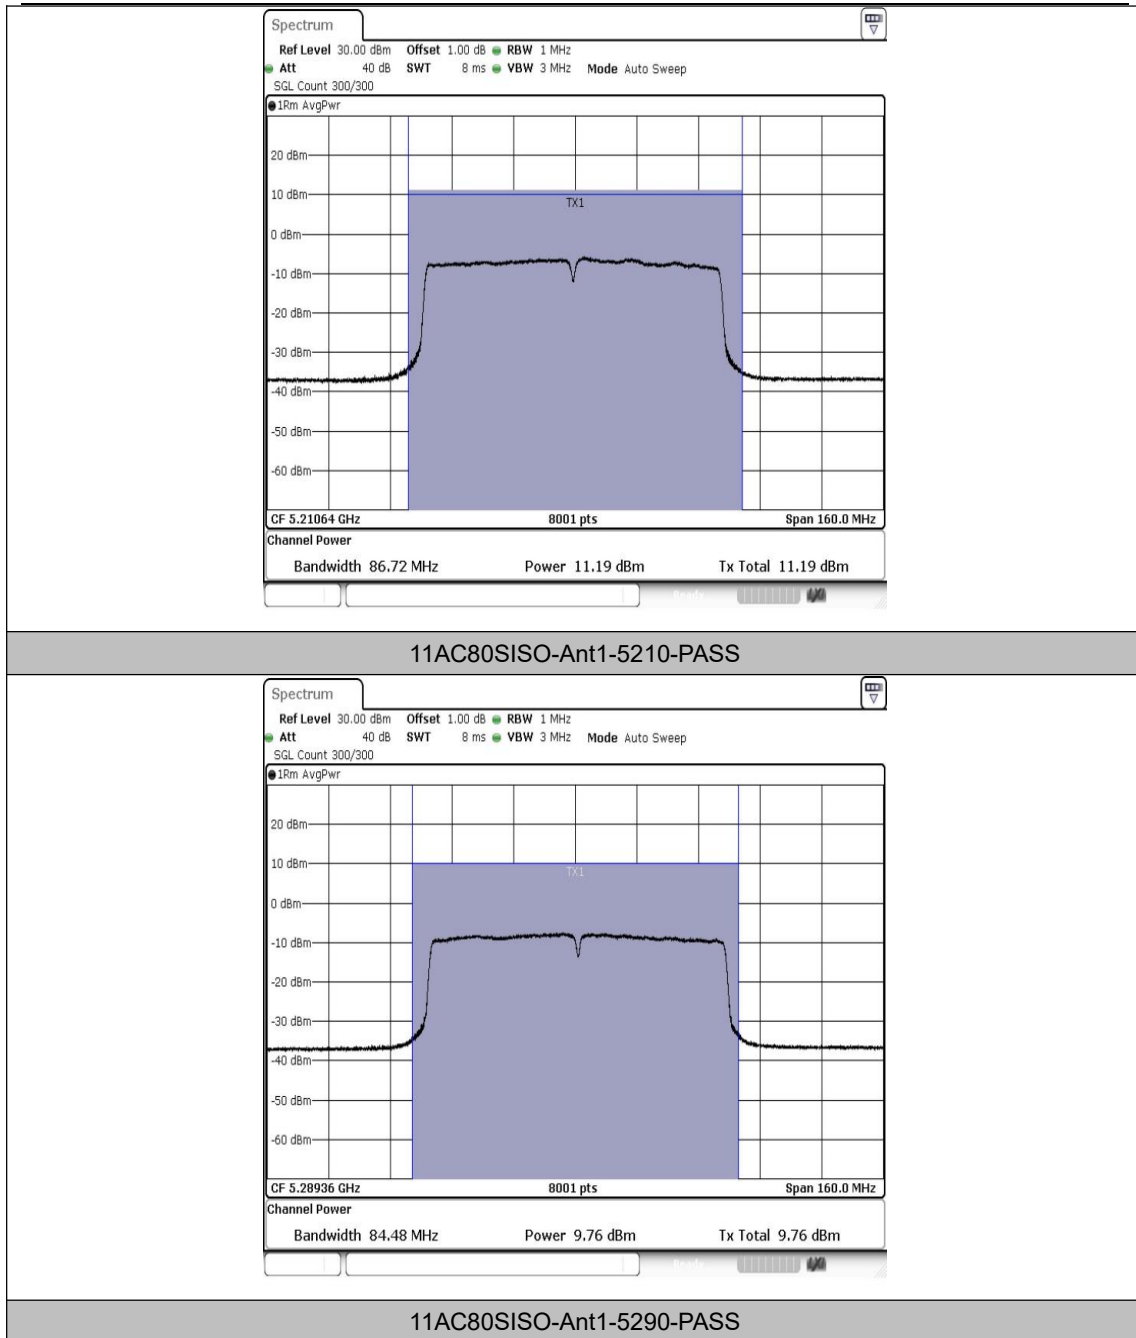


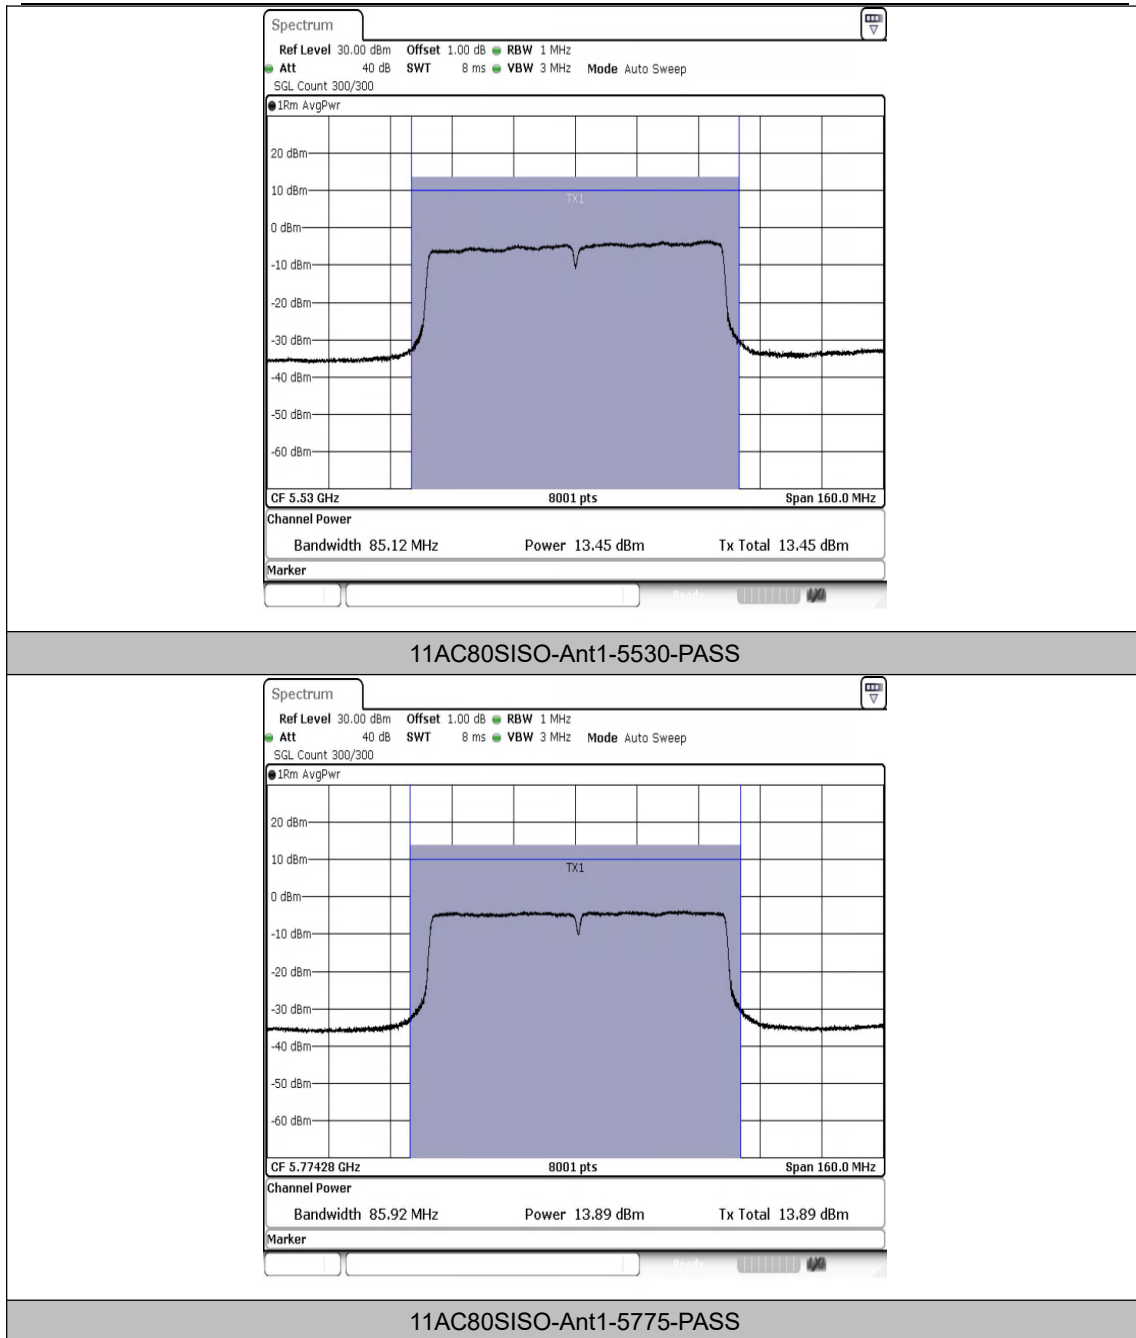

**Shenzhen Anbotech Compliance Laboratory Limited**

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,  
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: (86) 0755-26066440 Email: service@anbotech.com


 Hotline  
400-003-0500  
www.anbotech.com

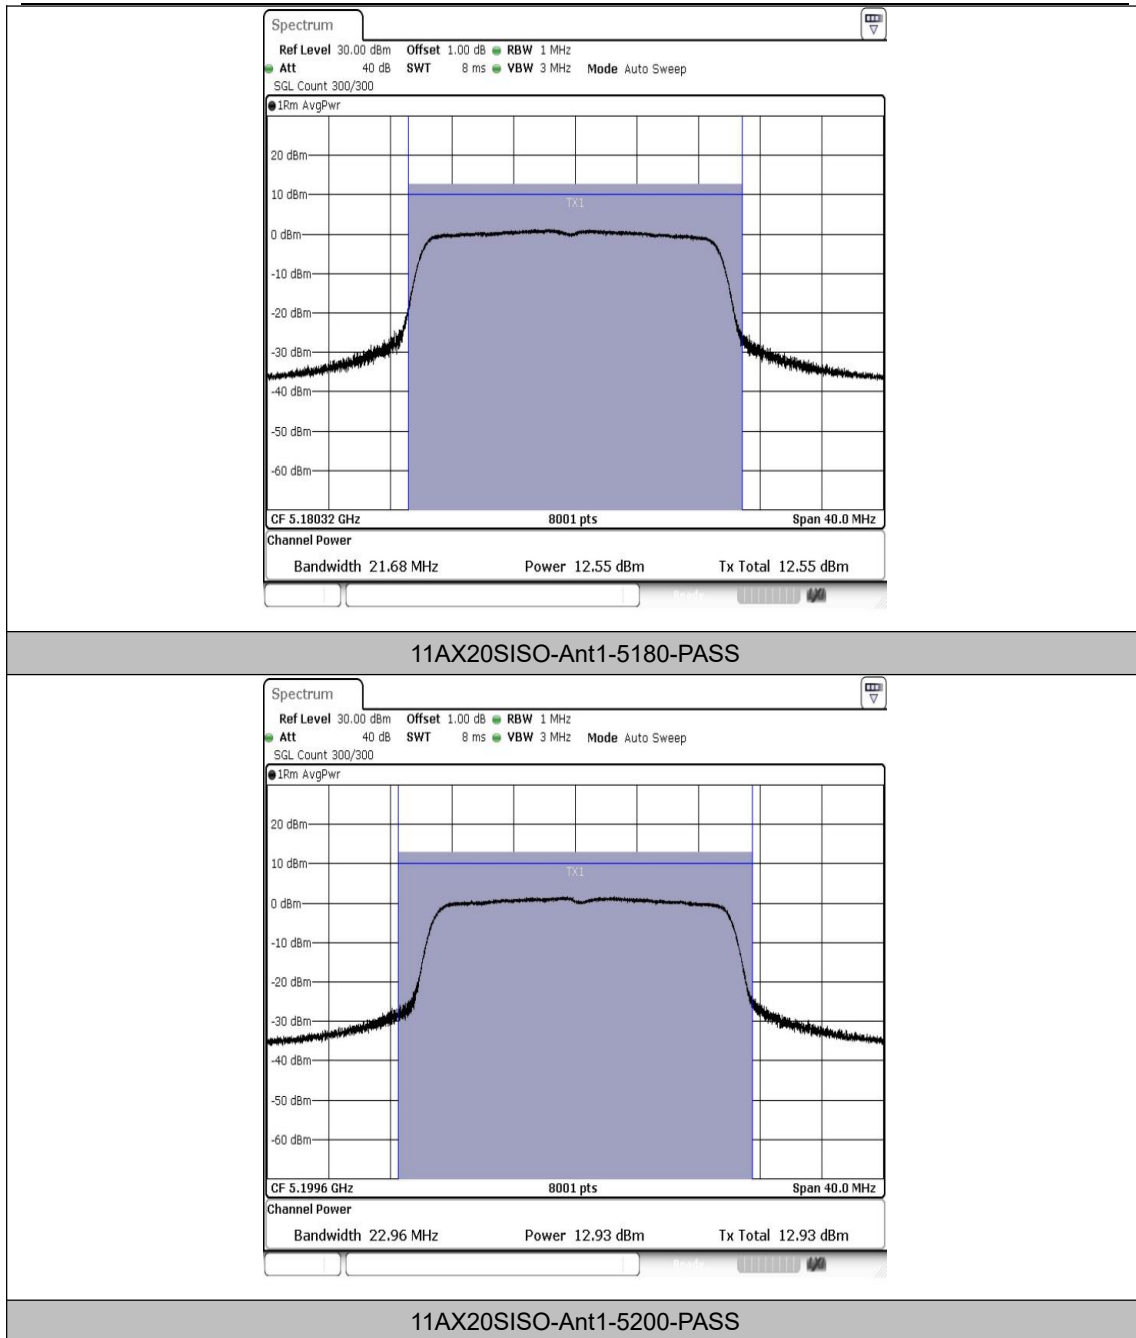


### Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,  
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel:(86)0755-26066440 Email:service@anbotech.com

 Hotline  
400-003-0500  
www.anbotech.com

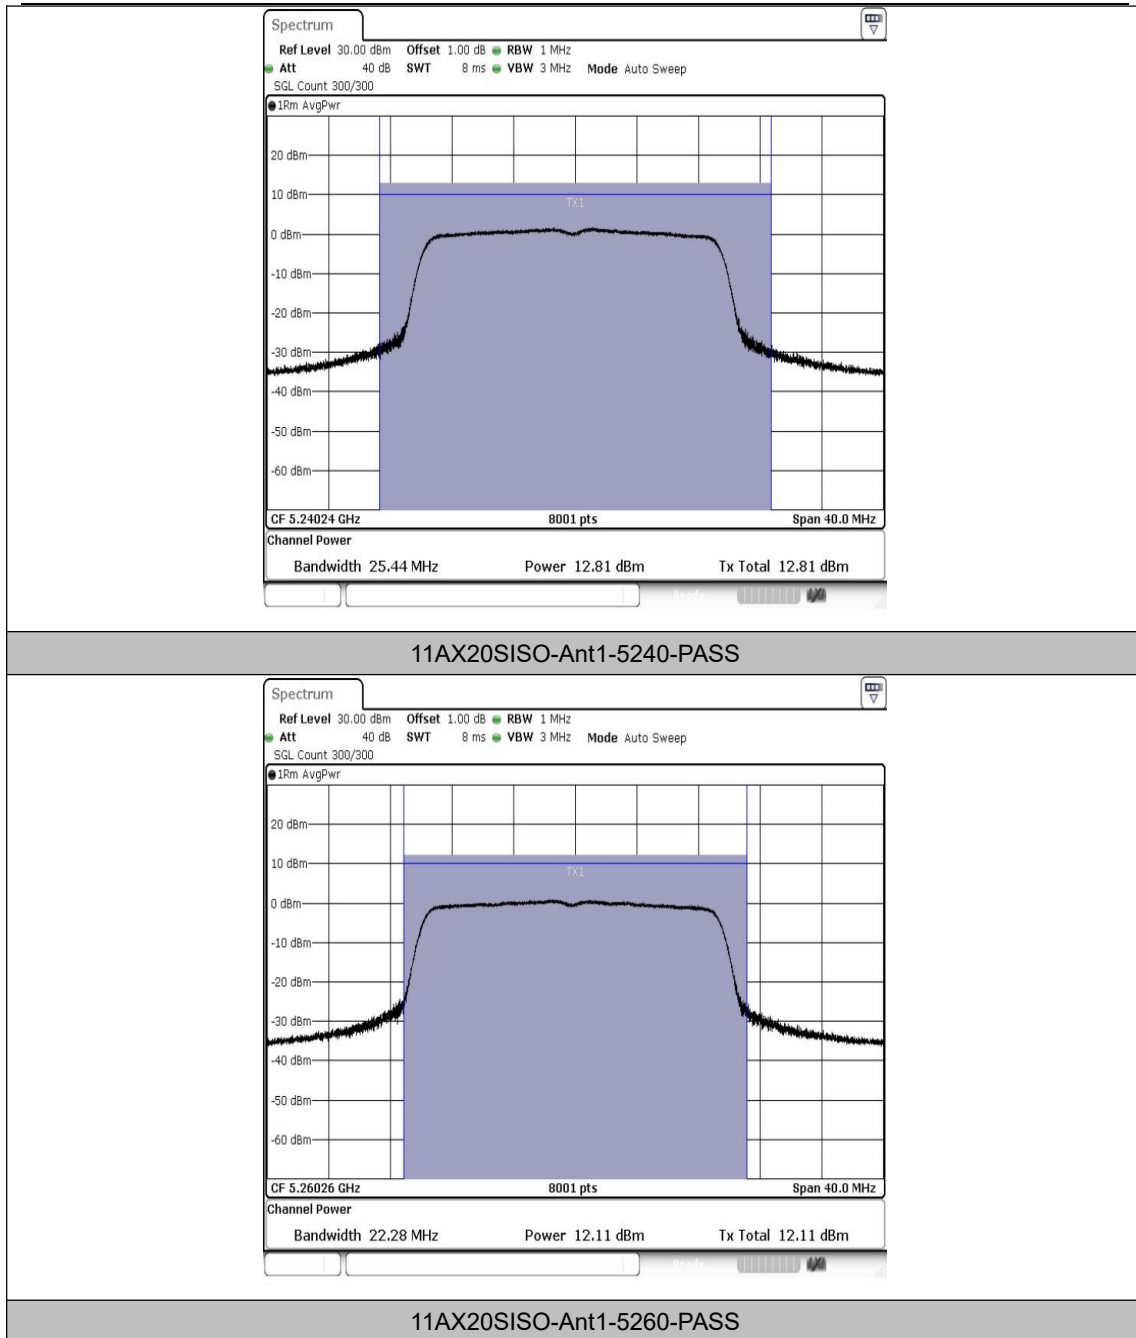


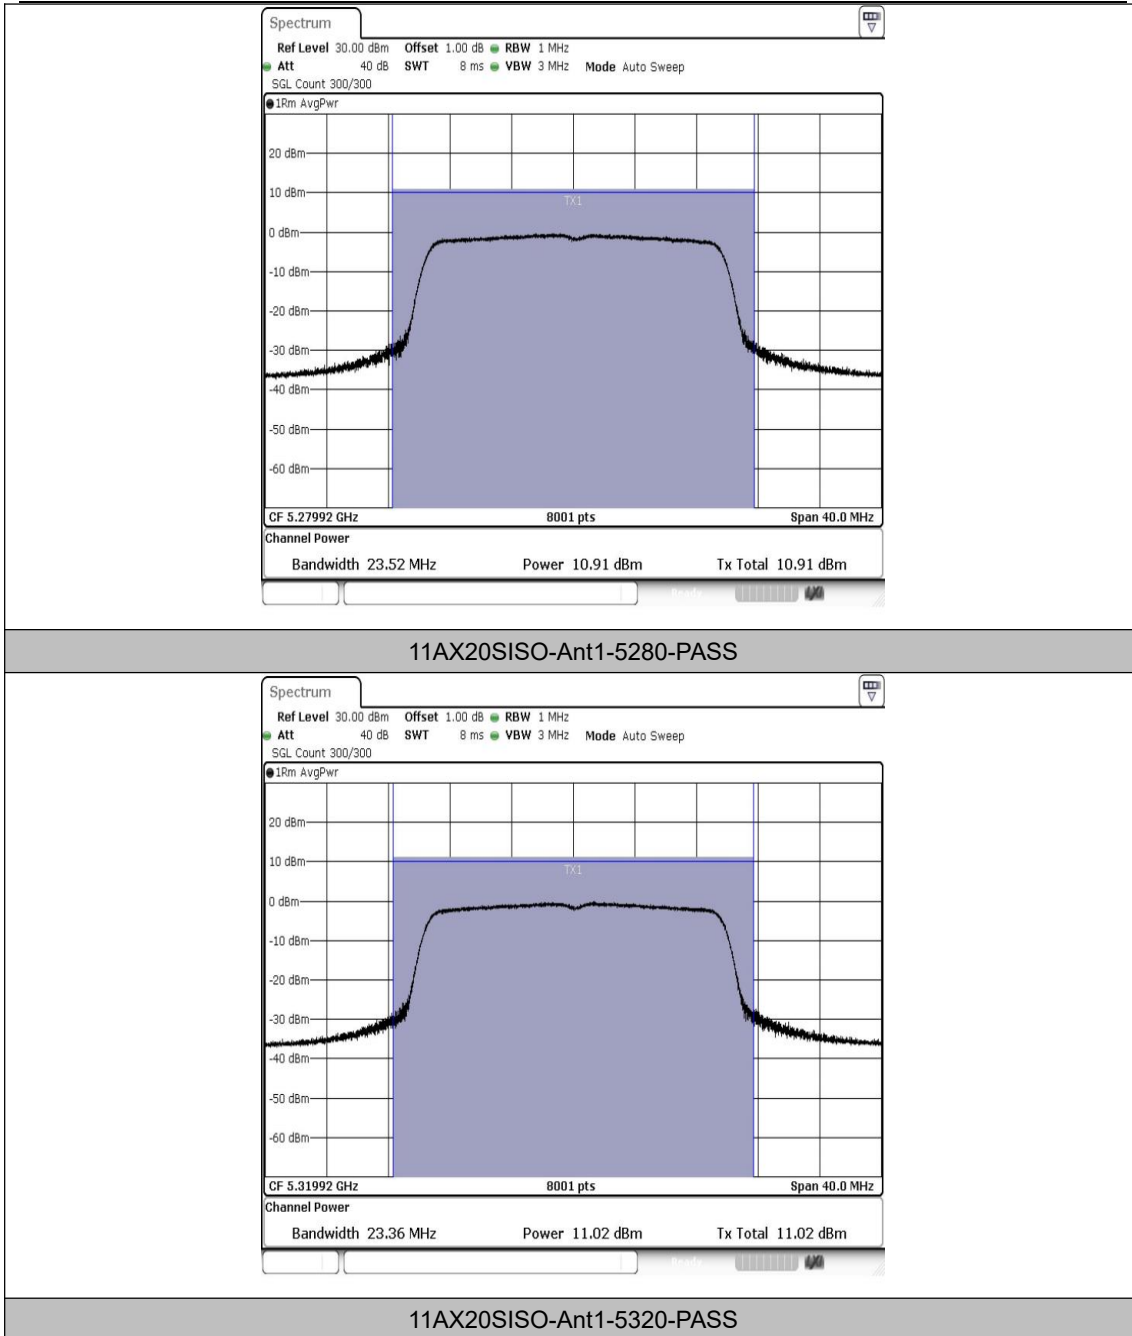

**Shenzhen Anbotech Compliance Laboratory Limited**

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,  
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel:(86)0755-26066440 Email:service@anbotech.com


 Hotline  
400-003-0500  
www.anbotech.com

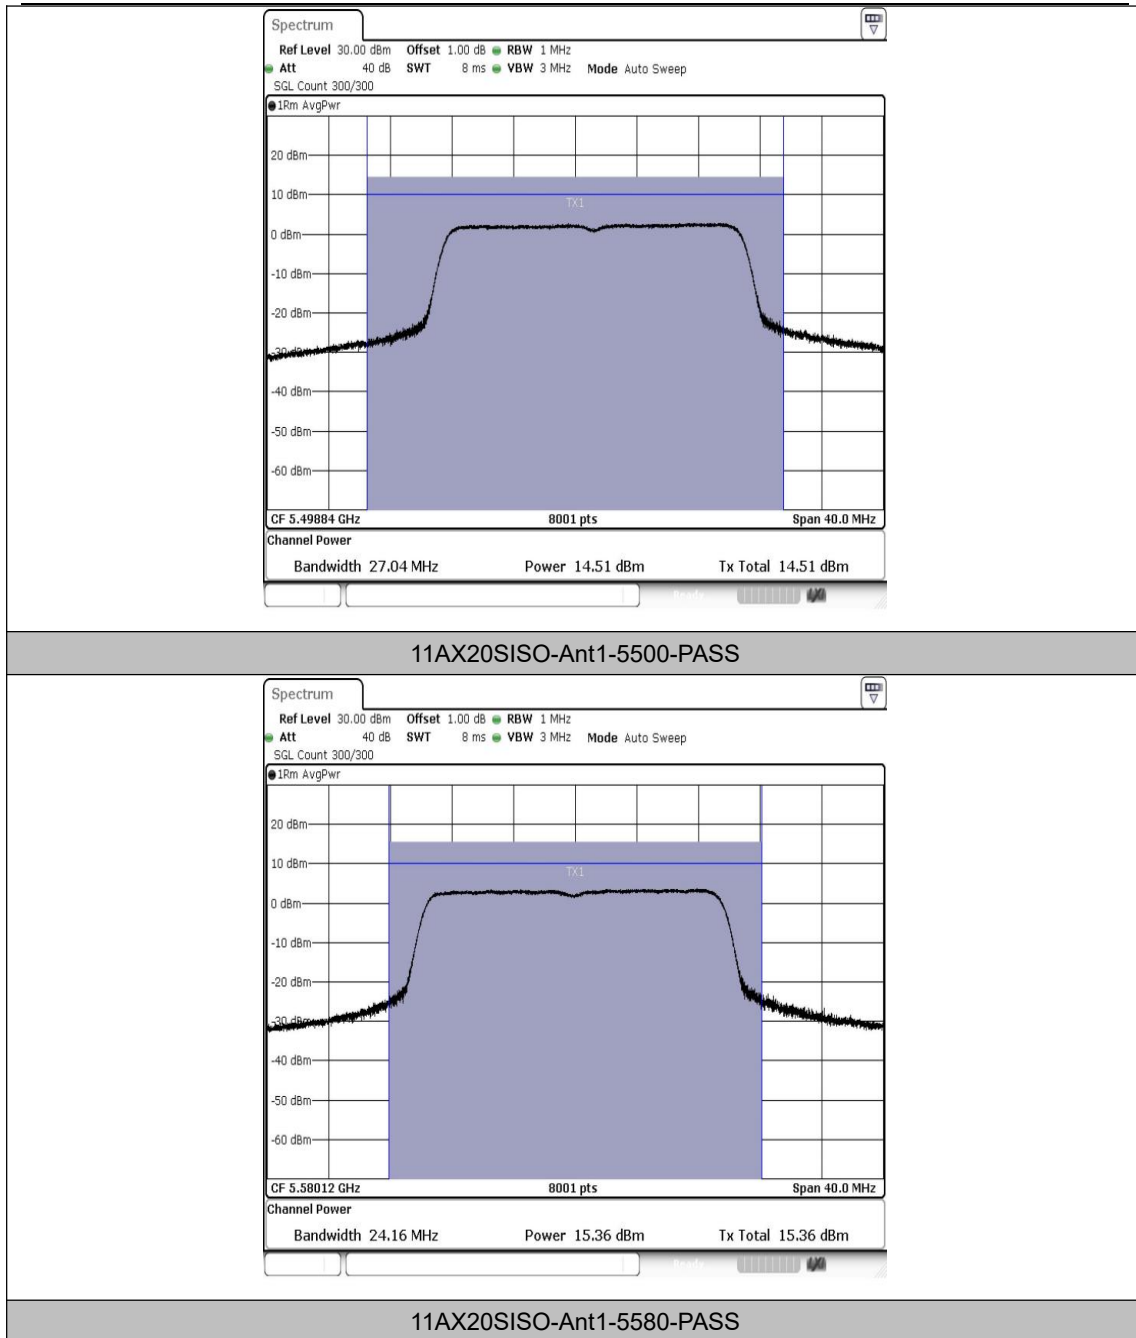

**Shenzhen Anbotech Compliance Laboratory Limited**

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,  
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: (86) 0755-26066440 Email: service@anbotech.com


Hotline  
400-003-0500  
www.anbotech.com

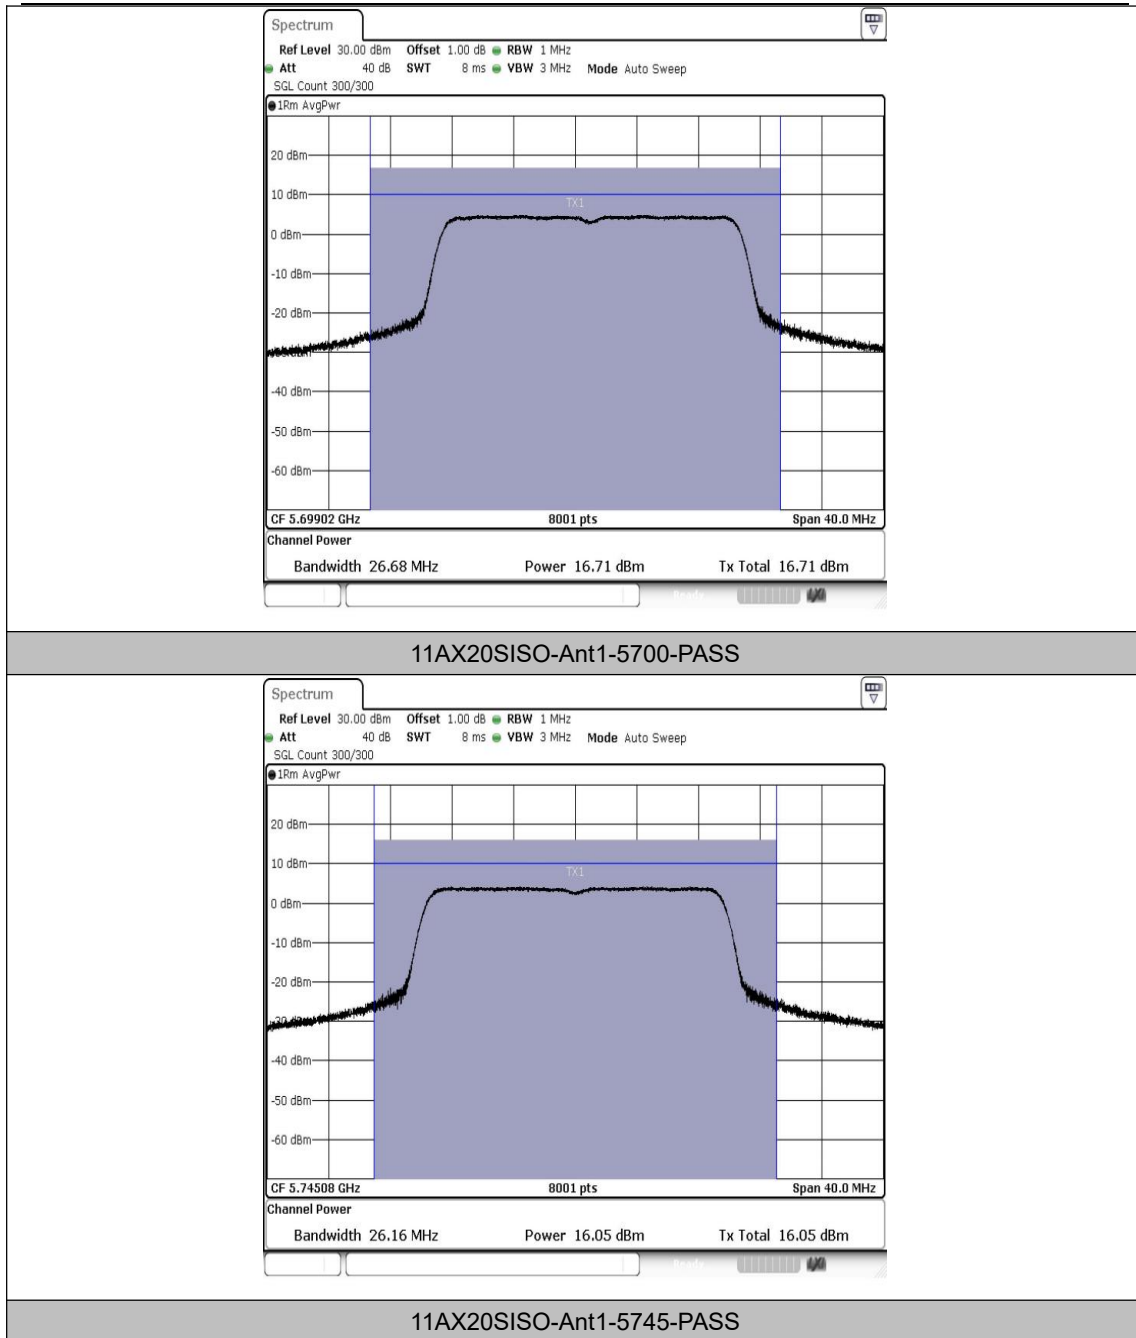


**Shenzhen Anbotek Compliance Laboratory Limited**

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,  
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: (86) 0755-26066440 Email: service@anbotek.com

 Hotline  
400-003-0500  
www.anbotek.com

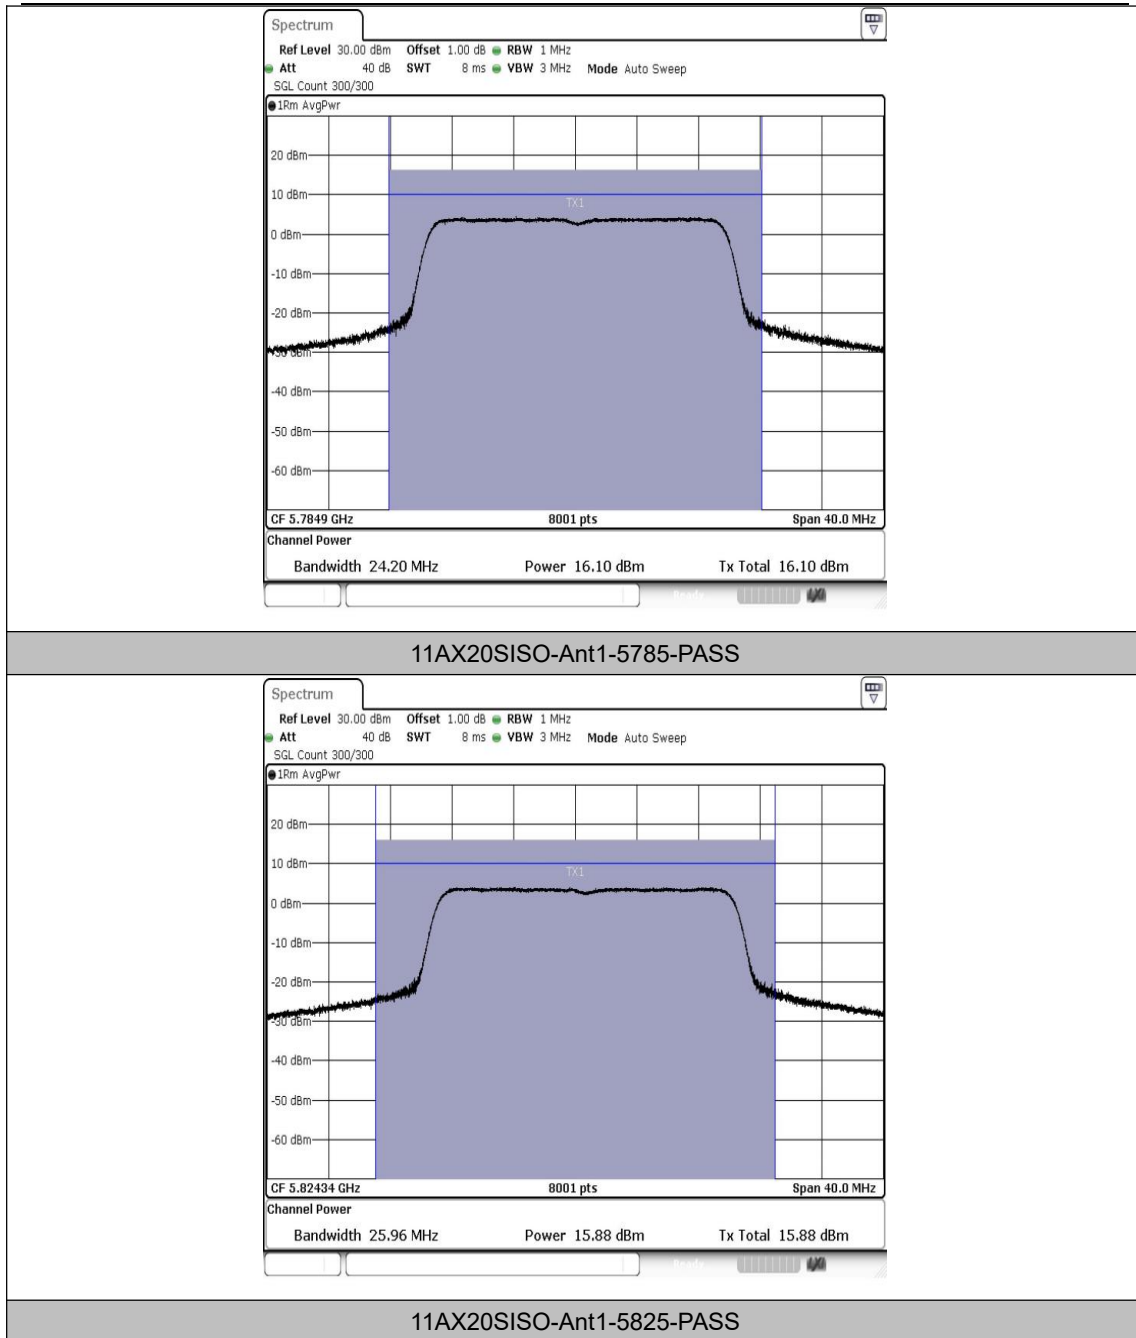


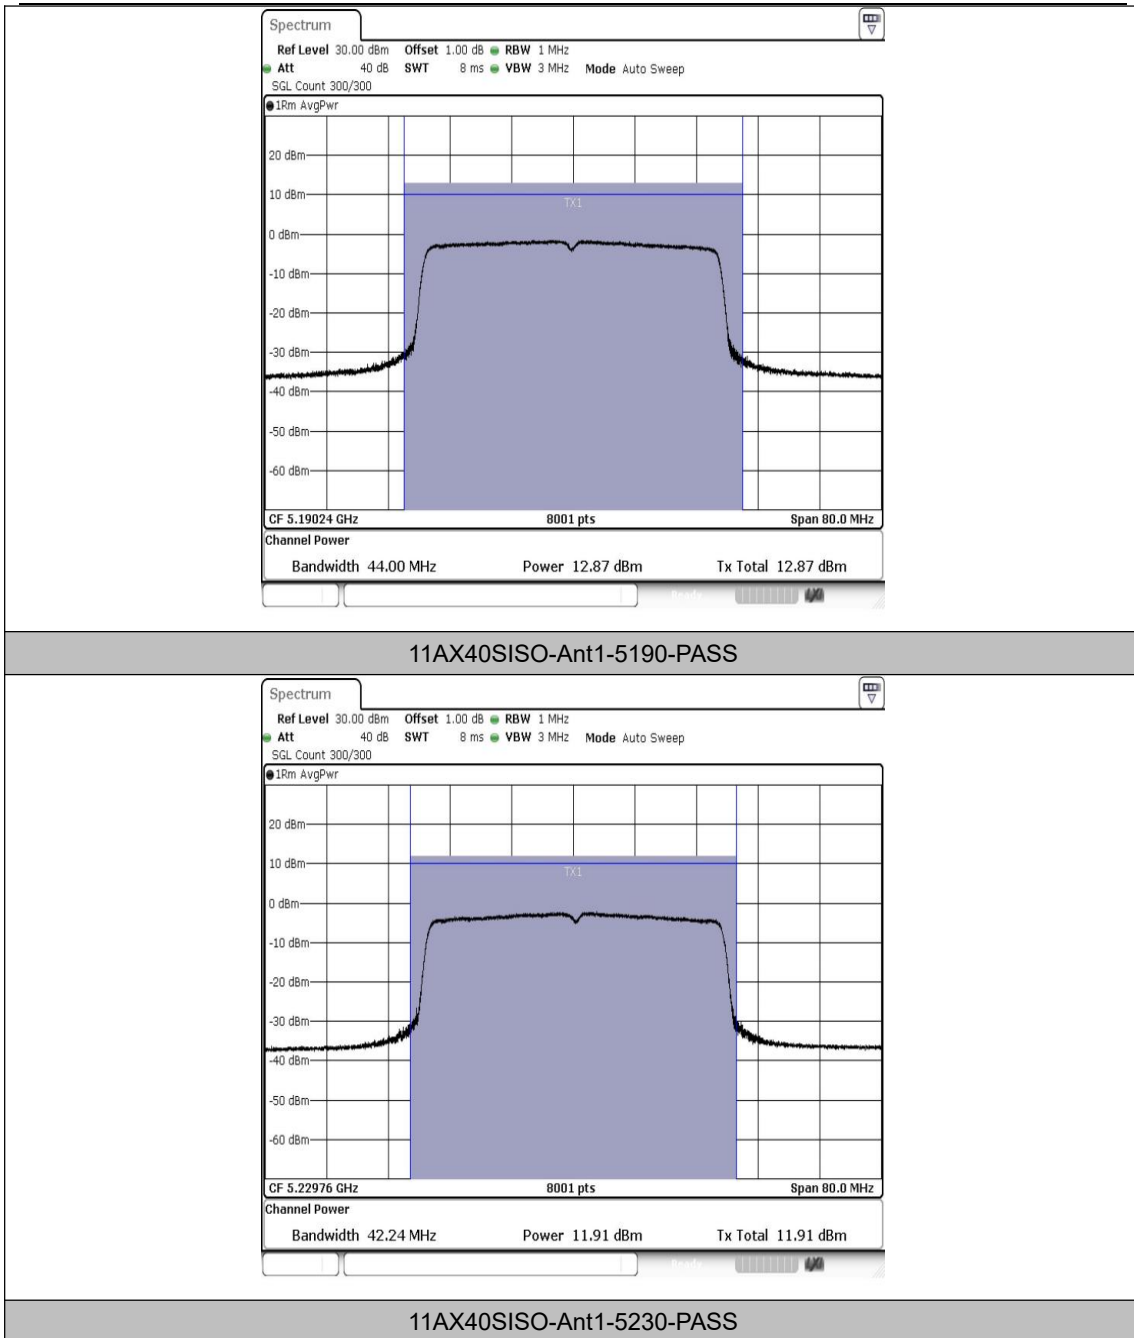

**Shenzhen Anbotech Compliance Laboratory Limited**

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,  
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: (86) 0755-26066440 Email: service@anbotech.com


Hotline  
400-003-0500  
www.anbotech.com

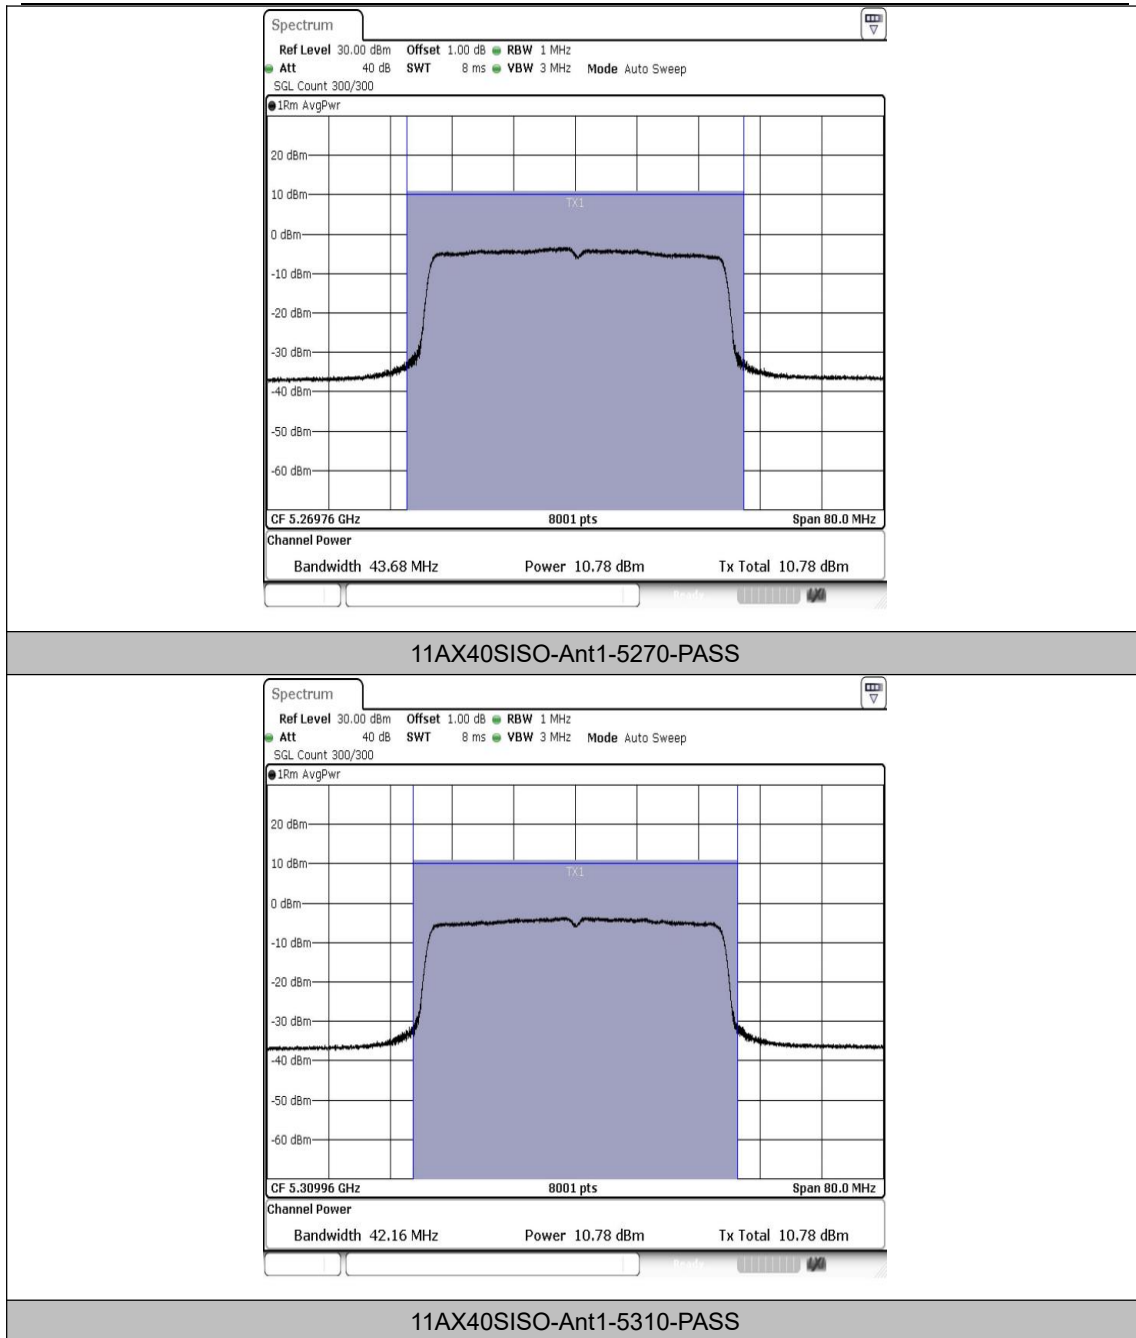

**Shenzhen Anbotech Compliance Laboratory Limited**

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,  
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel:(86)0755-26066440 Email:service@anbotech.com


 Hotline  
400-003-0500  
www.anbotech.com

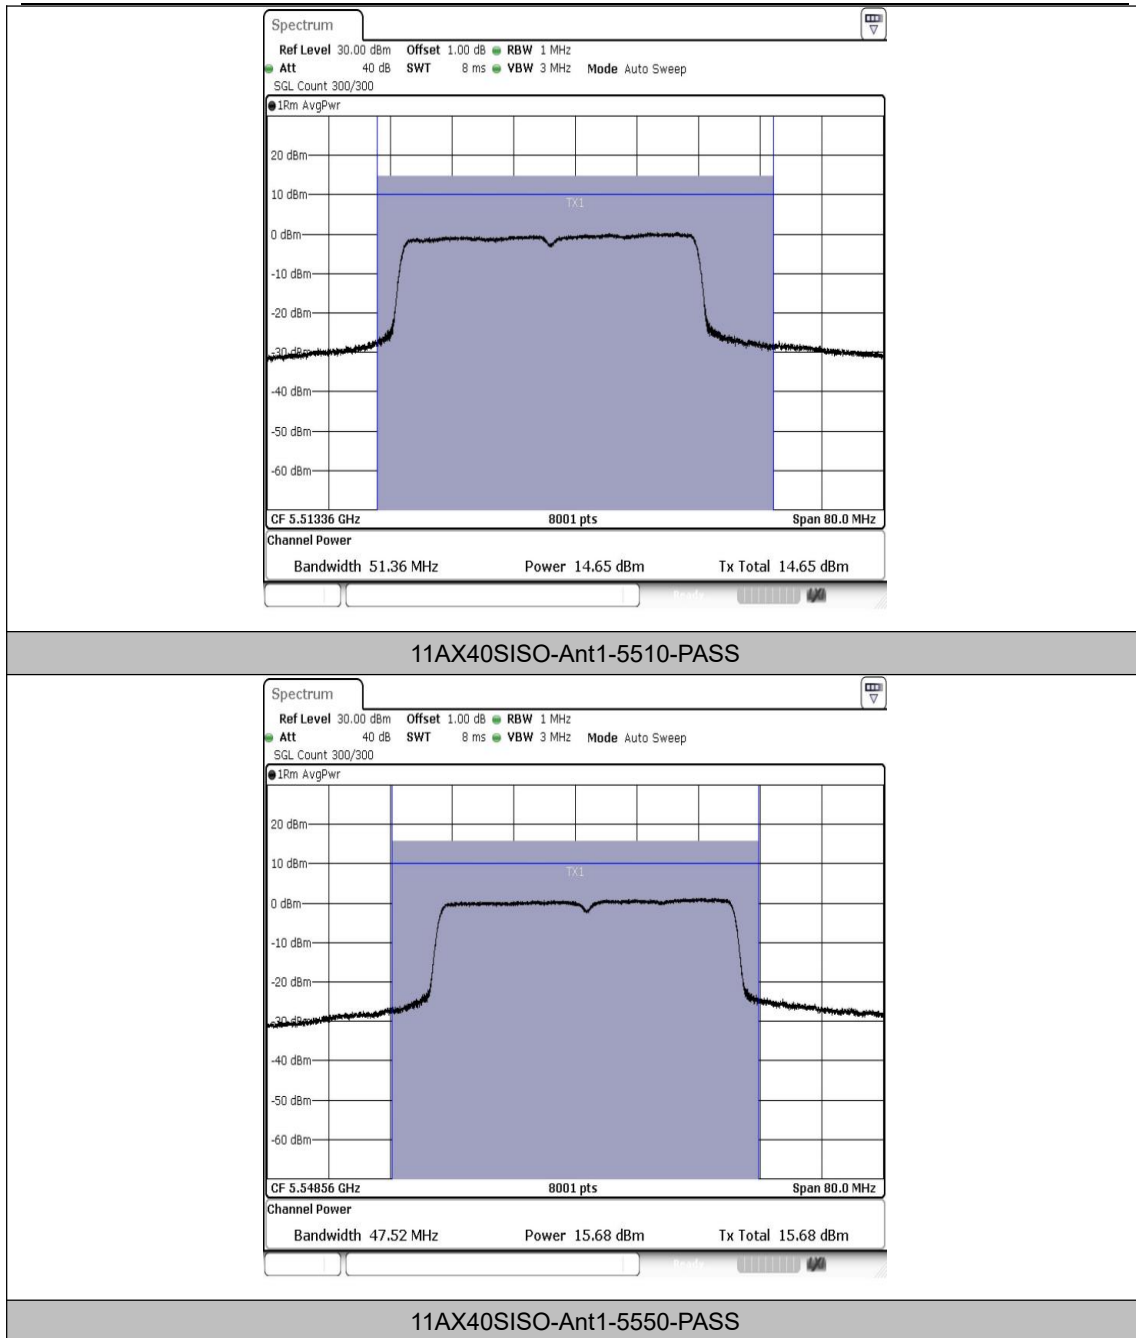


**Shenzhen Anbotek Compliance Laboratory Limited**

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,  
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: (86) 0755-26066440 Email: service@anbotek.com

 Hotline  
400-003-0500  
www.anbotek.com

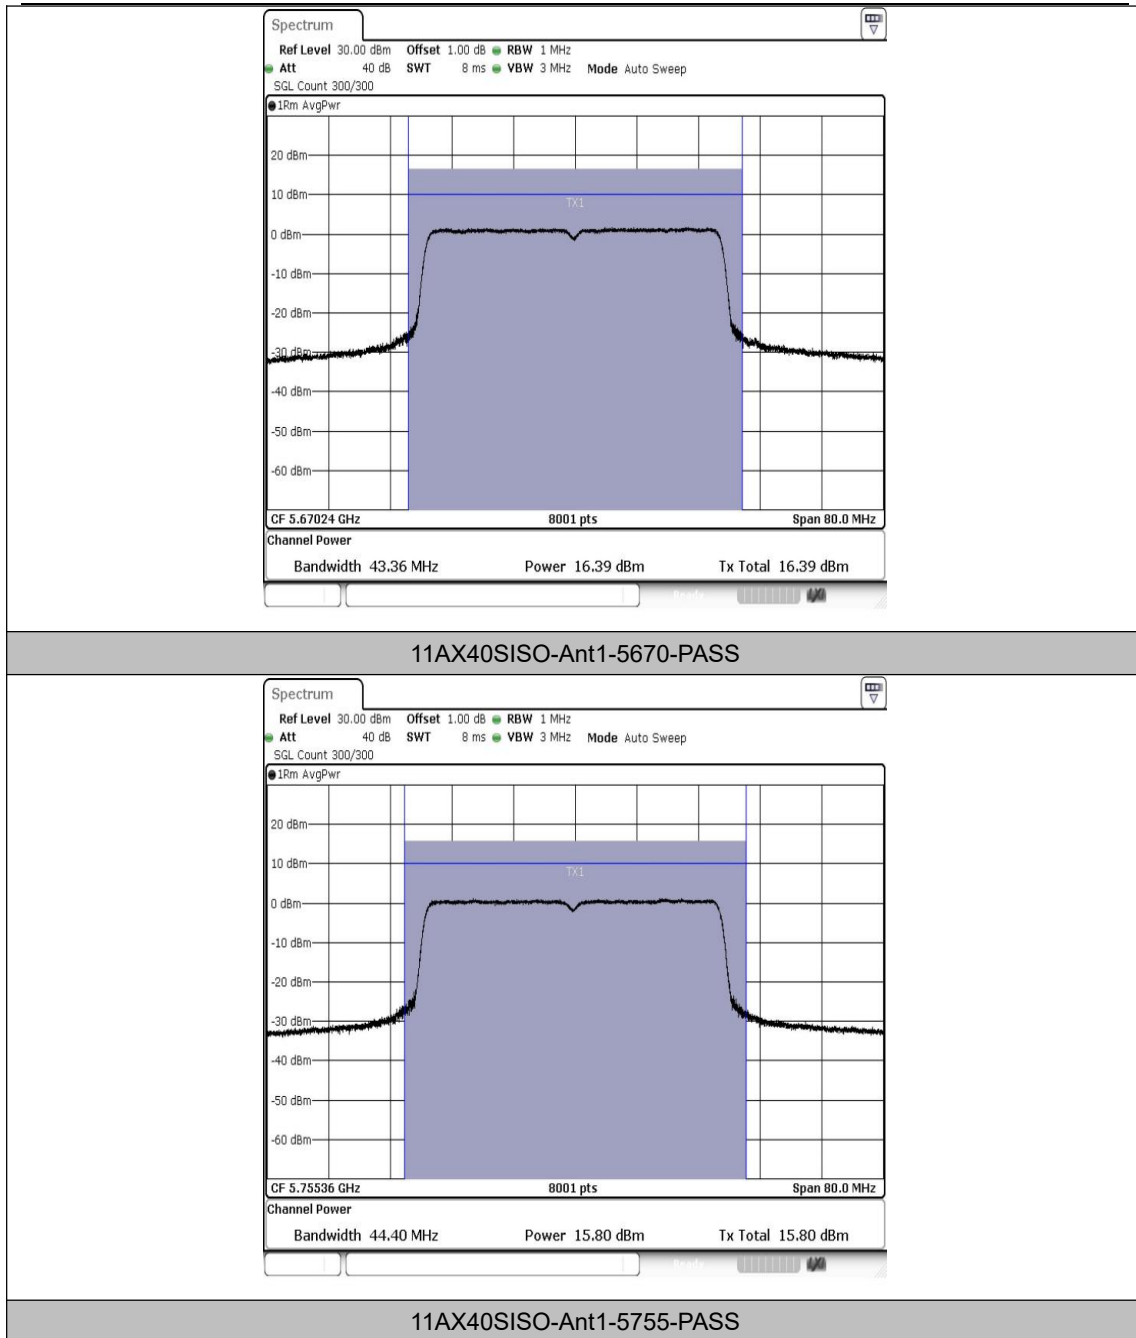


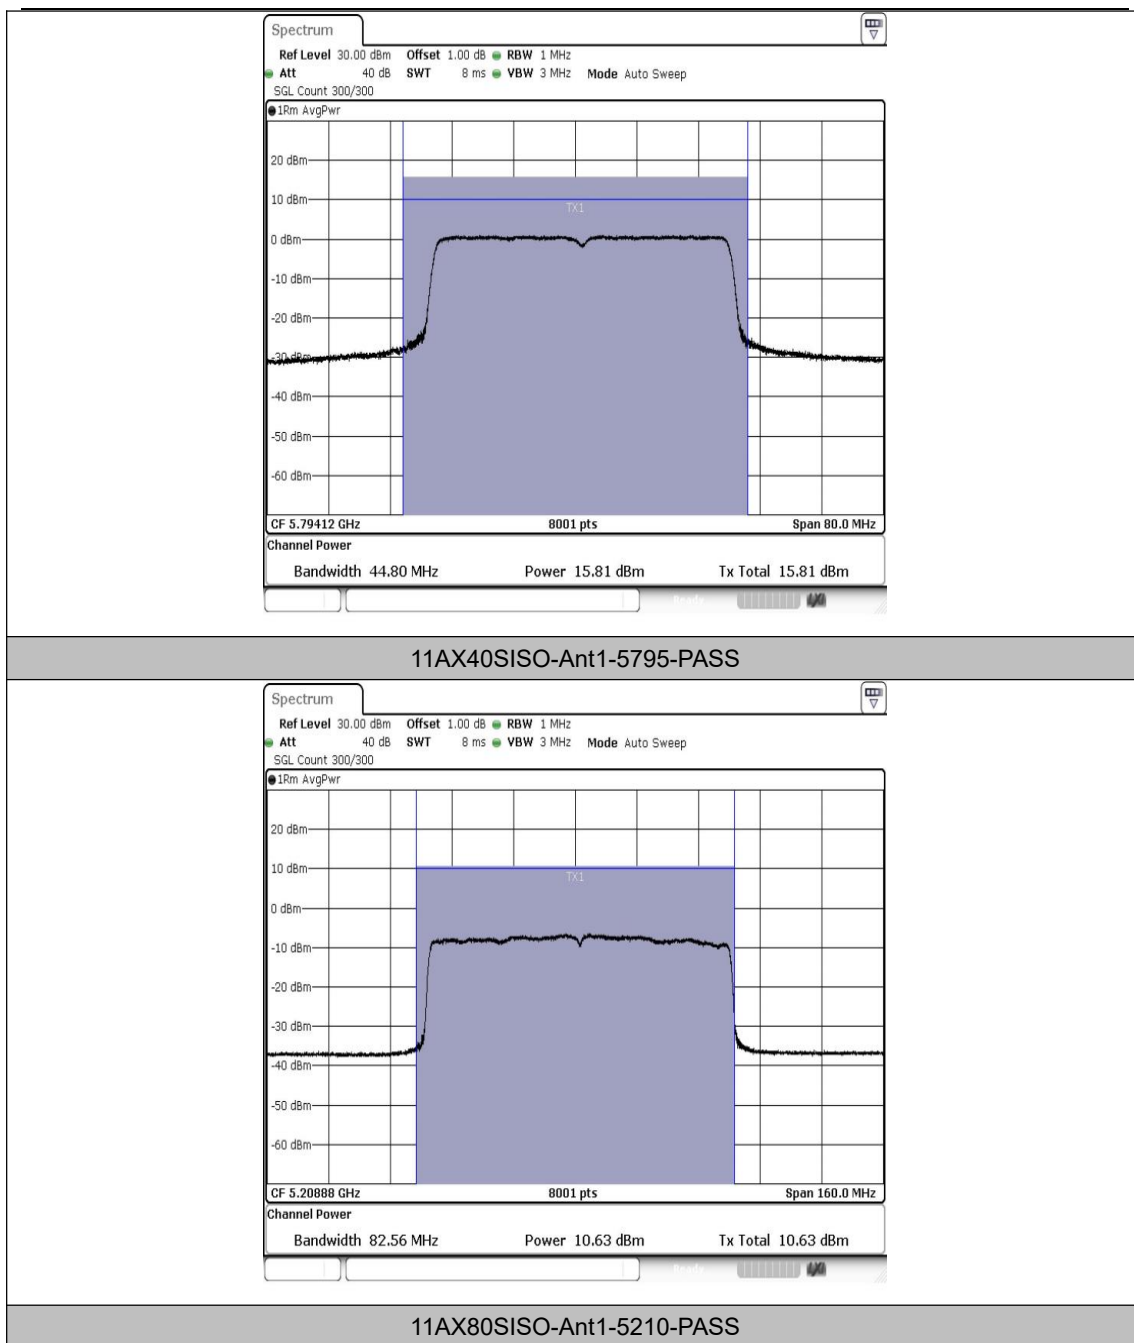

**Shenzhen Anbotek Compliance Laboratory Limited**

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline  
400-003-0500  
www.anbotek.com

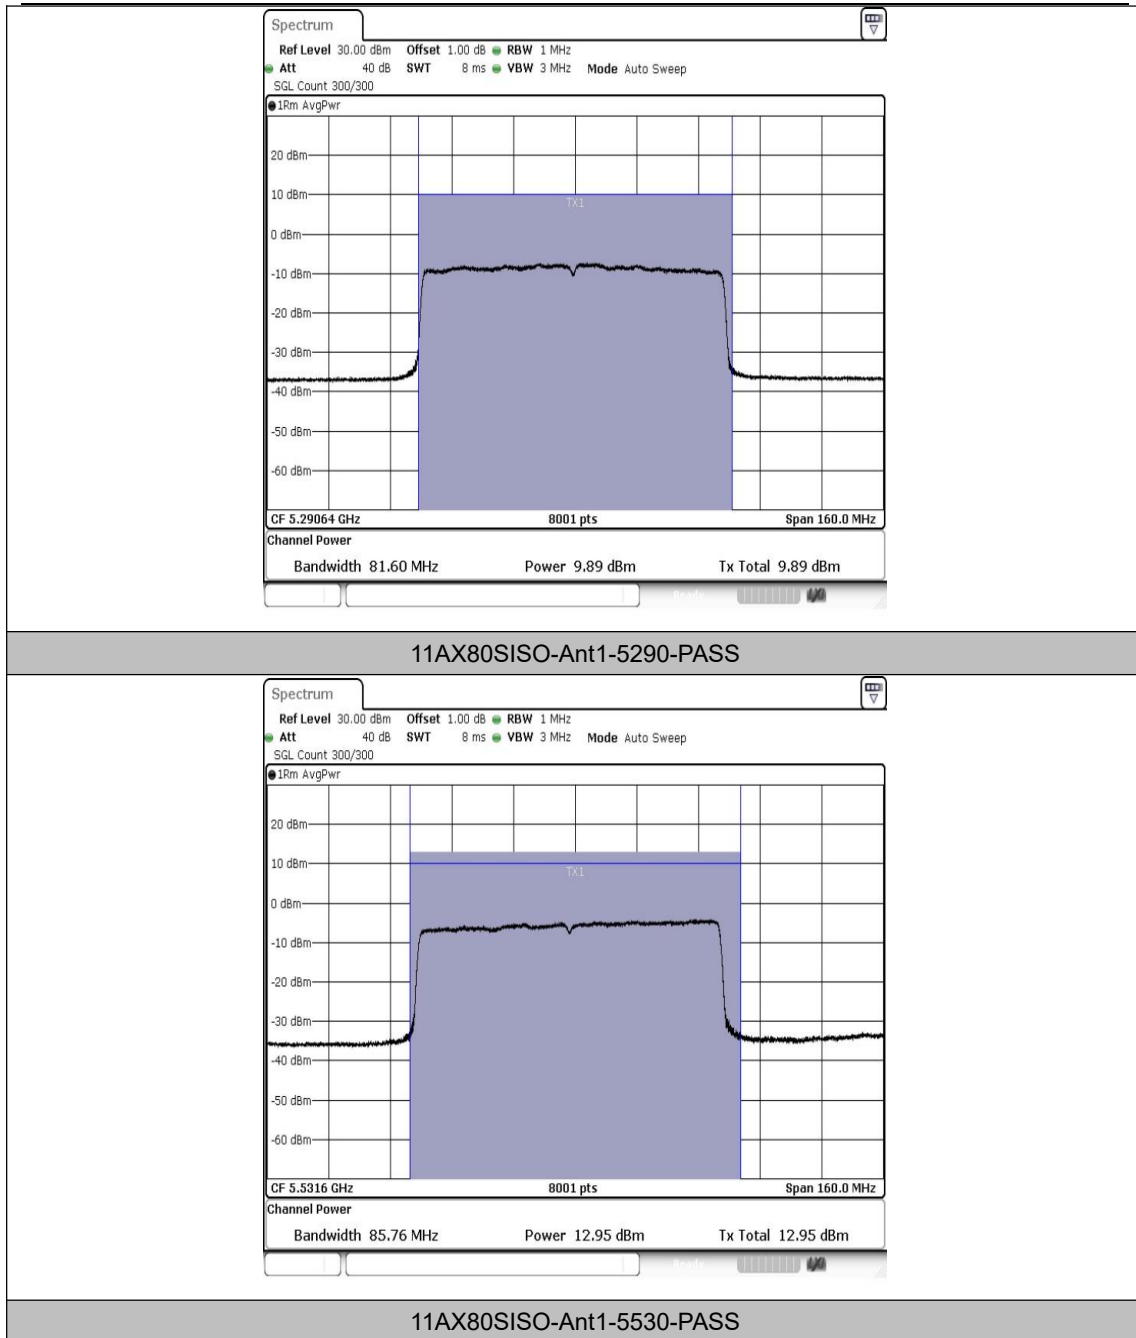

**Shenzhen Anbotech Compliance Laboratory Limited**

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,  
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: (86) 0755-26066440 Email: service@anbotech.com

 Hotline  
400-003-0500  
www.anbotech.com

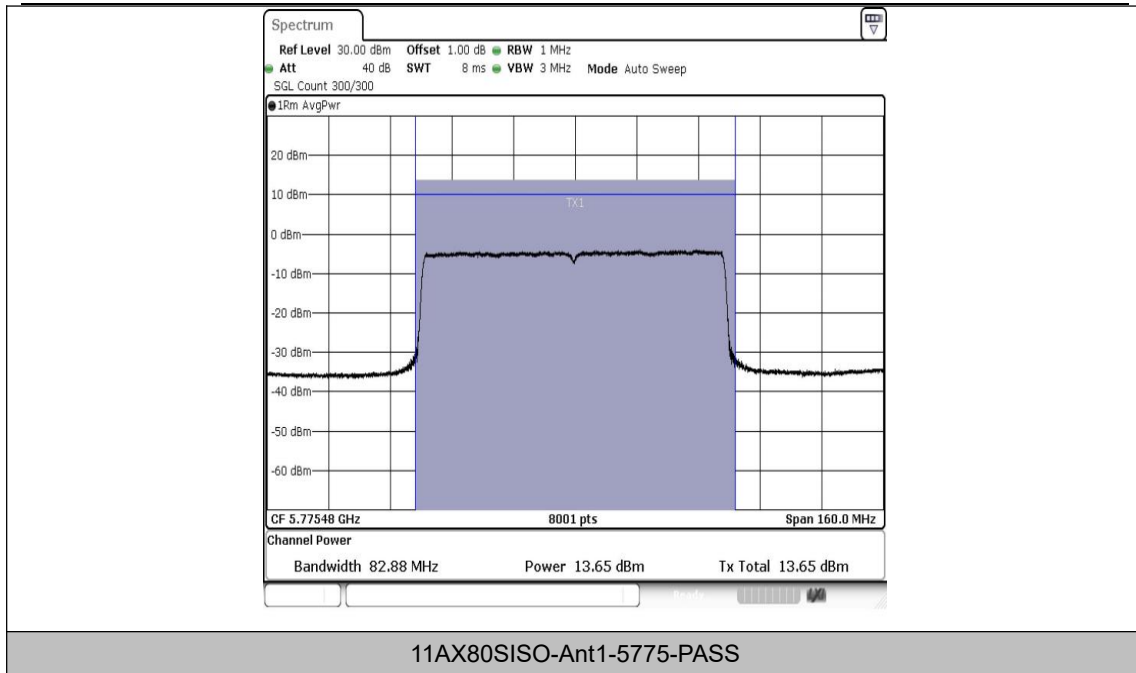

**Shenzhen Anbotek Compliance Laboratory Limited**

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,  
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: (86) 0755-26066440 Email: service@anbotek.com

 Hotline  
400-003-0500  
www.anbotek.com

## Appendix D: Maximum Power Spectral Density

### Test Result B1/2/3

| Test Mode  | Antenna | Frequency [MHz] | Reading Result [dBm/MHz] | DC Factor [dB] | Result [dBm/MHz] | Limit [dBm/MHz] | Verdict |
|------------|---------|-----------------|--------------------------|----------------|------------------|-----------------|---------|
| 11A        | Ant1    | 5180            | 2.1                      | 0.25           | 2.35             | ≤11.00          | PASS    |
| 11A        | Ant1    | 5200            | 2.61                     | 0.33           | 2.94             | ≤11.00          | PASS    |
| 11A        | Ant1    | 5240            | 2.66                     | 0.25           | 2.91             | ≤11.00          | PASS    |
| 11A        | Ant1    | 5260            | 1.83                     | 0.37           | 2.20             | ≤11.00          | PASS    |
| 11A        | Ant1    | 5280            | 0.44                     | 0.44           | 0.88             | ≤11.00          | PASS    |
| 11A        | Ant1    | 5320            | 0.86                     | 0.41           | 1.27             | ≤11.00          | PASS    |
| 11A        | Ant1    | 5500            | 4.34                     | 0.44           | 4.78             | ≤11.00          | PASS    |
| 11A        | Ant1    | 5580            | 4.62                     | 0.44           | 5.06             | ≤11.00          | PASS    |
| 11A        | Ant1    | 5700            | 6.06                     | 0.29           | 6.35             | ≤11.00          | PASS    |
| 11N20SISO  | Ant1    | 5180            | 1.95                     | 0.40           | 2.35             | ≤11.00          | PASS    |
| 11N20SISO  | Ant1    | 5200            | 2.18                     | 0.39           | 2.57             | ≤11.00          | PASS    |
| 11N20SISO  | Ant1    | 5240            | 1.94                     | 0.35           | 2.29             | ≤11.00          | PASS    |
| 11N20SISO  | Ant1    | 5260            | 1.02                     | 1.02           | 2.04             | ≤11.00          | PASS    |
| 11N20SISO  | Ant1    | 5280            | 0.07                     | 0.48           | 0.55             | ≤11.00          | PASS    |
| 11N20SISO  | Ant1    | 5320            | 0.47                     | 0.39           | 0.86             | ≤11.00          | PASS    |
| 11N20SISO  | Ant1    | 5500            | 3.63                     | 0.48           | 4.11             | ≤11.00          | PASS    |
| 11N20SISO  | Ant1    | 5580            | 4.3                      | 0.52           | 4.82             | ≤11.00          | PASS    |
| 11N20SISO  | Ant1    | 5700            | 5.88                     | 0.52           | 6.40             | ≤11.00          | PASS    |
| 11N40SISO  | Ant1    | 5190            | -0.83                    | 1.20           | 0.37             | ≤11.00          | PASS    |
| 11N40SISO  | Ant1    | 5230            | -1.44                    | 0.68           | -0.76            | ≤11.00          | PASS    |
| 11N40SISO  | Ant1    | 5270            | -2.61                    | 1.01           | -1.60            | ≤11.00          | PASS    |
| 11N40SISO  | Ant1    | 5310            | -2.51                    | 0.93           | -1.58            | ≤11.00          | PASS    |
| 11N40SISO  | Ant1    | 5510            | 0.77                     | 1.01           | 1.78             | ≤11.00          | PASS    |
| 11N40SISO  | Ant1    | 5550            | 2.3                      | 1.88           | 4.18             | ≤11.00          | PASS    |
| 11N40SISO  | Ant1    | 5670            | 2.54                     | 0.99           | 3.53             | ≤11.00          | PASS    |
| 11AC20SISO | Ant1    | 5180            | 2.12                     | 0.39           | 2.51             | ≤11.00          | PASS    |
| 11AC20SISO | Ant1    | 5200            | 1.87                     | 0.39           | 2.26             | ≤11.00          | PASS    |
| 11AC20SISO | Ant1    | 5240            | 0.55                     | 0.39           | 0.94             | ≤11.00          | PASS    |
| 11AC20SISO | Ant1    | 5260            | 0.59                     | 0.31           | 0.90             | ≤11.00          | PASS    |
| 11AC20SISO | Ant1    | 5280            | -0.4                     | 0.43           | 0.03             | ≤11.00          | PASS    |
| 11AC20SISO | Ant1    | 5320            | 0.16                     | 0.48           | 0.64             | ≤11.00          | PASS    |
| 11AC20SISO | Ant1    | 5500            | 2.88                     | 0.52           | 3.40             | ≤11.00          | PASS    |
| 11AC20SISO | Ant1    | 5580            | 3.82                     | 0.48           | 4.30             | ≤11.00          | PASS    |
| 11AC20SISO | Ant1    | 5700            | 4.94                     | 0.52           | 5.46             | ≤11.00          | PASS    |
| 11AC40SISO | Ant1    | 5190            | -2.32                    | 1.60           | -0.72            | ≤11.00          | PASS    |
| 11AC40SISO | Ant1    | 5230            | -1.94                    | 0.99           | -0.95            | ≤11.00          | PASS    |

#### Shenzhen Anbotech Compliance Laboratory Limited



|            |      |      |       |      |       |        |      |
|------------|------|------|-------|------|-------|--------|------|
| 11AC40SISO | Ant1 | 5270 | -3.23 | 0.99 | -2.24 | ≤11.00 | PASS |
| 11AC40SISO | Ant1 | 5310 | -3.15 | 1.88 | -1.27 | ≤11.00 | PASS |
| 11AC40SISO | Ant1 | 5510 | 0.44  | 0.99 | 1.43  | ≤11.00 | PASS |
| 11AC40SISO | Ant1 | 5550 | 1     | 1.01 | 2.01  | ≤11.00 | PASS |
| 11AC40SISO | Ant1 | 5670 | 2.19  | 1.01 | 3.20  | ≤11.00 | PASS |
| 11AC80SISO | Ant1 | 5210 | -5.64 | 3.11 | -2.53 | ≤11.00 | PASS |
| 11AC80SISO | Ant1 | 5290 | -6.71 | 1.82 | -4.89 | ≤11.00 | PASS |
| 11AC80SISO | Ant1 | 5530 | -3.56 | 3.20 | -0.36 | ≤11.00 | PASS |
| 11AX20SISO | Ant1 | 5180 | 1.16  | 0.66 | 1.82  | ≤11.00 | PASS |
| 11AX20SISO | Ant1 | 5200 | 1.31  | 0.45 | 1.76  | ≤11.00 | PASS |
| 11AX20SISO | Ant1 | 5240 | 1.45  | 0.45 | 1.90  | ≤11.00 | PASS |
| 11AX20SISO | Ant1 | 5260 | 0     | 0.66 | 0.66  | ≤11.00 | PASS |
| 11AX20SISO | Ant1 | 5280 | -0.64 | 0.66 | 0.02  | ≤11.00 | PASS |
| 11AX20SISO | Ant1 | 5320 | -0.54 | 0.45 | -0.09 | ≤11.00 | PASS |
| 11AX20SISO | Ant1 | 5500 | 2.64  | 0.61 | 3.25  | ≤11.00 | PASS |
| 11AX20SISO | Ant1 | 5580 | 3.41  | 0.56 | 3.97  | ≤11.00 | PASS |
| 11AX20SISO | Ant1 | 5700 | 4.83  | 0.51 | 5.34  | ≤11.00 | PASS |
| 11AX40SISO | Ant1 | 5190 | -1.27 | 0.92 | -0.35 | ≤11.00 | PASS |
| 11AX40SISO | Ant1 | 5230 | -2.2  | 0.92 | -1.28 | ≤11.00 | PASS |
| 11AX40SISO | Ant1 | 5270 | -3.23 | 1.10 | -2.13 | ≤11.00 | PASS |
| 11AX40SISO | Ant1 | 5310 | -3.54 | 0.92 | -2.62 | ≤11.00 | PASS |
| 11AX40SISO | Ant1 | 5510 | 0.43  | 1.19 | 1.62  | ≤11.00 | PASS |
| 11AX40SISO | Ant1 | 5550 | 1.59  | 1.10 | 2.69  | ≤11.00 | PASS |
| 11AX40SISO | Ant1 | 5670 | 1.53  | 1.19 | 2.72  | ≤11.00 | PASS |
| 11AX80SISO | Ant1 | 5210 | -5.94 | 1.90 | -4.04 | ≤11.00 | PASS |
| 11AX80SISO | Ant1 | 5290 | -6.43 | 2.04 | -4.39 | ≤11.00 | PASS |
| 11AX80SISO | Ant1 | 5530 | -5.01 | 2.13 | -2.88 | ≤11.00 | PASS |

Note: 1.The Duty Cycle Factor and cable loss and RBW Factor are compensated in the graph.

## Test Result B4

| Test Mode | Antenna | Frequency [MHz] | Reading Result [dBm/500 KHz] | DC Factor [dB] | Result [dBm/500 KHz] | Limit [dBm/500 KHz] | Verdict |
|-----------|---------|-----------------|------------------------------|----------------|----------------------|---------------------|---------|
| 11A       | Ant1    | 5745            | 2.72                         | 0.63           | 3.35                 | ≤30.00              | PASS    |
| 11A       | Ant1    | 5785            | 2.07                         | 0.48           | 2.55                 | ≤30.00              | PASS    |
| 11A       | Ant1    | 5825            | 1.85                         | 0.49           | 2.34                 | ≤30.00              | PASS    |
| 11N20SISO | Ant1    | 5745            | 2.16                         | 0.48           | 2.64                 | ≤30.00              | PASS    |
| 11N20SISO | Ant1    | 5785            | 2.06                         | 0.39           | 2.45                 | ≤30.00              | PASS    |
| 11N20SISO | Ant1    | 5825            | 1.83                         | 0.44           | 2.27                 | ≤30.00              | PASS    |
| 11N40SISO | Ant1    | 5755            | -0.83                        | 0.76           | -0.07                | ≤30.00              | PASS    |

### Shenzhen Anbotech Compliance Laboratory Limited




|            |      |      |       |      |       |        |      |
|------------|------|------|-------|------|-------|--------|------|
| 11N40SISO  | Ant1 | 5795 | -1.26 | 1.01 | -0.25 | ≤30.00 | PASS |
| 11AC20SISO | Ant1 | 5745 | 1.87  | 0.48 | 2.35  | ≤30.00 | PASS |
| 11AC20SISO | Ant1 | 5785 | 2.3   | 0.35 | 2.65  | ≤30.00 | PASS |
| 11AC20SISO | Ant1 | 5825 | 1.33  | 0.31 | 1.64  | ≤30.00 | PASS |
| 11AC40SISO | Ant1 | 5755 | -1.65 | 0.76 | -0.89 | ≤30.00 | PASS |
| 11AC40SISO | Ant1 | 5795 | -1.63 | 0.91 | -0.72 | ≤30.00 | PASS |
| 11AC80SISO | Ant1 | 5775 | -6.42 | 1.82 | -4.60 | ≤30.00 | PASS |
| 11AX20SISO | Ant1 | 5745 | 1.66  | 0.45 | 2.11  | ≤30.00 | PASS |
| 11AX20SISO | Ant1 | 5785 | 1.5   | 0.51 | 2.01  | ≤30.00 | PASS |
| 11AX20SISO | Ant1 | 5825 | 1.25  | 0.66 | 1.91  | ≤30.00 | PASS |
| 11AX40SISO | Ant1 | 5755 | -1.52 | 1.19 | -0.33 | ≤30.00 | PASS |
| 11AX40SISO | Ant1 | 5795 | -1.85 | 1.25 | -0.60 | ≤30.00 | PASS |
| 11AX80SISO | Ant1 | 5775 | -6.75 | 1.97 | -4.78 | ≤30.00 | PASS |

Note: 1.The Duty Cycle Factor and cable loss and RBW Factor are compensated in the graph.



## Test Graphs B1/2/3

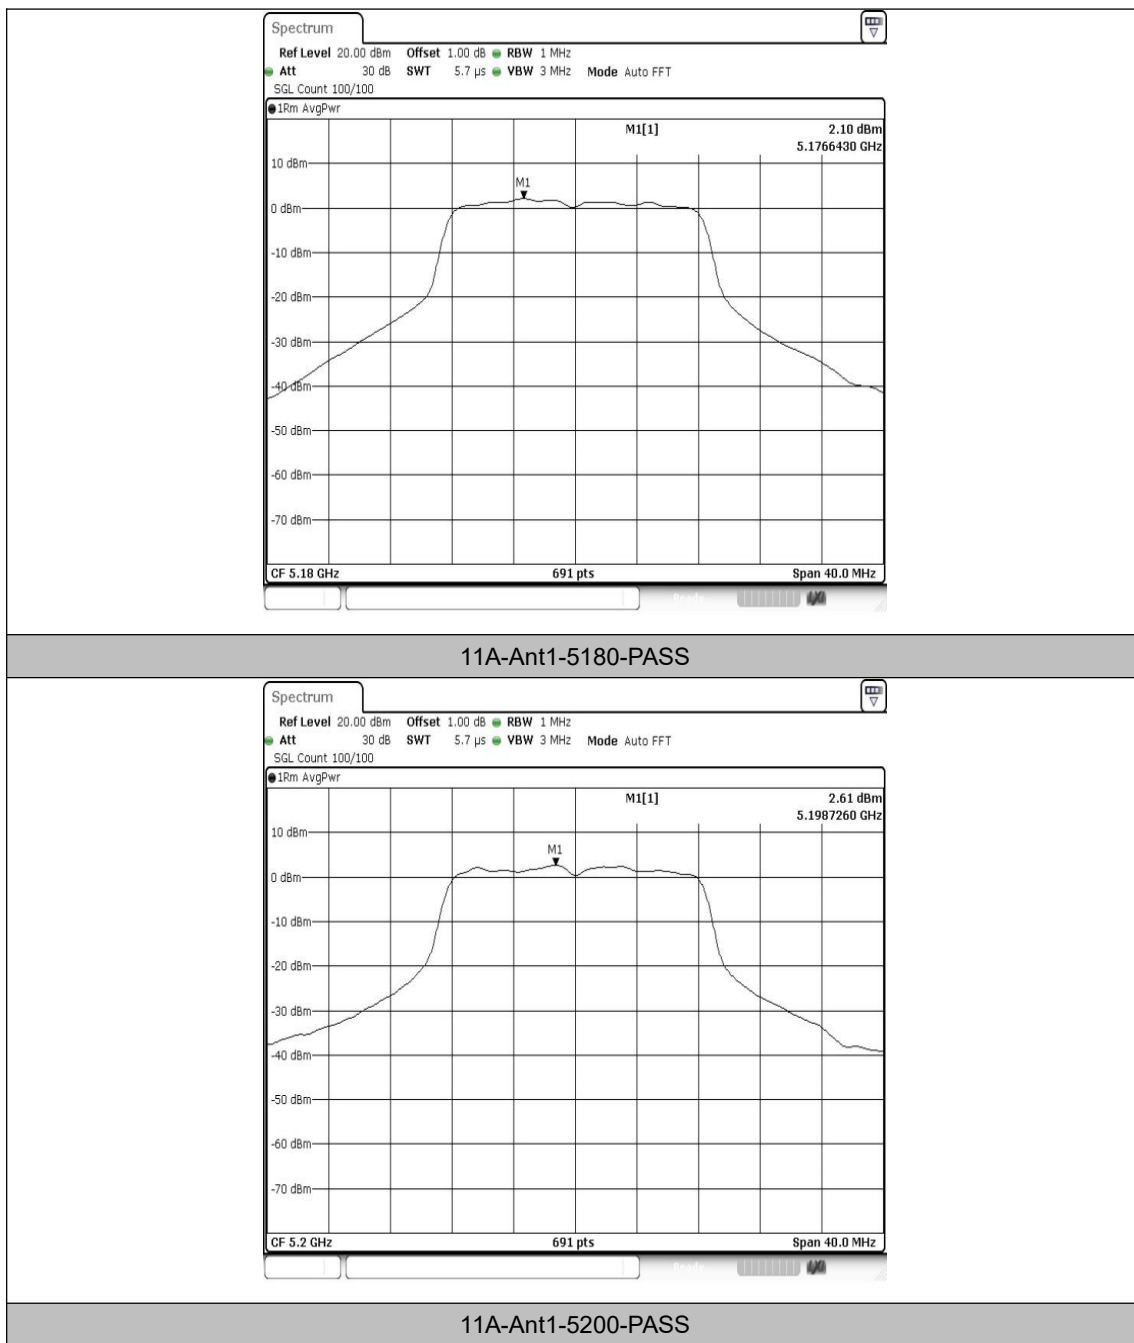


## Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,  
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: (86) 0755-26066440 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com

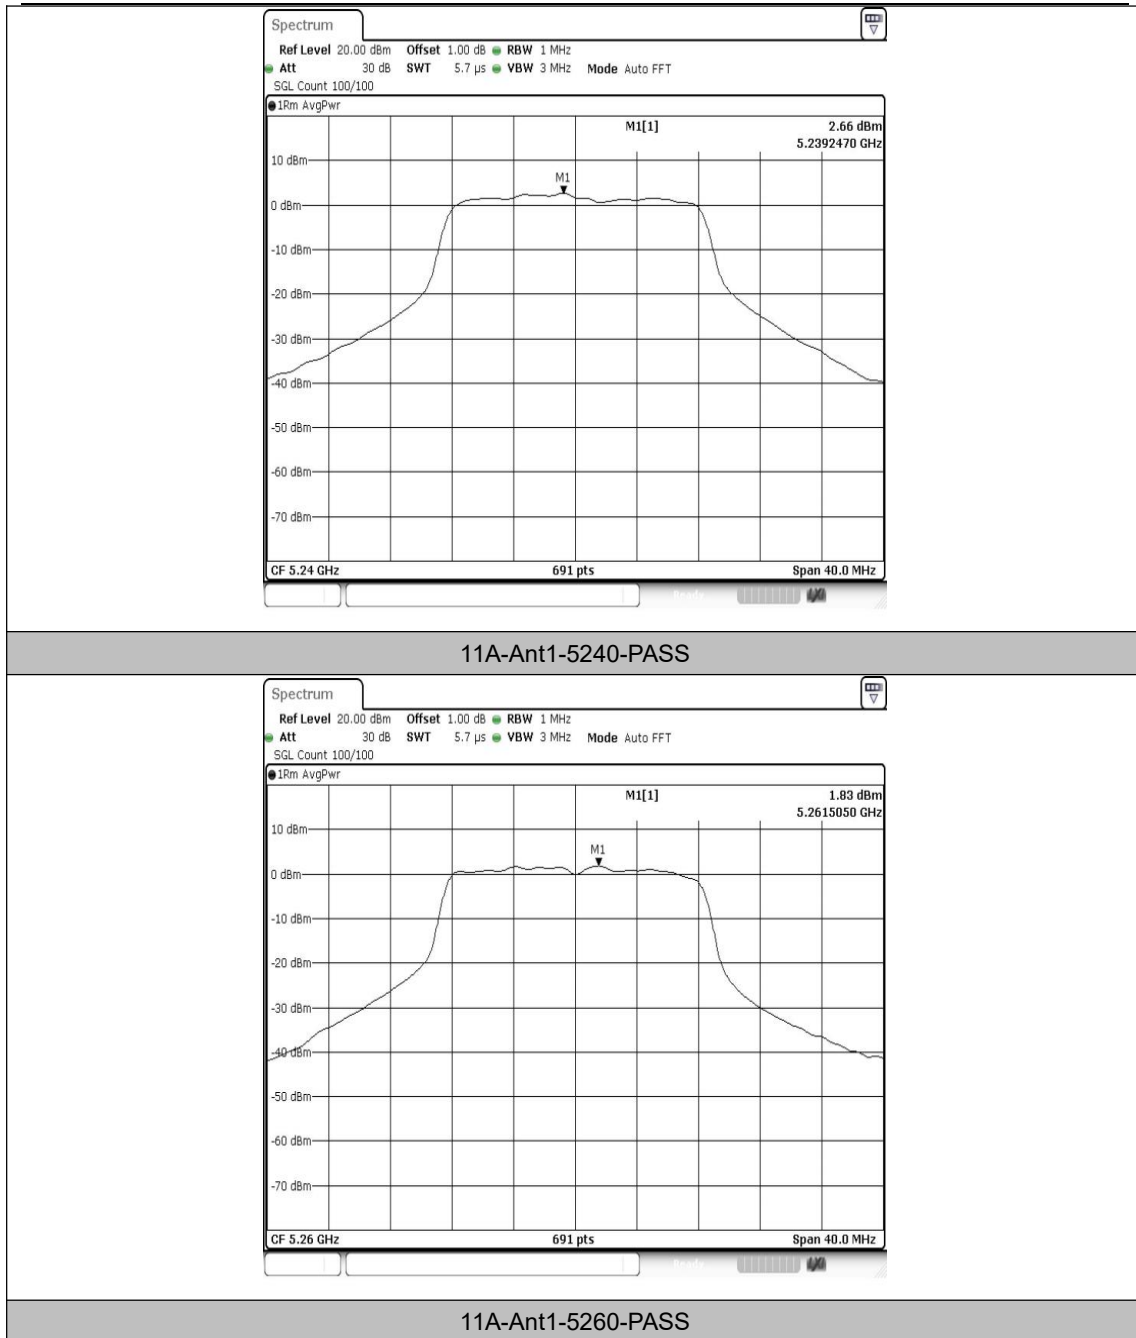

**Shenzhen Anbotek Compliance Laboratory Limited**

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,  
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline  
400-003-0500  
www.anbotek.com

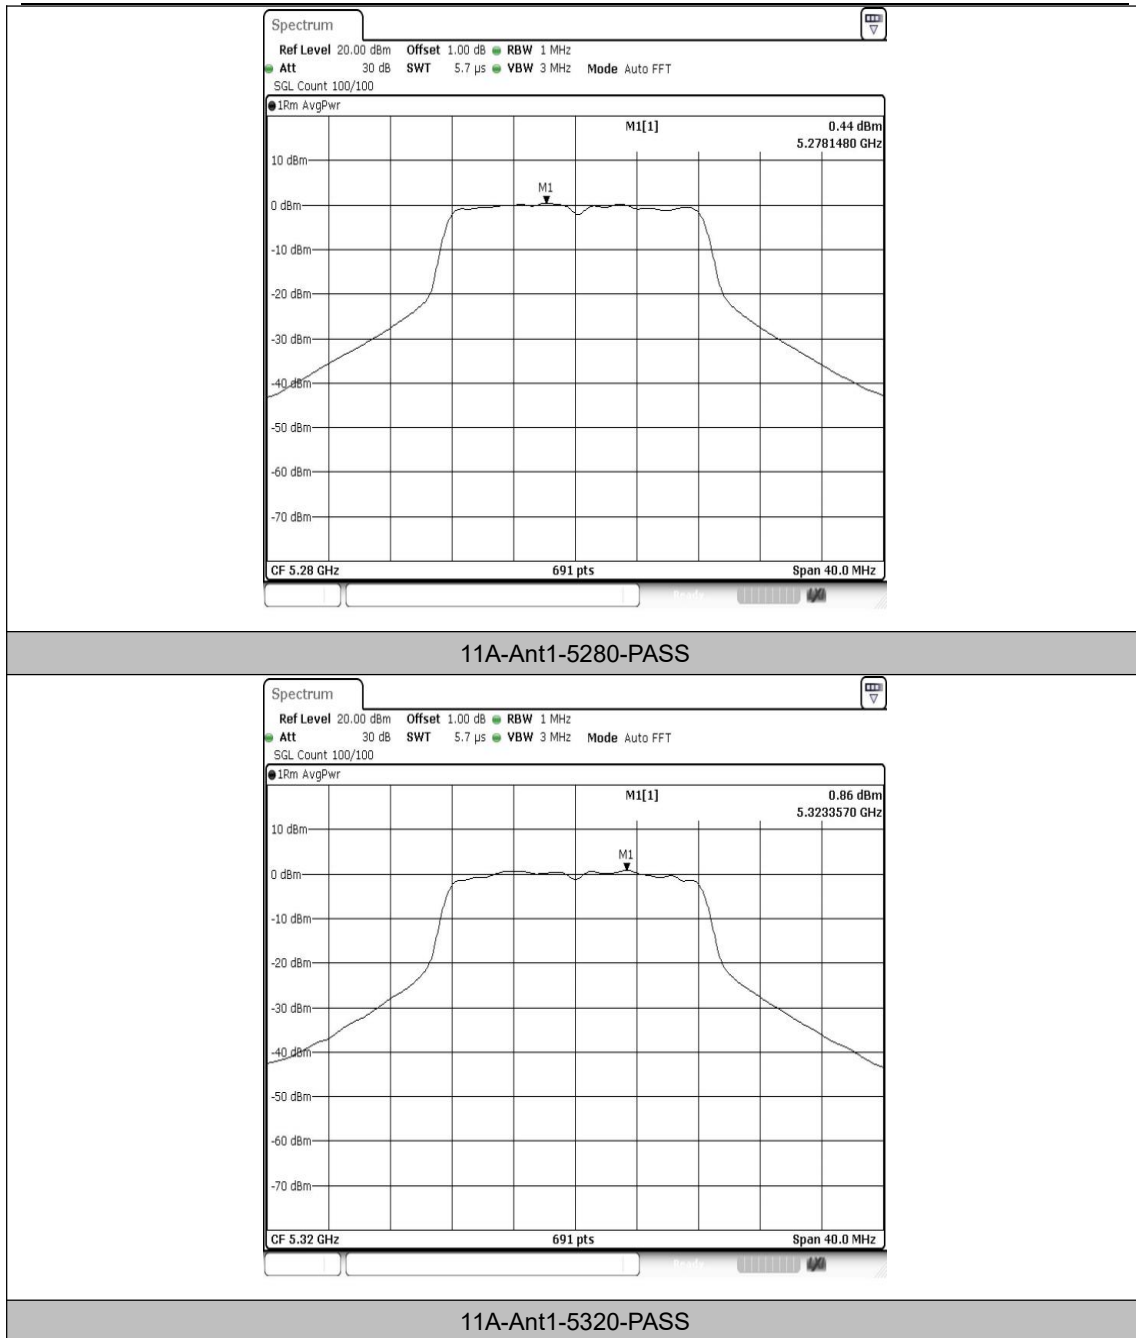



**Shenzhen Anbotek Compliance Laboratory Limited**

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,  
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel:(86)0755-26066440 Email:service@anbotek.com

Hotline  
400-003-0500  
www.anbotek.com

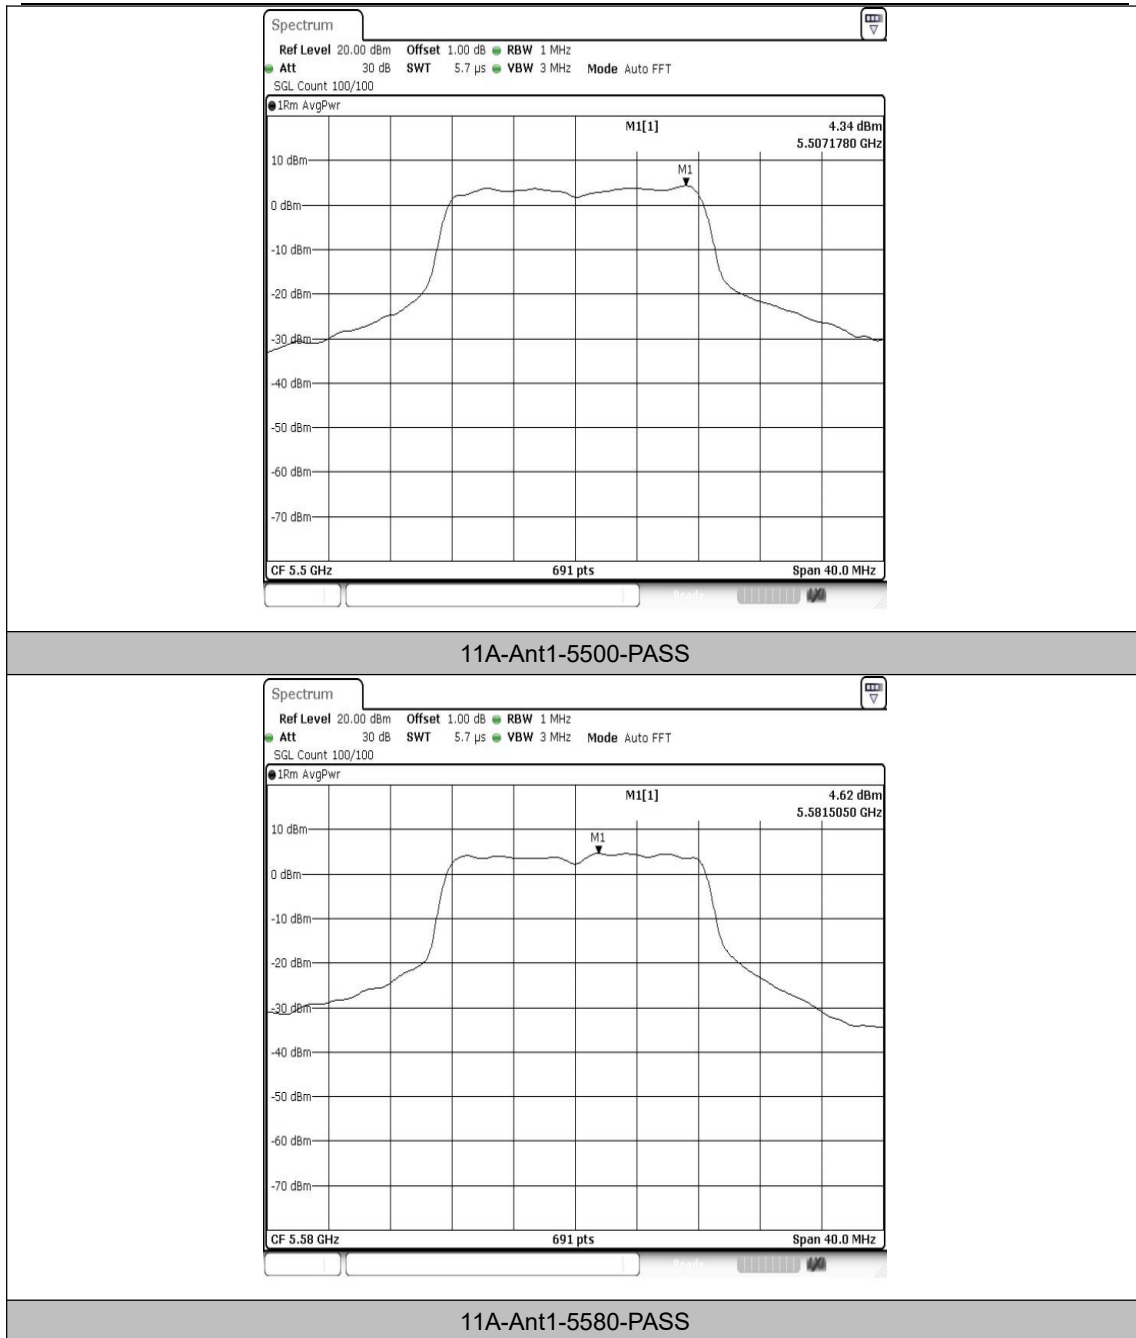

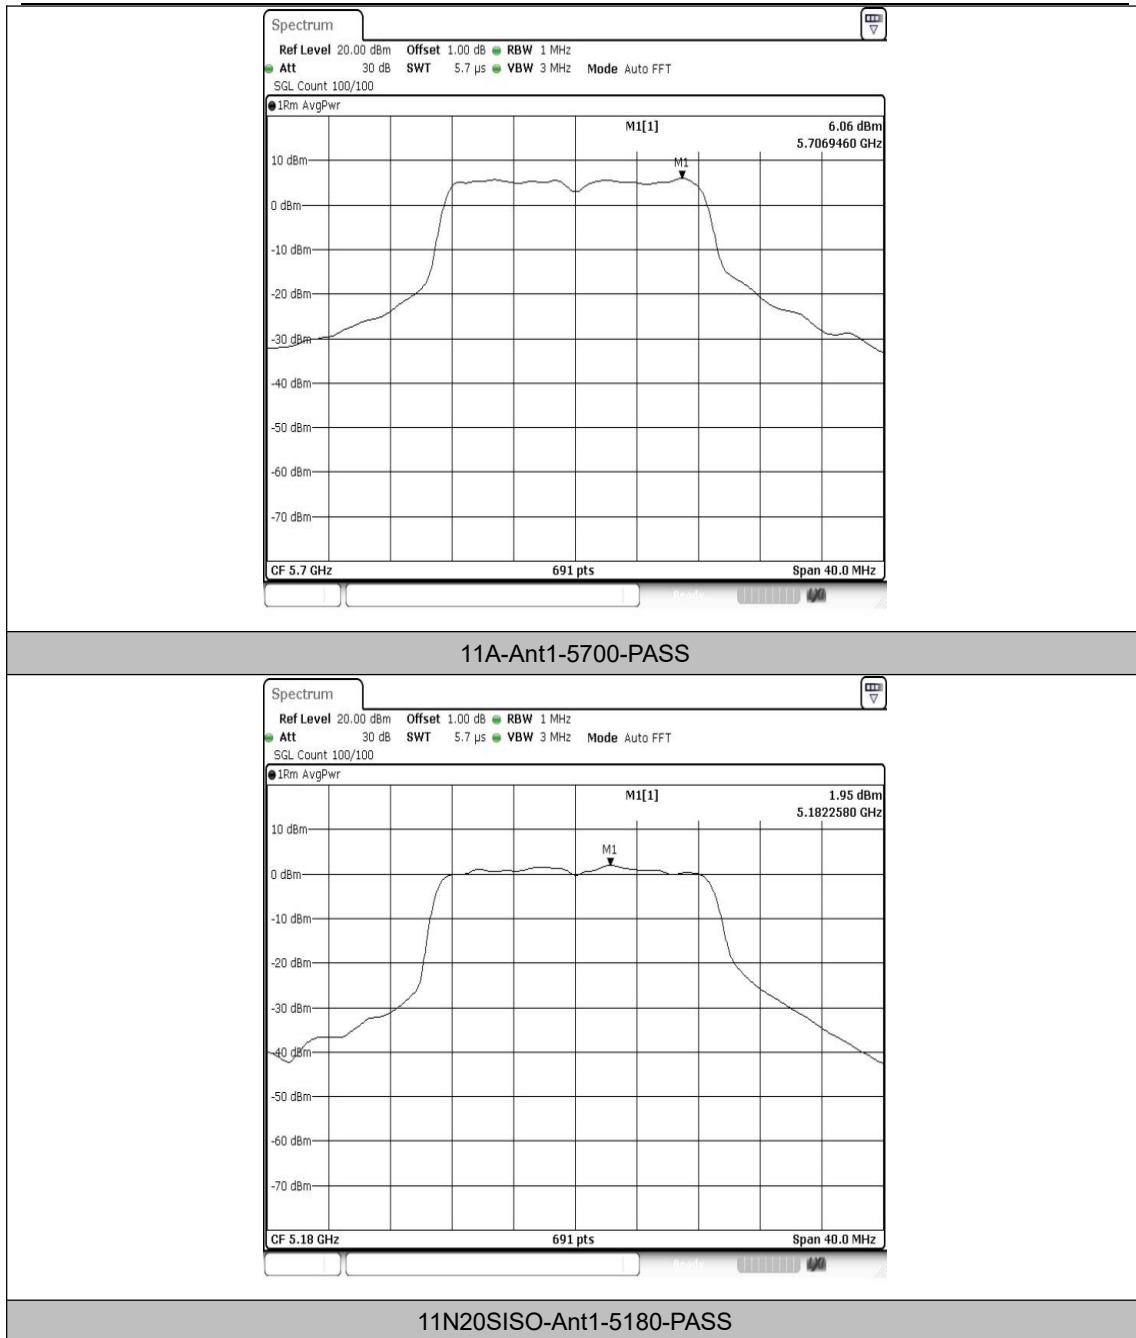


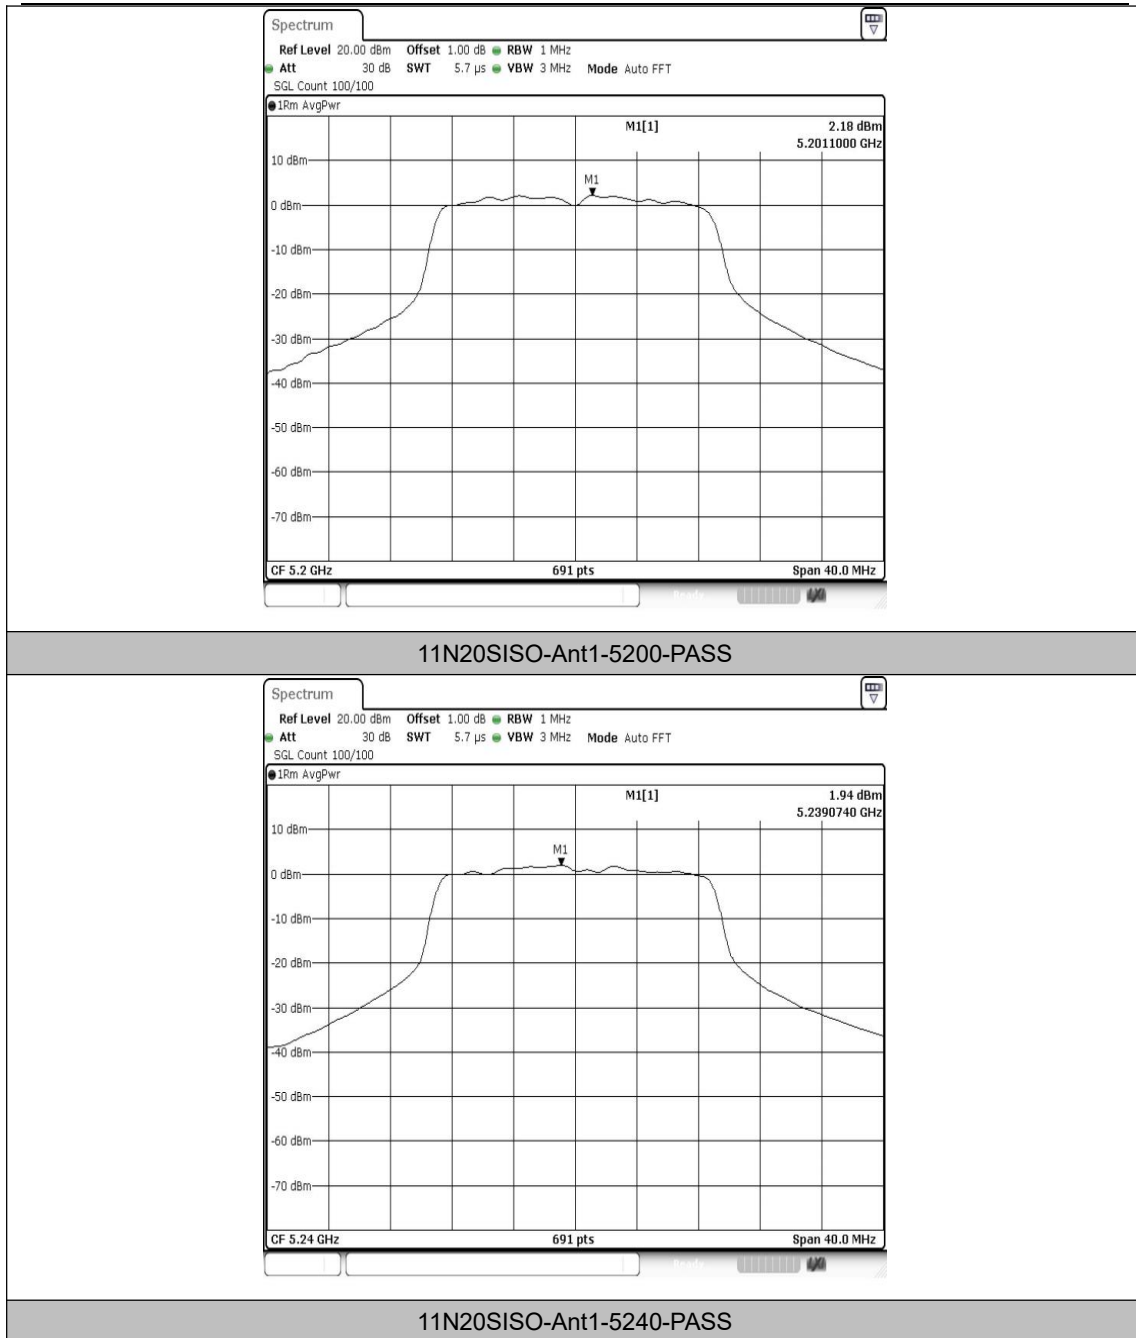

**Shenzhen Anbotek Compliance Laboratory Limited**

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,  
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel:(86)0755-26066440 Email:service@anbotek.com


Hotline  
400-003-0500  
www.anbotek.com

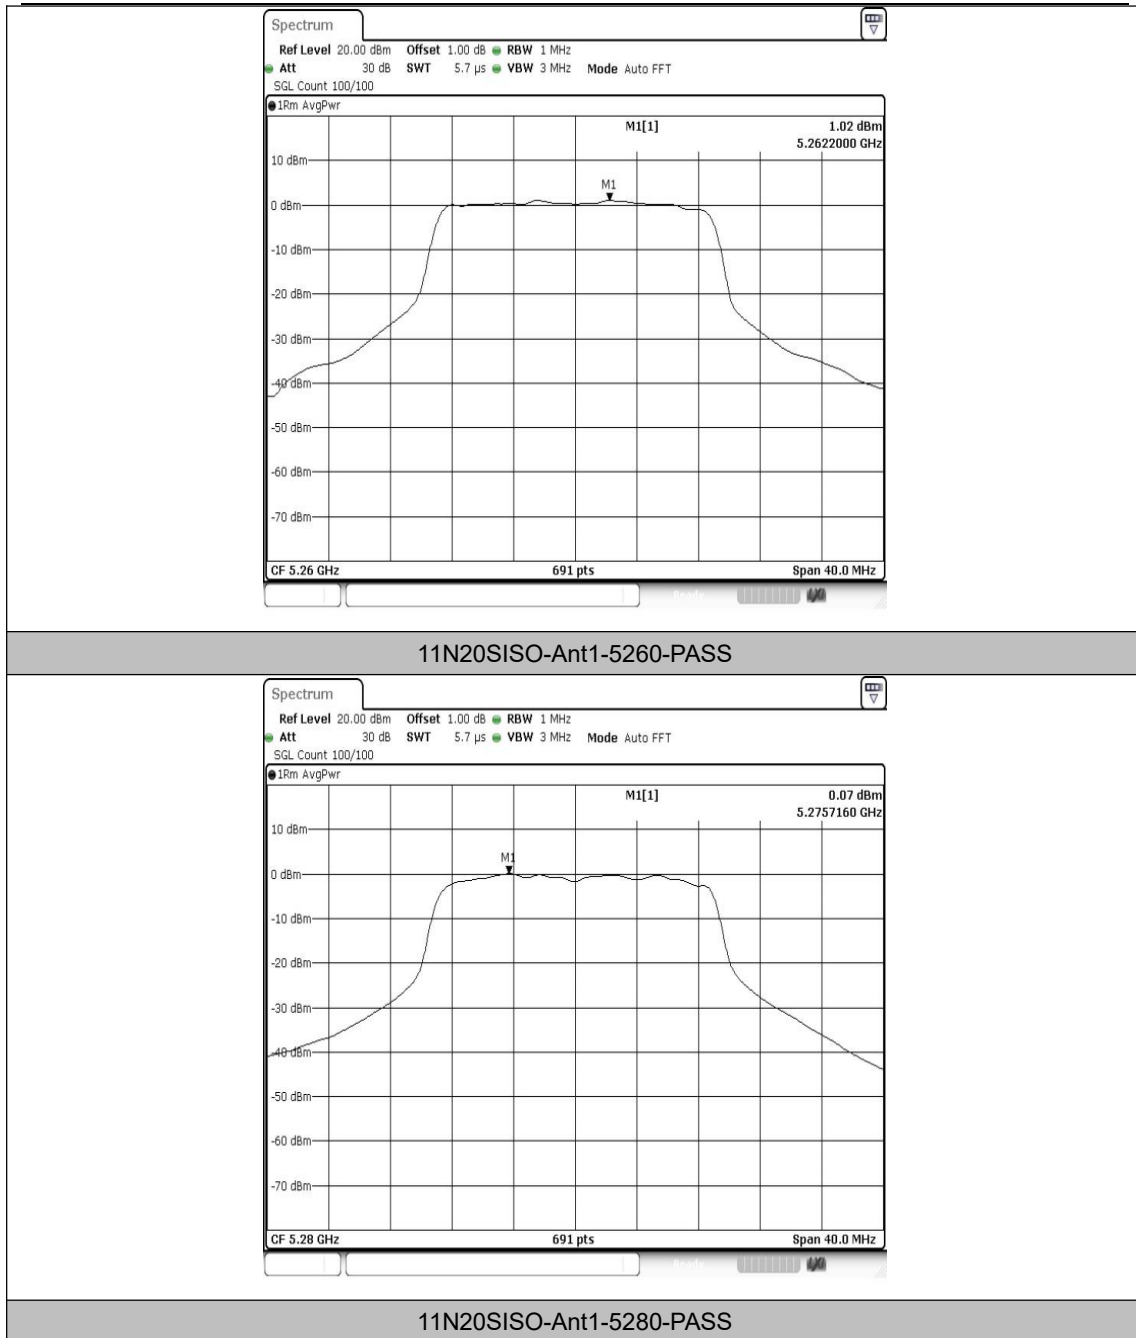


**Shenzhen Anbotek Compliance Laboratory Limited**

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,  
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel:(86)0755-26066440 Email:service@anbotek.com

Hotline  
400-003-0500  
www.anbotek.com

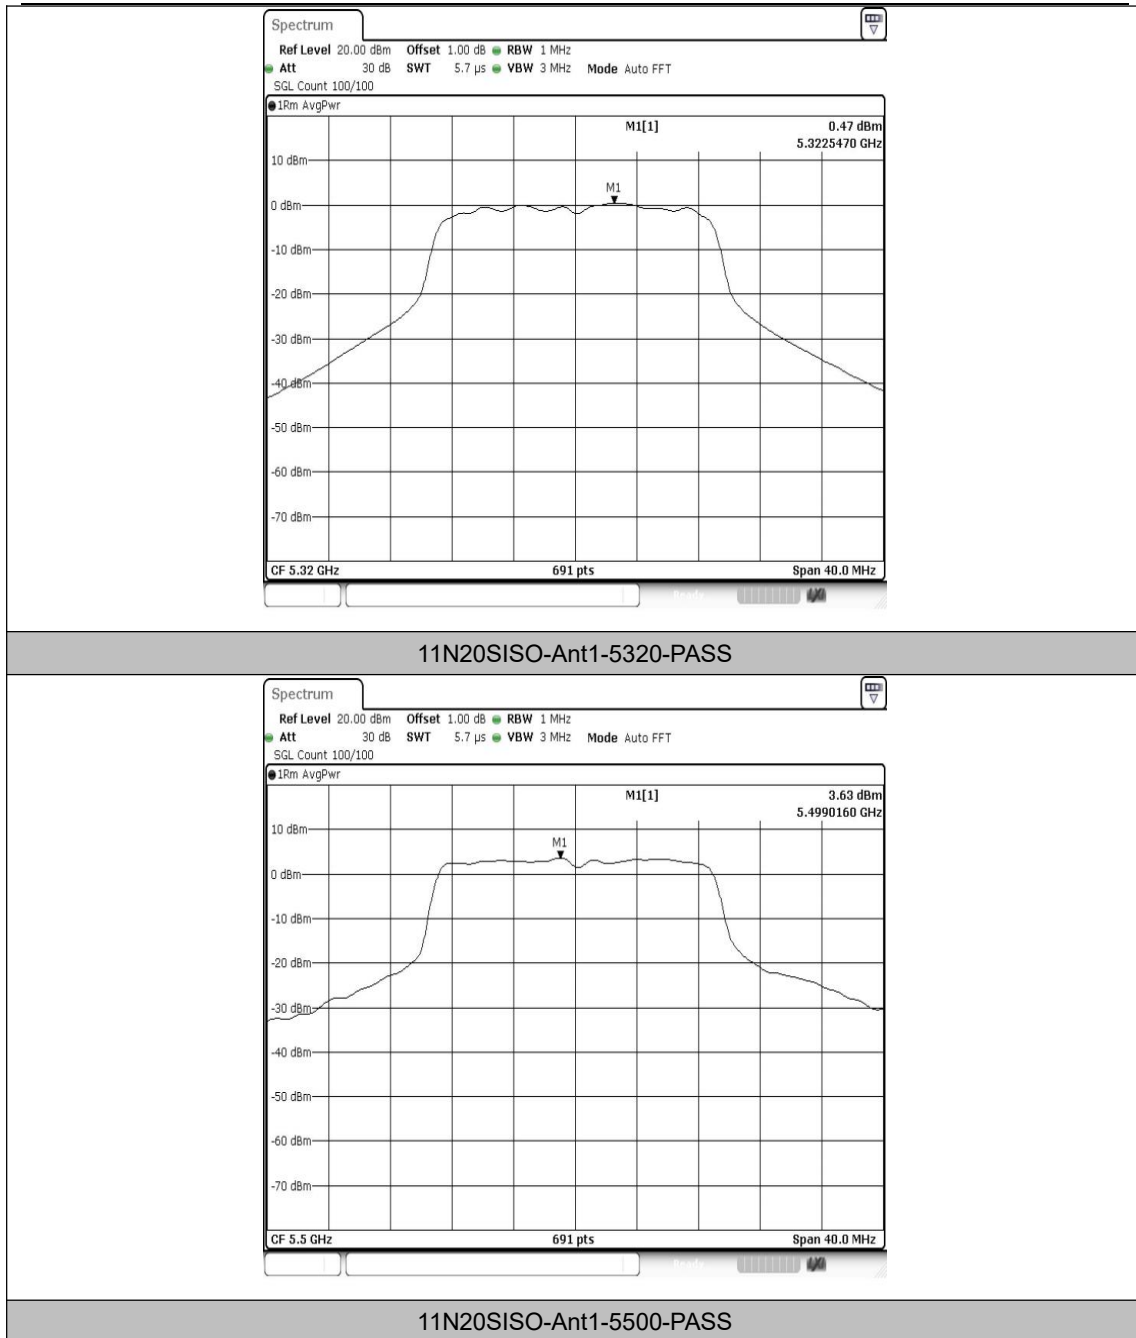


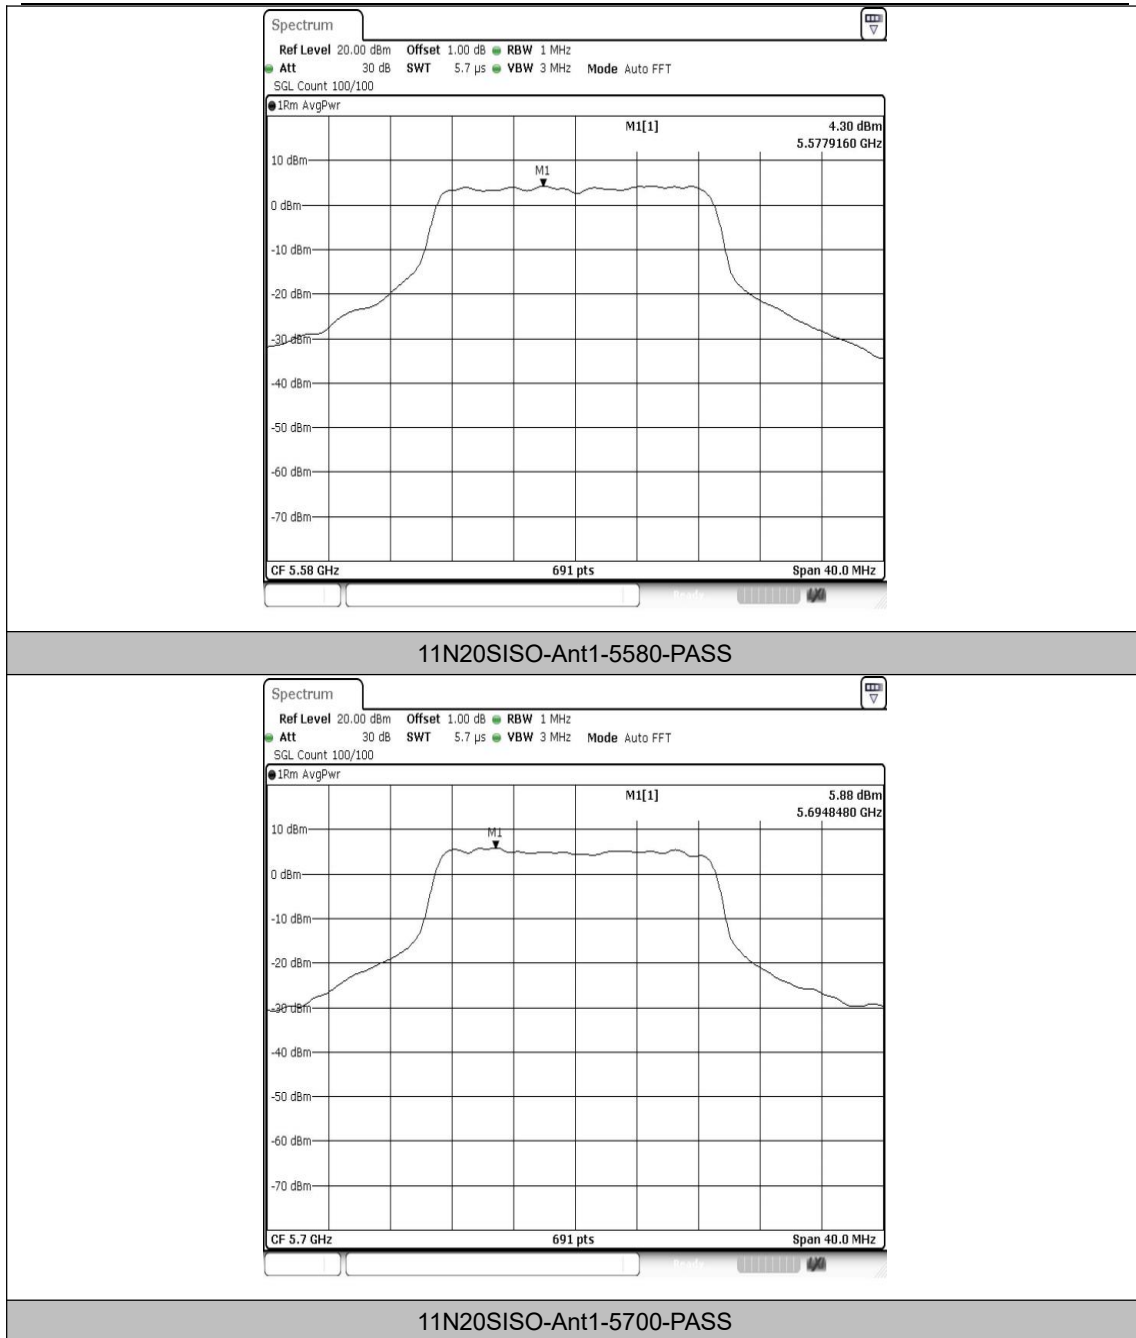

**Shenzhen Anbotek Compliance Laboratory Limited**

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,  
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel:(86)0755-26066440 Email:service@anbotek.com


Hotline  
400-003-0500  
www.anbotek.com

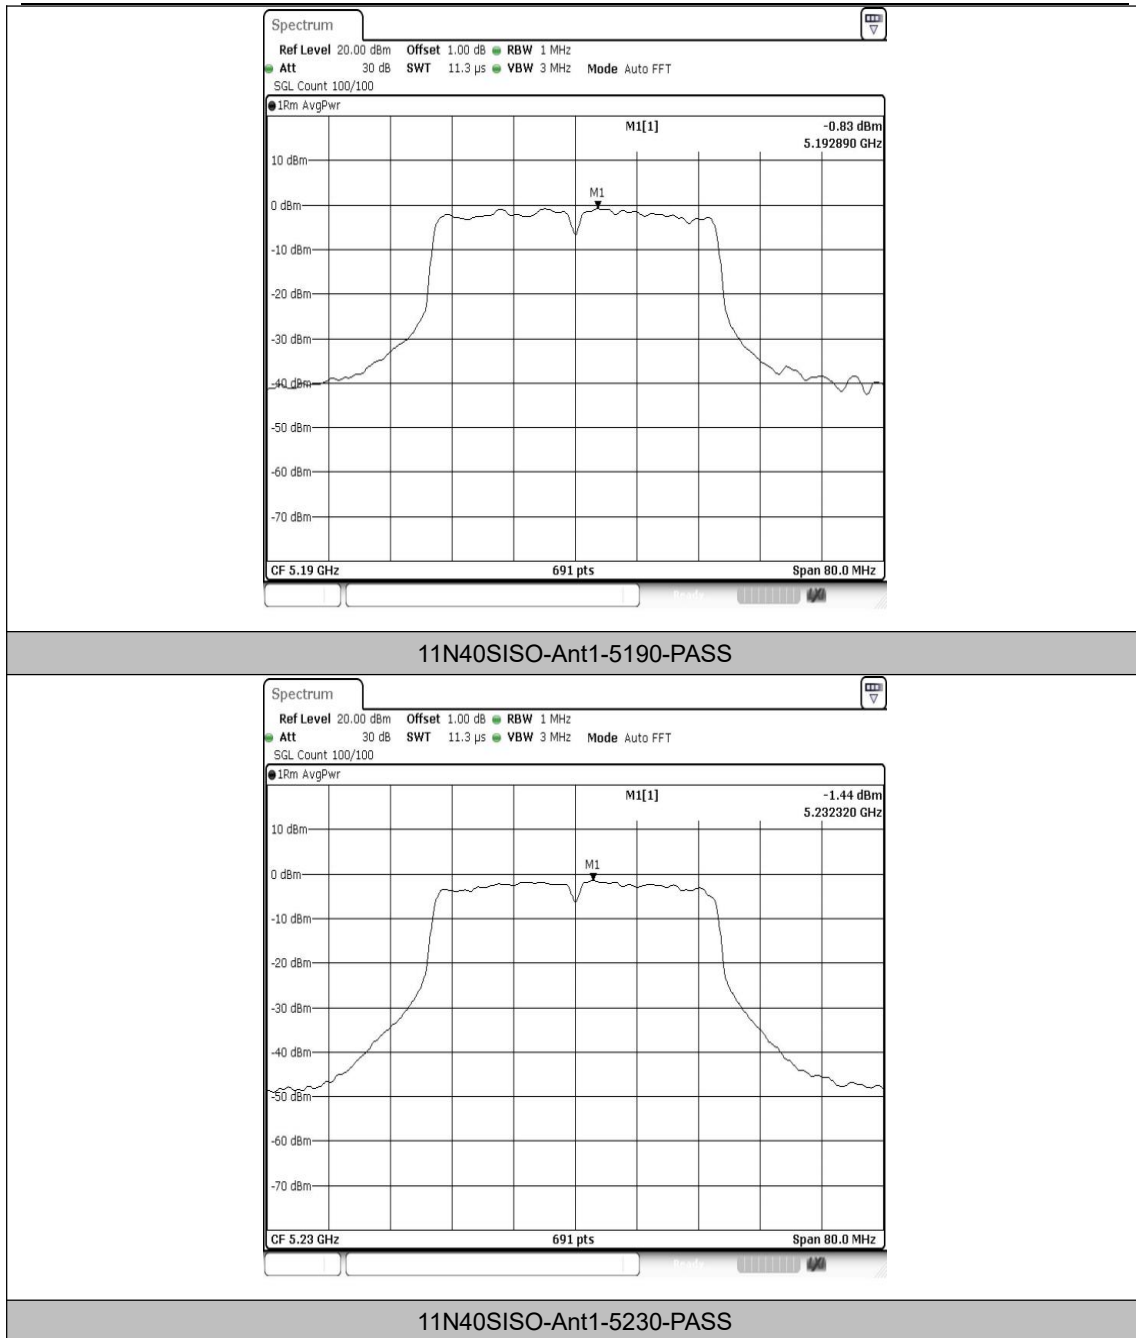

**Shenzhen Anbotek Compliance Laboratory Limited**

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,  
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: (86) 0755-26066440 Email: service@anbotek.com


 Hotline  
400-003-0500  
www.anbotek.com

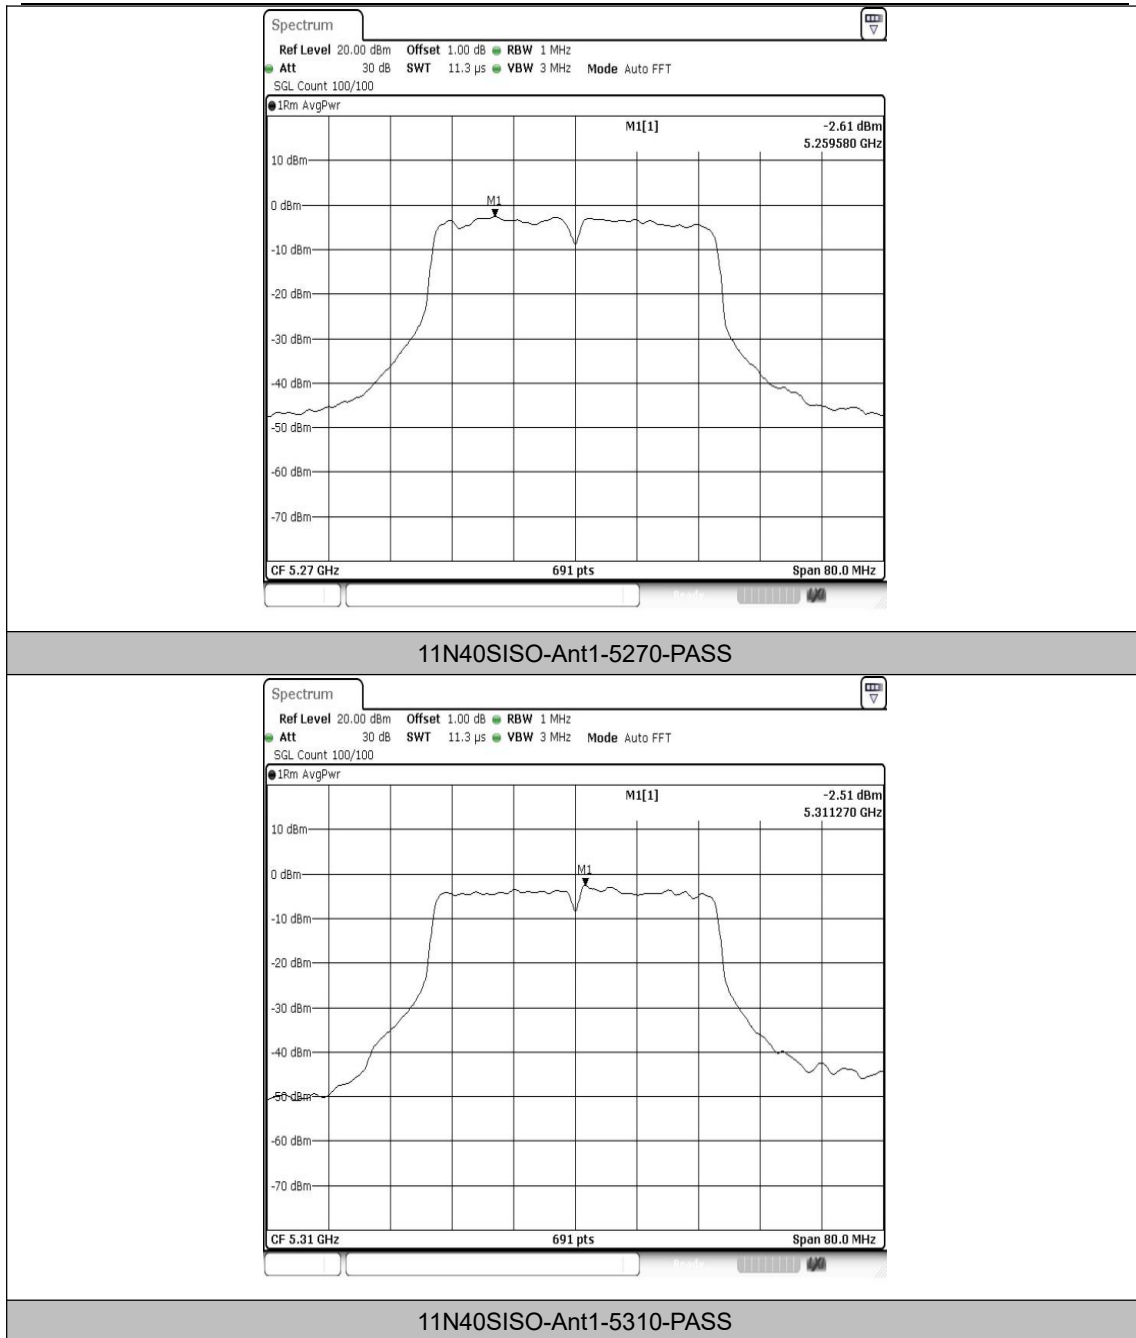



**Shenzhen Anbotek Compliance Laboratory Limited**

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,  
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline  
400-003-0500  
www.anbotek.com

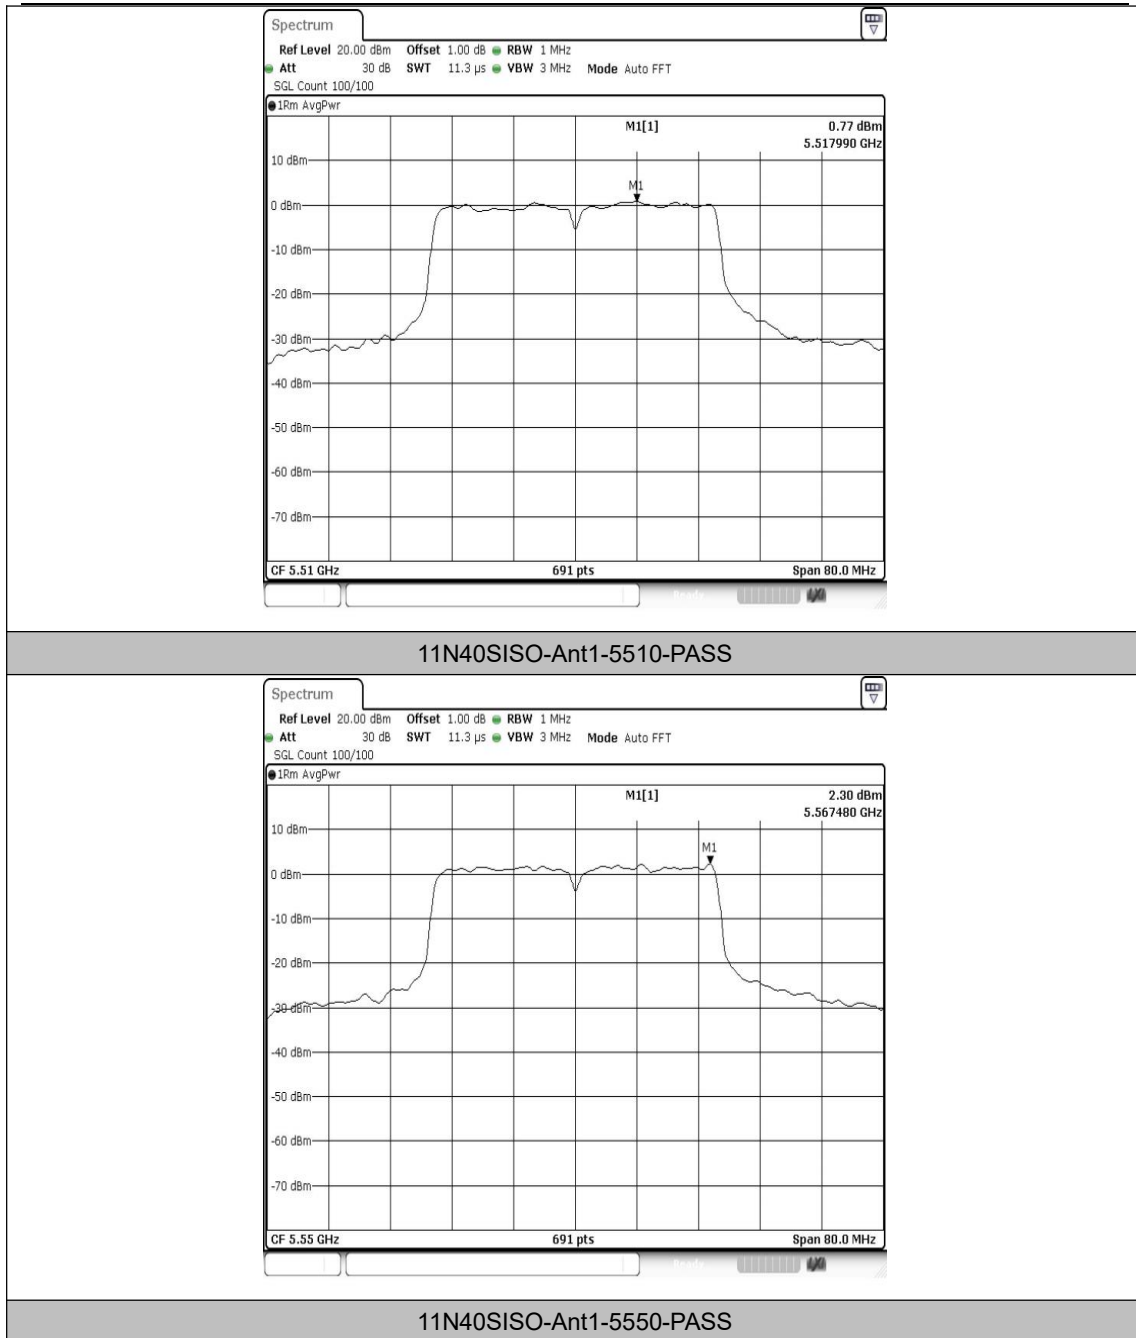

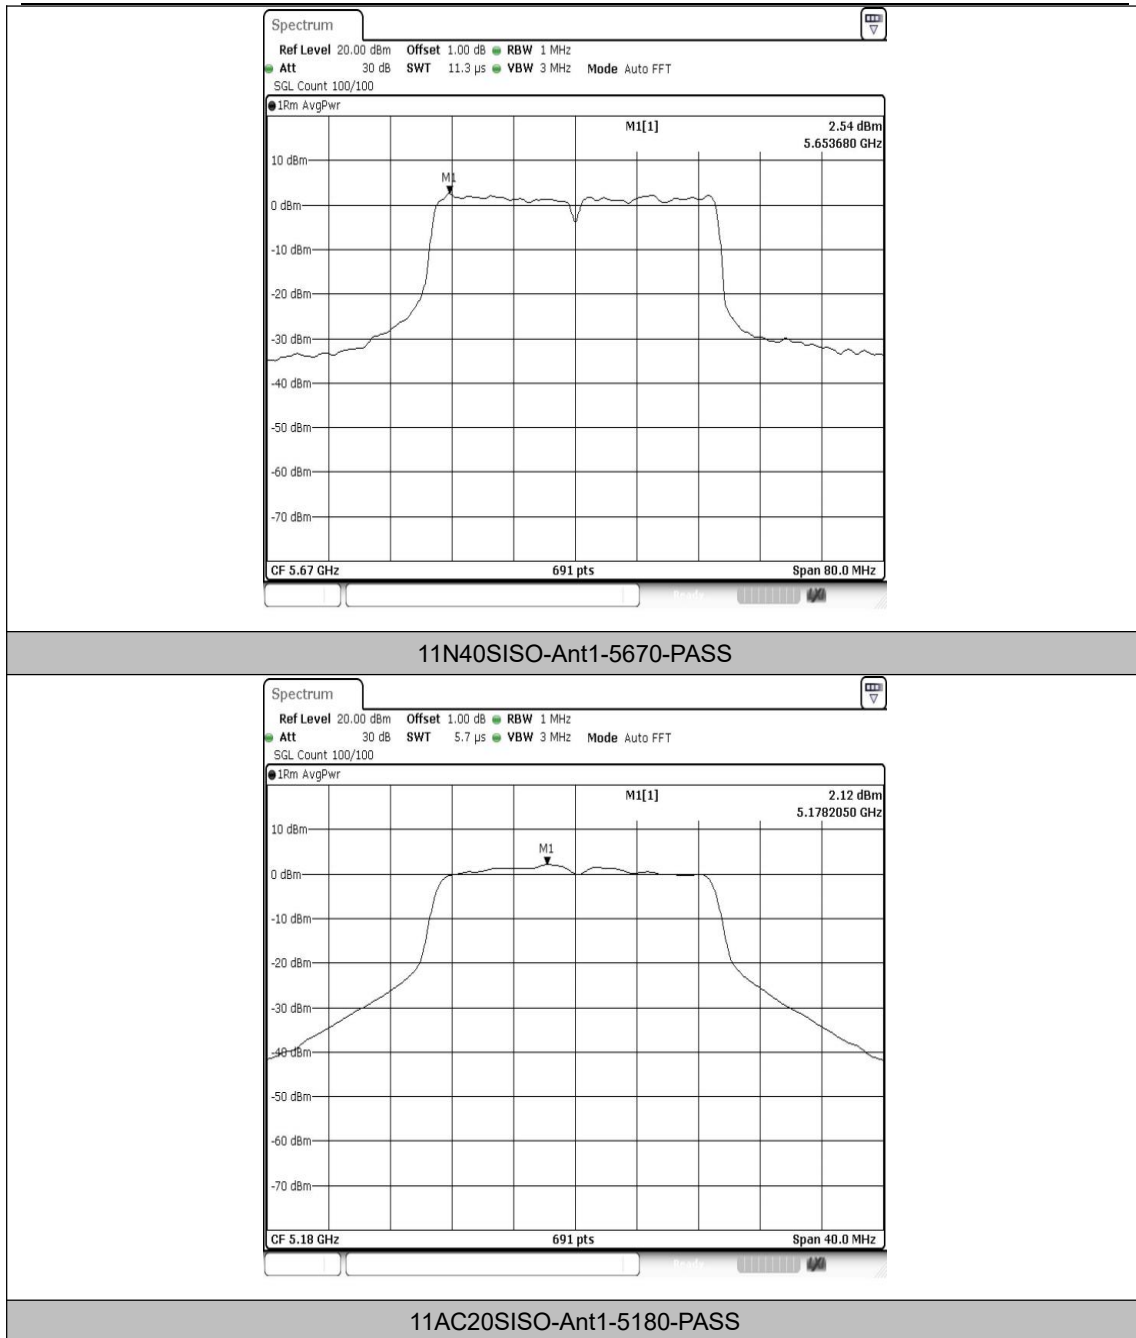


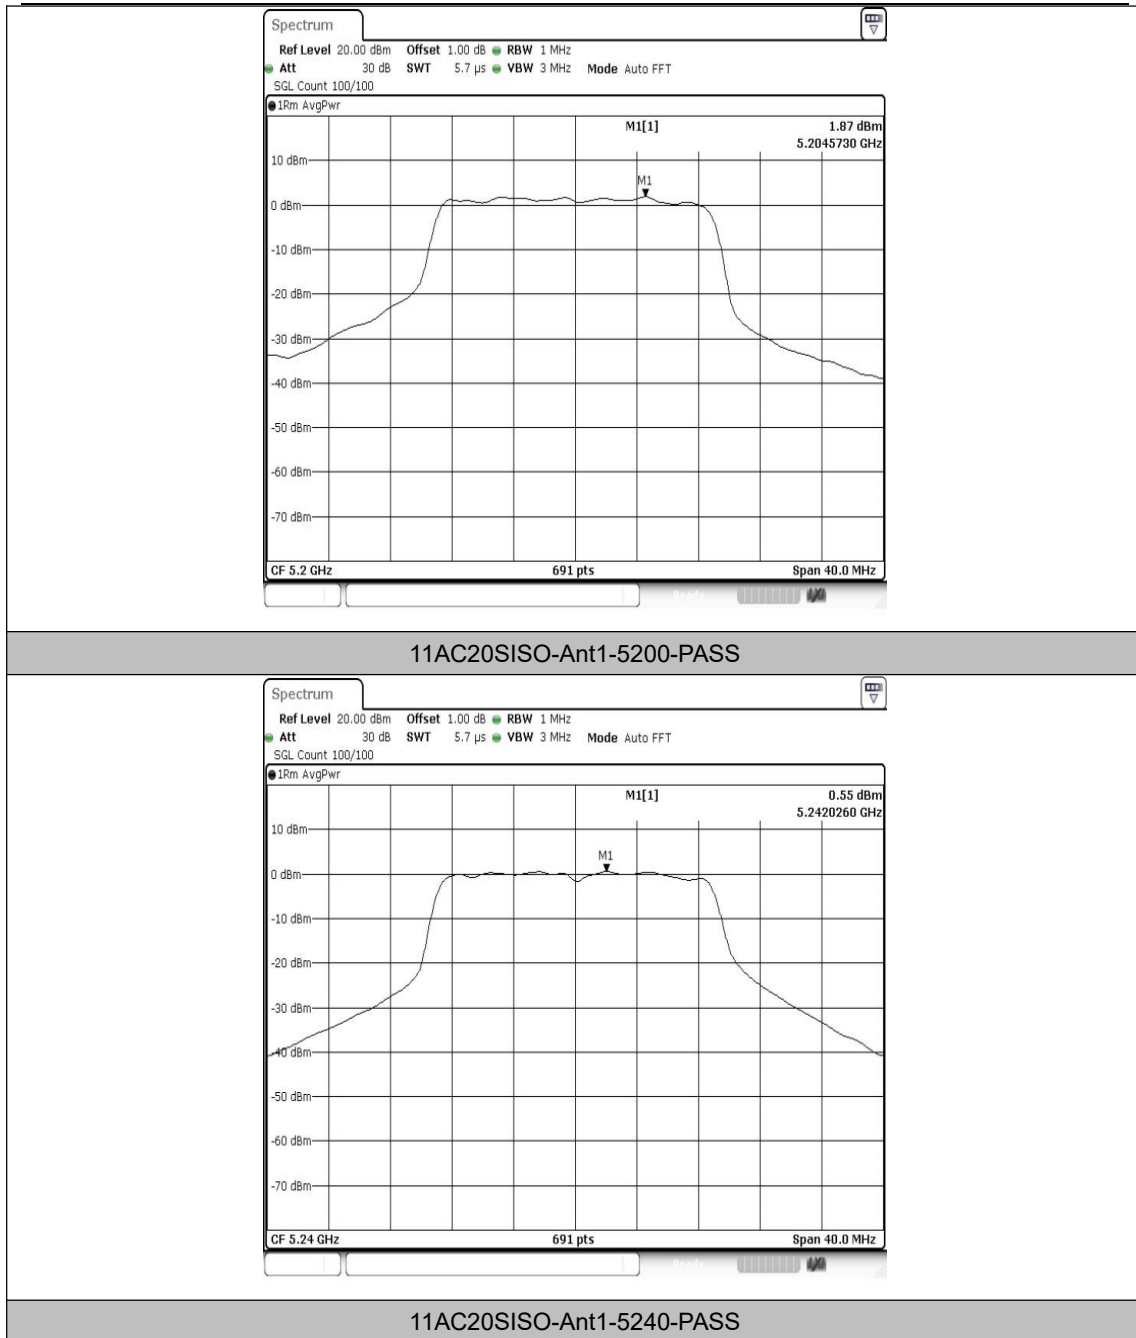

## Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,  
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline  
400-003-0500  
www.anbotek.com

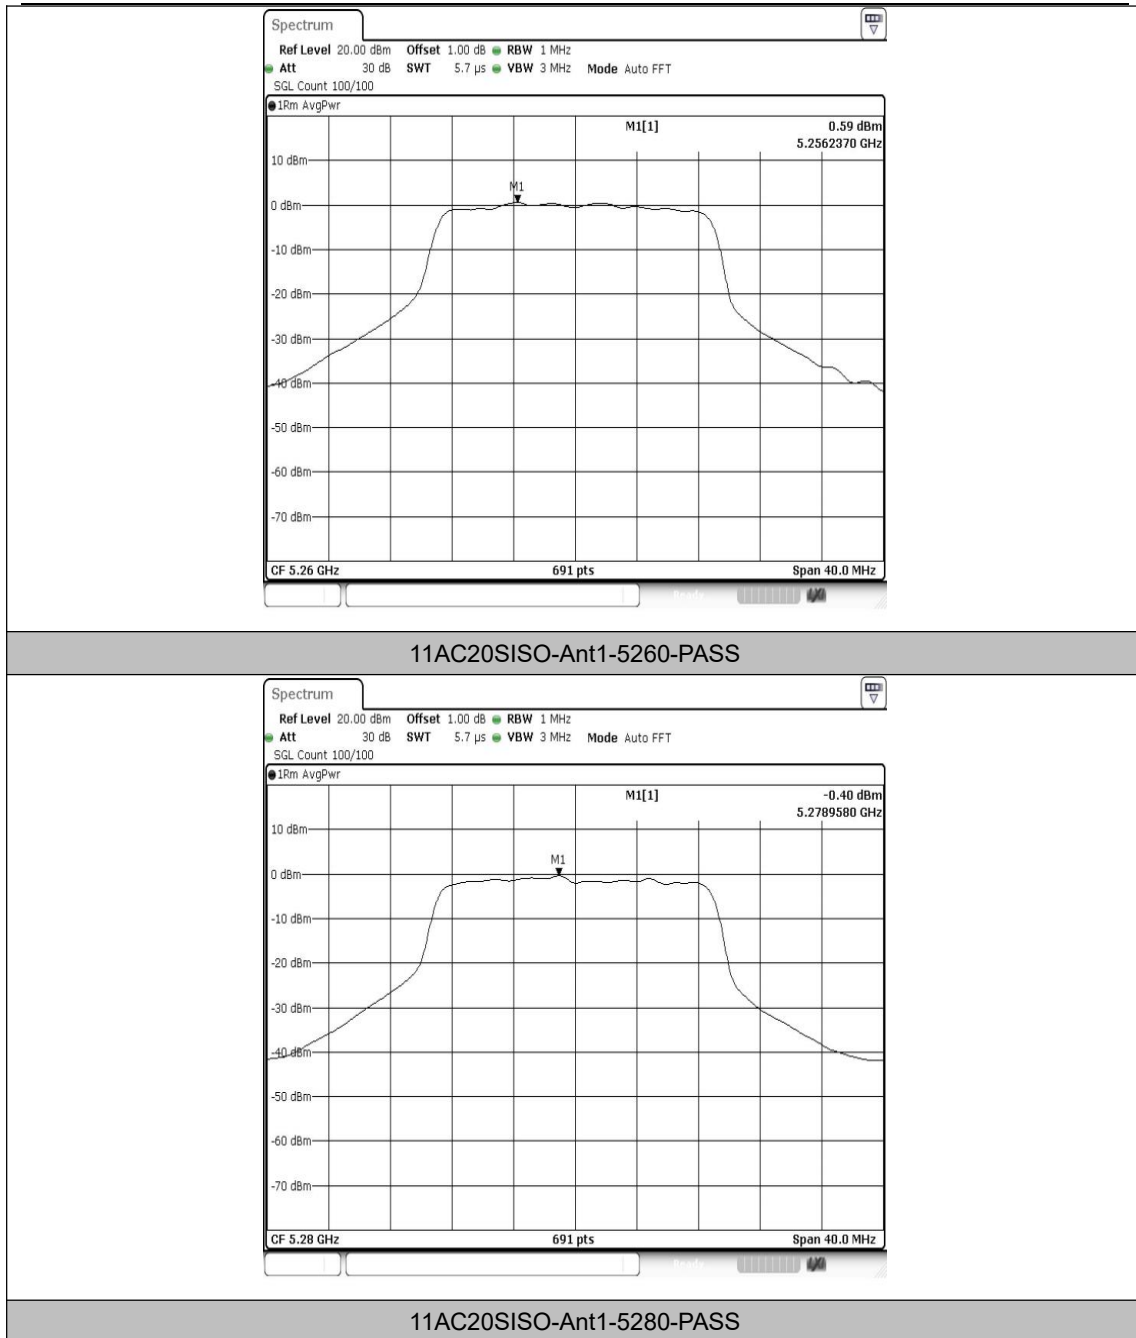


### Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,  
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline  
400-003-0500  
www.anbotek.com

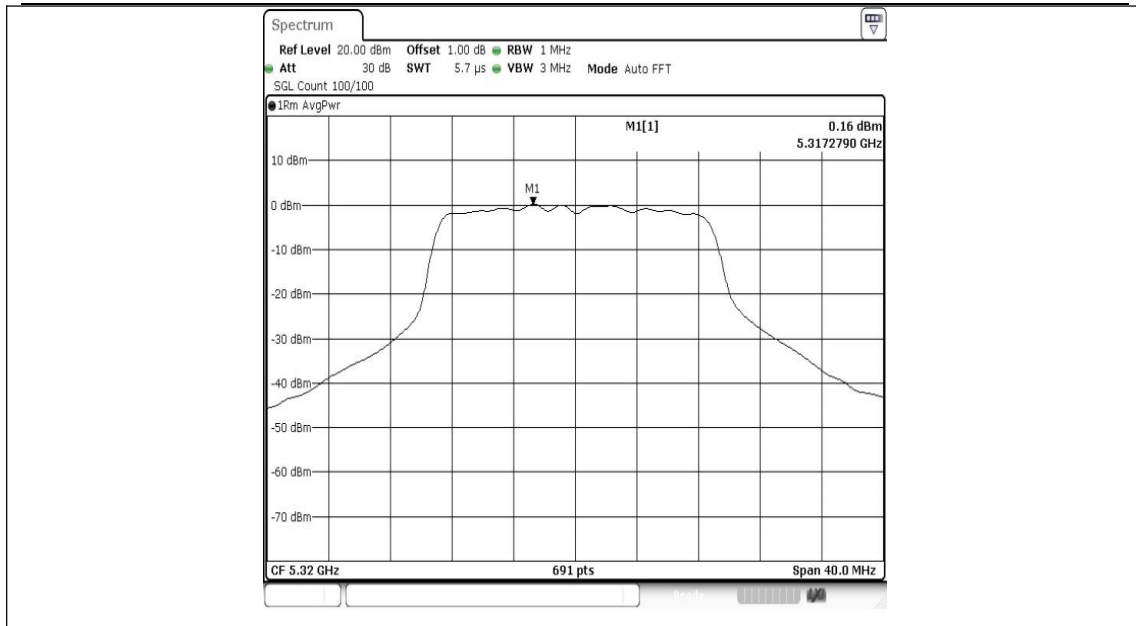


11AC20SISO-Ant1-5320-PASS

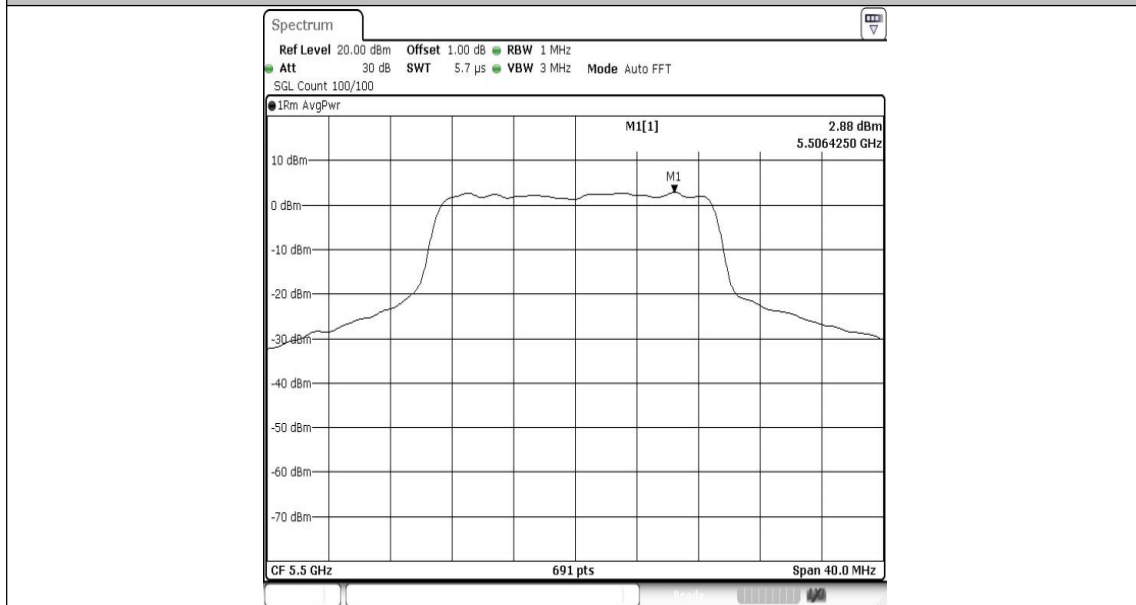

11AC20SISO-Ant1-5500-PASS

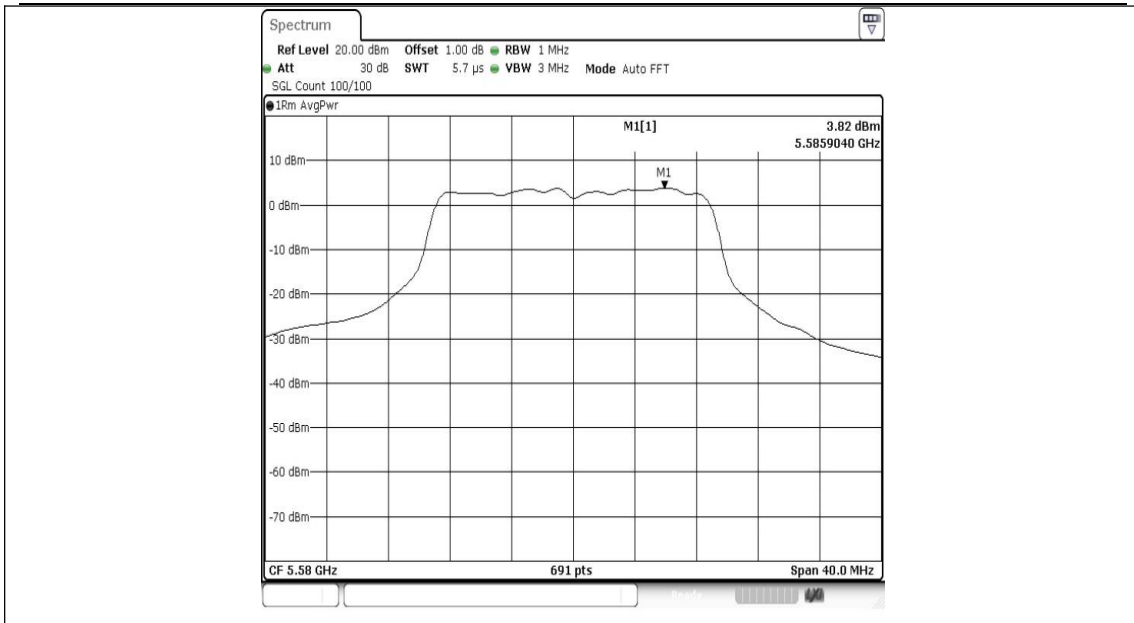

11AC20SISO-Ant1-5580-PASS

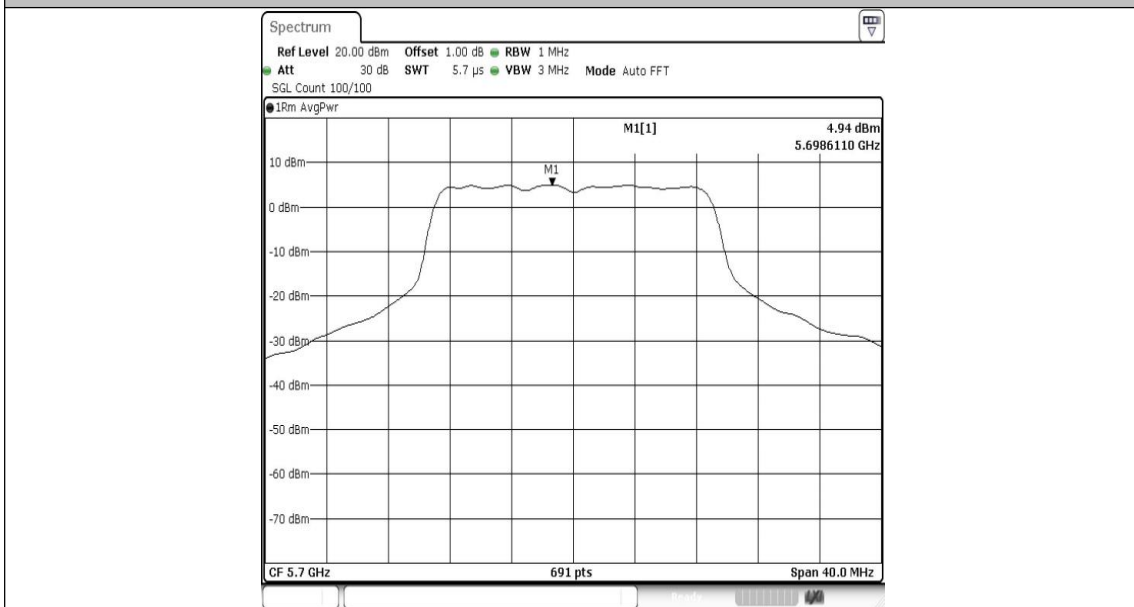


11AC20SISO-Ant1-5700-PASS

## Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,  
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: (86) 0755-26066440 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com

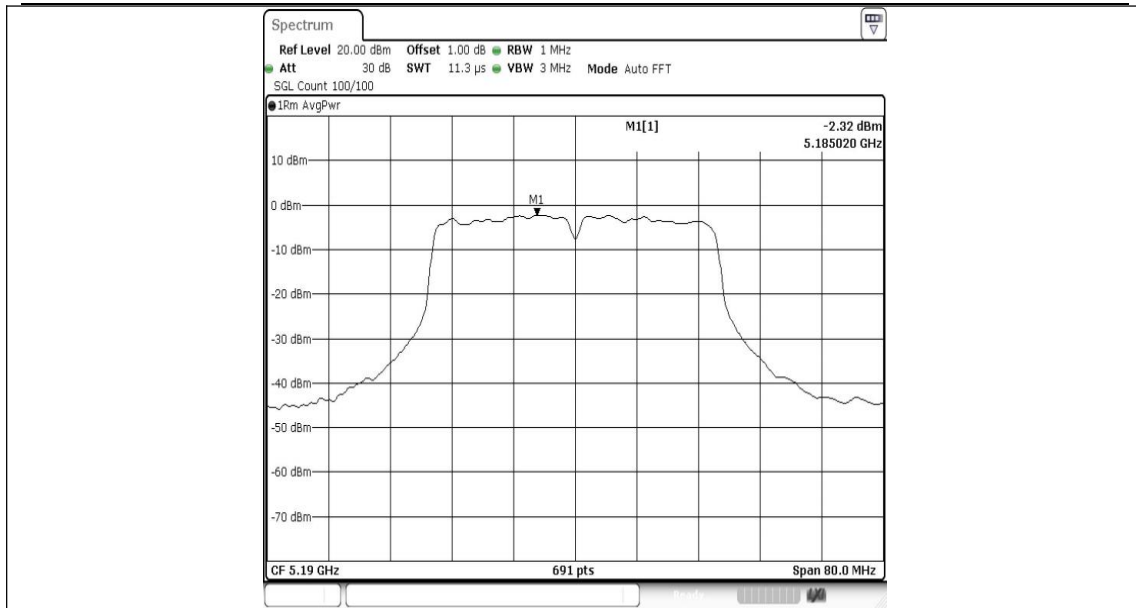


11AC40SISO-Ant1-5190-PASS

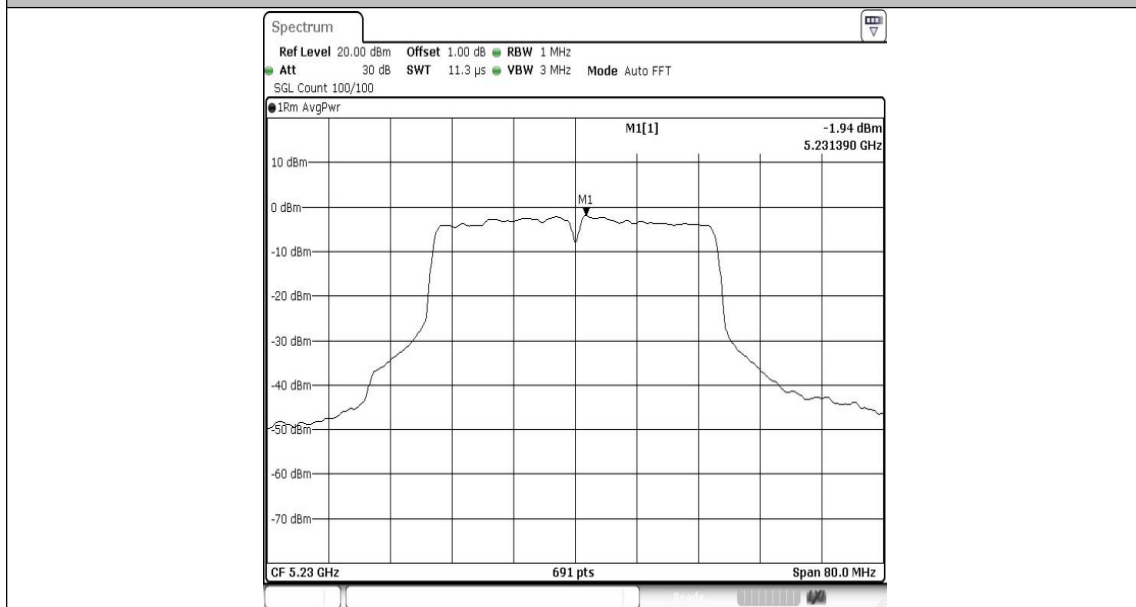

11AC40SISO-Ant1-5230-PASS

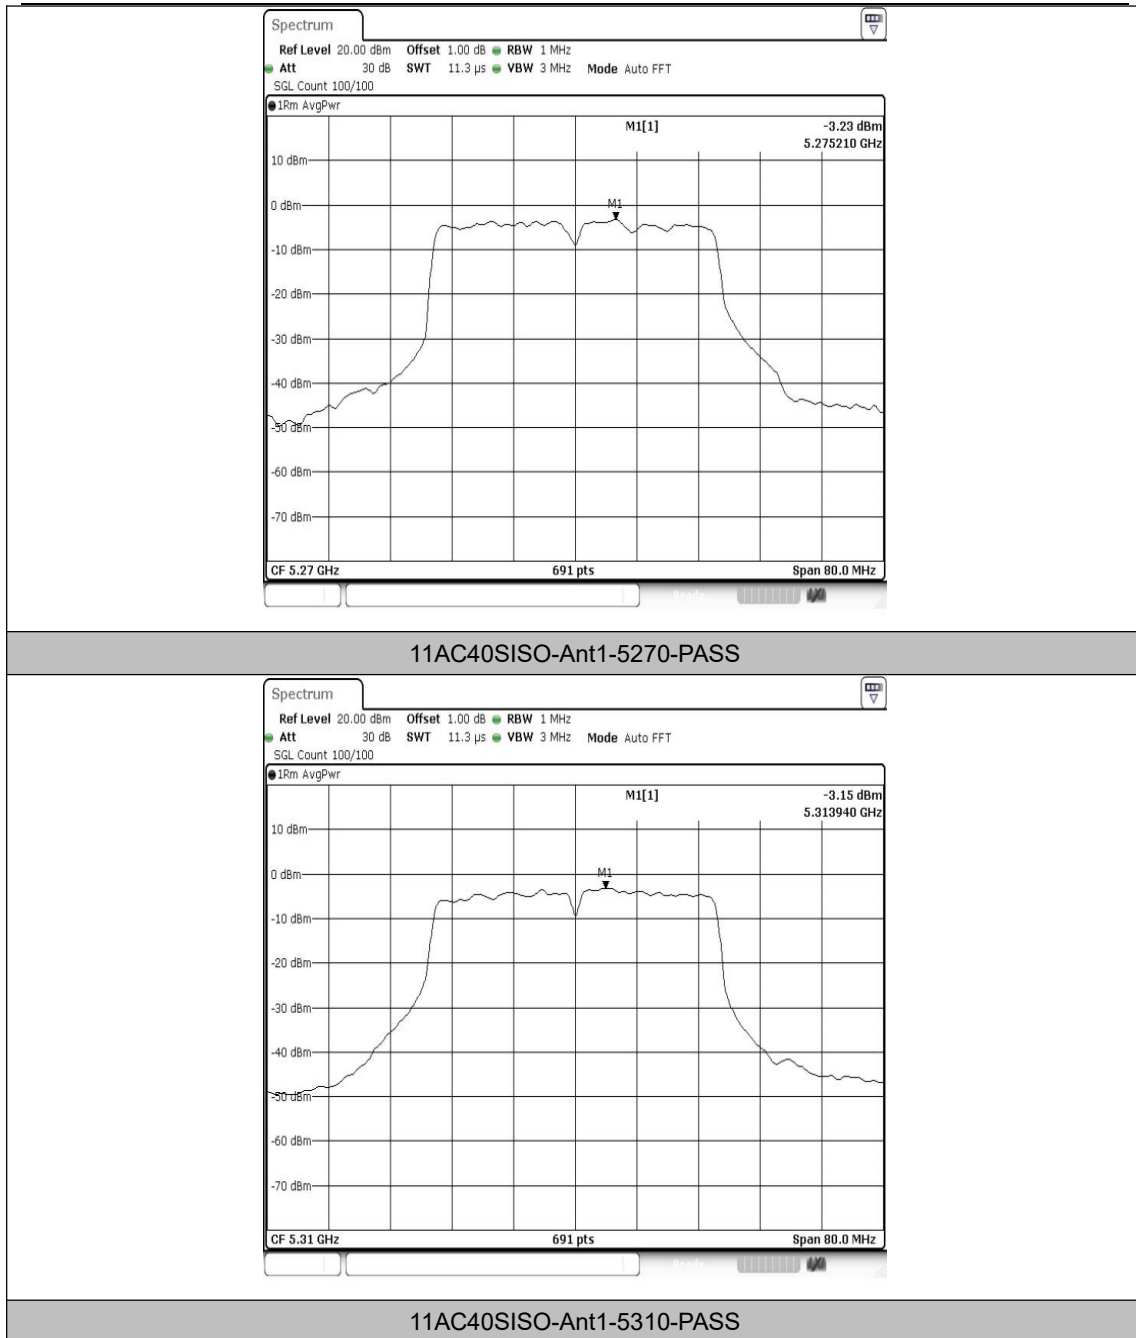


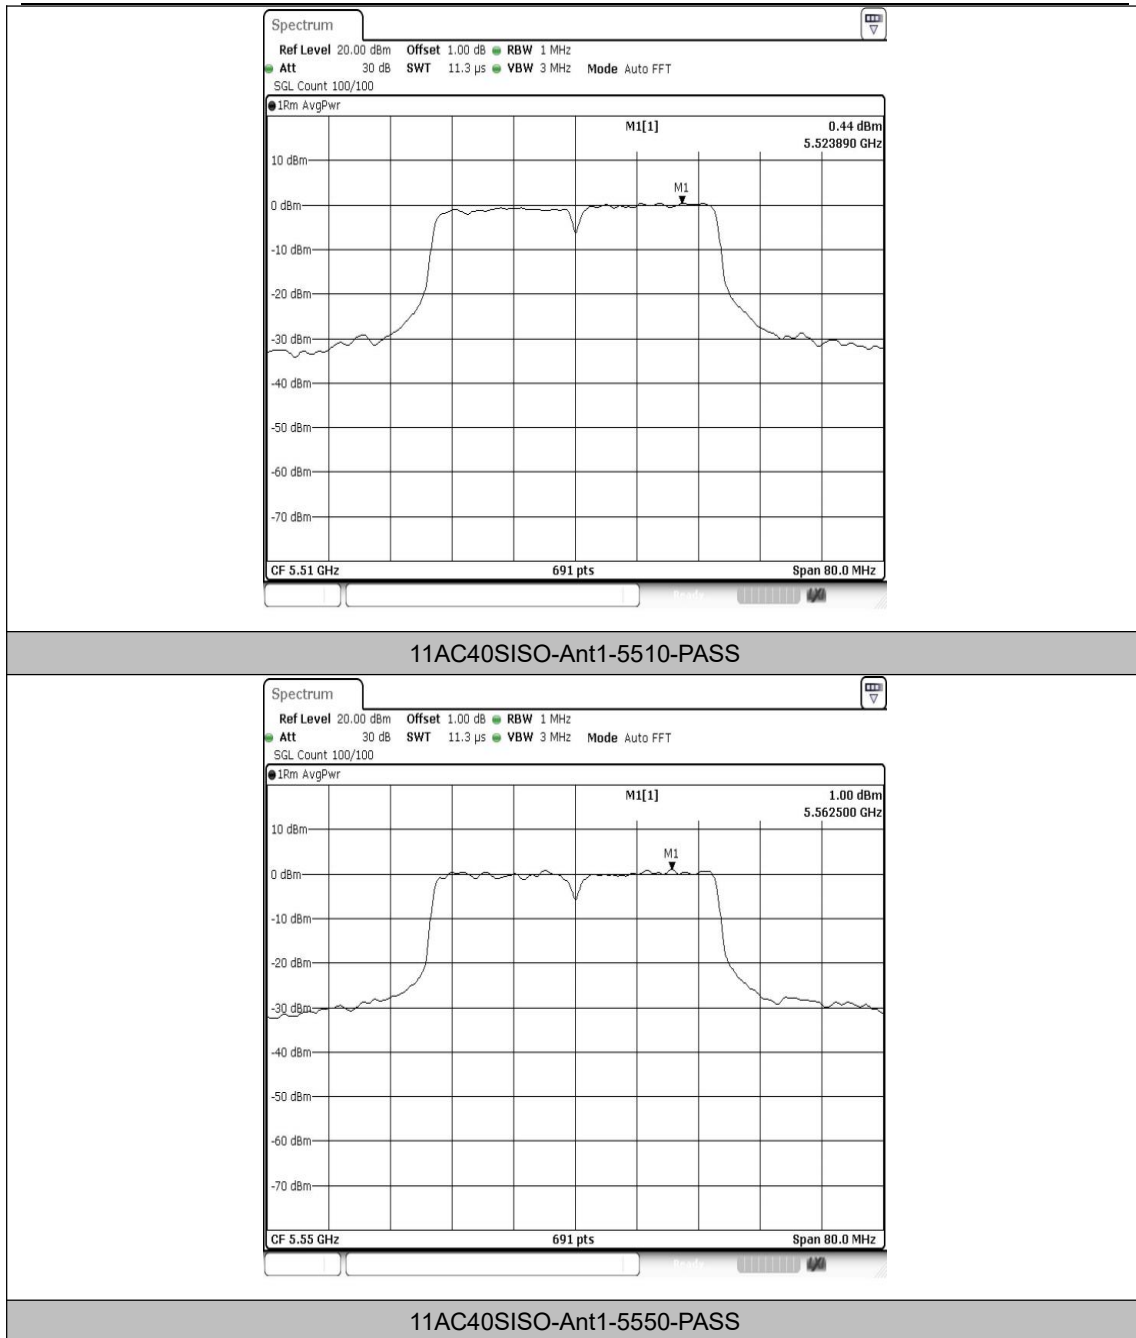

**Shenzhen Anbotek Compliance Laboratory Limited**

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,  
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline  
400-003-0500  
www.anbotek.com

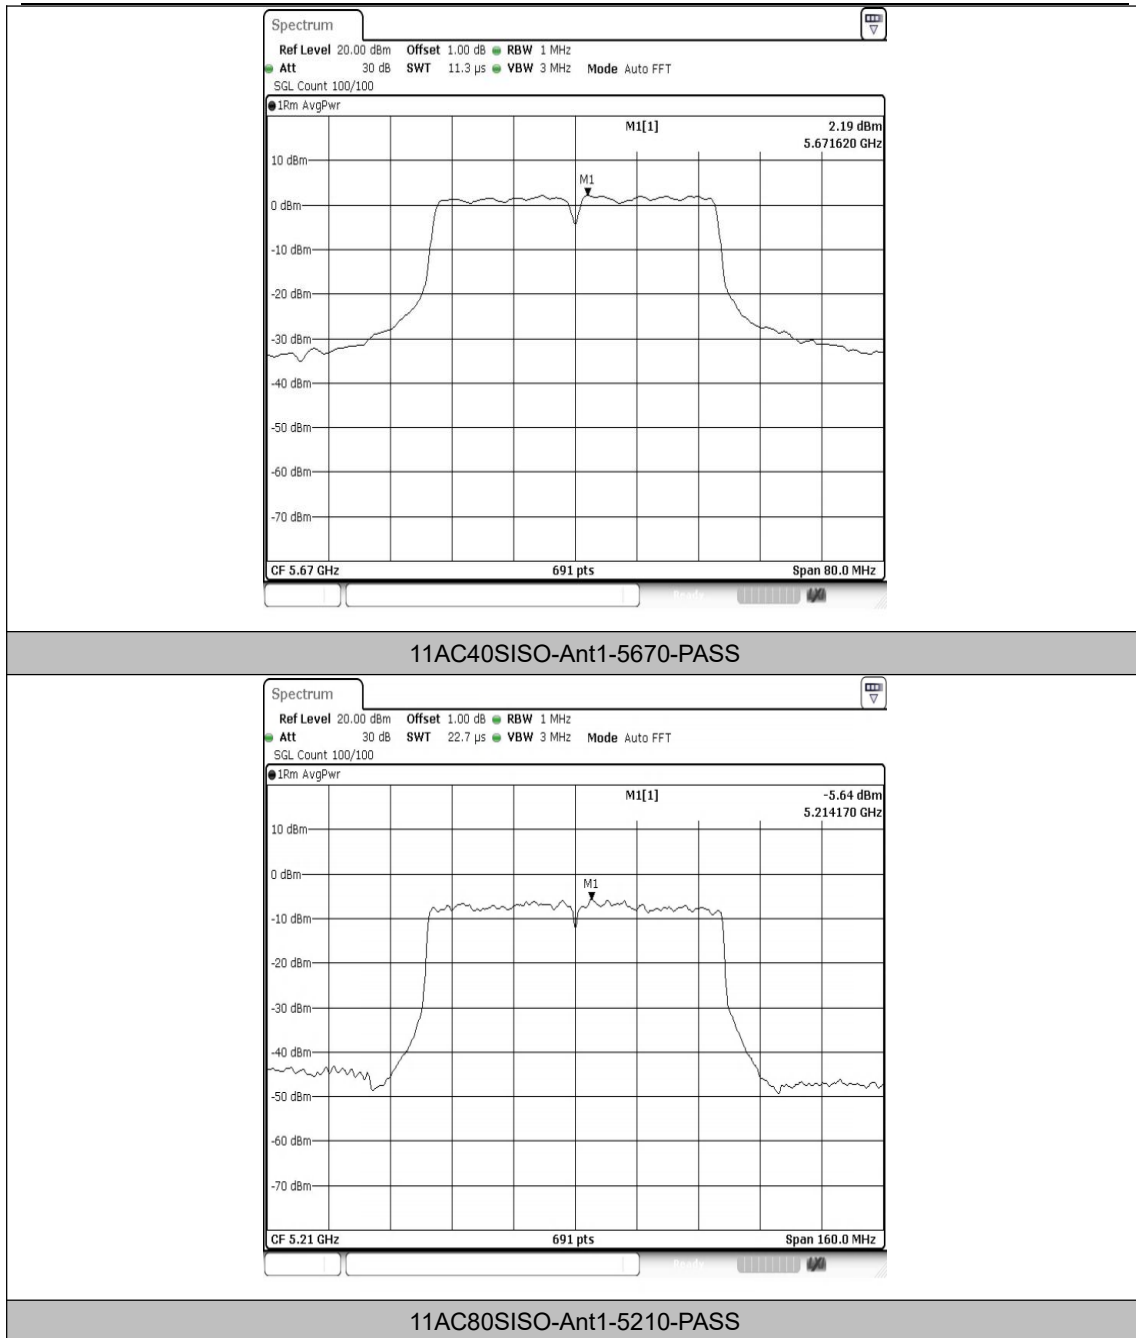


**Shenzhen Anbotek Compliance Laboratory Limited**

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,  
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline  
400-003-0500  
www.anbotek.com

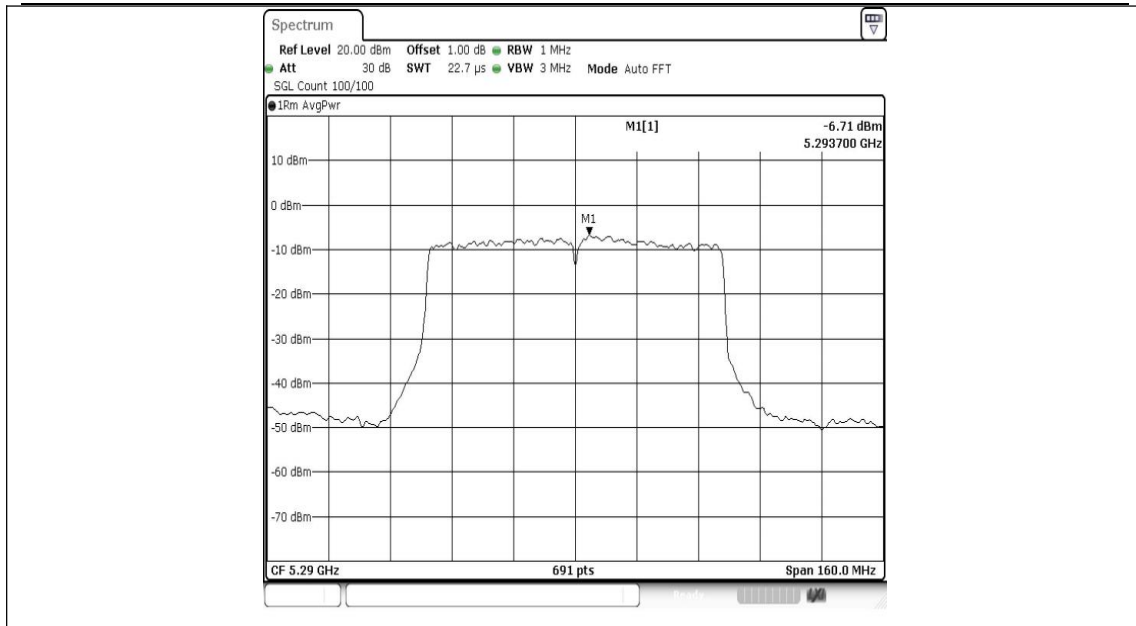

11AC80SISO-Ant1-5290-PASS

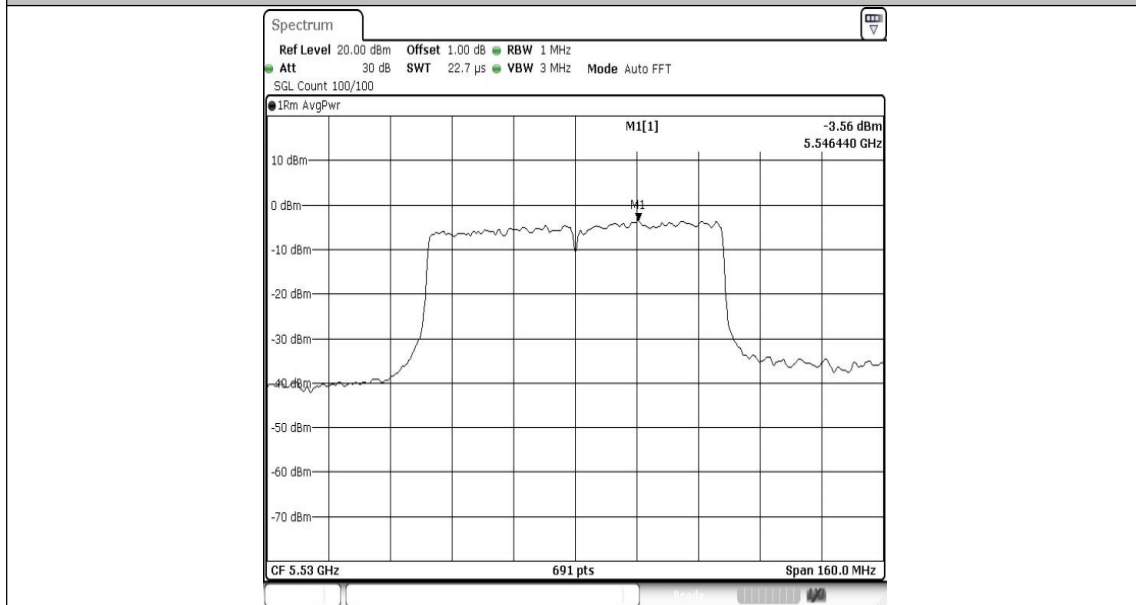


11AC80SISO-Ant1-5530-PASS

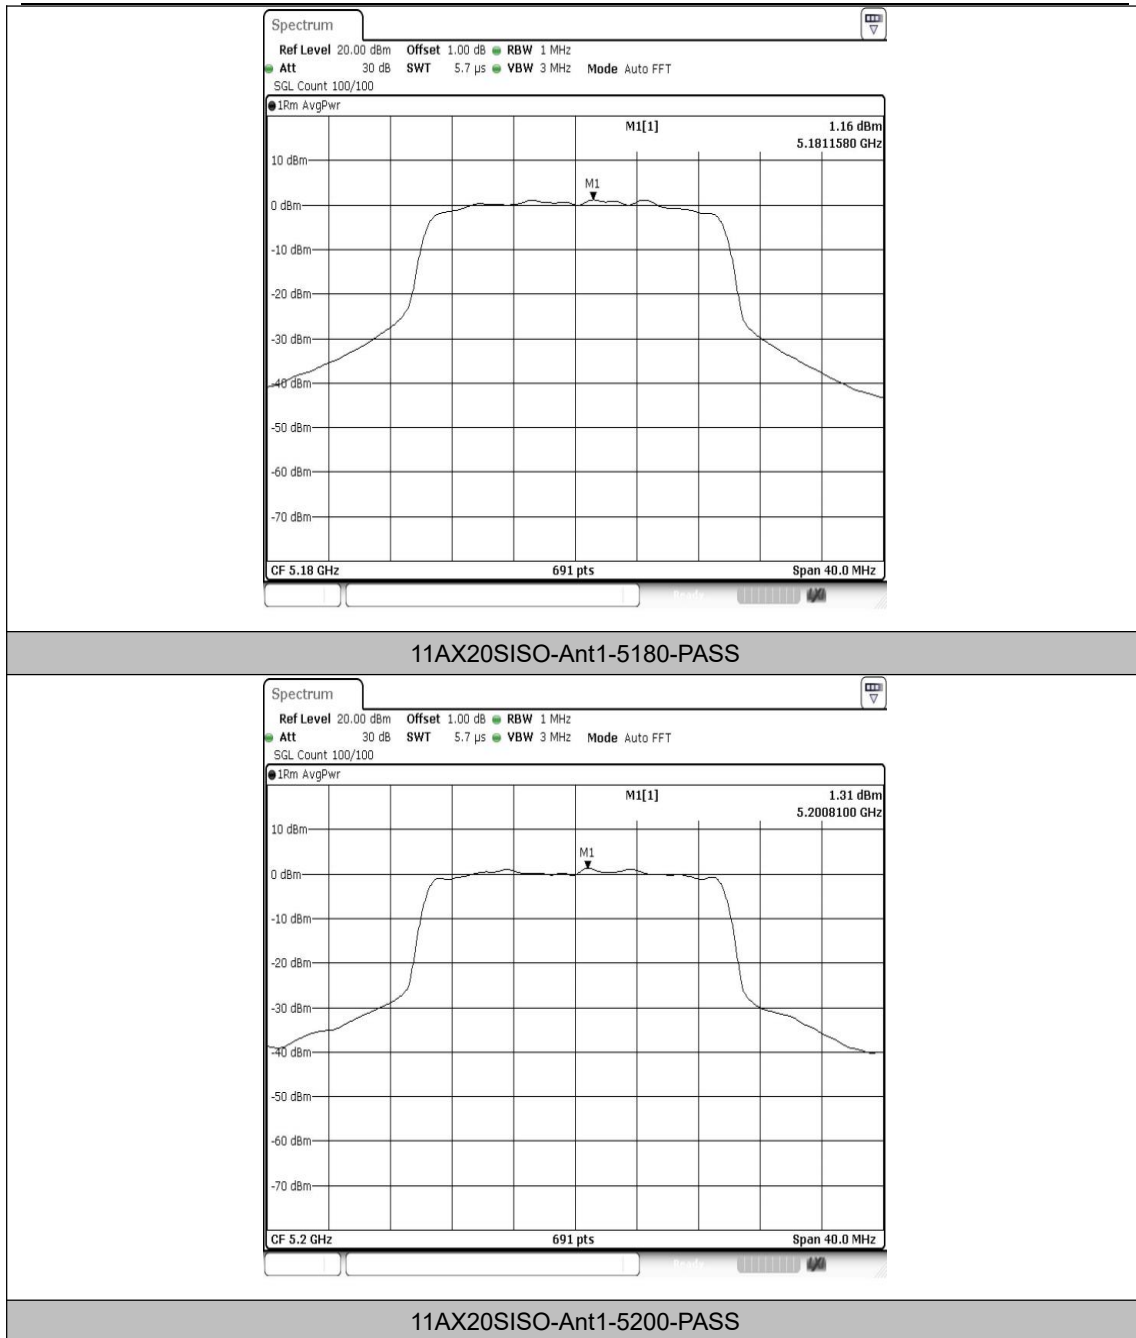

**Shenzhen Anbotek Compliance Laboratory Limited**

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,  
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline  
400-003-0500  
www.anbotek.com

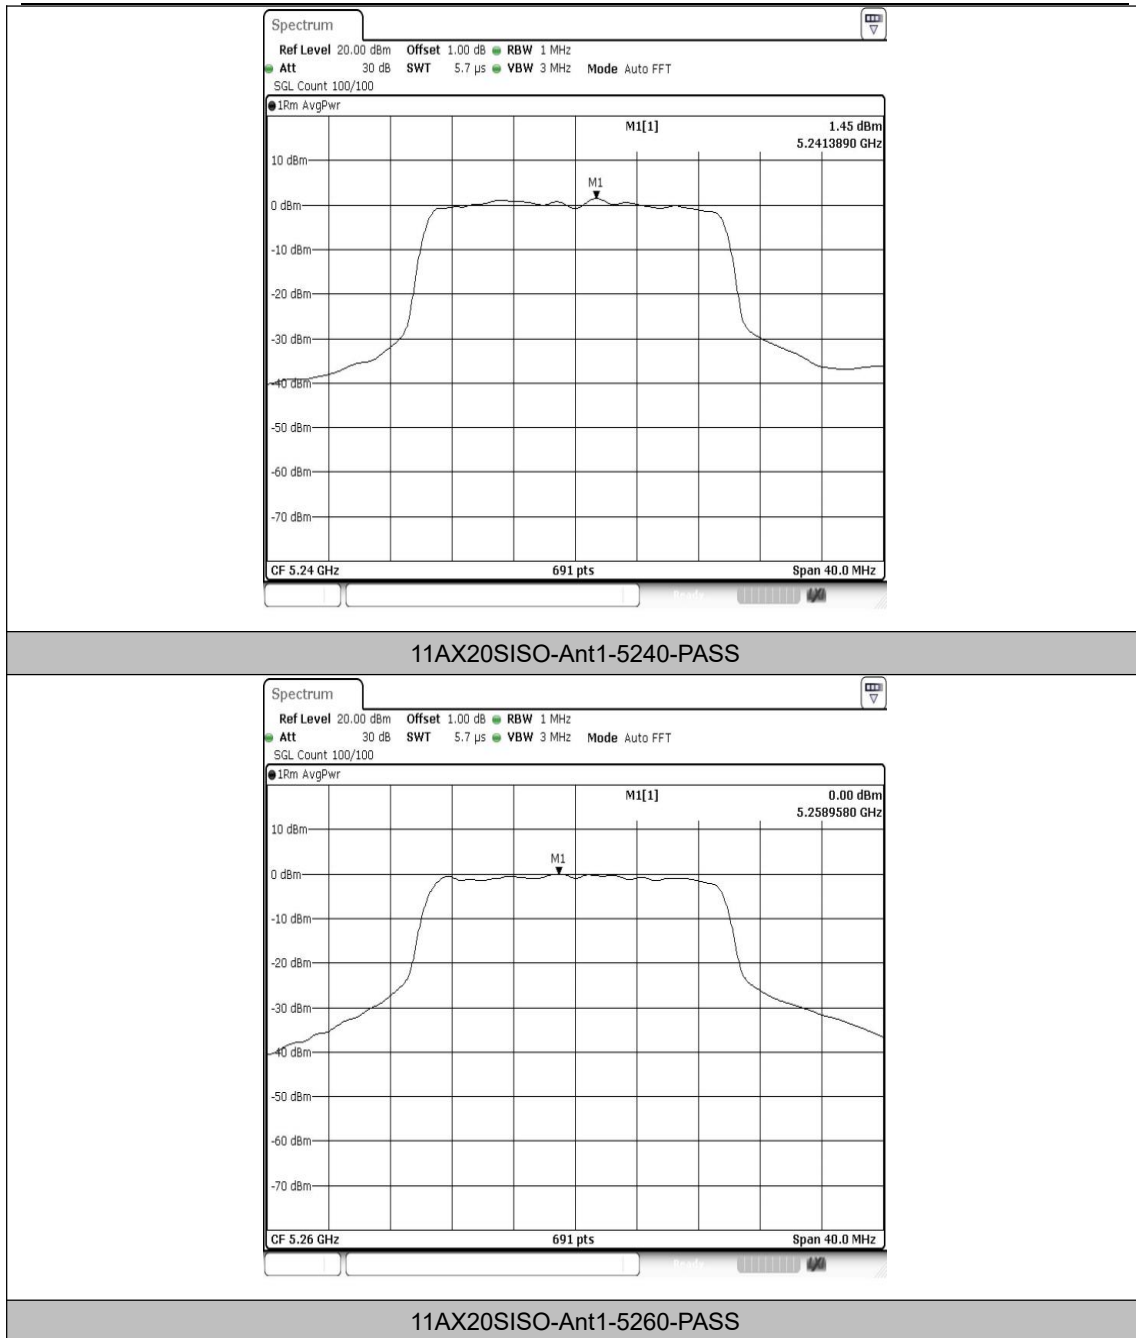

### Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,  
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline  
400-003-0500  
www.anbotek.com

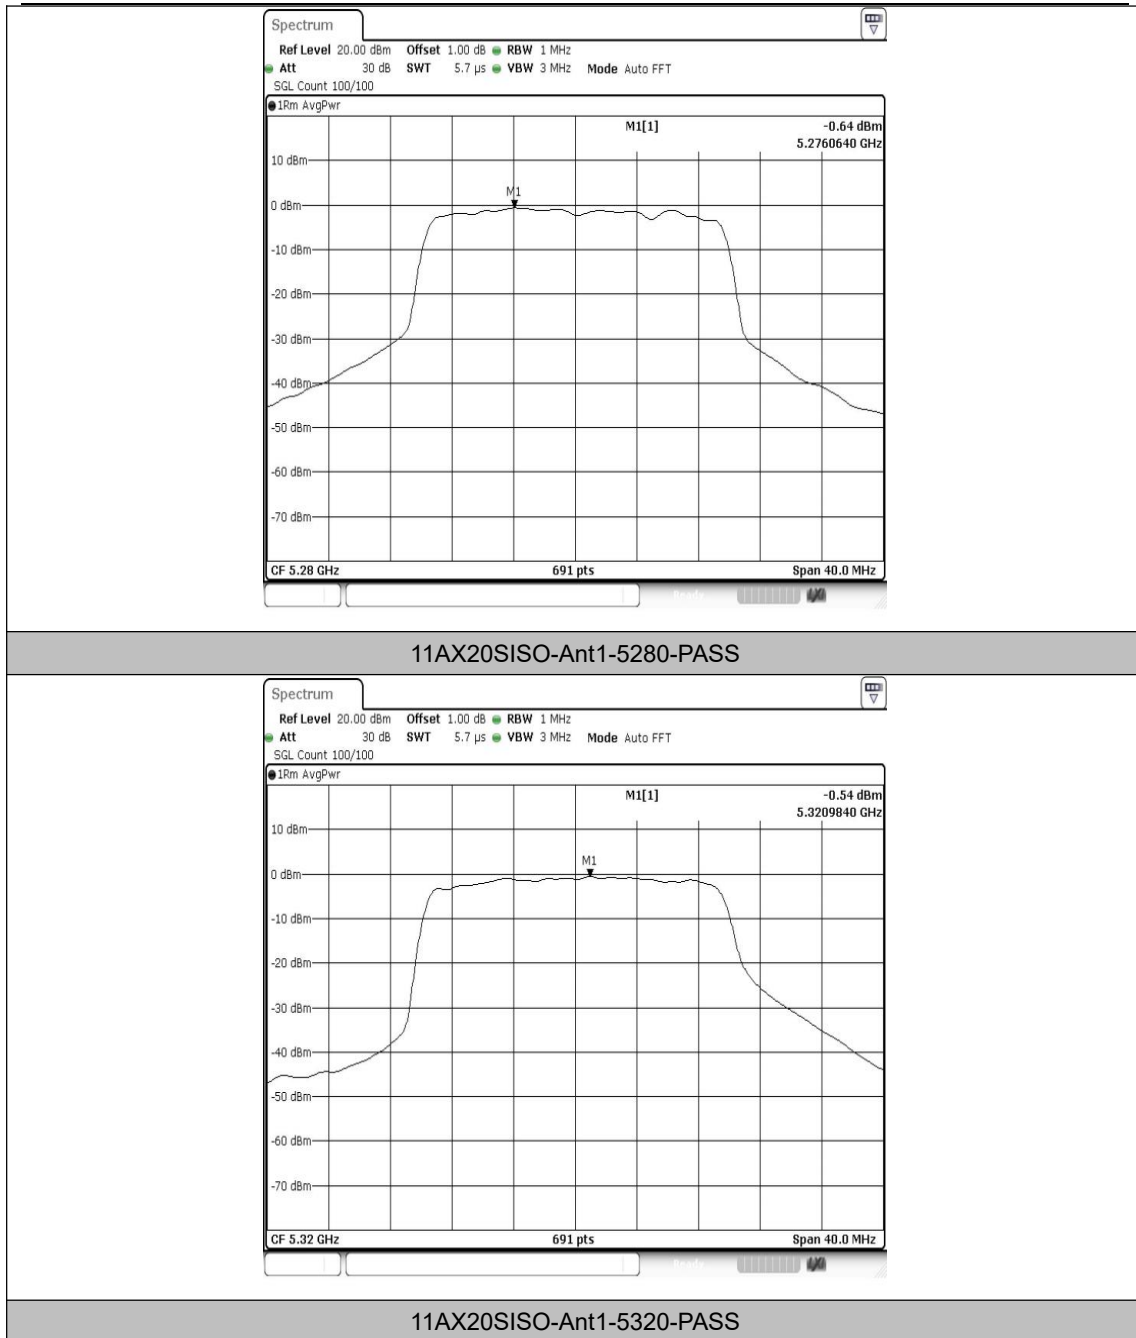


### Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,  
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline  
400-003-0500  
www.anbotek.com

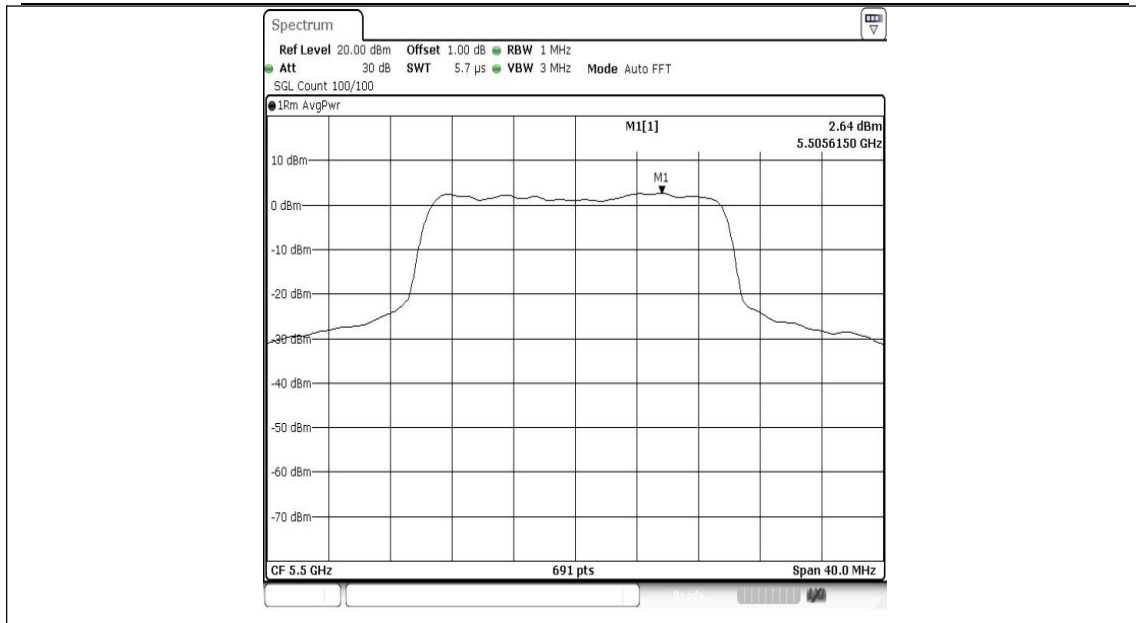

11AX20SISO-Ant1-5500-PASS

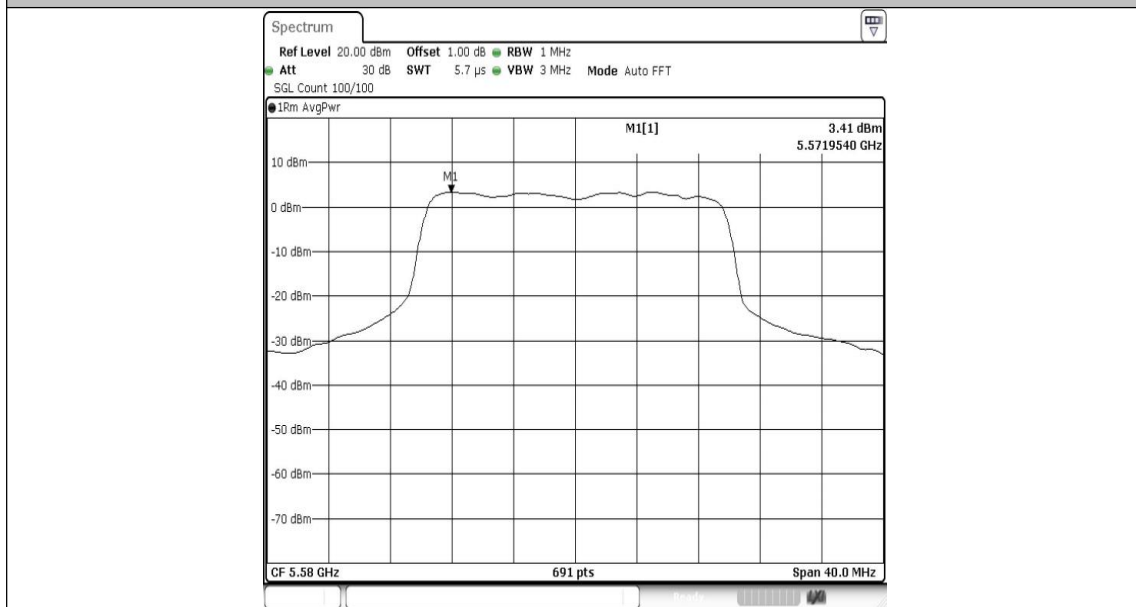

11AX20SISO-Ant1-5580-PASS