



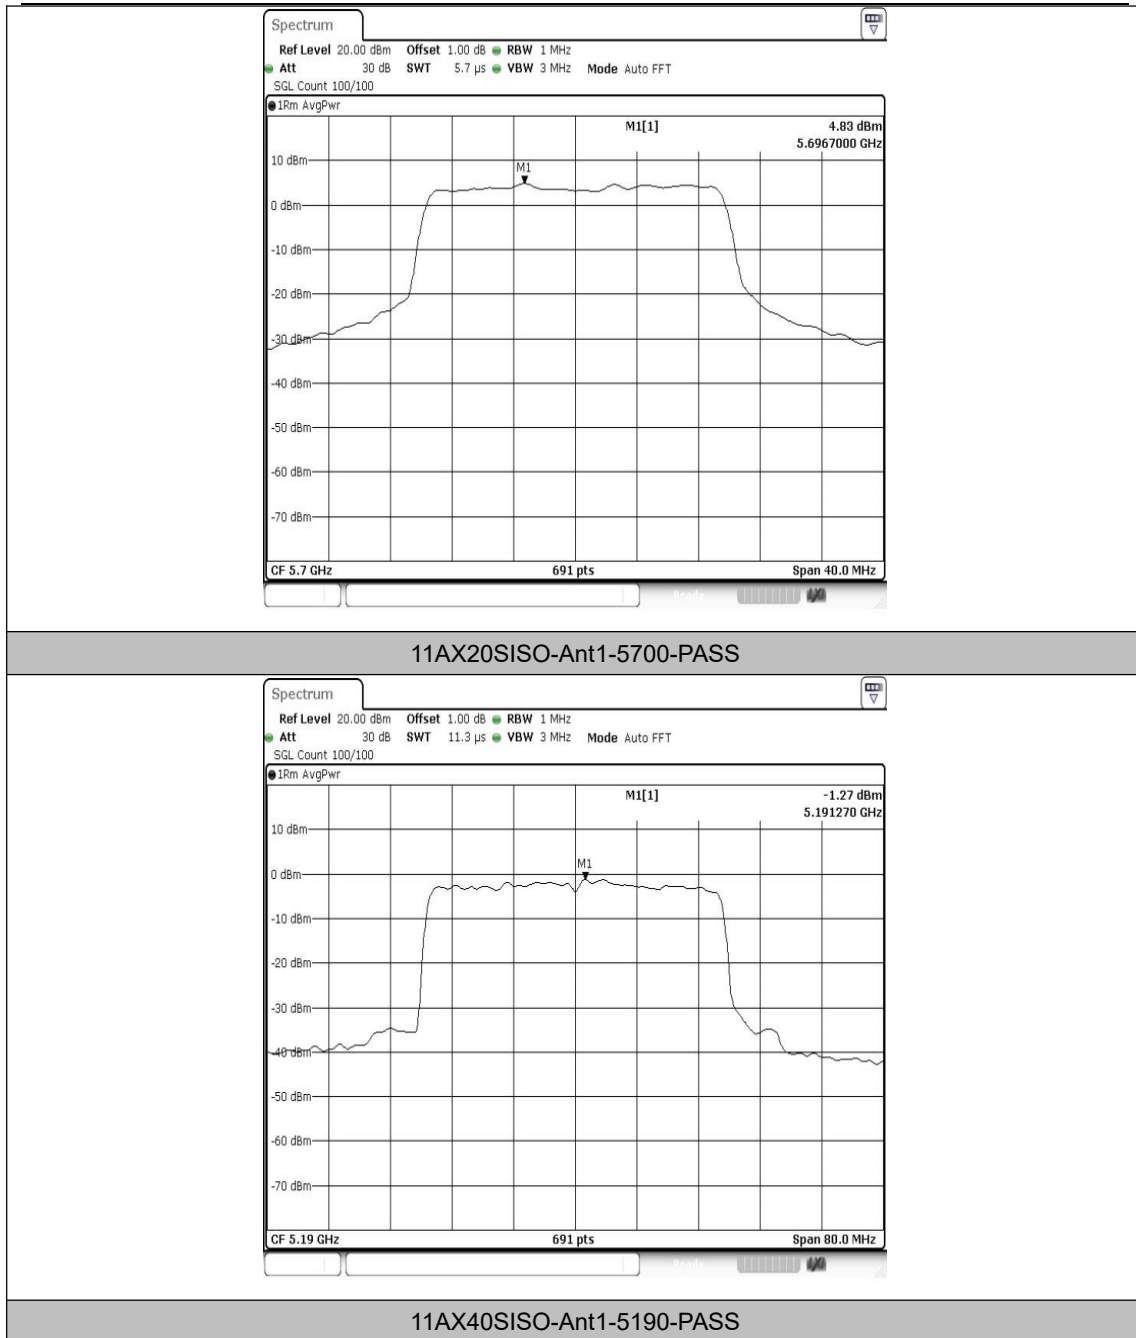


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com

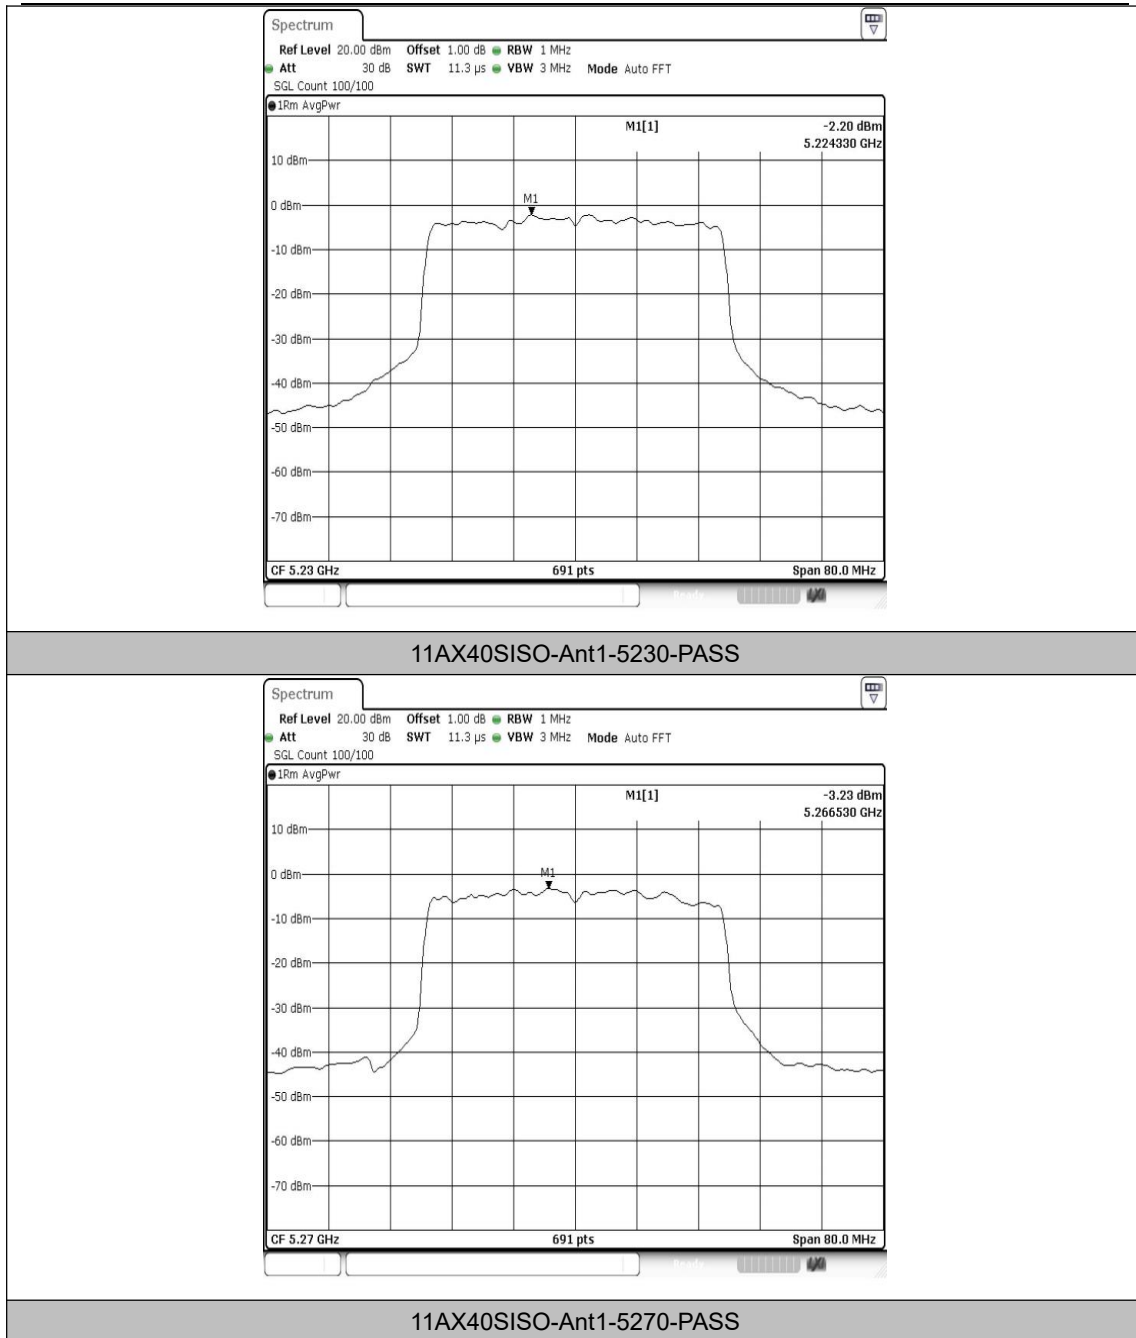


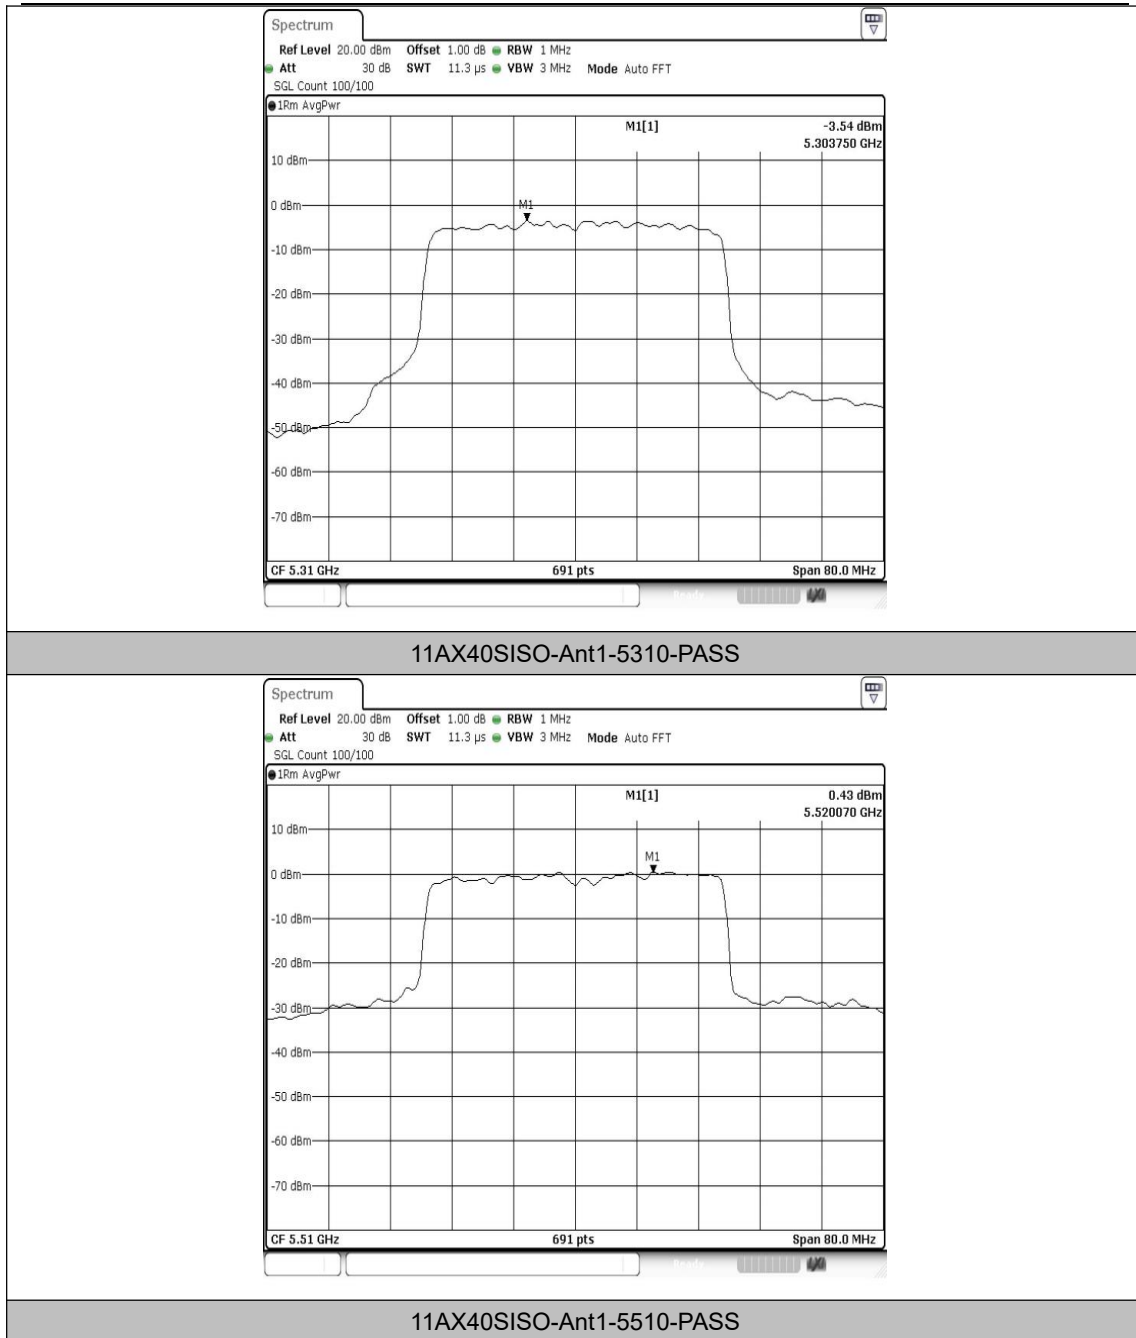

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

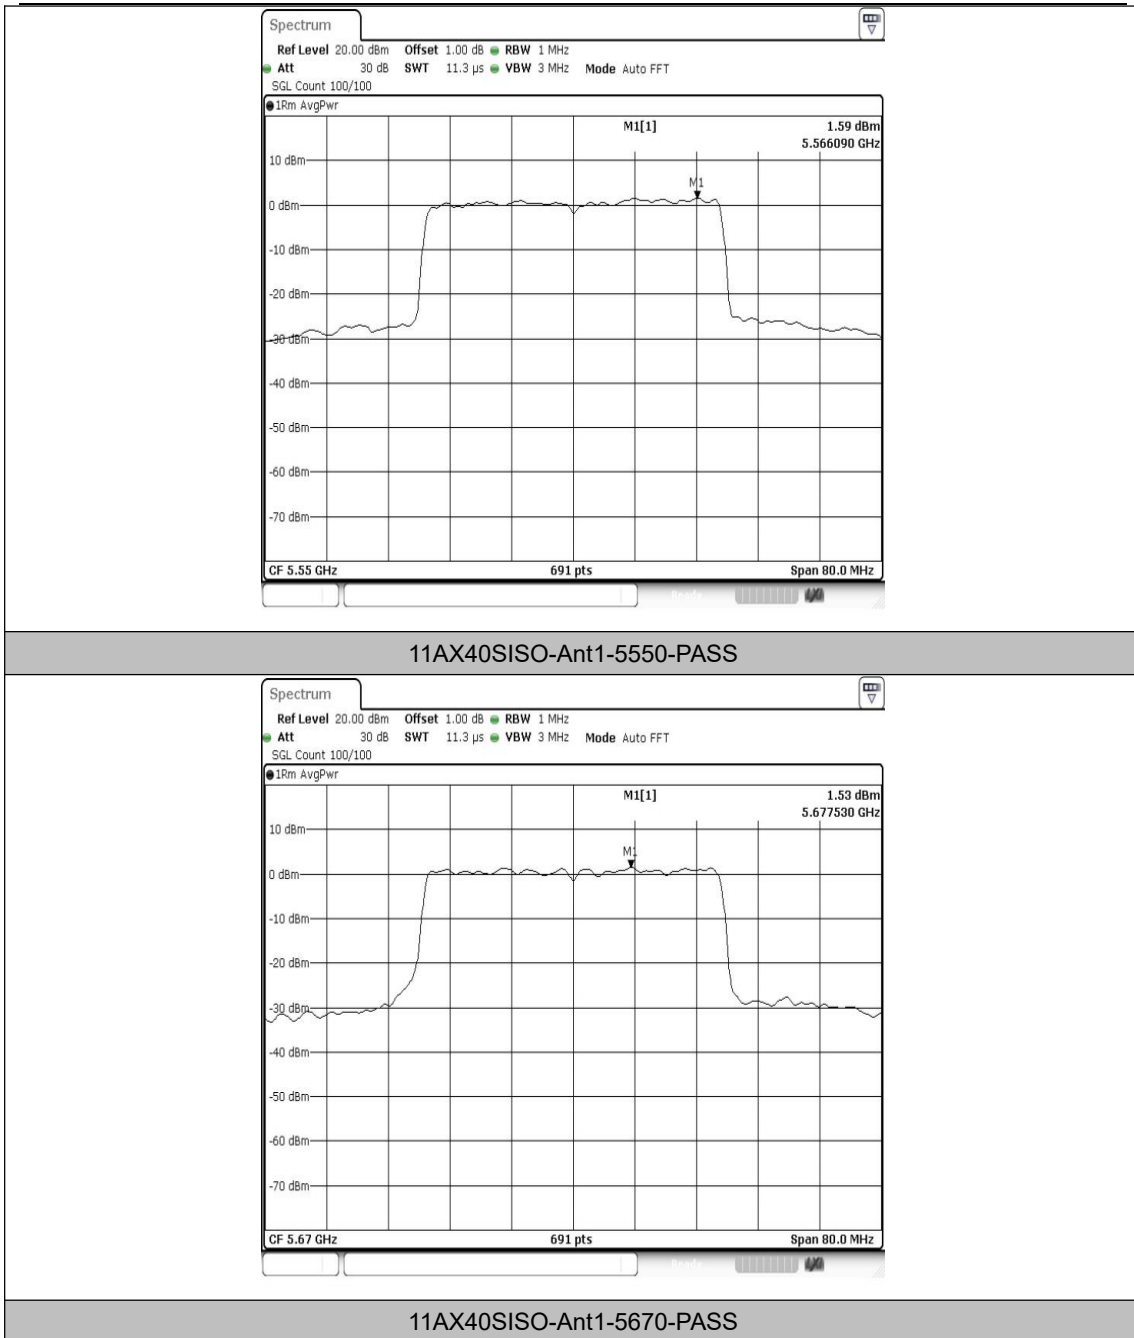

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

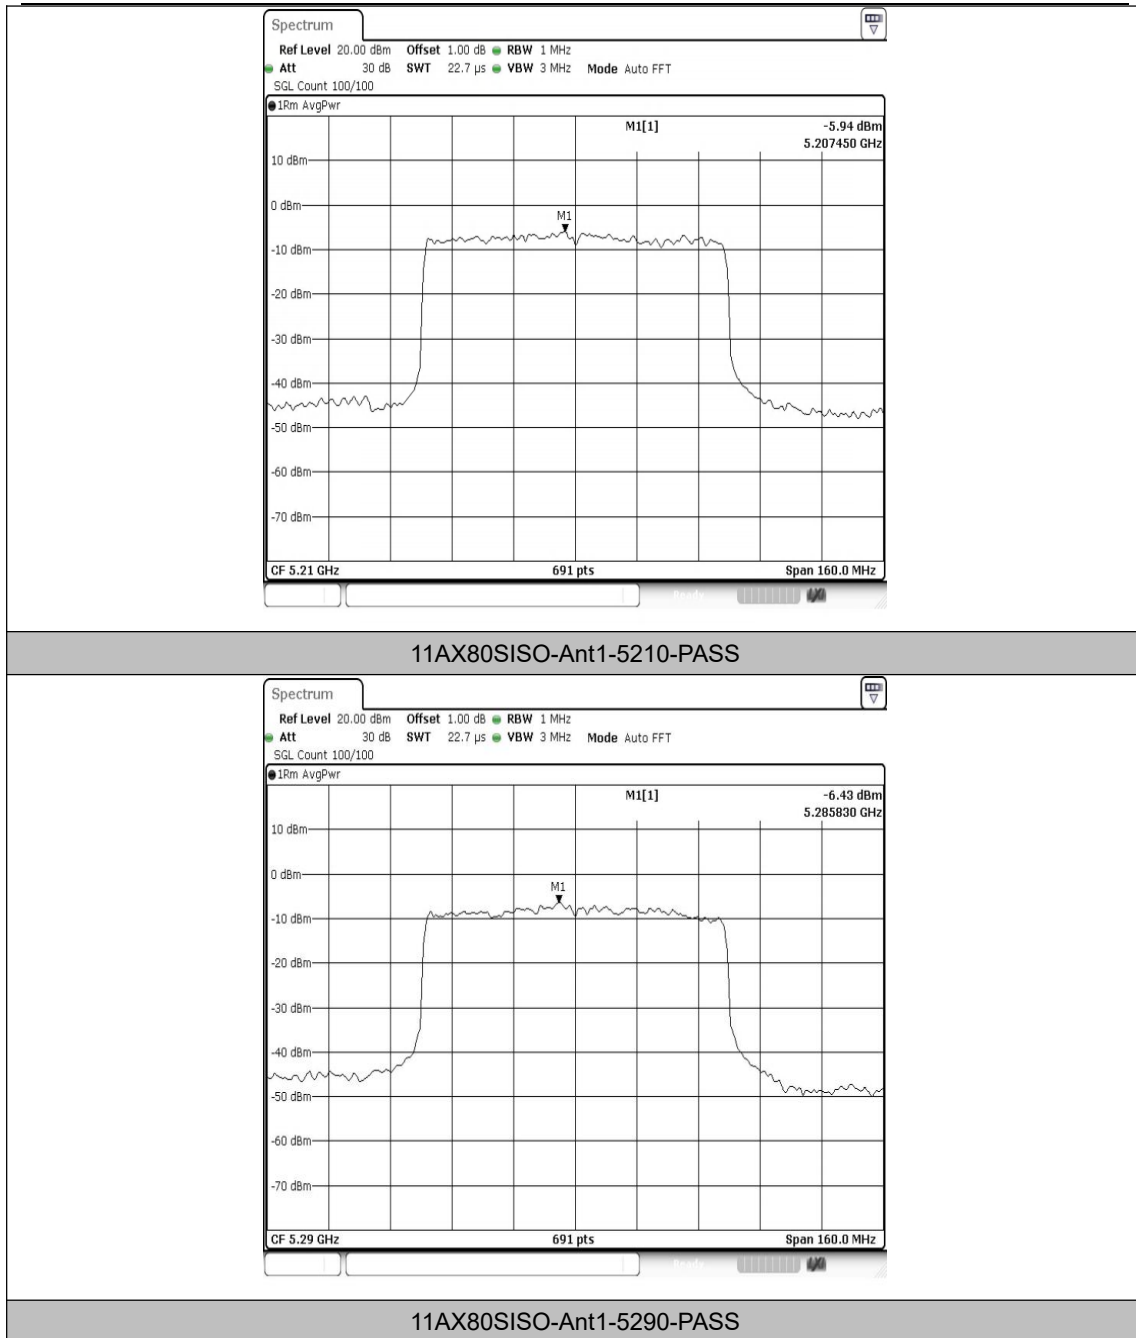

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com

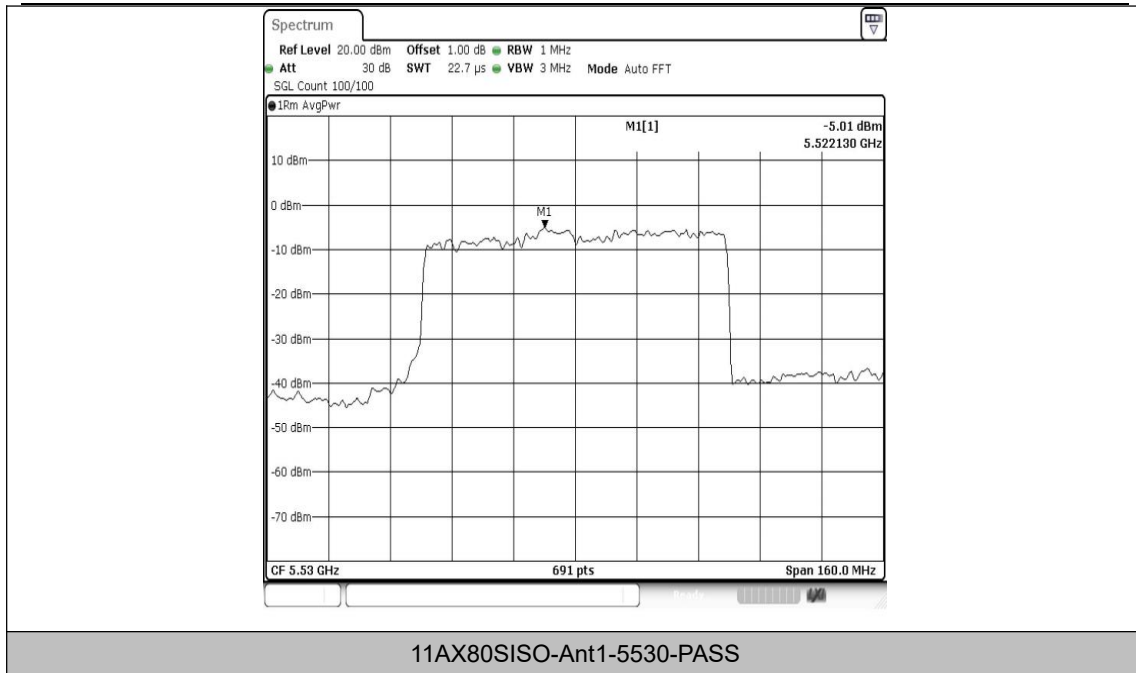


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com


Test Graphs B4

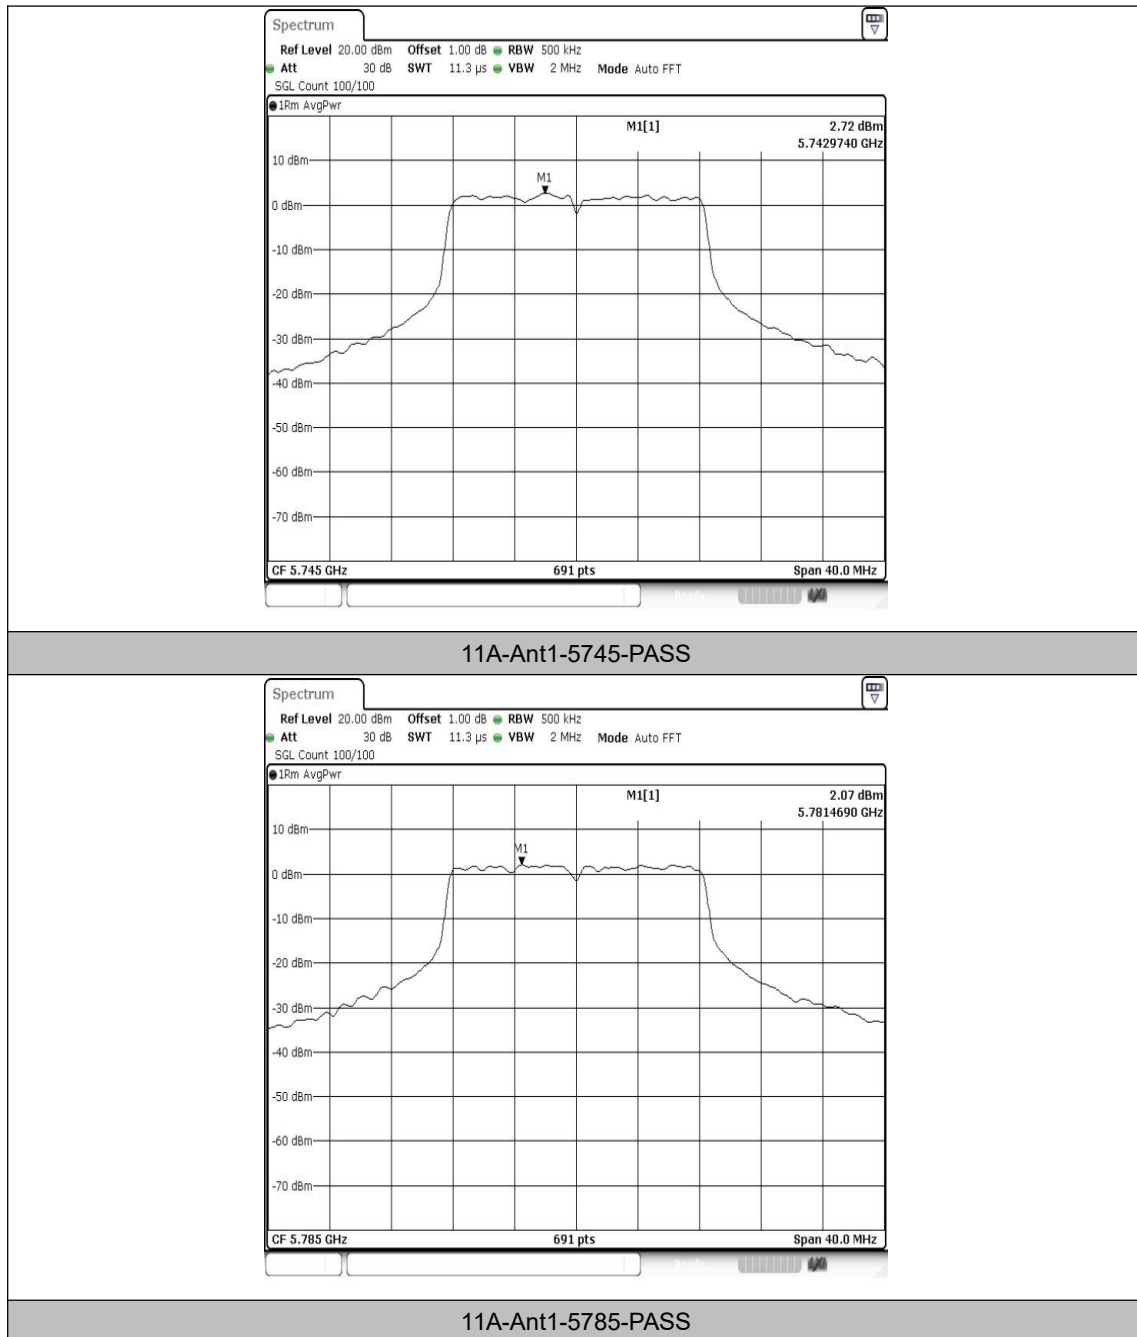

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

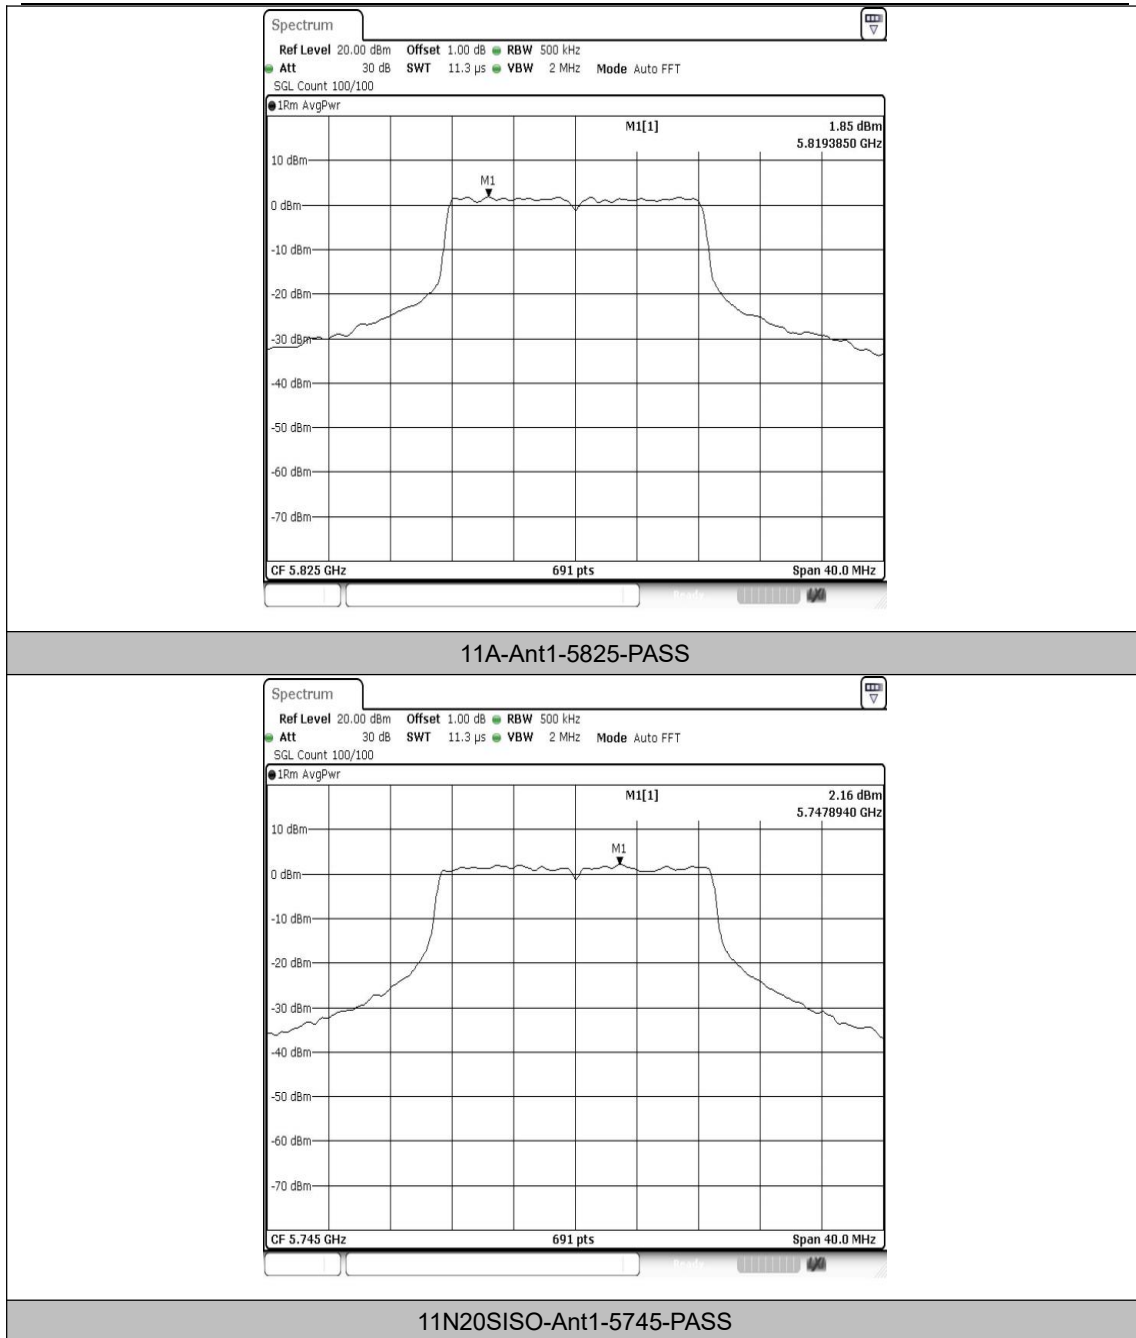

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

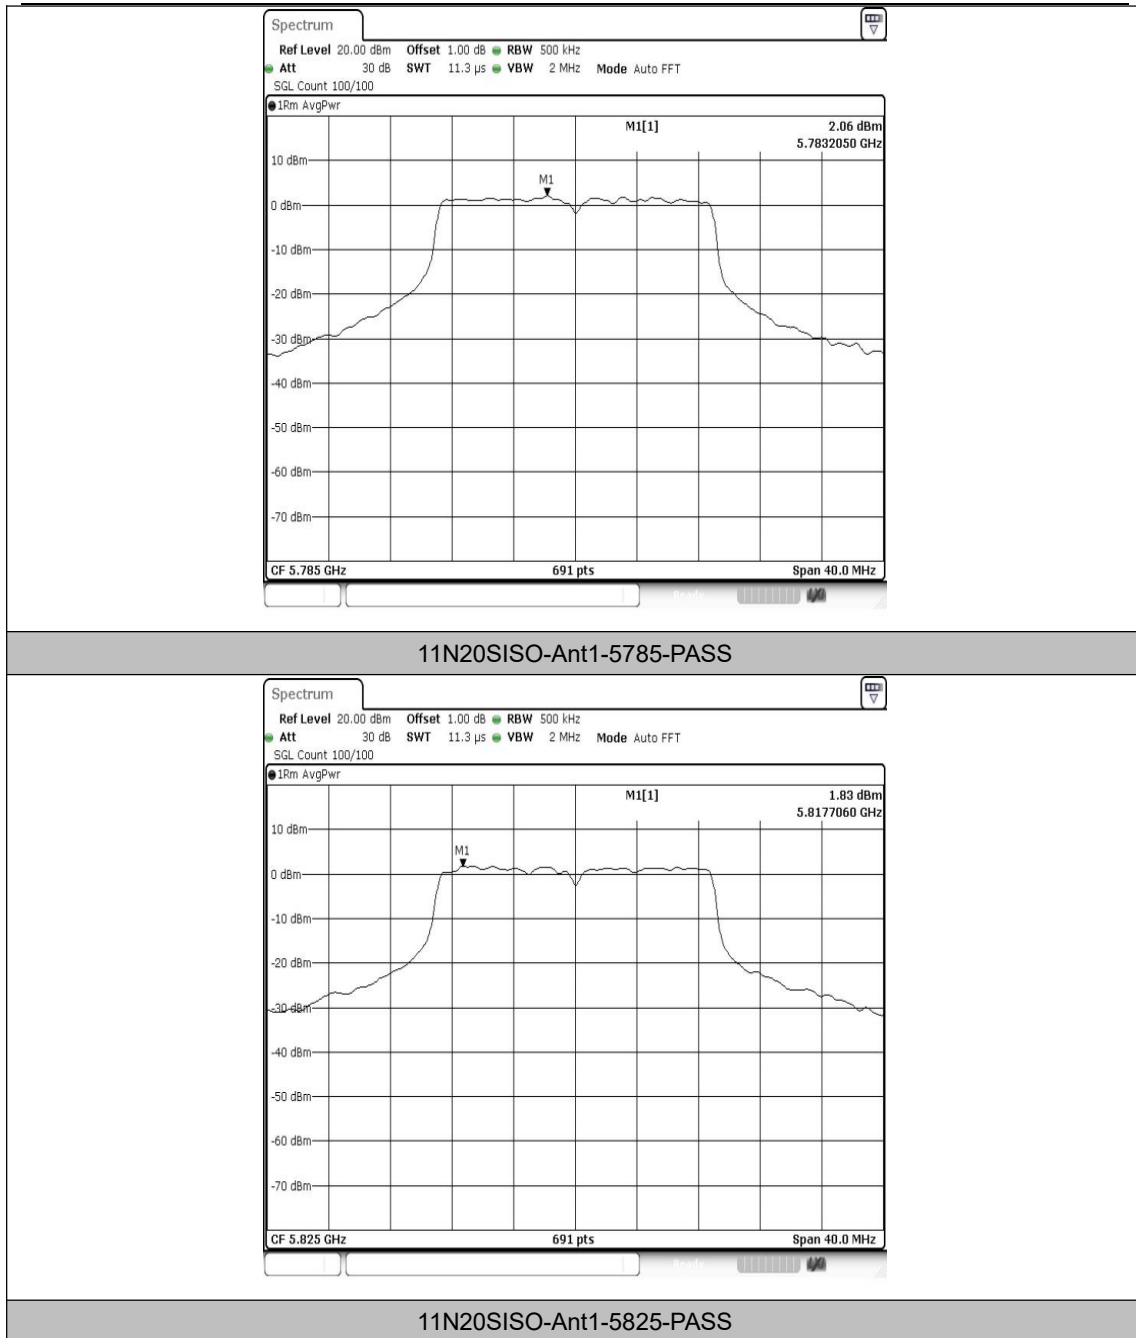


Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com

Hotline
400-003-0500
www.anbotek.com

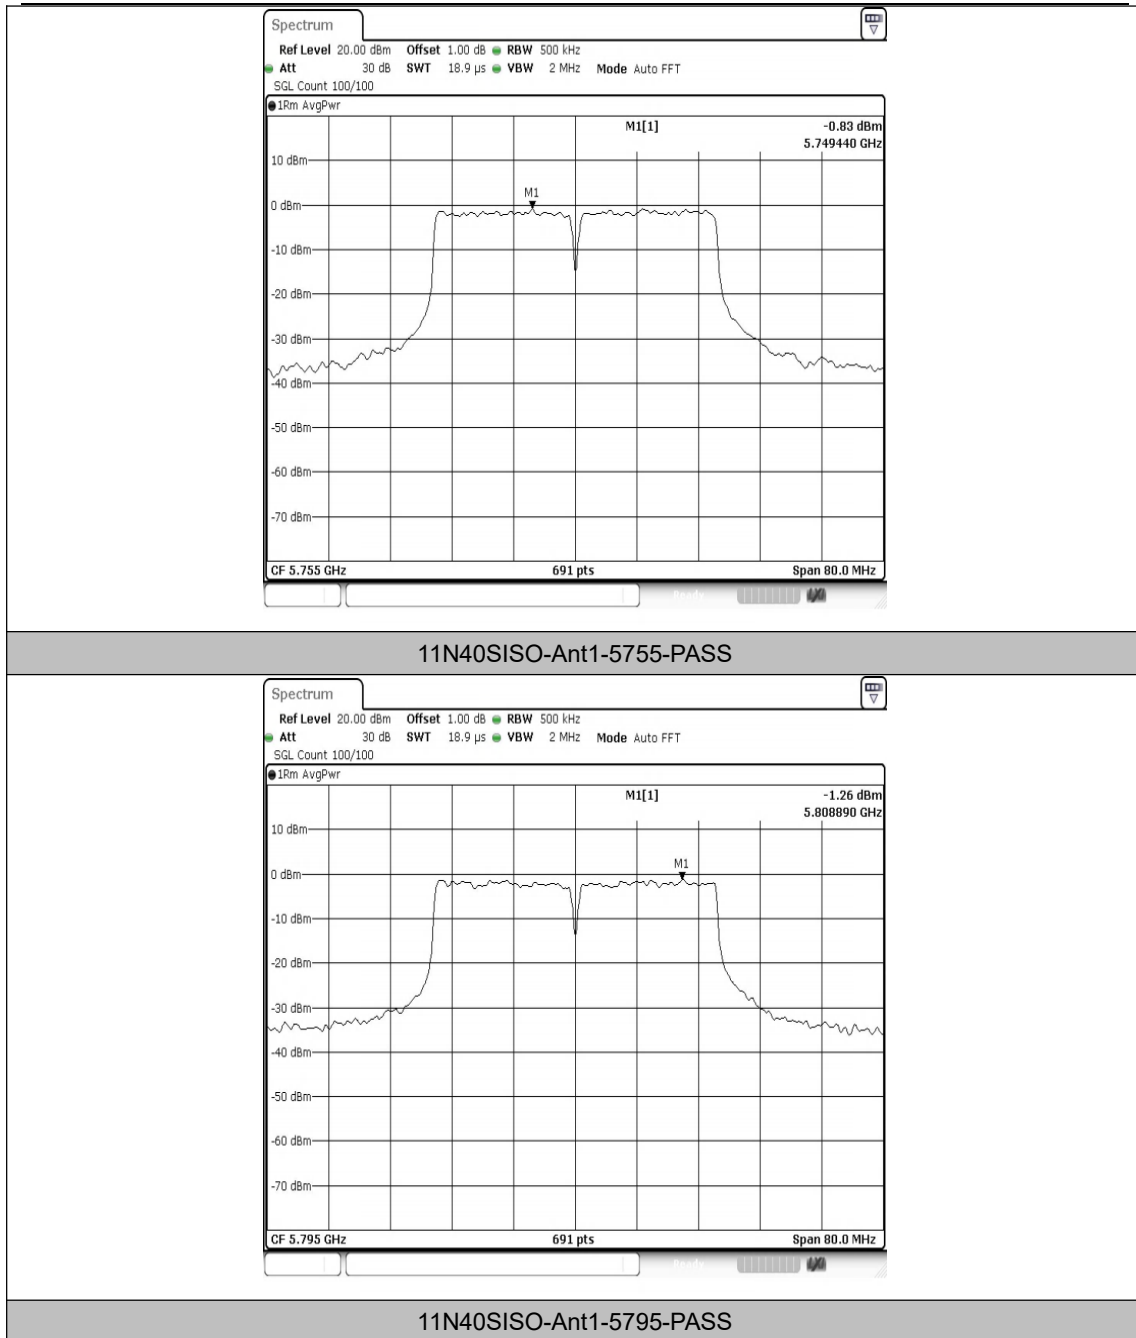


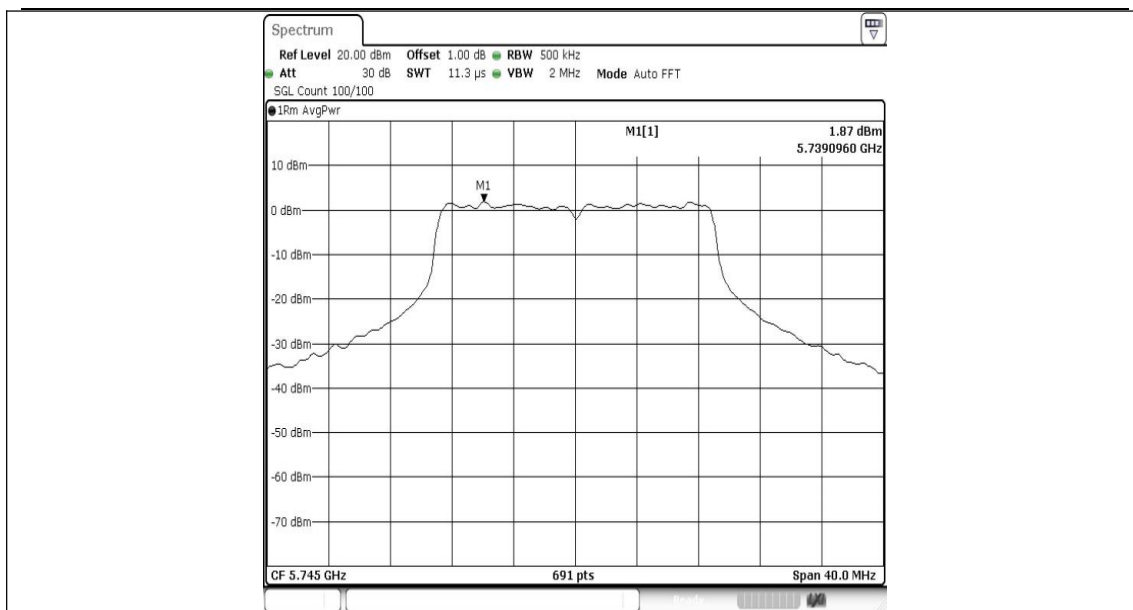

11AC20SISO-Ant1-5745-PASS

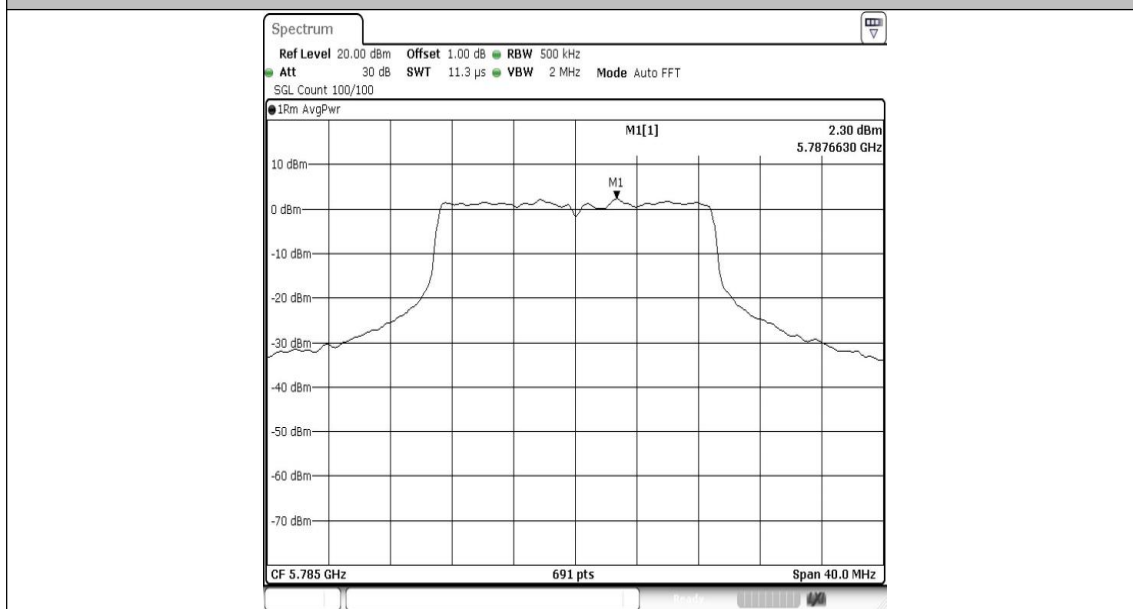


11AC20SISO-Ant1-5785-PASS

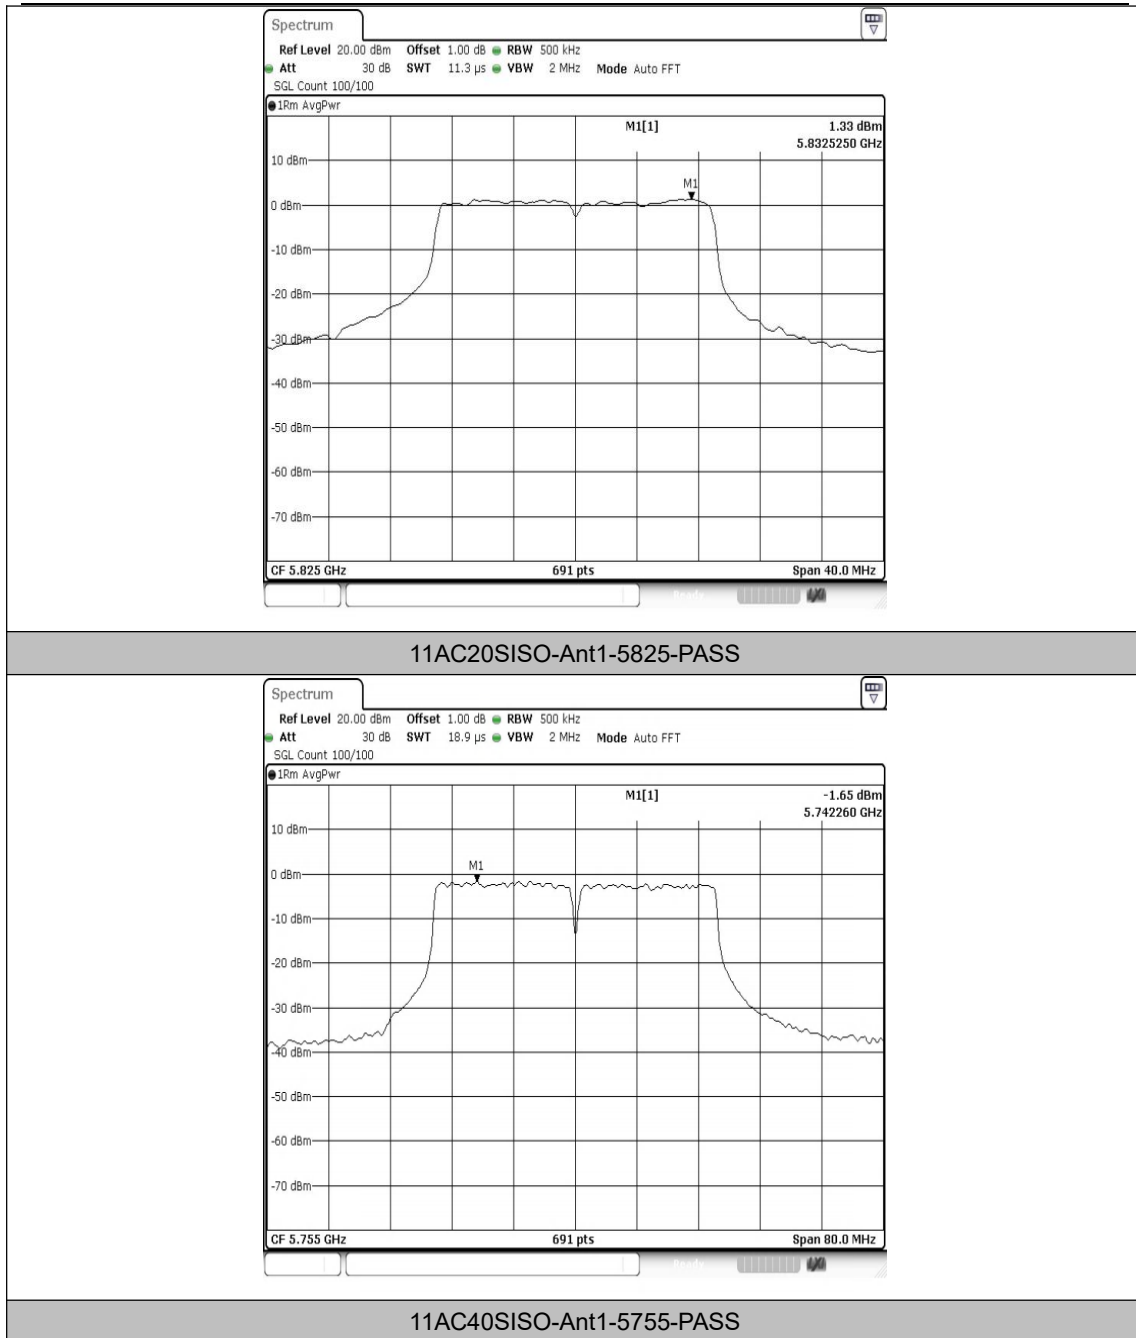


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

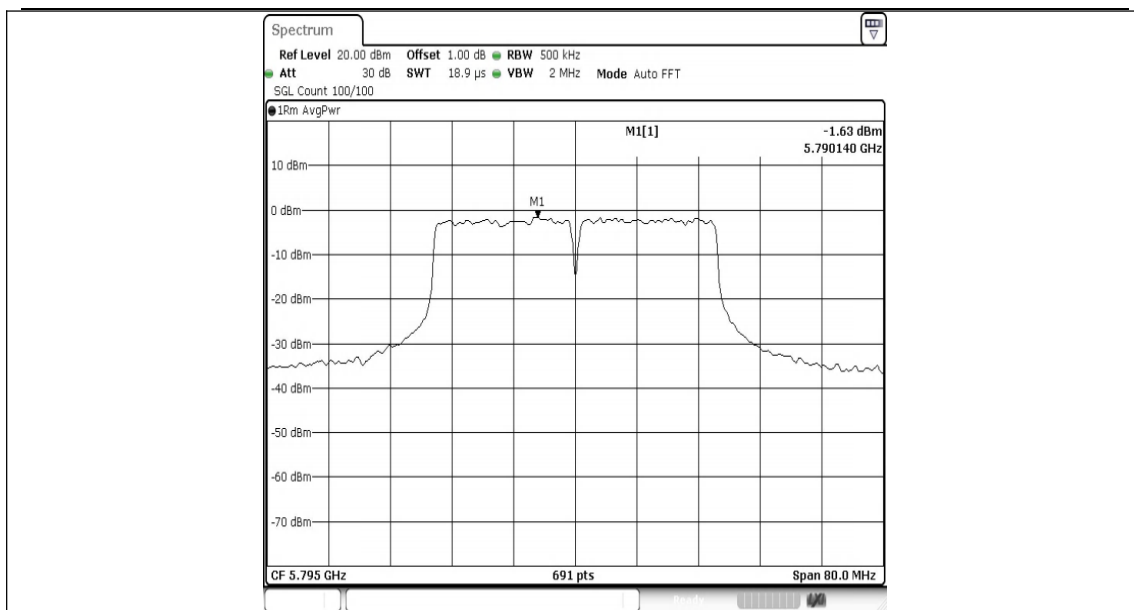

11AC40SISO-Ant1-5795-PASS

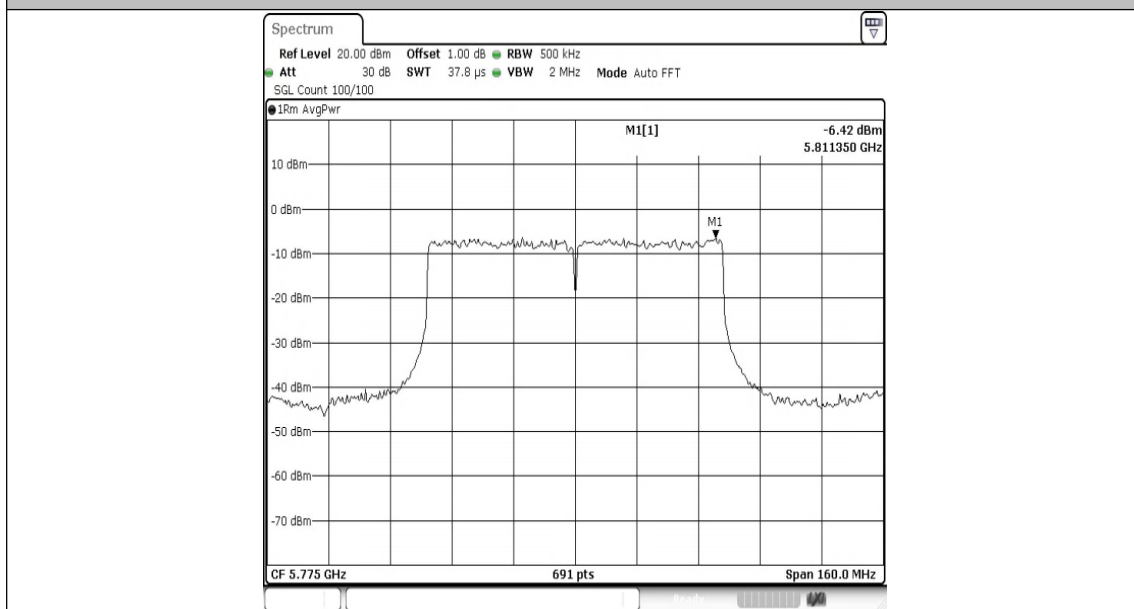


11AC80SISO-Ant1-5775-PASS

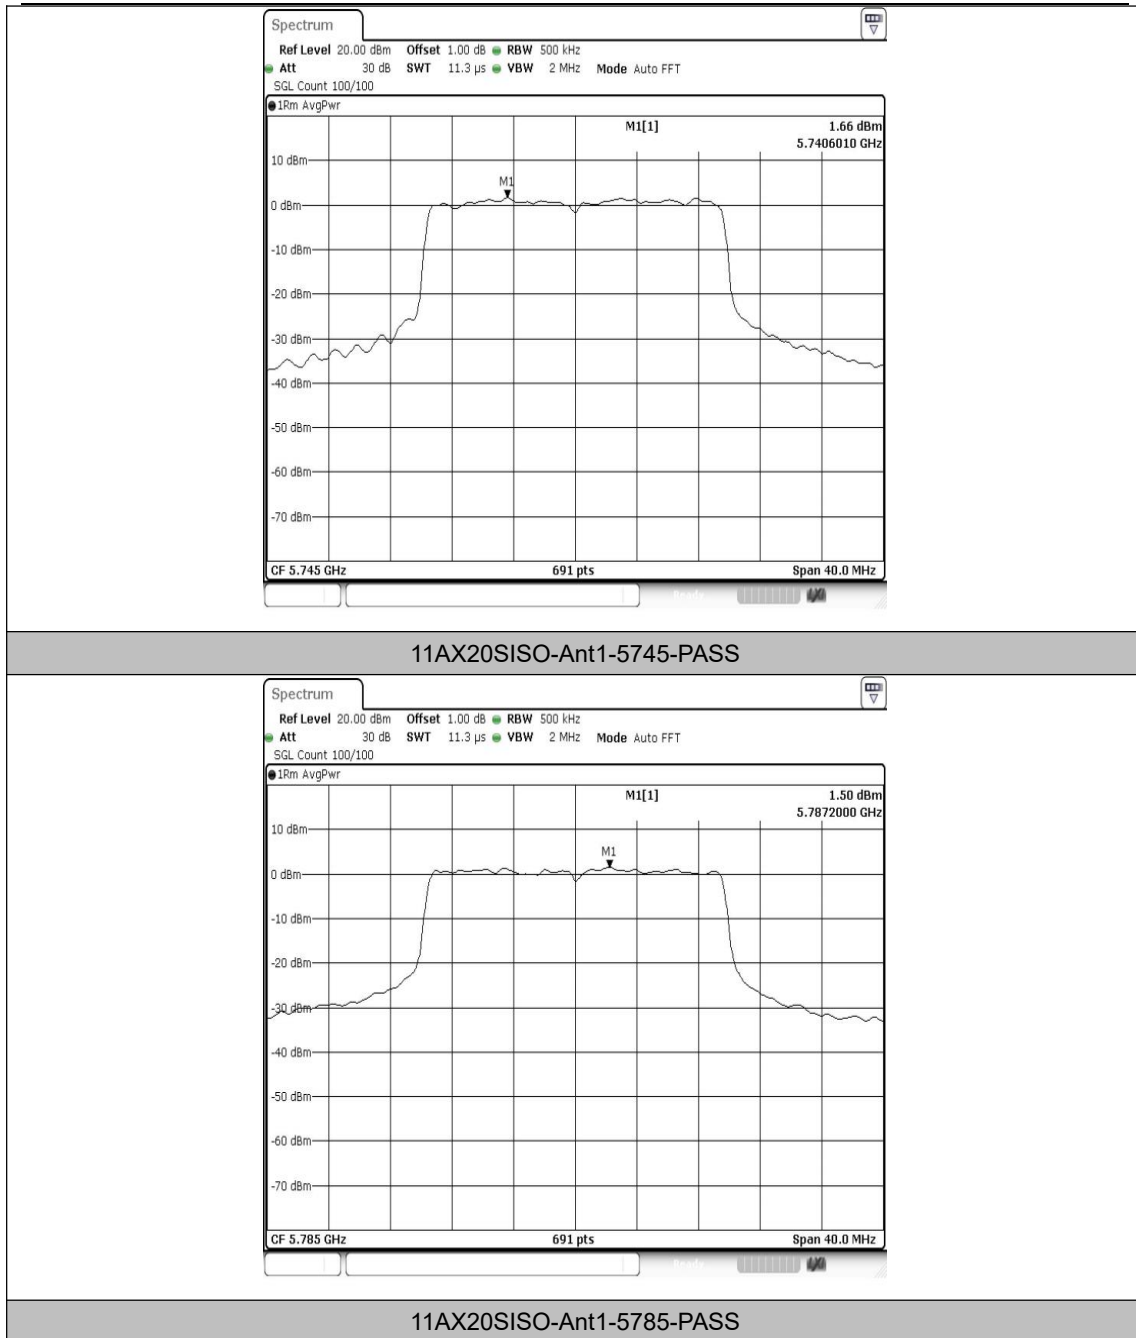

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com


 Hotline
400-003-0500
www.anbotek.com

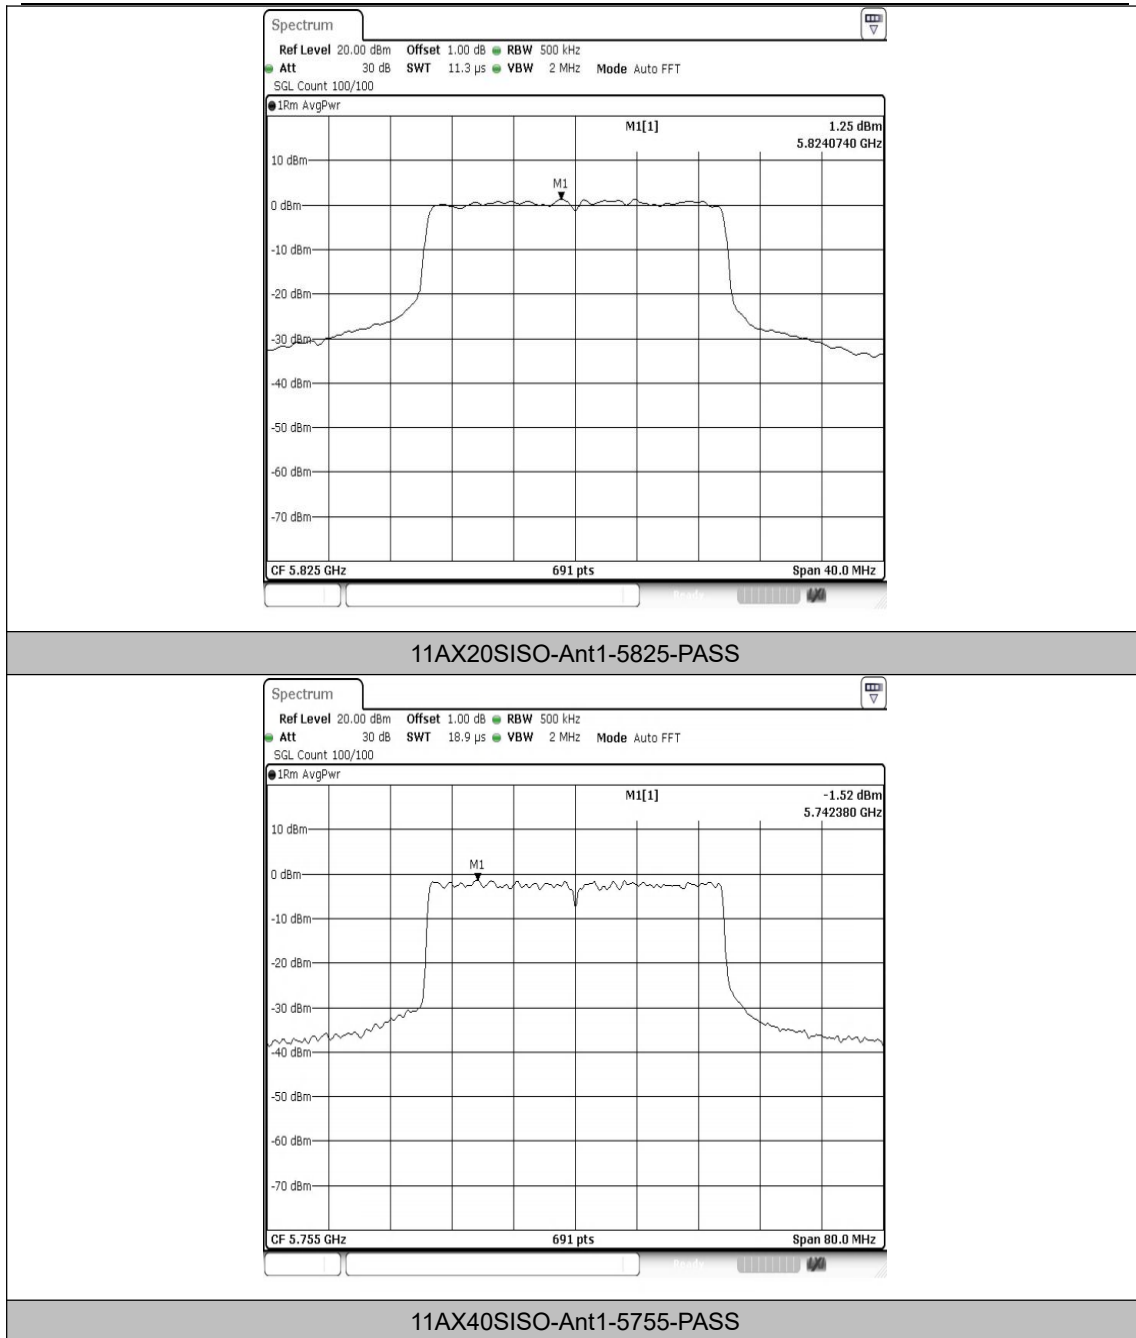

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com

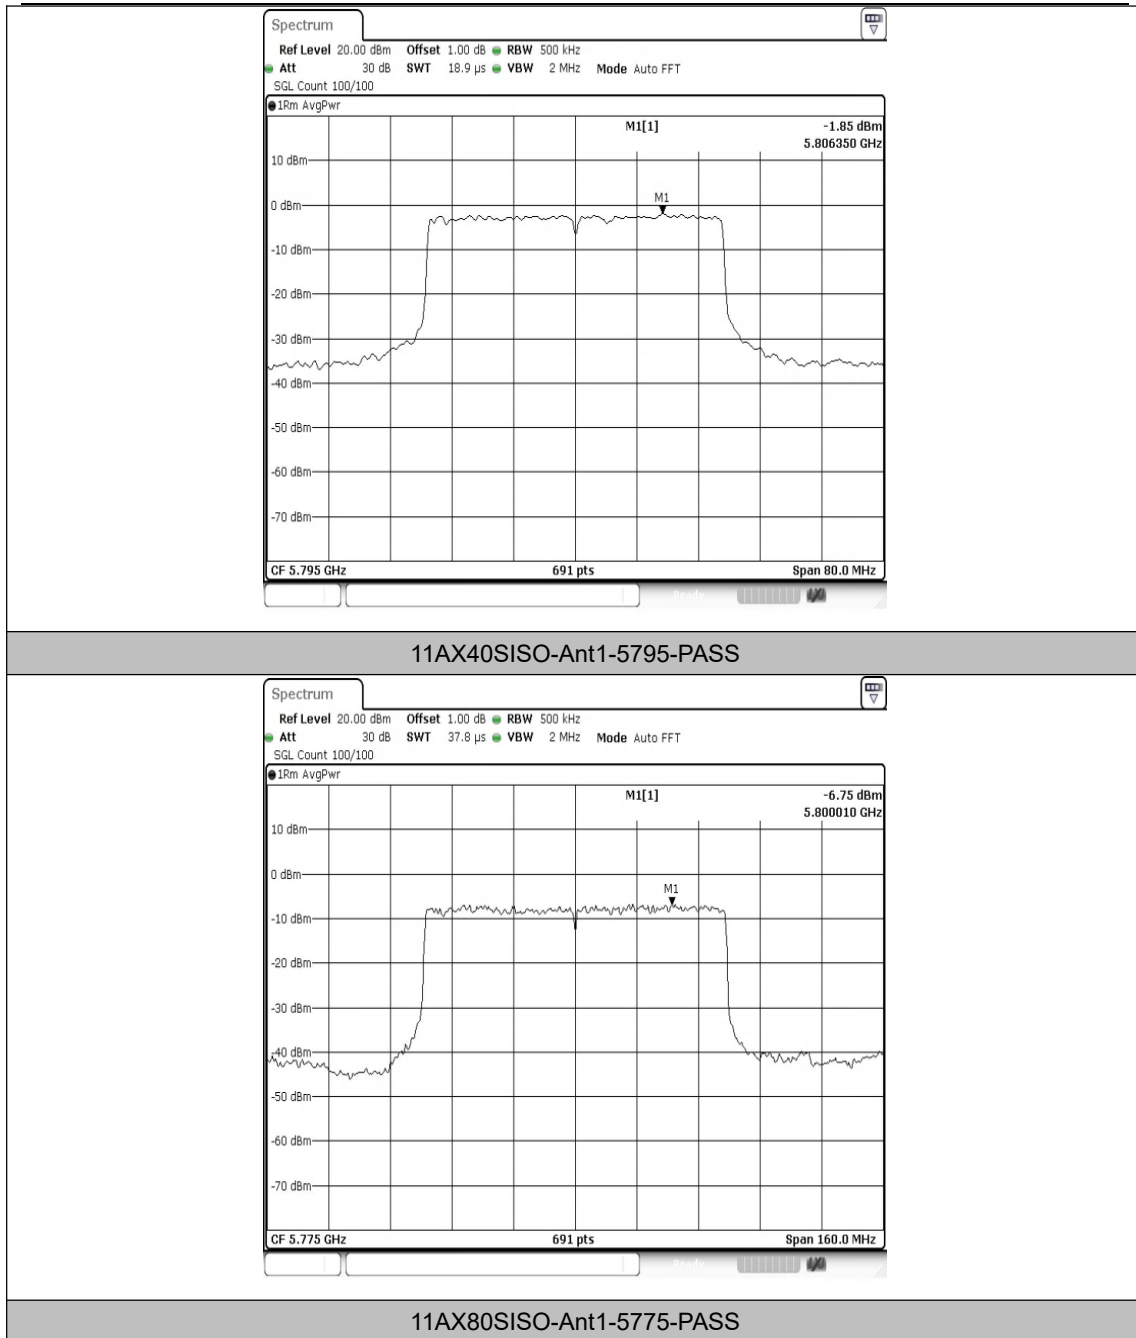

Appendix E: Band edge measurements

Test Result B1/2/3

Test Mode	Antenna	ChName	Frequency[MHz]	Result[dBm]	Limit[dBm]	Verdict
11A	Ant1	Low	5180	-30.95	≤-27	PASS
11A	Ant1	High	5320	-33.51	≤-27	PASS
11A	Ant1	Low	5500	-39.6	≤-27	PASS
11A	Ant1	High	5700	-39.92	≤-27	PASS
11N20SISO	Ant1	Low	5180	-34.37	≤-27	PASS
11N20SISO	Ant1	High	5320	-35.1	≤-27	PASS
11N20SISO	Ant1	Low	5500	-39.27	≤-27	PASS
11N20SISO	Ant1	High	5700	-40.72	≤-27	PASS
11N40SISO	Ant1	Low	5190	-34.9	≤-27	PASS
11N40SISO	Ant1	High	5310	-29.99	≤-27	PASS
11N40SISO	Ant1	Low	5510	-39.9	≤-27	PASS
11N40SISO	Ant1	High	5670	-42.46	≤-27	PASS
11AC20SISO	Ant1	Low	5180	-29.89	≤-27	PASS
11AC20SISO	Ant1	High	5320	-30.73	≤-27	PASS
11AC20SISO	Ant1	Low	5500	-40.97	≤-27	PASS
11AC20SISO	Ant1	High	5700	-40.38	≤-27	PASS
11AC40SISO	Ant1	Low	5190	-35.13	≤-27	PASS
11AC40SISO	Ant1	High	5310	-32.42	≤-27	PASS
11AC40SISO	Ant1	Low	5510	-39.5	≤-27	PASS
11AC40SISO	Ant1	High	5670	-42.1	≤-27	PASS
11AC80SISO	Ant1	Low	5210	-33.47	≤-27	PASS
11AC80SISO	Ant1	High	5290	-28.21	≤-27	PASS
11AC80SISO	Ant1	Low	5530	-31.96	≤-27	PASS
11AX20SISO	Ant1	Low	5180	-27.85	≤-27	PASS
11AX20SISO	Ant1	High	5320	-32.85	≤-27	PASS
11AX20SISO	Ant1	Low	5500	-40.58	≤-27	PASS
11AX20SISO	Ant1	High	5700	-39.71	≤-27	PASS
11AX40SISO	Ant1	Low	5190	-34.97	≤-27	PASS
11AX40SISO	Ant1	High	5310	-33.6	≤-27	PASS
11AX40SISO	Ant1	Low	5510	-39.59	≤-27	PASS
11AX40SISO	Ant1	High	5670	-41.41	≤-27	PASS
11AX80SISO	Ant1	Low	5210	-35.31	≤-27	PASS
11AX80SISO	Ant1	High	5290	-30.23	≤-27	PASS
11AX80SISO	Ant1	Low	5530	-36.87	≤-27	PASS

Note: The margin plus the antenna gain also meets the limit.

Test Result B4

Test Mode	Antenna	Ch. Name	Frequency [MHz]	FreqRange [MHz]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	Low	5745	5720~5725	-16.19	≤16.36	PASS
11A	Ant1	Low	5745	5700~5720	-17.64	≤15.60	PASS
11A	Ant1	Low	5745	5650~5700	-42.47	≤-26.75	PASS
11A	Ant1	Low	5745	5760~5650	-41.94	≤-27	PASS
11A	Ant1	High	5825	5850~5855	-18.21	≤15.65	PASS
11A	Ant1	High	5825	5855~5875	-17.79	≤15.50	PASS
11A	Ant1	High	5825	5875~5925	-40.64	≤-25.42	PASS
11A	Ant1	High	5825	5925~5935	-40.38	≤-27	PASS
11N20SISO	Ant1	Low	5745	5720~5725	-19.75	≤15.98	PASS
11N20SISO	Ant1	Low	5745	5700~5720	-19.92	≤15.18	PASS
11N20SISO	Ant1	Low	5745	5650~5700	-42.36	≤-26.38	PASS
11N20SISO	Ant1	Low	5745	5760~5650	-41.98	≤-27	PASS
11N20SISO	Ant1	High	5825	5850~5855	-19.52	≤15.65	PASS
11N20SISO	Ant1	High	5825	5855~5875	-16.53	≤15.44	PASS
11N20SISO	Ant1	High	5825	5875~5925	-39.21	≤-26.44	PASS
11N20SISO	Ant1	High	5825	5925~5935	-38.04	≤-27	PASS
11N40SISO	Ant1	Low	5755	5720~5725	-18.7	≤15.90	PASS
11N40SISO	Ant1	Low	5755	5700~5720	-19.86	≤10.71	PASS
11N40SISO	Ant1	Low	5755	5650~5700	-34.39	≤-26.94	PASS
11N40SISO	Ant1	Low	5755	5780~5650	-34.43	≤-27	PASS
11N40SISO	Ant1	High	5795	5850~5855	-22.92	≤15.85	PASS
11N40SISO	Ant1	High	5795	5855~5875	-19.03	≤13.35	PASS
11N40SISO	Ant1	High	5795	5875~5925	-39.47	≤-26.97	PASS
11N40SISO	Ant1	High	5795	5925~5935	-38.48	≤-27	PASS
11AC20SISO	Ant1	Low	5745	5720~5725	-20.16	≤15.98	PASS
11AC20SISO	Ant1	Low	5745	5700~5720	-20.29	≤15.60	PASS
11AC20SISO	Ant1	Low	5745	5650~5700	-38.04	≤-26.01	PASS
11AC20SISO	Ant1	Low	5745	5760~5650	-40.06	≤-27	PASS
11AC20SISO	Ant1	High	5825	5850~5855	-16.56	≤15.65	PASS
11AC20SISO	Ant1	High	5825	5855~5875	-16.32	≤15.44	PASS
11AC20SISO	Ant1	High	5825	5875~5925	-40.96	≤-26.87	PASS
11AC20SISO	Ant1	High	5825	5925~5935	-37.89	≤-27	PASS
11AC40SISO	Ant1	Low	5755	5720~5725	-16.55	≤15.90	PASS
11AC40SISO	Ant1	Low	5755	5700~5720	-16.85	≤13.28	PASS
11AC40SISO	Ant1	Low	5755	5650~5700	-33.02	≤-24.76	PASS
11AC40SISO	Ant1	Low	5755	5780~5650	-34.84	≤-27	PASS
11AC40SISO	Ant1	High	5795	5850~5855	-21.93	≤16.39	PASS
11AC40SISO	Ant1	High	5795	5855~5875	-18.82	≤12.75	PASS
11AC40SISO	Ant1	High	5795	5875~5925	-37.61	≤-25.91	PASS

Shenzhen Anbotek Compliance Laboratory Limited




11AC40SISO	Ant1	High	5795	5925~5935	-39.88	≤-27	PASS
11AC80SISO	Ant1	Low	5775	5720~5725	-15.79	≤15.67	PASS
11AC80SISO	Ant1	Low	5775	5700~5720	-15.93	≤10.20	PASS
11AC80SISO	Ant1	Low	5775	5650~5700	-25.6	≤-25.21	PASS
11AC80SISO	Ant1	Low	5775	5800~5650	-28.32	≤-27	PASS
11AC80SISO	Ant1	High	5775	5850~5855	-18.74	≤15.98	PASS
11AC80SISO	Ant1	High	5775	5855~5875	-15.84	≤11.22	PASS
11AC80SISO	Ant1	High	5775	5875~5925	-32.93	≤-26.46	PASS
11AC80SISO	Ant1	High	5775	5925~5935	-33.3	≤-27	PASS
11AX20SISO	Ant1	Low	5745	5720~5725	-18.03	≤15.98	PASS
11AX20SISO	Ant1	Low	5745	5700~5720	-18.05	≤15.55	PASS
11AX20SISO	Ant1	Low	5745	5650~5700	-36.81	≤-26.26	PASS
11AX20SISO	Ant1	Low	5745	5760~5650	-38.7	≤-27	PASS
11AX20SISO	Ant1	High	5825	5850~5855	-17.73	≤16.54	PASS
11AX20SISO	Ant1	High	5825	5855~5875	-22.65	≤11.39	PASS
11AX20SISO	Ant1	High	5825	5875~5925	-41.19	≤-26.73	PASS
11AX20SISO	Ant1	High	5825	5925~5935	-39.1	≤-27	PASS
11AX40SISO	Ant1	Low	5755	5720~5725	-18.5	≤15.90	PASS
11AX40SISO	Ant1	Low	5755	5700~5720	-18.21	≤14.38	PASS
11AX40SISO	Ant1	Low	5755	5650~5700	-33.29	≤-25.05	PASS
11AX40SISO	Ant1	Low	5755	5780~5650	-35.95	≤-27	PASS
11AX40SISO	Ant1	High	5795	5850~5855	-21.16	≤15.85	PASS
11AX40SISO	Ant1	High	5795	5855~5875	-23.05	≤10.54	PASS
11AX40SISO	Ant1	High	5795	5875~5925	-38.28	≤-25.02	PASS
11AX40SISO	Ant1	High	5795	5925~5935	-38.1	≤-27	PASS
11AX80SISO	Ant1	Low	5775	5720~5725	-22.43	≤15.67	PASS
11AX80SISO	Ant1	Low	5775	5700~5720	-23.3	≤10.64	PASS
11AX80SISO	Ant1	Low	5775	5650~5700	-33.56	≤-26.54	PASS
11AX80SISO	Ant1	Low	5775	5800~5650	-34.19	≤-27	PASS
11AX80SISO	Ant1	High	5775	5850~5855	-20.14	≤16.59	PASS
11AX80SISO	Ant1	High	5775	5855~5875	-20.31	≤11.52	PASS
11AX80SISO	Ant1	High	5775	5875~5925	-39.45	≤-26.86	PASS
11AX80SISO	Ant1	High	5775	5925~5935	-39.28	≤-27	PASS


Note: The margin plus the antenna gain also meets the limit.





Test Graphs B1/2/3

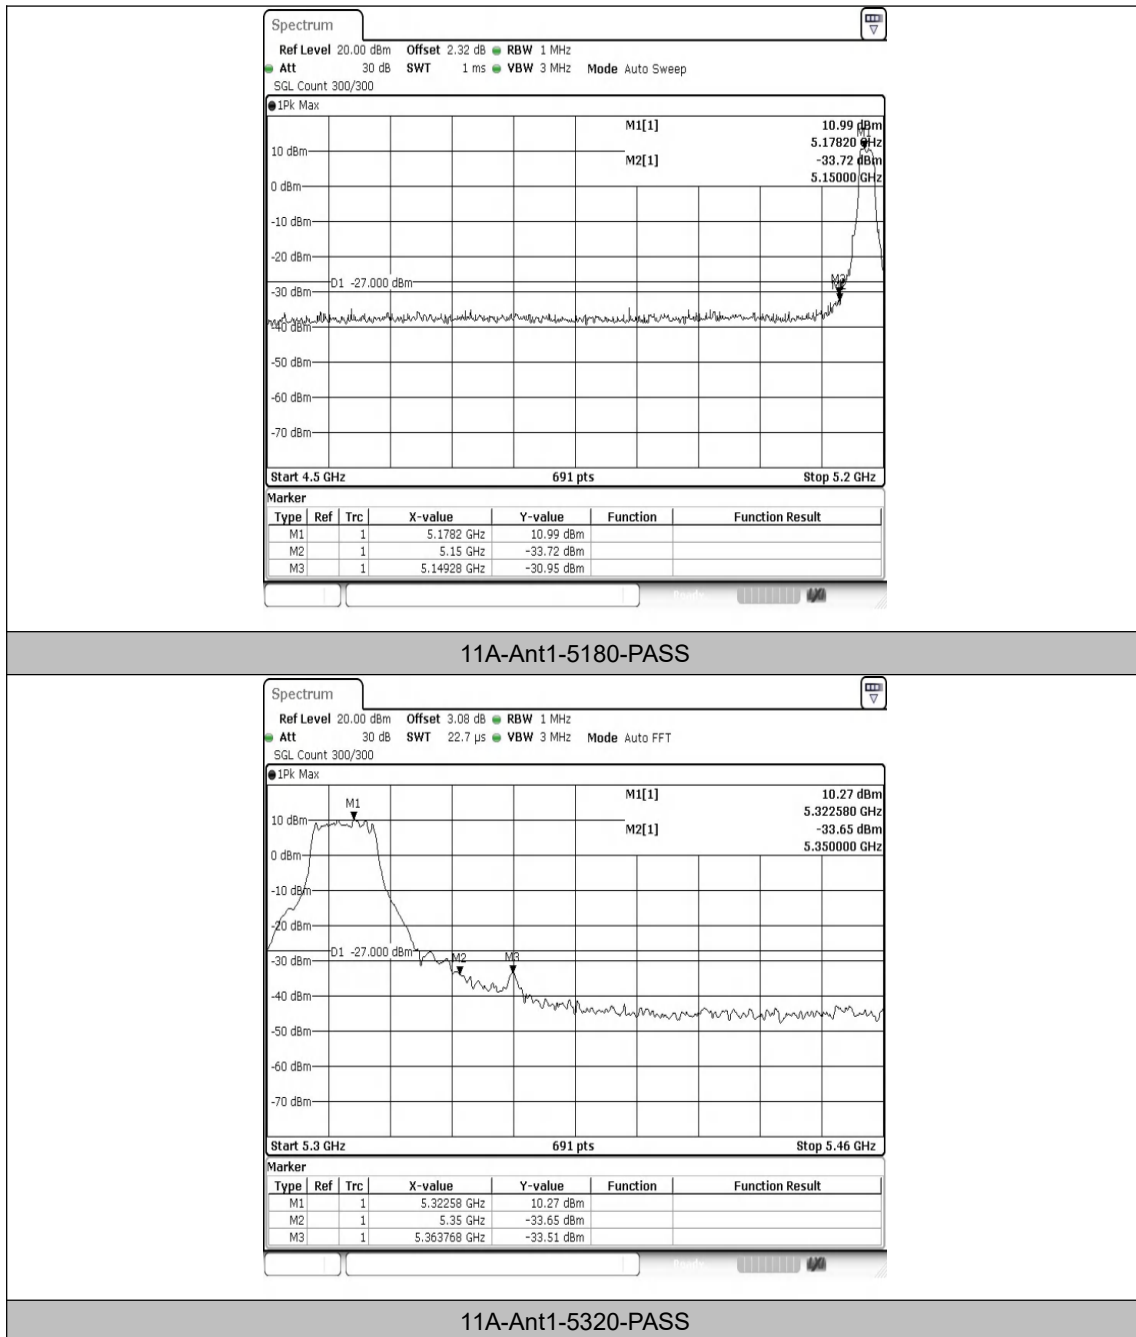

Shenzhen Anbotech Compliance Laboratory Limited

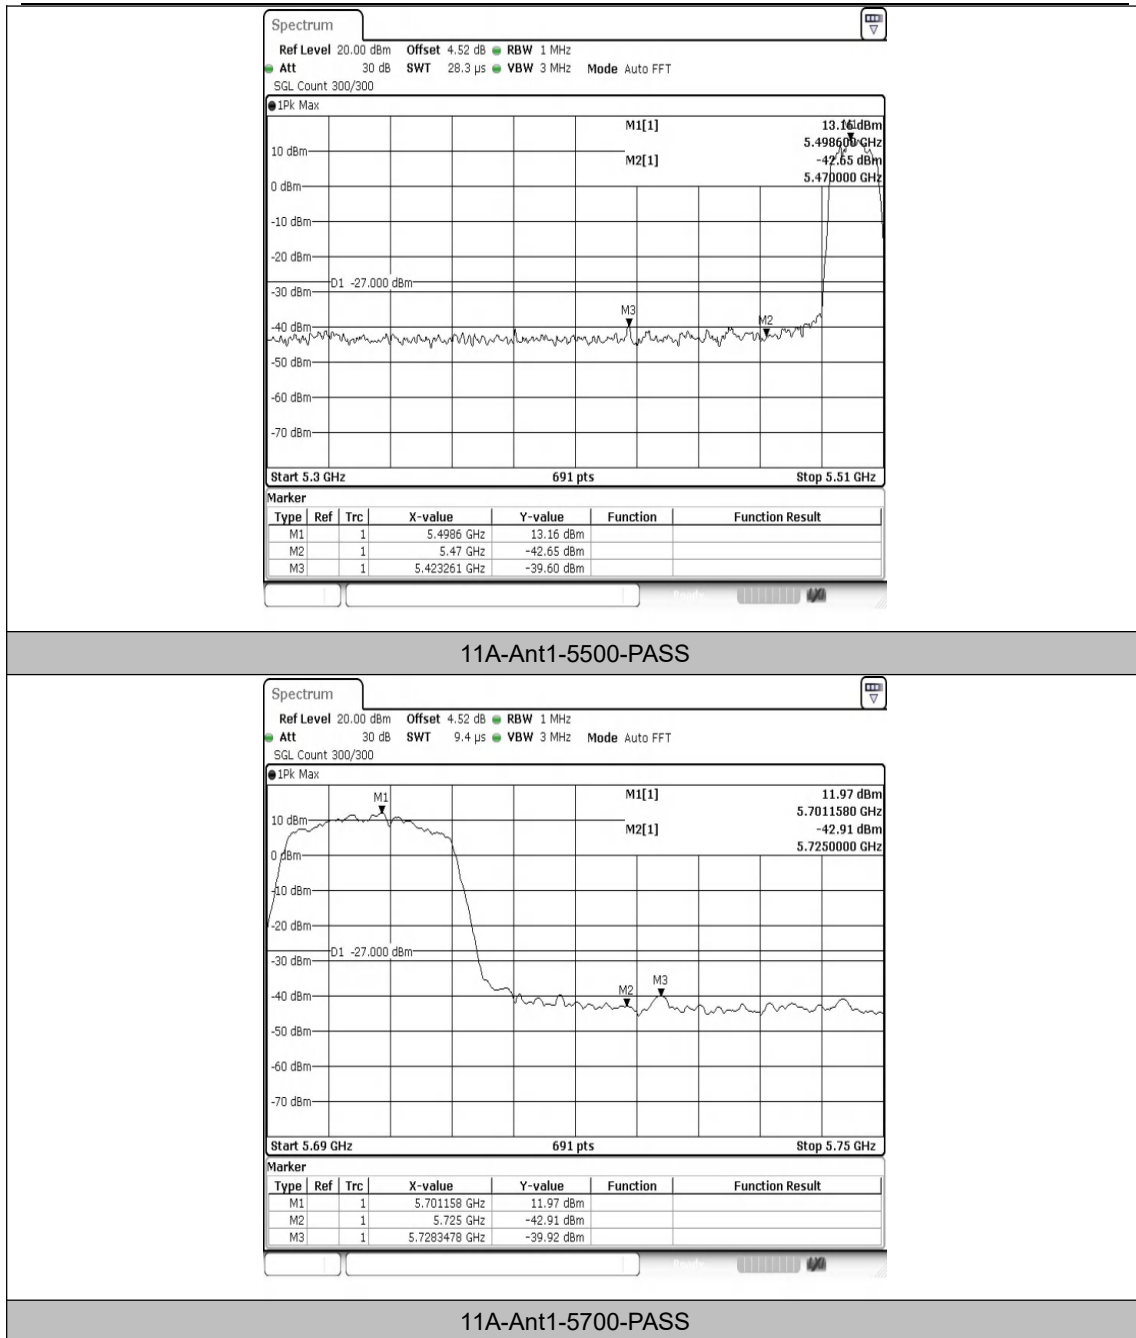

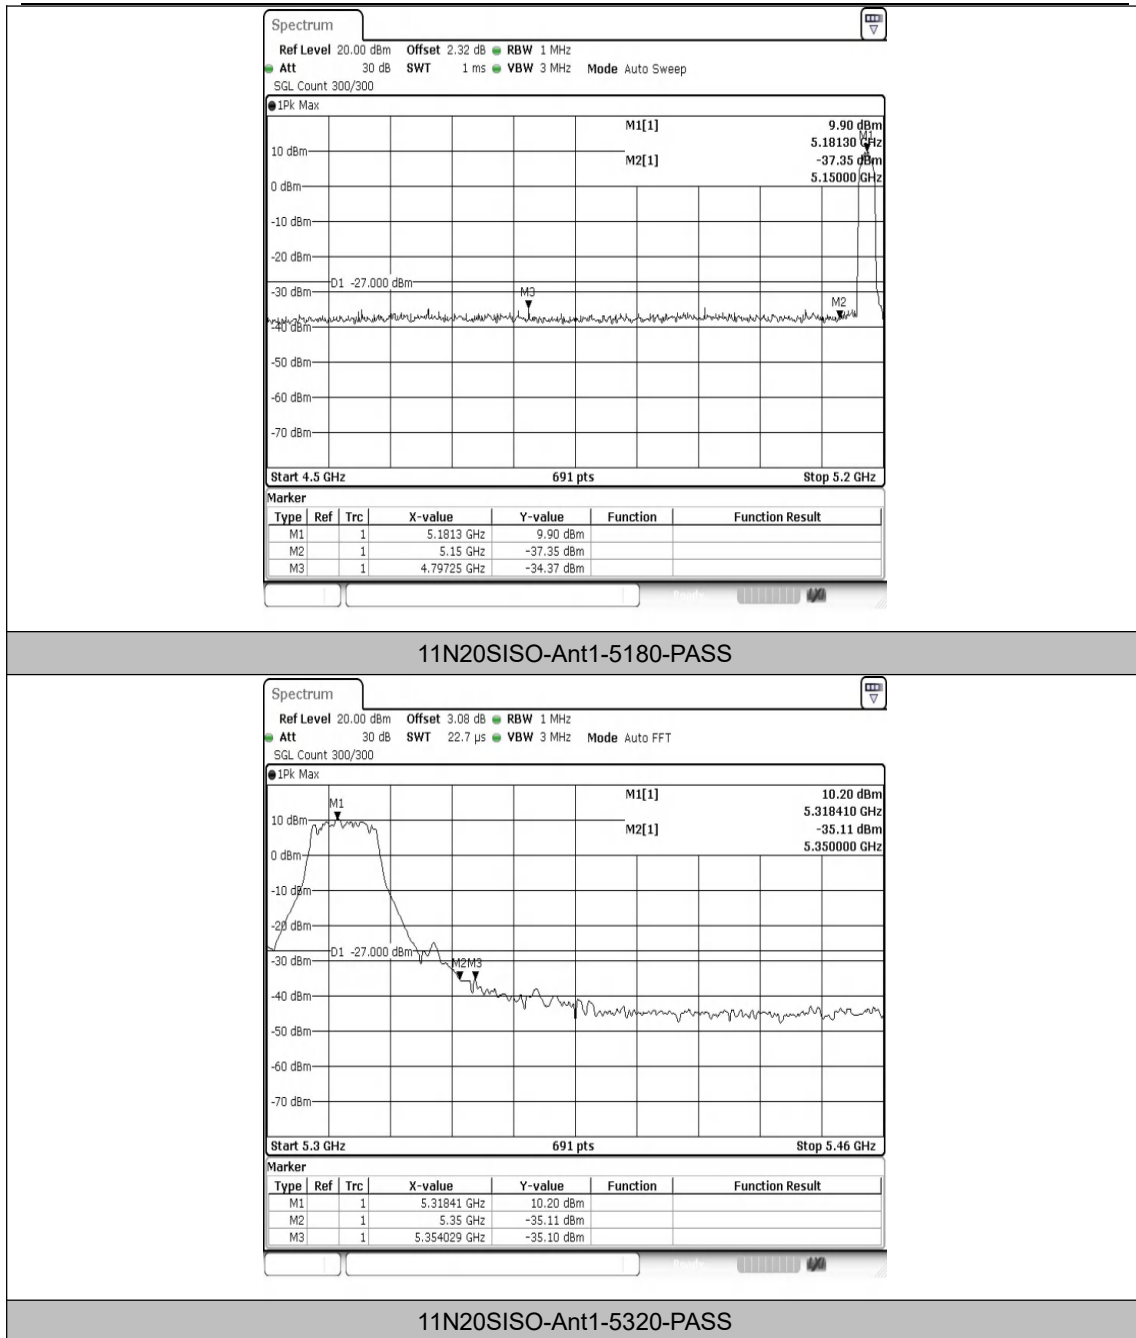


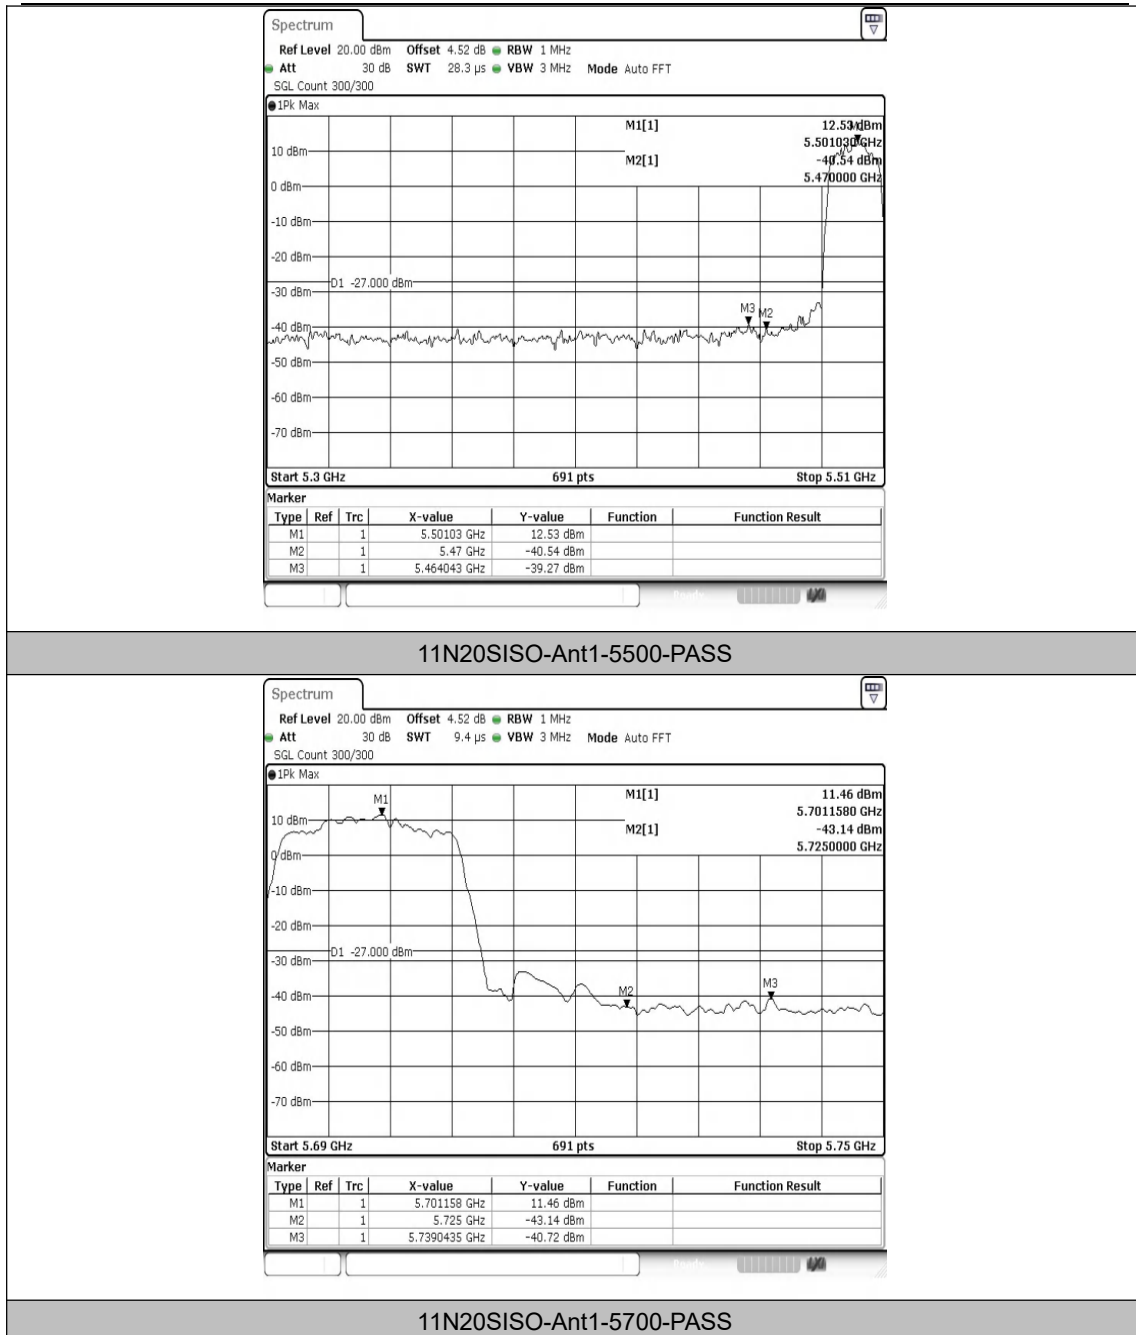



Shenzhen Anbotech Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

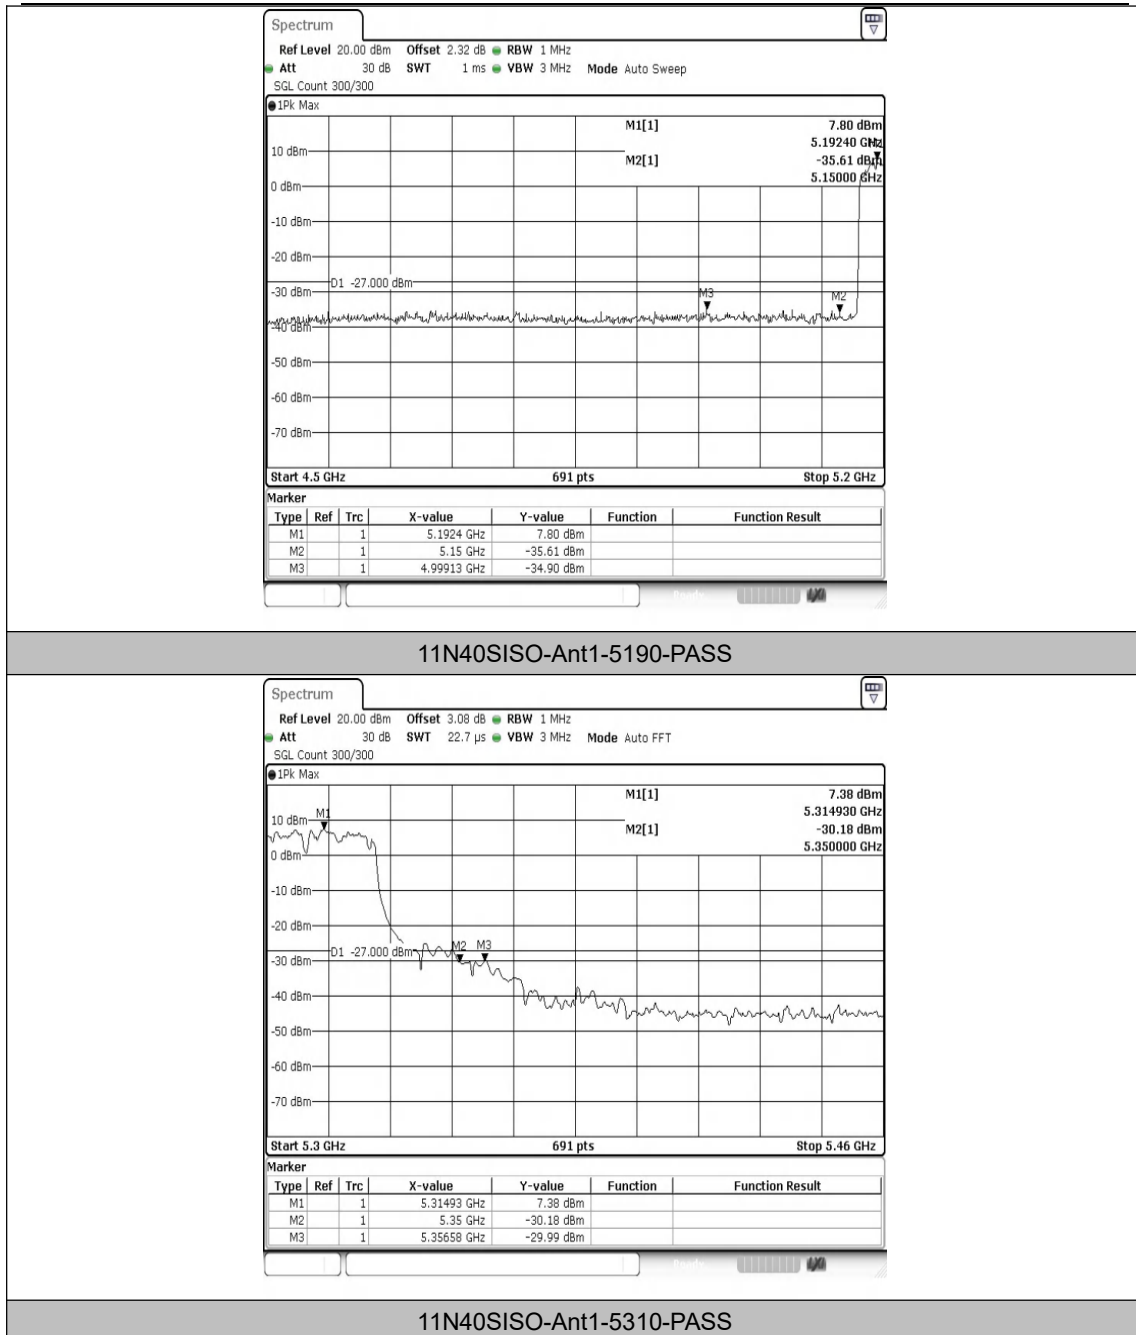


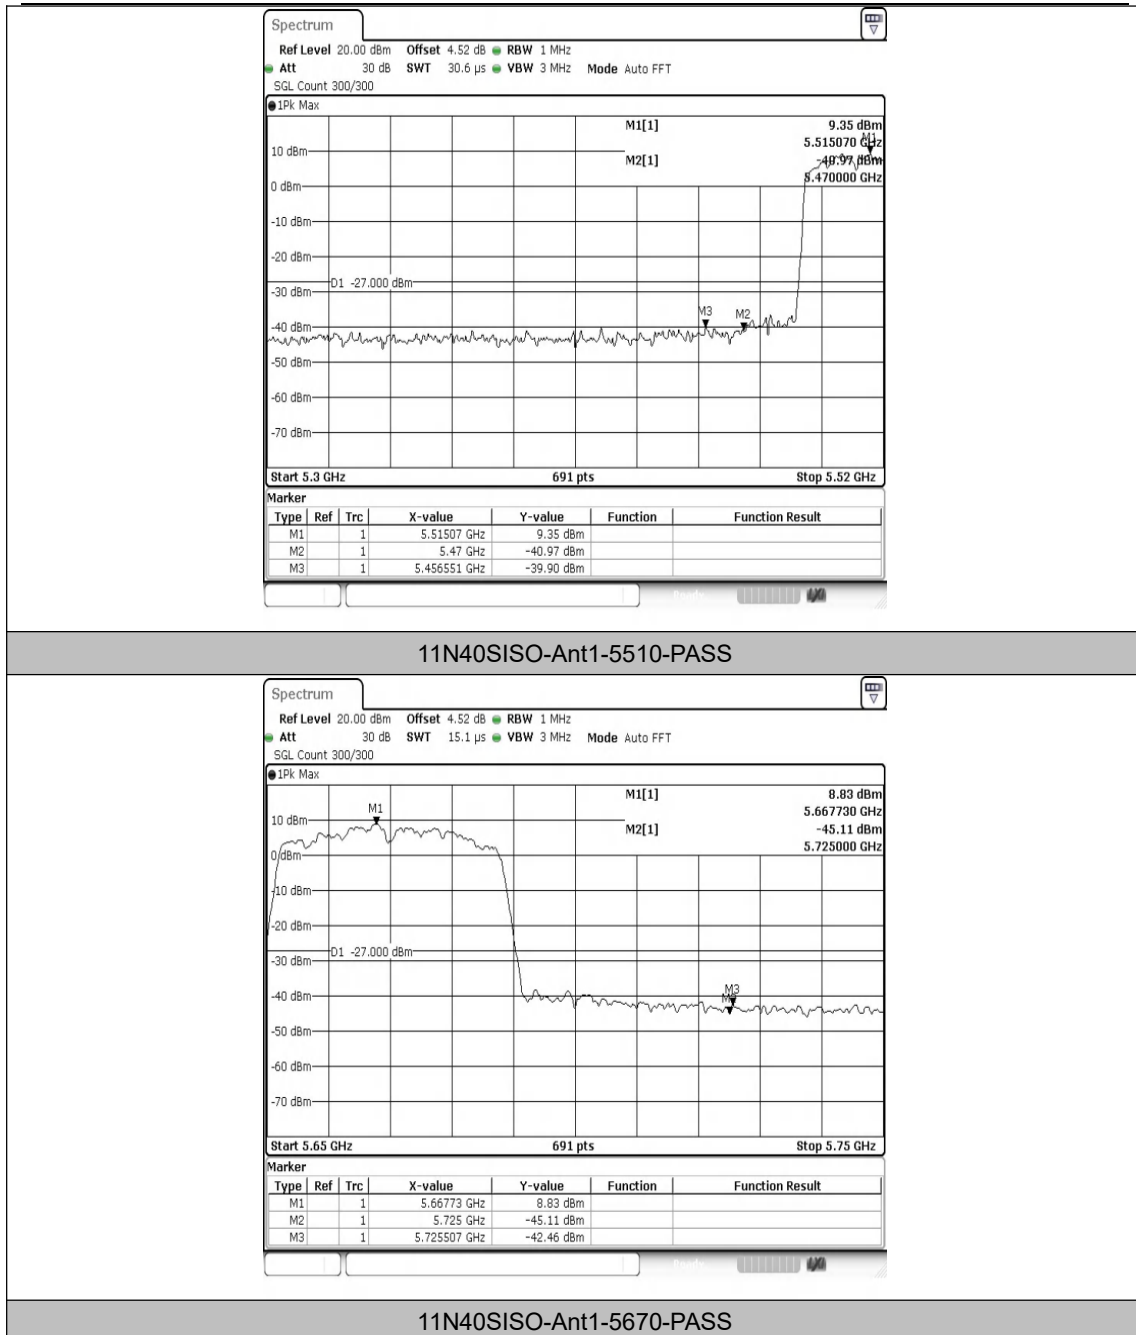


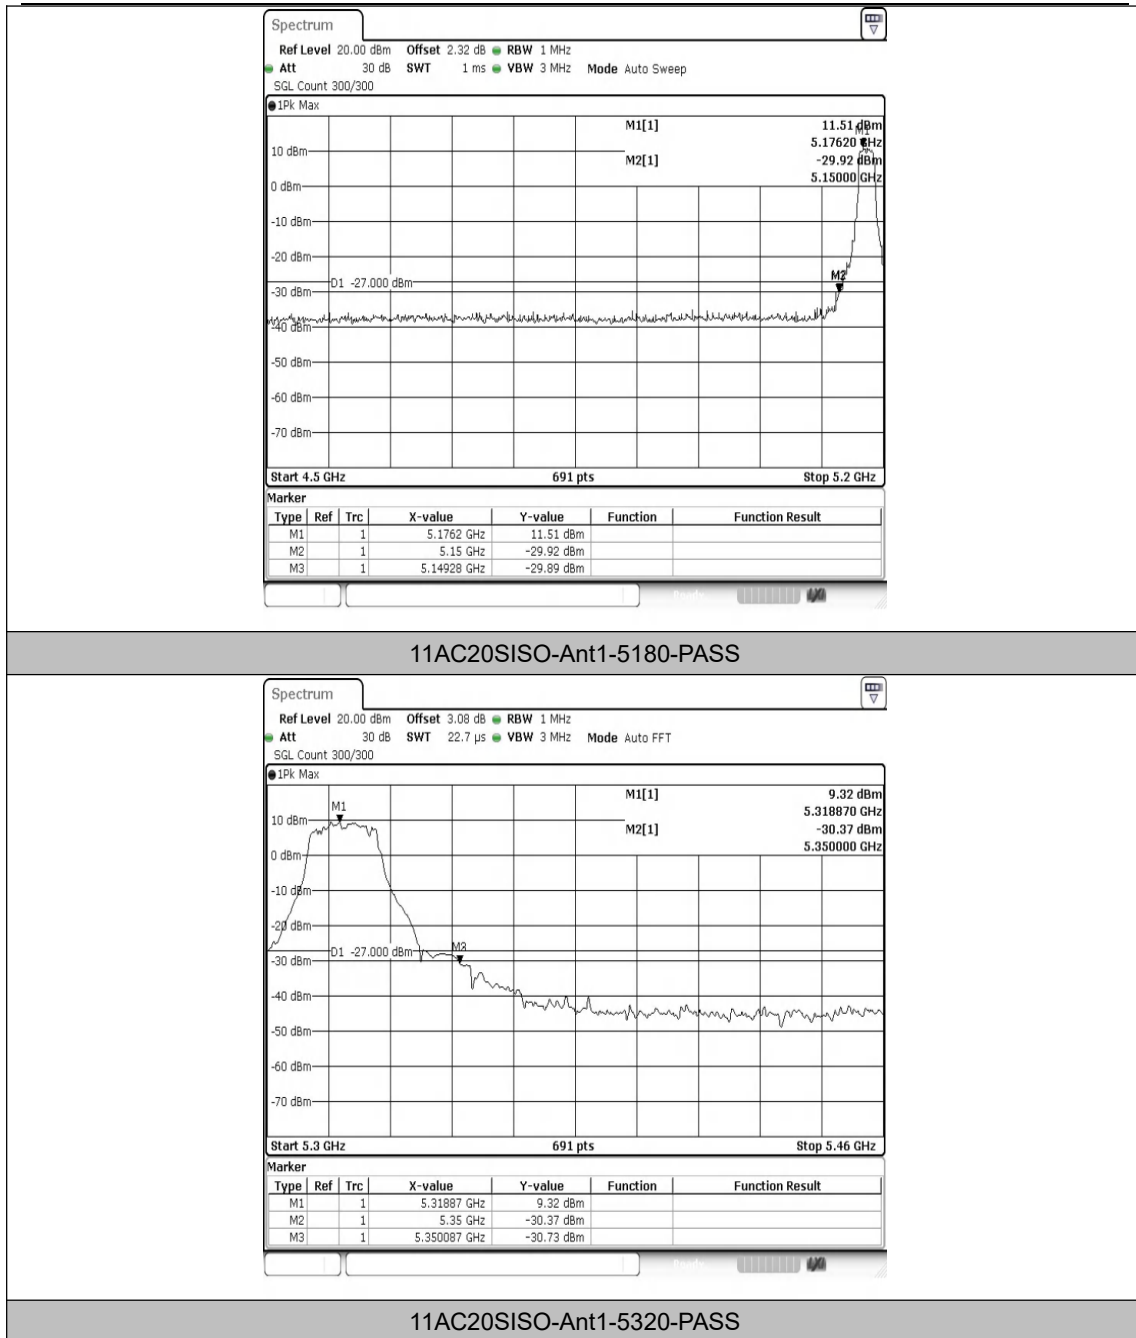


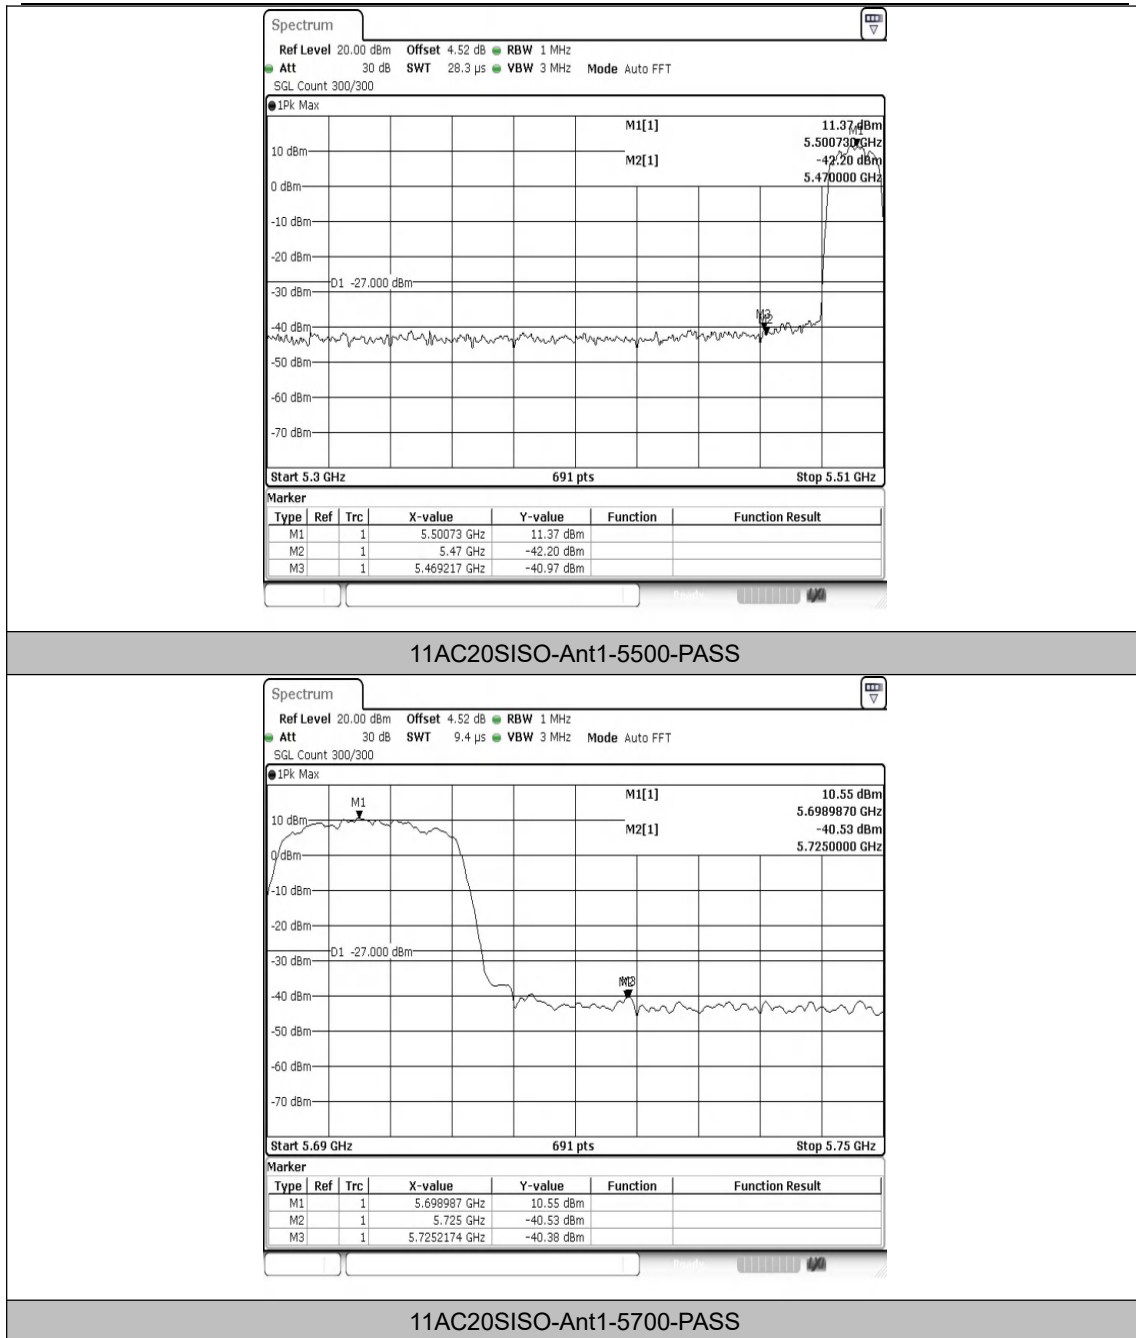

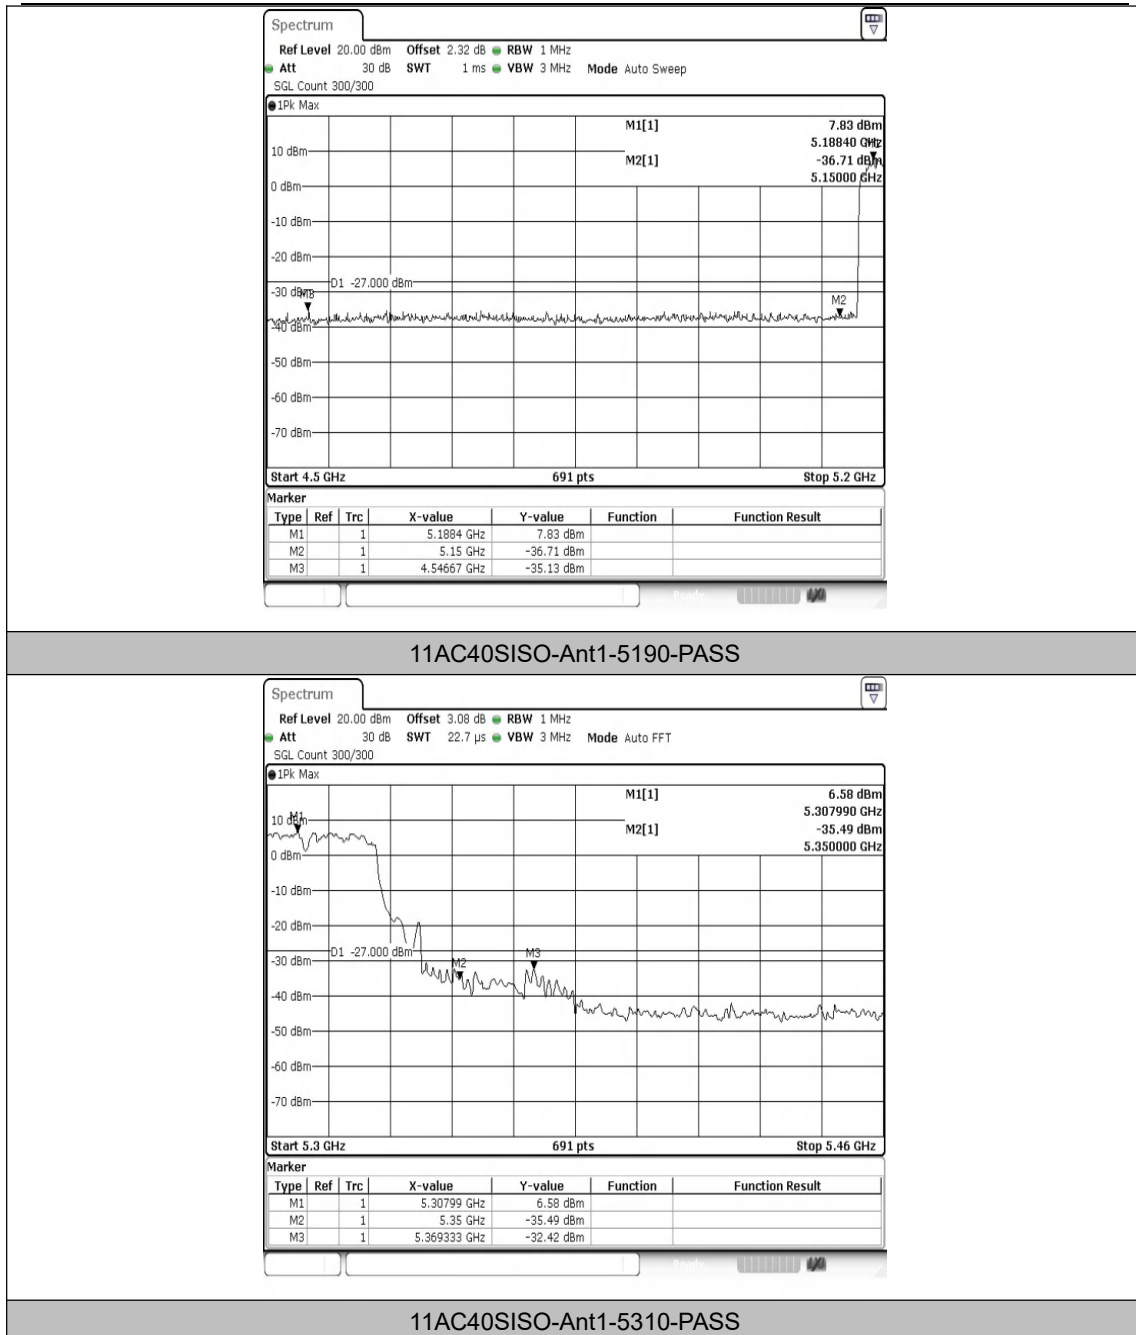

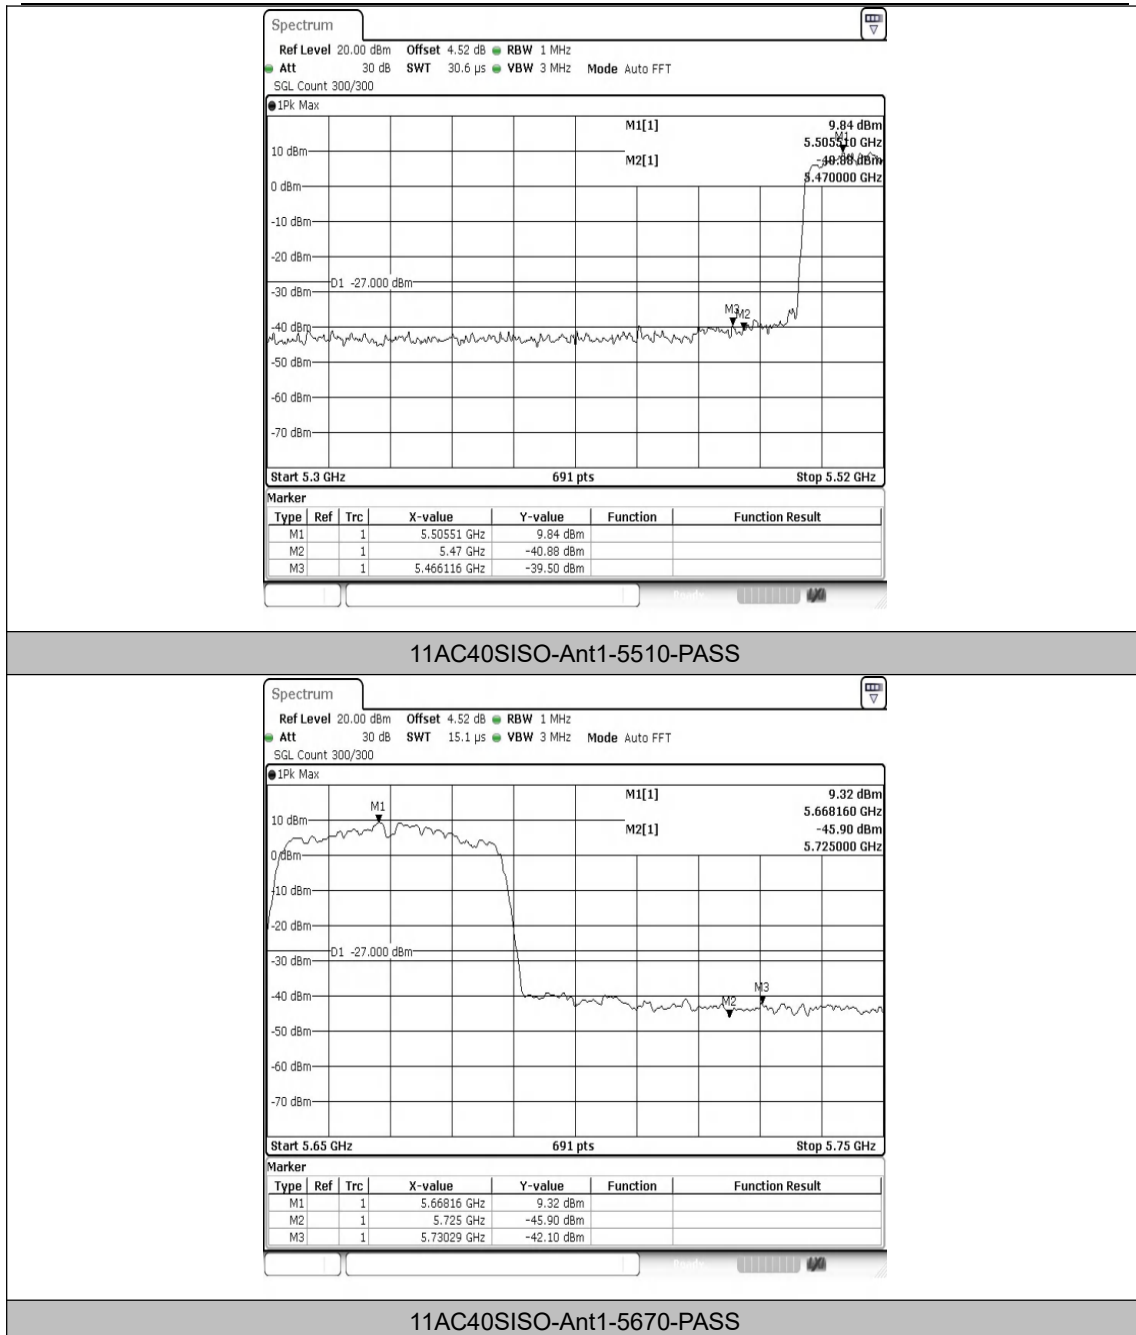

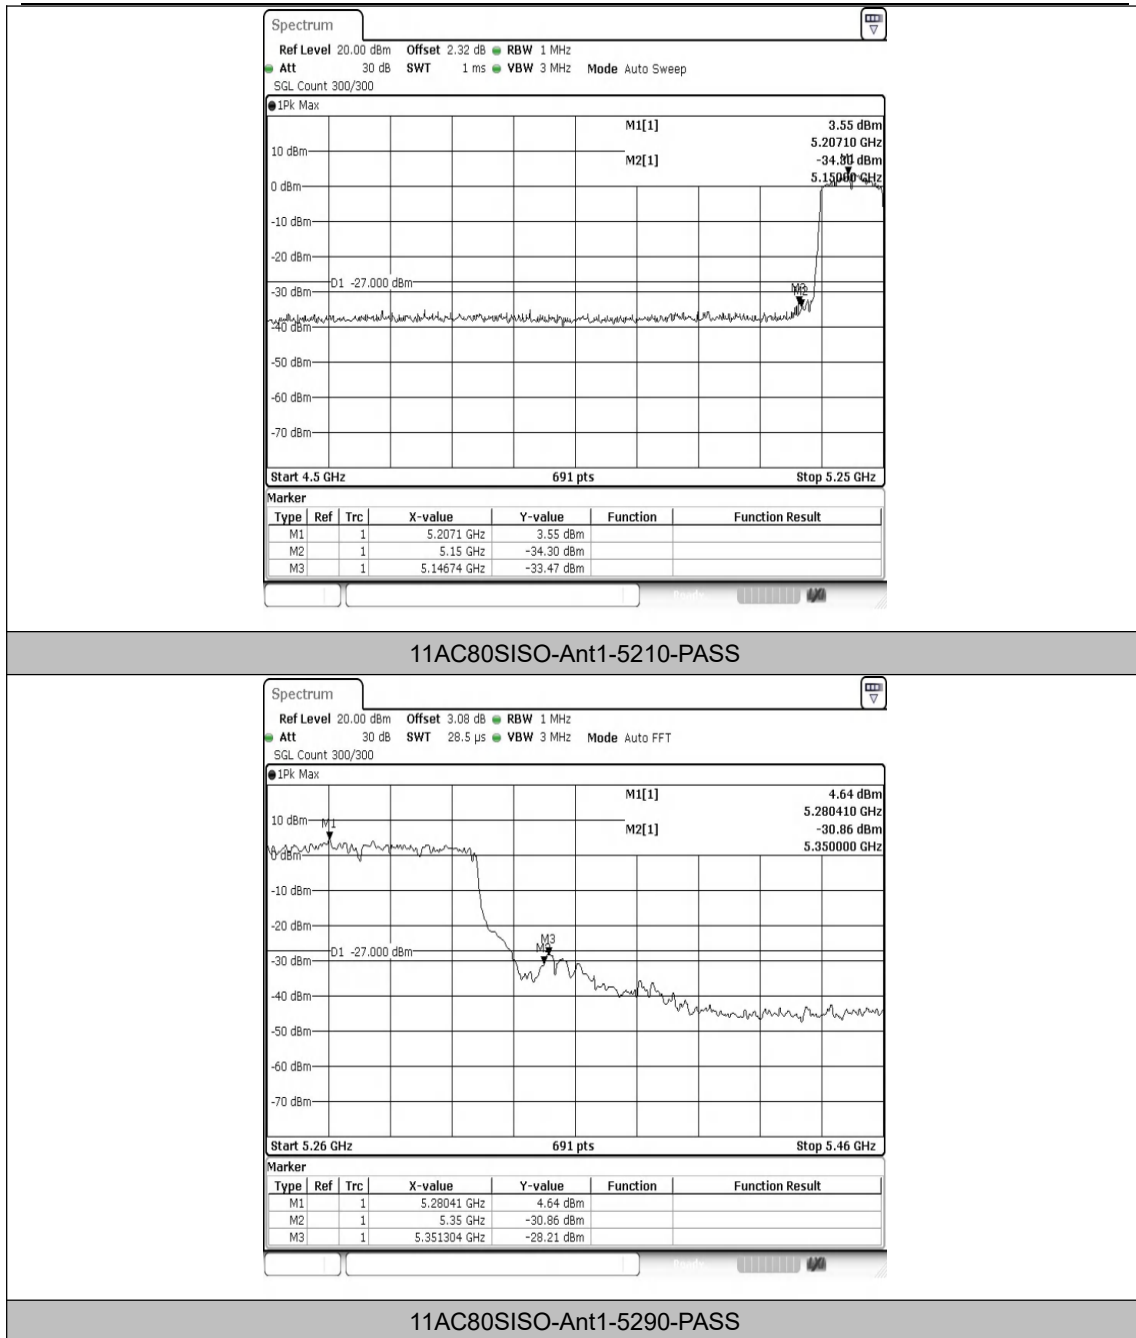


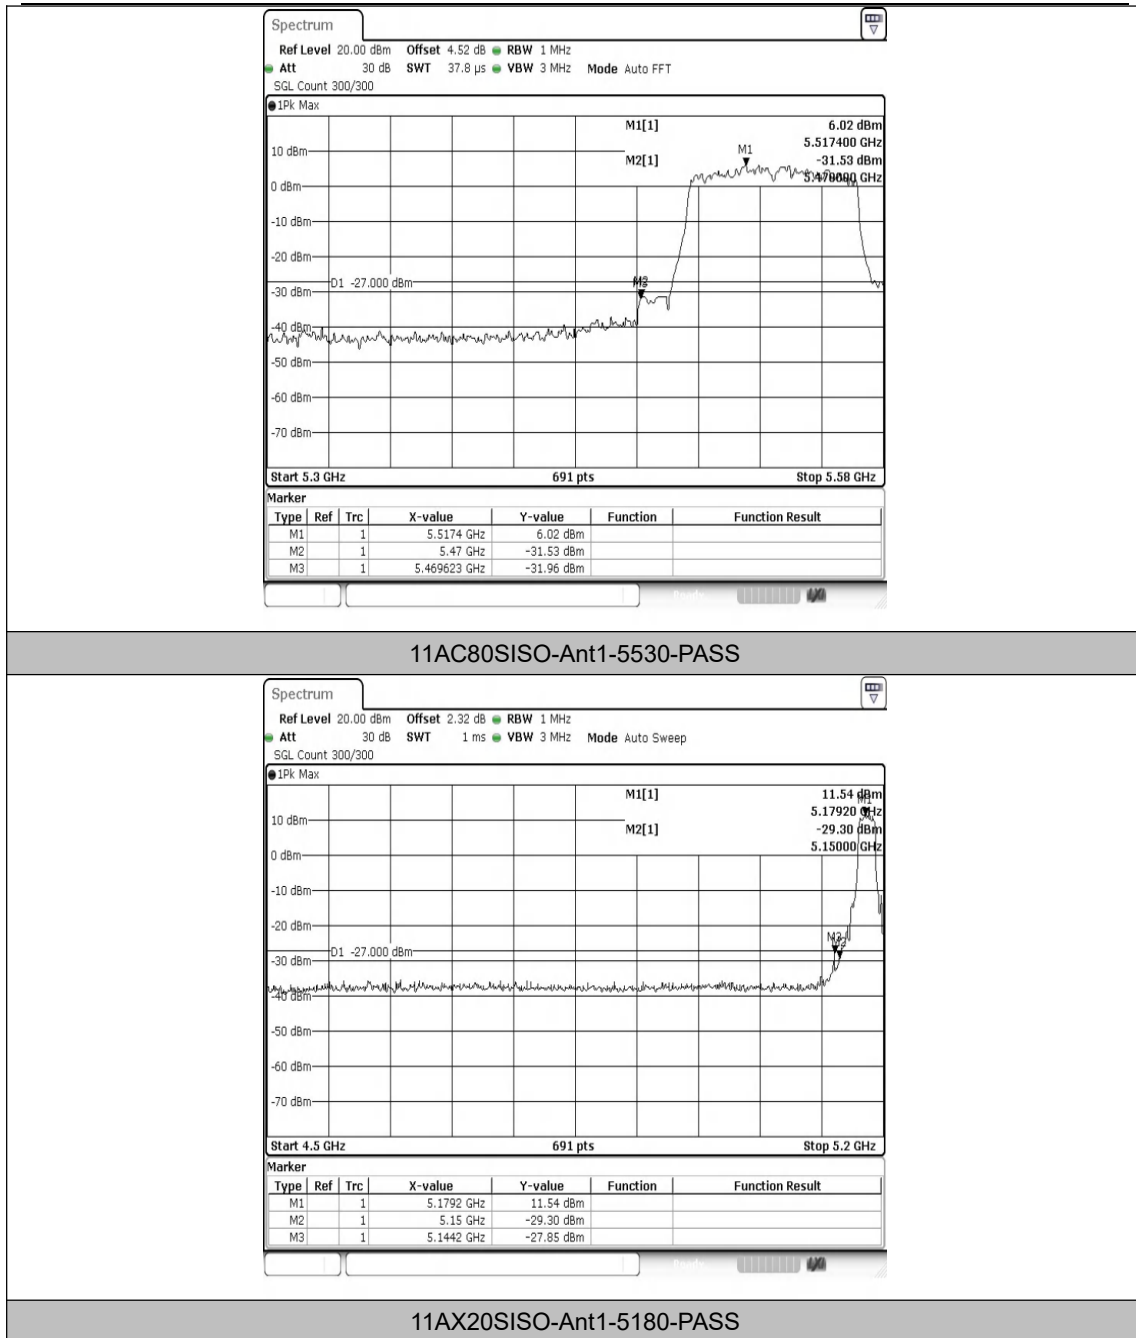

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

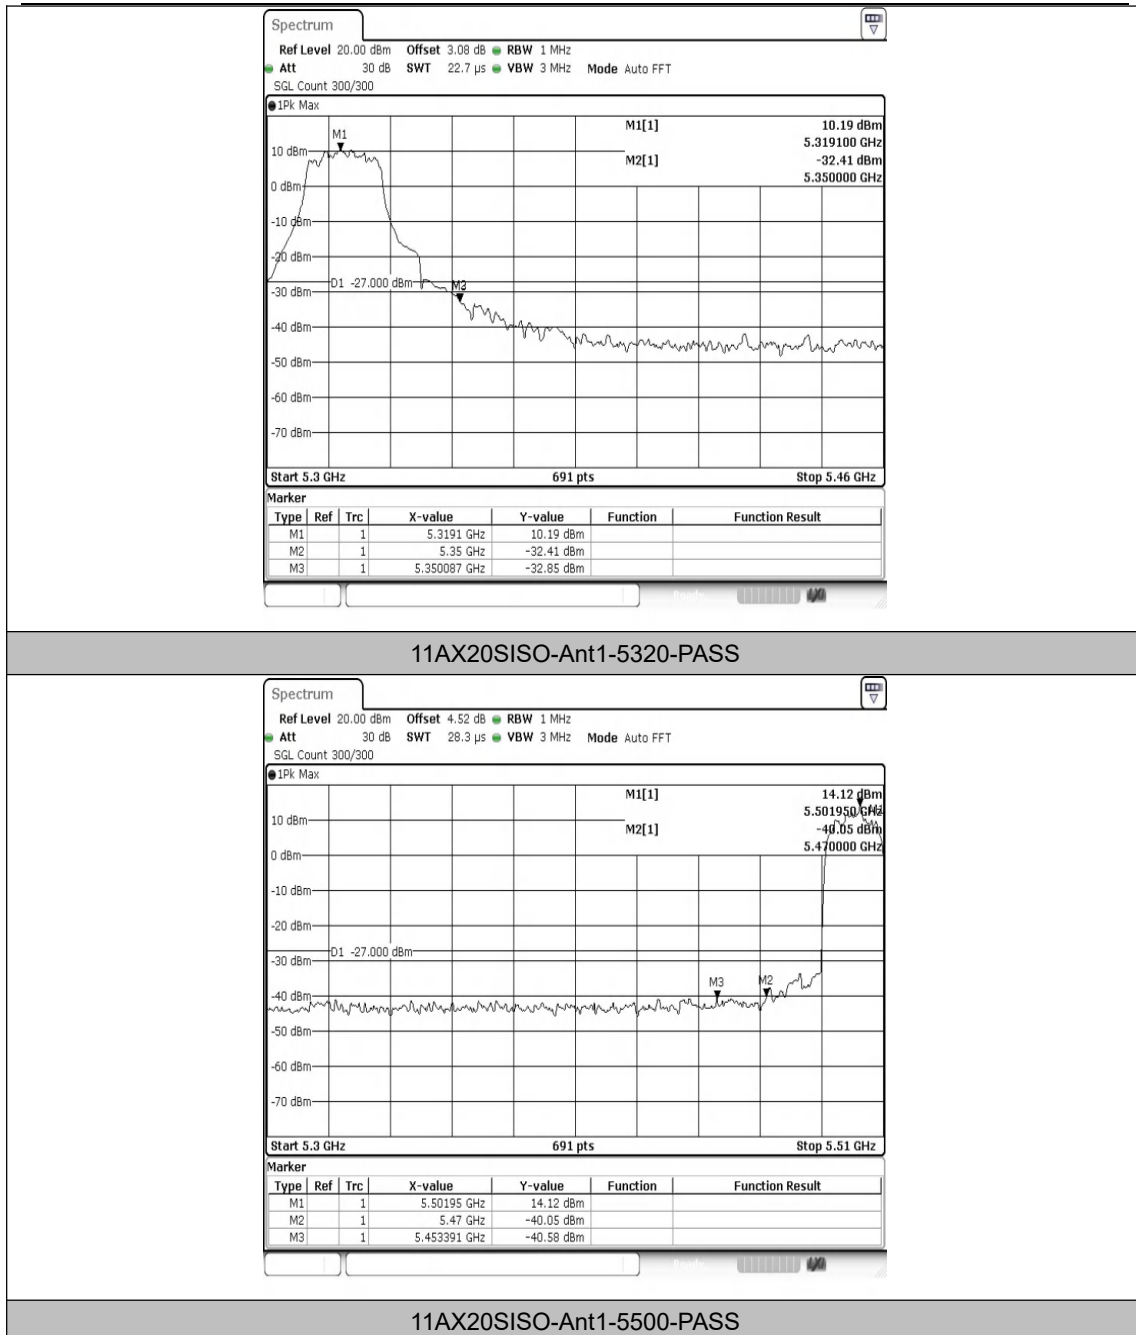

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

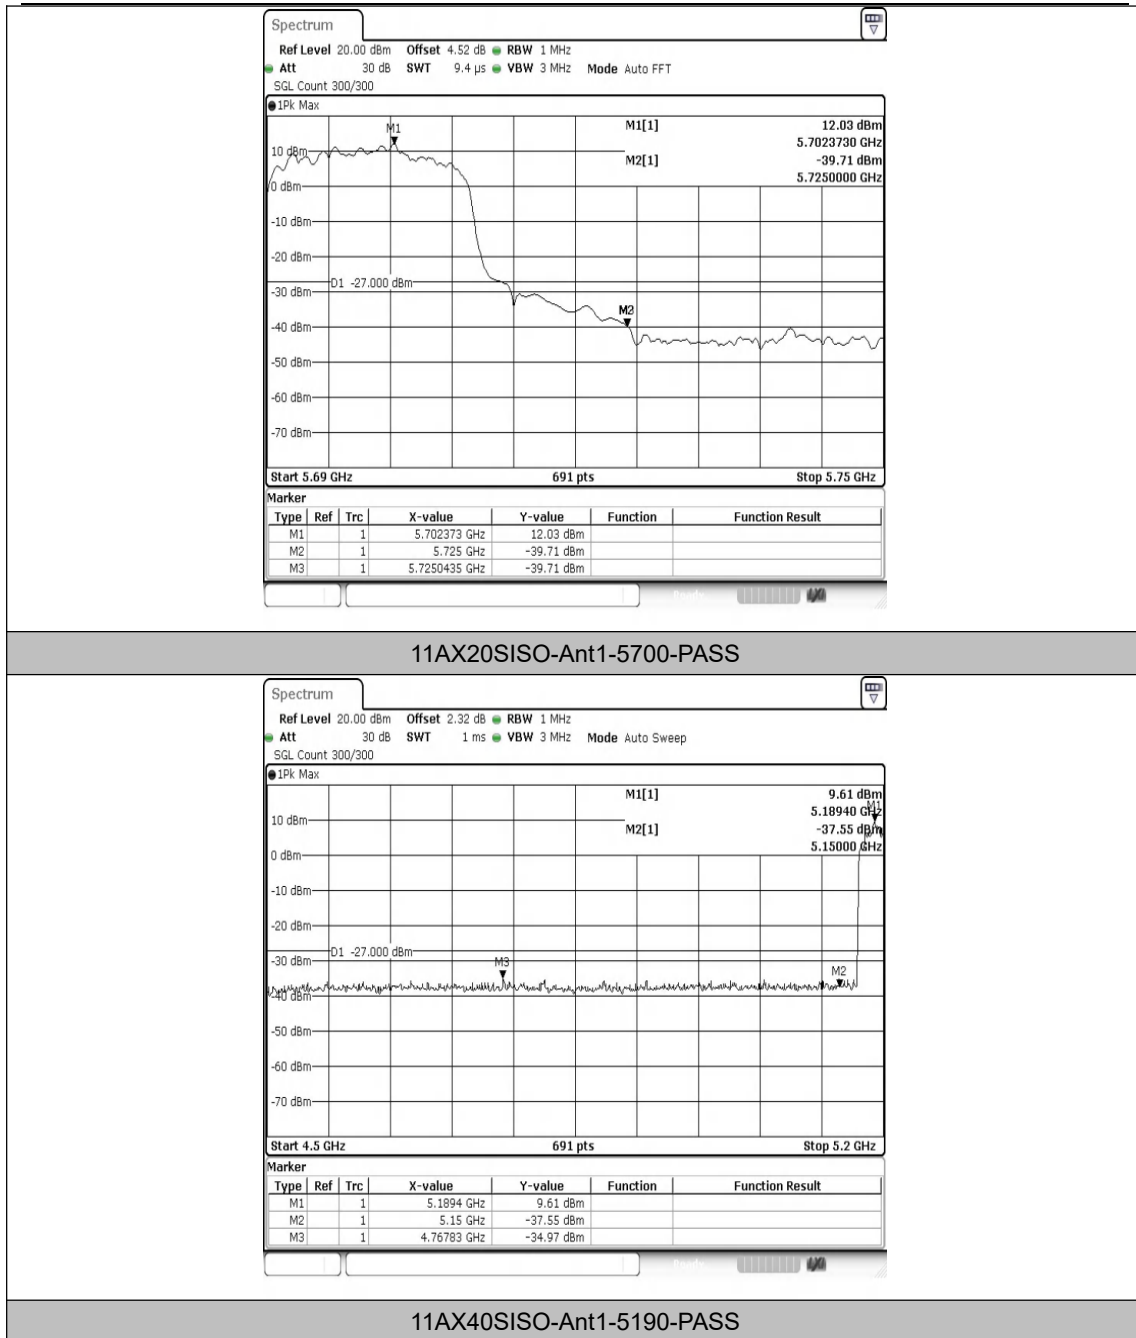


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com

Hotline
400-003-0500
www.anbotek.com

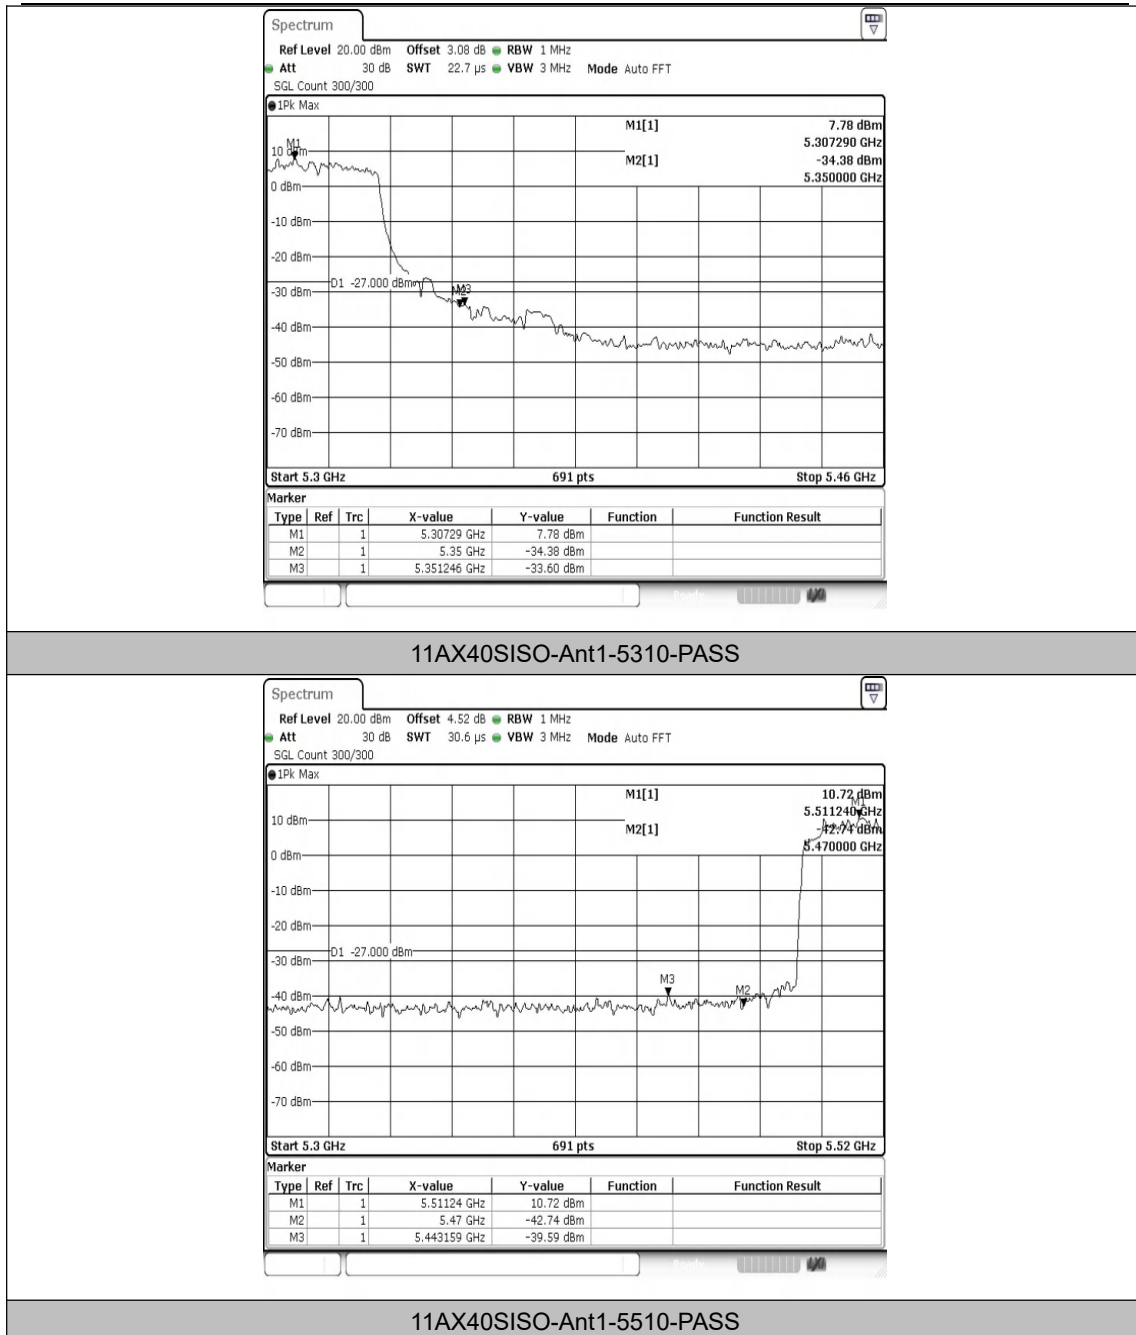


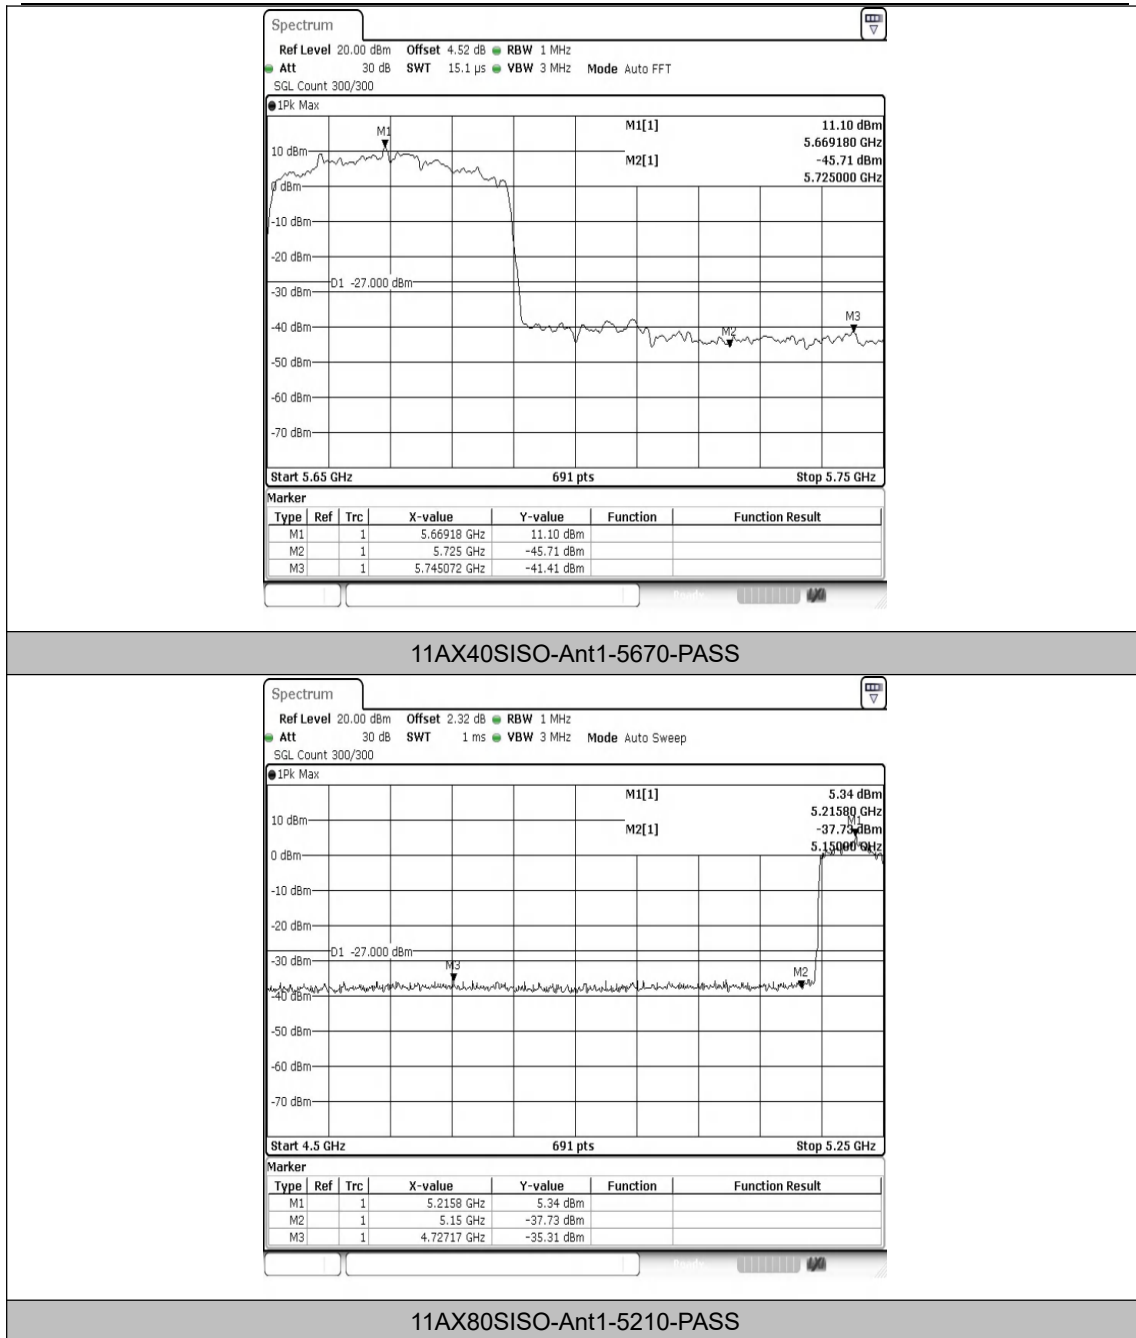


Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

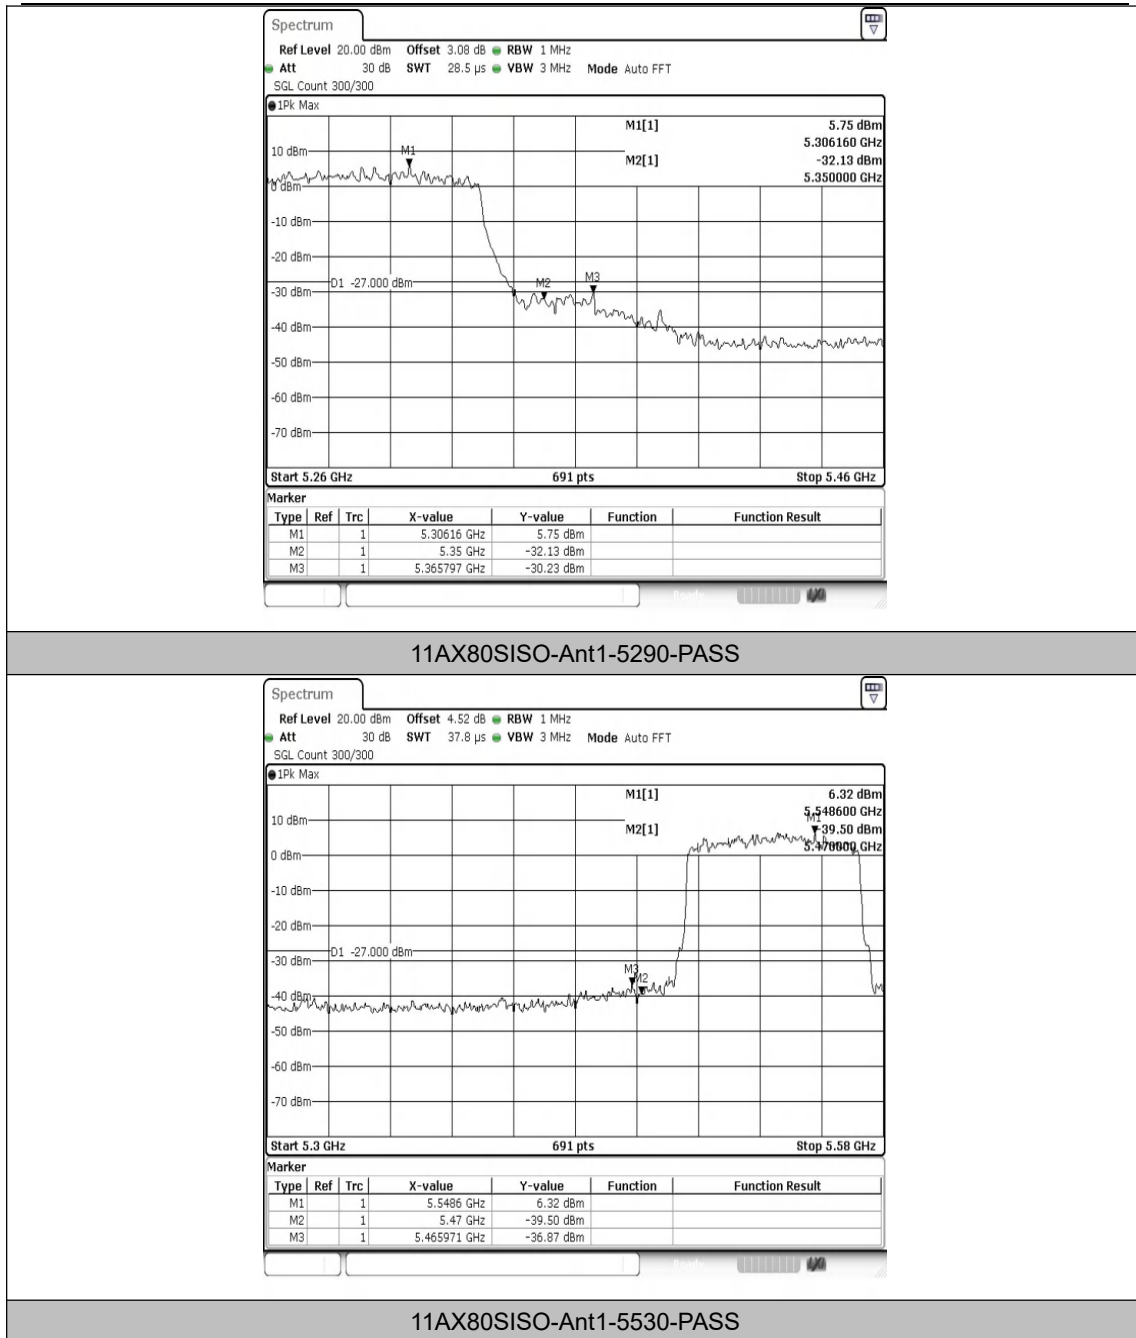



Test Graphs B4

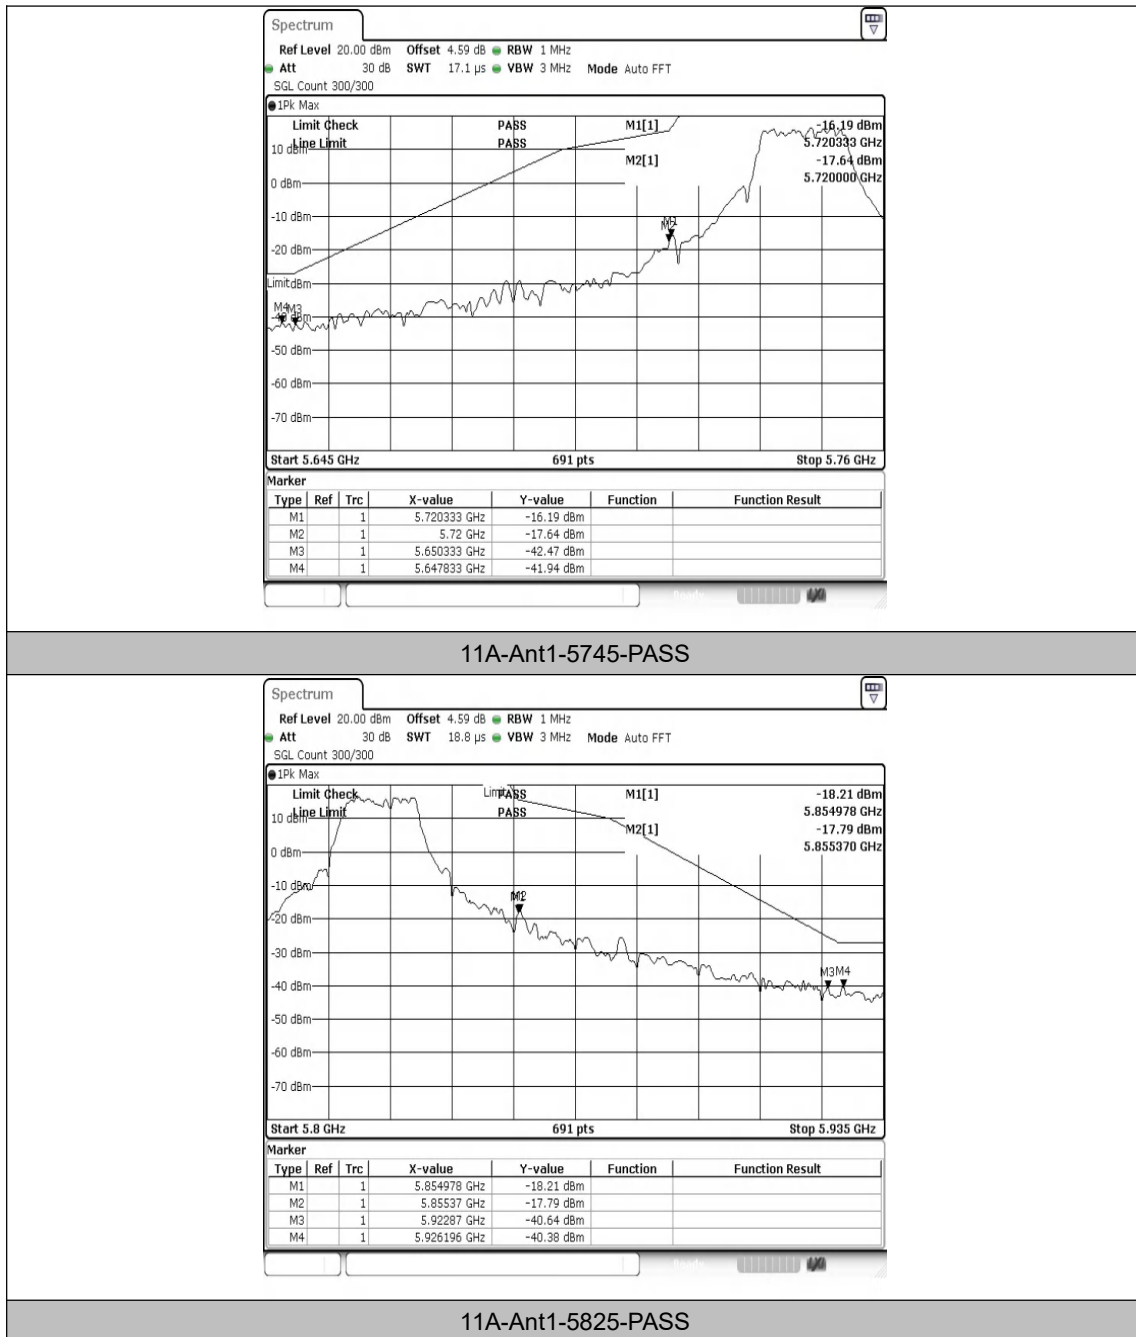


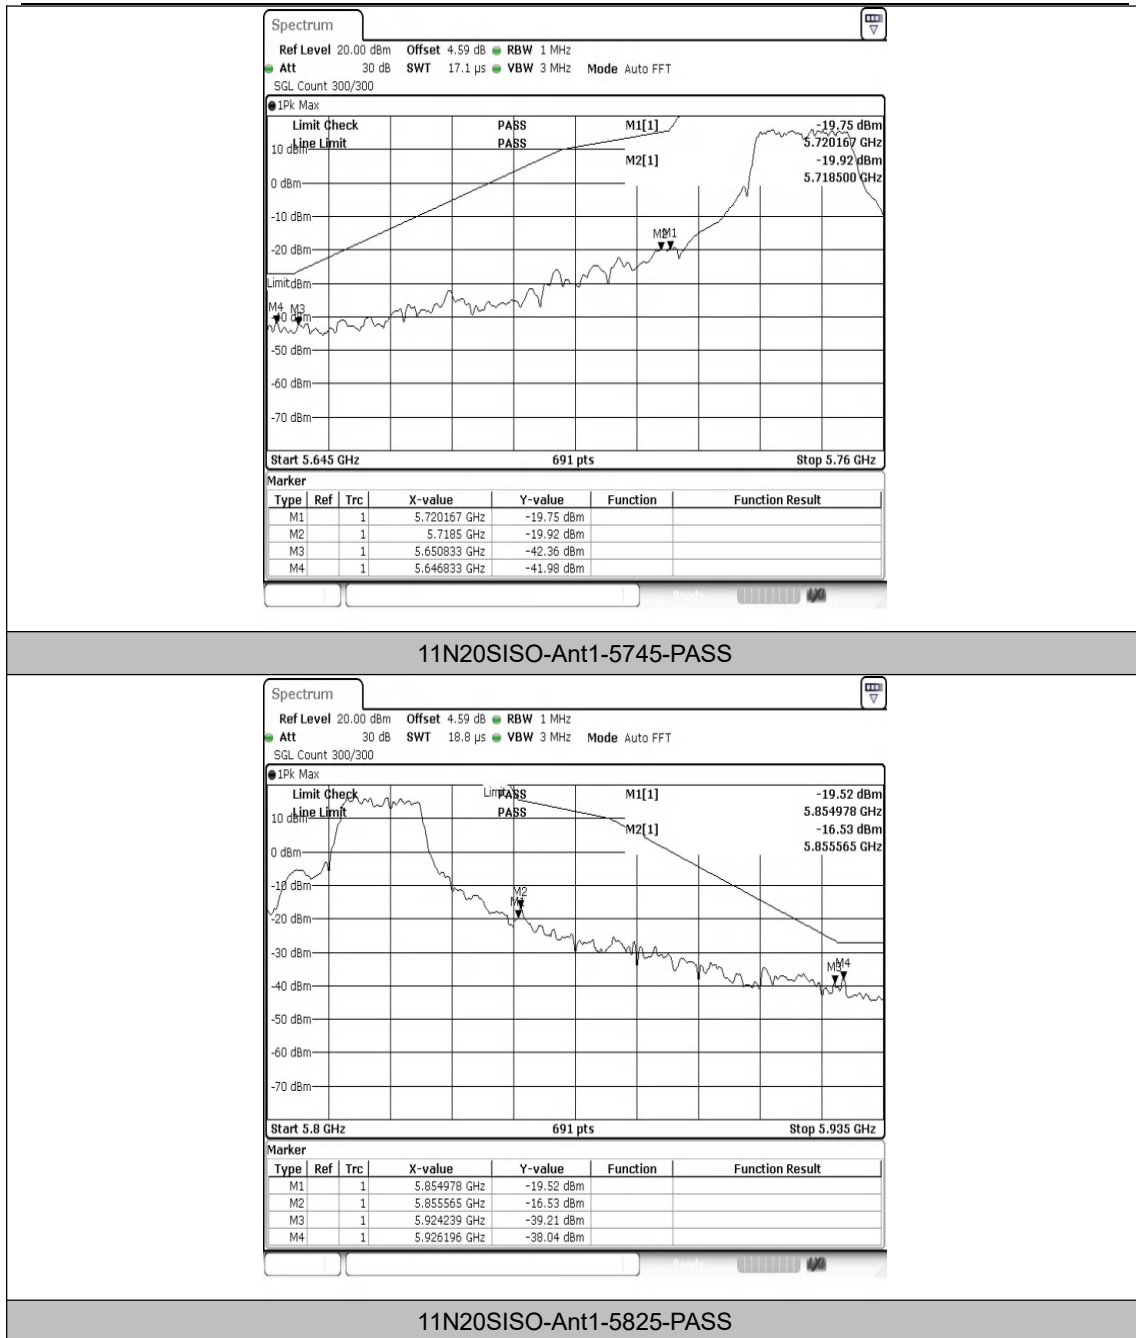


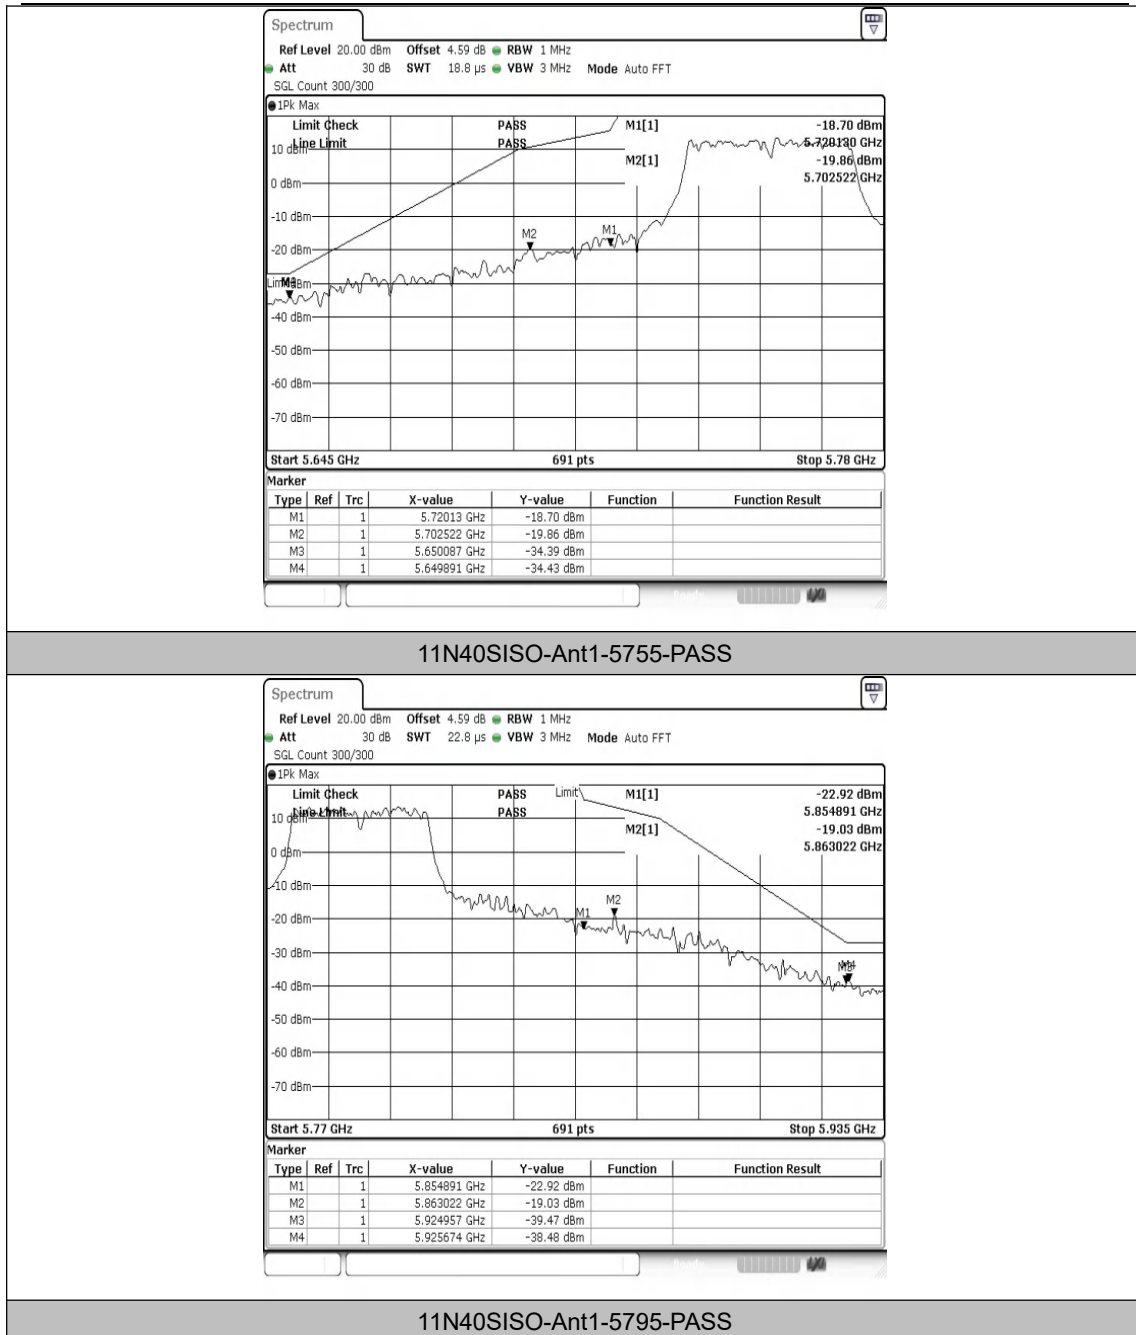


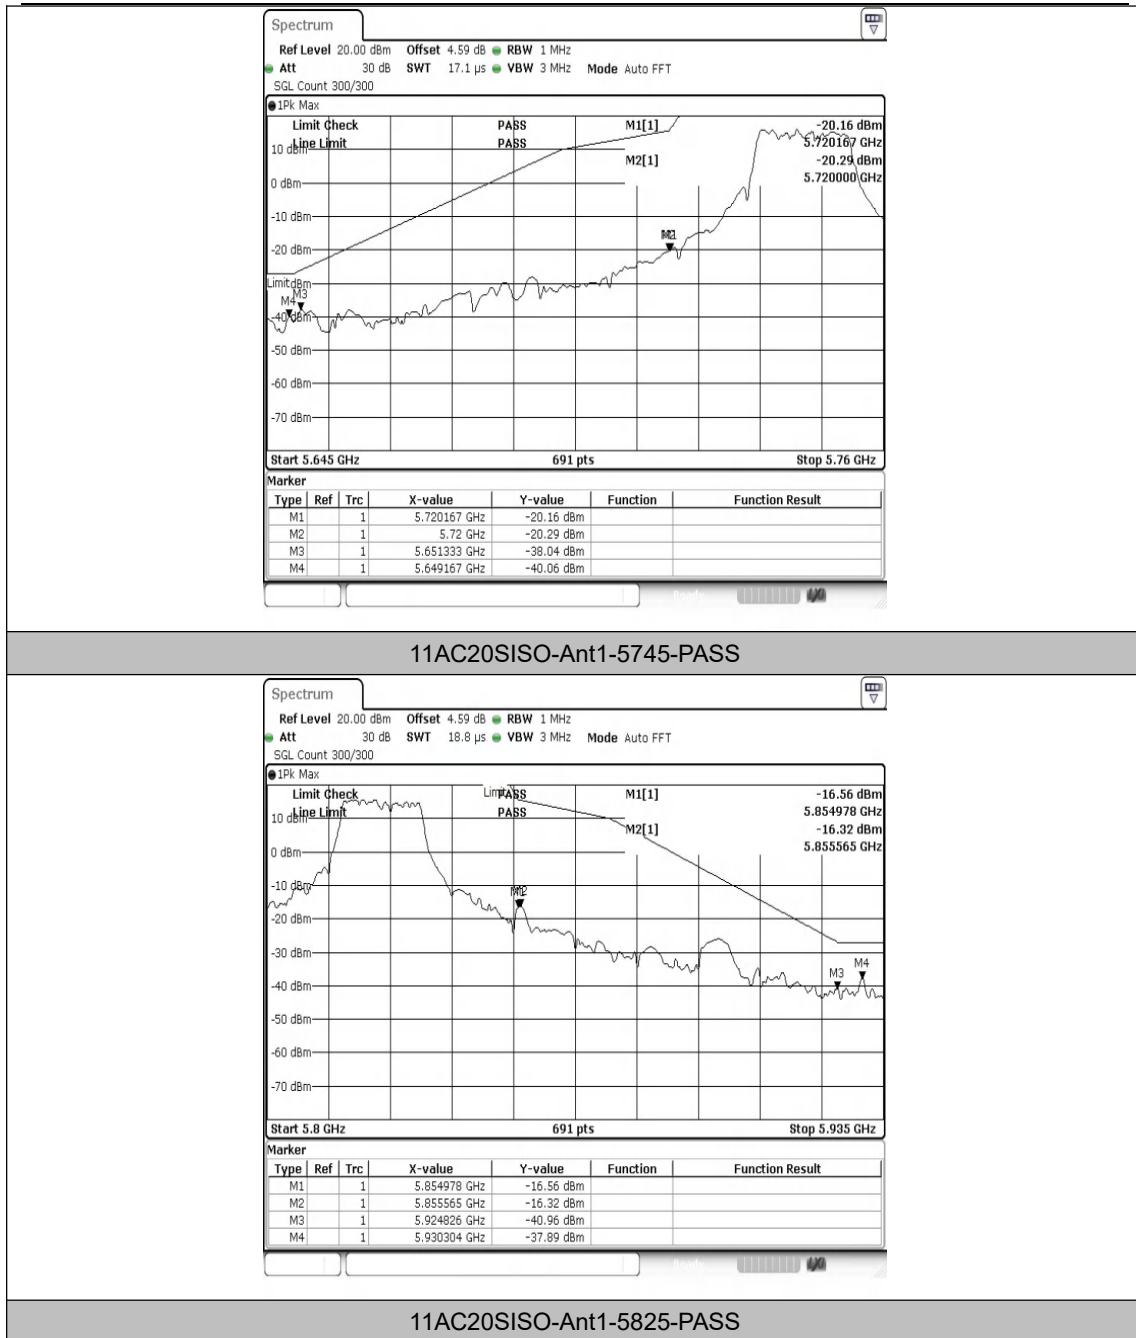

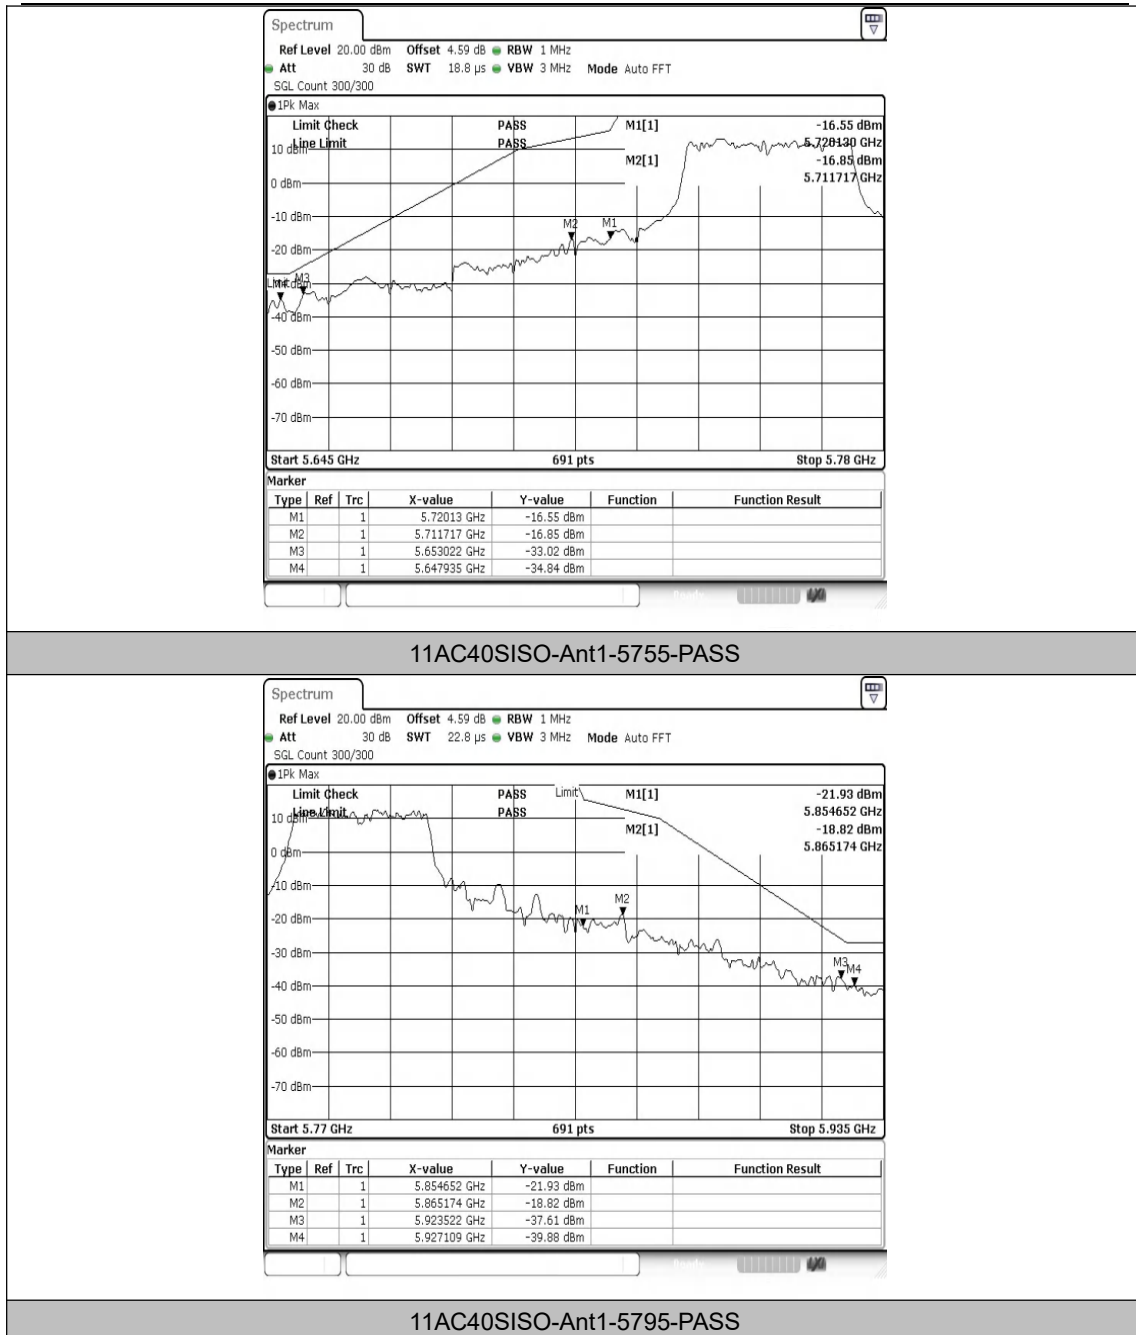


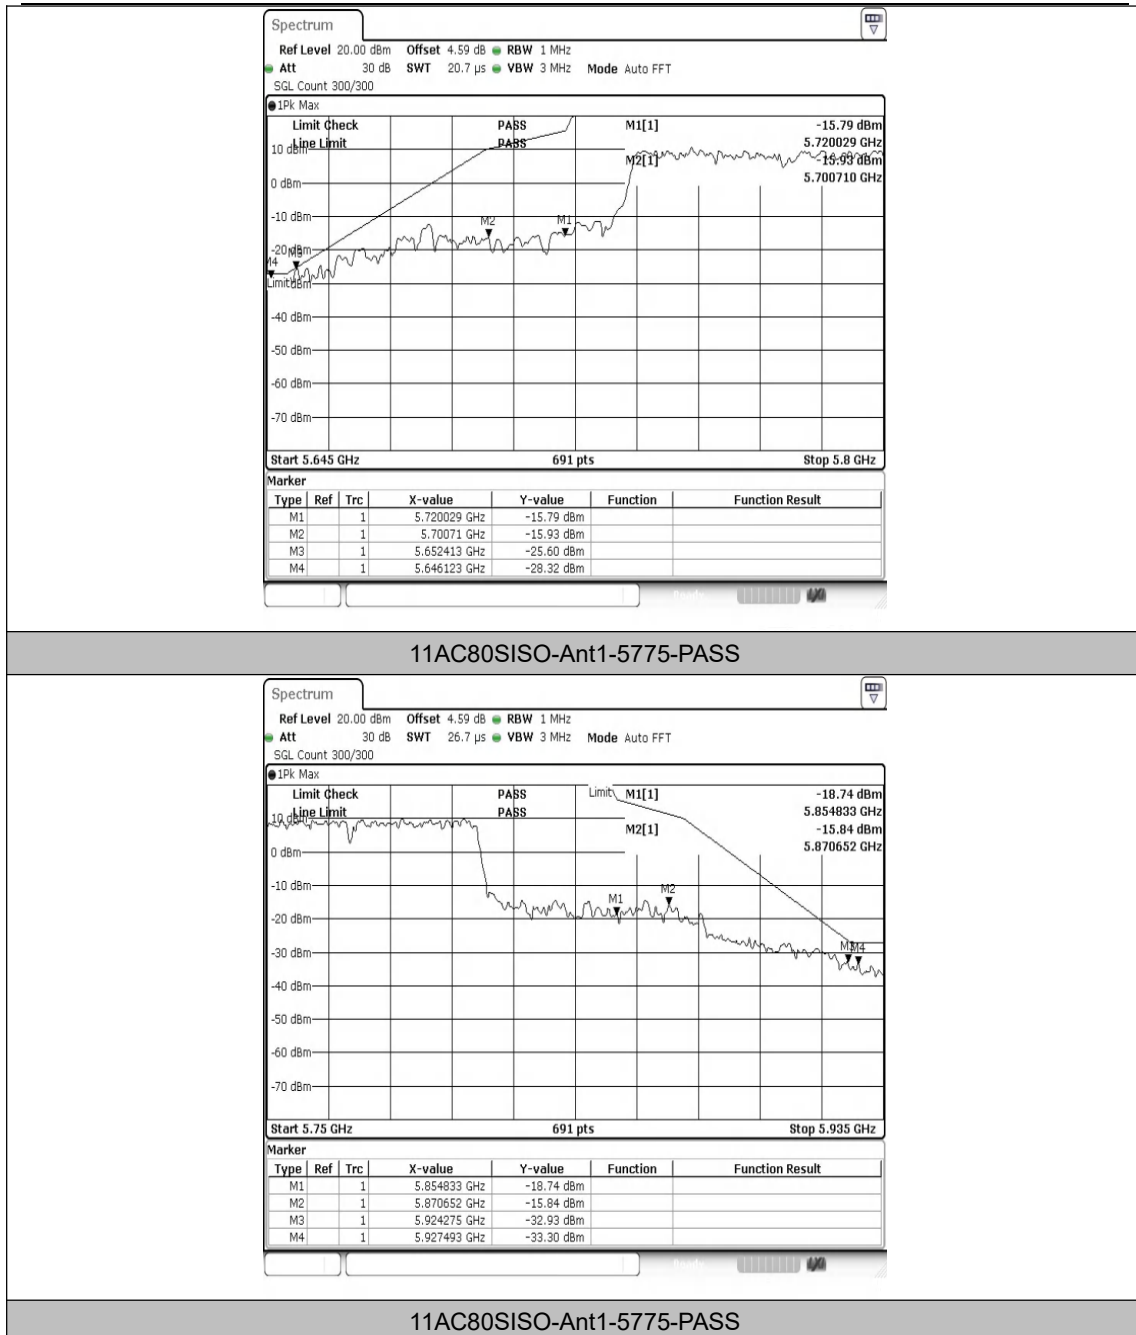

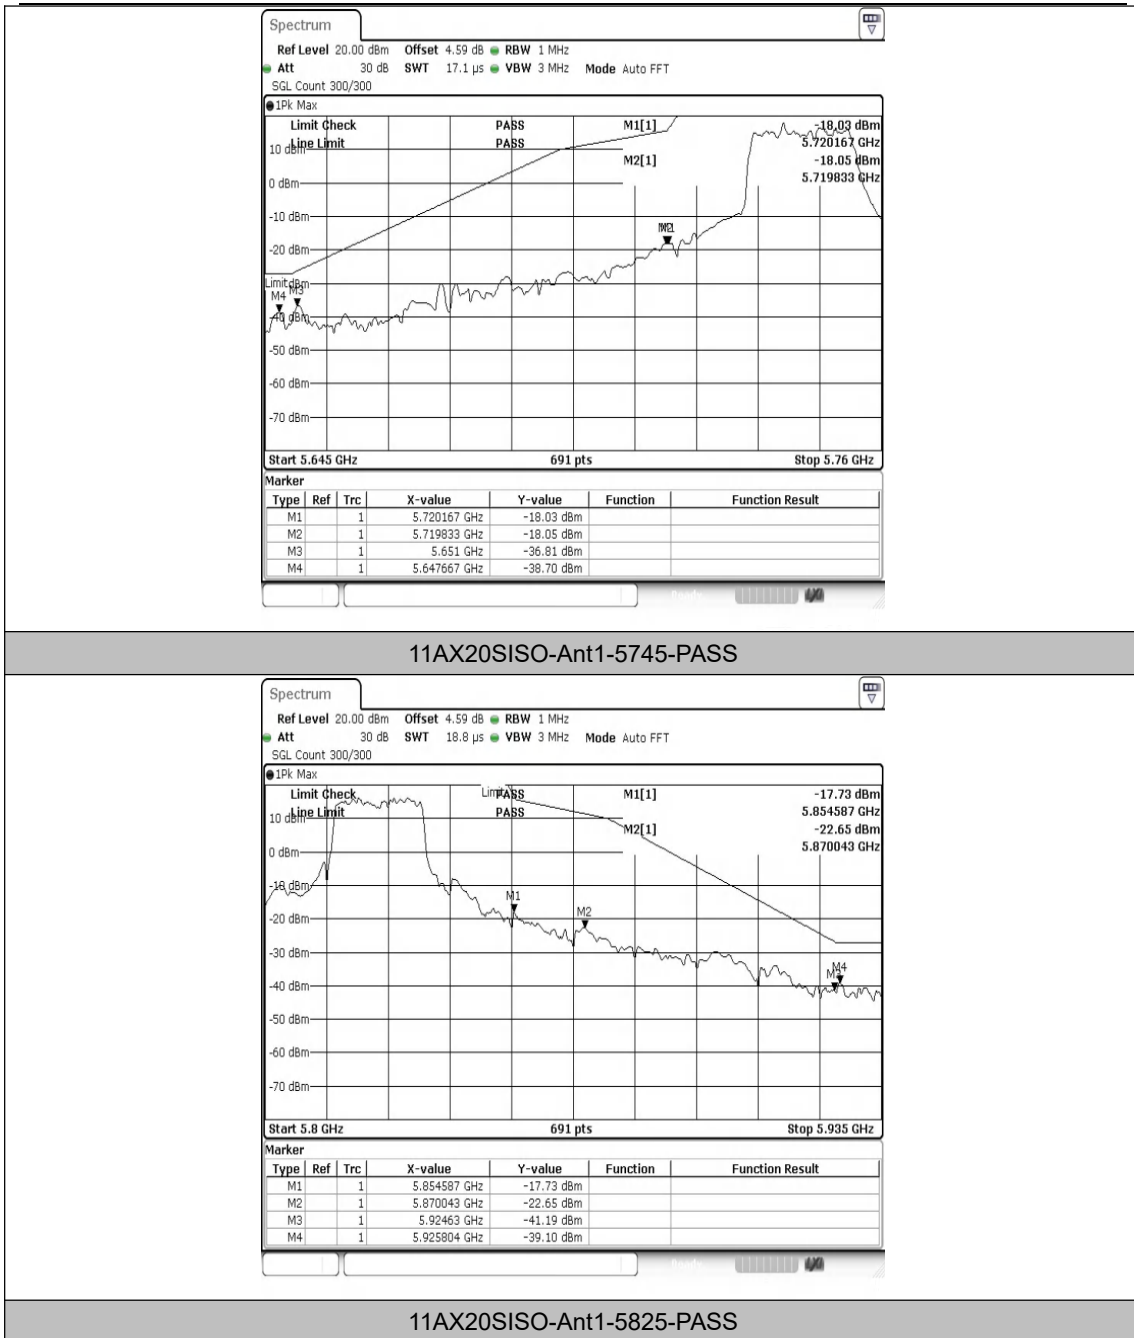


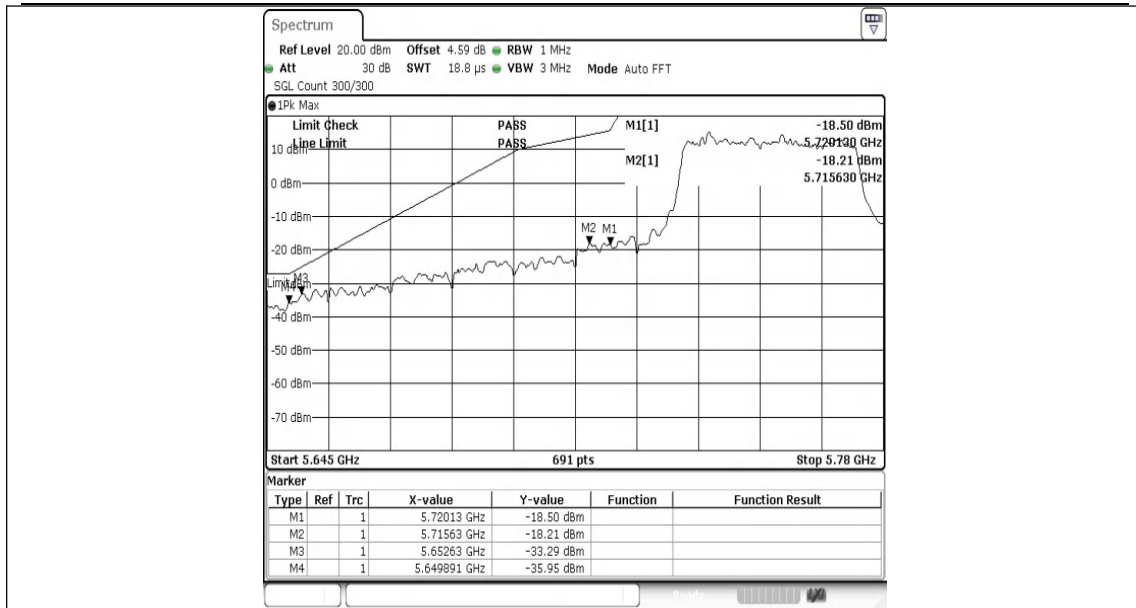

11AX40SISO-Ant1-5755-PASS

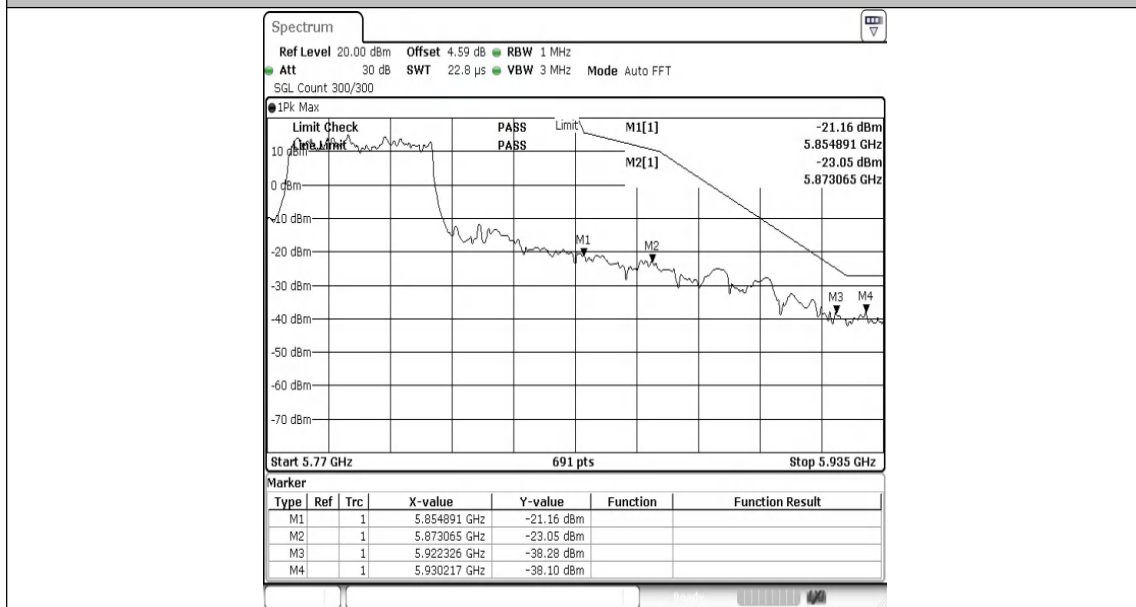

11AX40SISO-Ant1-5795-PASS

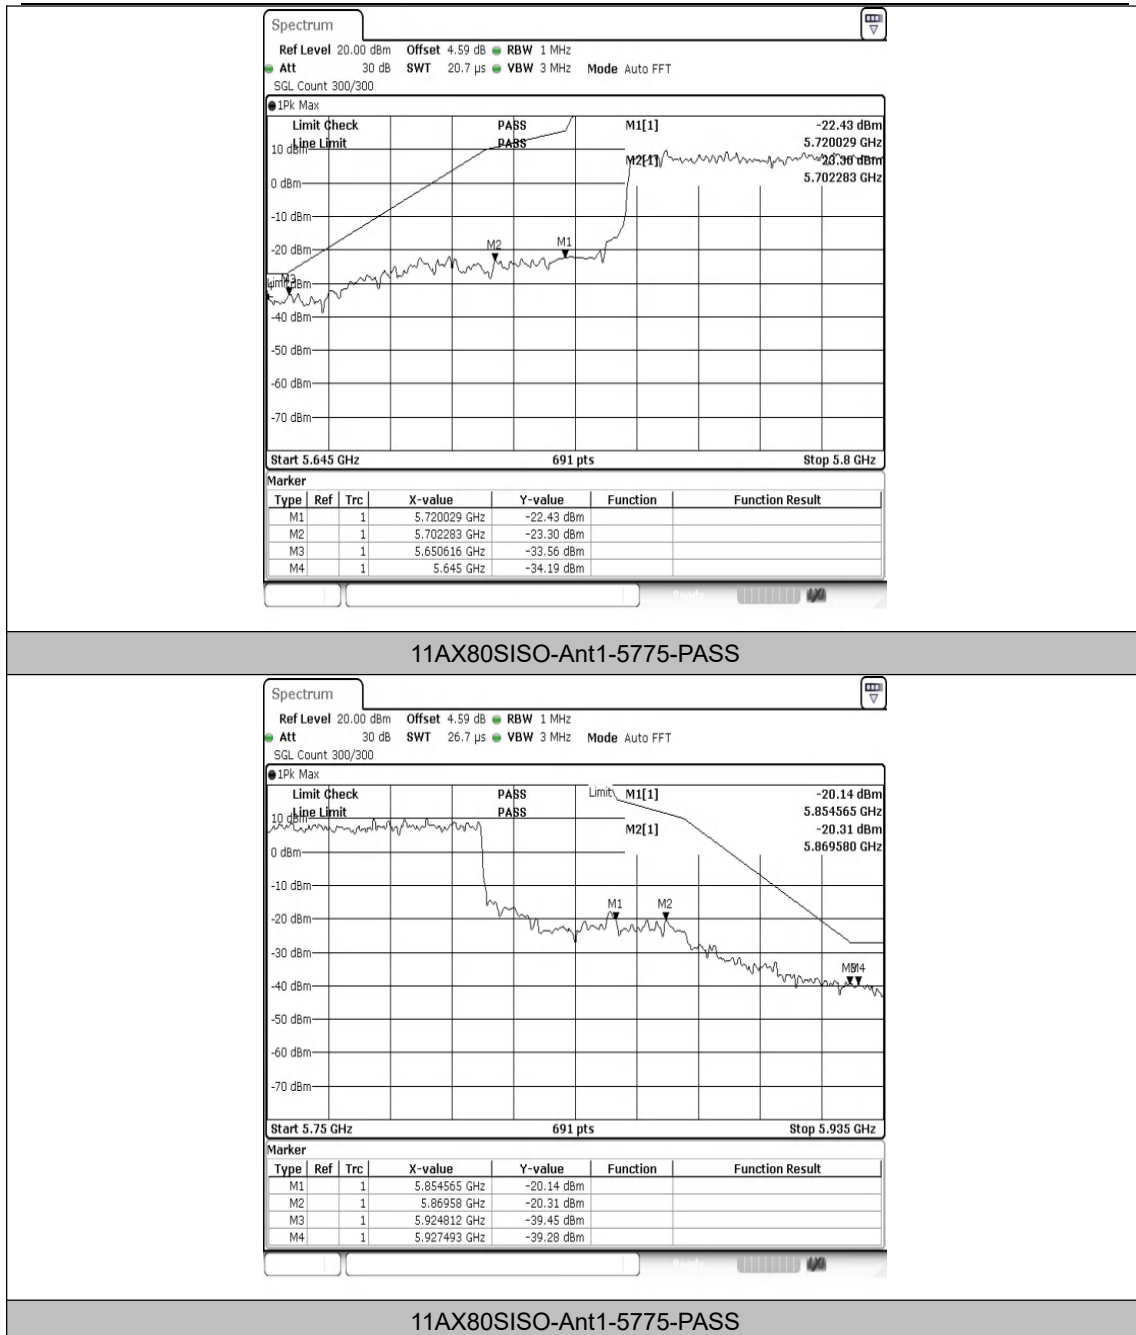


Appendix F: DFS Detection Thresholds

Test Result

TestMode	Frequency[MHz]	Radar Type	Result[dbm]	Limit[dbm]	Verdict
11AX80SISO	5290	Type0	-62.06	-62.00	PASS
	5530	Type0	-62.29	-62.00	PASS

Test Graphs

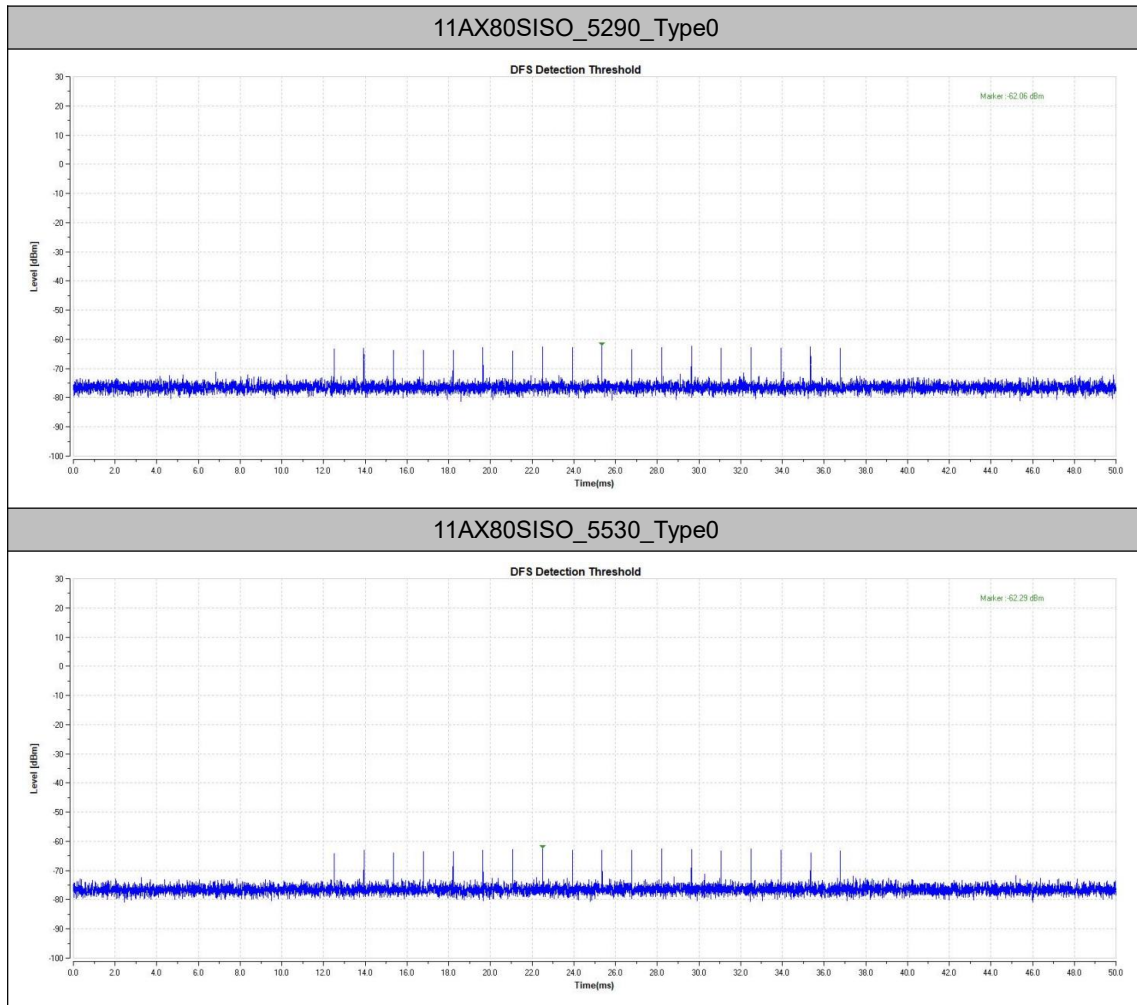

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com



Hotline
400-003-0500
www.anbotech.com

Appendix G: Channel Move Time and Channel Closing


Transmission Time

Test Result

TestMode	Frequency[MHz]	CCT[ms]	Limit[ms]	CMT[ms]	Limit[ms]	Verdict
11AX80SISO	5290	200+18.2	200+60	798.2	10000	PASS
11AX80SISO	5530	200+13	200+60	521.3	10000	PASS



Test Graphs

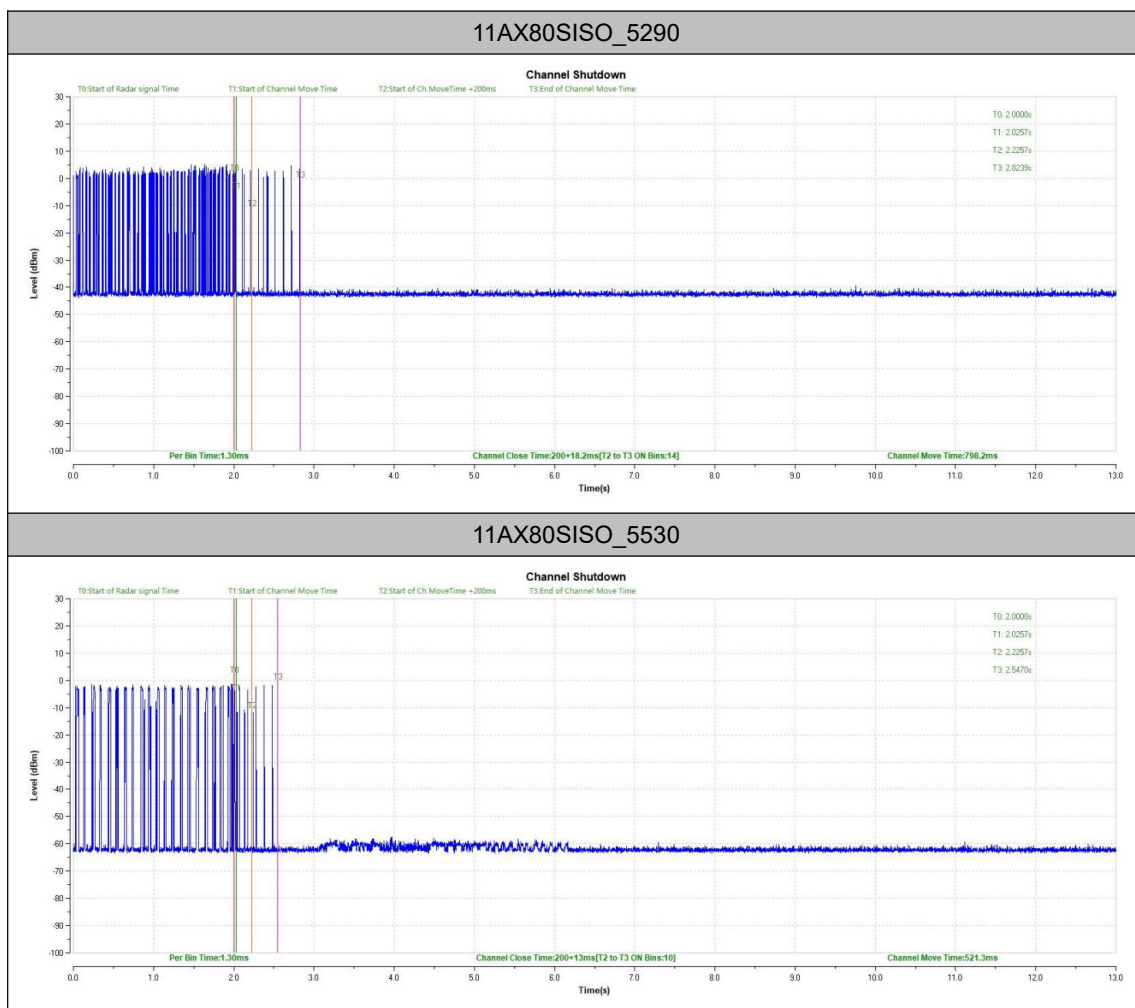

---End---

