



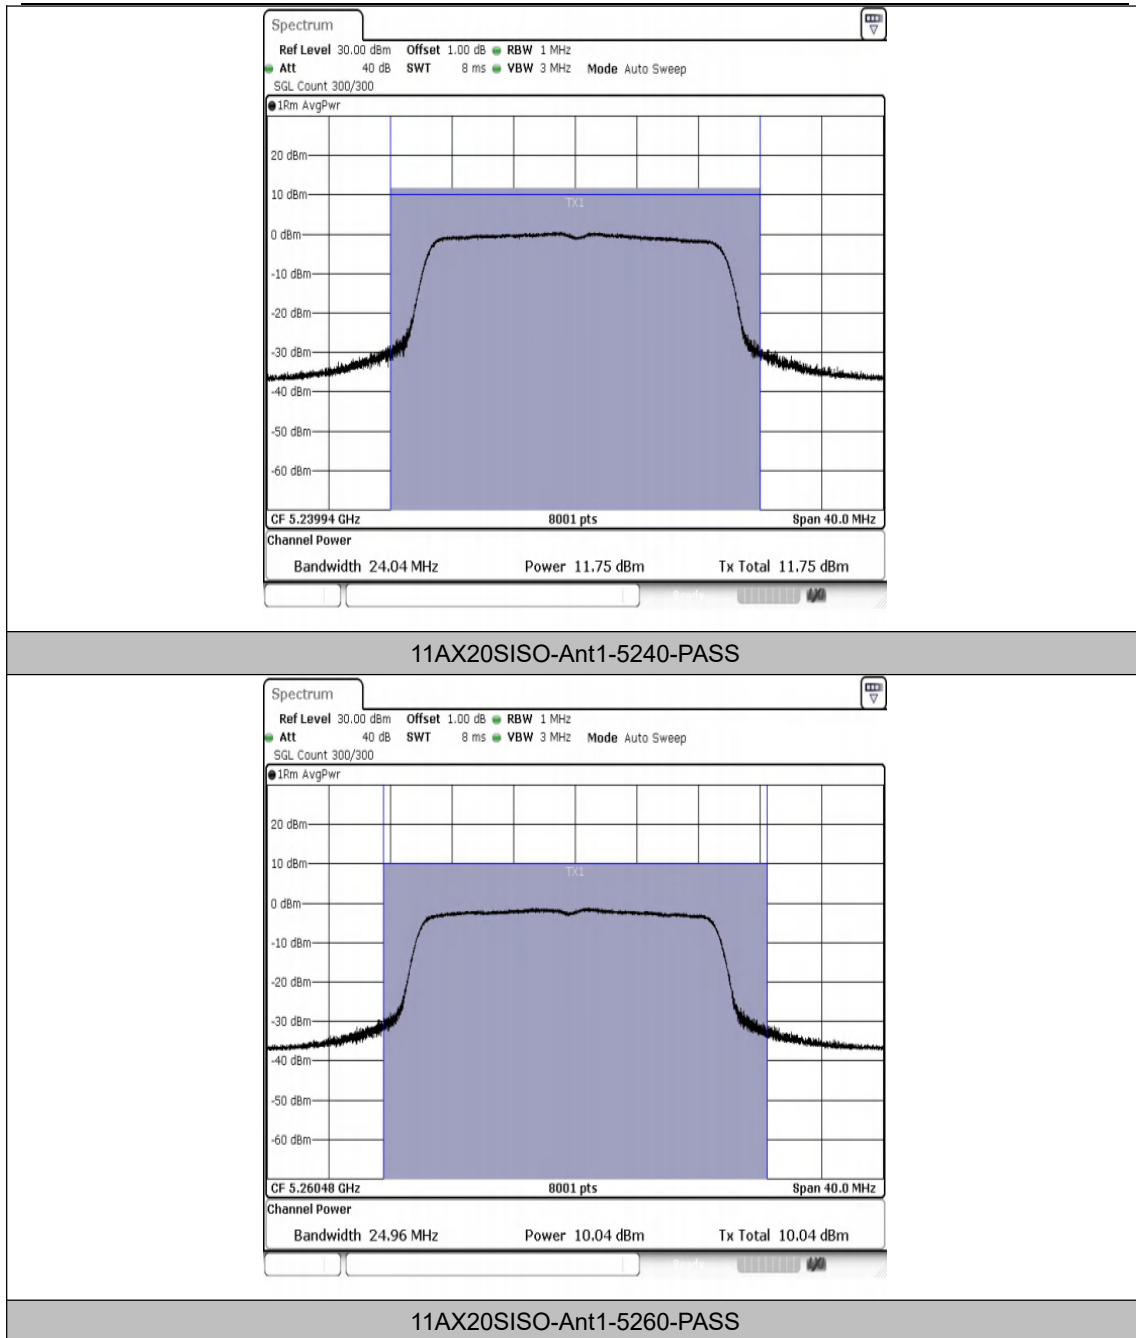

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotech.com


 **Hotline**
400-003-0500
www.anbotech.com

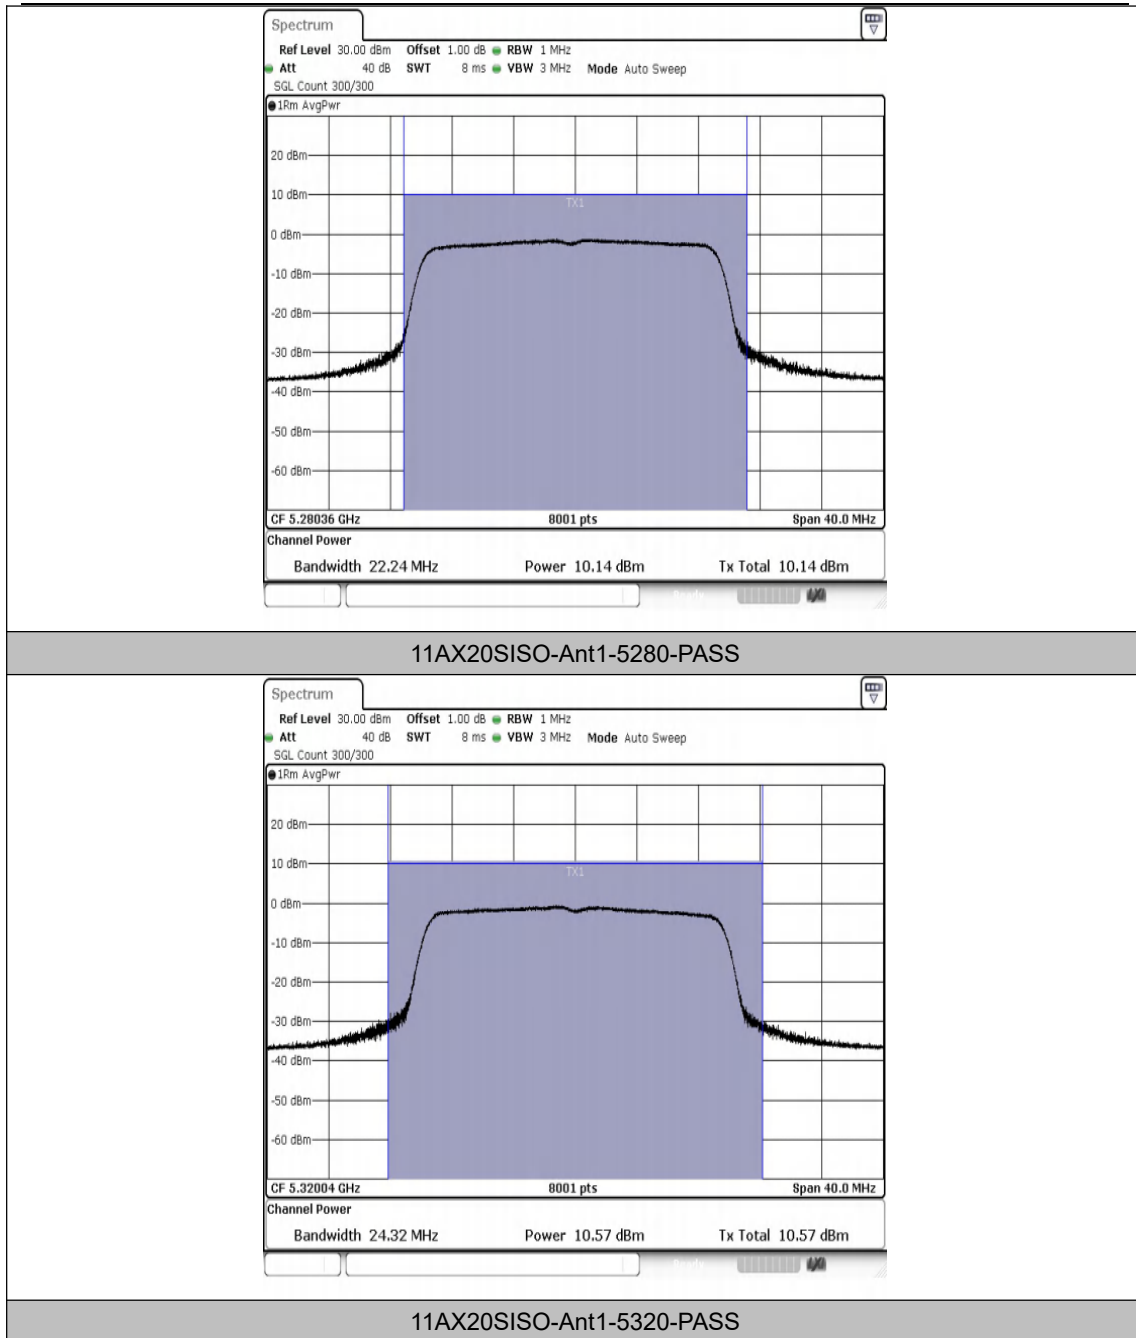


Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com

 Hotline
400-003-0500
www.anbotech.com

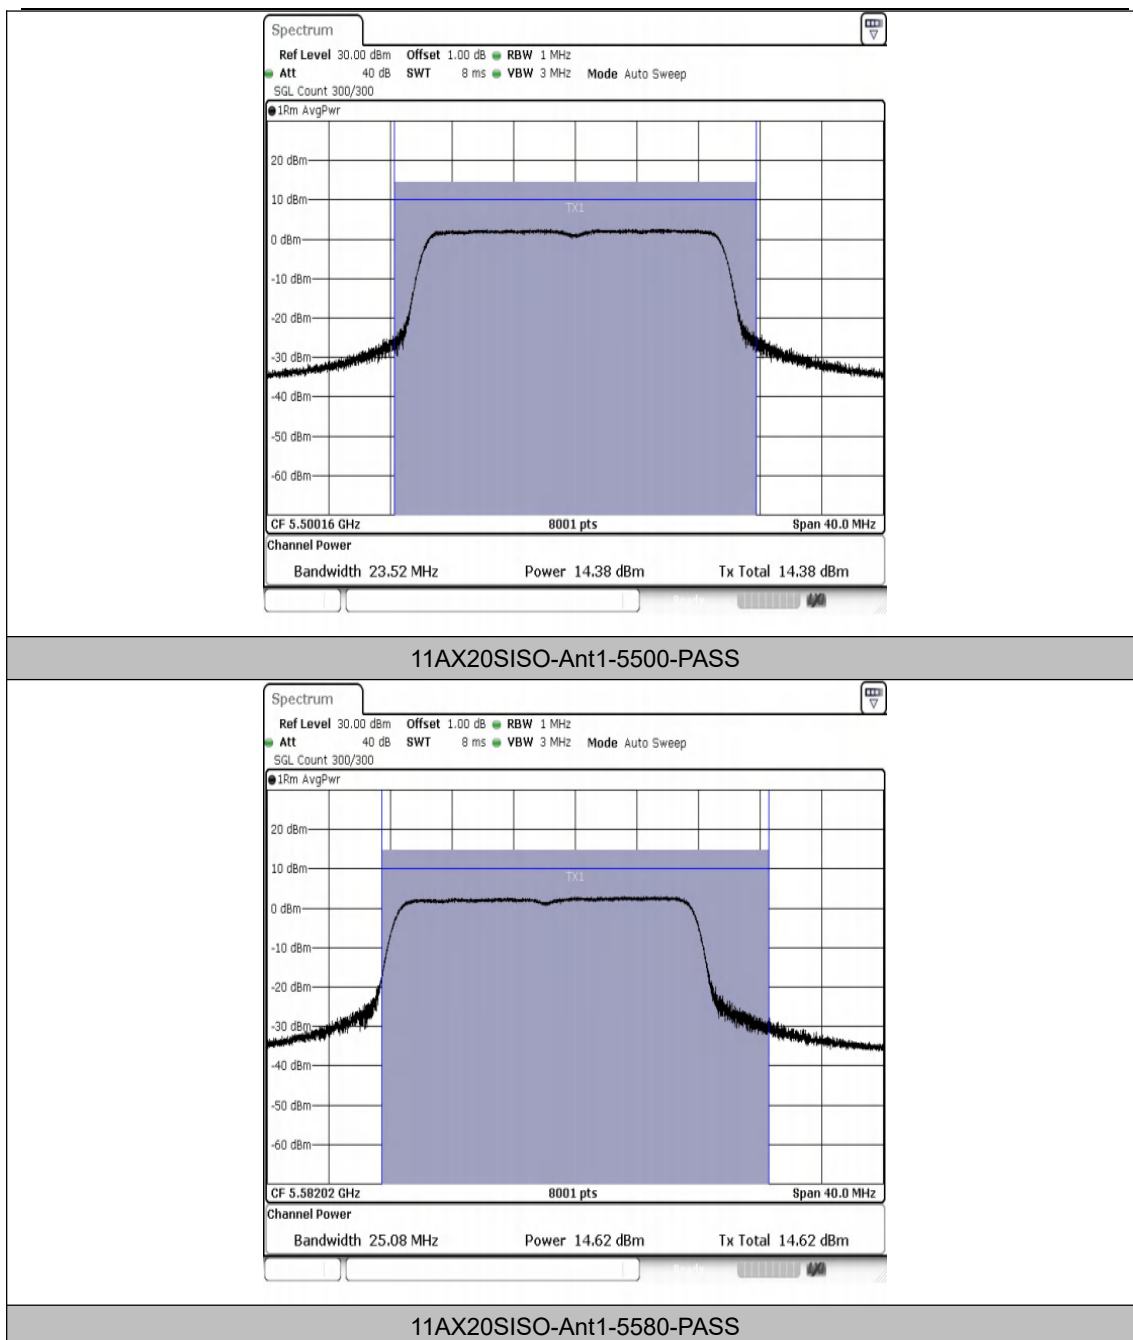


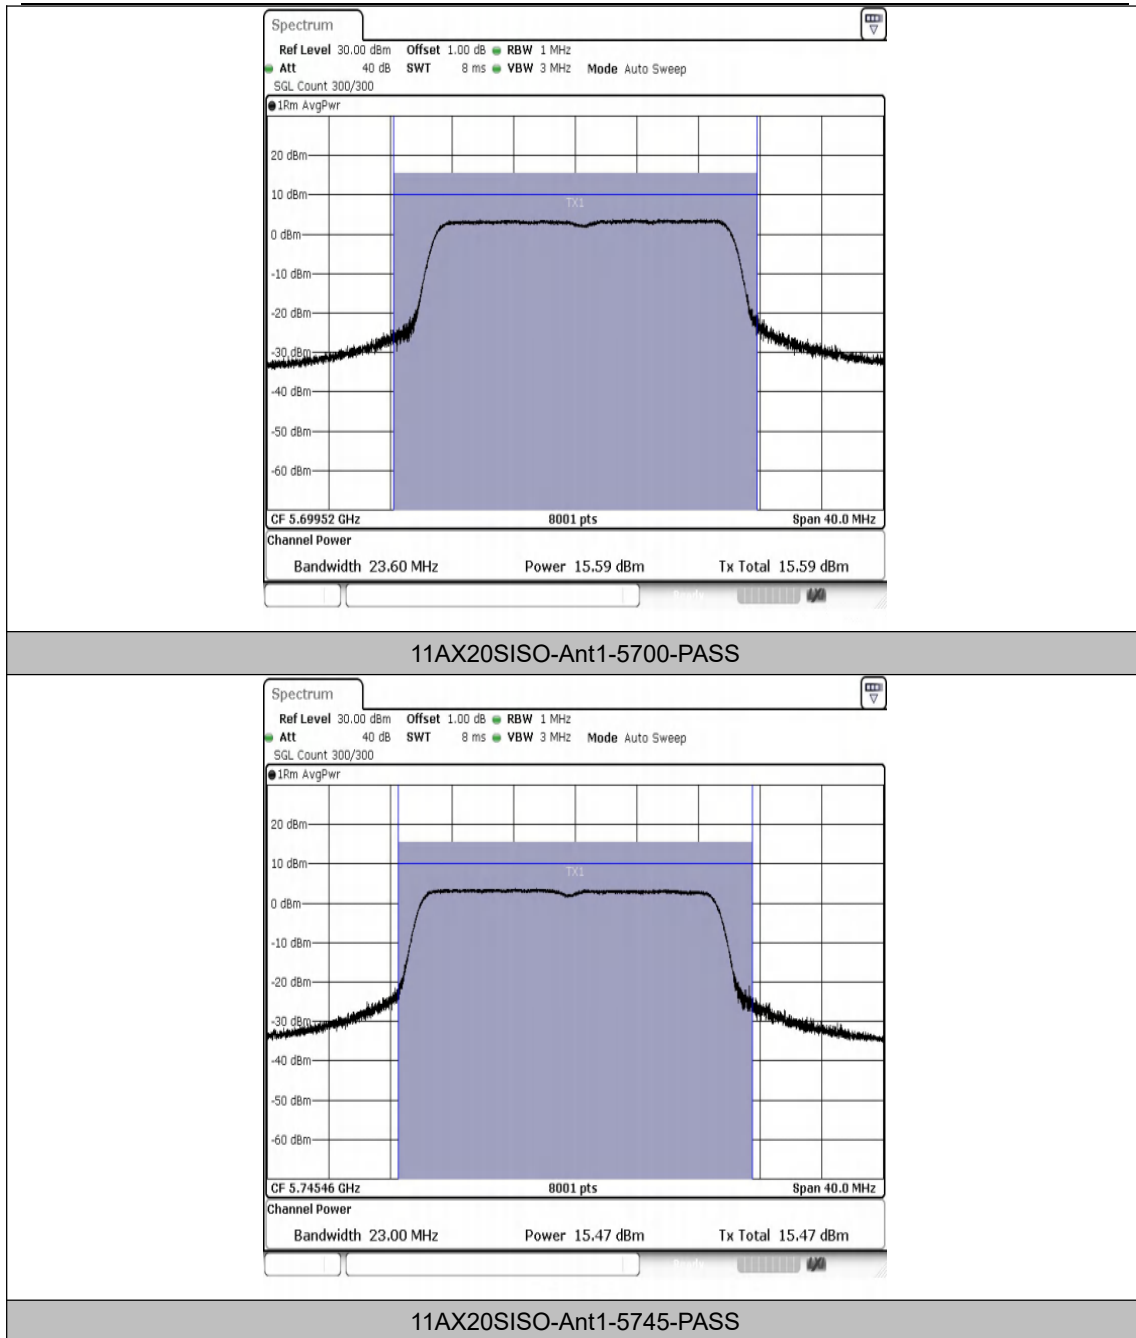

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

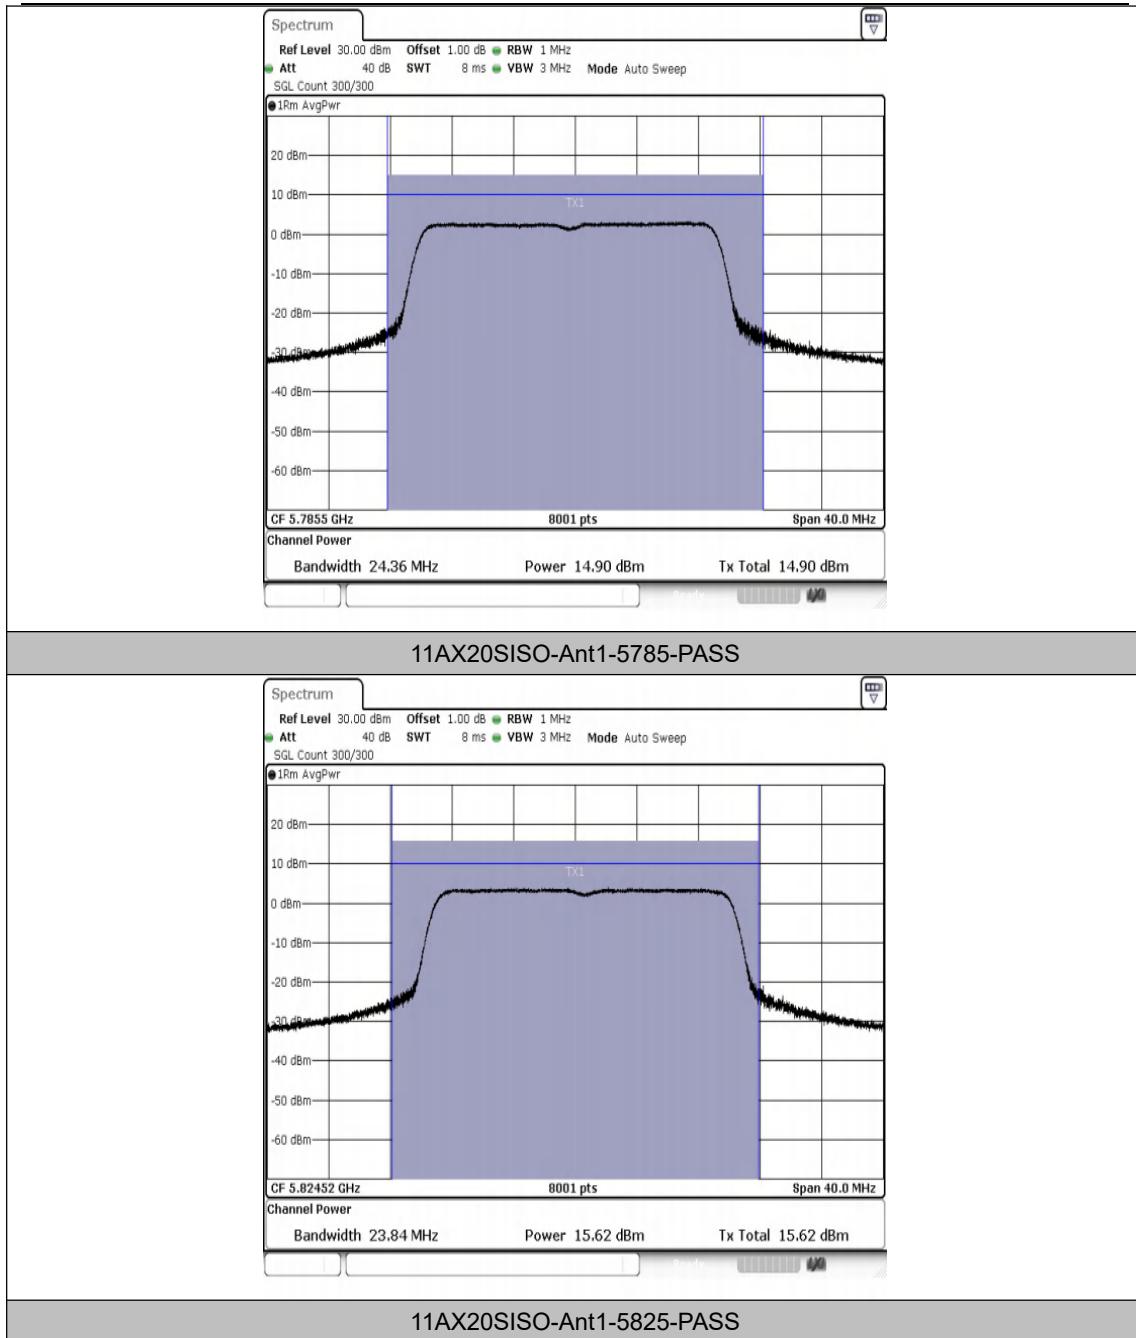


Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

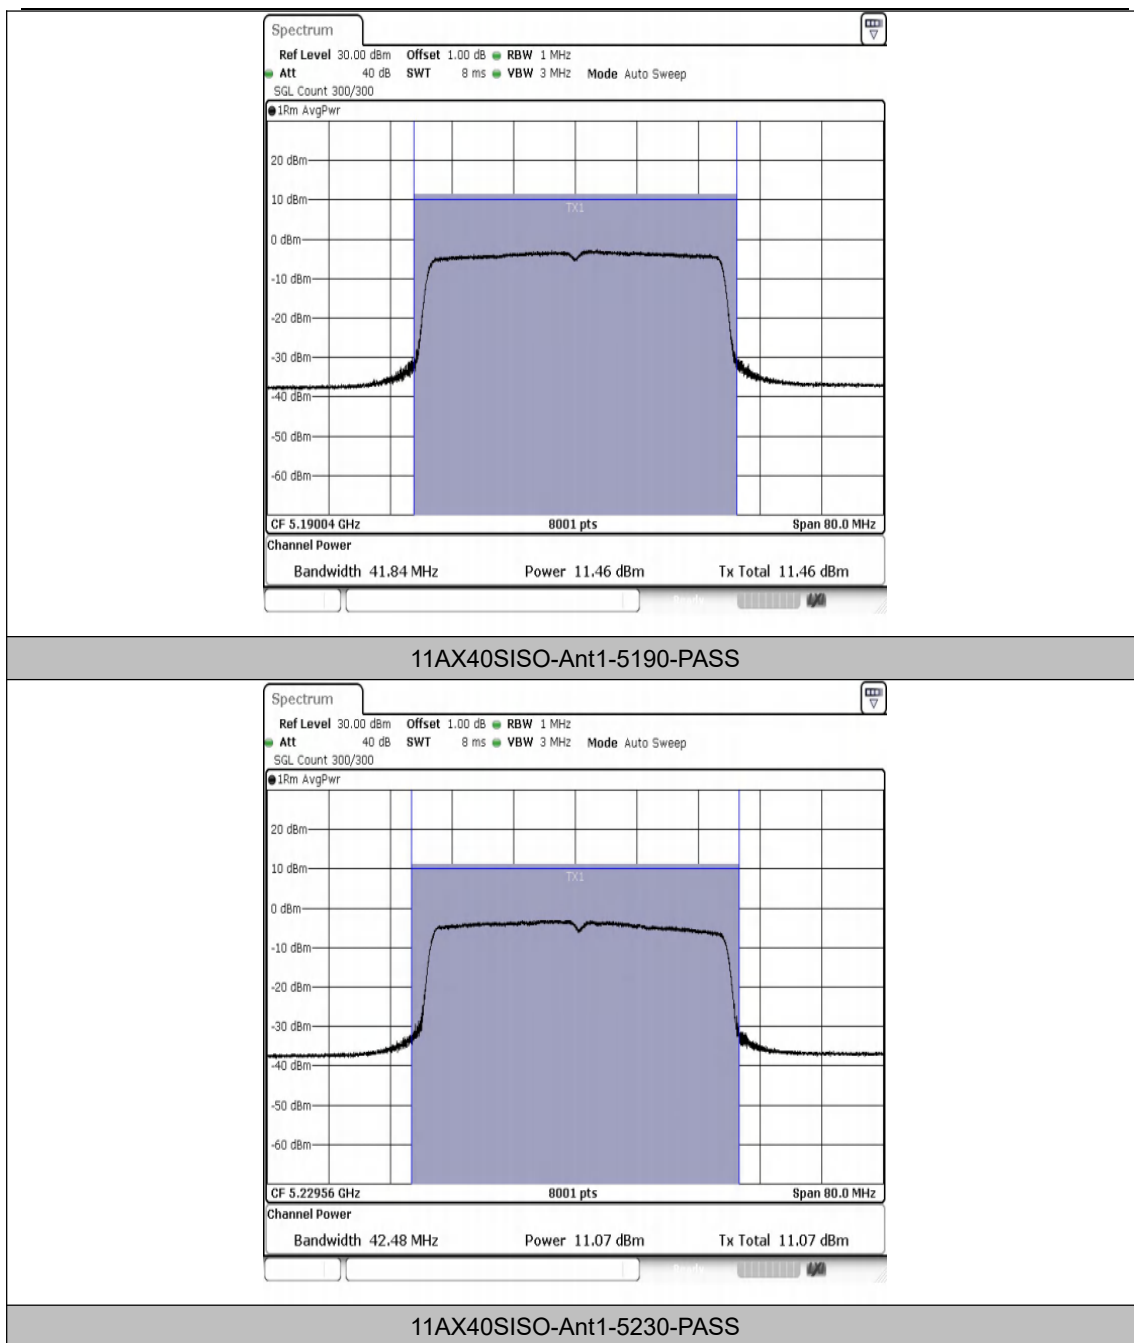


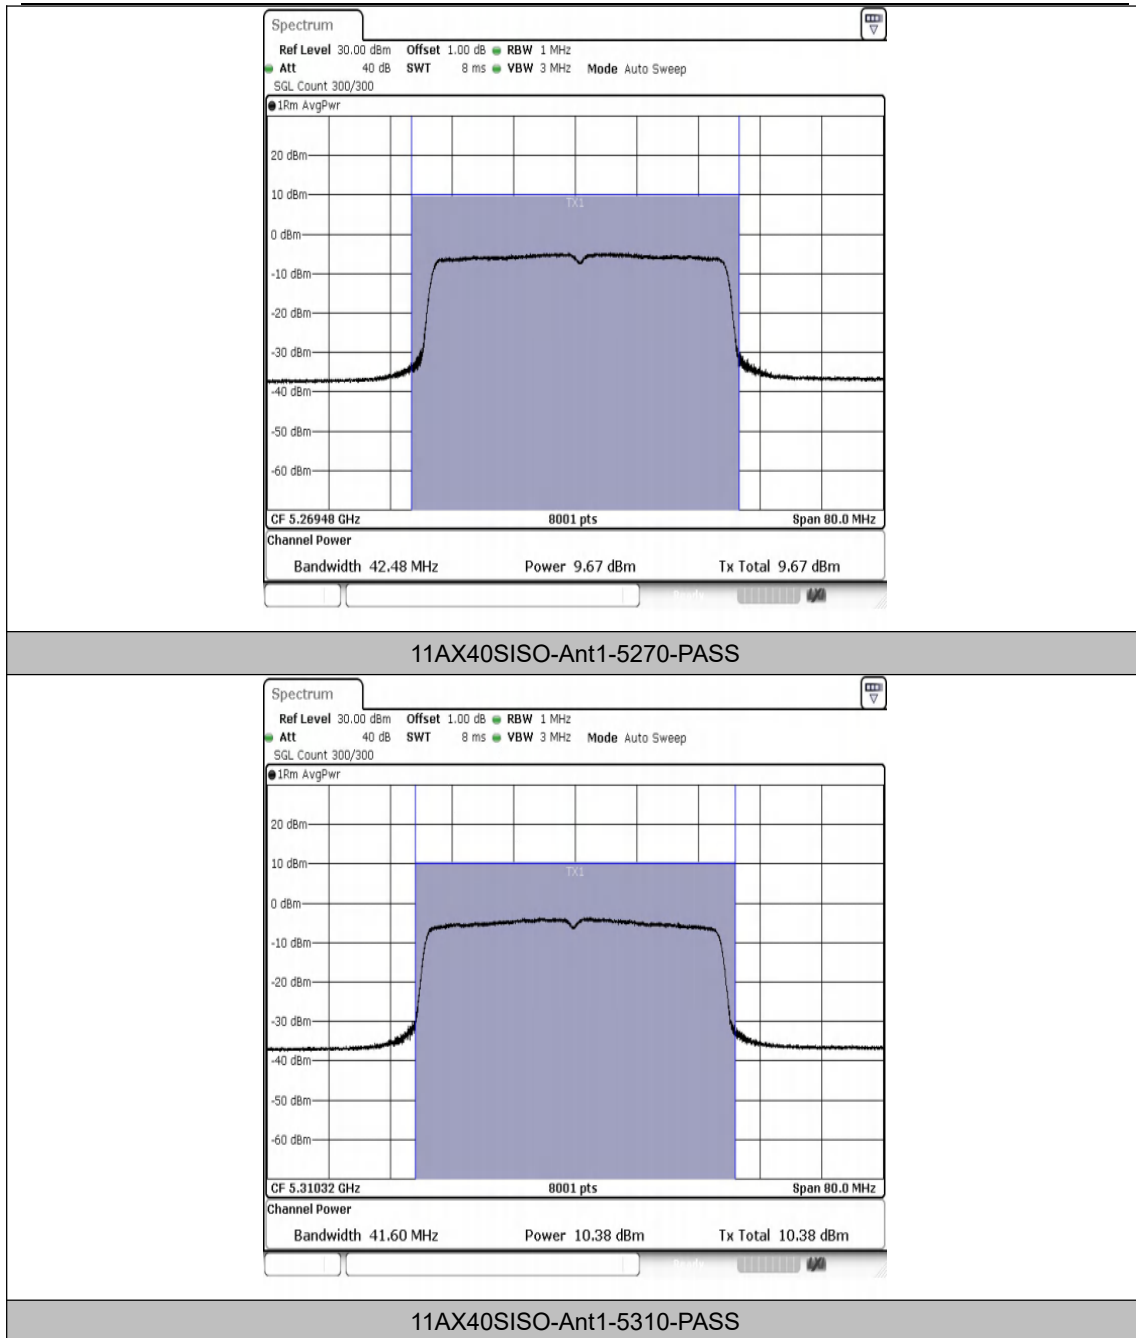



Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

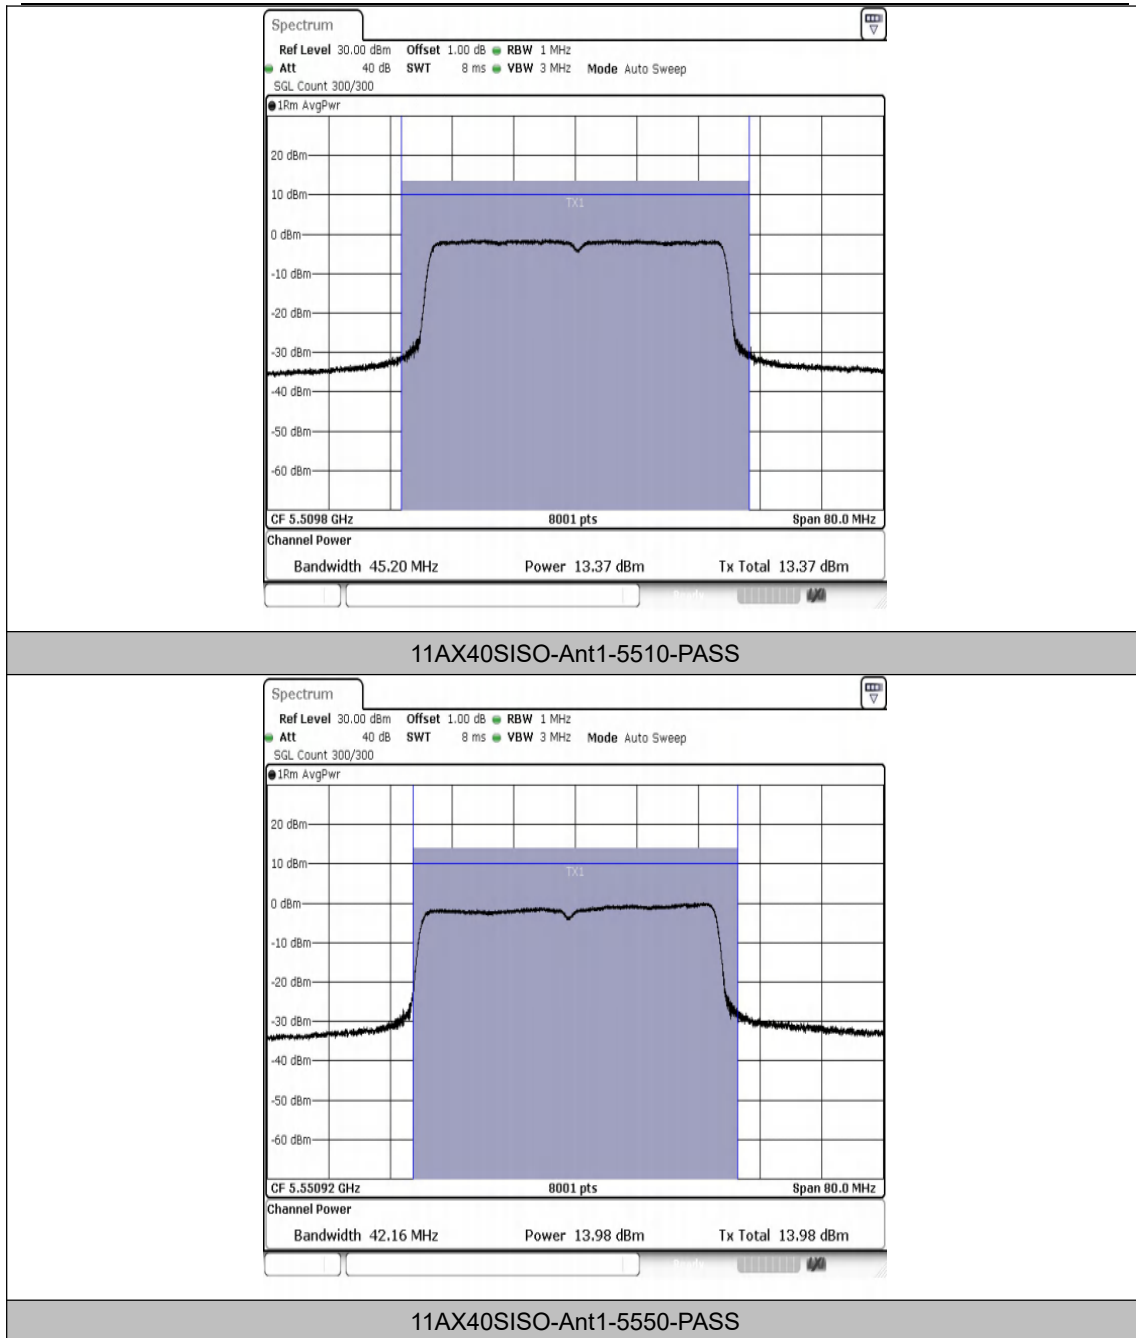

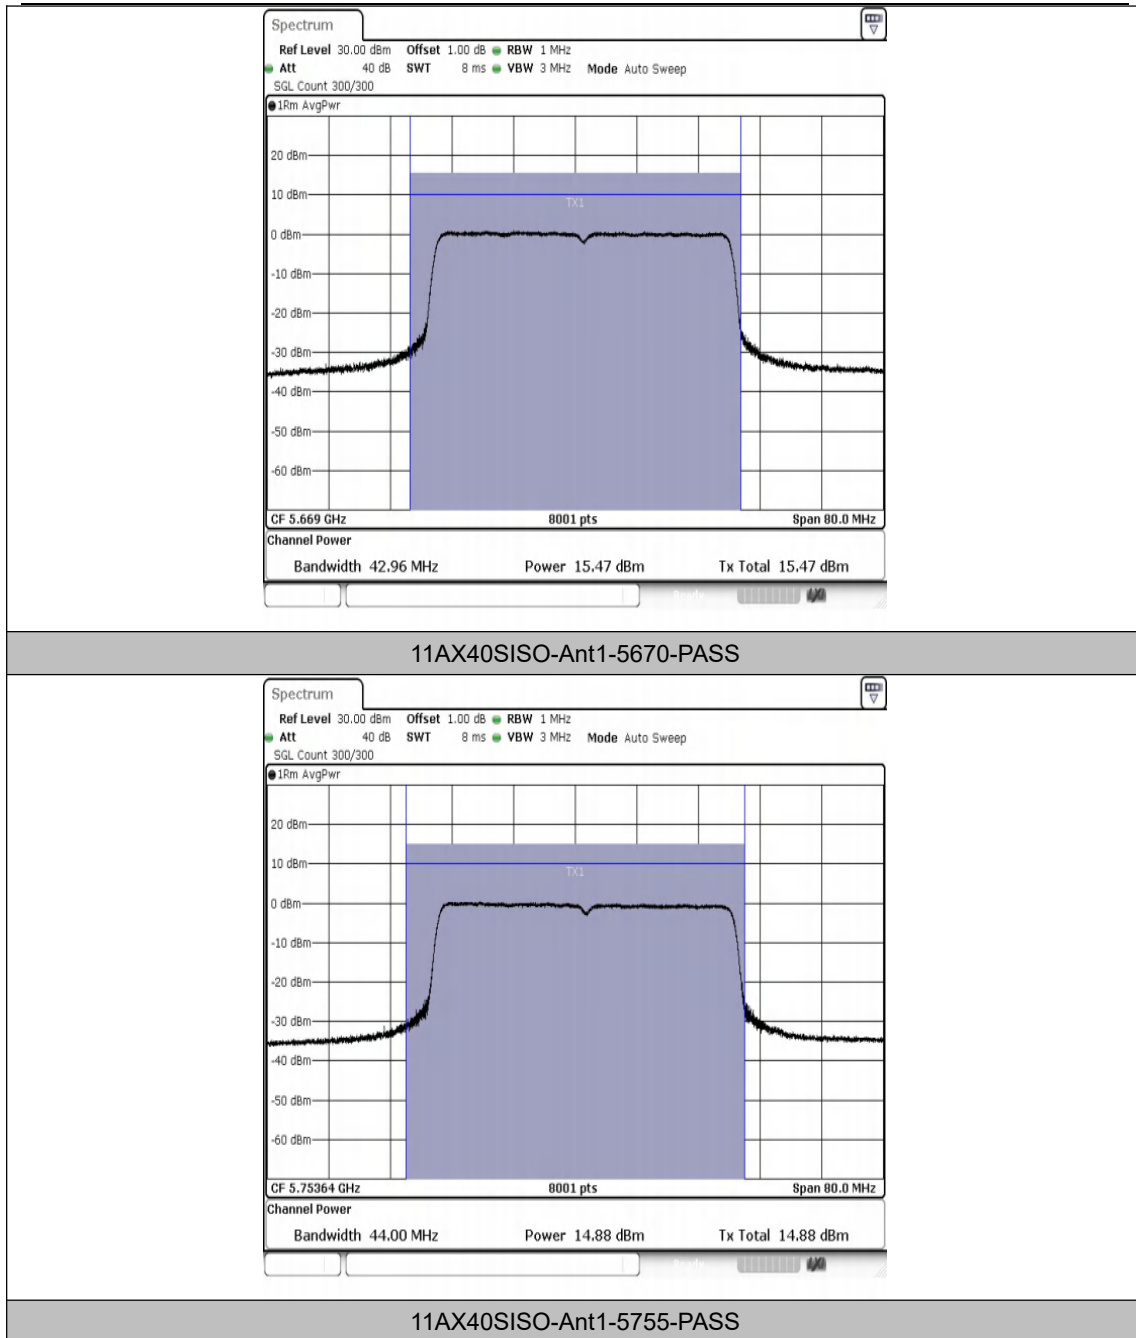


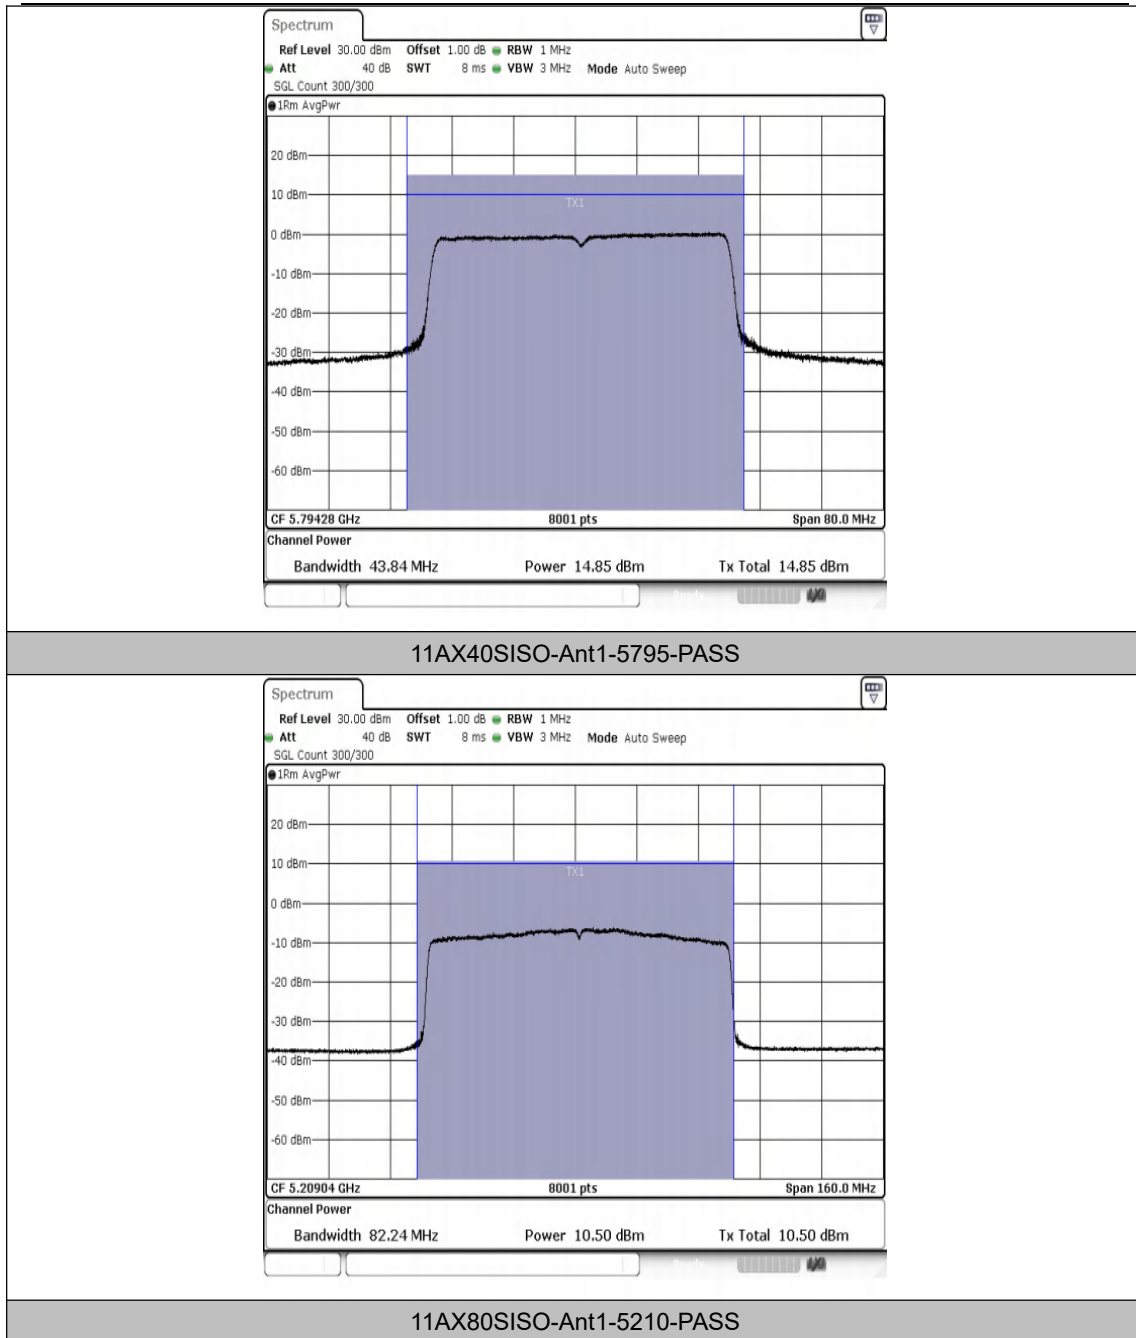


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

 Hotline
400-003-0500
www.anbotek.com

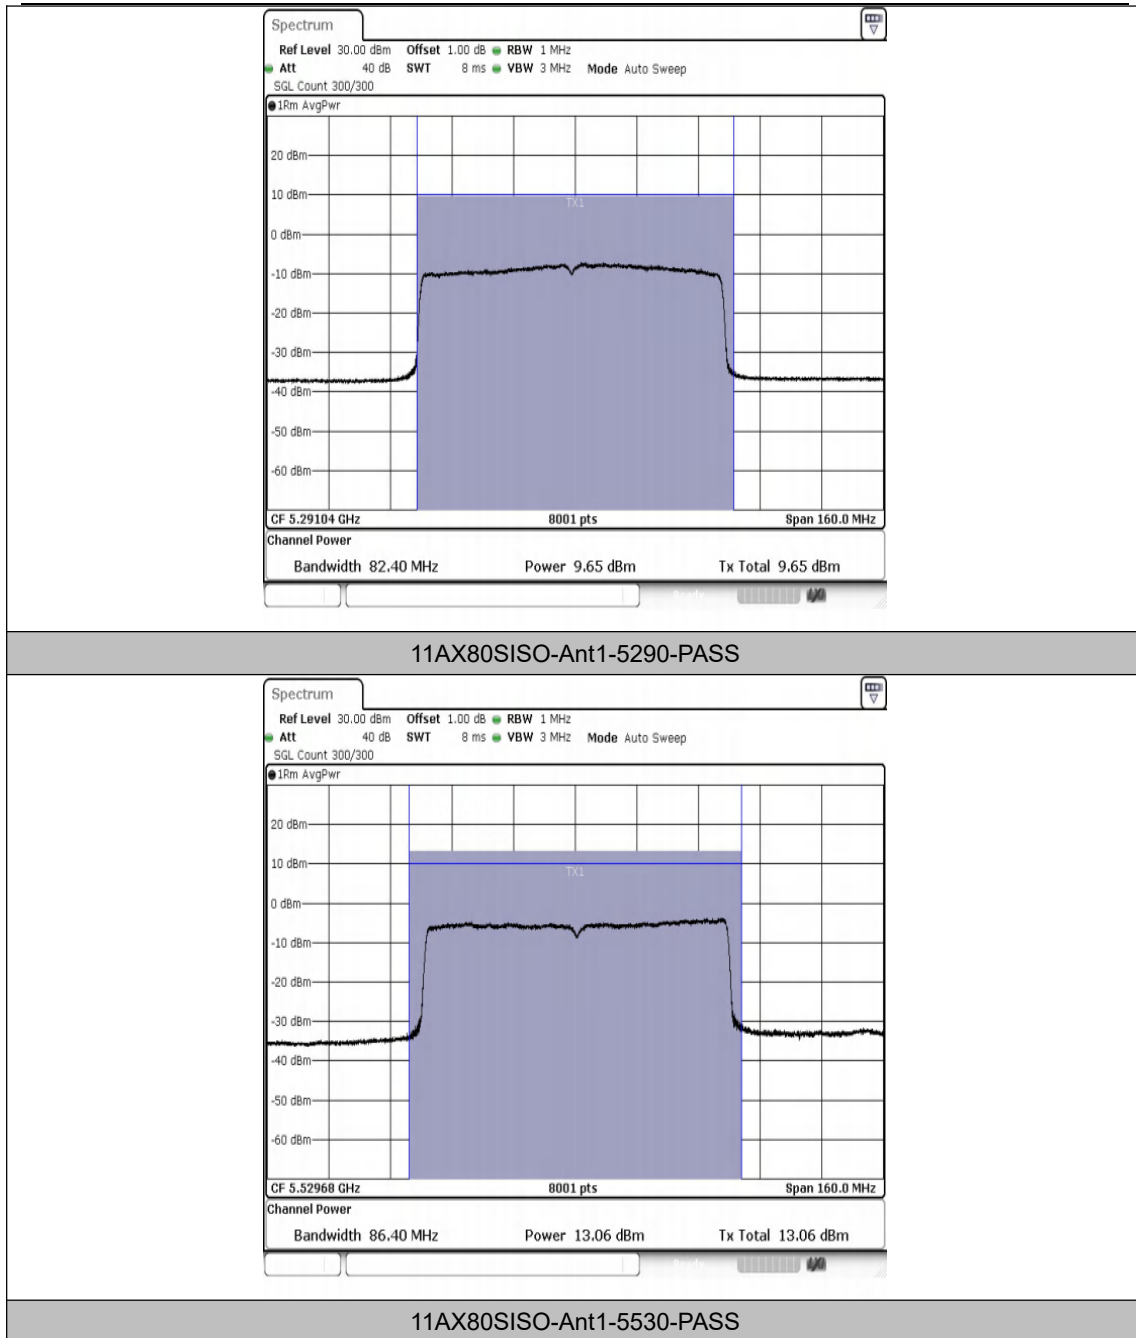

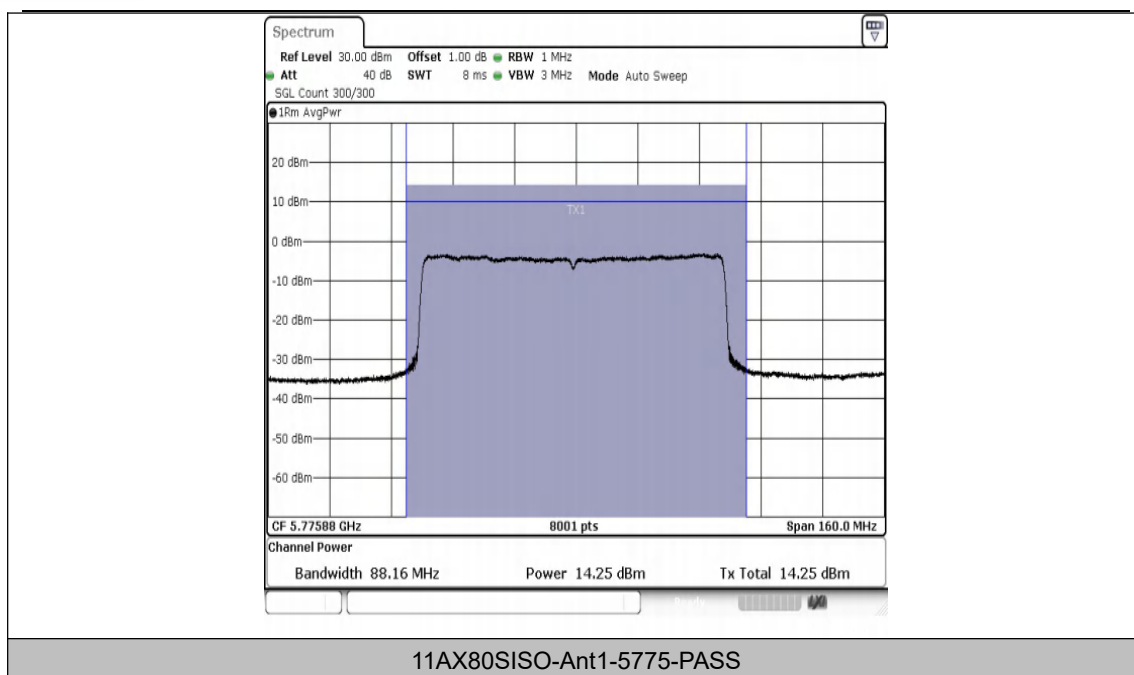

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com

Appendix D: Maximum Power Spectral Density

Test Result B1/2/3

Test Mode	Antenna	Frequency[MHz]	Reading Result[dBm/MHz]	DC Factor [dB]	Result [dBm/MHz]	Limit[dBm/MHz]	Verdict
11A	Ant1	5180	0.92	0.49	1.41	≤11.00	PASS
11A	Ant1	5200	0.89	0.37	1.26	≤11.00	PASS
11A	Ant1	5240	0.57	0.37	0.94	≤11.00	PASS
11A	Ant1	5260	-1.41	0.44	-0.97	≤11.00	PASS
11A	Ant1	5280	-0.74	0.37	-0.37	≤11.00	PASS
11A	Ant1	5320	-0.23	0.49	0.26	≤11.00	PASS
11A	Ant1	5500	2.86	0.41	3.27	≤11.00	PASS
11A	Ant1	5580	3.89	0.48	4.37	≤11.00	PASS
11A	Ant1	5700	4.65	0.45	5.10	≤11.00	PASS
11N20SISO	Ant1	5180	0.9	0.84	1.74	≤11.00	PASS
11N20SISO	Ant1	5200	0.48	0.72	1.20	≤11.00	PASS
11N20SISO	Ant1	5240	0.09	0.52	0.61	≤11.00	PASS
11N20SISO	Ant1	5260	-0.8	0.48	-0.32	≤11.00	PASS
11N20SISO	Ant1	5280	-1.05	0.35	-0.70	≤11.00	PASS
11N20SISO	Ant1	5320	-0.5	2.82	2.32	≤11.00	PASS
11N20SISO	Ant1	5500	3.58	0.48	4.06	≤11.00	PASS
11N20SISO	Ant1	5580	3.37	0.52	3.89	≤11.00	PASS
11N20SISO	Ant1	5700	3.94	0.52	4.46	≤11.00	PASS
11N40SISO	Ant1	5190	-2.81	0.78	-2.03	≤11.00	PASS
11N40SISO	Ant1	5230	-2.44	0.99	-1.45	≤11.00	PASS
11N40SISO	Ant1	5270	-4.08	0.91	-3.17	≤11.00	PASS
11N40SISO	Ant1	5310	-3.51	1.01	-2.50	≤11.00	PASS
11N40SISO	Ant1	5510	-0.05	1.01	0.96	≤11.00	PASS
11N40SISO	Ant1	5550	0.72	1.88	2.60	≤11.00	PASS
11N40SISO	Ant1	5670	1.38	1.01	2.39	≤11.00	PASS
11AC20SISO	Ant1	5180	0.28	0.52	0.80	≤11.00	PASS
11AC20SISO	Ant1	5200	0.5	0.39	0.89	≤11.00	PASS
11AC20SISO	Ant1	5240	1	0.35	1.35	≤11.00	PASS
11AC20SISO	Ant1	5260	-0.16	0.48	0.32	≤11.00	PASS
11AC20SISO	Ant1	5280	-0.95	0.39	-0.56	≤11.00	PASS
11AC20SISO	Ant1	5320	0.34	0.52	0.86	≤11.00	PASS
11AC20SISO	Ant1	5500	2.78	0.52	3.30	≤11.00	PASS
11AC20SISO	Ant1	5580	3.3	0.52	3.82	≤11.00	PASS
11AC20SISO	Ant1	5700	4.32	0.48	4.80	≤11.00	PASS
11AC40SISO	Ant1	5190	-2.73	0.76	-1.97	≤11.00	PASS
11AC40SISO	Ant1	5230	-2.17	0.99	-1.18	≤11.00	PASS

11AC40SISO	Ant1	5270	-4.76	0.91	-3.85	≤11.00	PASS
11AC40SISO	Ant1	5310	-2.99	0.99	-2.00	≤11.00	PASS
11AC40SISO	Ant1	5510	-0.68	2.46	1.78	≤11.00	PASS
11AC40SISO	Ant1	5550	0.42	0.99	1.41	≤11.00	PASS
11AC40SISO	Ant1	5670	1.62	0.93	2.55	≤11.00	PASS
11AC80SISO	Ant1	5210	-5.61	2.18	-3.43	≤11.00	PASS
11AC80SISO	Ant1	5290	-7.21	1.70	-5.51	≤11.00	PASS
11AC80SISO	Ant1	5530	-2.98	3.30	0.32	≤11.00	PASS
11AX20SISO	Ant1	5180	-0.23	0.51	0.28	≤11.00	PASS
11AX20SISO	Ant1	5200	0.5	0.34	0.84	≤11.00	PASS
11AX20SISO	Ant1	5240	0.48	0.51	0.99	≤11.00	PASS
11AX20SISO	Ant1	5260	-1.87	0.66	-1.21	≤11.00	PASS
11AX20SISO	Ant1	5280	-1.52	0.51	-1.01	≤11.00	PASS
11AX20SISO	Ant1	5320	-0.24	0.61	0.37	≤11.00	PASS
11AX20SISO	Ant1	5500	2.79	0.61	3.40	≤11.00	PASS
11AX20SISO	Ant1	5580	2.73	0.66	3.39	≤11.00	PASS
11AX20SISO	Ant1	5700	3.53	0.66	4.19	≤11.00	PASS
11AX40SISO	Ant1	5190	-2.81	0.92	-1.89	≤11.00	PASS
11AX40SISO	Ant1	5230	-3.7	0.83	-2.87	≤11.00	PASS
11AX40SISO	Ant1	5270	-4.04	1.10	-2.94	≤11.00	PASS
11AX40SISO	Ant1	5310	-3.09	0.92	-2.17	≤11.00	PASS
11AX40SISO	Ant1	5510	-1.42	2.95	1.53	≤11.00	PASS
11AX40SISO	Ant1	5550	0.62	2.95	3.57	≤11.00	PASS
11AX40SISO	Ant1	5670	0.8	1.19	1.99	≤11.00	PASS
11AX80SISO	Ant1	5210	-5.9	1.68	-4.22	≤11.00	PASS
11AX80SISO	Ant1	5290	-6.89	2.04	-4.85	≤11.00	PASS
11AX80SISO	Ant1	5530	-2.8	2.90	0.10	≤11.00	PASS

Note: 1.The Duty Cycle Factor and cable loss and RBW Factor are compensated in the graph.



Test Result B4

Test Mode	Antenna	Frequency [MHz]	Reading Result[dBm/500KHz]	DC Factor [dB]	Result [dBm/500 KHz]	Limit[dBm /500KHz]	V e r d i c t
11A	Ant1	5745	1.64	0.33	1.97	≤30.00	P A S S
11A	Ant1	5785	0.75	1.65	2.40	≤30.00	P A S S
11A	Ant1	5825	1.68	0.49	2.17	≤30.00	P A S S
11N20SISO	Ant1	5745	1	0.35	1.35	≤30.00	P A S S
11N20SISO	Ant1	5785	0.44	0.52	0.96	≤30.00	P A S S
11N20SISO	Ant1	5825	1.16	0.52	1.68	≤30.00	P A S S
11N40SISO	Ant1	5755	-2.68	1.60	-1.08	≤30.00	P A S S
11N40SISO	Ant1	5795	-2.13	0.77	-1.36	≤30.00	P A S S
11AC20SISO	Ant1	5745	1.22	0.68	1.90	≤30.00	P A S S

Shenzhen Anbotech Compliance Laboratory Limited



							S
11AC20SISO	Ant1	5785	1.05	0.39	1.44	≤30.00	P A S S
11AC20SISO	Ant1	5825	1.28	0.43	1.71	≤30.00	P A S S
11AC40SISO	Ant1	5755	-1.95	1.06	-0.89	≤30.00	P A S S
11AC40SISO	Ant1	5795	-2.01	0.99	-1.02	≤30.00	P A S S
11AC80SISO	Ant1	5775	-5.78	2.18	-3.60	≤30.00	P A S S
11AX20SISO	Ant1	5745	0.85	0.65	1.50	≤30.00	P A S S
11AX20SISO	Ant1	5785	0.54	1.23	1.77	≤30.00	P A S S
11AX20SISO	Ant1	5825	1.16	0.65	1.81	≤30.00	P A S S
11AX40SISO	Ant1	5755	-1.92	1.76	-0.16	≤30.00	P A S S
11AX40SISO	Ant1	5795	-2.18	2.06	-0.12	≤30.00	P A S S
11AX80SISO	Ant1	5775	-5.69	3.34	-2.35	≤30.00	P A

Shenzhen Anbotech Compliance Laboratory Limited



							S
							S


Note: 1.The Duty Cycle Factor and cable loss and RBW Factor are compensated in the graph.

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com

 Hotline
400-003-0500
www.anbotek.com

Test Graphs B1/2/3

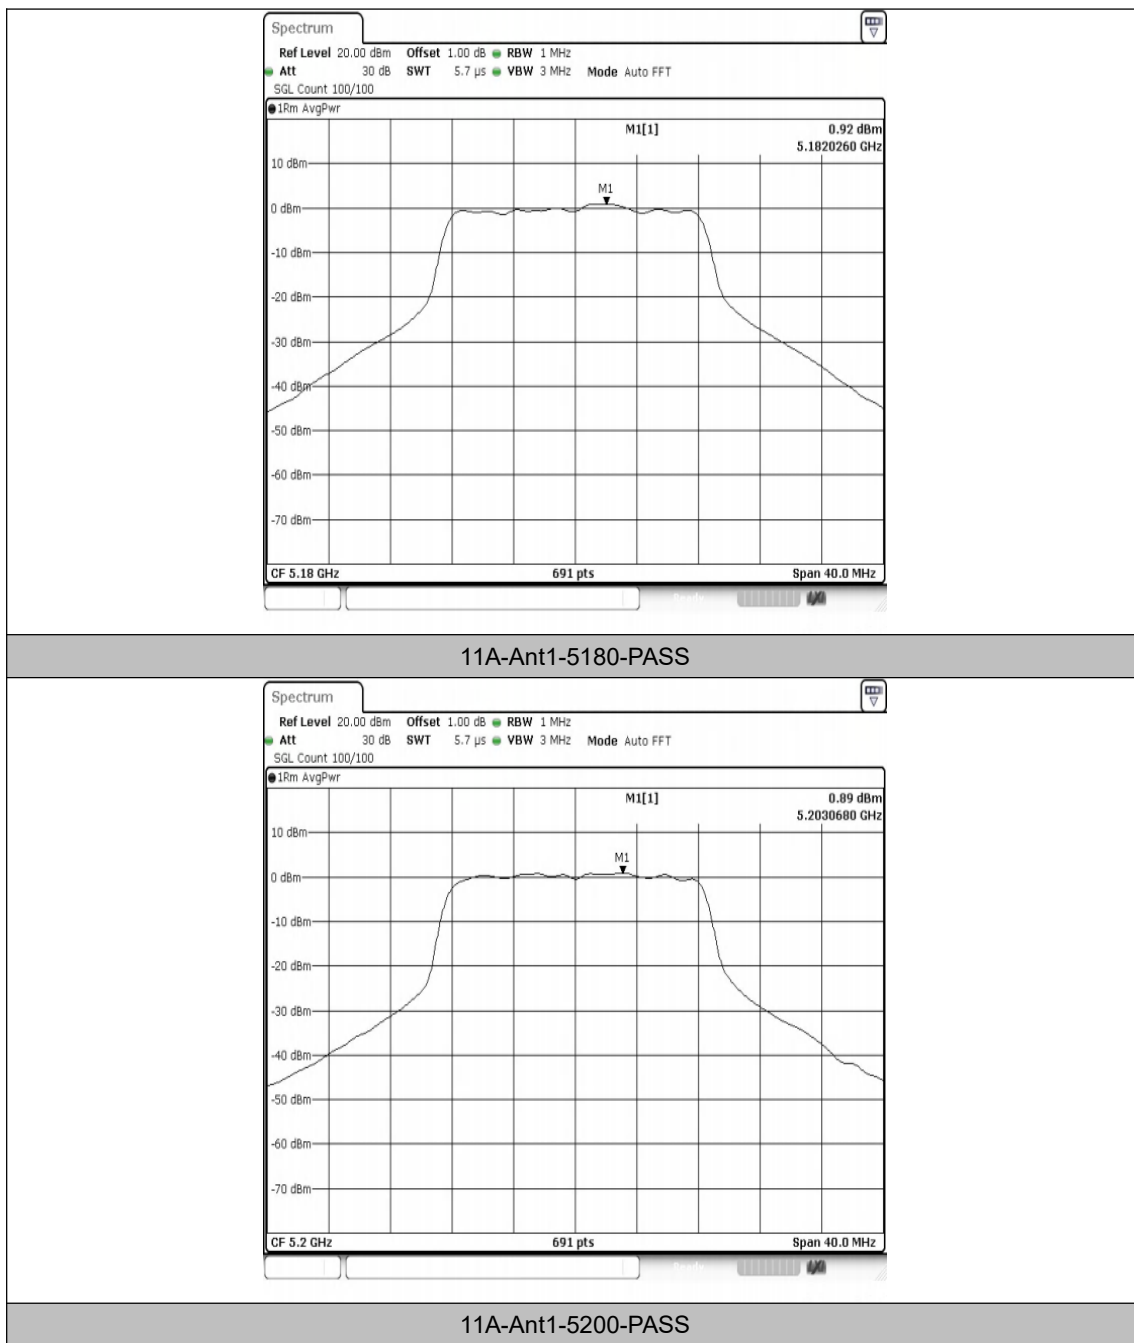


Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com

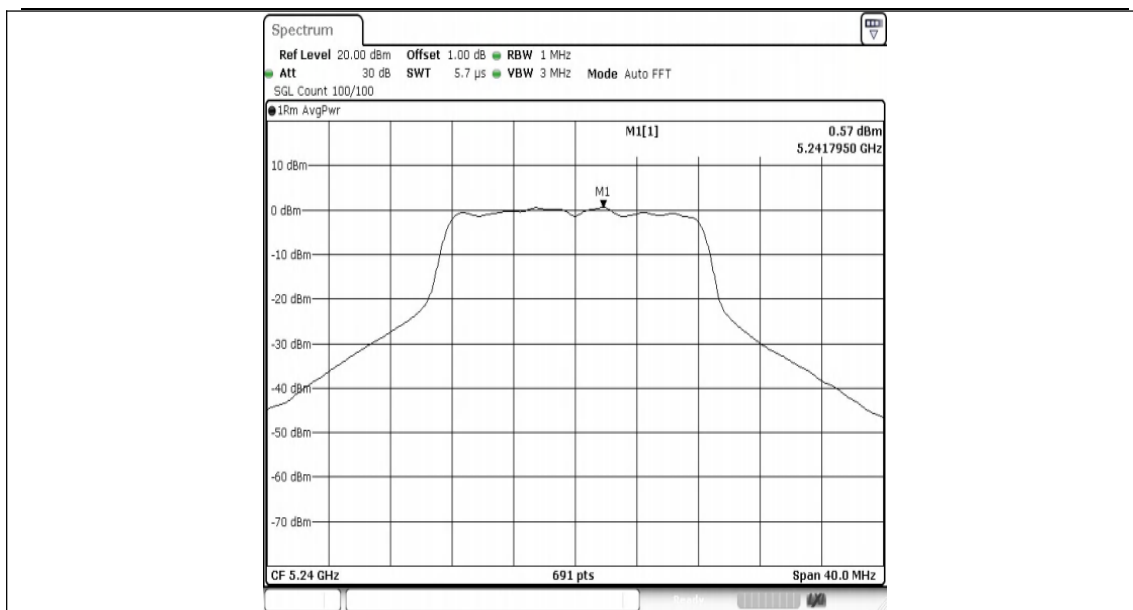


11A-Ant1-5240-PASS

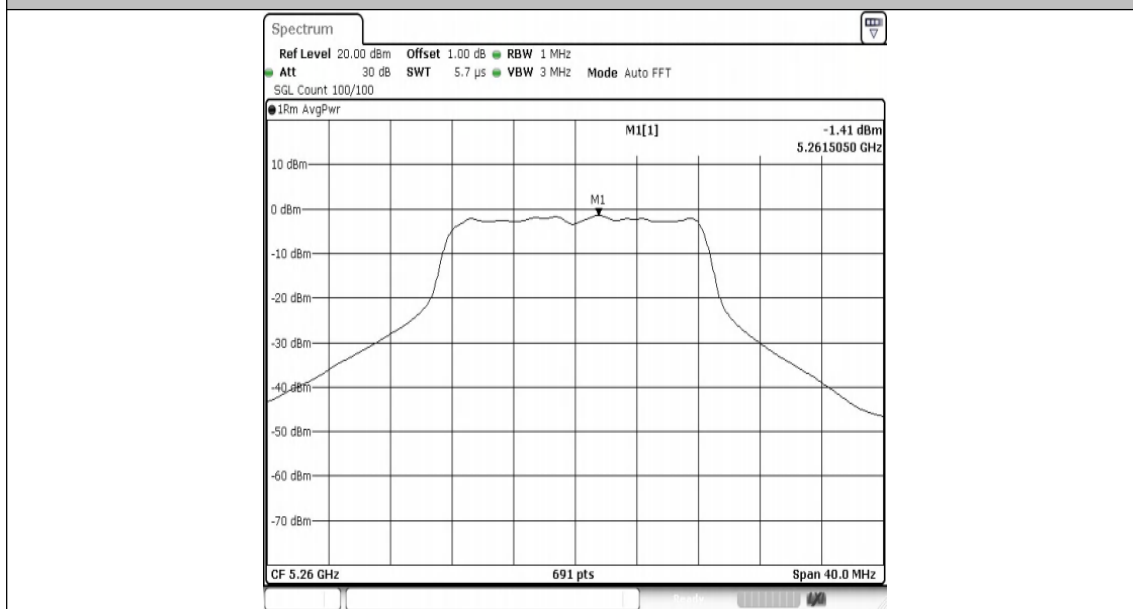


11A-Ant1-5260-PASS

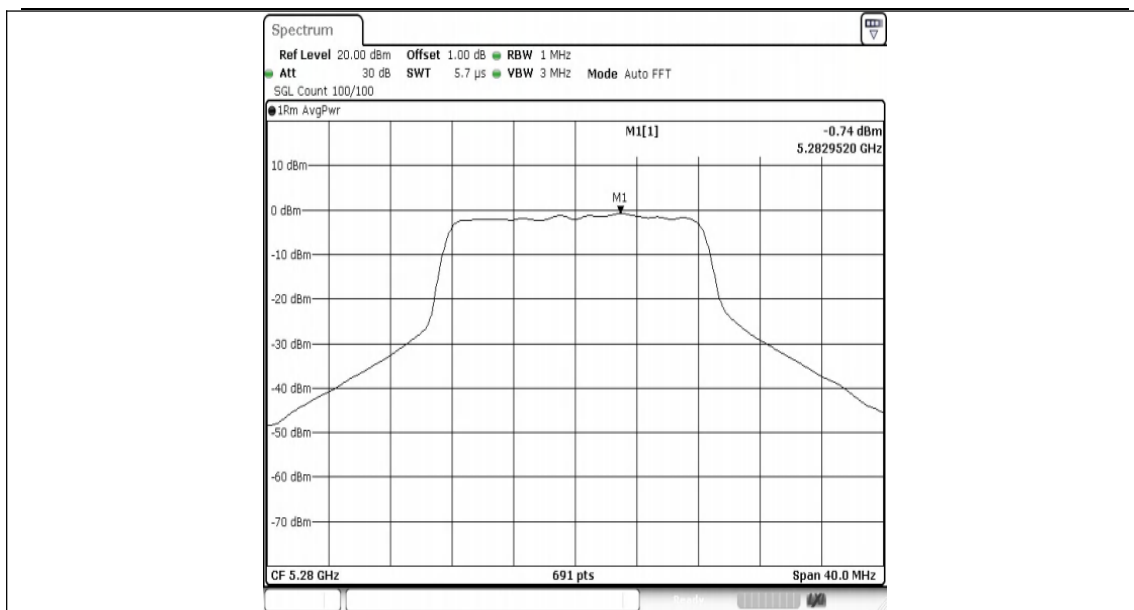


11A-Ant1-5280-PASS

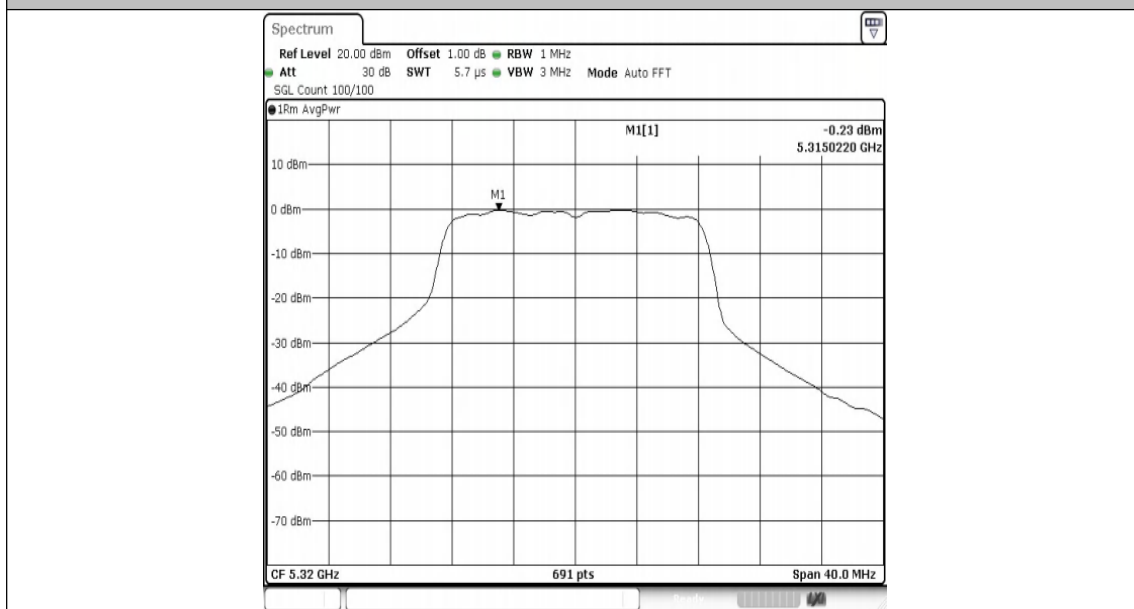


11A-Ant1-5320-PASS

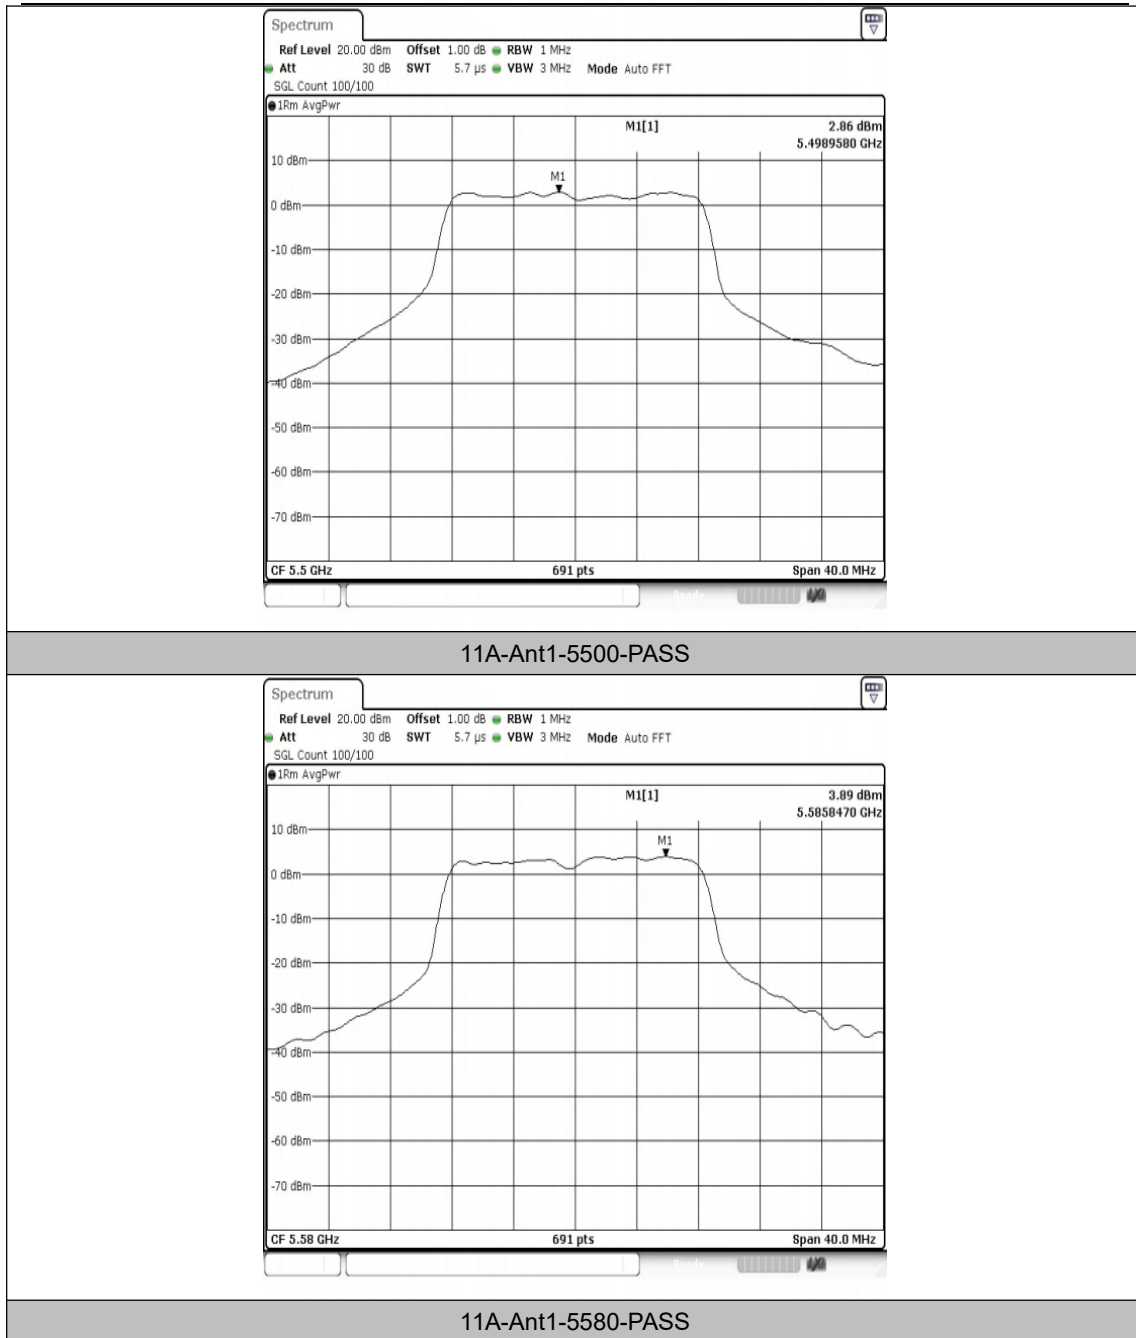


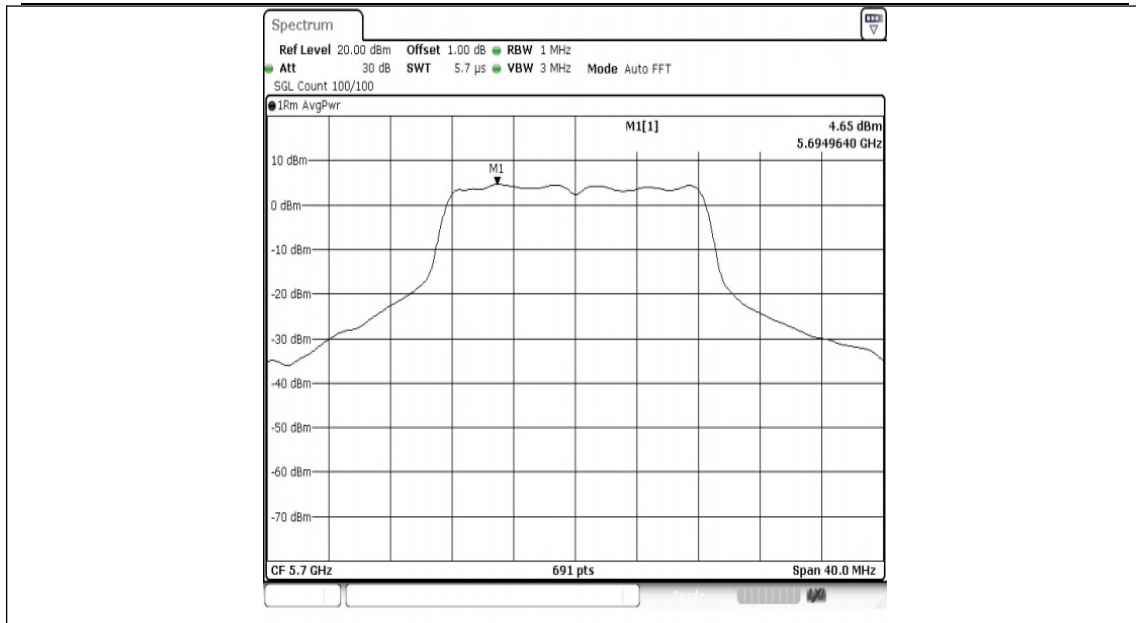


11A-Ant1-5700-PASS

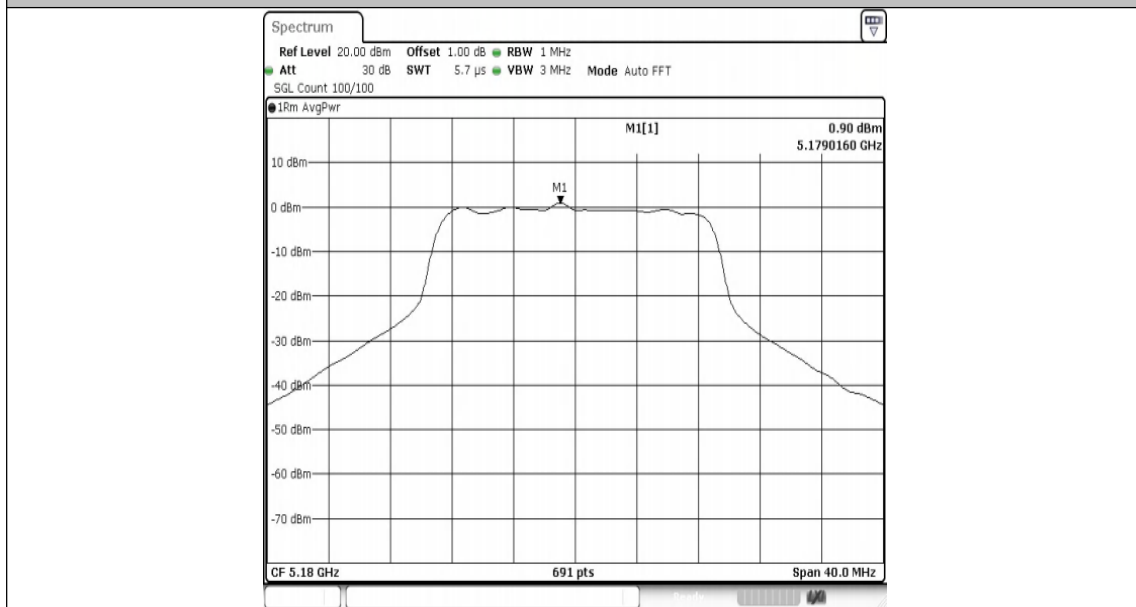


11N20SISO-Ant1-5180-PASS

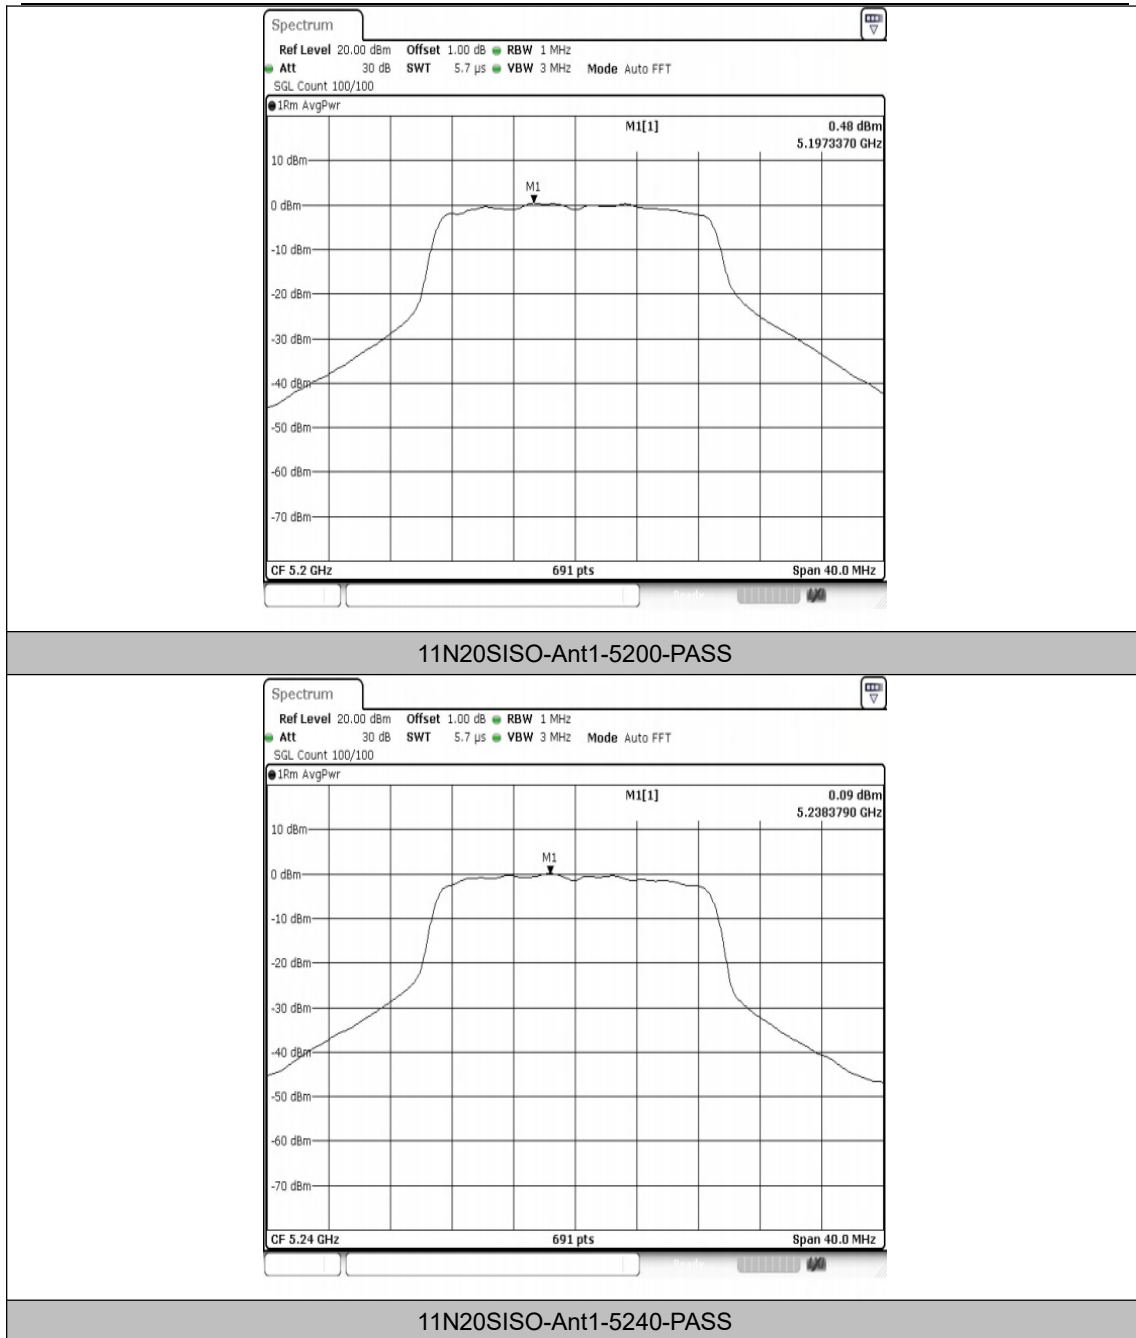


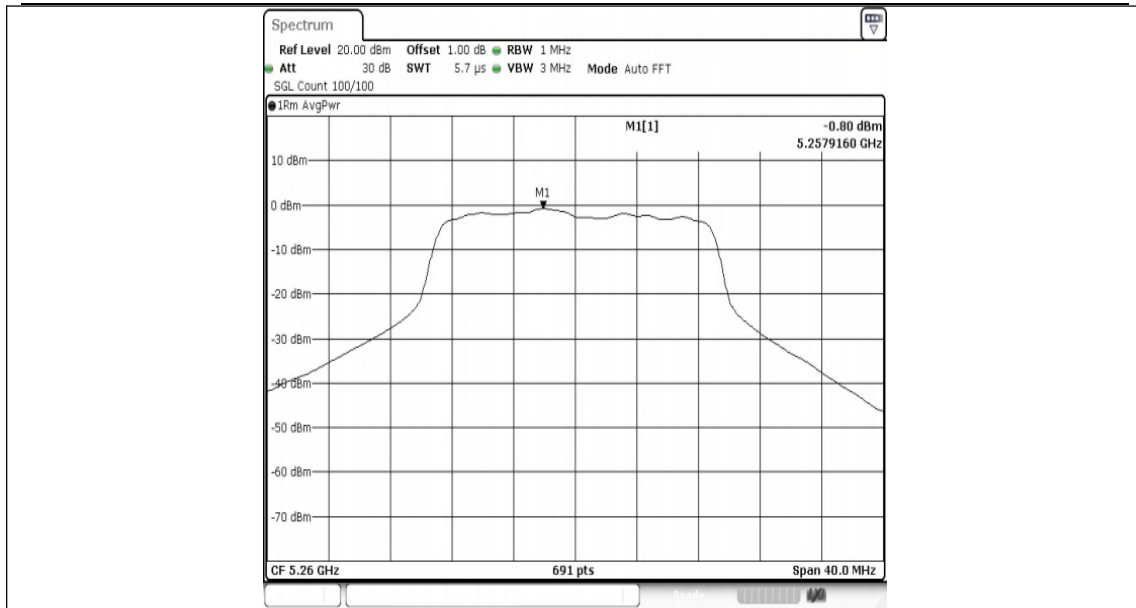



11N20SISO-Ant1-5260-PASS

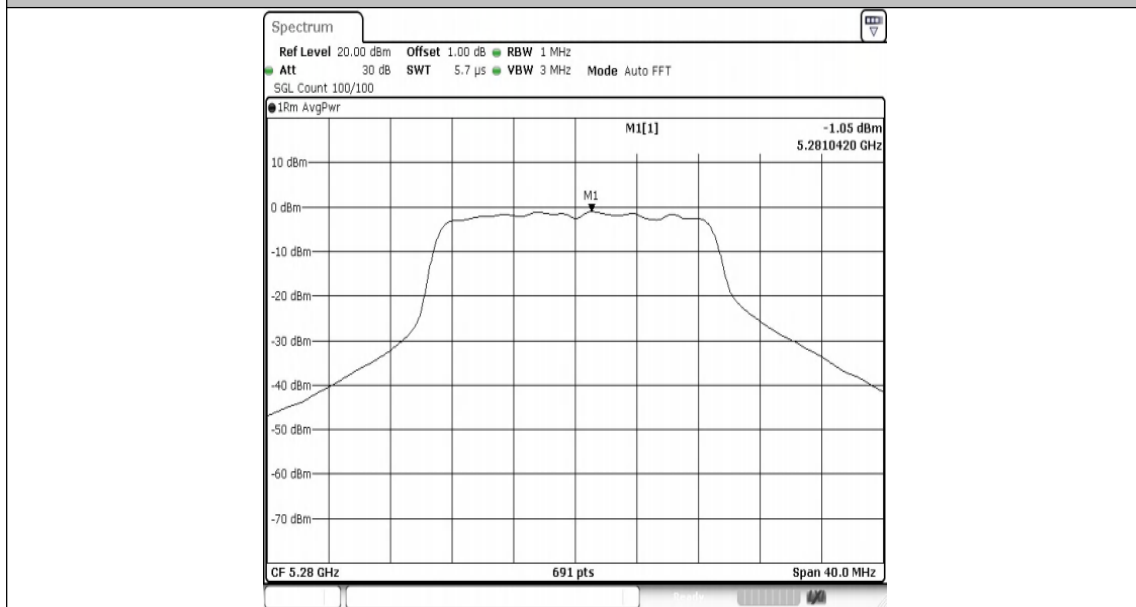



11N20SISO-Ant1-5280-PASS

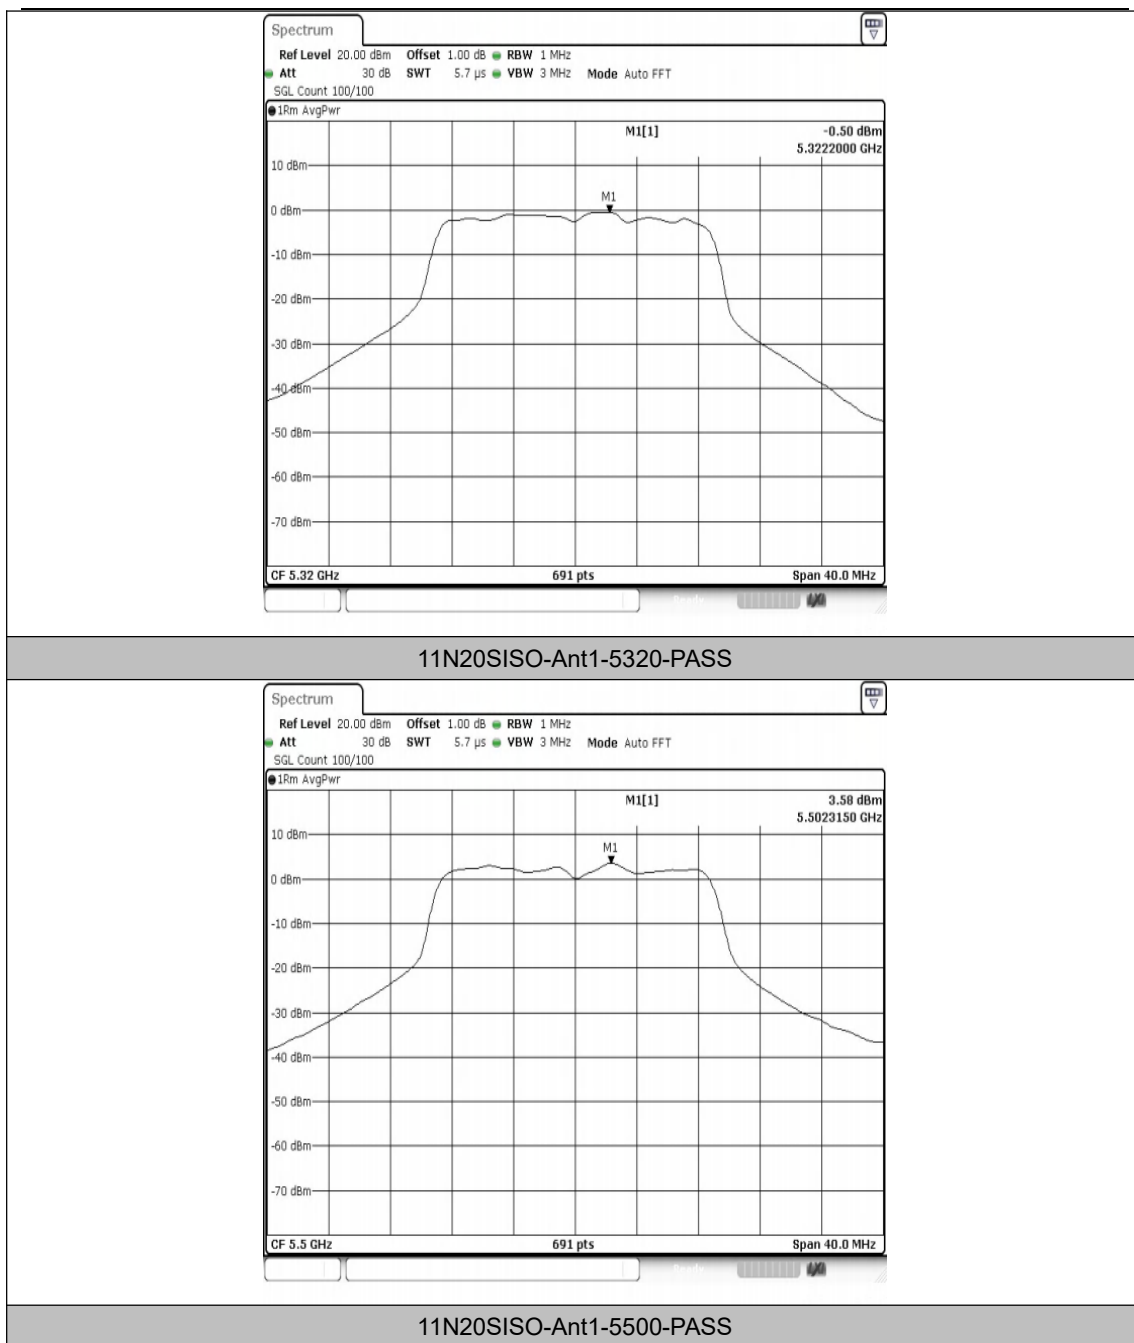

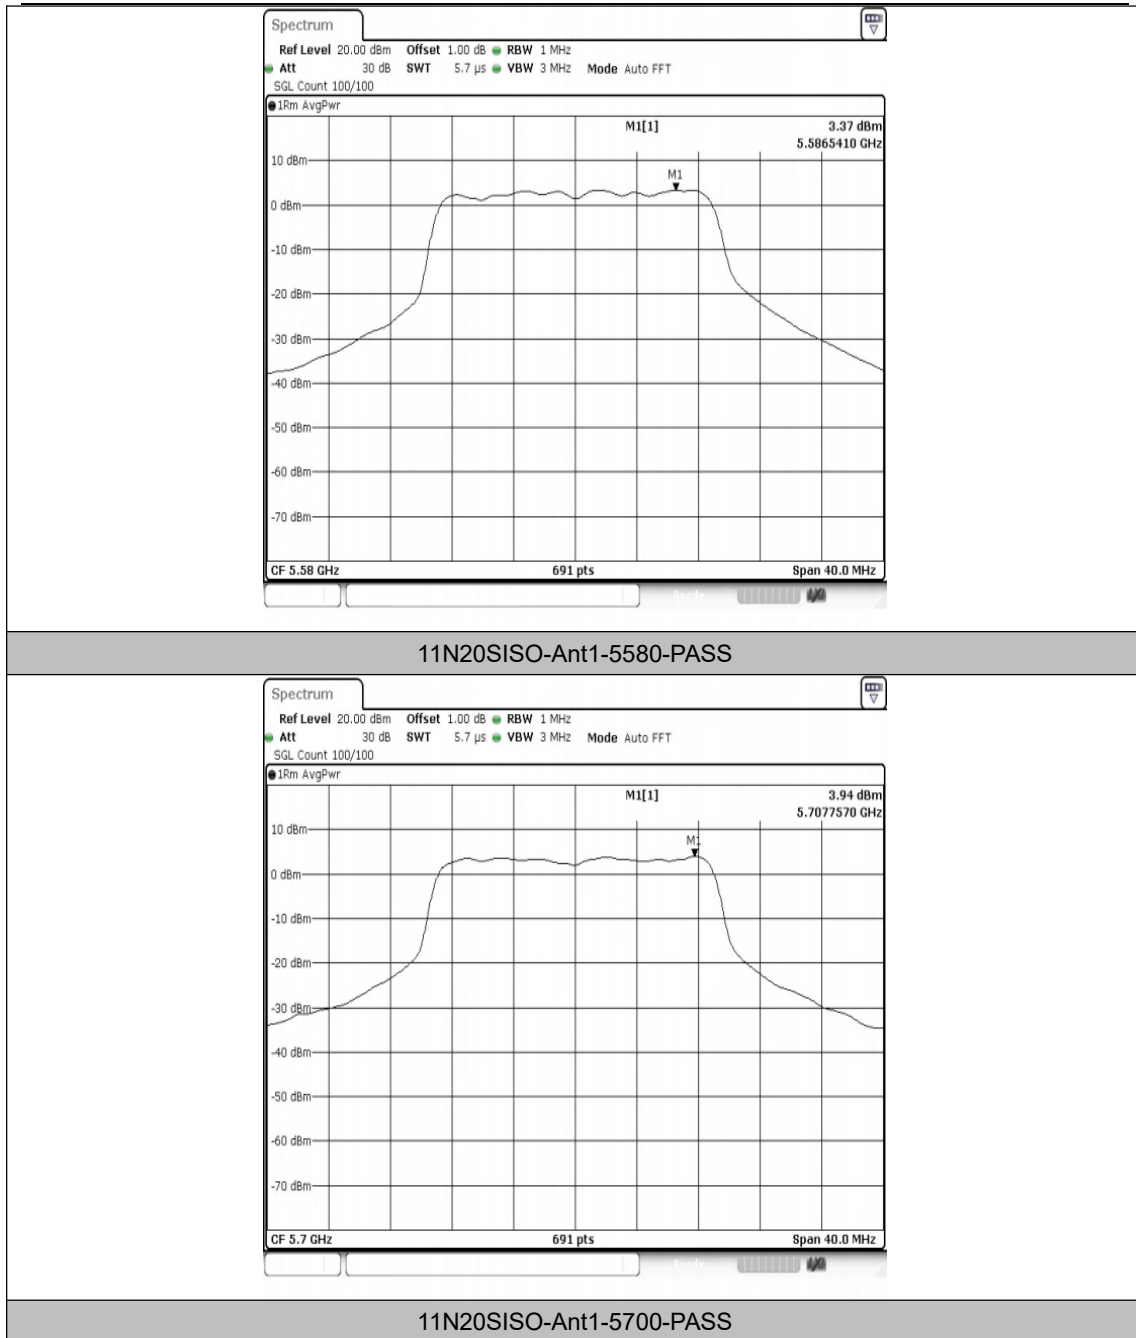

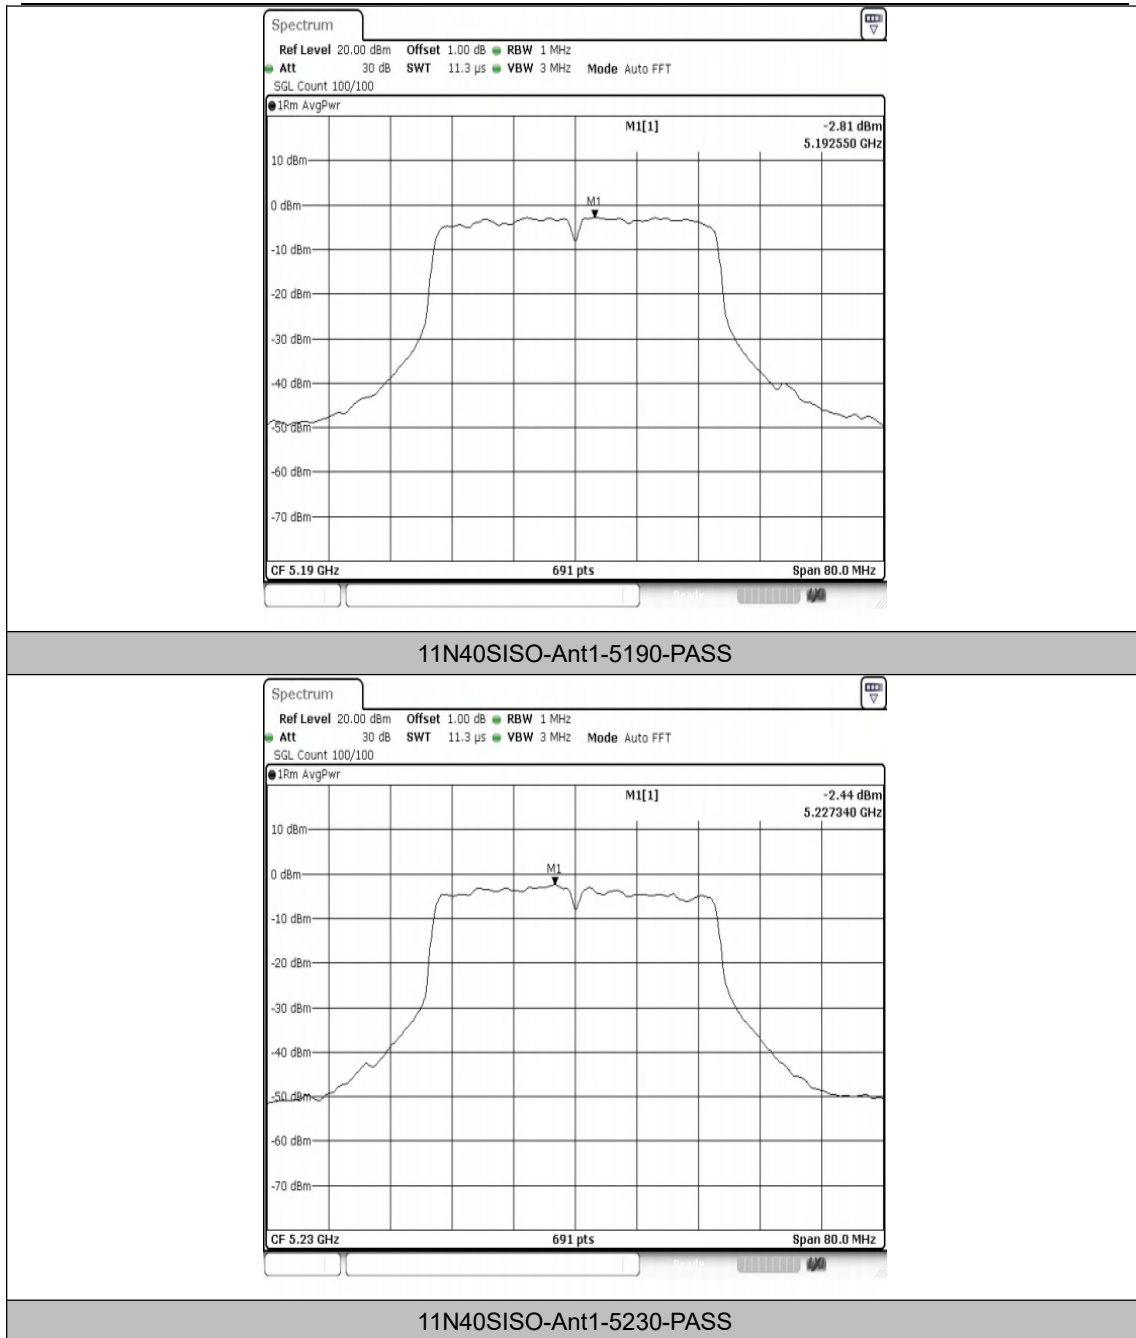

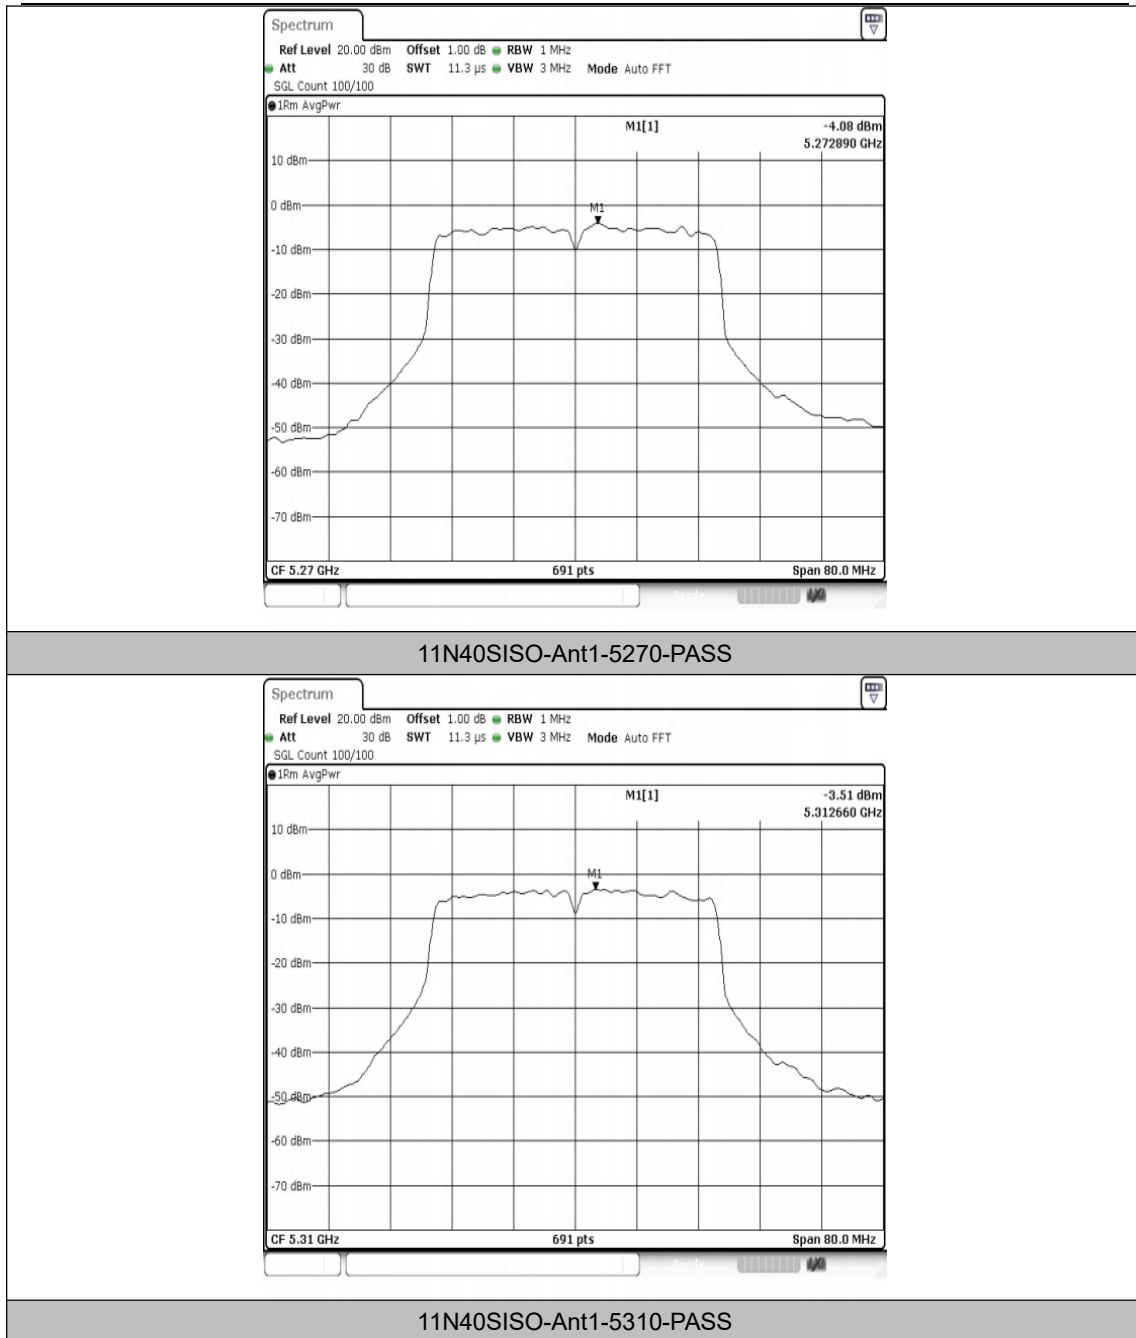


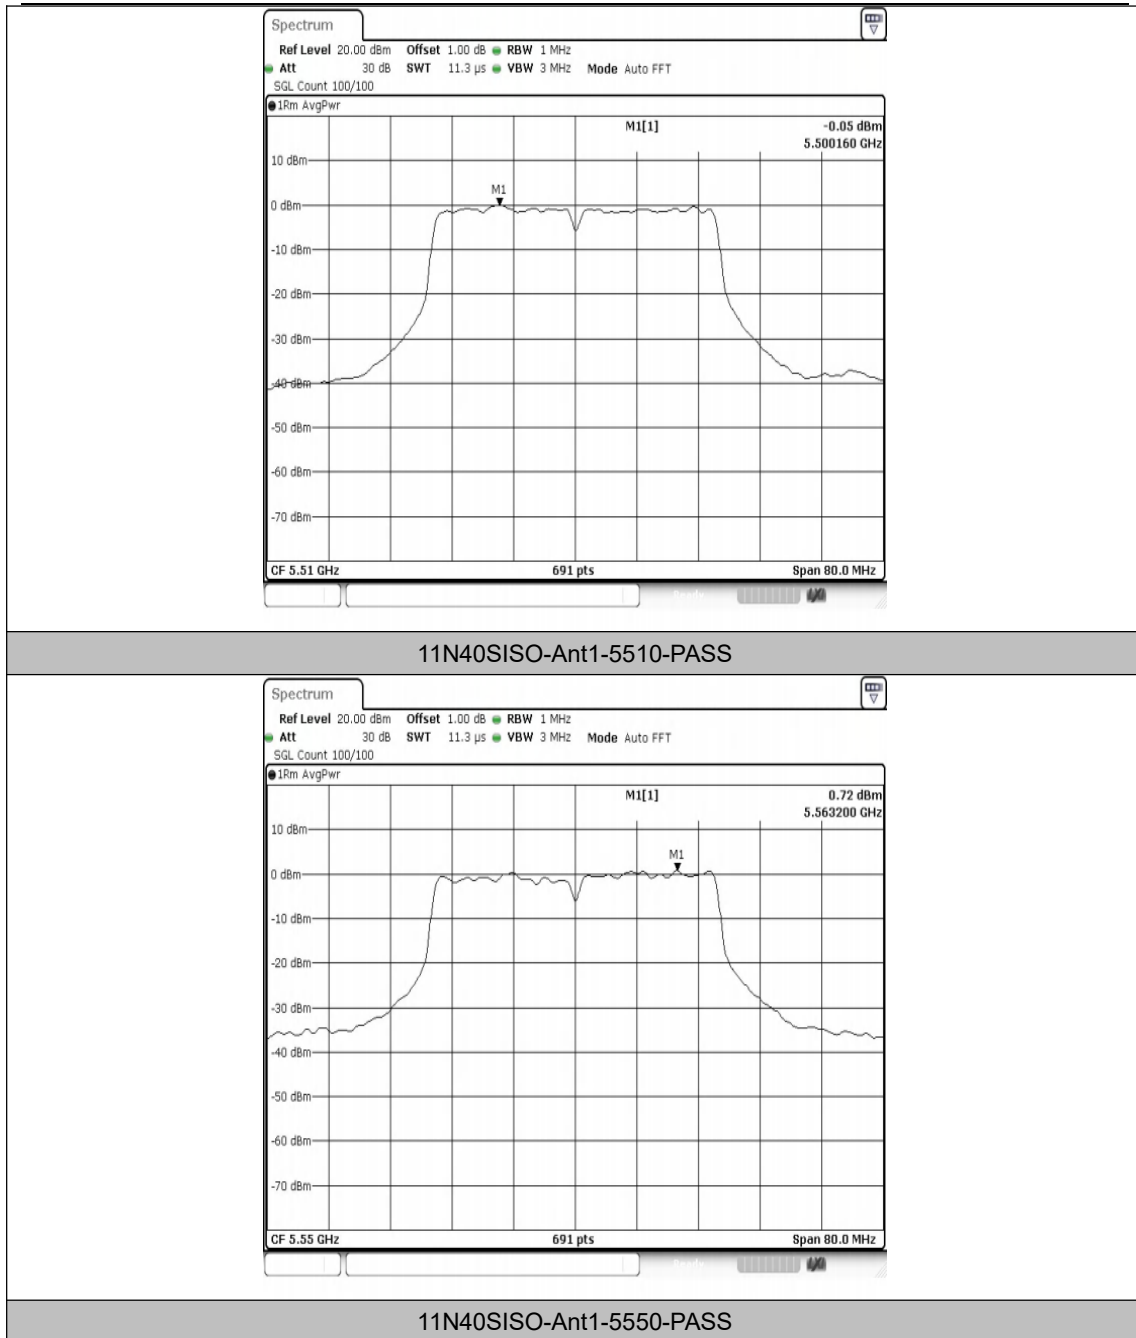


Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com

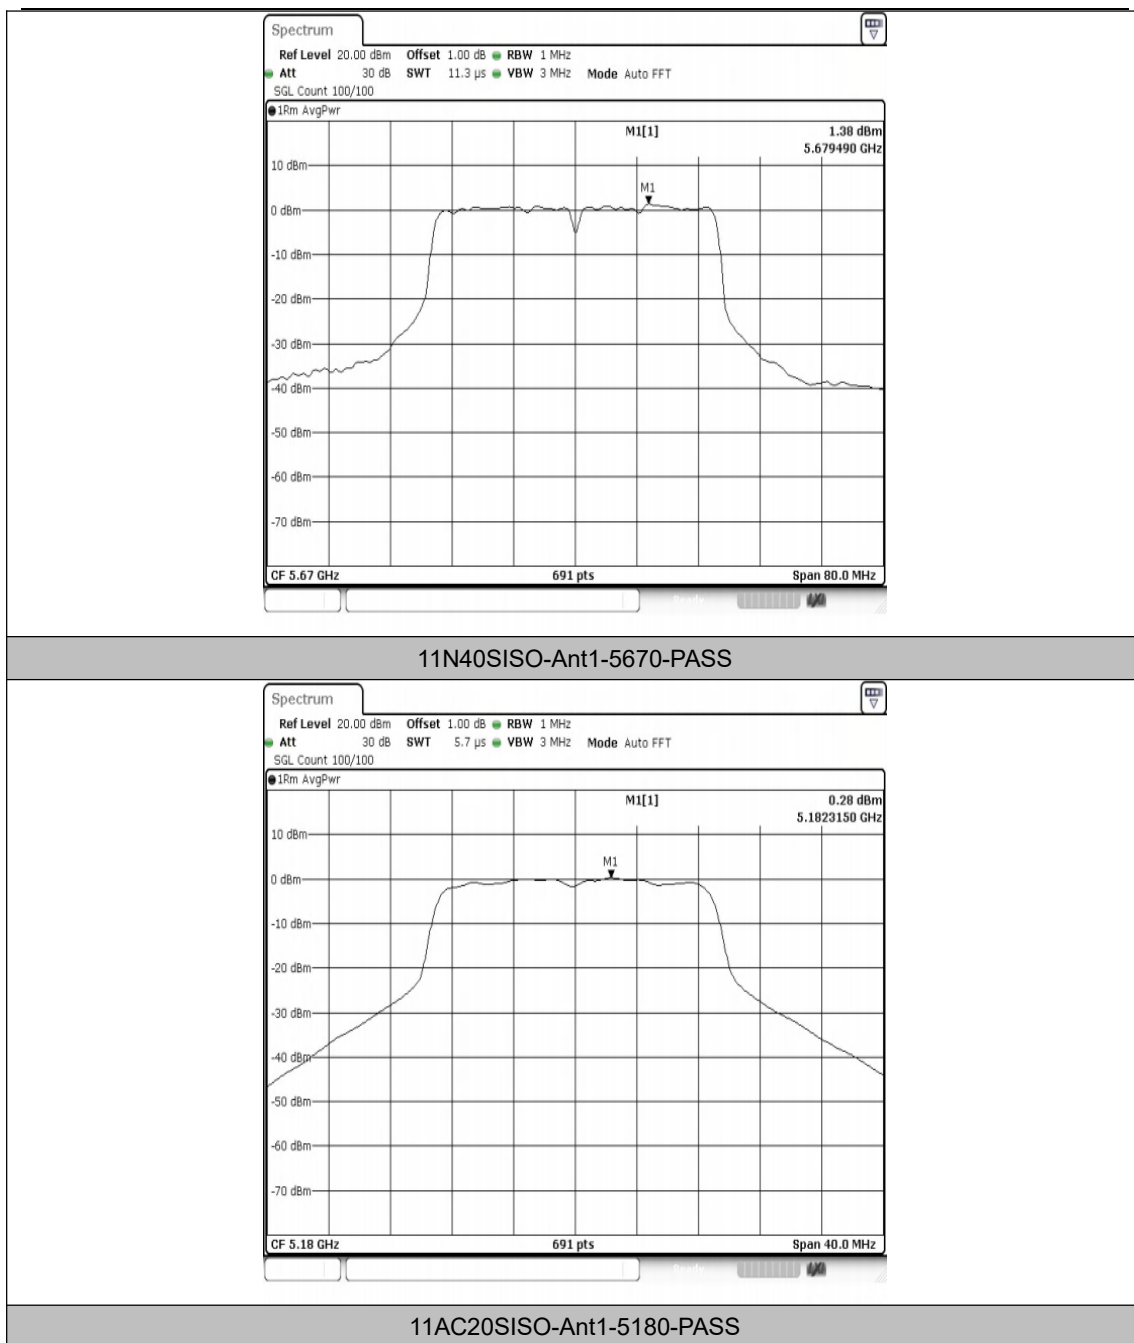


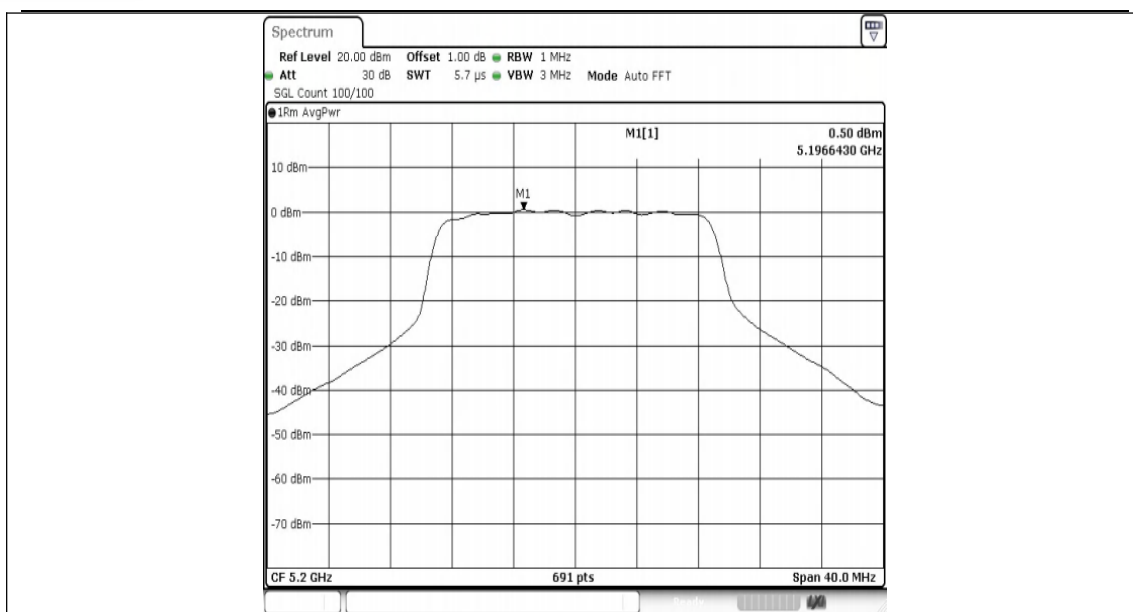


11AC20SISO-Ant1-5200-PASS

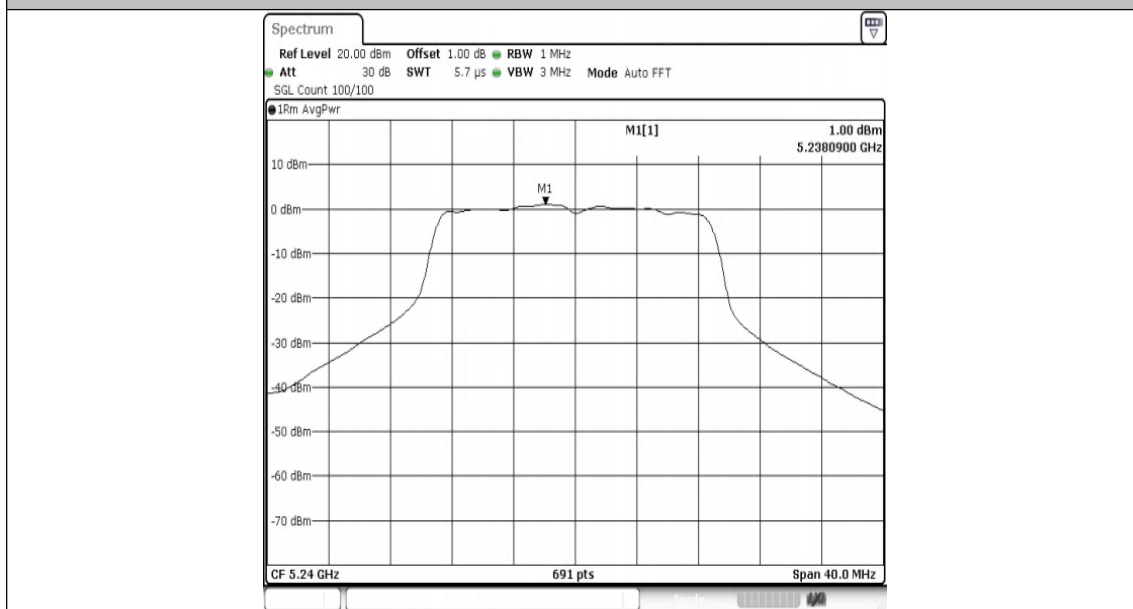


11AC20SISO-Ant1-5240-PASS

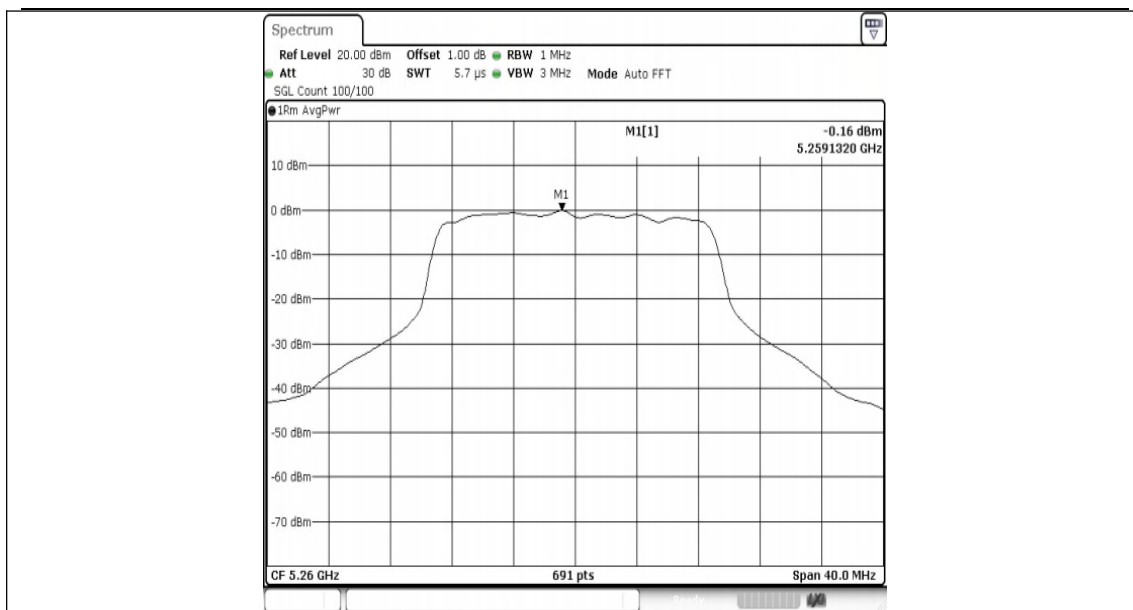


11AC20SISO-Ant1-5260-PASS

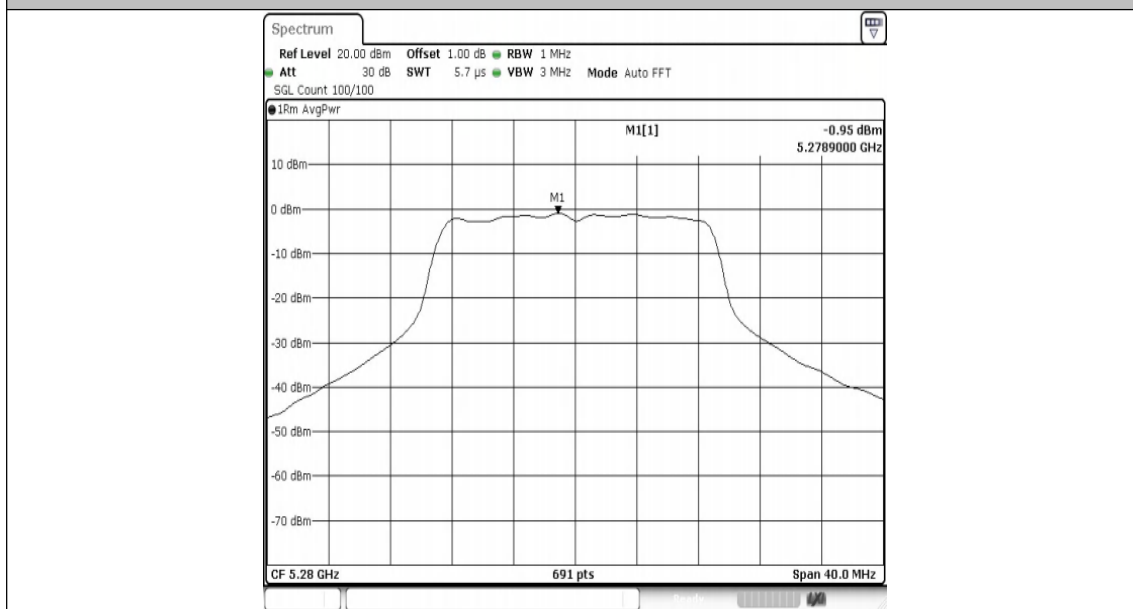


11AC20SISO-Ant1-5280-PASS

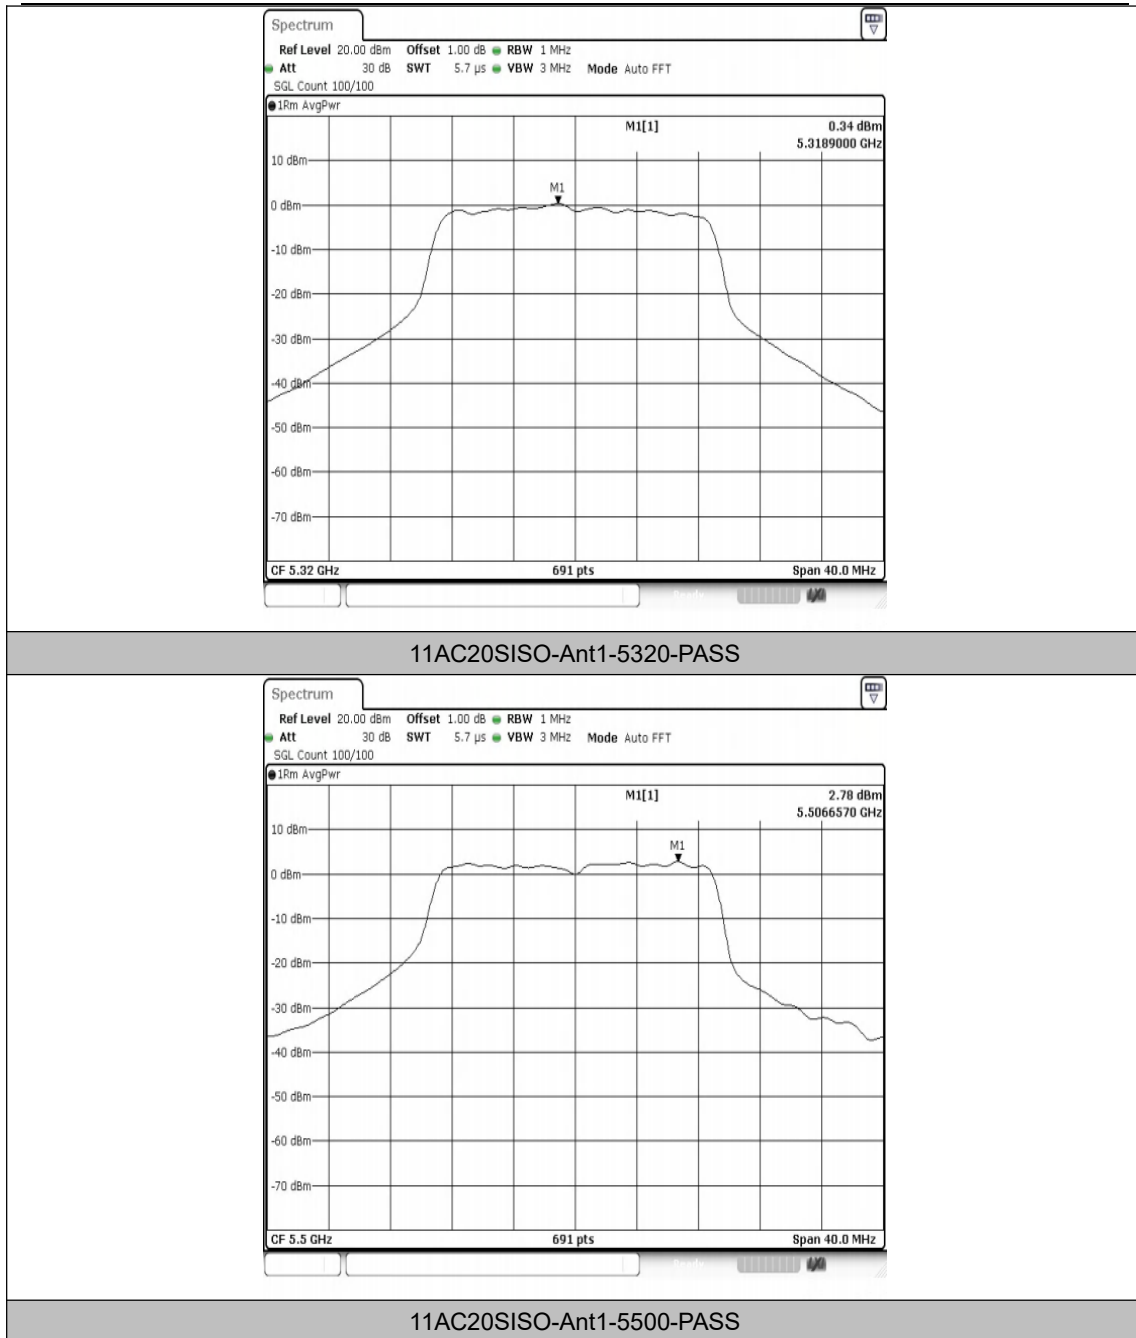


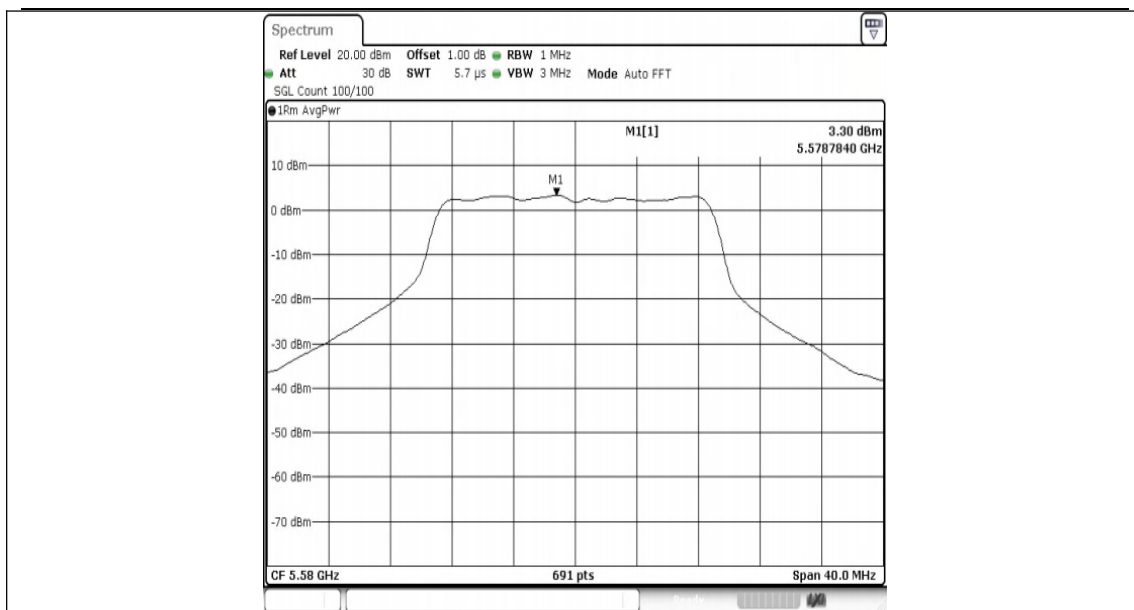


11AC20SISO-Ant1-5580-PASS

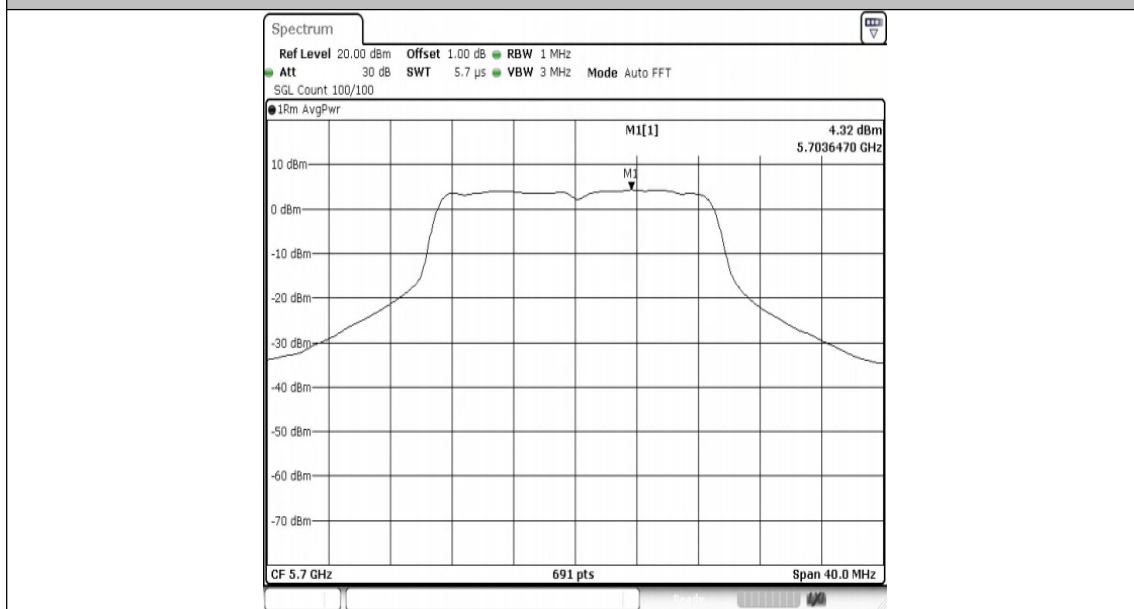


11AC20SISO-Ant1-5700-PASS

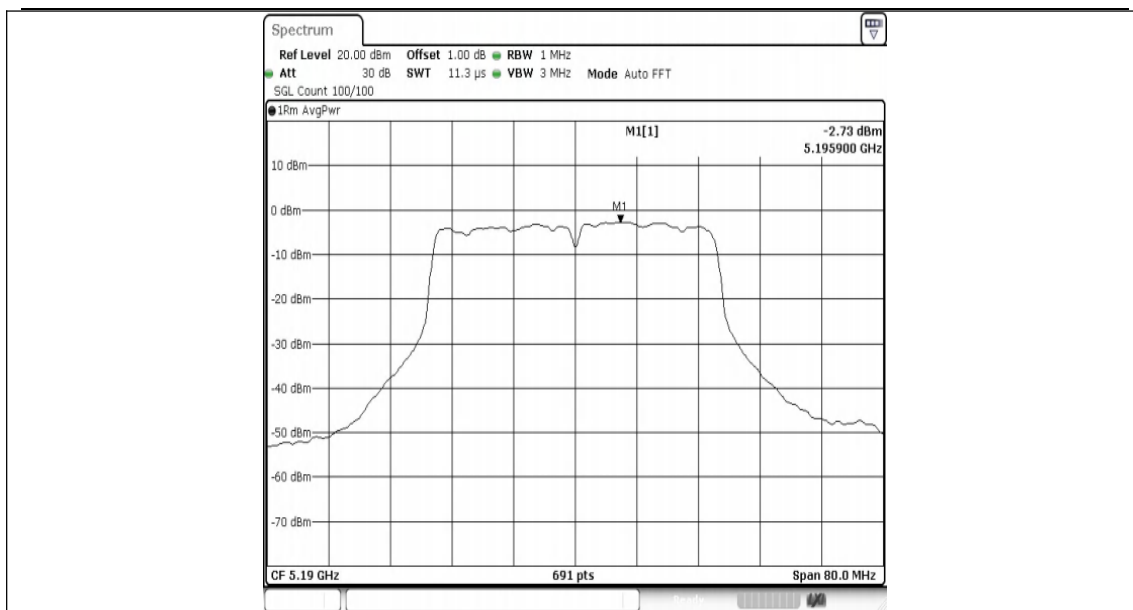


11AC40SISO-Ant1-5190-PASS

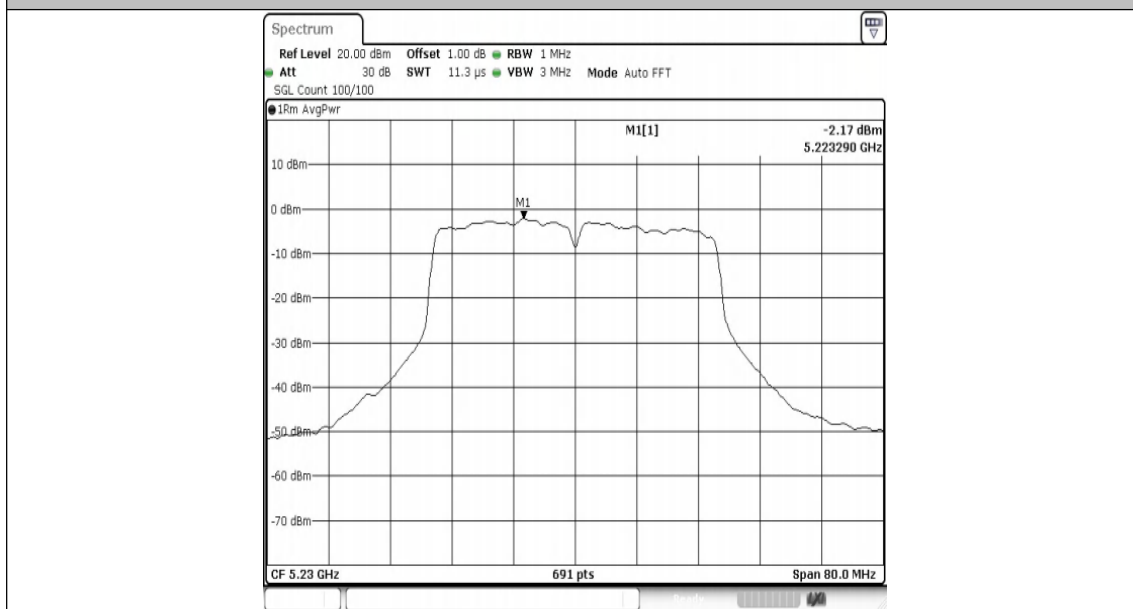


11AC40SISO-Ant1-5230-PASS

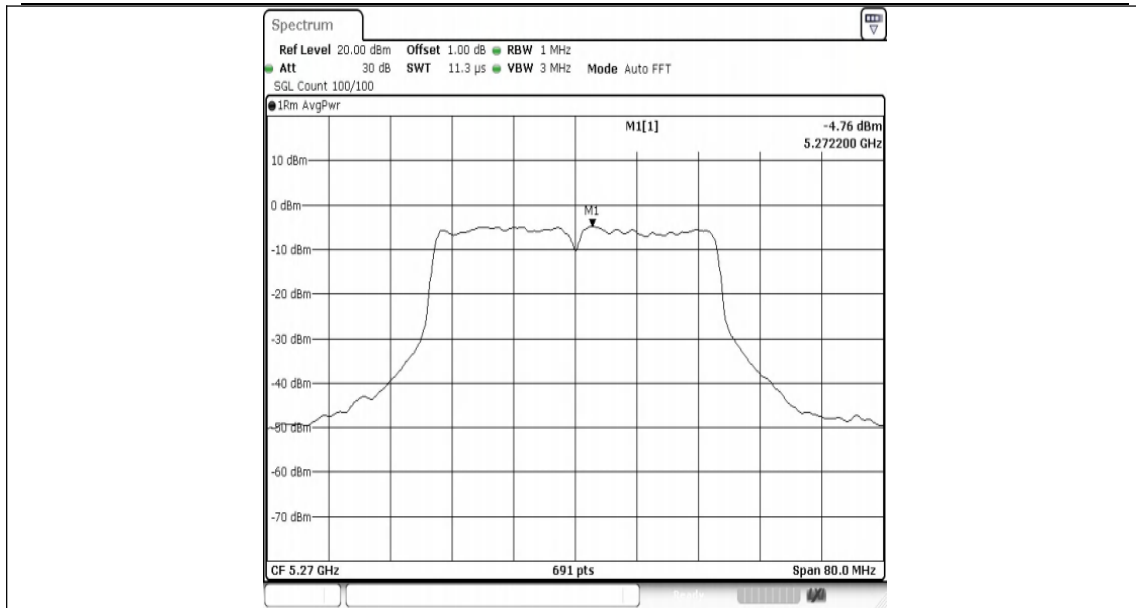


11AC40SISO-Ant1-5270-PASS

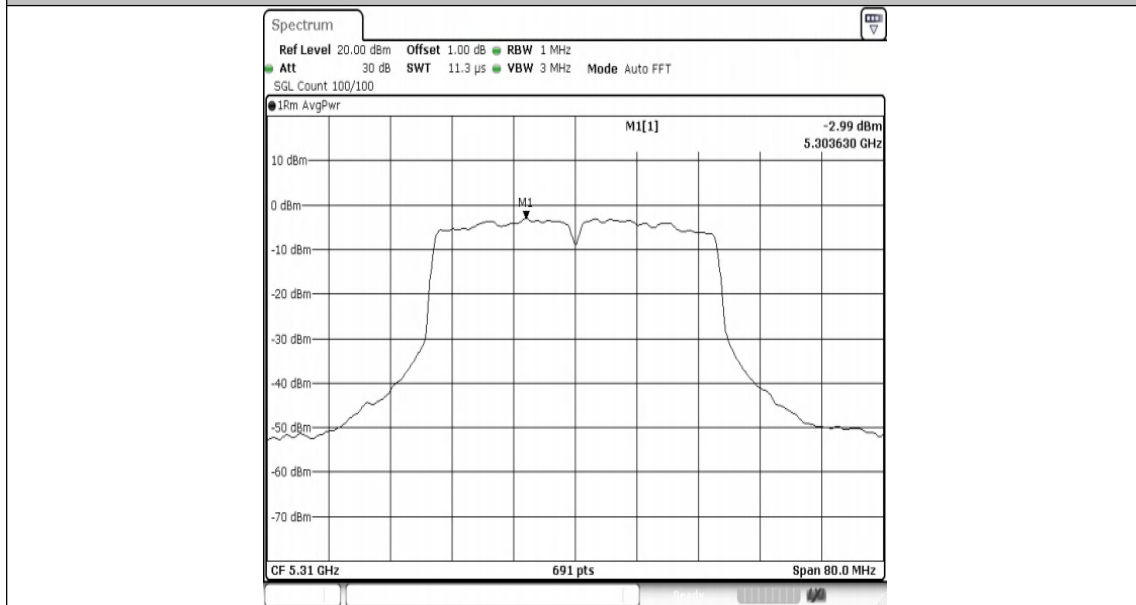


11AC40SISO-Ant1-5310-PASS

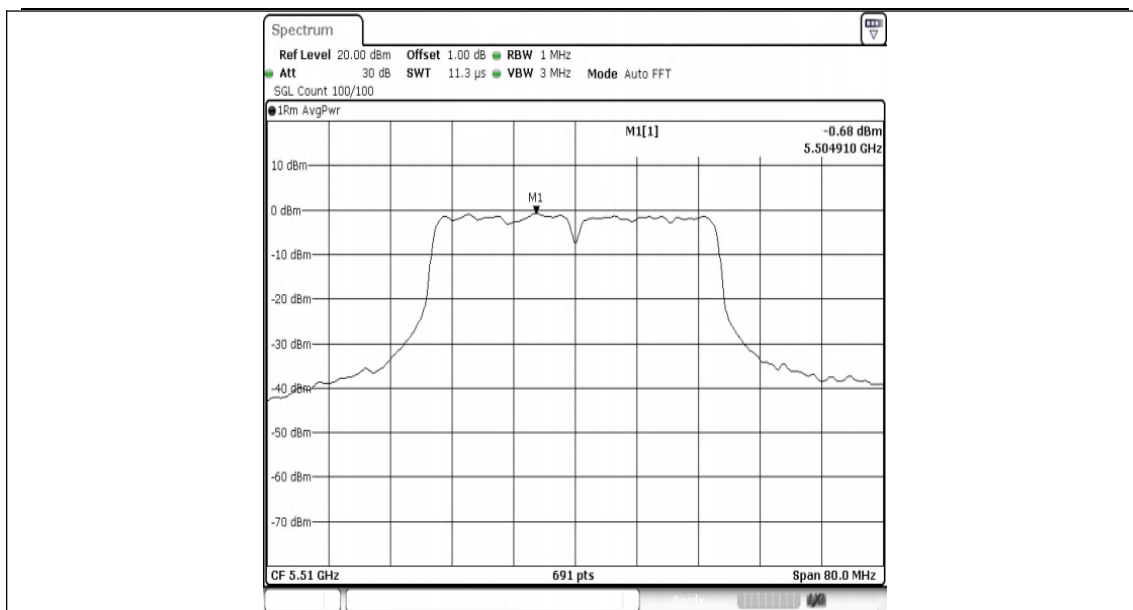


11AC40SISO-Ant1-5510-PASS

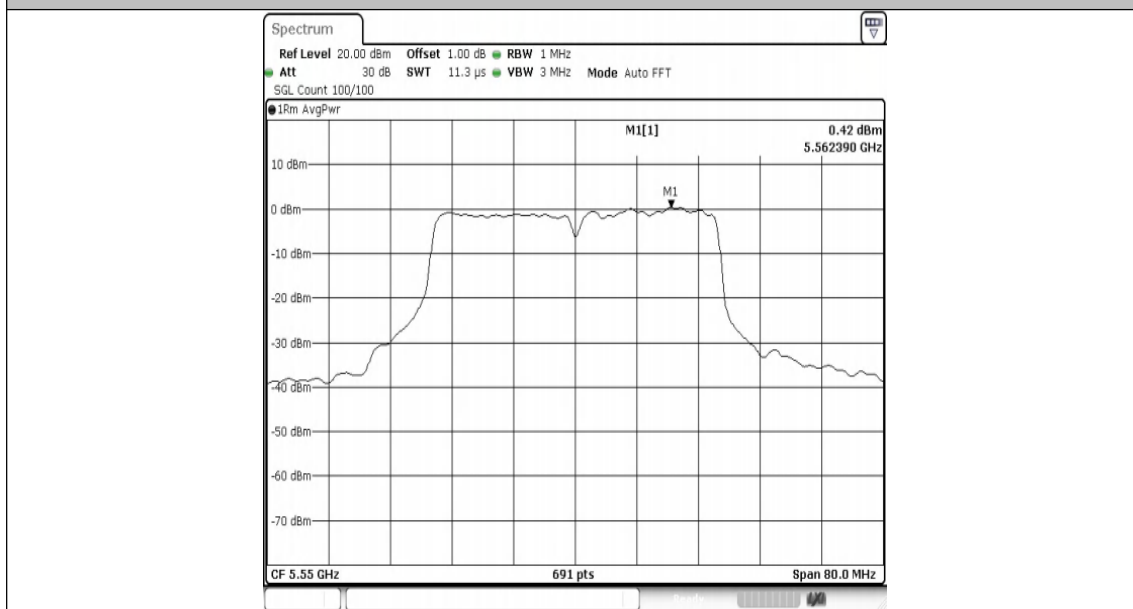


11AC40SISO-Ant1-5550-PASS

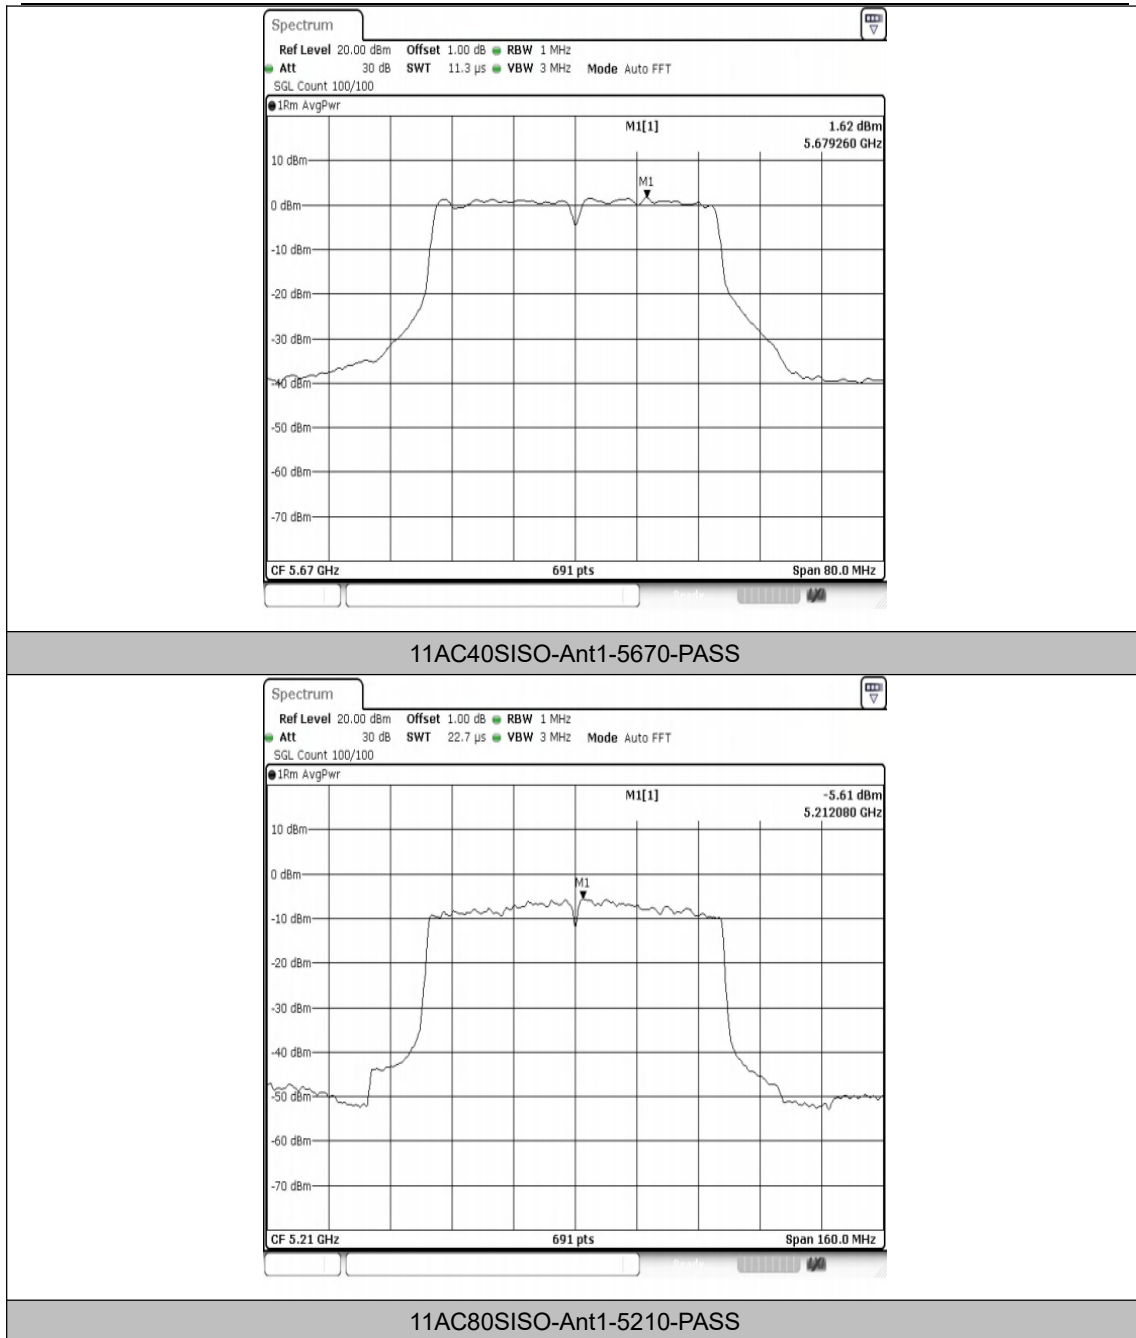


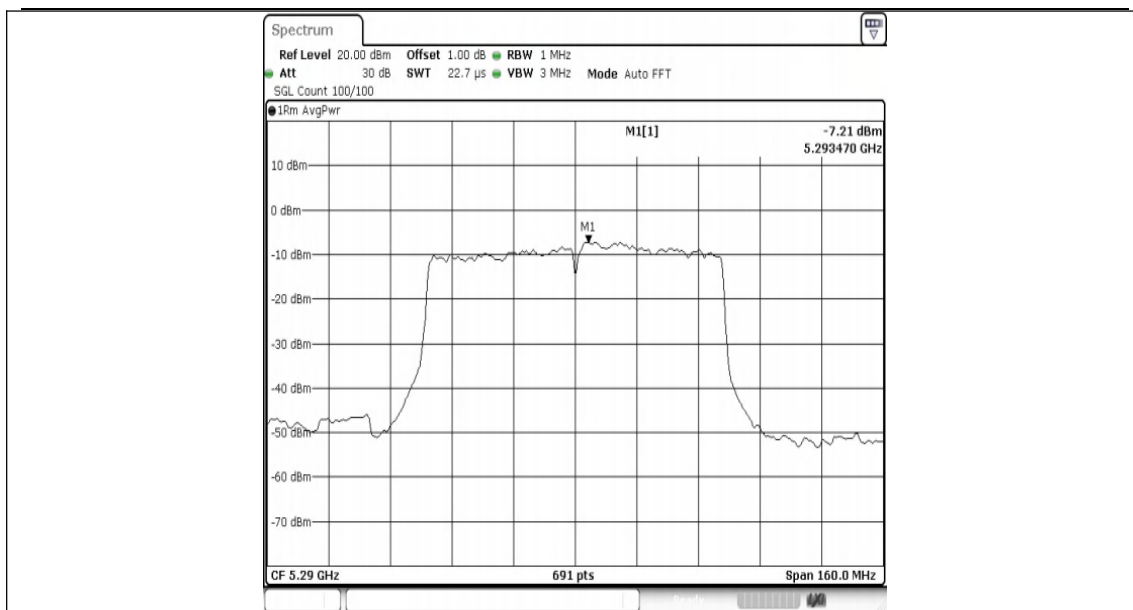


11AC80SISO-Ant1-5290-PASS

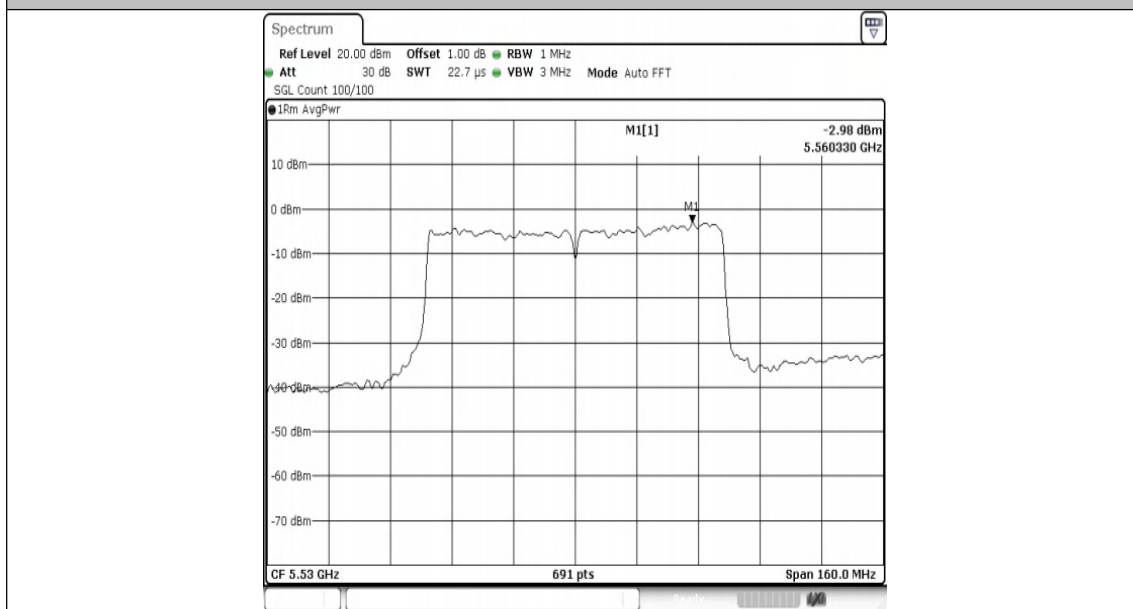


11AC80SISO-Ant1-5530-PASS

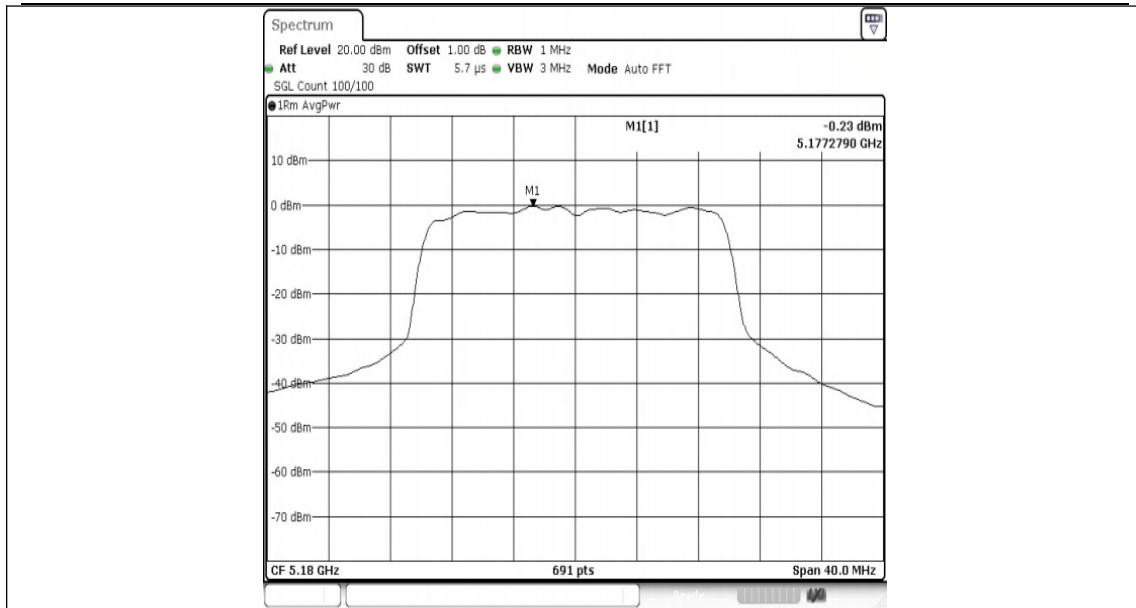


11AX20SISO-Ant1-5180-PASS

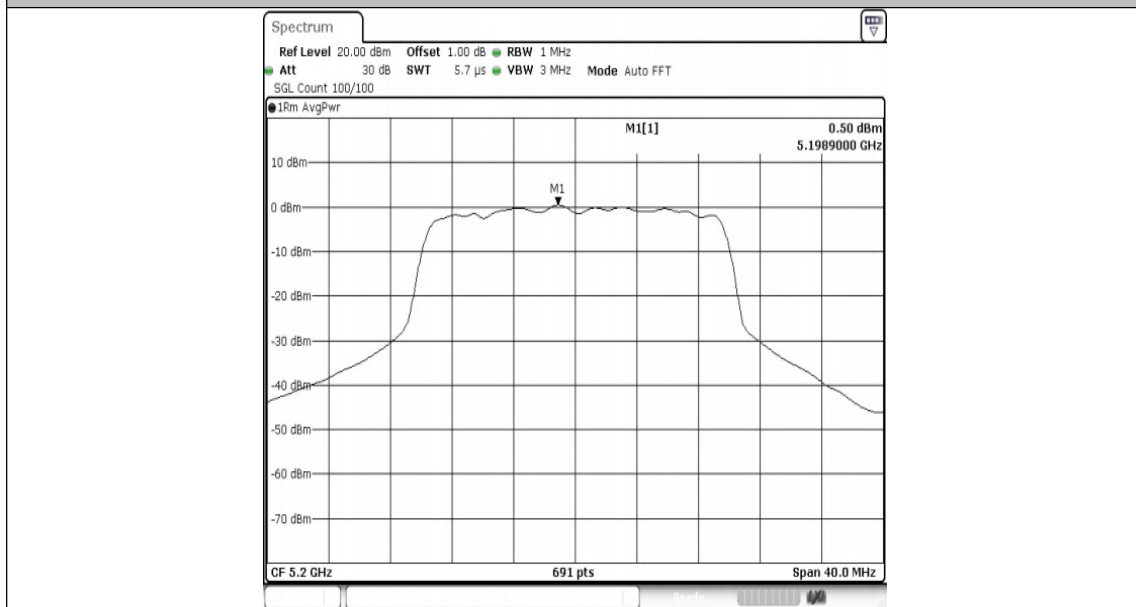


11AX20SISO-Ant1-5200-PASS

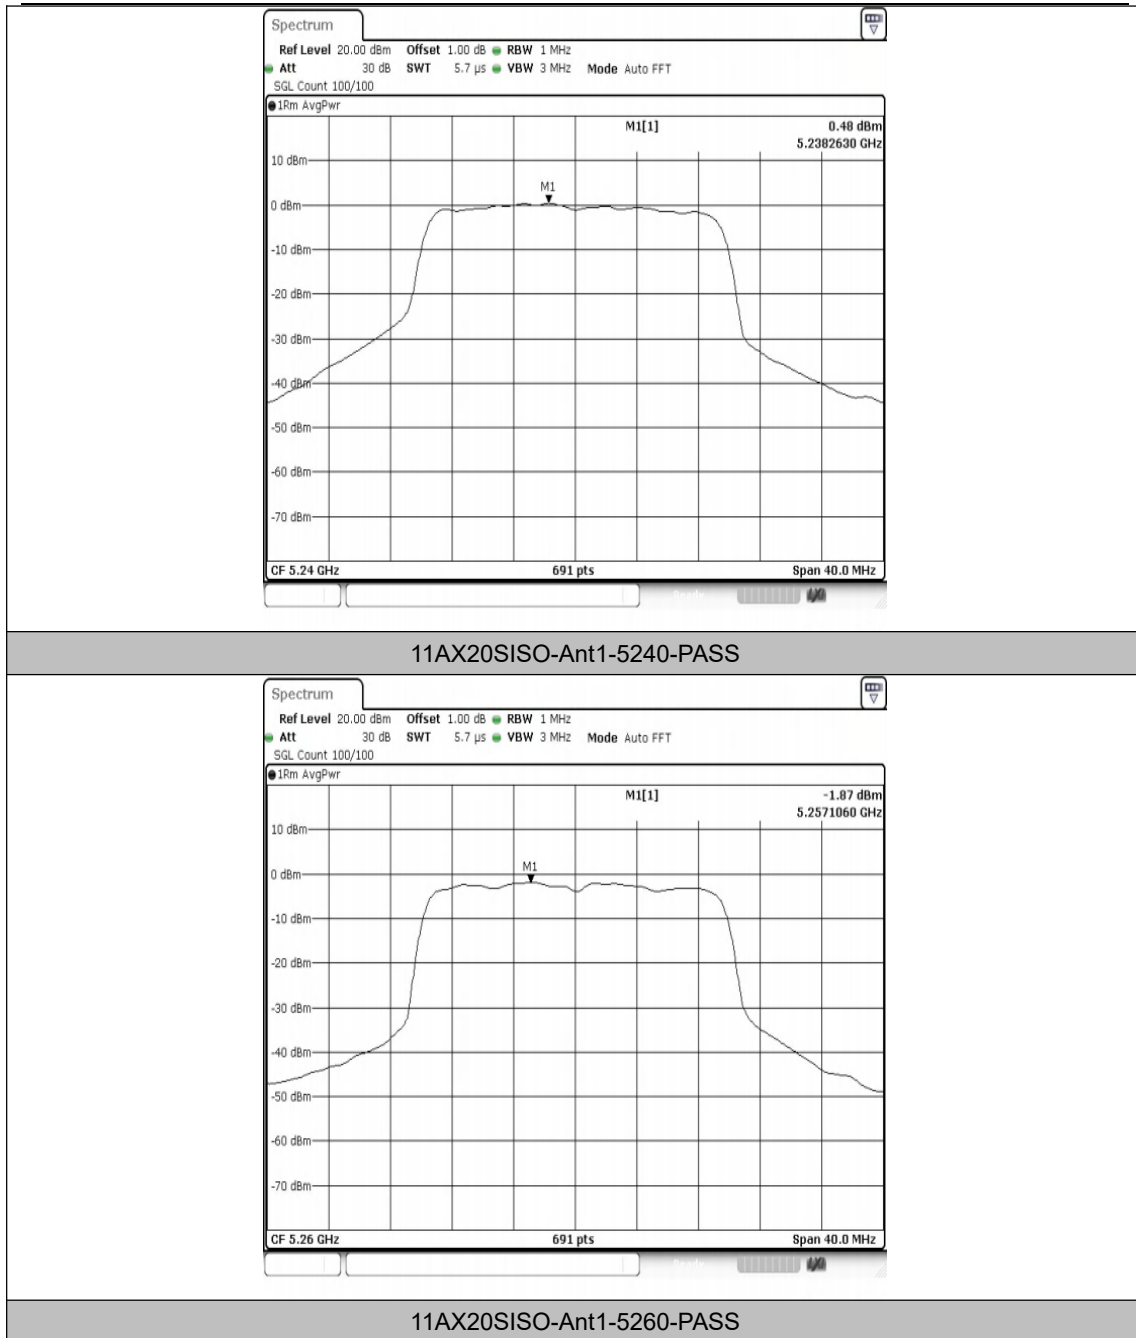


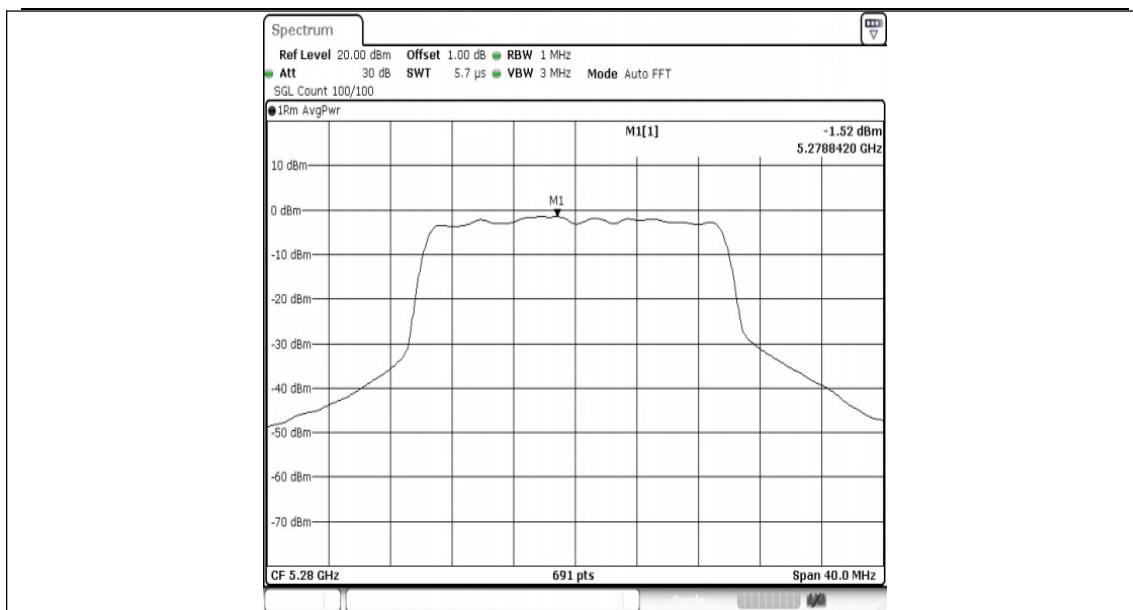


11AX20SISO-Ant1-5280-PASS

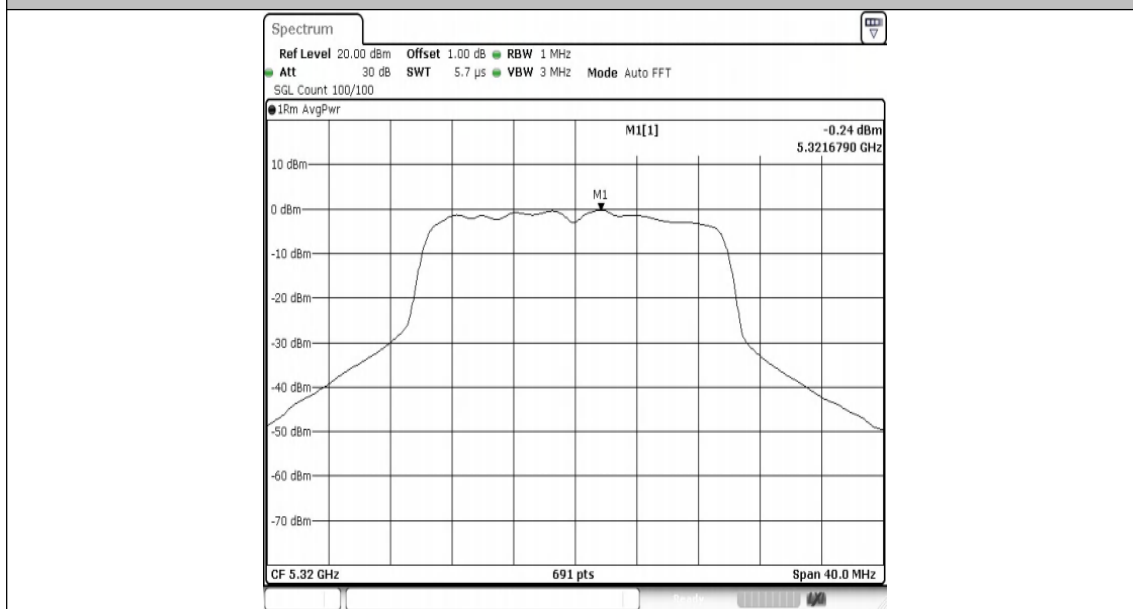


11AX20SISO-Ant1-5320-PASS

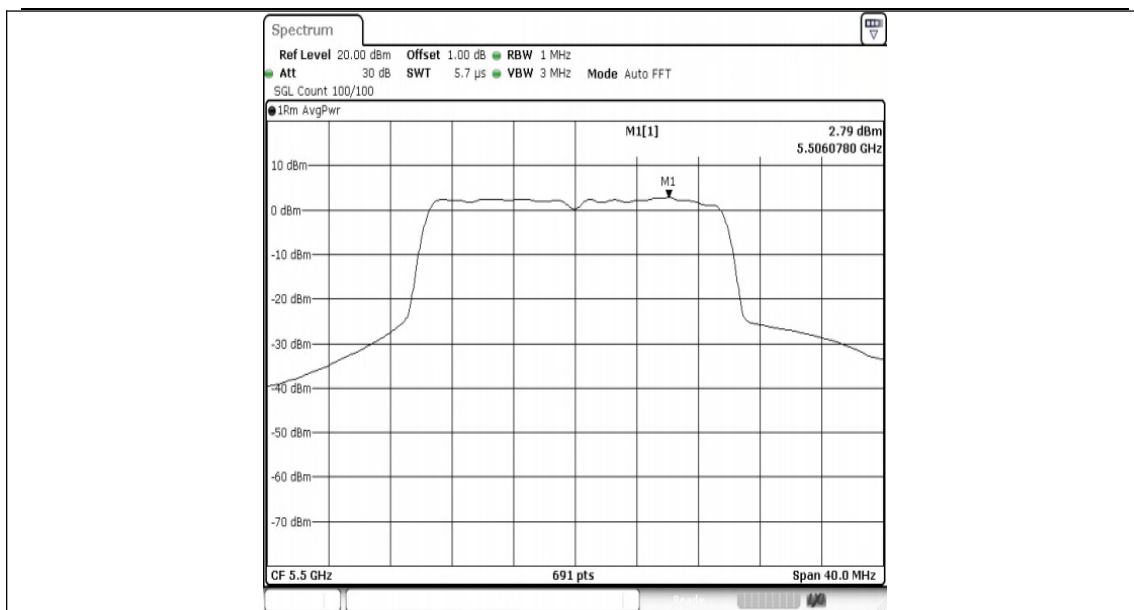


11AX20SISO-Ant1-5500-PASS

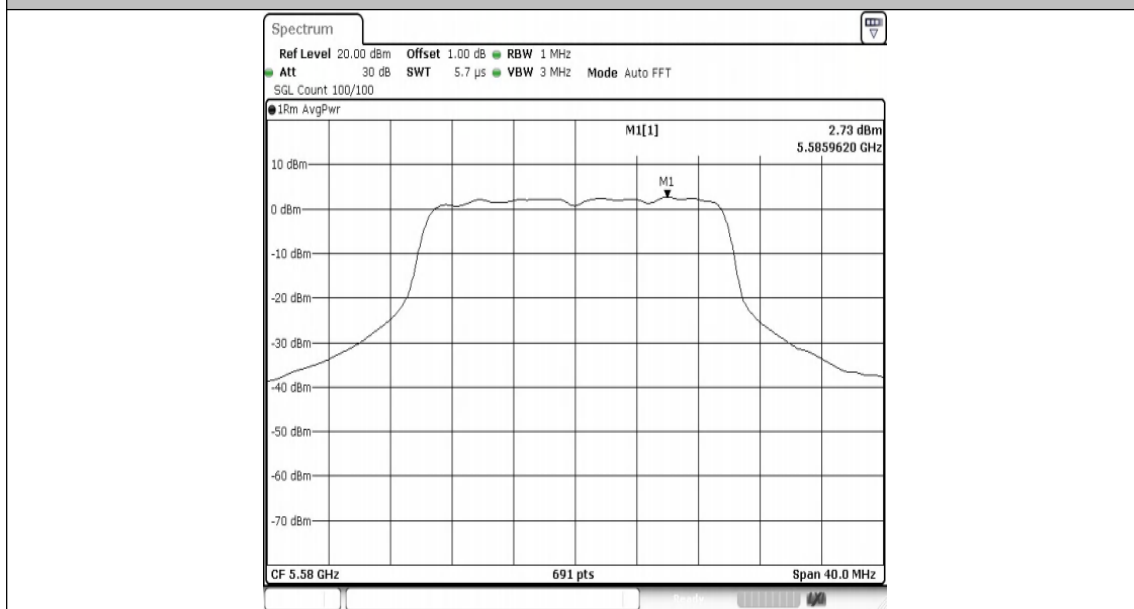


11AX20SISO-Ant1-5580-PASS

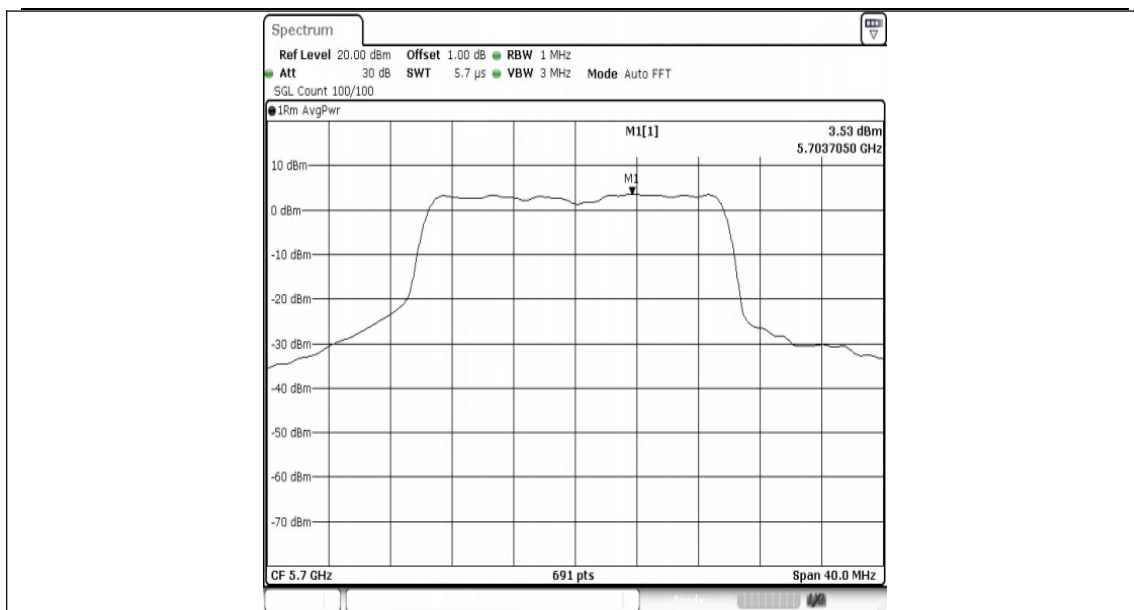


11AX20SISO-Ant1-5700-PASS

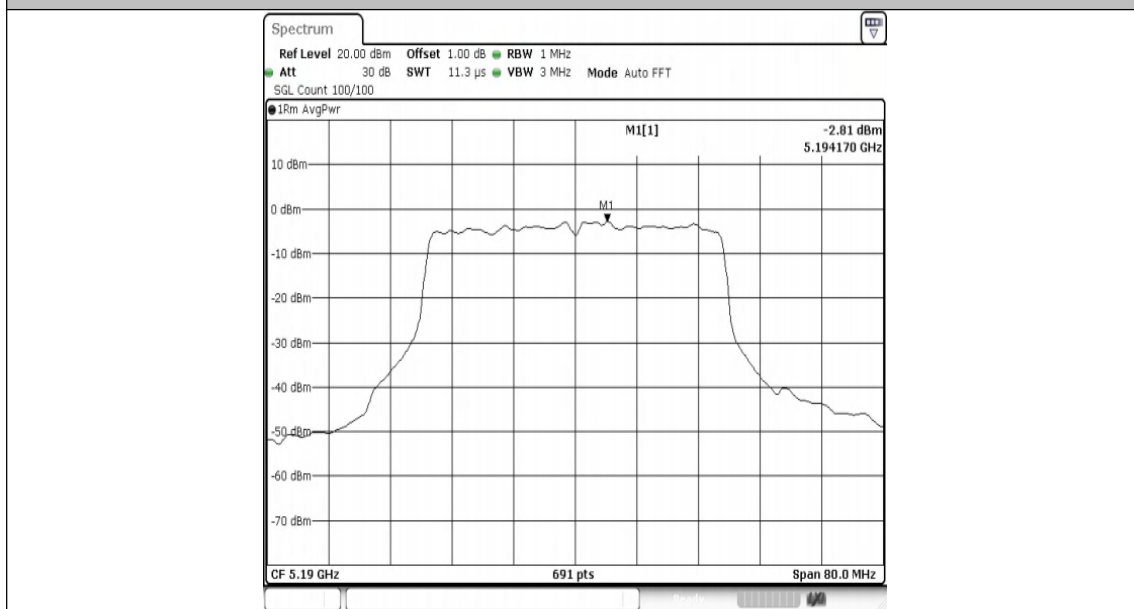


11AX40SISO-Ant1-5190-PASS

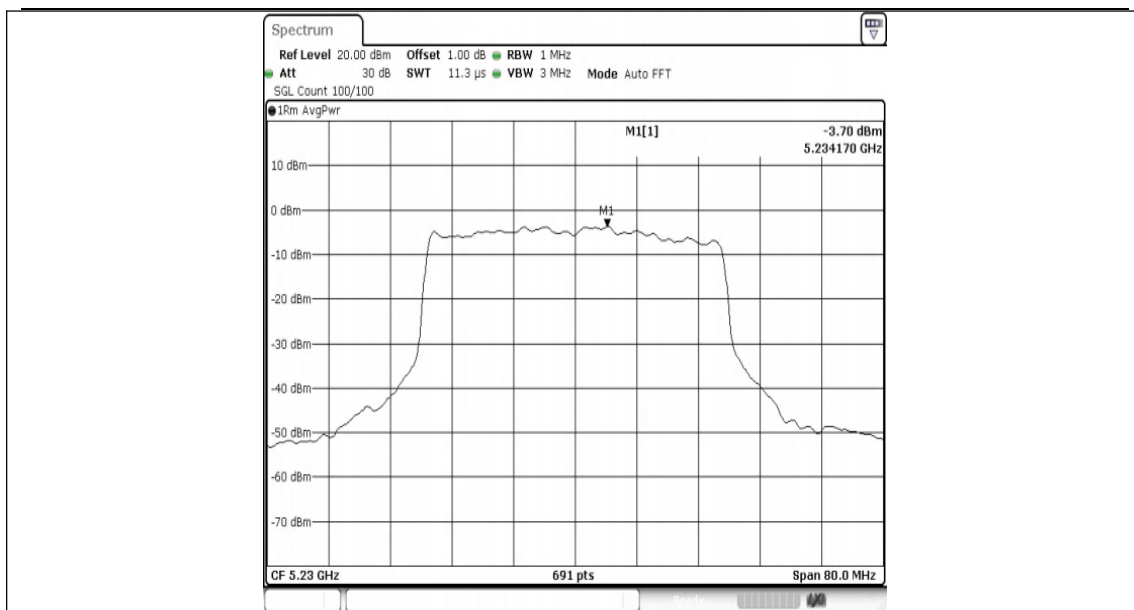


11AX40SISO-Ant1-5230-PASS

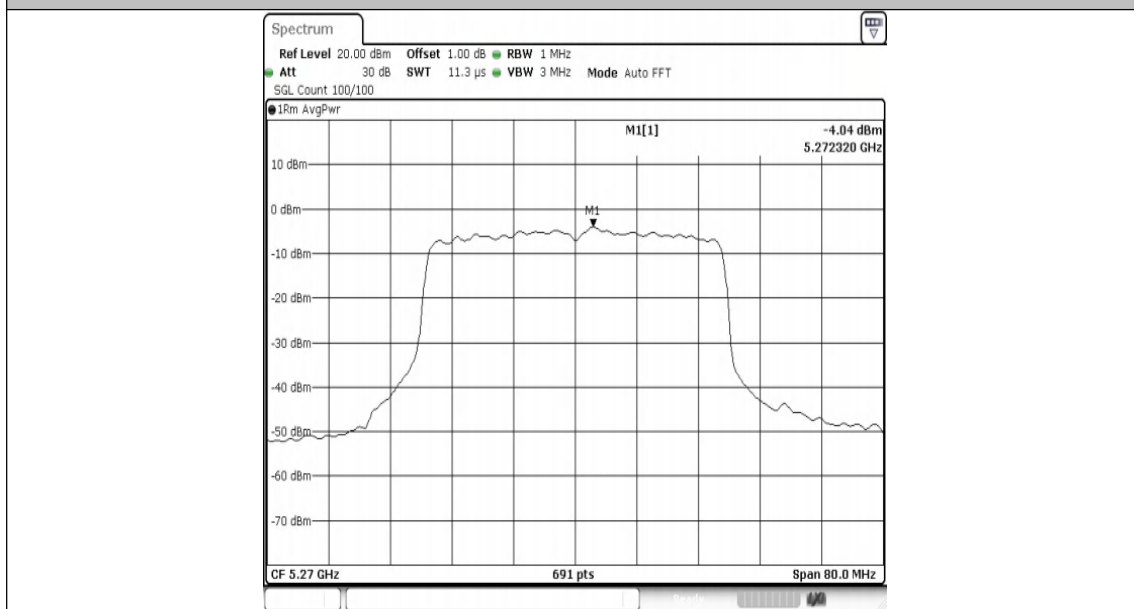


11AX40SISO-Ant1-5270-PASS

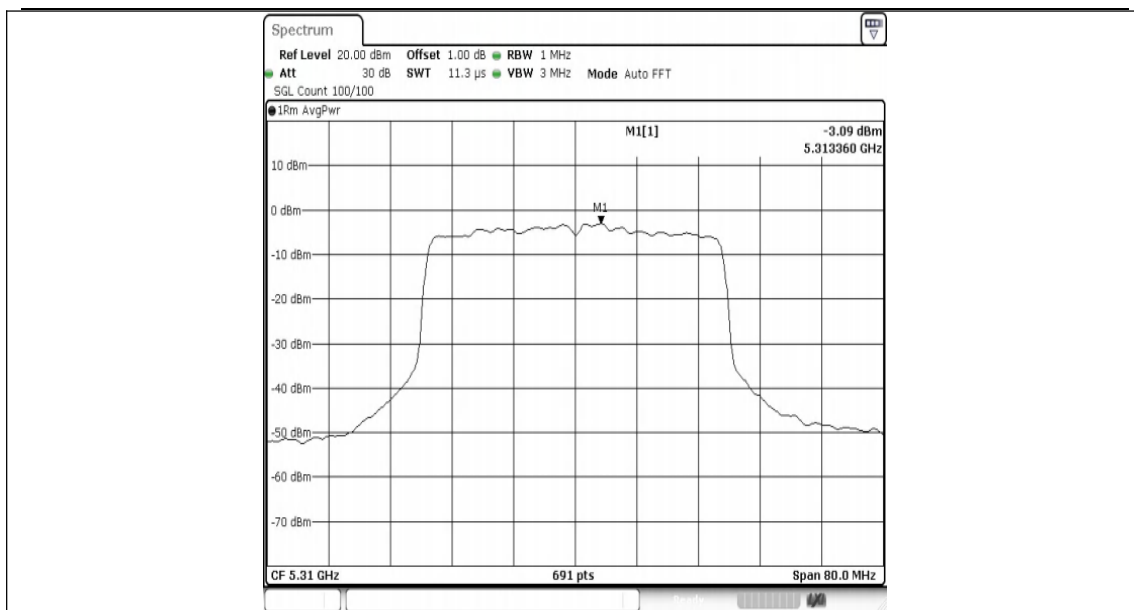


11AX40SISO-Ant1-5310-PASS

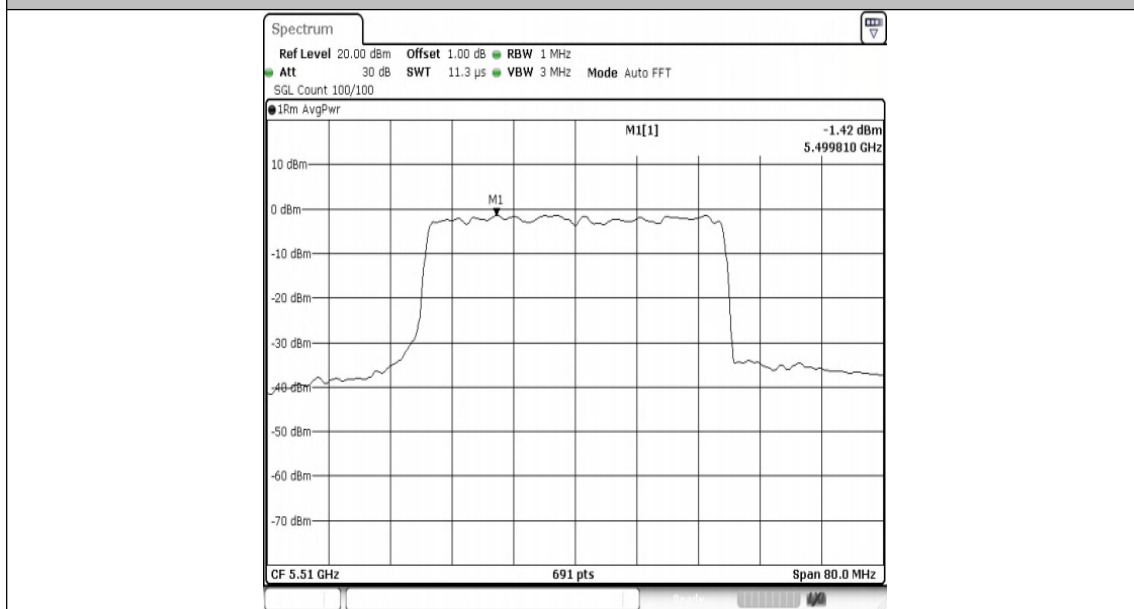


11AX40SISO-Ant1-5510-PASS

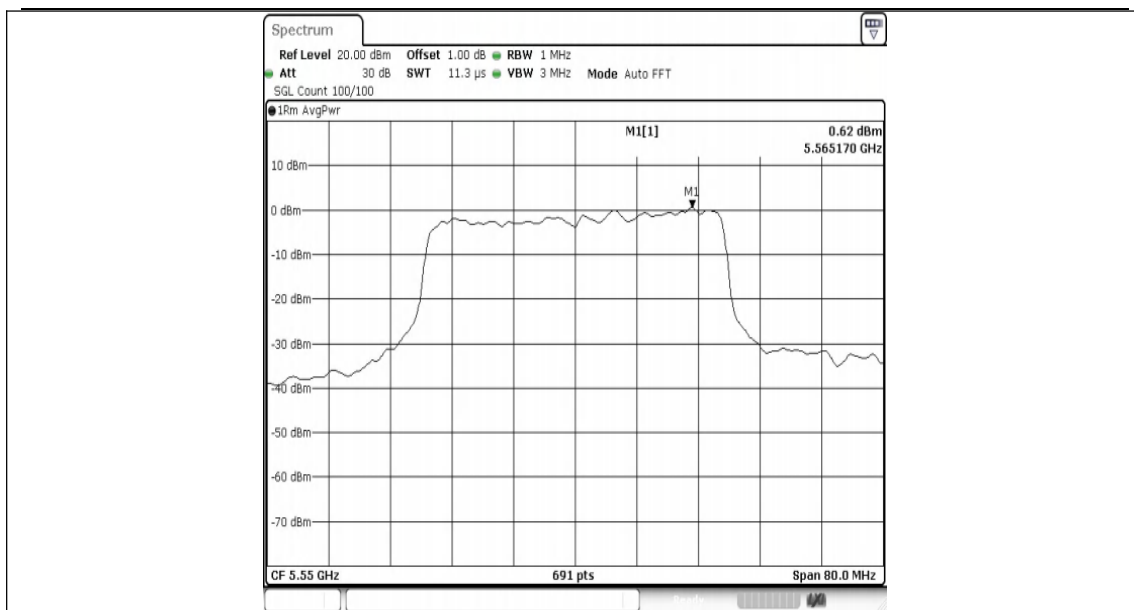


11AX40SISO-Ant1-5550-PASS

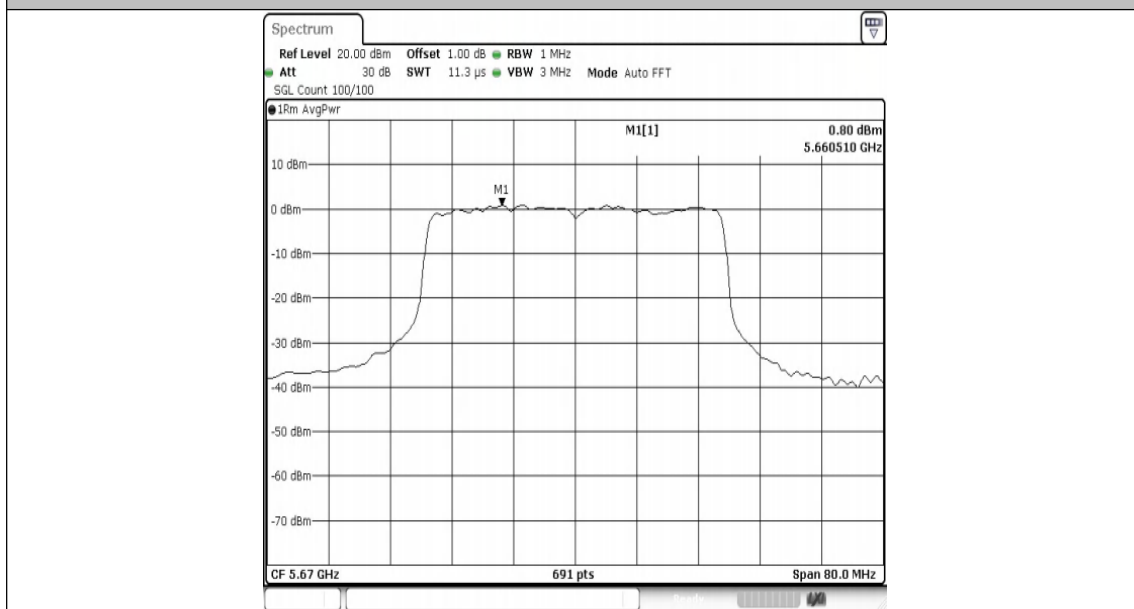


11AX40SISO-Ant1-5670-PASS

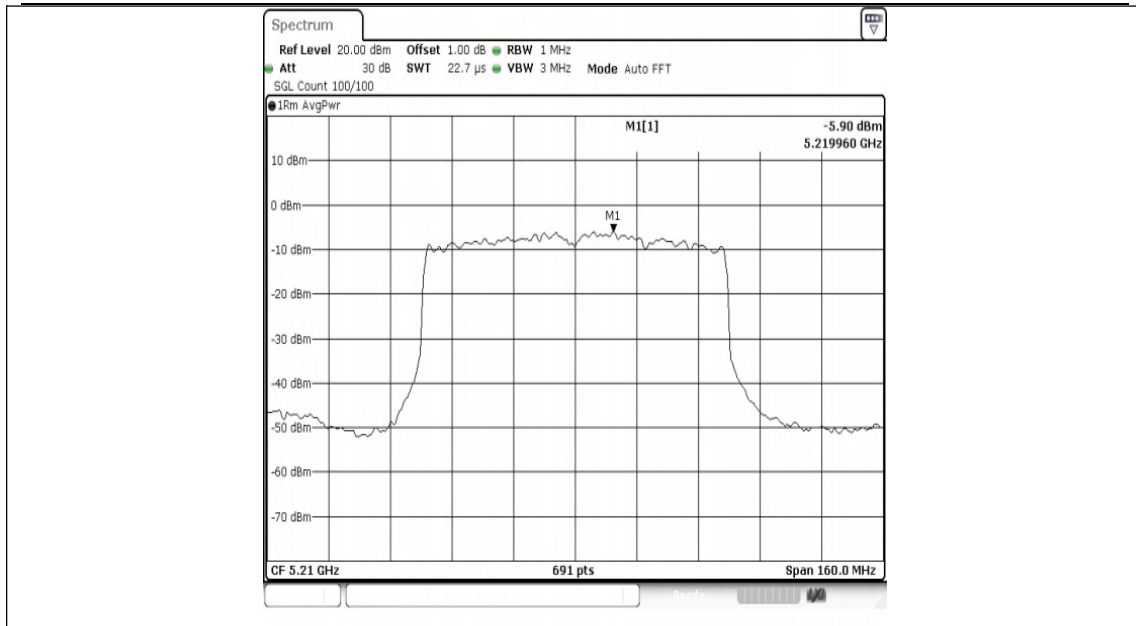

11AX80SISO-Ant1-5210-PASS

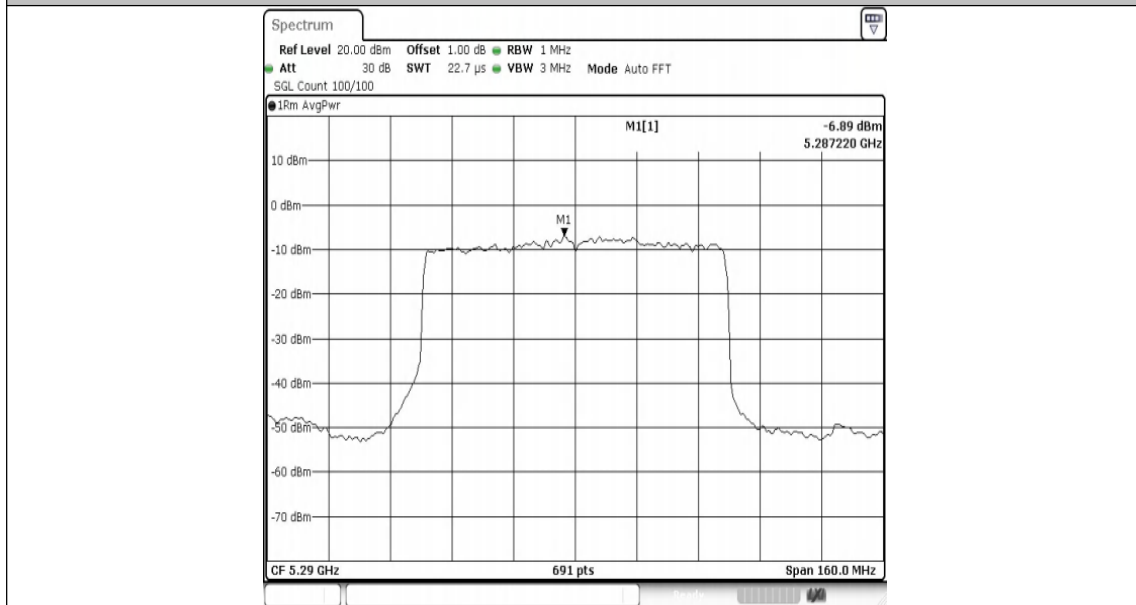

11AX80SISO-Ant1-5290-PASS

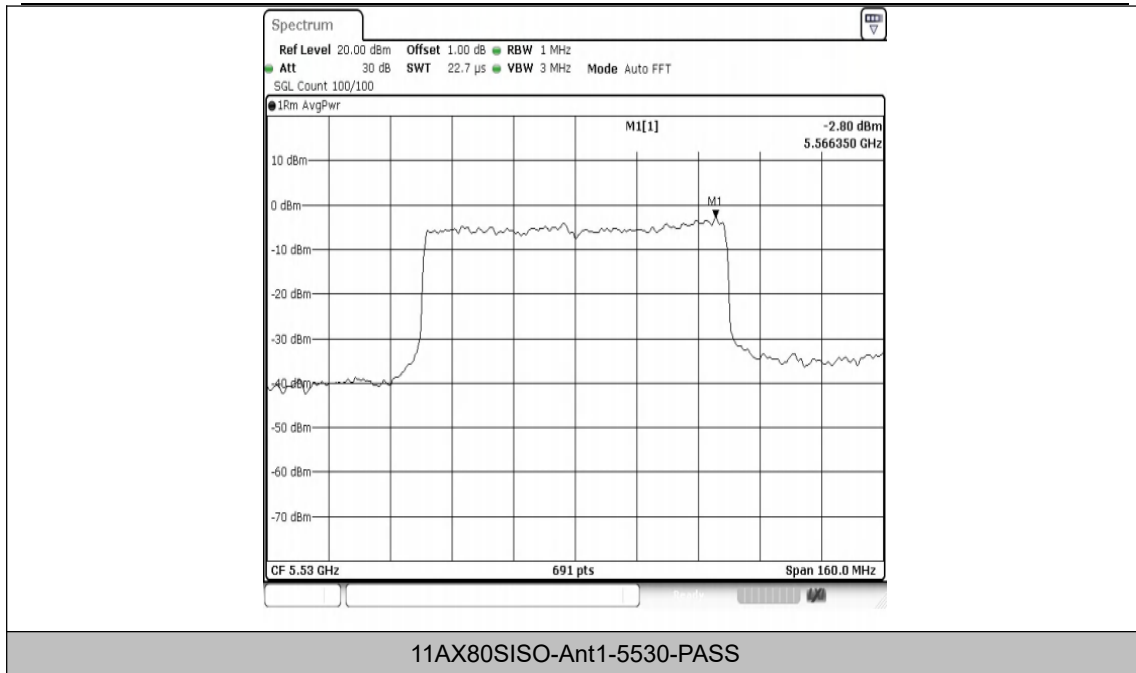


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com

Test Graphs B4

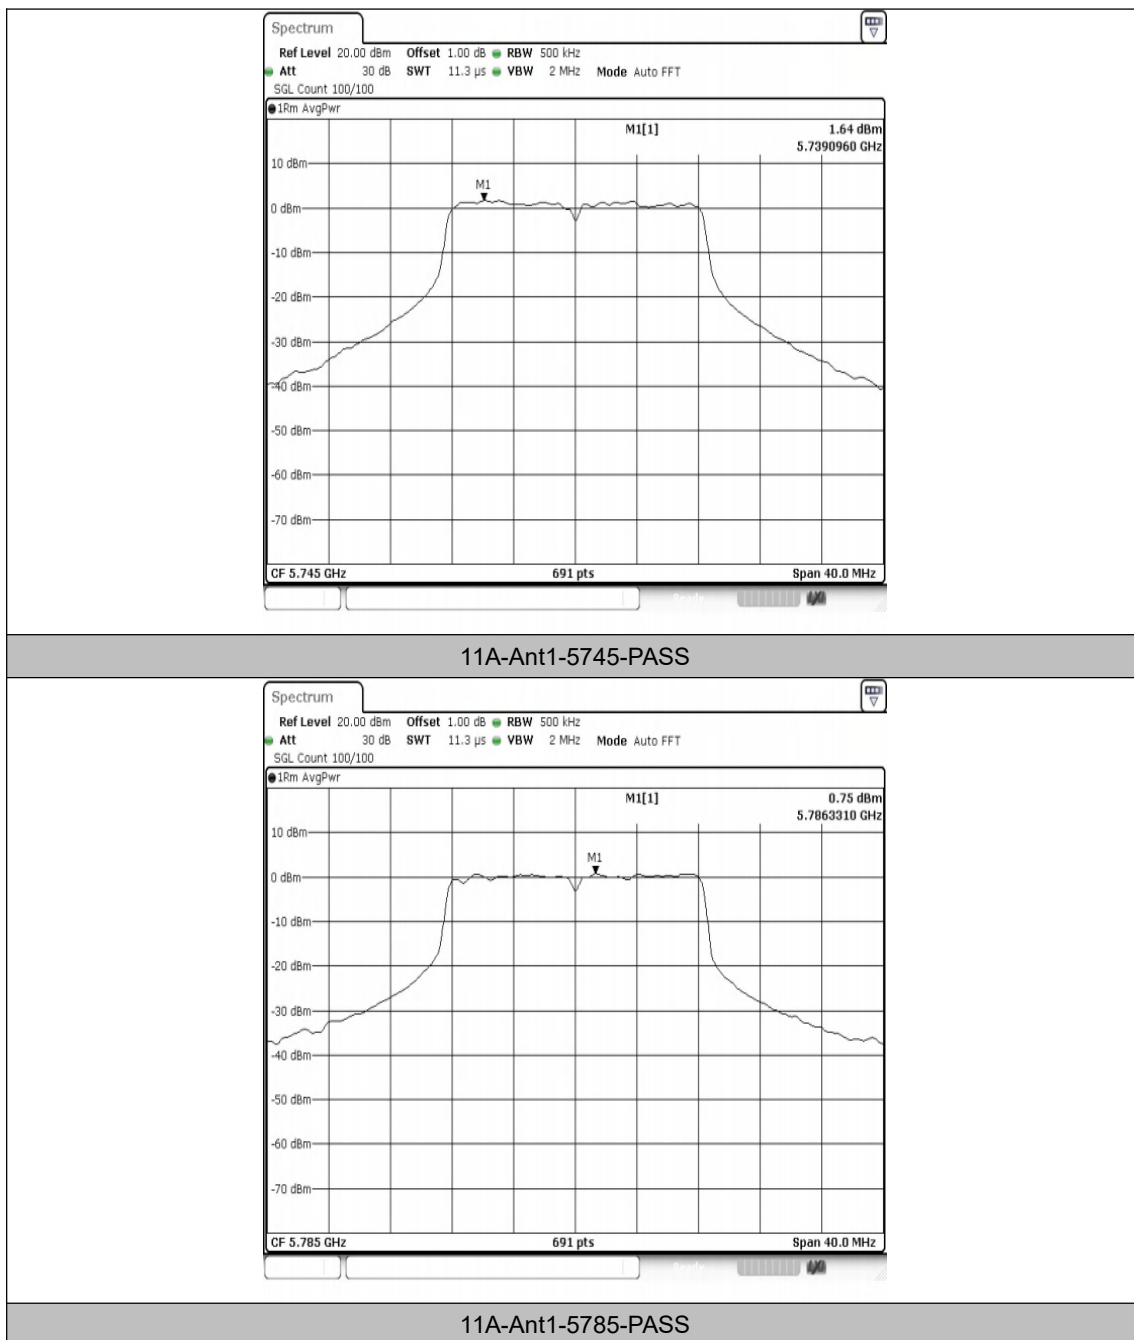


Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com

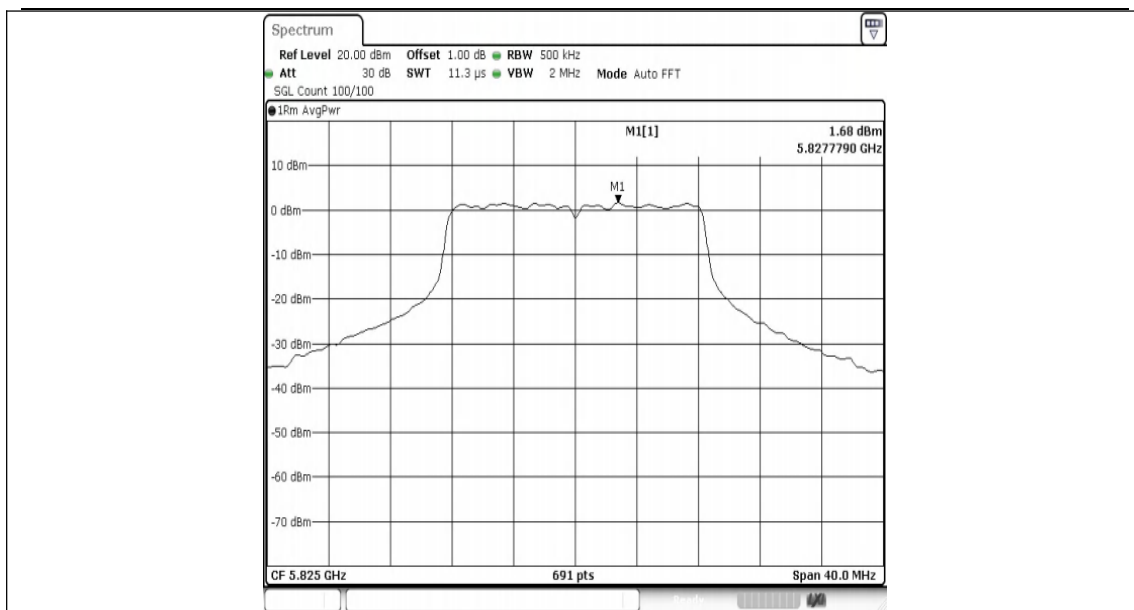

11A-Ant1-5825-PASS

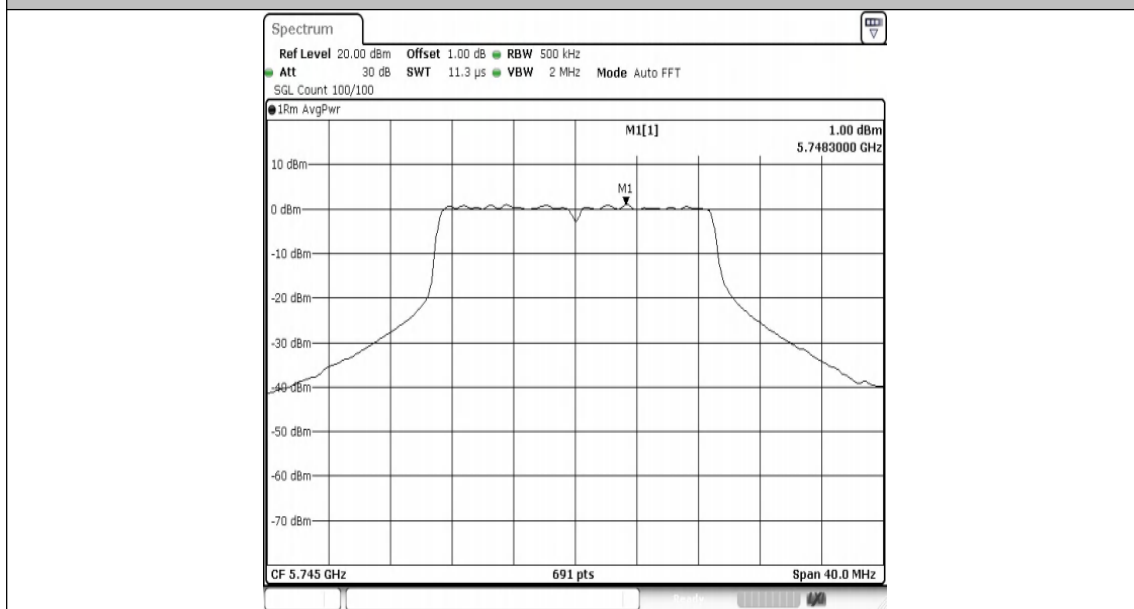


11N20SISO-Ant1-5745-PASS

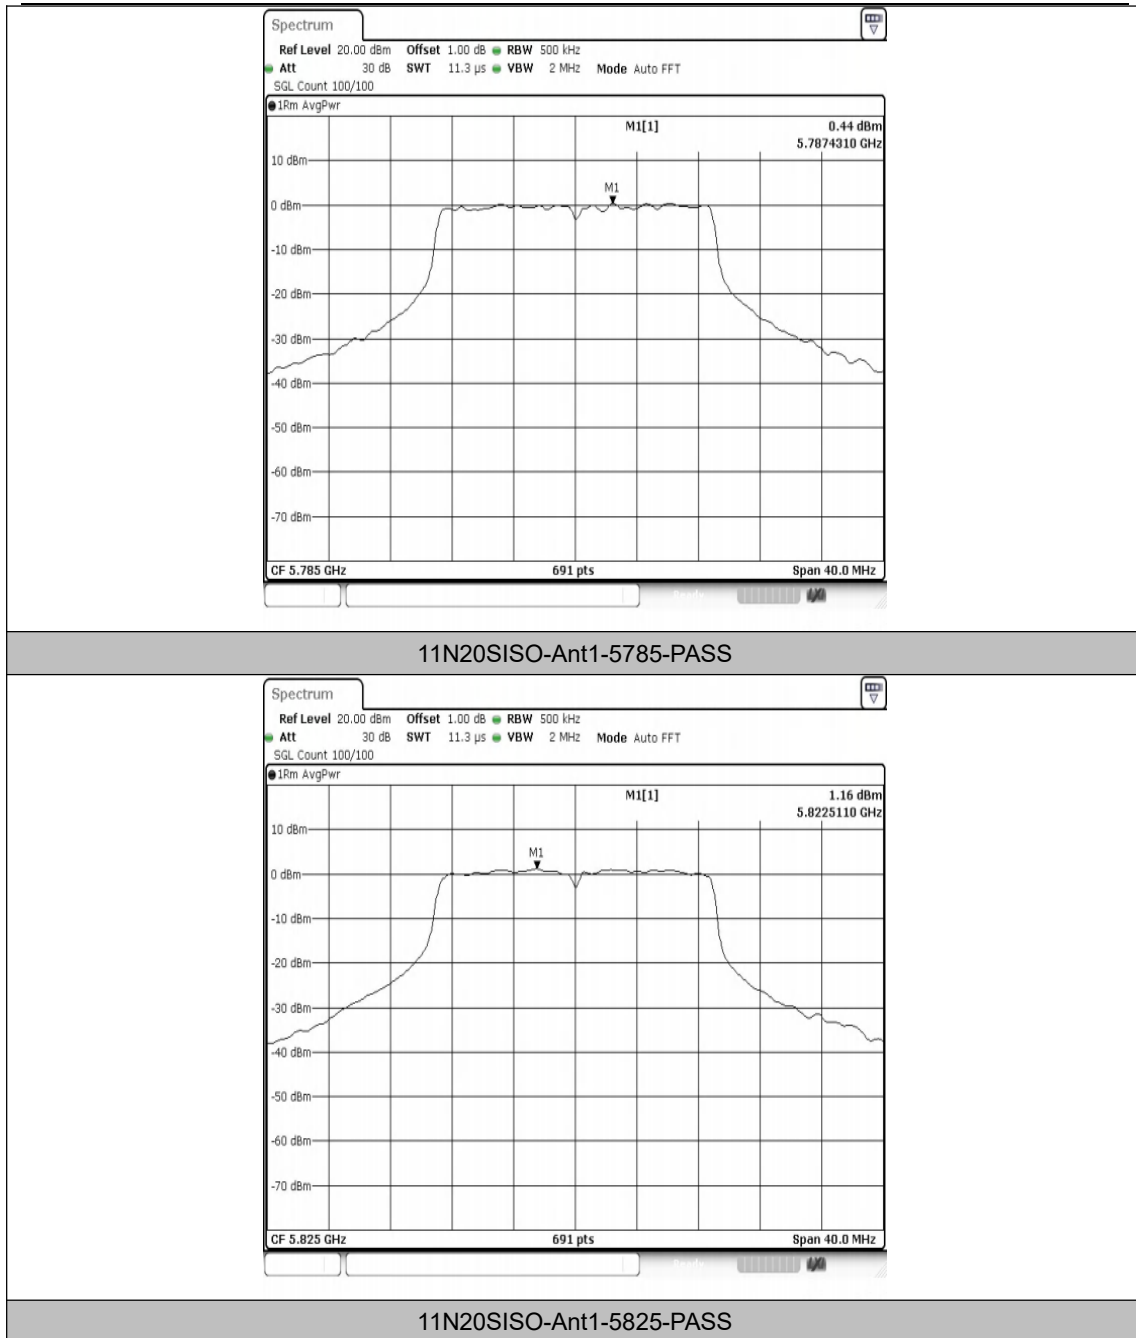


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

 Hotline
400-003-0500
www.anbotek.com

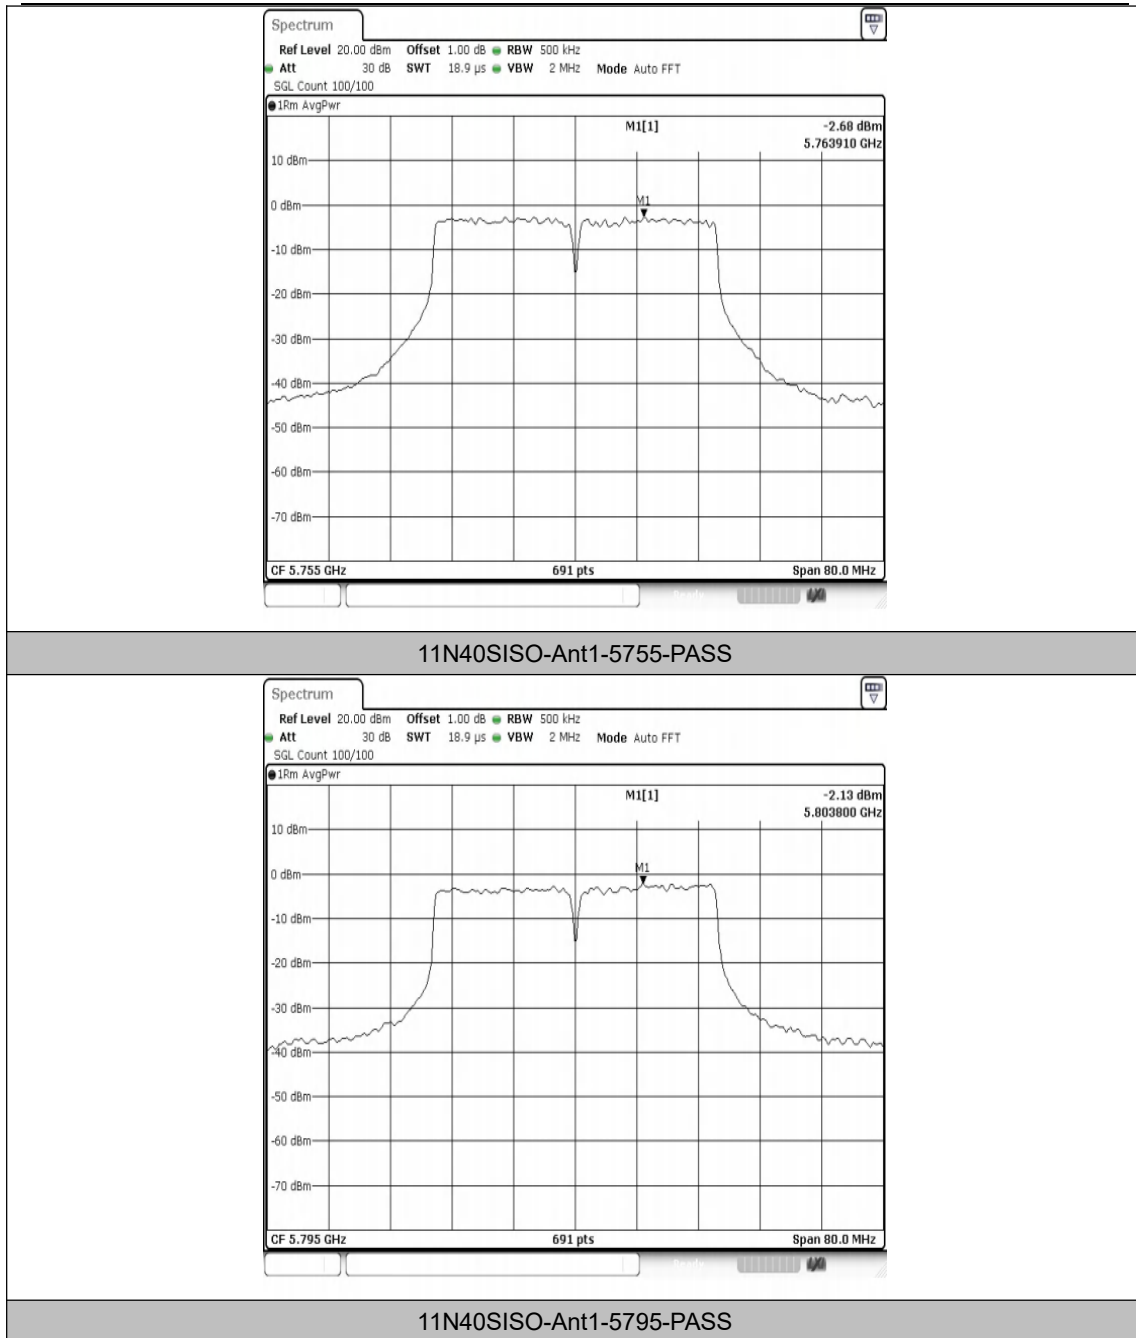


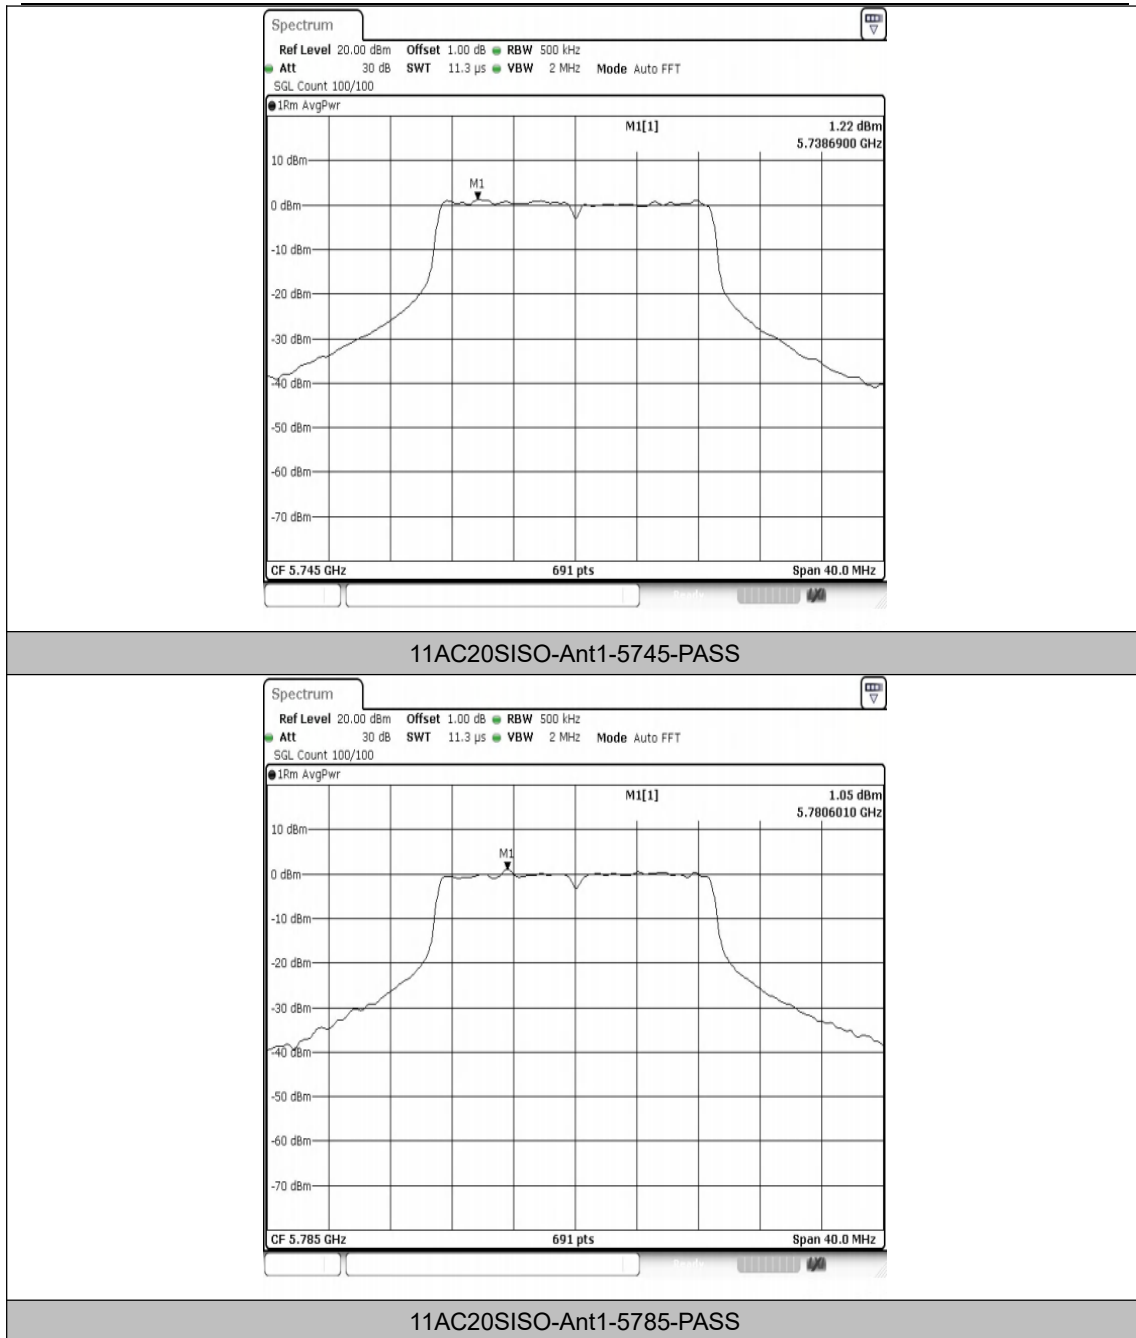

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
 Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
 Tel: (86) 0755-26066440 Email: service@anbotech.com


 Hotline
 400-003-0500
www.anbotech.com

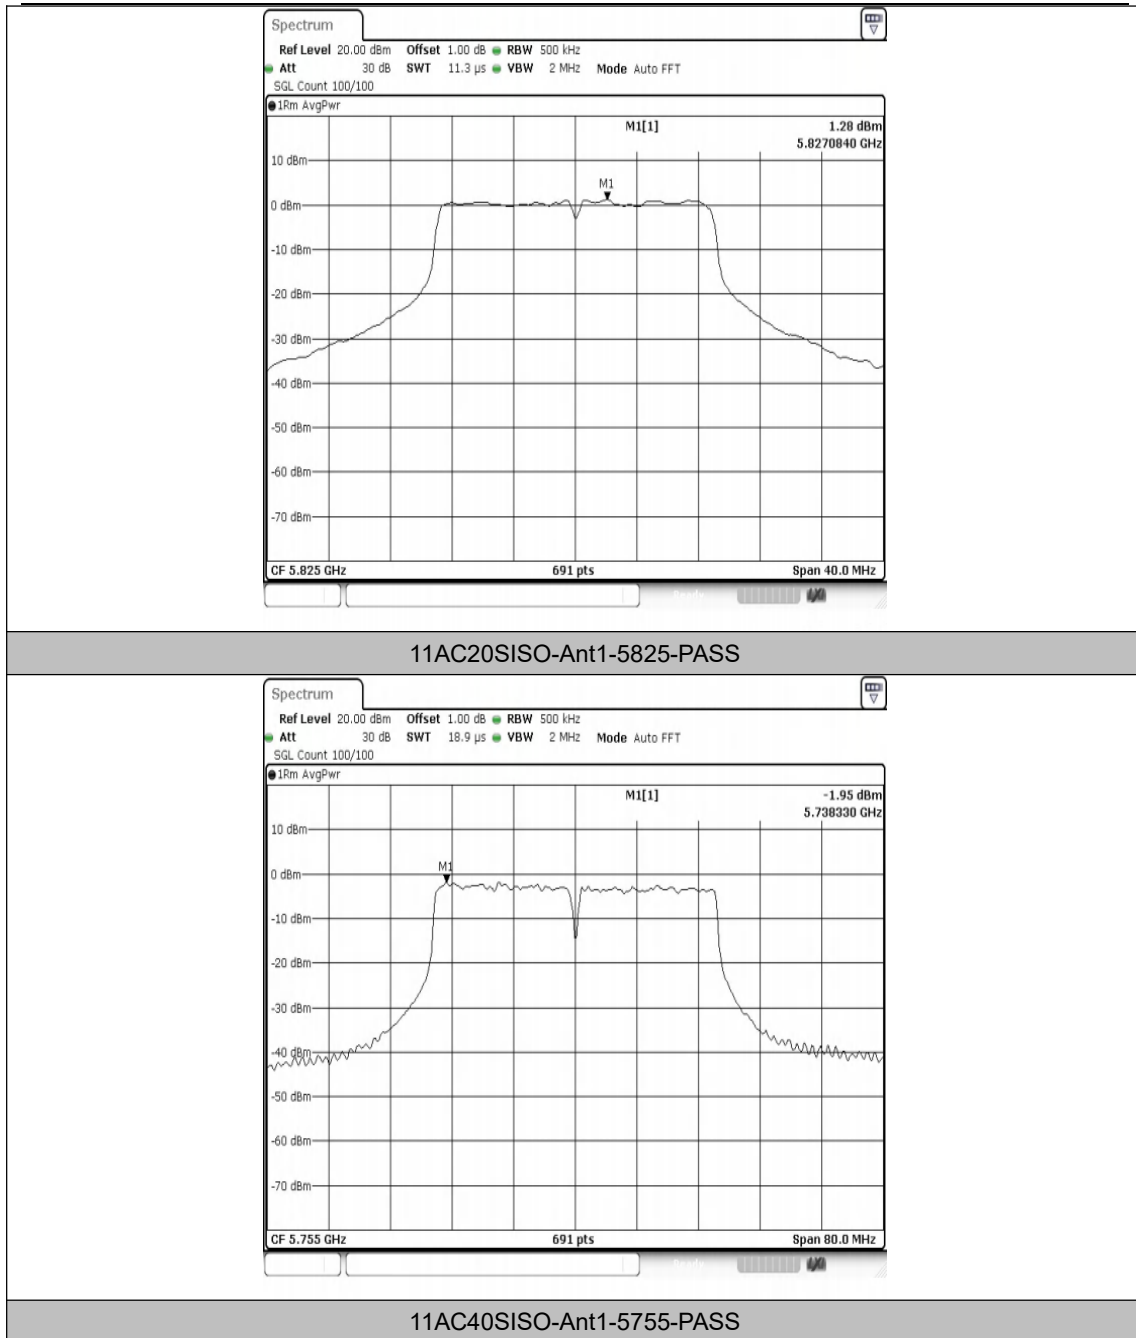


Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

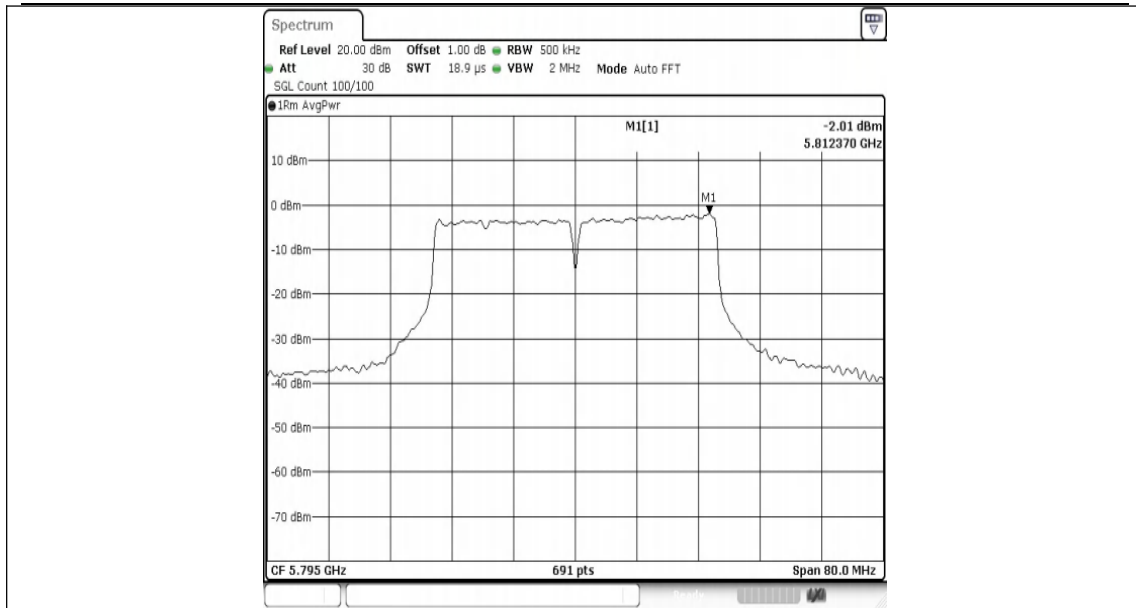


11AC40SISO-Ant1-5795-PASS

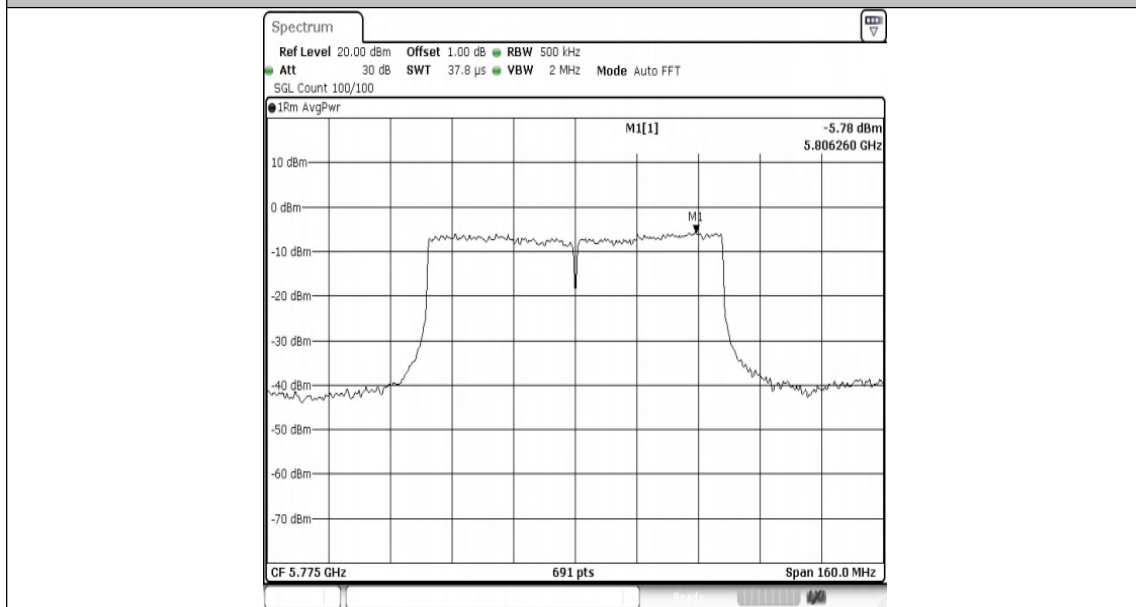


11AC80SISO-Ant1-5775-PASS

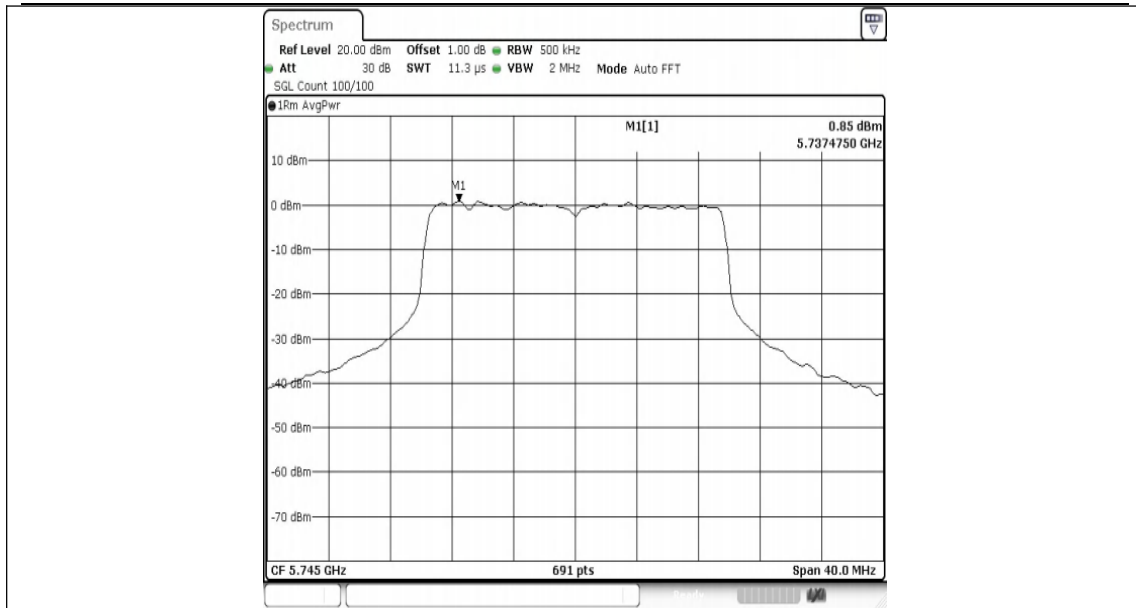


11AX20SISO-Ant1-5745-PASS

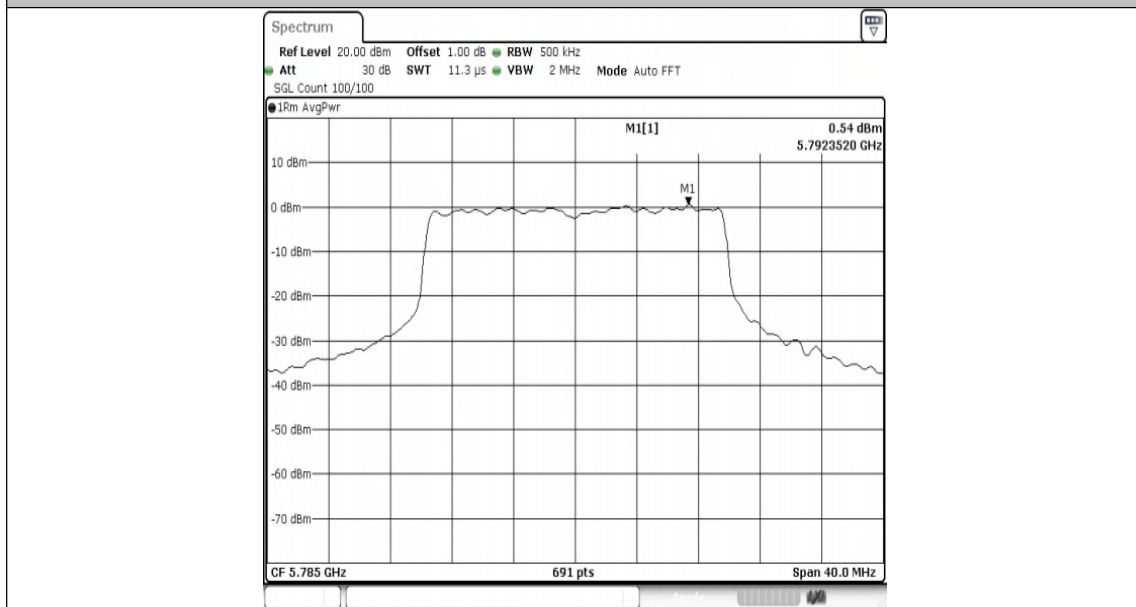


11AX20SISO-Ant1-5785-PASS

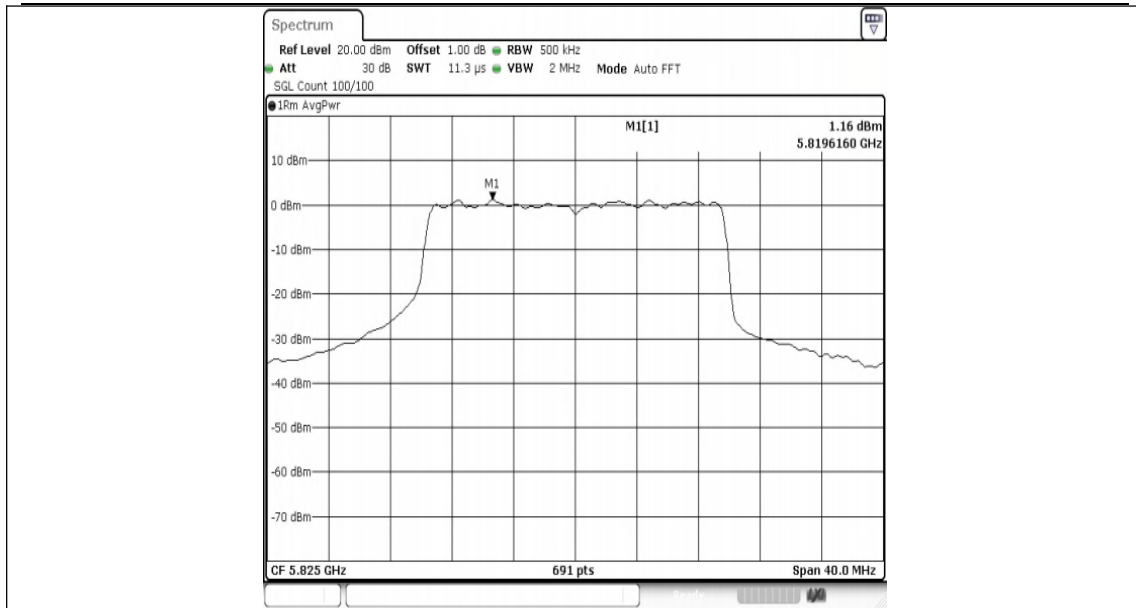


11AX20ISO-Ant1-5825-PASS

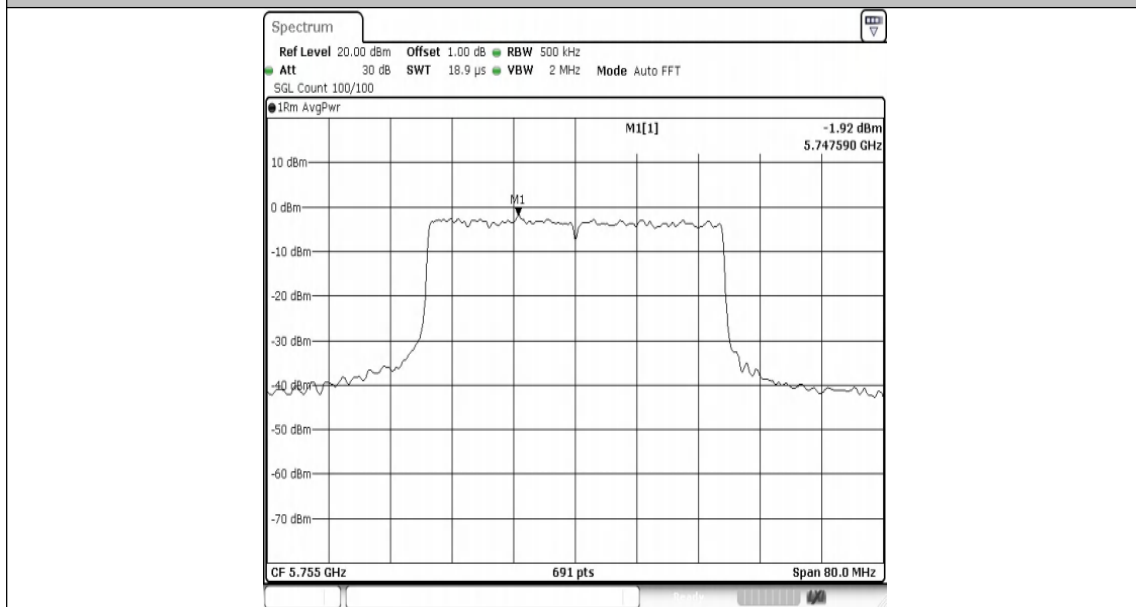

11AX40ISO-Ant1-5755-PASS

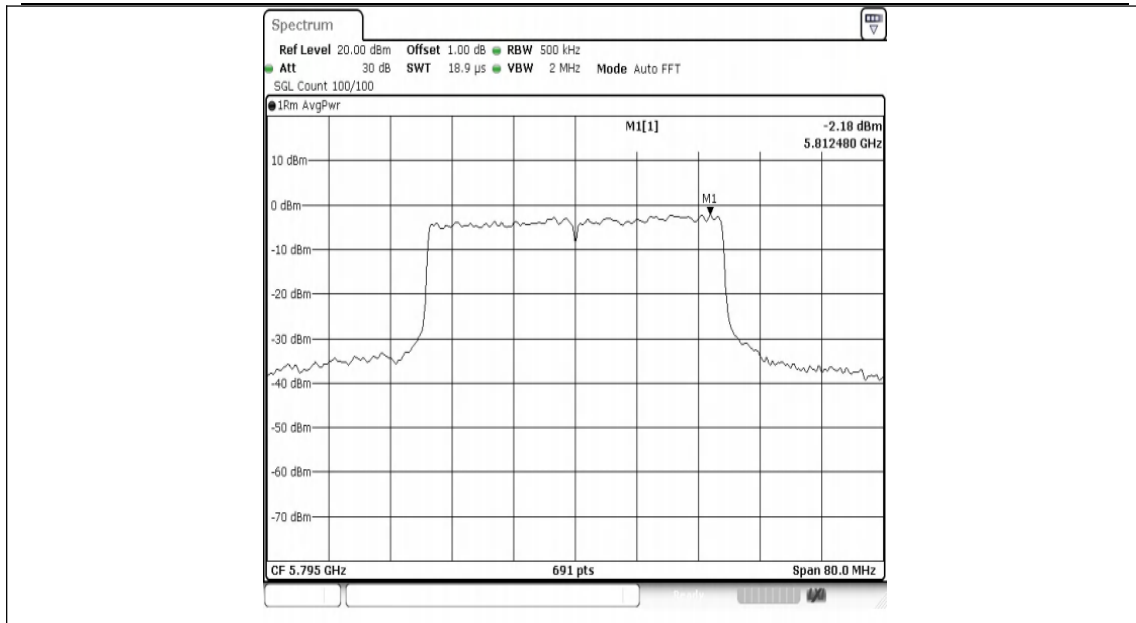

11AX40SISO-Ant1-5795-PASS

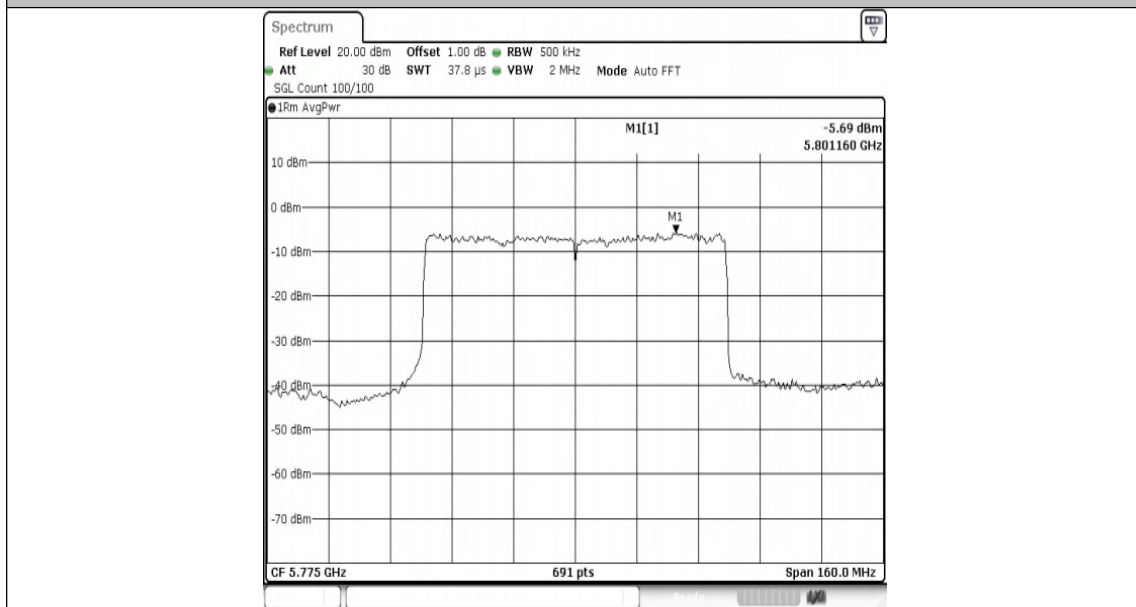

11AX80SISO-Ant1-5775-PASS

Appendix E: Band edge measurements

Test Result B1/2/3

Test Mode	Antenna	ChName	Frequency[MHz]	Result[dBm]	Limit[dBm]	Verdict
11A	Ant1	Low	5180	-36.98	≤-27	PASS
11A	Ant1	High	5320	-39.32	≤-27	PASS
11A	Ant1	Low	5500	-28.9	≤-27	PASS
11A	Ant1	High	5700	-36.78	≤-27	PASS
11N20SISO	Ant1	Low	5180	-33.1	≤-27	PASS
11N20SISO	Ant1	High	5320	-39.87	≤-27	PASS
11N20SISO	Ant1	Low	5500	-30.09	≤-27	PASS
11N20SISO	Ant1	High	5700	-39.06	≤-27	PASS
11N40SISO	Ant1	Low	5190	-30.33	≤-27	PASS
11N40SISO	Ant1	High	5310	-37.74	≤-27	PASS
11N40SISO	Ant1	Low	5510	-29.71	≤-27	PASS
11N40SISO	Ant1	High	5670	-28.39	≤-27	PASS
11AC20SISO	Ant1	Low	5180	-34.14	≤-27	PASS
11AC20SISO	Ant1	High	5320	-44.11	≤-27	PASS
11AC20SISO	Ant1	Low	5500	-30.59	≤-27	PASS
11AC20SISO	Ant1	High	5700	-37.58	≤-27	PASS
11AC40SISO	Ant1	Low	5190	-29.43	≤-27	PASS
11AC40SISO	Ant1	High	5310	-35.88	≤-27	PASS
11AC40SISO	Ant1	Low	5510	-40.33	≤-27	PASS
11AC40SISO	Ant1	High	5670	-29.81	≤-27	PASS
11AC80SISO	Ant1	Low	5210	-27.37	≤-27	PASS
11AC80SISO	Ant1	High	5290	-33.92	≤-27	PASS
11AC80SISO	Ant1	Low	5530	-32.17	≤-27	PASS
11AX20SISO	Ant1	Low	5180	-35.81	≤-27	PASS
11AX20SISO	Ant1	High	5320	-41.71	≤-27	PASS
11AX20SISO	Ant1	Low	5500	-29.36	≤-27	PASS
11AX20SISO	Ant1	High	5700	-37.58	≤-27	PASS
11AX40SISO	Ant1	Low	5190	-34.84	≤-27	PASS
11AX40SISO	Ant1	High	5310	-37.1	≤-27	PASS
11AX40SISO	Ant1	Low	5510	-37.45	≤-27	PASS
11AX40SISO	Ant1	High	5670	-42.34	≤-27	PASS
11AX80SISO	Ant1	Low	5210	-33.14	≤-27	PASS
11AX80SISO	Ant1	High	5290	-38.36	≤-27	PASS
11AX80SISO	Ant1	Low	5530	-34.61	≤-27	PASS

Note: The margin plus the antenna gain also meets the limit.

Test Result B4

Test Mode	Antenna	Ch. Name	Frequency[MHz]	FreqRange [MHz]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	Low	5745	5720~5725	-19.32	≤20.92	PASS
11A	Ant1	Low	5745	5700~5720	-26.03	≤14.99	PASS
11A	Ant1	Low	5745	5650~5700	-45.76	≤-26.88	PASS
11A	Ant1	Low	5745	5760~5650	-45.74	≤-27	PASS
11A	Ant1	High	5825	5850~5855	-25.44	≤16.10	PASS
11A	Ant1	High	5825	5855~5875	-26.88	≤14.13	PASS
11A	Ant1	High	5825	5875~5925	-46.45	≤-26.44	PASS
11A	Ant1	High	5825	5925~5935	-45.1	≤-27	PASS
11N20SI SO	Ant1	Low	5745	5720~5725	-24.78	≤15.98	PASS
11N20SI SO	Ant1	Low	5745	5700~5720	-24.91	≤15.60	PASS
11N20SI SO	Ant1	Low	5745	5650~5700	-46.77	≤-26.75	PASS
11N20SI SO	Ant1	Low	5745	5760~5650	-45.7	≤-27	PASS
11N20SI SO	Ant1	High	5825	5850~5855	-26.14	≤15.65	PASS
11N20SI SO	Ant1	High	5825	5855~5875	-26.28	≤15.55	PASS
11N20SI SO	Ant1	High	5825	5875~5925	-46.03	≤-26.00	PASS
11N20SI SO	Ant1	High	5825	5925~5935	-45.52	≤-27	PASS
11N40SI SO	Ant1	Low	5755	5720~5725	-25.99	≤15.90	PASS
11N40SI SO	Ant1	Low	5755	5700~5720	-27.48	≤12.08	PASS
11N40SI SO	Ant1	Low	5755	5650~5700	-41.69	≤-24.33	PASS
11N40SI SO	Ant1	Low	5755	5780~5650	-42.59	≤-27	PASS
11N40SI SO	Ant1	High	5795	5850~5855	-30.43	≤15.85	PASS
11N40SI SO	Ant1	High	5795	5855~5875	-33.52	≤10.47	PASS
11N40SI SO	Ant1	High	5795	5875~5925	-46.33	≤-26.97	PASS
11N40SI	Ant1	High	5795	5925~5935	-45.57	≤-27	PASS

Shenzhen Anbotech Compliance Laboratory Limited

SO							
11AC20S ISO	Ant1	Low	5745	5720~5725	-26.06	≤15.98	PASS
11AC20S ISO	Ant1	Low	5745	5700~5720	-26.05	≤15.51	PASS
11AC20S ISO	Ant1	Low	5745	5650~5700	-46.04	≤-26.38	PASS
11AC20S ISO	Ant1	Low	5745	5760~5650	-45.95	≤-27	PASS
11AC20S ISO	Ant1	High	5825	5850~5855	-24.94	≤15.65	PASS
11AC20S ISO	Ant1	High	5825	5855~5875	-26	≤12.32	PASS
11AC20S ISO	Ant1	High	5825	5875~5925	-45	≤-26.00	PASS
11AC20S ISO	Ant1	High	5825	5925~5935	-45.24	≤-27	PASS
11AC40S ISO	Ant1	Low	5755	5720~5725	-24.37	≤15.90	PASS
11AC40S ISO	Ant1	Low	5755	5700~5720	-23.74	≤15.25	PASS
11AC40S ISO	Ant1	Low	5755	5650~5700	-44.3	≤-26.65	PASS
11AC40S ISO	Ant1	Low	5755	5780~5650	-45.94	≤-27	PASS
11AC40S ISO	Ant1	High	5795	5850~5855	-29.83	≤15.85	PASS
11AC40S ISO	Ant1	High	5795	5855~5875	-27.06	≤13.55	PASS
11AC40S ISO	Ant1	High	5795	5875~5925	-44.84	≤-26.97	PASS
11AC40S ISO	Ant1	High	5795	5925~5935	-45.25	≤-27	PASS
11AC80S ISO	Ant1	Low	5775	5720~5725	-25.33	≤15.67	PASS
11AC80S ISO	Ant1	Low	5775	5700~5720	-22.74	≤13.85	PASS
11AC80S ISO	Ant1	Low	5775	5650~5700	-35.39	≤-25.88	PASS
11AC80S ISO	Ant1	Low	5775	5800~5650	-38.34	≤-27	PASS
11AC80S ISO	Ant1	High	5775	5850~5855	-25.99	≤15.98	PASS

Shenzhen Anbotech Compliance Laboratory Limited

11AC80S ISO	Ant1	High	5775	5855~5875	-22.14	≤13.17	PASS
11AC80S ISO	Ant1	High	5775	5875~5925	-40.72	≤-25.67	PASS
11AC80S ISO	Ant1	High	5775	5925~5935	-40.44	≤-27	PASS
11AX20SI SO	Ant1	Low	5745	5720~5725	-25.44	≤15.98	PASS
11AX20SI SO	Ant1	Low	5745	5700~5720	-25.84	≤15.13	PASS
11AX20SI SO	Ant1	Low	5745	5650~5700	-42.95	≤-26.26	PASS
11AX20SI SO	Ant1	Low	5745	5760~5650	-46.53	≤-27	PASS
11AX20SI SO	Ant1	High	5825	5850~5855	-25.88	≤16.10	PASS
11AX20SI SO	Ant1	High	5825	5855~5875	-25.83	≤15.33	PASS
11AX20SI SO	Ant1	High	5825	5875~5925	-46.64	≤-26.87	PASS
11AX20SI SO	Ant1	High	5825	5925~5935	-44.99	≤-27	PASS
11AX40SI SO	Ant1	Low	5755	5720~5725	-21.37	≤17.24	PASS
11AX40SI SO	Ant1	Low	5755	5700~5720	-21.99	≤15.31	PASS
11AX40SI SO	Ant1	Low	5755	5650~5700	-40.69	≤-24.91	PASS
11AX40SI SO	Ant1	Low	5755	5780~5650	-41.96	≤-27	PASS
11AX40SI SO	Ant1	High	5795	5850~5855	-24.99	≤16.39	PASS
11AX40SI SO	Ant1	High	5795	5855~5875	-26.56	≤14.09	PASS
11AX40SI SO	Ant1	High	5795	5875~5925	-43.73	≤-24.84	PASS
11AX40SI SO	Ant1	High	5795	5925~5935	-44.91	≤-27	PASS
11AX80SI SO	Ant1	Low	5775	5720~5725	-26.02	≤15.67	PASS
11AX80SI SO	Ant1	Low	5775	5700~5720	-21.95	≤11.33	PASS
11AX80SI	Ant1	Low	5775	5650~5700	-35.79	≤-26.38	PASS

Shenzhen Anbotech Compliance Laboratory Limited





SO							
11AX80SI SO	Ant1	Low	5775	5800~5650	-36.79	≤ -27	PASS
11AX80SI SO	Ant1	High	5775	5850~5855	-26.35	≤ 15.98	PASS
11AX80SI SO	Ant1	High	5775	5855~5875	-20.24	≤ 13.09	PASS
11AX80SI SO	Ant1	High	5775	5875~5925	-39.81	≤ -26.86	PASS
11AX80SI SO	Ant1	High	5775	5925~5935	-39.3	≤ -27	PASS


Note: The margin plus the antenna gain also meets the limit.




Test Graphs B1/2/3

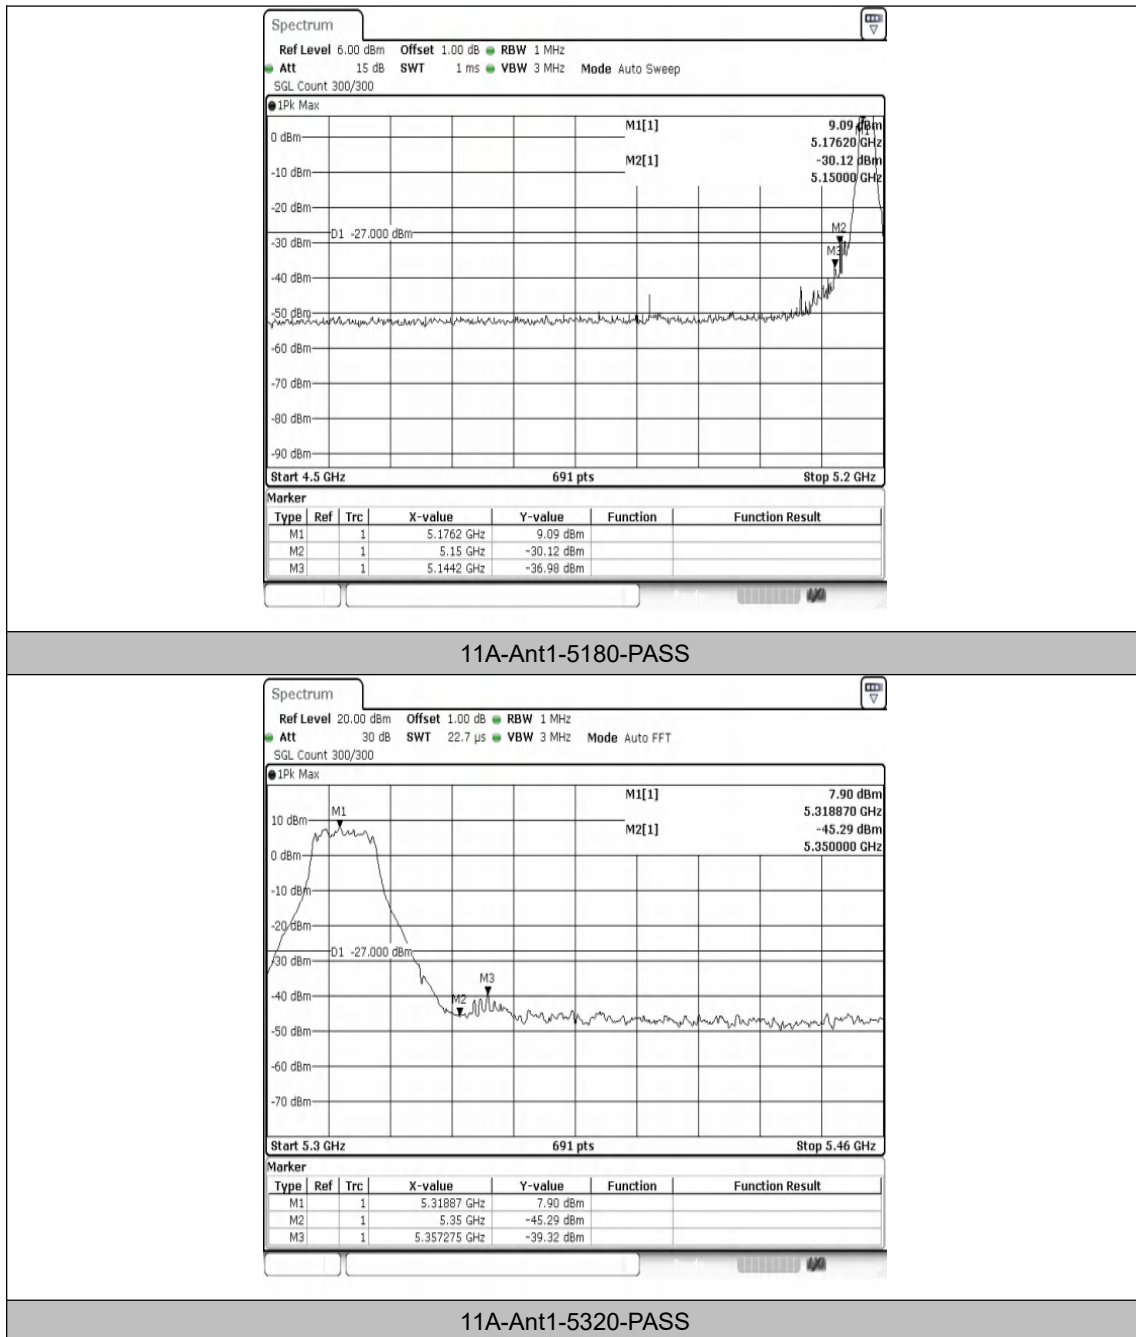


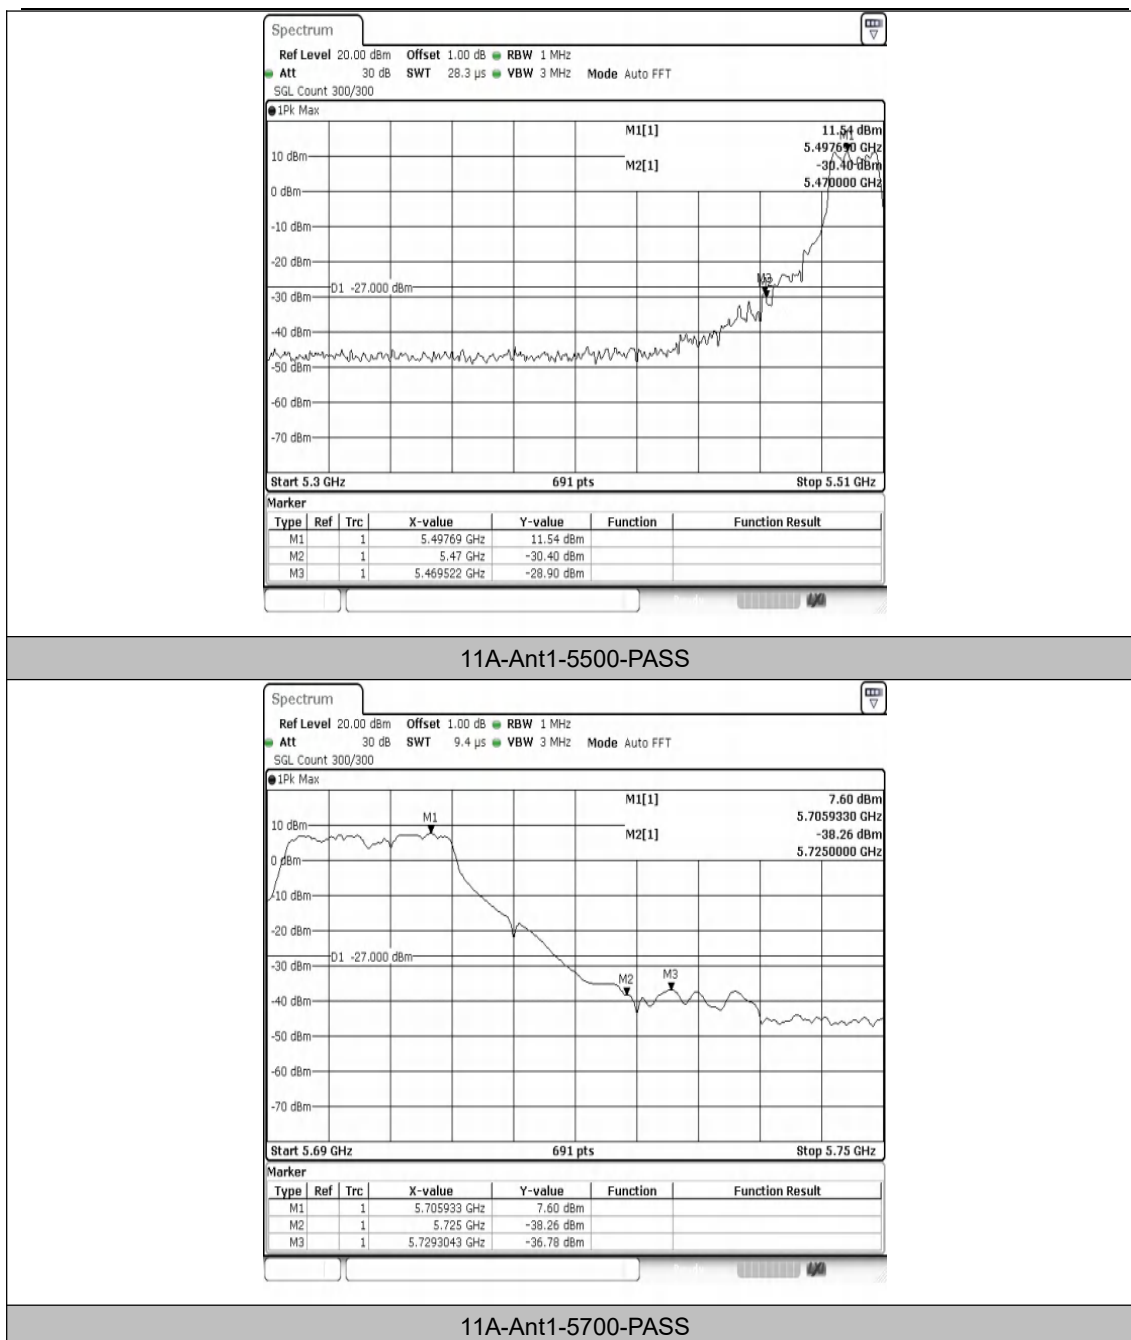

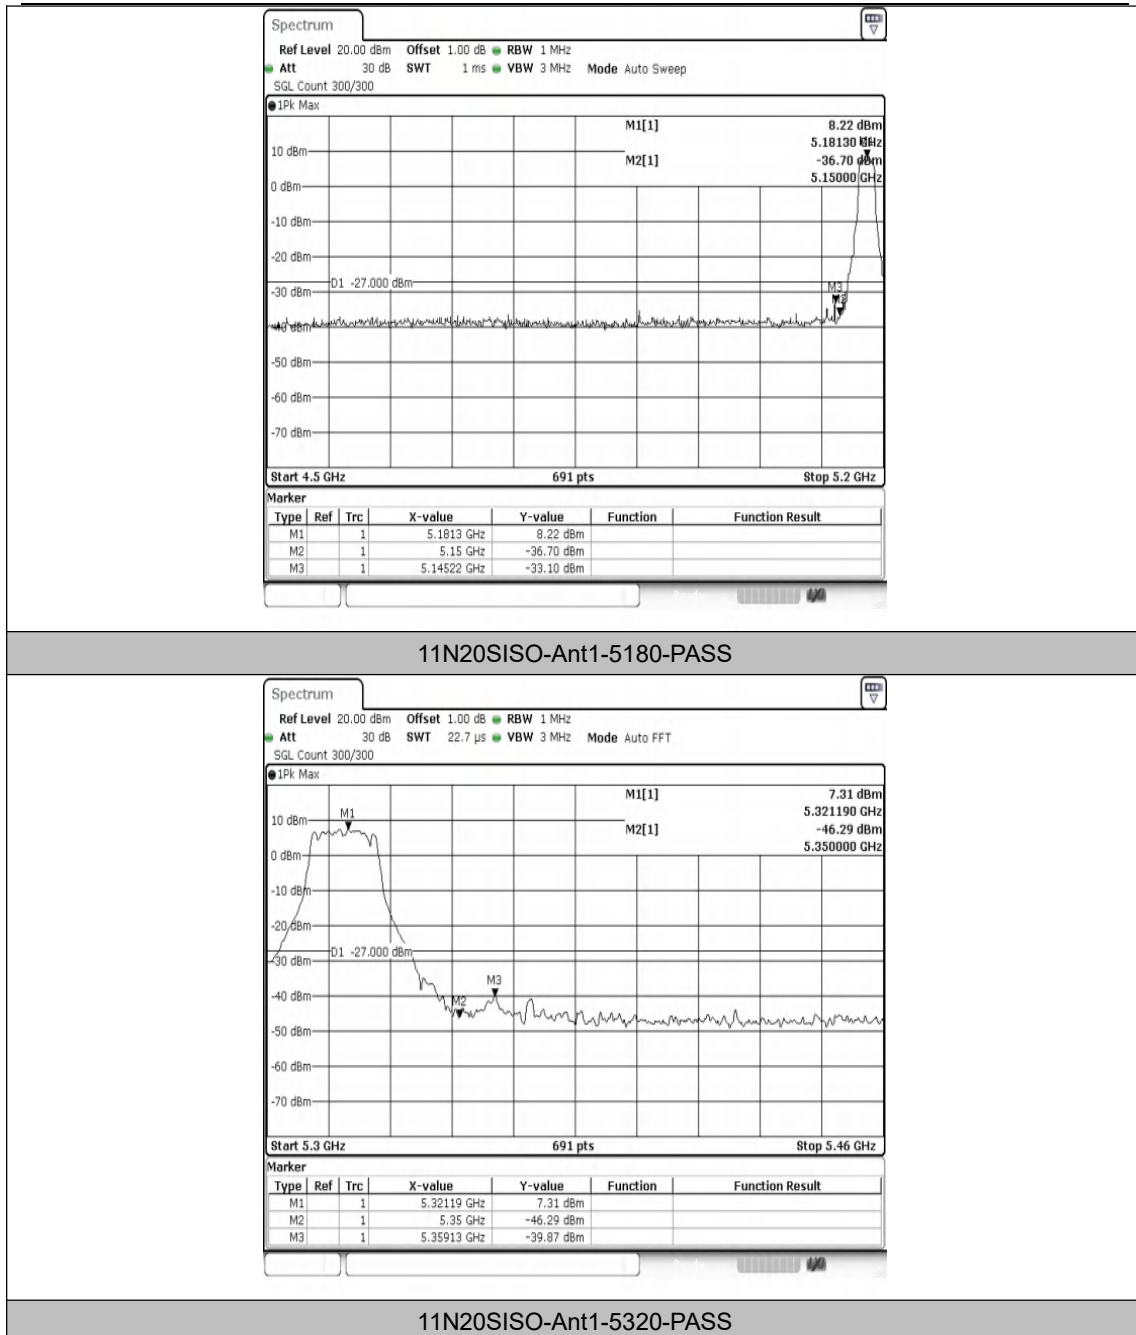


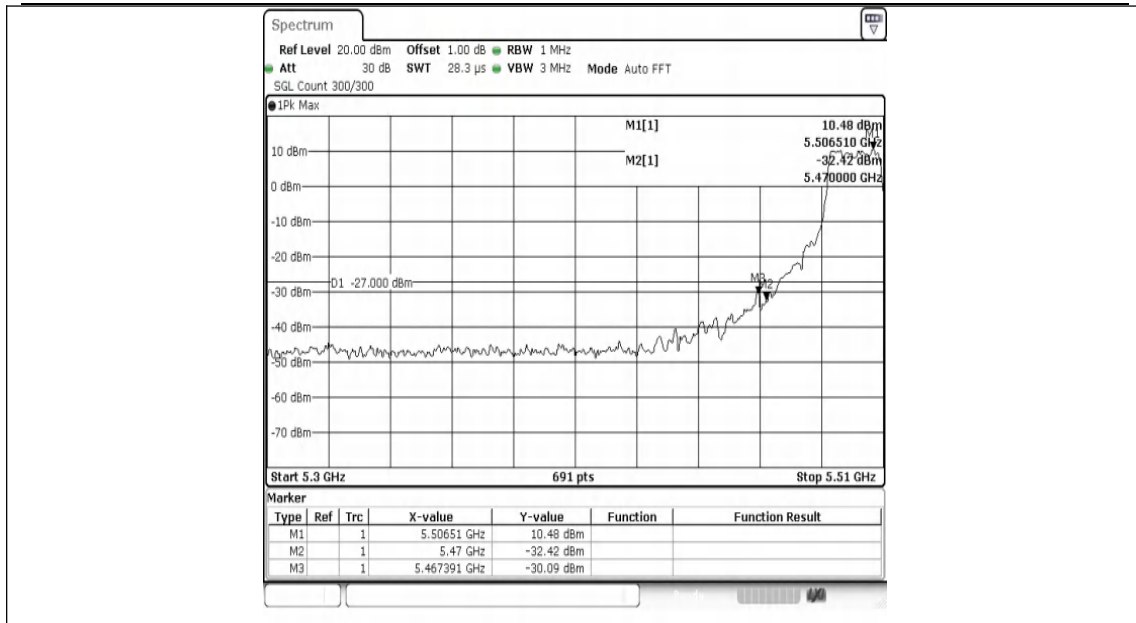


11N20SISO-Ant1-5500-PASS

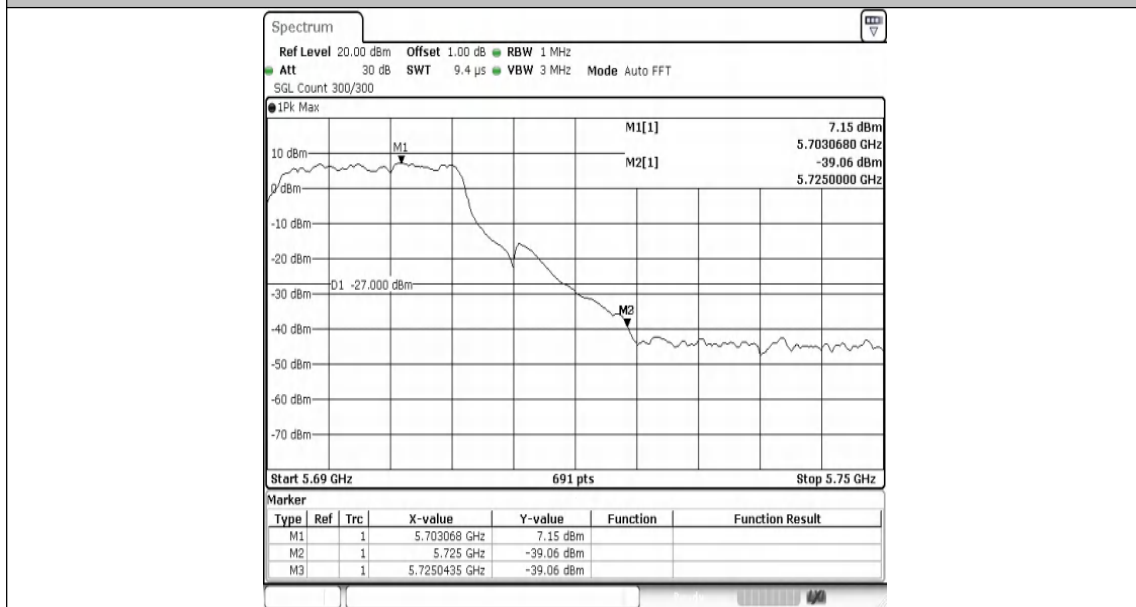


11N20SISO-Ant1-5700-PASS

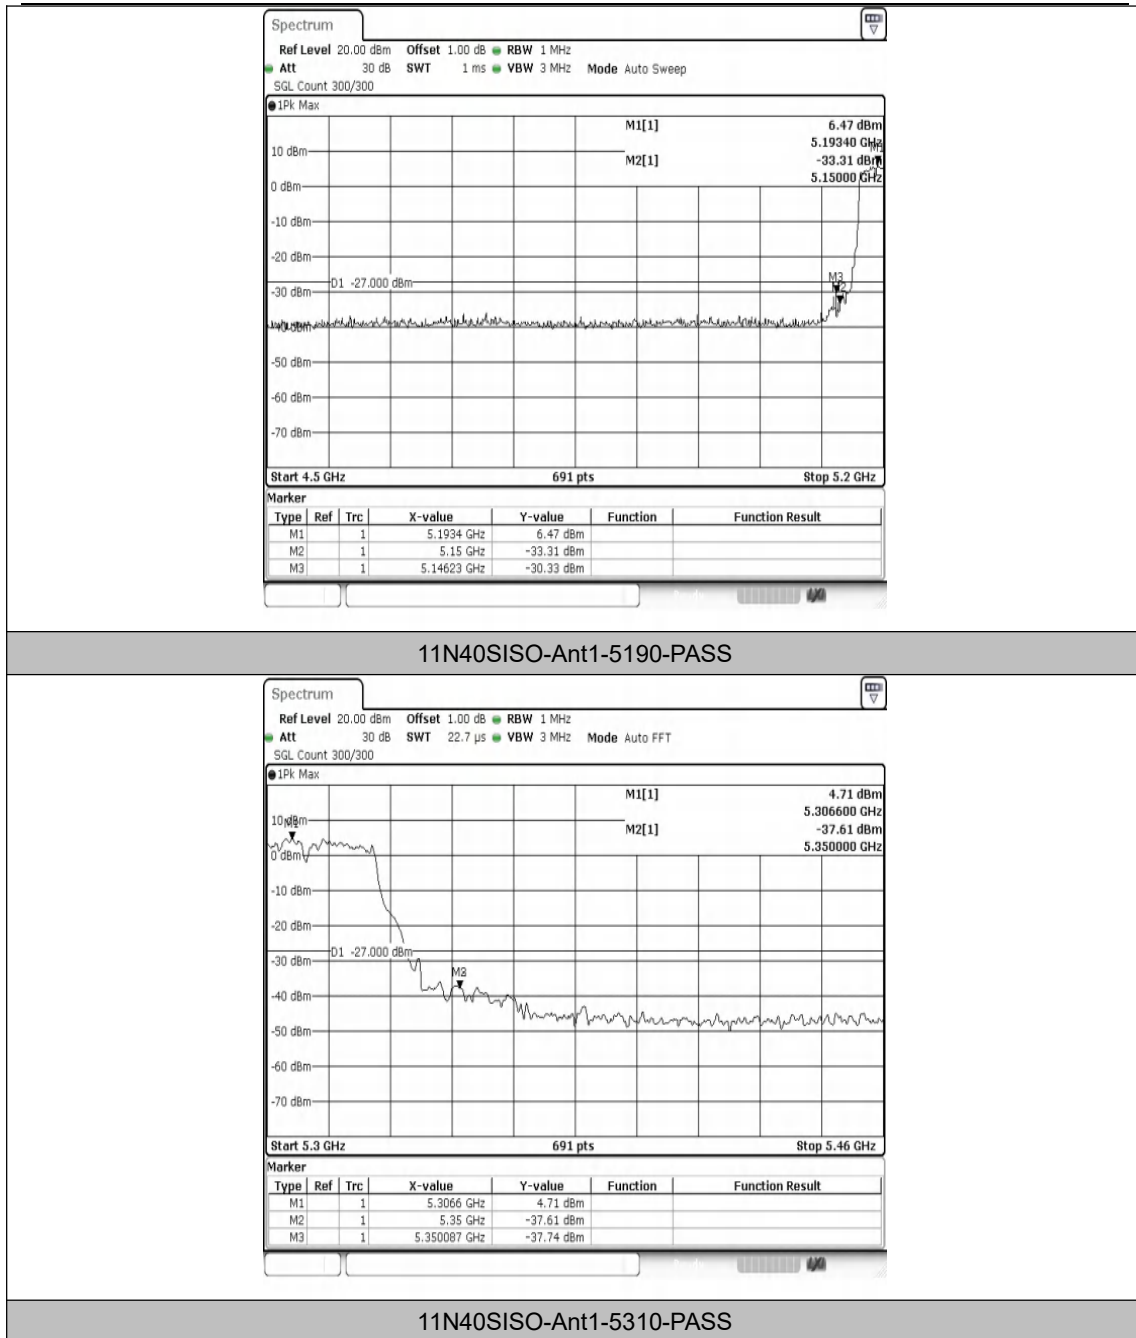


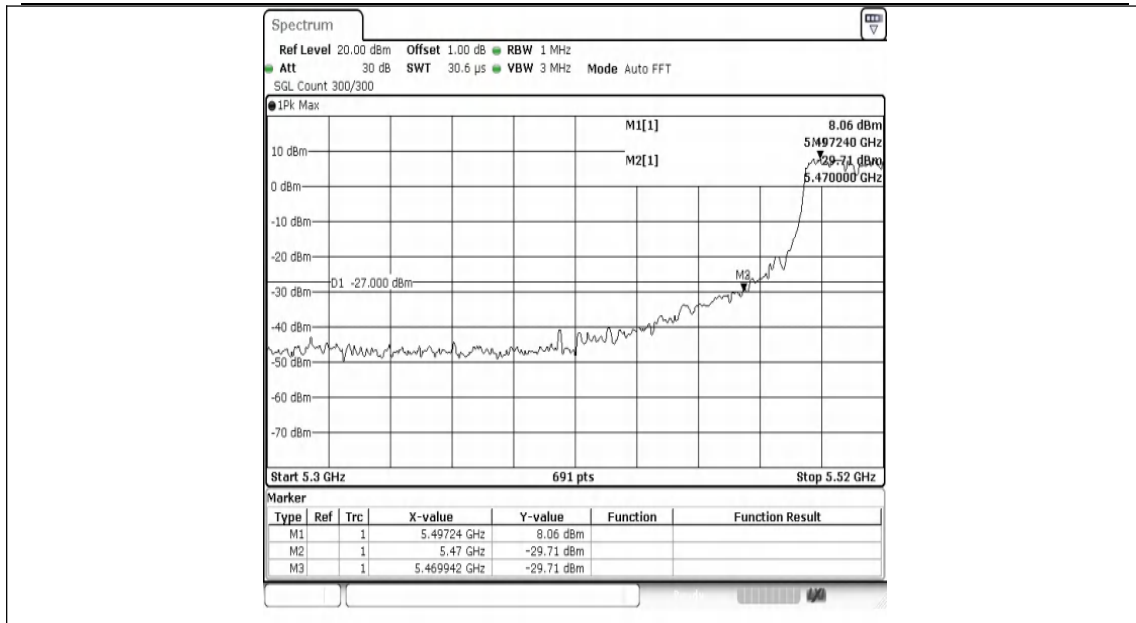



11N40SISO-Ant1-5510-PASS

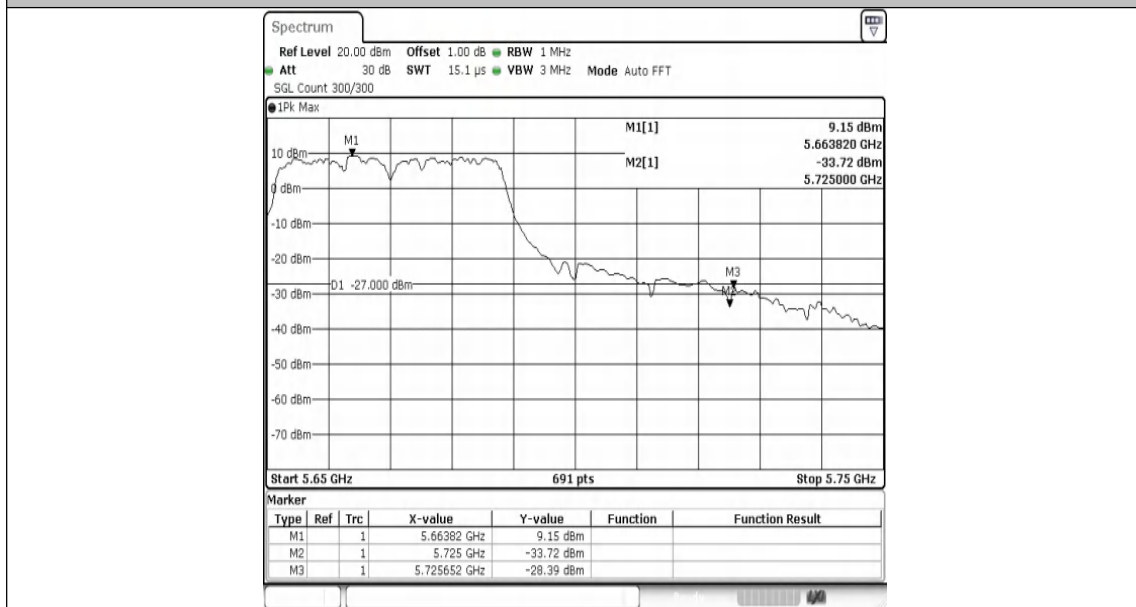


11N40SISO-Ant1-5670-PASS

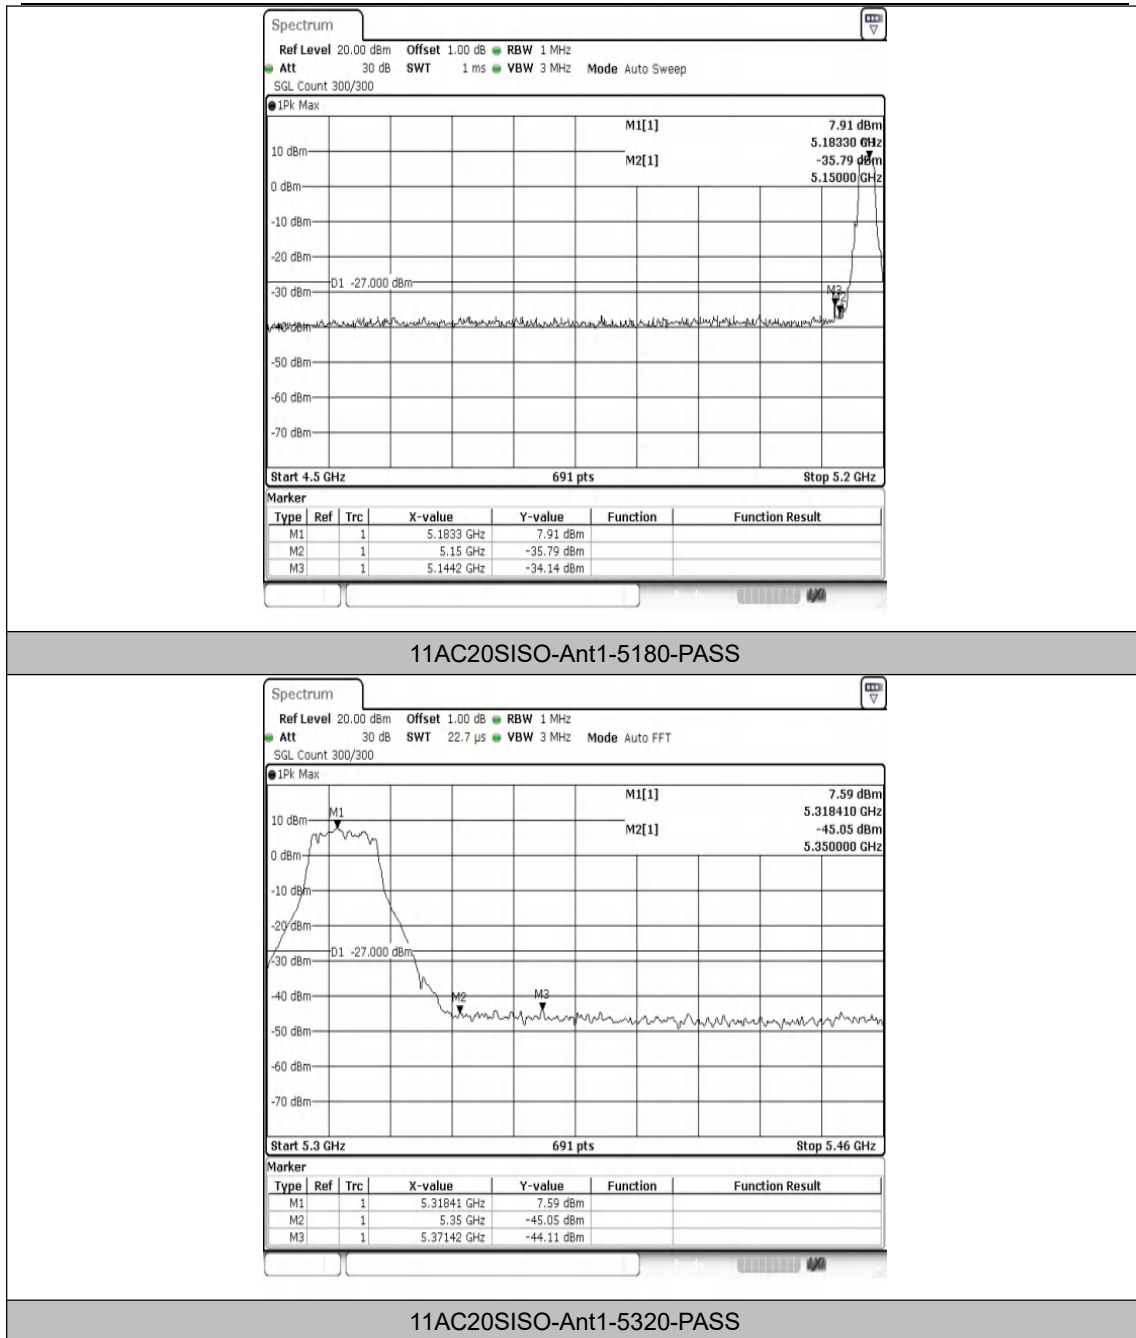

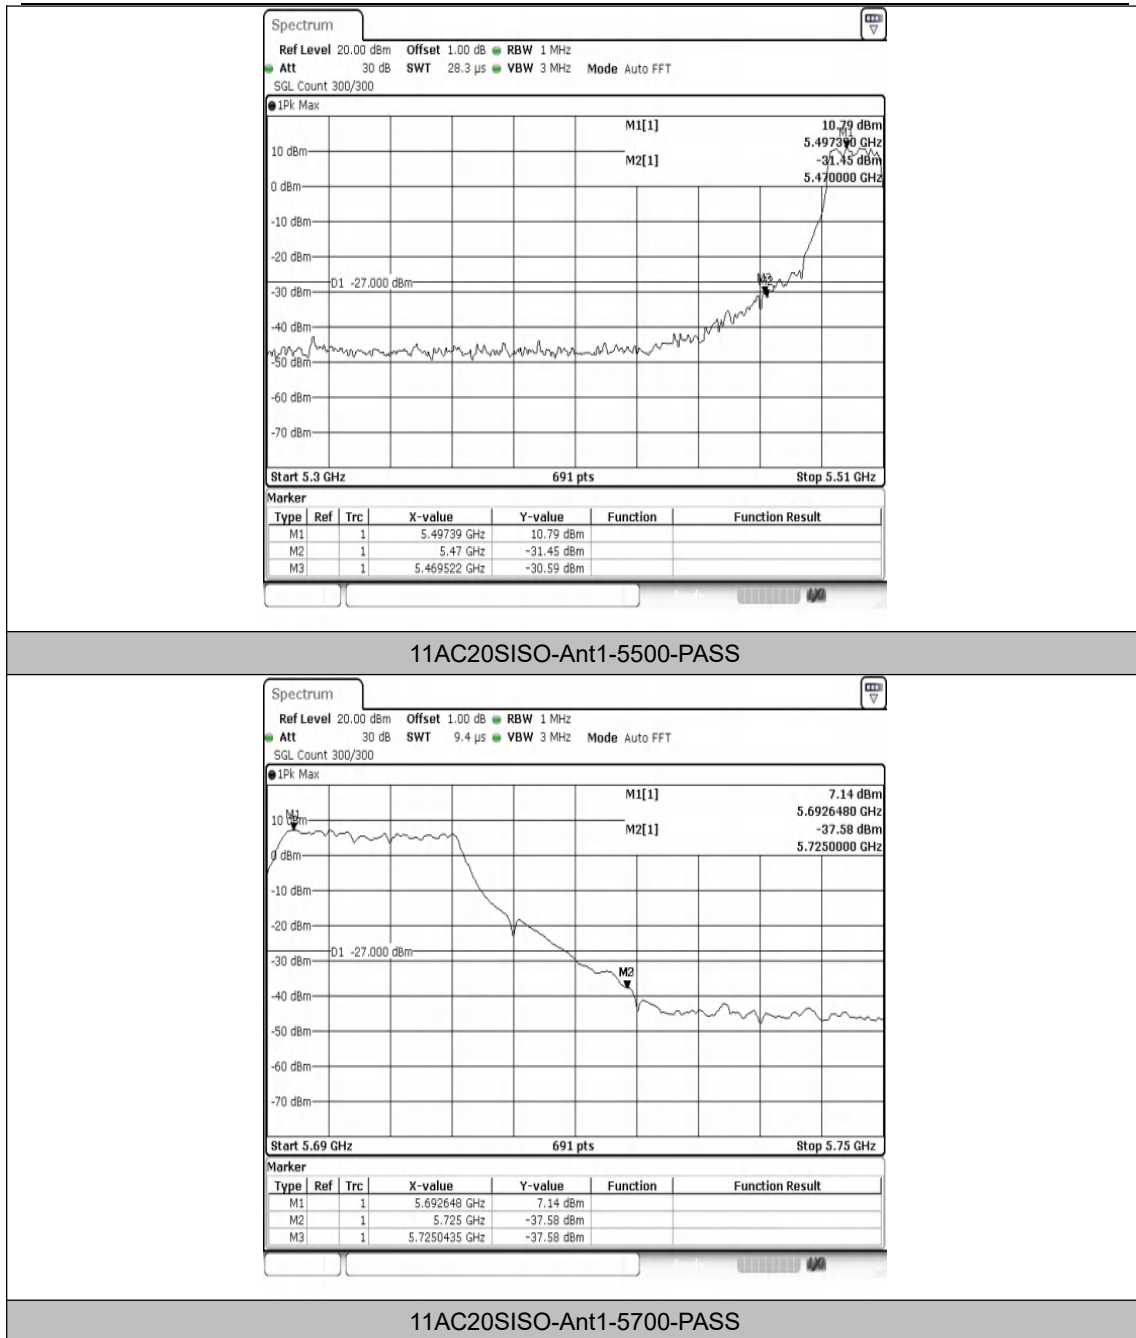


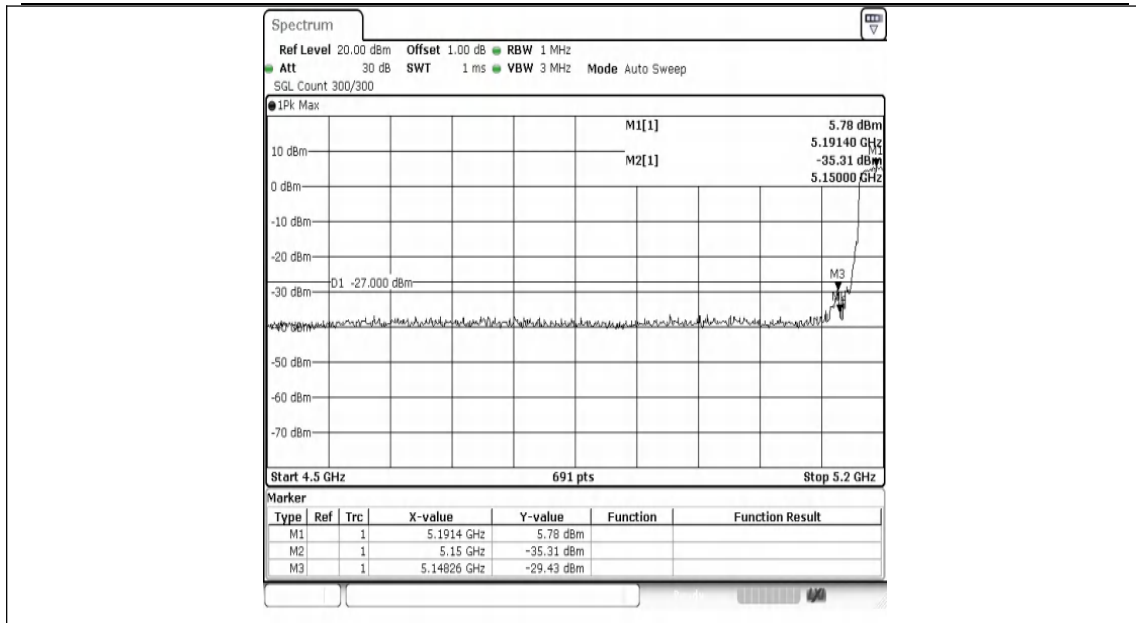


11AC40SISO-Ant1-5190-PASS

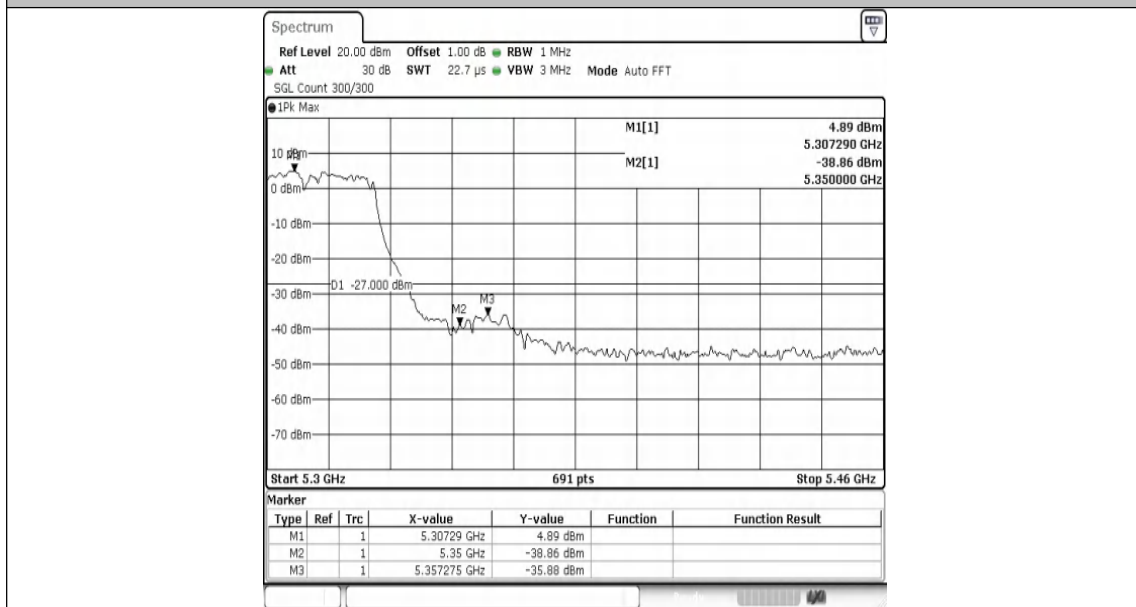


11AC40SISO-Ant1-5310-PASS

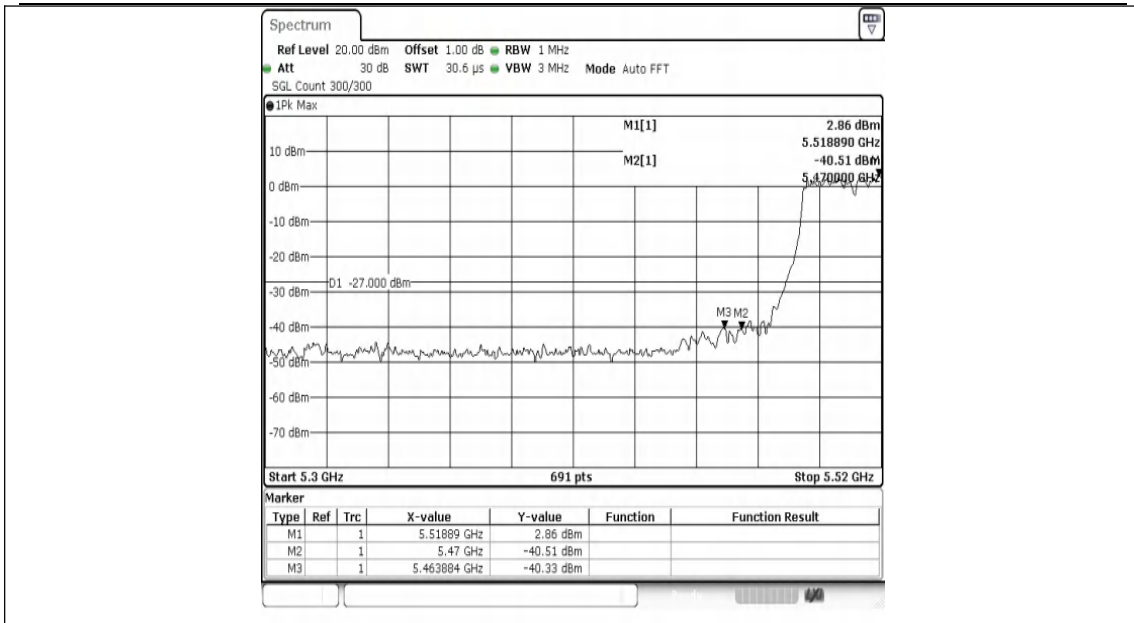



11AC40SISO-Ant1-5510-PASS

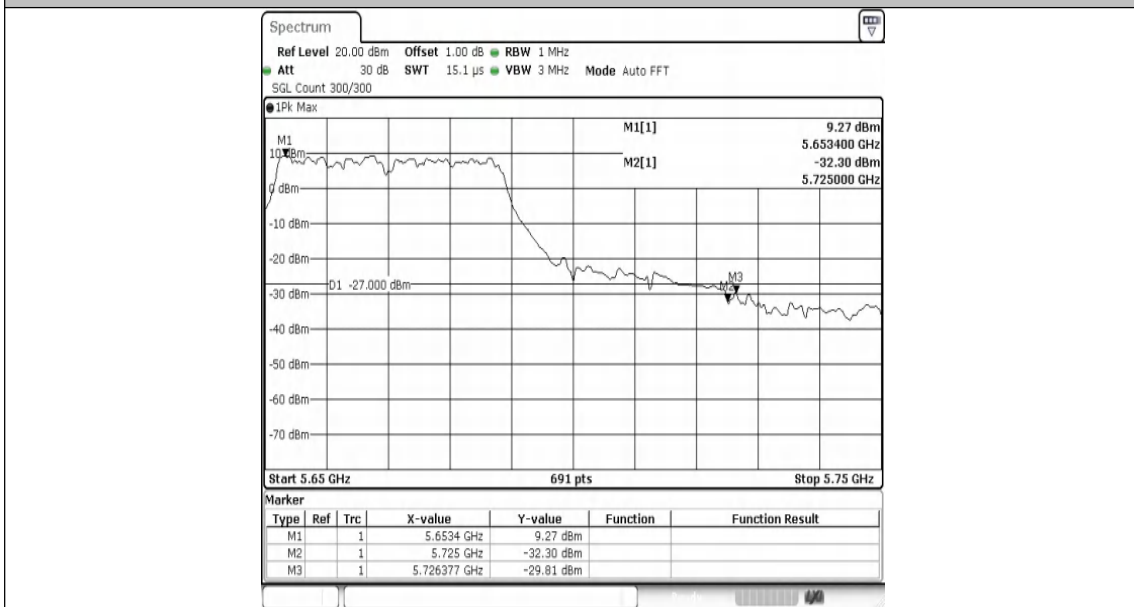

11AC40SISO-Ant1-5670-PASS

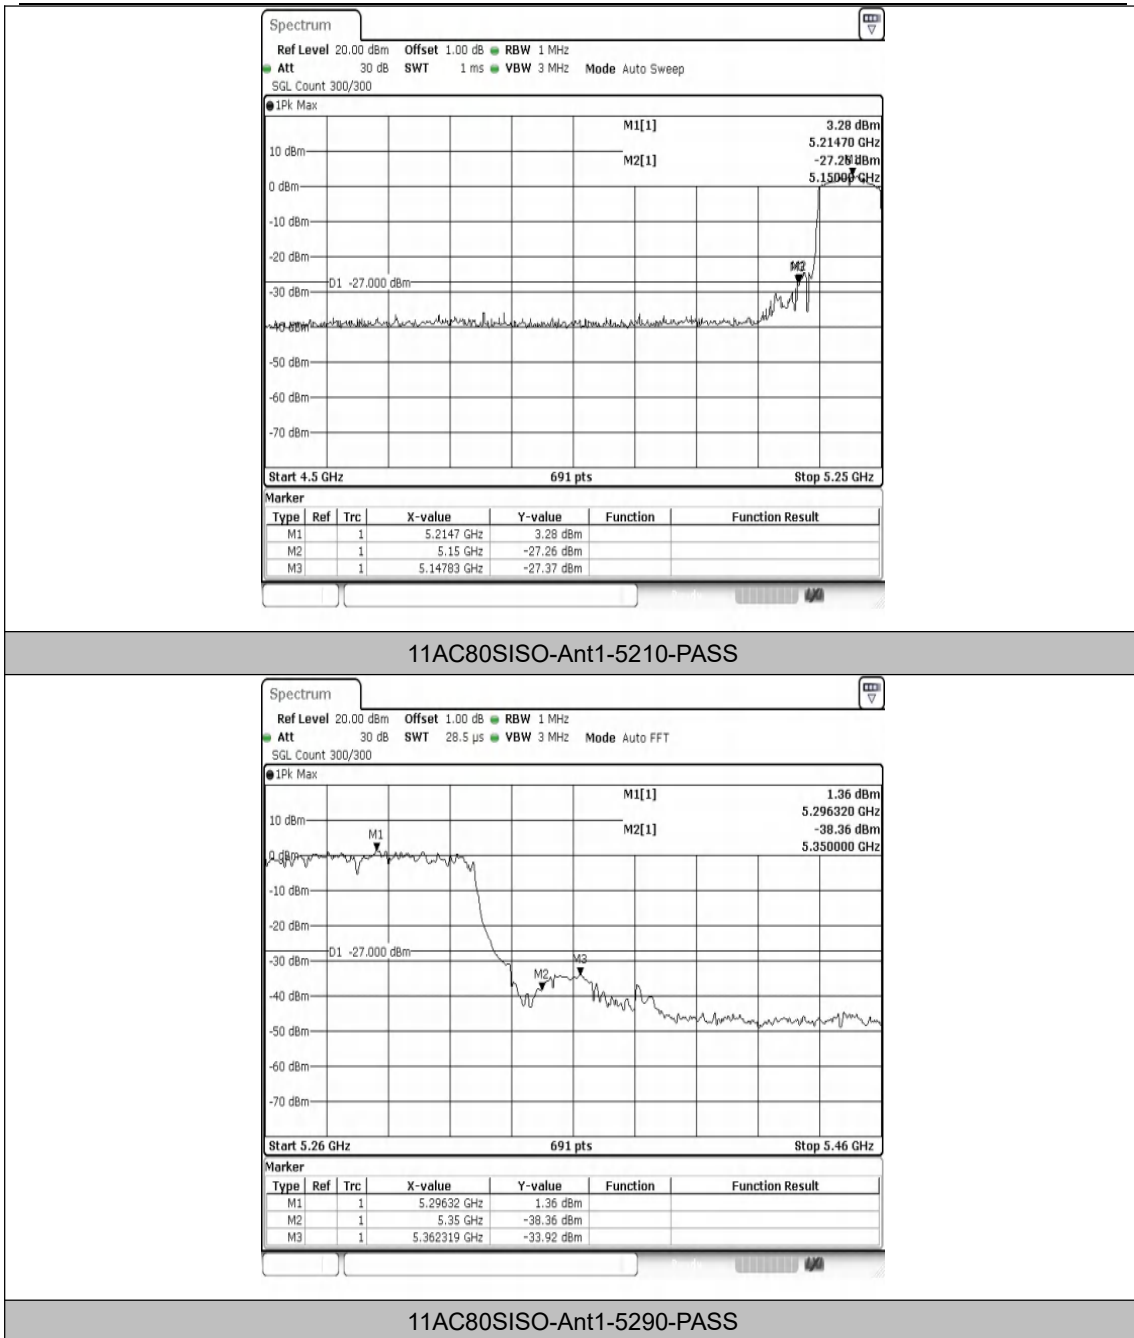

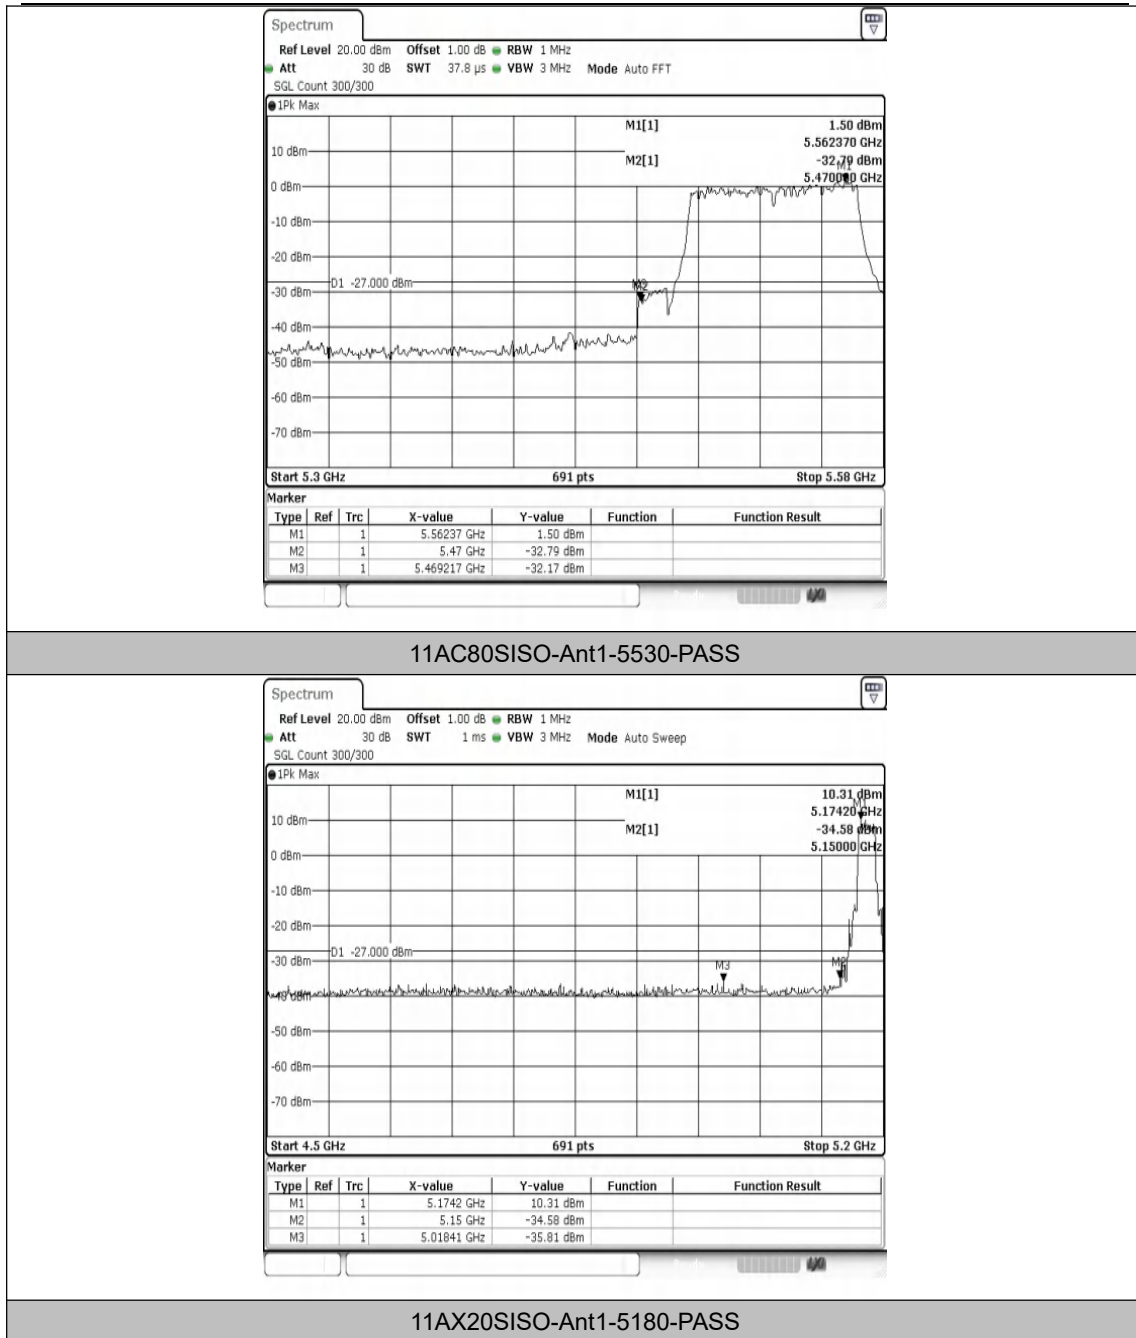


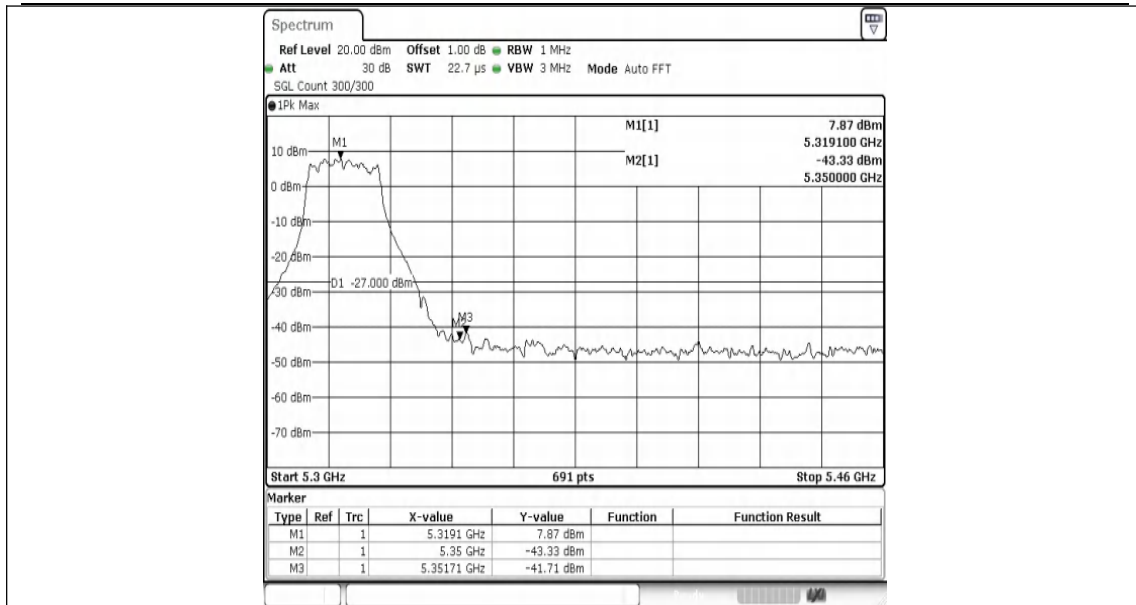


11AX20SISO-Ant1-5320-PASS




11AX20SISO-Ant1-5500-PASS

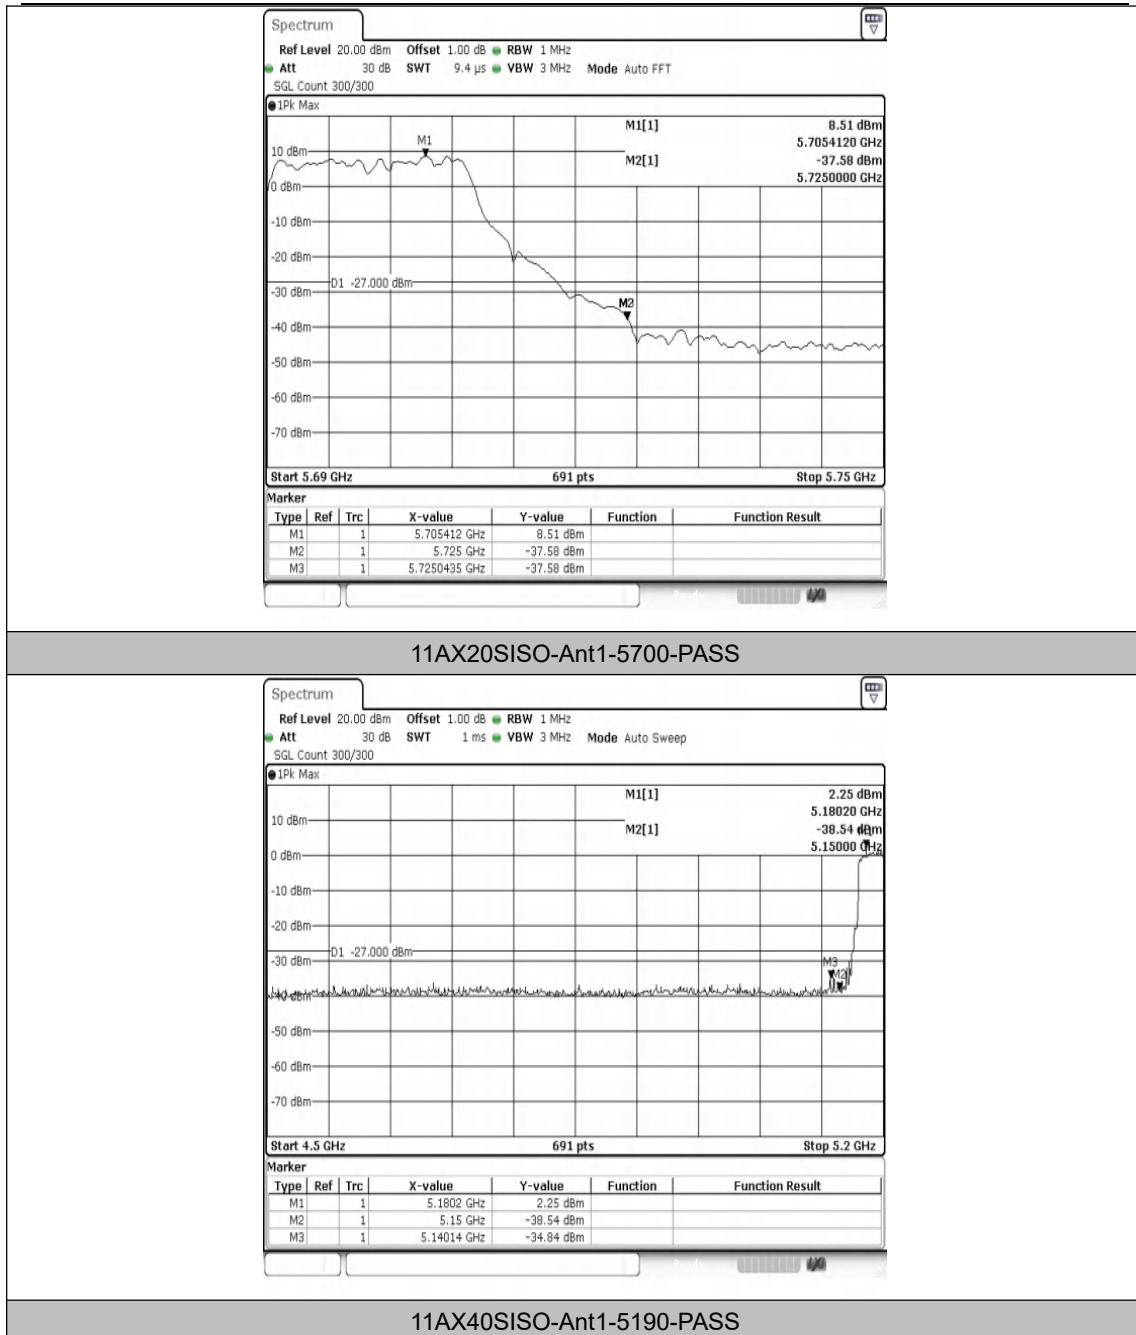


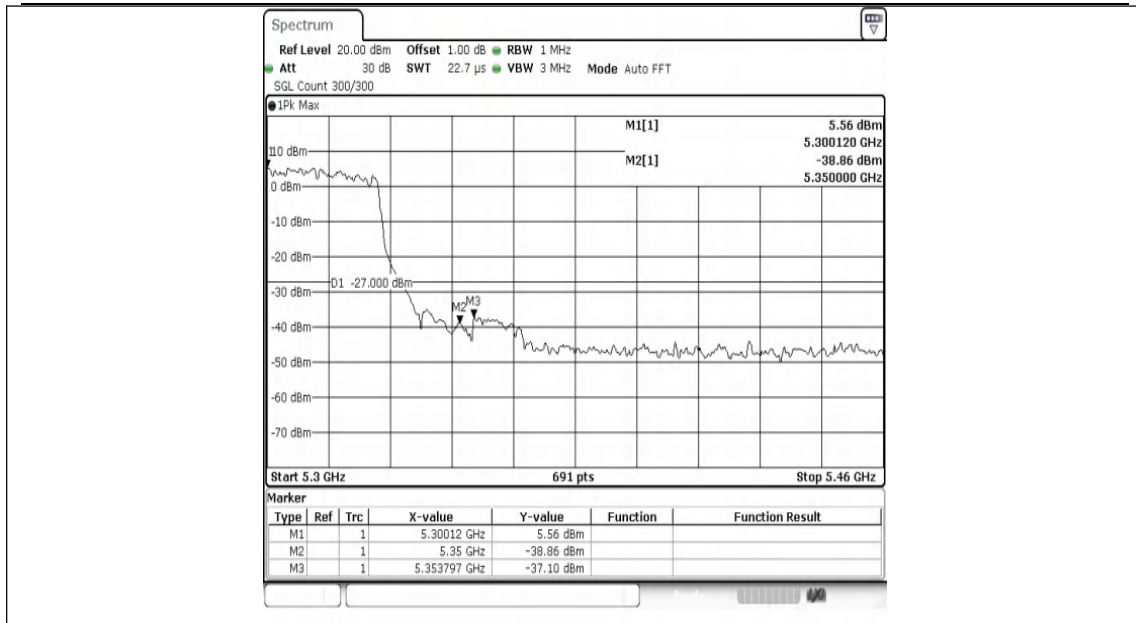


11AX40SISO-Ant1-5310-PASS

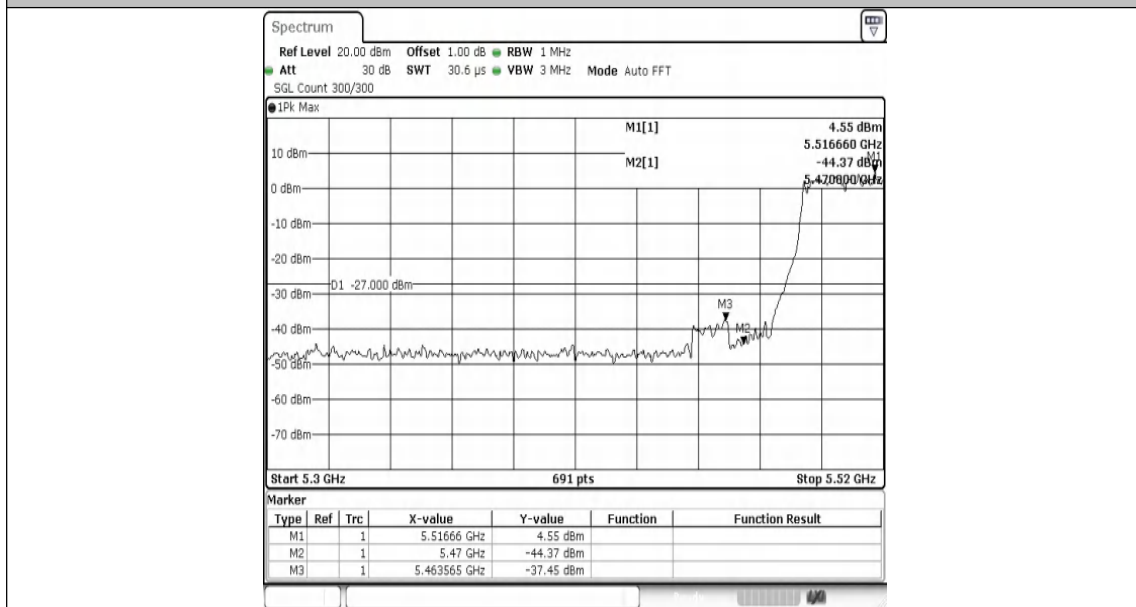

11AX40SISO-Ant1-5510-PASS

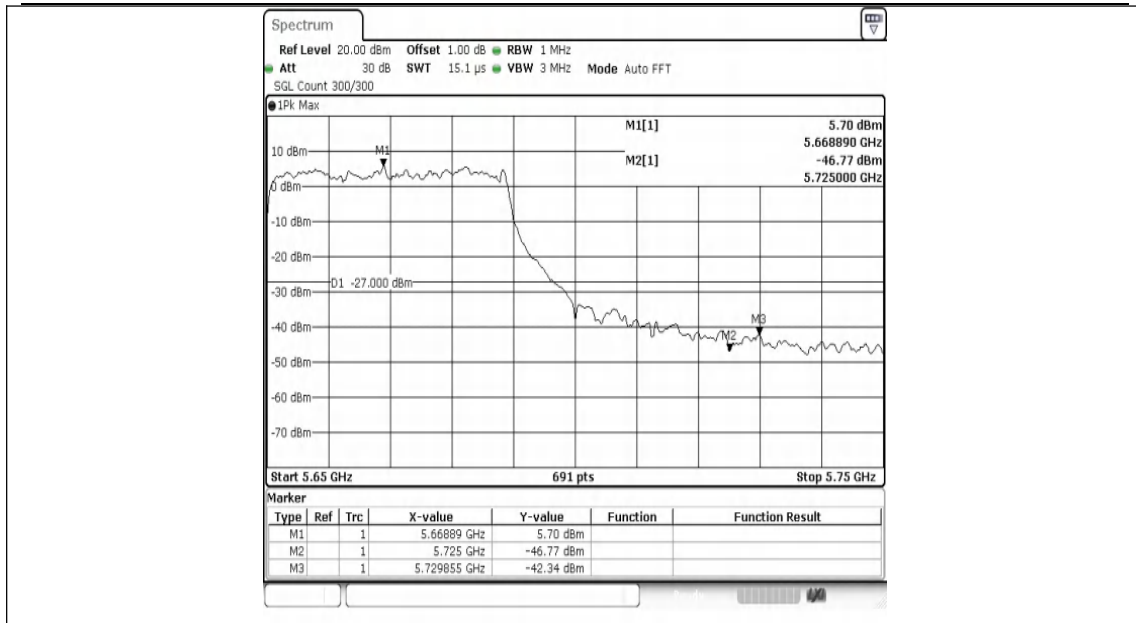


11AX40SISO-Ant1-5670-PASS

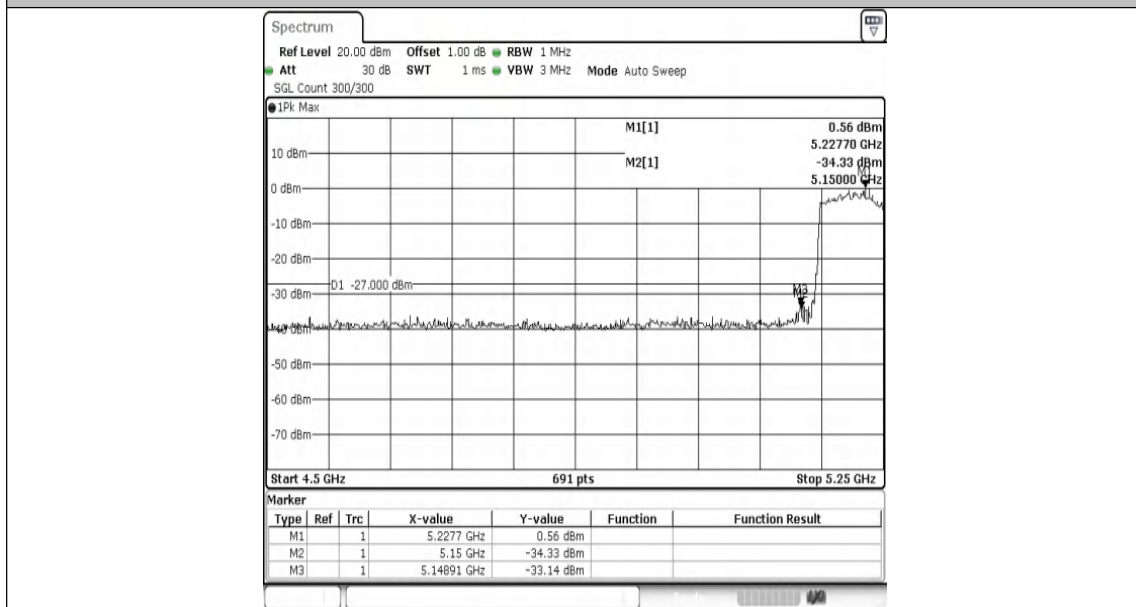

11AX80SISO-Ant1-5210-PASS



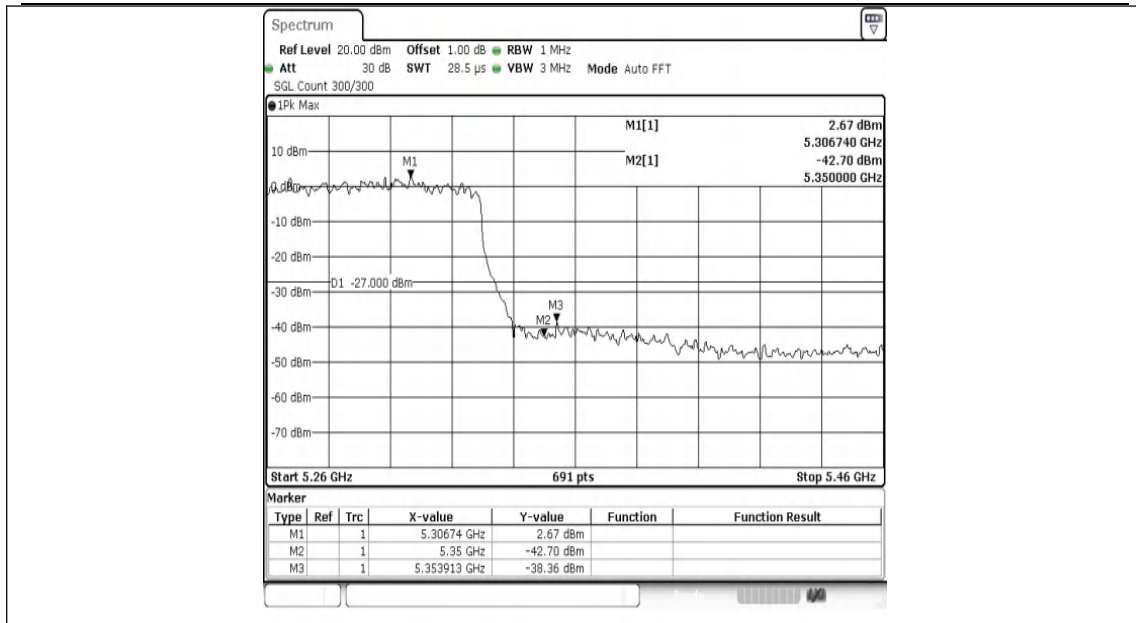



11AX80SISO-Ant1-5290-PASS




11AX80SISO-Ant1-5530-PASS

Test Graphs B4

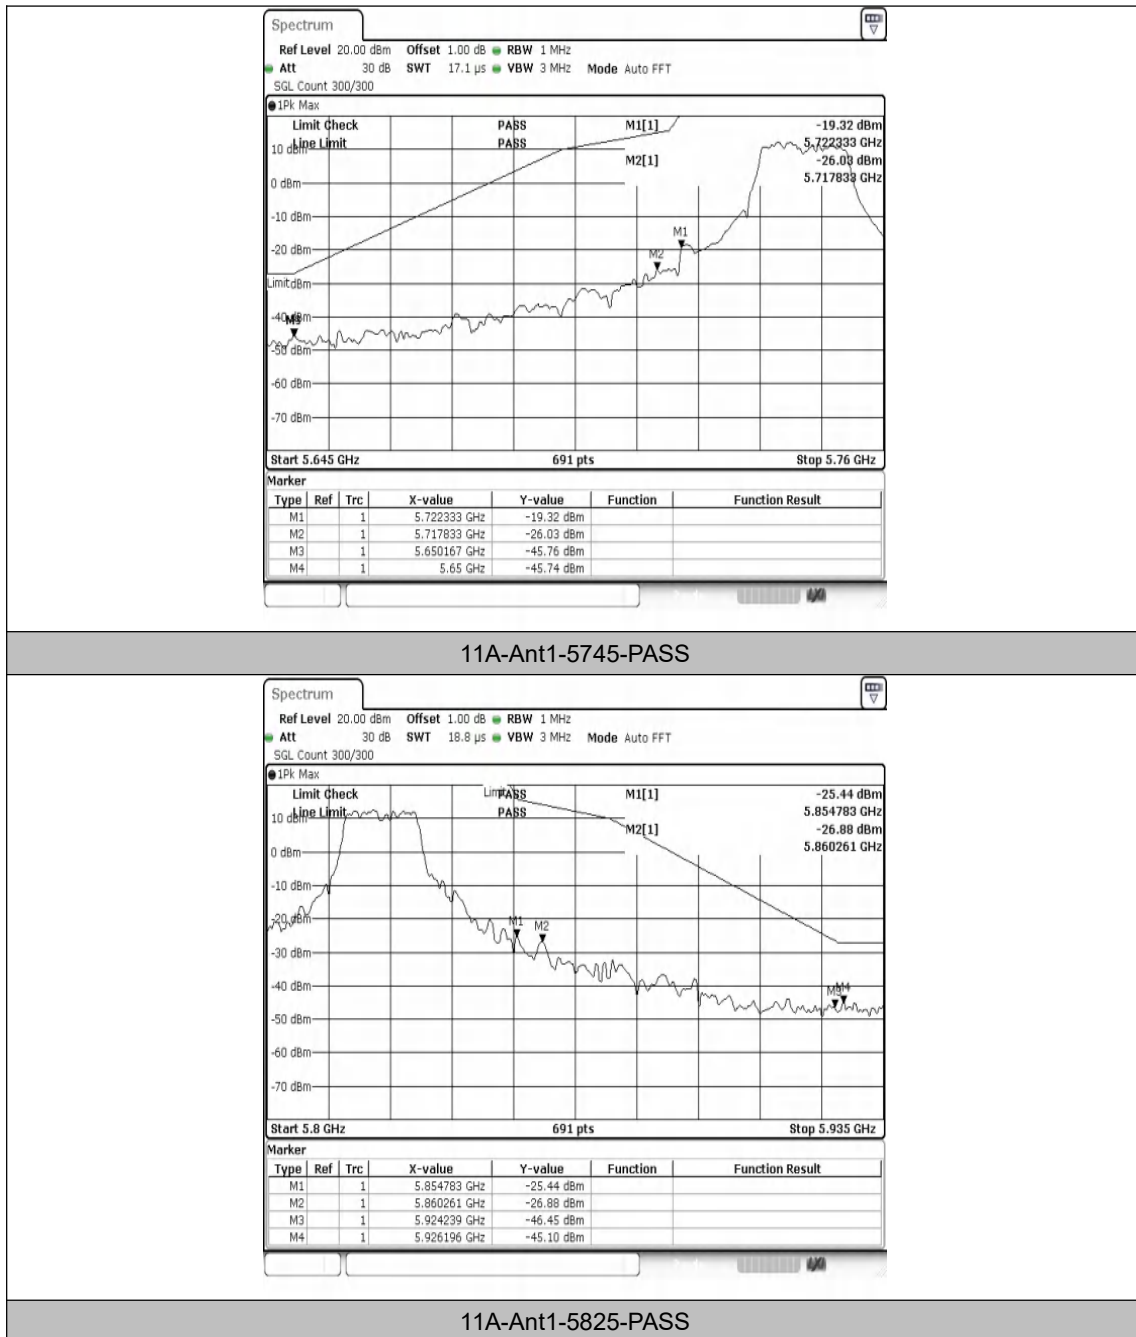


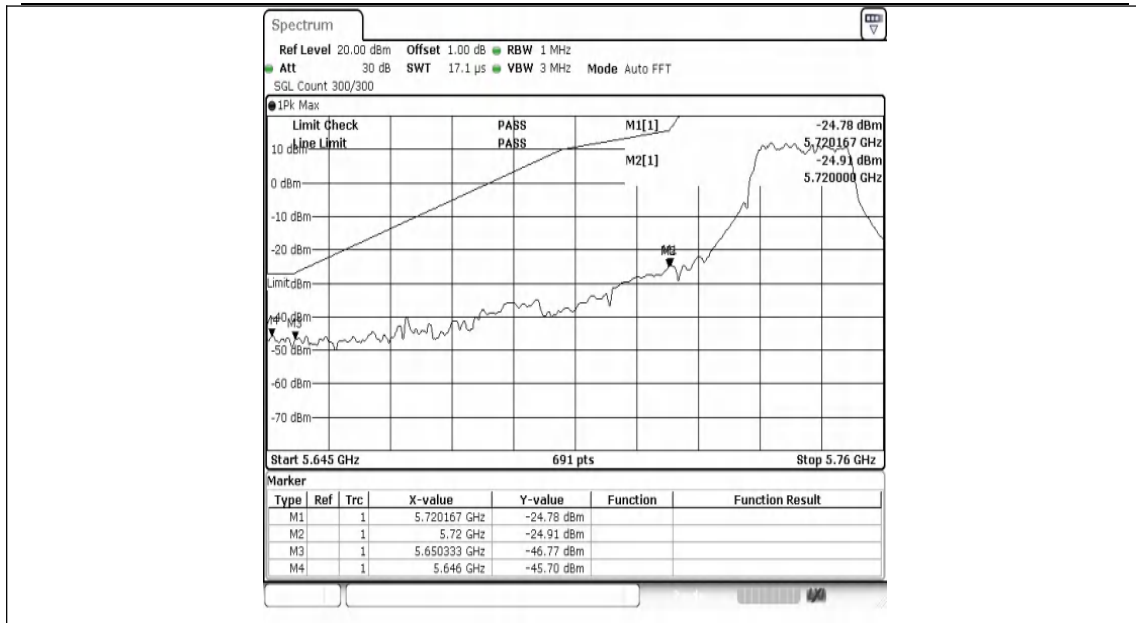


11N20SISO-Ant1-5745-PASS

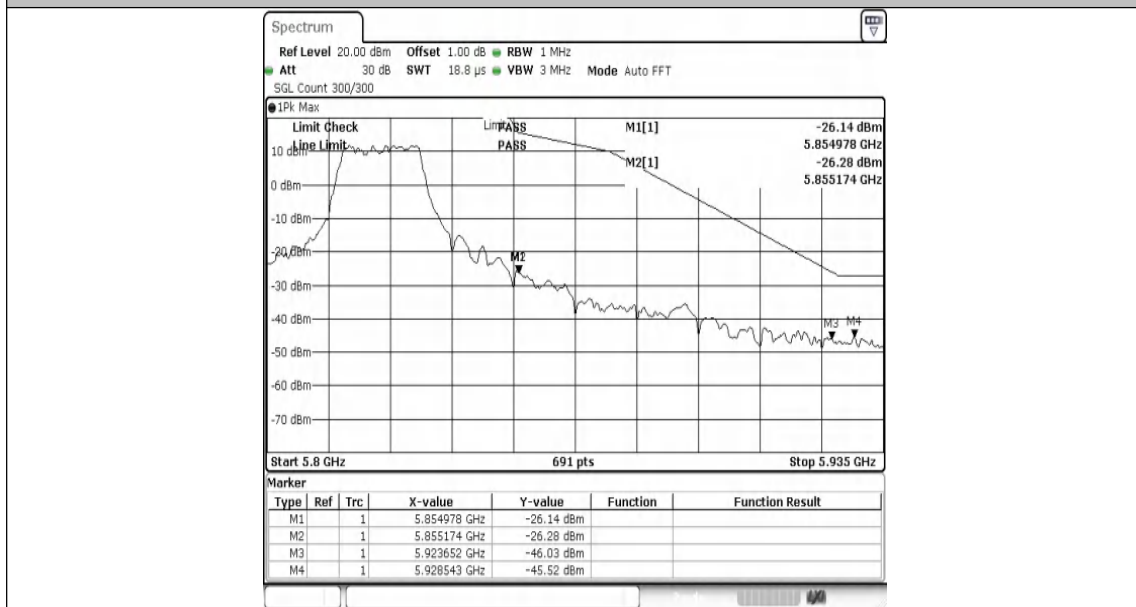


11N20SISO-Ant1-5825-PASS

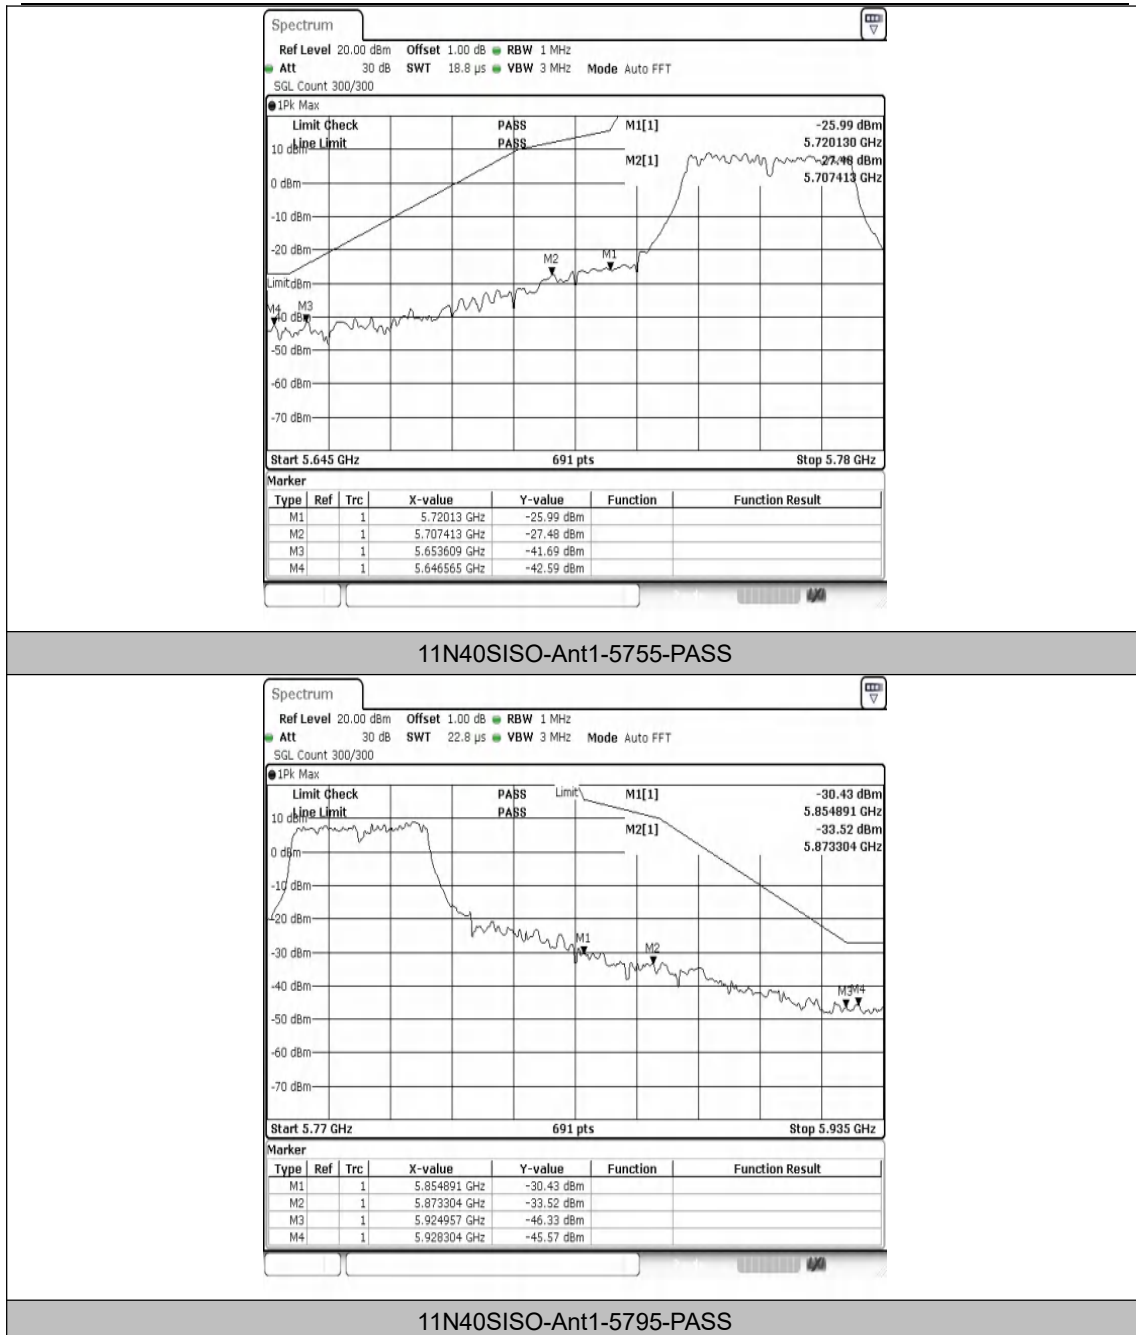


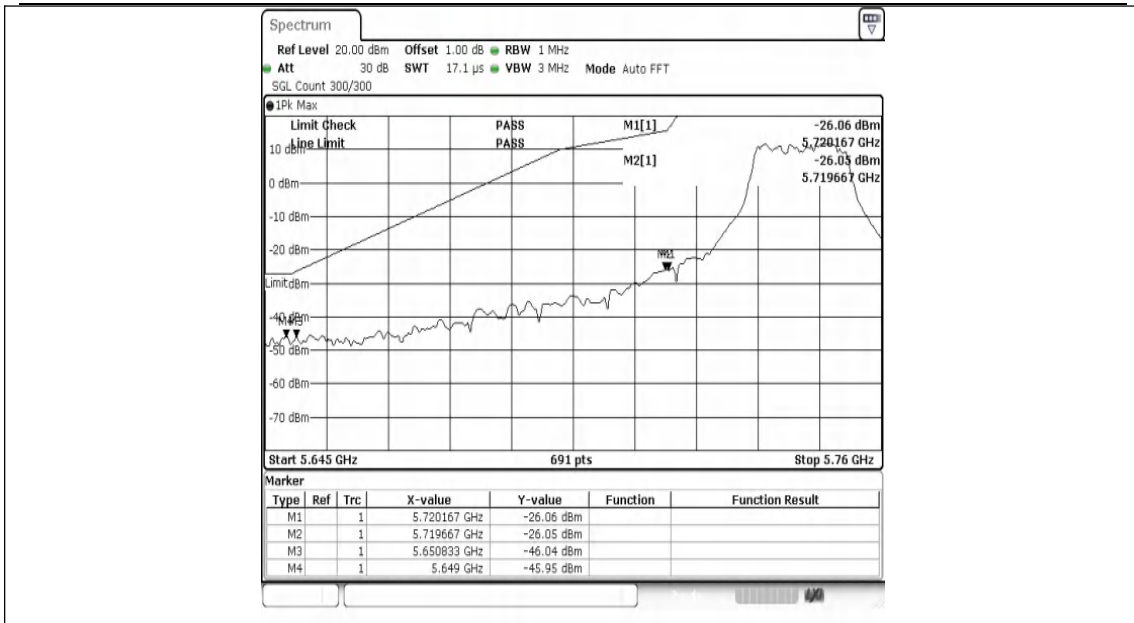


11AC20SISO-Ant1-5745-PASS

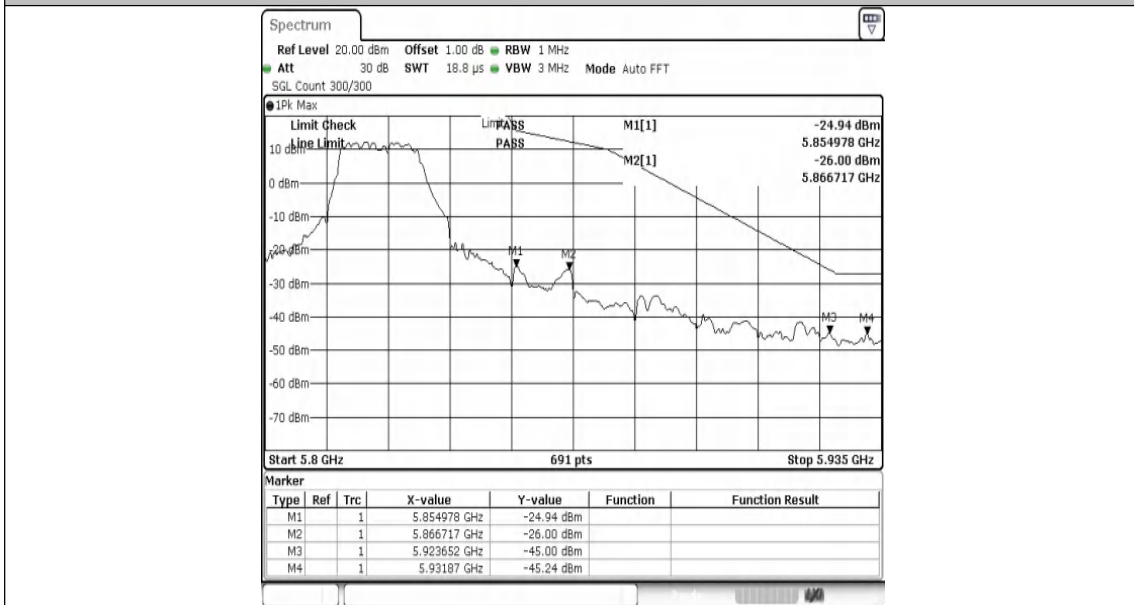


11AC20SISO-Ant1-5825-PASS

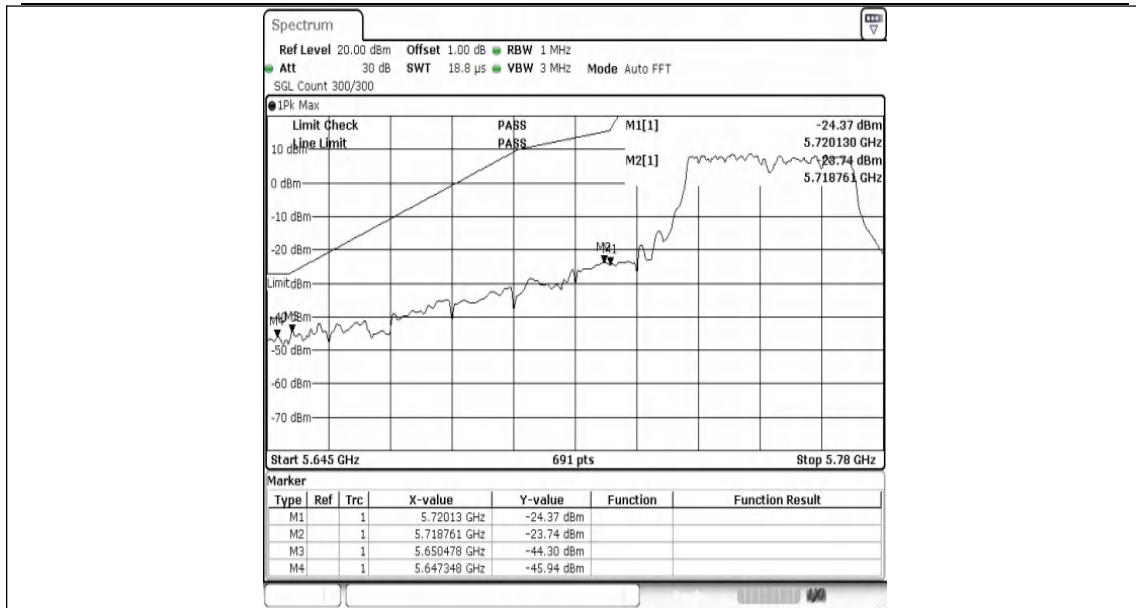


11AC40SISO-Ant1-5755-PASS

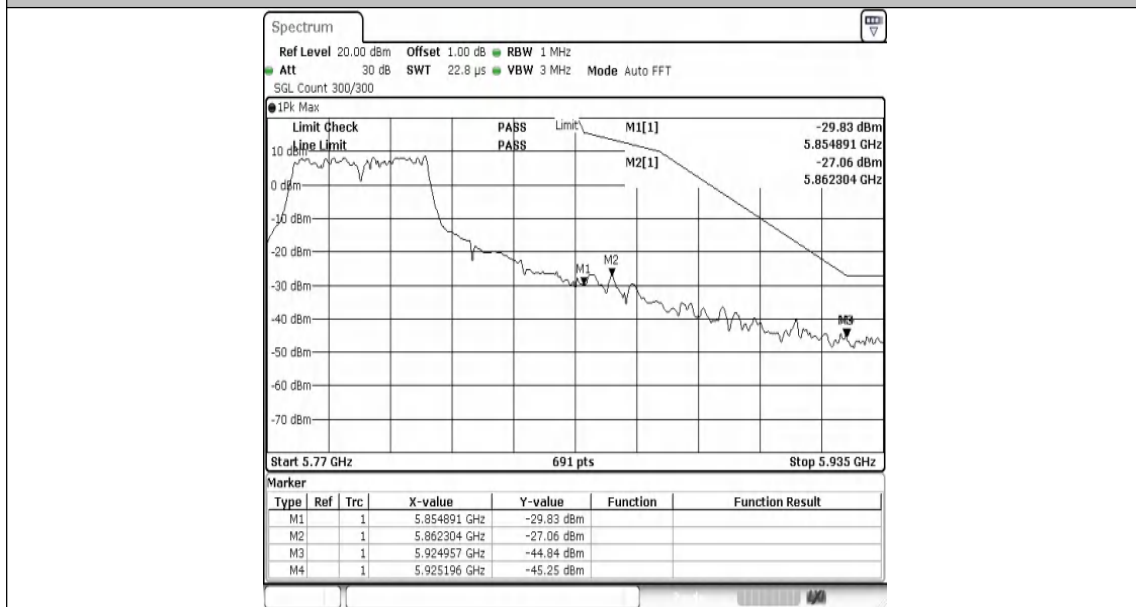


11AC40SISO-Ant1-5795-PASS

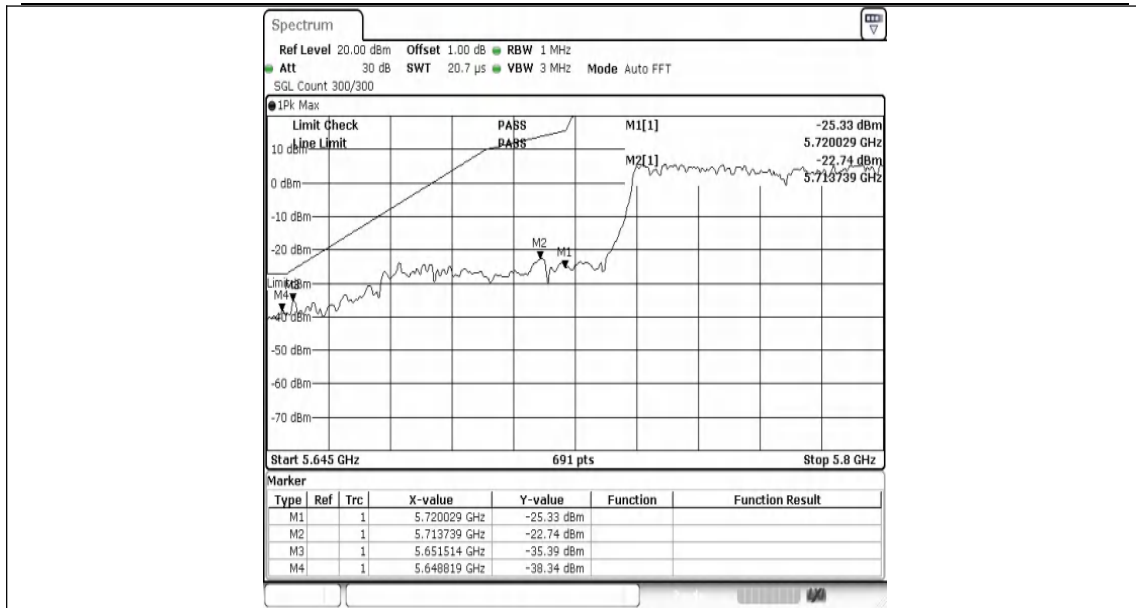


11AC80SISO-Ant1-5775-PASS

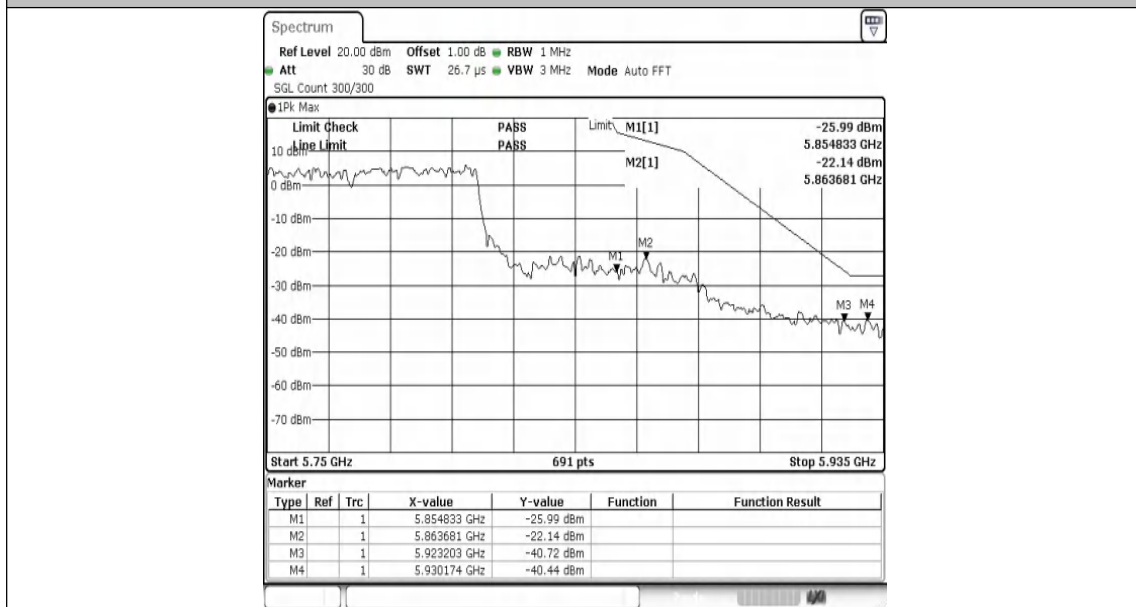


11AC80SISO-Ant1-5775-PASS

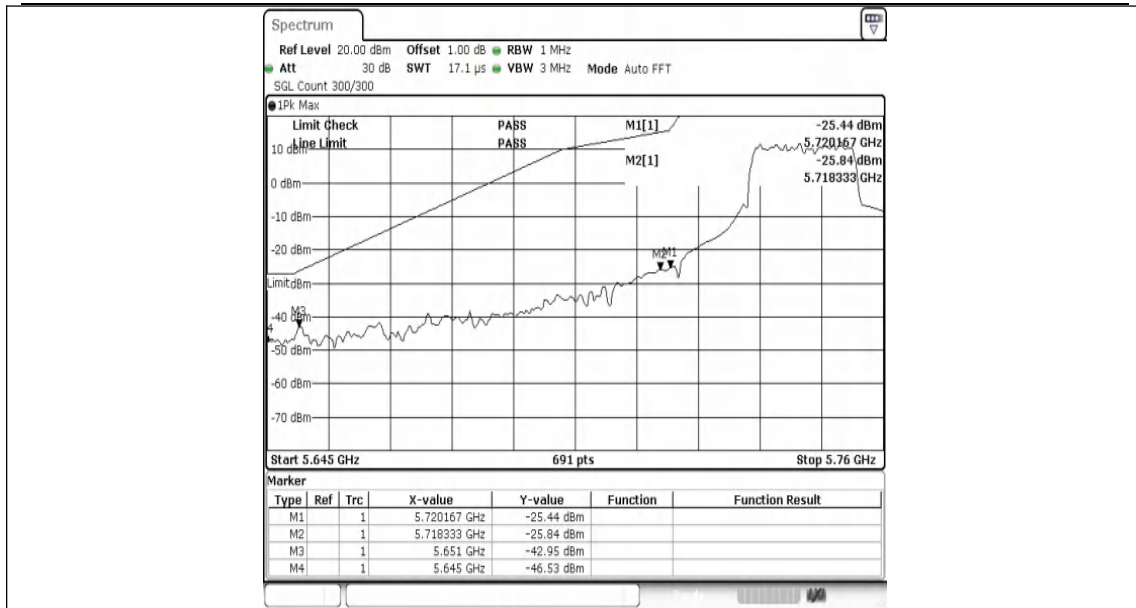


11AX20SISO-Ant1-5745-PASS

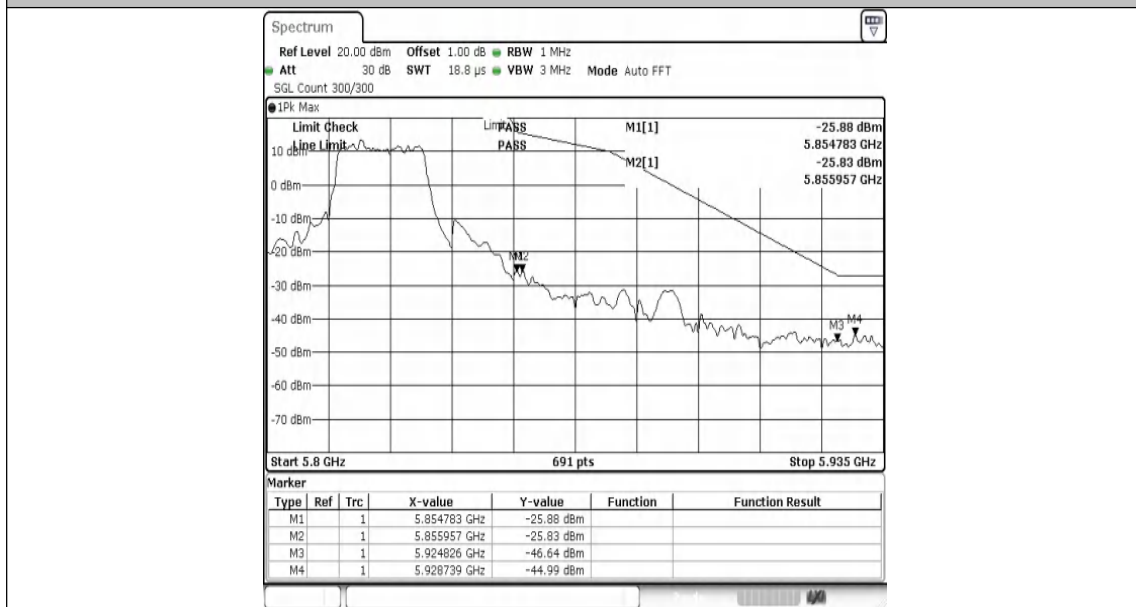


11AX20SISO-Ant1-5825-PASS

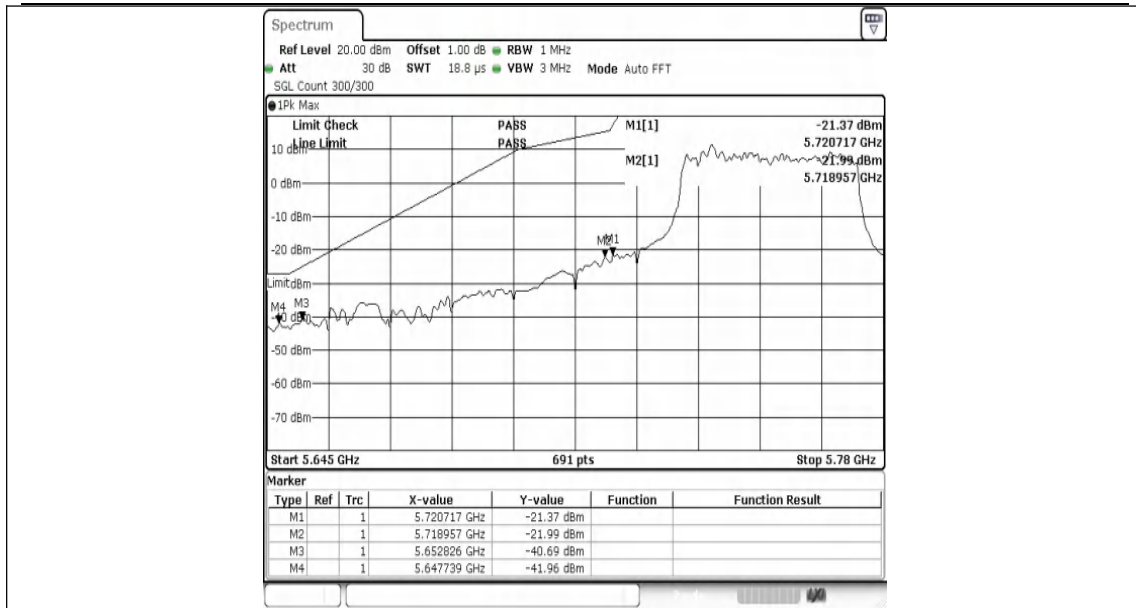


11AX40SISO-Ant1-5755-PASS

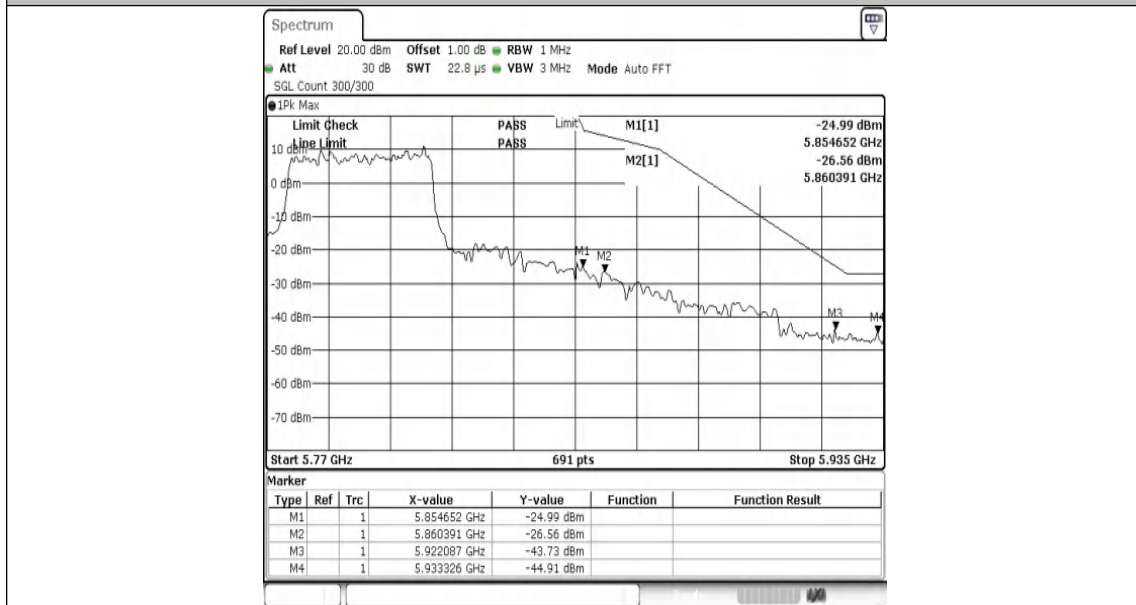

11AX40SISO-Ant1-5795-PASS

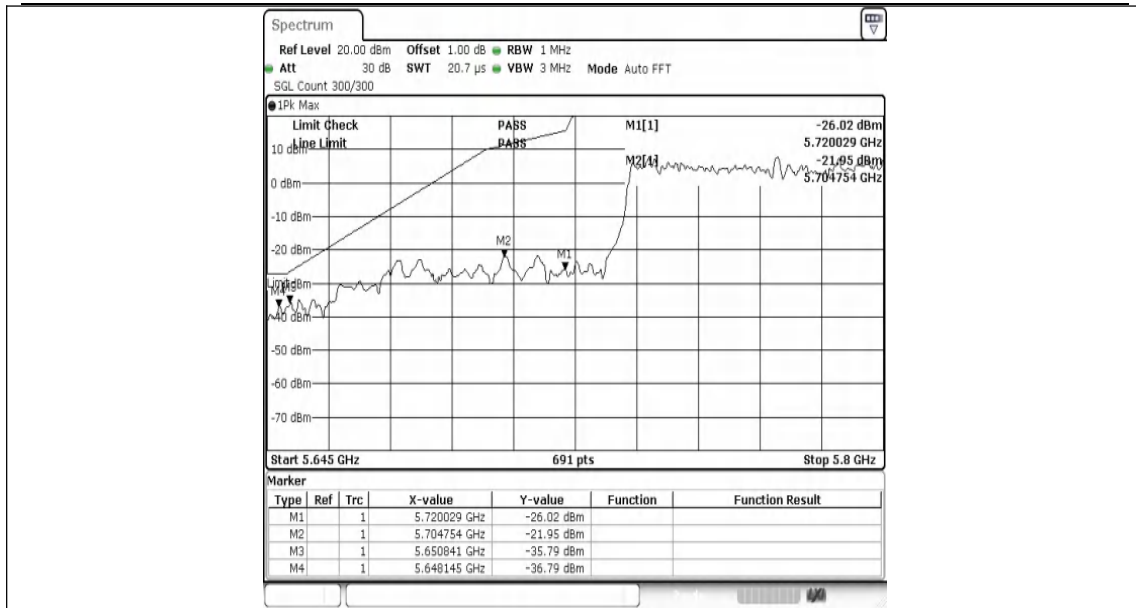

11AX80SiSO-Ant1-5775-PASS

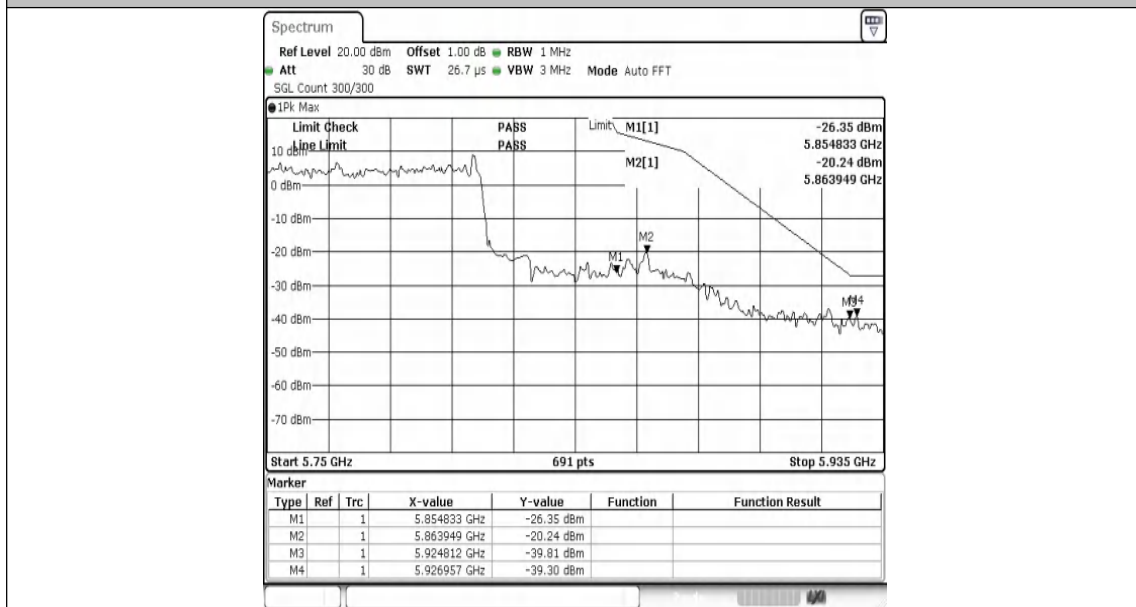


11AX80SiSO-Ant1-5775-PASS

Appendix F: DFS Detection Thresholds

Test Result

TestMode	Frequency[MHz]	Radar Type	Result[dbm]	Limit[dbm]	Verdict
11AX80SISO	5290	Type0	-62.02	-62.00	PASS
	5530	Type0	-62.03	-62.00	PASS

Test Graphs

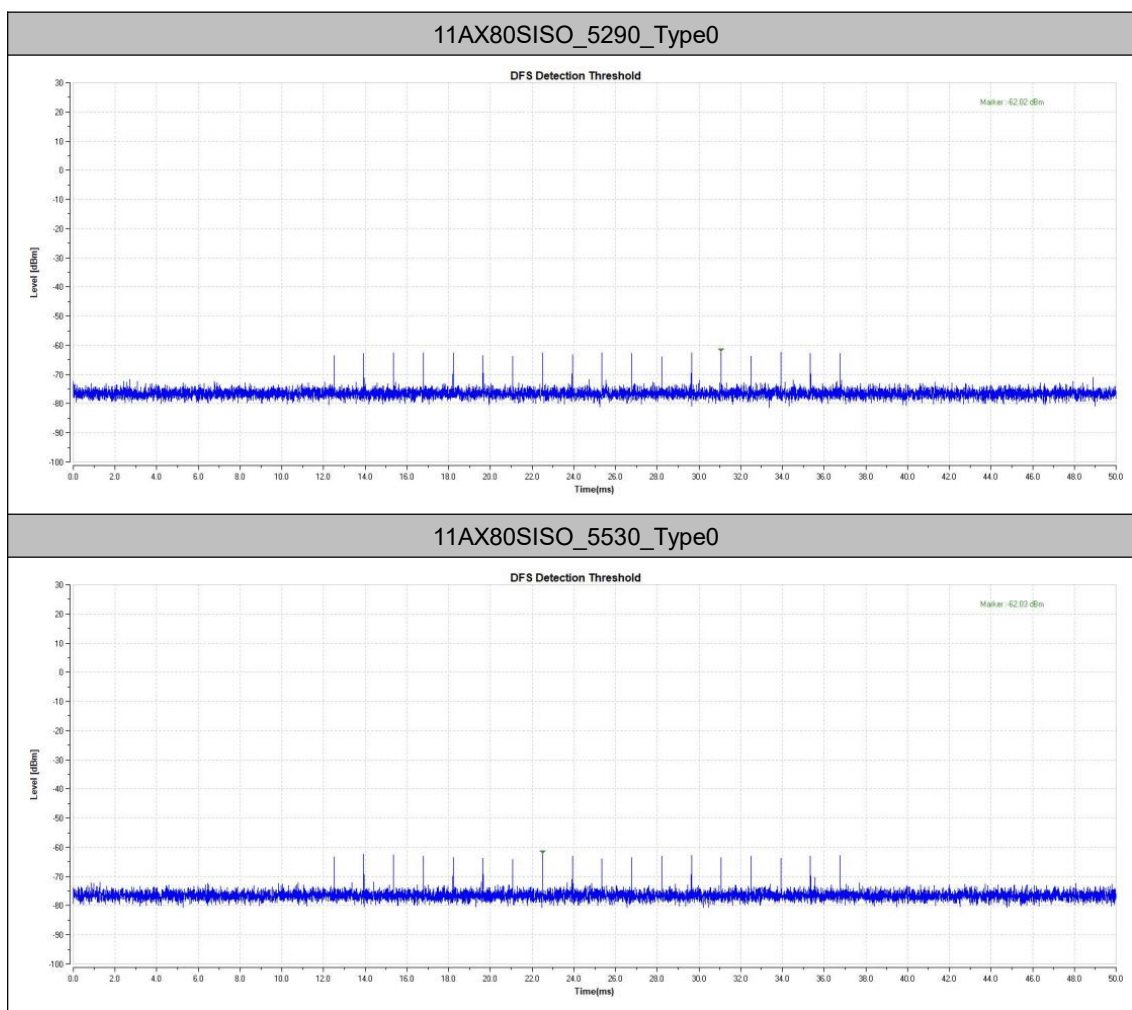


Appendix G: Channel Move Time and Channel Closing

Transmission Time

Test Result

TestMode	Frequency[MHz]	CCT[ms]	Limit[ms]	CMT[ms]	Limit[ms]	Verdict
11AX80SISO	5290	200+13	200+60	494.0	10000	PASS
11AX80SISO	5530	200+6.5	200+60	410.7	10000	PASS

Test Graphs

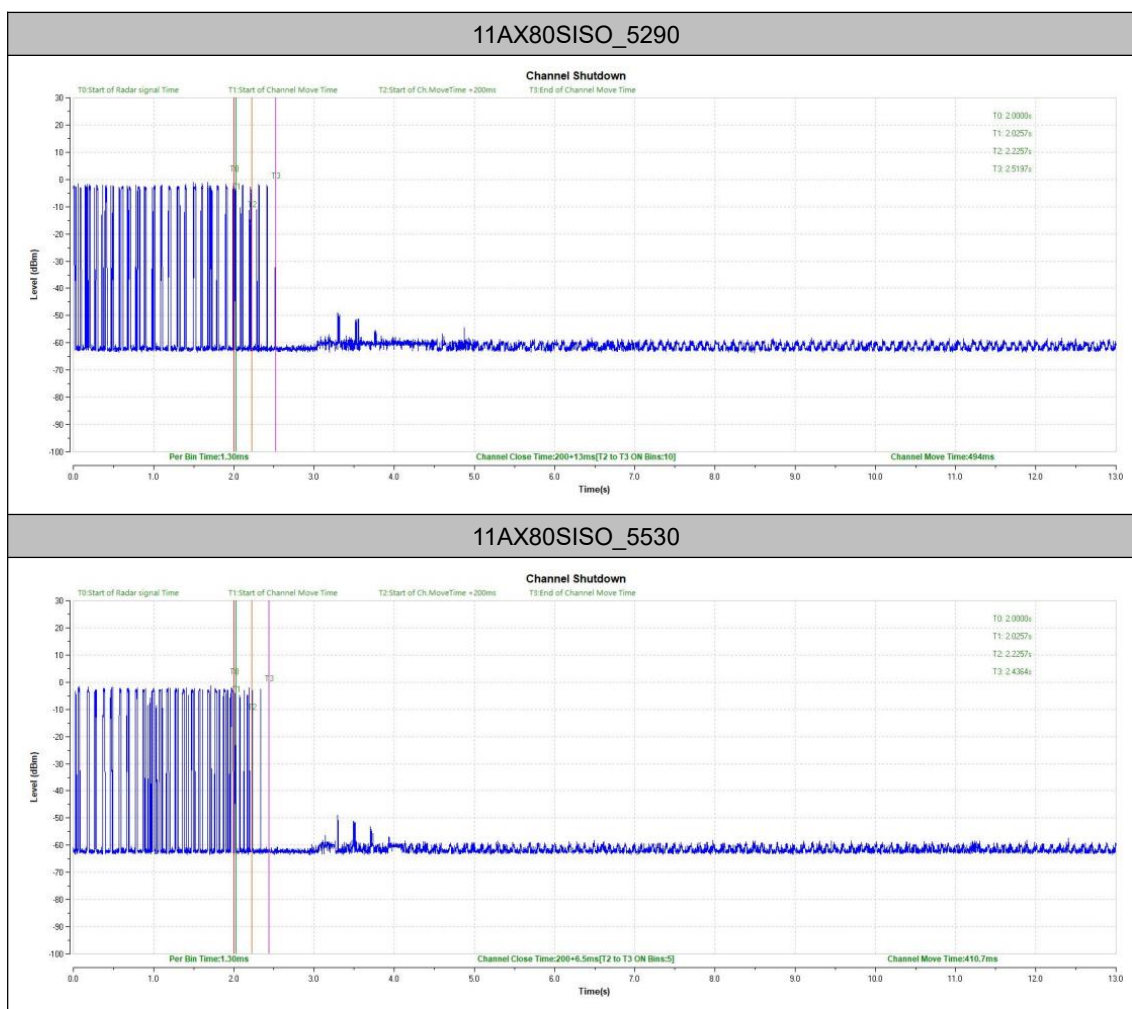

---End---