

Appendix A2: 99% Occupied Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	OCB [MHz]	FL[MHz]	FH[MHz]
11A	Ant1	5180	17.343	5171.4885	5188.8312
11A	Ant1	5200	17.742	5190.7293	5208.4715
11A	Ant1	5240	18.142	5230.9690	5249.1109
11A	Ant1	5260	17.063	5251.6084	5268.6713
11A	Ant1	5280	17.662	5271.0090	5288.6713
11A	Ant1	5320	17.143	5311.2488	5328.3916
11A	Ant1	5500	18.701	5491.2488	5509.9500
11A	Ant1	5580	17.622	5571.5285	5589.1508
11A	Ant1	5700	18.062	5690.9690	5709.0310
11A	Ant1	5745	17.862	5736.4086	5754.2707
11A	Ant1	5785	17.502	5776.2887	5793.7912
11A	Ant1	5825	17.183	5816.4486	5833.6314
11N20SISO	Ant1	5180	17.982	5171.0889	5189.0709
11N20SISO	Ant1	5200	19.141	5190.3696	5209.5105
11N20SISO	Ant1	5240	18.142	5230.9690	5249.1109
11N20SISO	Ant1	5260	19.021	5250.0899	5269.1109
11N20SISO	Ant1	5280	18.462	5271.0490	5289.5105
11N20SISO	Ant1	5320	18.941	5310.4895	5329.4306
11N20SISO	Ant1	5500	19.101	5490.6094	5509.7103
11N20SISO	Ant1	5580	19.381	5569.8901	5589.2707
11N20SISO	Ant1	5700	18.901	5690.7692	5709.6703
11N20SISO	Ant1	5745	20.02	5735.0899	5755.1099
11N20SISO	Ant1	5785	19.461	5775.3297	5794.7902
11N20SISO	Ant1	5825	18.382	5815.9291	5834.3107
11N40SISO	Ant1	5190	36.603	5171.6184	5208.2218
11N40SISO	Ant1	5230	36.763	5211.7782	5248.5415
11N40SISO	Ant1	5270	36.923	5251.6983	5288.6214
11N40SISO	Ant1	5310	36.923	5291.7782	5328.7013
11N40SISO	Ant1	5510	37.403	5491.3786	5528.7812
11N40SISO	Ant1	5550	37.163	5531.2987	5568.4615
11N40SISO	Ant1	5670	36.923	5651.5385	5688.4615
11N40SISO	Ant1	5755	36.923	5736.4585	5773.3816
11N40SISO	Ant1	5795	37.802	5776.4585	5814.2607
11AC20SISO	Ant1	5180	18.941	5170.6494	5189.5904
11AC20SISO	Ant1	5200	18.901	5190.4496	5209.3506
11AC20SISO	Ant1	5240	18.621	5230.9690	5249.5904
11AC20SISO	Ant1	5260	19.421	5250.5694	5269.9900
11AC20SISO	Ant1	5280	18.422	5270.8092	5289.2308

11AC20SISO	Ant1	5320	19.021	5310.3696	5329.3906
11AC20SISO	Ant1	5500	20.819	5490.4096	5511.2288
11AC20SISO	Ant1	5580	18.781	5570.7293	5589.5105
11AC20SISO	Ant1	5700	19.341	5690.6494	5709.9900
11AC20SISO	Ant1	5745	18.462	5735.6094	5754.0709
11AC20SISO	Ant1	5785	18.462	5775.6094	5794.0709
11AC20SISO	Ant1	5825	19.341	5815.7293	5835.0699
11AC40SISO	Ant1	5190	37.163	5171.2188	5208.3816
11AC40SISO	Ant1	5230	36.603	5211.6983	5248.3017
11AC40SISO	Ant1	5270	36.364	5251.7782	5288.1419
11AC40SISO	Ant1	5310	37.163	5291.5385	5328.7013
11AC40SISO	Ant1	5510	36.683	5491.6983	5528.3816
11AC40SISO	Ant1	5550	37.003	5531.3786	5568.3816
11AC40SISO	Ant1	5670	36.923	5651.2987	5688.2218
11AC40SISO	Ant1	5755	36.923	5736.4585	5773.3816
11AC40SISO	Ant1	5795	36.843	5776.5385	5813.3816
11AC80SISO	Ant1	5210	76.244	5171.6384	5247.8821
11AC80SISO	Ant1	5290	76.563	5251.7982	5328.3616
11AC80SISO	Ant1	5530	76.244	5492.1179	5568.3616
11AC80SISO	Ant1	5610	76.723	5571.6384	5648.3616
11AC80SISO	Ant1	5775	76.723	5736.7982	5813.5215
11AX20SISO	Ant1	5180	19.021	5170.5295	5189.5504
11AX20SISO	Ant1	5200	19.061	5190.4895	5209.5504
11AX20SISO	Ant1	5240	18.981	5230.5295	5249.5105
11AX20SISO	Ant1	5260	19.101	5250.4895	5269.5904
11AX20SISO	Ant1	5280	19.461	5270.4096	5289.8701
11AX20SISO	Ant1	5320	19.301	5310.4496	5329.7502
11AX20SISO	Ant1	5500	19.061	5490.4496	5509.5105
11AX20SISO	Ant1	5580	19.181	5570.3696	5589.5504
11AX20SISO	Ant1	5700	19.261	5690.3696	5709.6304
11AX20SISO	Ant1	5745	19.461	5735.2098	5754.6703
11AX20SISO	Ant1	5785	19.7	5775.3297	5795.0300
11AX20SISO	Ant1	5825	19.061	5815.5694	5834.6304
11AX40SISO	Ant1	5190	37.962	5170.9790	5208.9411
11AX40SISO	Ant1	5230	38.042	5210.9790	5249.0210
11AX40SISO	Ant1	5270	38.122	5250.8991	5289.0210
11AX40SISO	Ant1	5310	37.722	5290.9790	5328.7013
11AX40SISO	Ant1	5510	38.122	5491.0589	5529.1808
11AX40SISO	Ant1	5550	38.282	5530.8991	5569.1808
11AX40SISO	Ant1	5670	38.362	5650.9790	5689.3407
11AX40SISO	Ant1	5755	38.122	5735.9790	5774.1009
11AX40SISO	Ant1	5795	38.122	5775.9790	5814.1009

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotech.com



Hotline
400-003-0500
www.anbotech.com

11AX80SISO	Ant1	5210	78.002	5170.9990	5249.0010
11AX80SISO	Ant1	5290	77.363	5251.1588	5328.5215
11AX80SISO	Ant1	5530	77.842	5491.3187	5569.1608
11AX80SISO	Ant1	5610	77.842	5571.1588	5649.0010
11AX80SISO	Ant1	5775	78.002	5735.9990	5814.0010


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com


Test Graphs

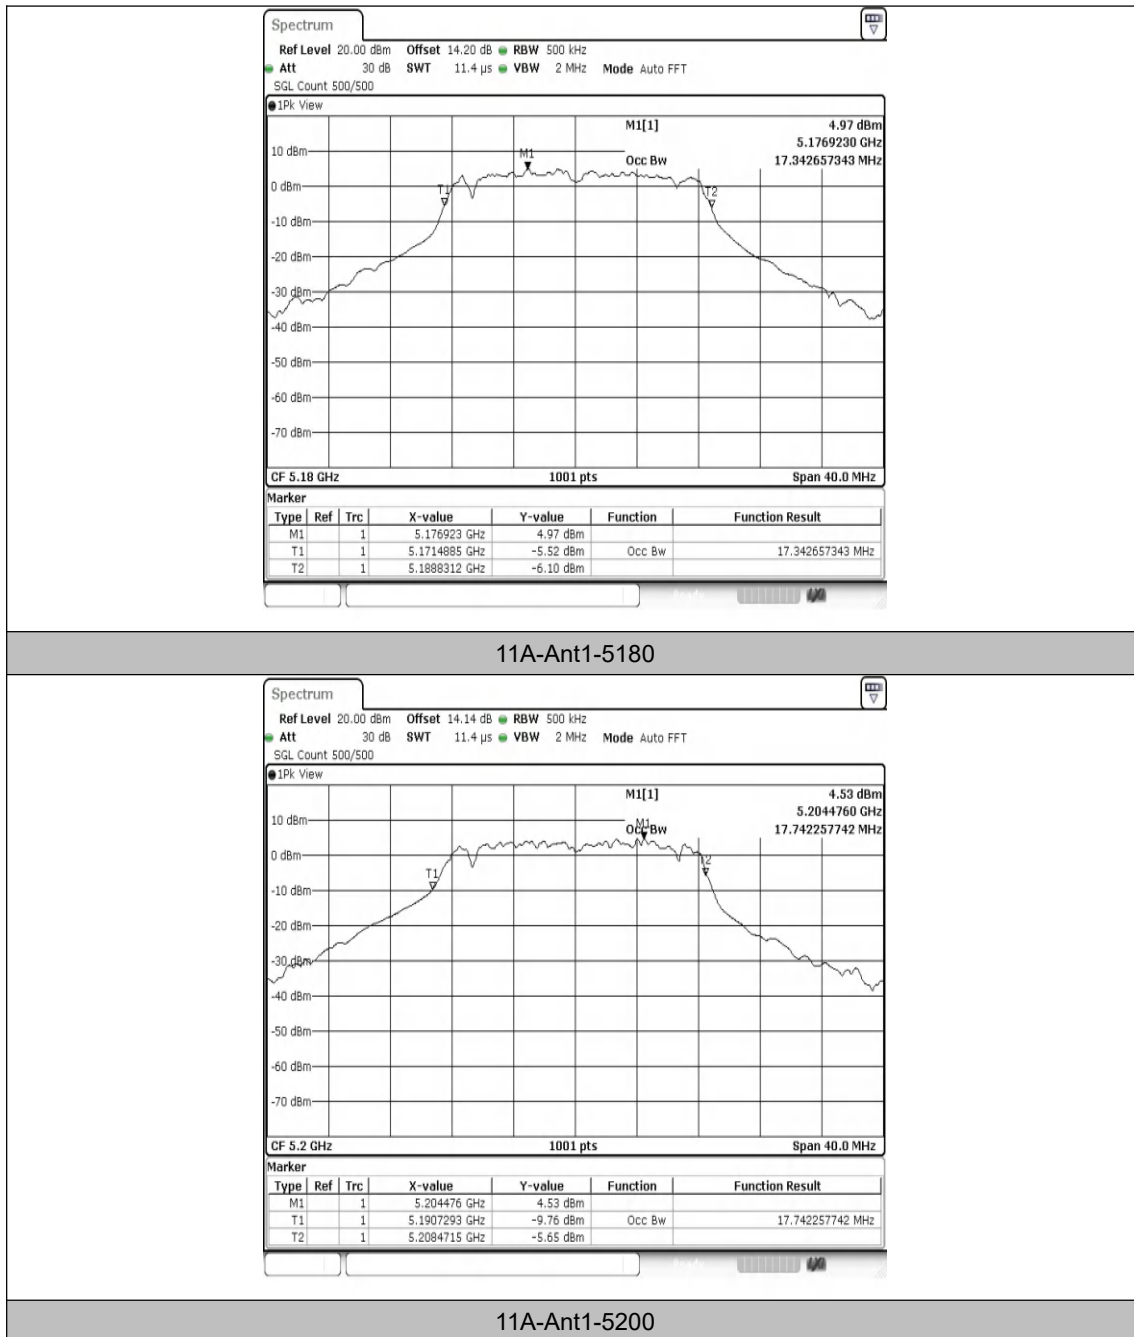


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

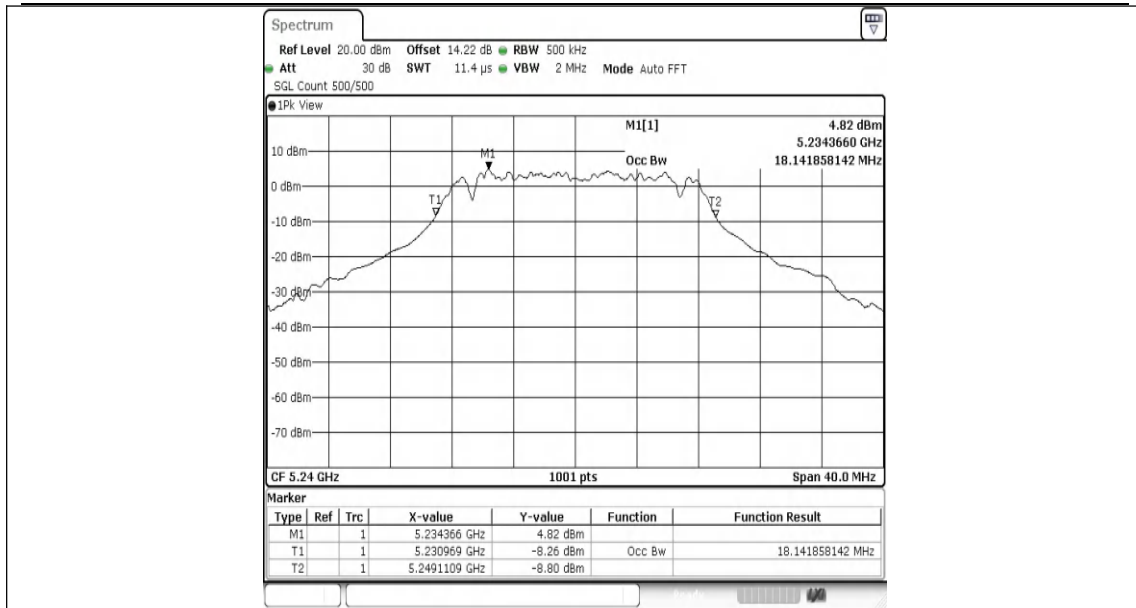


11A-Ant1-5240

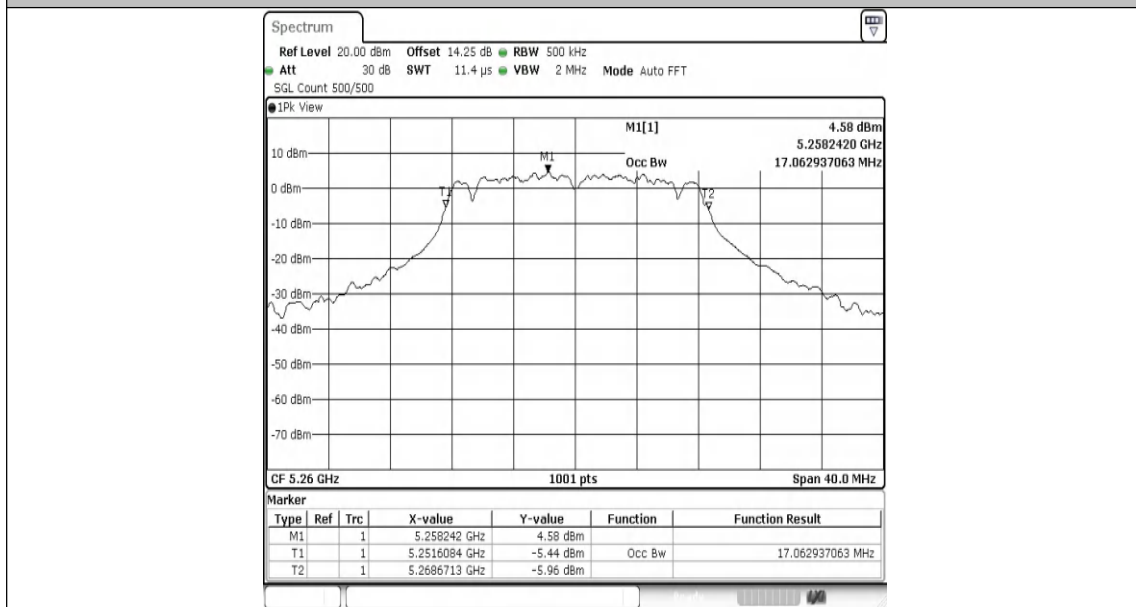


11A-Ant1-5260

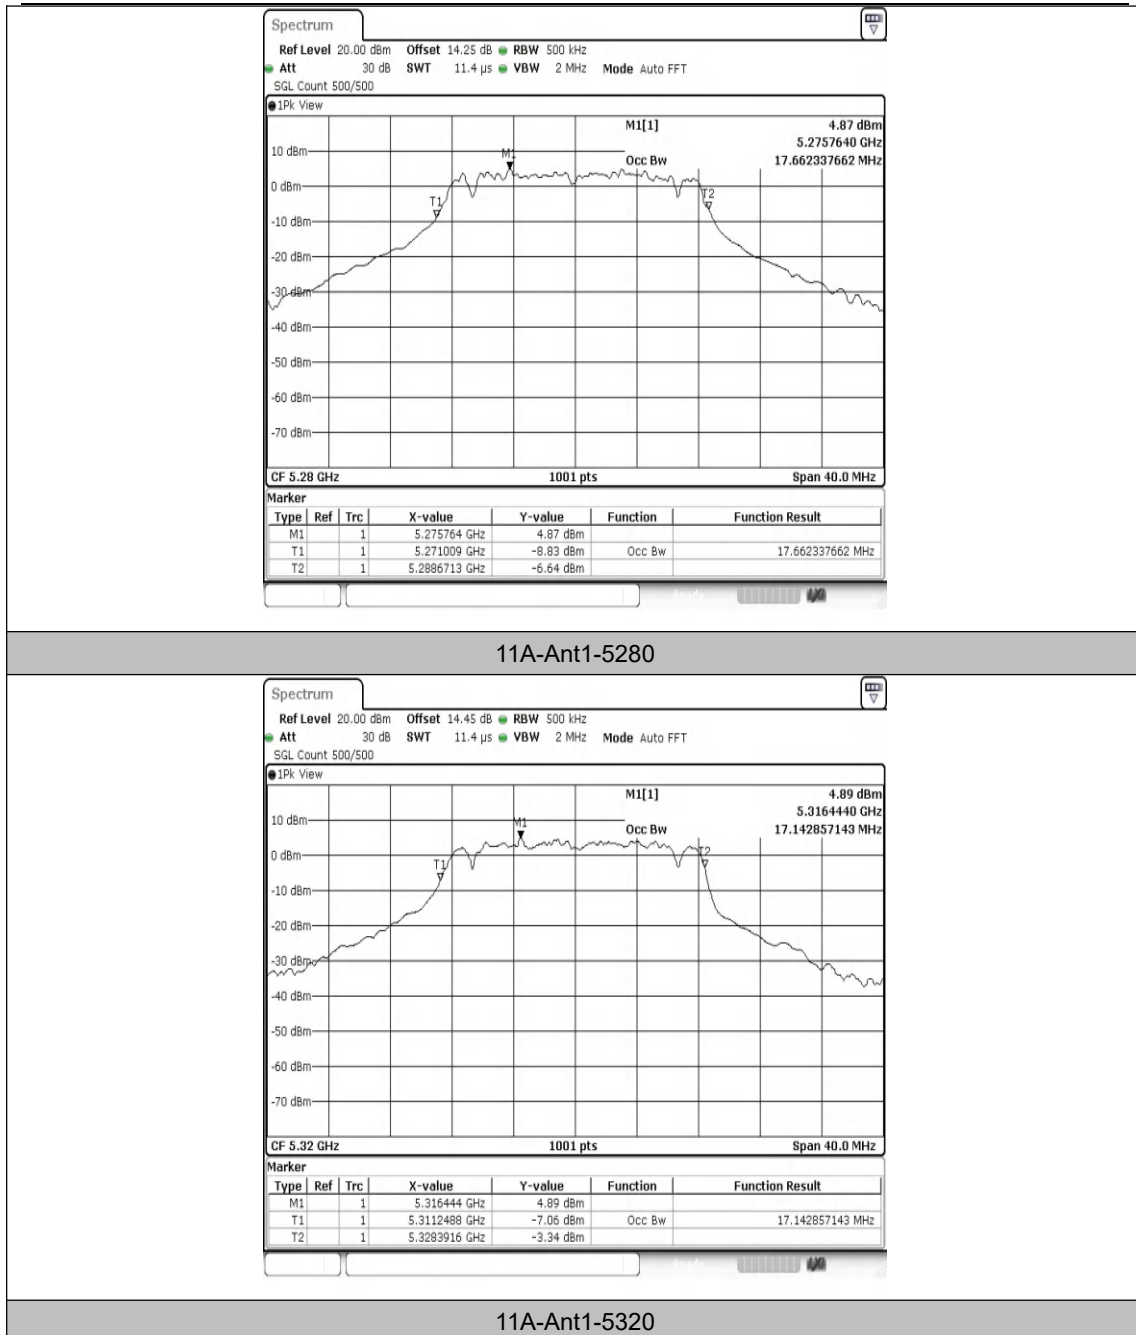


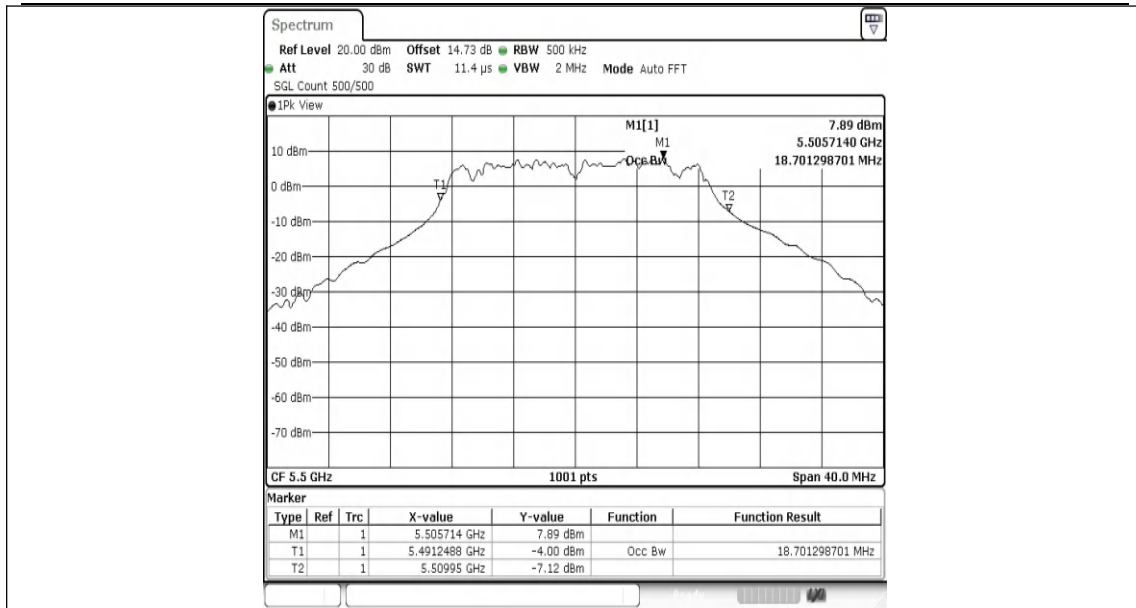



11A-Ant1-5500

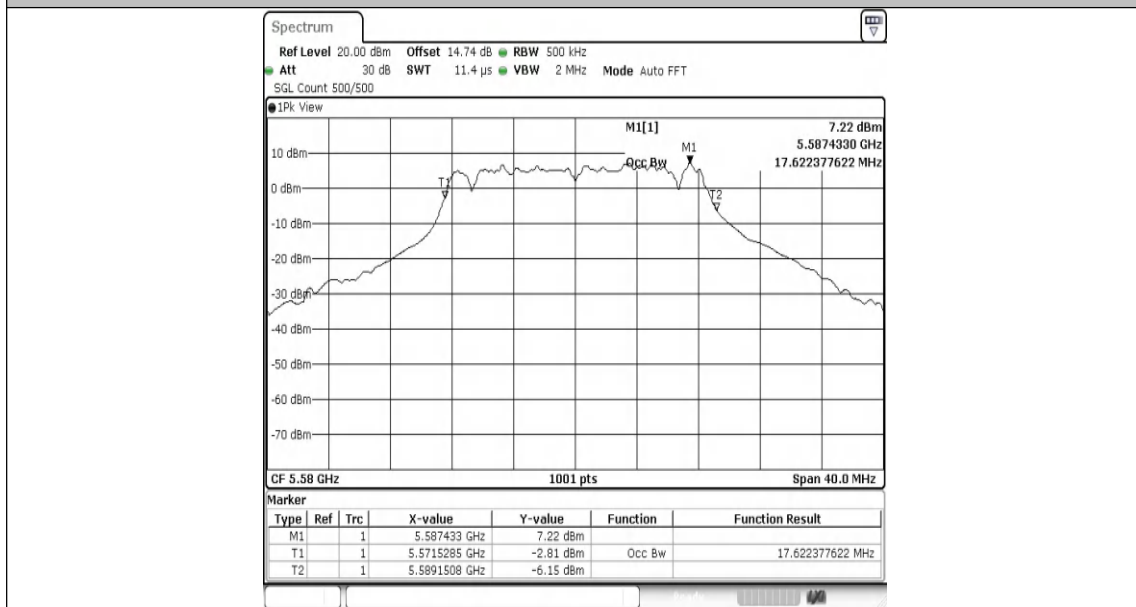



11A-Ant1-5580

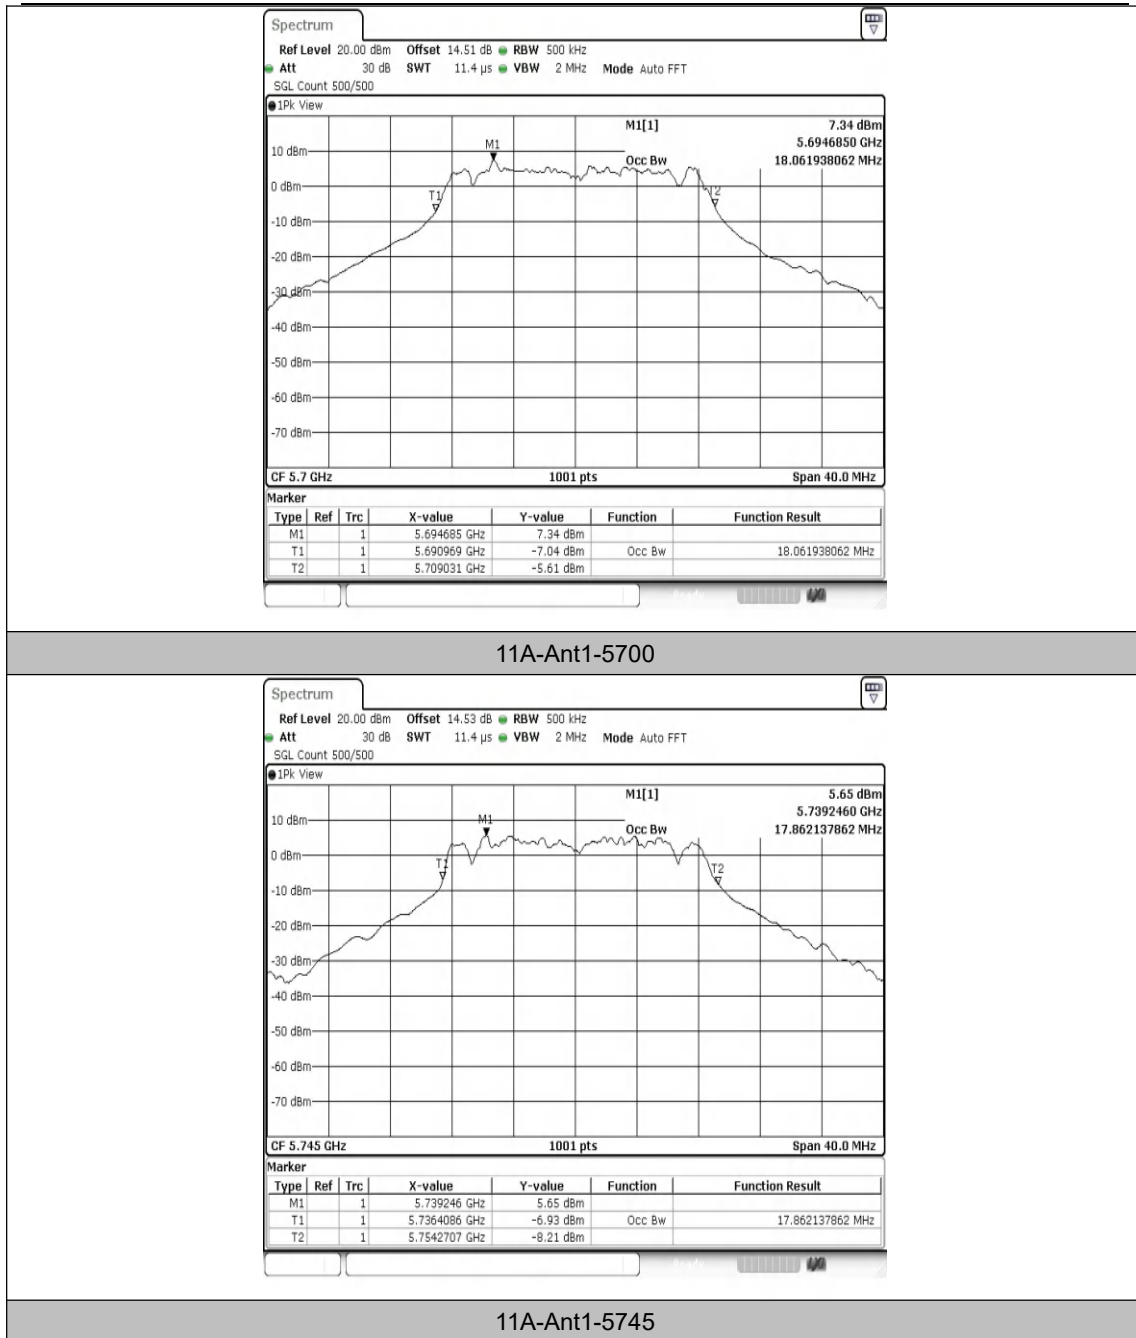


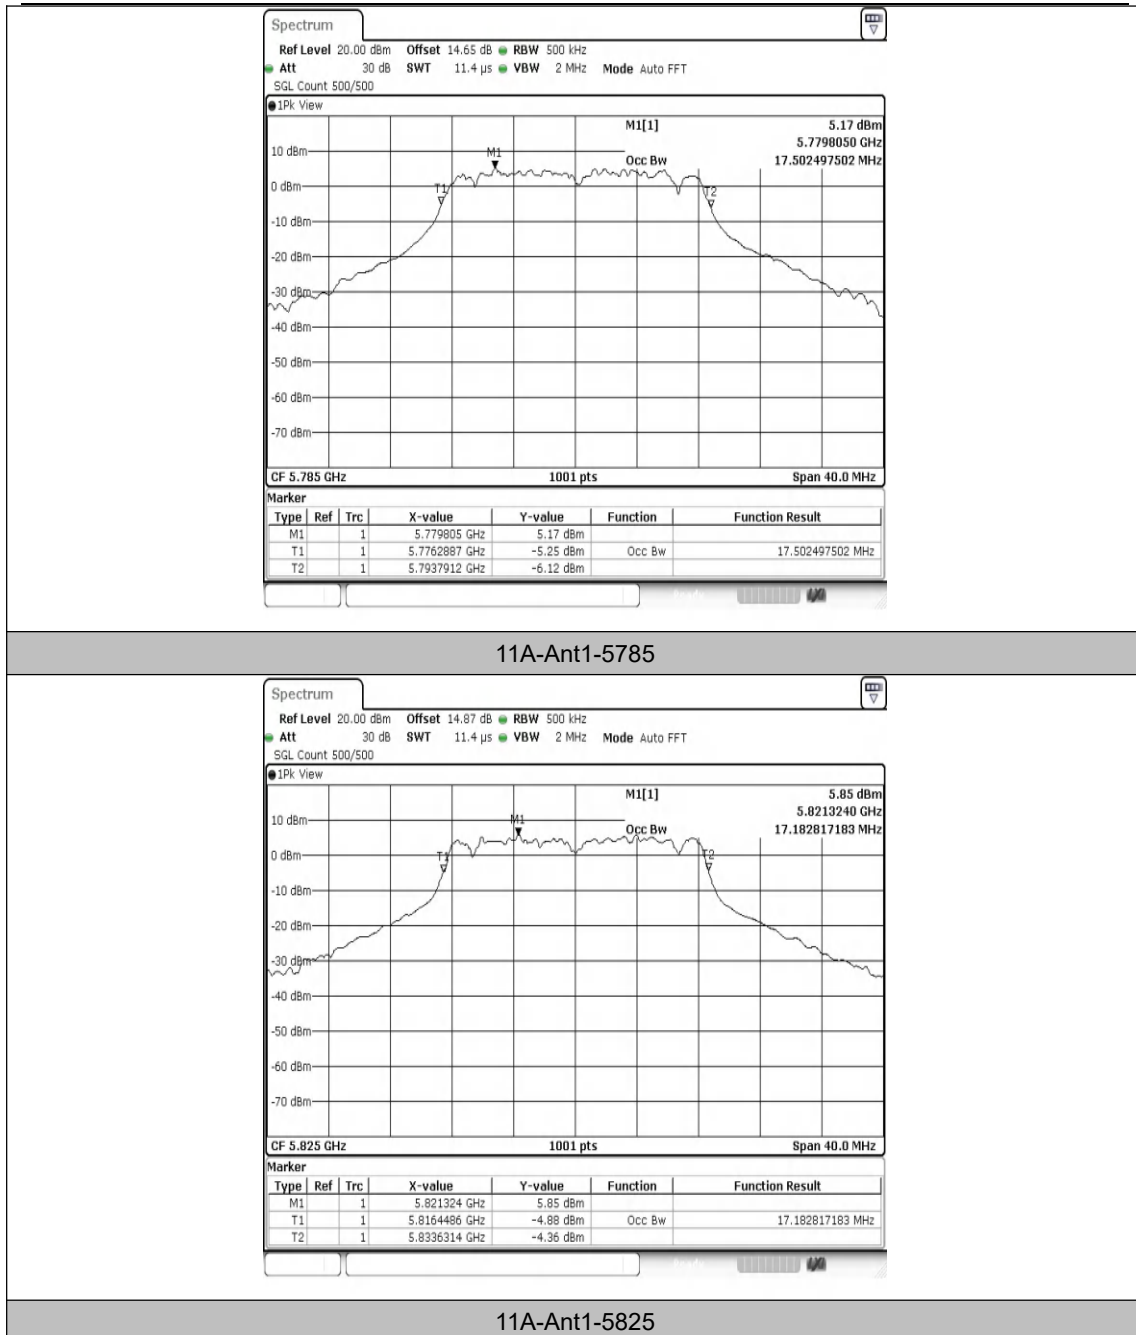


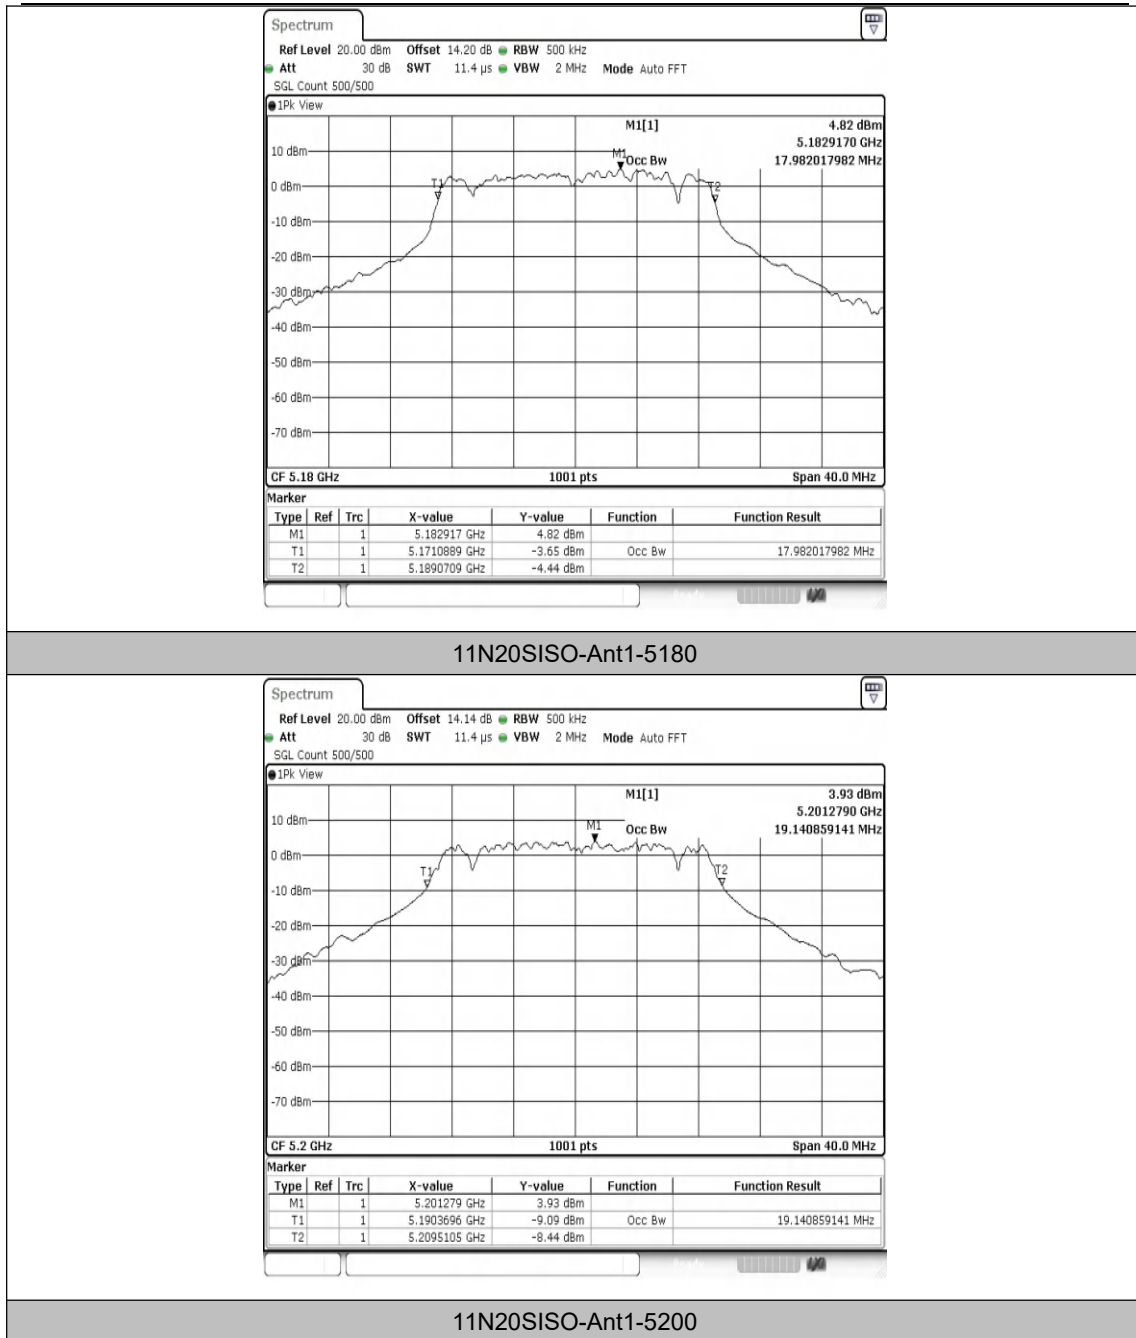


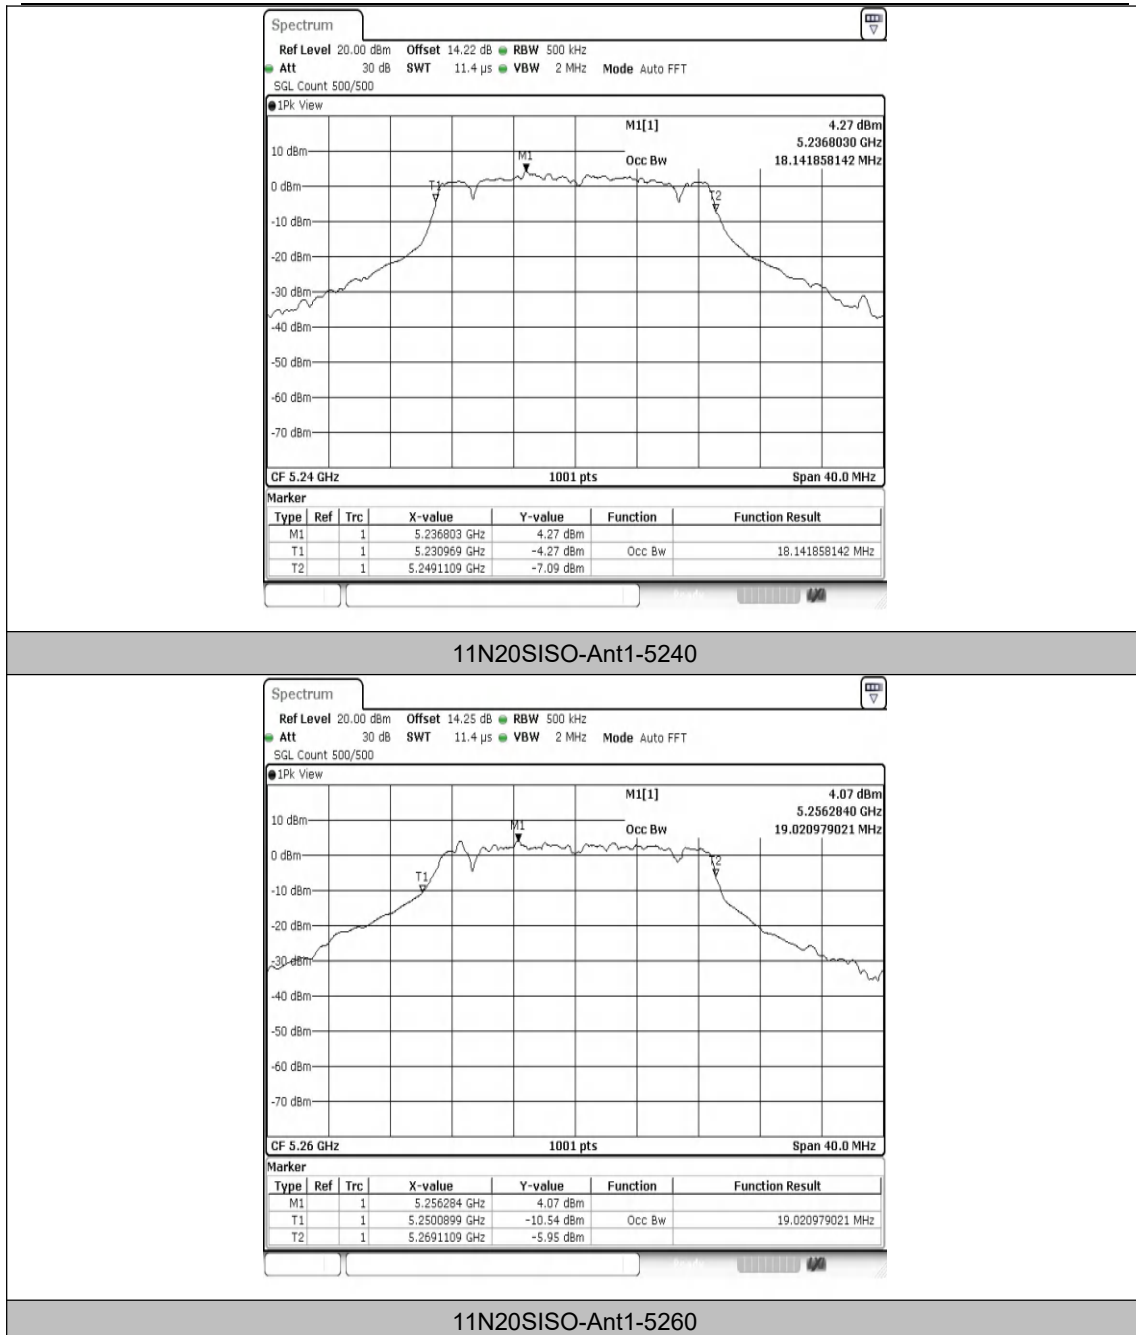


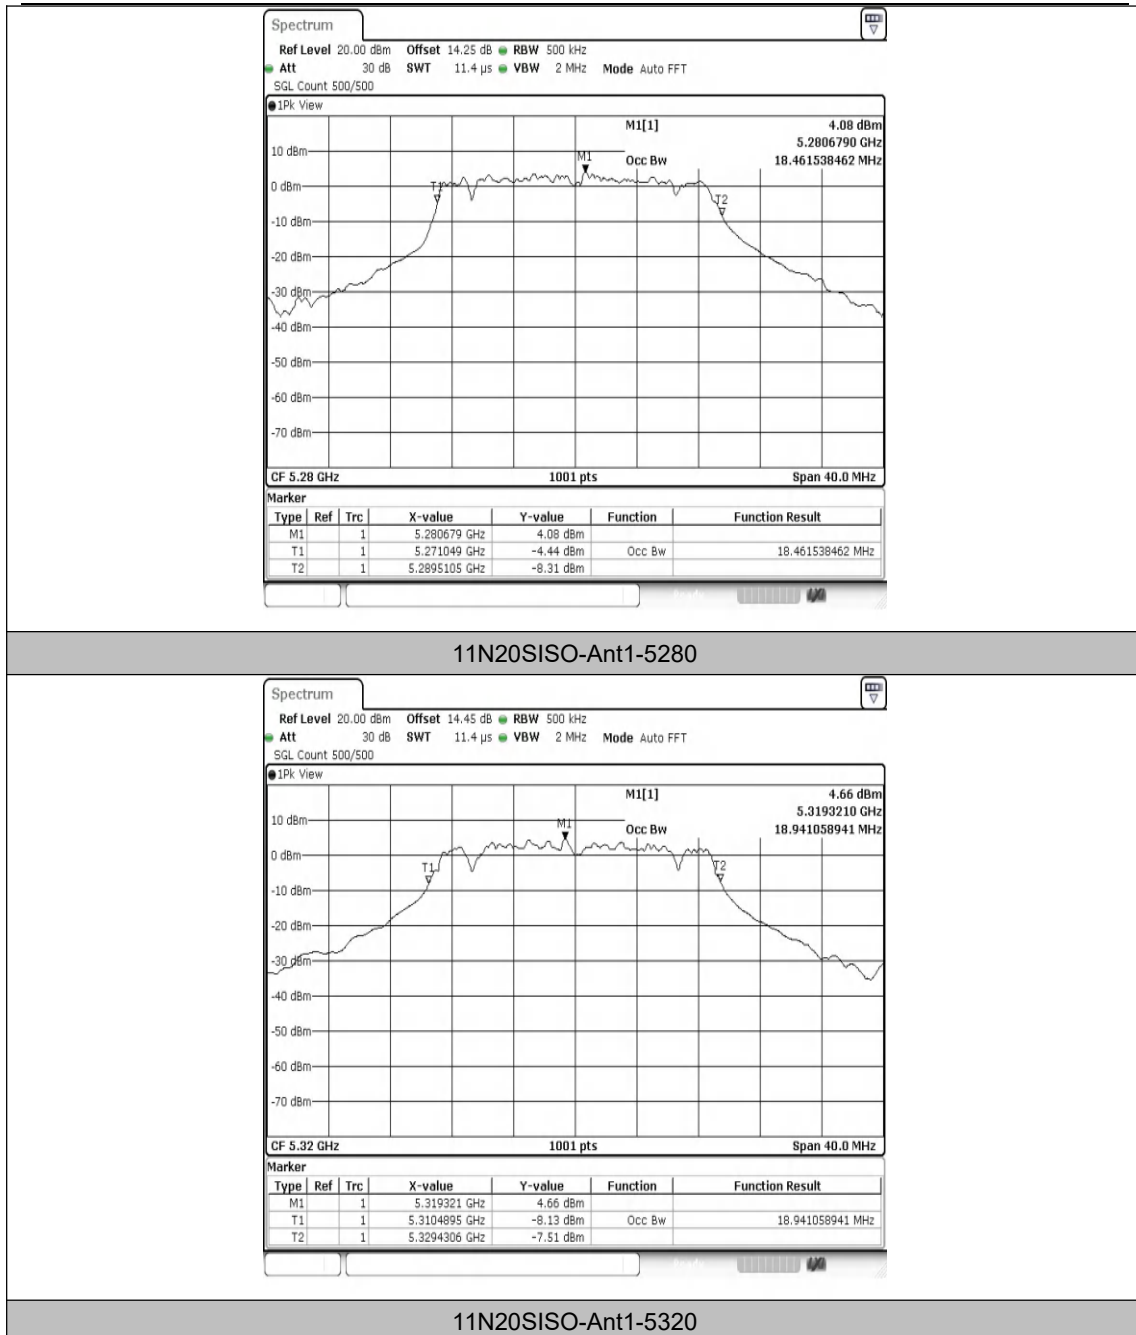


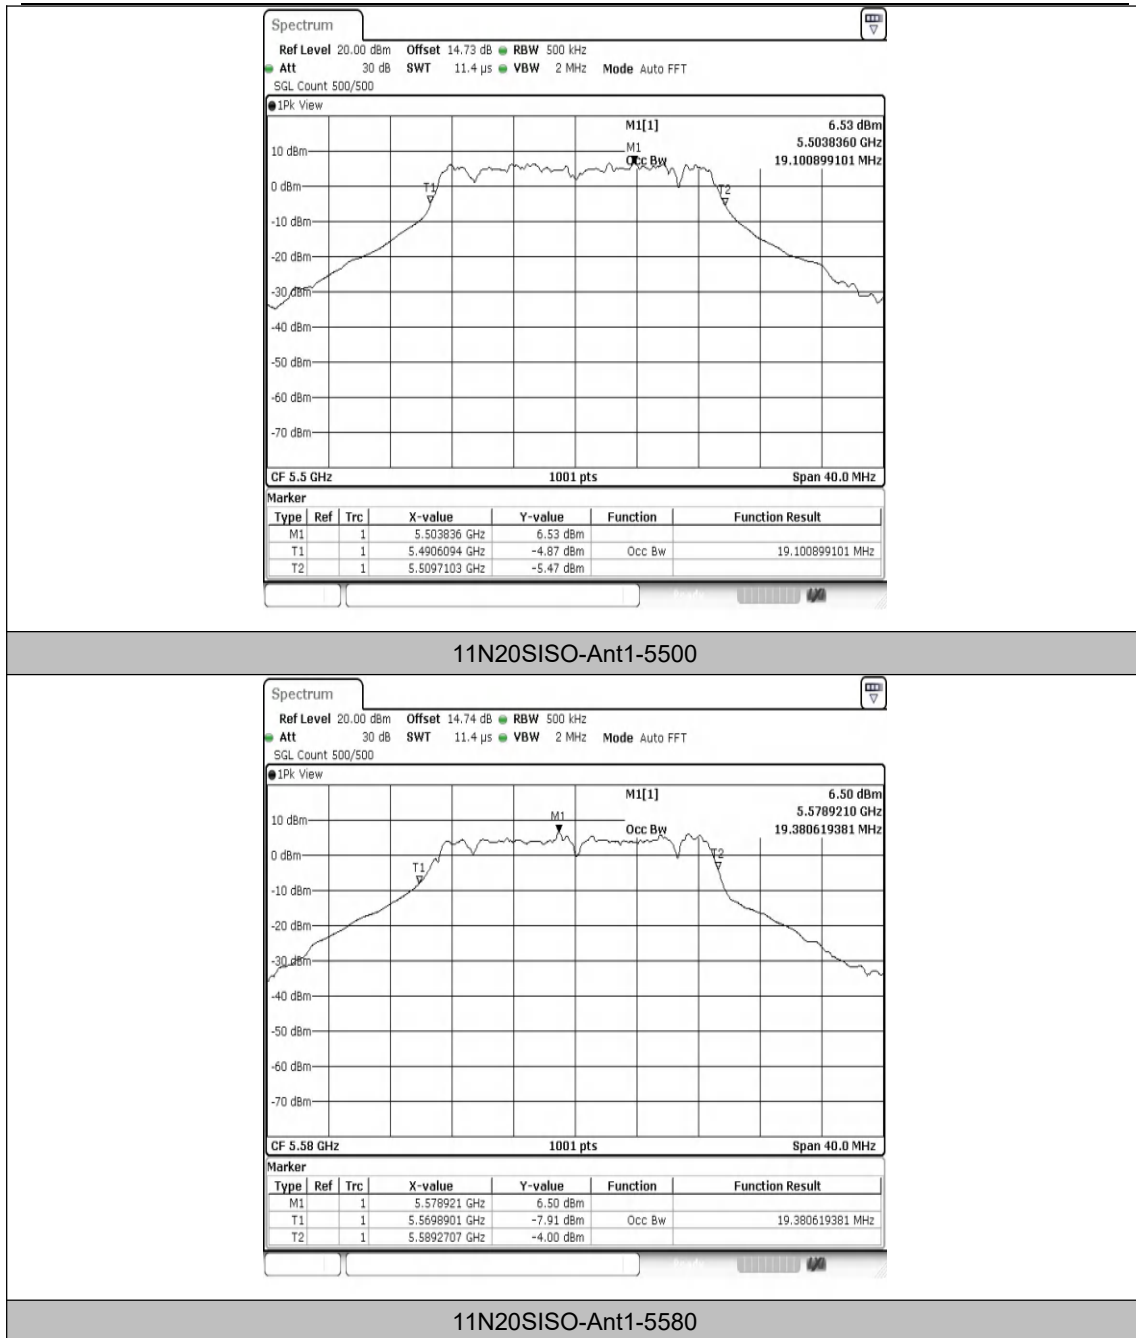


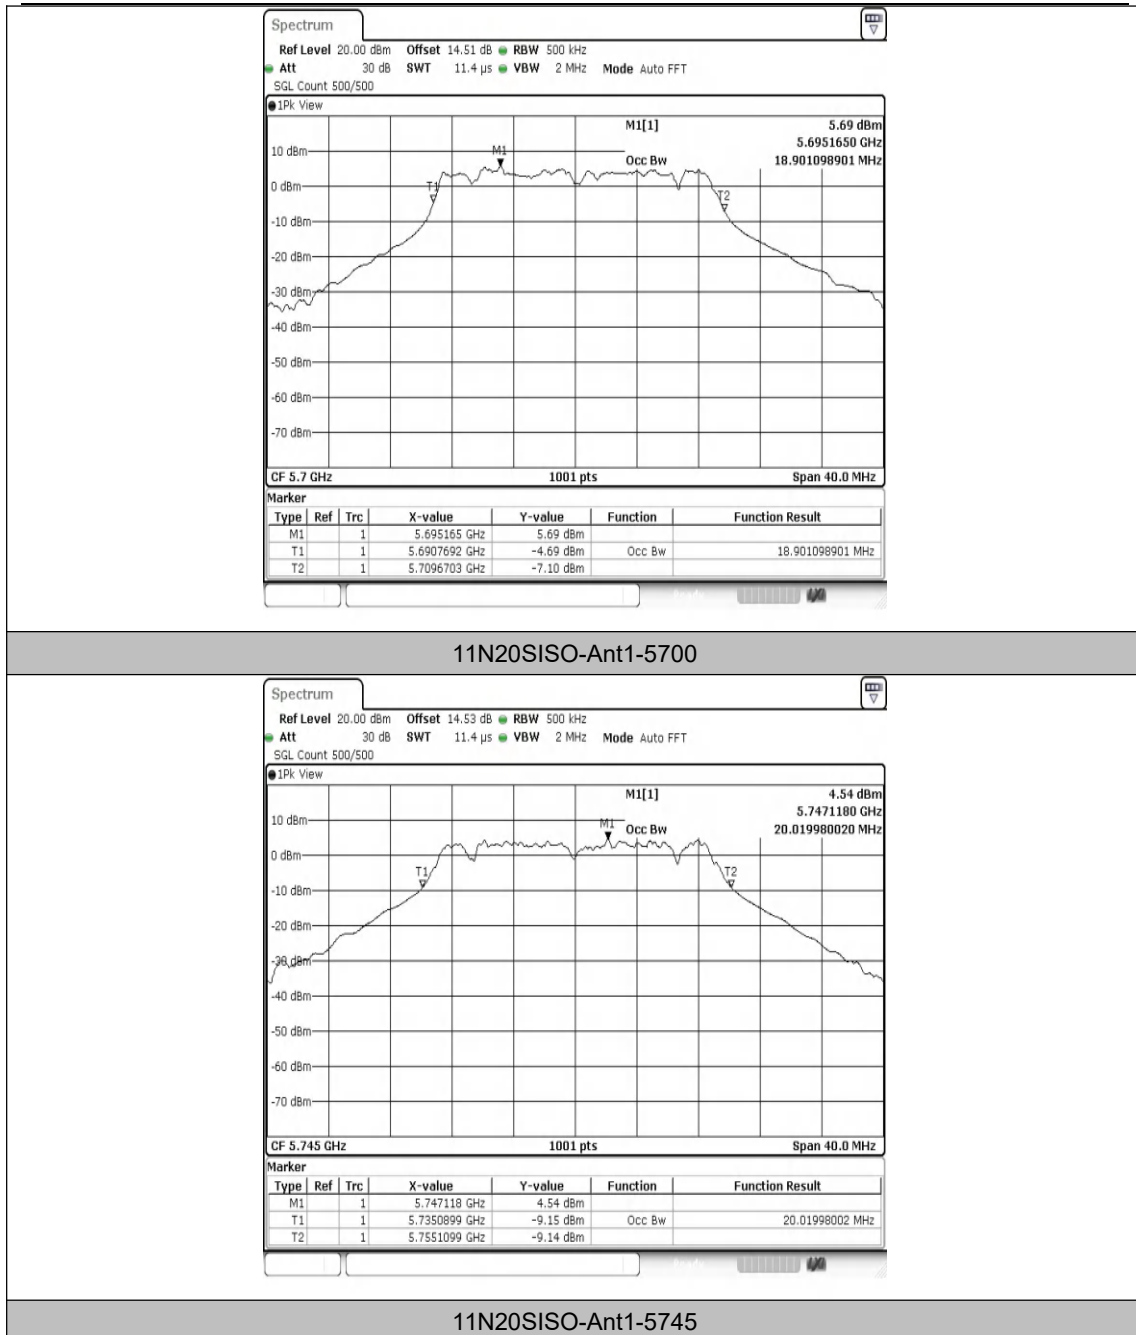


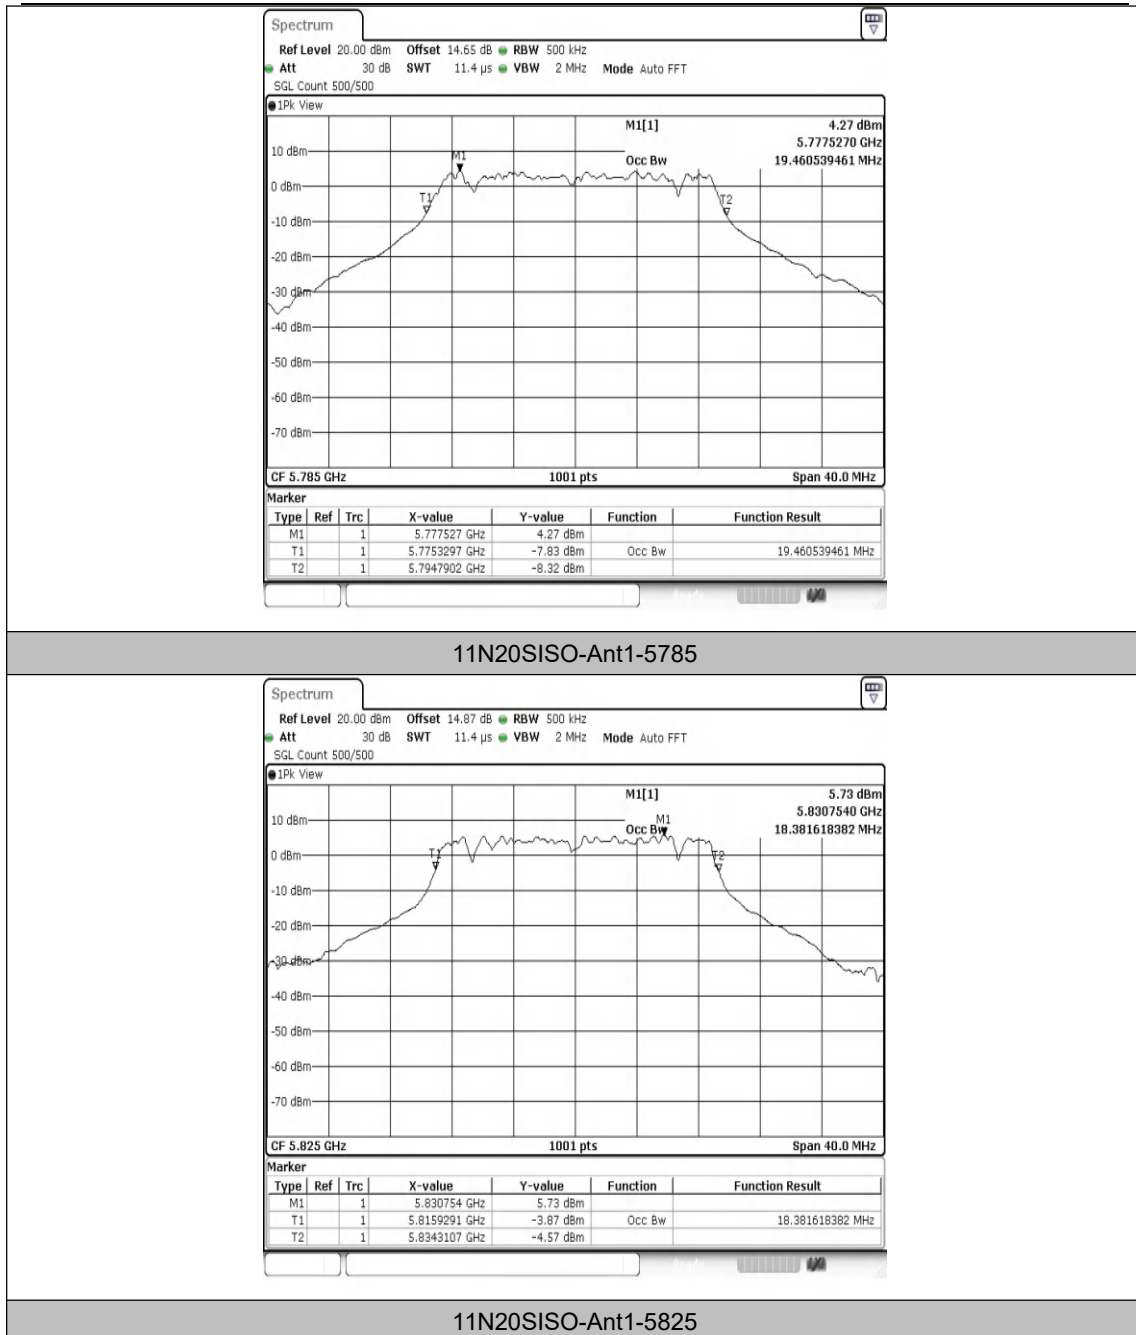


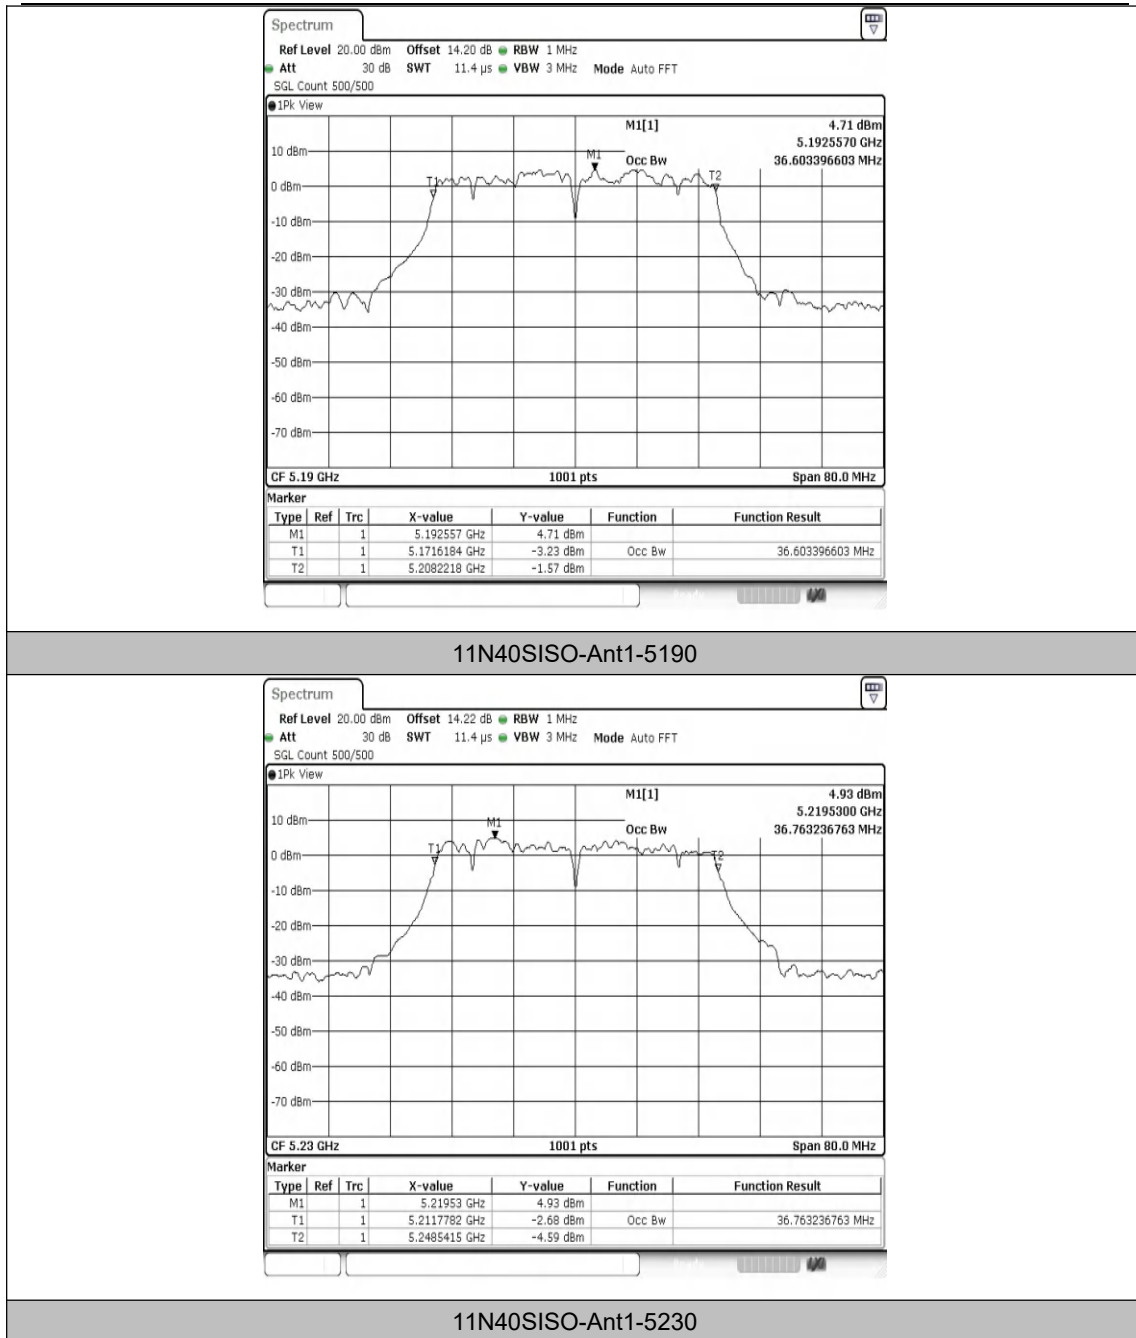

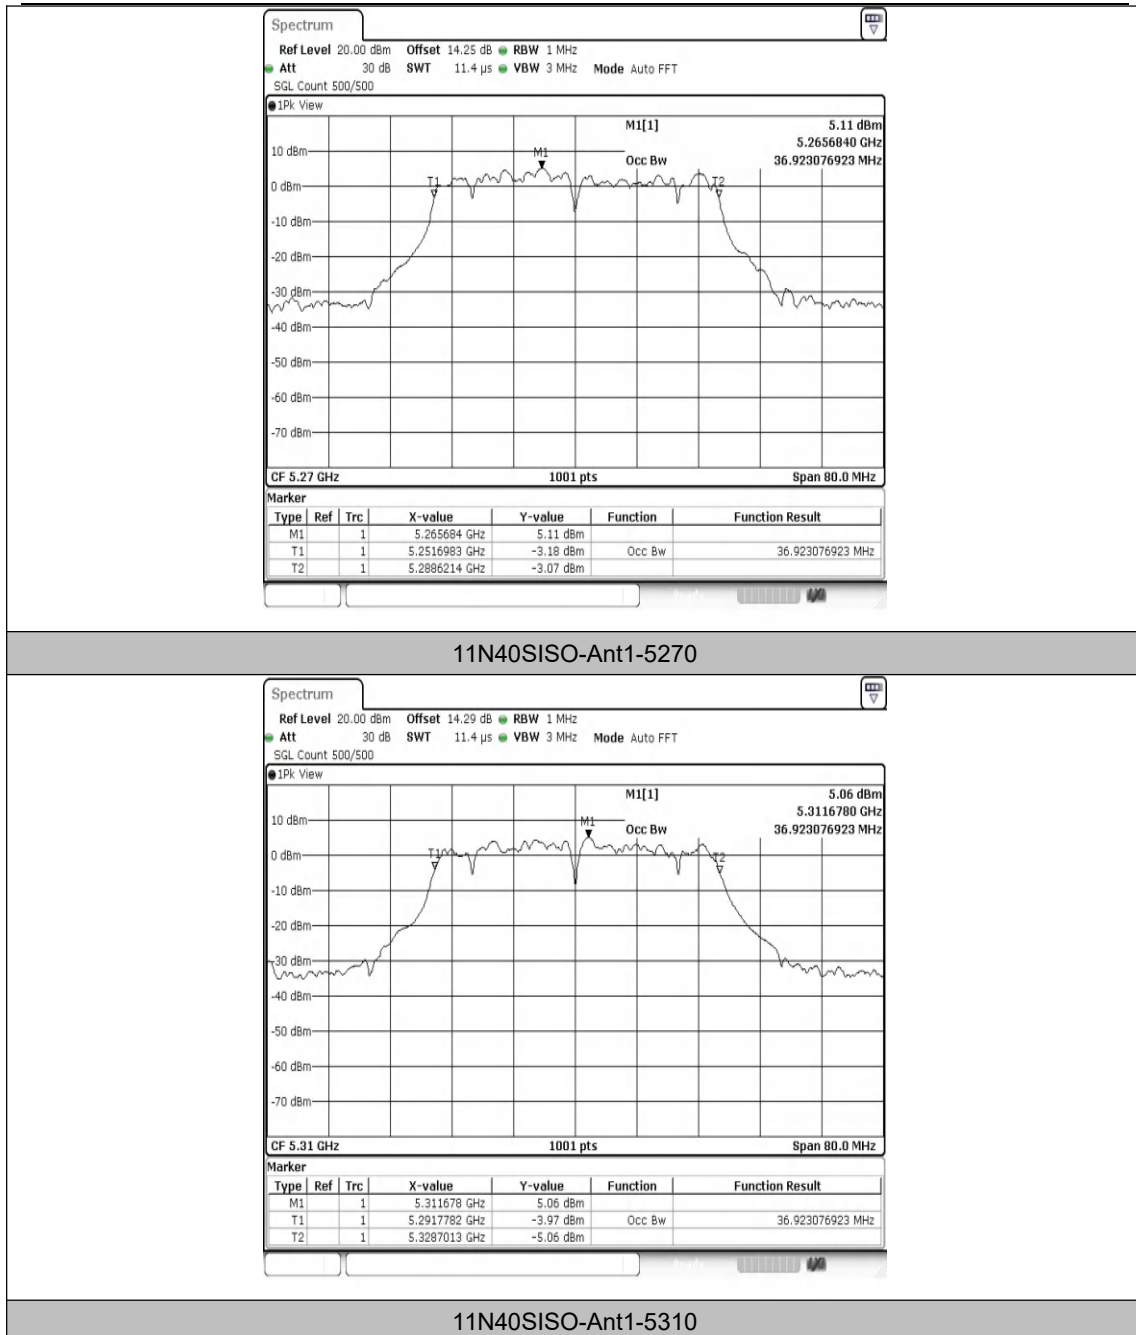

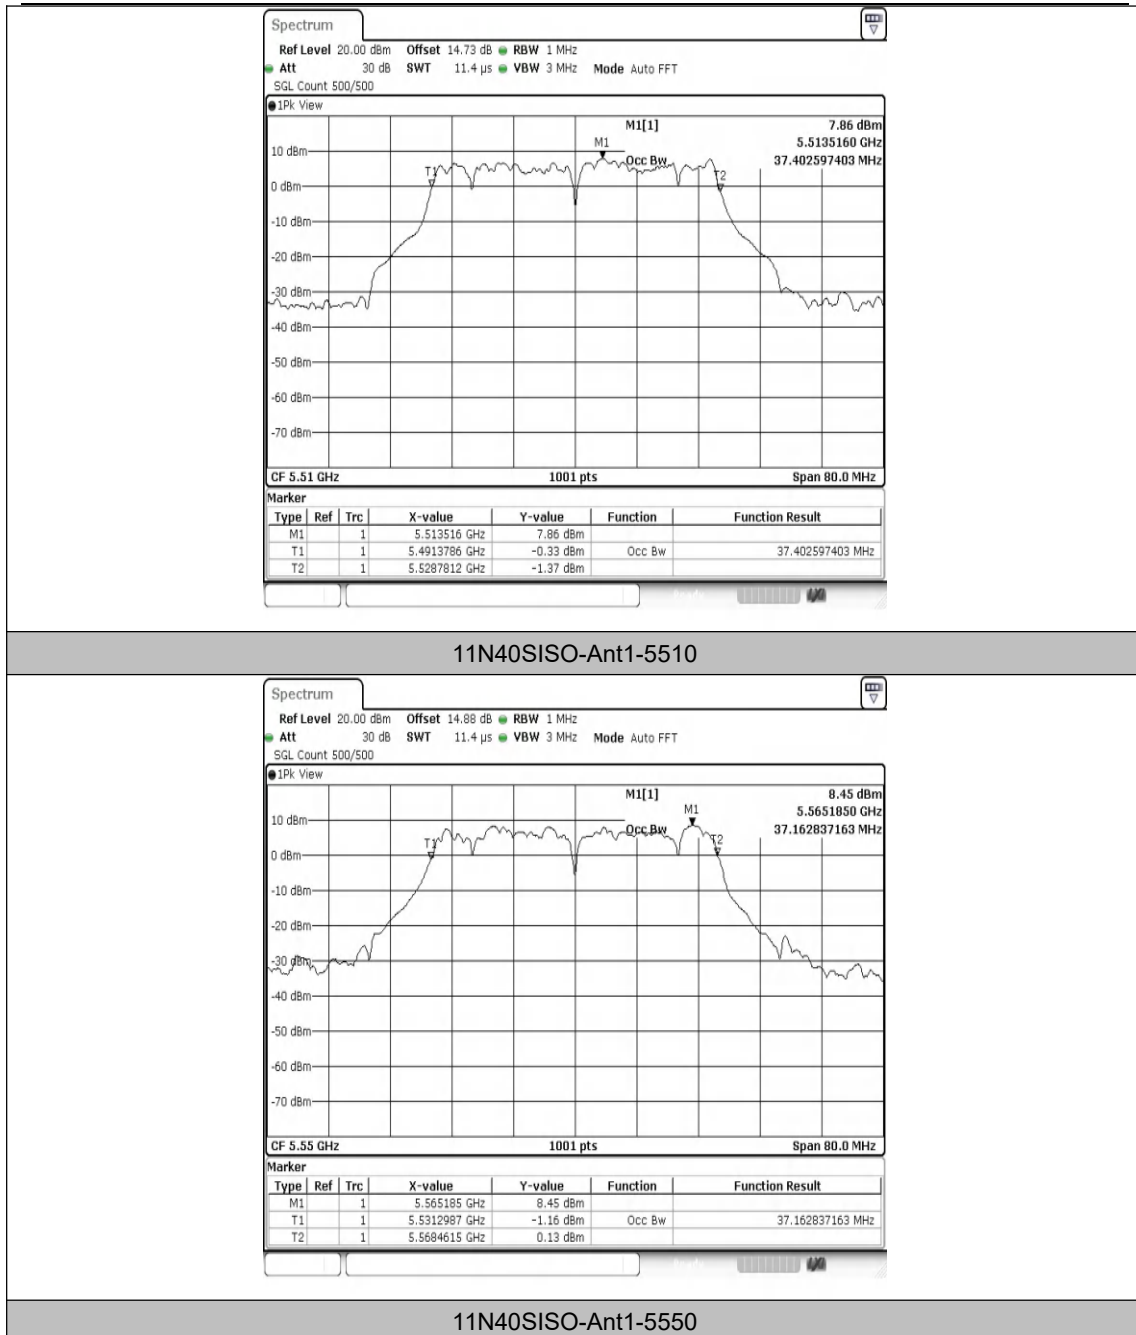

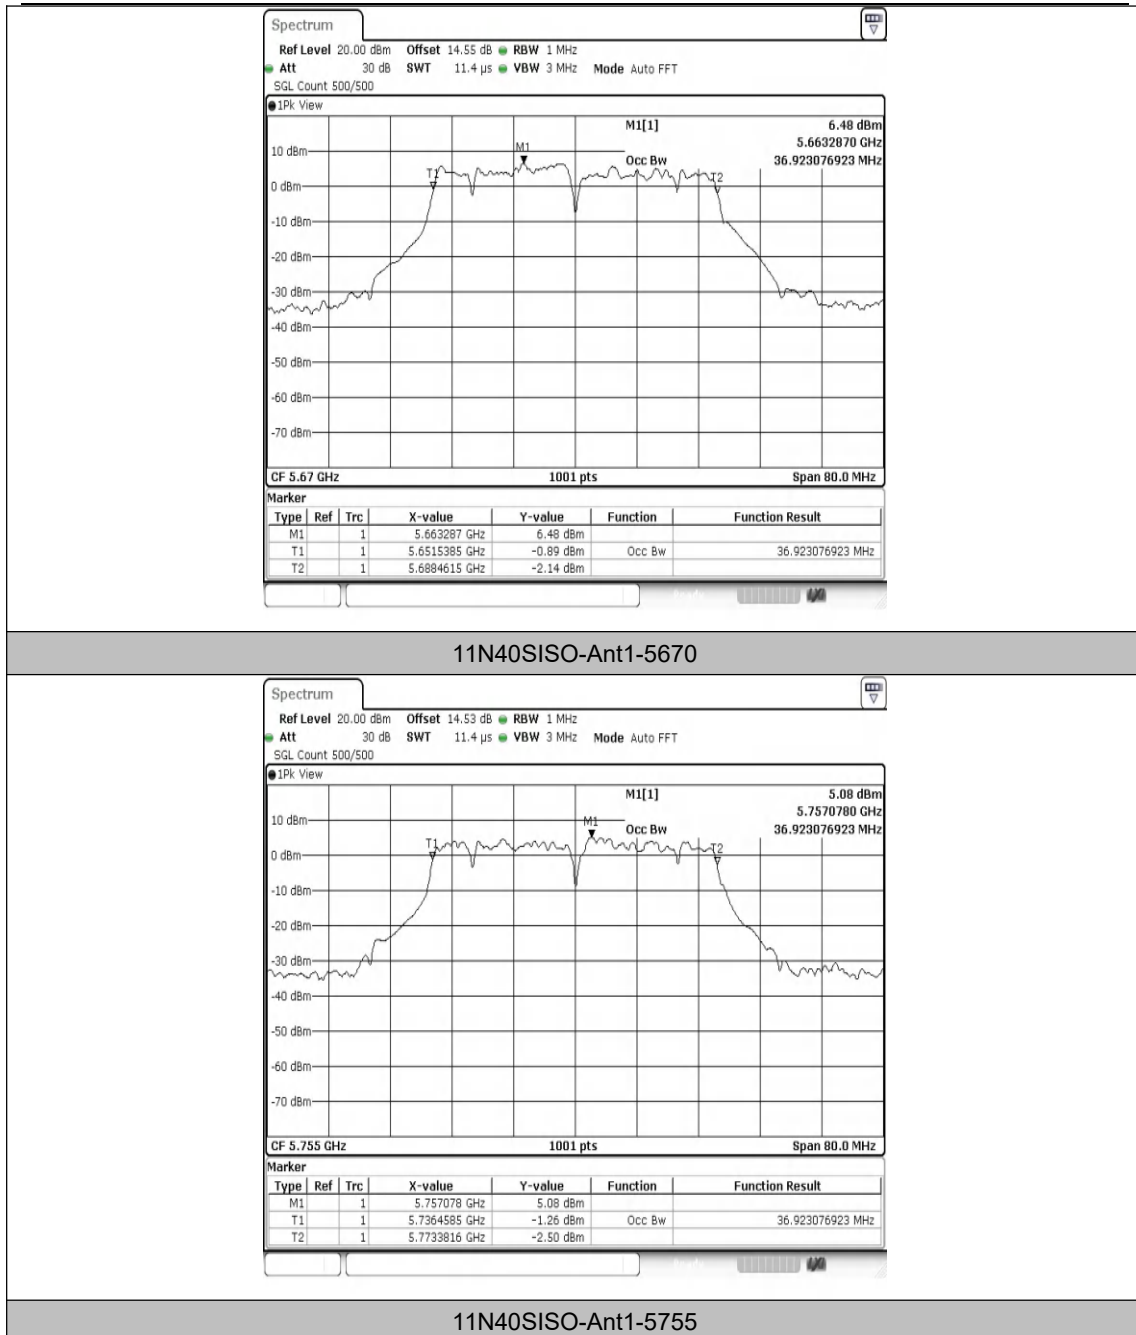


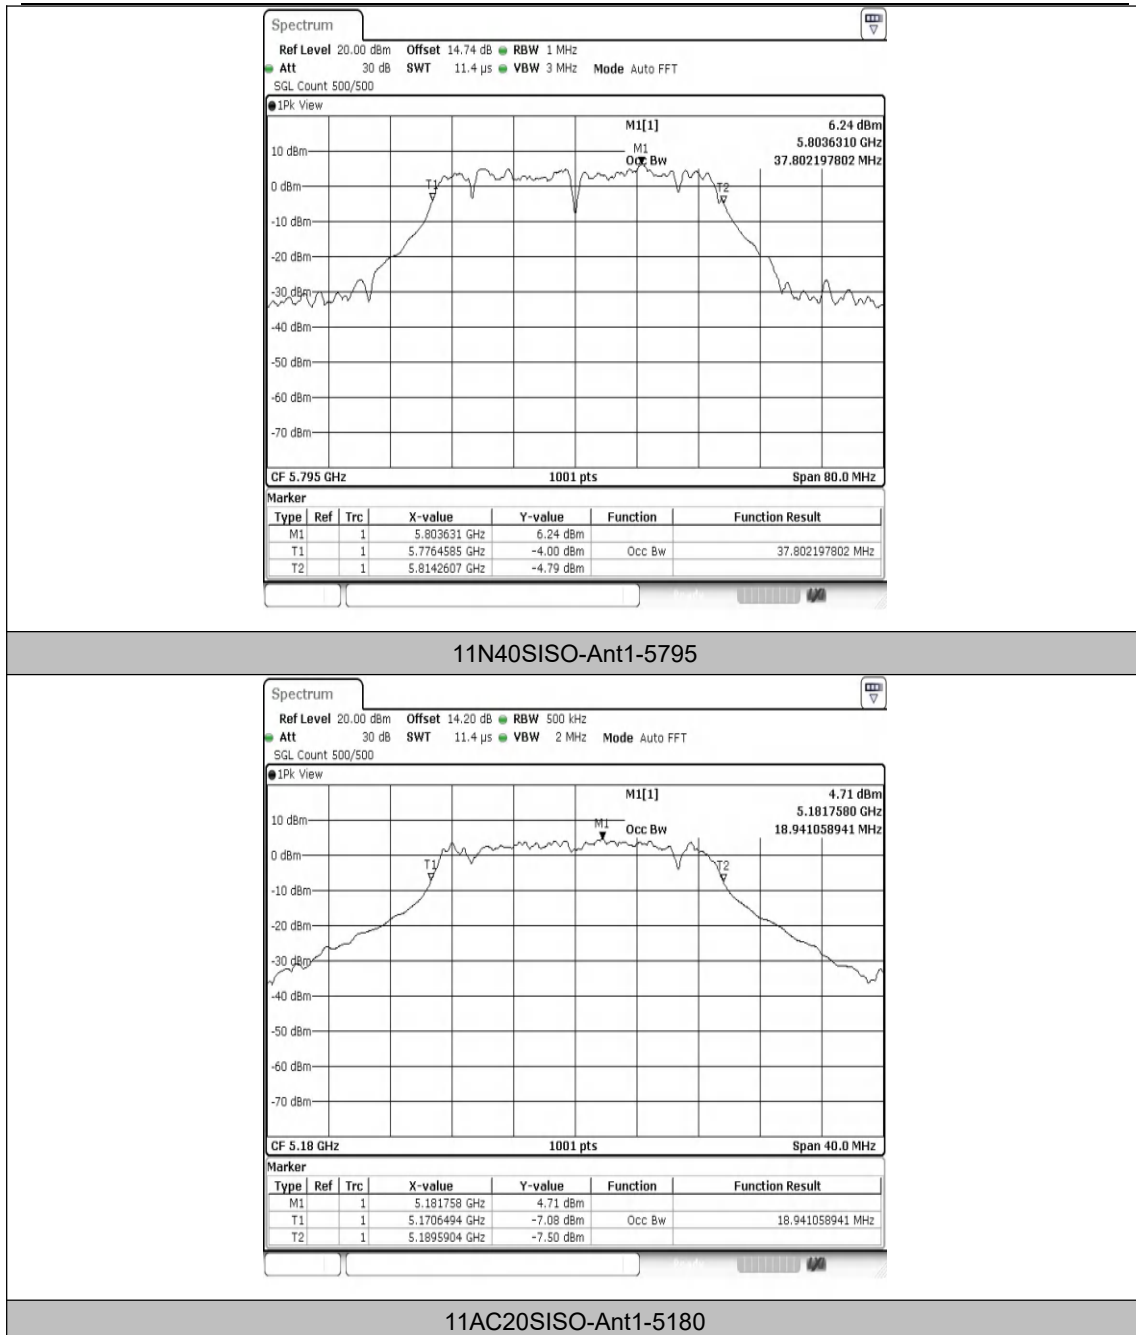



Shenzhen Anbotech Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

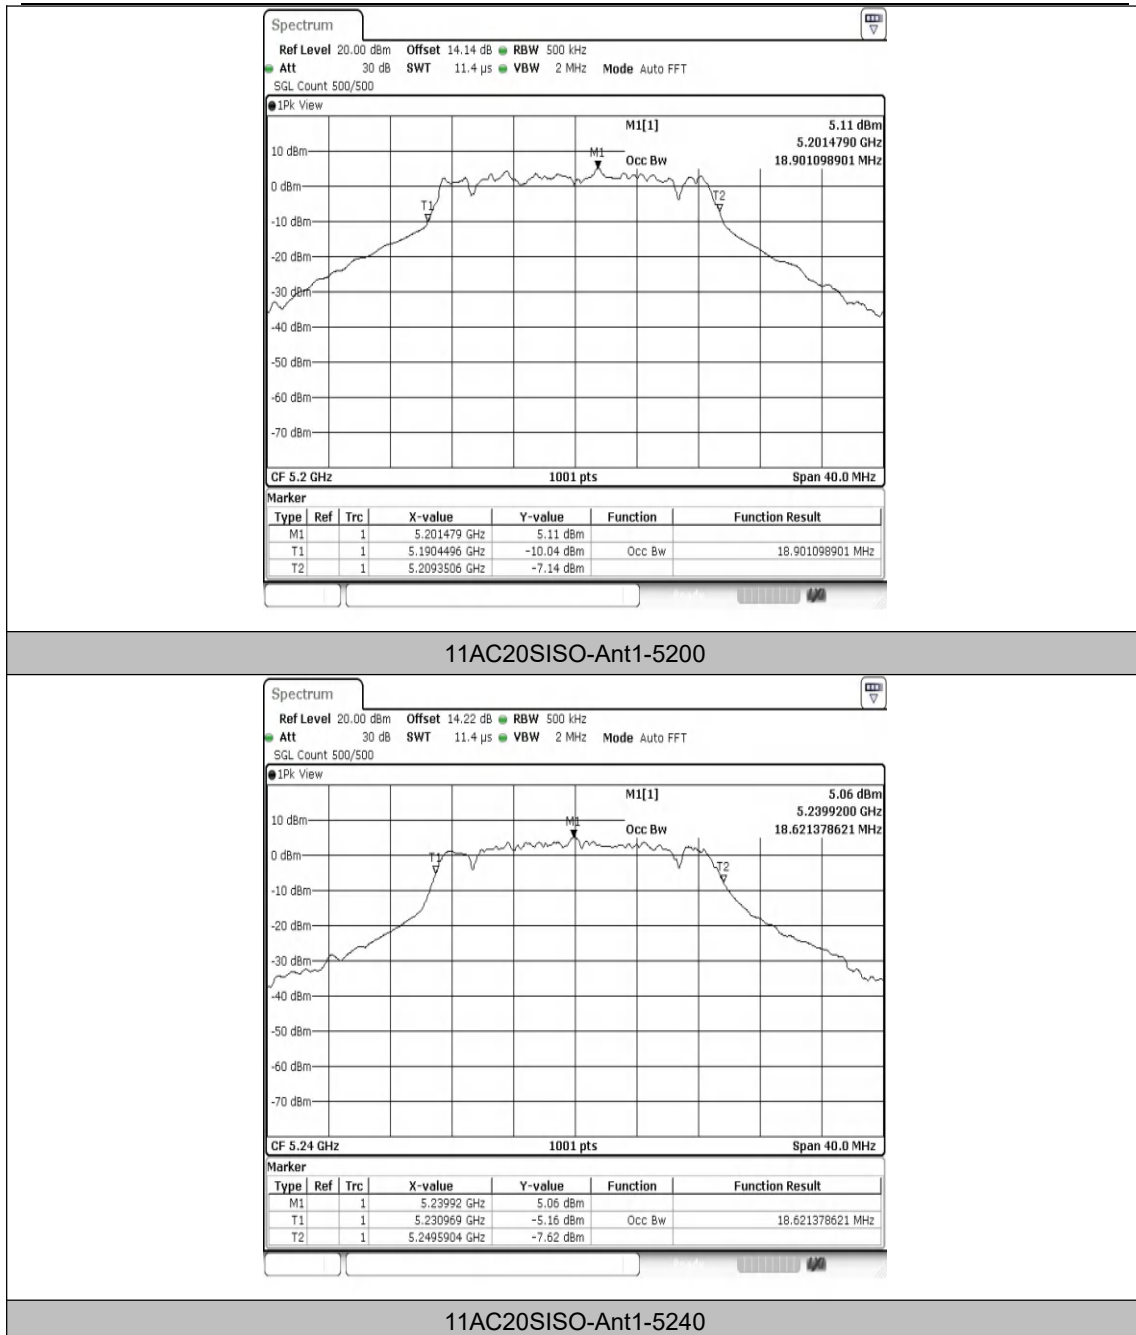

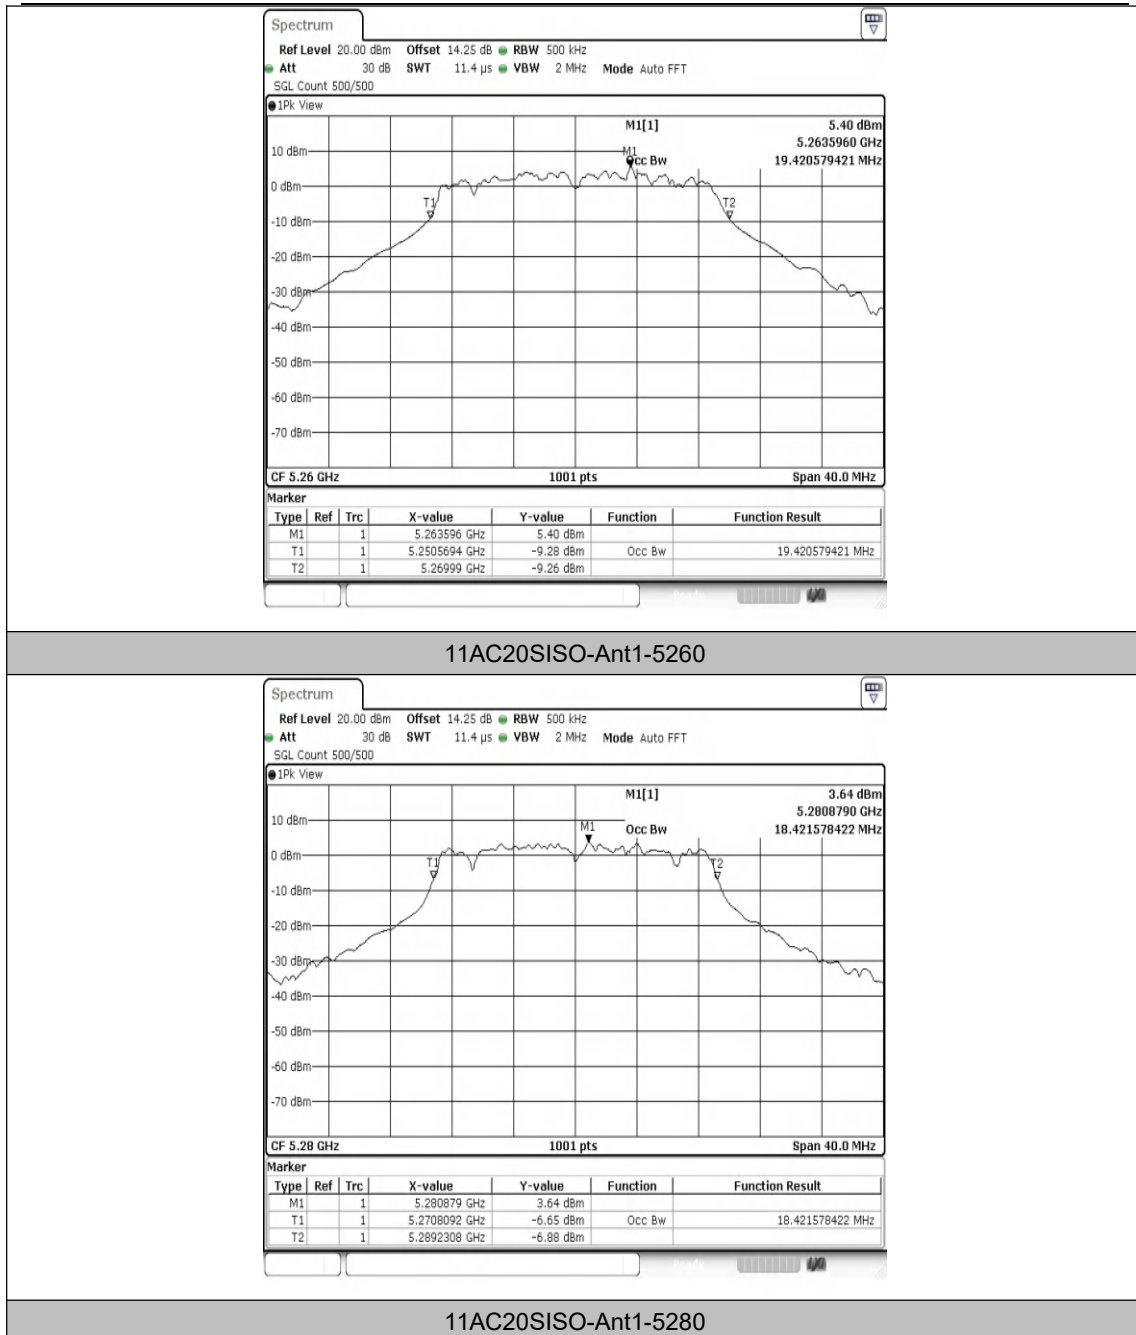

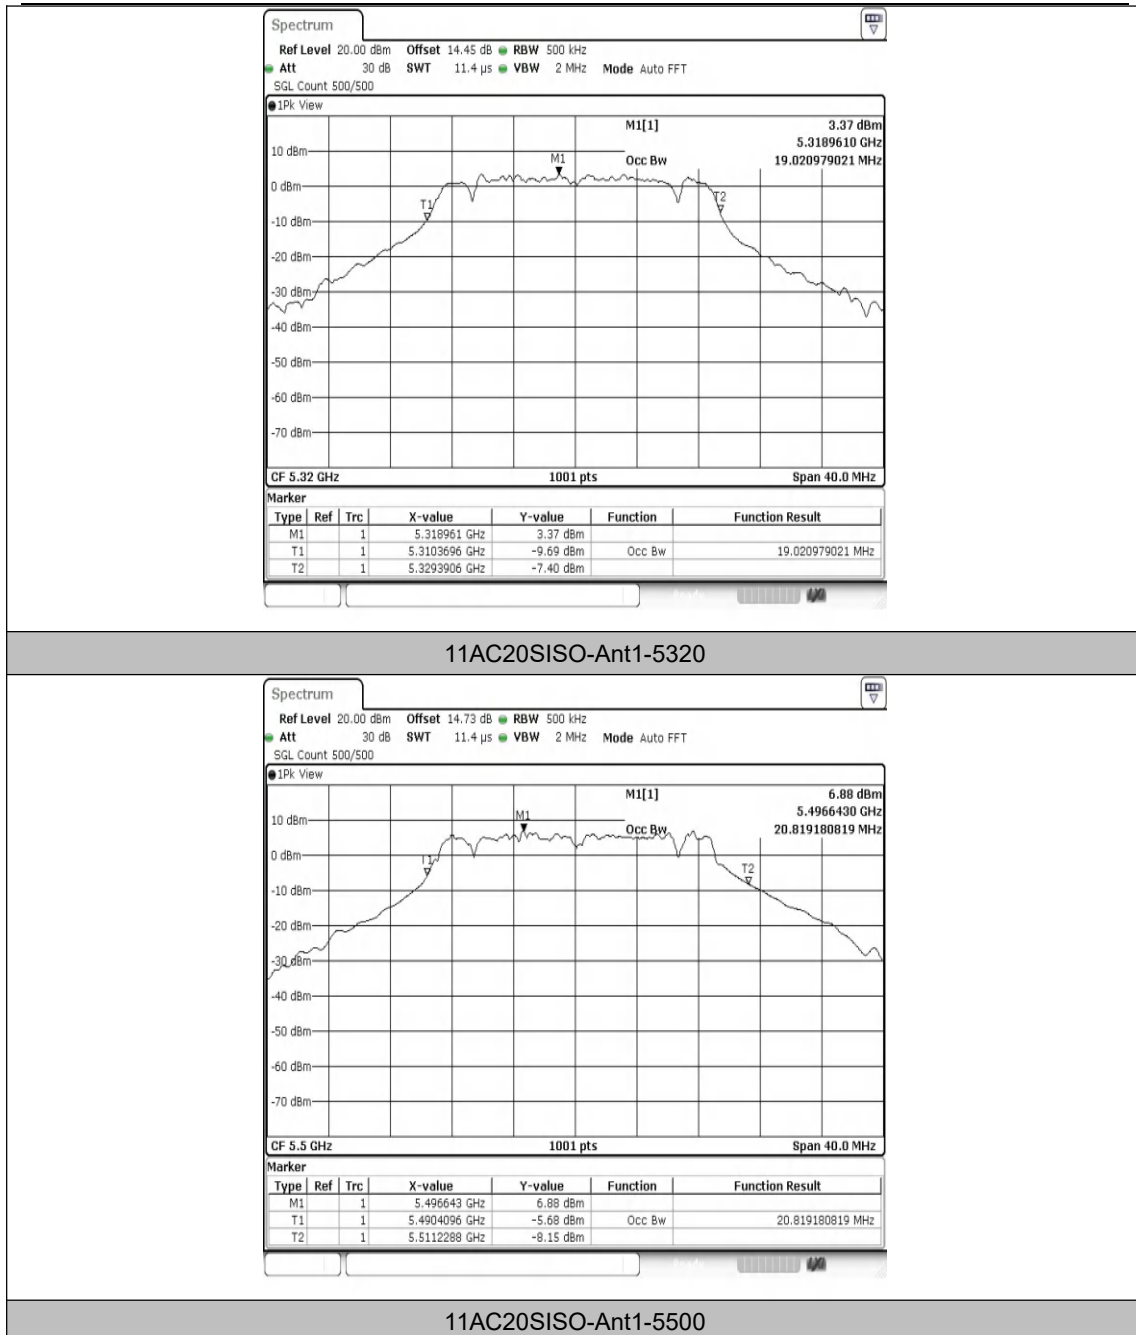

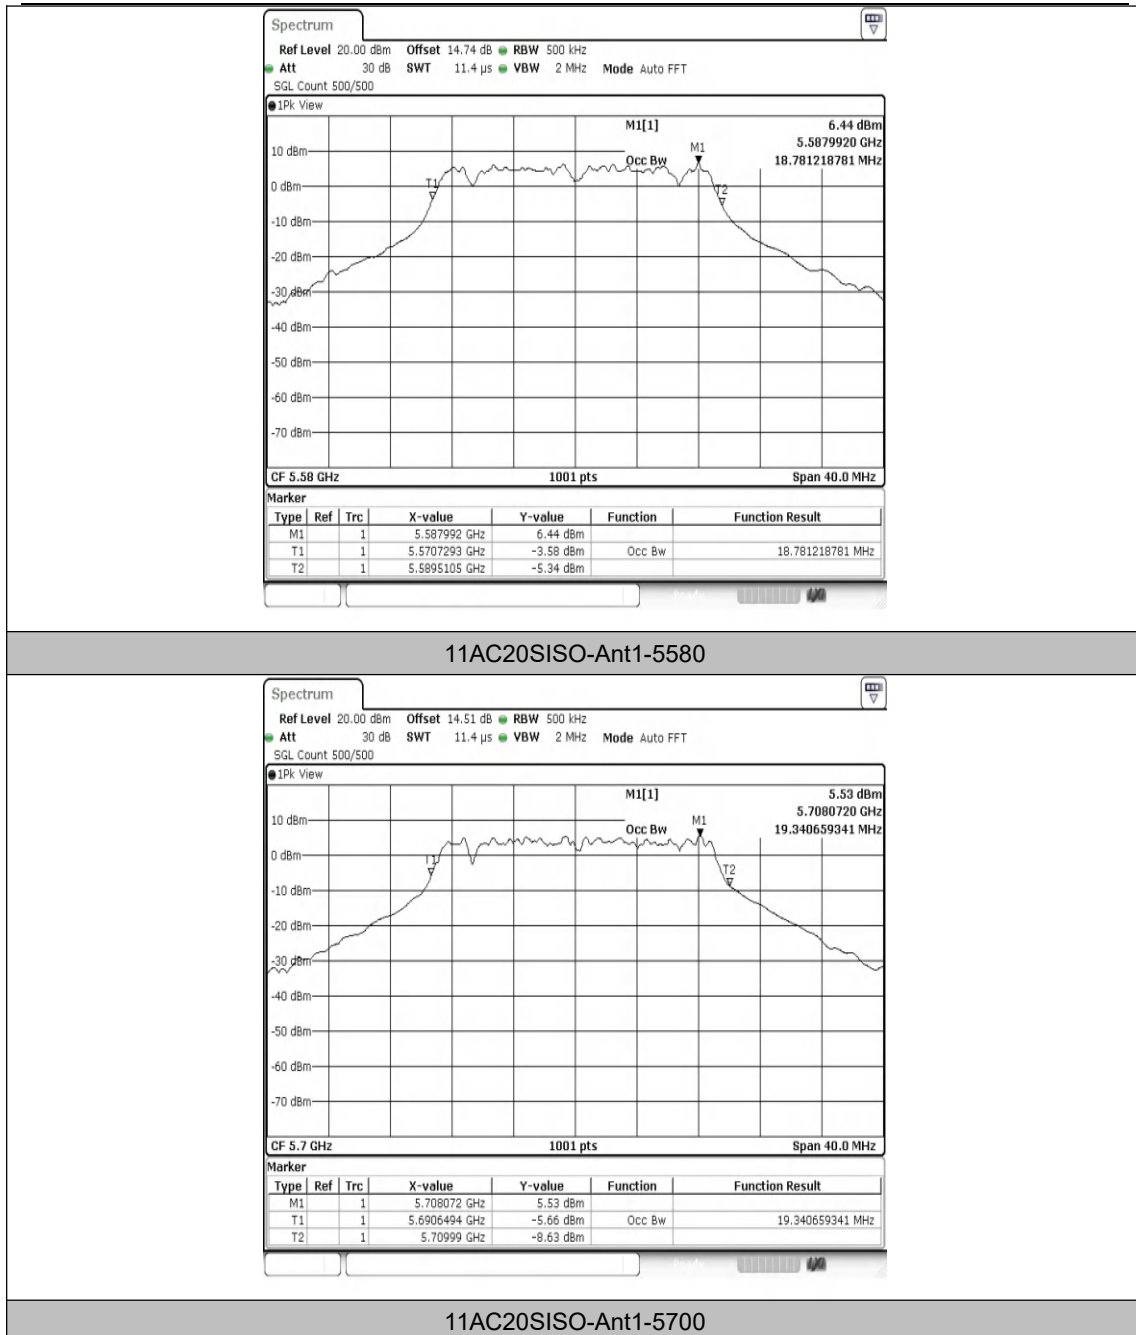


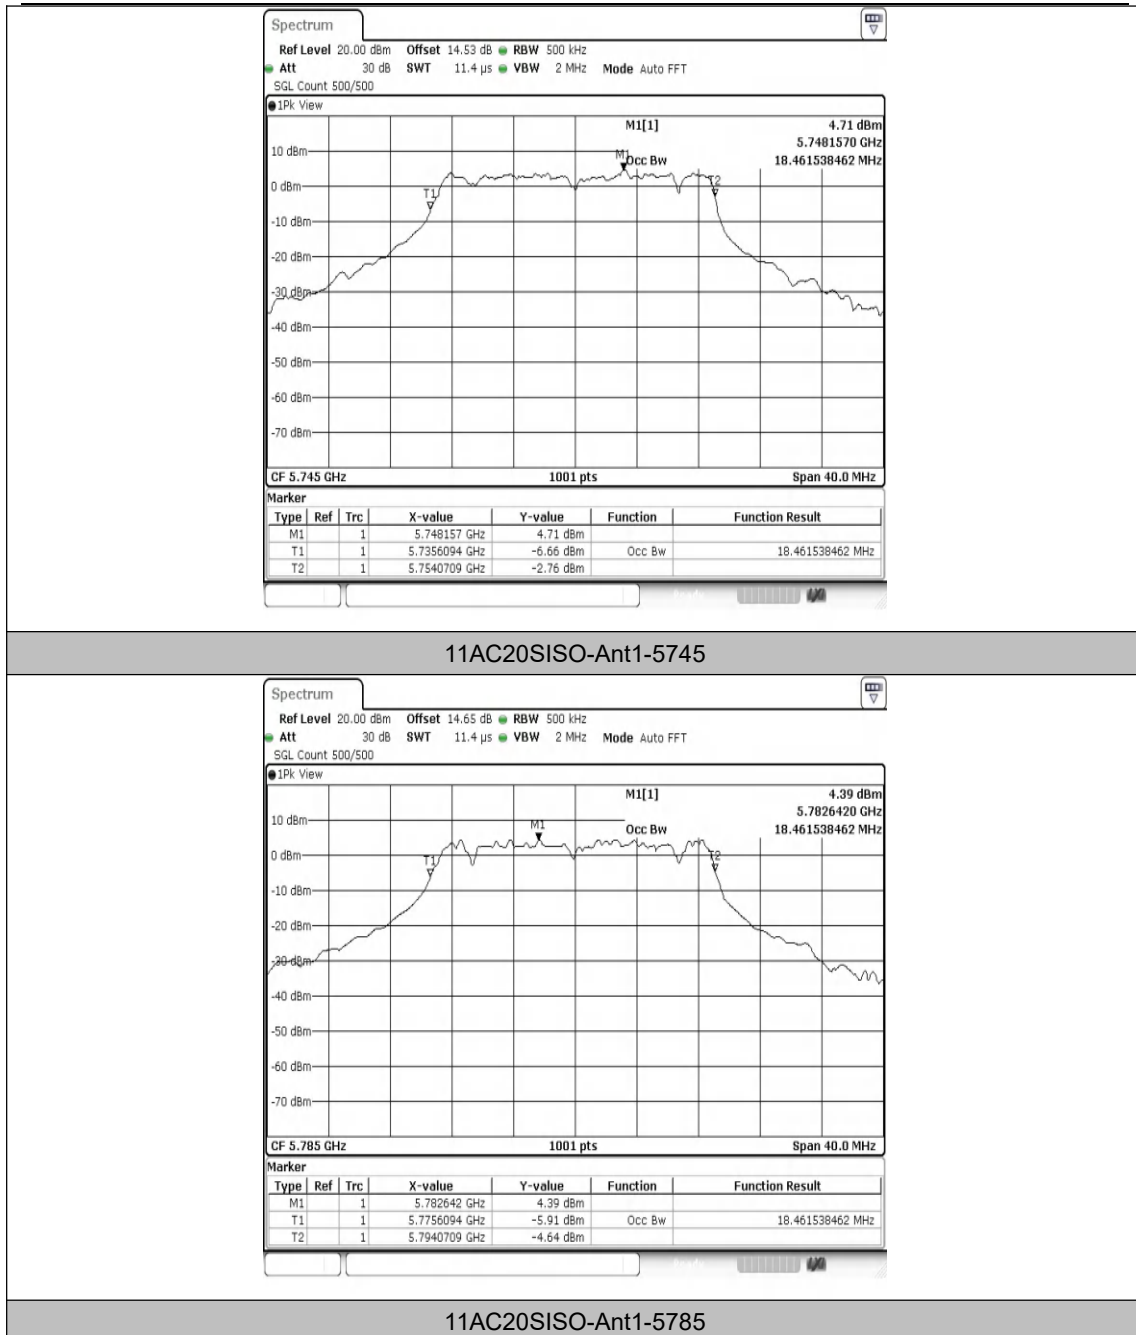



Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

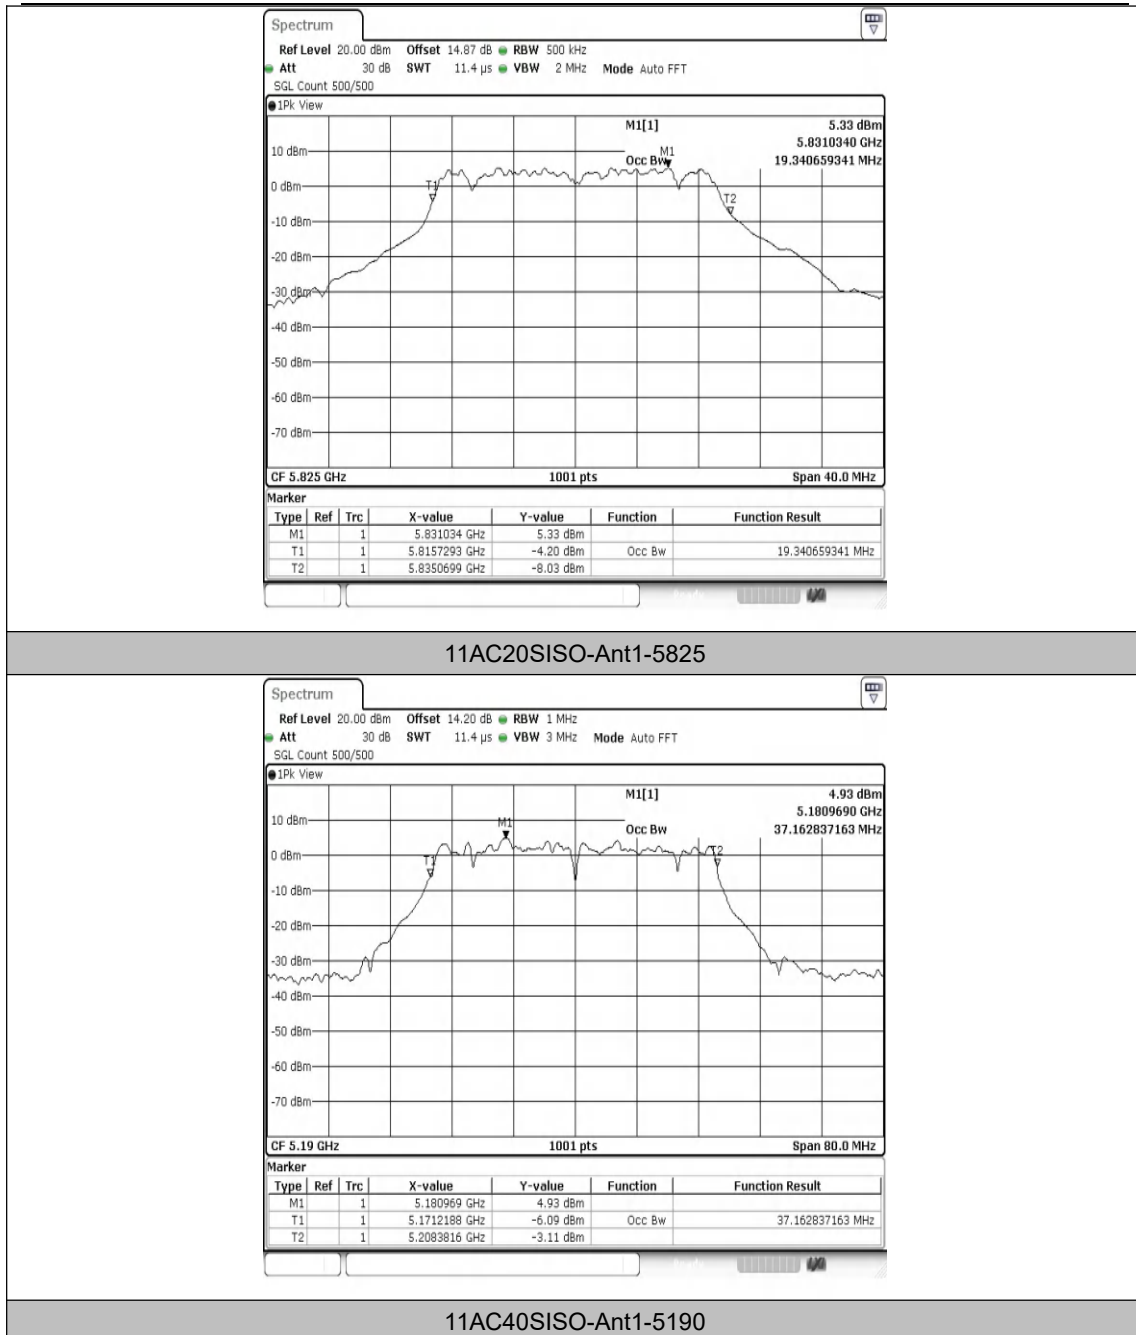

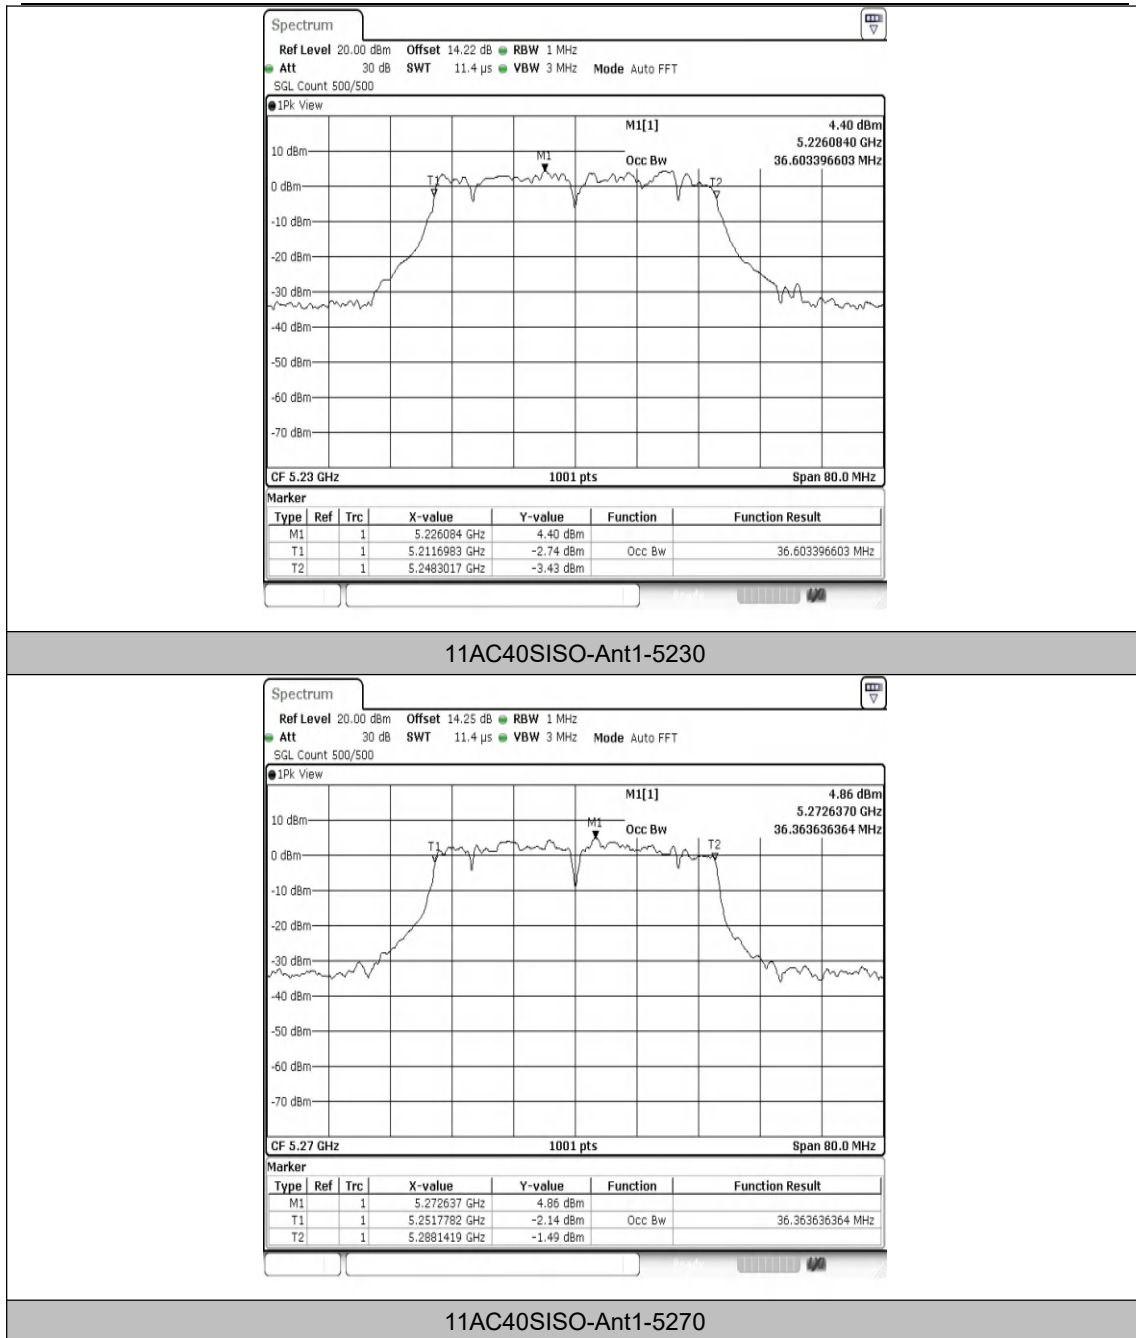


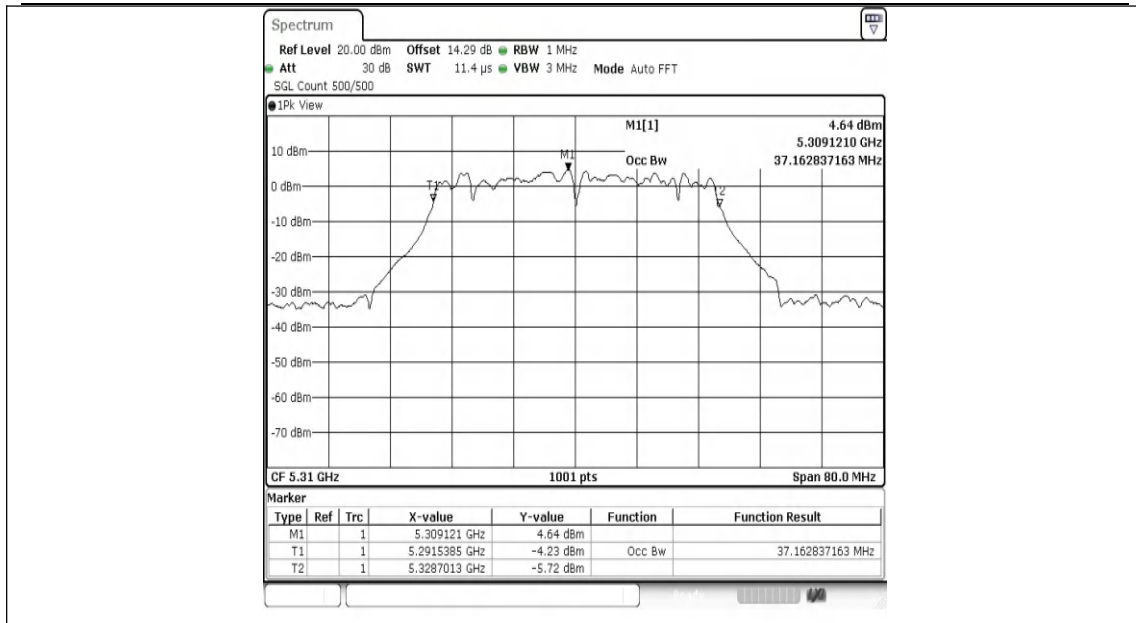



11AC40SISO-Ant1-5310

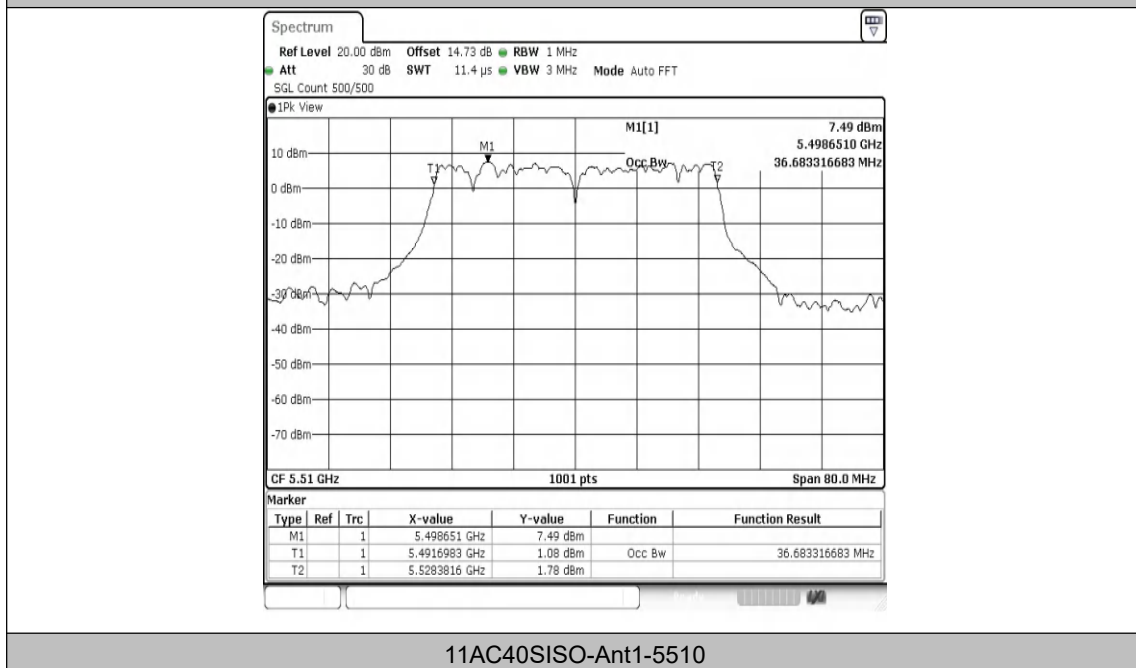



11AC40SISO-Ant1-5510

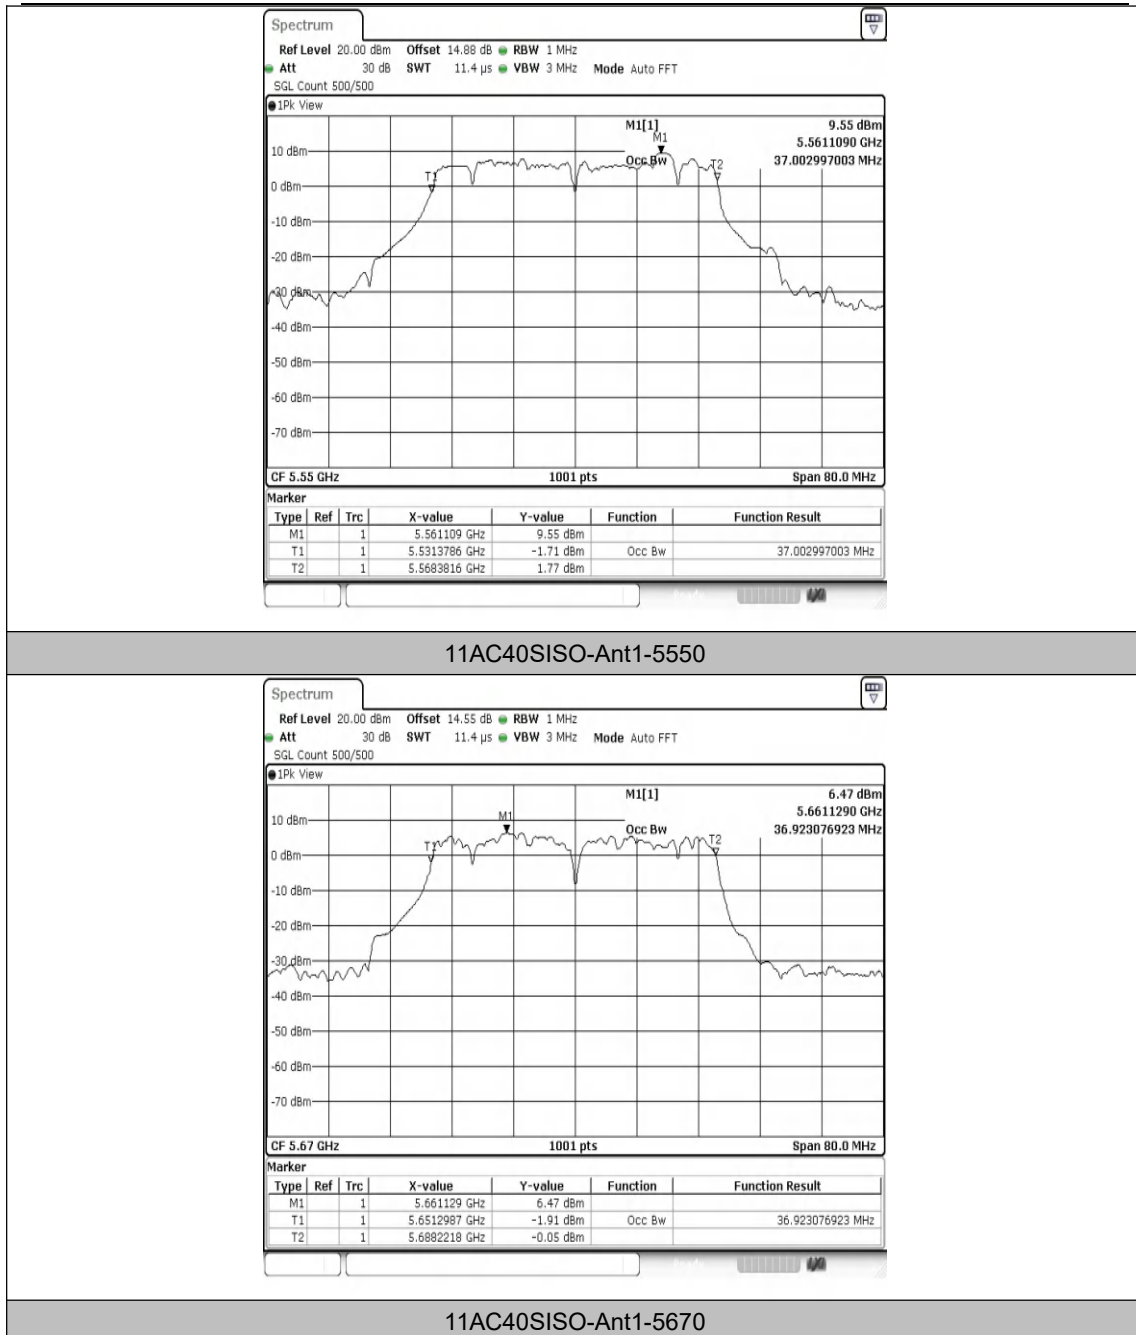


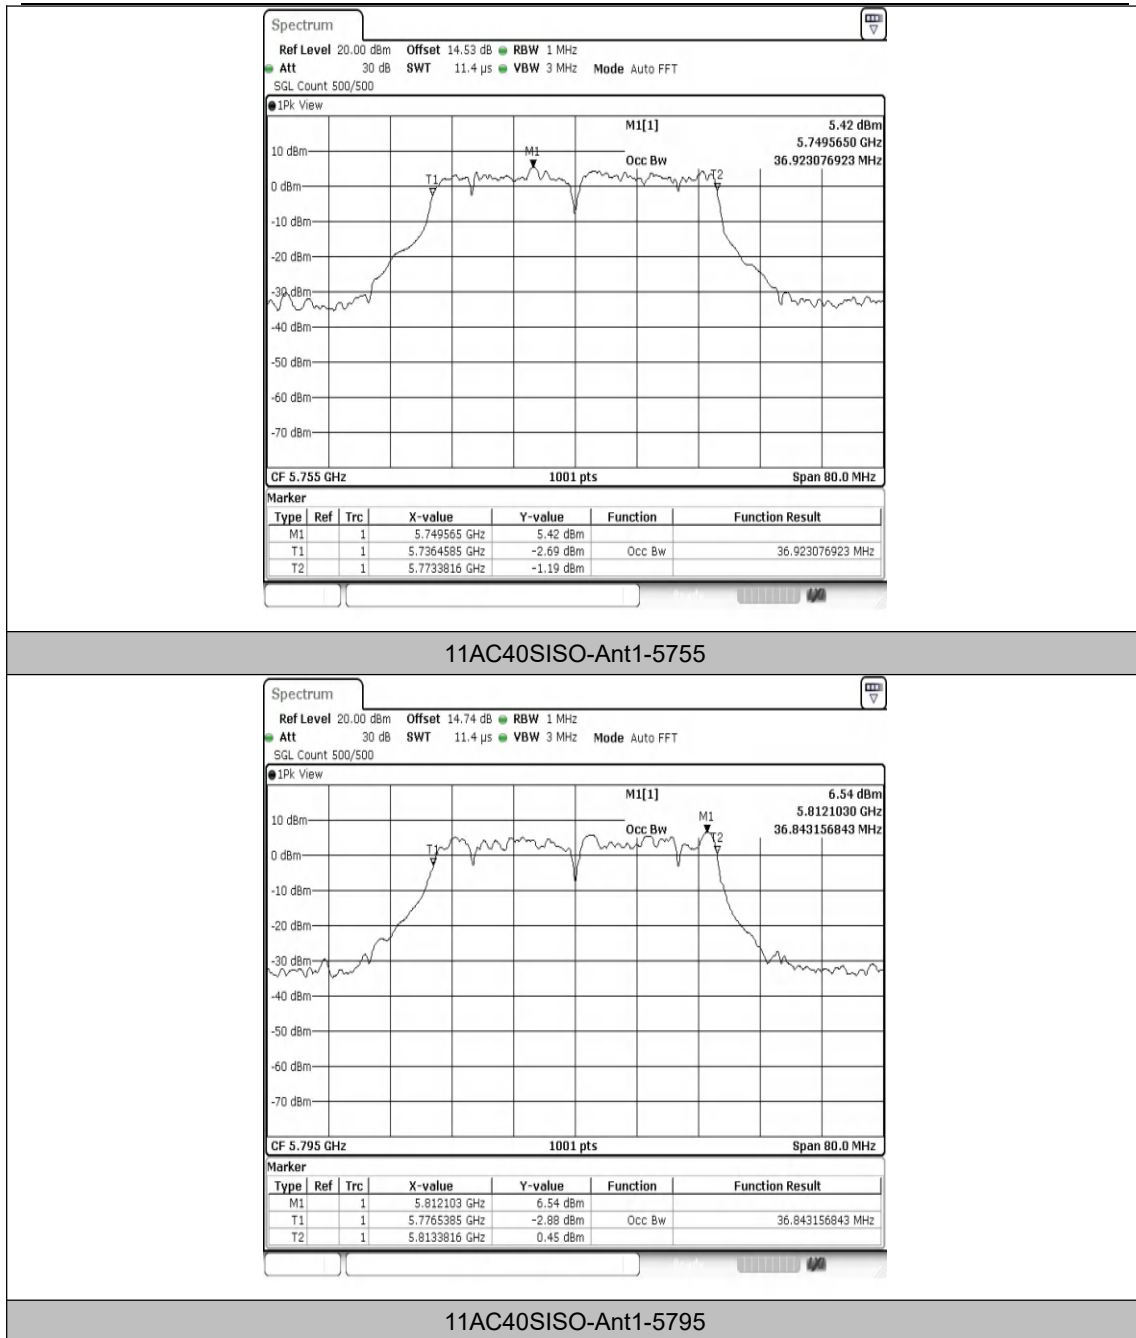


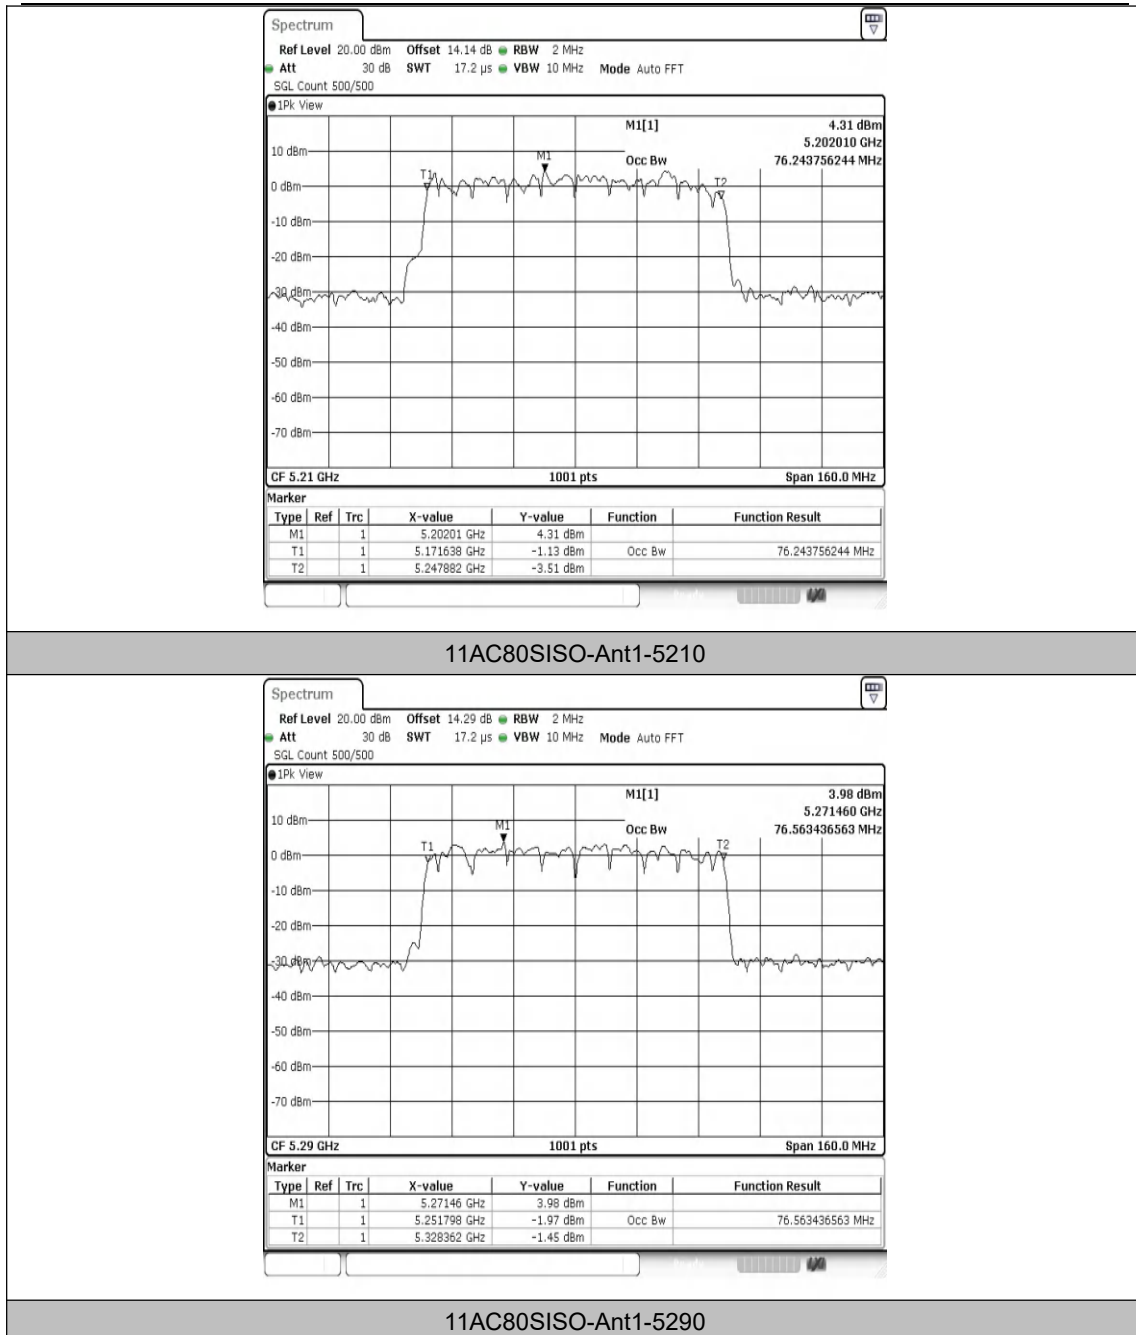

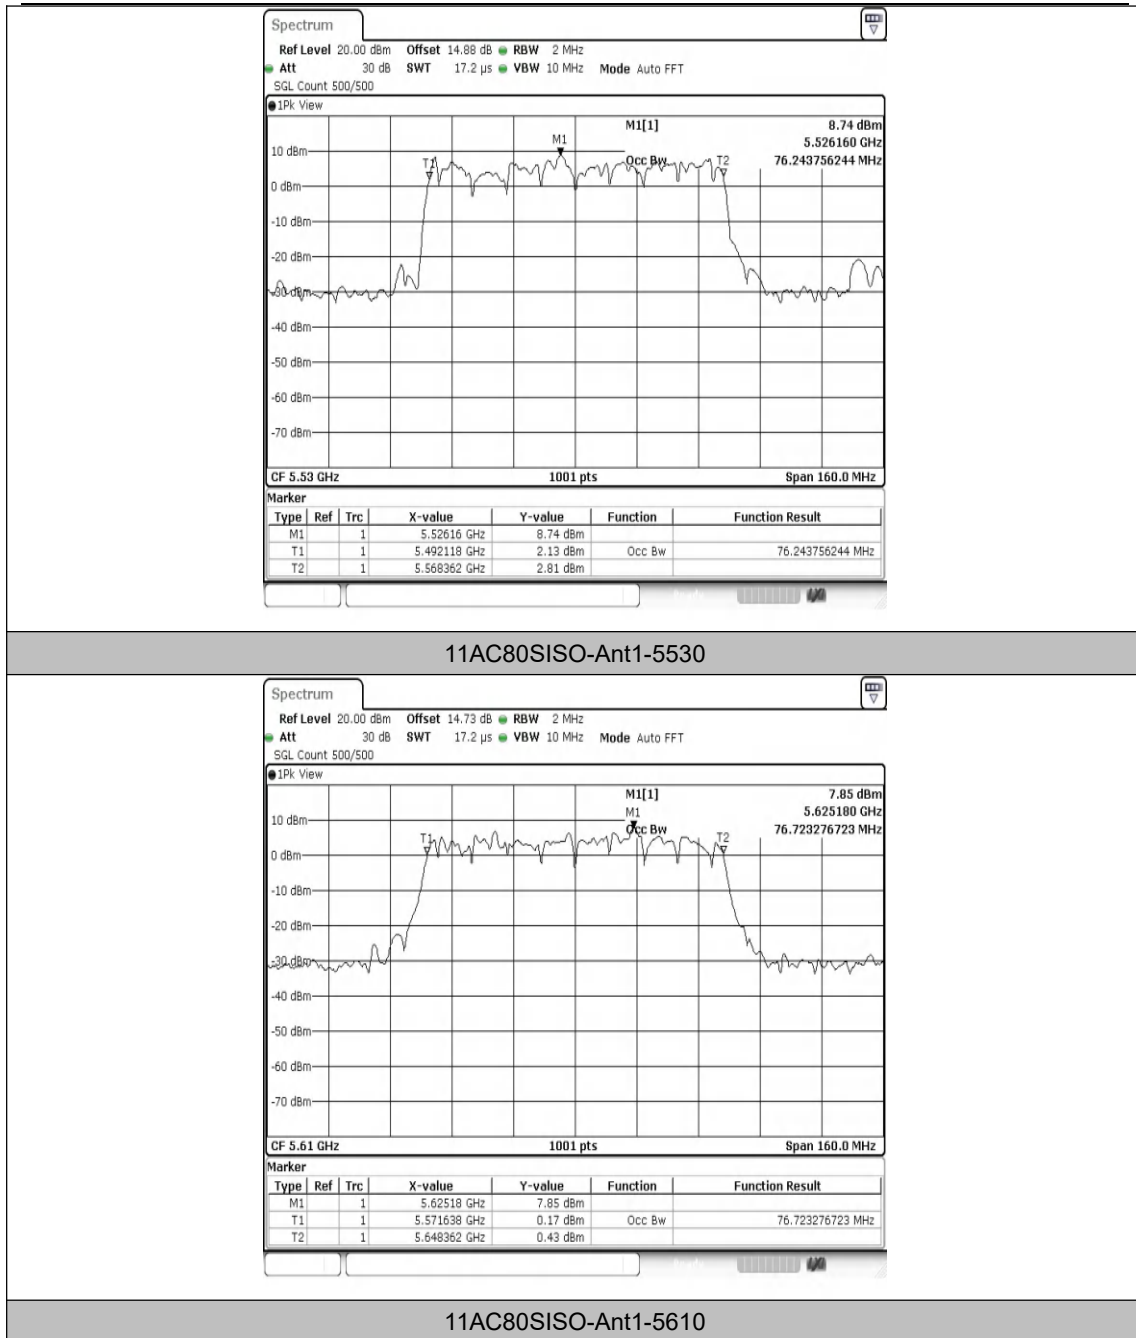

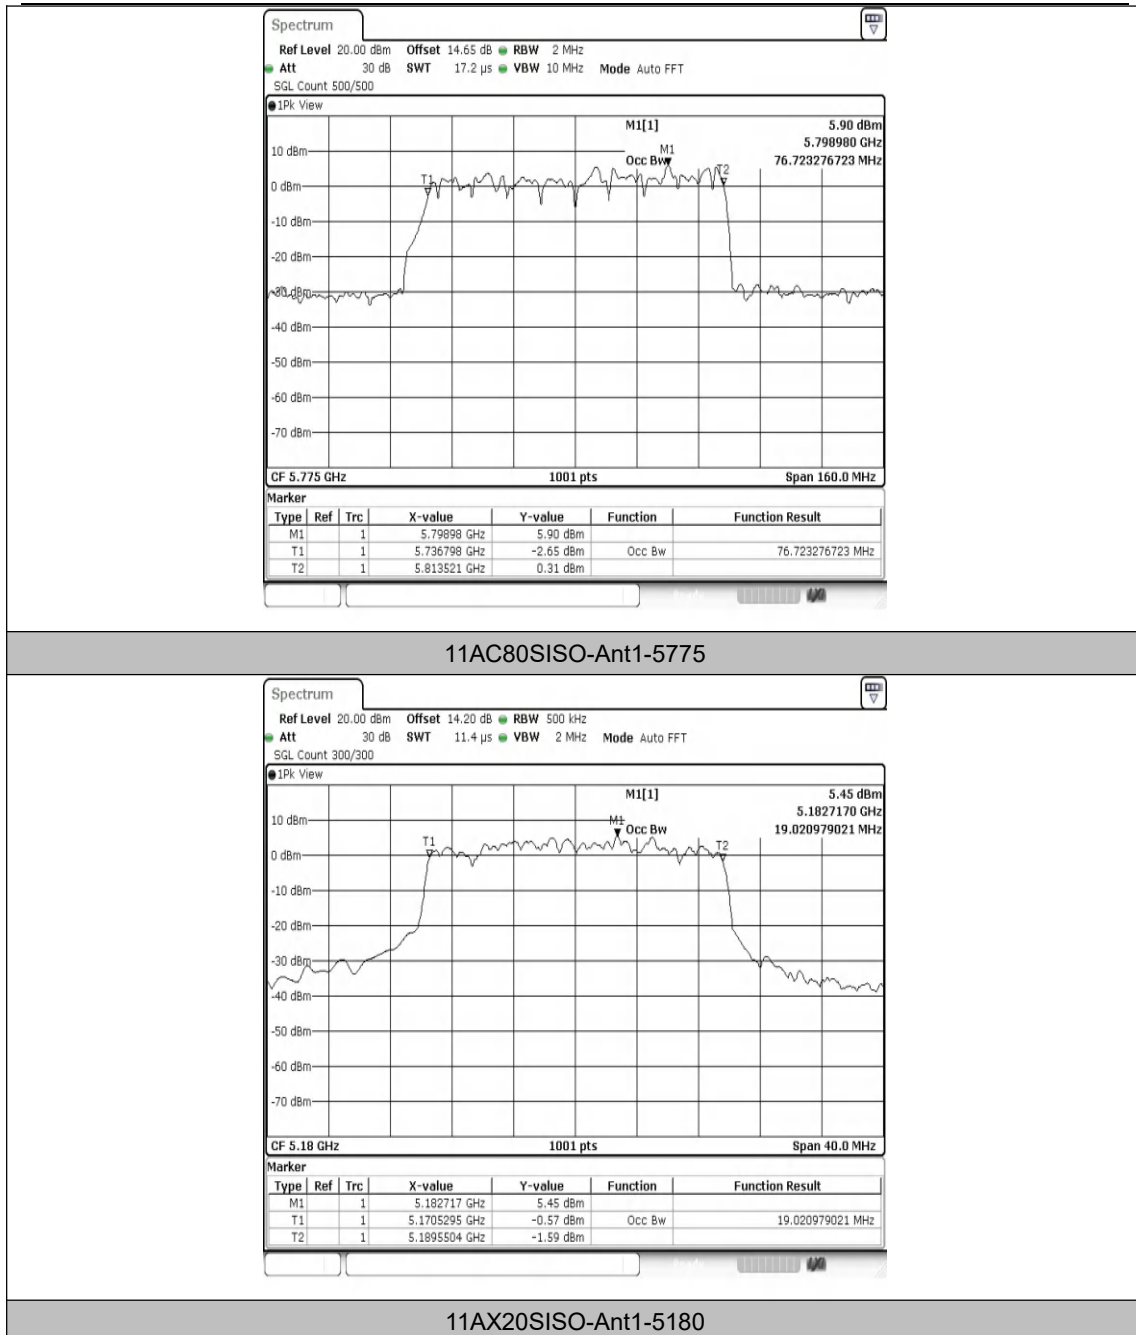

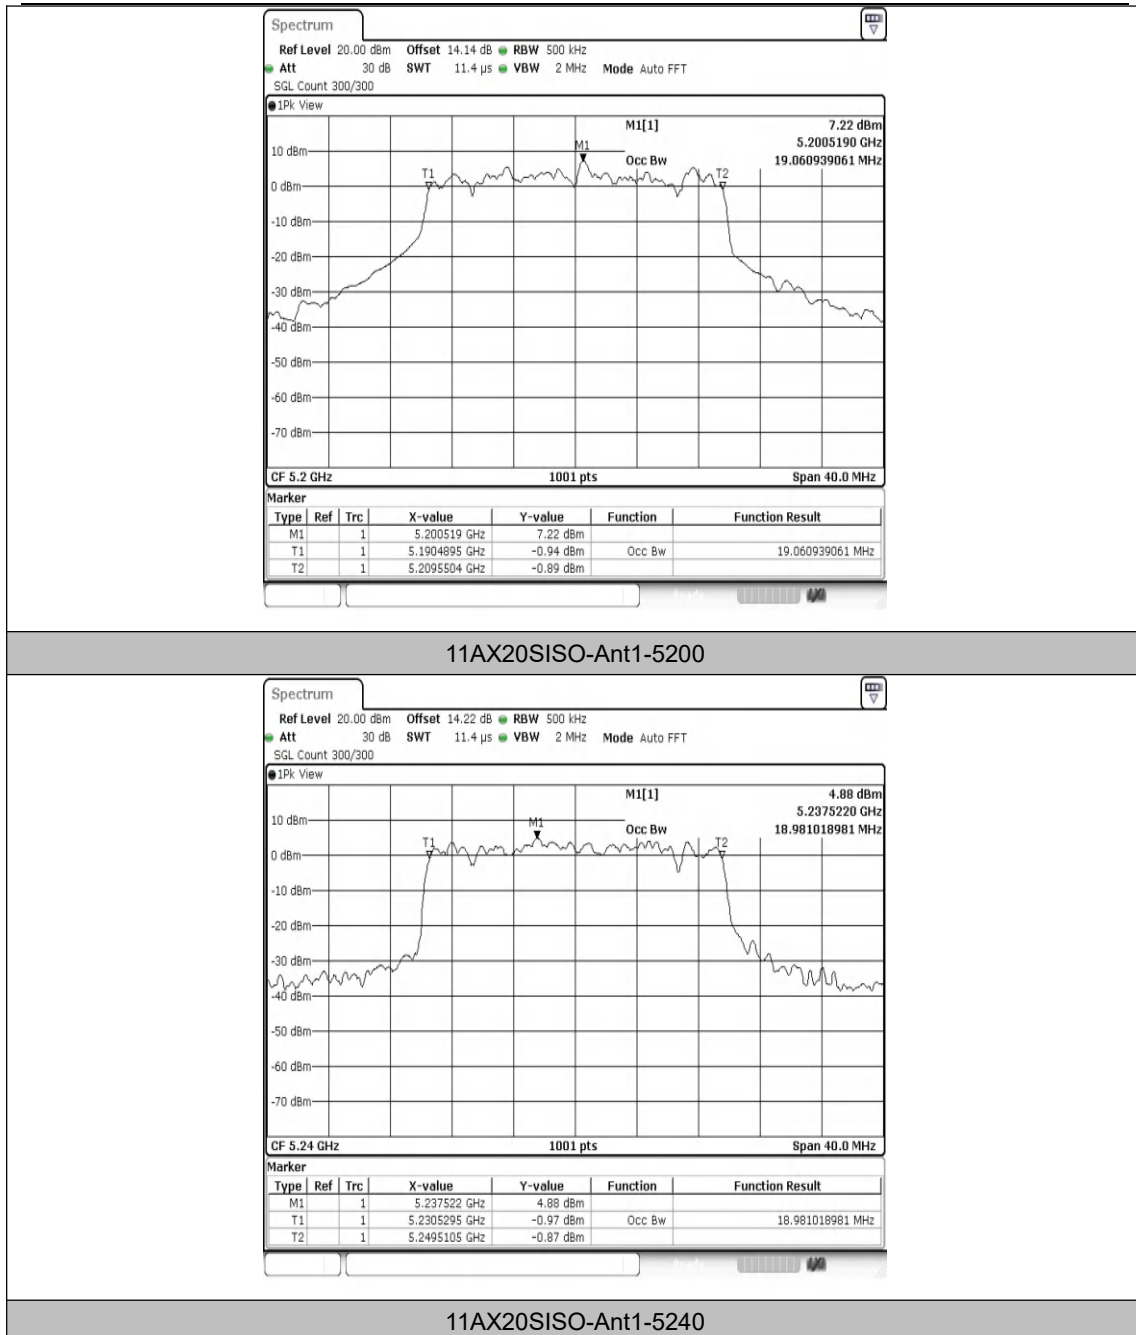


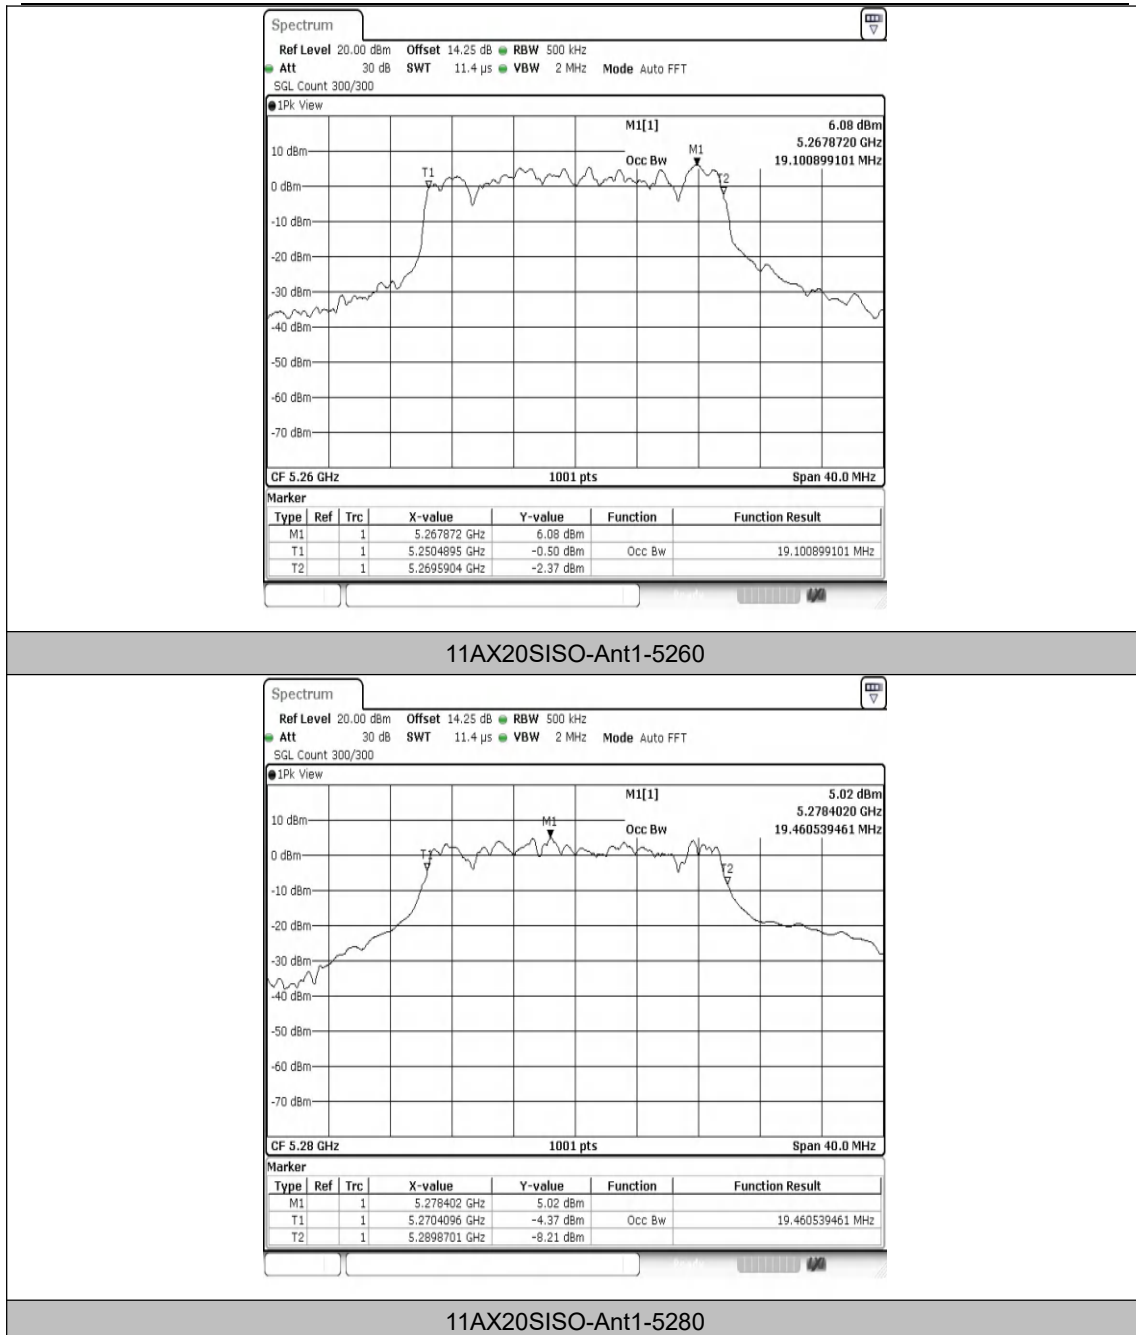



Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com

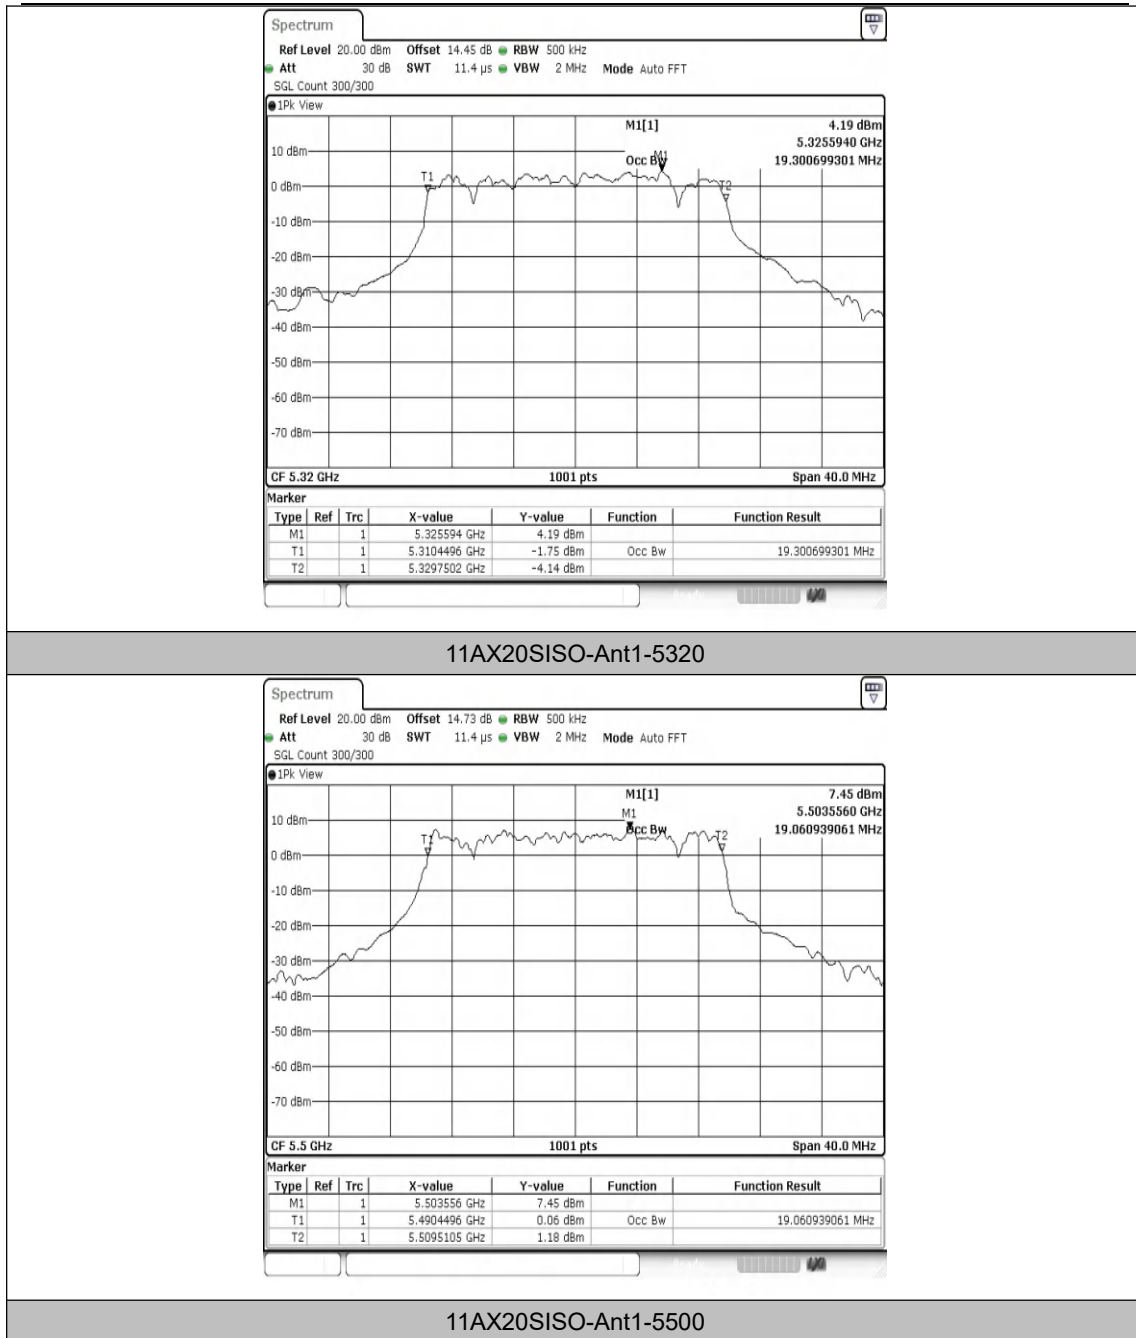

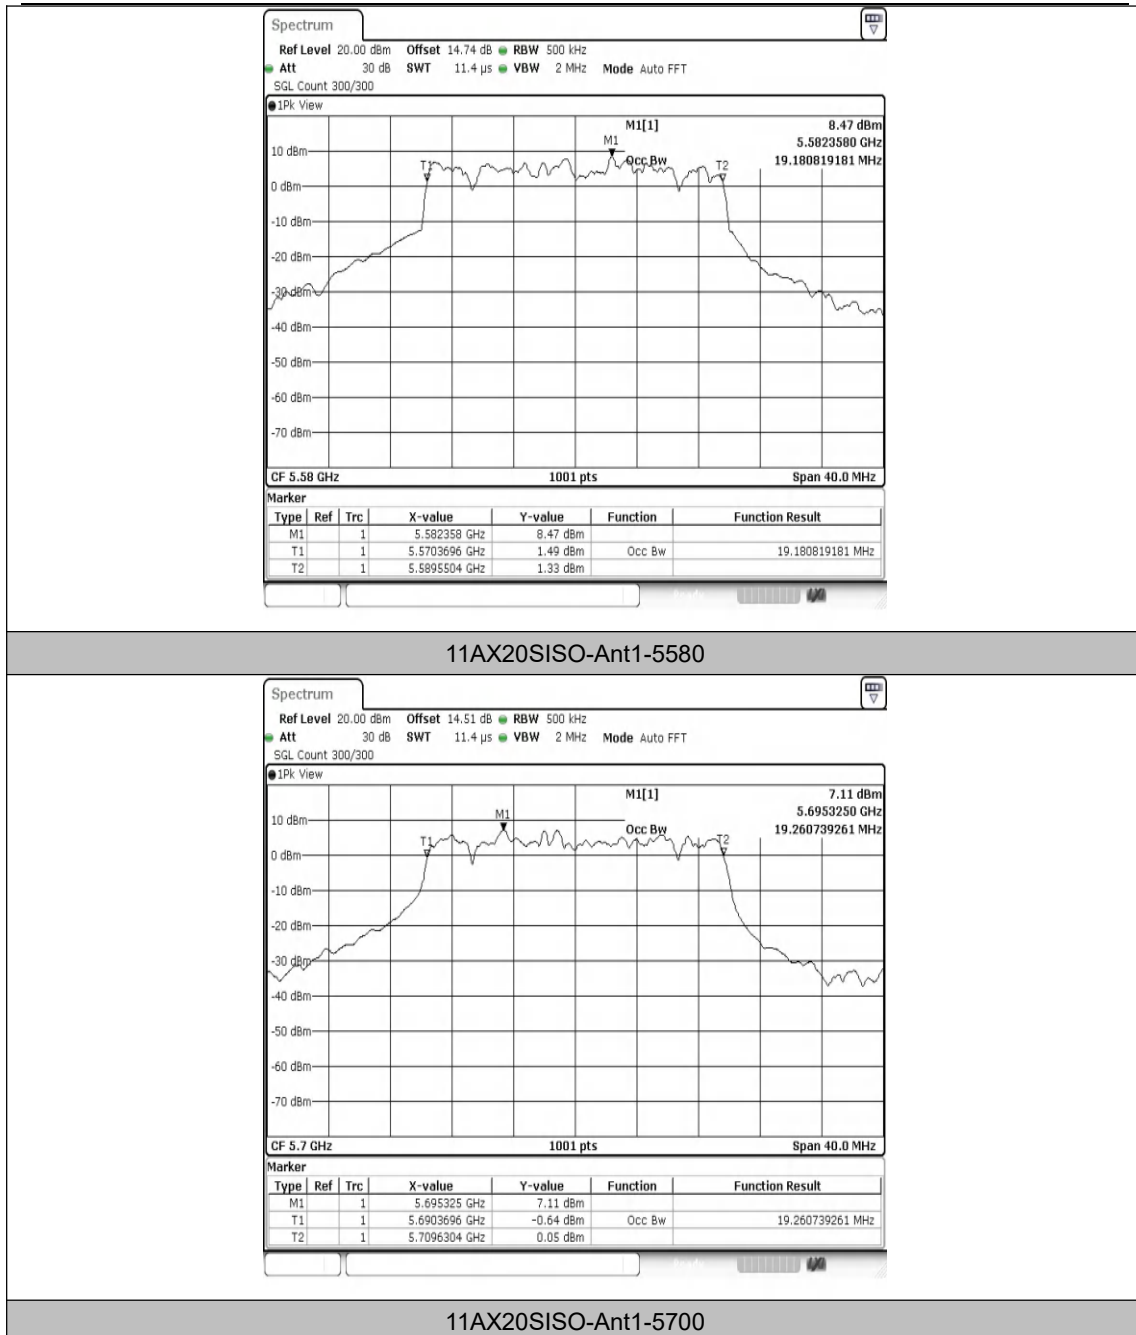

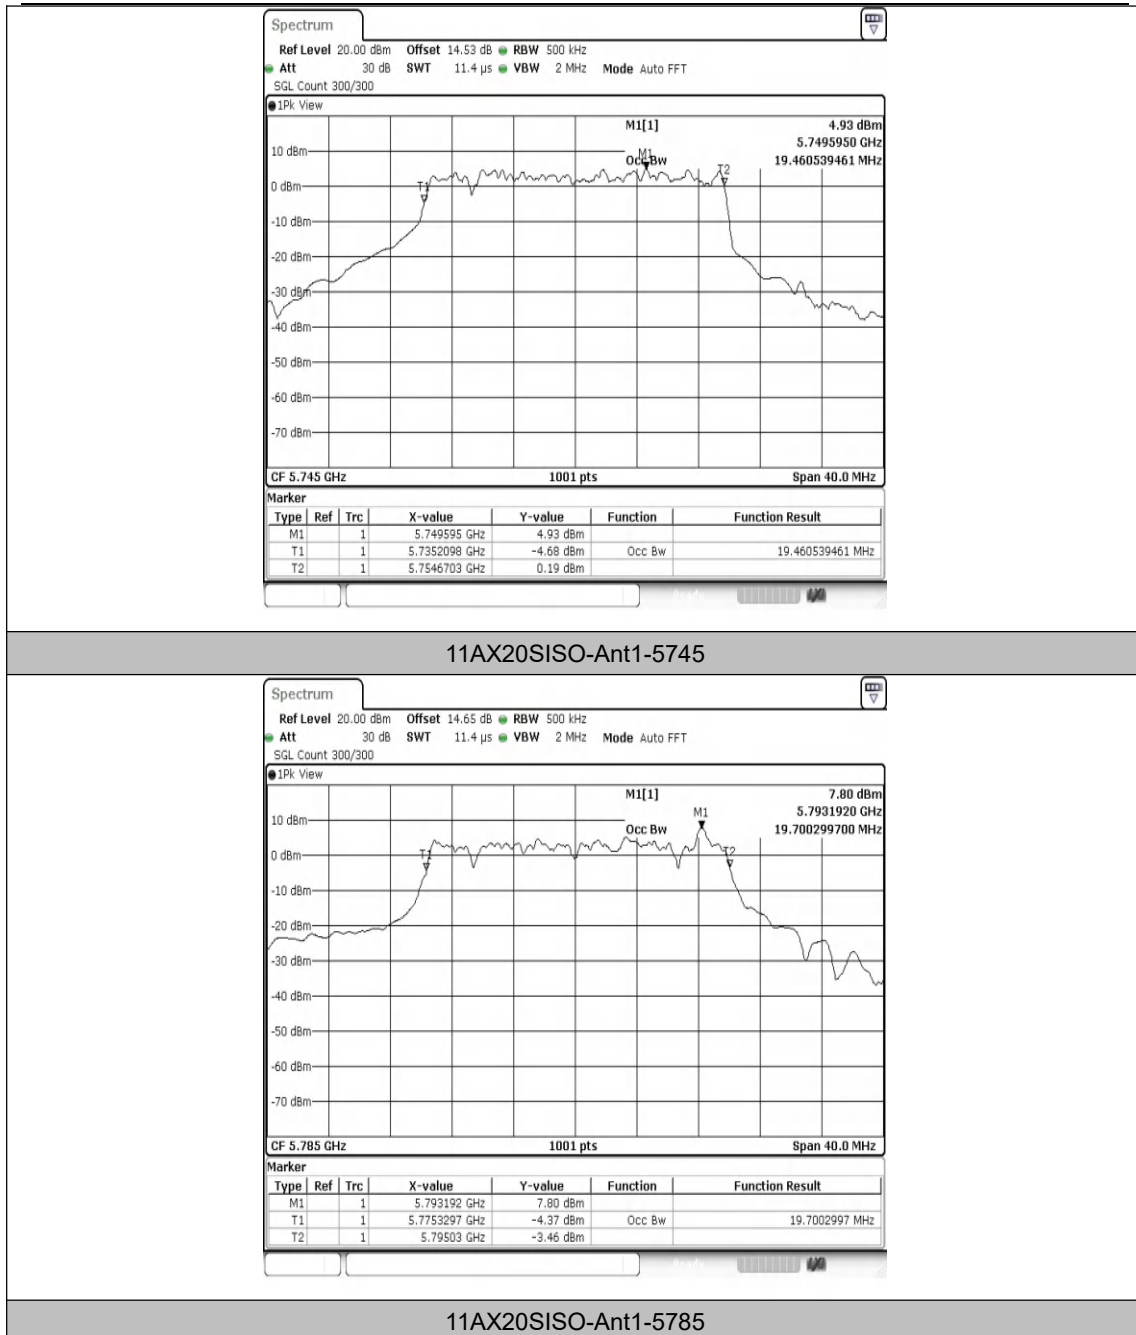


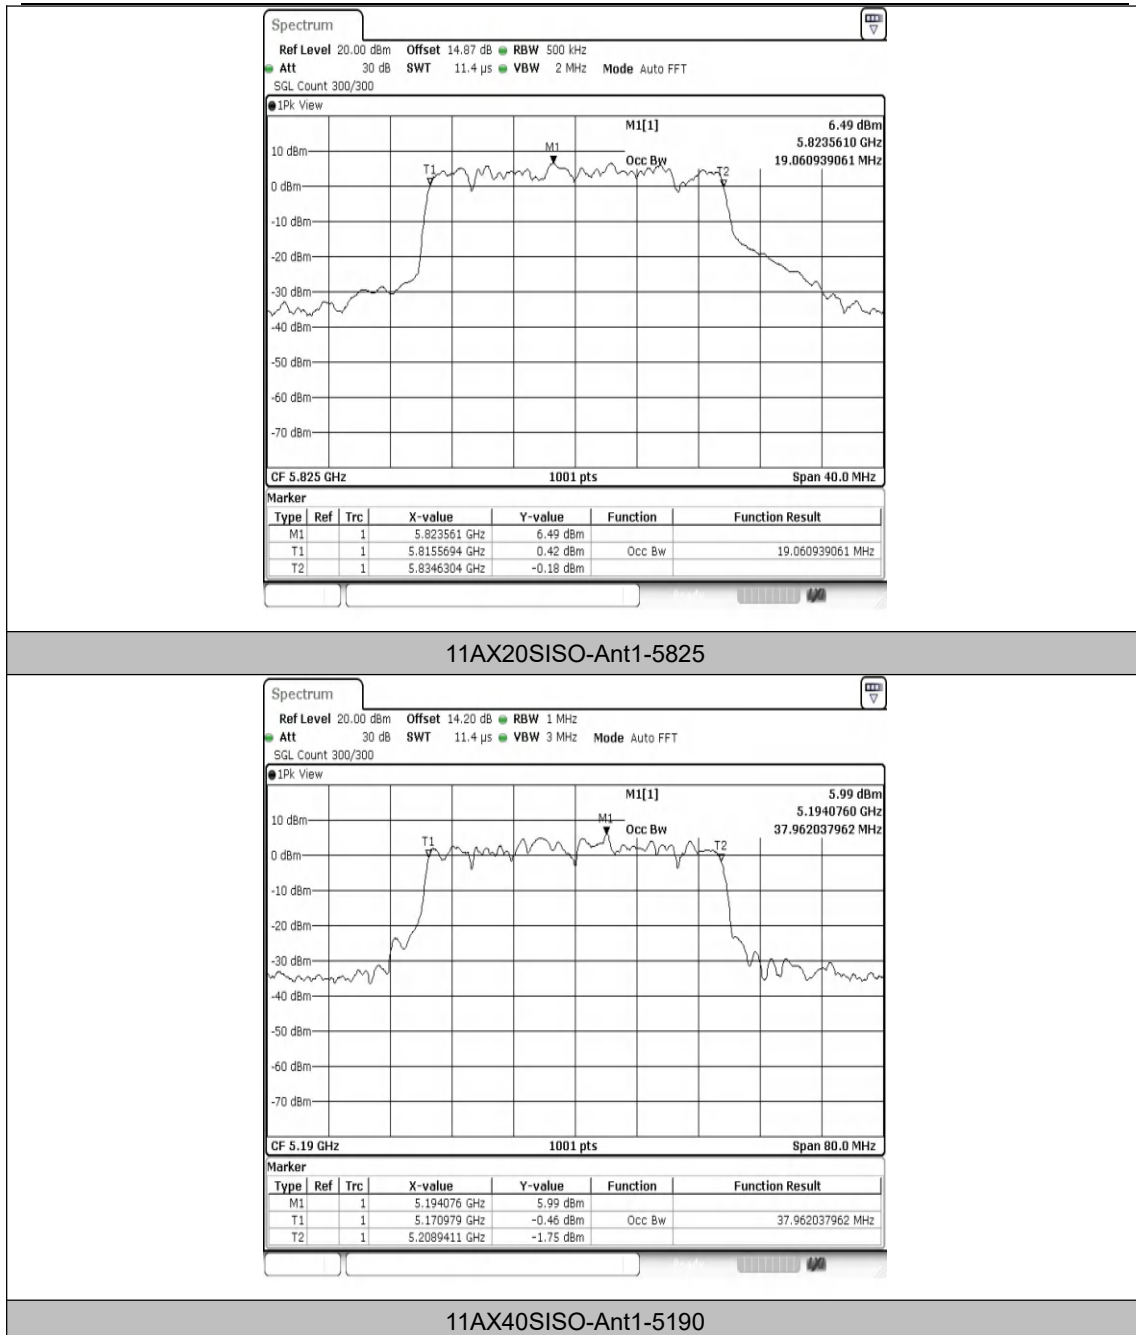


Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

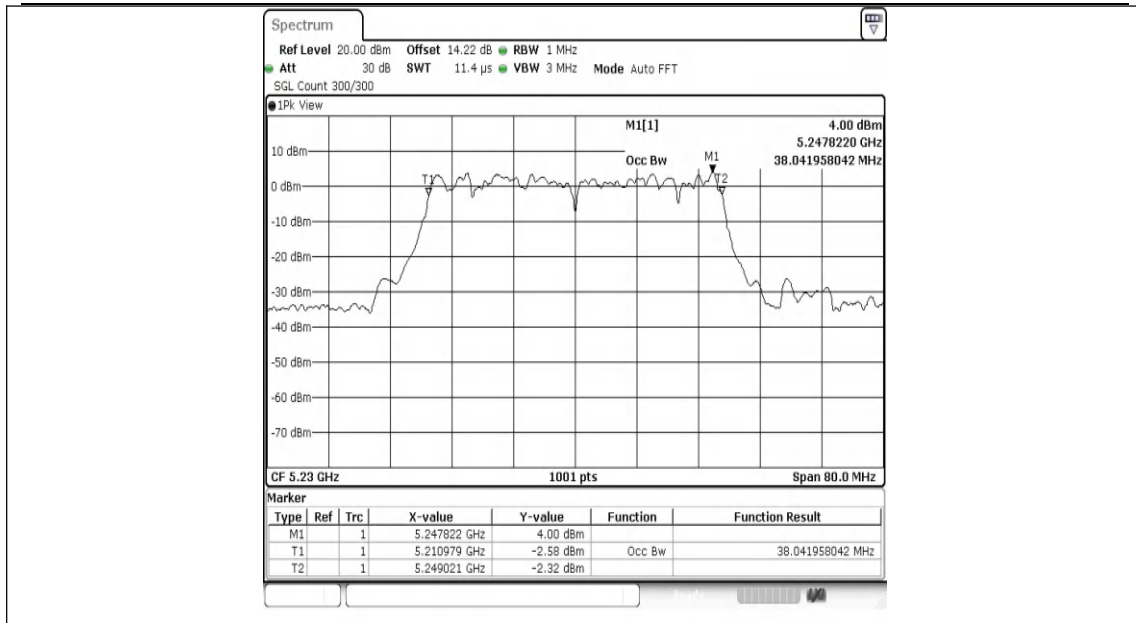



11AX40SISO-Ant1-5230

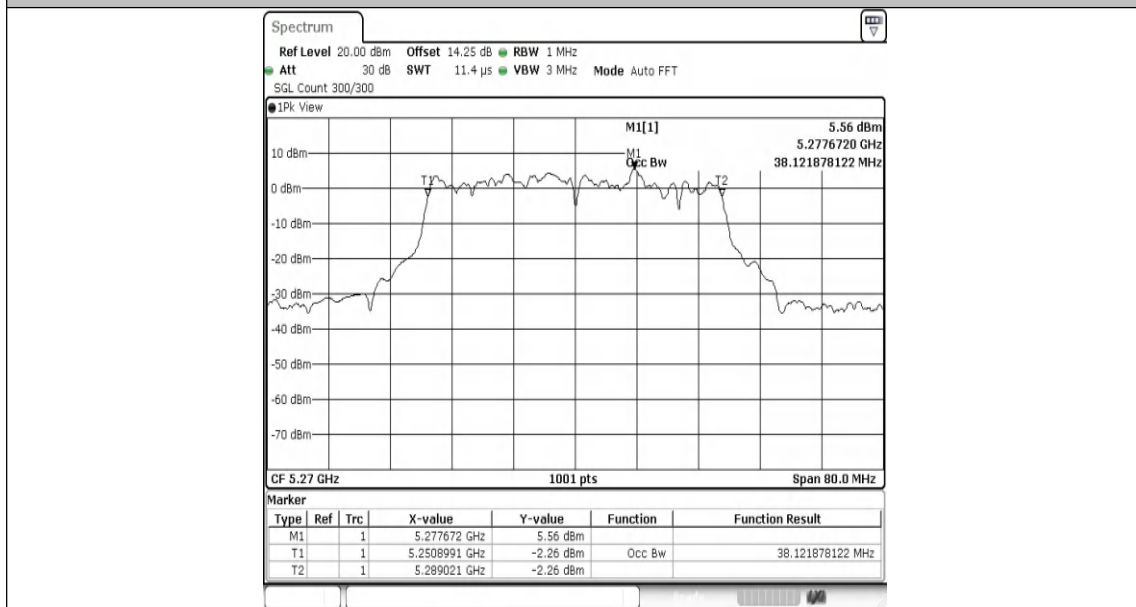



11AX40SISO-Ant1-5270

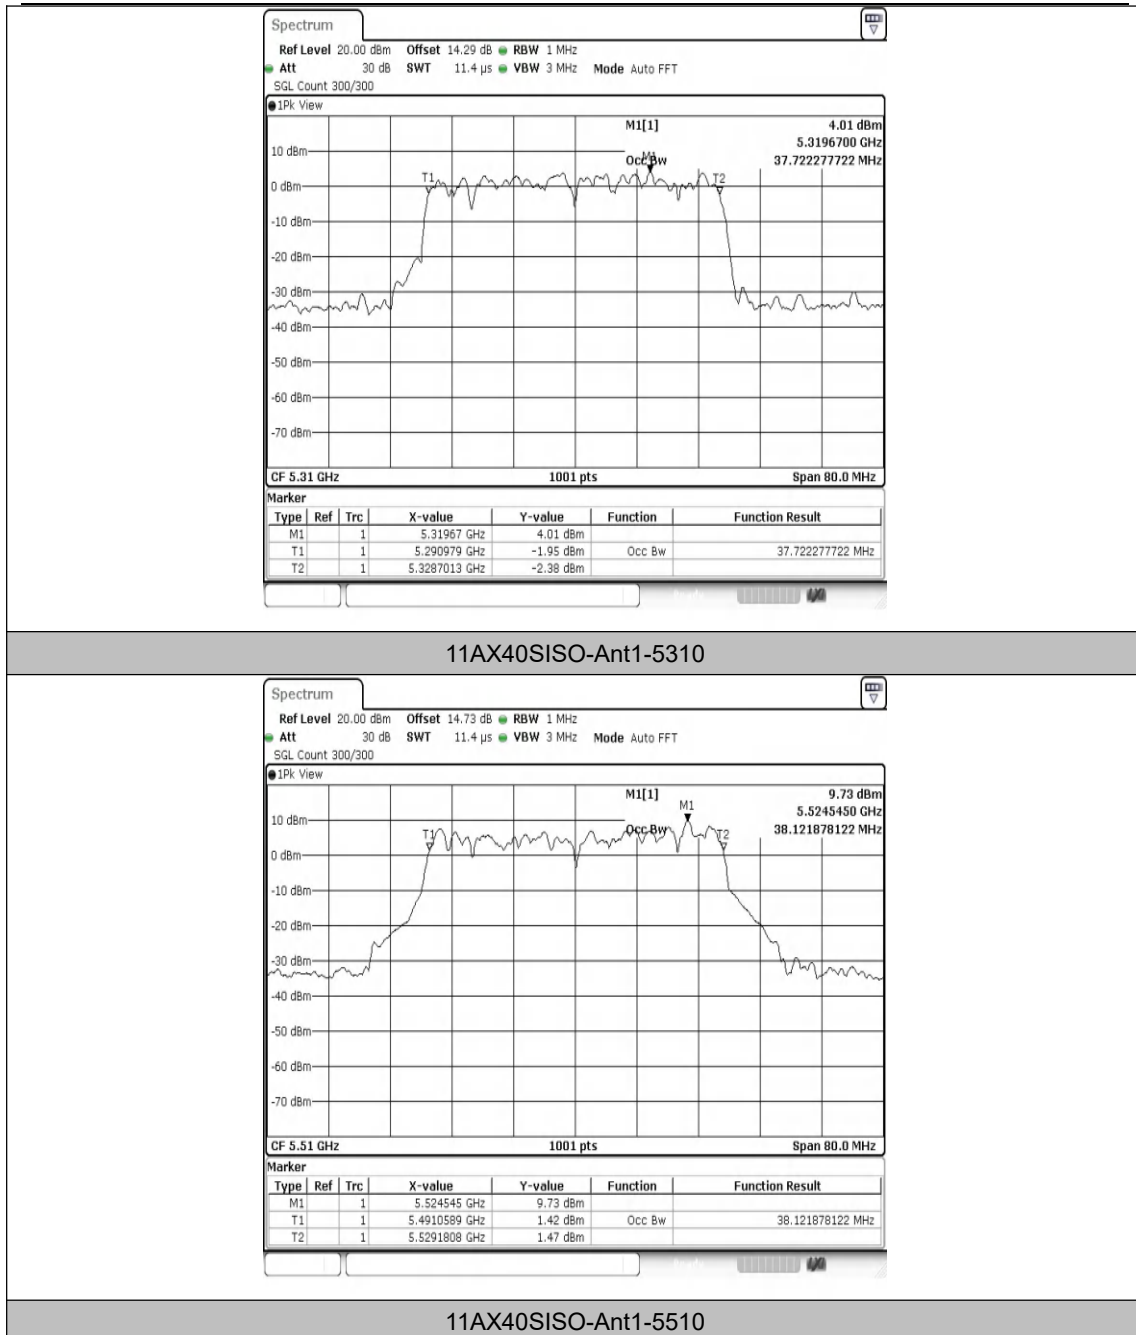

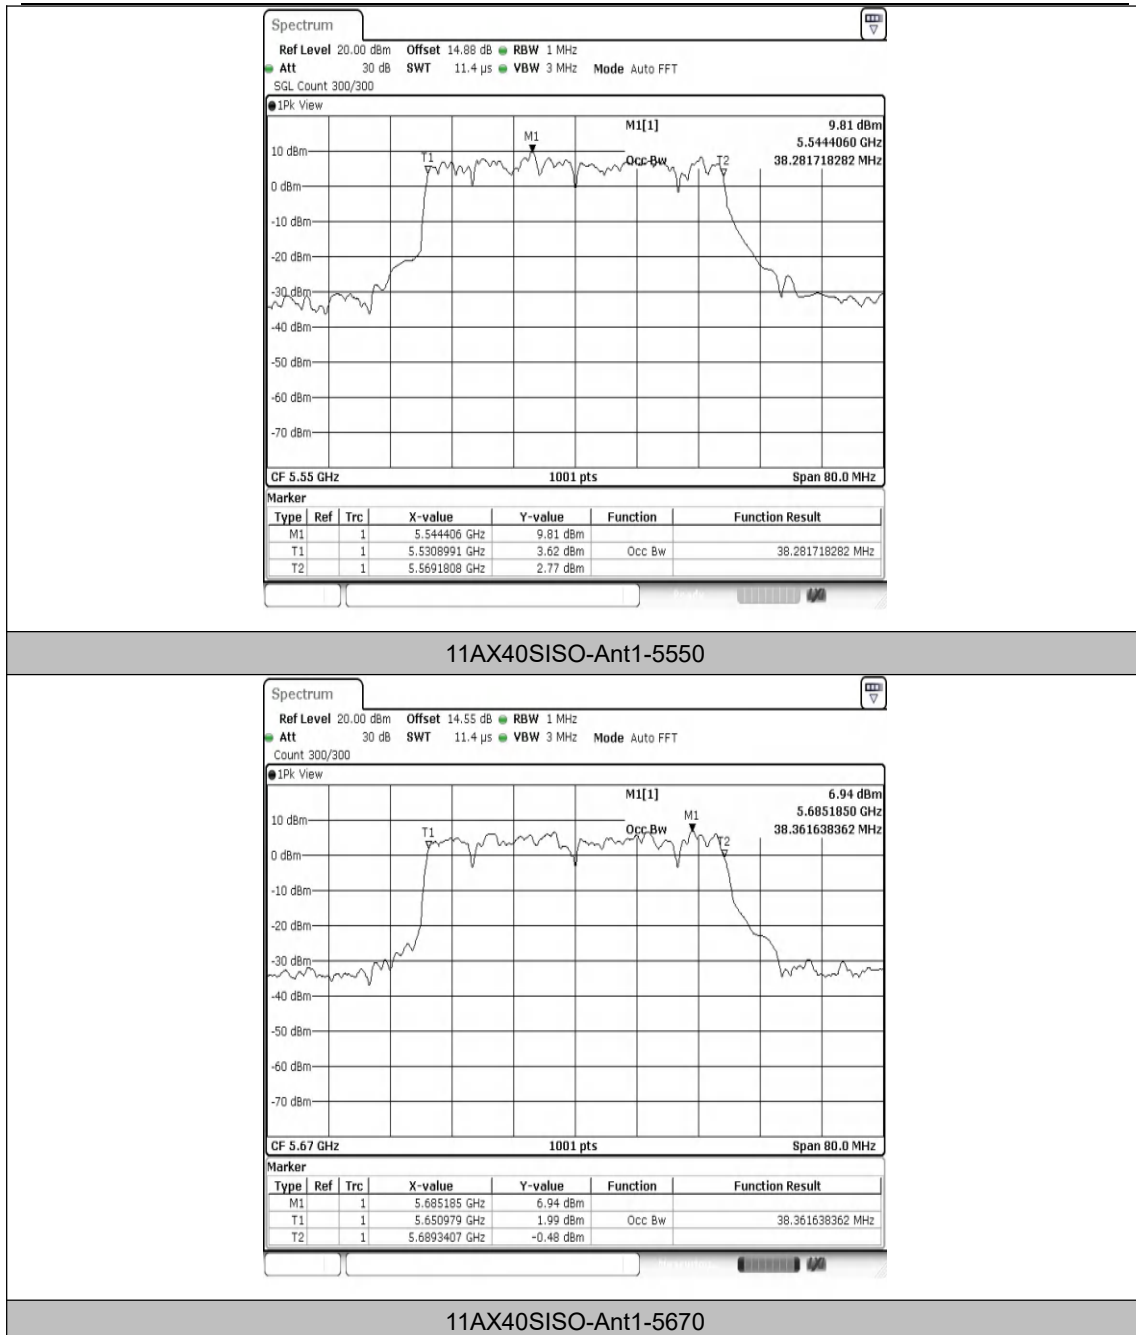


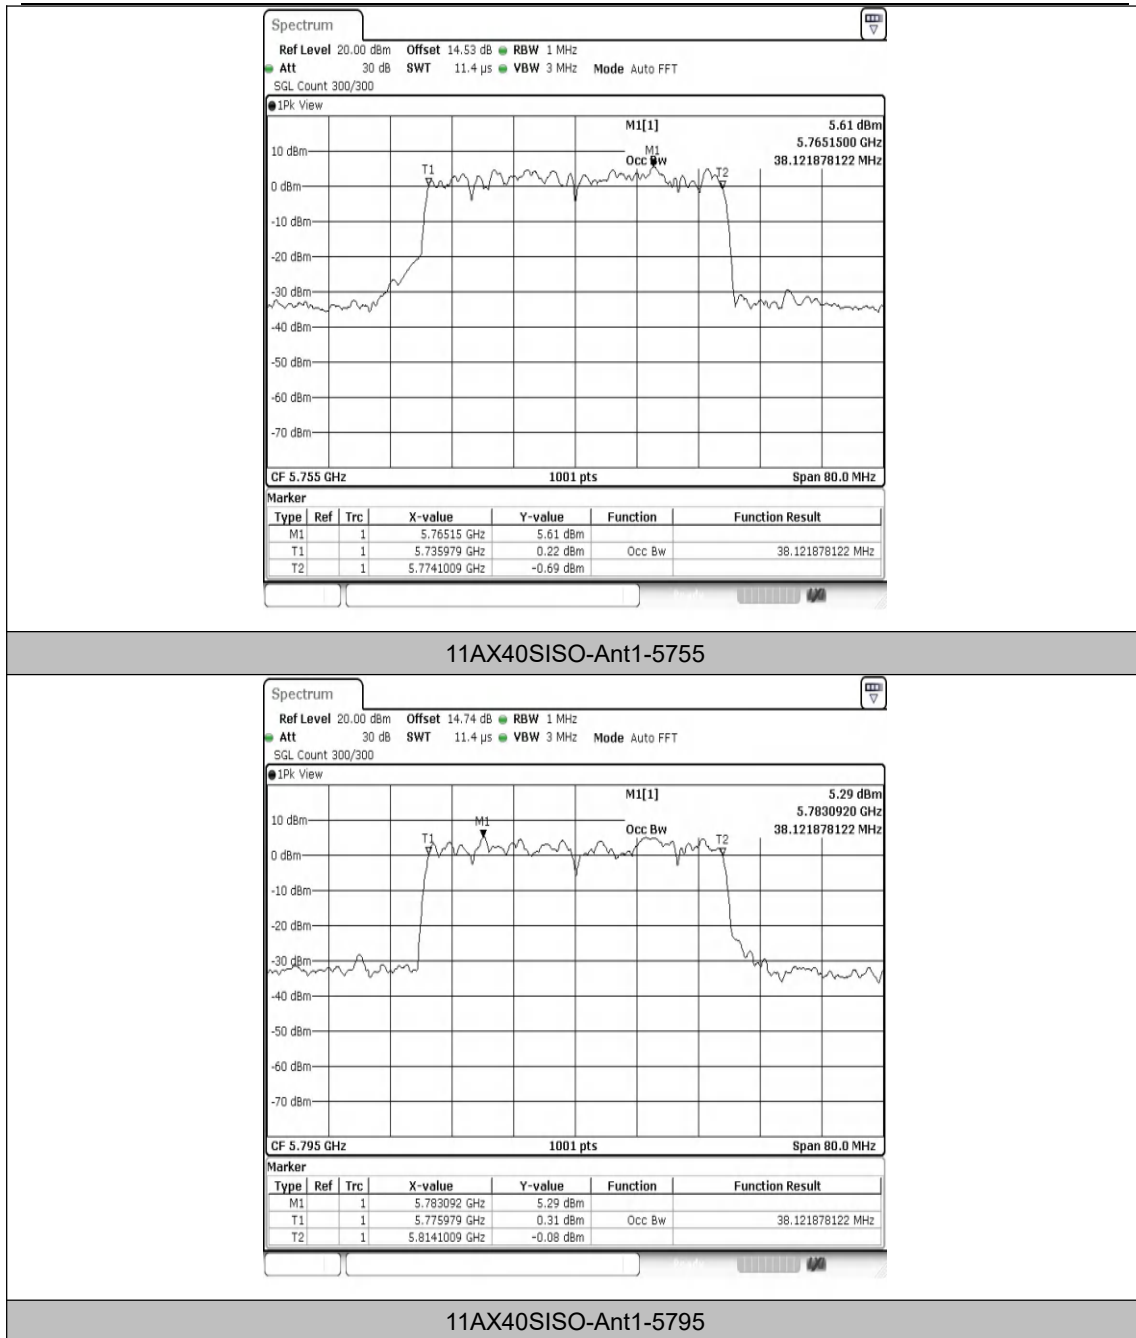

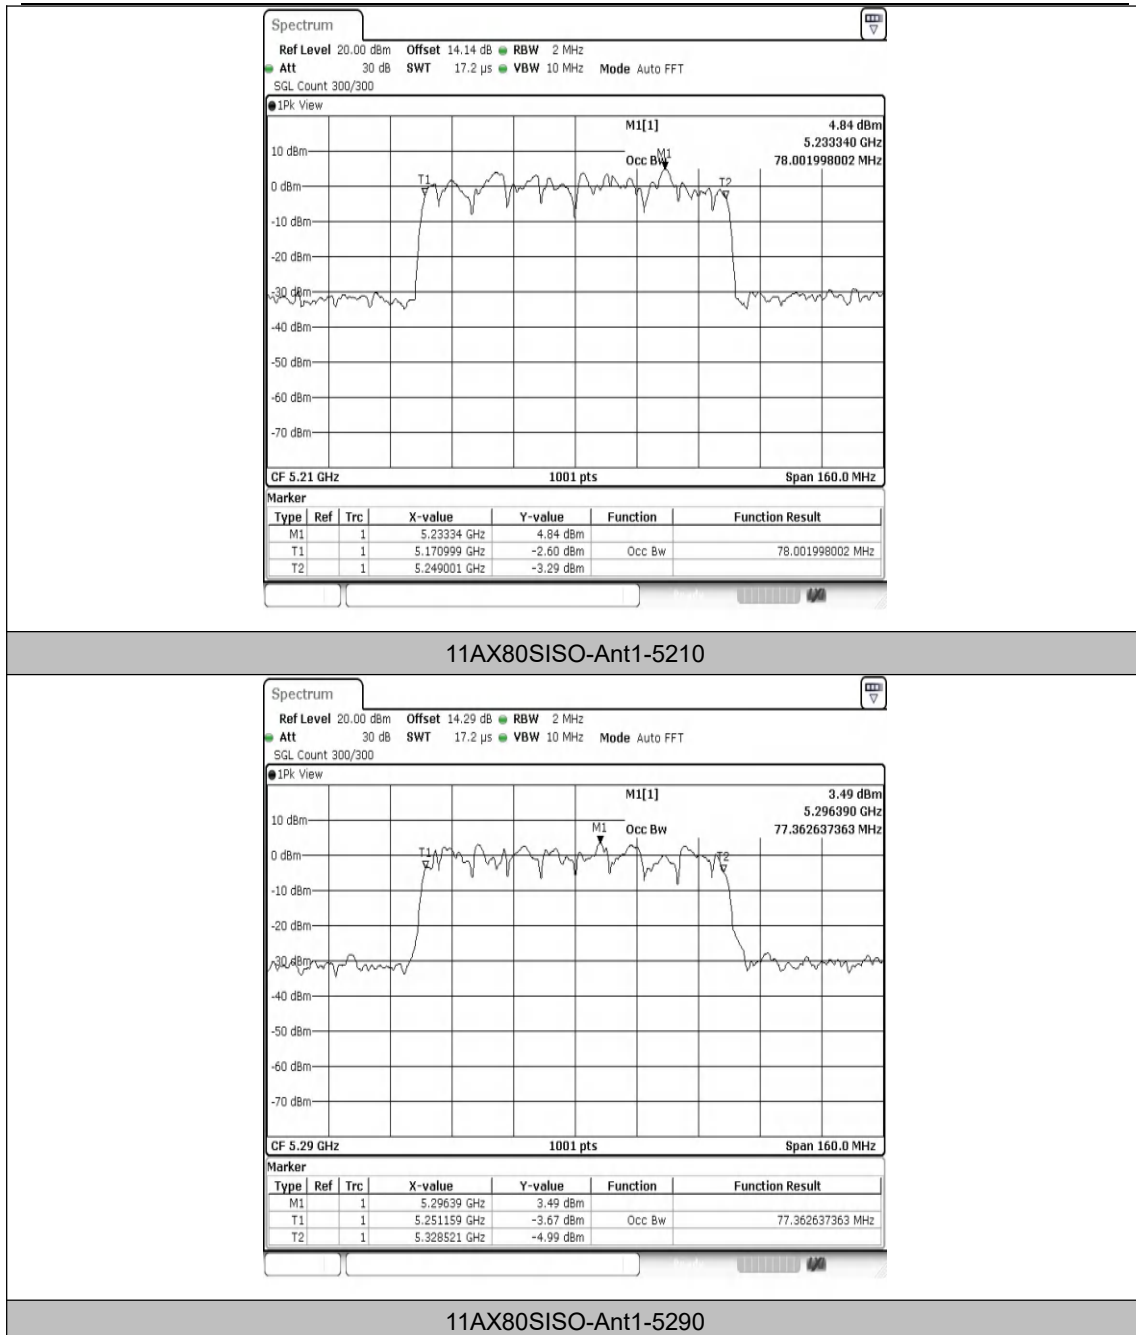

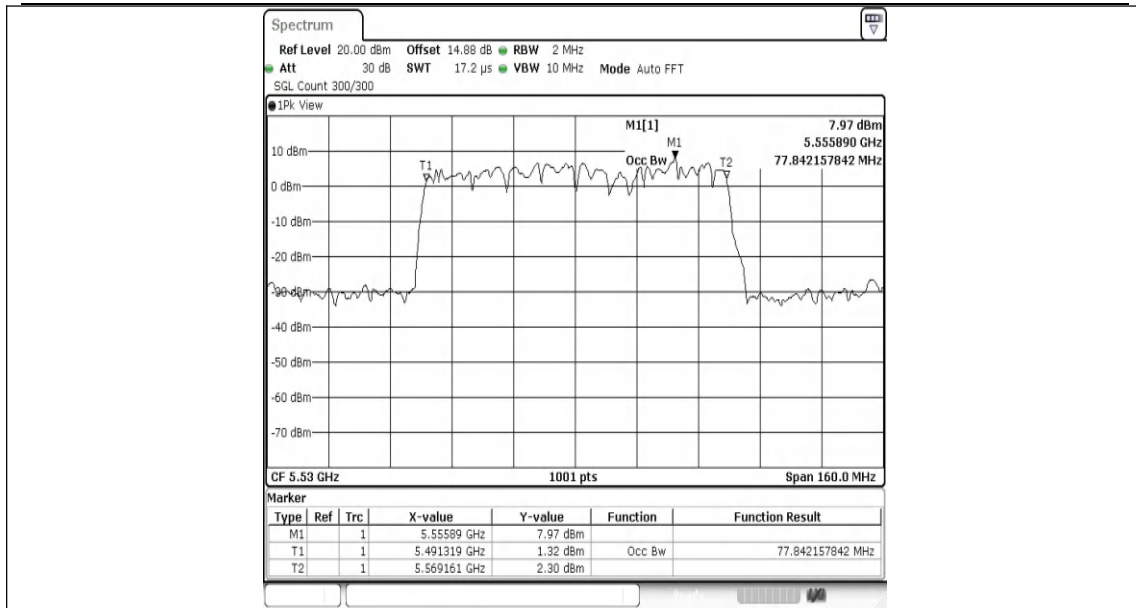

11AX80SISO-Ant1-5530

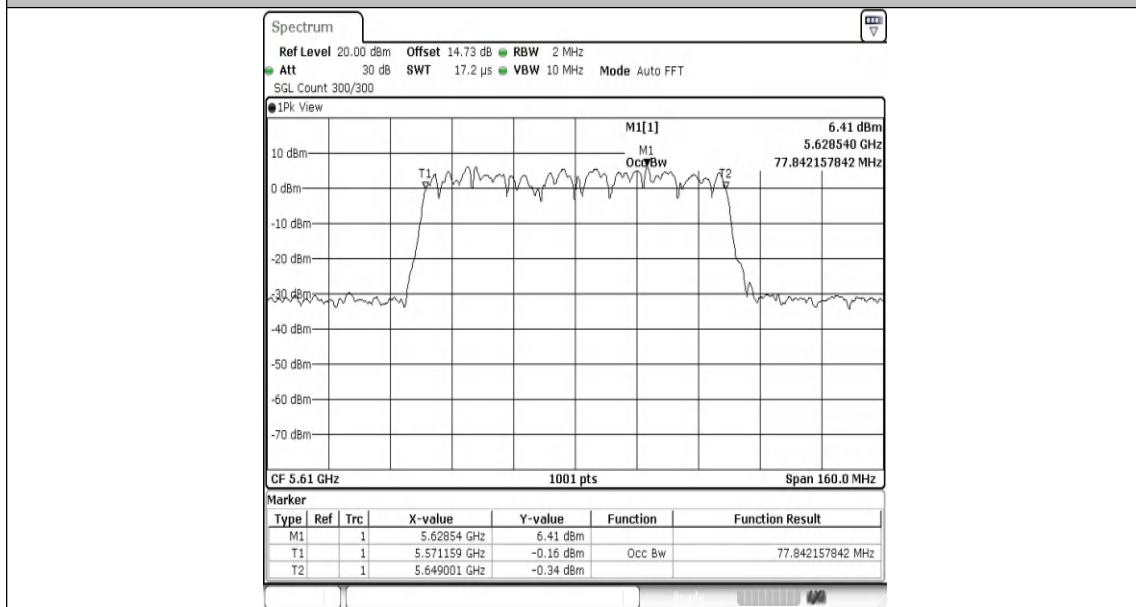

11AX80SISO-Ant1-5610



Shenzhen Anbotek Compliance Laboratory Limited