




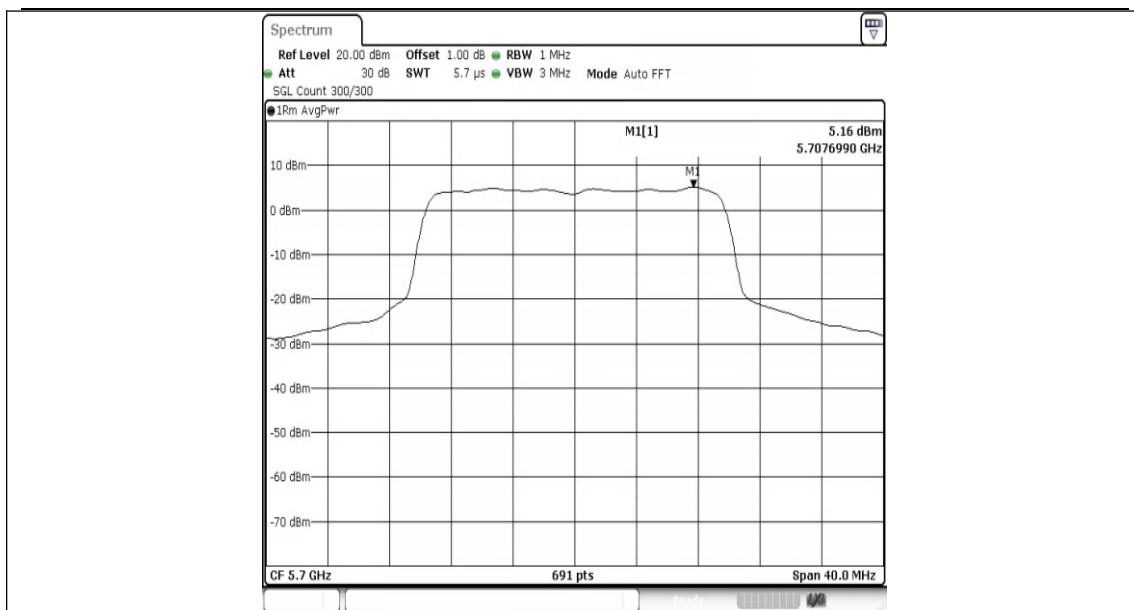

11AX20SISO-Ant1-5700-PASS

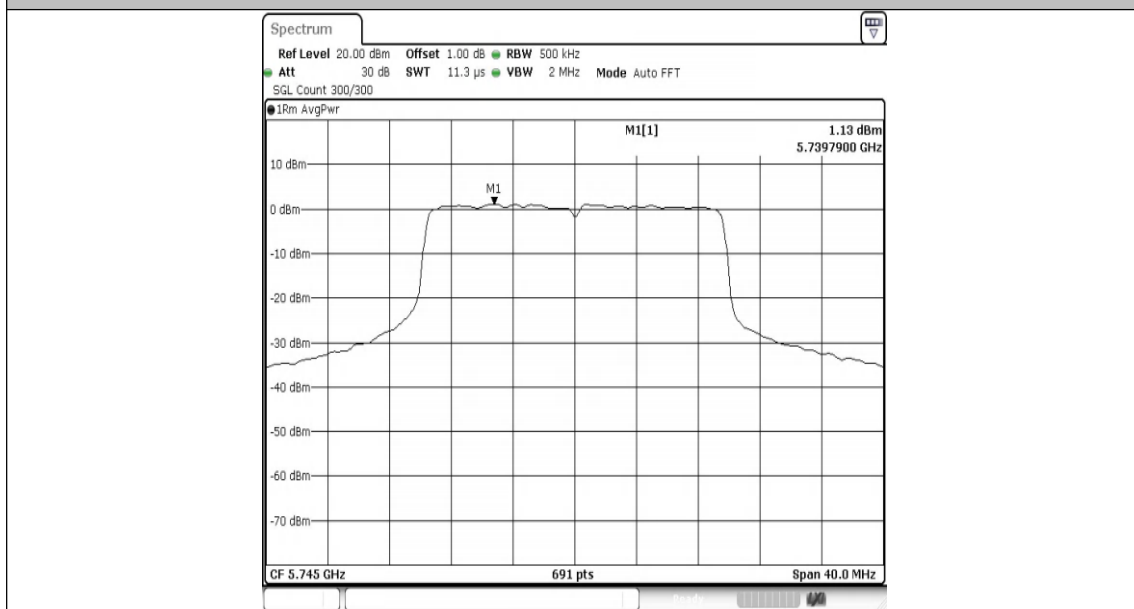


11AX20SISO-Ant1-5745-PASS

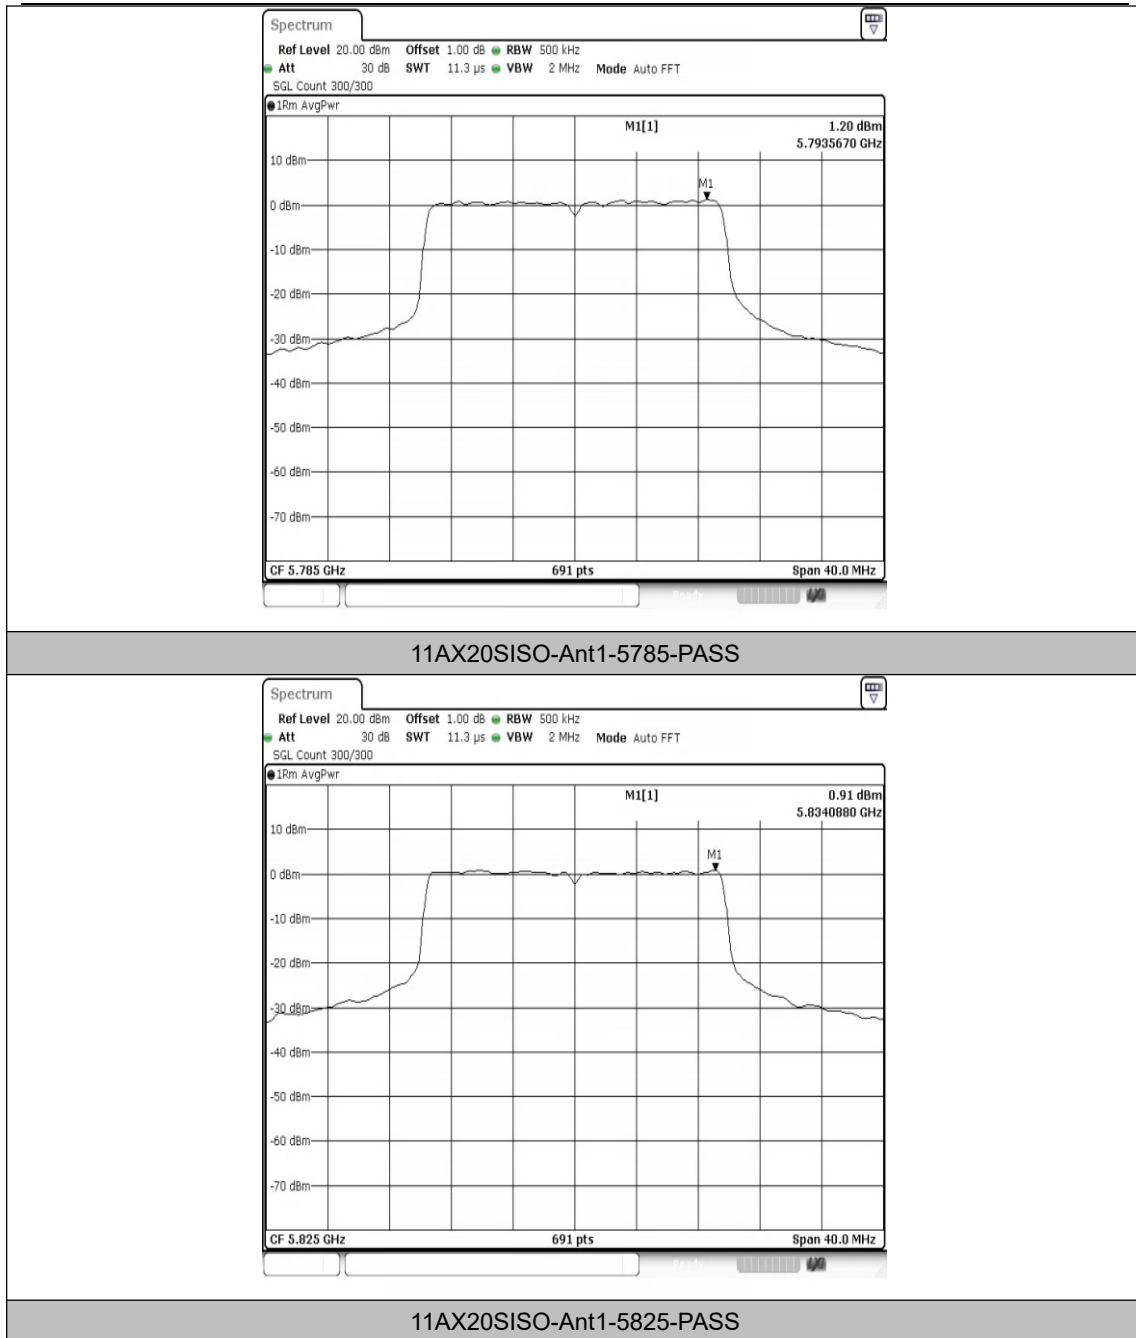


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

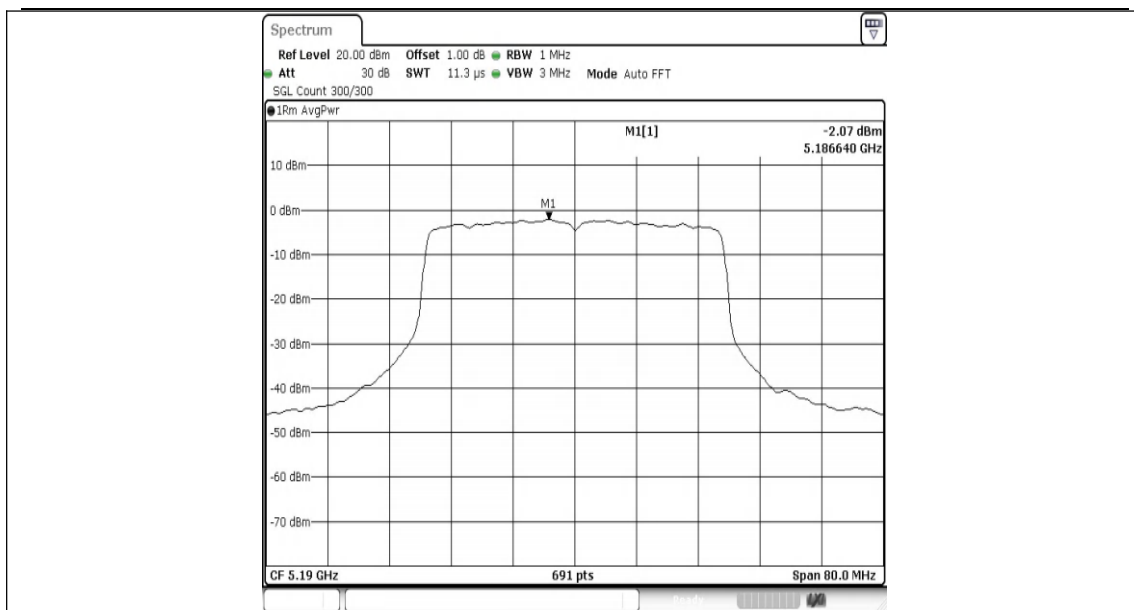


11AX40SISO-Ant1-5190-PASS

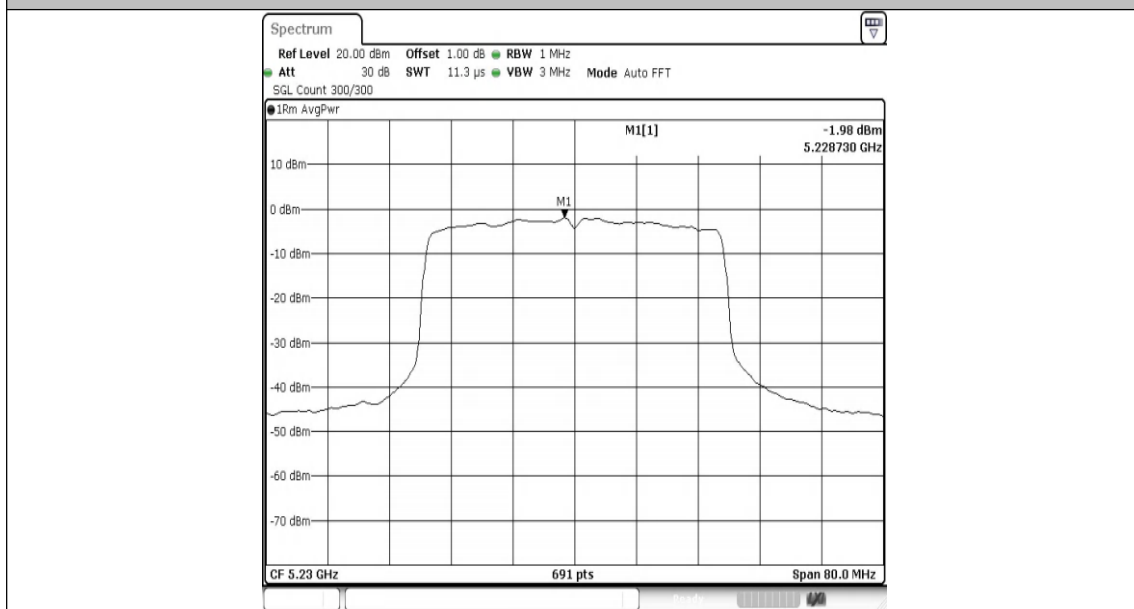


11AX40SISO-Ant1-5230-PASS

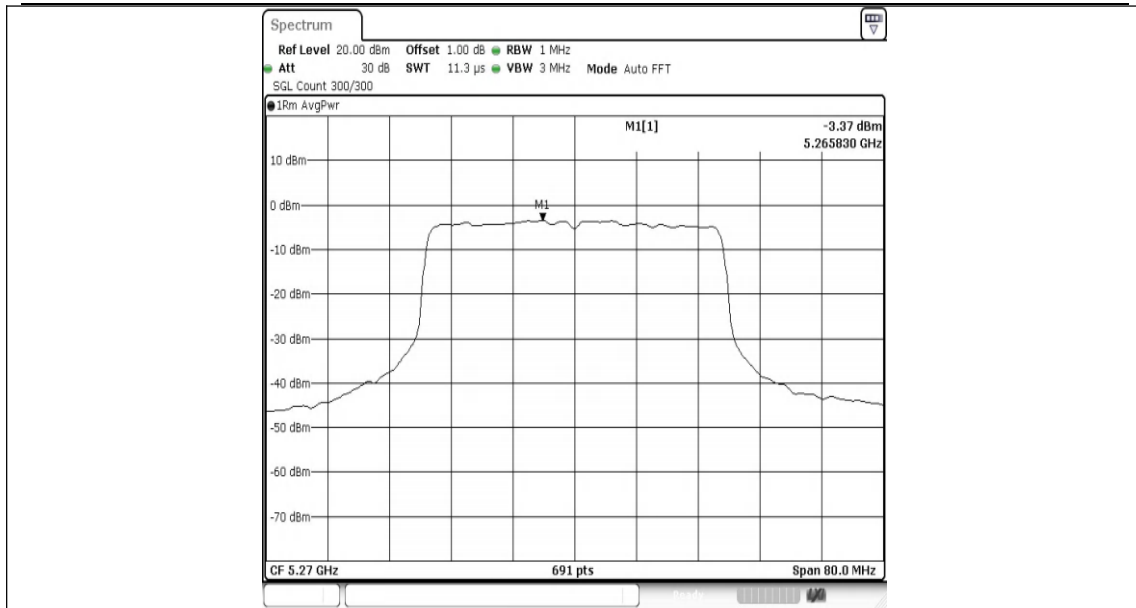


11AX40SISO-Ant1-5270-PASS

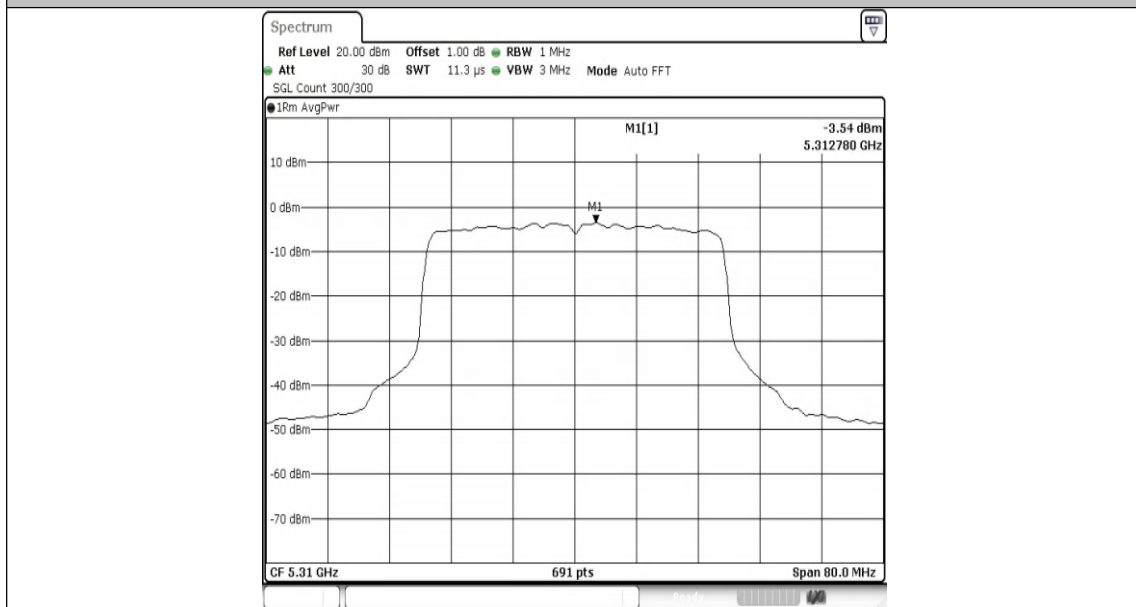


11AX40SISO-Ant1-5310-PASS

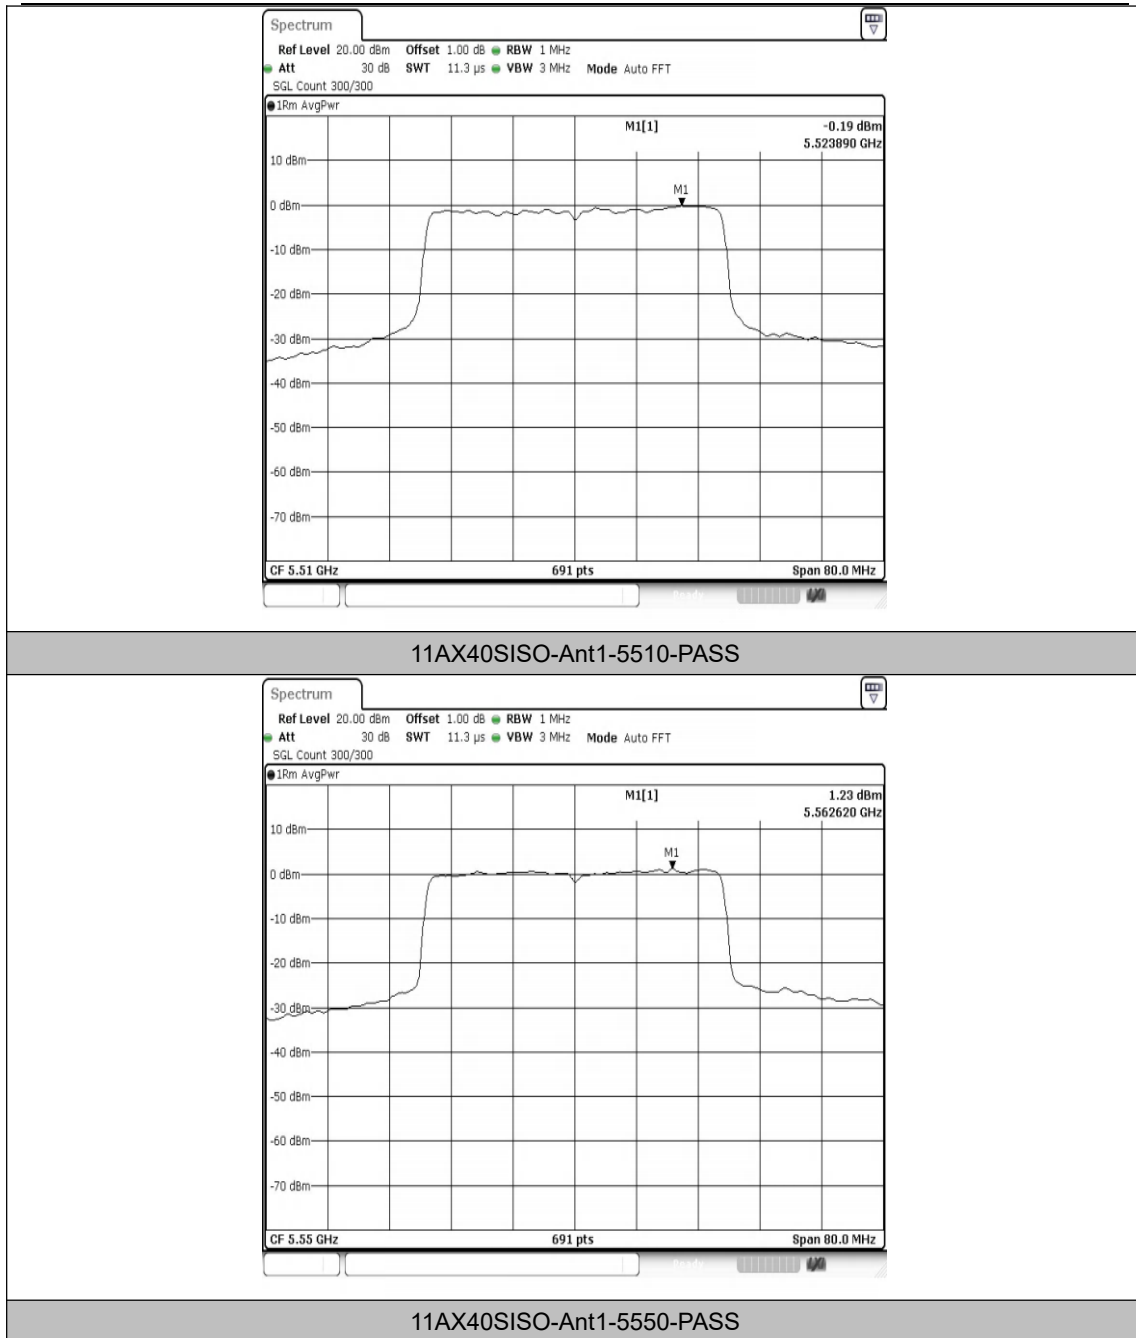


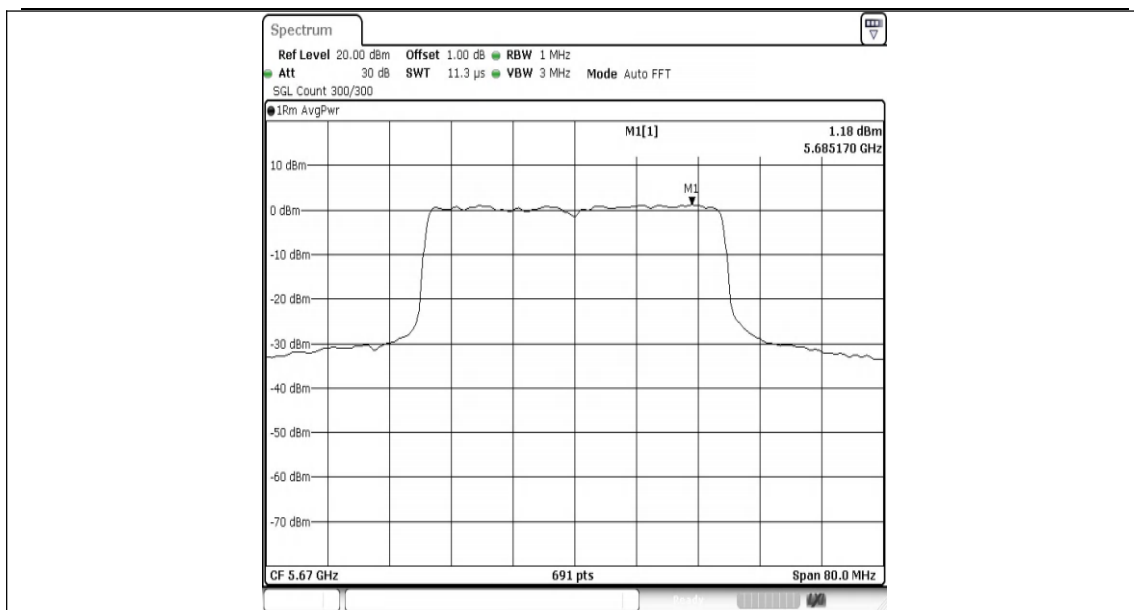


11AX40SISO-Ant1-5670-PASS

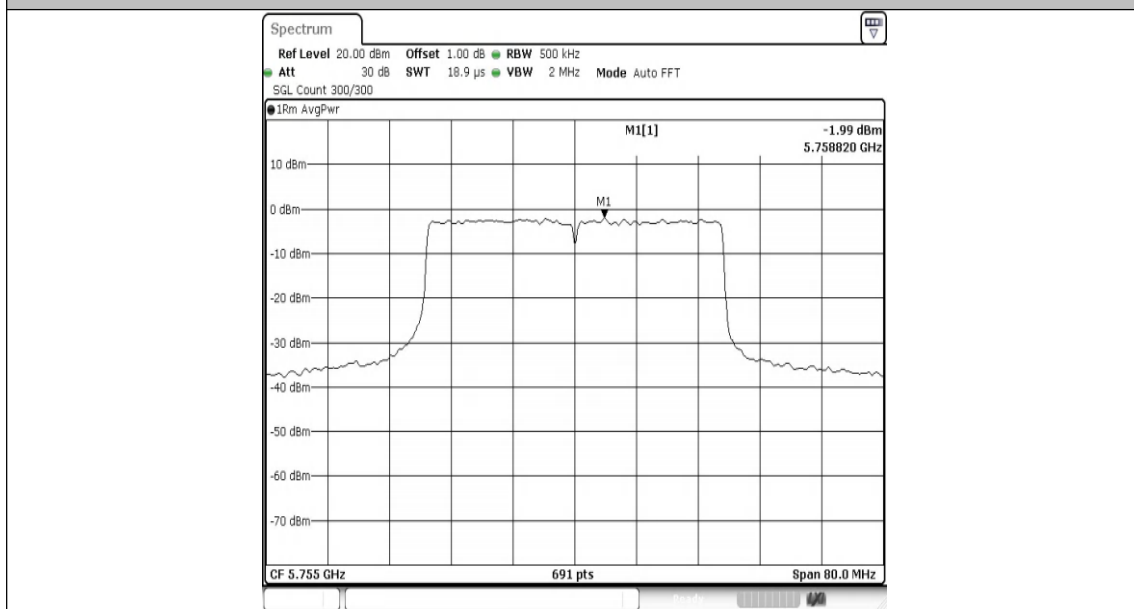


11AX40SISO-Ant1-5755-PASS

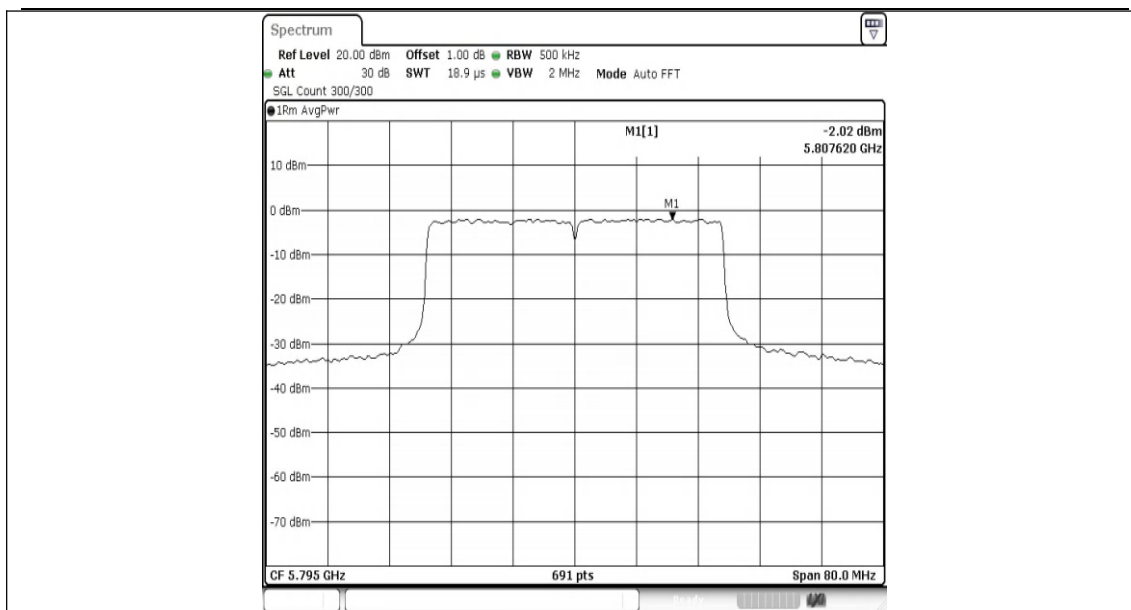


11AX40SISO-Ant1-5795-PASS

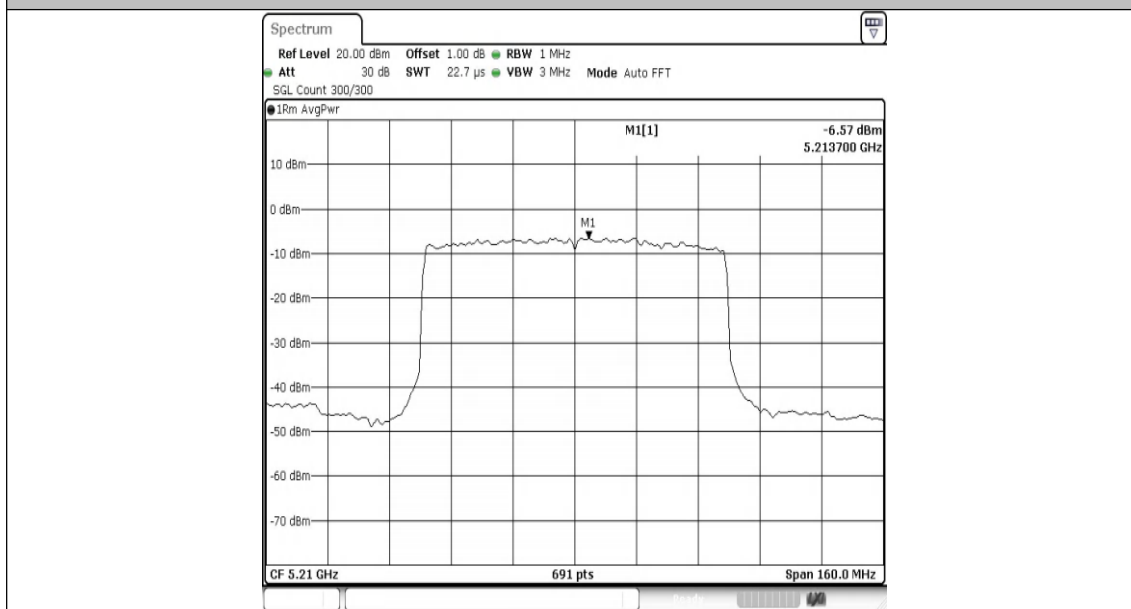


11AX80SISO-Ant1-5210-PASS

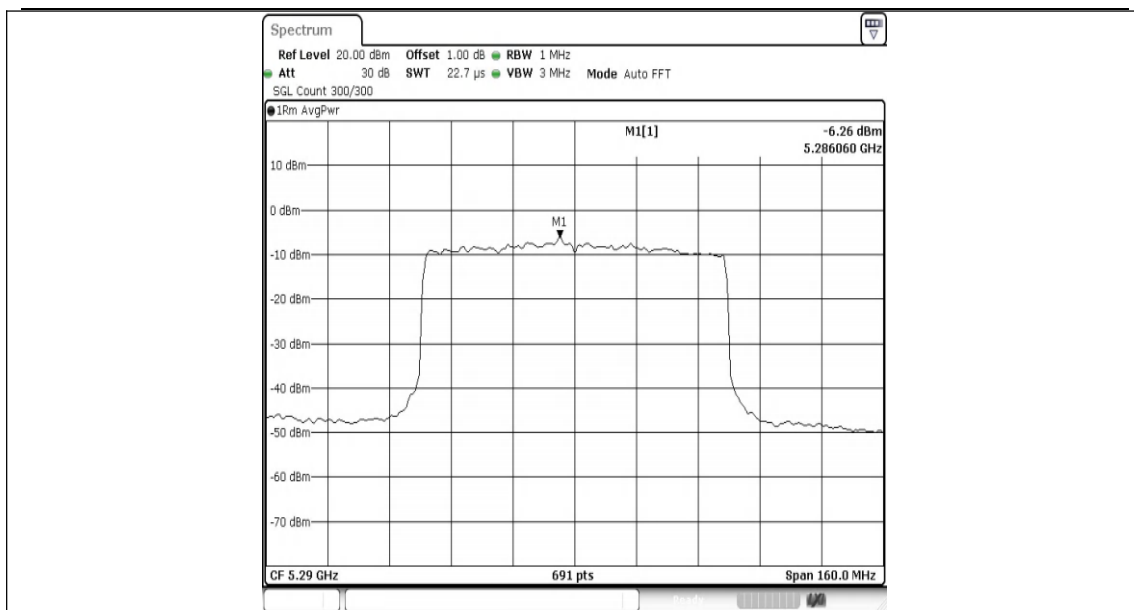

11AX80ISO-Ant1-5290-PASS

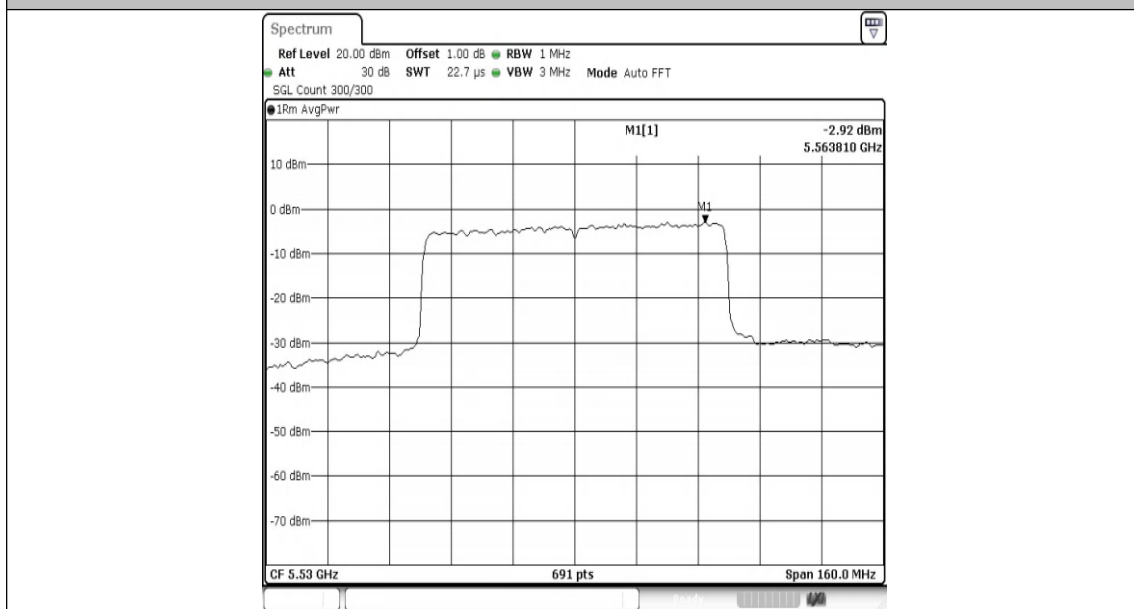

11AX80ISO-Ant1-5530-PASS

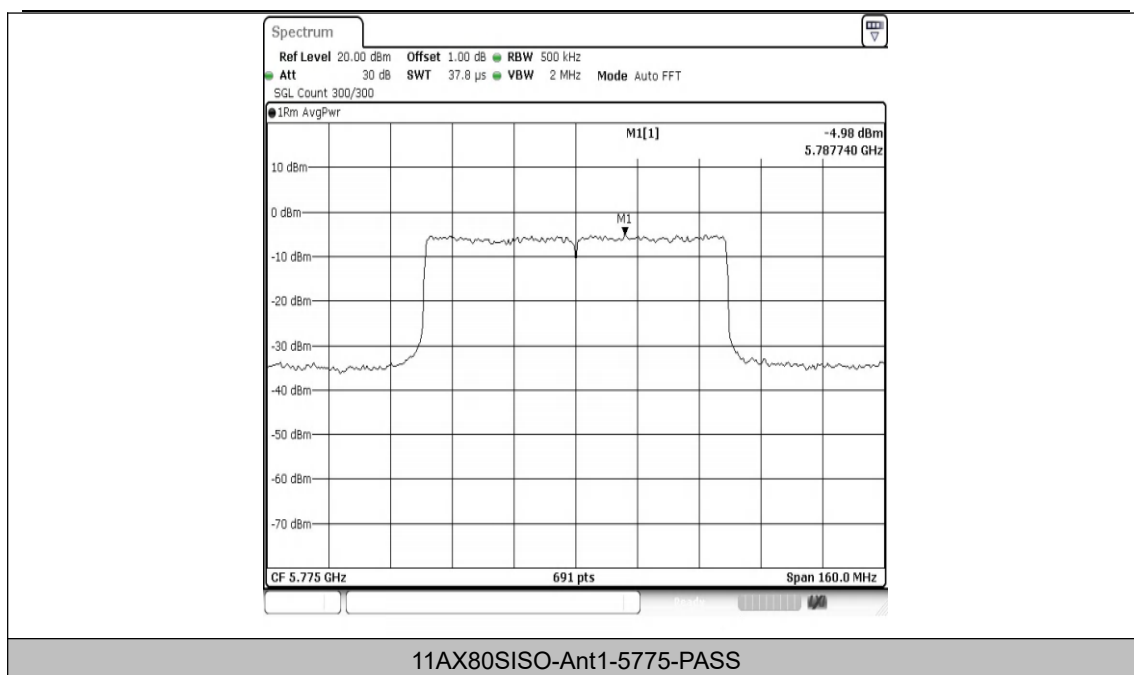

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

Appendix E: Band edge measurements

Test Result B1/2/3

Test Mode	Antenna	ChName	Frequency[MHz]	Result[dBm]	Limit[dBm]	Verdict
11A	Ant1	Low	5180	-36.81	≤-27	PASS
11A	Ant1	High	5320	-37.54	≤-27	PASS
11A	Ant1	Low	5500	-39.52	≤-27	PASS
11A	Ant1	High	5700	-38.98	≤-27	PASS
11N20SISO	Ant1	Low	5180	-32.21	≤-27	PASS
11N20SISO	Ant1	High	5320	-37.11	≤-27	PASS
11N20SISO	Ant1	Low	5500	-36.83	≤-27	PASS
11N20SISO	Ant1	High	5700	-38.11	≤-27	PASS
11N40SISO	Ant1	Low	5190	-36.5	≤-27	PASS
11N40SISO	Ant1	High	5310	-37.65	≤-27	PASS
11N40SISO	Ant1	Low	5510	-39.06	≤-27	PASS
11N40SISO	Ant1	High	5670	-44.71	≤-27	PASS
11AC20SISO	Ant1	Low	5180	-36.08	≤-27	PASS
11AC20SISO	Ant1	High	5320	-39.72	≤-27	PASS
11AC20SISO	Ant1	Low	5500	-36.74	≤-27	PASS
11AC20SISO	Ant1	High	5700	-37.71	≤-27	PASS
11AC40SISO	Ant1	Low	5190	-31.54	≤-27	PASS
11AC40SISO	Ant1	High	5310	-36.53	≤-27	PASS
11AC40SISO	Ant1	Low	5510	-35.25	≤-27	PASS
11AC40SISO	Ant1	High	5670	-40.99	≤-27	PASS
11AC80SISO	Ant1	Low	5210	-36.13	≤-27	PASS
11AC80SISO	Ant1	High	5290	-34.55	≤-27	PASS
11AC80SISO	Ant1	Low	5530	-33.8	≤-27	PASS
11AC80SISO	Ant1	High	5610	-42.91	≤-27	PASS
11AX20SISO	Ant1	Low	5180	-36.47	≤-27	PASS
11AX20SISO	Ant1	High	5320	-41.23	≤-27	PASS
11AX20SISO	Ant1	Low	5500	-35.55	≤-27	PASS
11AX20SISO	Ant1	High	5700	-37.05	≤-27	PASS
11AX40SISO	Ant1	Low	5190	-35.8	≤-27	PASS
11AX40SISO	Ant1	High	5310	-39.33	≤-27	PASS
11AX40SISO	Ant1	Low	5510	-33.9	≤-27	PASS
11AX40SISO	Ant1	High	5670	-41.06	≤-27	PASS
11AX80SISO	Ant1	Low	5210	-35.78	≤-27	PASS
11AX80SISO	Ant1	High	5290	-36.3	≤-27	PASS
11AX80SISO	Ant1	Low	5530	-34.32	≤-27	PASS
11AX80SISO	Ant1	High	5610	-45.59	≤-27	PASS

Note: The margin plus the antenna gain also meets the limit.

Shenzhen Anbotek Compliance Laboratory Limited

Test Result B4

Test Mode	Antenna	Ch. Name	Frequency [MHz]	FreqRange [MHz]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	Low	5745	5720~5725	-36.6	≤16.36	PASS
11A	Ant1	Low	5745	5700~5720	-40.78	≤10.37	PASS
11A	Ant1	Low	5745	5650~5700	-47.95	≤-26.63	PASS
11A	Ant1	Low	5745	5645~5650	-46.93	≤-27	PASS
11A	Ant1	High	5825	5850~5855	-42.82	≤15.65	PASS
11A	Ant1	High	5825	5855~5875	-39.35	≤10.18	PASS
11A	Ant1	High	5825	5875~5925	-46.67	≤-26.73	PASS
11A	Ant1	High	5825	5925~5935	-44.89	≤-27	PASS
11N20SISO	Ant1	Low	5745	5720~5725	-34.78	≤17.88	PASS
11N20SISO	Ant1	Low	5745	5700~5720	-40.9	≤10.98	PASS
11N20SISO	Ant1	Low	5745	5650~5700	-46.12	≤-25.27	PASS
11N20SISO	Ant1	Low	5745	5645~5650	-46.68	≤-27	PASS
11N20SISO	Ant1	High	5825	5850~5855	-40.42	≤15.65	PASS
11N20SISO	Ant1	High	5825	5855~5875	-41.15	≤10.02	PASS
11N20SISO	Ant1	High	5825	5875~5925	-47.07	≤-26.87	PASS
11N20SISO	Ant1	High	5825	5925~5935	-45.5	≤-27	PASS
11N40SISO	Ant1	Low	5755	5720~5725	-37.44	≤15.90	PASS
11N40SISO	Ant1	Low	5755	5700~5720	-38.05	≤11.69	PASS
11N40SISO	Ant1	Low	5755	5650~5700	-48.91	≤-26.94	PASS
11N40SISO	Ant1	Low	5755	5645~5650	-46.09	≤-27	PASS
11N40SISO	Ant1	High	5795	5850~5855	-44.47	≤15.85	PASS
11N40SISO	Ant1	High	5795	5855~5875	-43.85	≤10.54	PASS
11N40SISO	Ant1	High	5795	5875~5925	-44.96	≤-26.79	PASS
11N40SISO	Ant1	High	5795	5925~5935	-46.64	≤-27	PASS
11AC20SISO	Ant1	Low	5745	5720~5725	-32.11	≤20.92	PASS
11AC20SISO	Ant1	Low	5745	5700~5720	-39.86	≤13.31	PASS
11AC20SISO	Ant1	Low	5745	5650~5700	-44.88	≤-26.51	PASS
11AC20SISO	Ant1	Low	5745	5645~5650	-43.41	≤-27	PASS
11AC20SISO	Ant1	High	5825	5850~5855	-42.22	≤15.65	PASS
11AC20SISO	Ant1	High	5825	5855~5875	-42.27	≤10.51	PASS
11AC20SISO	Ant1	High	5825	5875~5925	-47.23	≤-26.87	PASS
11AC20SISO	Ant1	High	5825	5925~5935	-45.97	≤-27	PASS
11AC40SISO	Ant1	Low	5755	5720~5725	-39.7	≤16.34	PASS
11AC40SISO	Ant1	Low	5755	5700~5720	-37.72	≤14.81	PASS
11AC40SISO	Ant1	Low	5755	5650~5700	-49.01	≤-26.79	PASS
11AC40SISO	Ant1	Low	5755	5645~5650	-46.63	≤-27	PASS
11AC40SISO	Ant1	High	5795	5850~5855	-41.18	≤15.85	PASS
11AC40SISO	Ant1	High	5795	5855~5875	-45.53	≤10.07	PASS
11AC40SISO	Ant1	High	5795	5875~5925	-45.17	≤-25.02	PASS


Shenzhen Anbotech Compliance Laboratory Limited



11AC40SISO	Ant1	High	5795	5925~5935	-46.33	≤-27	PASS
11AC80SISO	Ant1	Low	5775	5720~5725	-40.56	≤18.74	PASS
11AC80SISO	Ant1	Low	5775	5700~5720	-41.41	≤10.01	PASS
11AC80SISO	Ant1	Low	5775	5650~5700	-46.47	≤-25.05	PASS
11AC80SISO	Ant1	Low	5775	5645~5650	-47.65	≤-27	PASS
11AC80SISO	Ant1	High	5775	5850~5855	-35.79	≤15.98	PASS
11AC80SISO	Ant1	High	5775	5855~5875	-35.8	≤10.92	PASS
11AC80SISO	Ant1	High	5775	5875~5925	-45.38	≤-25.87	PASS
11AC80SISO	Ant1	High	5775	5925~5935	-45.49	≤-27	PASS
11AX20SISO	Ant1	Low	5745	5720~5725	-40.57	≤16.36	PASS
11AX20SISO	Ant1	Low	5745	5700~5720	-40.9	≤10.84	PASS
11AX20SISO	Ant1	Low	5745	5650~5700	-48.67	≤-26.75	PASS
11AX20SISO	Ant1	Low	5745	5645~5650	-47.91	≤-27	PASS
11AX20SISO	Ant1	High	5825	5850~5855	-40.31	≤16.54	PASS
11AX20SISO	Ant1	High	5825	5855~5875	-42.66	≤10.02	PASS
11AX20SISO	Ant1	High	5825	5875~5925	-46.07	≤-26.44	PASS
11AX20SISO	Ant1	High	5825	5925~5935	-46.18	≤-27	PASS
11AX40SISO	Ant1	Low	5755	5720~5725	-39.25	≤15.90	PASS
11AX40SISO	Ant1	Low	5755	5700~5720	-37.52	≤14.43	PASS
11AX40SISO	Ant1	Low	5755	5650~5700	-46.39	≤-26.94	PASS
11AX40SISO	Ant1	Low	5755	5645~5650	-46.41	≤-27	PASS
11AX40SISO	Ant1	High	5795	5850~5855	-46.25	≤15.85	PASS
11AX40SISO	Ant1	High	5795	5855~5875	-43.77	≤11.01	PASS
11AX40SISO	Ant1	High	5795	5875~5925	-46.06	≤-26.61	PASS
11AX40SISO	Ant1	High	5795	5925~5935	-45.23	≤-27	PASS
11AX80SISO	Ant1	Low	5775	5720~5725	-43.63	≤15.67	PASS
11AX80SISO	Ant1	Low	5775	5700~5720	-39.27	≤11.77	PASS
11AX80SISO	Ant1	Low	5775	5650~5700	-46.42	≤-25.55	PASS
11AX80SISO	Ant1	Low	5775	5645~5650	-45.92	≤-27	PASS
11AX80SISO	Ant1	High	5775	5850~5855	-36.74	≤16.59	PASS
11AX80SISO	Ant1	High	5775	5855~5875	-34.74	≤11.89	PASS
11AX80SISO	Ant1	High	5775	5875~5925	-47.92	≤-26.86	PASS
11AX80SISO	Ant1	High	5775	5925~5935	-46.27	≤-27	PASS

Note: The margin plus the antenna gain also meets the limit.


Test Graphs B1/2/3

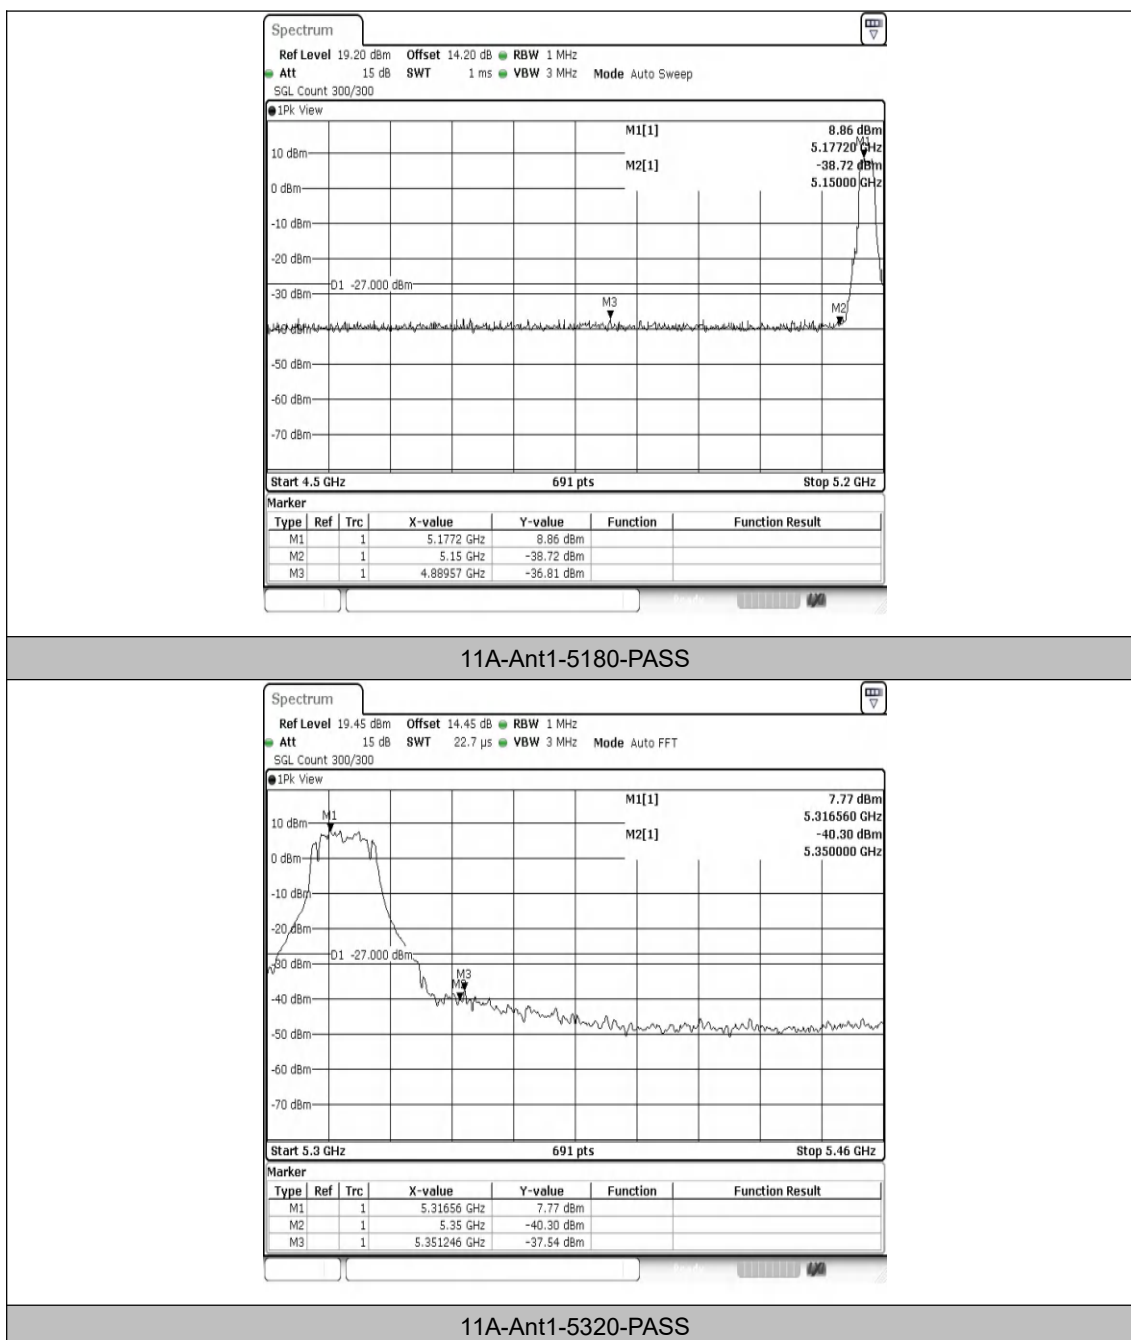



Shenzhen Anbotech Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

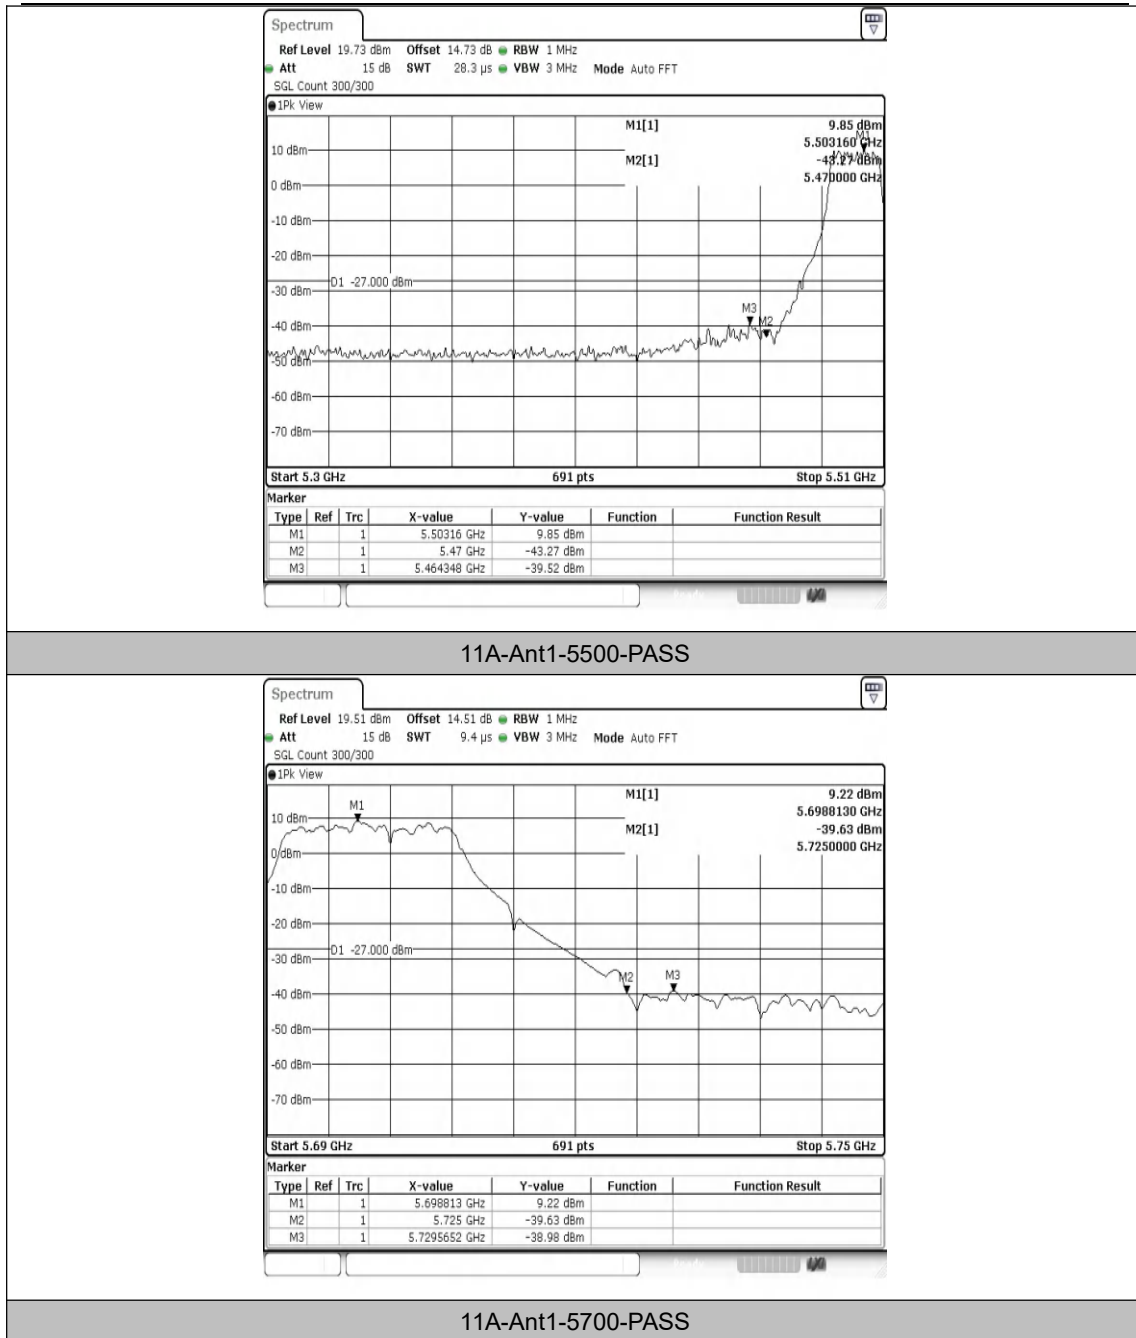


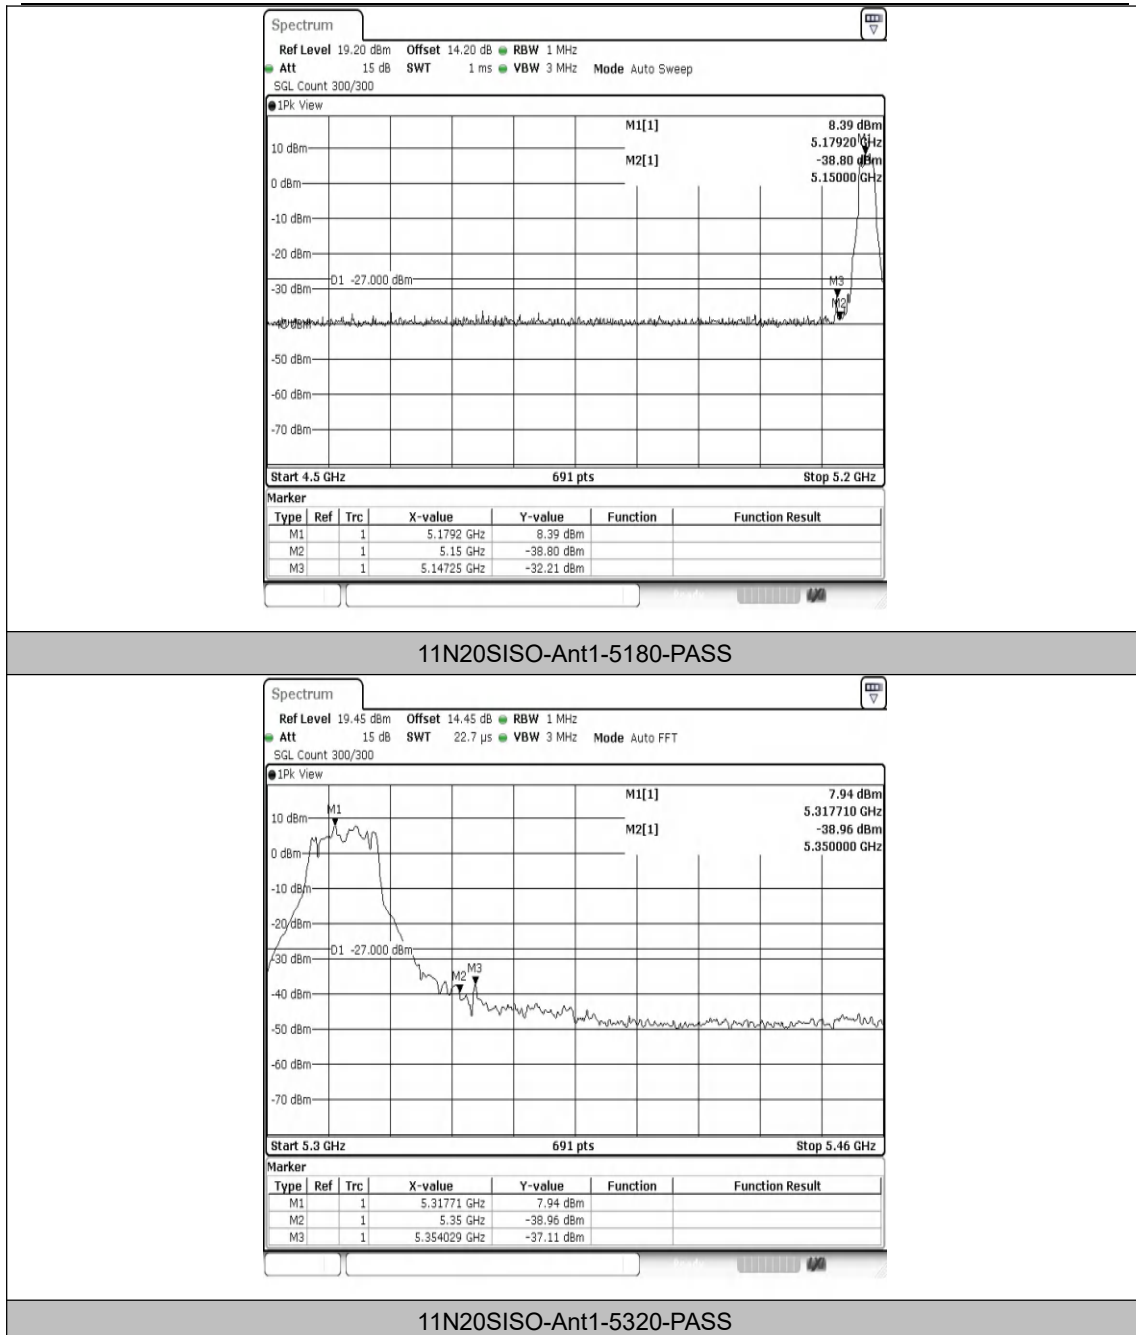

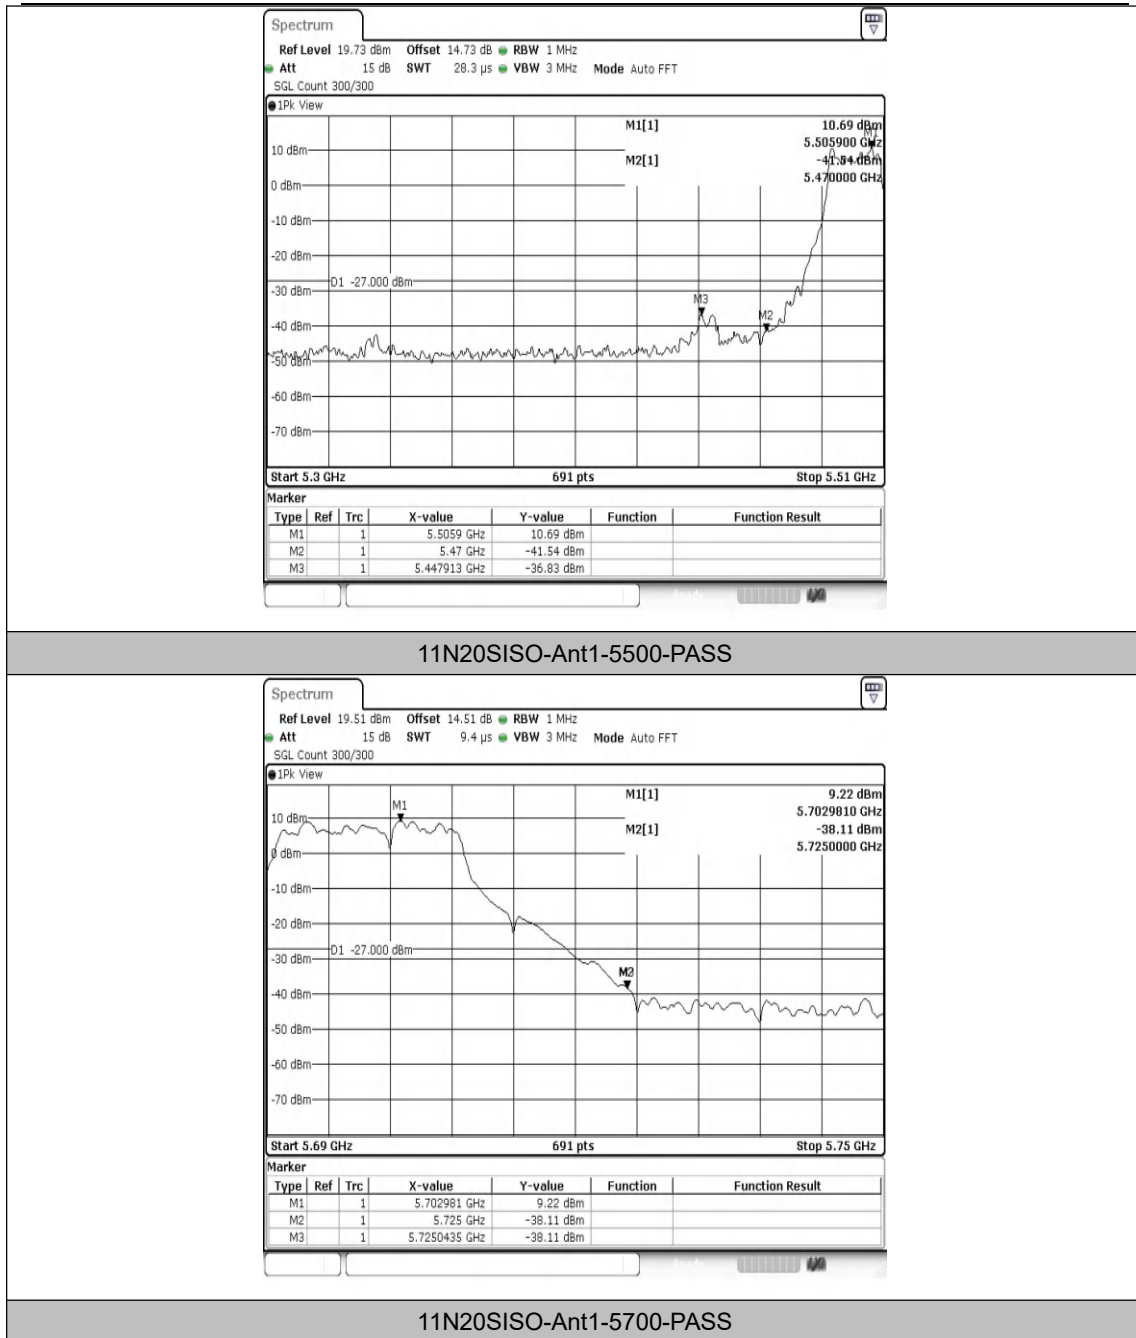


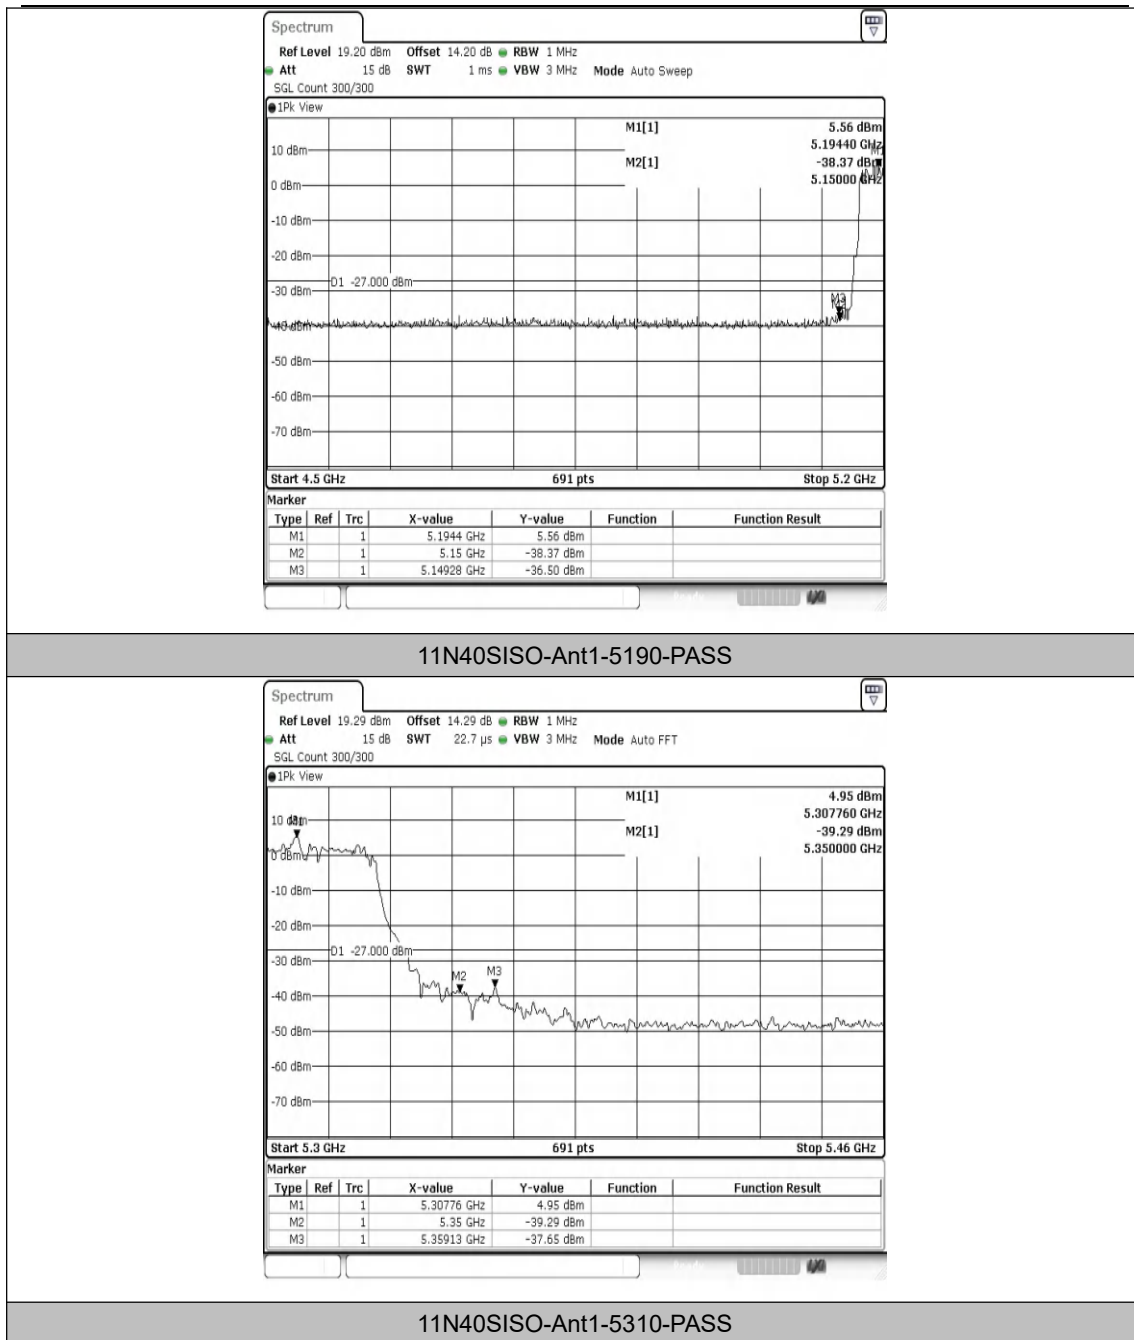

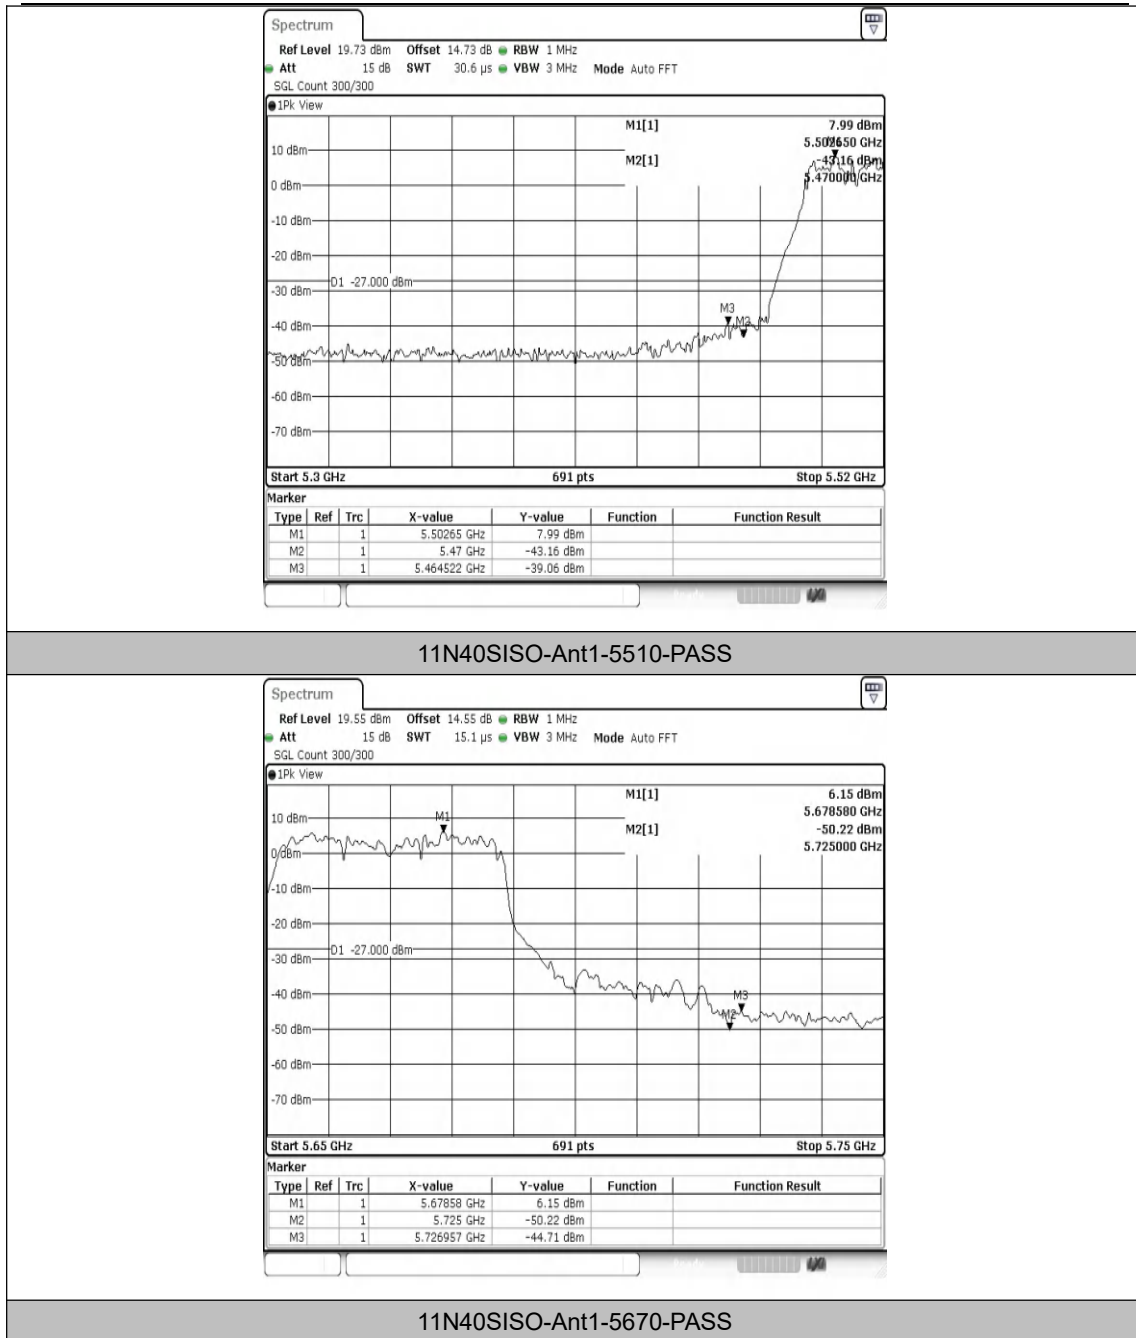


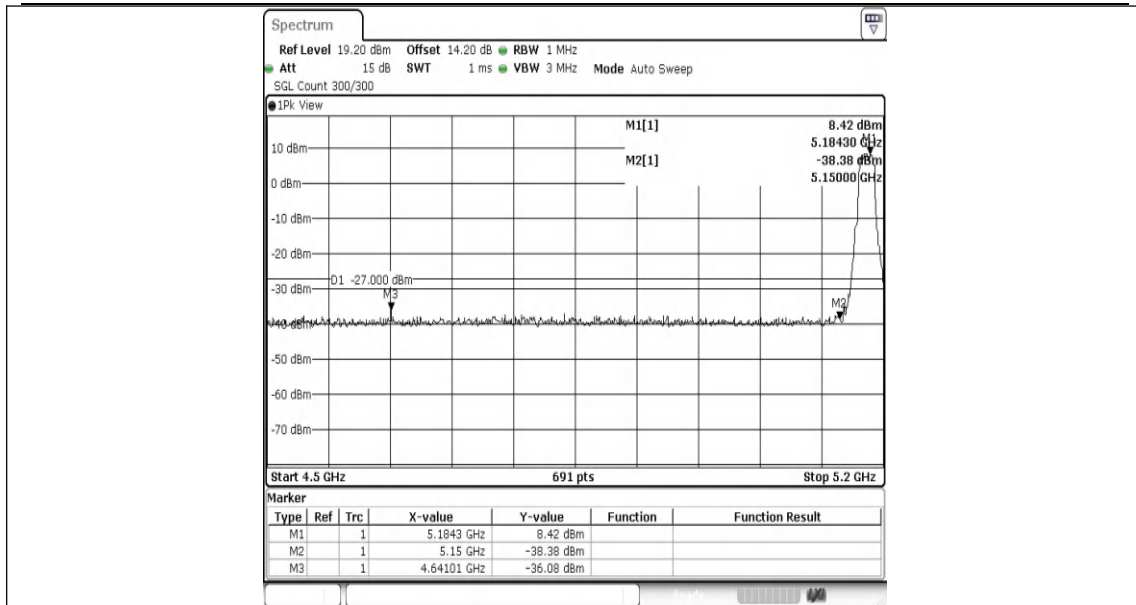


11AC20SISO-Ant1-5180-PASS

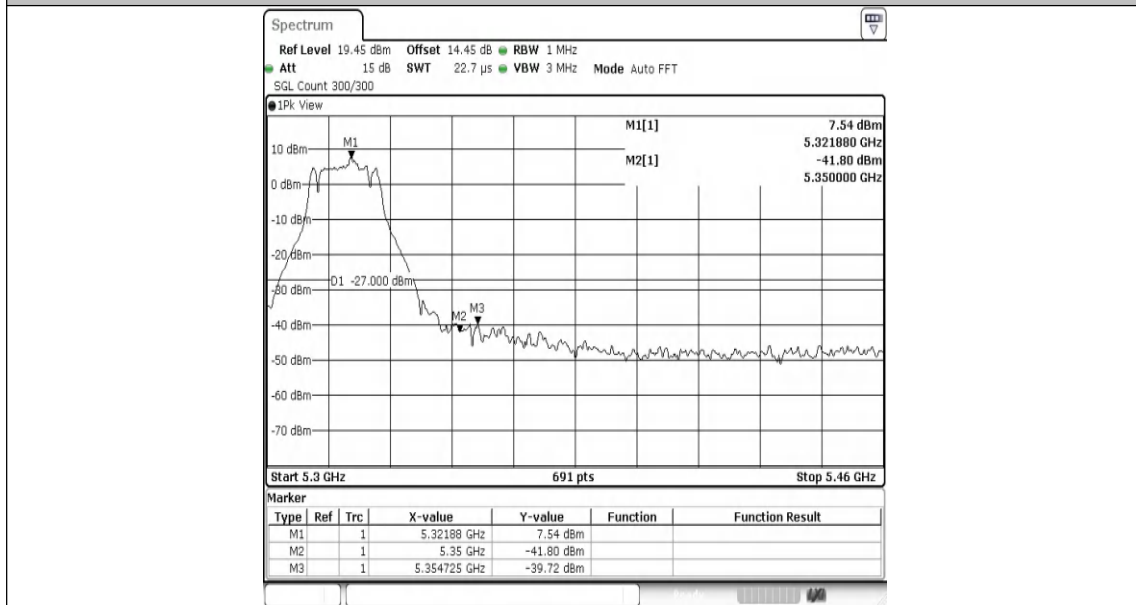


11AC20SISO-Ant1-5320-PASS

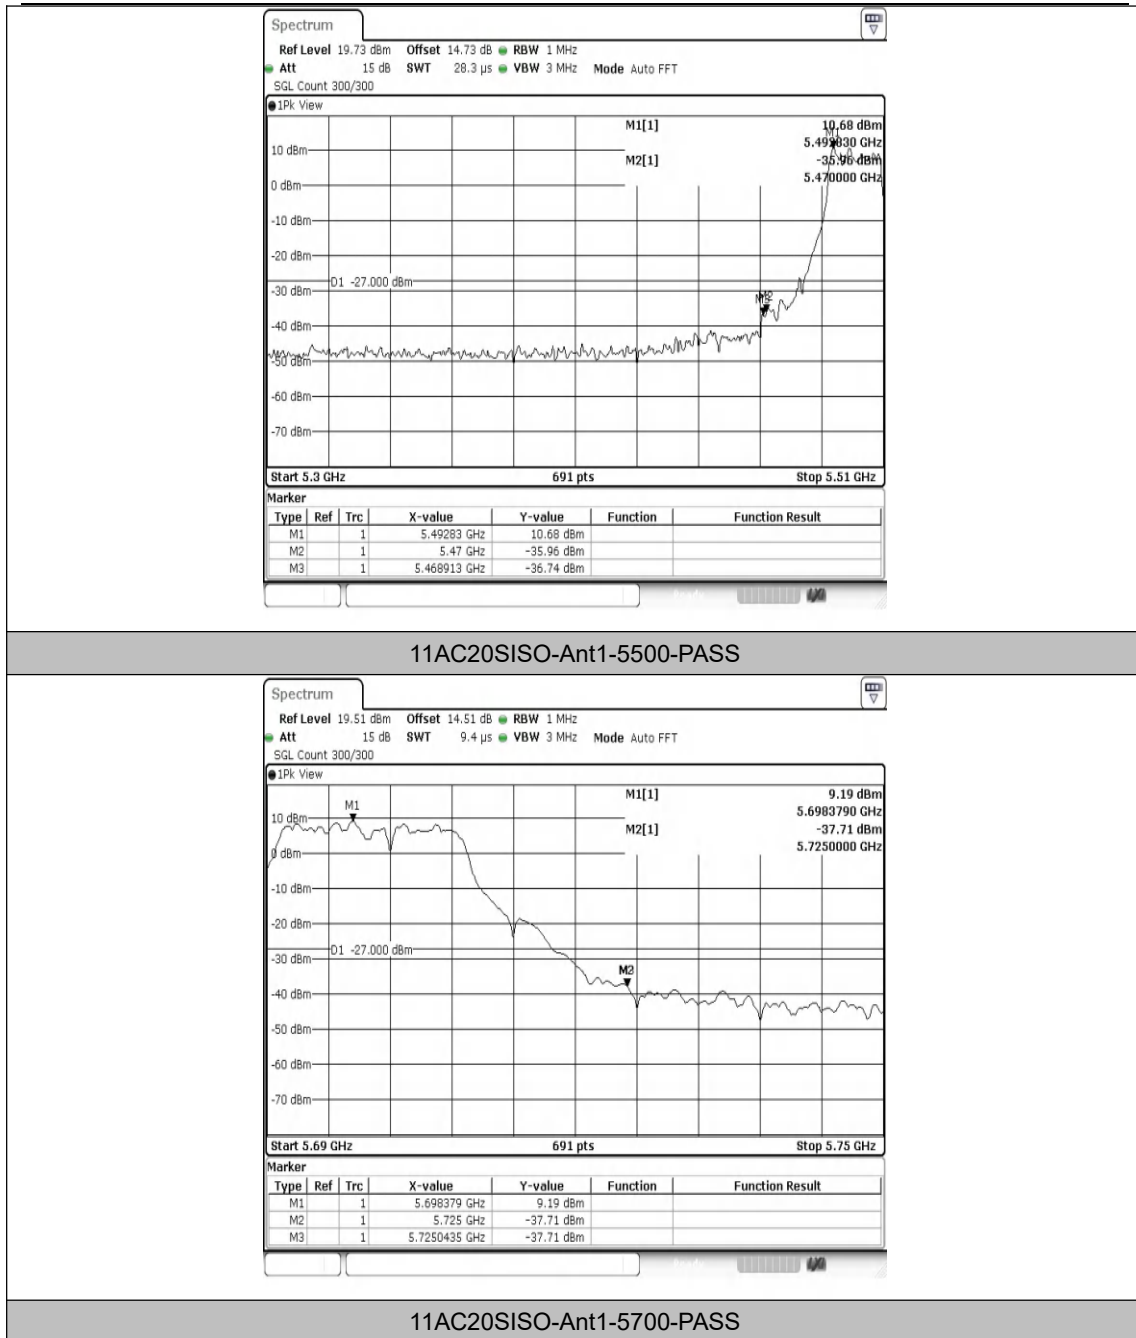


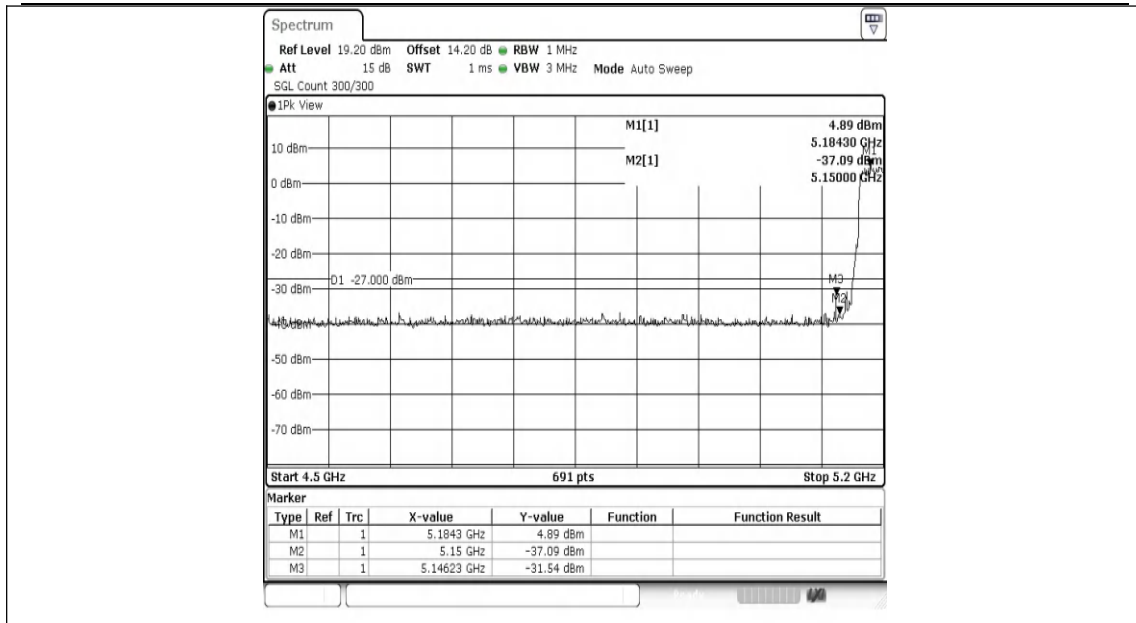



11AC40SISO-Ant1-5190-PASS

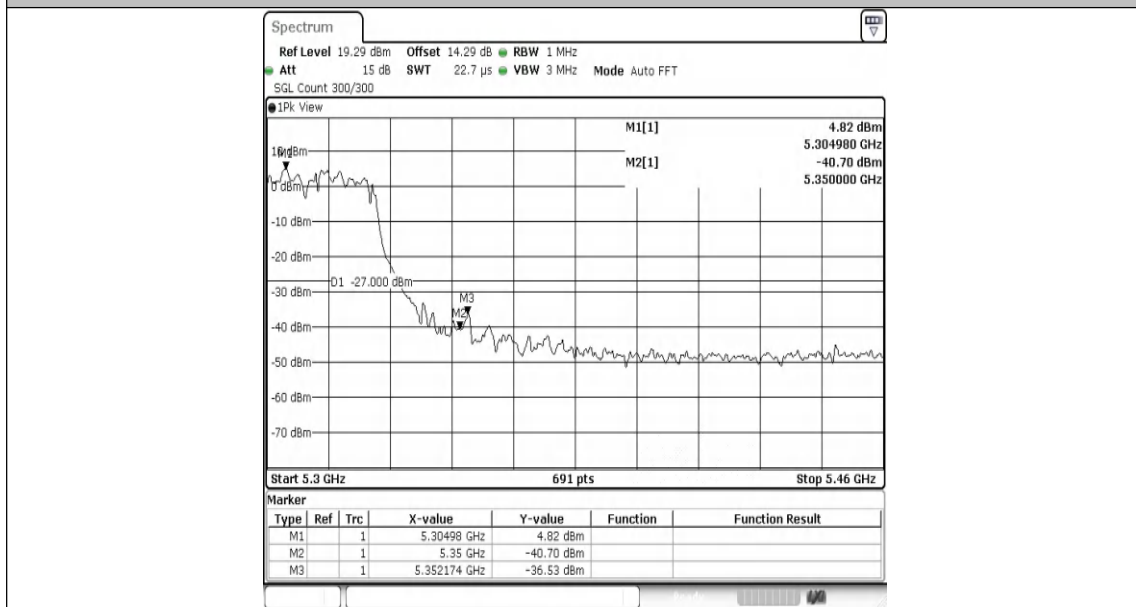



11AC40SISO-Ant1-5310-PASS

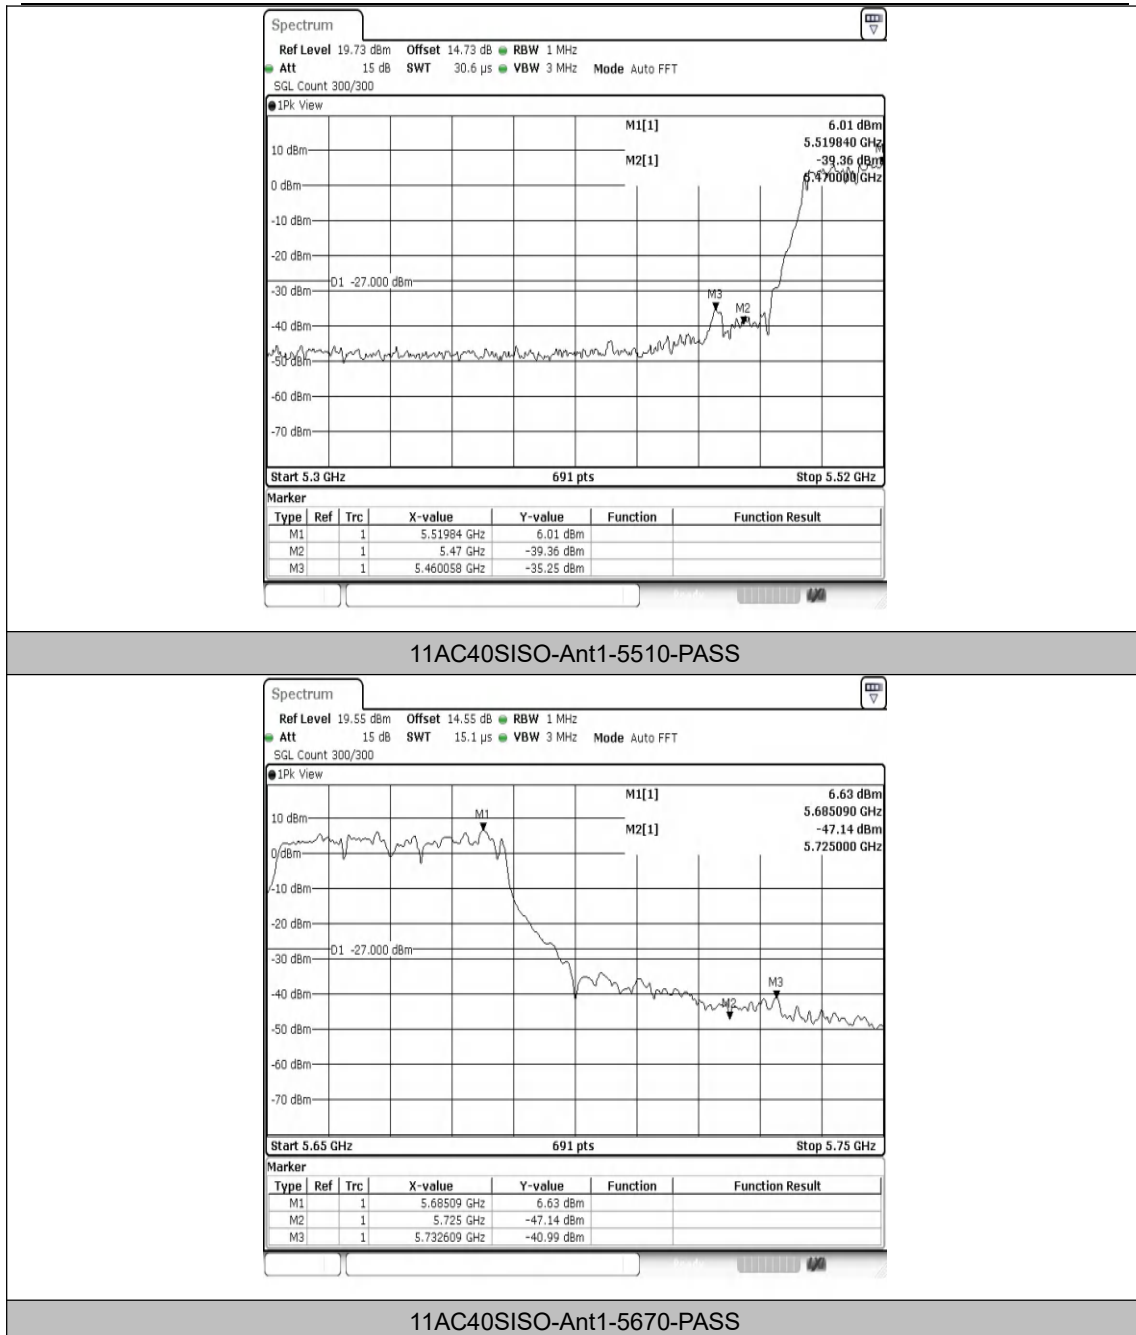

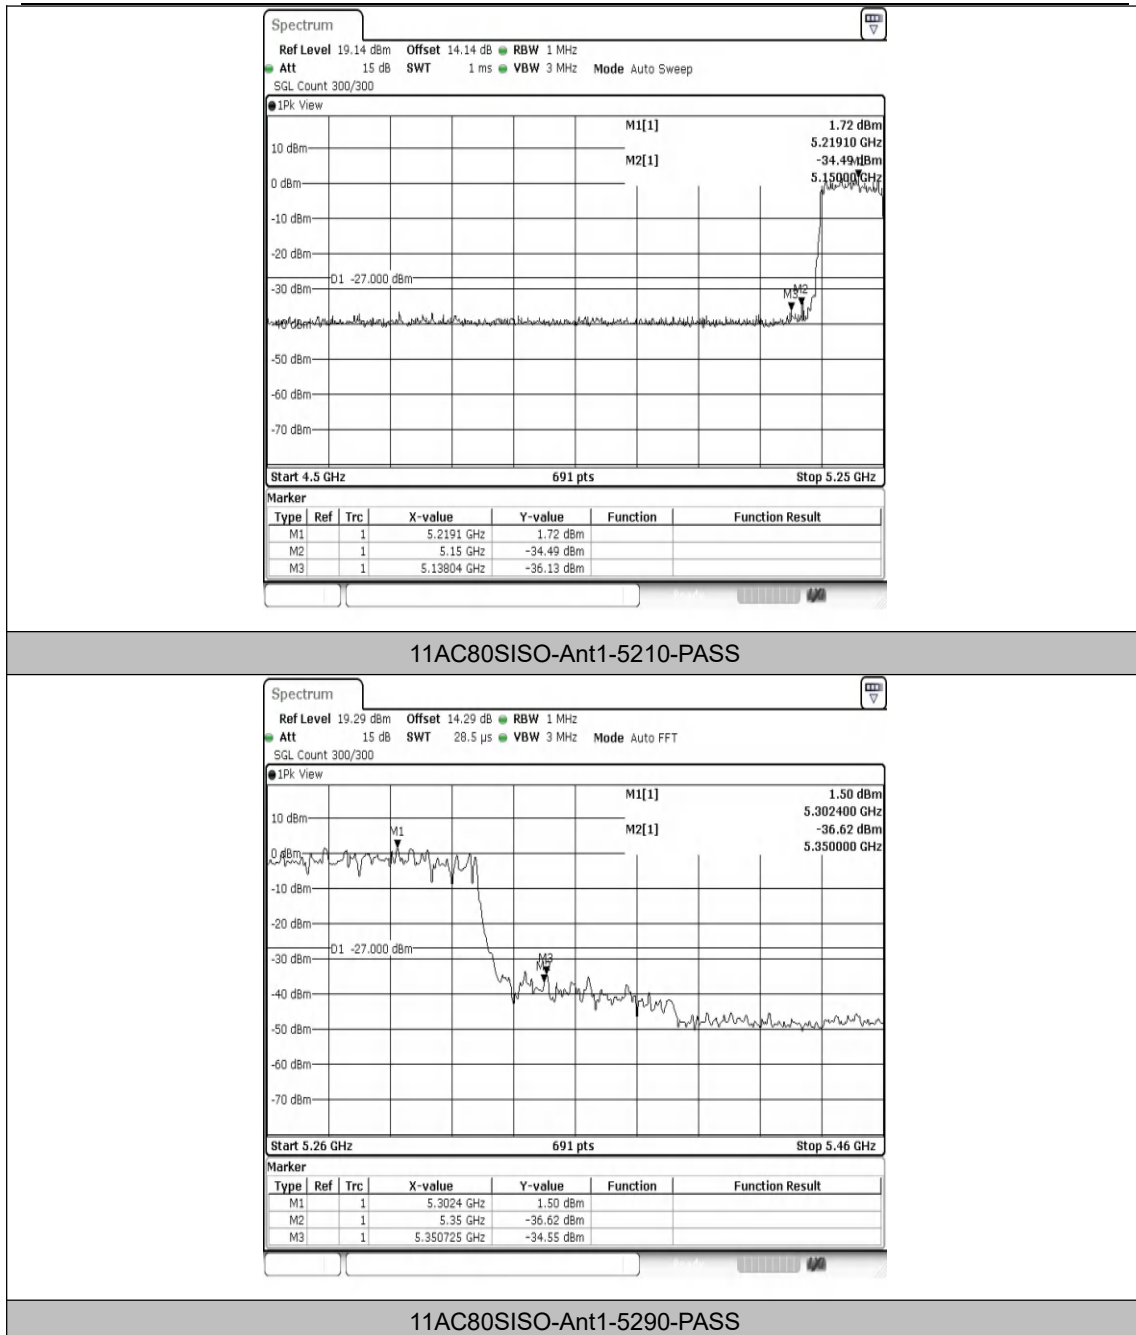


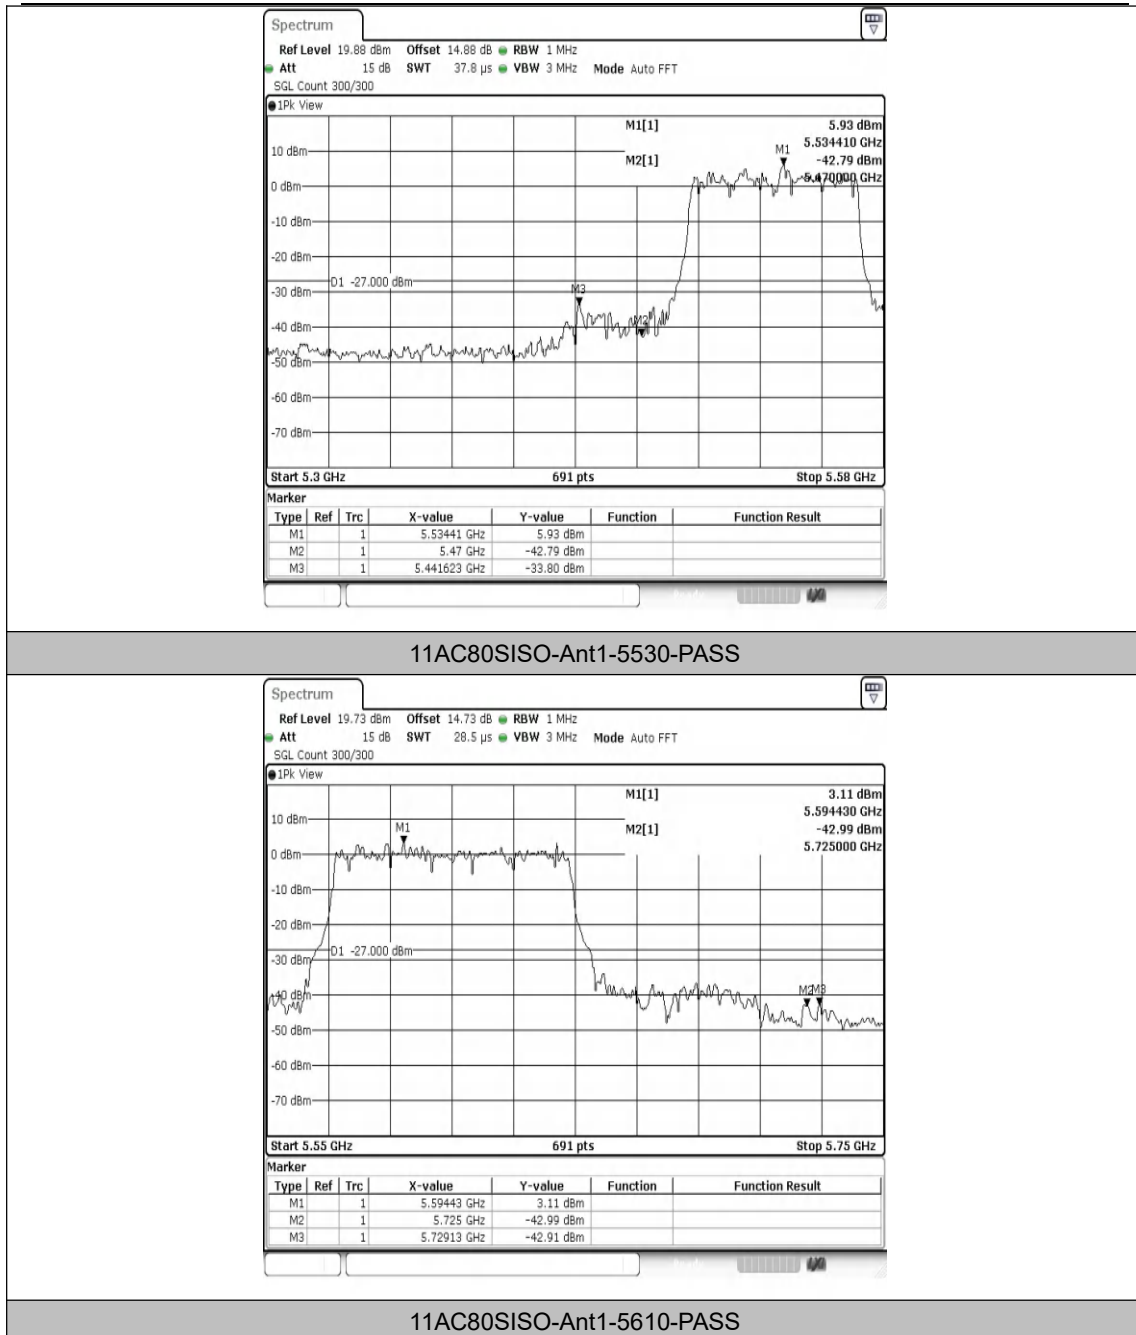

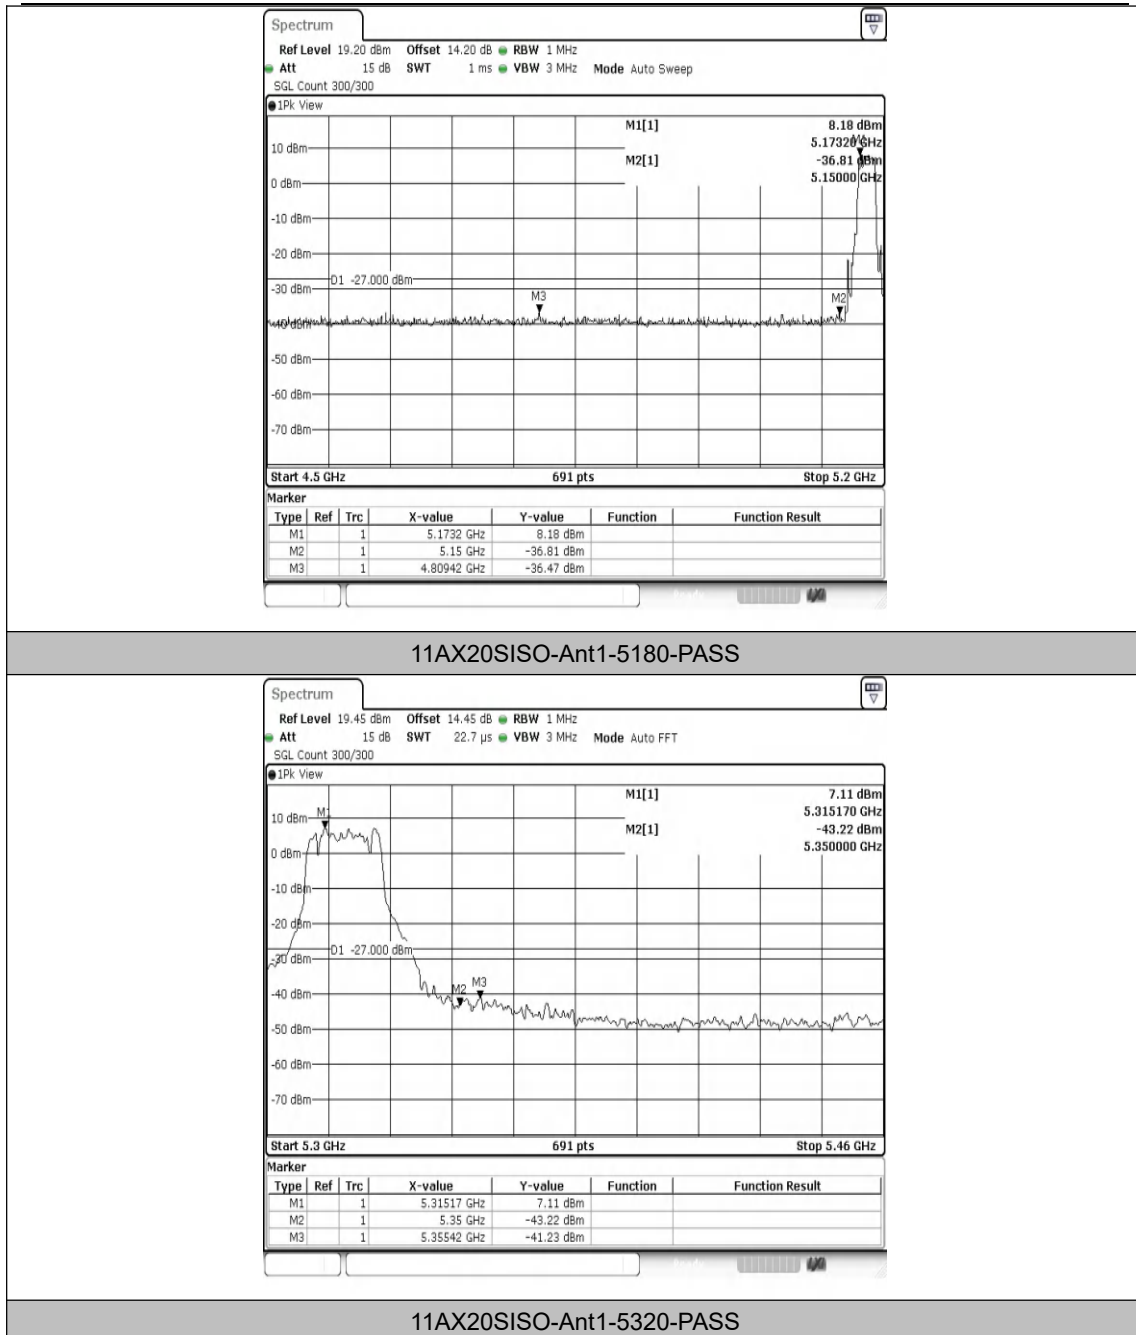


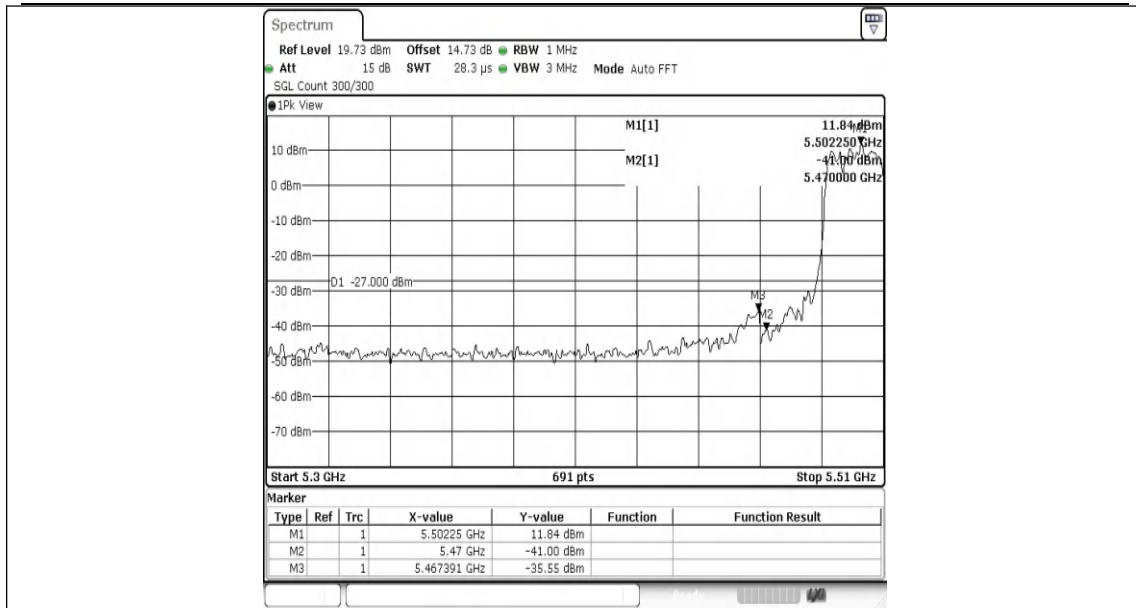



11AX20SISO-Ant1-5500-PASS

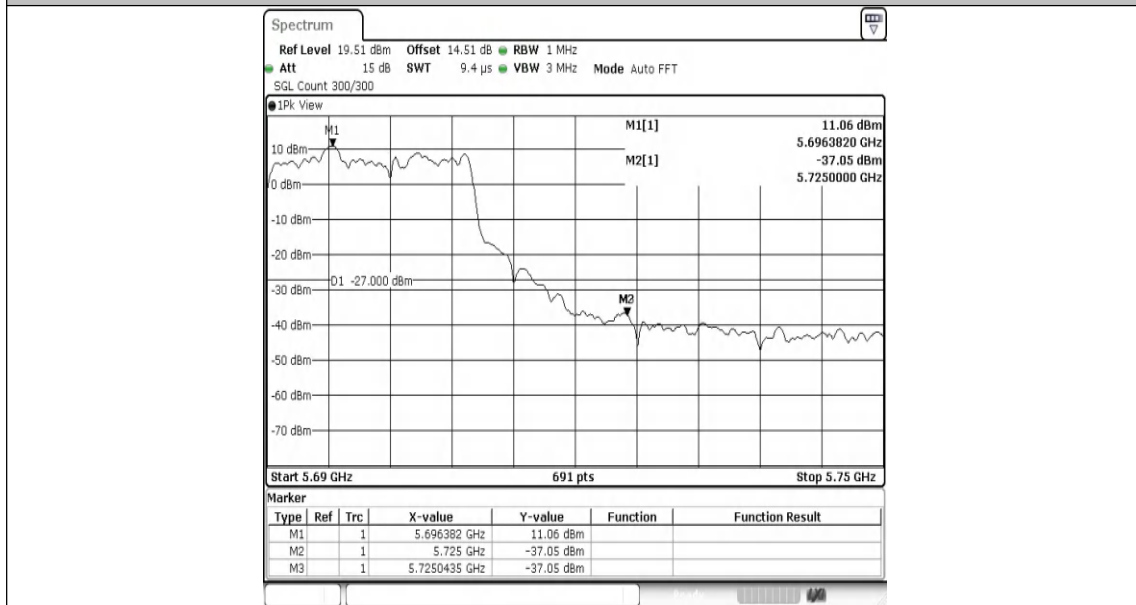


11AX20SISO-Ant1-5700-PASS

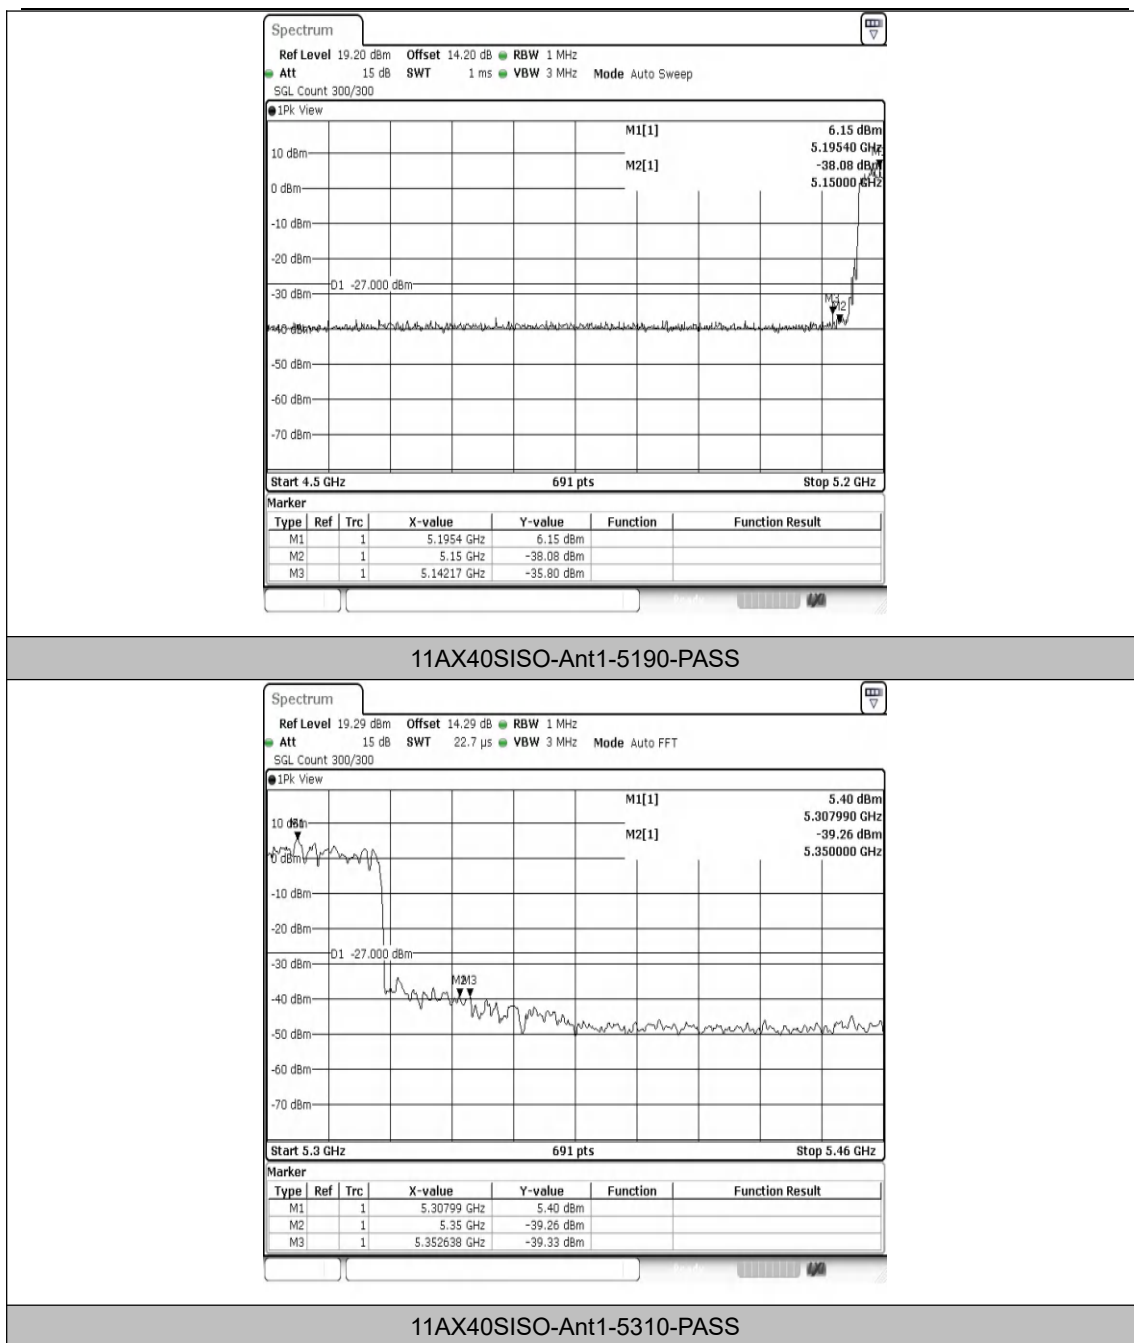


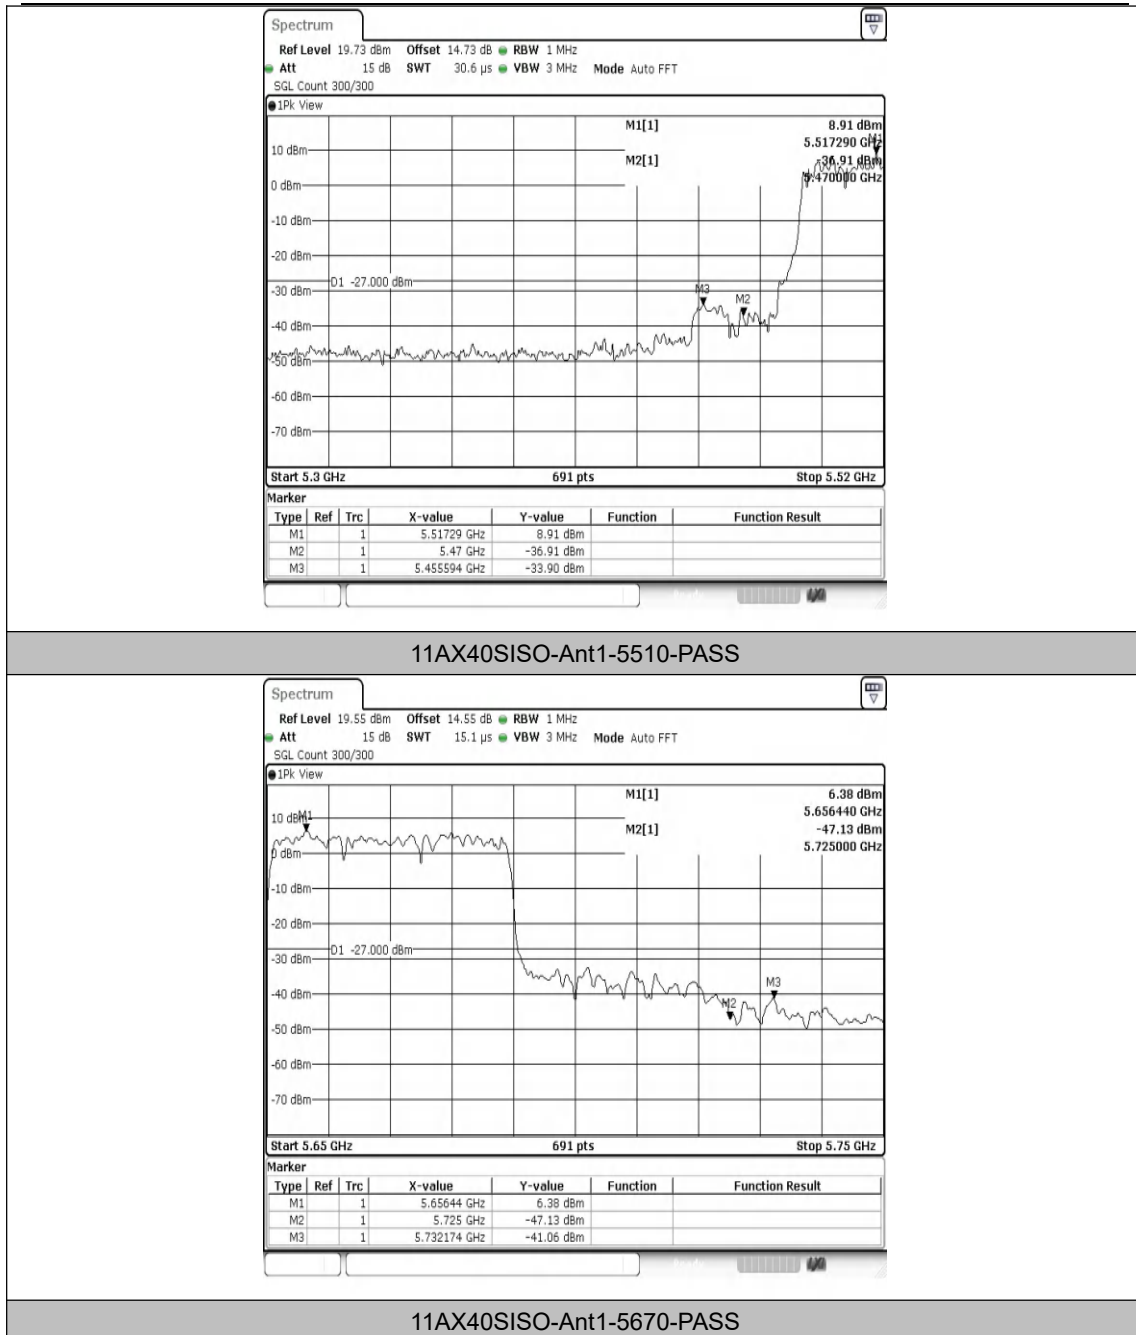


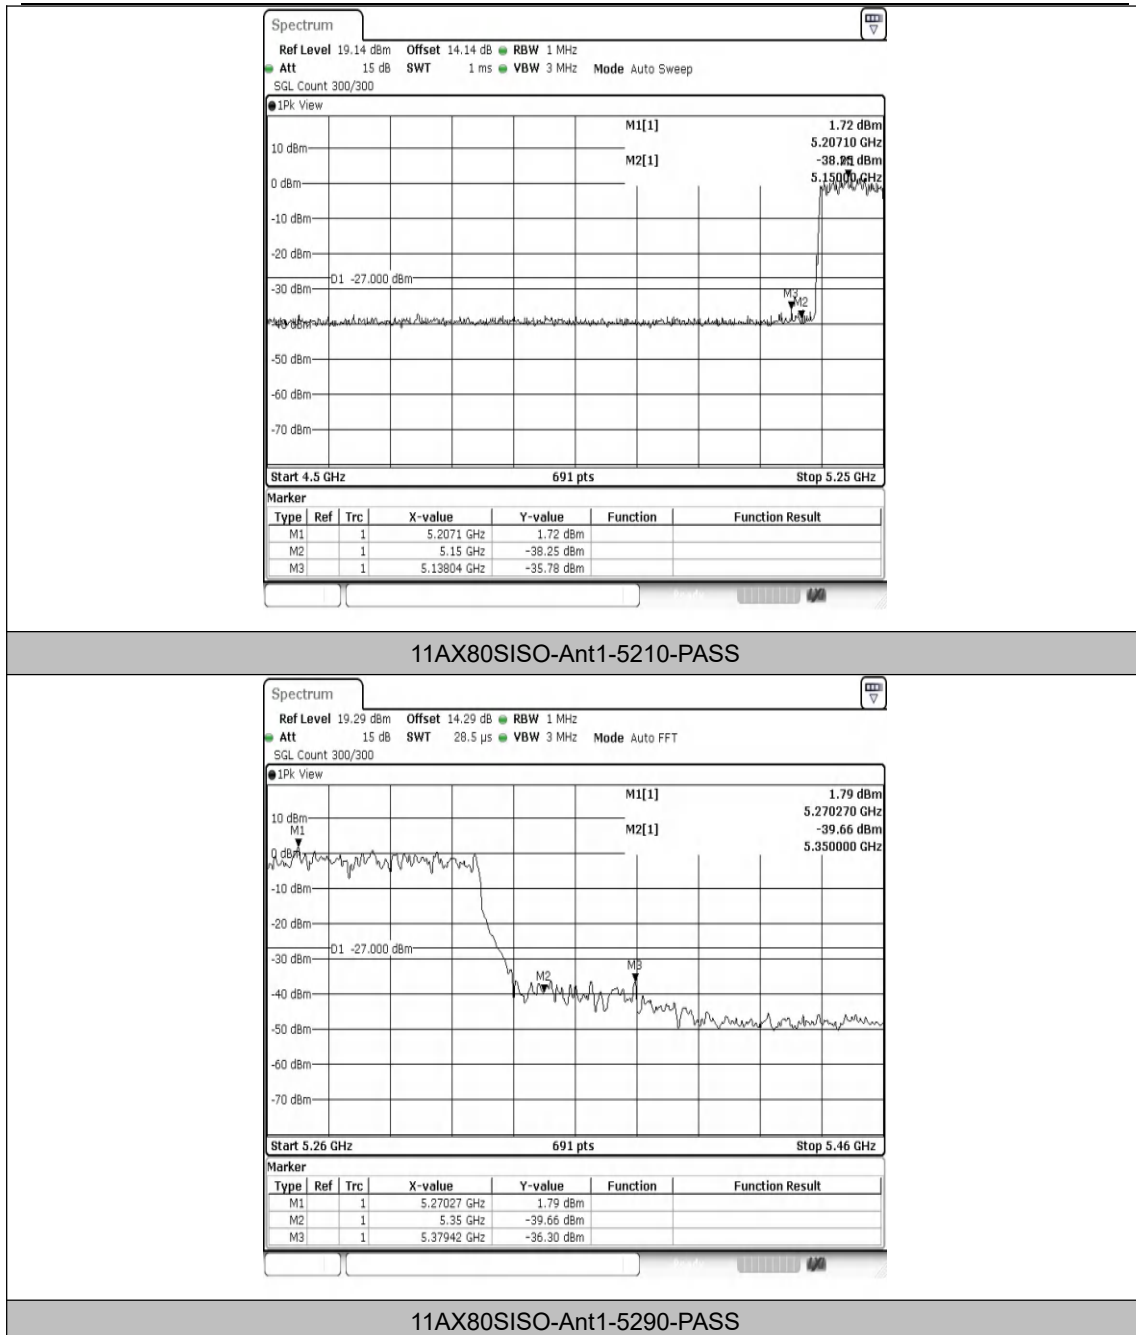


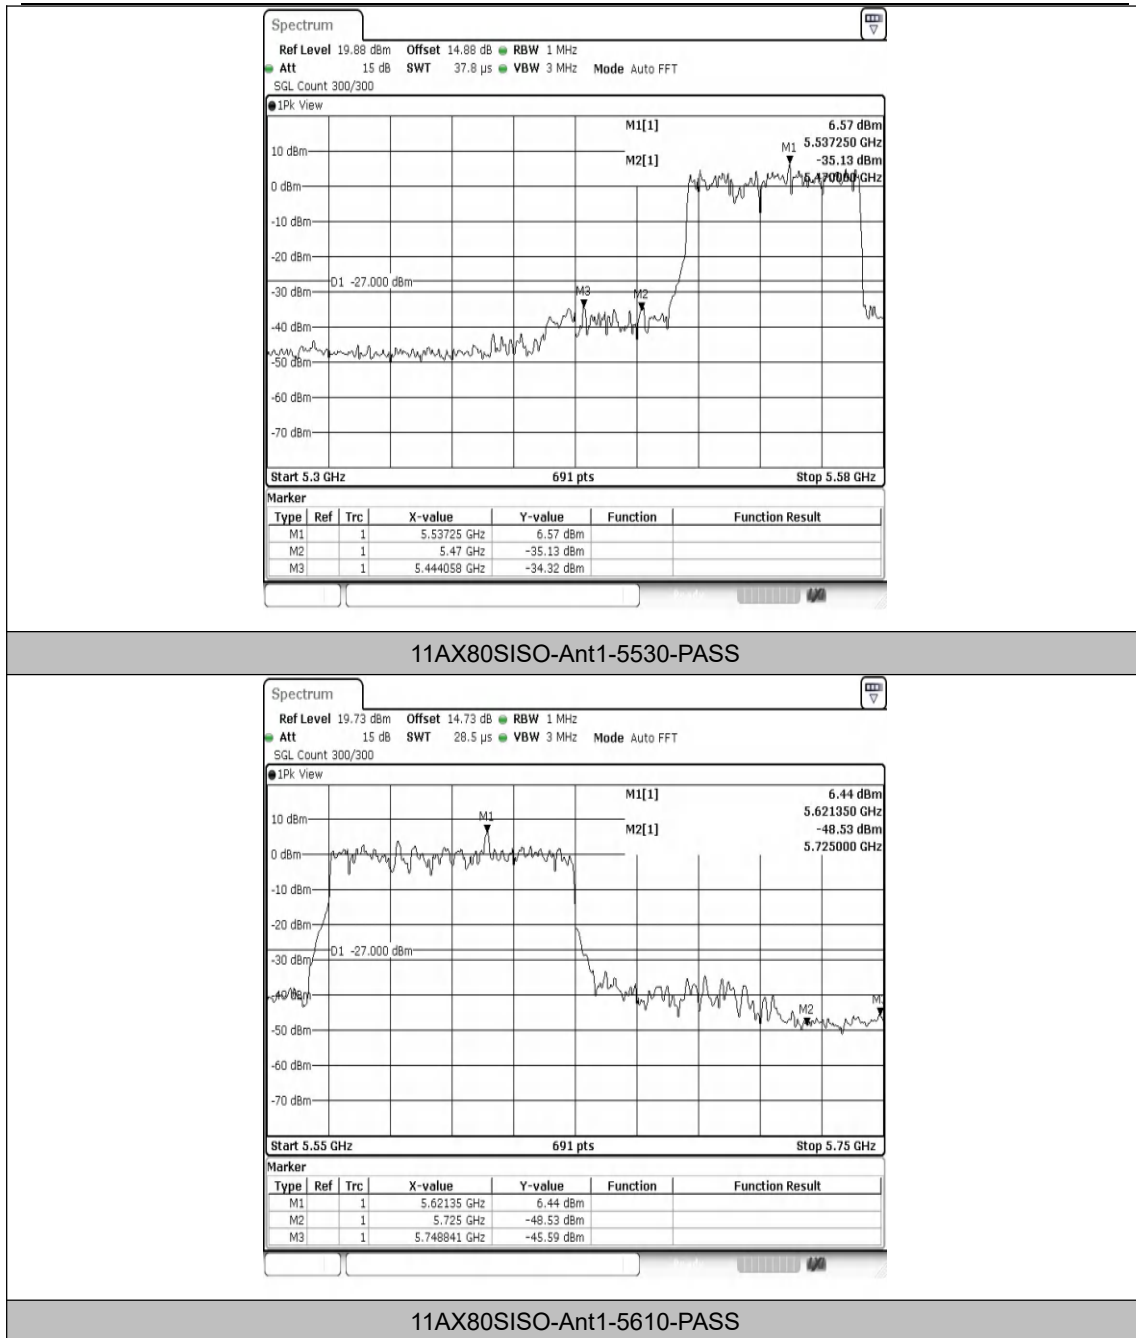


Test Graphs B4

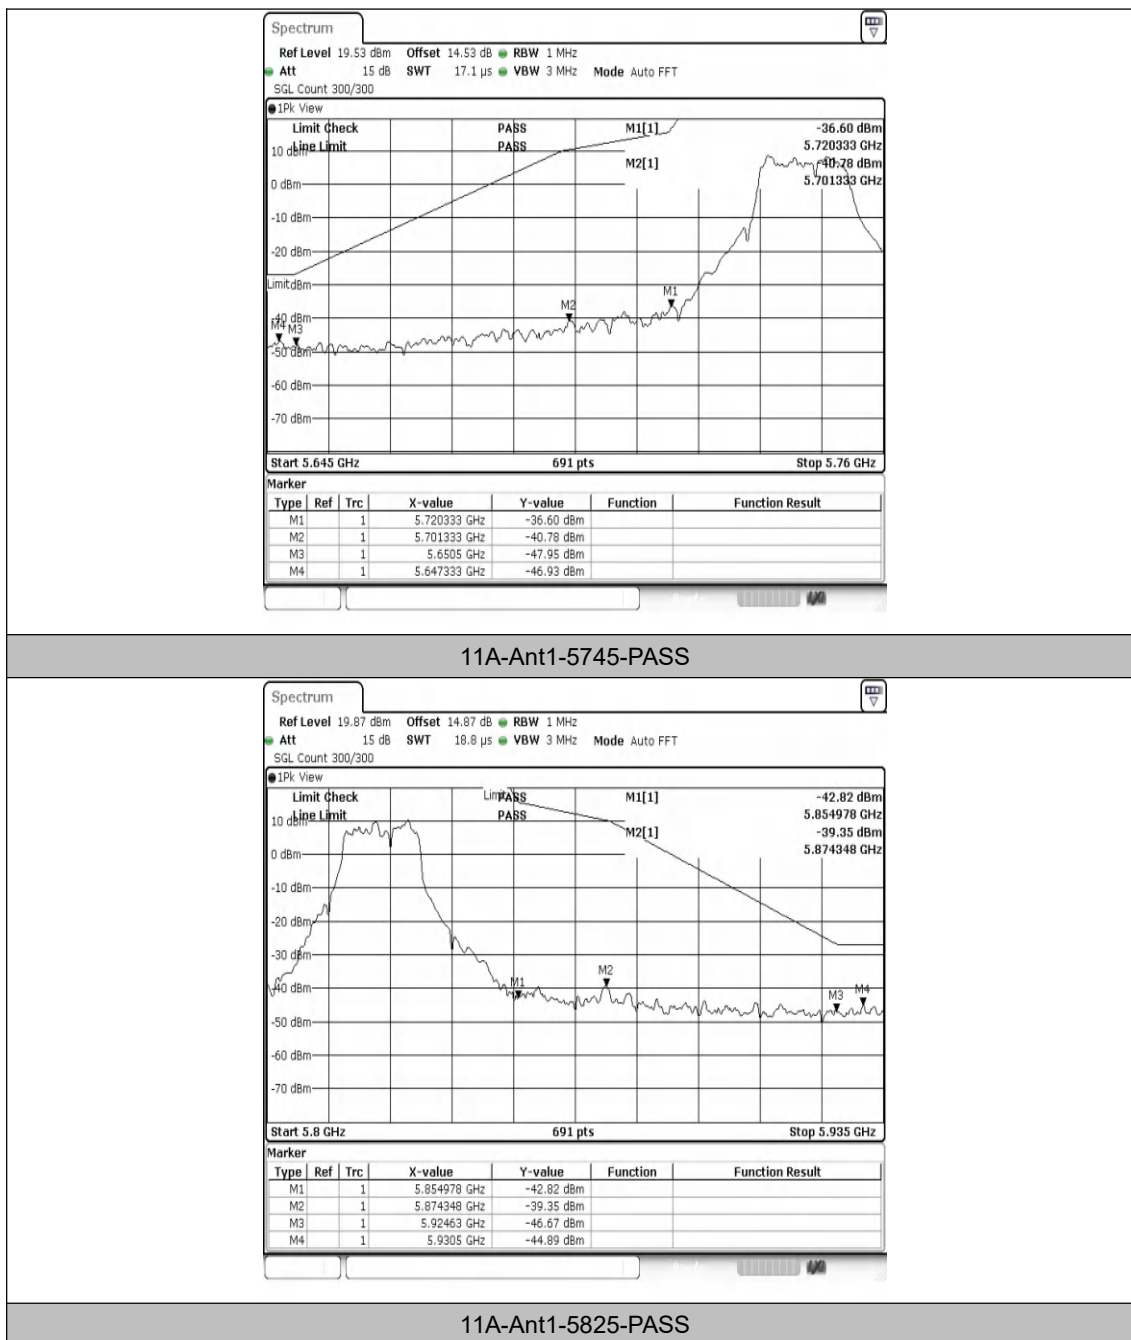

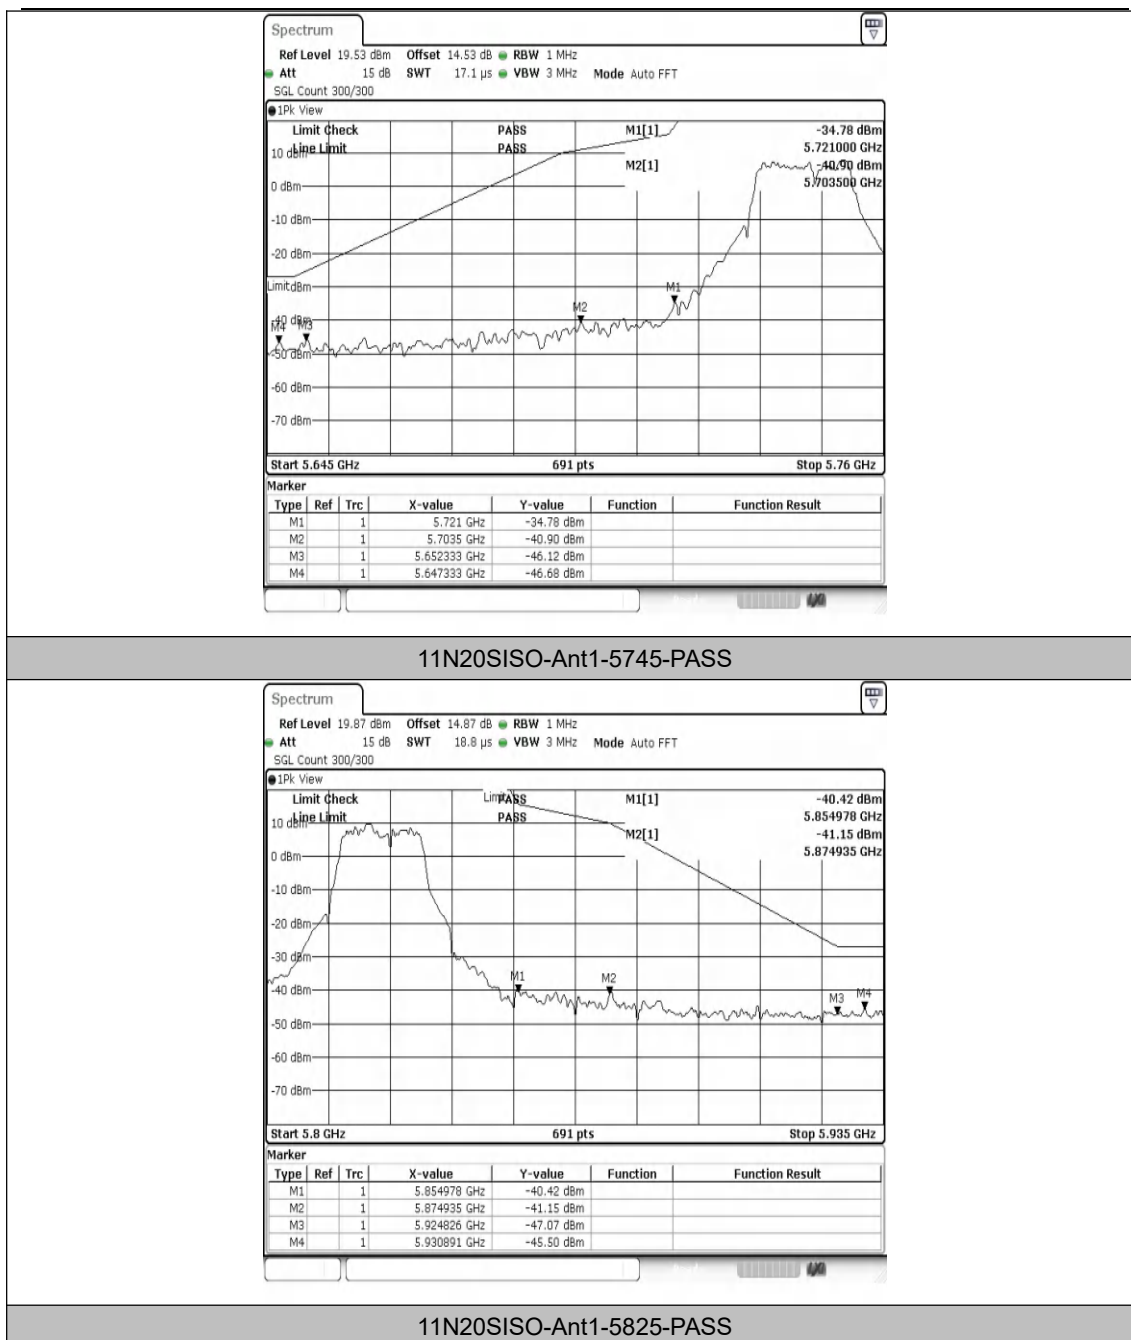


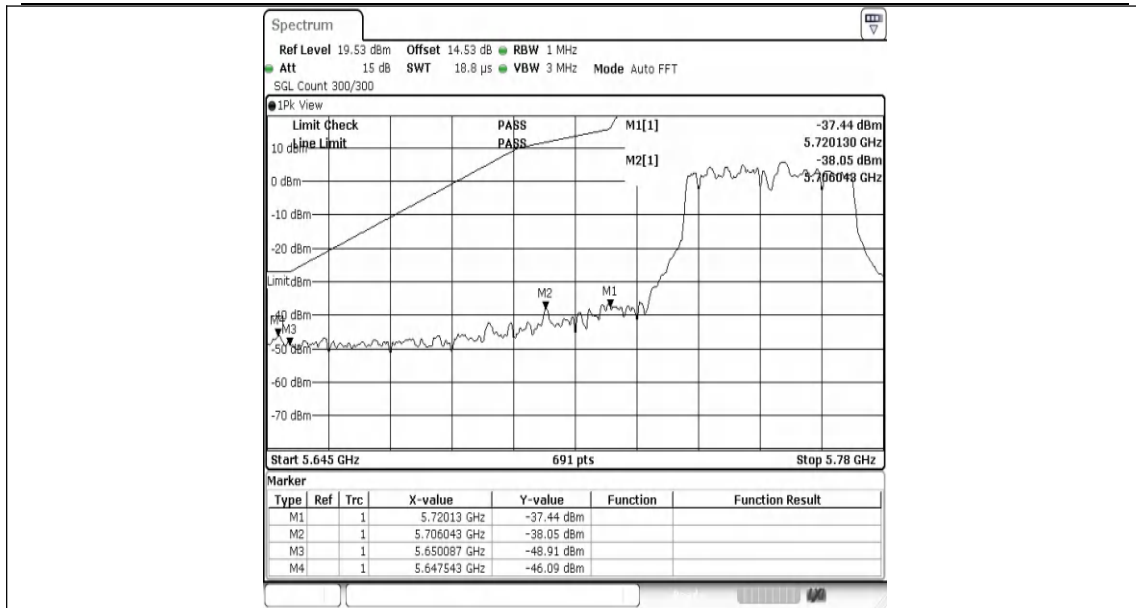



11N40SISO-Ant1-5755-PASS

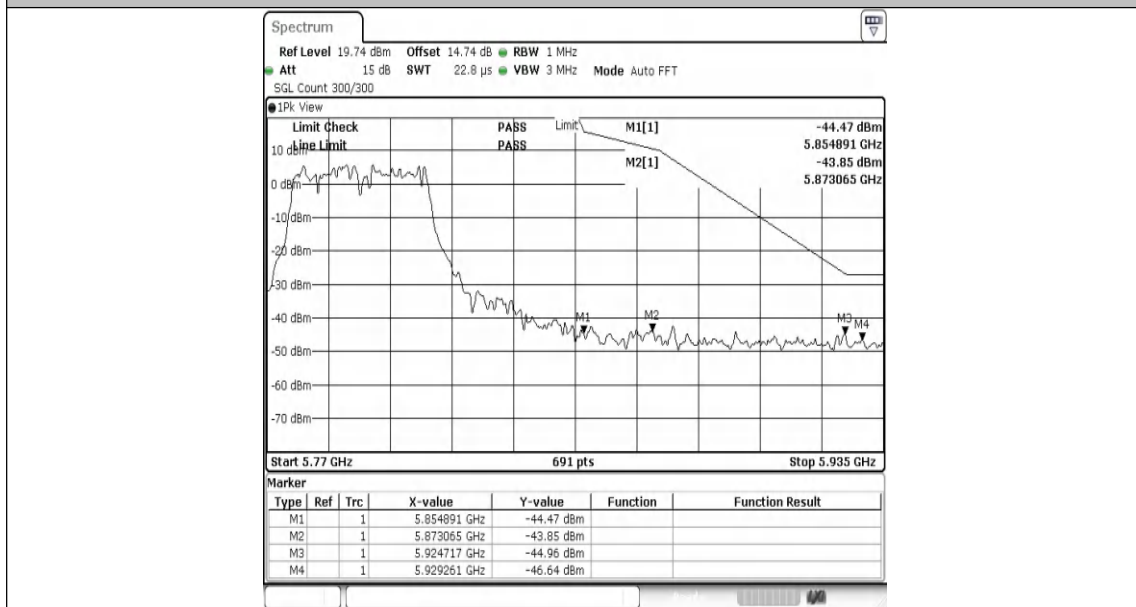



11N40SISO-Ant1-5795-PASS

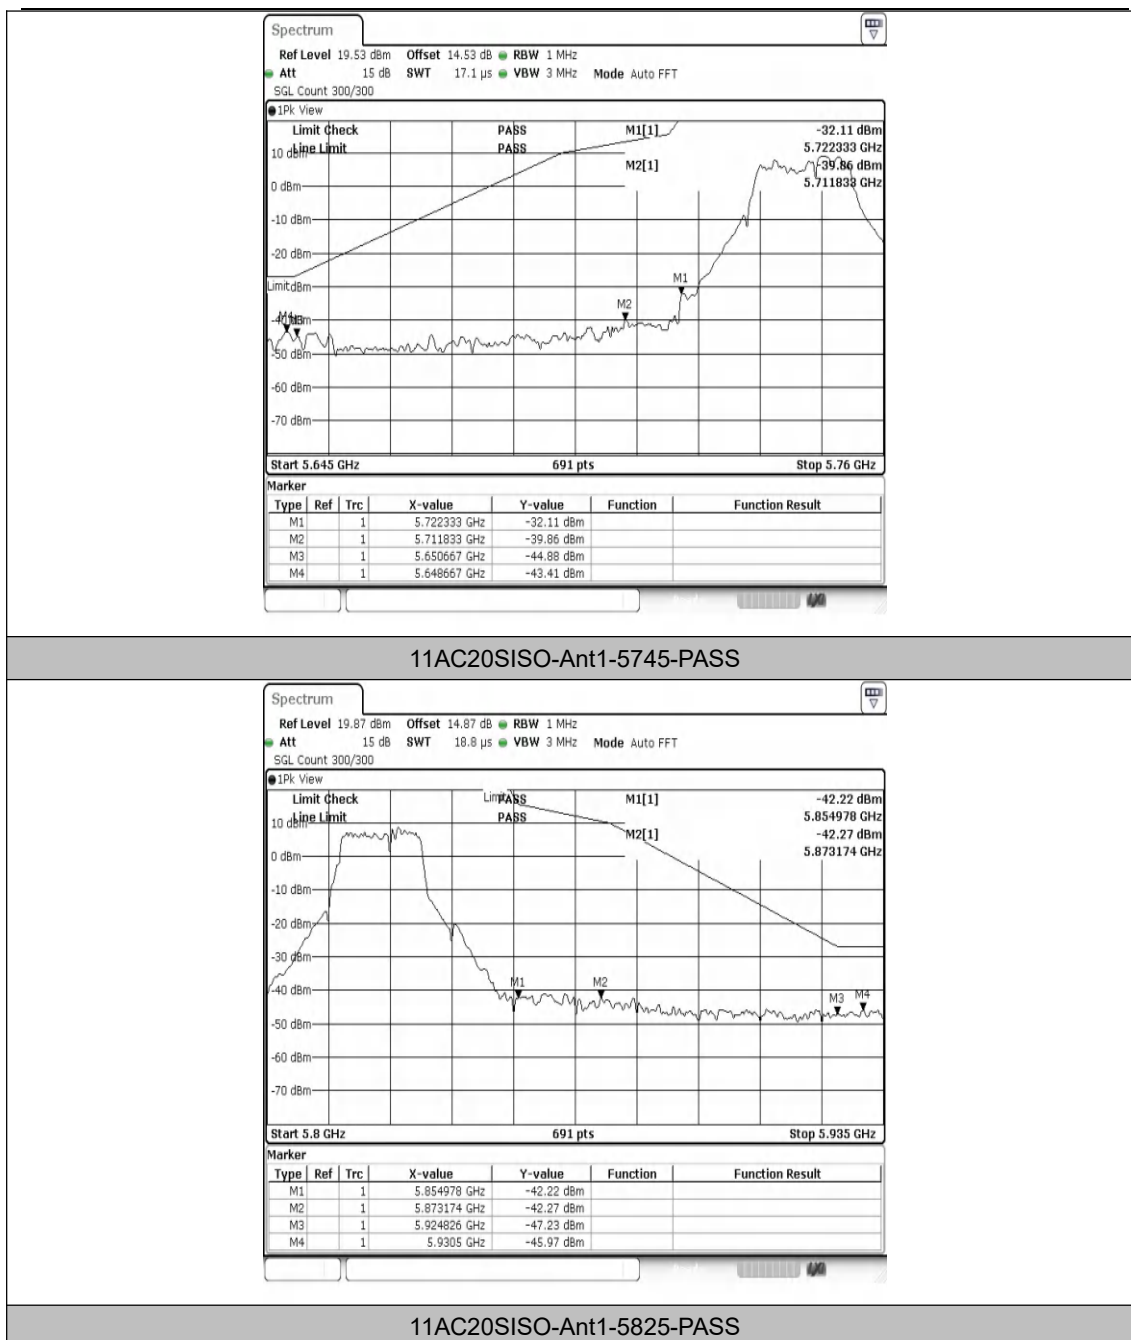

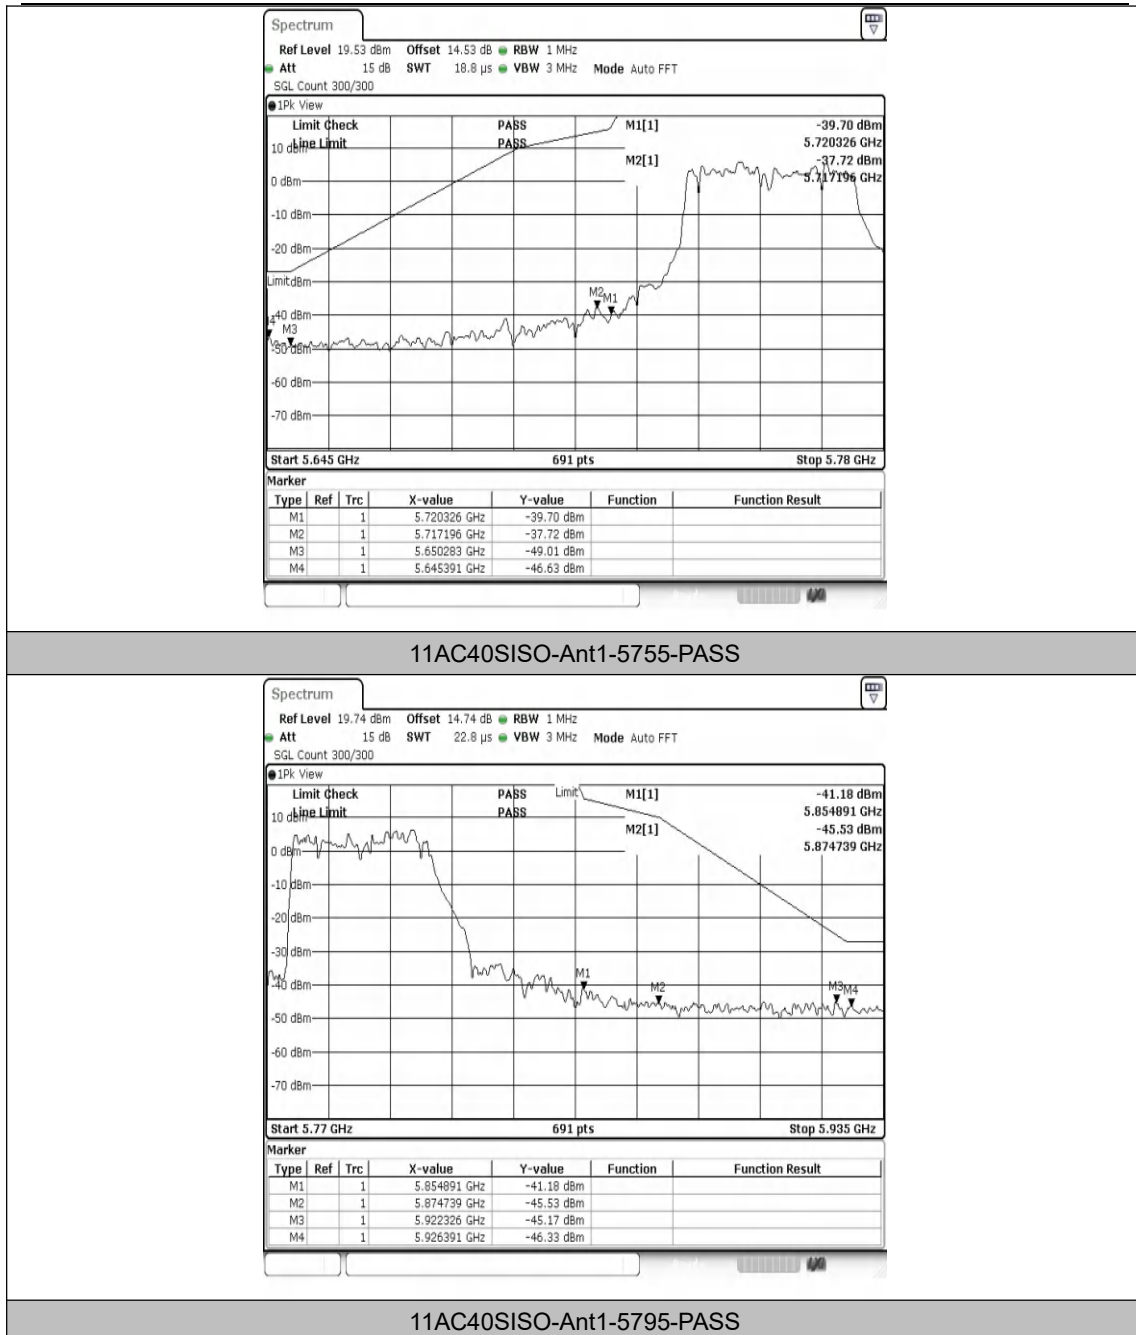


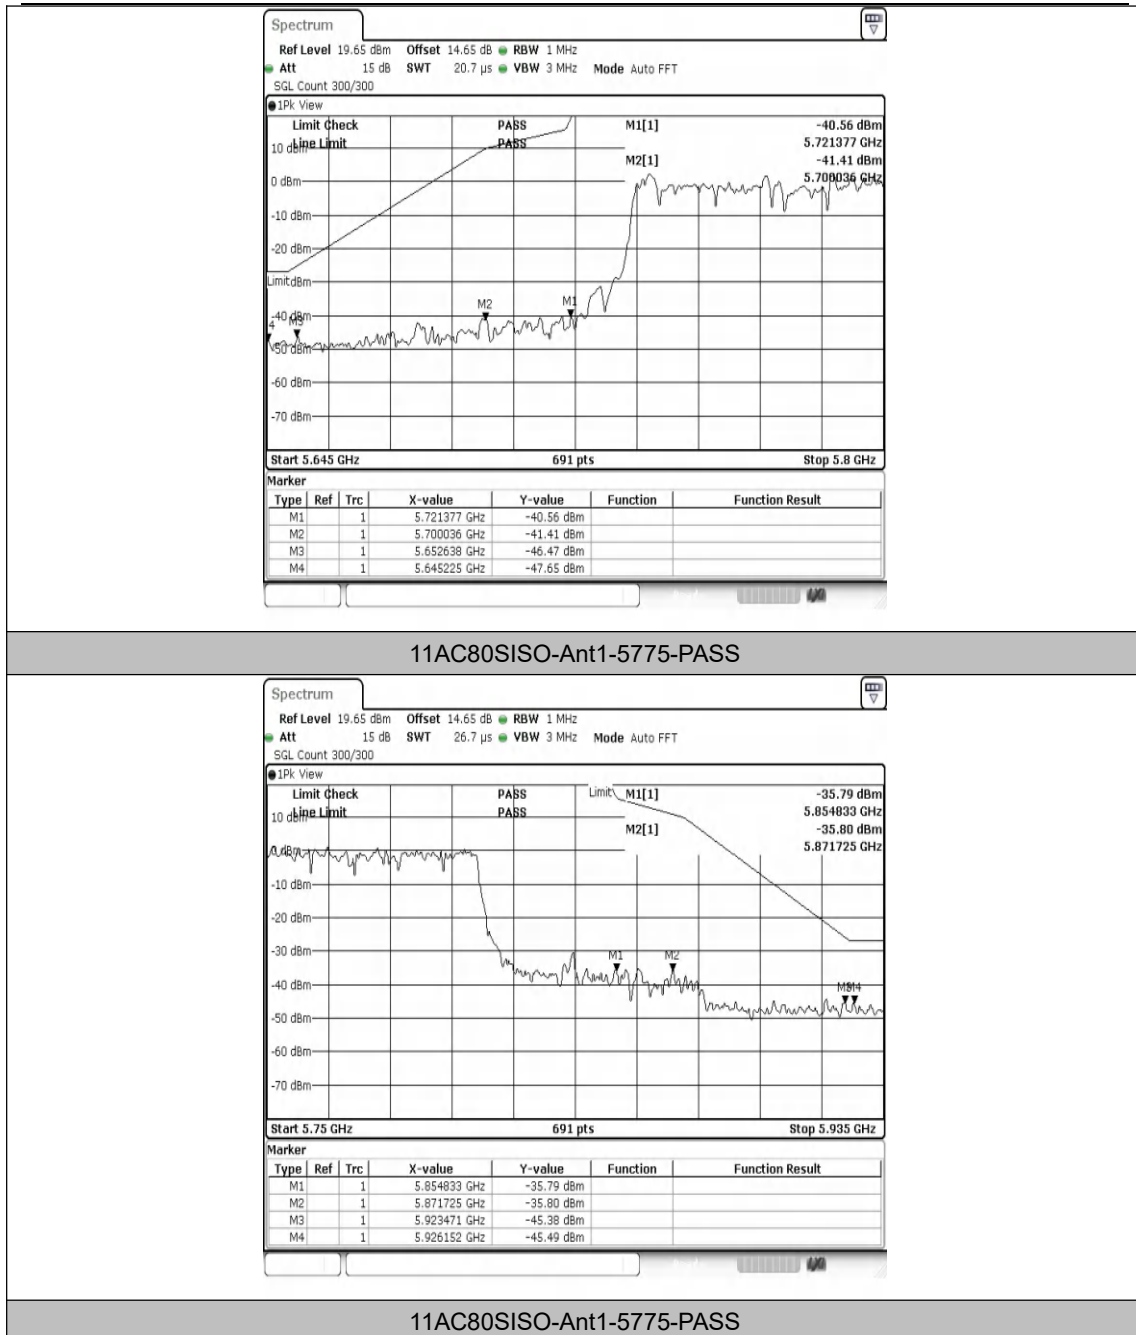

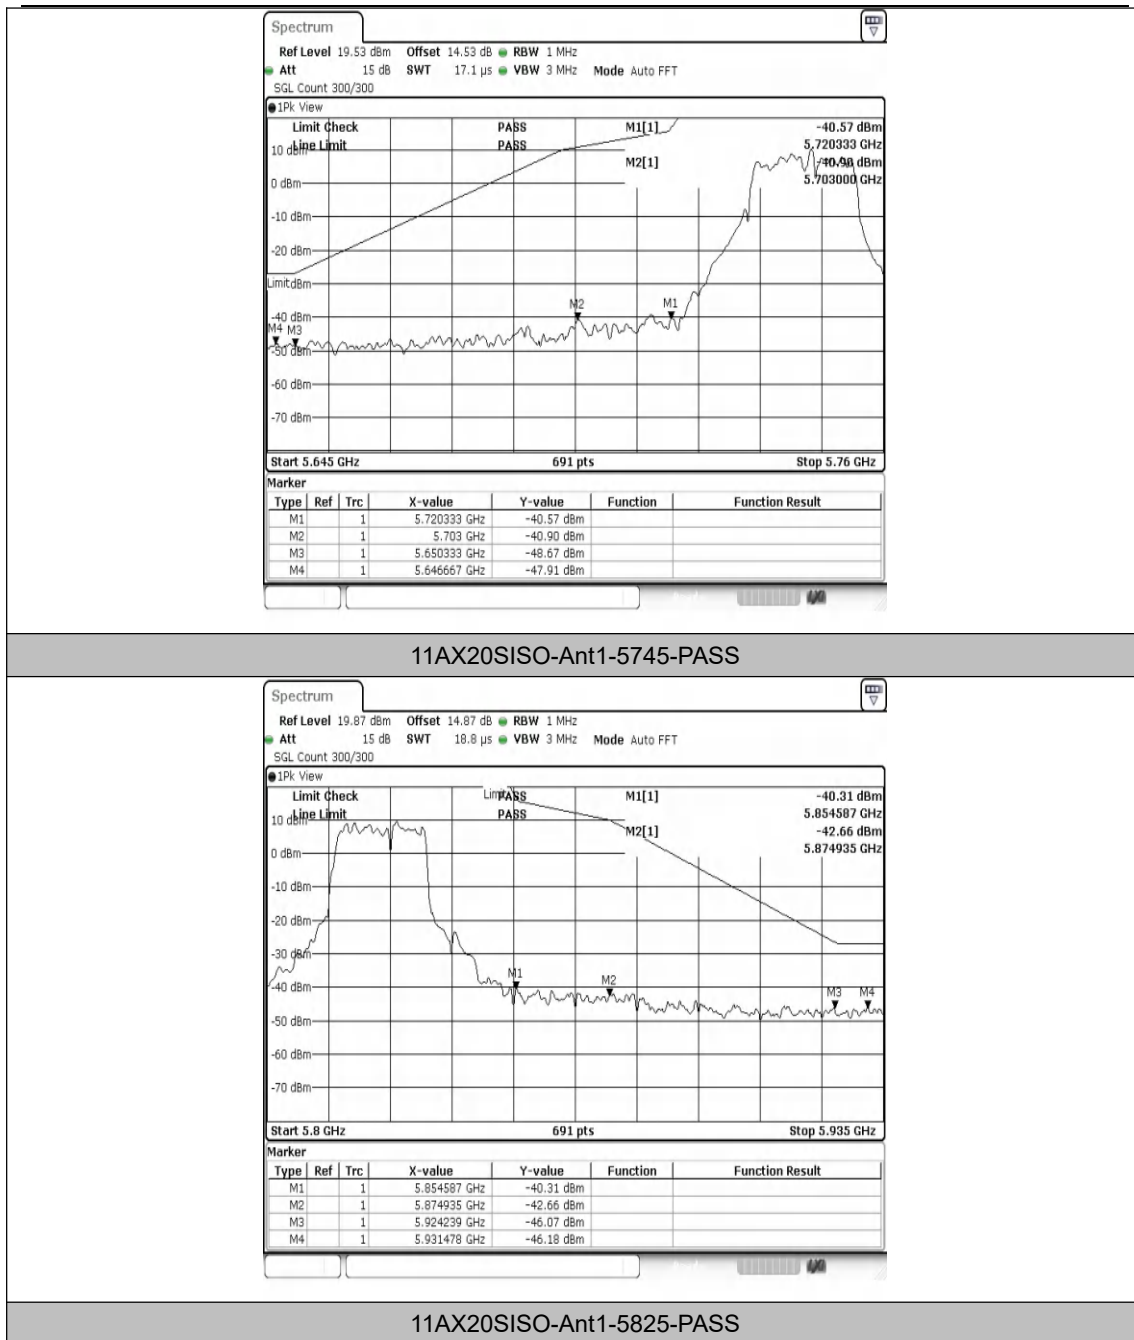


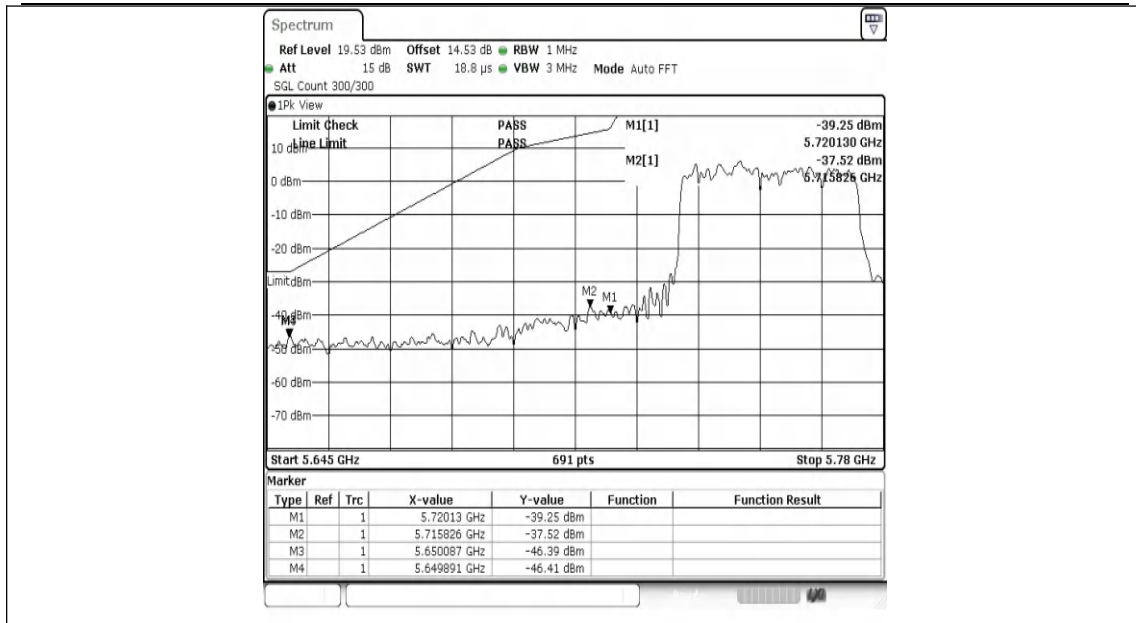

11AX40SISO-Ant1-5755-PASS

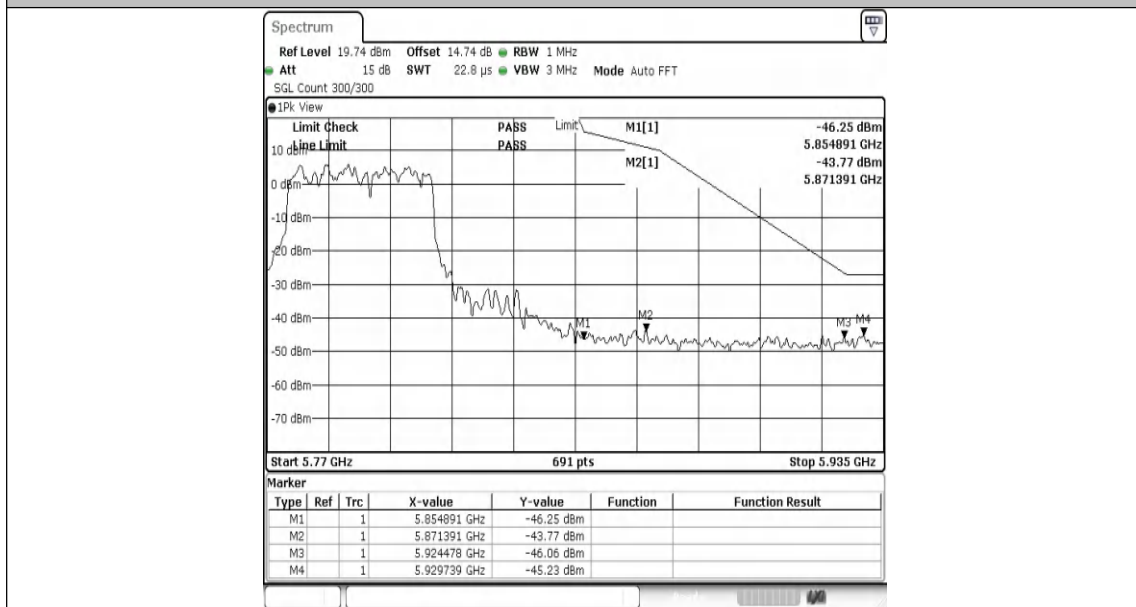

11AX40SISO-Ant1-5795-PASS

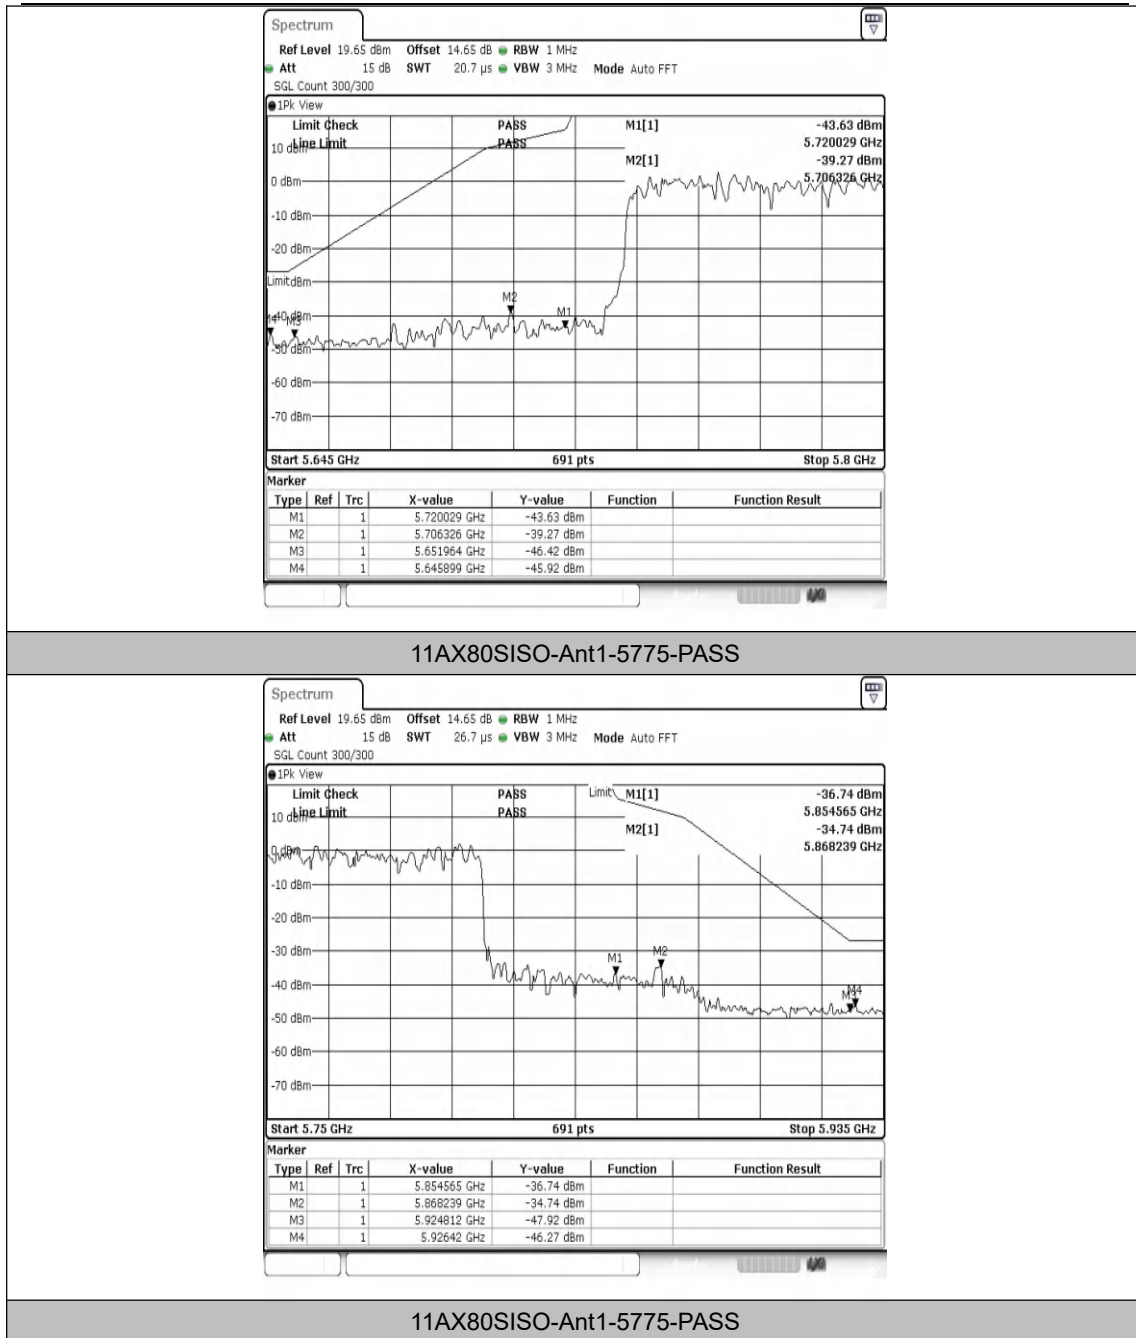

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com

Hotline
400-003-0500
www.anbotek.com


Appendix F: DFS Detection Thresholds

Test Result

TestMode	Frequency[MHz]	Radar Type	Result	Limit[dbm]	Verdict
11AX80SISO	5290	Type0	-63.05	-62.00	PASS
	5530	Type0	-63.21	-62.00	PASS



Test Graphs

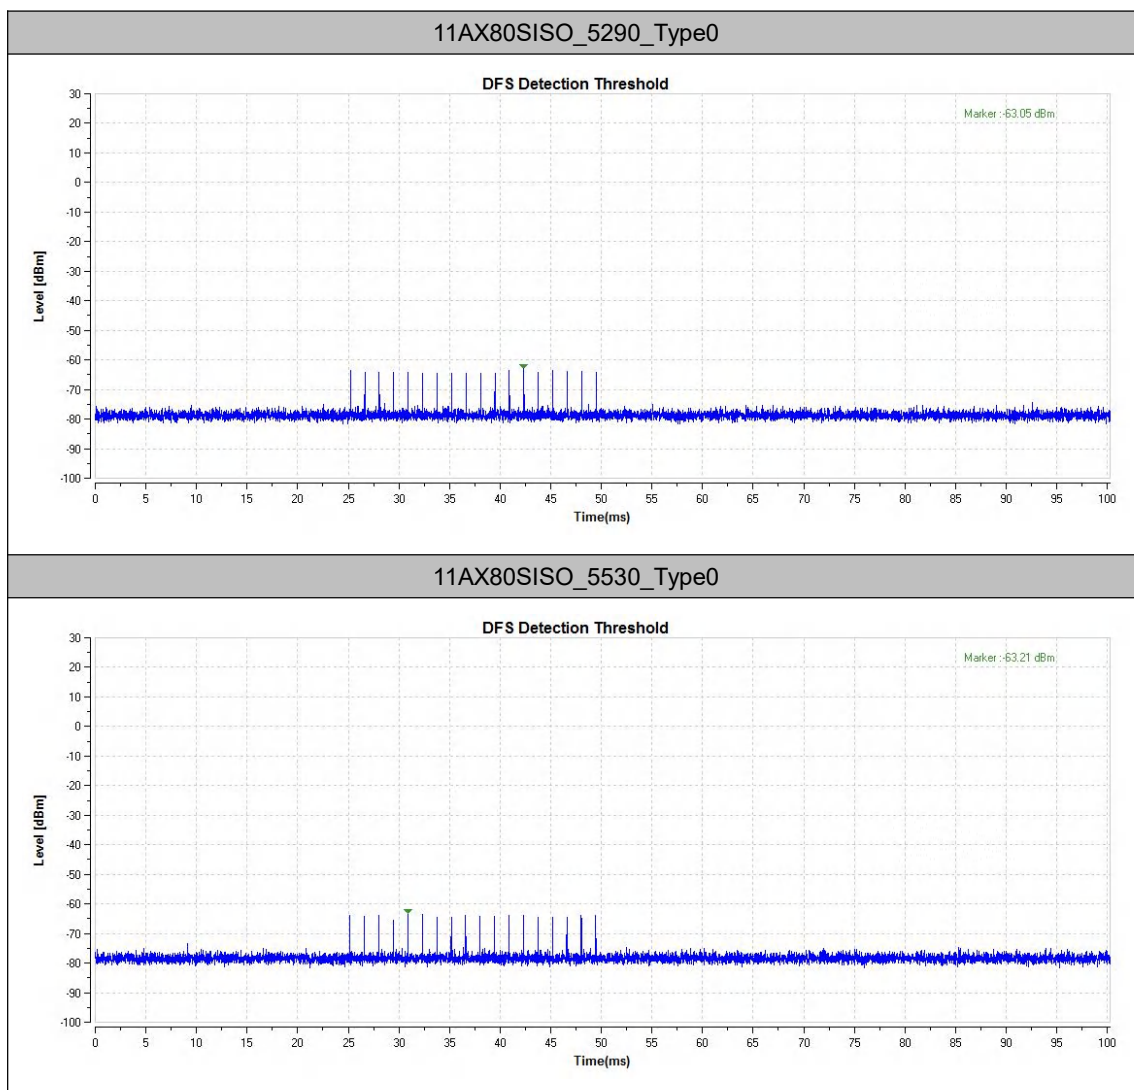

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com



Hotline
400-003-0500
www.anbotech.com

Appendix G: Channel Move Time and Channel Closing


Transmission Time

Test Result

TestMode	Frequency[MHz]	CCT[ms]	Limit[ms]	CMT[ms]	Limit[ms]	Verdict
11AX80SISO	5290	200+14.3	200+60	894.9	10000	PASS
11AX80SISO	5530	200+15.6	200+60	890.5	10000	PASS



Test Graphs

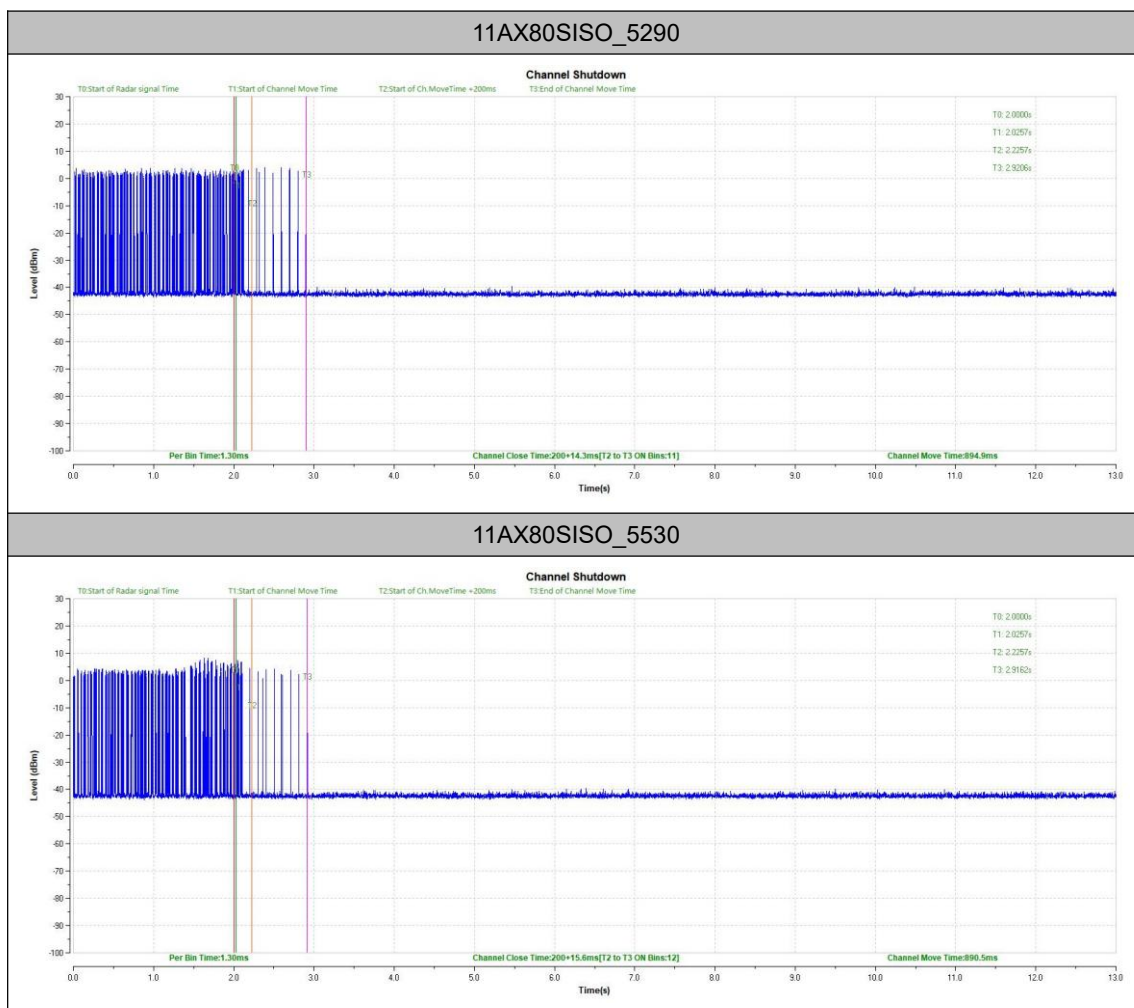

---End---

