



## 7.6 Conducted RF Spurious Emission

| Condition | Mode   | Frequency (MHz) | Antenna | Max Value (dBc) | Limit (dBc) | Verdict |
|-----------|--------|-----------------|---------|-----------------|-------------|---------|
| NVNT      | BLE 1M | 2402            | Ant1    | -40.83          | -20         | Pass    |
| NVNT      | BLE 1M | 2442            | Ant1    | -40.13          | -20         | Pass    |
| NVNT      | BLE 1M | 2480            | Ant1    | -39.58          | -20         | Pass    |
| NVNT      | BLE 2M | 2402            | Ant1    | -39.75          | -20         | Pass    |
| NVNT      | BLE 2M | 2442            | Ant1    | -39.15          | -20         | Pass    |
| NVNT      | BLE 2M | 2480            | Ant1    | -37.98          | -20         | Pass    |


## Tx. Spurious NVNT BLE 1M 2402MHz Ant1 Ref

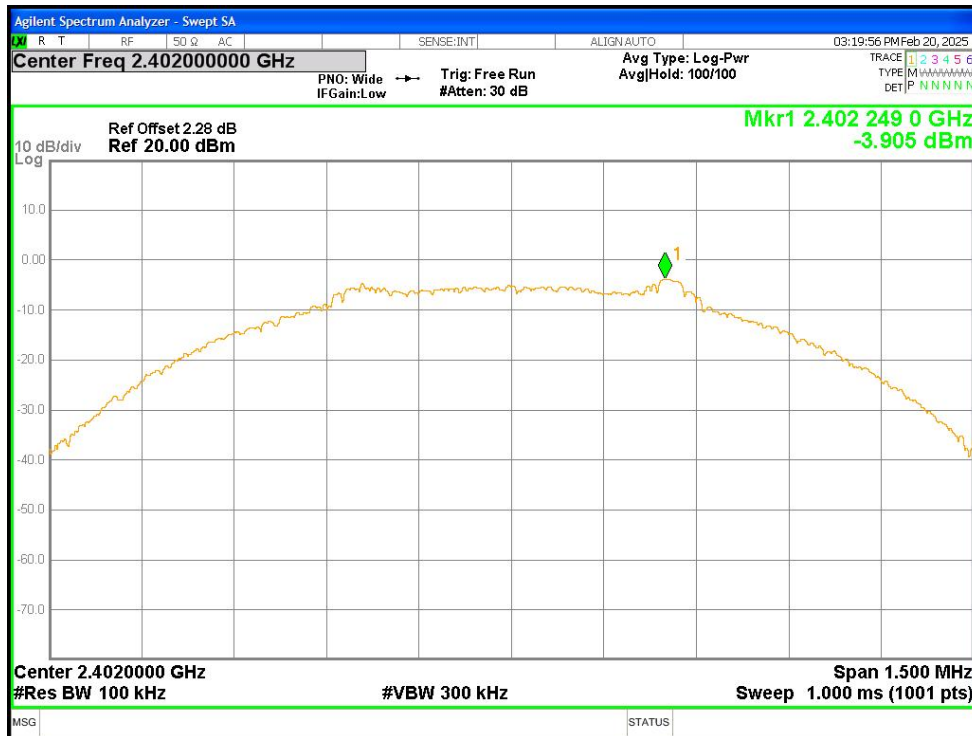


## Tx. Spurious NVNT BLE 1M 2402MHz Ant1 Emission

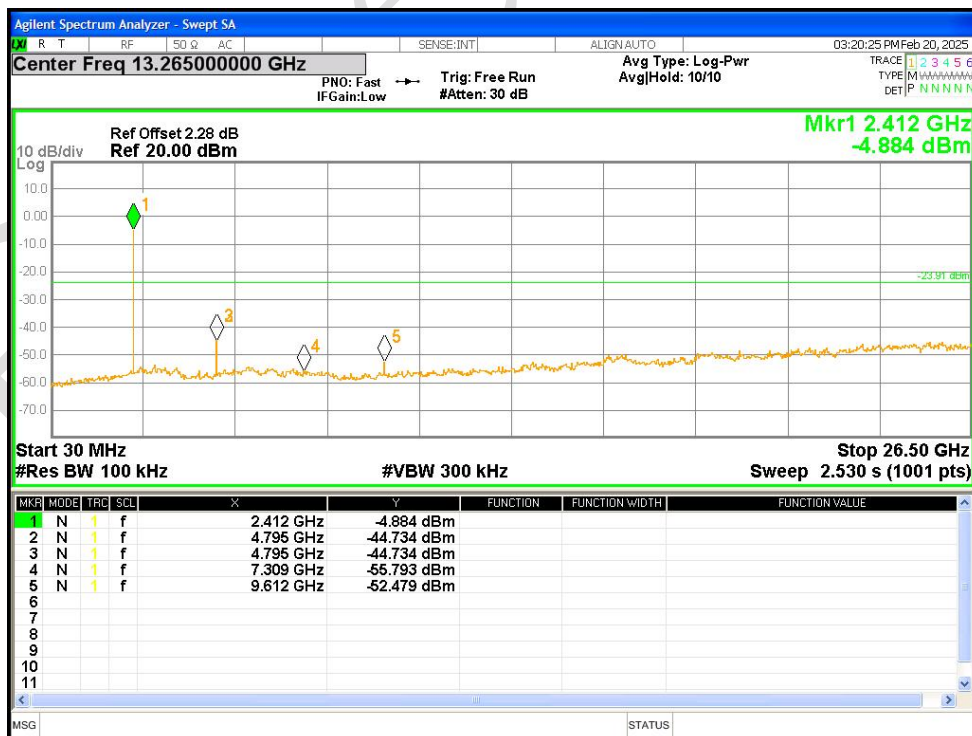


## Tx. Spurious NVNT BLE 1M 2442MHz Ant1 Ref

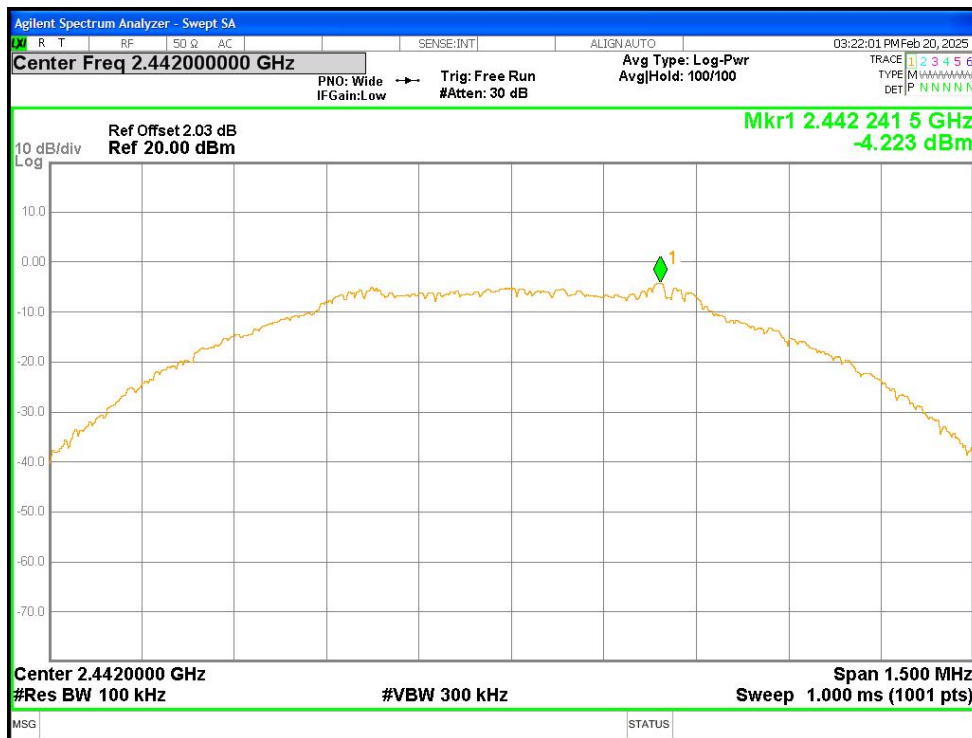


## Tx. Spurious NVNT BLE 1M 2442MHz Ant1 Emission

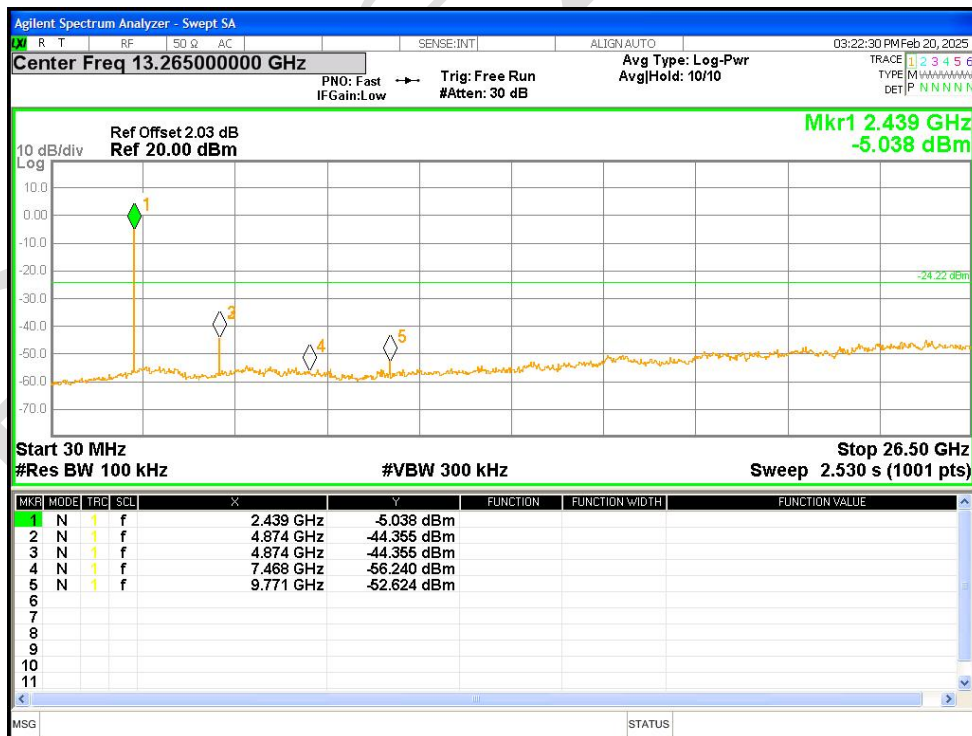


## Tx. Spurious NVNT BLE 1M 2480MHz Ant1 Ref

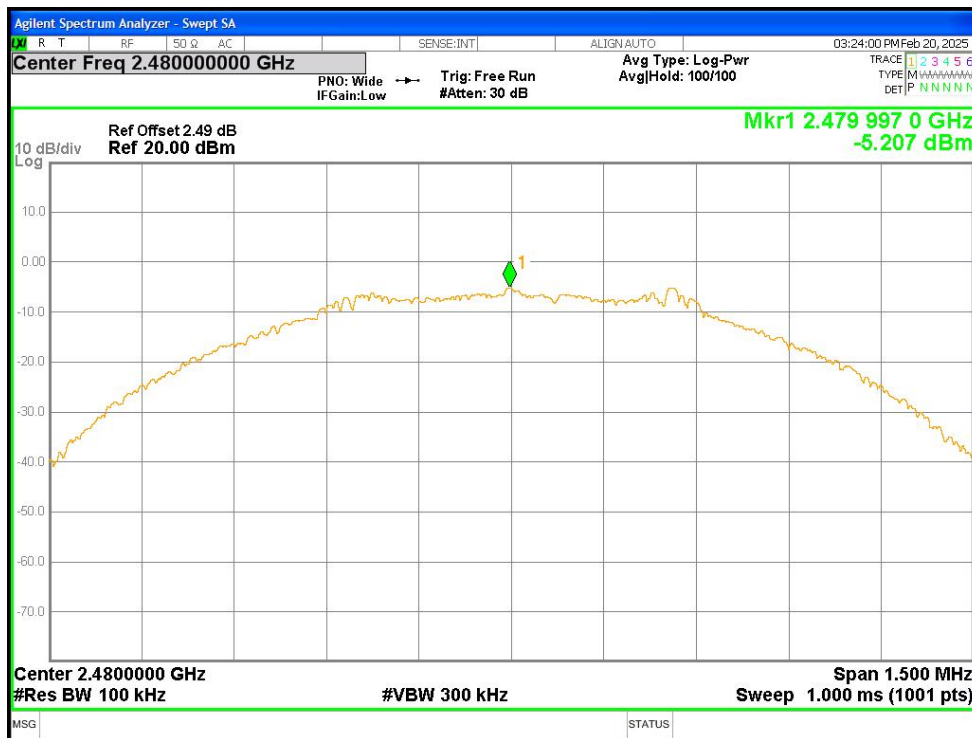


## Tx. Spurious NVNT BLE 1M 2480MHz Ant1 Emission

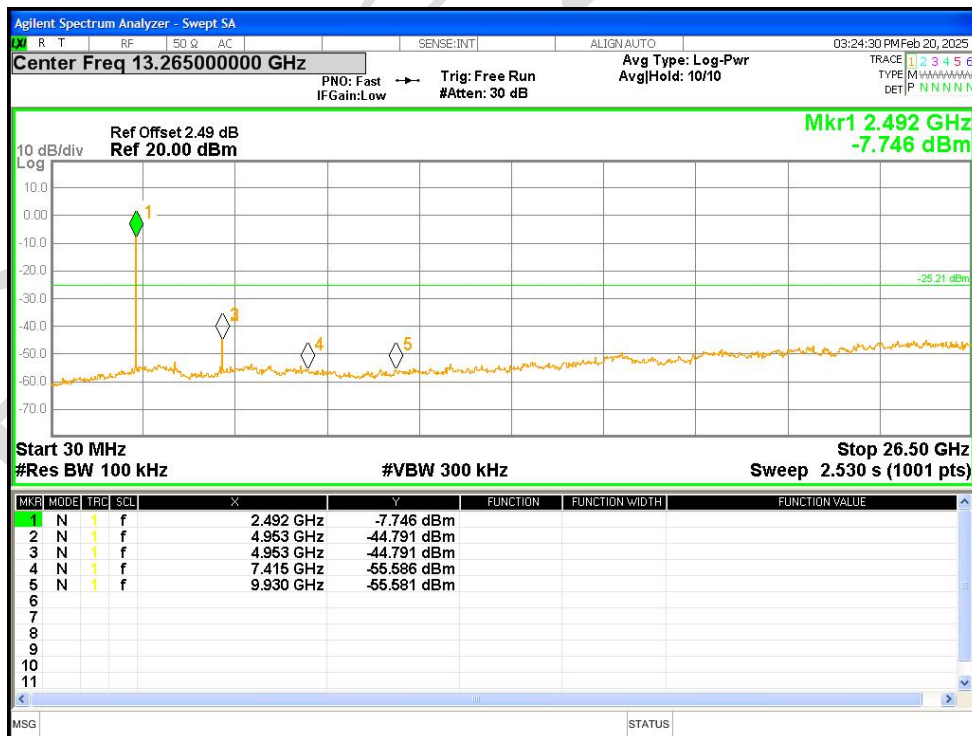

## Tx. Spurious NVNT BLE 2M 2402MHz Ant1 Ref

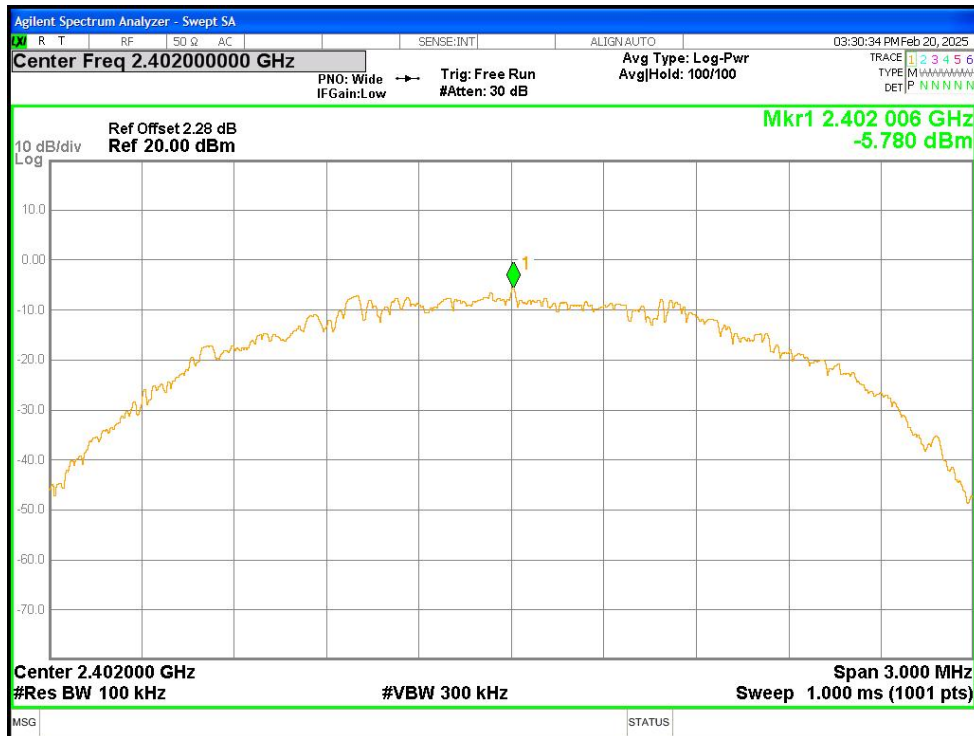


## Tx. Spurious NVNT BLE 2M 2402MHz Ant1 Emission

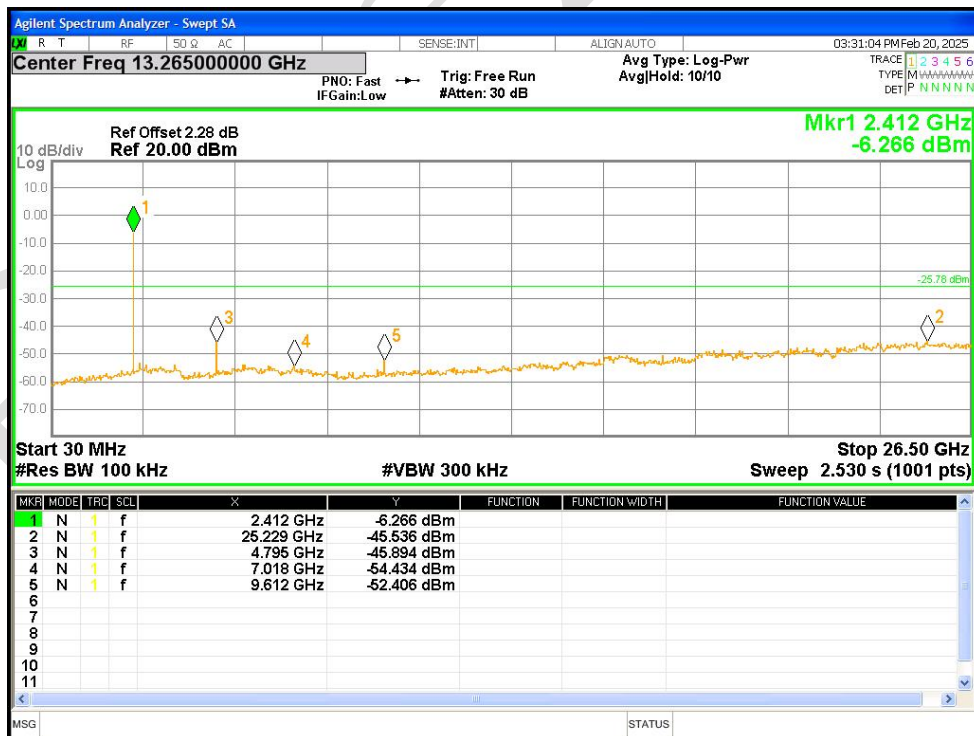

## Tx. Spurious NVNT BLE 2M 2442MHz Ant1 Ref




## Tx. Spurious NVNT BLE 2M 2442MHz Ant1 Emission

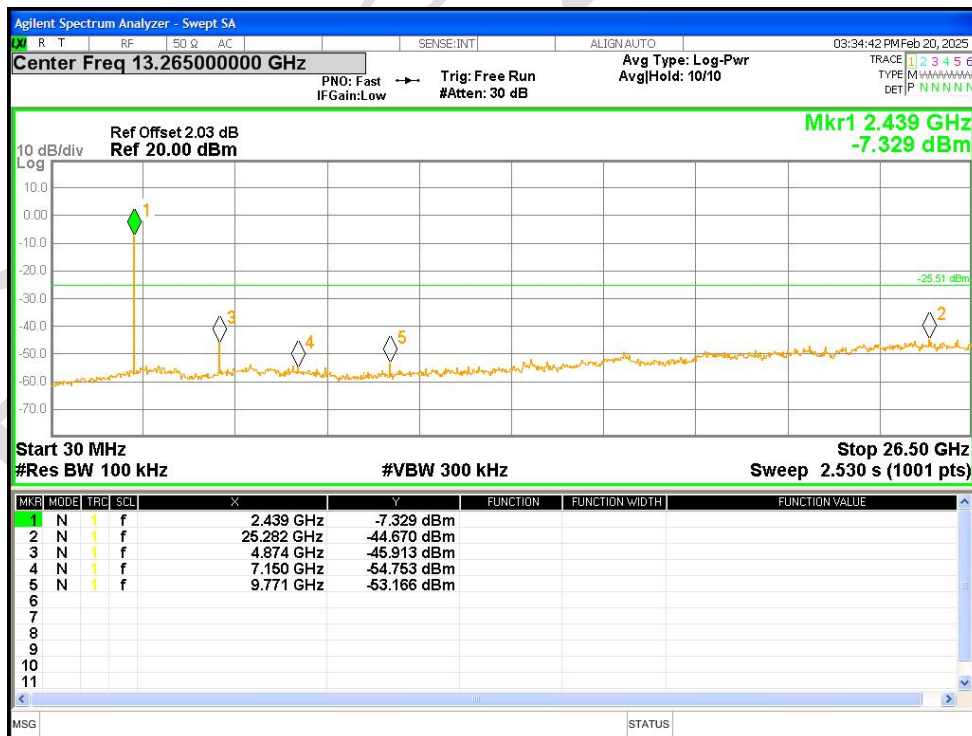

Tx. Spurious NVNT BLE 2M 2480MHz Ant1 Ref



Tx. Spurious NVNT BLE 2M 2480MHz Ant1 Emission

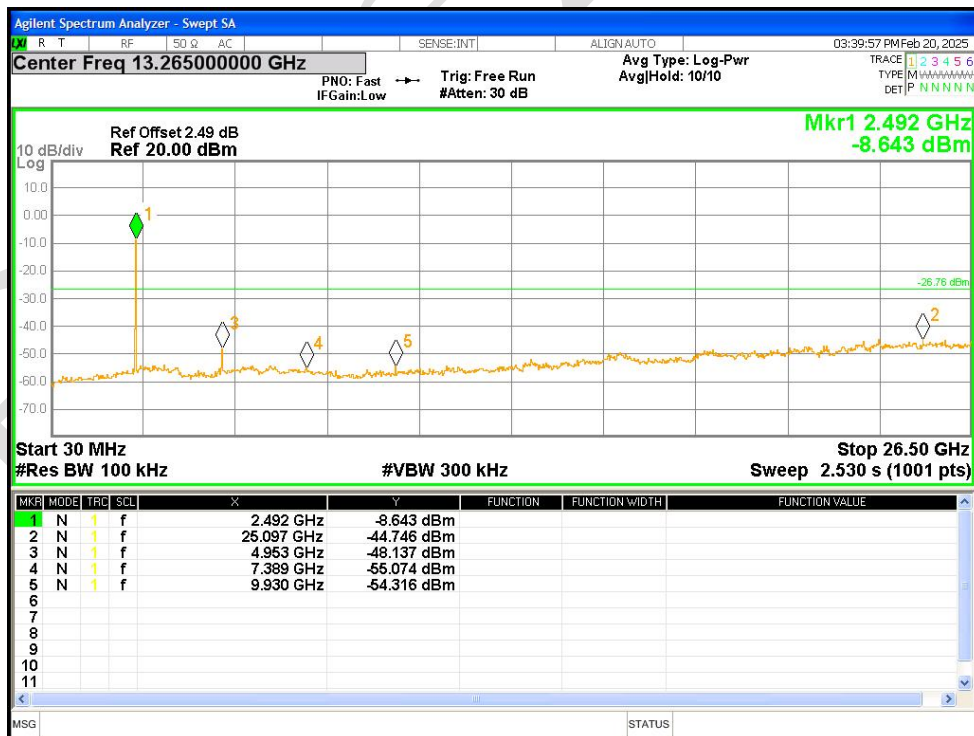


## Appendix B: photographs of test setup

Conducted emissions at AC power line (150kHz-30MHz)



Radiated Emissions (30MHz-1GHz)

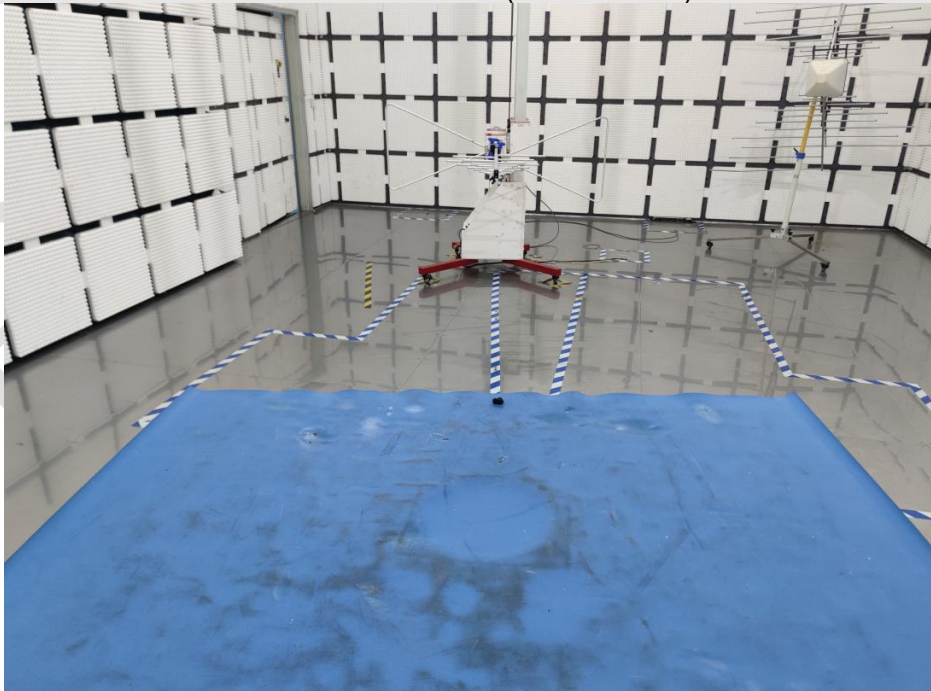

Radiated Emissions (above 1GHz)



## Appendix C: photographs of EUT

Reference to the test report no. BLA-EMC-202501-A3201

**----END OF REPORT----**

The test report is effective only with both signature and specialized stamp, the result(s) shown in this report refer only to the sample(s) tested. Without written approval of BlueAsia, this report can't be reproduced except in full.