

Appendix Test Data

Report No.:	1812C50021012502	Test Sample No.:	1-2-2
Start Test Date:	2025.1.15	Finish Test Date:	2025.1.21
Test Engineer:	Hansen Guan	Auditor:	Justin Feng
Temperature:	22.3°C	Relative Humidity:	40%
Pressure:	101kPa		


Appendix A1: 26dB Bandwidth


Test Result


Test Mode	Antenna	Frequency[MHz]	26db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	21.32	5169.24	5190.56	---	---
11A	Ant1	5200	20.80	5189.64	5210.44	---	---
11A	Ant1	5240	20.76	5230.16	5250.92	---	---
11N20SISO	Ant1	5180	21.40	5168.92	5190.32	---	---
11N20SISO	Ant1	5200	21.08	5189.20	5210.28	---	---
11N20SISO	Ant1	5240	21.72	5229.04	5250.76	---	---
11N40SISO	Ant1	5190	40.24	5169.76	5210.00	---	---
11N40SISO	Ant1	5230	39.20	5211.04	5250.24	---	---
11AC20SISO	Ant1	5180	21.48	5169.16	5190.64	---	---
11AC20SISO	Ant1	5200	21.32	5189.00	5210.32	---	---
11AC20SISO	Ant1	5240	21.32	5229.28	5250.60	---	---
11AC40SISO	Ant1	5190	39.60	5170.72	5210.32	---	---
11AC40SISO	Ant1	5230	39.92	5210.40	5250.32	---	---
11AC80SISO	Ant1	5210	80.32	5169.20	5249.52	---	---





Test Graphs

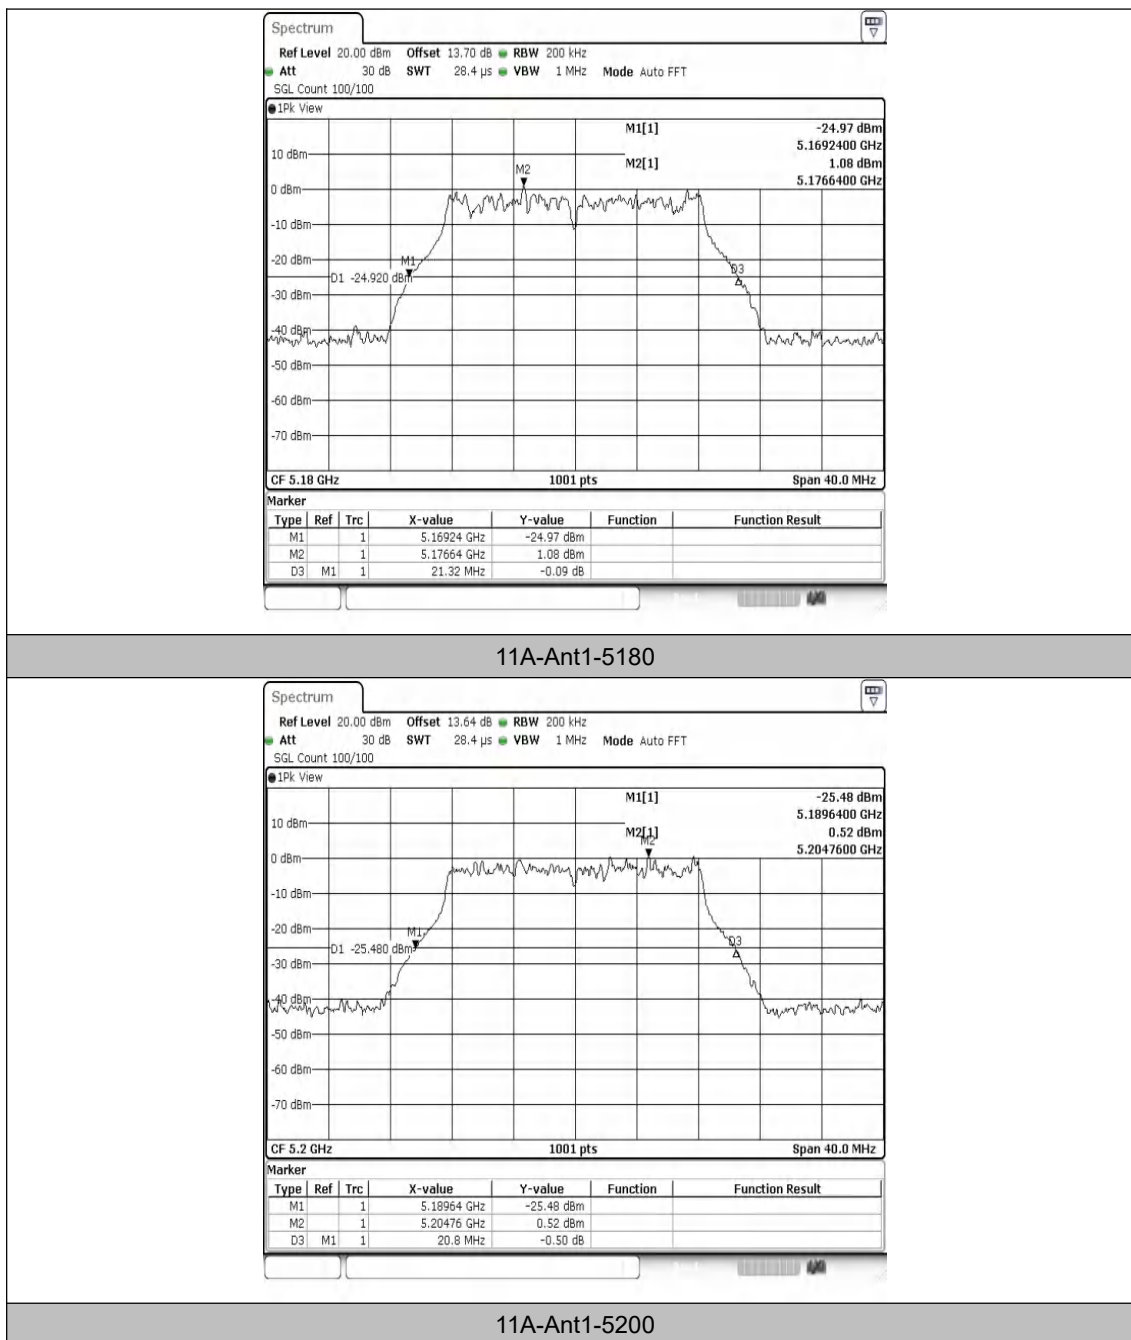


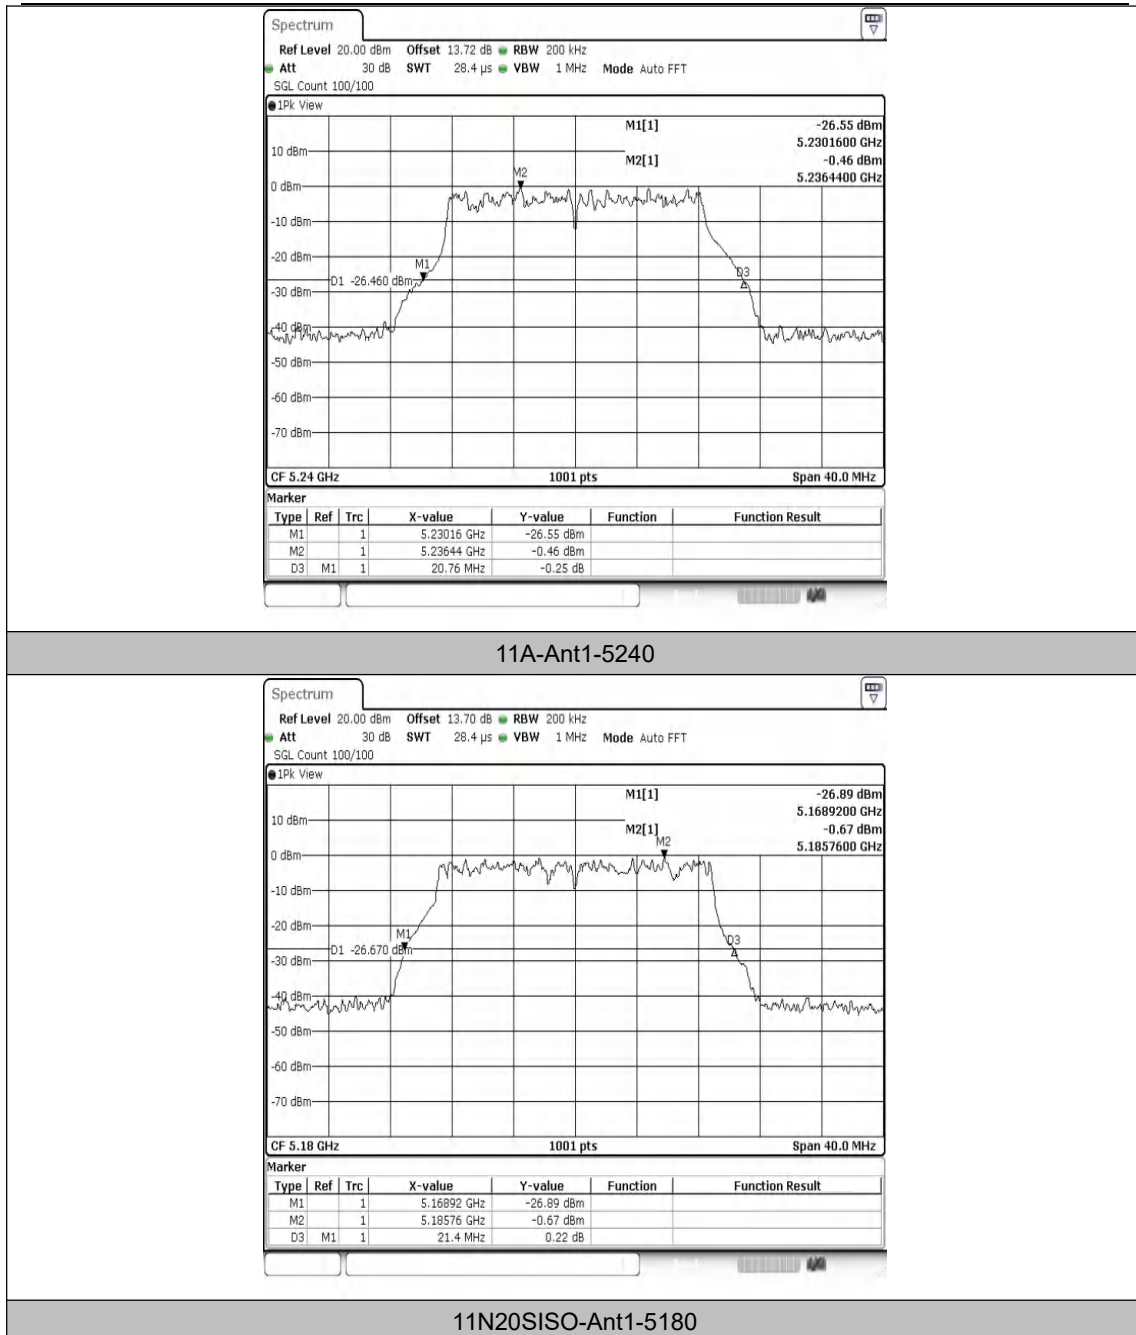

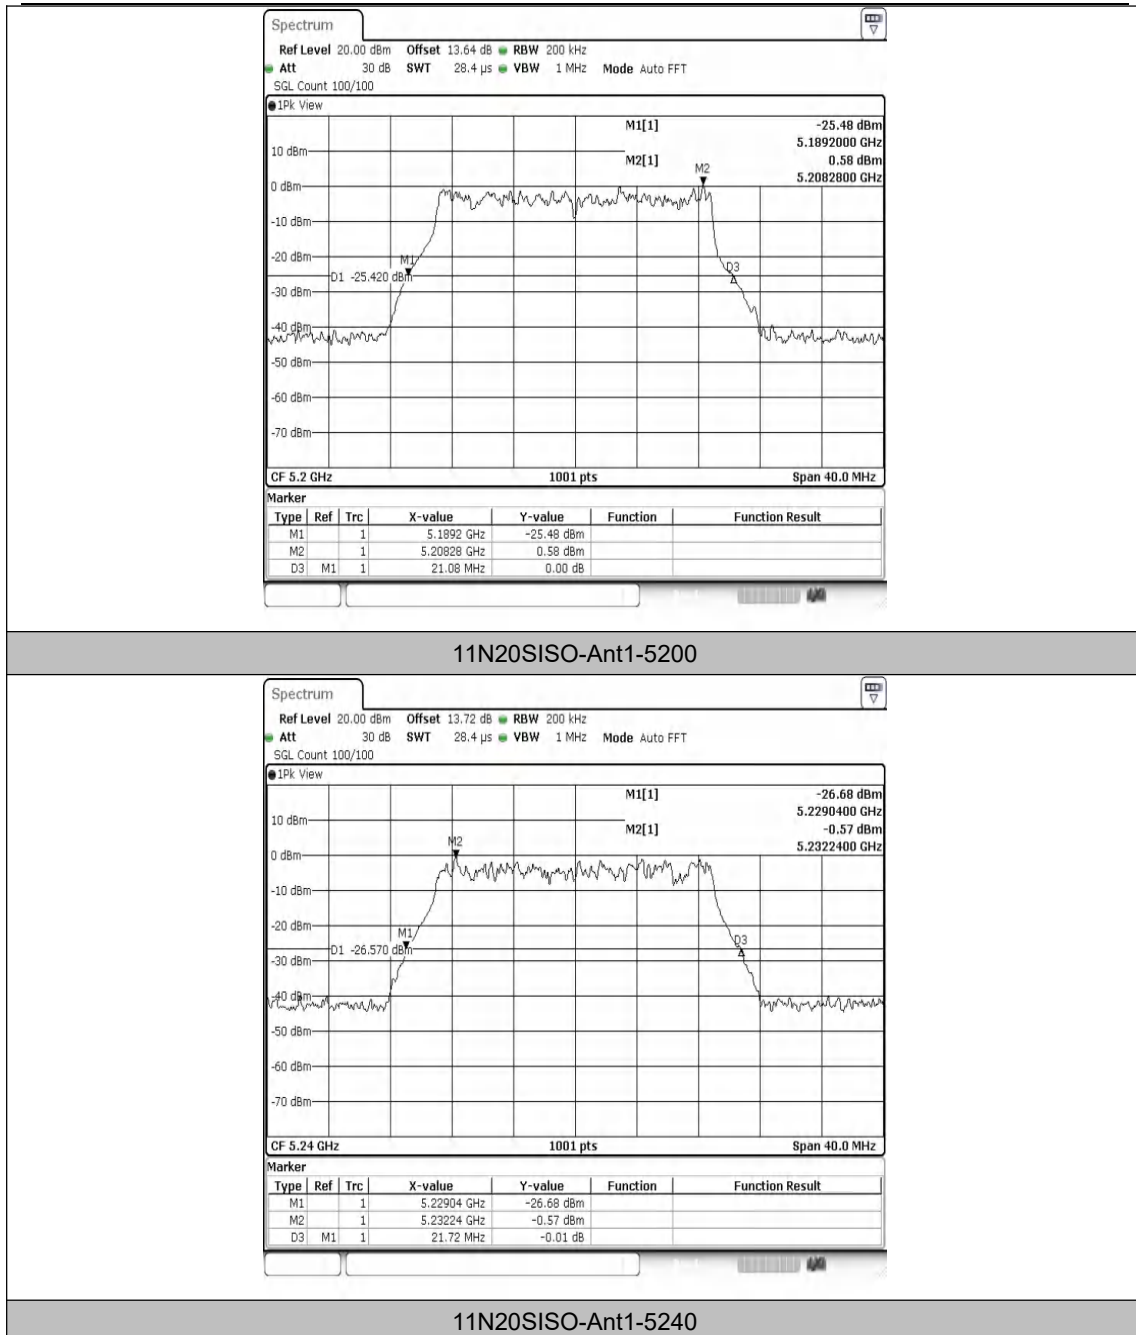

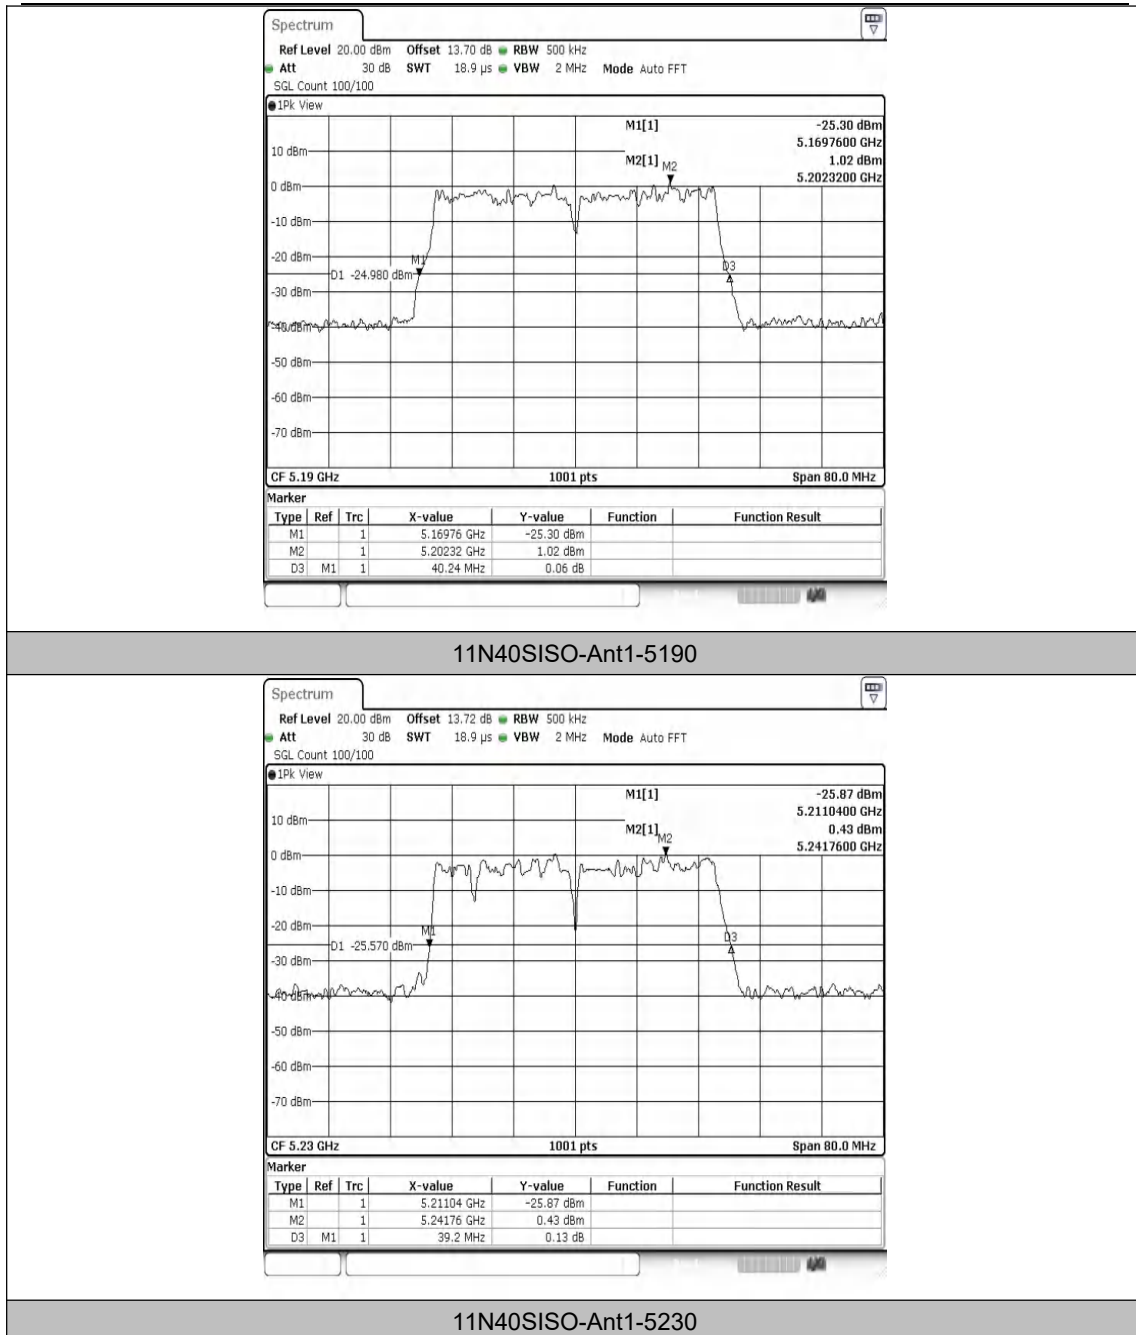

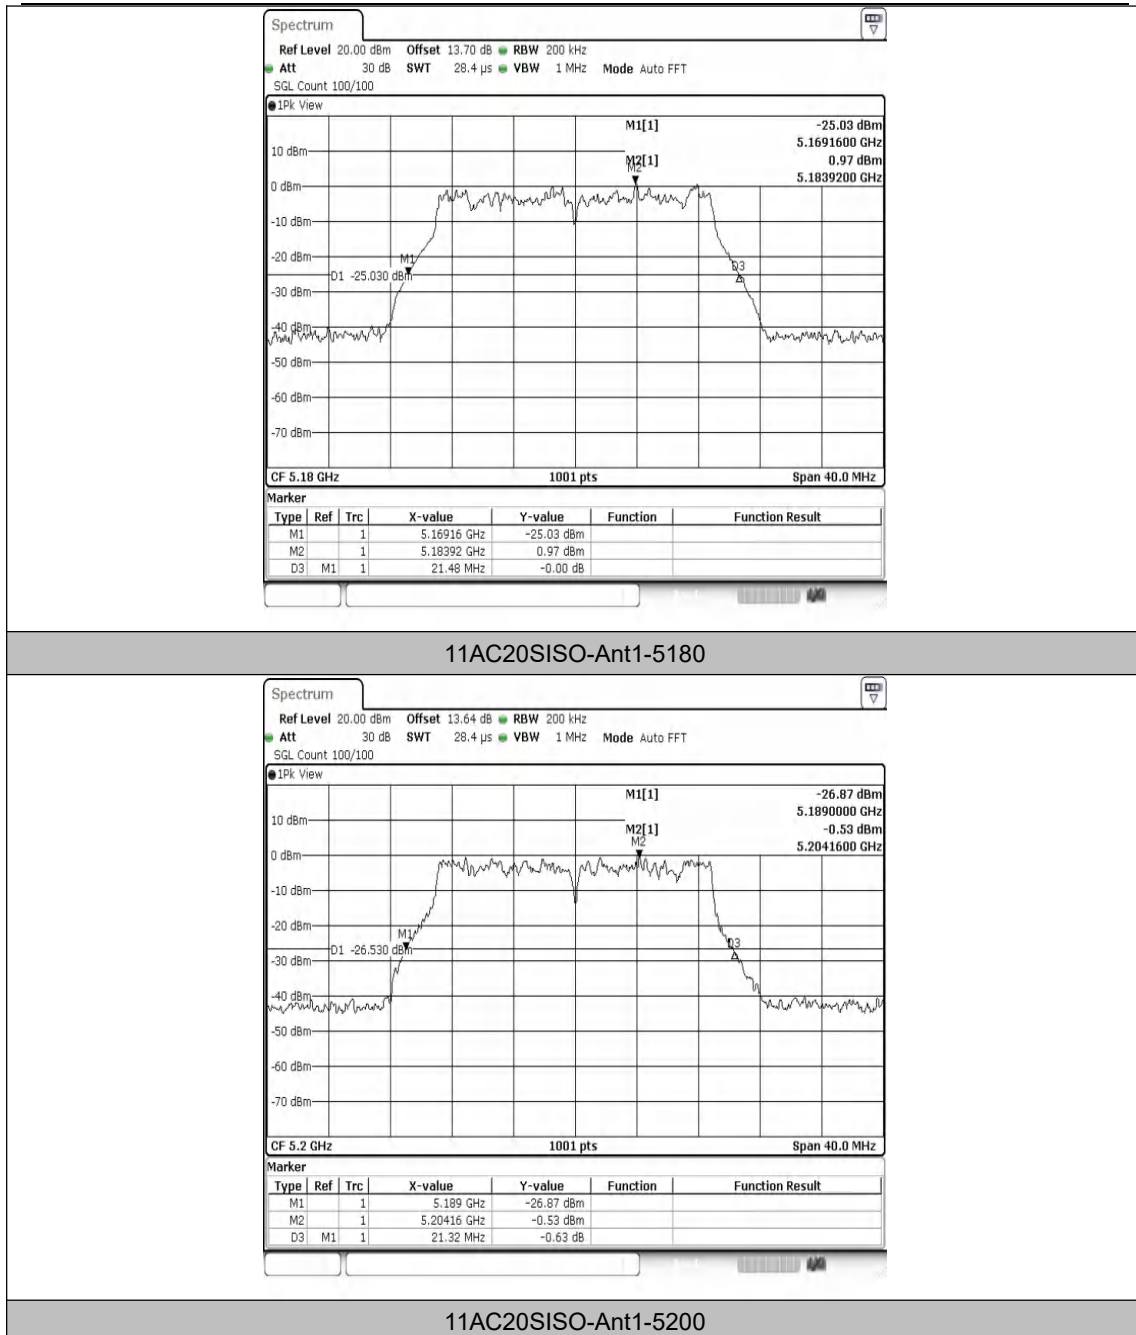


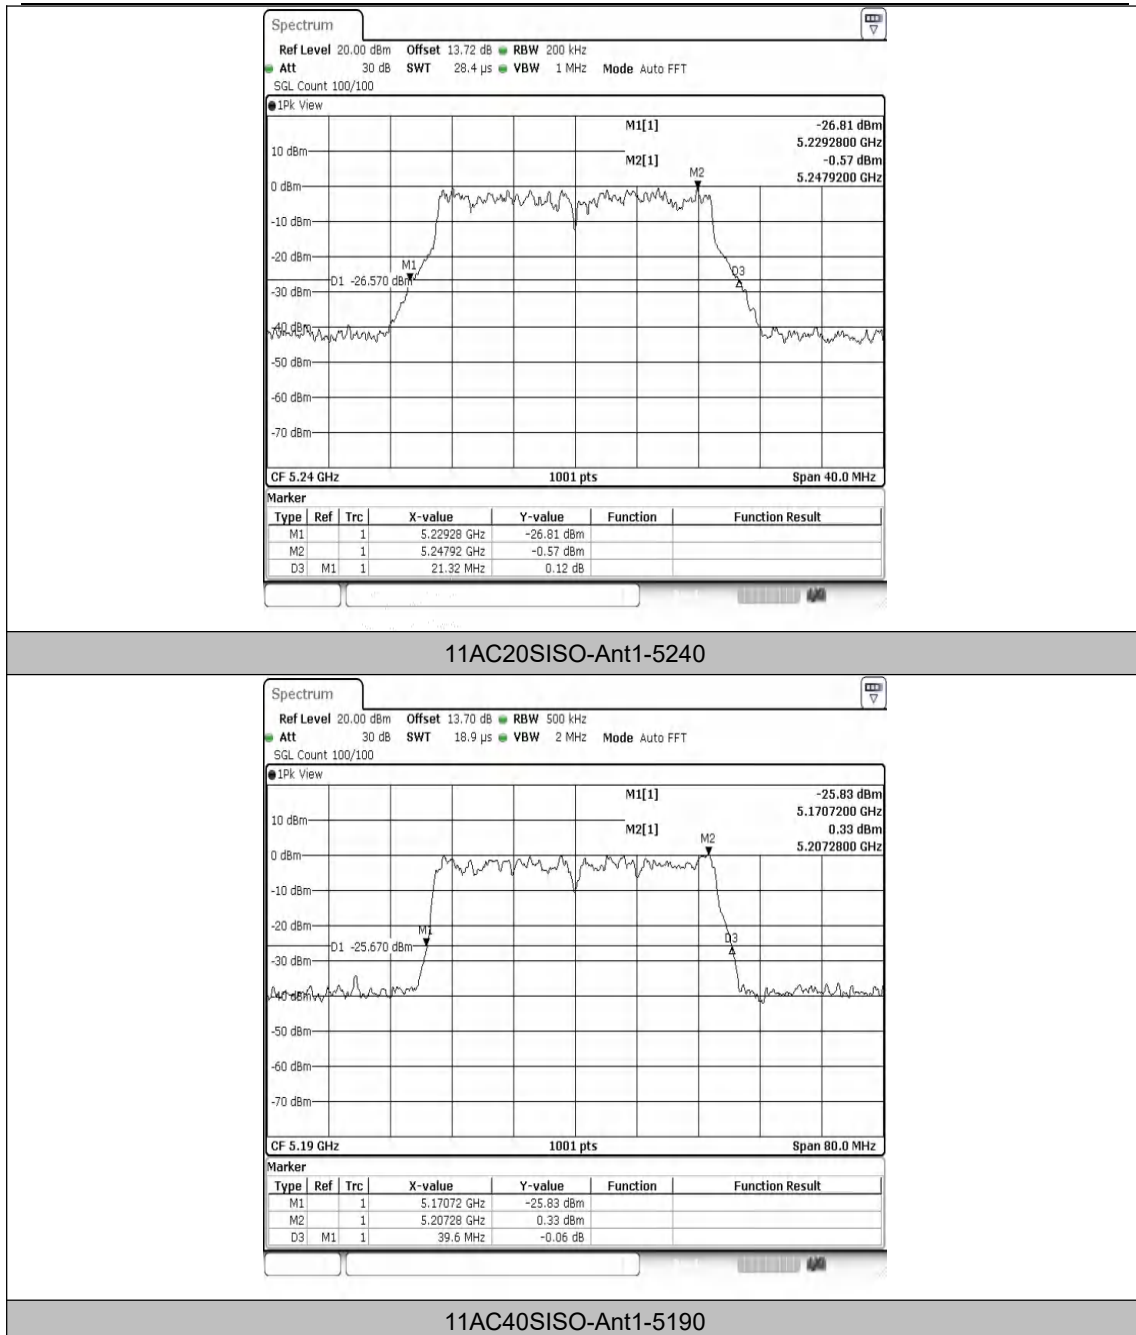

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com

Hotline
400-003-0500
www.anbotek.com

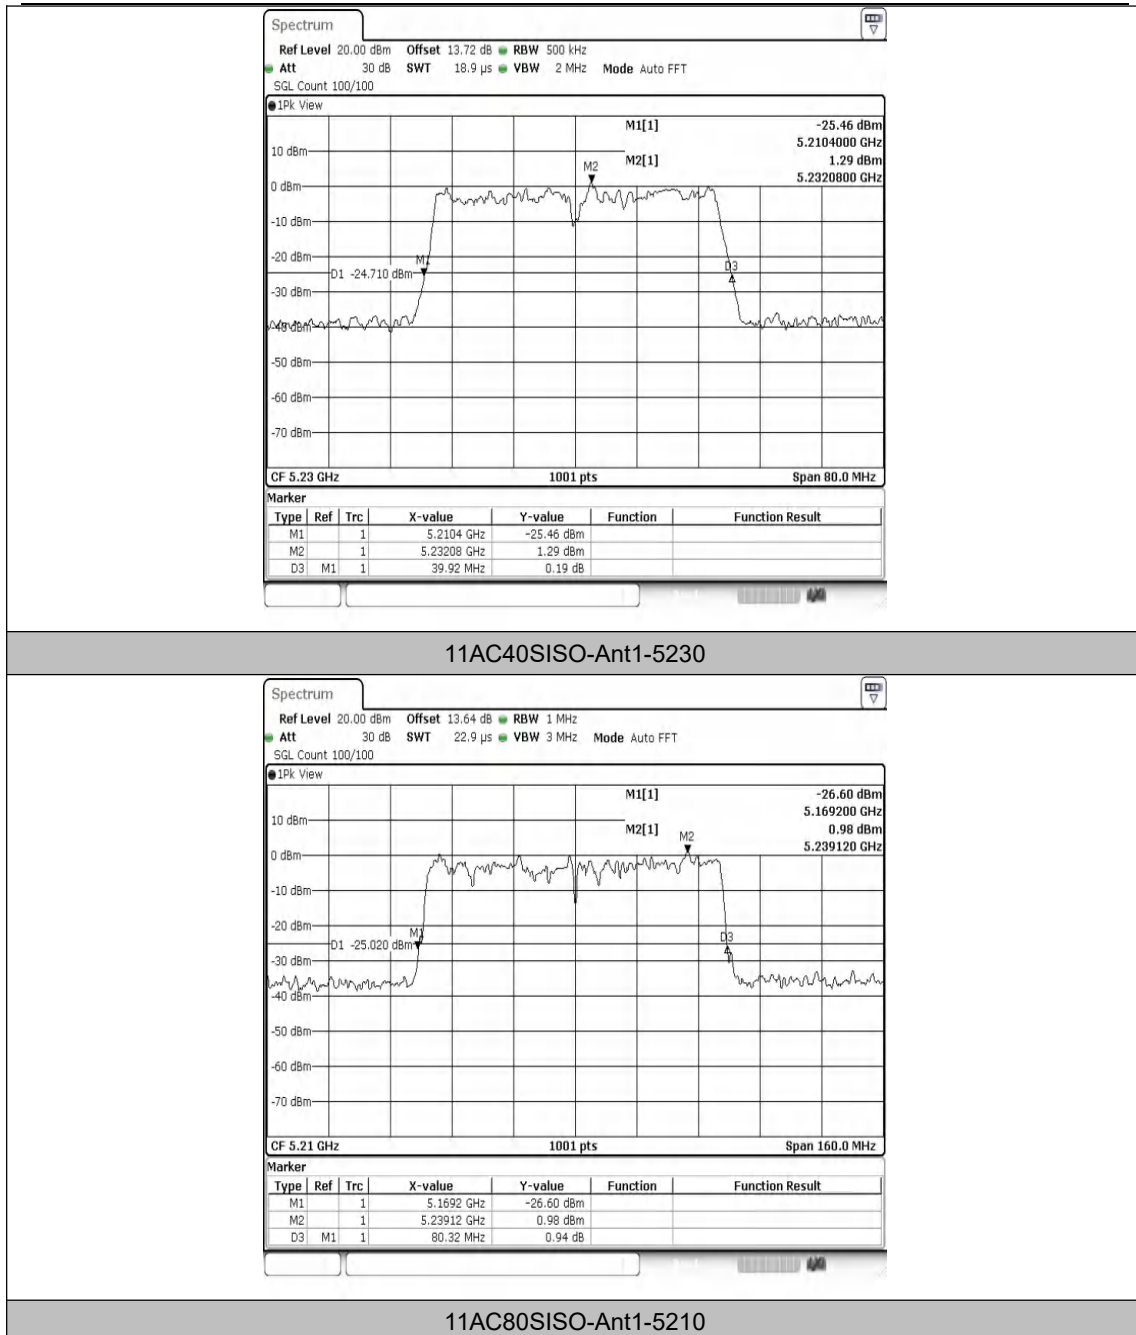


Appendix A2: 99% Occupied Bandwidth


Test Result


Test Mode	Antenna	Frequency[MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	17.822	5171.2488	5189.0709	---	---
11A	Ant1	5200	17.143	5191.2488	5208.3916	---	---
11A	Ant1	5240	17.542	5231.0490	5248.5914	---	---
11N20SISO	Ant1	5180	18.382	5170.6494	5189.0310	---	---
11N20SISO	Ant1	5200	18.741	5190.4096	5209.1508	---	---
11N20SISO	Ant1	5240	18.422	5230.6494	5249.0709	---	---
11N40SISO	Ant1	5190	37.083	5171.5385	5208.6214	---	---
11N40SISO	Ant1	5230	36.603	5211.7782	5248.3816	---	---
11AC20SISO	Ant1	5180	18.422	5170.6094	5189.0310	---	---
11AC20SISO	Ant1	5200	18.422	5190.7692	5209.1908	---	---
11AC20SISO	Ant1	5240	18.382	5230.7293	5249.1109	---	---
11AC40SISO	Ant1	5190	37.323	5171.2188	5208.5415	---	---
11AC40SISO	Ant1	5230	36.523	5211.6983	5248.2218	---	---
11AC80SISO	Ant1	5210	76.084	5171.9580	5248.0420	---	---





Test Graphs

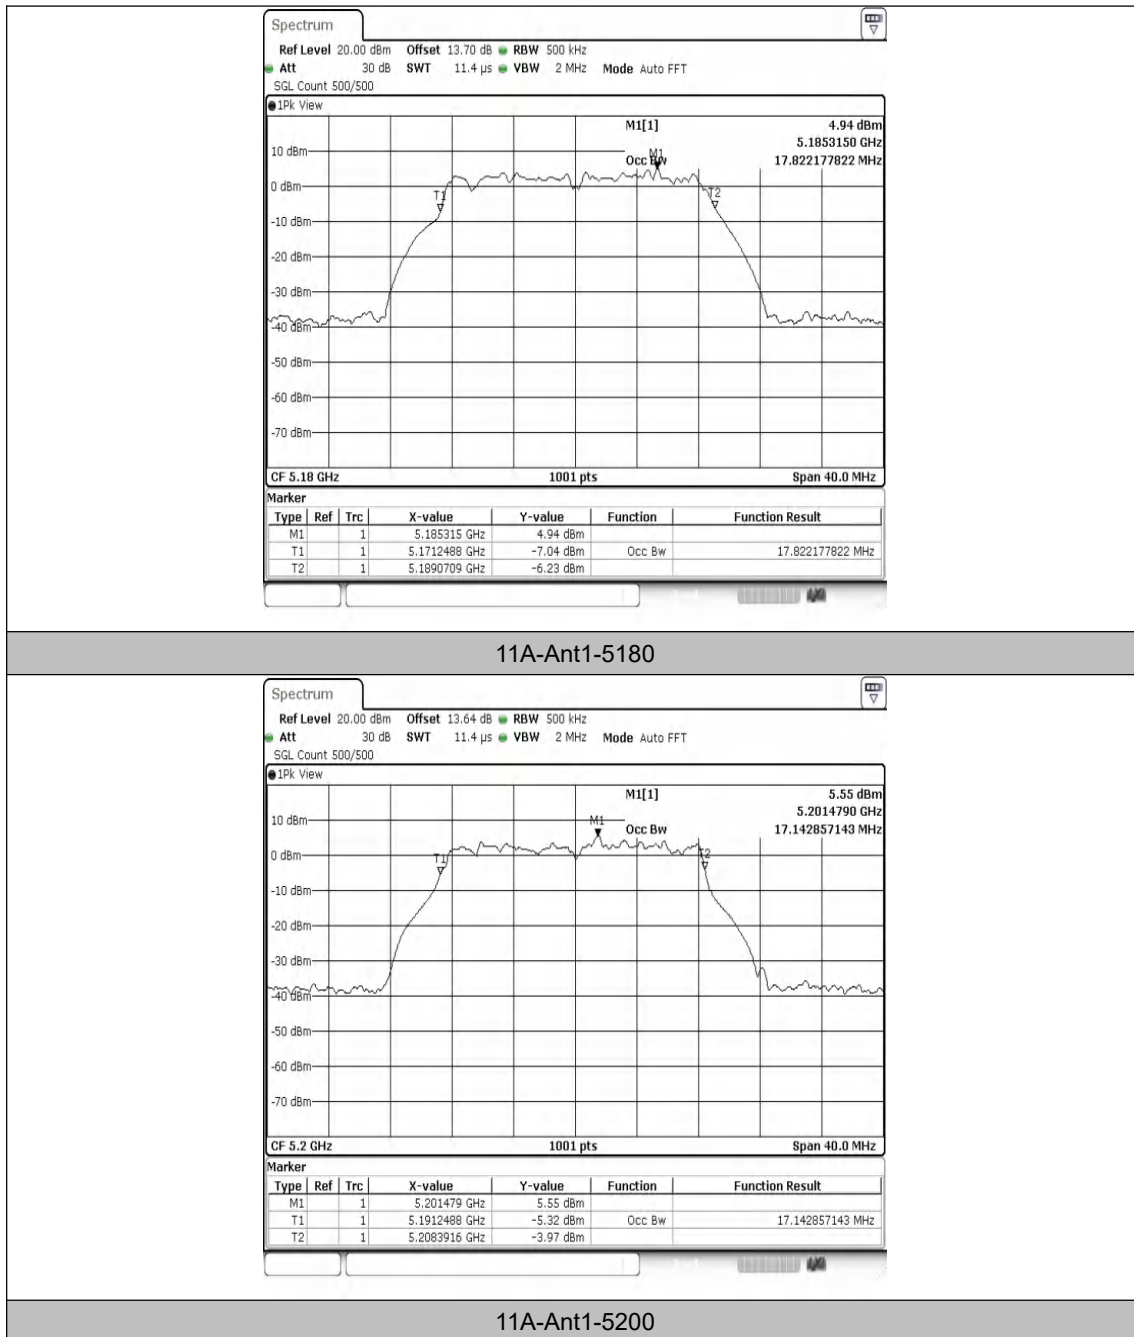


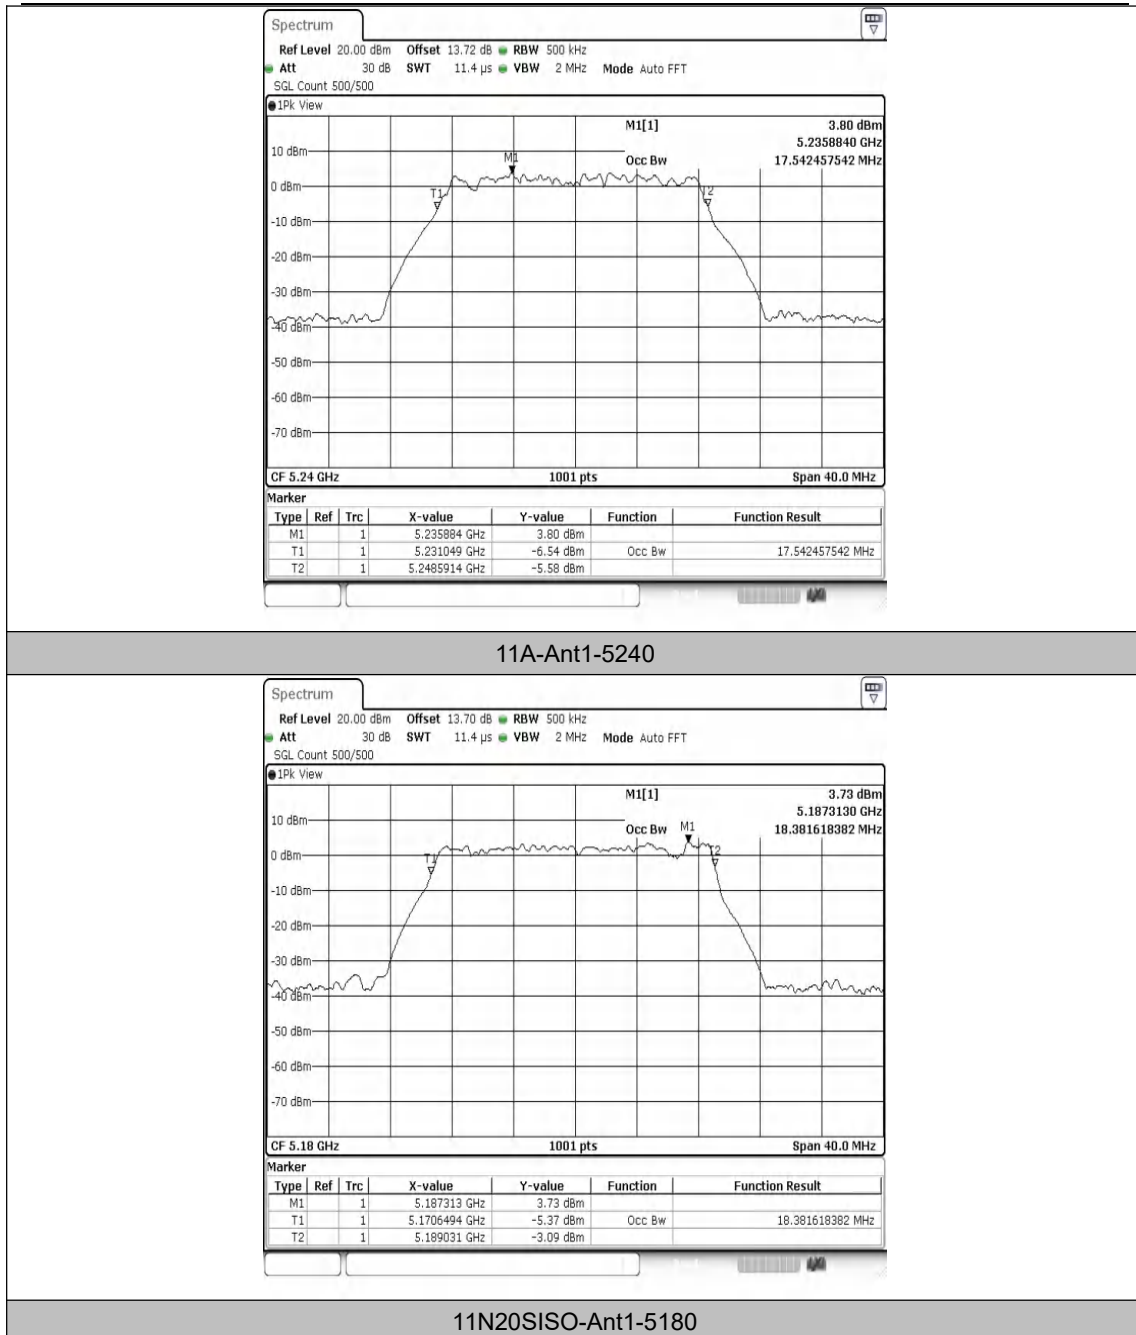


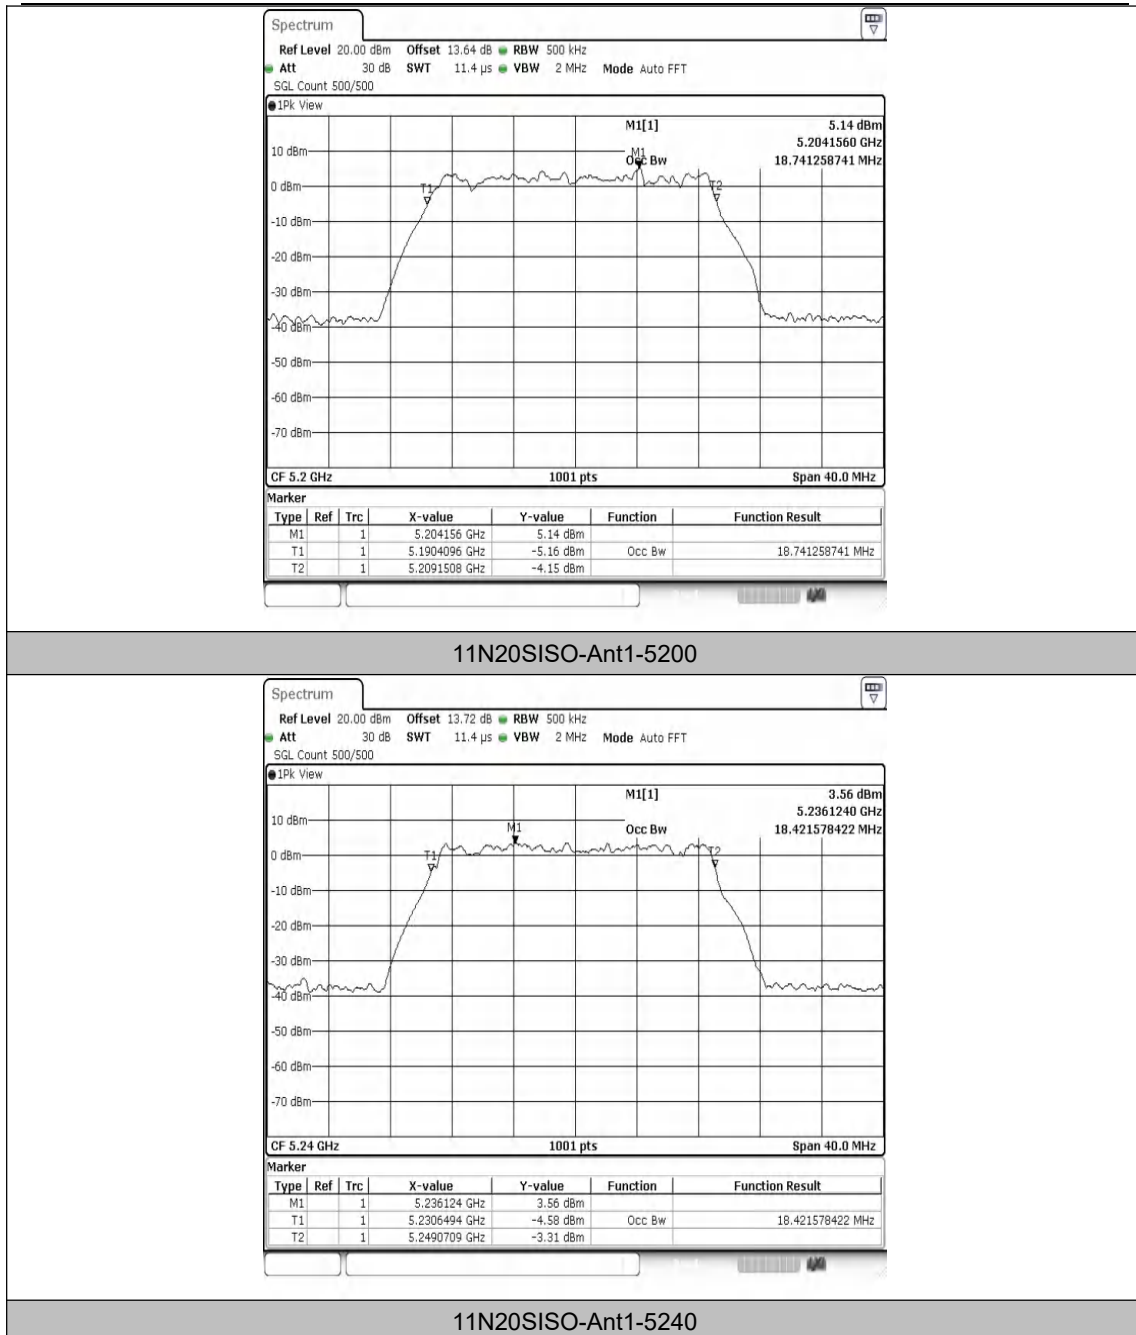

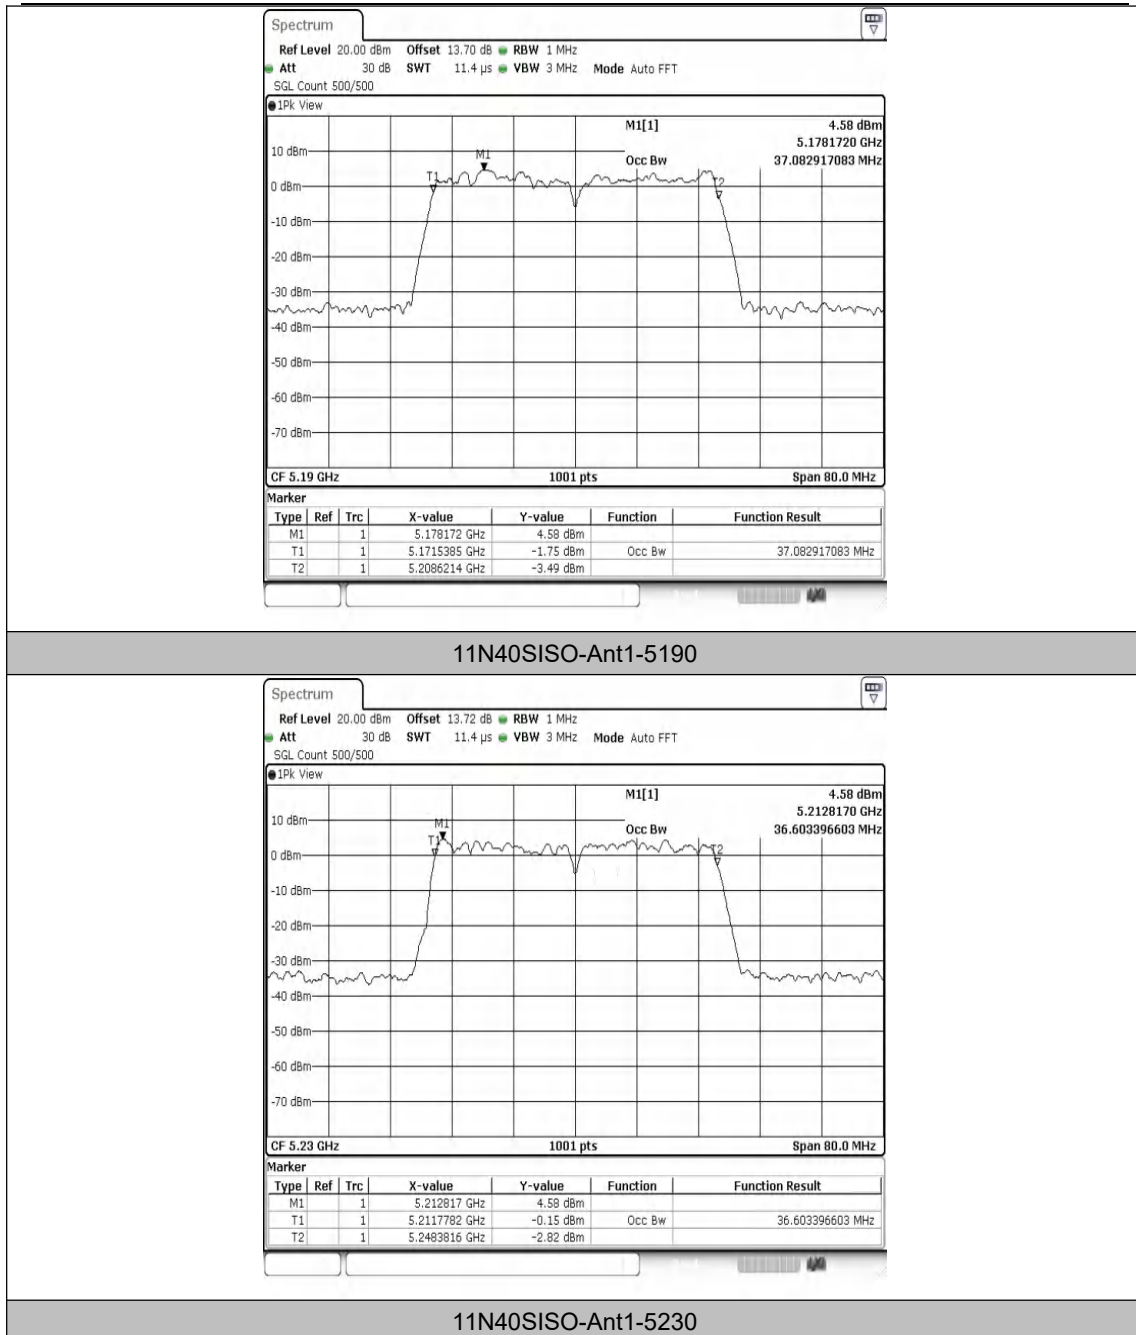

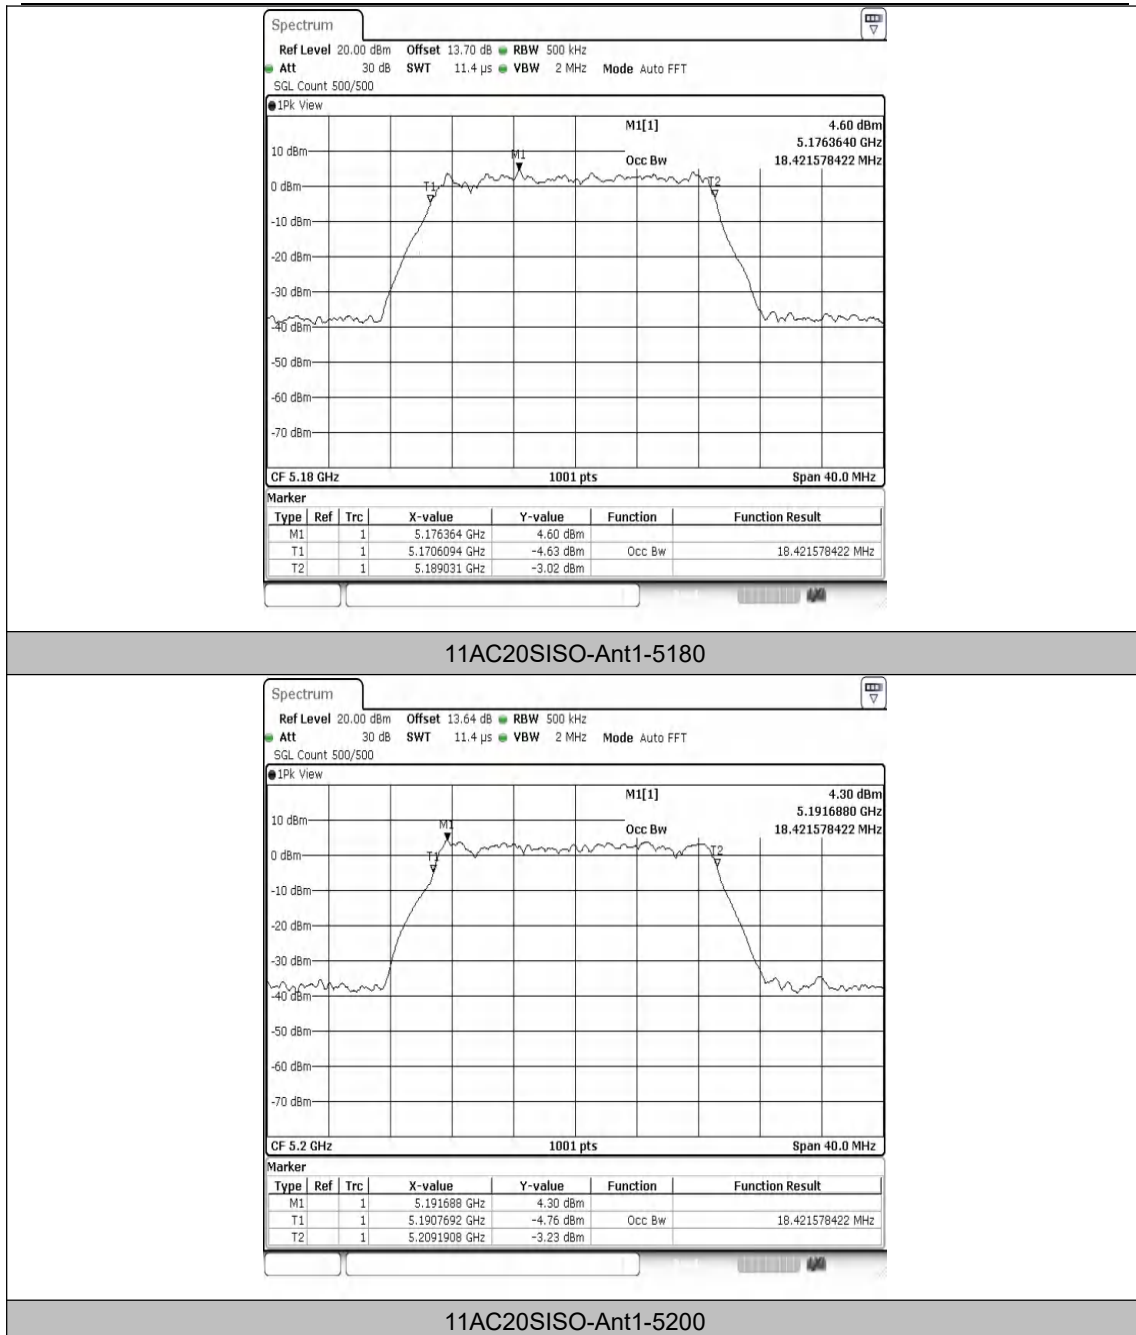

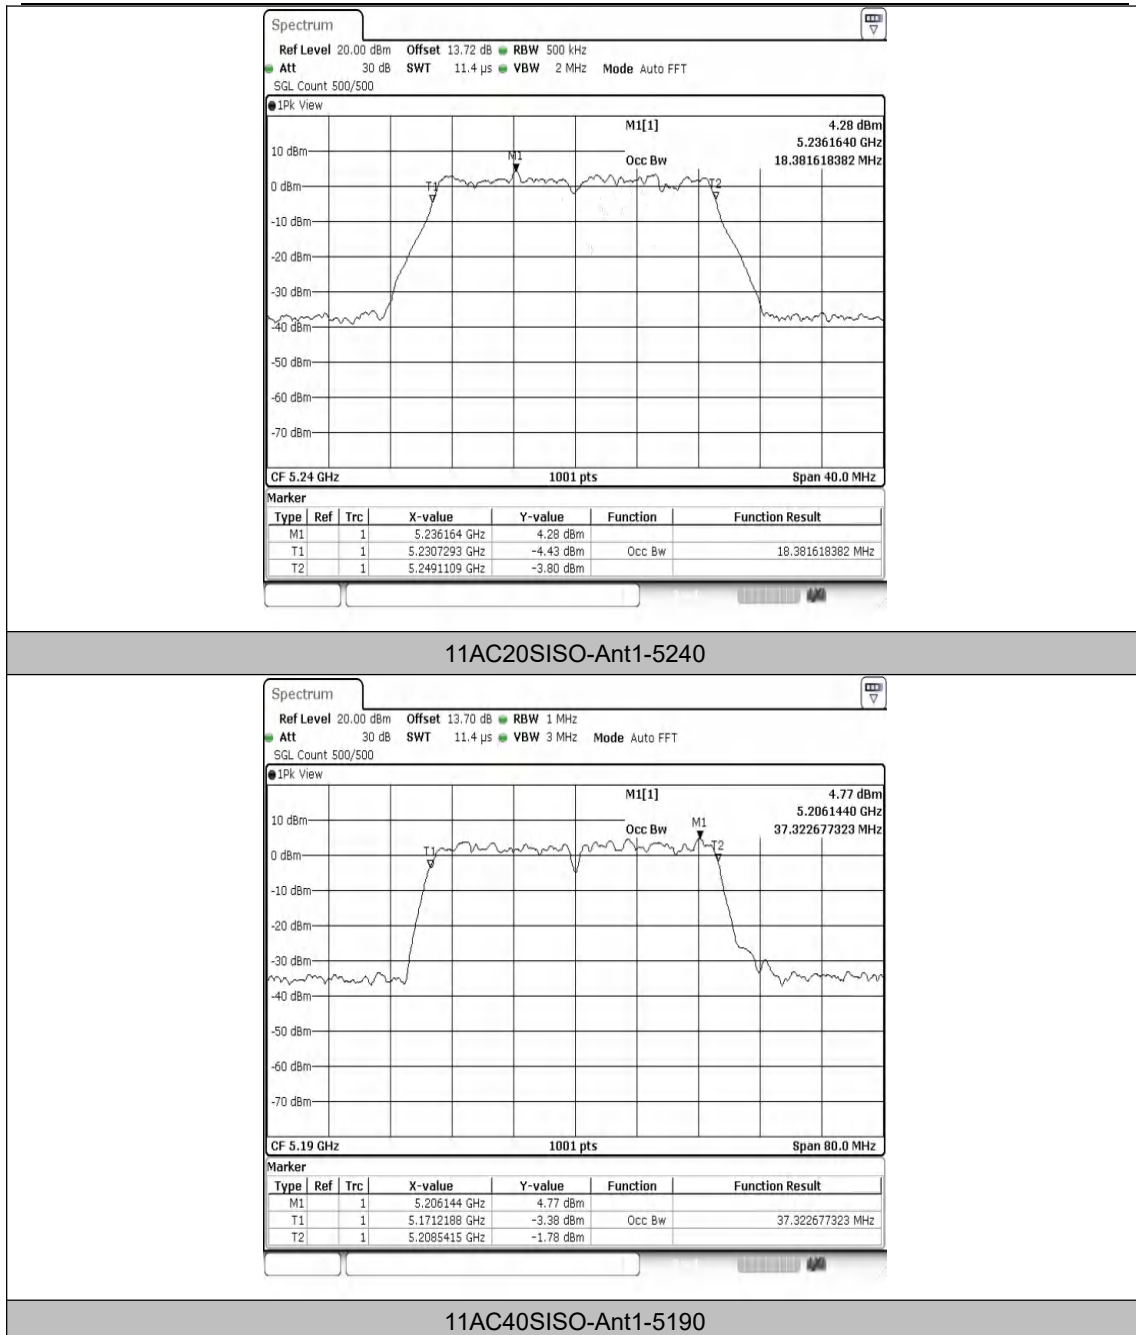

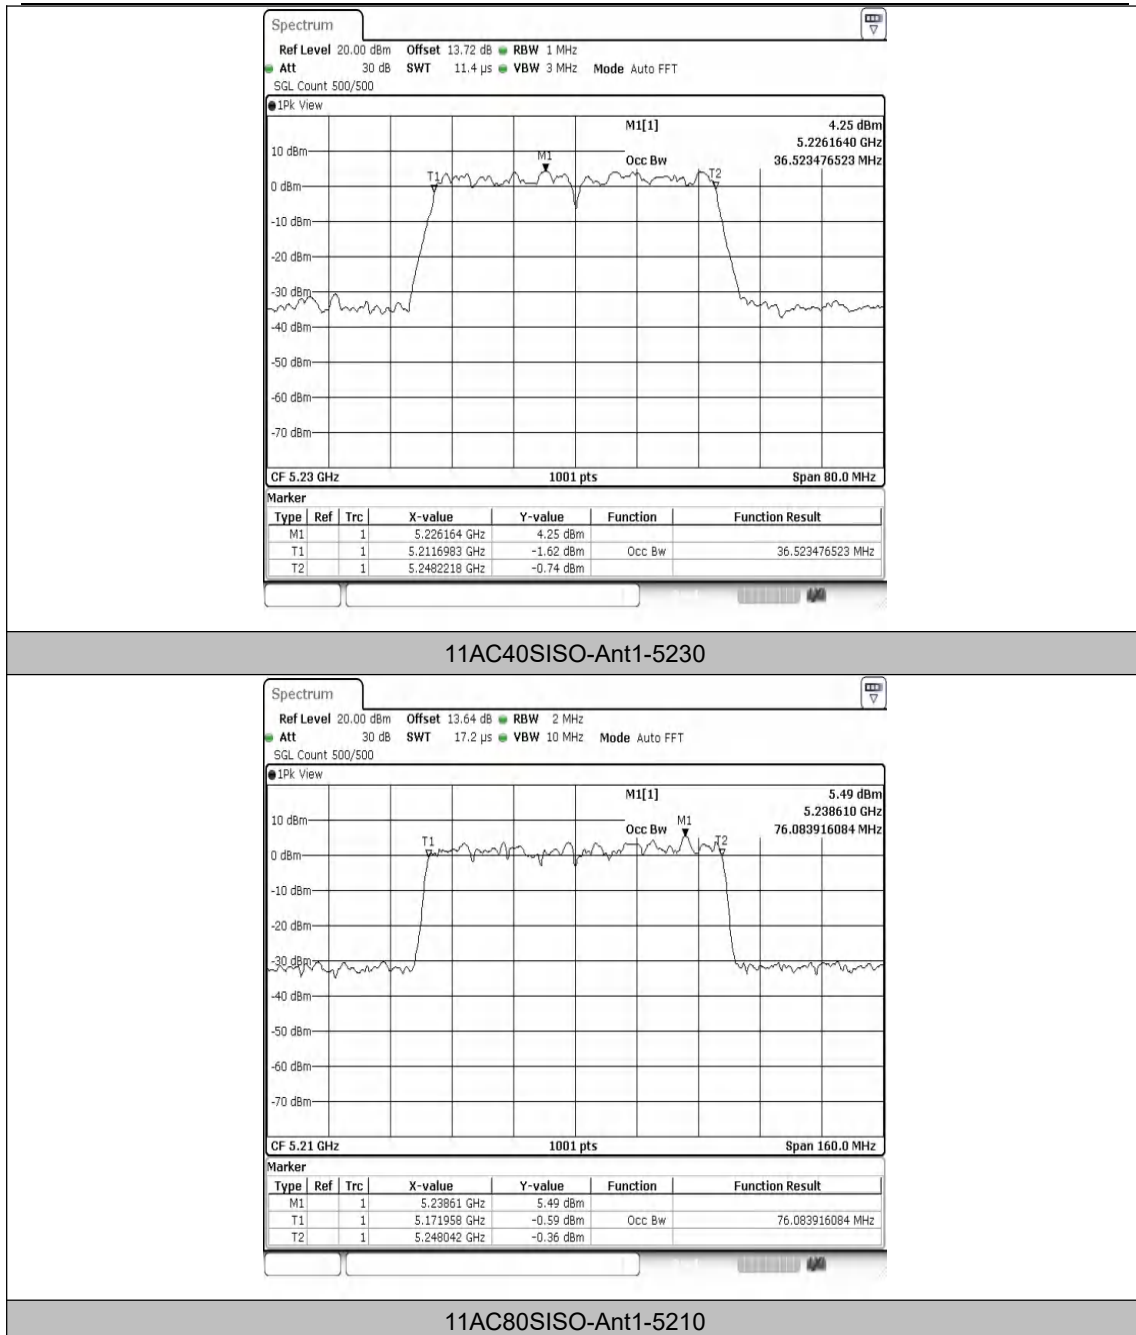


Appendix B: Duty Cycle


Test Result


Test Mode	Antenna	Frequency[MHz]	Transmission Duration [ms]	Transmission Period [ms]	Duty Cycle [%]	Dc Factor [dB]	1/T
11A	Ant1	5180	5.40	45.40	11.89	9.25	0.19
11A	Ant1	5200	5.50	45.40	12.11	9.17	0.18
11A	Ant1	5240	5.50	45.40	12.11	9.17	0.18
11N20SISO	Ant1	5180	5.40	47.40	11.39	9.43	0.19
11N20SISO	Ant1	5200	5.30	47.40	11.18	9.52	0.19
11N20SISO	Ant1	5240	5.30	47.40	11.18	9.52	0.19
11N40SISO	Ant1	5190	5.20	47.40	10.97	9.60	0.19
11N40SISO	Ant1	5230	5.20	47.40	10.97	9.60	0.19
11AC20SISO	Ant1	5180	5.30	47.40	11.18	9.52	0.19
11AC20SISO	Ant1	5200	5.40	47.60	11.34	9.45	0.19
11AC20SISO	Ant1	5240	5.40	47.40	11.39	9.43	0.19
11AC40SISO	Ant1	5190	5.10	47.40	10.76	9.68	0.20
11AC40SISO	Ant1	5230	5.20	47.40	10.97	9.60	0.19
11AC80SISO	Ant1	5210	4.70	47.40	9.92	10.03	0.21





Test Graphs

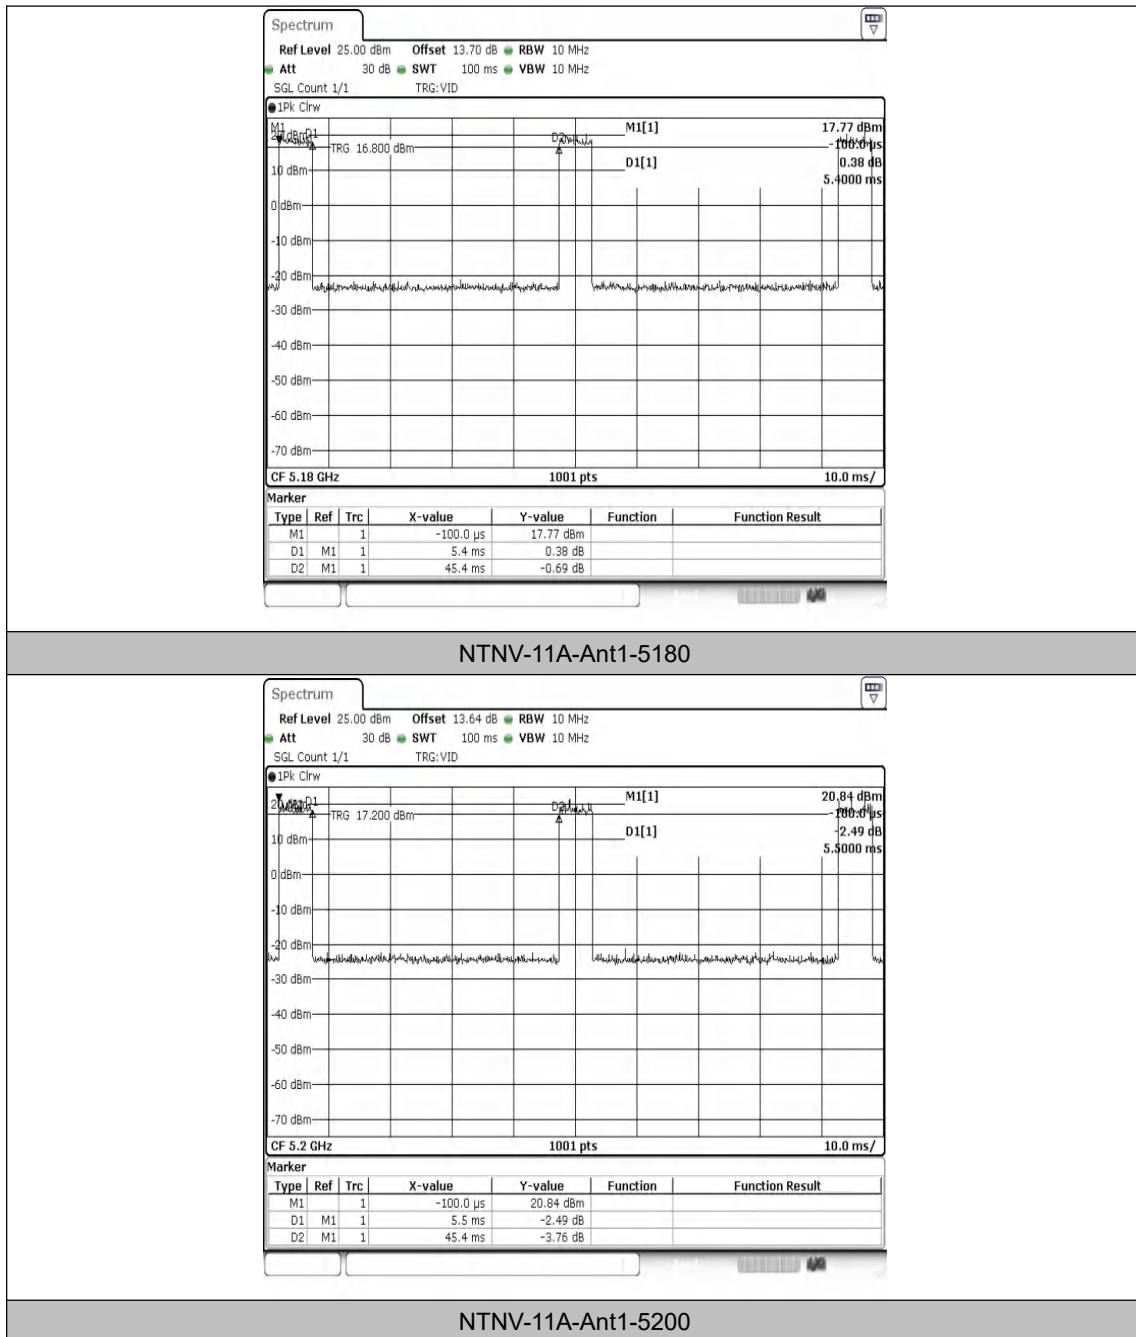


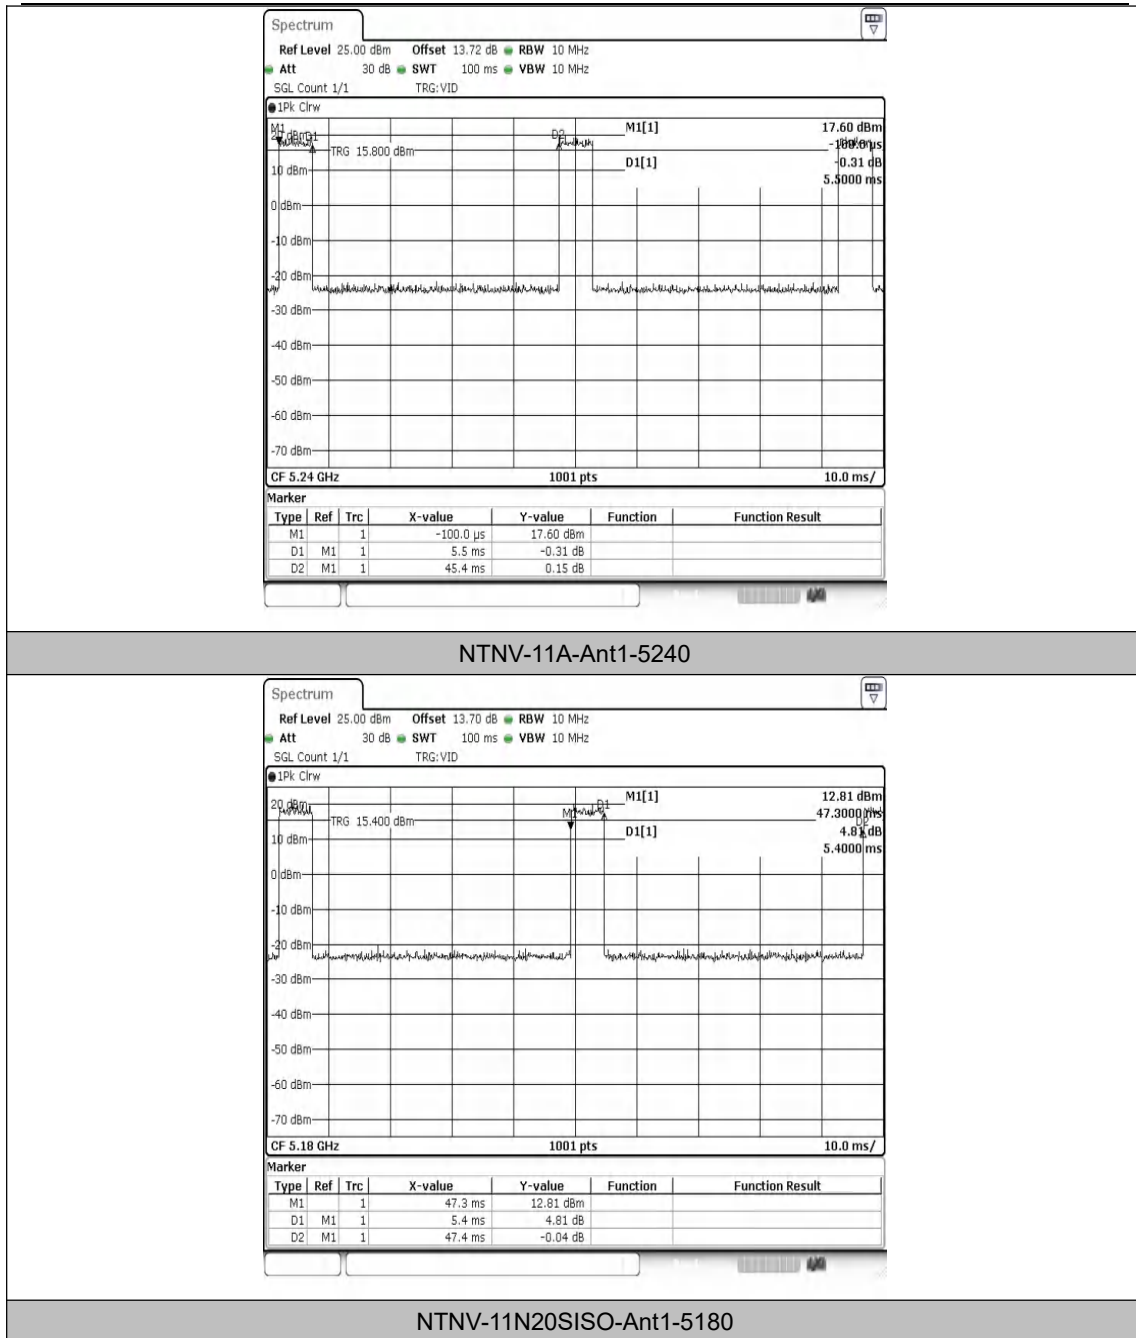


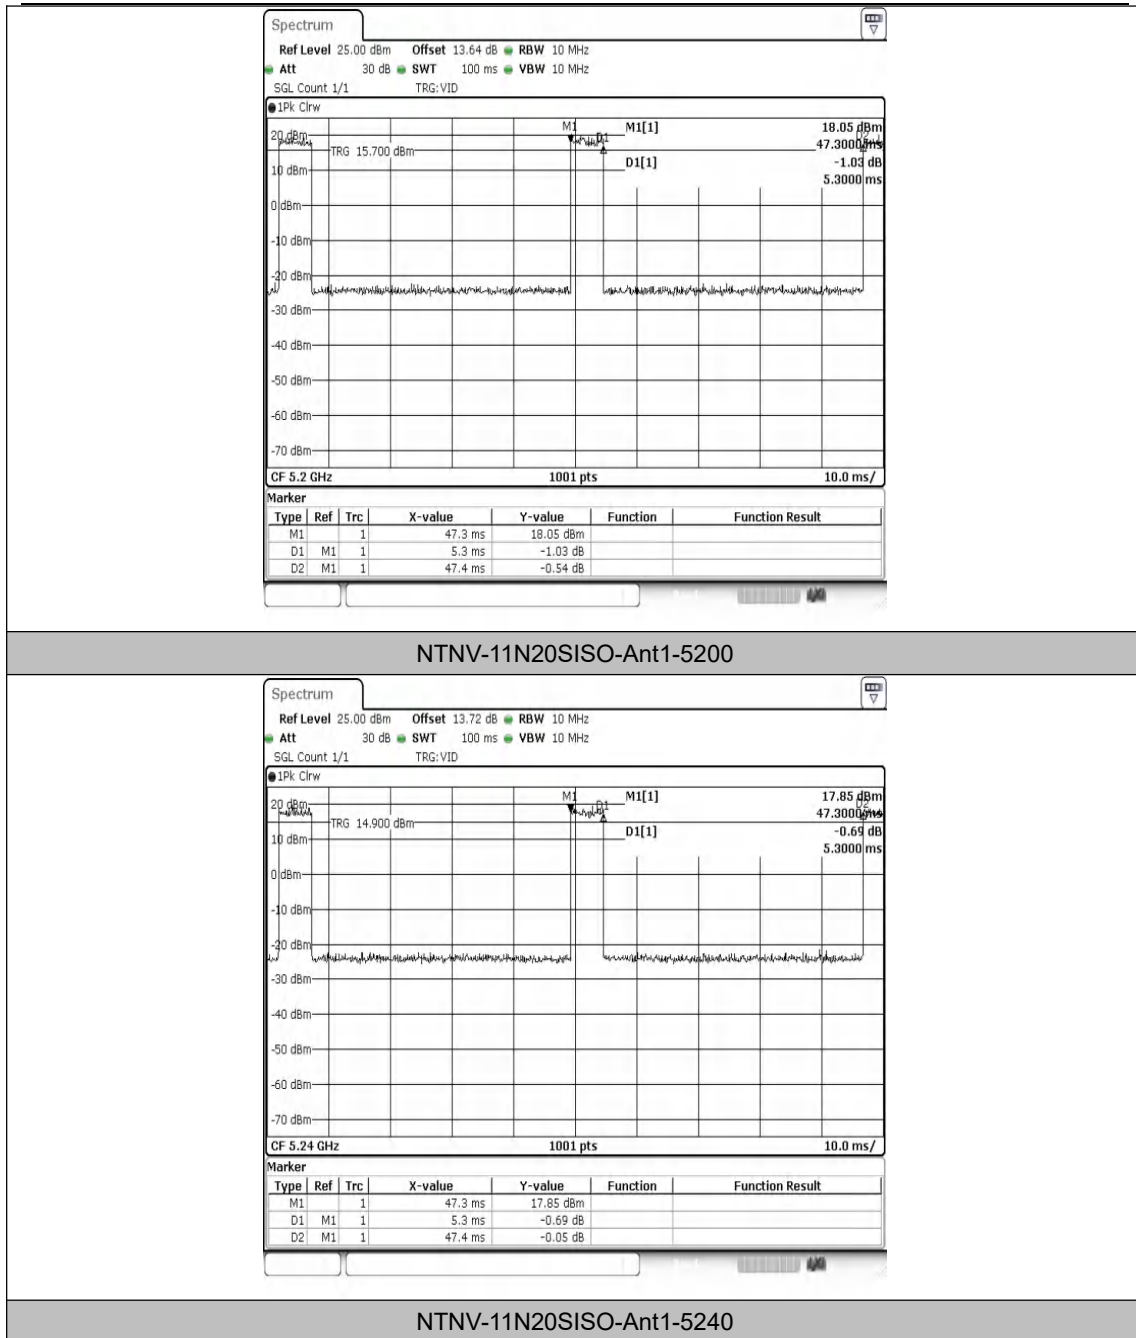

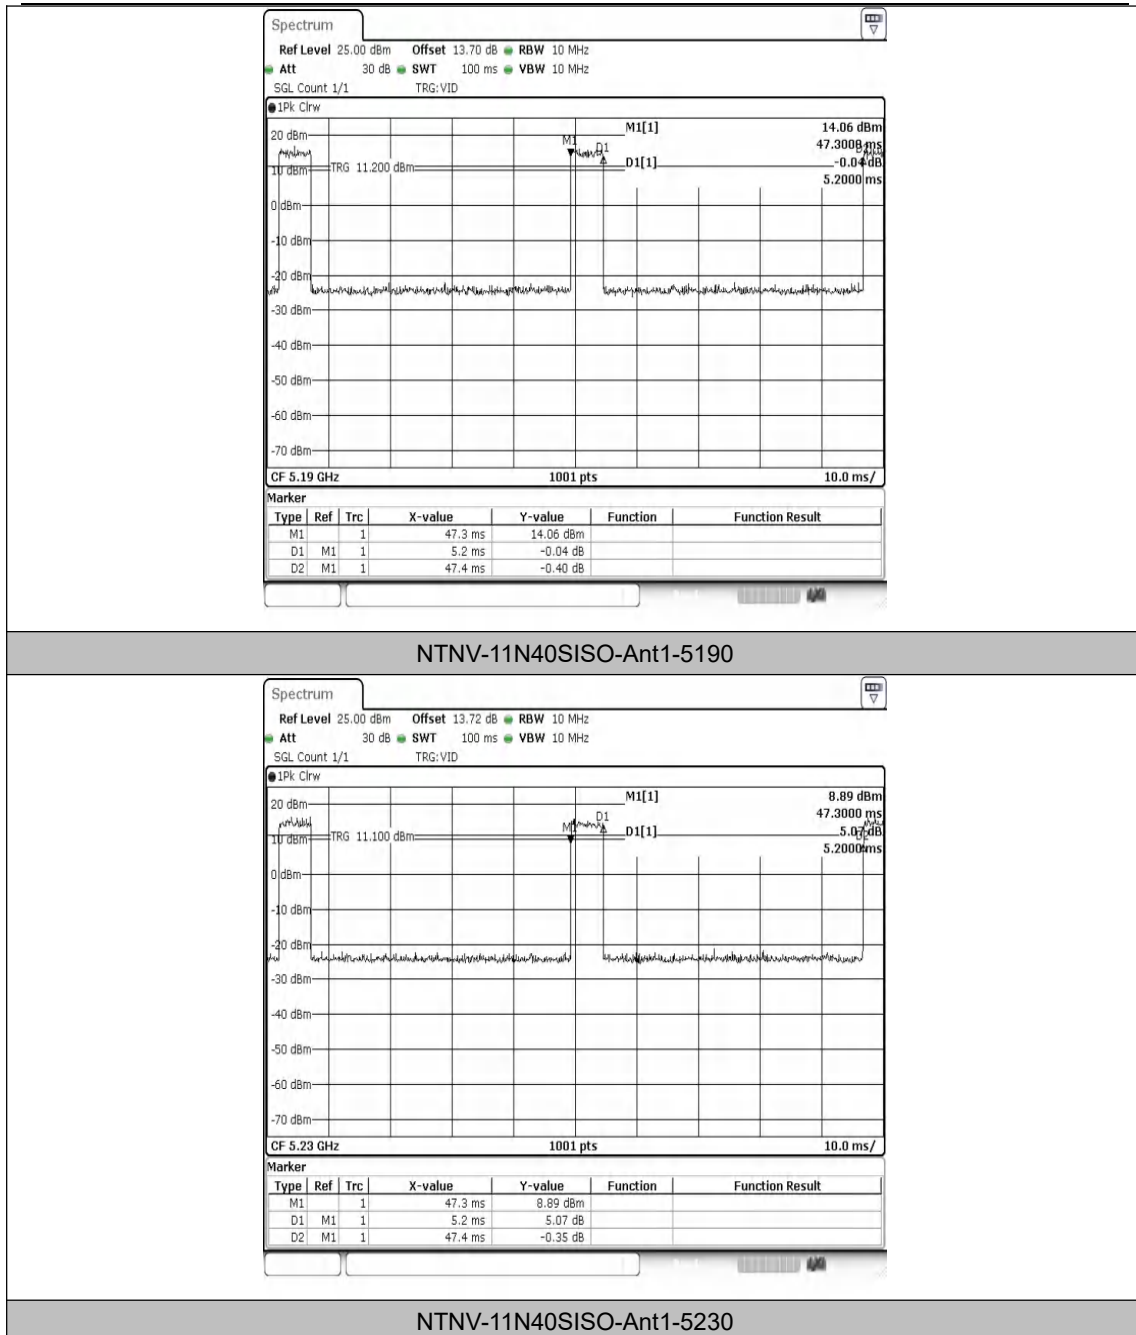

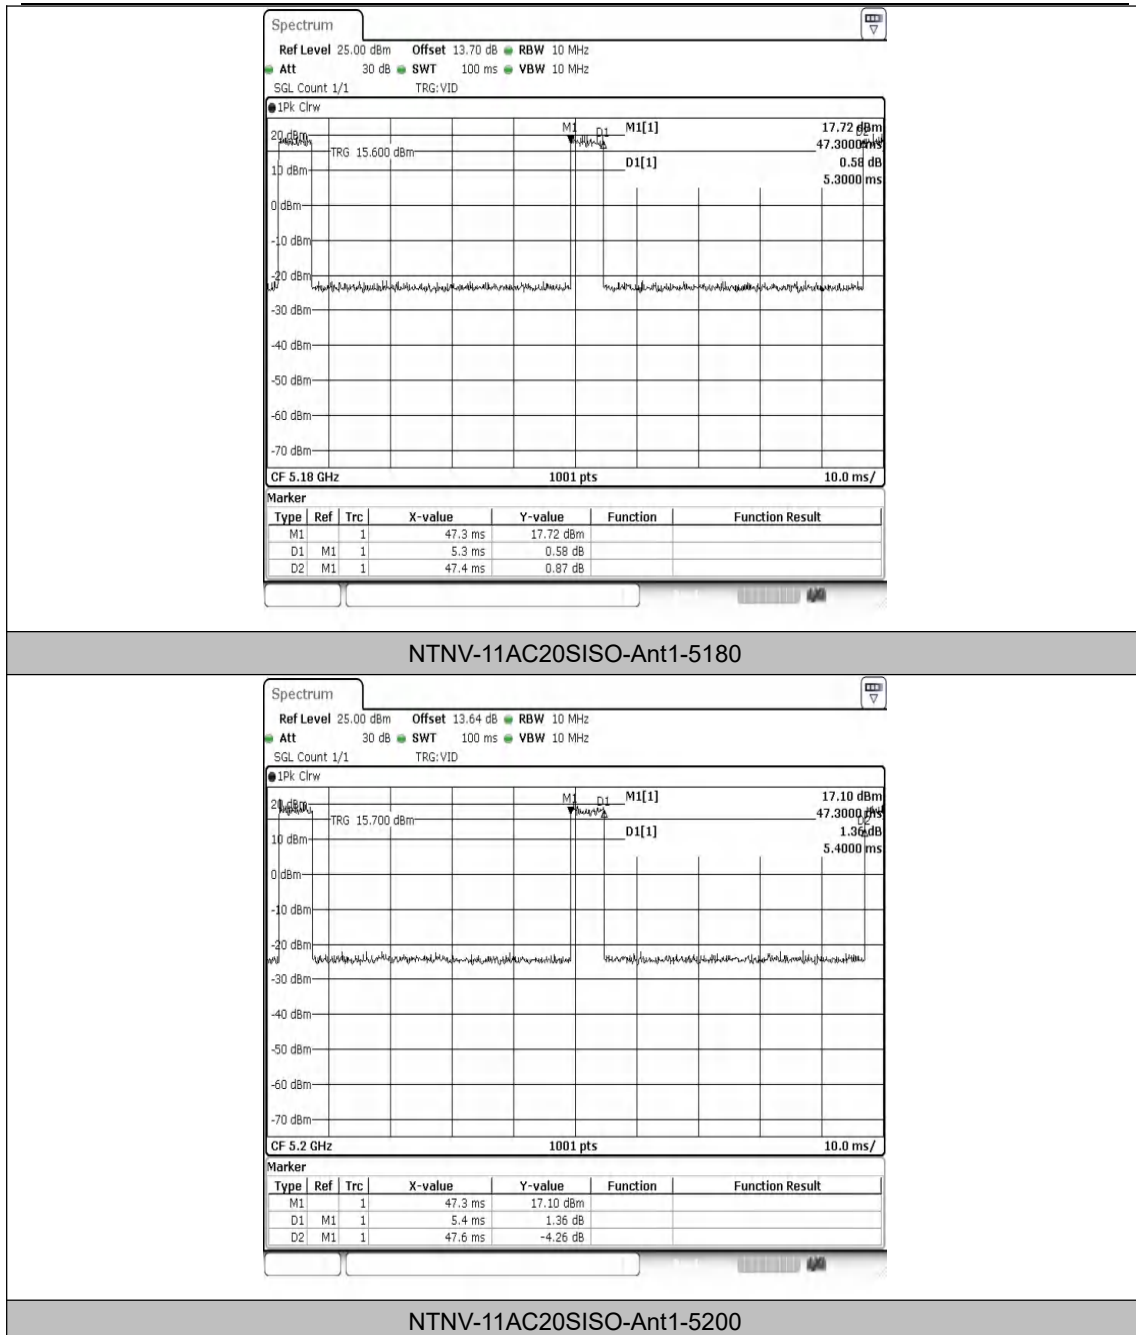

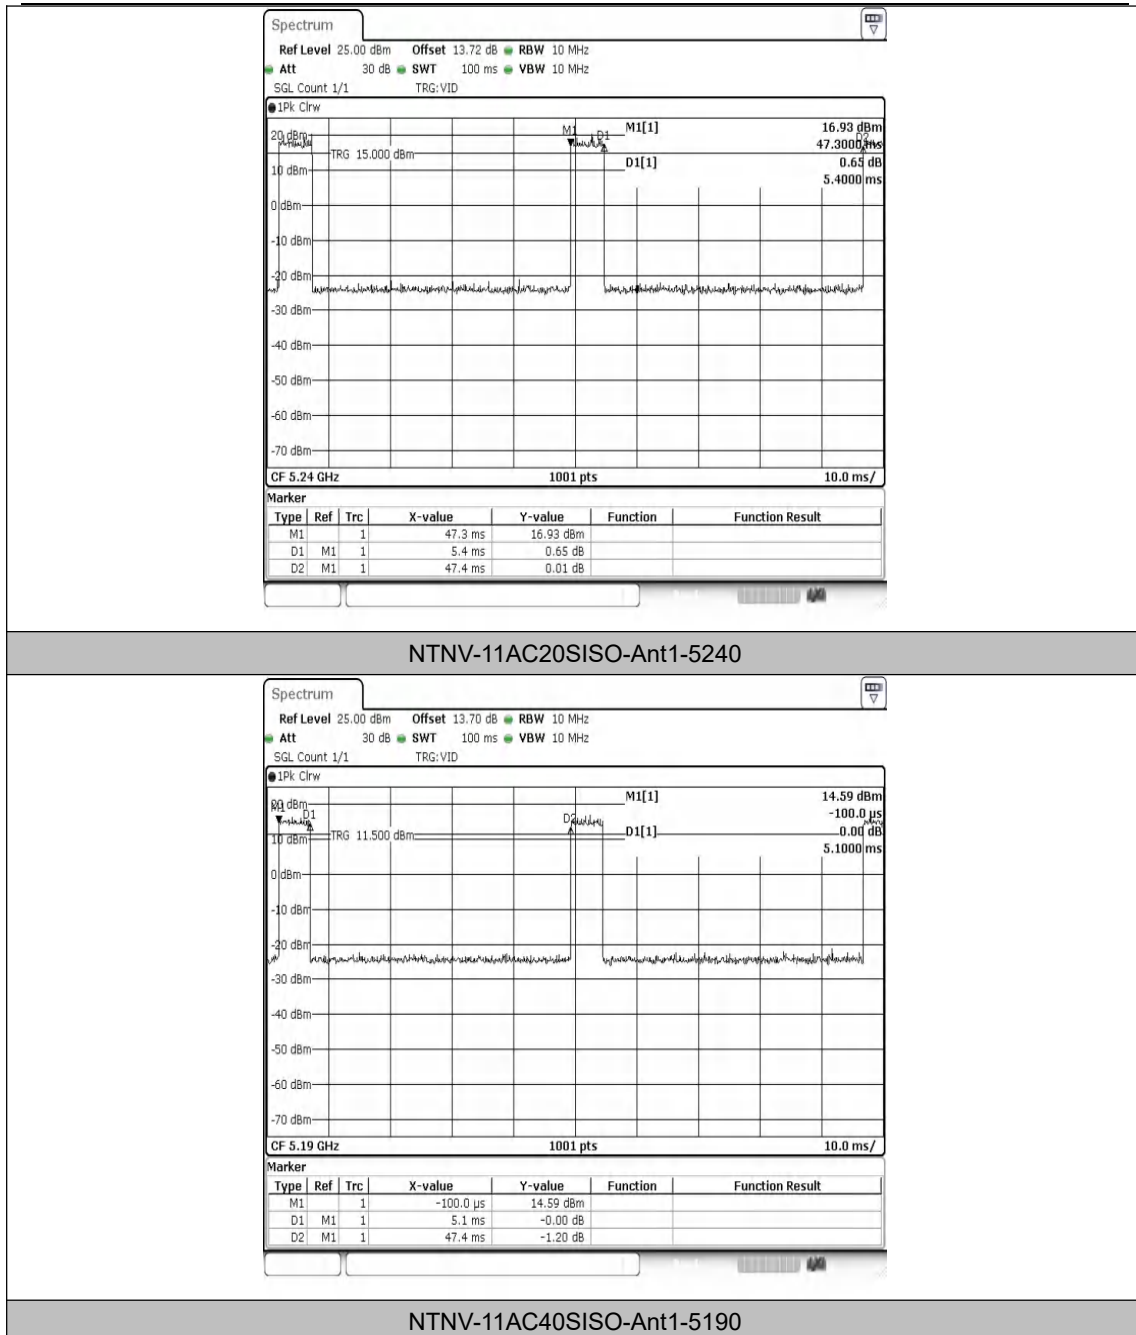

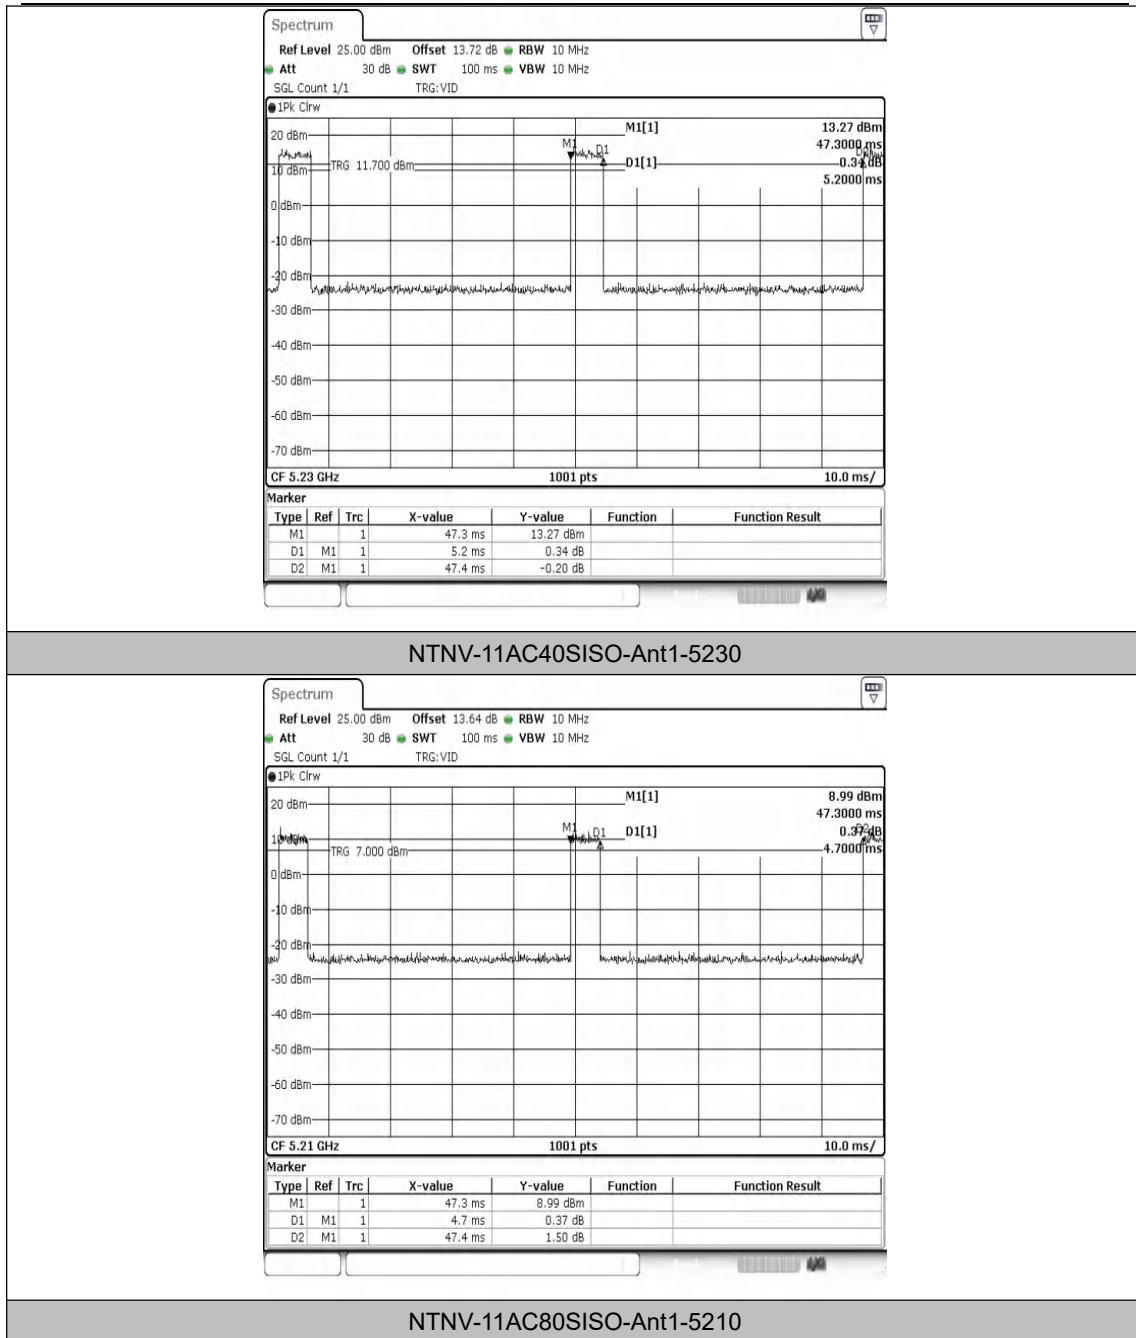


Appendix C: Maximum Conducted Output Power


Test Result Channel Power

Test Mode	Antenna	Frequency[MHz]	Channel Power [dBm]	Duty Cycle [%]	DC Factor [dB]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	5180	3.46	11.89	9.25	12.71	≤23.98	PASS
11A	Ant1	5200	3.19	12.11	9.17	12.36	≤23.98	PASS
11A	Ant1	5240	2.73	12.11	9.17	11.90	≤23.98	PASS
11N20SISO	Ant1	5180	3.07	11.39	9.43	12.50	≤23.98	PASS
11N20SISO	Ant1	5200	2.96	11.18	9.52	12.48	≤23.98	PASS
11N20SISO	Ant1	5240	2.93	11.18	9.52	12.45	≤23.98	PASS
11N40SISO	Ant1	5190	4.29	10.97	9.60	13.89	≤23.98	PASS
11N40SISO	Ant1	5230	4.23	10.97	9.60	13.83	≤23.98	PASS
11AC20SISO	Ant1	5180	1.56	11.18	9.52	11.08	≤23.98	PASS
11AC20SISO	Ant1	5200	3.00	11.34	9.45	12.45	≤23.98	PASS
11AC20SISO	Ant1	5240	0.58	11.39	9.43	10.01	≤23.98	PASS
11AC40SISO	Ant1	5190	2.82	10.76	9.68	12.50	≤23.98	PASS
11AC40SISO	Ant1	5230	3.05	10.97	9.60	12.65	≤23.98	PASS
11AC80SISO	Ant1	5210	1.39	9.92	10.03	11.42	≤23.98	PASS

Note: 1.The cable loss are compensated in the graph.

Test Graphs Channel Power

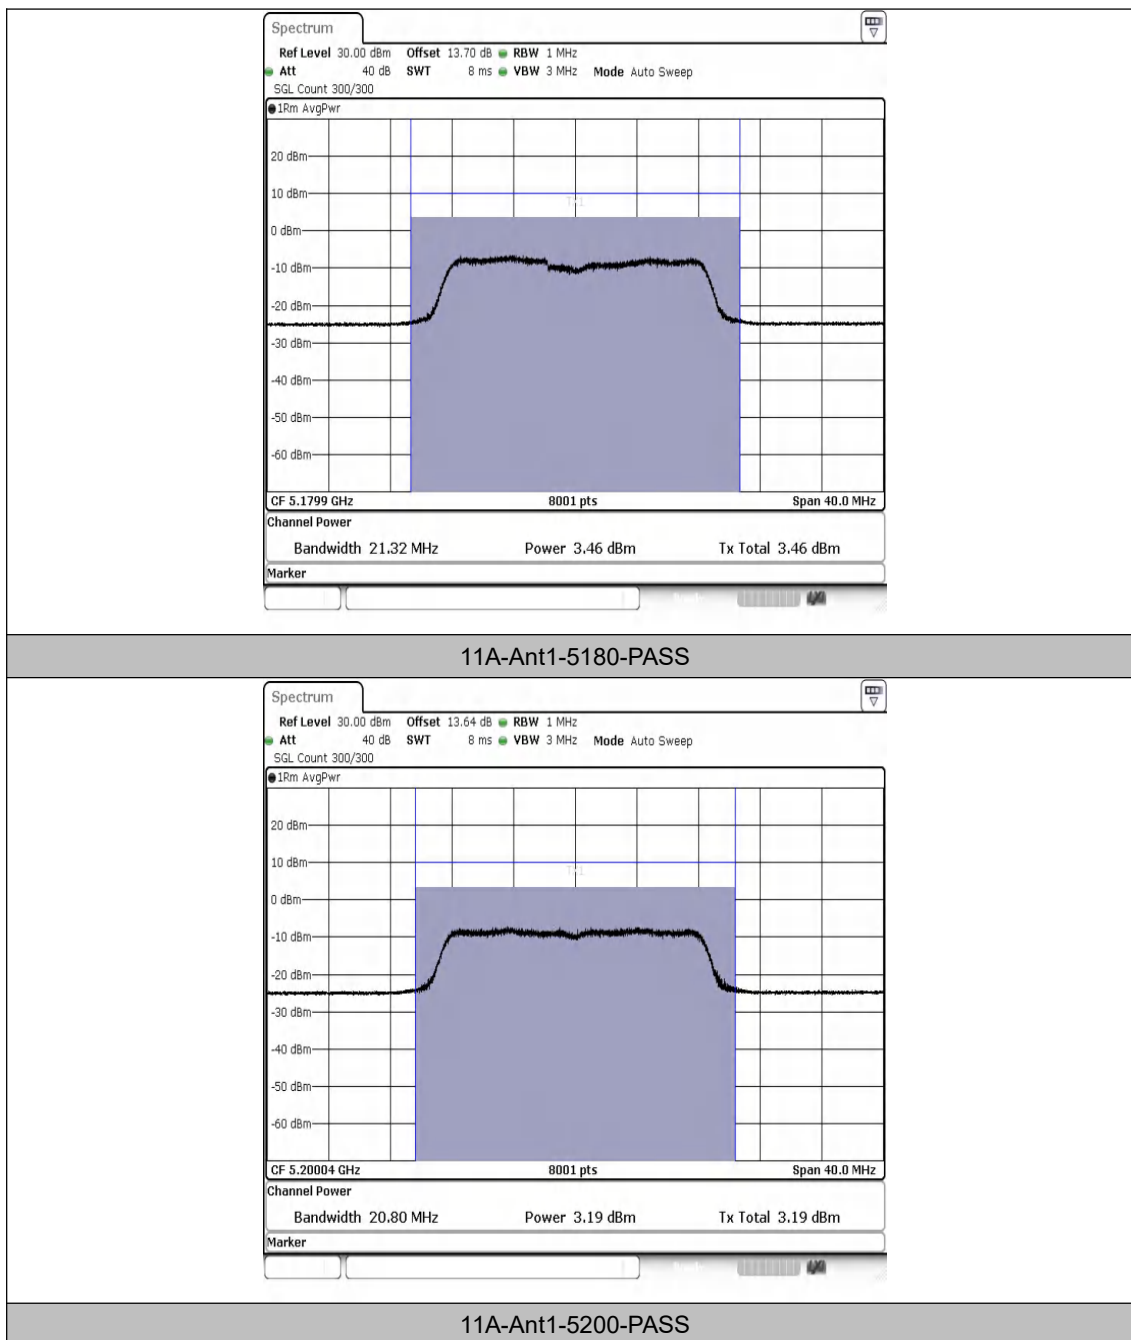


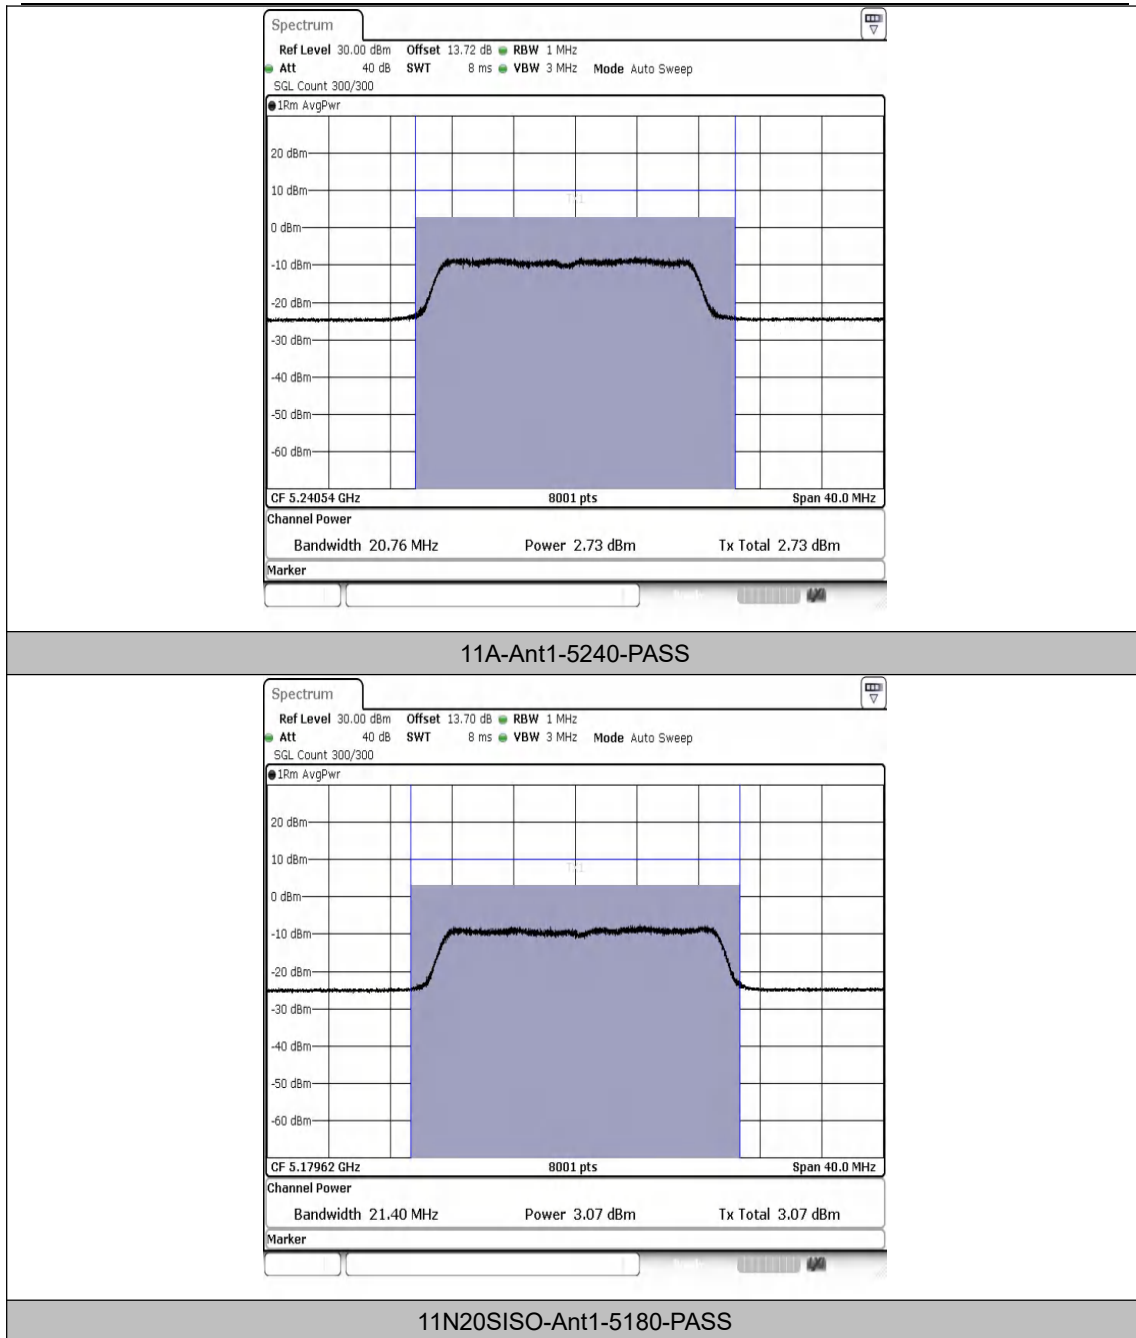

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

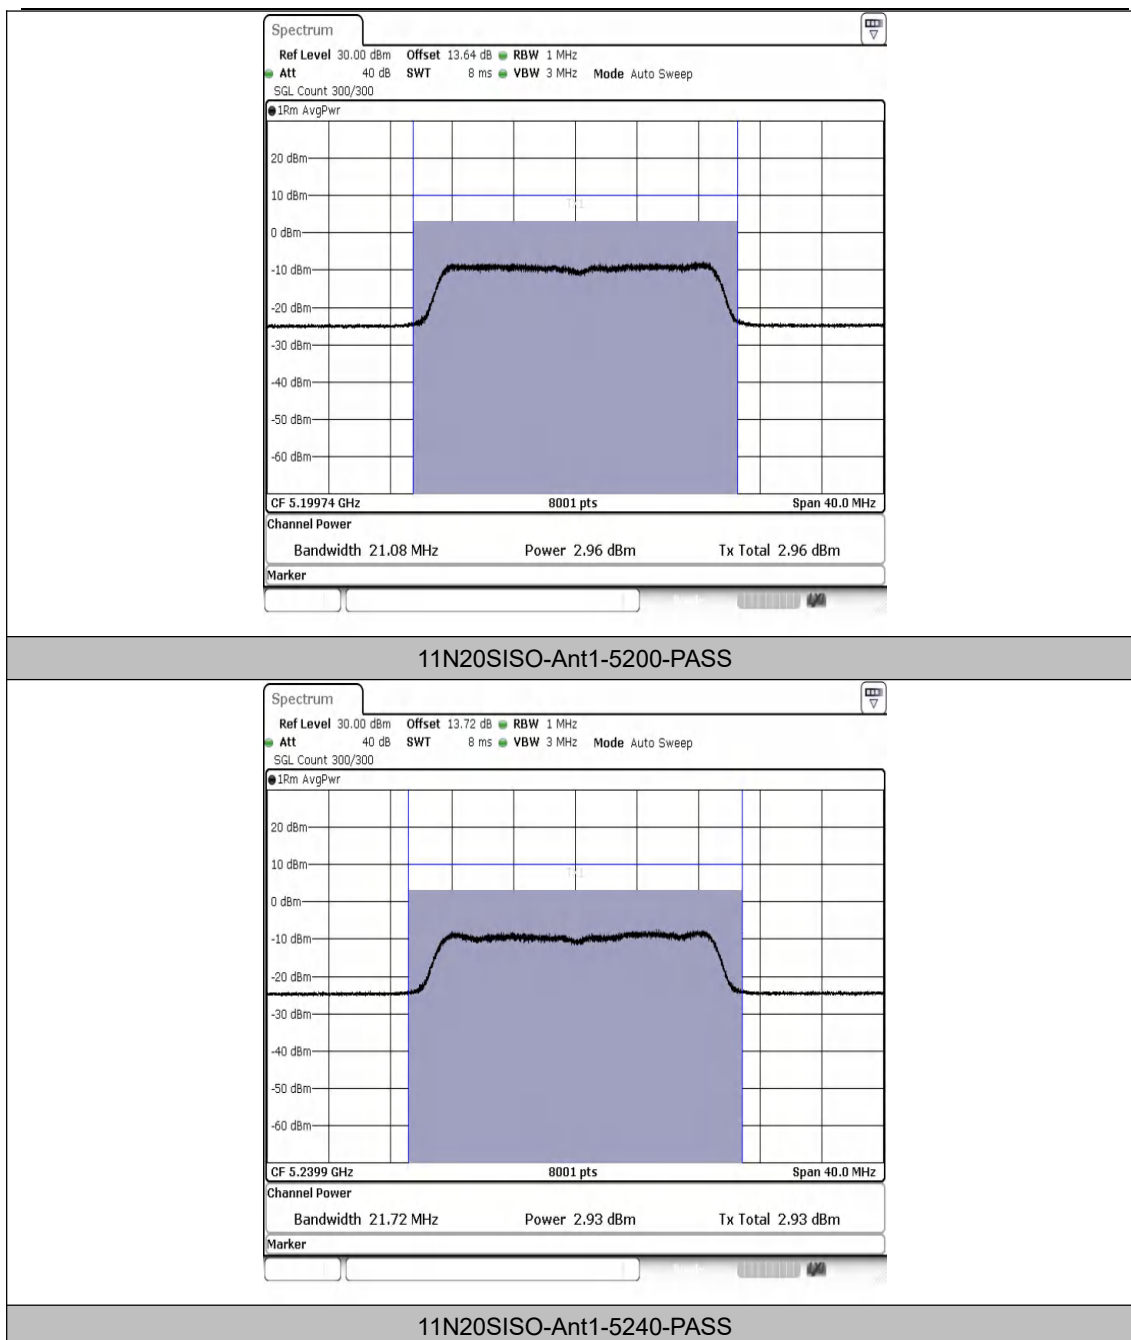


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
 Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
 Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
 400-003-0500
www.anbotek.com

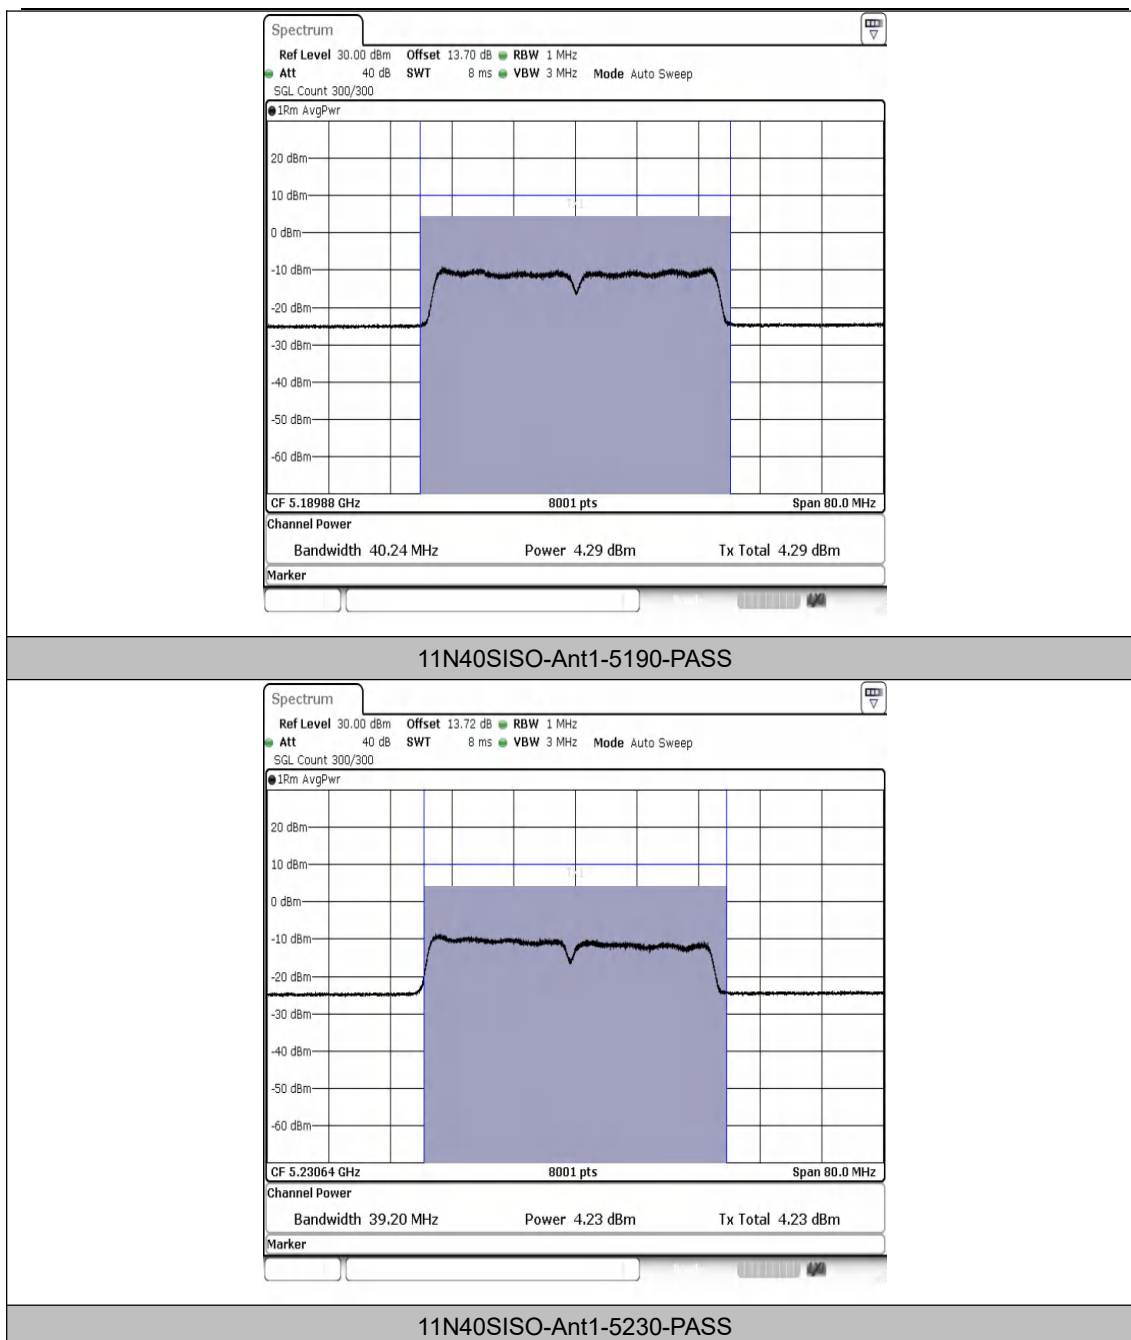


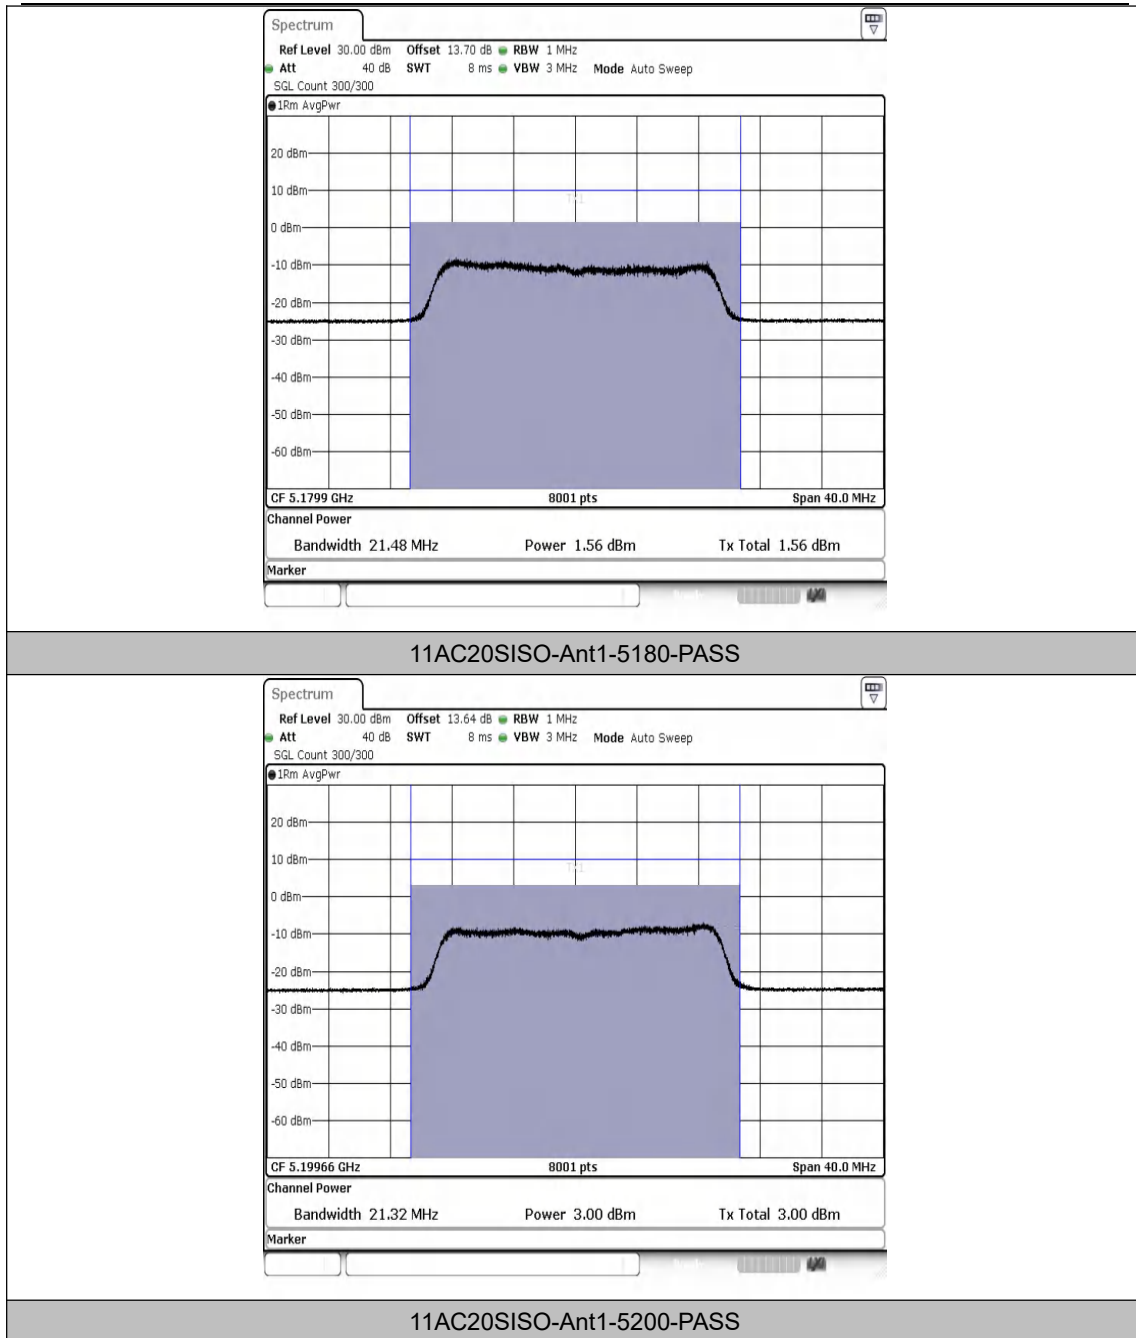

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
 Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
 Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline
 400-003-0500
www.anbotek.com

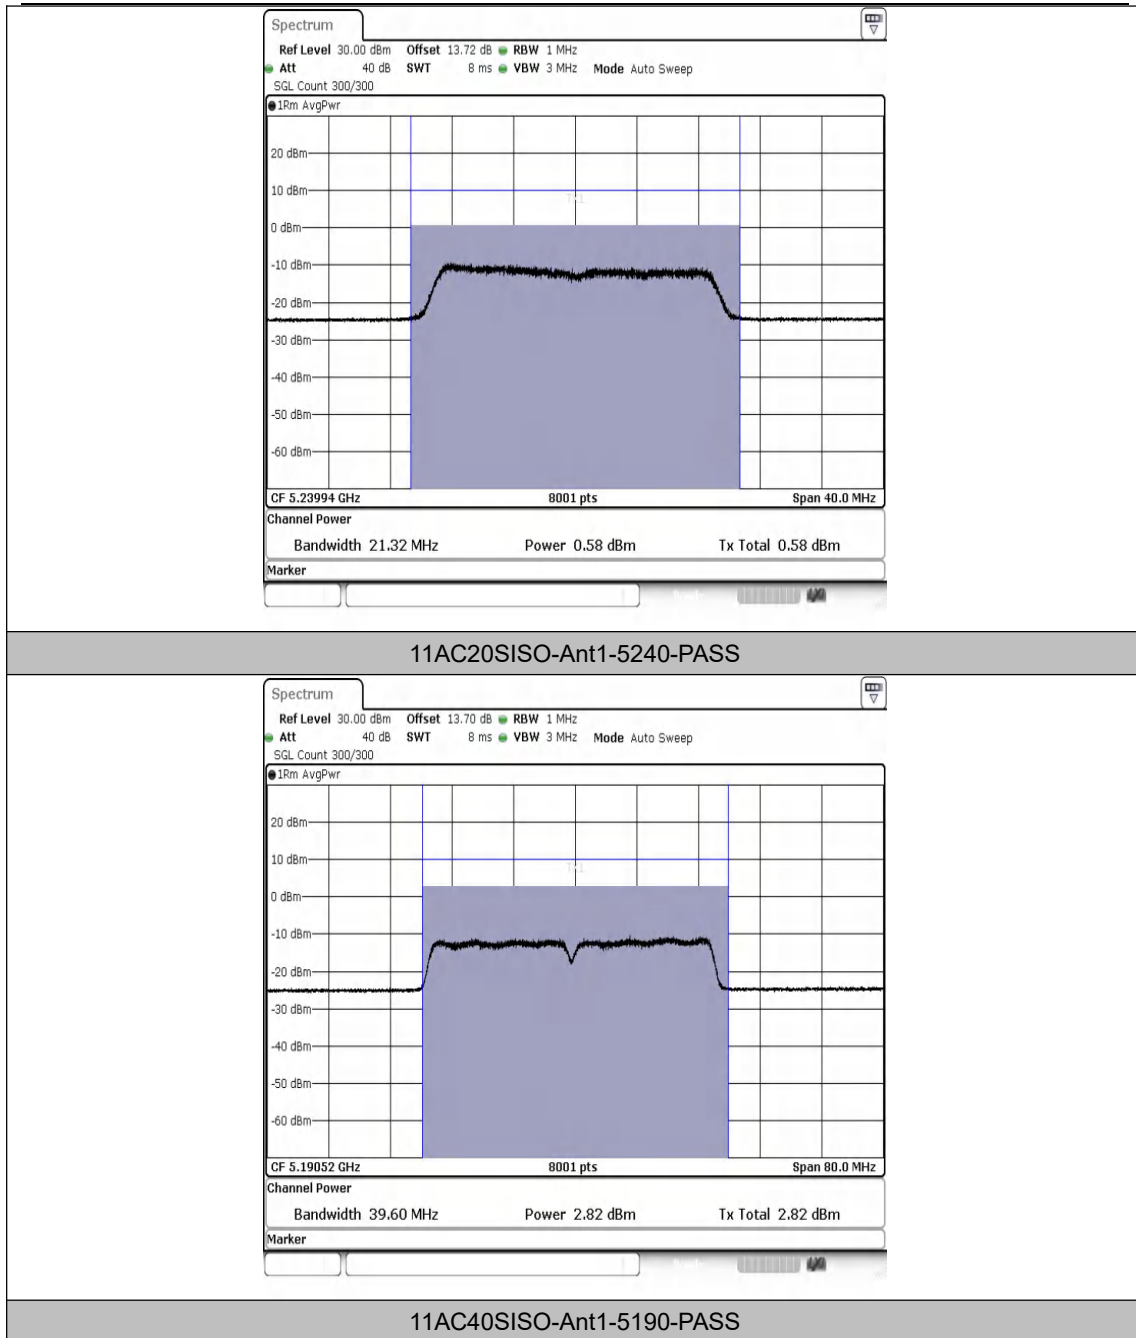

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com

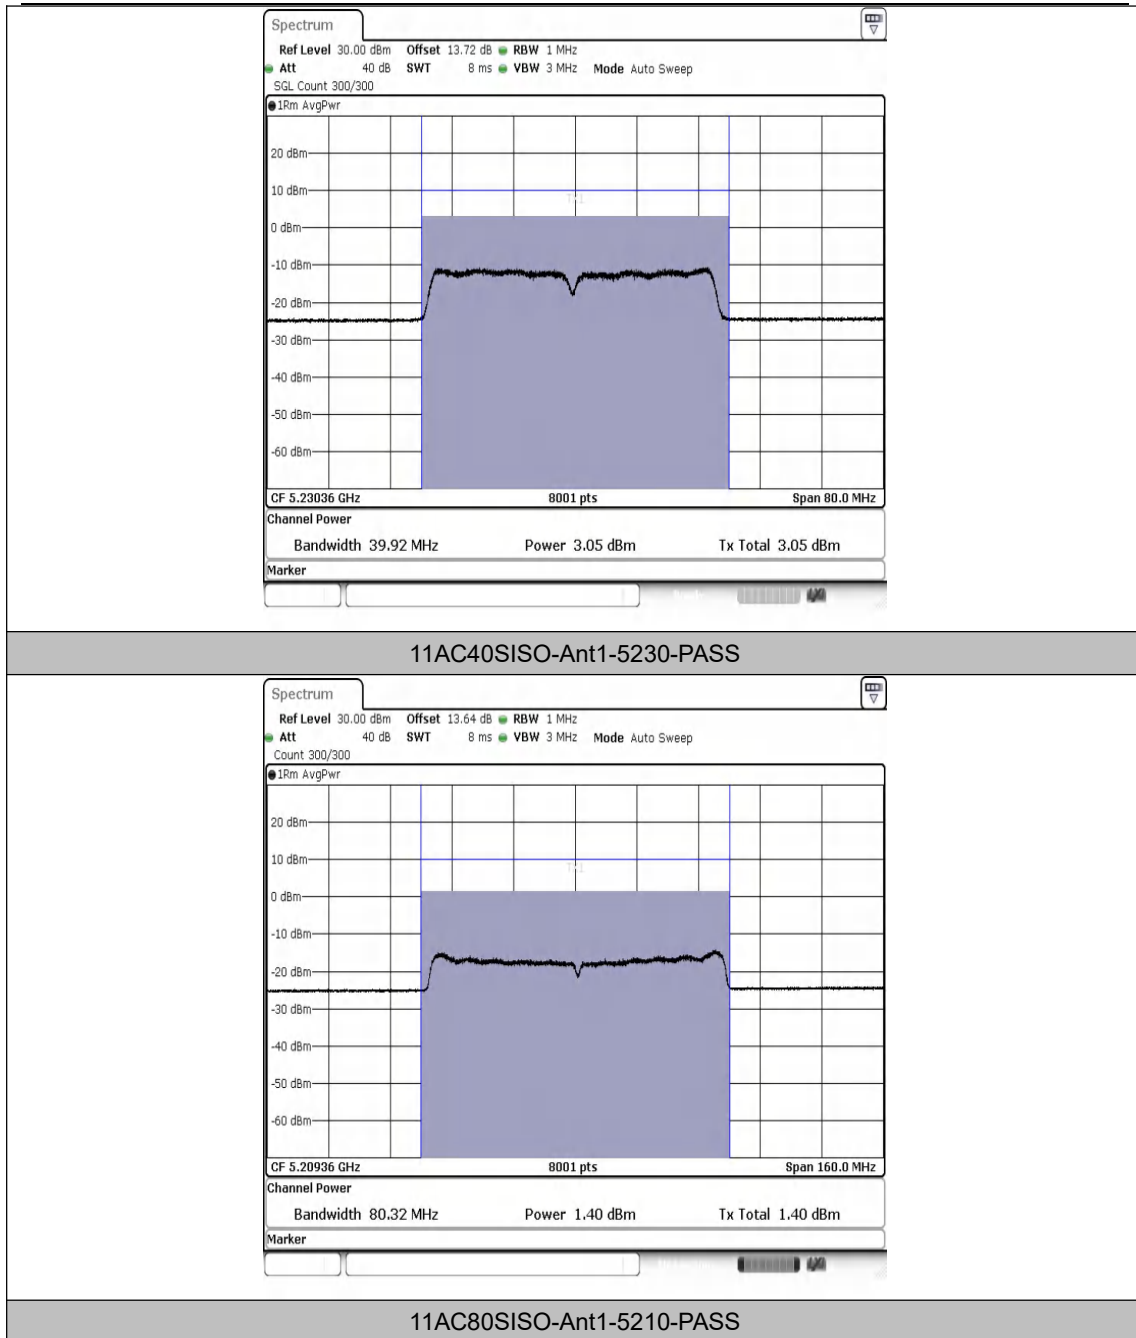

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
 Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
 Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
 400-003-0500
www.anbotek.com

Appendix D: Maximum Power Spectral Density


Test Result

Test Mode	Antenna	Frequency [MHz]	Reading Result[dBm/MHz]	DC Factor [dB]	Result [dBm/MHz]	Limit[dBm/MHz]	Verdict
11A	Ant1	5180	-8.63	9.25	0.62	≤11.00	PASS
11A	Ant1	5200	-6.59	9.17	2.58	≤11.00	PASS
11A	Ant1	5240	-8.12	9.17	1.05	≤11.00	PASS
11N20SISO	Ant1	5180	-7.92	9.43	1.51	≤11.00	PASS
11N20SISO	Ant1	5200	-6.1	9.52	3.42	≤11.00	PASS
11N20SISO	Ant1	5240	-8.04	9.52	1.48	≤11.00	PASS
11N40SISO	Ant1	5190	-10.1	9.60	-0.50	≤11.00	PASS
11N40SISO	Ant1	5230	-11.1	9.60	-1.50	≤11.00	PASS
11AC20SISO	Ant1	5180	-6.18	9.52	3.34	≤11.00	PASS
11AC20SISO	Ant1	5200	-6.83	9.45	2.62	≤11.00	PASS
11AC20SISO	Ant1	5240	-8.37	9.43	1.06	≤11.00	PASS
11AC40SISO	Ant1	5190	-9.25	9.68	0.43	≤11.00	PASS
11AC40SISO	Ant1	5230	-11.43	9.60	-1.83	≤11.00	PASS
11AC80SISO	Ant1	5210	-13.13	10.03	-3.10	≤11.00	PASS

Note: 1.The cable loss are compensated in the graph.




Test Graphs

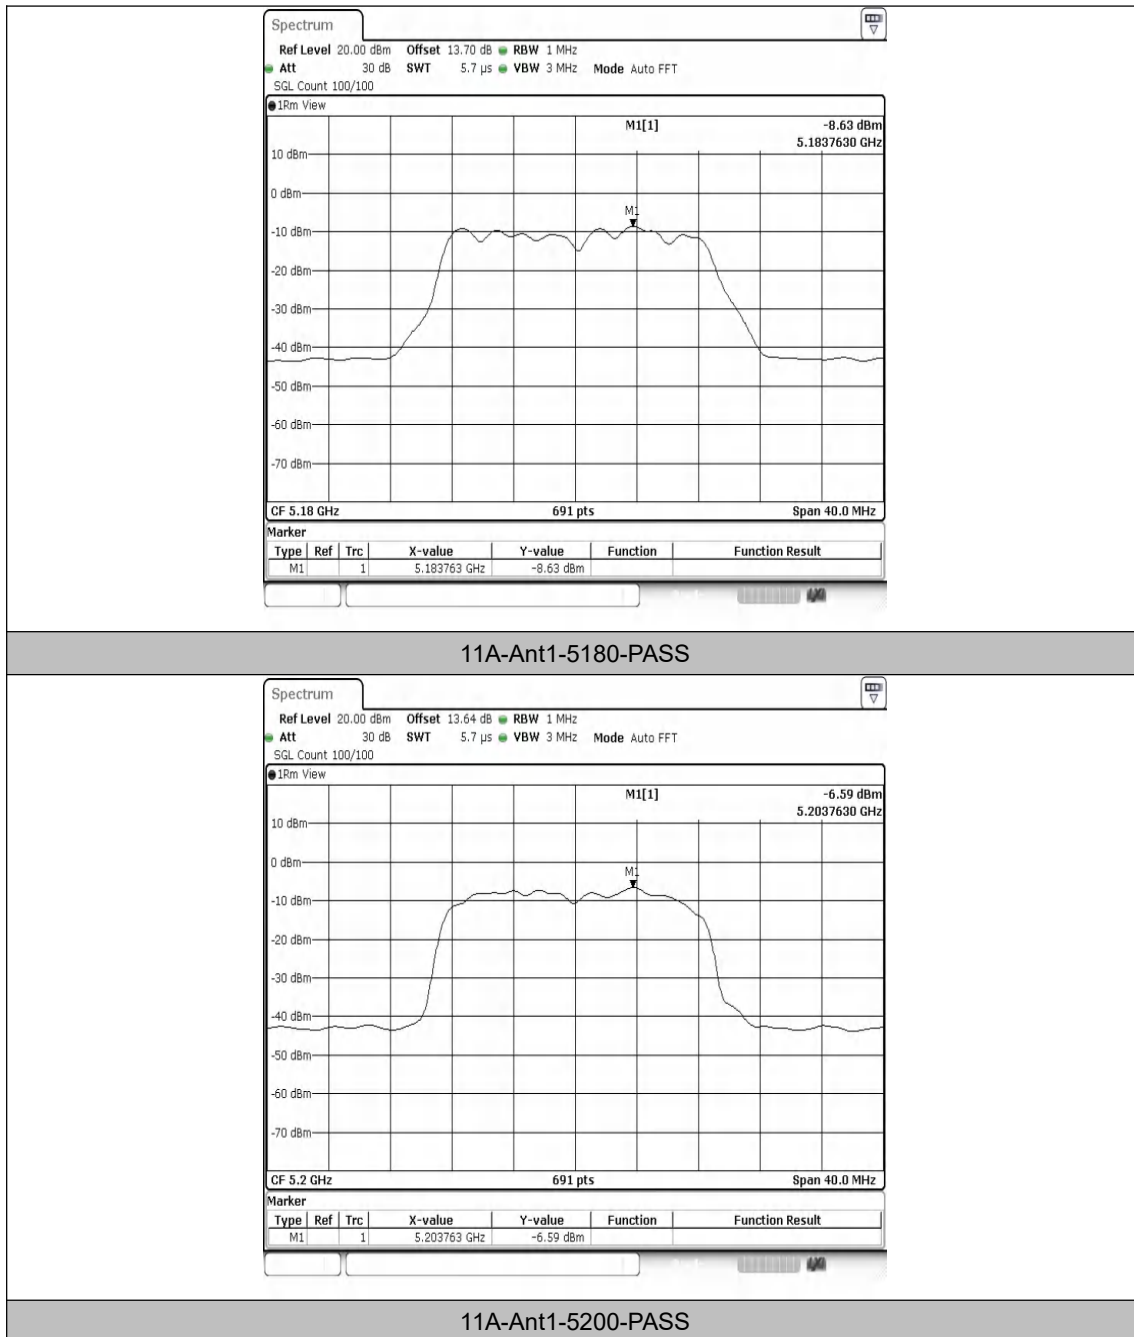



Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

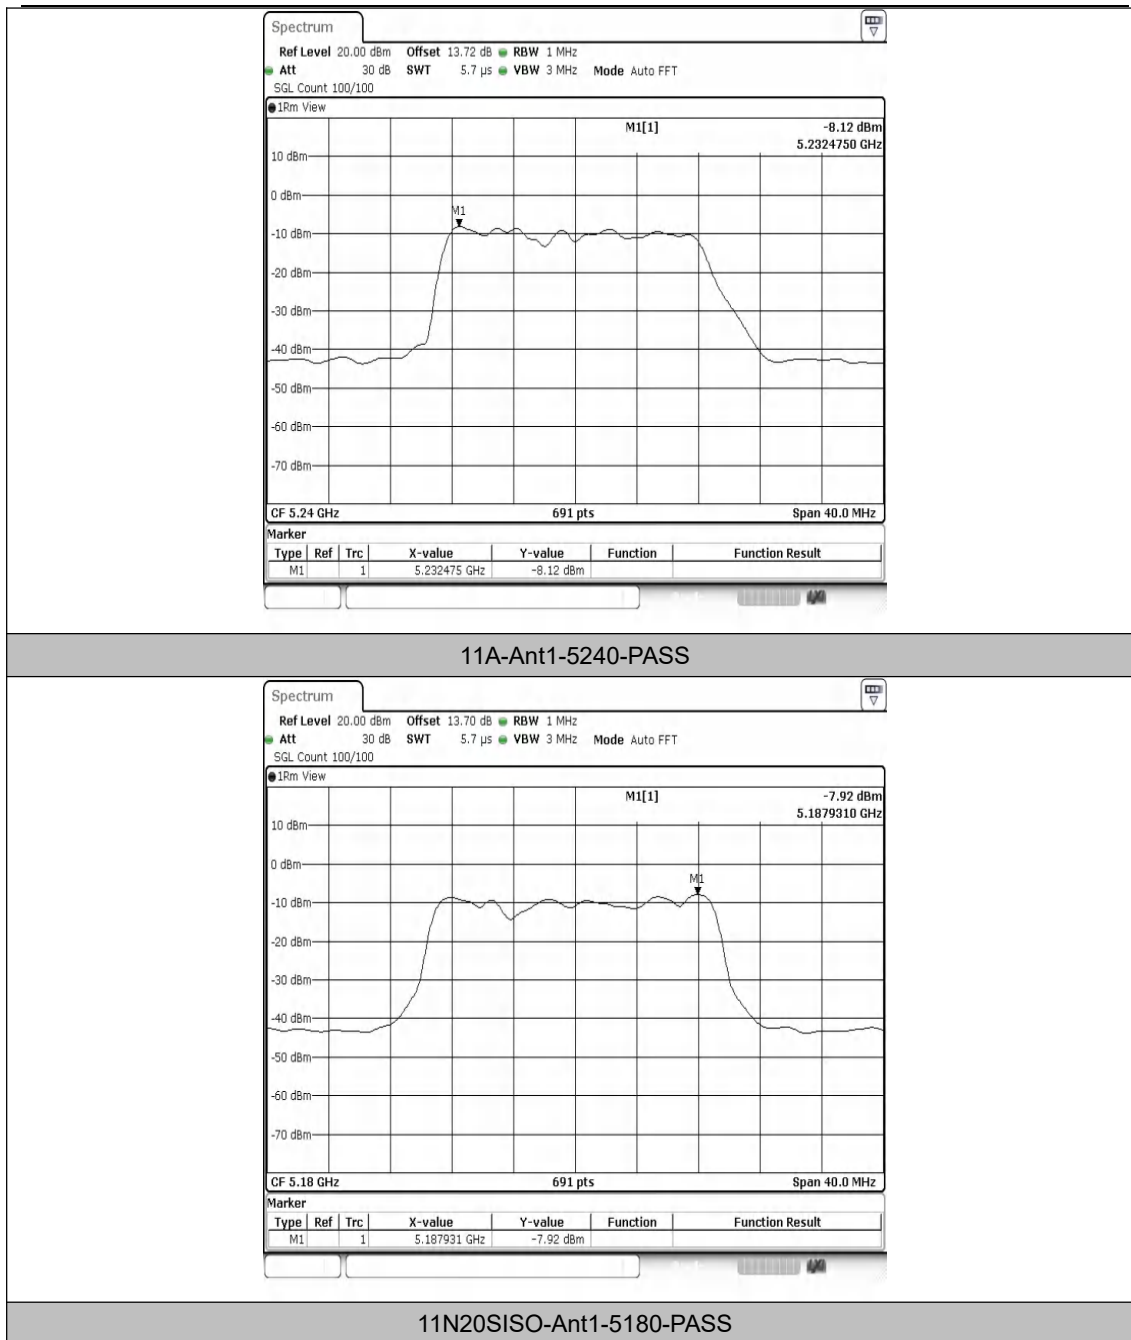


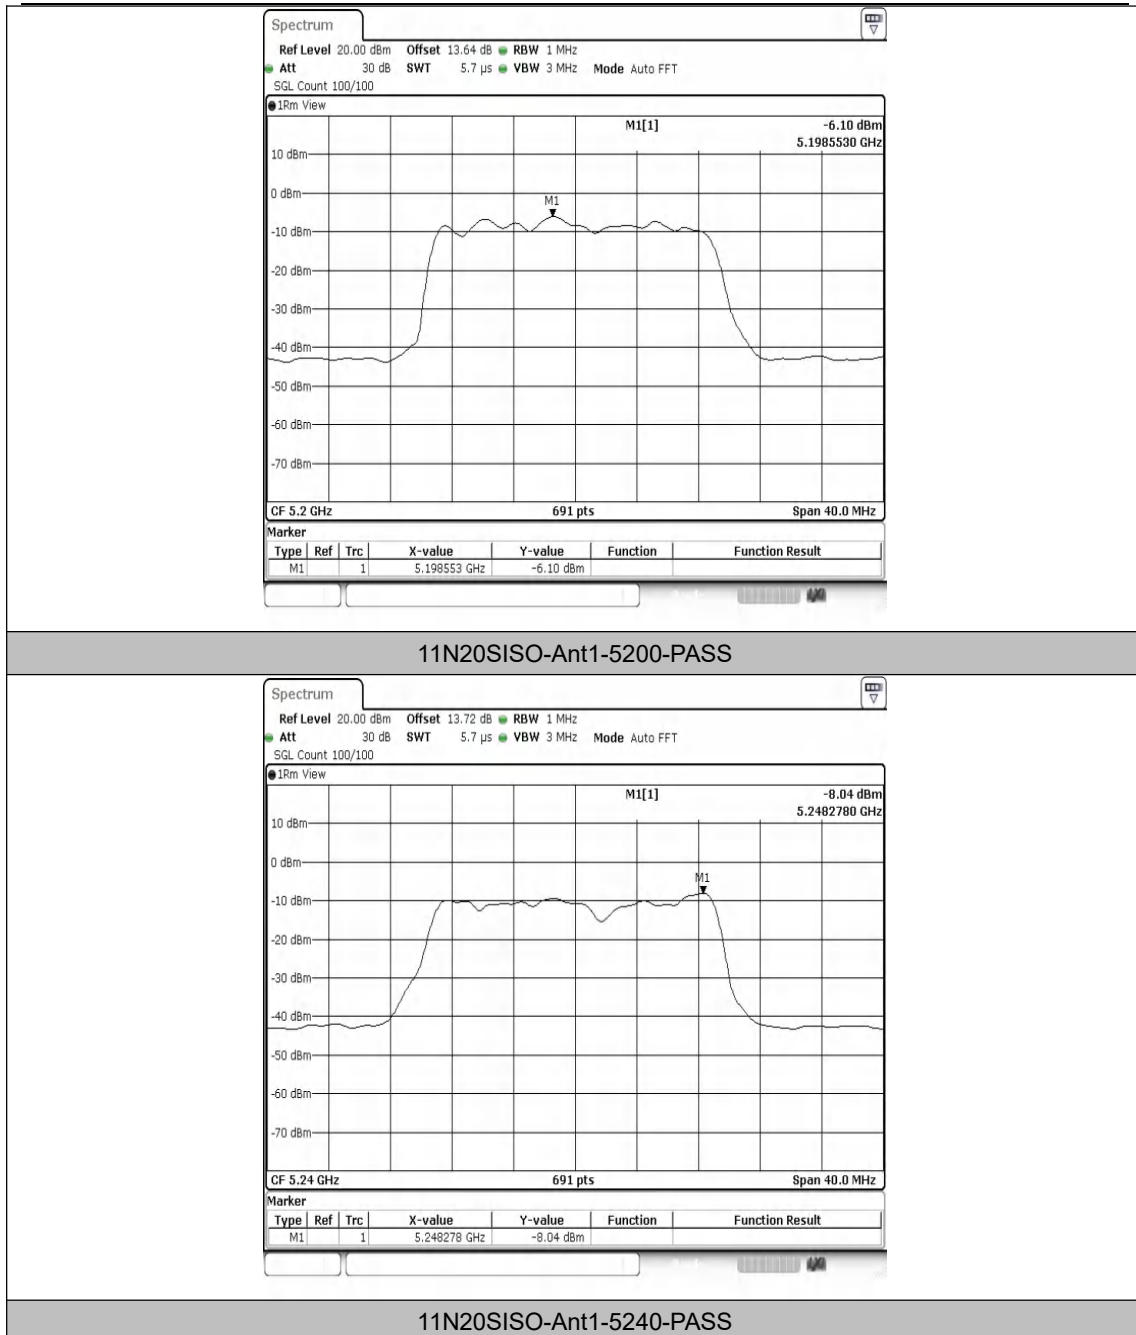

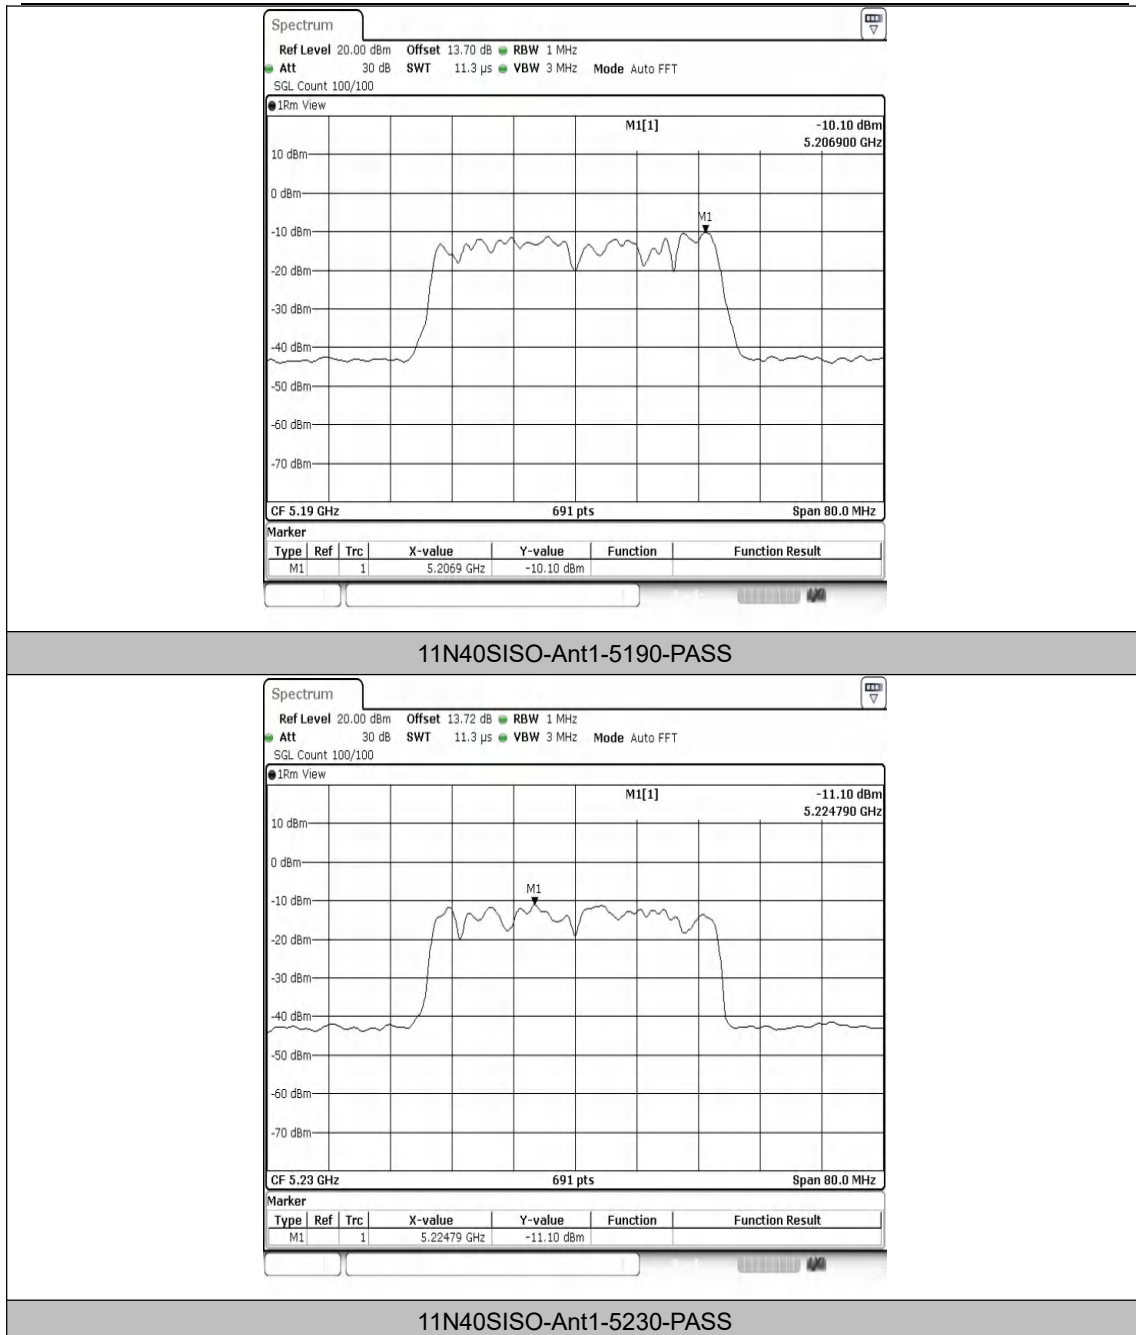

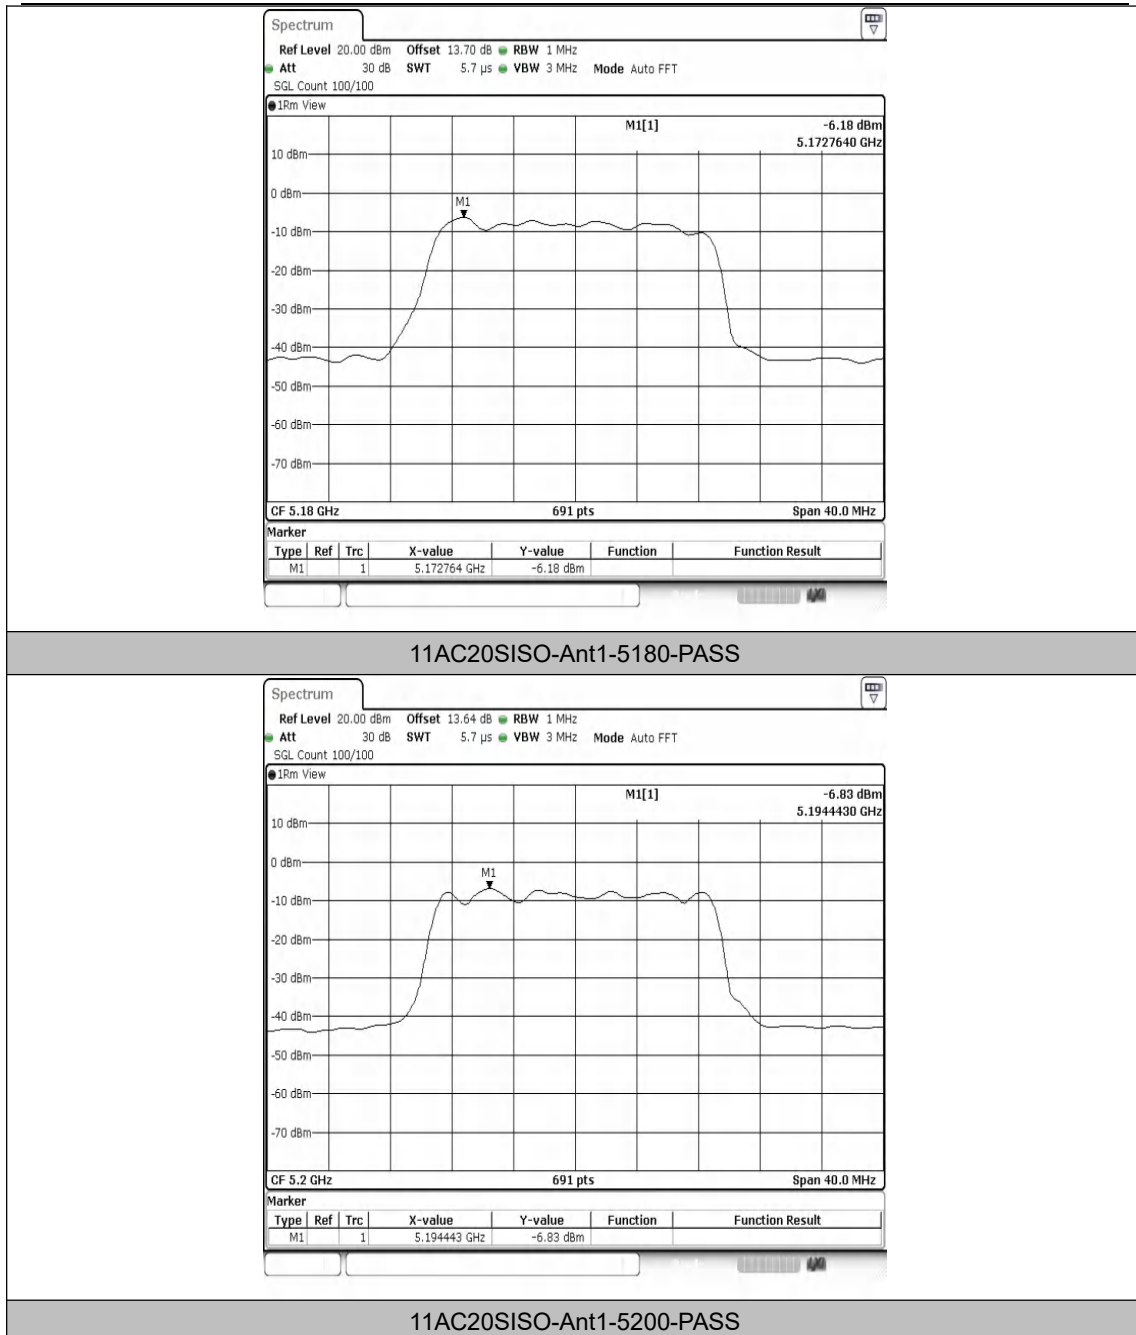

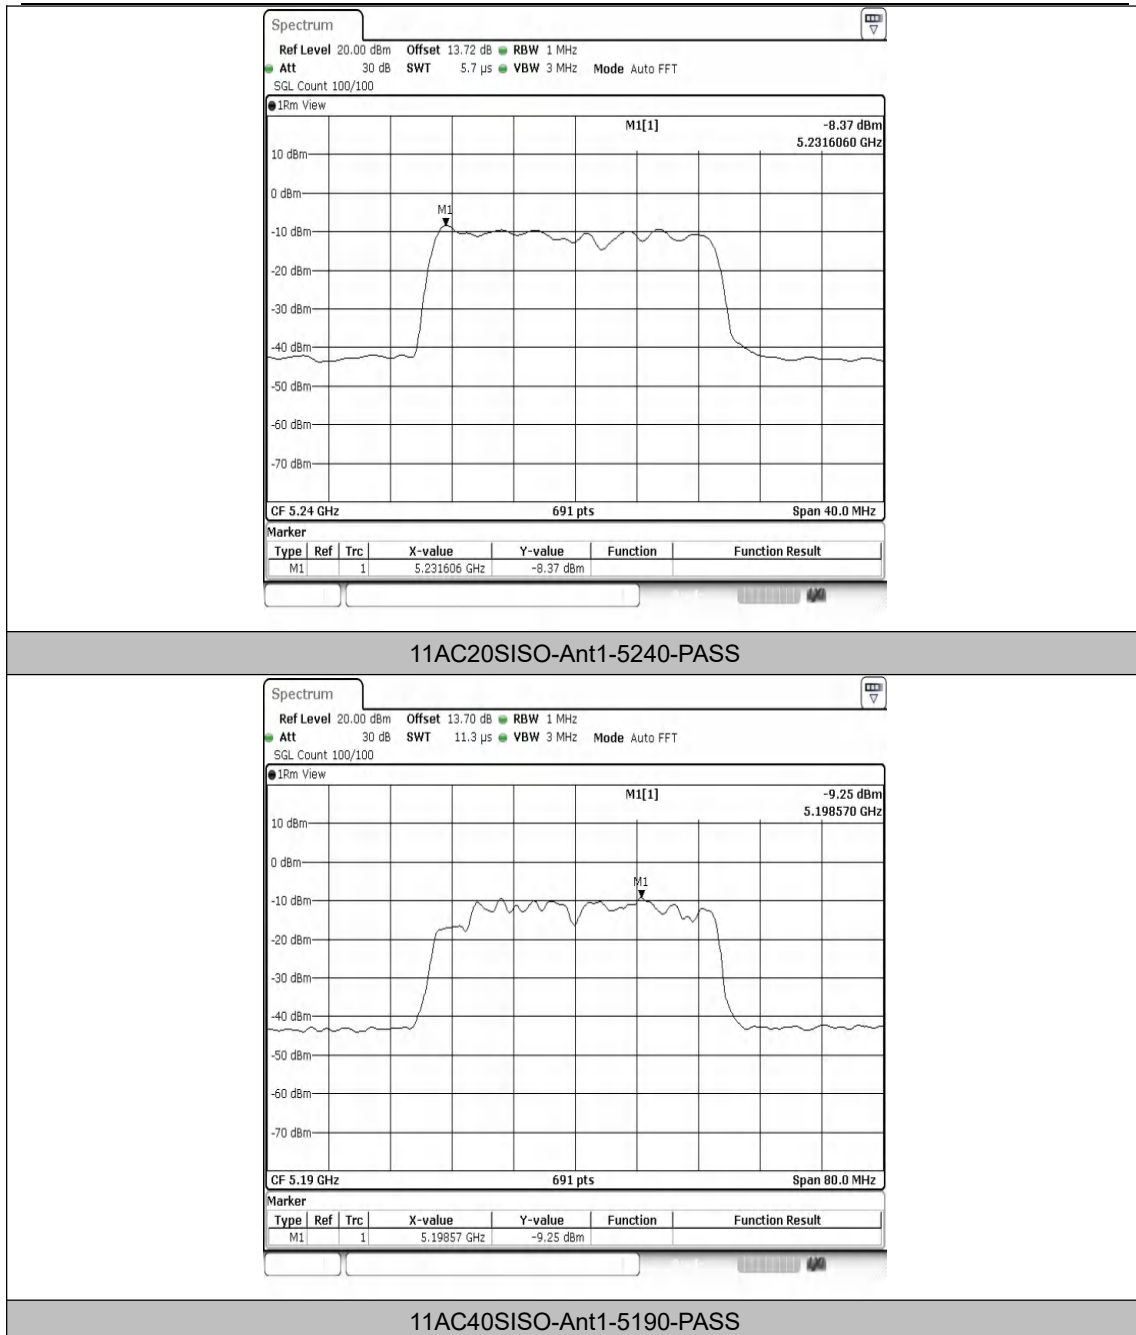

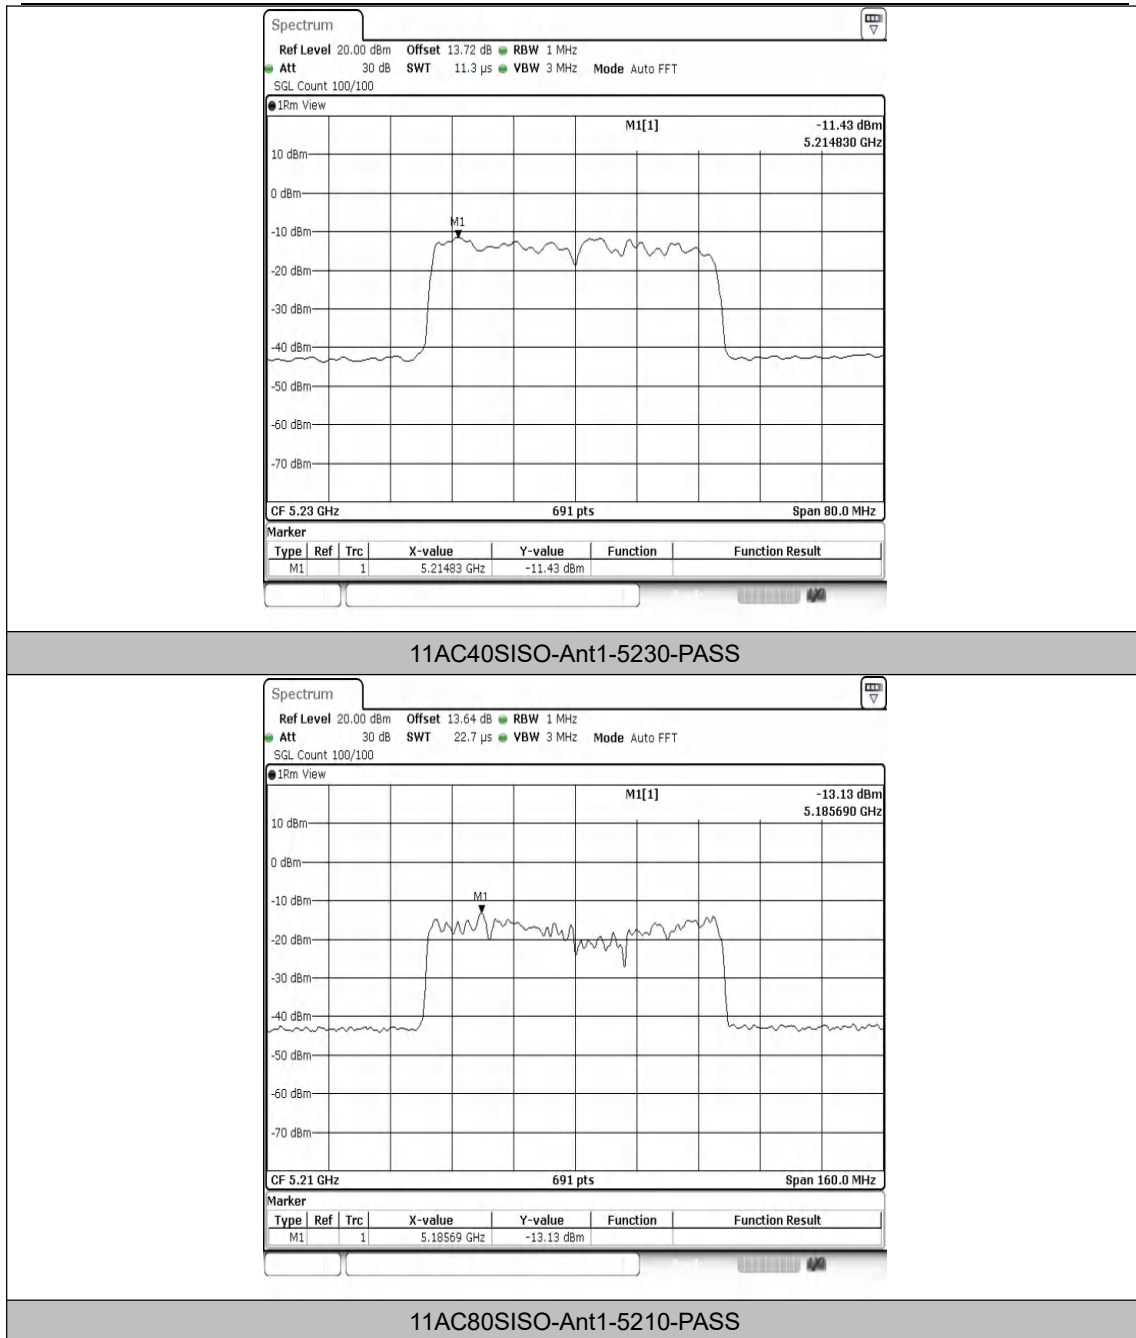

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotech.com

 Hotline
400-003-0500
www.anbotech.com


Appendix E: Band edge measurements


Test Result B1


Test Mode	Antenna	ChName	Frequency[MHz]	Result[dBm]	Limit[dBm]	Verdict
11A	Ant1	Low	5180	-36.74	≤-27	PASS
11A	Ant1	High	5240	-44.84	≤-27	PASS
11N20SISO	Ant1	Low	5180	-35.75	≤-27	PASS
11N20SISO	Ant1	High	5240	-44.03	≤-27	PASS
11N40SISO	Ant1	Low	5190	-37.31	≤-27	PASS
11N40SISO	Ant1	High	5230	-46.44	≤-27	PASS
11AC20SISO	Ant1	Low	5180	-37.34	≤-27	PASS
11AC20SISO	Ant1	High	5240	-45.98	≤-27	PASS
11AC40SISO	Ant1	Low	5190	-37.19	≤-27	PASS
11AC40SISO	Ant1	High	5230	-45.34	≤-27	PASS
11AC80SISO	Ant1	Low	5210	-35.38	≤-27	PASS
11AC80SISO	Ant1	High	5210	-46.76	≤-27	PASS


Note: The margin is at least greater than the antenna gain plus the cable loss.


Test Graphs B1

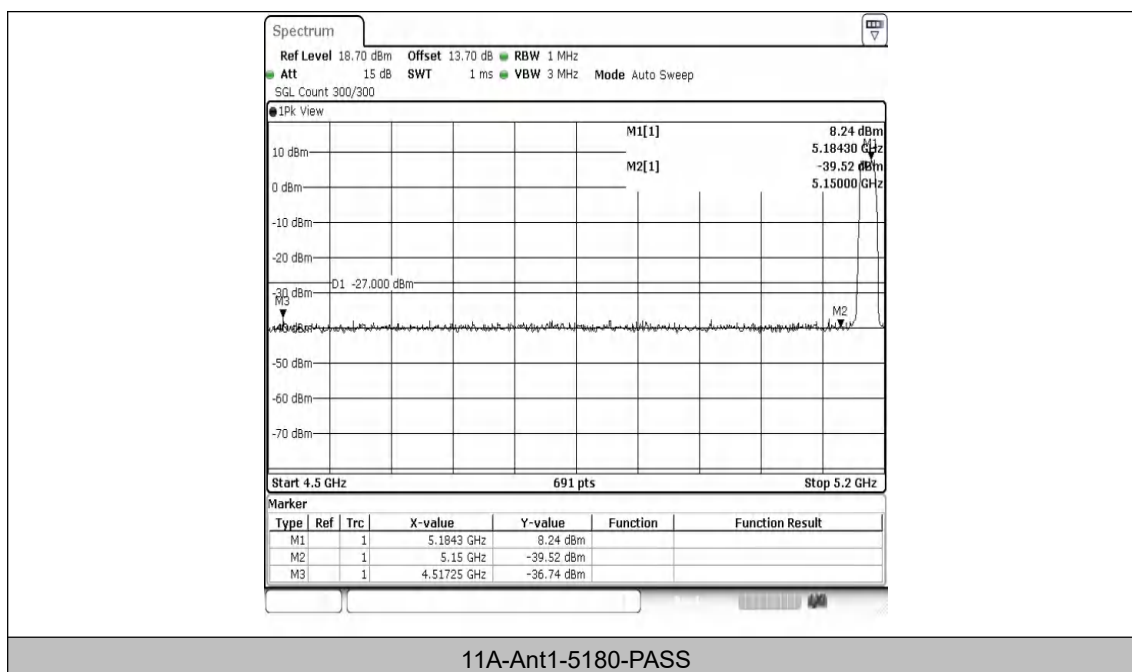

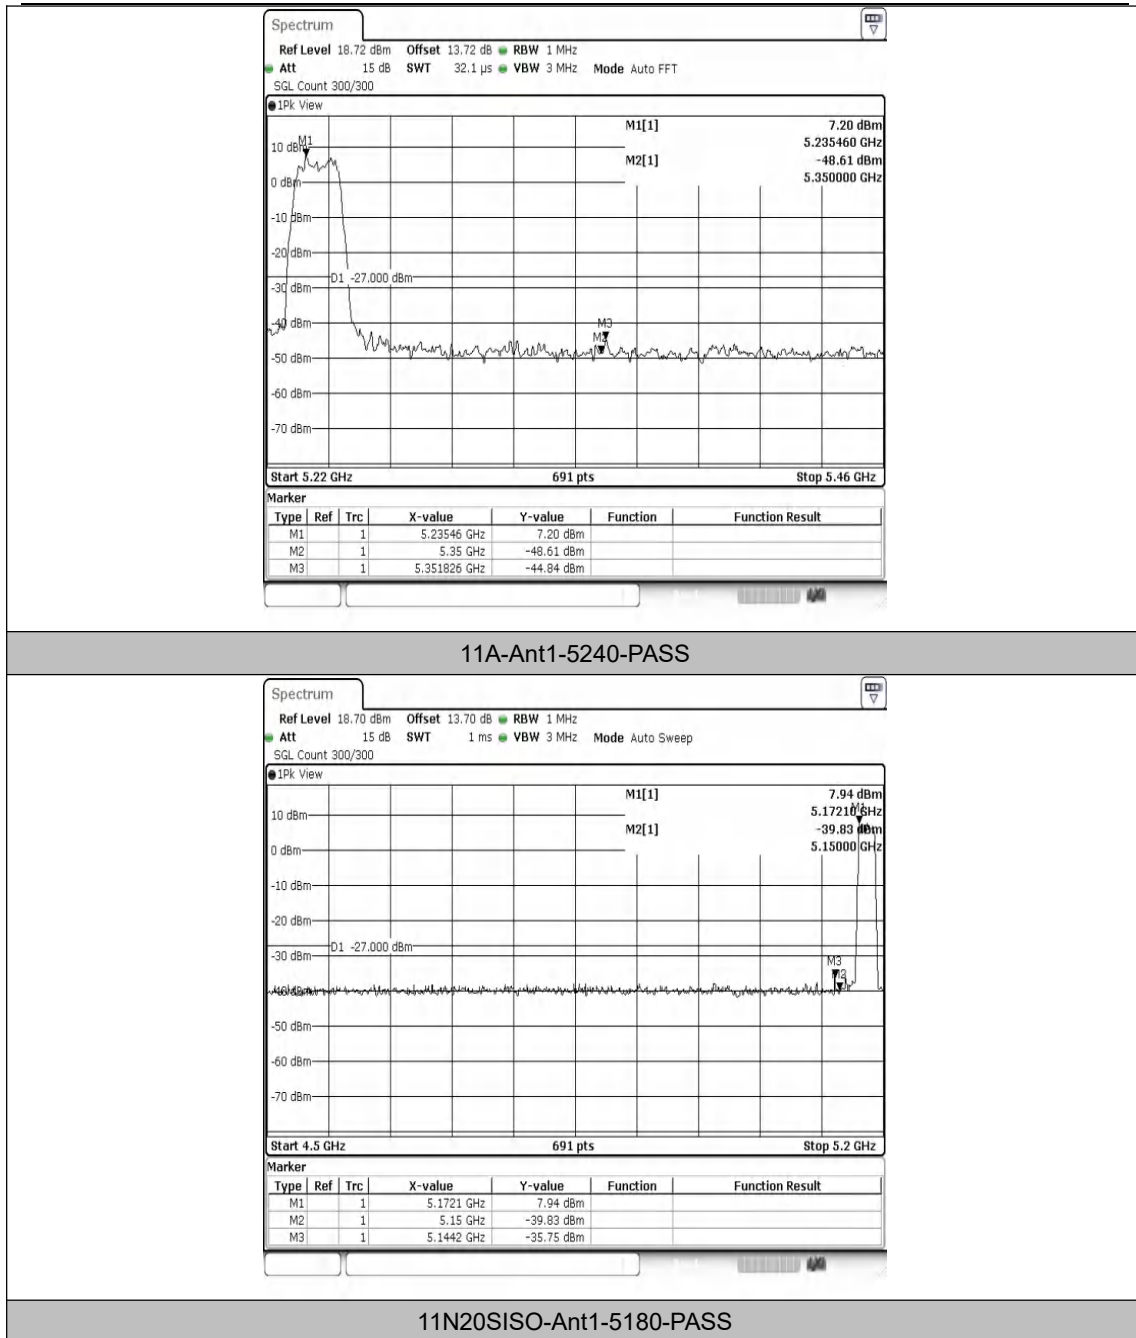


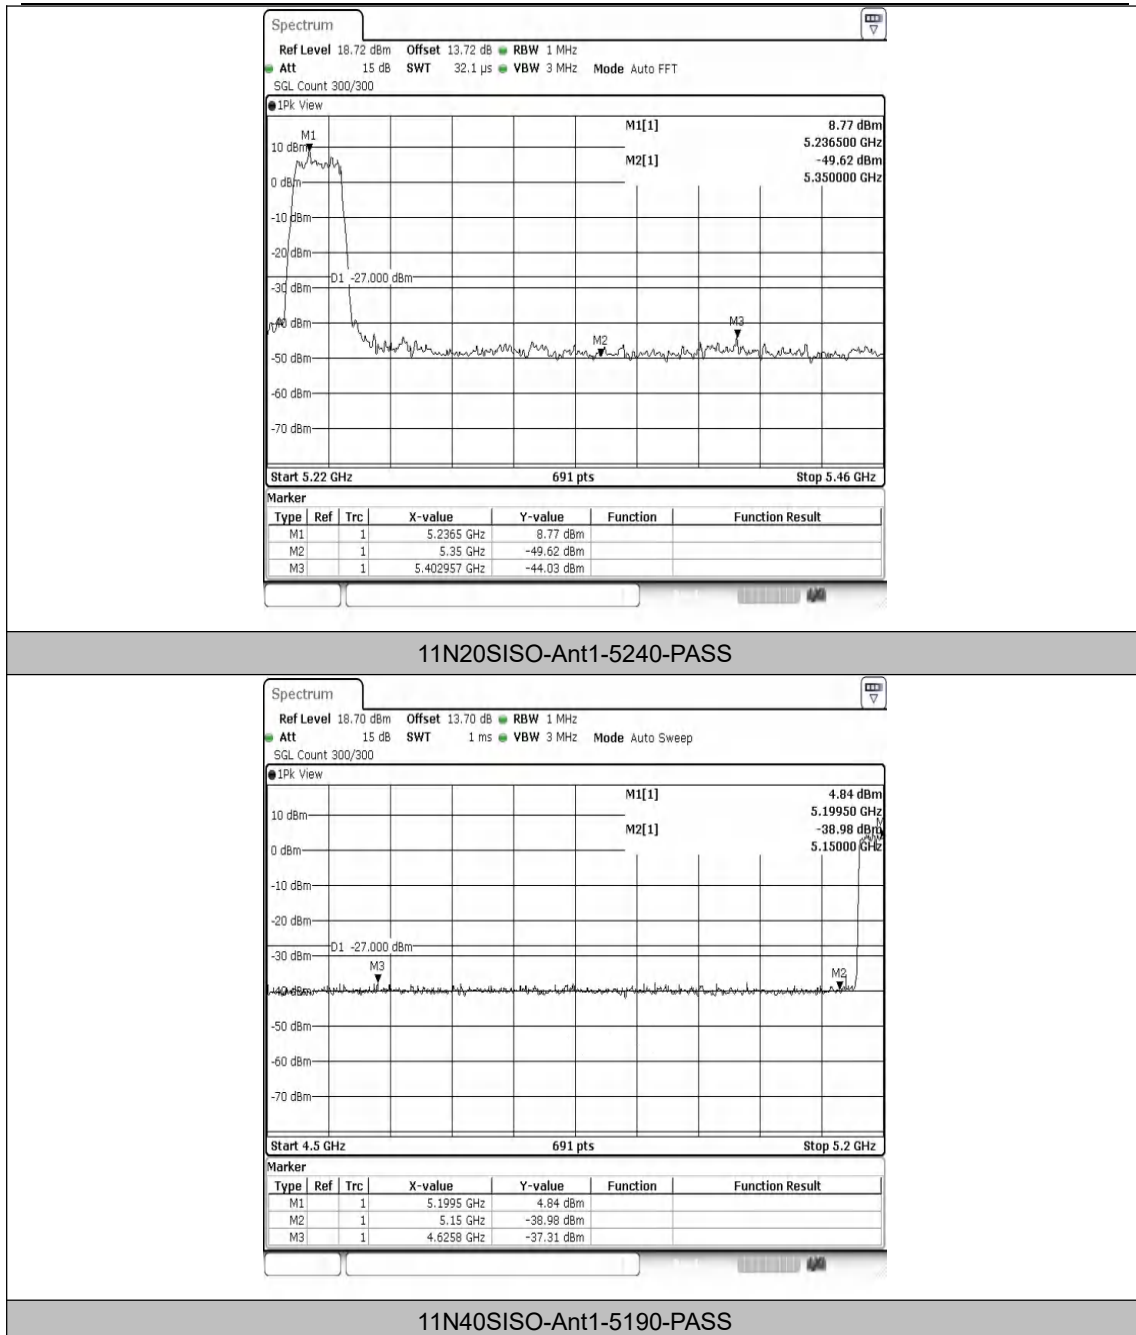

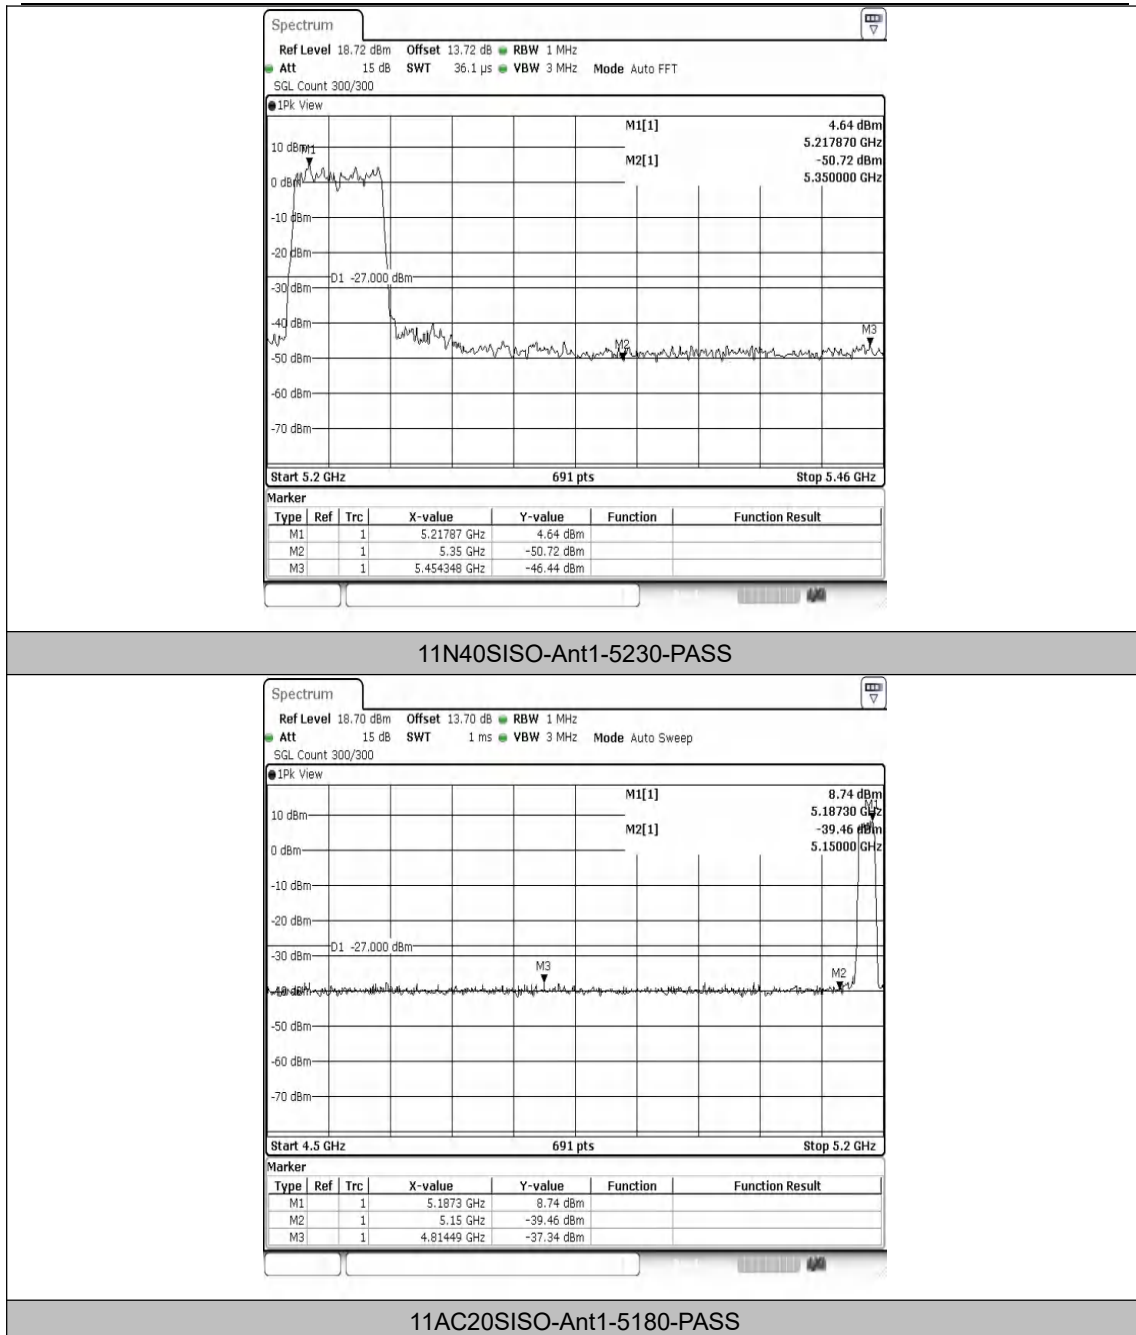


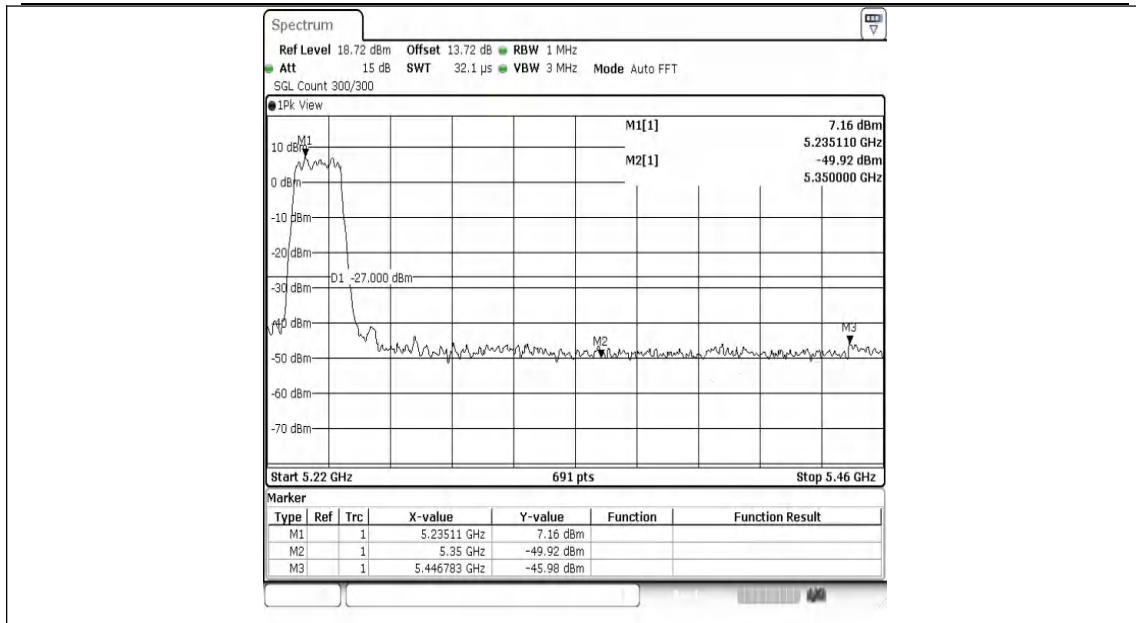


11AC20SISO-Ant1-5240-PASS

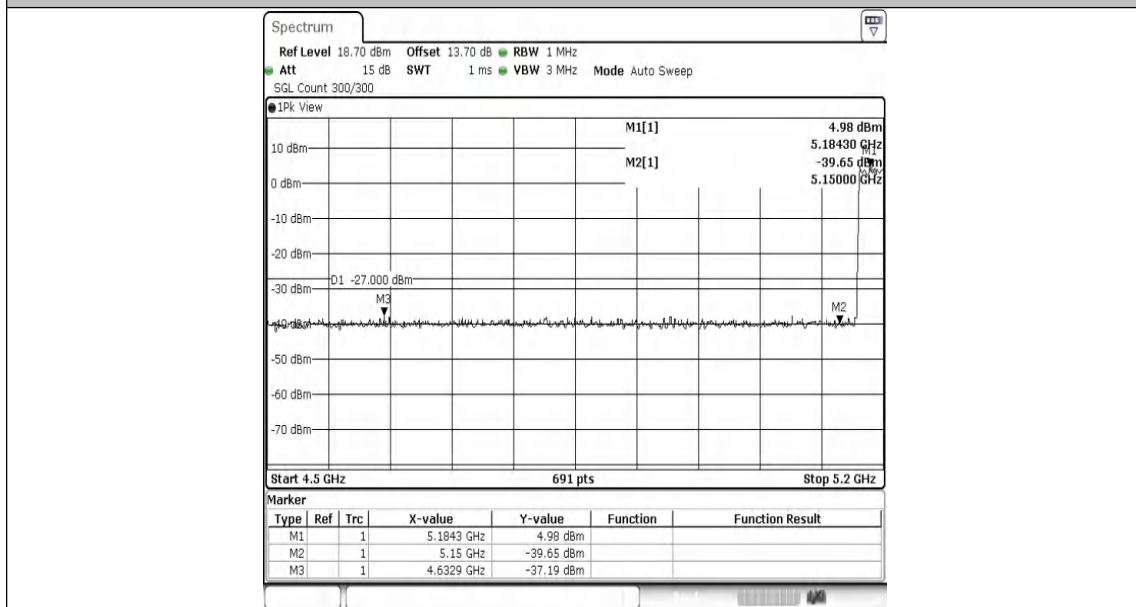

11AC40SISO-Ant1-5190-PASS

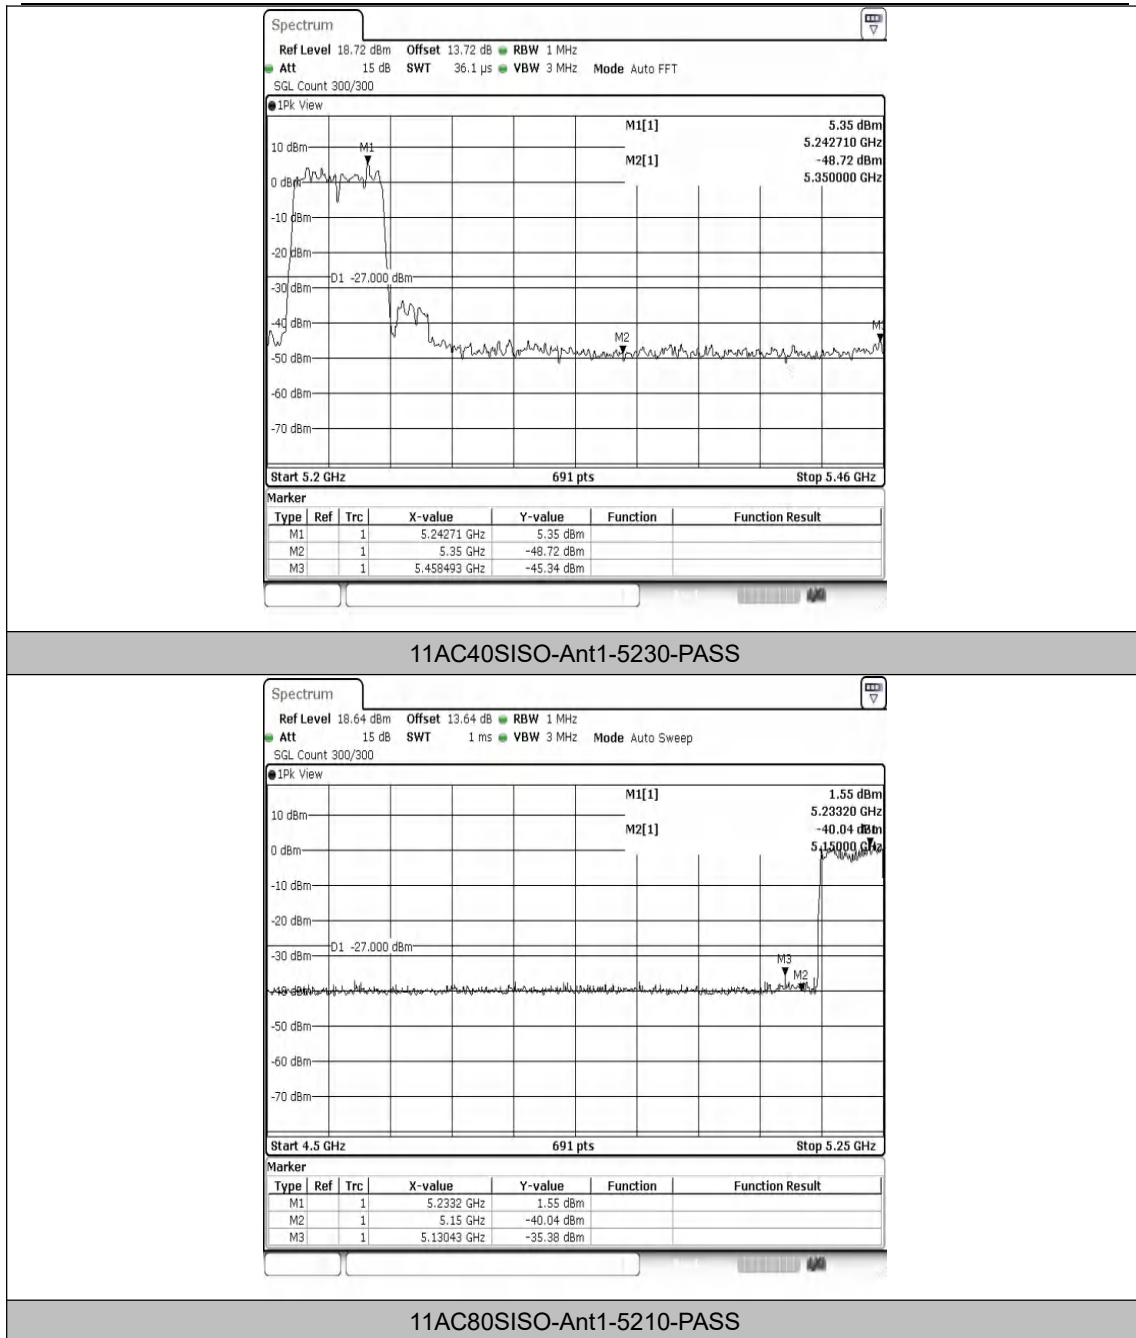

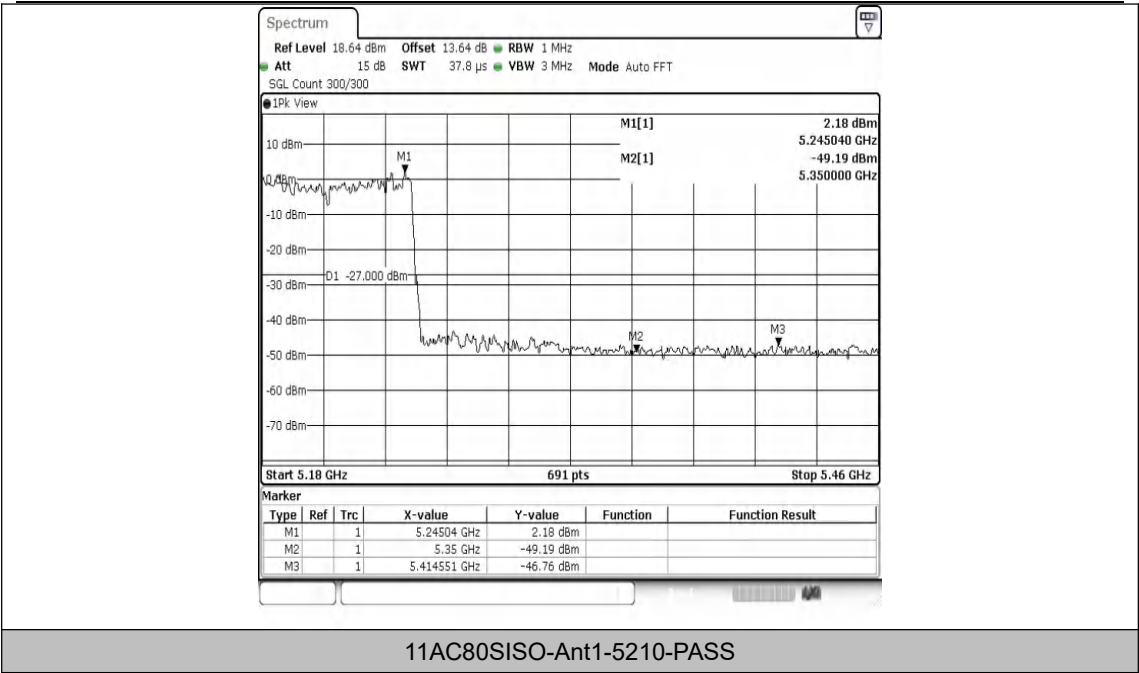

---End---