





Restrict Band NVNT ax40 5270MHz Ant0 Peak

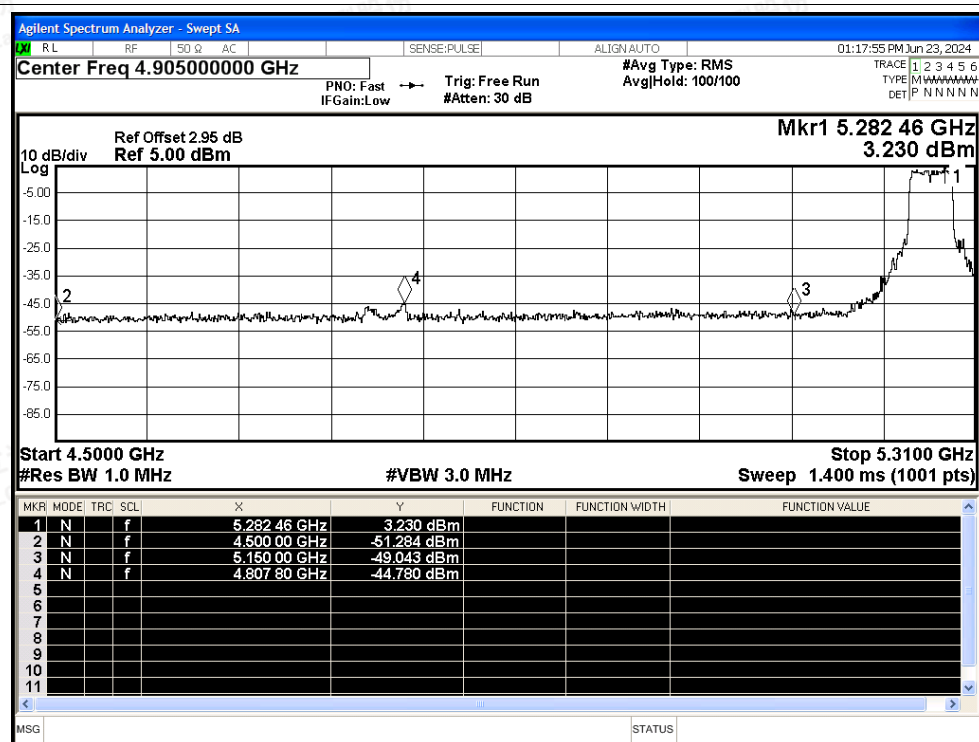

Restrict Band NVNT ax40 5270MHz Ant0 Average

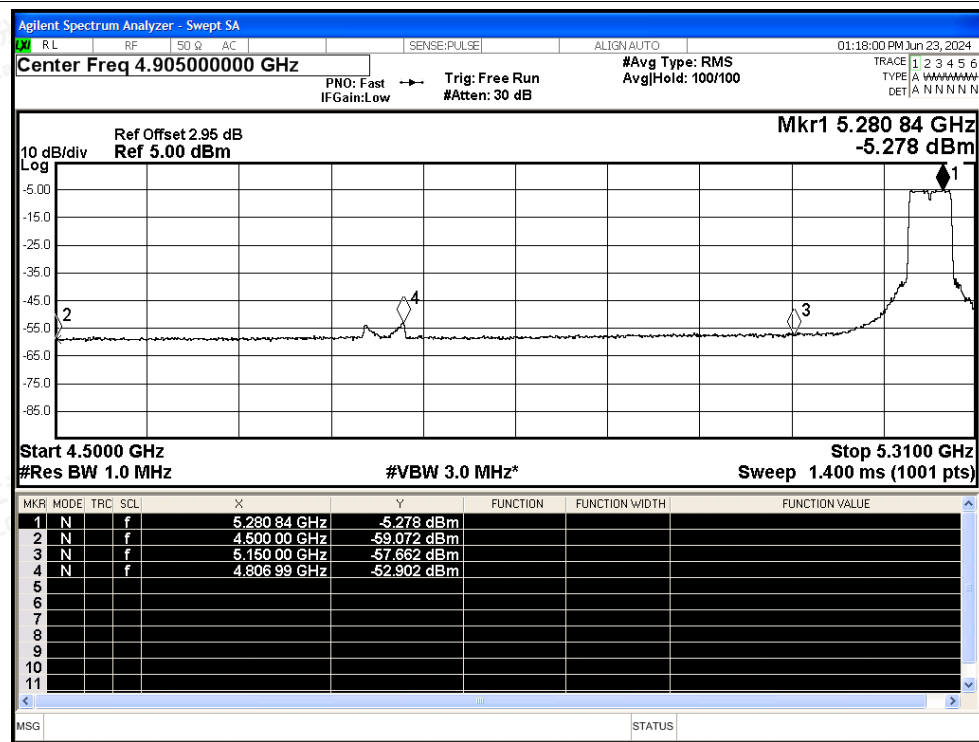

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5310MHz Ant0 Peak

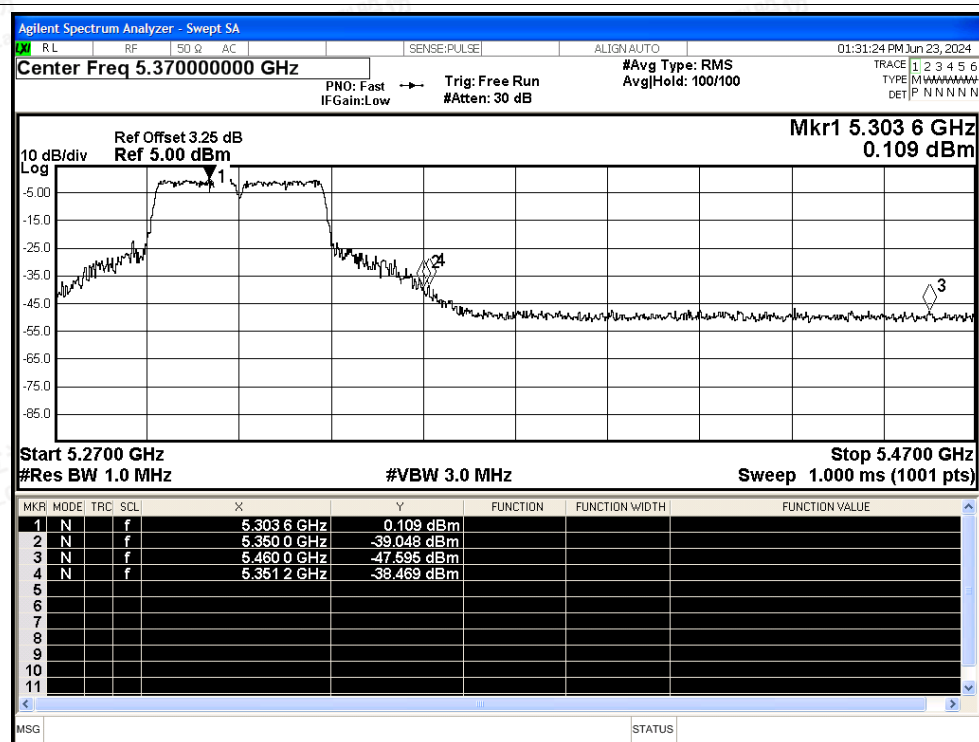

Restrict Band NVNT ax40 5310MHz Ant0 Average

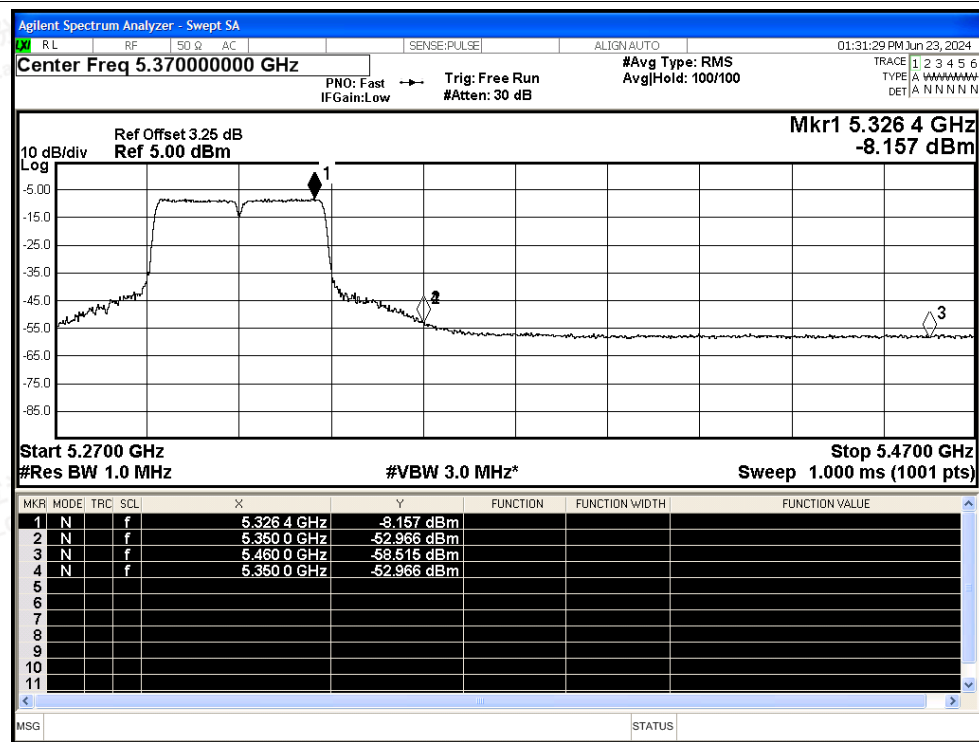

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5290MHz Ant0 Peak

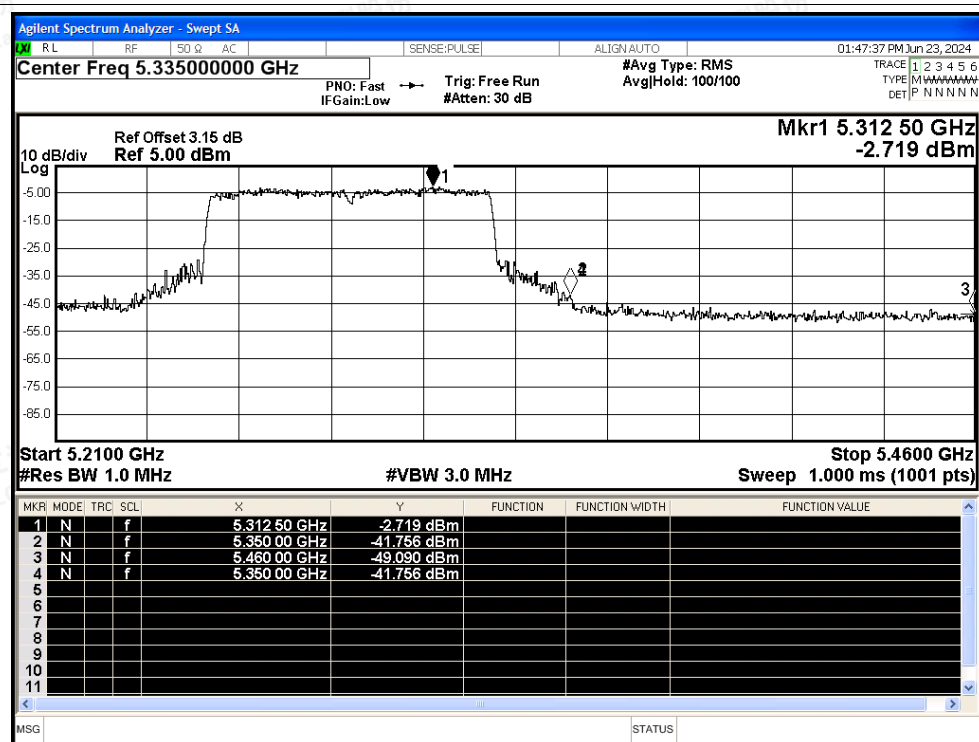

Restrict Band NVNT ax80 5290MHz Ant0 Average

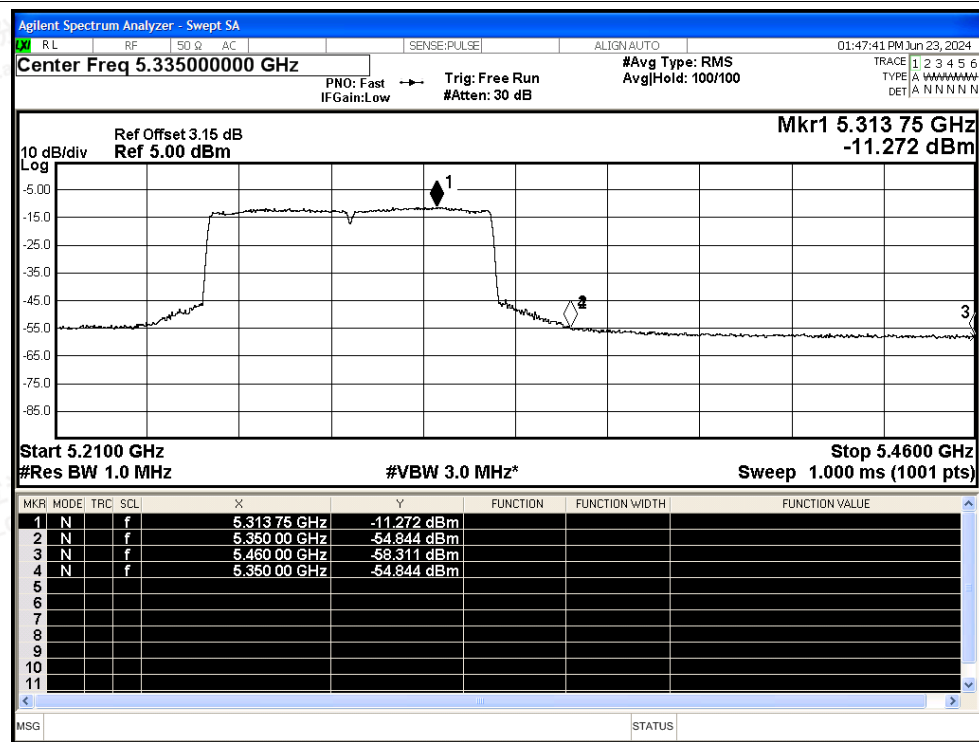

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5290MHz Ant0 Peak

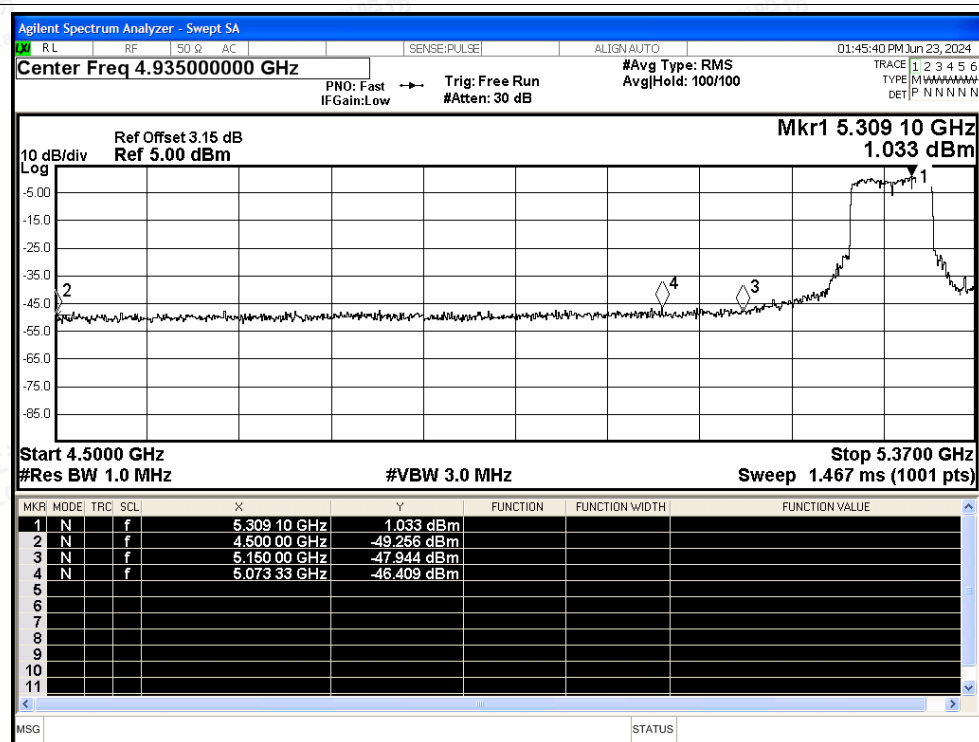

Restrict Band NVNT ax80 5290MHz Ant0 Average

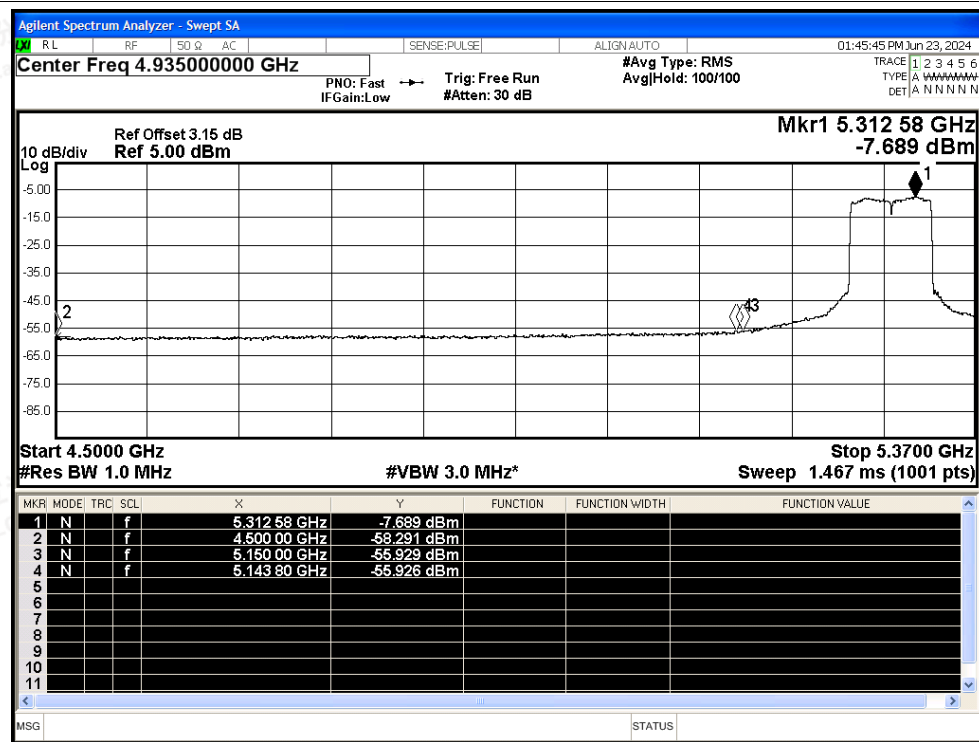

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5260	Ant1	4500	-50.26	3.47	-	48.44	Peak	74	Pass
NVNT	a	5260	Ant1	4500	-59.27	3.47	0.24	39.67	Average	54	Pass
NVNT	a	5260	Ant1	5067.06	-45.53	3.47	-	53.17	Peak	74	Pass
NVNT	a	5260	Ant1	4787.82	-55.45	3.47	0.24	43.49	Average	54	Pass
NVNT	a	5260	Ant1	5150	-47.14	3.47	-	51.56	Peak	74	Pass
NVNT	a	5260	Ant1	5150	-56.86	3.47	0.24	42.08	Average	54	Pass
NVNT	a	5320	Ant1	5350	-41.45	3.47	-	57.25	Peak	74	Pass
NVNT	a	5320	Ant1	5350	-54.63	3.47	0.24	44.31	Average	54	Pass
NVNT	a	5320	Ant1	5460	-49.08	3.47	-	49.62	Peak	74	Pass
NVNT	a	5320	Ant1	5460	-58.11	3.47	0.24	40.83	Average	54	Pass
NVNT	n20	5260	Ant1	4500	-51.22	3.47	-	47.48	Peak	74	Pass
NVNT	n20	5260	Ant1	4500	-59.47	3.47	0.28	39.51	Average	54	Pass
NVNT	n20	5260	Ant1	4787.04	-46.77	3.47	-	51.93	Peak	74	Pass
NVNT	n20	5260	Ant1	4772.22	-55.54	3.47	0.28	43.44	Average	54	Pass
NVNT	n20	5260	Ant1	5150	-49.3	3.47	-	49.40	Peak	74	Pass
NVNT	n20	5260	Ant1	5150	-57.69	3.47	0.28	41.29	Average	54	Pass
NVNT	n20	5320	Ant1	5350	-43.33	3.47	-	55.37	Peak	74	Pass
NVNT	n20	5320	Ant1	5350	-54.42	3.47	0.28	44.56	Average	54	Pass
NVNT	n20	5320	Ant1	5460	-50.78	3.47	-	47.92	Peak	74	Pass
NVNT	n20	5320	Ant1	5460	-58.01	3.47	0.28	40.97	Average	54	Pass
NVNT	n40	5270	Ant1	4500	-50.16	3.47	-	48.54	Peak	74	Pass
NVNT	n40	5270	Ant1	4500	-59.08	3.47	0.12	39.74	Average	54	Pass
NVNT	n40	5270	Ant1	4806.99	-44.45	3.47	-	54.25	Peak	74	Pass
NVNT	n40	5270	Ant1	4806.99	-53.36	3.47	0.12	45.46	Average	54	Pass
NVNT	n40	5270	Ant1	5150	-48.86	3.47	-	49.84	Peak	74	Pass
NVNT	n40	5270	Ant1	5150	-57.52	3.47	0.12	41.30	Average	54	Pass
NVNT	n40	5310	Ant1	5350	-43.6	3.47	-	55.10	Peak	74	Pass
NVNT	n40	5310	Ant1	5350	-53.85	3.47	0.12	44.97	Average	54	Pass
NVNT	n40	5310	Ant1	5350.6	-34.93	3.47	-	63.77	Peak	74	Pass
NVNT	n40	5310	Ant1	5350.2	-53.59	3.47	0.12	45.23	Average	54	Pass
NVNT	n40	5310	Ant1	5460	-49.23	3.47	-	49.47	Peak	74	Pass
NVNT	n40	5310	Ant1	5460	-57.75	3.47	0.12	41.07	Average	54	Pass
NVNT	ac20	5260	Ant1	4500	-48.49	3.47	-	50.21	Peak	74	Pass
NVNT	ac20	5260	Ant1	4500	-59.1	3.47	0.28	39.88	Average	54	Pass
NVNT	ac20	5260	Ant1	5149.74	-46.53	3.47	-	52.17	Peak	74	Pass
NVNT	ac20	5260	Ant1	4773	-56.14	3.47	0.28	42.84	Average	54	Pass
NVNT	ac20	5260	Ant1	5150	-46.53	3.47	-	52.17	Peak	74	Pass
NVNT	ac20	5260	Ant1	5150	-56.68	3.47	0.28	42.30	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5320	Ant1	5350	-43.05	3.47	-	55.65	Peak	74	Pass
NVNT	ac20	5320	Ant1	5350	-54.38	3.47	0.28	44.60	Average	54	Pass
NVNT	ac20	5320	Ant1	5351.4	-39.14	3.47	-	59.56	Peak	74	Pass
NVNT	ac20	5320	Ant1	5460	-58.1	3.47	0.28	40.88	Average	54	Pass
NVNT	ac40	5270	Ant1	4500	-49.81	3.47	-	48.89	Peak	74	Pass
NVNT	ac40	5270	Ant1	4500	-59.2	3.47	0.53	40.03	Average	54	Pass
NVNT	ac40	5270	Ant1	4802.94	-45.33	3.47	-	53.37	Peak	74	Pass
NVNT	ac40	5270	Ant1	4806.99	-53.54	3.47	0.53	45.69	Average	54	Pass
NVNT	ac40	5270	Ant1	5150	-47.59	3.47	-	51.11	Peak	74	Pass
NVNT	ac40	5270	Ant1	5150	-57.03	3.47	0.53	42.20	Average	54	Pass
NVNT	ac40	5310	Ant1	5350	-37.31	3.47	-	61.39	Peak	74	Pass
NVNT	ac40	5310	Ant1	5350	-52.35	3.47	0.12	46.47	Average	54	Pass
NVNT	ac40	5310	Ant1	5460	-49.53	3.47	-	49.17	Peak	74	Pass
NVNT	ac40	5310	Ant1	5460	-58.74	3.47	0.12	40.08	Average	54	Pass
NVNT	ac80	5290	Ant1	4500	-50.45	3.47	-	48.25	Peak	74	Pass
NVNT	ac80	5290	Ant1	4500	-58.98	3.47	0.25	39.97	Average	54	Pass
NVNT	ac80	5290	Ant1	4935.87	-46.92	3.47	-	51.78	Peak	74	Pass
NVNT	ac80	5290	Ant1	5149.89	-56.46	3.47	0.25	42.49	Average	54	Pass
NVNT	ac80	5290	Ant1	5150	-48.95	3.47	-	49.75	Peak	74	Pass
NVNT	ac80	5290	Ant1	5150	-56.46	3.47	0.25	42.49	Average	54	Pass
NVNT	ac80	5290	Ant1	5350	-45.87	3.47	-	52.83	Peak	74	Pass
NVNT	ac80	5290	Ant1	5350	-53.97	3.47	0.25	44.98	Average	54	Pass
NVNT	ac80	5290	Ant1	5353	-38.96	3.47	-	59.74	Peak	74	Pass
NVNT	ac80	5290	Ant1	5350.25	-53.26	3.47	0.25	45.69	Average	54	Pass
NVNT	ac80	5290	Ant1	5460	-50.75	3.47	-	47.95	Peak	74	Pass
NVNT	ac80	5290	Ant1	5460	-58.48	3.47	0.25	40.47	Average	54	Pass
NVNT	ax20	5260	Ant1	4500	-51.39	3.47	-	47.31	Peak	74	Pass
NVNT	ax20	5260	Ant1	4500	-59.17	3.47	0.28	39.81	Average	54	Pass
NVNT	ax20	5260	Ant1	5135.7	-46.61	3.47	-	52.09	Peak	74	Pass
NVNT	ax20	5260	Ant1	4787.04	-55.6	3.47	0.28	43.38	Average	54	Pass
NVNT	ax20	5260	Ant1	5150	-48.47	3.47	-	50.23	Peak	74	Pass
NVNT	ax20	5260	Ant1	5150	-56.96	3.47	0.28	42.02	Average	54	Pass
NVNT	ax20	5320	Ant1	5350	-41.41	3.47	-	57.29	Peak	74	Pass
NVNT	ax20	5320	Ant1	5350	-53.77	3.47	0.28	45.21	Average	54	Pass
NVNT	ax20	5320	Ant1	5351	-38.79	3.47	-	59.91	Peak	74	Pass
NVNT	ax20	5320	Ant1	5460	-57.97	3.47	0.28	41.01	Average	54	Pass
NVNT	ax40	5270	Ant1	4500	-48.53	3.47	-	50.17	Peak	74	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5270	Ant1	4500	-58.9	3.47	0.53	40.33	Average	54	Pass
NVNT	ax40	5270	Ant1	4805.37	-45.57	3.47	-	53.13	Peak	74	Pass
NVNT	ax40	5270	Ant1	4806.18	-53.4	3.47	0.53	45.83	Average	54	Pass
NVNT	ax40	5270	Ant1	5150	-49.07	3.47	-	49.63	Peak	74	Pass
NVNT	ax40	5270	Ant1	5150	-57.18	3.47	0.53	42.05	Average	54	Pass
NVNT	ax40	5310	Ant1	5350	-37.25	3.47	-	61.45	Peak	74	Pass
NVNT	ax40	5310	Ant1	5350	-52.33	3.47	0.53	46.90	Average	54	Pass
NVNT	ax40	5310	Ant1	5460	-50.4	3.47	-	48.30	Peak	74	Pass
NVNT	ax40	5310	Ant1	5460	-57.97	3.47	0.53	41.26	Average	54	Pass
NVNT	ax80	5290	Ant1	5350	-44.22	3.47	-	54.48	Peak	74	Pass
NVNT	ax80	5290	Ant1	5350	-53.93	3.47	0.25	45.02	Average	54	Pass
NVNT	ax80	5290	Ant1	5460	-50.48	3.47	-	48.22	Peak	74	Pass
NVNT	ax80	5290	Ant1	5460	-58.12	3.47	0.25	40.83	Average	54	Pass
NVNT	ax80	5290	Ant1	4500	-51.29	3.47	-	47.41	Peak	74	Pass
NVNT	ax80	5290	Ant1	4500	-58.76	3.47	0.25	40.19	Average	54	Pass
NVNT	ax80	5290	Ant1	5115.96	-47.07	3.47	-	51.63	Peak	74	Pass
NVNT	ax80	5290	Ant1	5141.19	-56.15	3.47	0.25	42.80	Average	54	Pass
NVNT	ax80	5290	Ant1	5150	-48.48	3.47	-	50.22	Peak	74	Pass
NVNT	ax80	5290	Ant1	5150	-56.84	3.47	0.25	42.11	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5260MHz Ant1 Peak

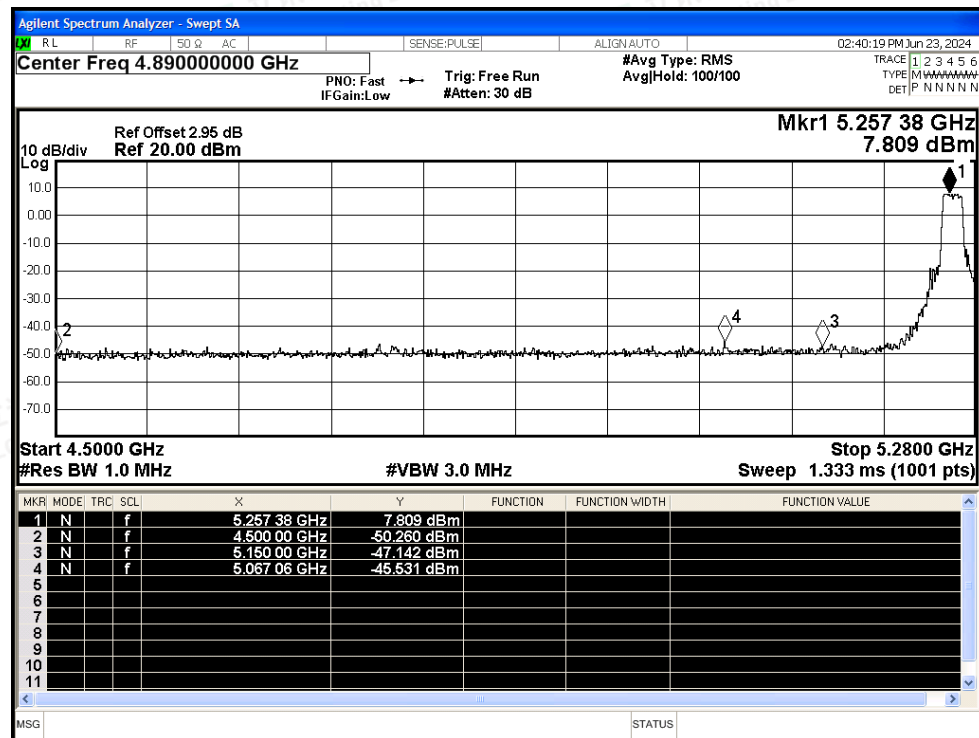

Restrict Band NVNT a 5260MHz Ant1 Average

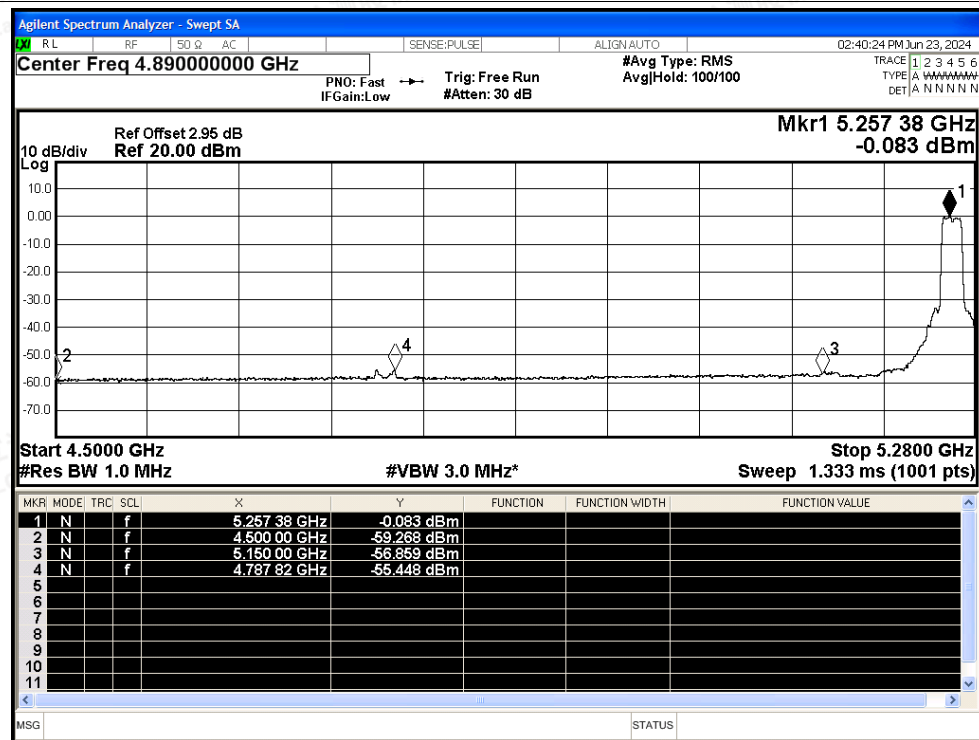

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5320MHz Ant1 Peak

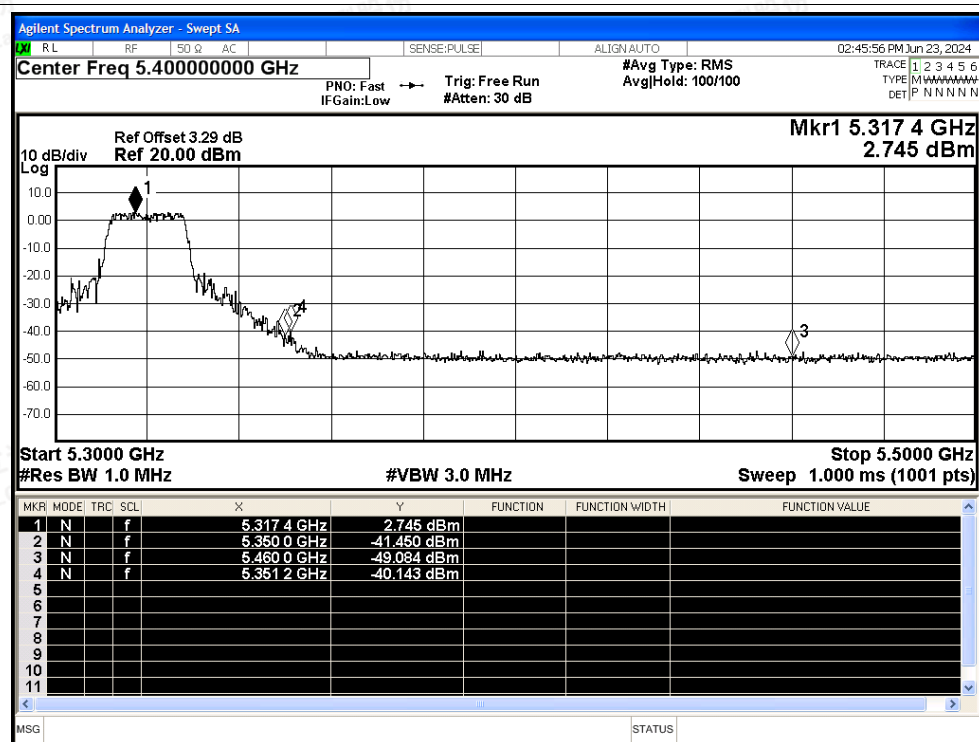

Restrict Band NVNT a 5320MHz Ant1 Average

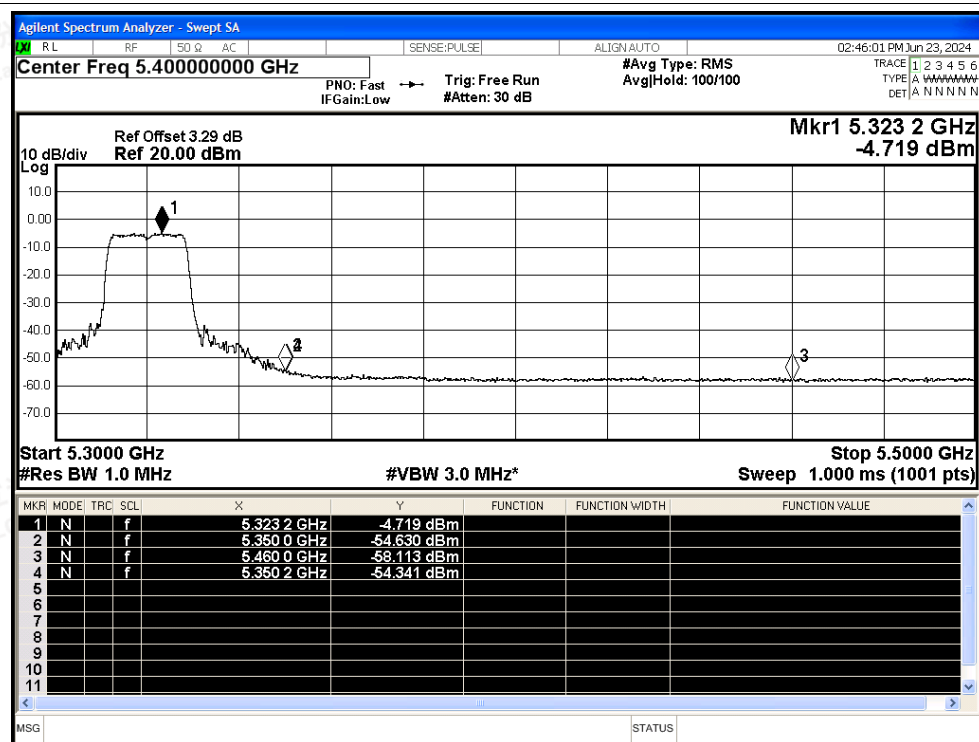

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5260MHz Ant1 Peak

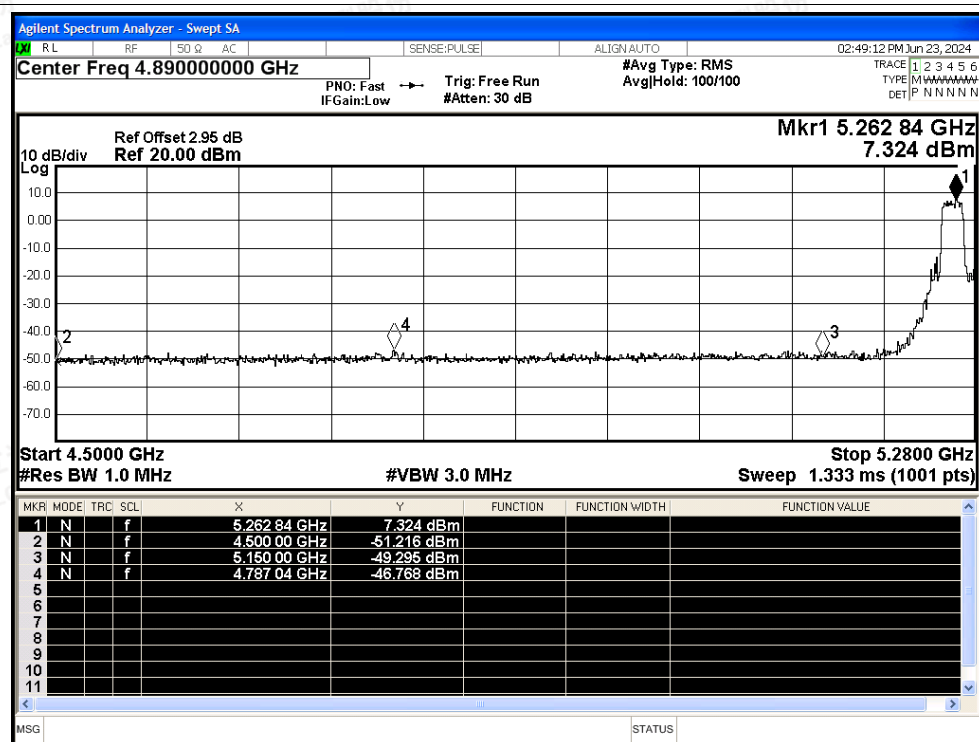

Restrict Band NVNT n20 5260MHz Ant1 Average

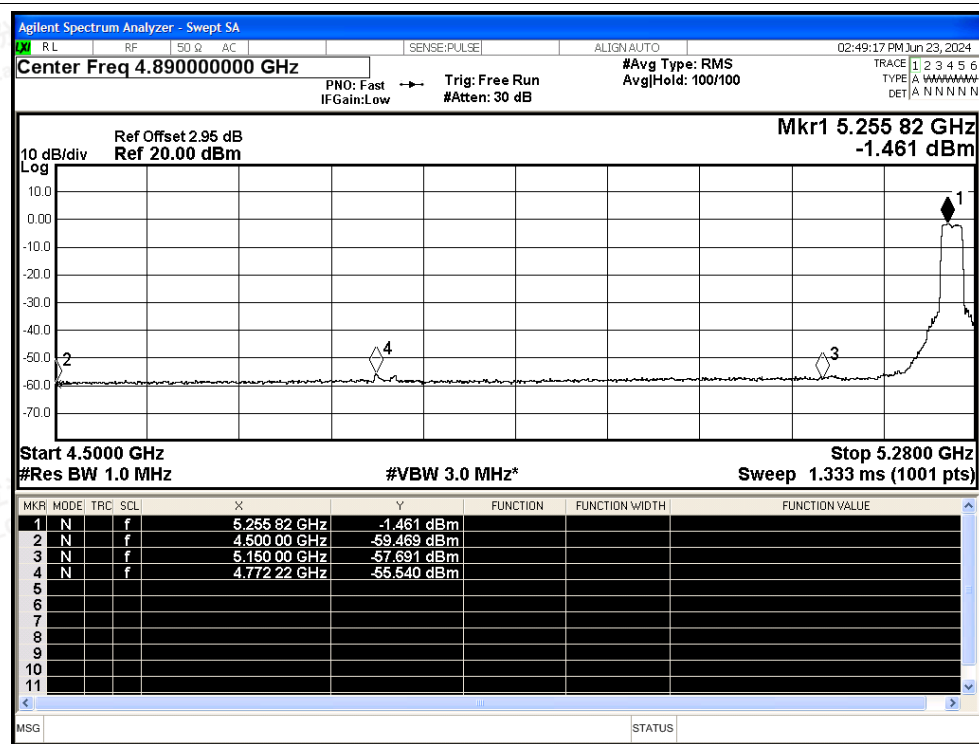

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5320MHz Ant1 Peak

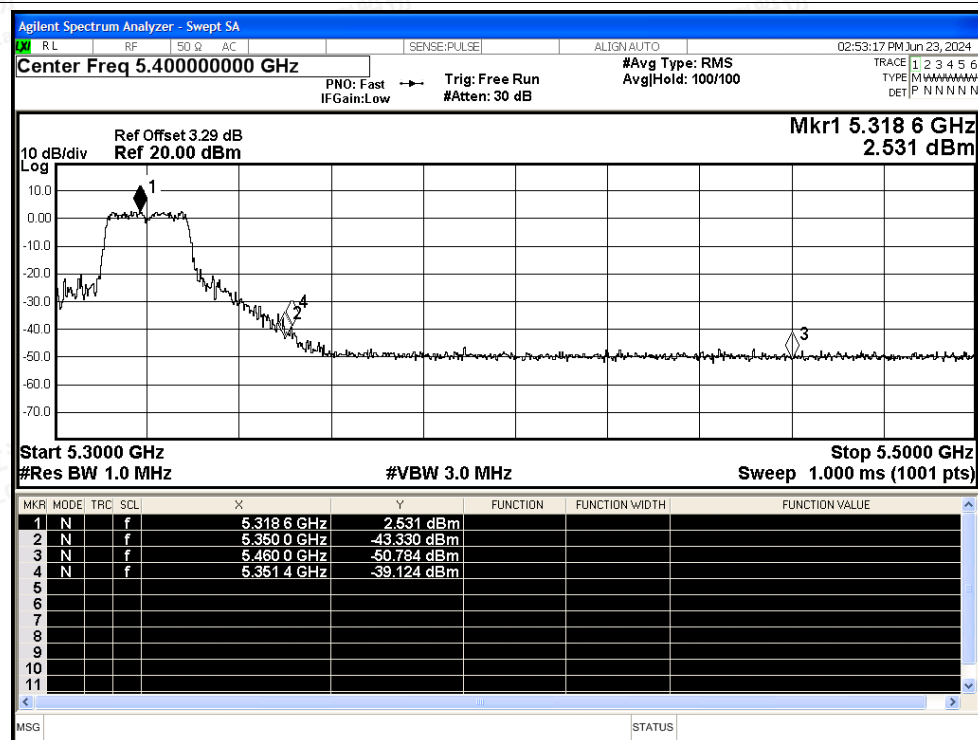

Restrict Band NVNT n20 5320MHz Ant1 Average

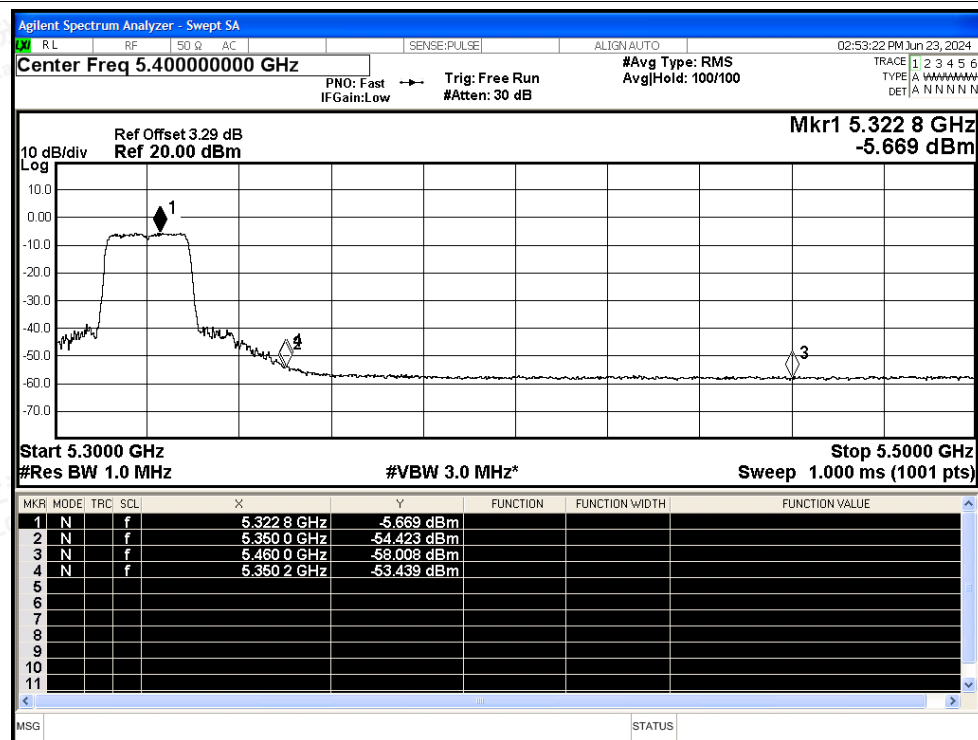

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5270MHz Ant1 Peak

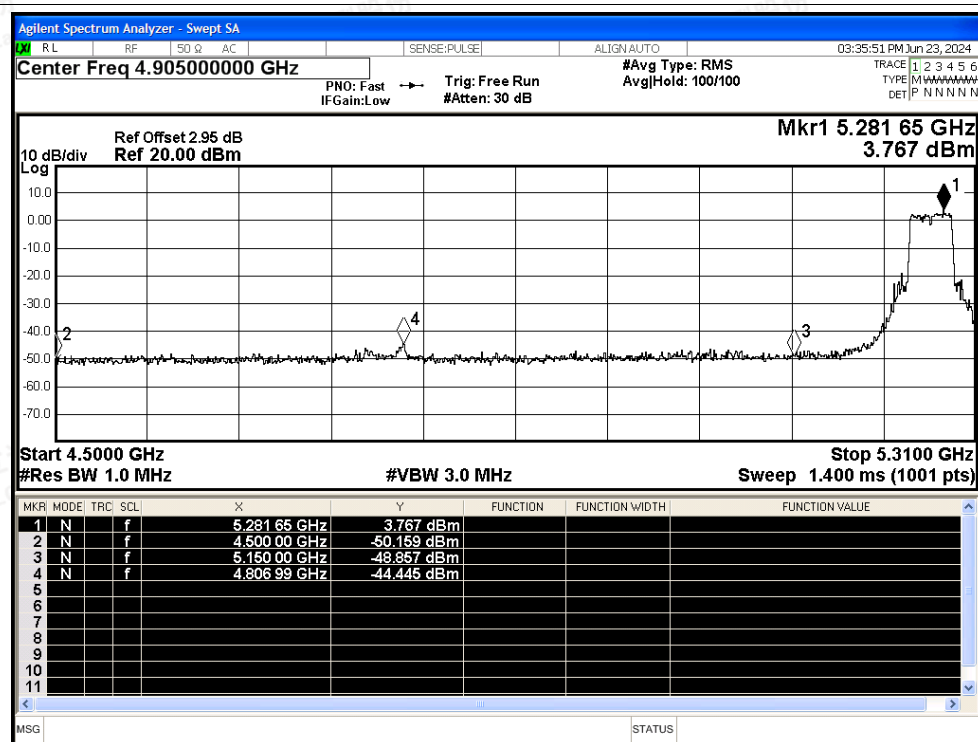

Restrict Band NVNT n40 5270MHz Ant1 Average

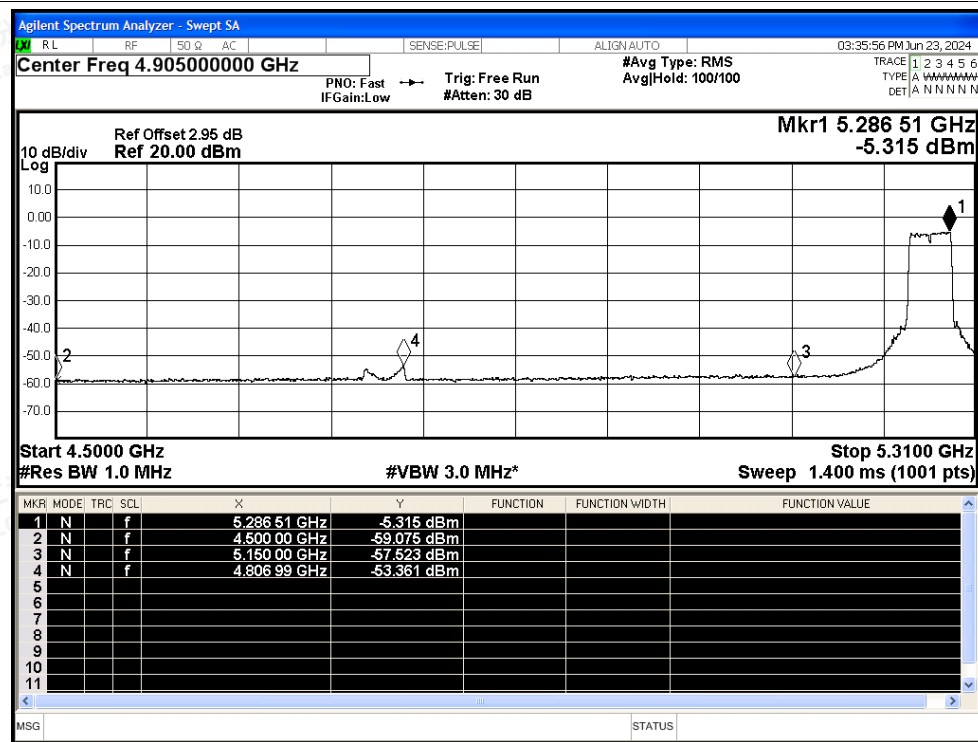

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5310MHz Ant1 Peak

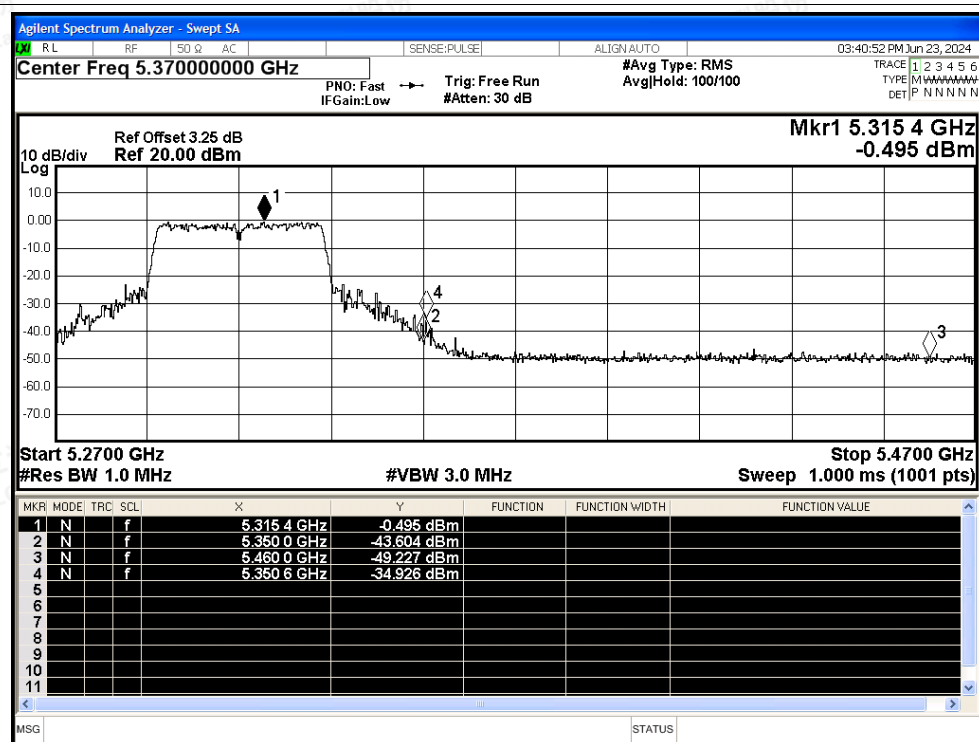

Restrict Band NVNT n40 5310MHz Ant1 Average

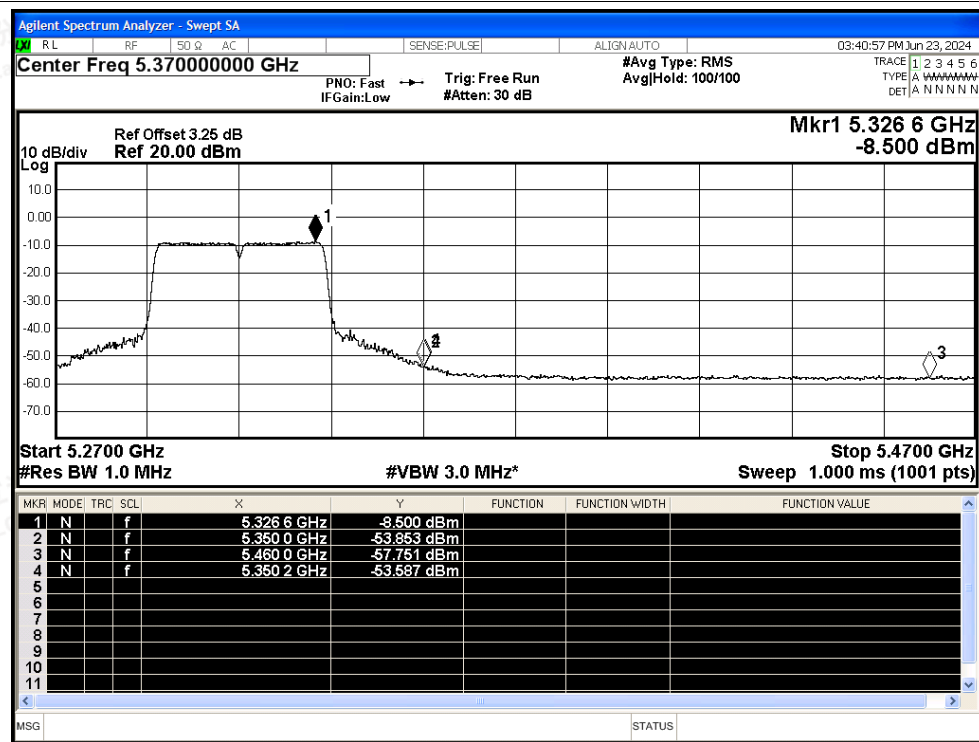

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5260MHz Ant1 Peak

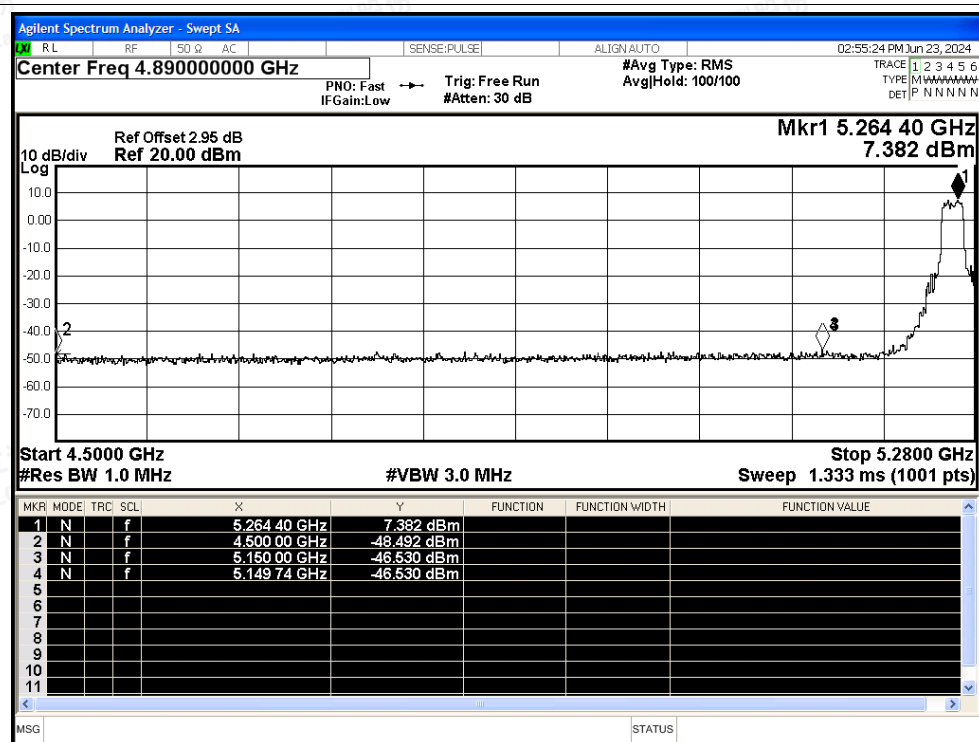

Restrict Band NVNT ac20 5260MHz Ant1 Average

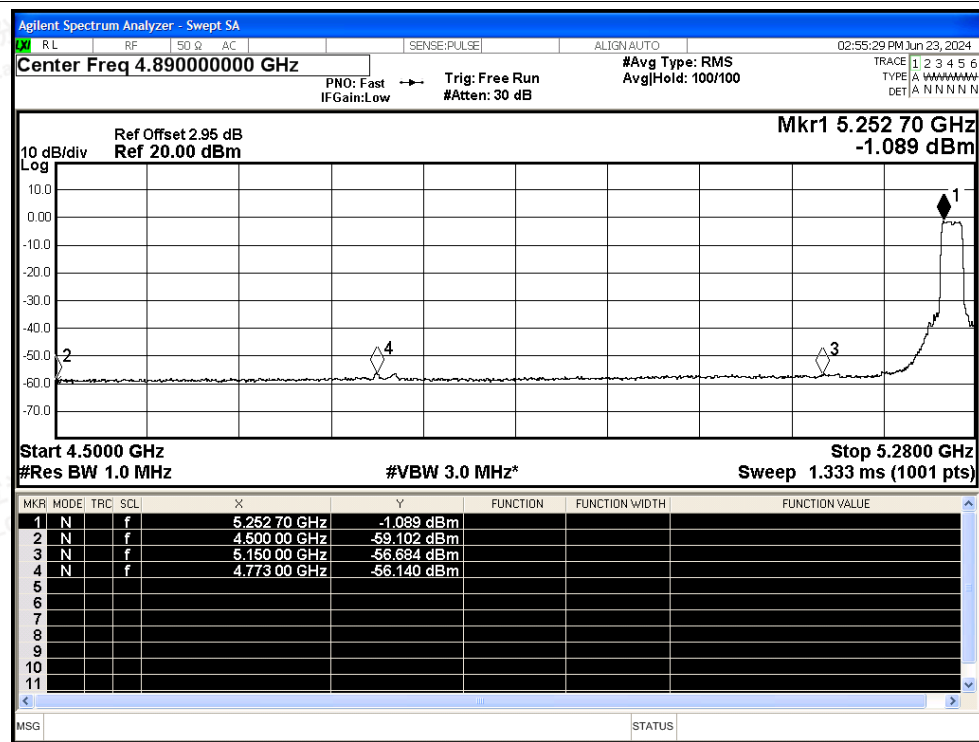

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5320MHz Ant1 Peak

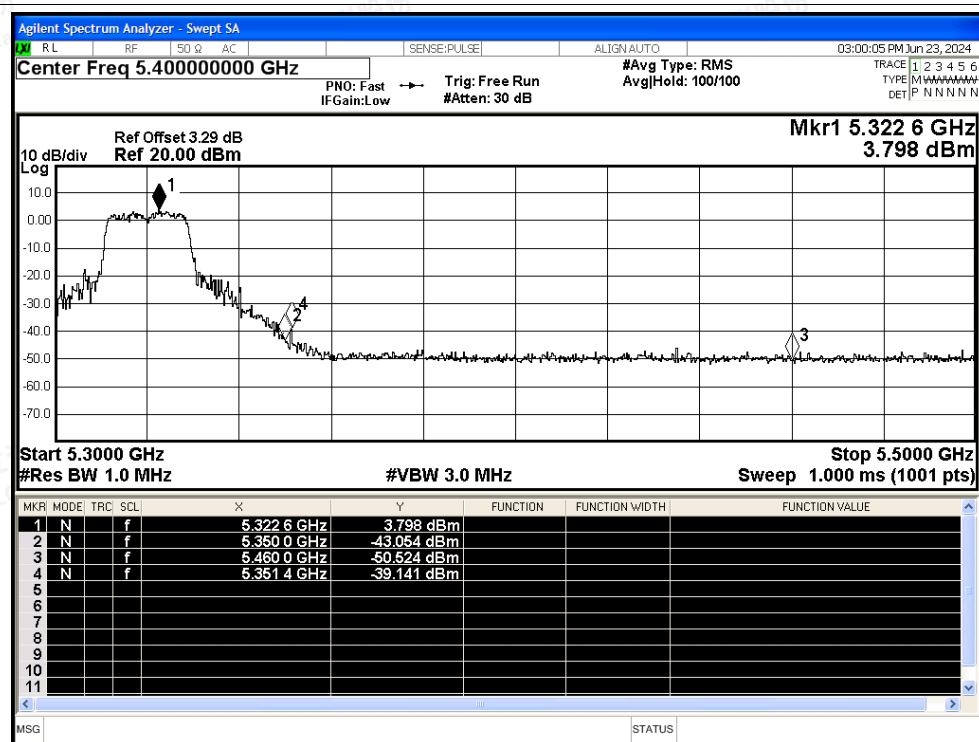

Restrict Band NVNT ac20 5320MHz Ant1 Average

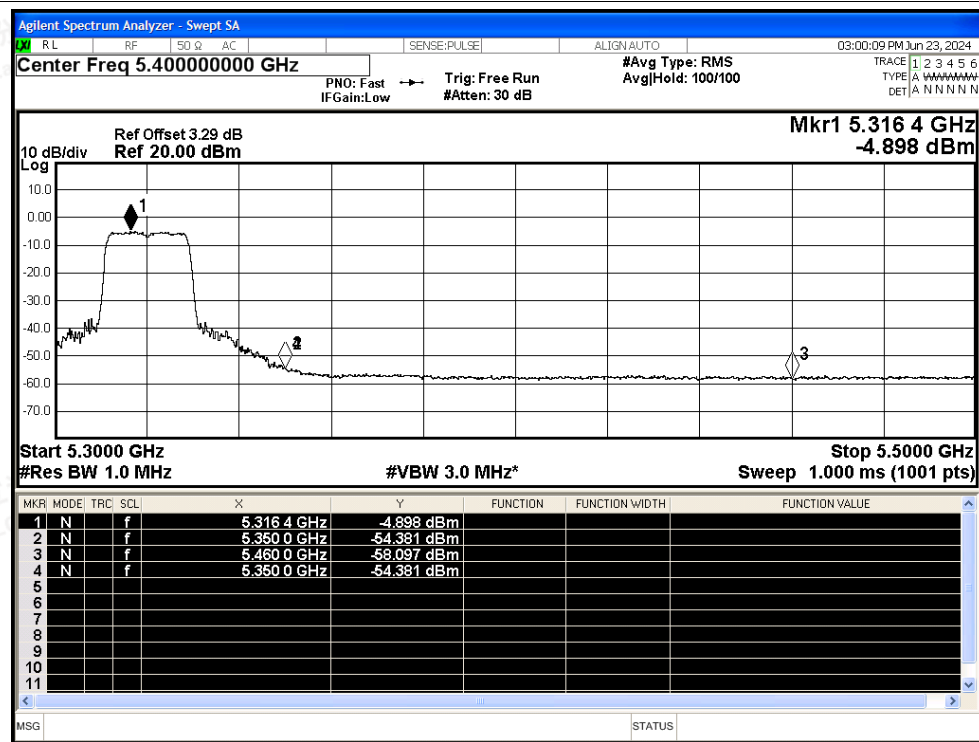

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5270MHz Ant1 Peak

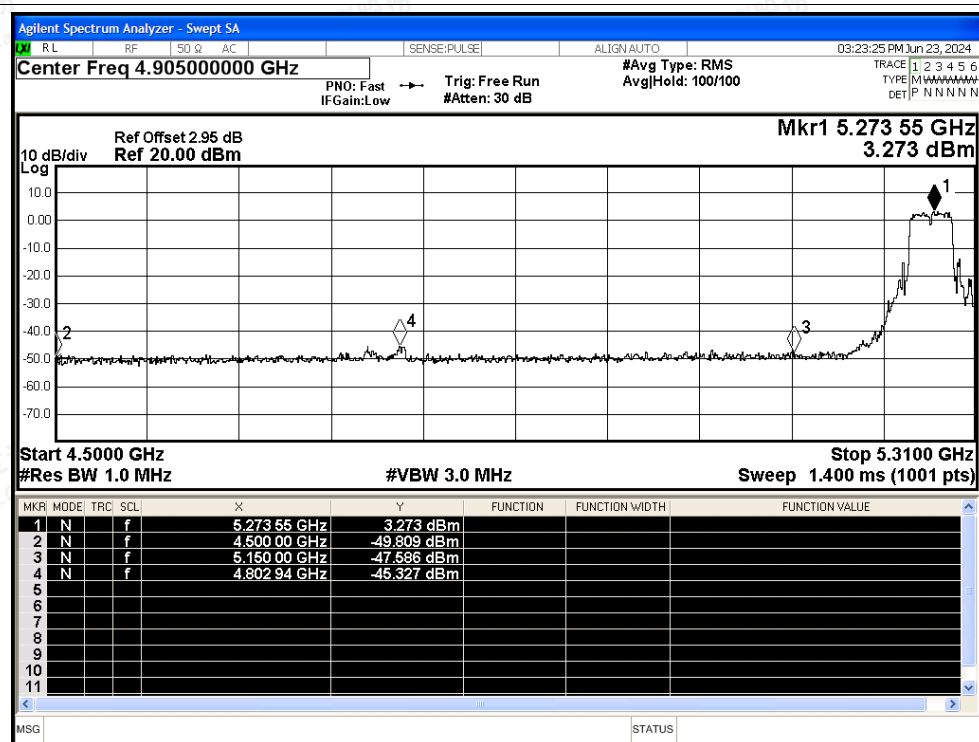

Restrict Band NVNT ac40 5270MHz Ant1 Average

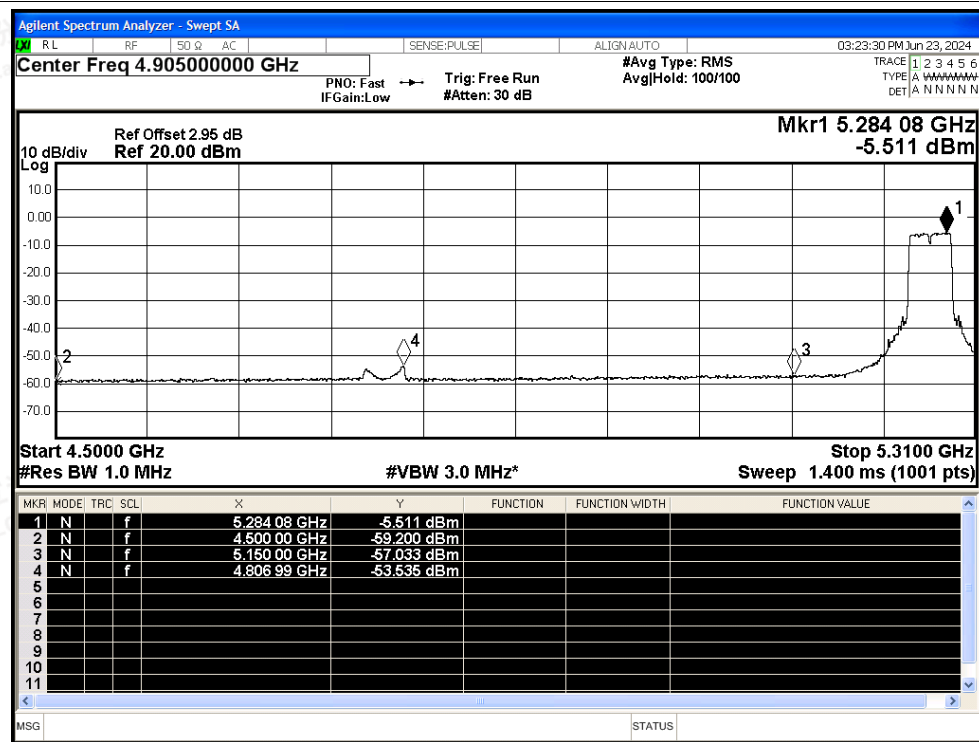

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5310MHz Ant1 Peak

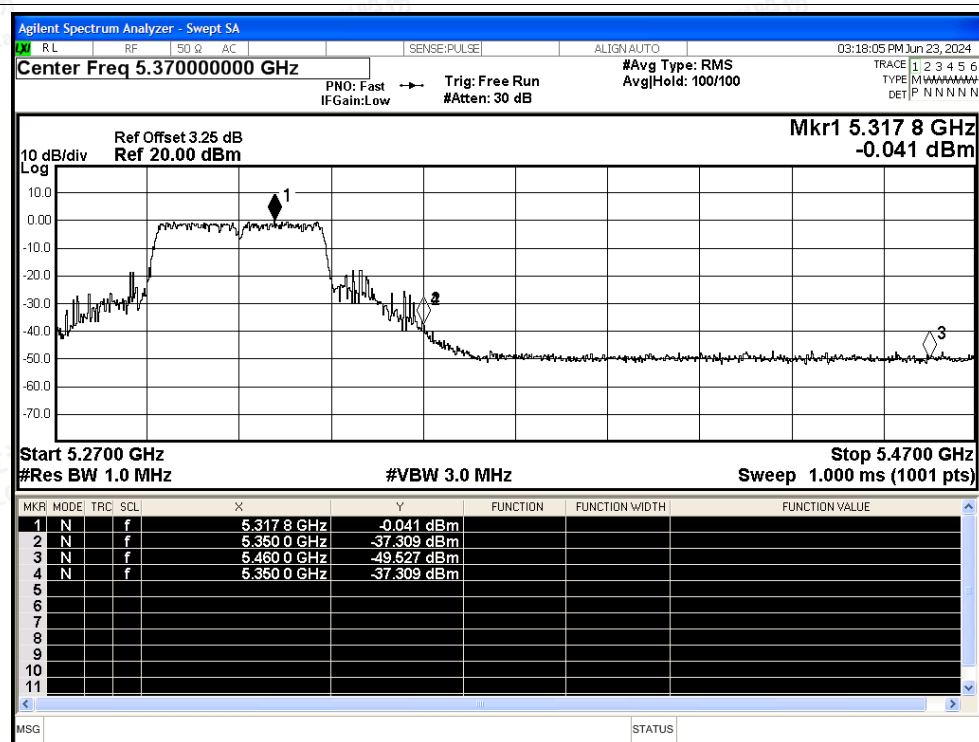

Restrict Band NVNT ac40 5310MHz Ant1 Average

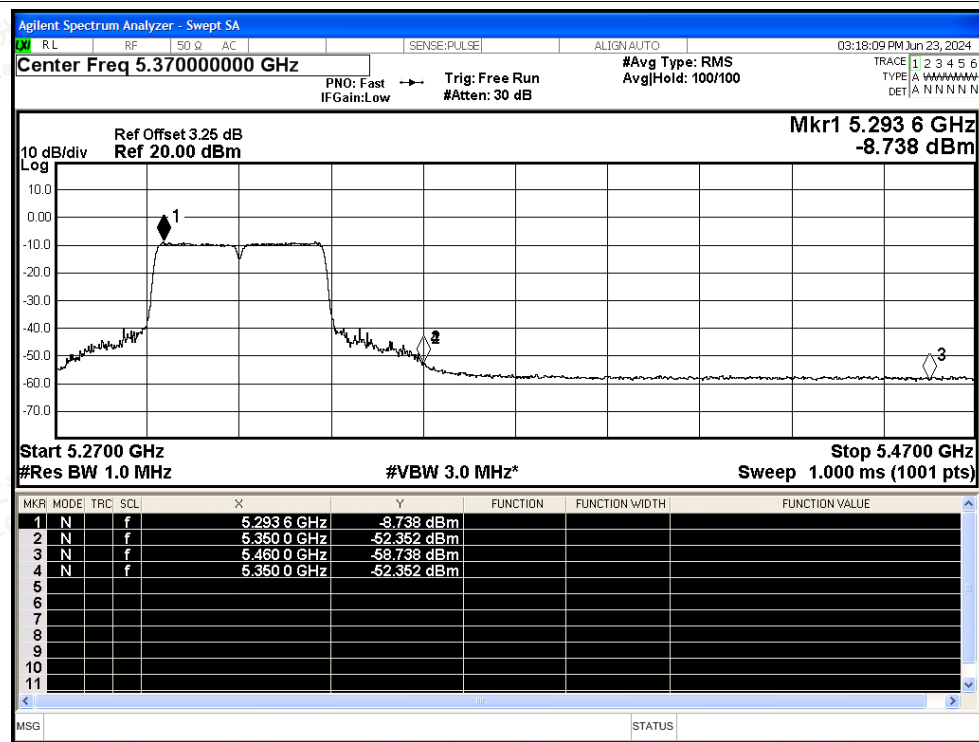

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5290MHz Ant1 Peak

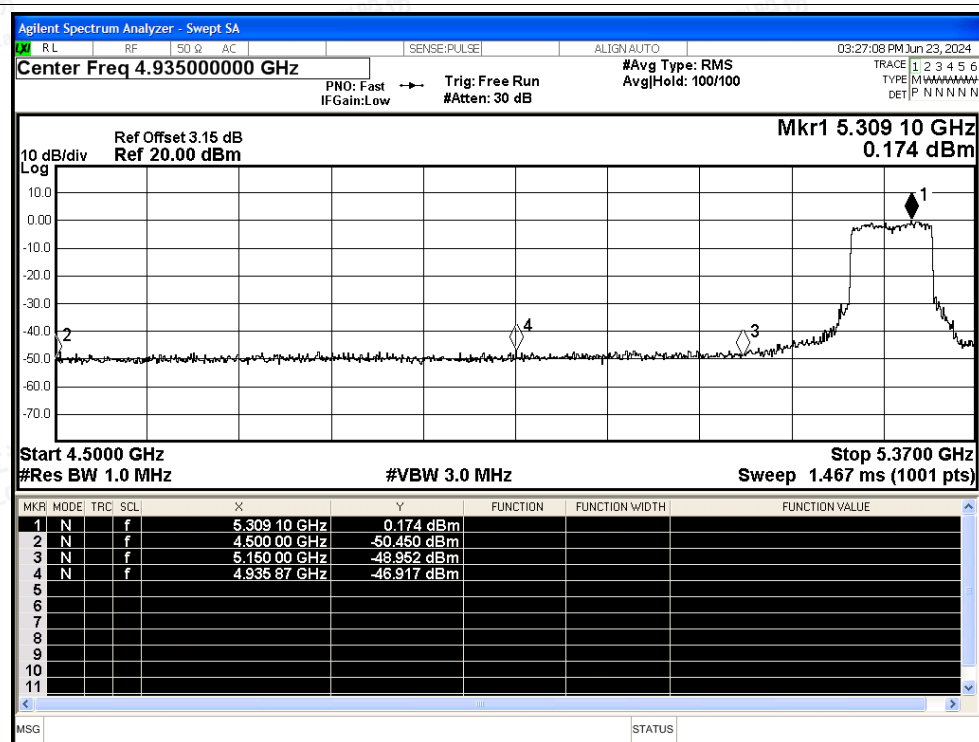

Restrict Band NVNT ac80 5290MHz Ant1 Average

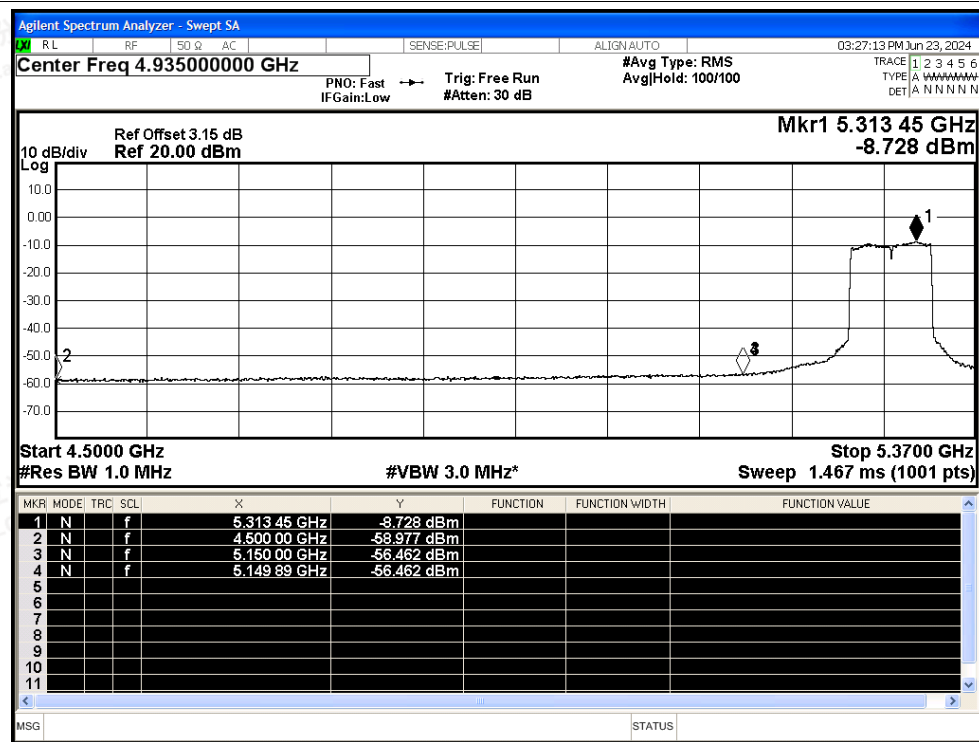

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5290MHz Ant1 Peak

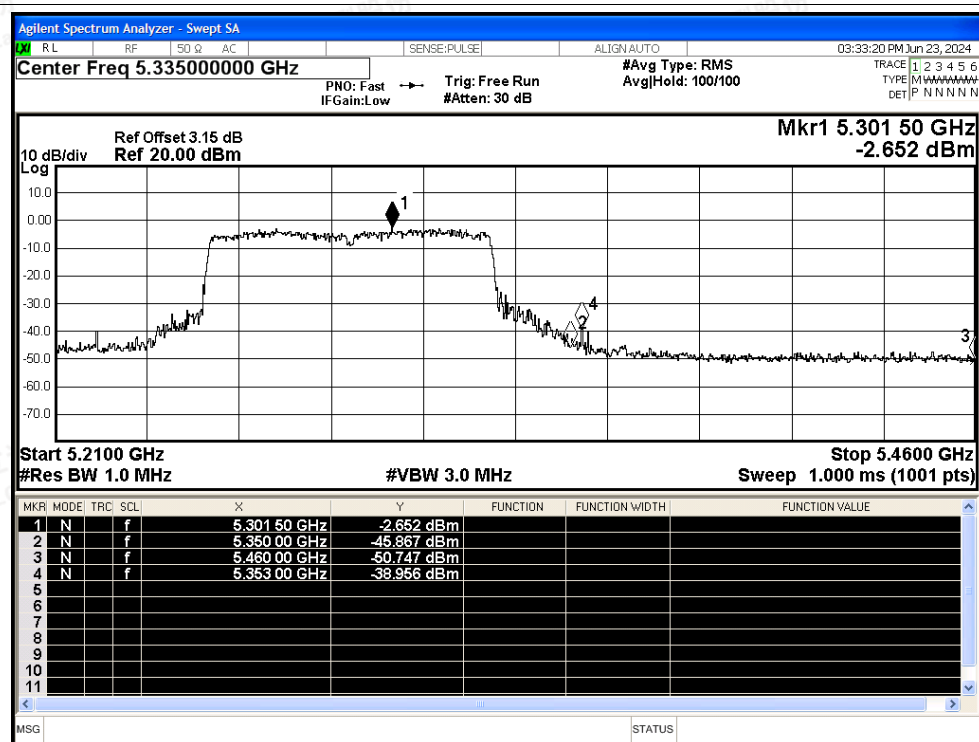

Restrict Band NVNT ac80 5290MHz Ant1 Average

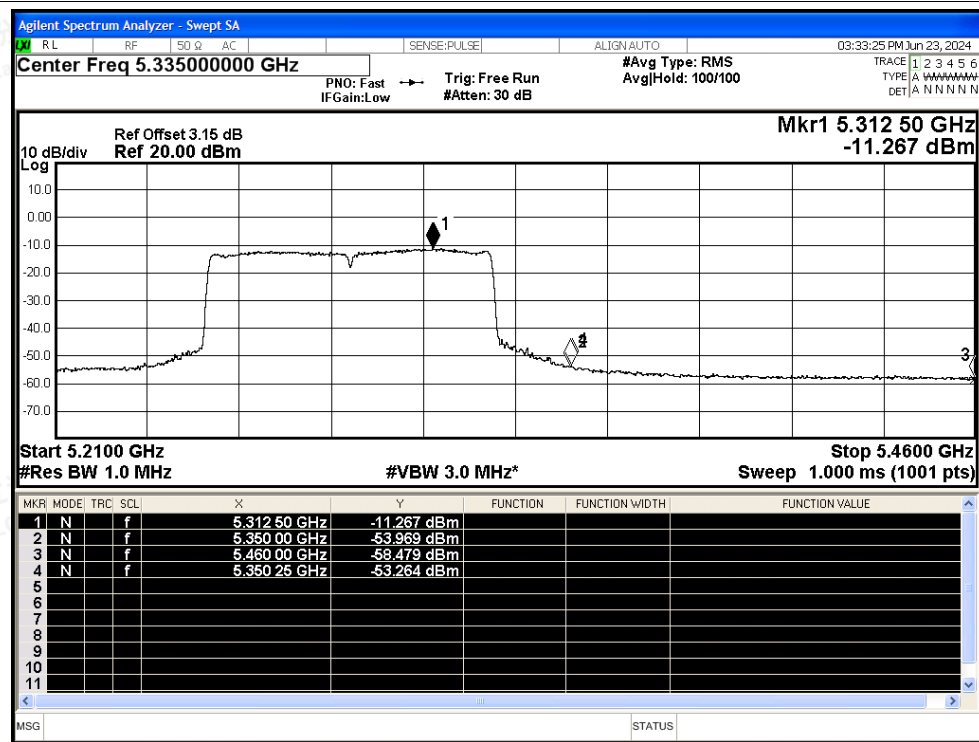

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5260MHz Ant1 Peak

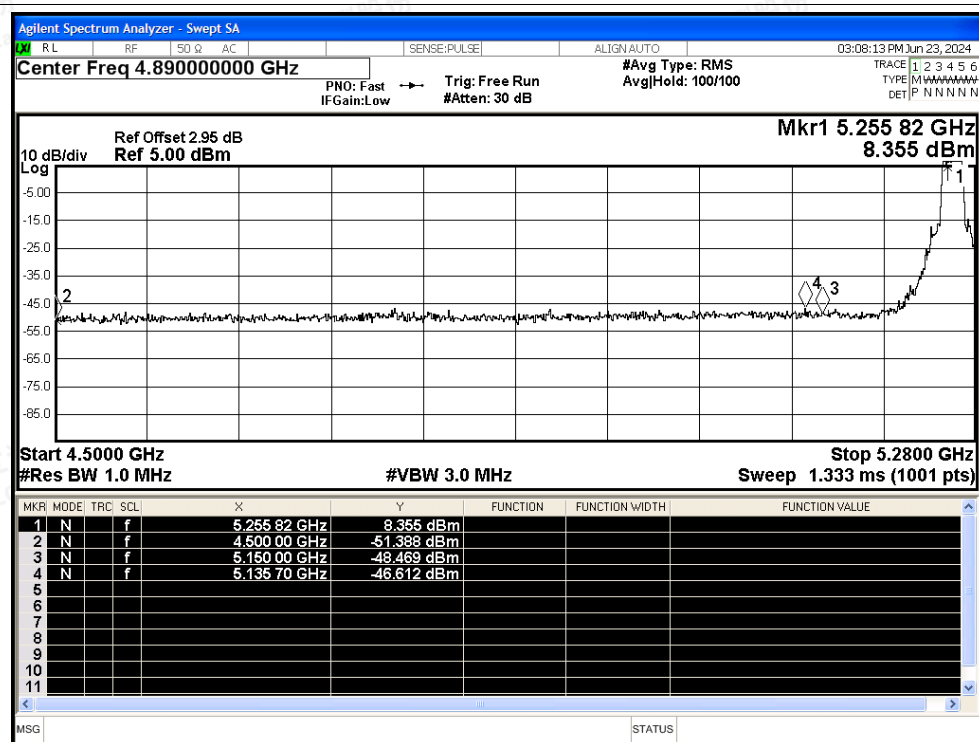

Restrict Band NVNT ax20 5260MHz Ant1 Average

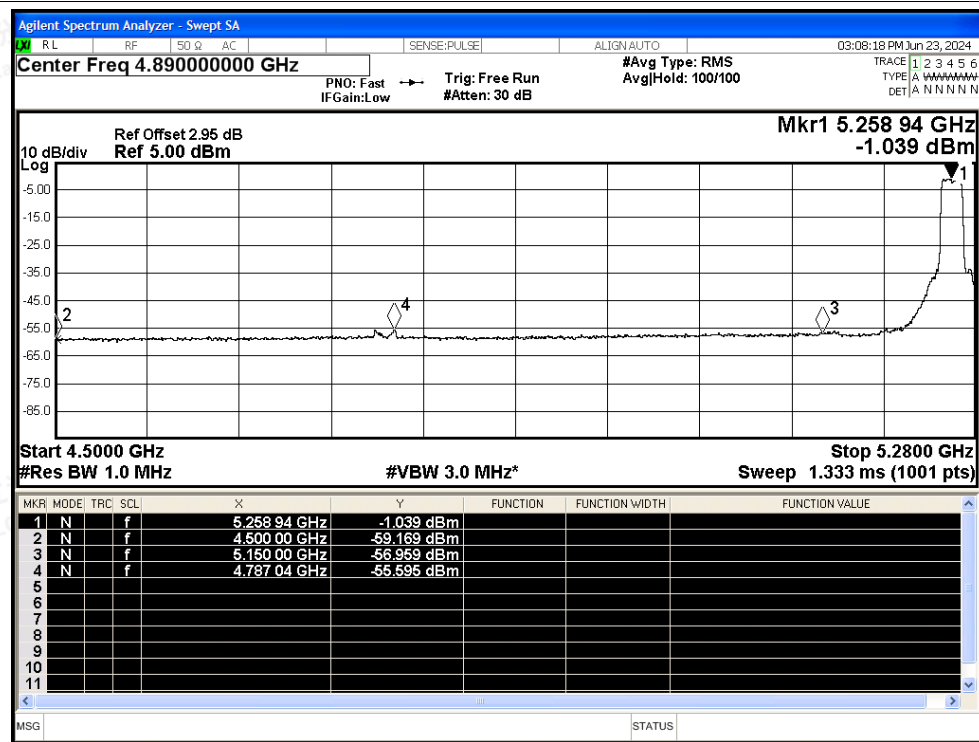

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5320MHz Ant1 Peak

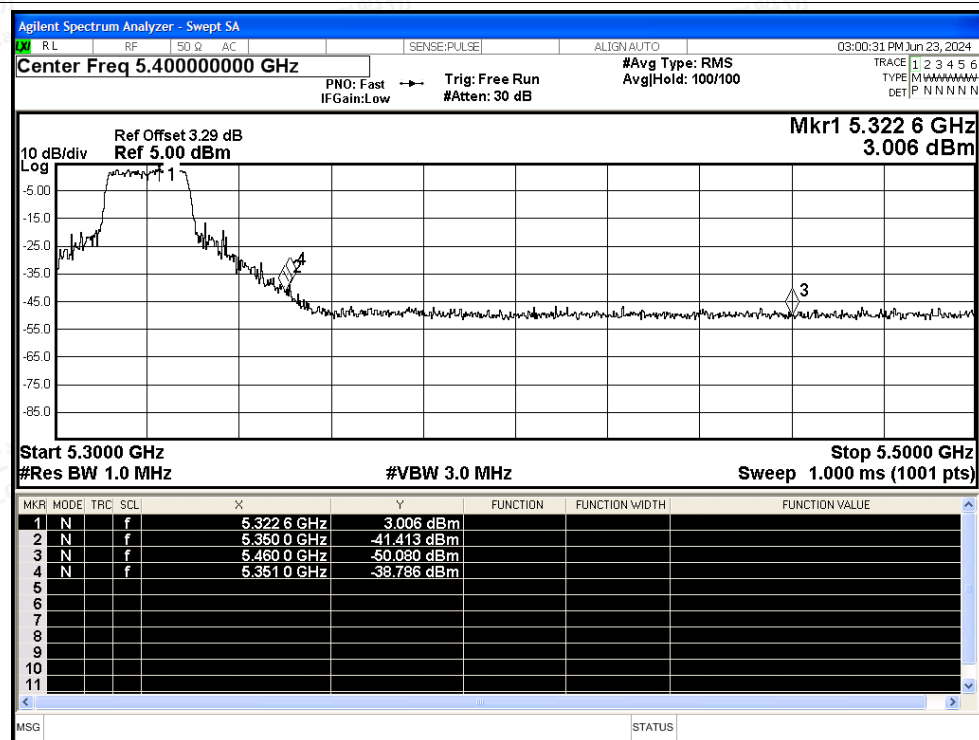

Restrict Band NVNT ax20 5320MHz Ant1 Average

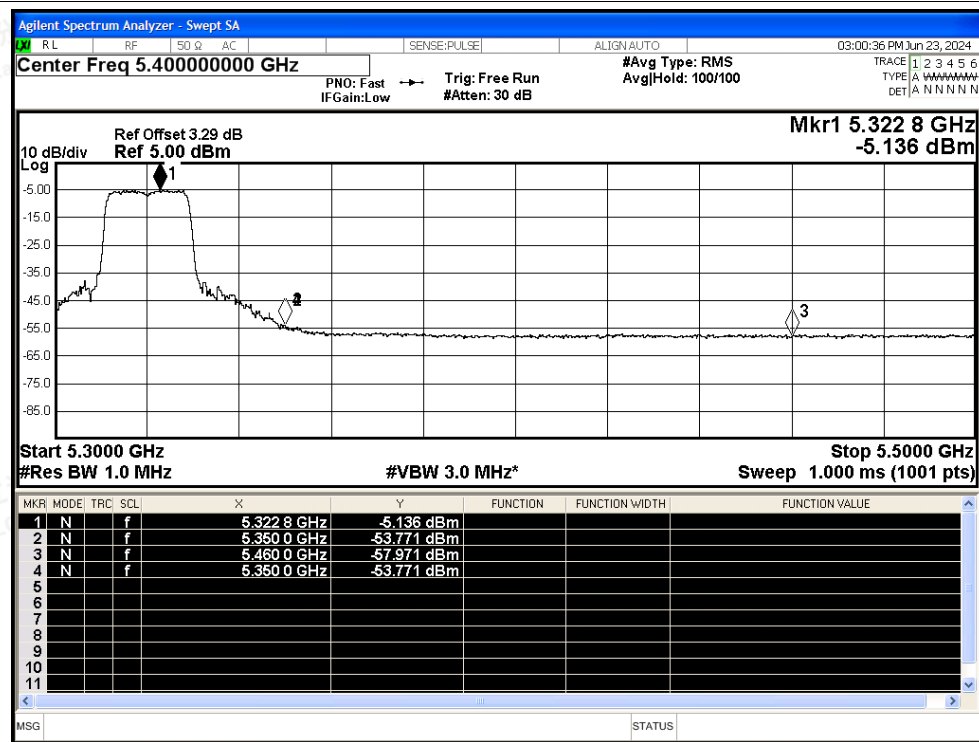

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5270MHz Ant1 Peak

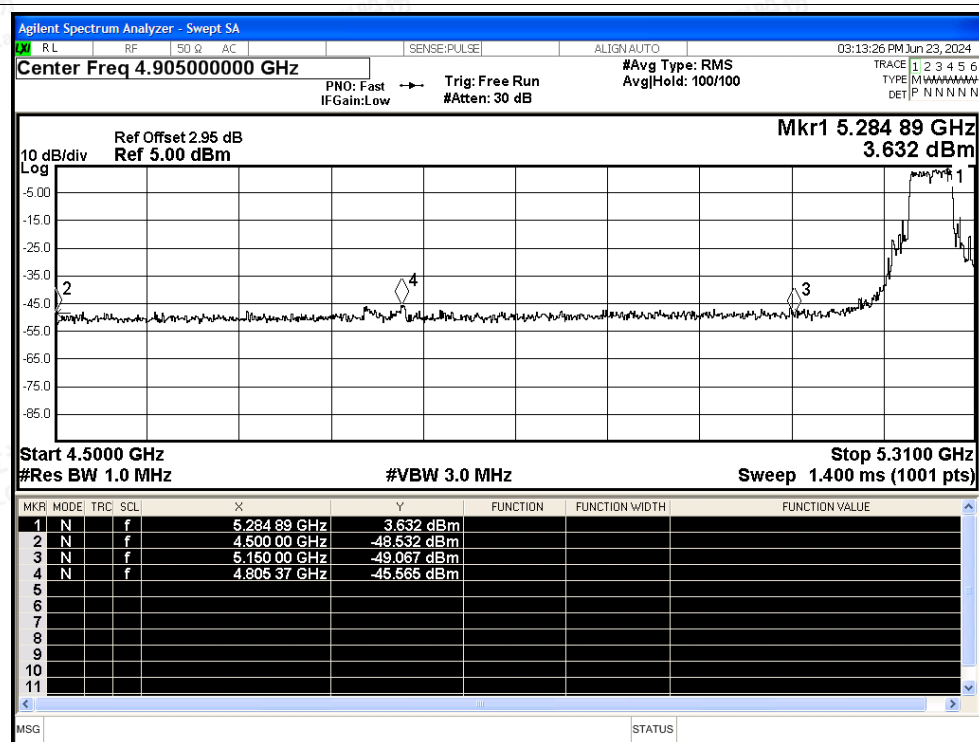

Restrict Band NVNT ax40 5270MHz Ant1 Average

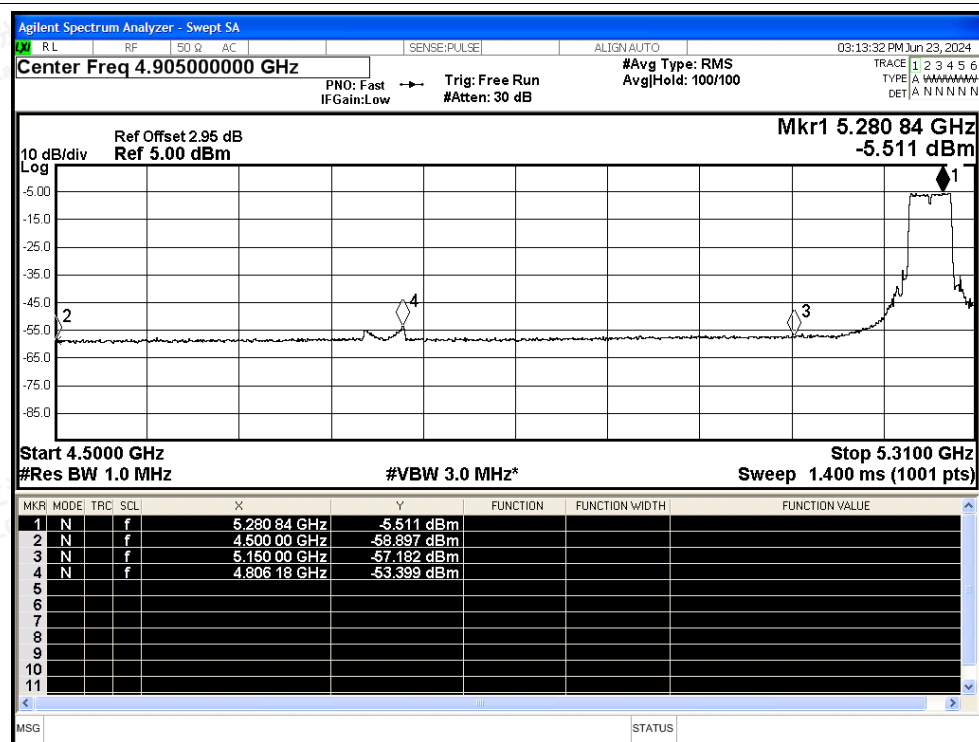

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5310MHz Ant1 Peak

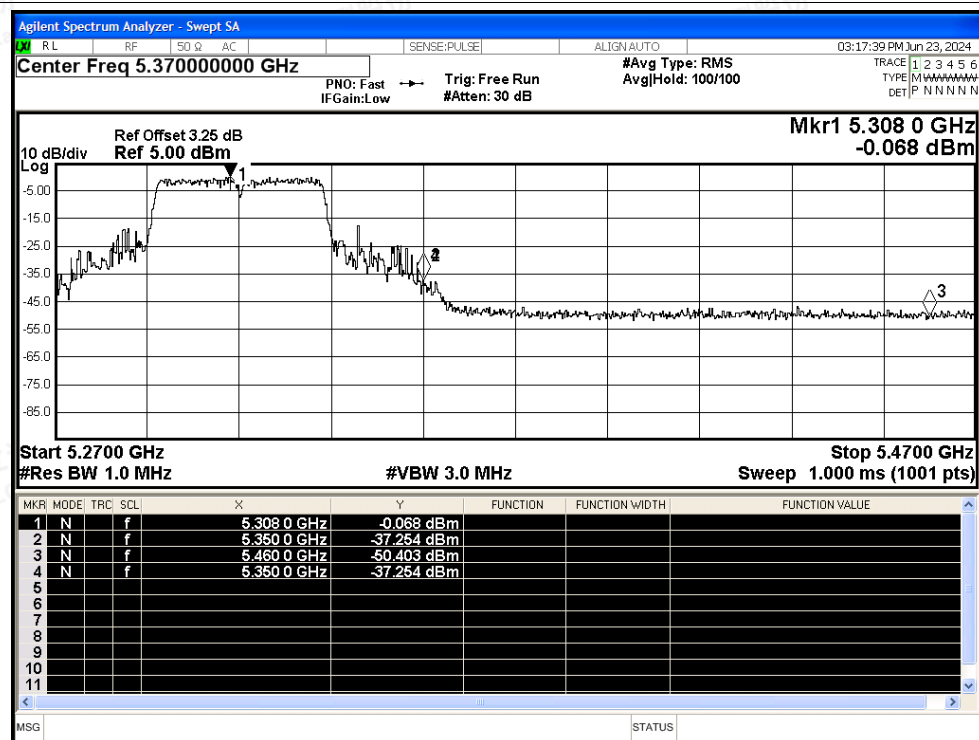

Restrict Band NVNT ax40 5310MHz Ant1 Average

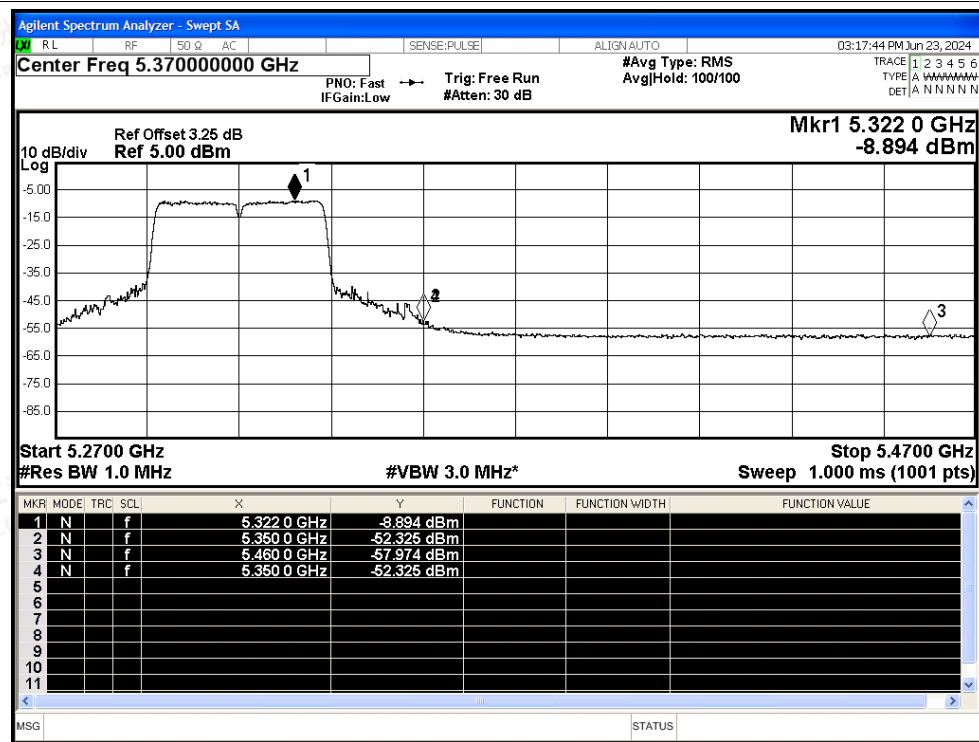

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5290MHz Ant1 Peak

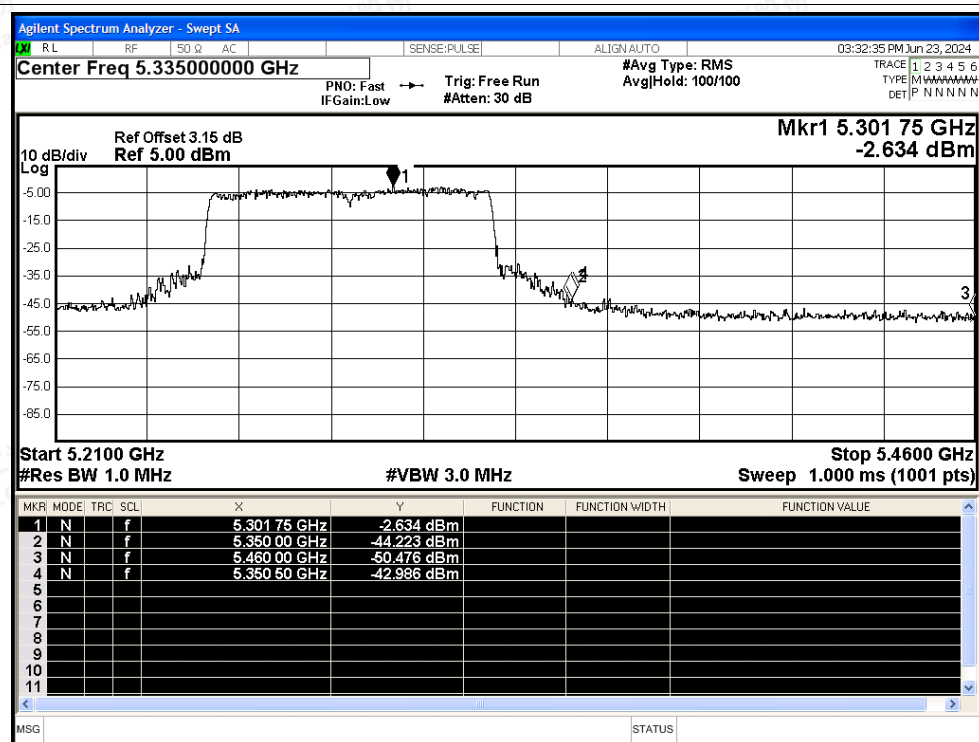

Restrict Band NVNT ax80 5290MHz Ant1 Average

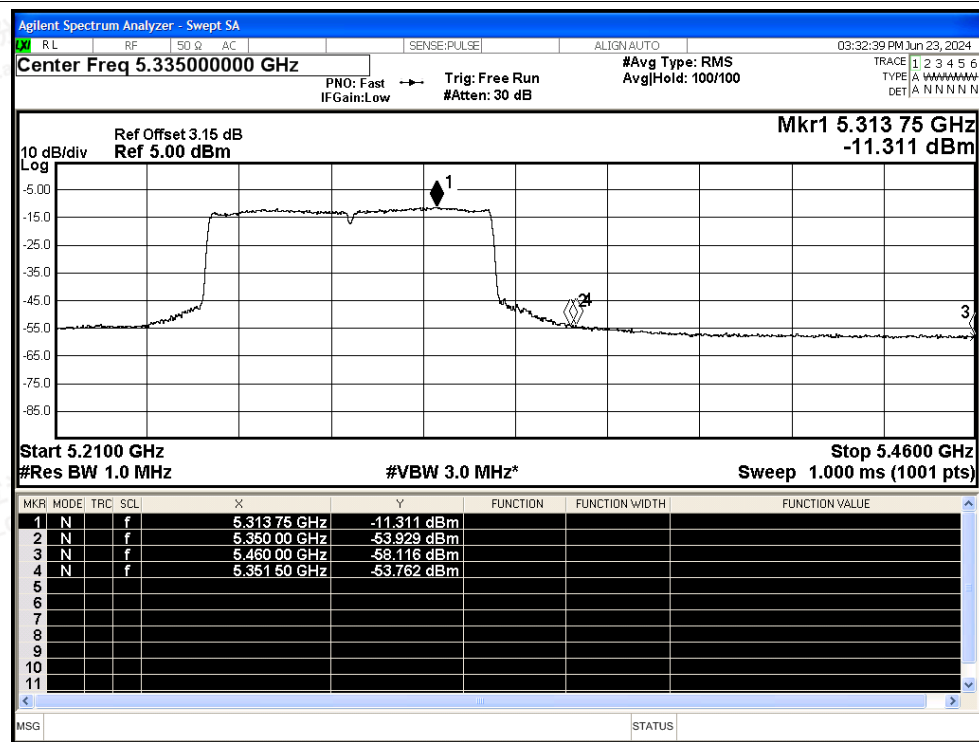

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5290MHz Ant1 Peak

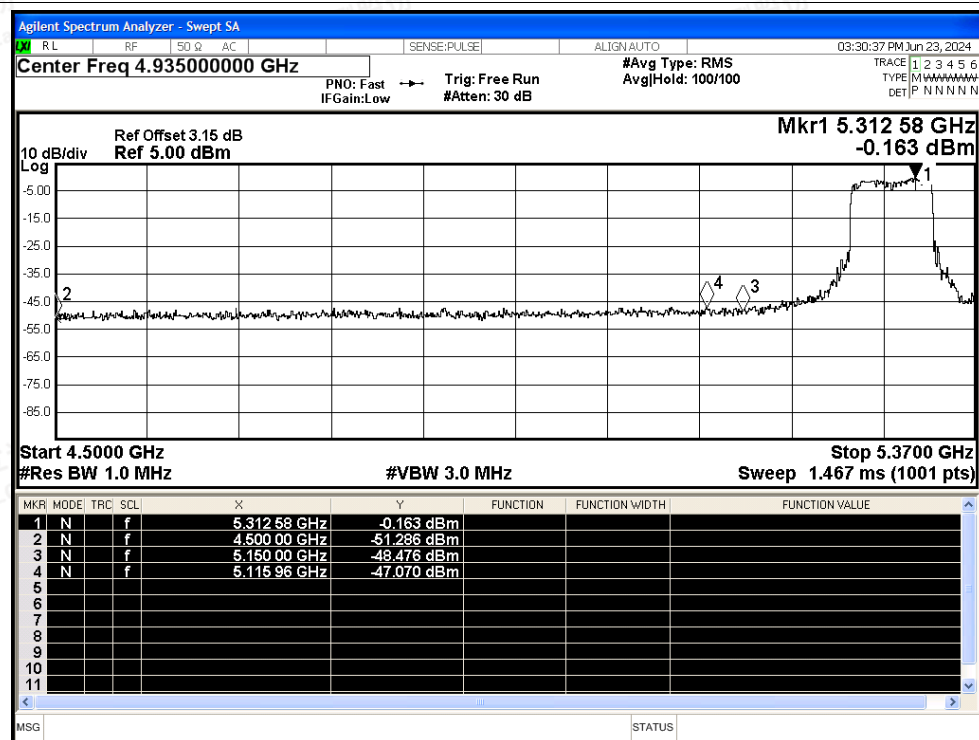

Restrict Band NVNT ax80 5290MHz Ant1 Average

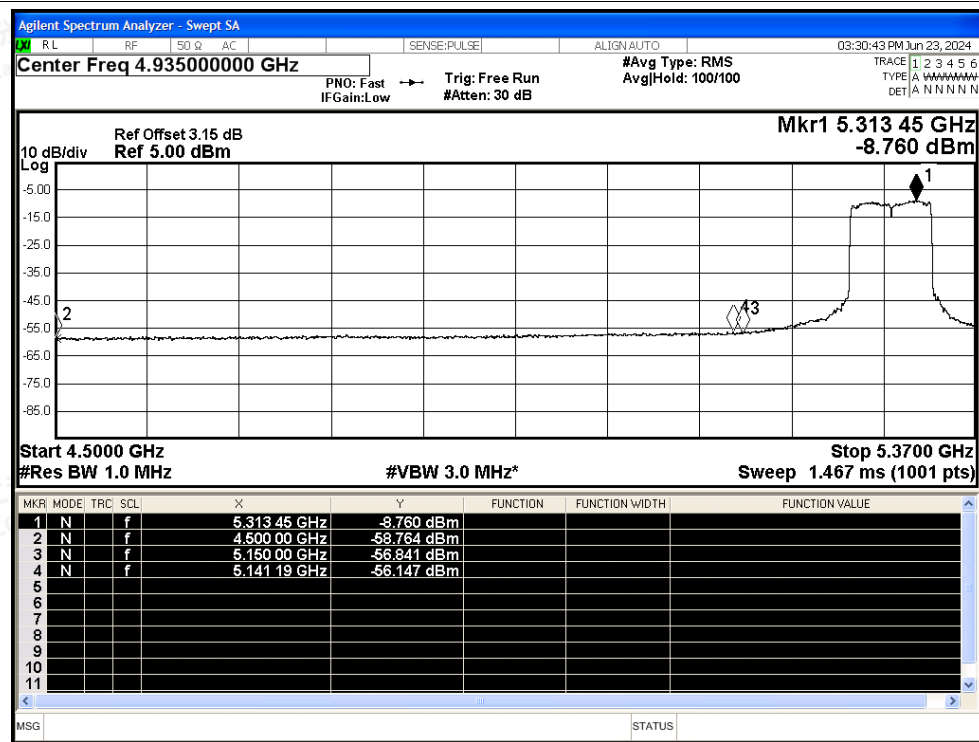

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

**MIMO**

Condition	Mode	Frequency (MHz)	Spur Freq (MHz)	ANT0 Power (dBm)	ANT1 Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5260	4500	-50.56	-51.22	6.48	53.84	Peak	74	Pass
NVNT	n20	5260	4500	-59.41	-59.47	6.48	45.28	Average	54	Pass
NVNT	n20	5260	4773	-45.87	-46.77	6.48	58.42	Peak	74	Pass
NVNT	n20	5260	4788.6	-55.26	-55.54	6.48	49.32	Average	54	Pass
NVNT	n20	5260	5150	-48.74	-49.3	6.48	55.71	Peak	74	Pass
NVNT	n20	5260	5150	-57.05	-57.69	6.48	47.36	Average	54	Pass
NVNT	n20	5320	5350	-39.3	-43.33	6.48	63.85	Peak	74	Pass
NVNT	n20	5320	5350	-51.99	-54.42	6.48	51.68	Average	54	Pass
NVNT	n20	5320	5460	-49.55	-50.78	6.48	54.60	Peak	74	Pass
NVNT	n20	5320	5460	-57.57	-58.01	6.48	46.93	Average	54	Pass
NVNT	n40	5270	4500	-51.18	-50.16	6.48	54.08	Peak	74	Pass
NVNT	n40	5270	4500	-59.12	-59.08	6.48	45.62	Average	54	Pass
NVNT	n40	5270	4807.8	-45.22	-44.45	6.48	59.90	Peak	74	Pass
NVNT	n40	5270	4806.99	-53.16	-53.36	6.48	51.46	Average	54	Pass
NVNT	n40	5270	5150	-49.51	-48.86	6.48	55.55	Peak	74	Pass
NVNT	n40	5270	5150	-57.11	-57.52	6.48	47.41	Average	54	Pass
NVNT	n40	5310	5350	-42.57	-43.6	6.48	61.66	Peak	74	Pass
NVNT	n40	5310	5350	-53.89	-53.85	6.48	50.85	Average	54	Pass
NVNT	n40	5310	5350.2	-39.54	-34.93	6.48	68.07	Peak	74	Pass
NVNT	n40	5310	5350.8	-53.2	-53.59	6.48	51.33	Average	54	Pass
NVNT	n40	5310	5460	-49.9	-49.23	6.48	55.17	Peak	74	Pass
NVNT	n40	5310	5460	-58.41	-57.75	6.48	46.65	Average	54	Pass
NVNT	ac20	5260	4500	-51.04	-48.49	6.48	55.14	Peak	74	Pass
NVNT	ac20	5260	4500	-59.17	-59.1	6.48	45.58	Average	54	Pass
NVNT	ac20	5260	4773	-46.74	-46.53	6.48	58.08	Peak	74	Pass
NVNT	ac20	5260	4787.04	-55.17	-56.14	6.48	49.09	Average	54	Pass
NVNT	ac20	5260	5150	-48.98	-46.53	6.48	57.13	Peak	74	Pass
NVNT	ac20	5260	5150	-56.68	-56.68	6.48	48.04	Average	54	Pass
NVNT	ac20	5320	5350	-43.01	-43.05	6.48	61.69	Peak	74	Pass
NVNT	ac20	5320	5350	-54.59	-54.38	6.48	50.23	Average	54	Pass
NVNT	ac20	5320	5352.8	-37.94	-39.14	6.48	66.22	Peak	74	Pass
NVNT	ac20	5320	5350.6	-53.43	-58.1	6.48	49.55	Average	54	Pass
NVNT	ac40	5270	4500	-49.8	-49.81	6.48	54.91	Peak	74	Pass
NVNT	ac40	5270	4500	-58.85	-59.2	6.48	45.70	Average	54	Pass
NVNT	ac40	5270	4803.75	-45.02	-45.33	6.48	59.55	Peak	74	Pass
NVNT	ac40	5270	4806.99	-53.48	-53.54	6.48	51.21	Average	54	Pass
NVNT	ac40	5270	5150	-49.41	-47.59	6.48	56.31	Peak	74	Pass
NVNT	ac40	5270	5150	-56.98	-57.03	6.48	47.71	Average	54	Pass
NVNT	ac40	5310	5350	-38.53	-37.31	6.48	66.84	Peak	74	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5310	5350	-53.25	-52.35	6.48	51.94	Average	54	Pass
NVNT	ac40	5310	5460	-48.67	-49.53	6.48	55.64	Peak	74	Pass
NVNT	ac40	5310	5460	-57.86	-58.74	6.48	46.44	Average	54	Pass
NVNT	ac80	5290	4500	-49.64	-50.45	6.48	54.69	Peak	74	Pass
NVNT	ac80	5290	4500	-59.47	-58.98	6.48	45.50	Average	54	Pass
NVNT	ac80	5290	5100.3	-46.5	-46.92	6.48	58.01	Peak	74	Pass
NVNT	ac80	5290	5141.19	-55.88	-56.46	6.48	48.56	Average	54	Pass
NVNT	ac80	5290	5150	-48.29	-48.95	6.48	56.11	Peak	74	Pass
NVNT	ac80	5290	5150	-56.18	-56.46	6.48	48.40	Average	54	Pass
NVNT	ac80	5290	5350	-44.67	-45.87	6.48	59.49	Peak	74	Pass
NVNT	ac80	5290	5350	-55.51	-53.97	6.48	50.05	Average	54	Pass
NVNT	ac80	5290	5351.25	-41.1	-38.96	6.48	64.82	Peak	74	Pass
NVNT	ac80	5290	5352.25	-54.7	-53.26	6.48	50.80	Average	54	Pass
NVNT	ac80	5290	5460	-50.38	-50.75	6.48	54.16	Peak	74	Pass
NVNT	ac80	5290	5460	-58.46	-58.48	6.48	46.25	Average	54	Pass
NVNT	ax20	5260	4500	-50.66	-51.39	6.48	53.71	Peak	74	Pass
NVNT	ax20	5260	4500	-59.44	-59.17	6.48	45.41	Average	54	Pass
NVNT	ax20	5260	4772.22	-46.08	-46.61	6.48	58.38	Peak	74	Pass
NVNT	ax20	5260	4787.82	-54.87	-55.6	6.48	49.50	Average	54	Pass
NVNT	ax20	5260	5150	-46.63	-48.47	6.48	57.26	Peak	74	Pass
NVNT	ax20	5260	5150	-56.96	-56.96	6.48	47.76	Average	54	Pass
NVNT	ax20	5320	5350	-42.61	-41.41	6.48	62.75	Peak	74	Pass
NVNT	ax20	5320	5350	-53.04	-53.77	6.48	51.33	Average	54	Pass
NVNT	ax20	5320	5350.8	-38.82	-38.79	6.48	65.91	Peak	74	Pass
NVNT	ax20	5320	5350.4	-52.45	-57.97	6.48	50.33	Average	54	Pass
NVNT	ax40	5270	4500	-51.28	-48.53	6.48	55.03	Peak	74	Pass
NVNT	ax40	5270	4500	-59.07	-58.9	6.48	45.73	Average	54	Pass
NVNT	ax40	5270	4807.8	-44.78	-45.57	6.48	59.56	Peak	74	Pass
NVNT	ax40	5270	4806.99	-52.9	-53.4	6.48	51.58	Average	54	Pass
NVNT	ax40	5270	5150	-49.04	-49.07	6.48	55.66	Peak	74	Pass
NVNT	ax40	5270	5150	-57.66	-57.18	6.48	47.30	Average	54	Pass
NVNT	ax40	5310	5350	-39.05	-37.25	6.48	66.66	Peak	74	Pass
NVNT	ax40	5310	5350	-52.97	-52.33	6.48	52.08	Average	54	Pass
NVNT	ax40	5310	5351.2	-38.47	-50.4	6.48	63.51	Peak	74	Pass
NVNT	ax40	5310	5460	-58.52	-57.97	6.48	46.48	Average	54	Pass
NVNT	ax80	5290	5350	-41.76	-44.22	6.48	61.90	Peak	74	Pass
NVNT	ax80	5290	5350	-54.84	-53.93	6.48	50.36	Average	54	Pass
NVNT	ax80	5290	5460	-49.09	-50.48	6.48	54.99	Peak	74	Pass
NVNT	ax80	5290	5460	-58.31	-58.12	6.48	46.50	Average	54	Pass
NVNT	ax80	5290	4500	-49.26	-51.29	6.48	54.56	Peak	74	Pass
NVNT	ax80	5290	4500	-58.29	-58.76	6.48	46.20	Average	54	Pass
NVNT	ax80	5290	5073.33	-46.41	-47.07	6.48	57.99	Peak	74	Pass
NVNT	ax80	5290	5143.8	-55.93	-56.15	6.48	48.68	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax80	5290	5150	-47.94	-48.48	6.48	56.52	Peak	74	Pass
NVNT	ax80	5290	5150	-55.93	-56.84	6.48	48.36	Average	54	Pass





E.5 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	ac20	5260	Ant0	5260	0	0	25	Pass
NVNT	ac20	5300	Ant0	5300	0	0	25	Pass
NVNT	ac20	5320	Ant0	5319.98	-20000	-3.76	25	Pass
NVNT	ac40	5270	Ant0	5270	0	0	25	Pass
NVNT	ac40	5310	Ant0	5310	0	0	25	Pass
NVNT	ac80	5290	Ant0	5290	0	0	25	Pass
NVNT	ax20	5260	Ant0	5259.98	-20000	-3.8	25	Pass
NVNT	ax20	5300	Ant0	5299.98	-20000	-3.77	25	Pass
NVNT	ax20	5320	Ant0	5319.98	-20000	-3.76	25	Pass
NVNT	ax40	5270	Ant0	5270	0	0	25	Pass
NVNT	ax40	5310	Ant0	5310	0	0	25	Pass
NVNT	ax80	5290	Ant0	5290	0	0	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT ac20 5260MHz Ant0

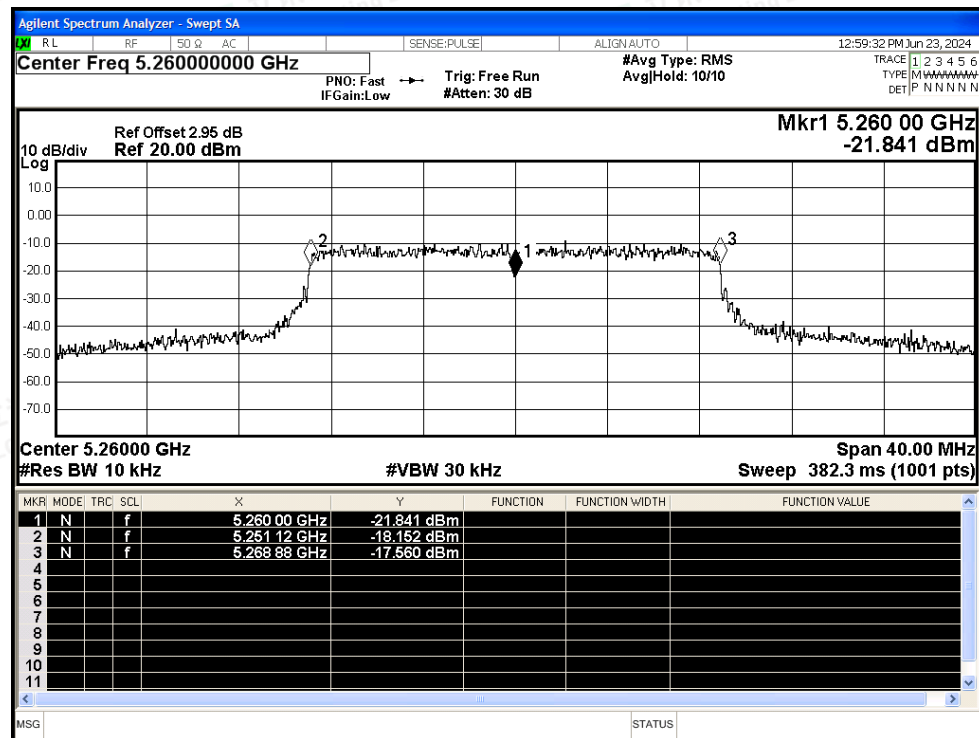

Freq. Stability NVNT ac20 5300MHz Ant0

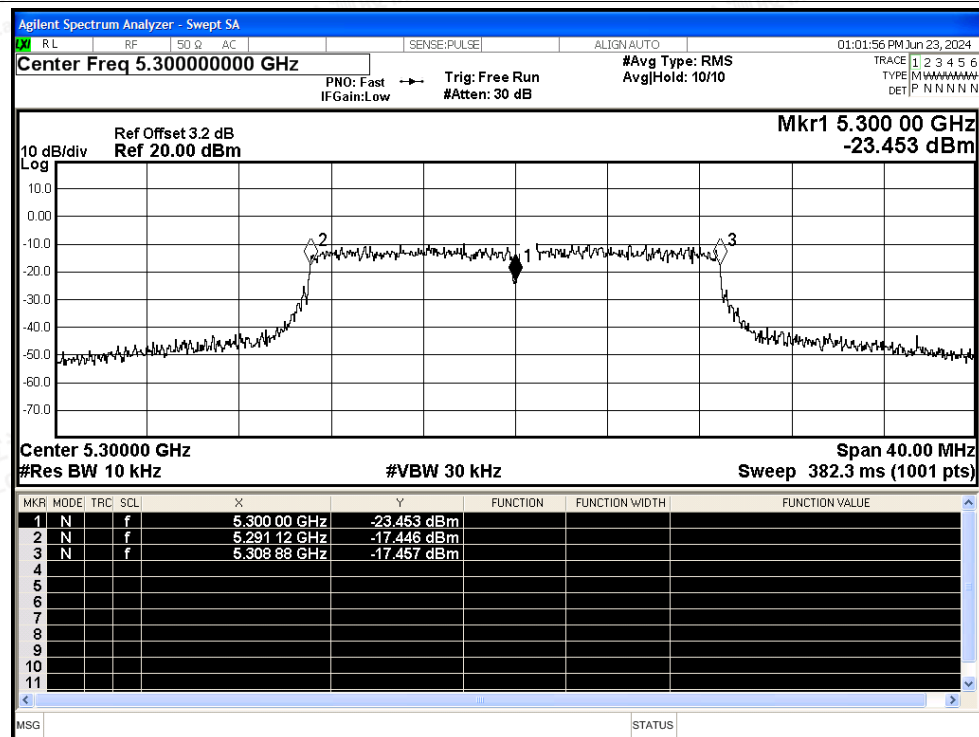

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5320MHz Ant0

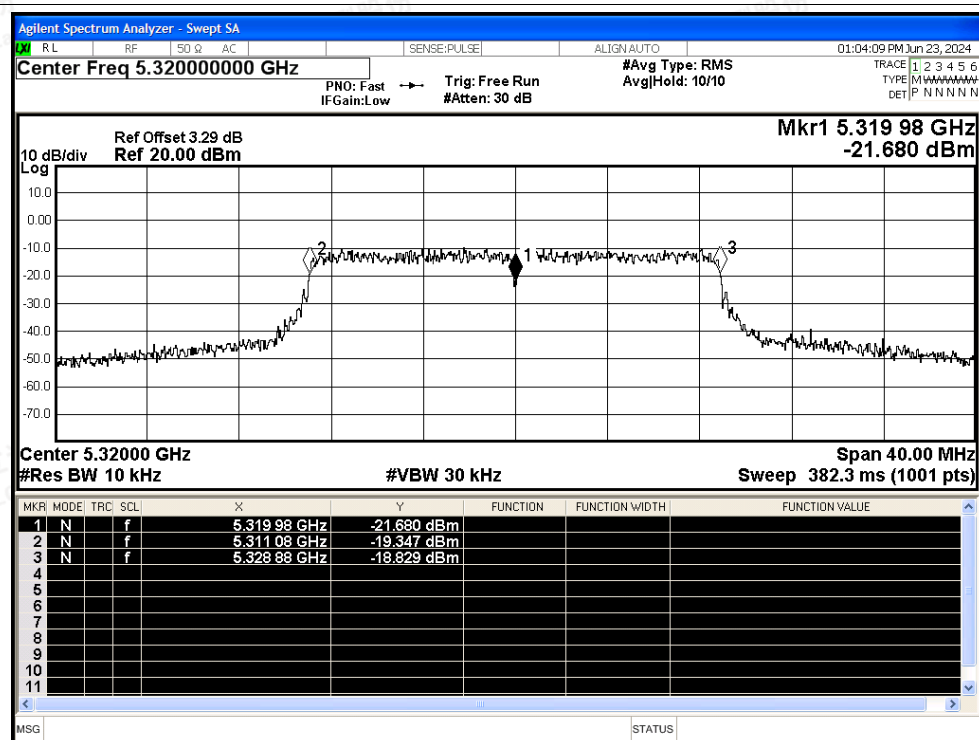

Freq. Stability NVNT ac40 5270MHz Ant0

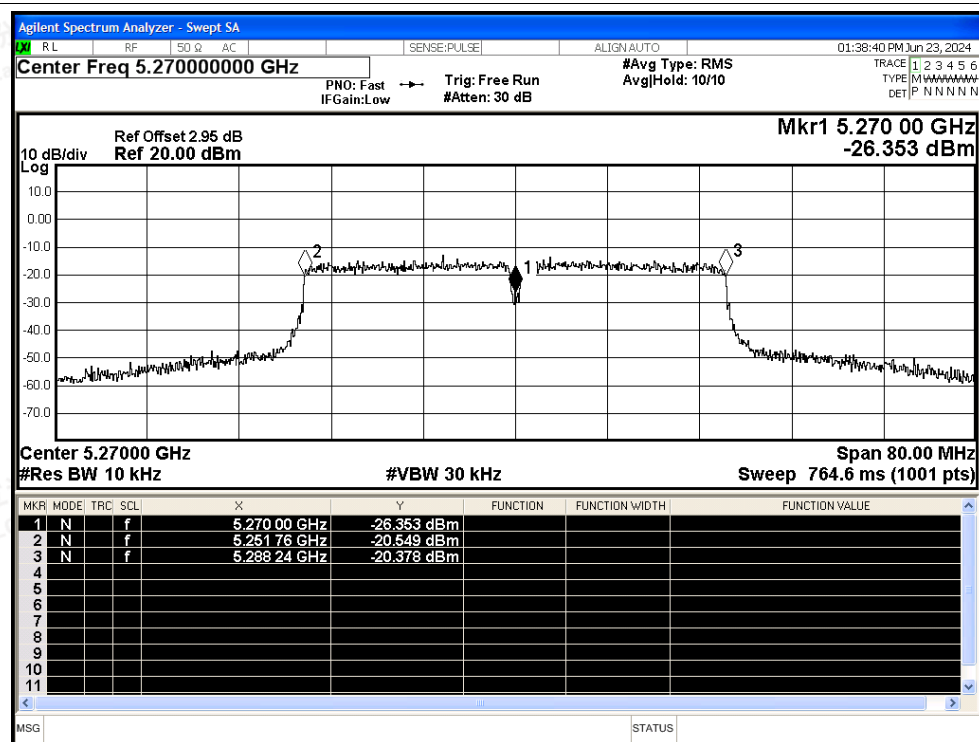

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5310MHz Ant0

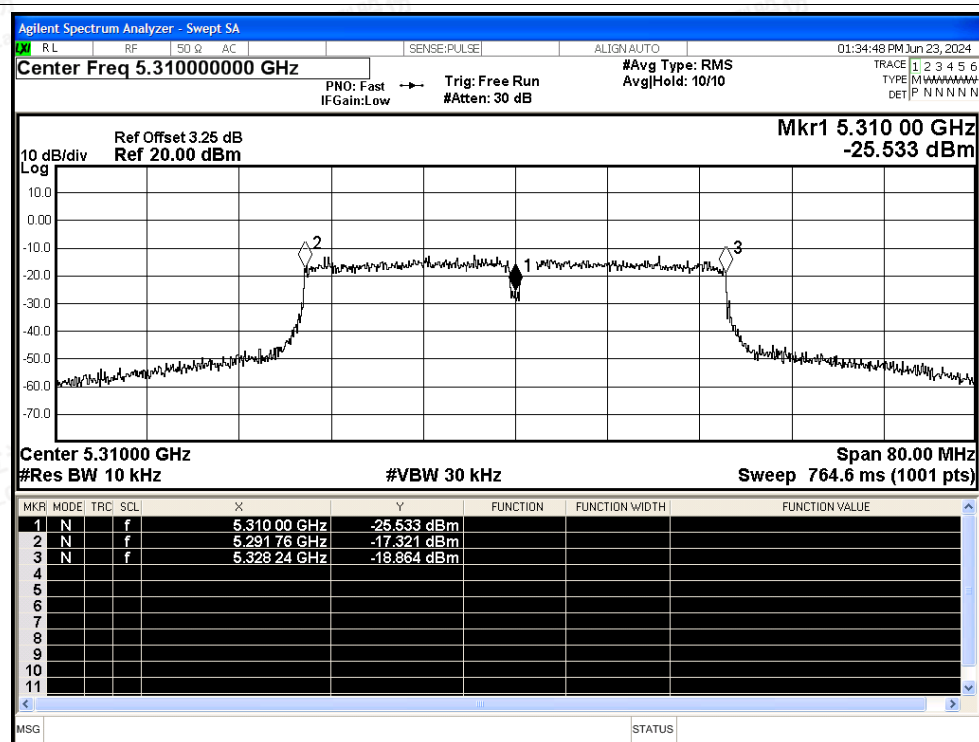

Freq. Stability NVNT ac80 5290MHz Ant0

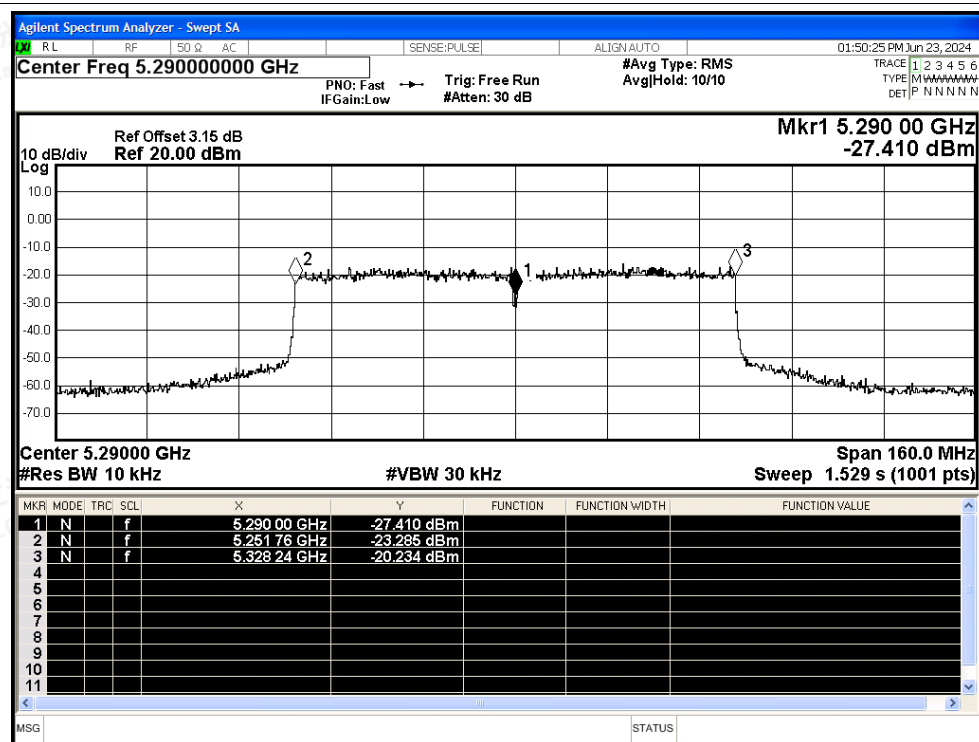

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5260MHz Ant0

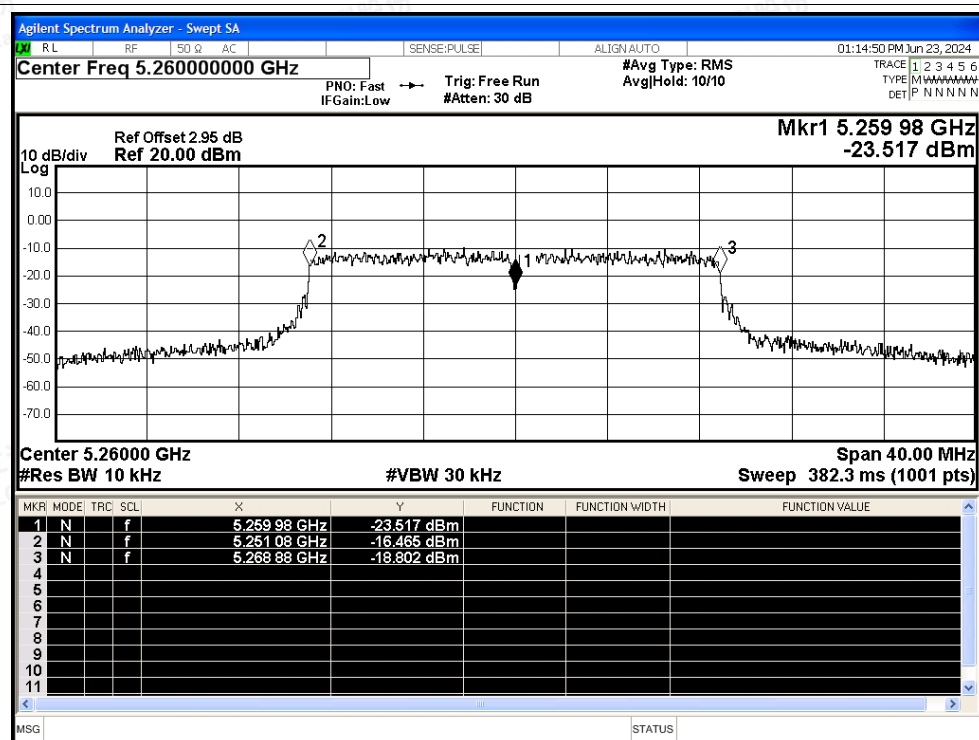

Freq. Stability NVNT ax20 5300MHz Ant0

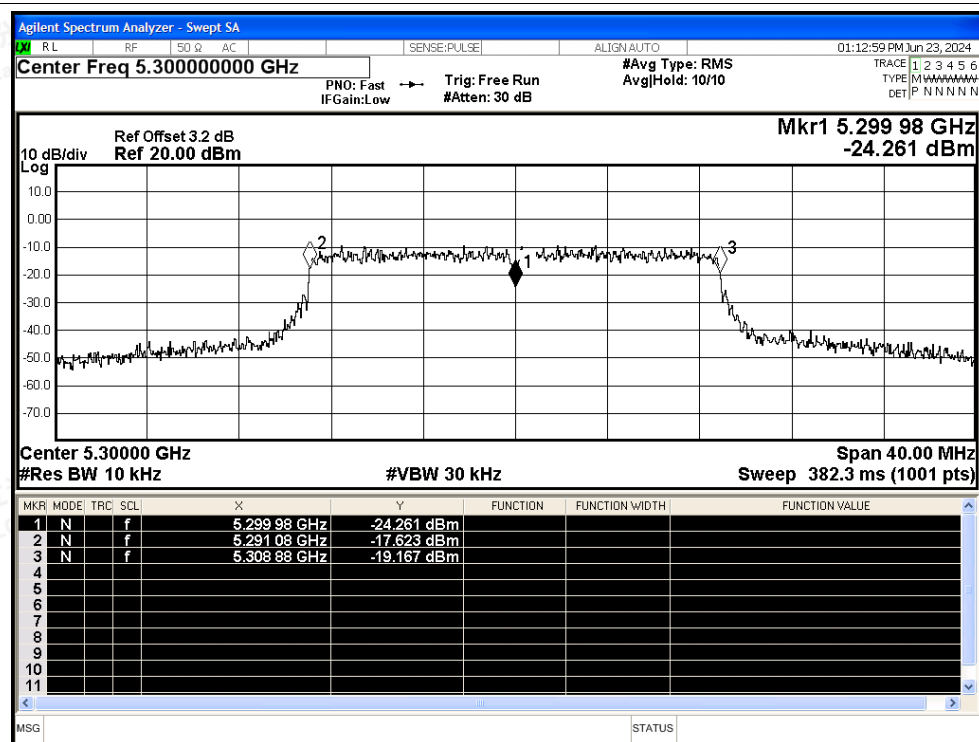

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5320MHz Ant0

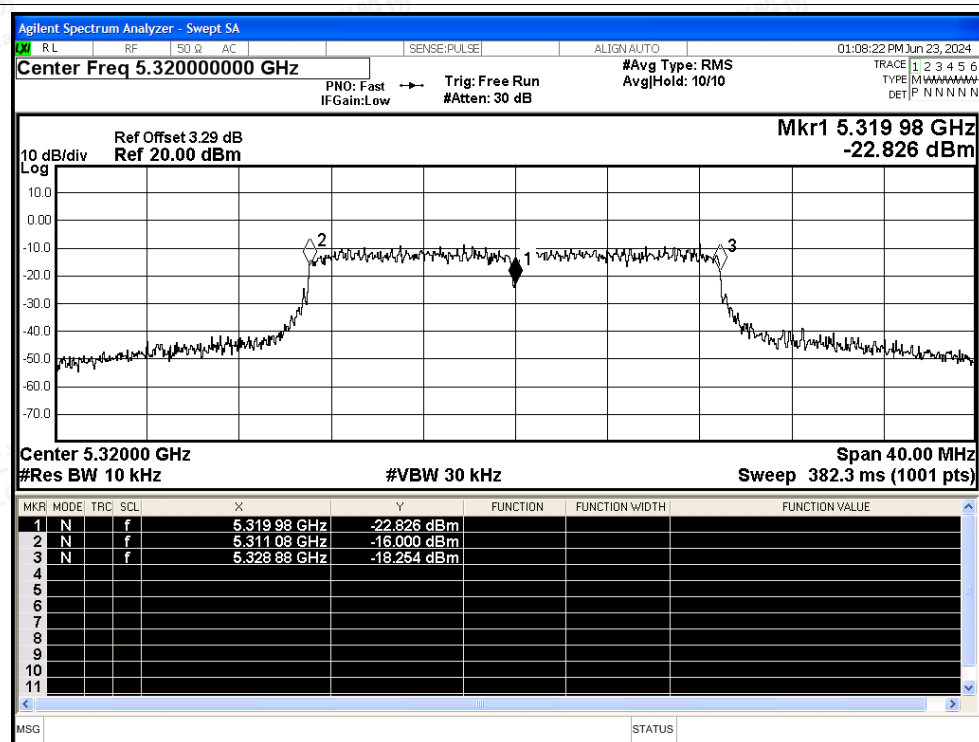

Freq. Stability NVNT ax40 5270MHz Ant0

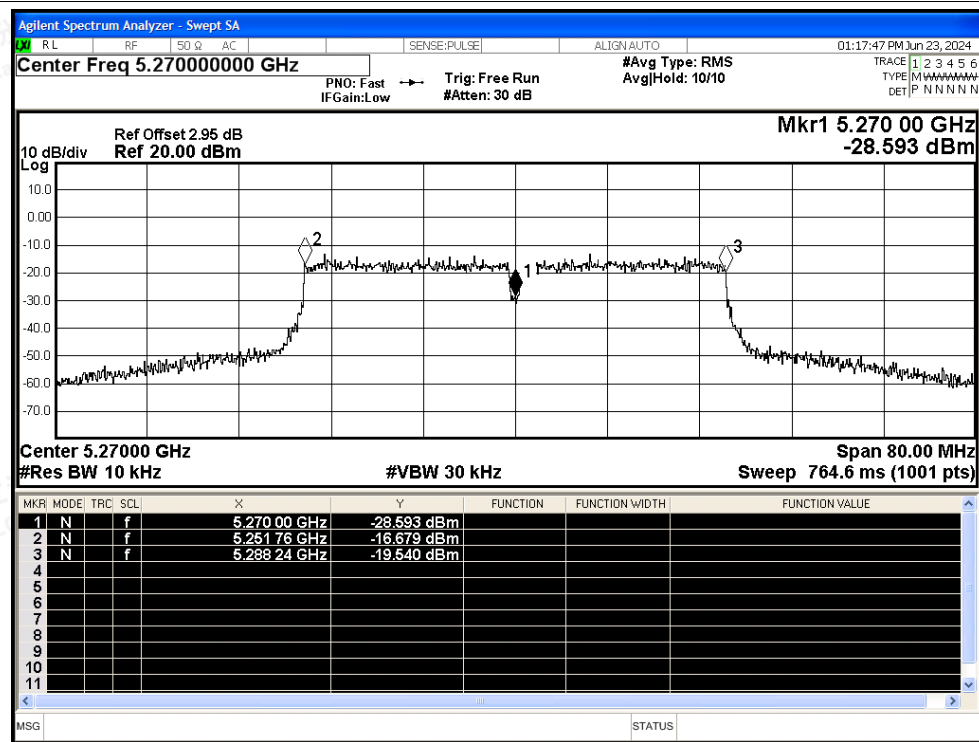

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5310MHz Ant0

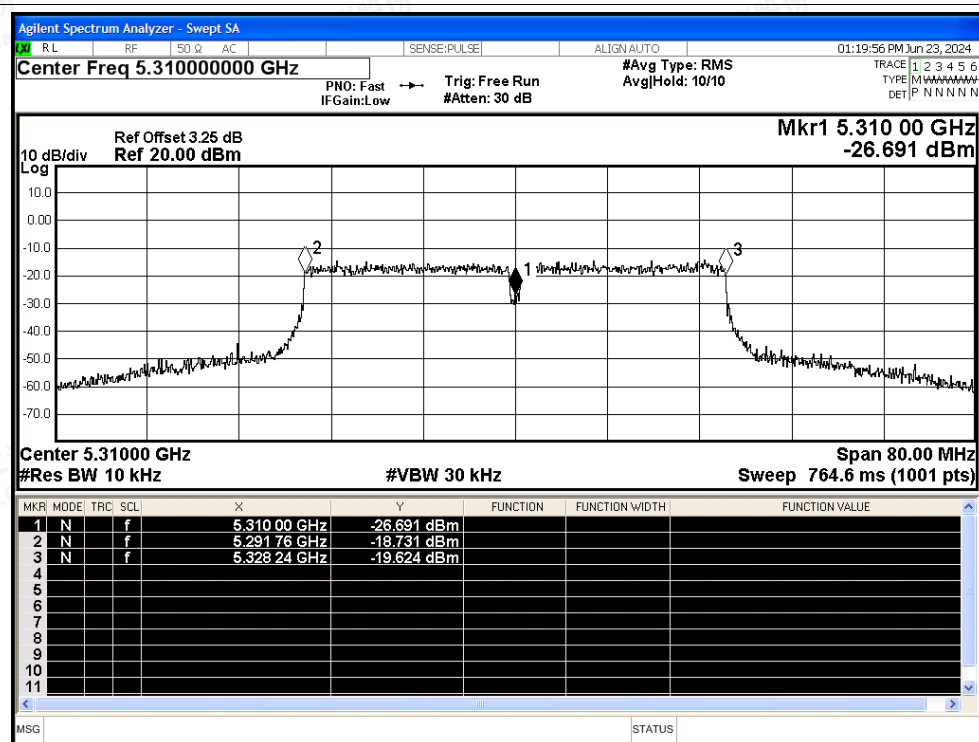

Freq. Stability NVNT ax80 5290MHz Ant0

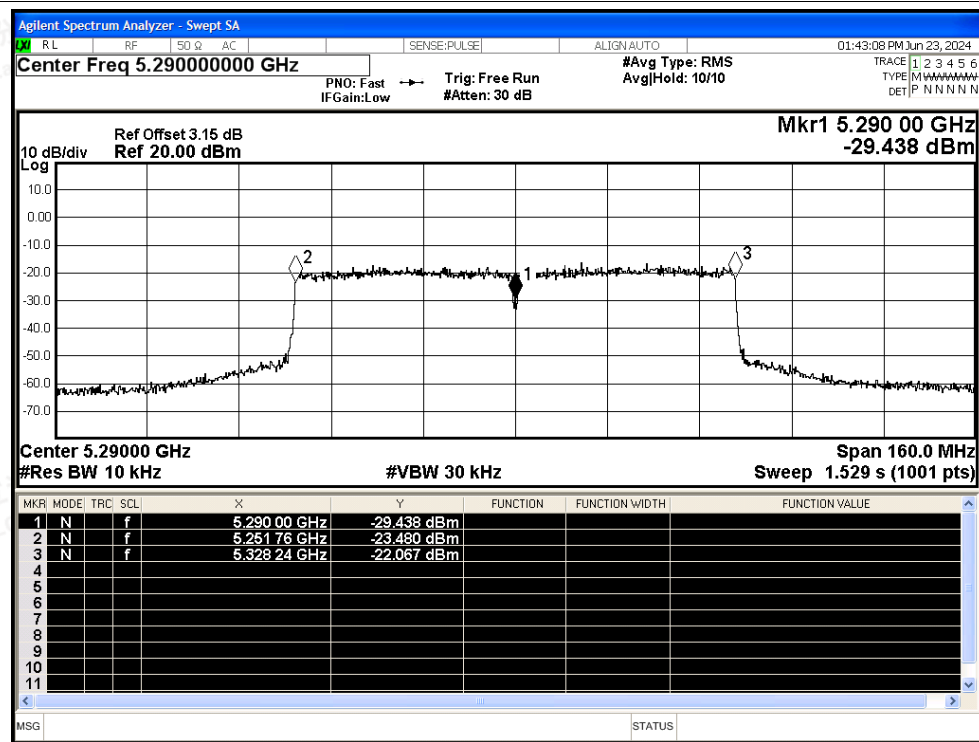

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	ac20	5260	Ant1	5259.96	-40000	-7.6	25	Pass
NVNT	ac20	5300	Ant1	5299.96	-40000	-7.55	25	Pass
NVNT	ac20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
NVNT	ac40	5270	Ant1	5270	0	0	25	Pass
NVNT	ac40	5310	Ant1	5309.96	-40000	-7.53	25	Pass
NVNT	ac80	5290	Ant1	5290	0	0	25	Pass
NVNT	ax20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
NVNT	ax20	5300	Ant1	5300	0	0	25	Pass
NVNT	ax20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
NVNT	ax40	5270	Ant1	5270	0	0	25	Pass
NVNT	ax40	5310	Ant1	5310	0	0	25	Pass
NVNT	ax80	5290	Ant1	5290	0	0	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT ac20 5260MHz Ant1

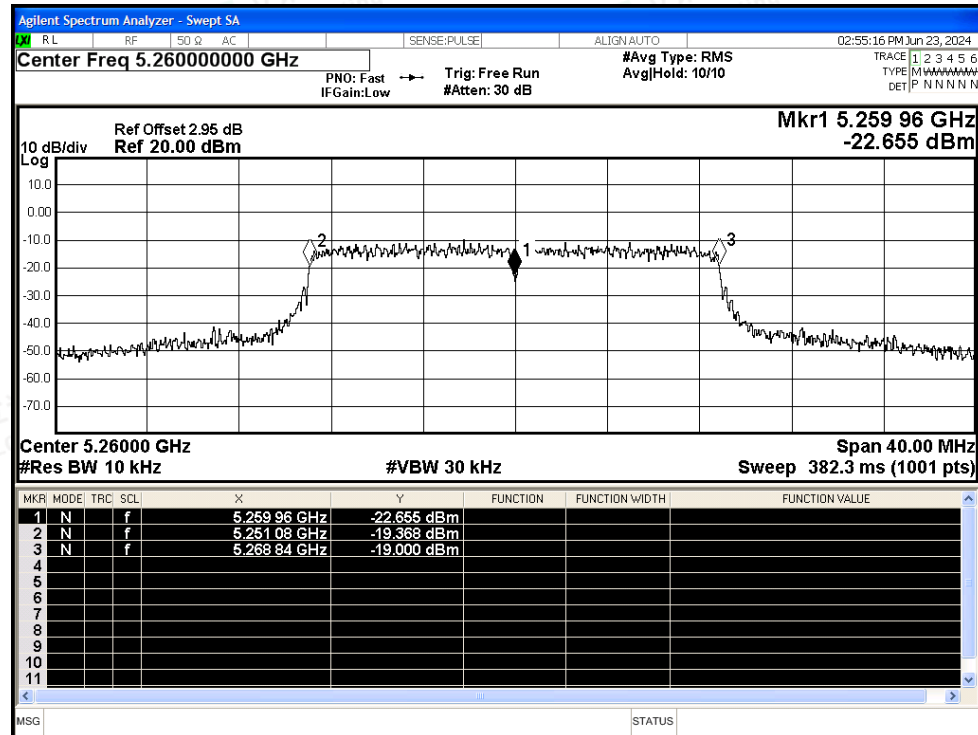

Freq. Stability NVNT ac20 5300MHz Ant1

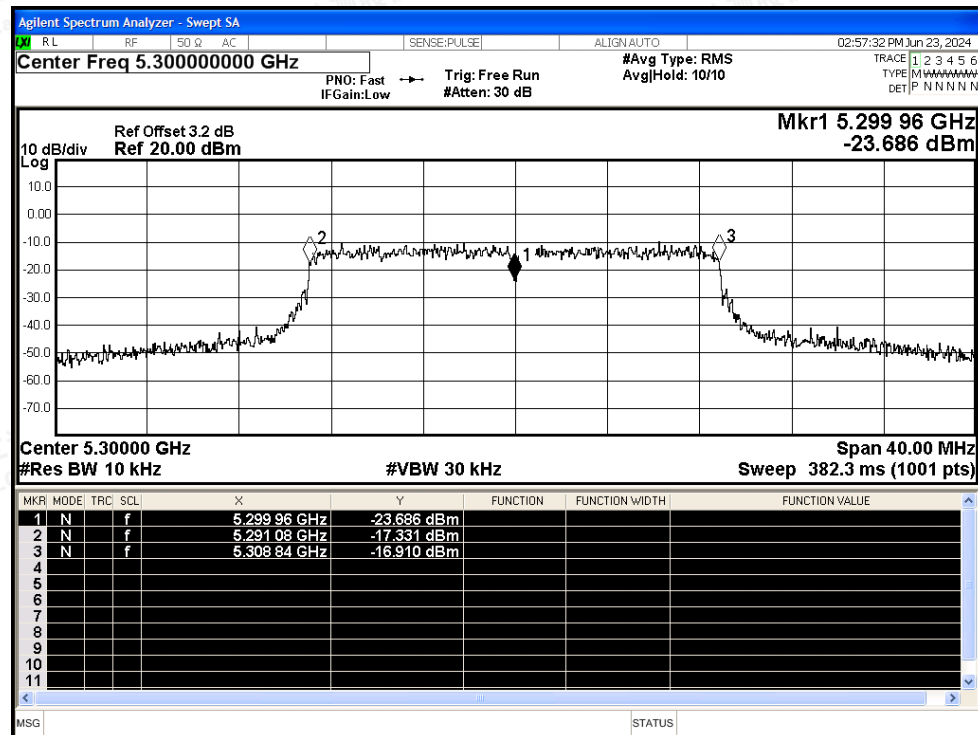

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5320MHz Ant1

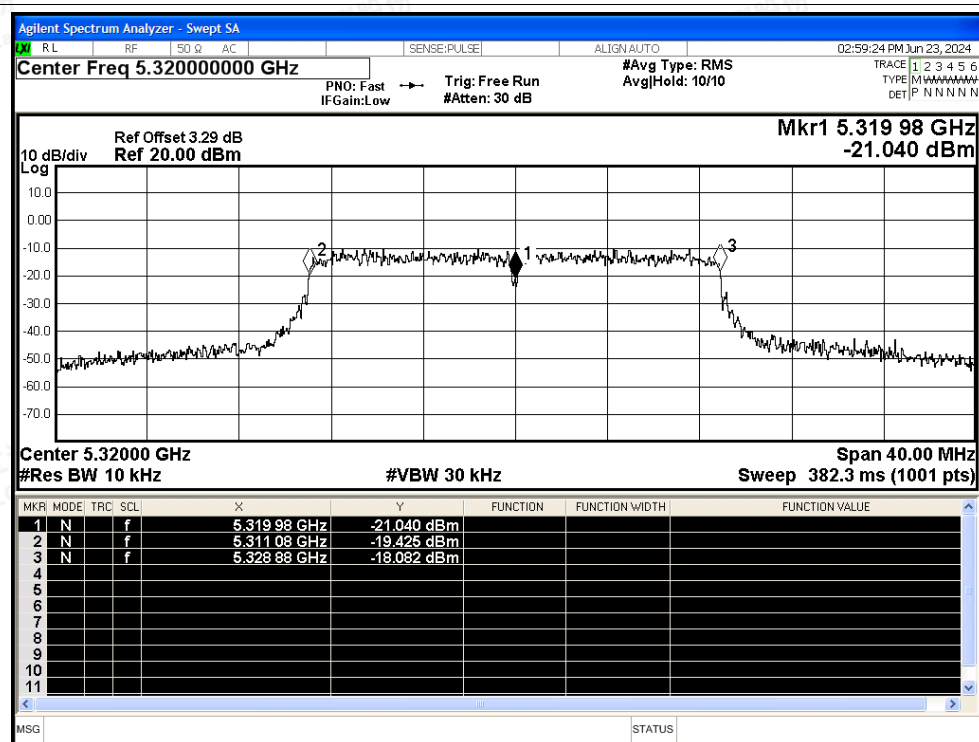

Freq. Stability NVNT ac40 5270MHz Ant1

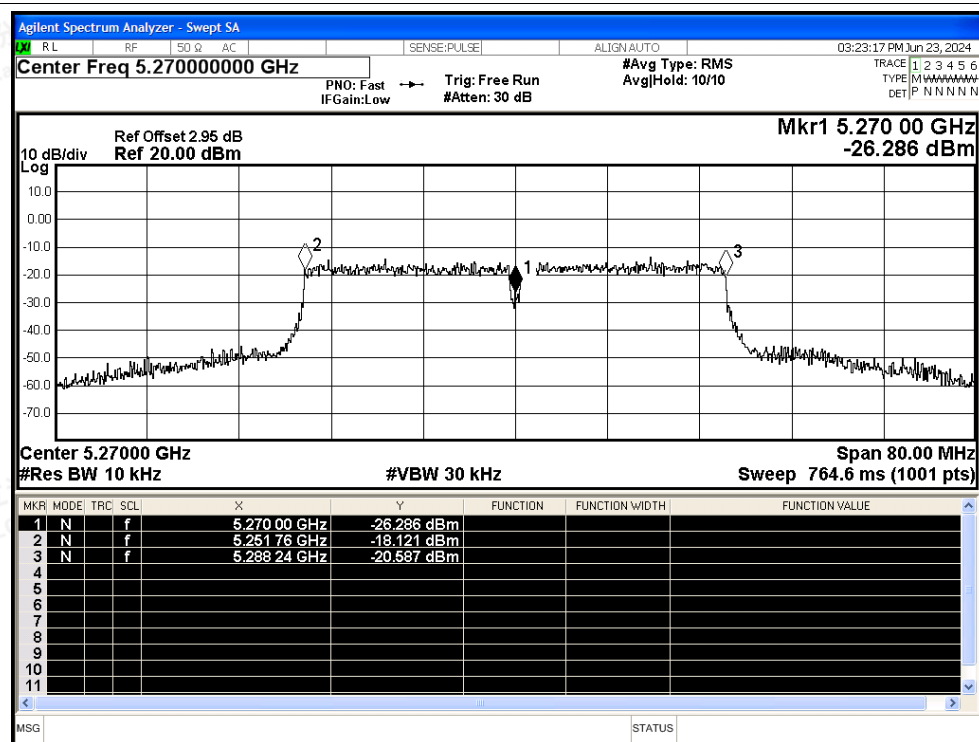

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5310MHz Ant1

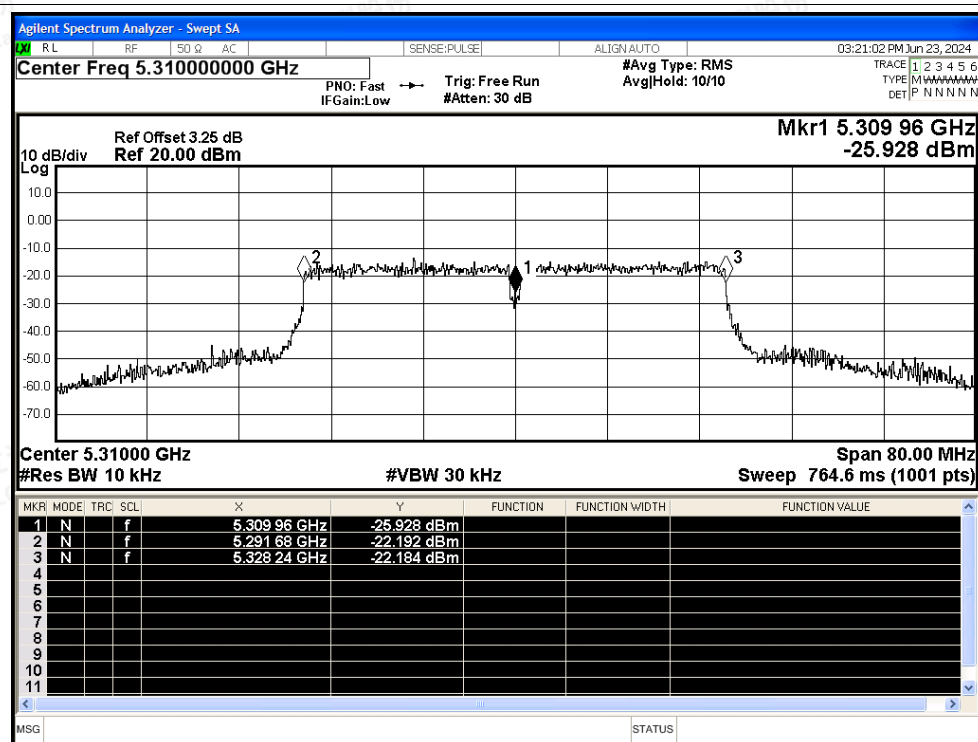

Freq. Stability NVNT ac80 5290MHz Ant1

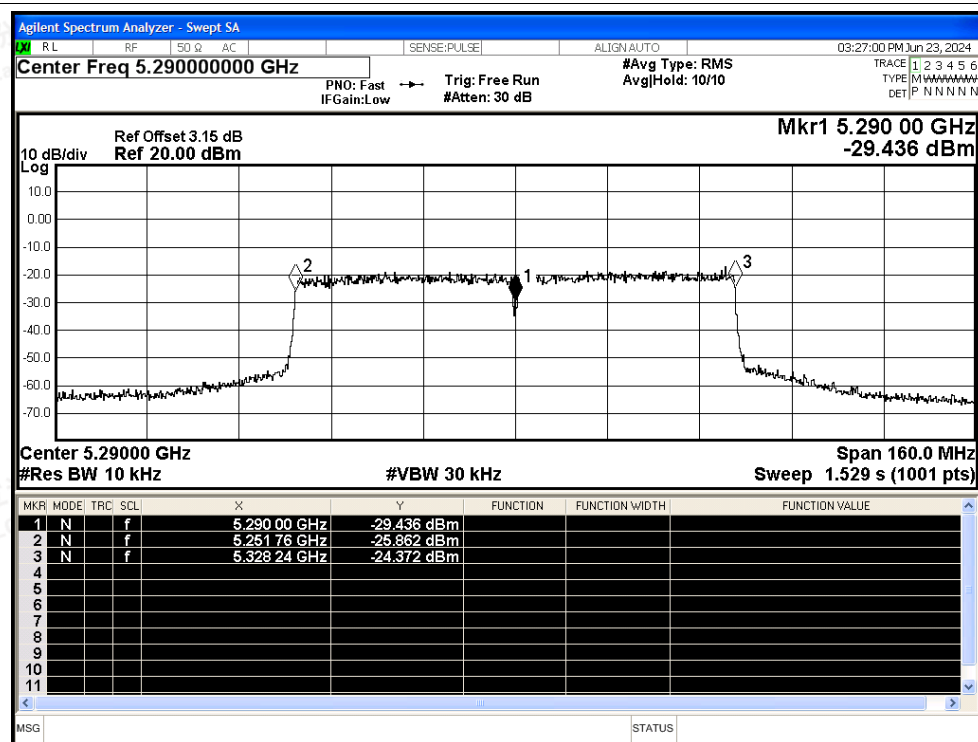

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5260MHz Ant1

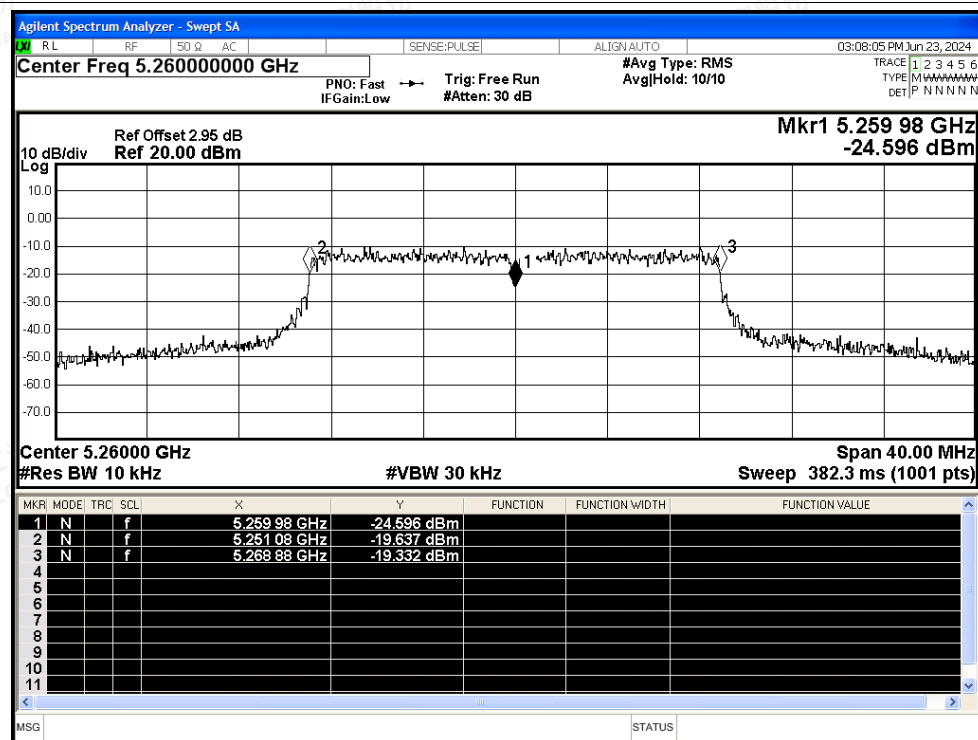

Freq. Stability NVNT ax20 5300MHz Ant1

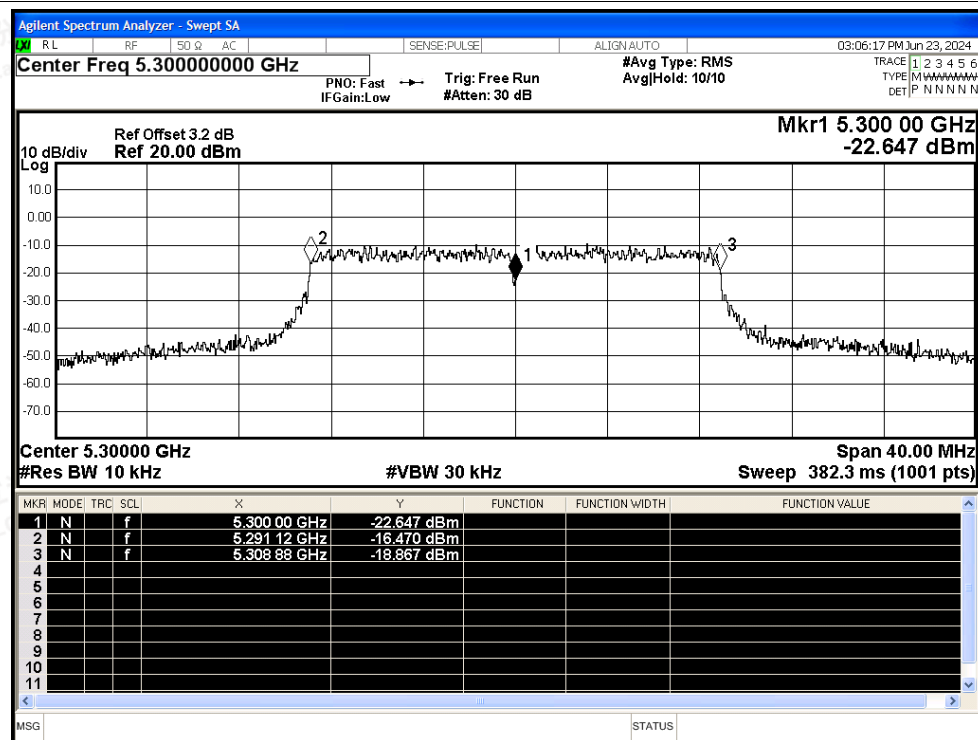

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5320MHz Ant1

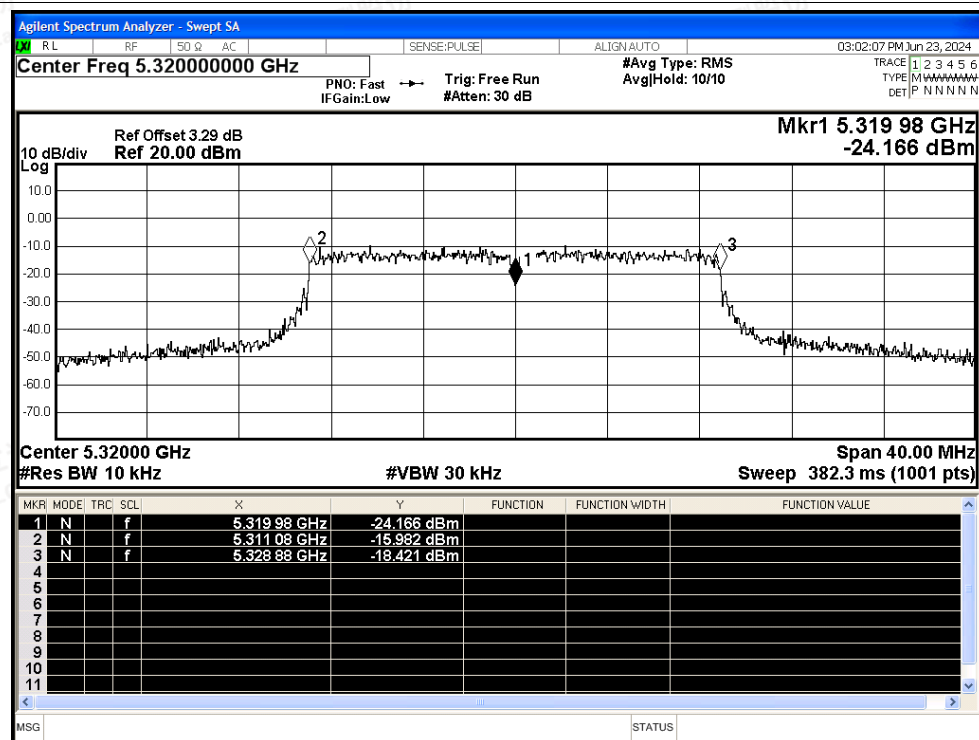

Freq. Stability NVNT ax40 5270MHz Ant1

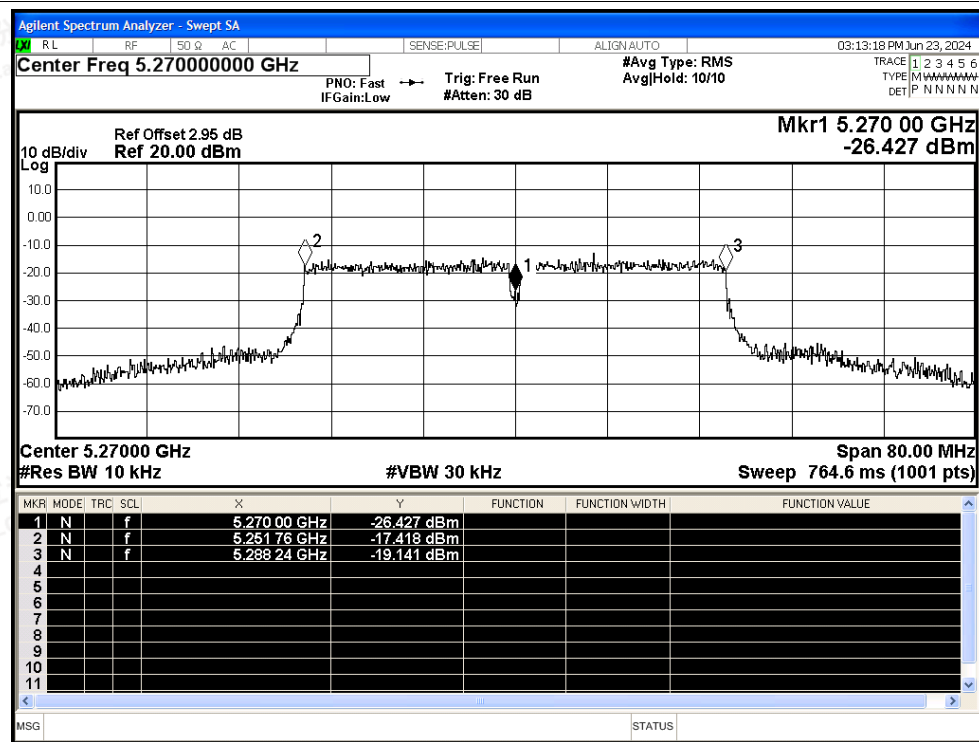

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5310MHz Ant1

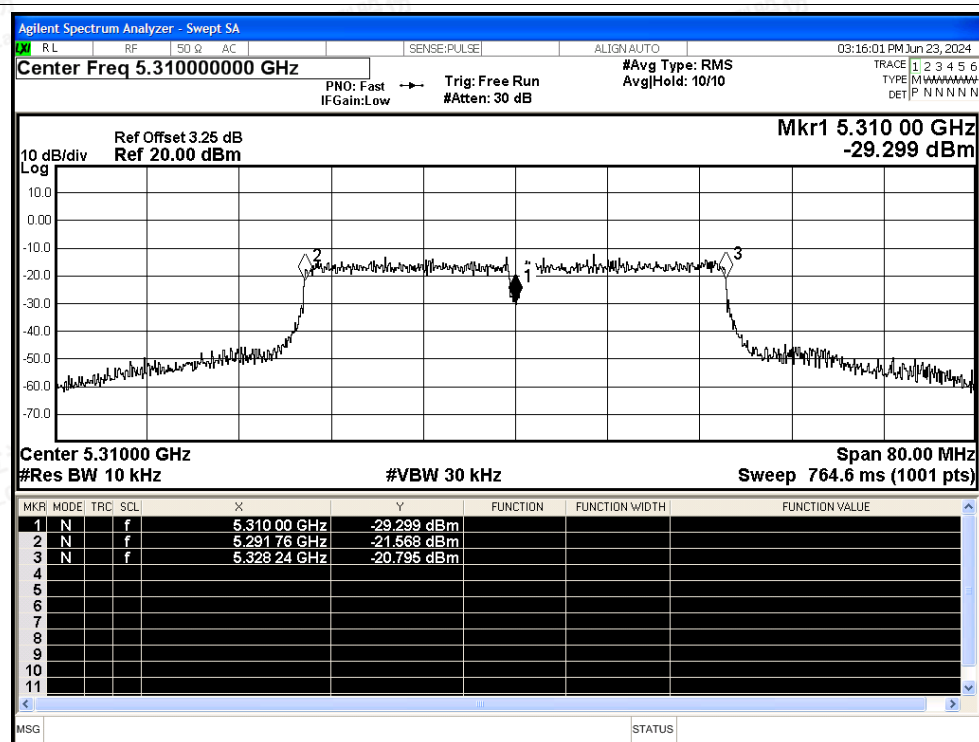

Freq. Stability NVNT ax80 5290MHz Ant1

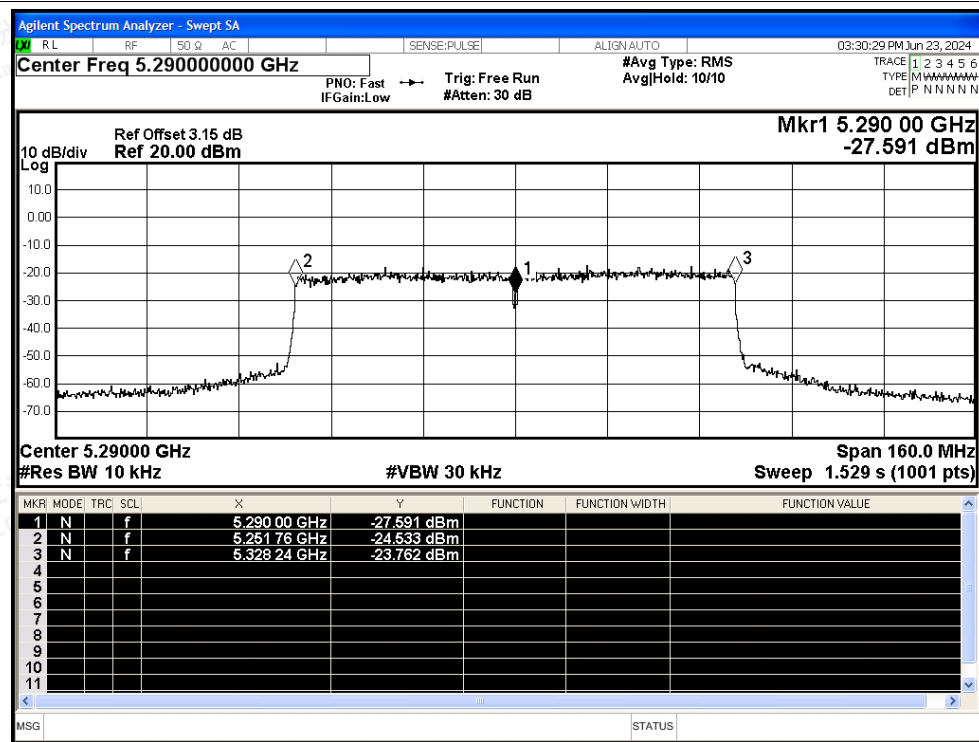

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



E.6 Duty Cycle

Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5260	Ant0	94.65	0.24	0.91
NVNT	a	5300	Ant0	94.65	0.24	0.91
NVNT	a	5320	Ant0	94.56	0.24	0.91
NVNT	n20	5260	Ant0	93.77	0.28	1.07
NVNT	n20	5300	Ant0	93.67	0.28	1.07
NVNT	n20	5320	Ant0	93.77	0.28	1.07
NVNT	n40	5270	Ant0	97.23	0.12	0.46
NVNT	n40	5310	Ant0	97.23	0.12	0.46
NVNT	ac20	5260	Ant0	93.72	0.28	1.06
NVNT	ac20	5300	Ant0	93.82	0.28	1.06
NVNT	ac20	5320	Ant0	93.72	0.28	1.06
NVNT	ac40	5270	Ant0	97.19	0.12	0.46
NVNT	ac40	5310	Ant0	97.24	0.12	0.46
NVNT	ac80	5290	Ant0	94.41	0.25	0.97
NVNT	ax20	5260	Ant0	93.72	0.28	1.06
NVNT	ax20	5300	Ant0	93.72	0.28	1.06
NVNT	ax20	5320	Ant0	93.72	0.28	1.06
NVNT	ax40	5270	Ant0	97.2	0.12	0.46
NVNT	ax40	5310	Ant0	97.24	0.12	0.46
NVNT	ax80	5290	Ant0	94.32	0.25	0.97



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Duty Cycle NVNT a 5260MHz Ant0

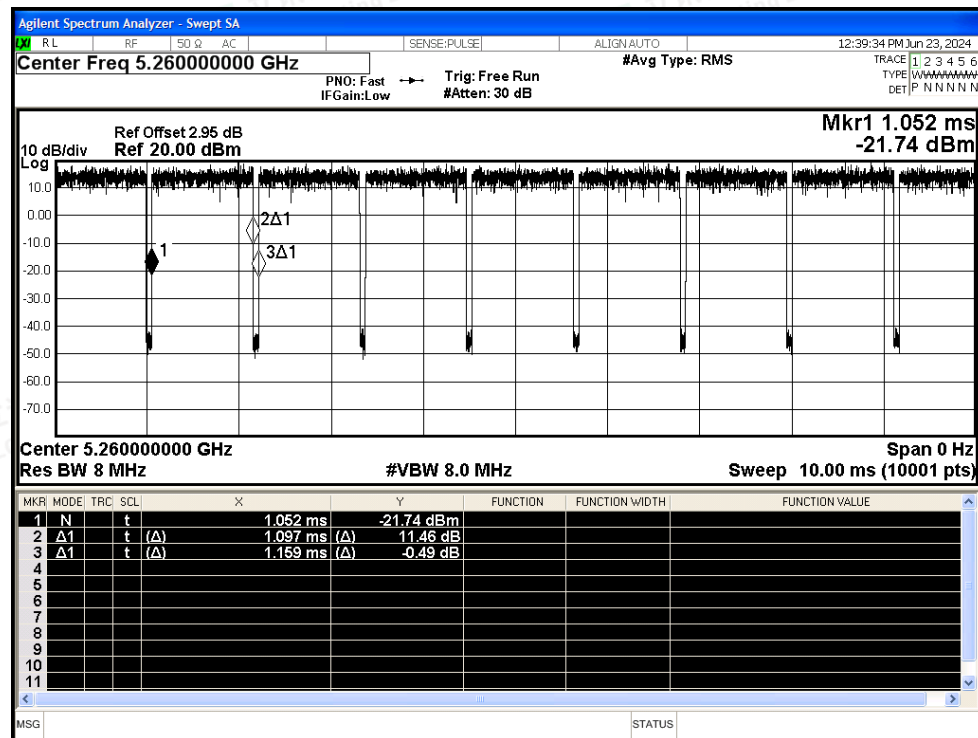

Duty Cycle NVNT a 5300MHz Ant0

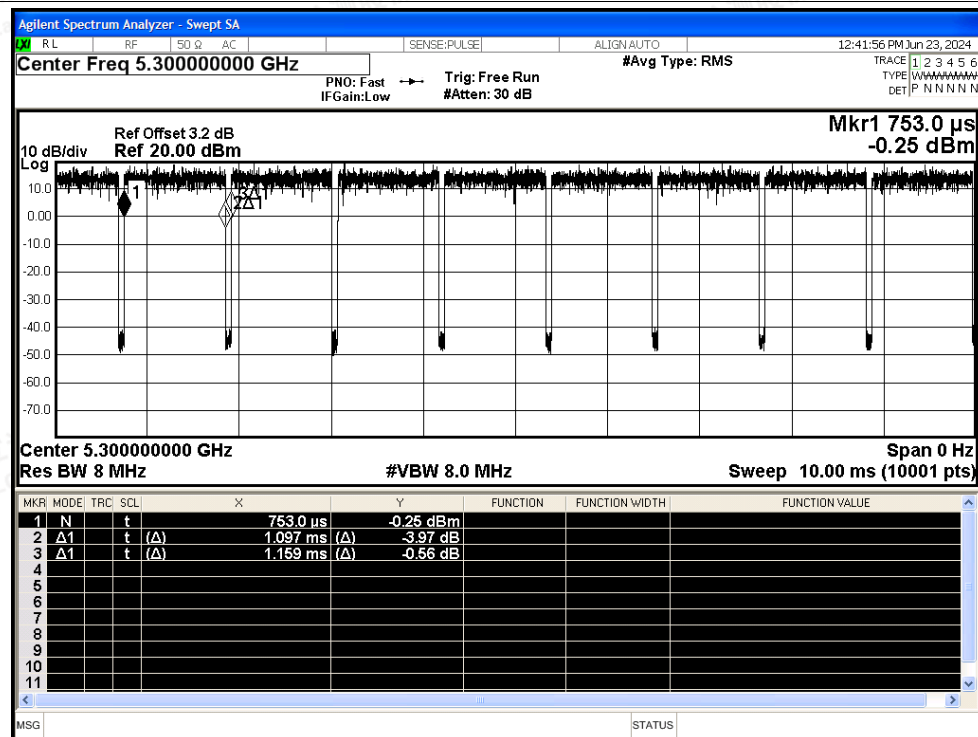

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5320MHz Ant0

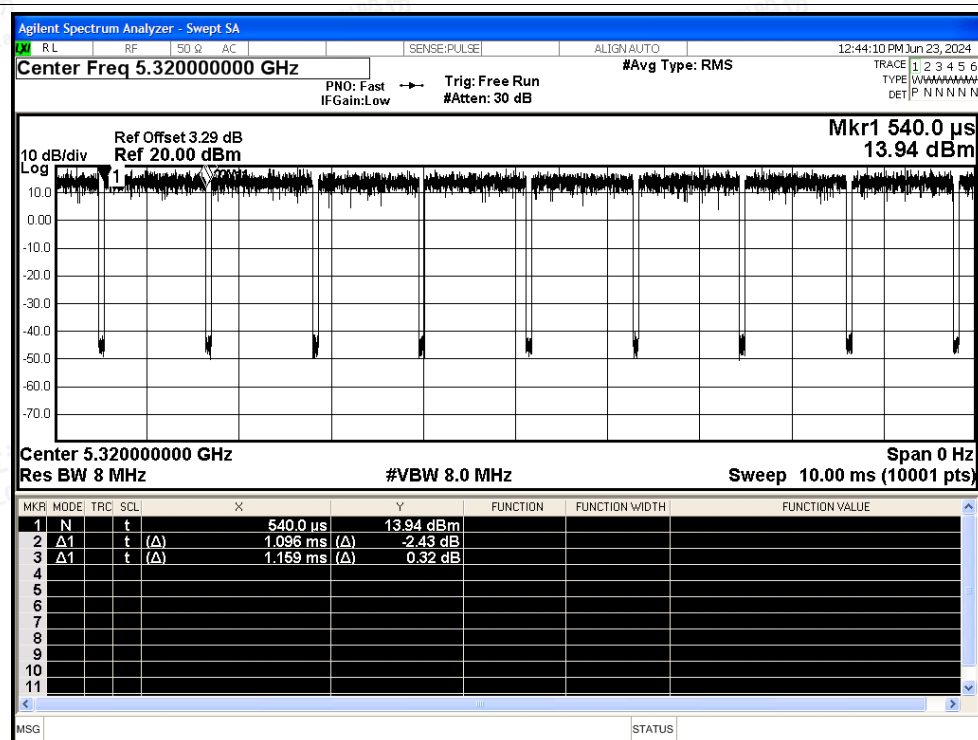

Duty Cycle NVNT n20 5260MHz Ant0


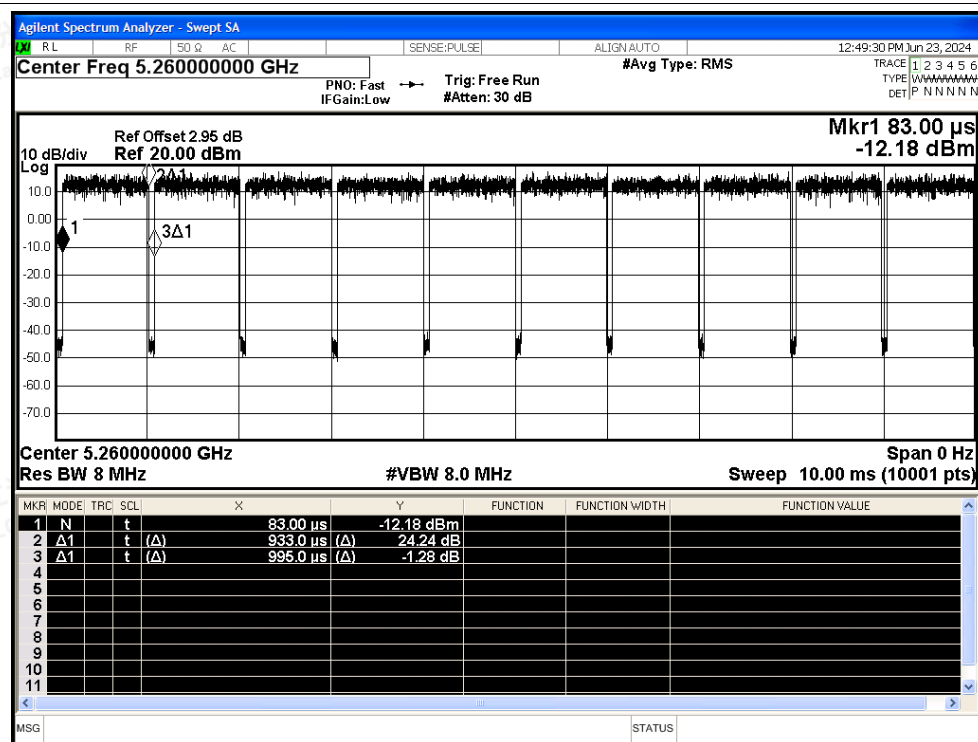


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

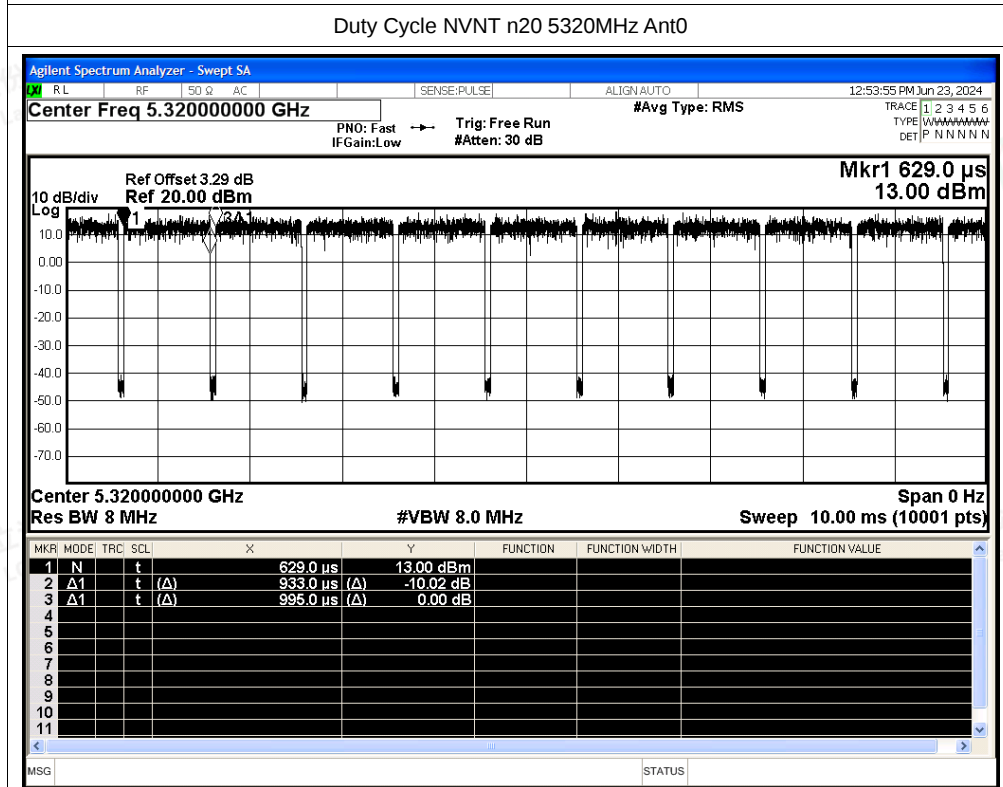
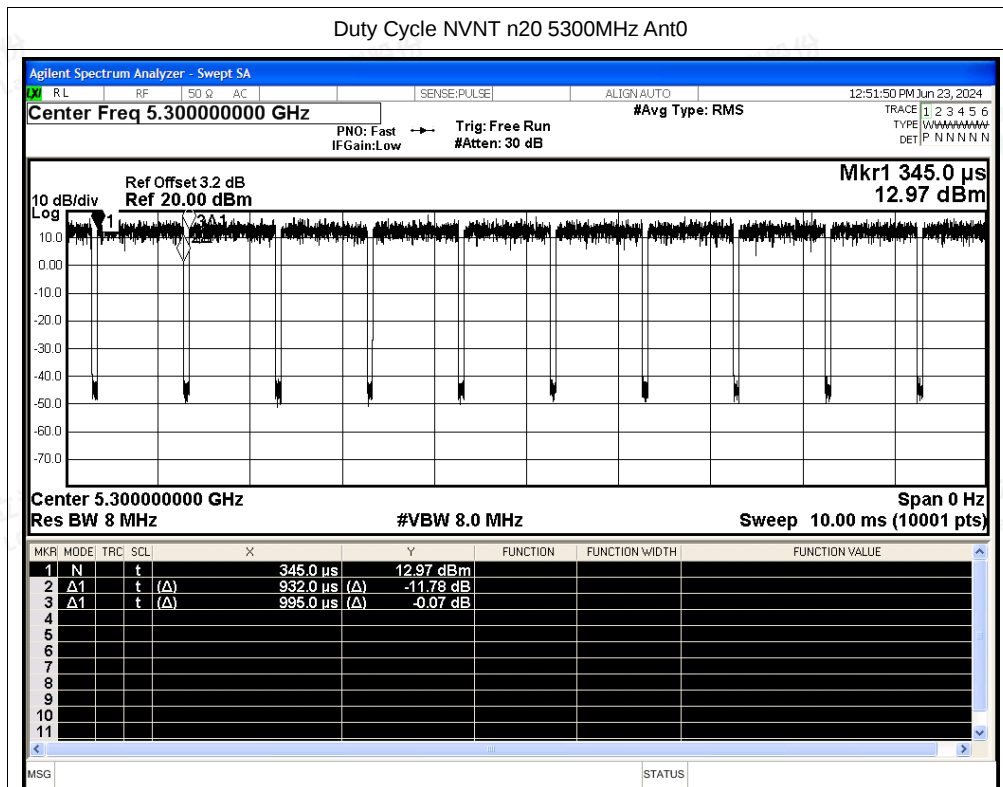


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

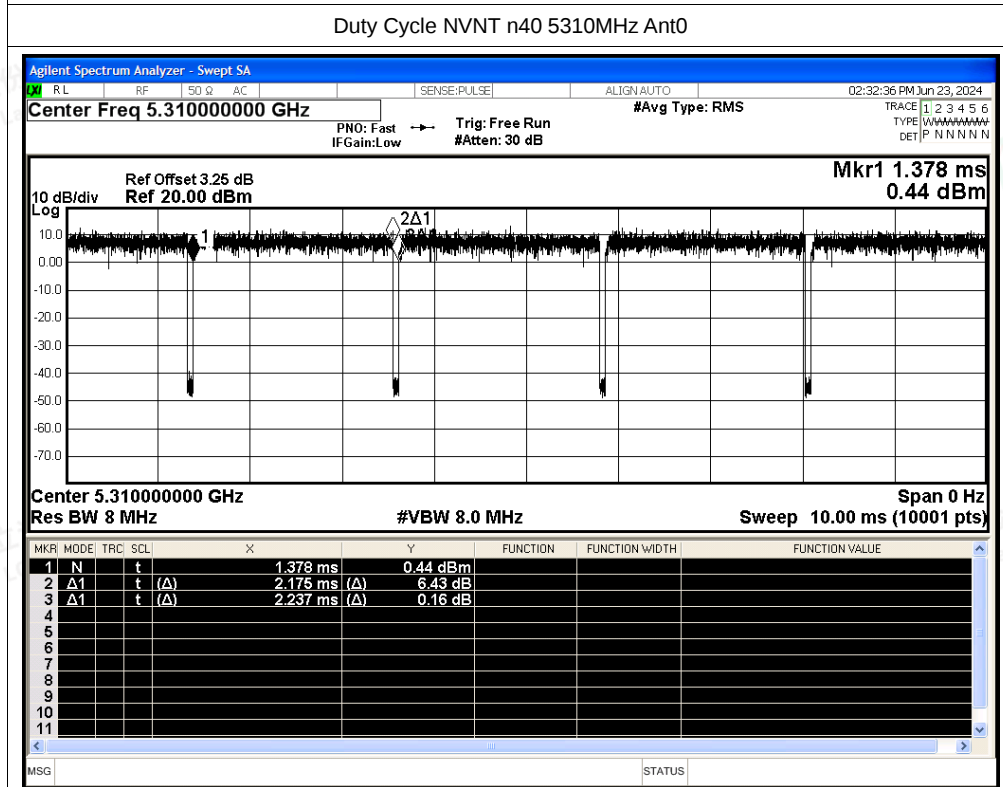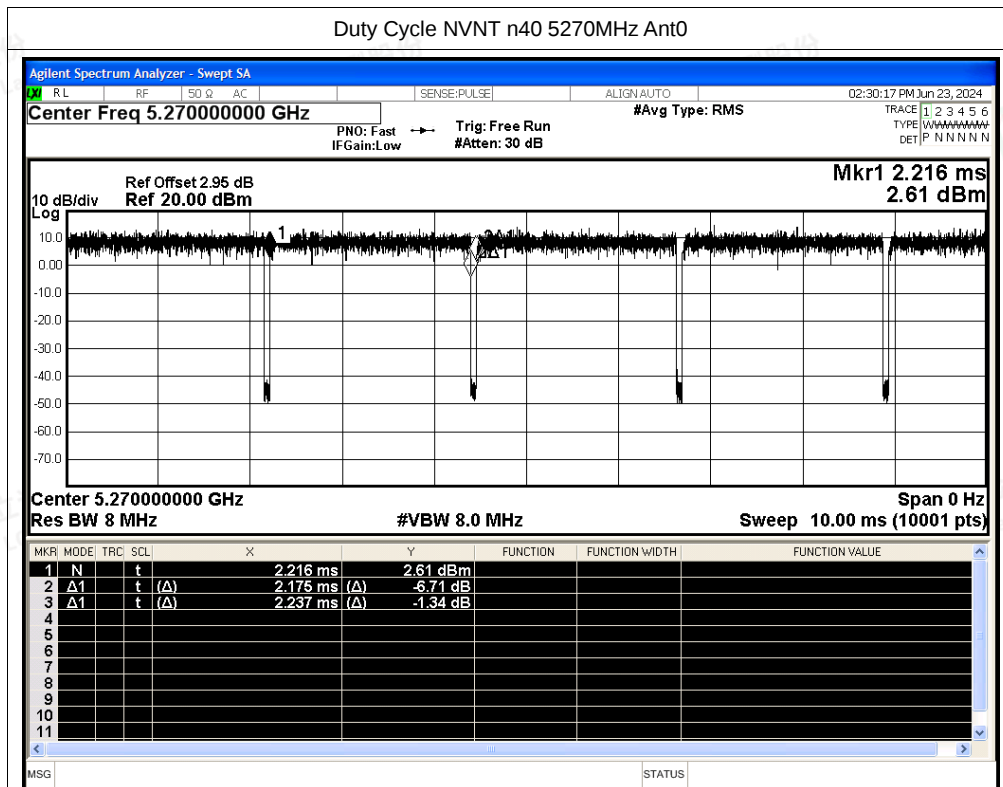

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5260MHz Ant0

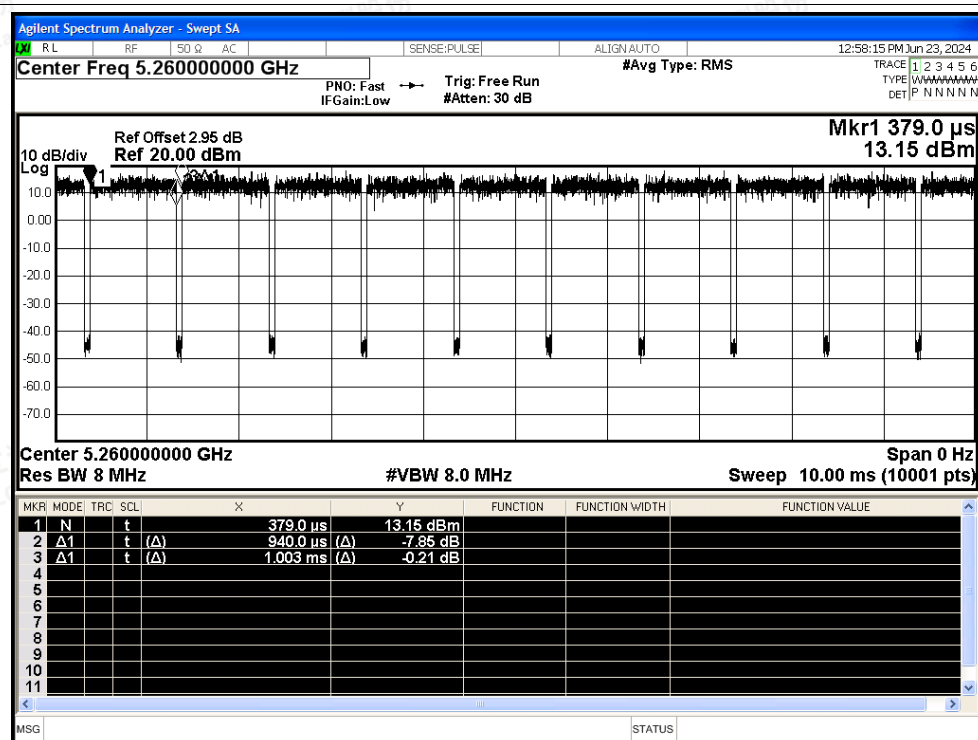

Duty Cycle NVNT ac20 5300MHz Ant0


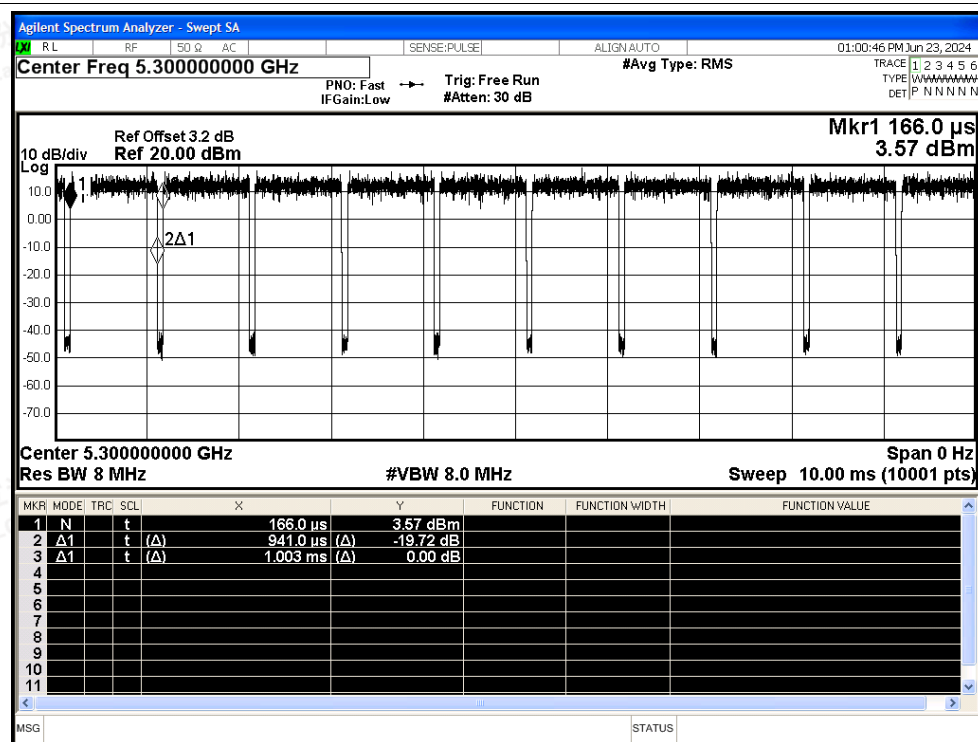


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

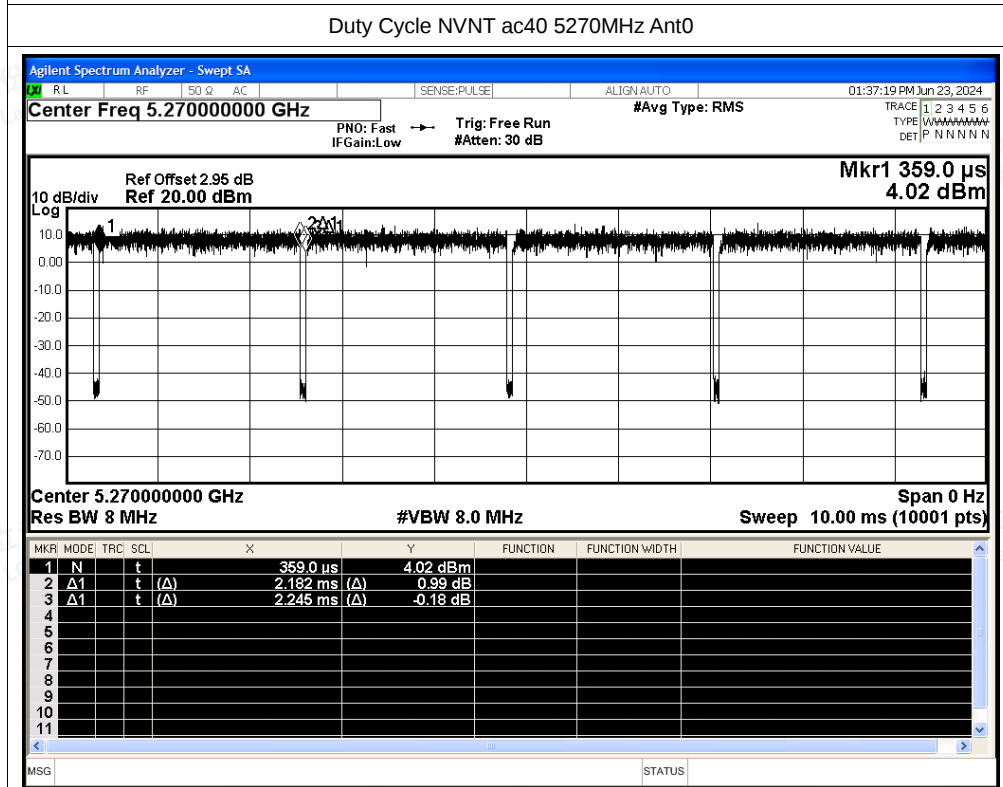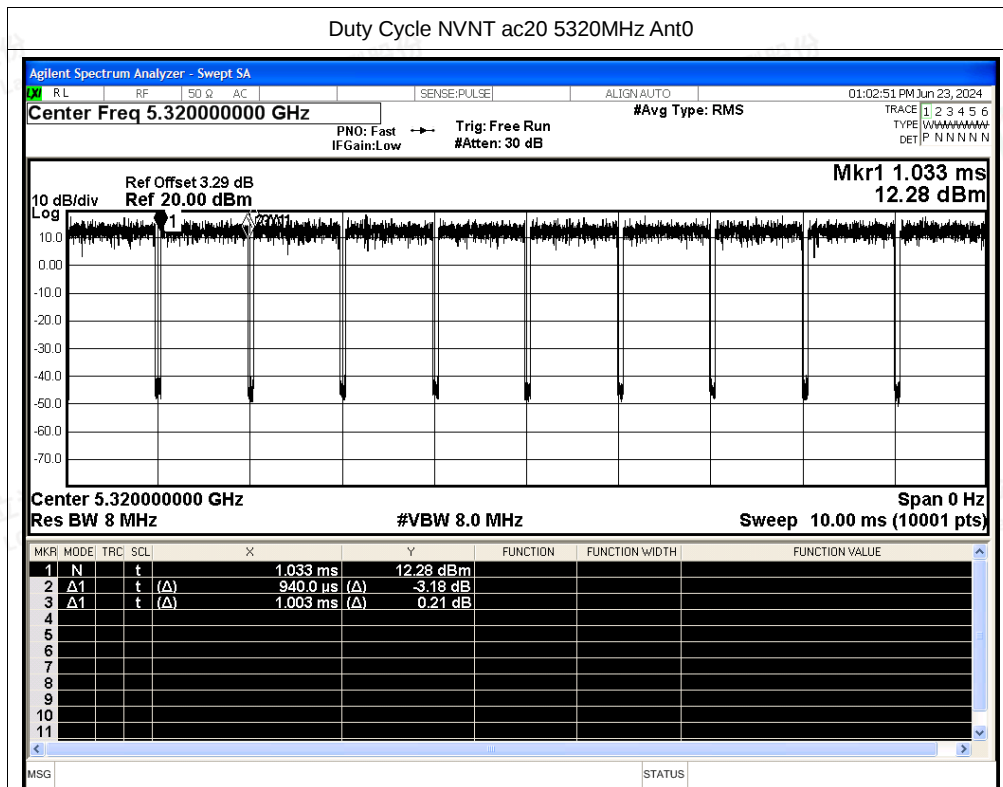

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5310MHz Ant0

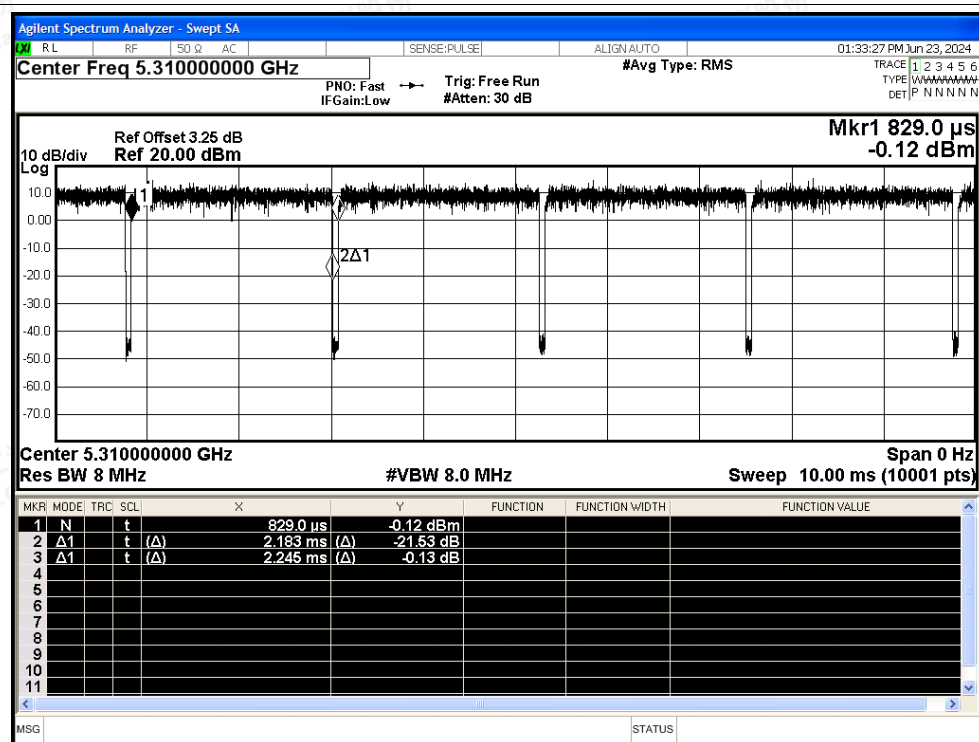

Duty Cycle NVNT ac80 5290MHz Ant0

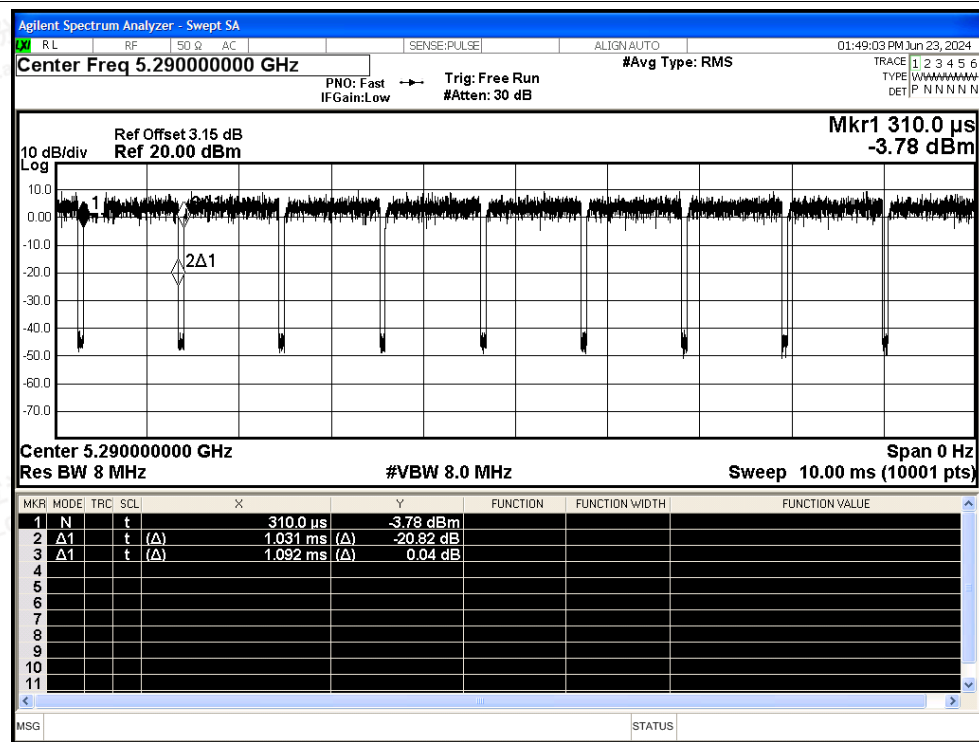

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5260MHz Ant0

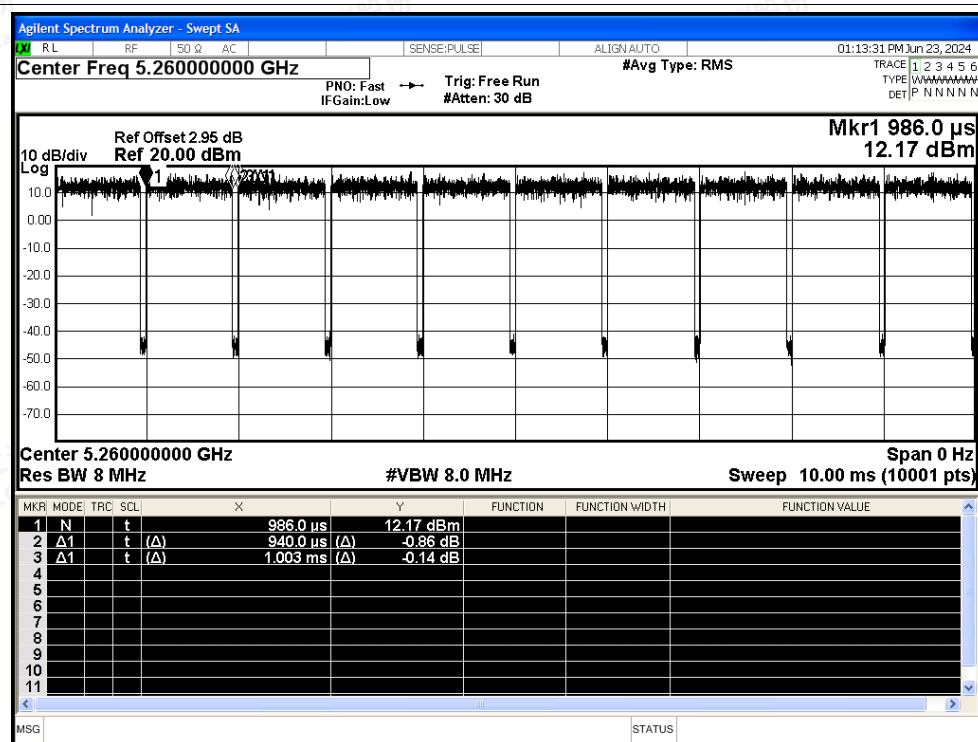

Duty Cycle NVNT ax20 5300MHz Ant0

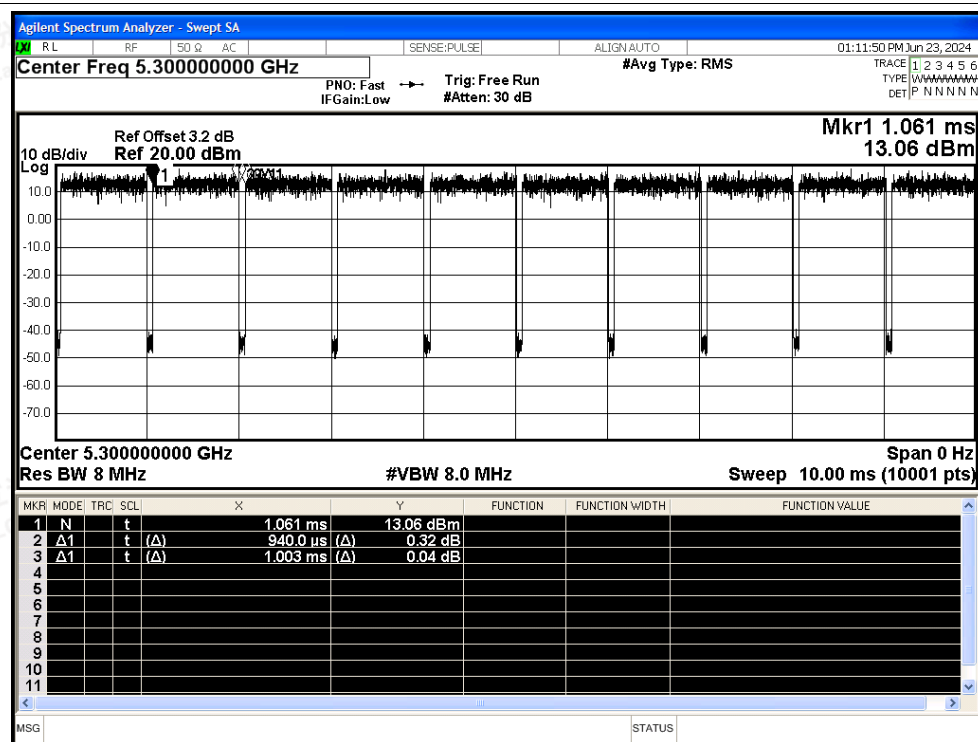

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5320MHz Ant0

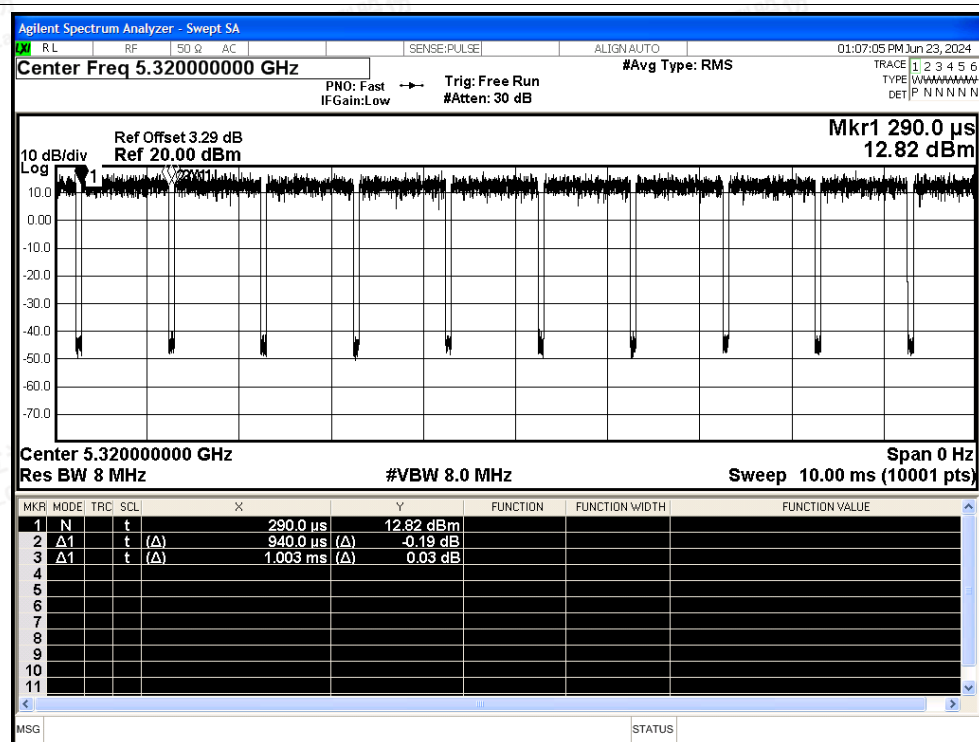

Duty Cycle NVNT ax40 5270MHz Ant0

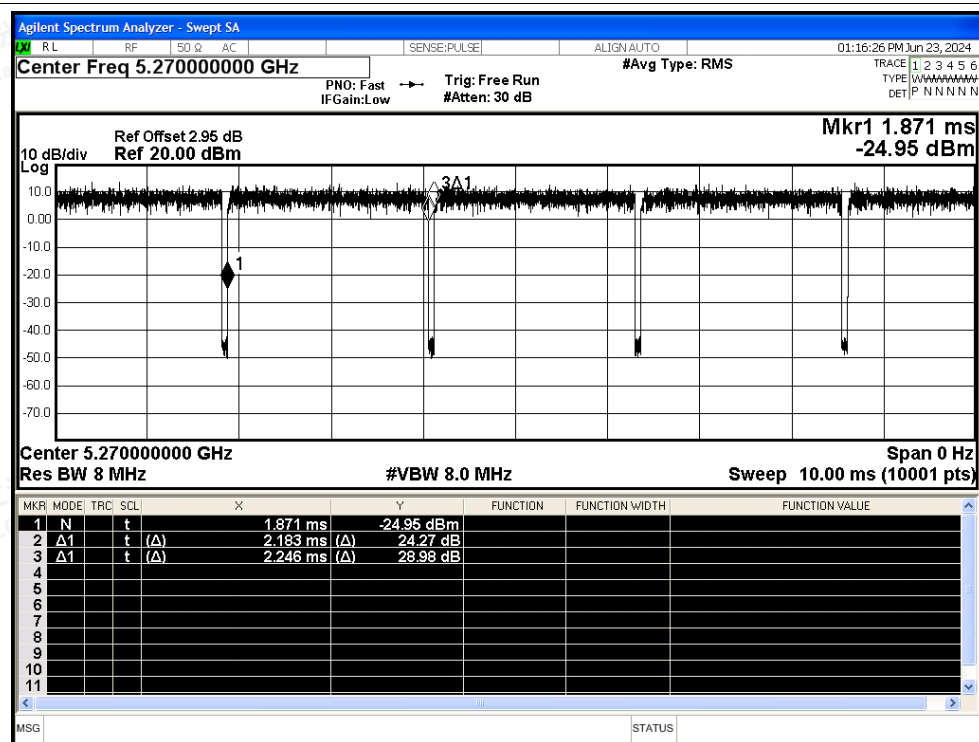

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax40 5310MHz Ant0

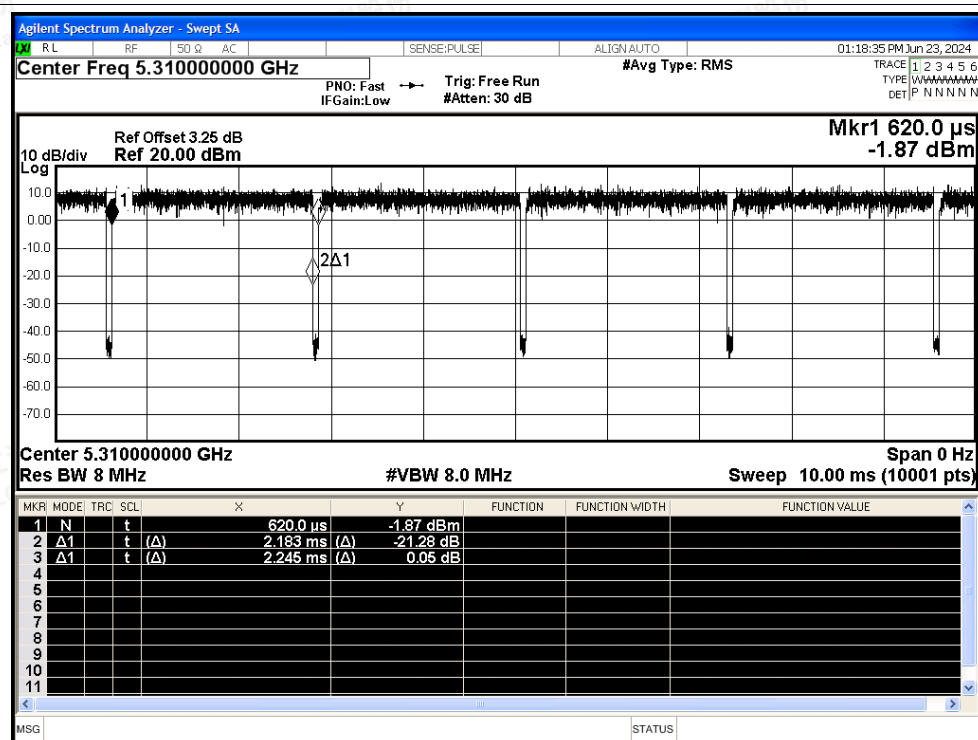

Duty Cycle NVNT ax80 5290MHz Ant0

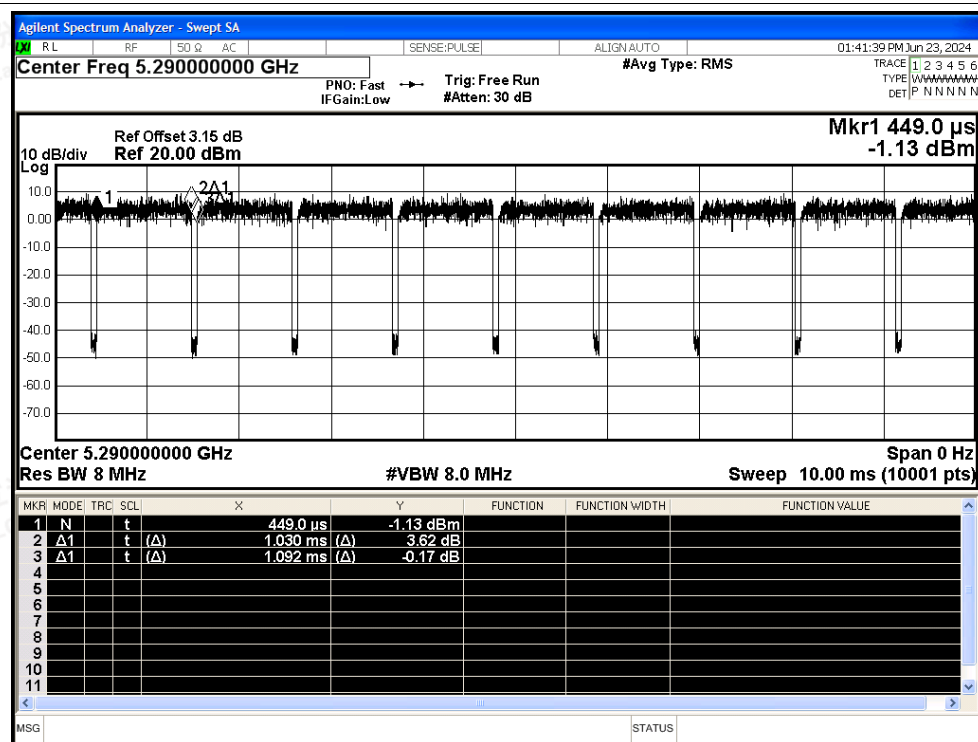

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5260	Ant1	94.56	0.24	0.91
NVNT	a	5300	Ant1	94.56	0.24	0.91
NVNT	a	5320	Ant1	94.65	0.24	0.91
NVNT	n20	5260	Ant1	93.67	0.28	1.07
NVNT	n20	5300	Ant1	93.77	0.28	1.07
NVNT	n20	5320	Ant1	93.67	0.28	1.07
NVNT	n40	5270	Ant1	97.23	0.12	0.46
NVNT	n40	5310	Ant1	97.18	0.12	0.46
NVNT	ac20	5260	Ant1	93.72	0.28	1.06
NVNT	ac20	5300	Ant1	93.82	0.28	1.06
NVNT	ac20	5320	Ant1	93.72	0.28	1.06
NVNT	ac40	5270	Ant1	88.48	0.53	2.1
NVNT	ac40	5310	Ant1	88.48	0.53	2.1
NVNT	ac80	5290	Ant1	94.32	0.25	0.97
NVNT	ax20	5260	Ant1	93.72	0.28	1.06
NVNT	ax20	5300	Ant1	93.82	0.28	1.06
NVNT	ax20	5320	Ant1	93.82	0.28	1.06
NVNT	ax40	5270	Ant1	88.48	0.53	2.1
NVNT	ax40	5310	Ant1	88.48	0.53	2.1
NVNT	ax80	5290	Ant1	94.41	0.25	0.97



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Duty Cycle NVNT a 5260MHz Ant1

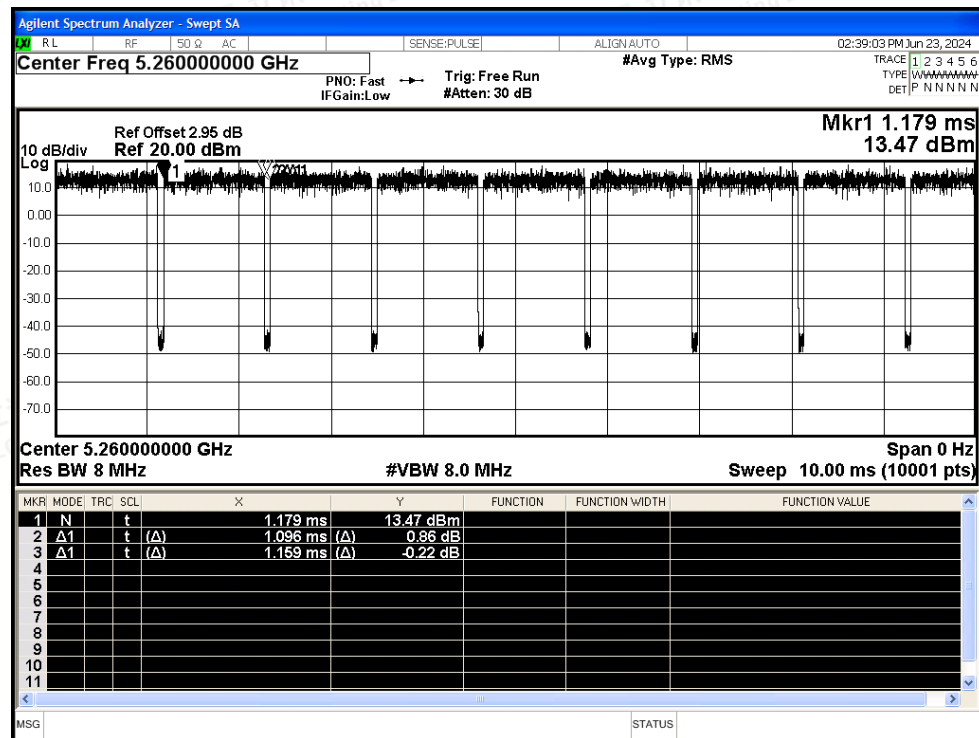

Duty Cycle NVNT a 5300MHz Ant1

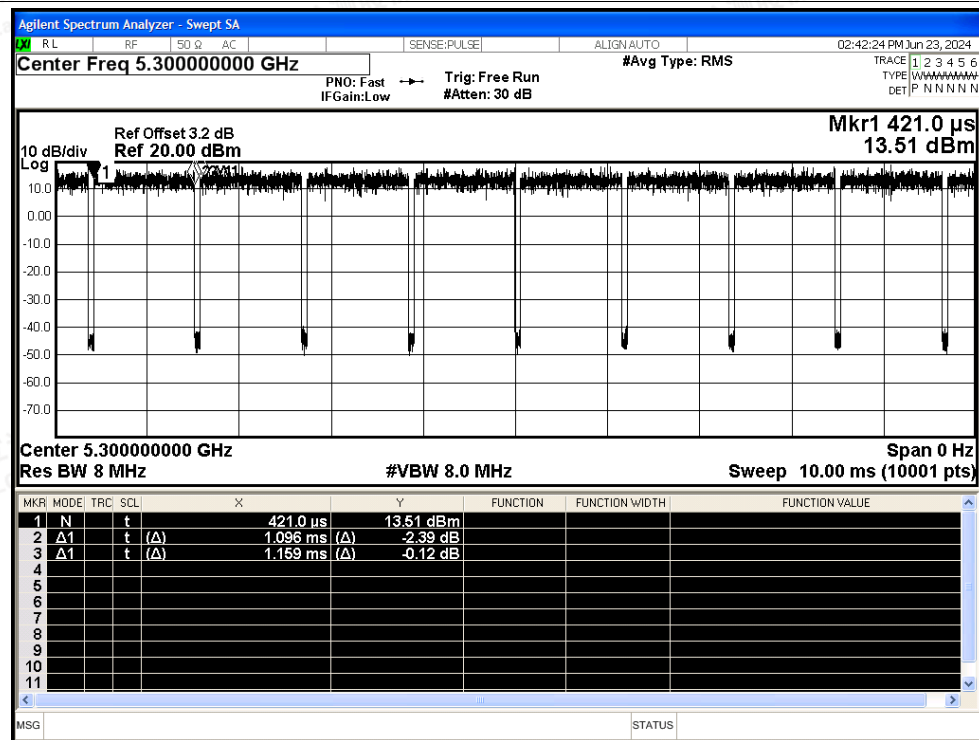

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5320MHz Ant1

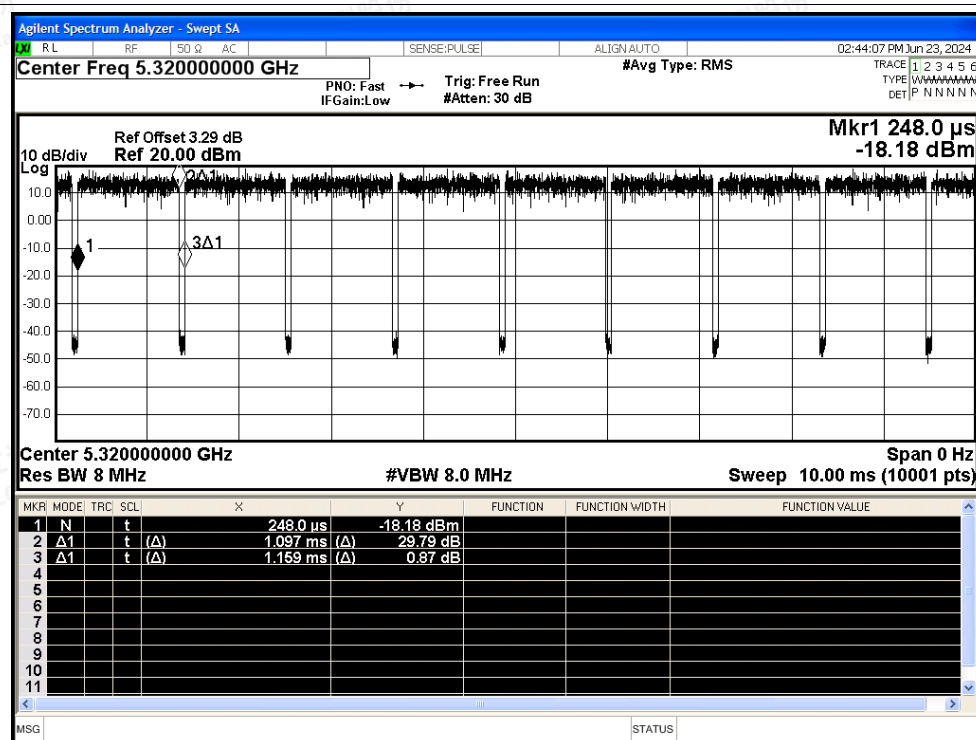

Duty Cycle NVNT n20 5260MHz Ant1

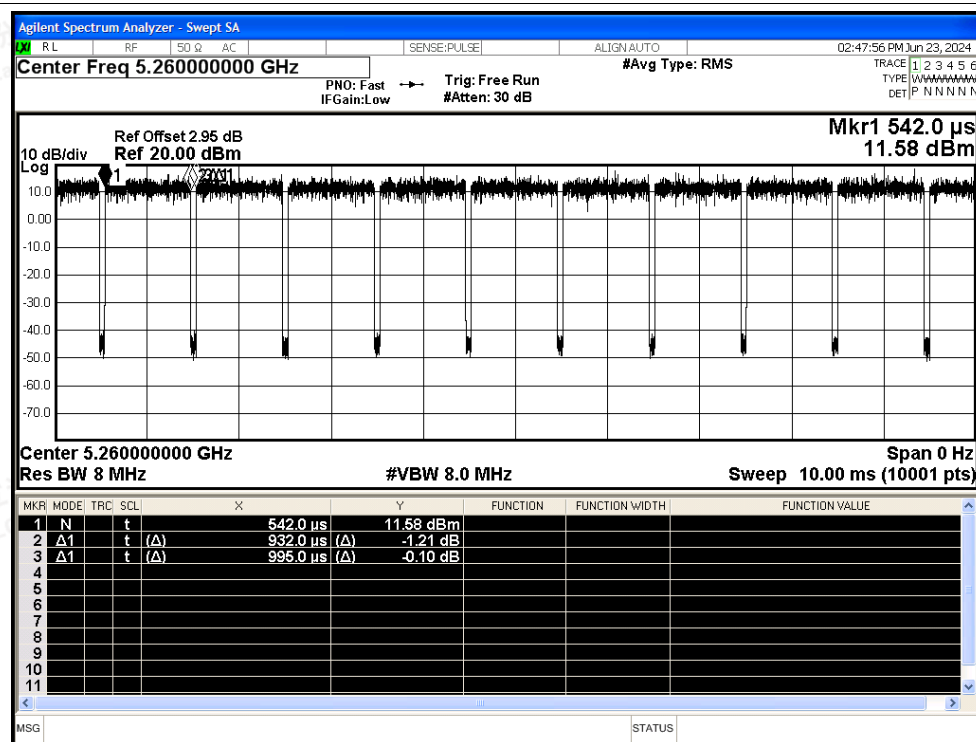

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n20 5300MHz Ant1

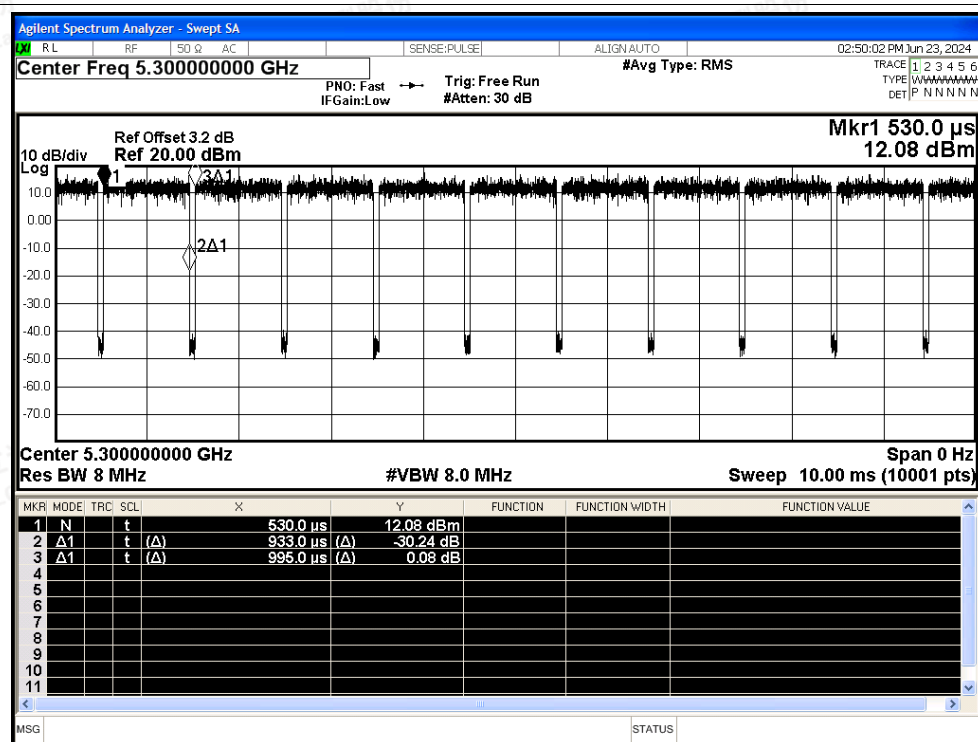

Duty Cycle NVNT n20 5320MHz Ant1


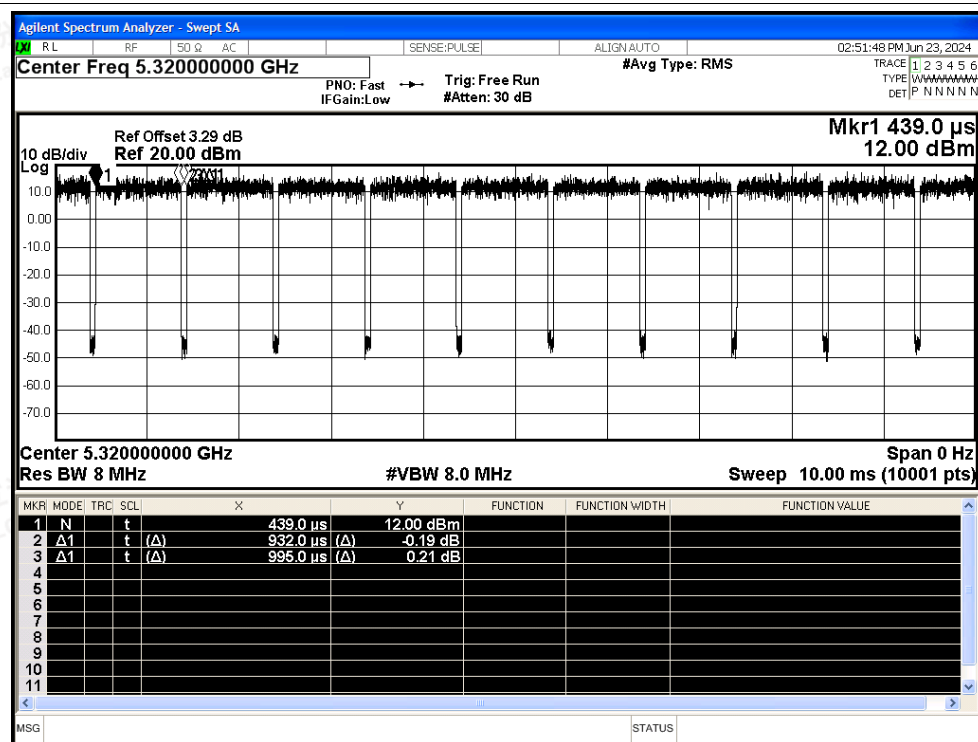


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

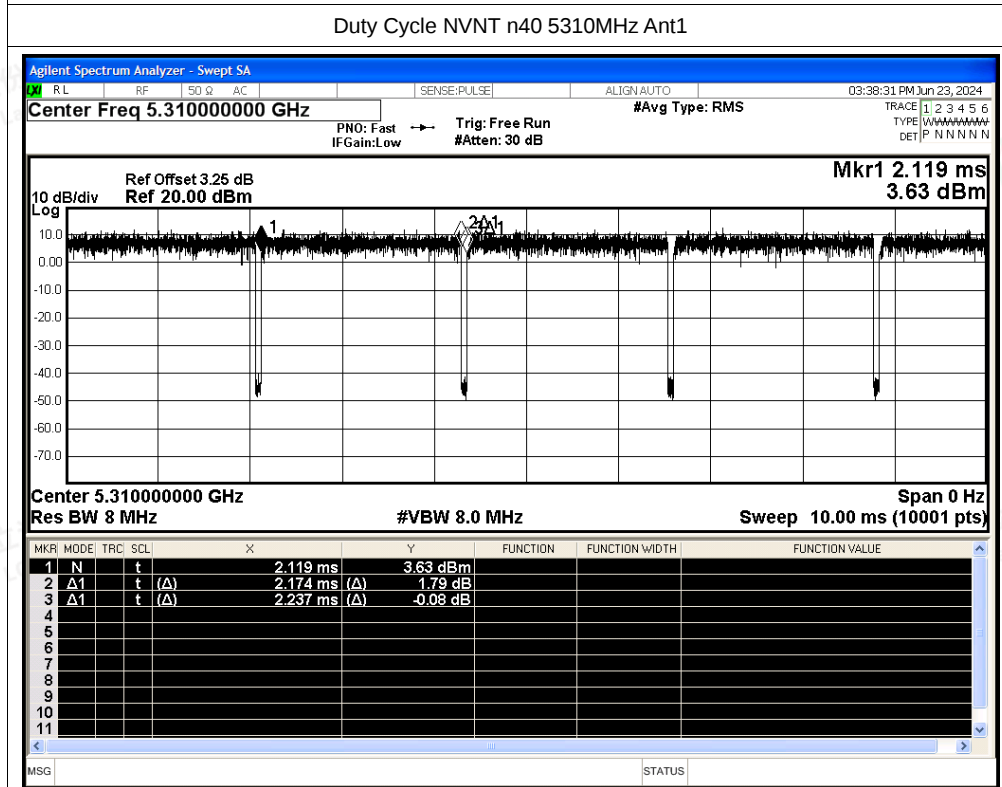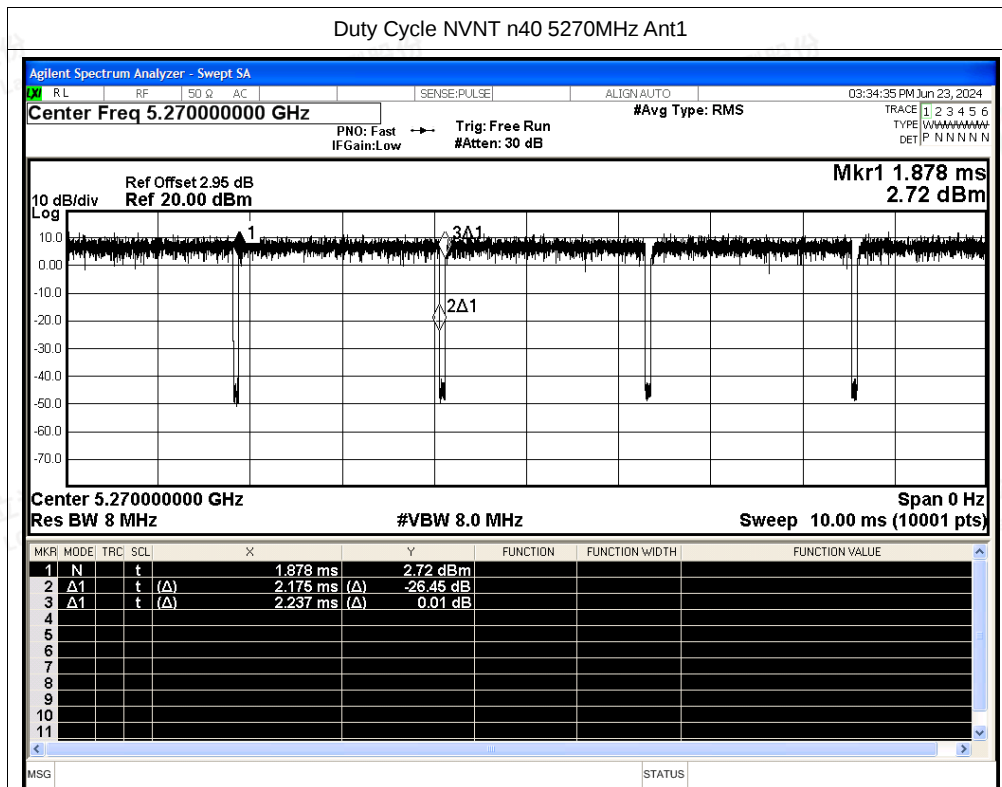

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5260MHz Ant1

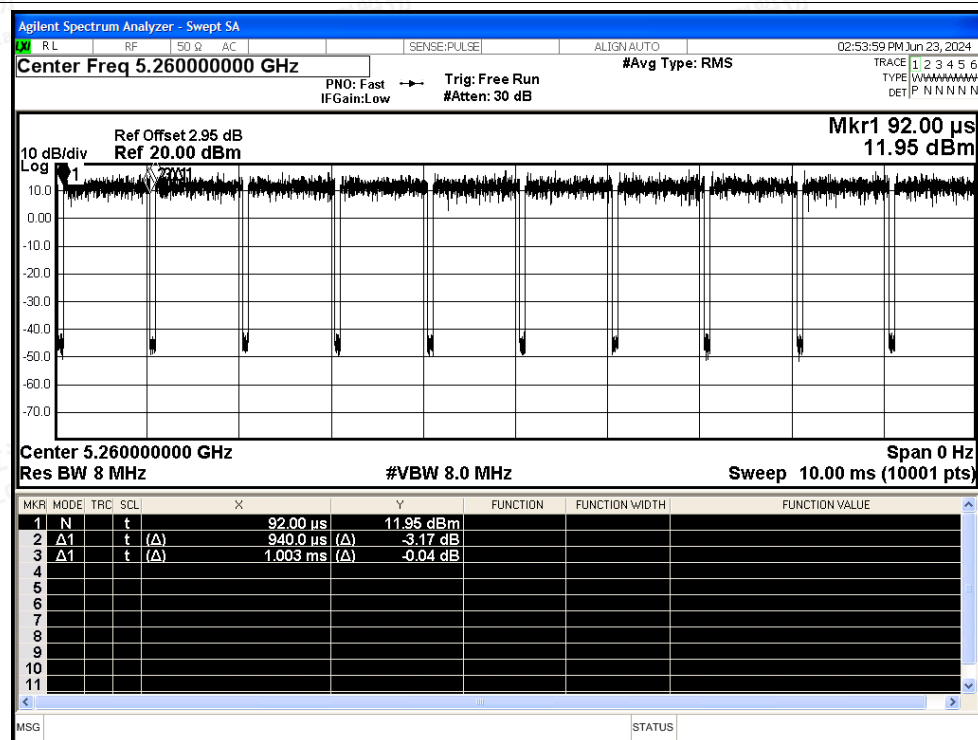

Duty Cycle NVNT ac20 5300MHz Ant1

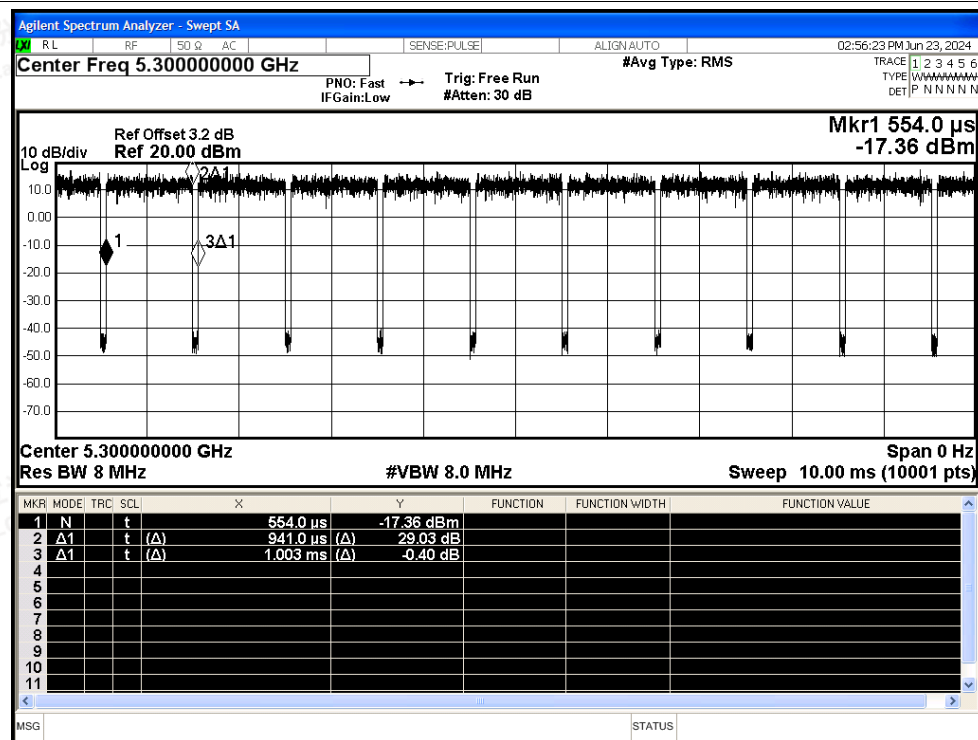

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5320MHz Ant1

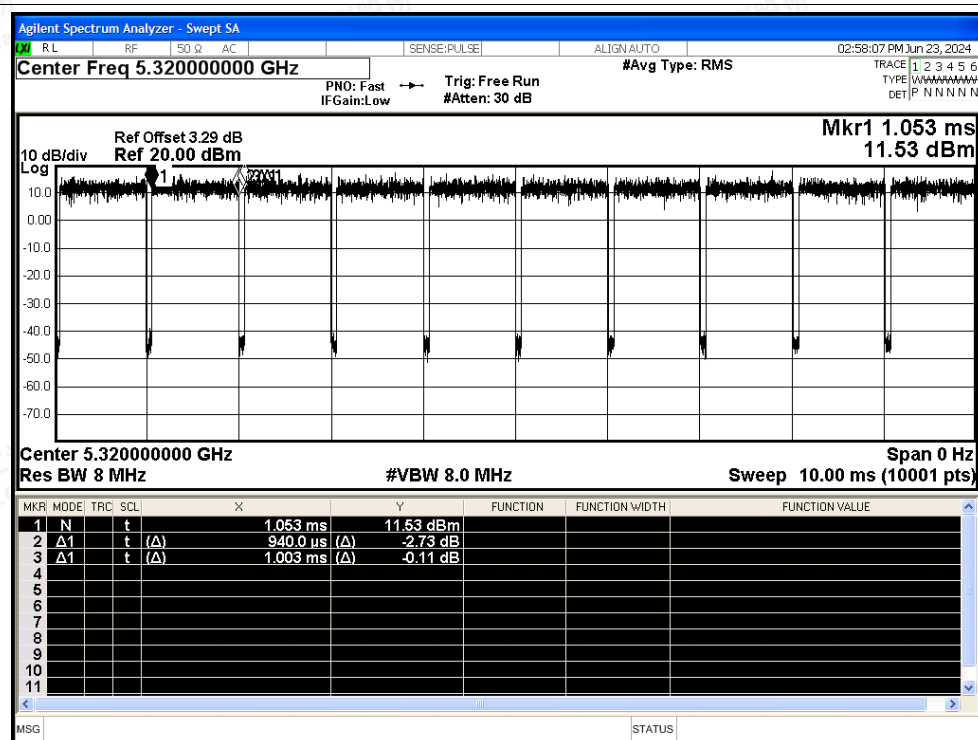

Duty Cycle NVNT ac40 5270MHz Ant1

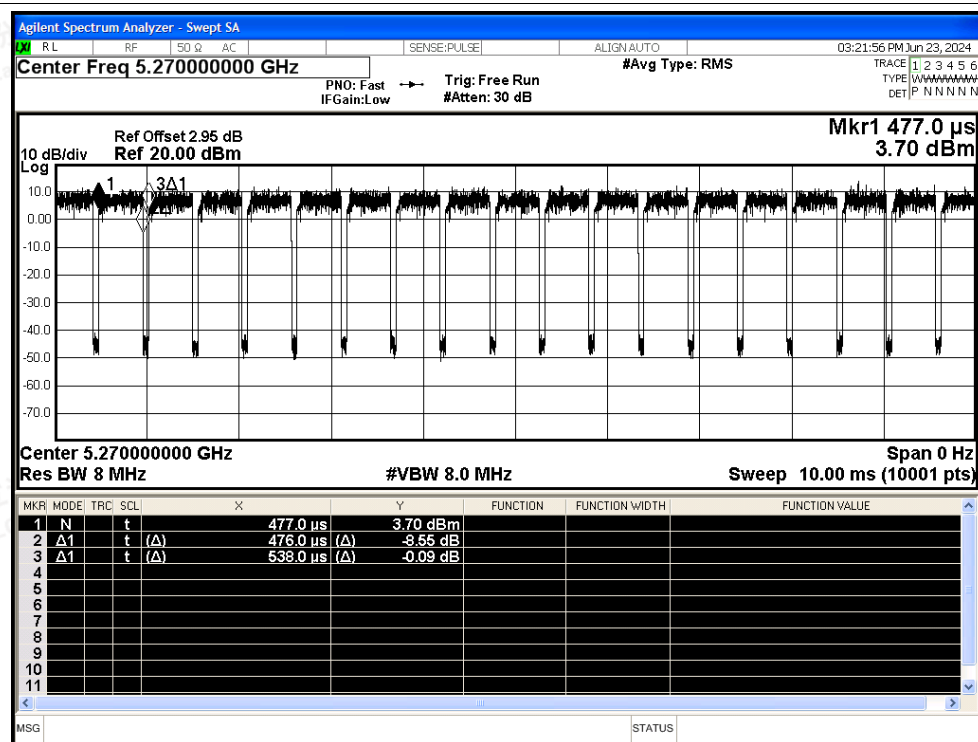

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5310MHz Ant1

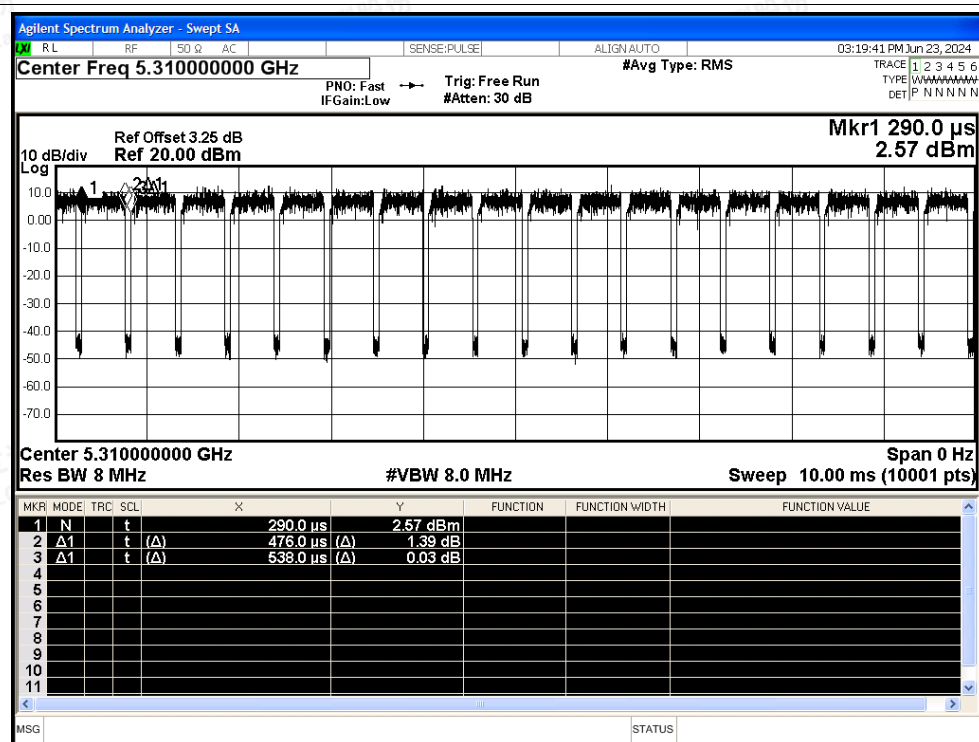

Duty Cycle NVNT ac80 5290MHz Ant1

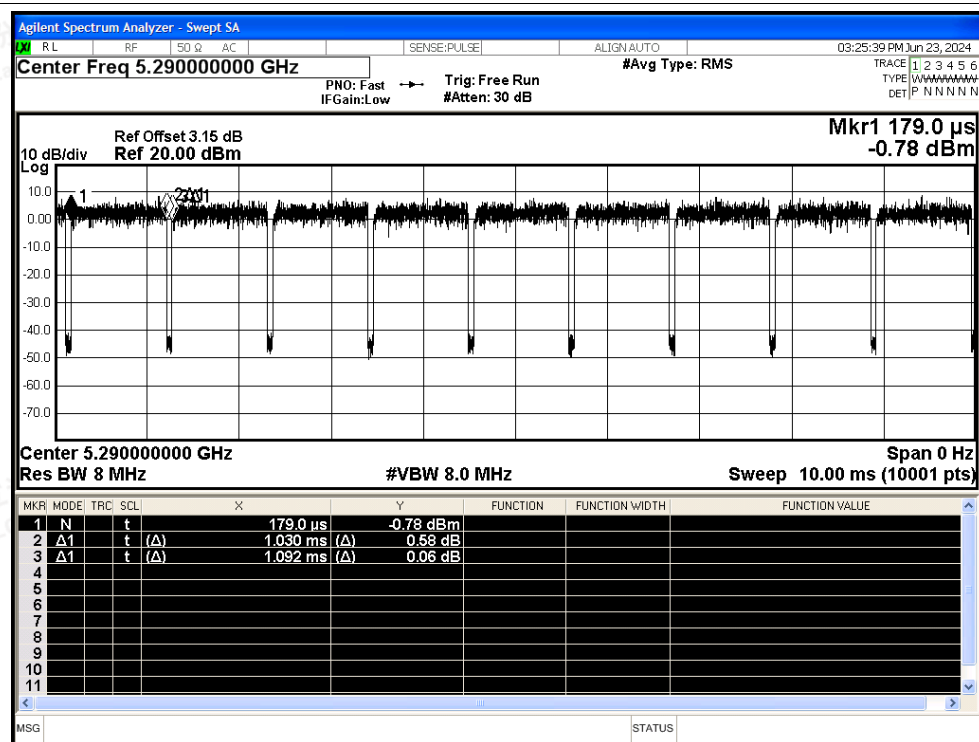

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5260MHz Ant1

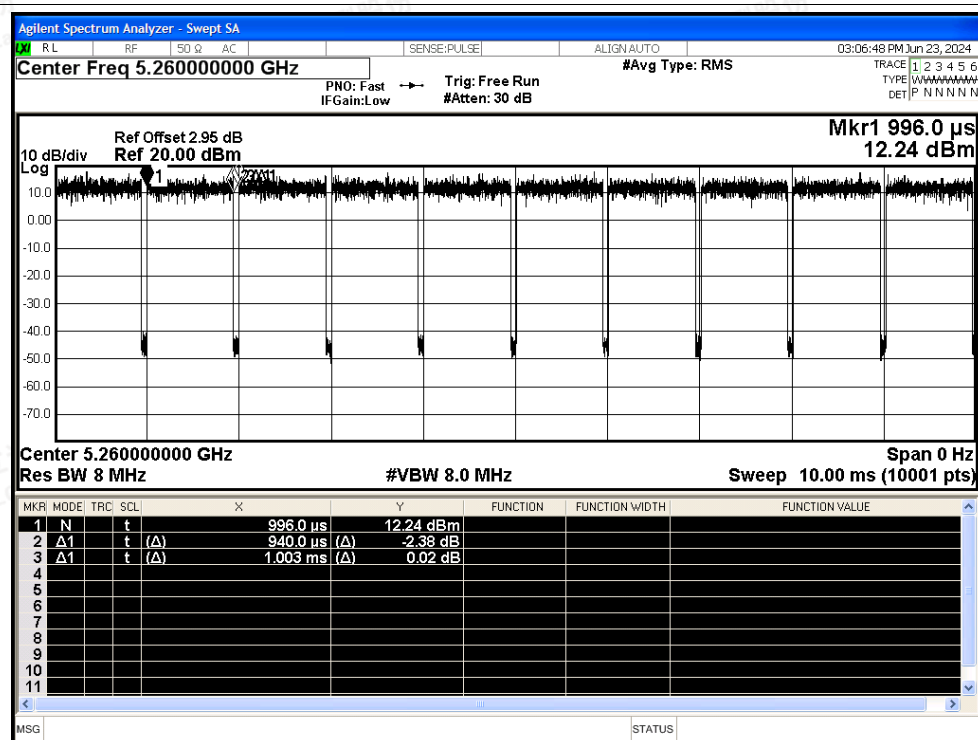

Duty Cycle NVNT ax20 5300MHz Ant1

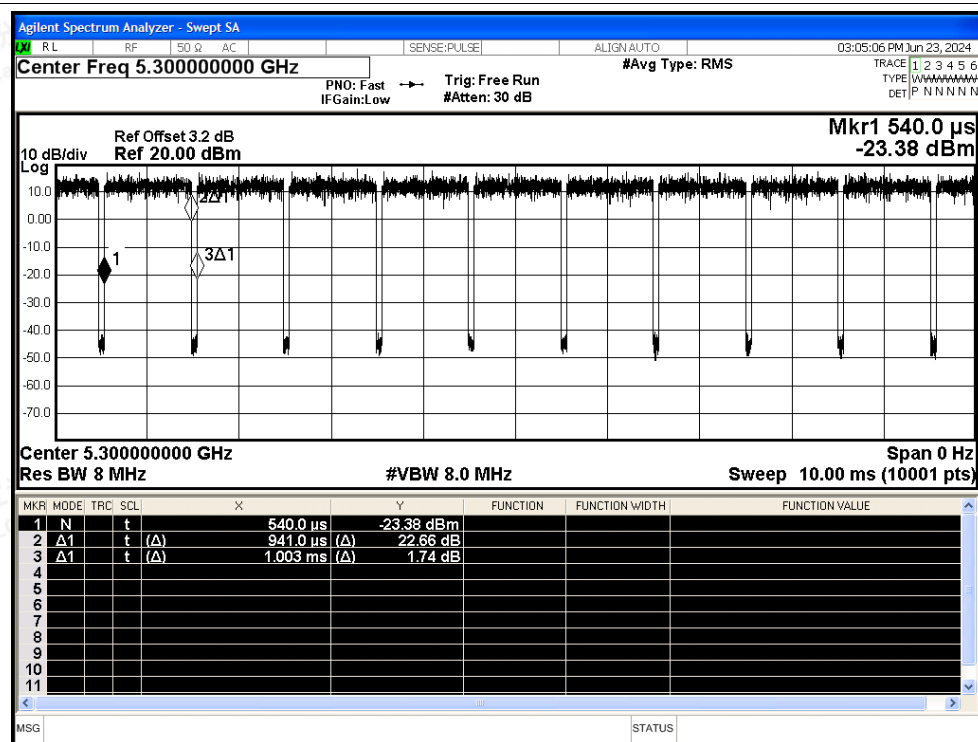

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5320MHz Ant1

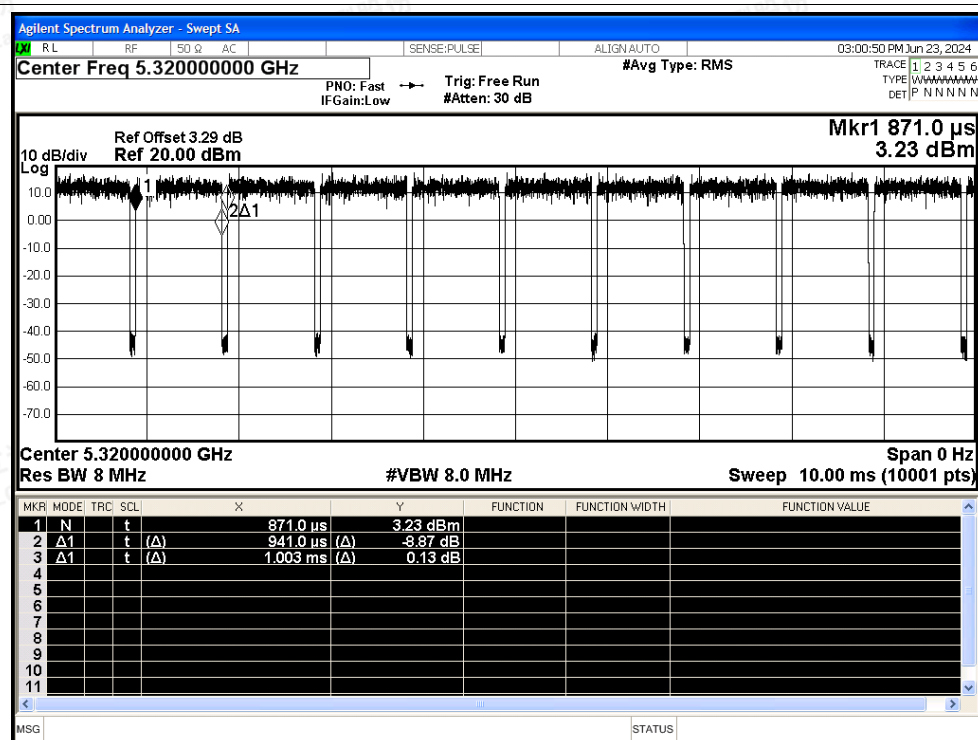

Duty Cycle NVNT ax40 5270MHz Ant1

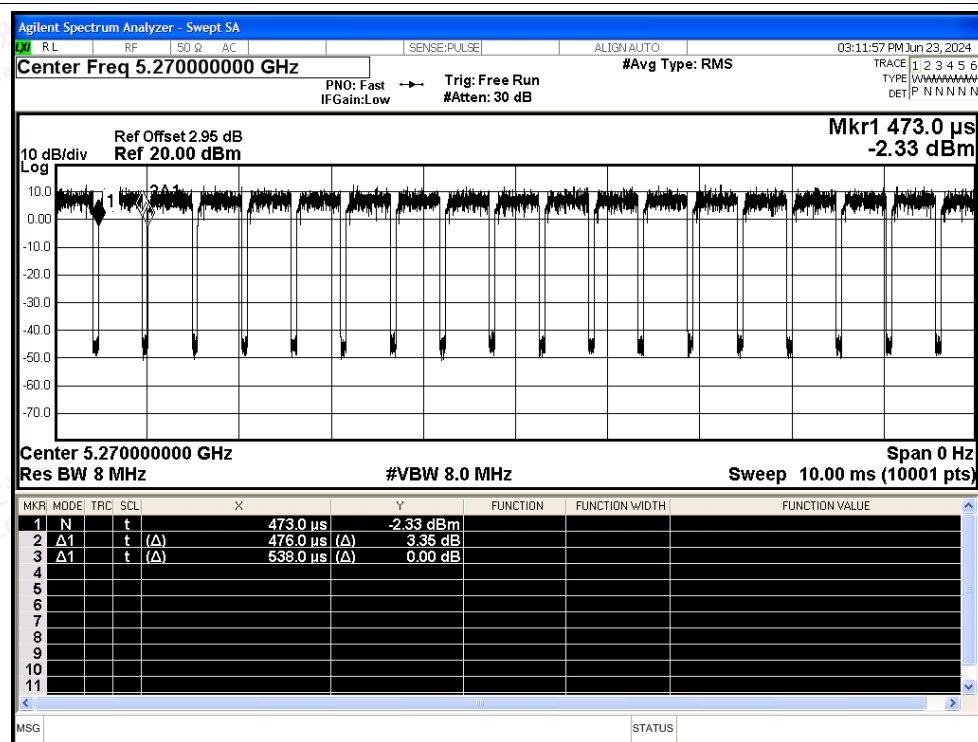

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax40 5310MHz Ant1

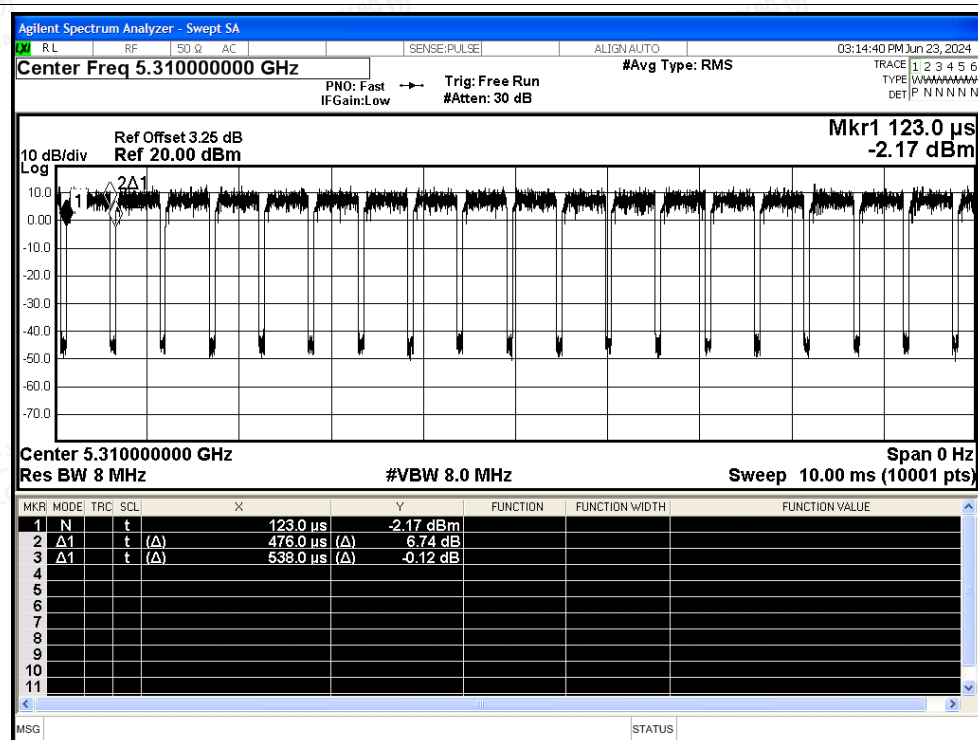

Duty Cycle NVNT ax80 5290MHz Ant1

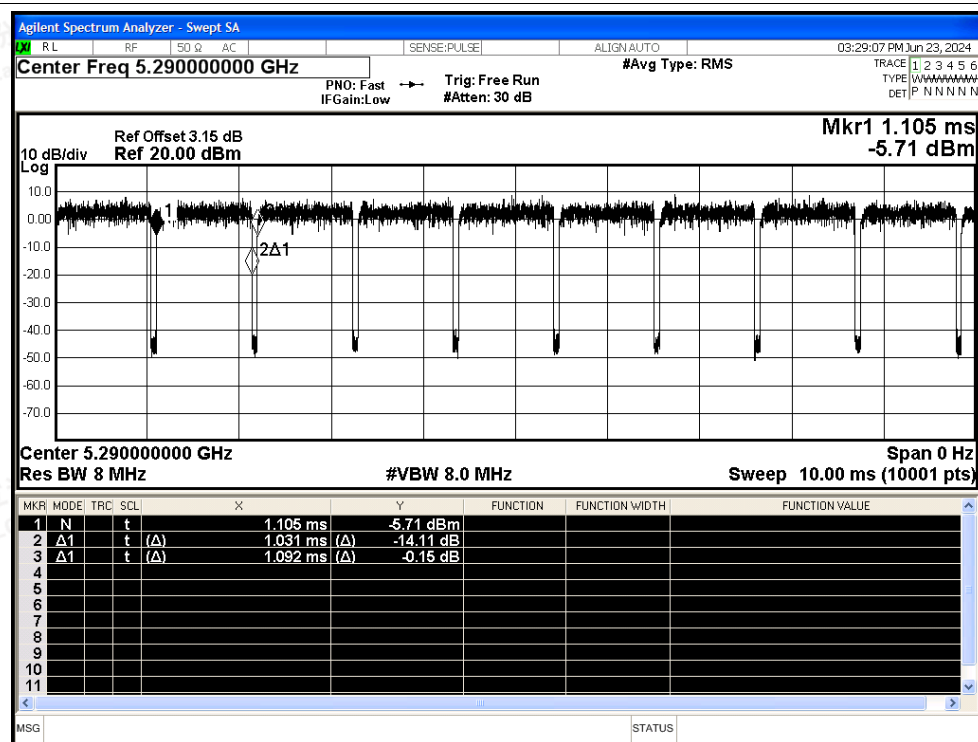

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

