





## Restrict Band NVNT ax20 5745MHz Ant0 Peak

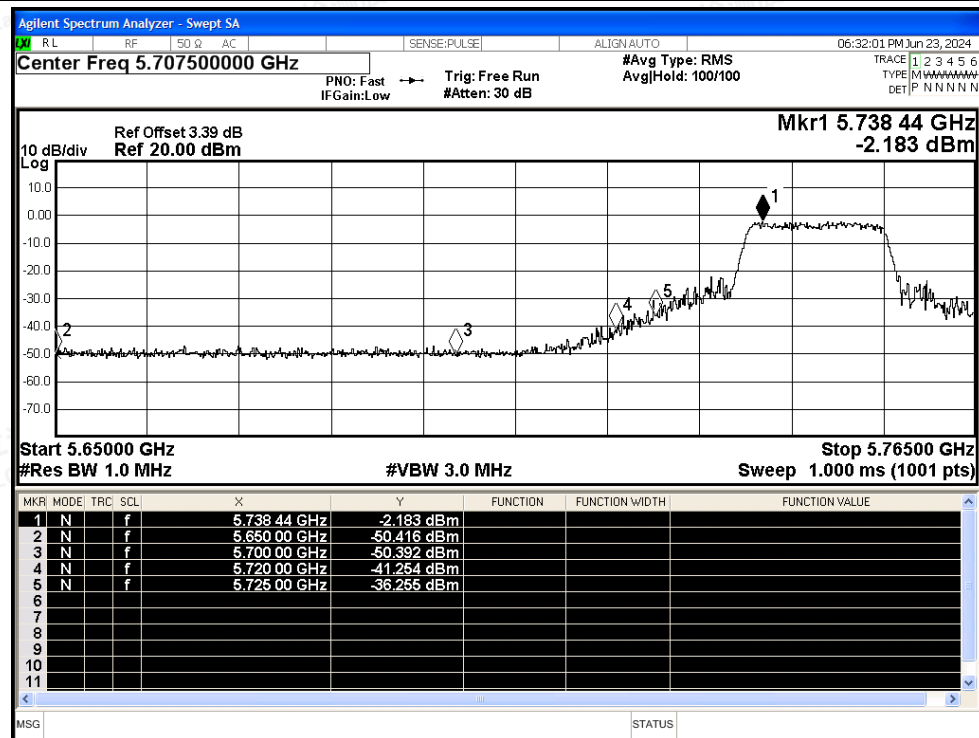

## Restrict Band NVNT ax20 5745MHz Ant0 Average

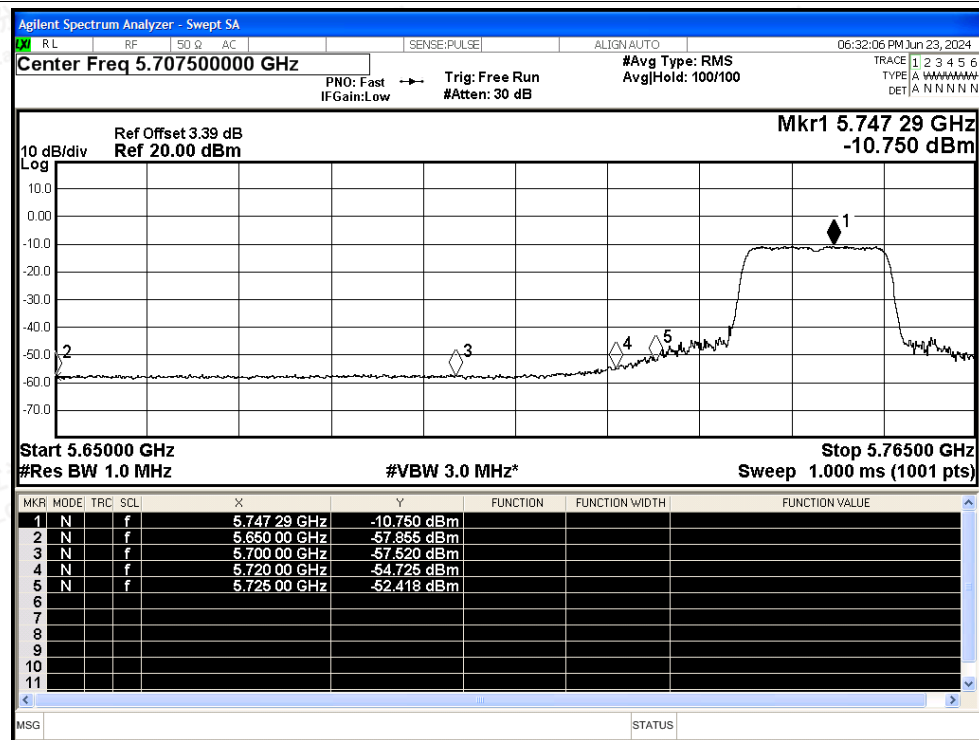

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax20 5825MHz Ant0 Peak

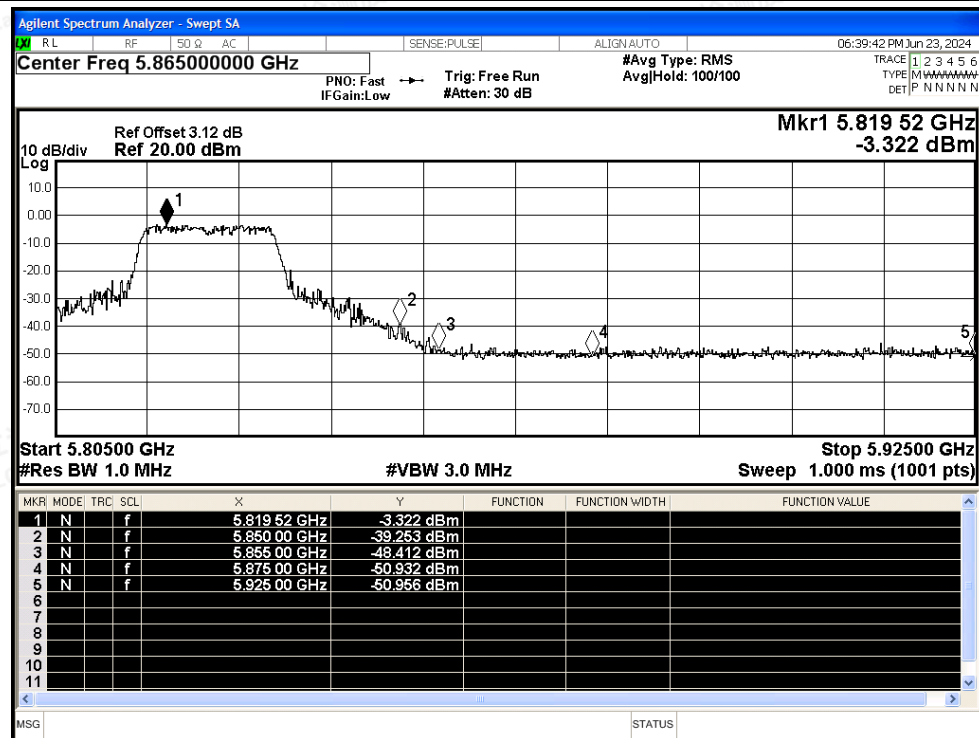

## Restrict Band NVNT ax20 5825MHz Ant0 Average

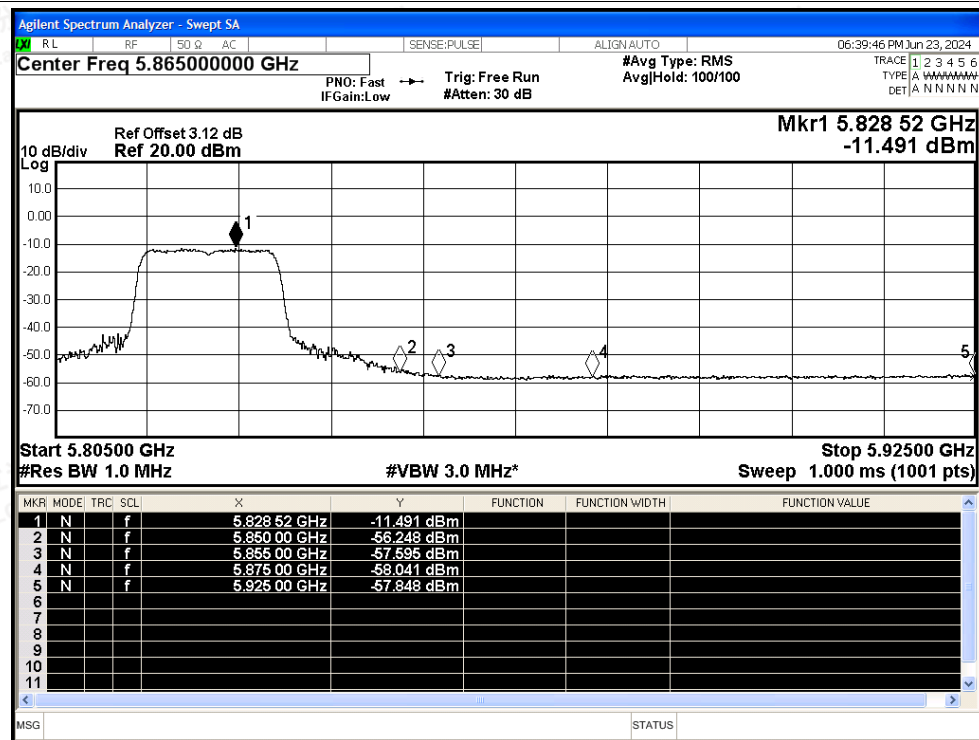

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax40 5755MHz Ant0 Peak

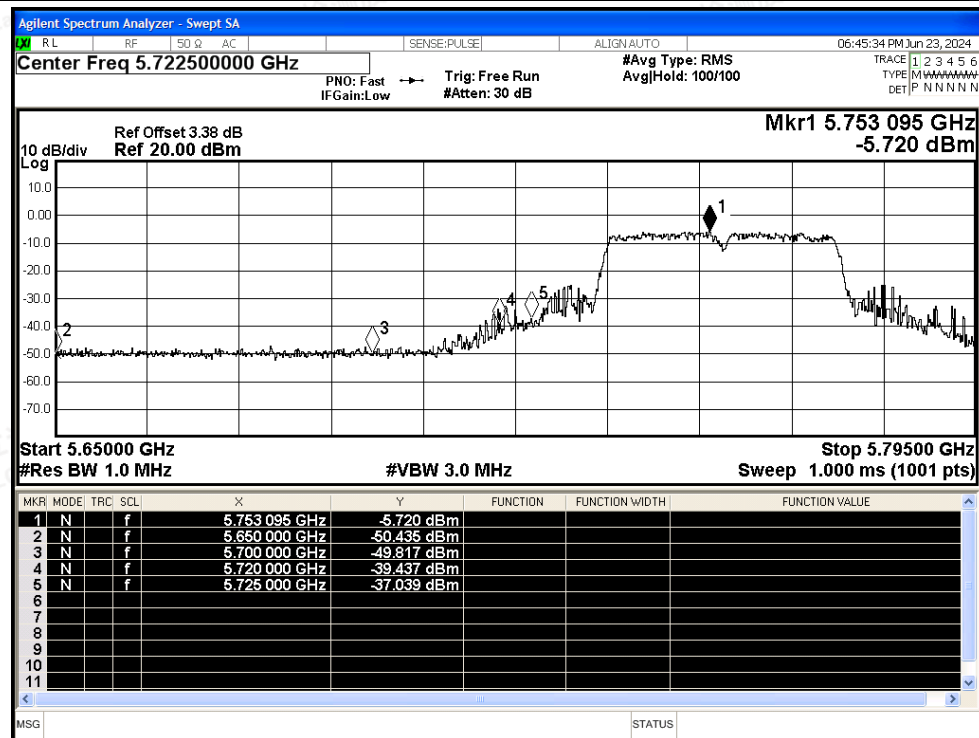

## Restrict Band NVNT ax40 5755MHz Ant0 Average

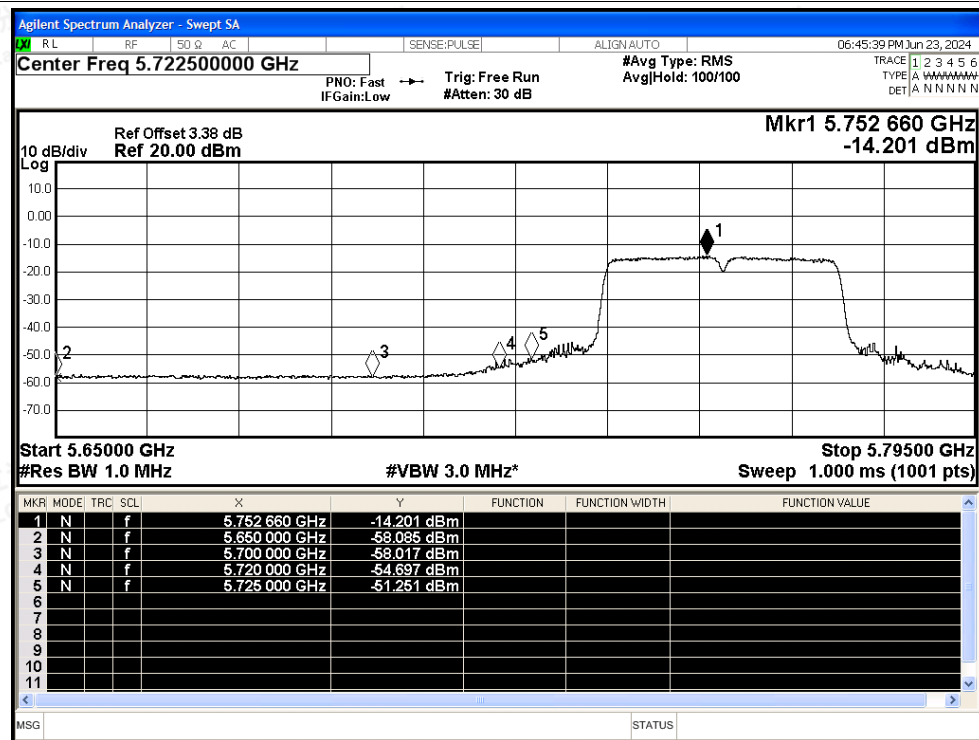

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax40 5795MHz Ant0 Peak

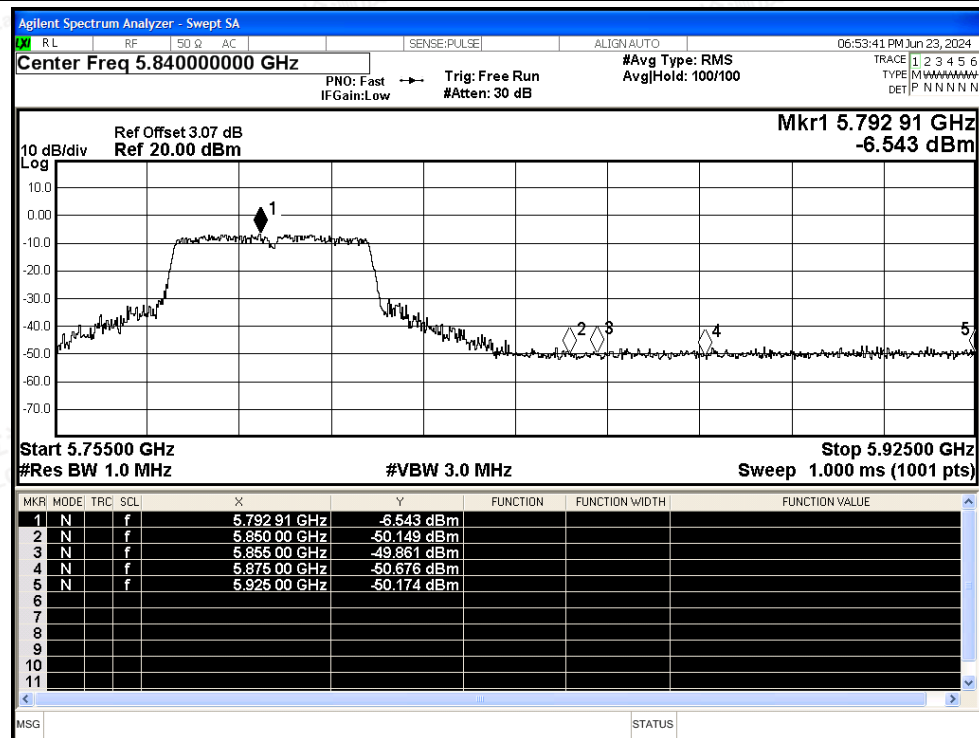

## Restrict Band NVNT ax40 5795MHz Ant0 Average

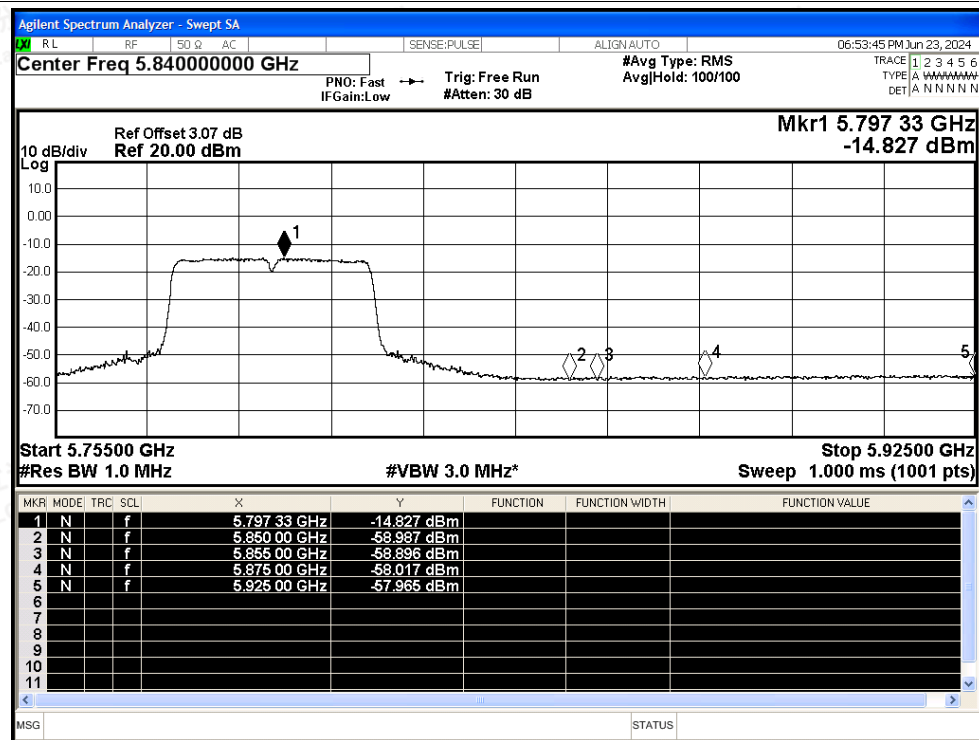

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax80 5775MHz Ant0 Peak

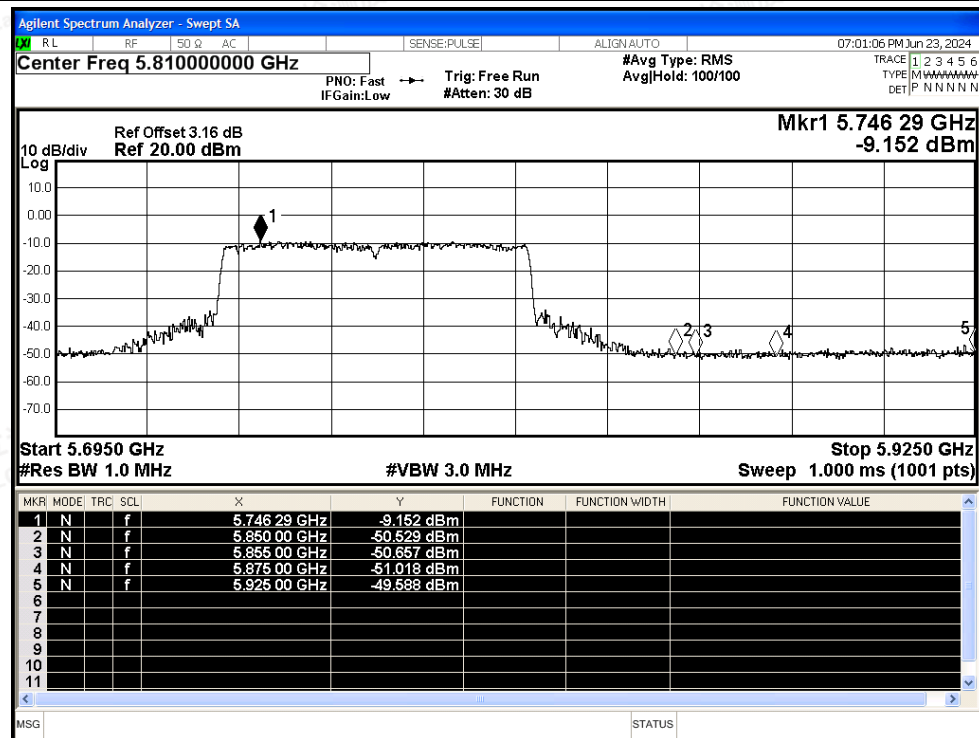

## Restrict Band NVNT ax80 5775MHz Ant0 Average

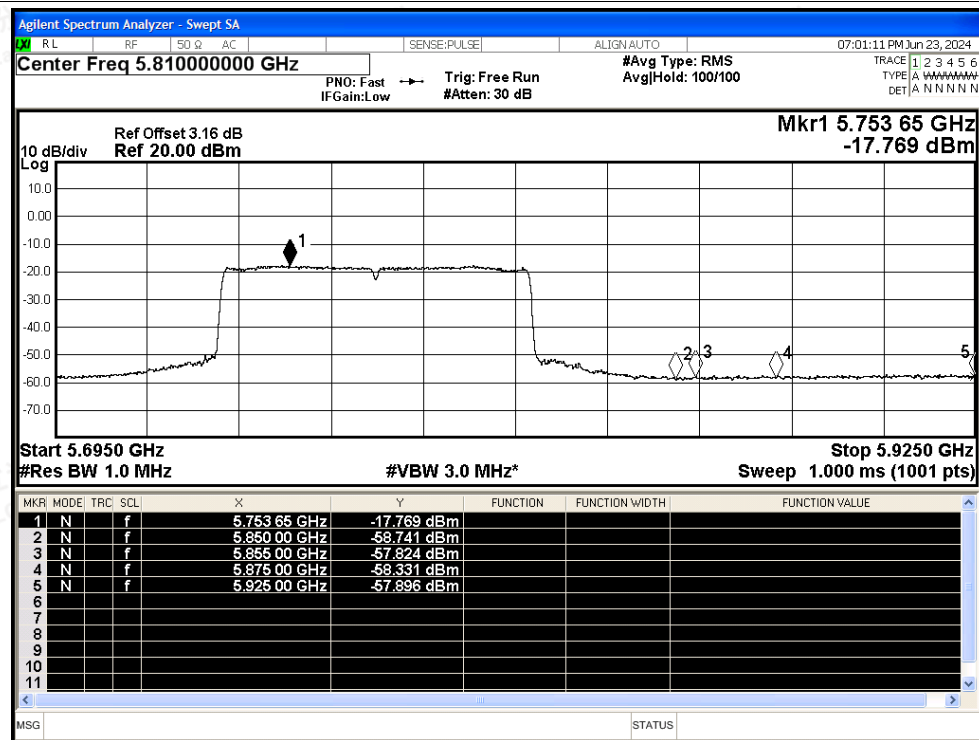

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax80 5775MHz Ant0 Peak

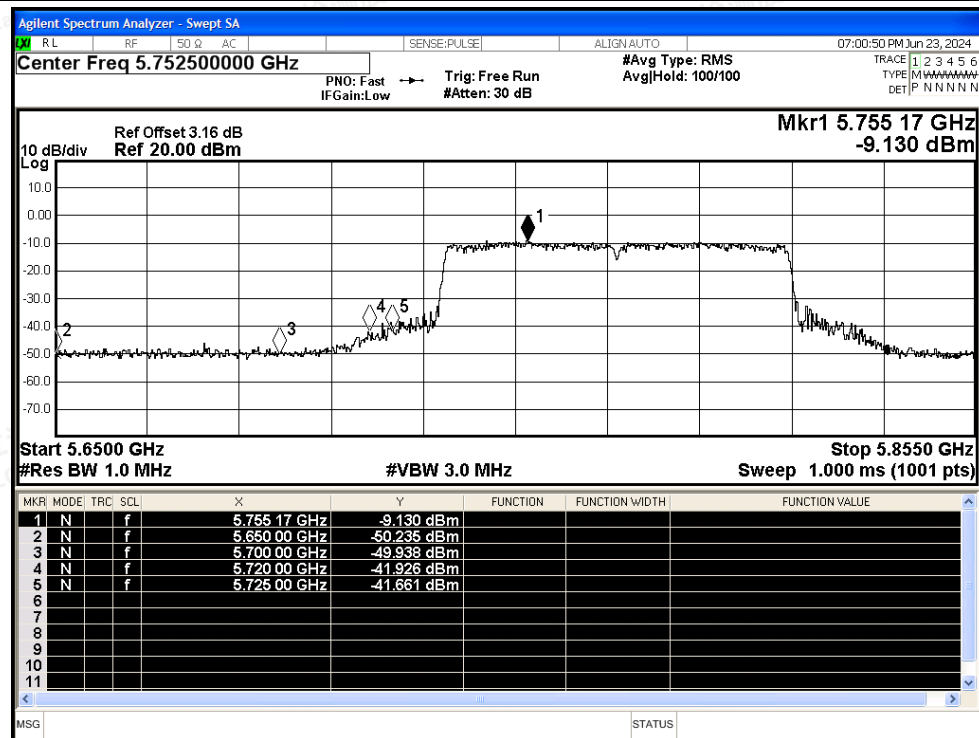

## Restrict Band NVNT ax80 5775MHz Ant0 Average

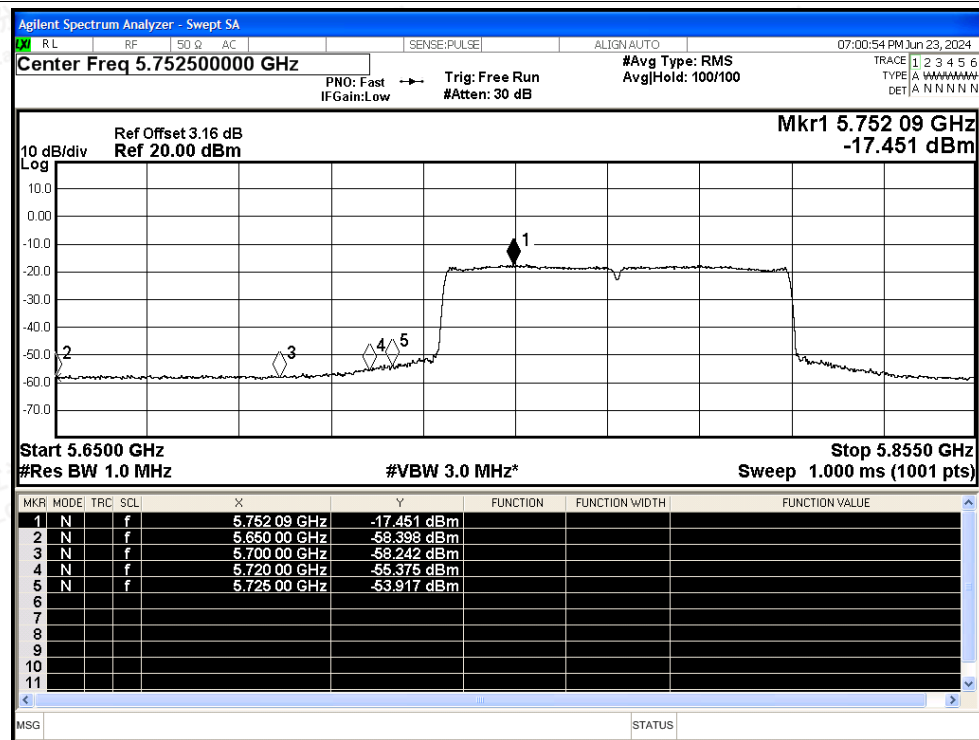

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



| Condition | Mode | Frequency (MHz) | Antenna | Spur Freq (MHz) | Power (dBm) | Gain (dBi) | Duty Factor (dB) | EIRP Power (dBm) | Detector | Limit (dBm) | Verdict |
|-----------|------|-----------------|---------|-----------------|-------------|------------|------------------|------------------|----------|-------------|---------|
| NVNT      | a    | 5745            | Ant1    | 5650            | -50.34      | 3.47       | -                | -46.87           | Peak     | -27         | Pass    |
| NVNT      | a    | 5745            | Ant1    | 5650            | -58.2       | 3.47       | 0.24             | -54.49           | Average  | -27         | Pass    |
| NVNT      | a    | 5745            | Ant1    | 5700            | -49.89      | 3.47       | -                | -46.42           | Peak     | 10          | Pass    |
| NVNT      | a    | 5745            | Ant1    | 5700            | -57.98      | 3.47       | 0.24             | -54.27           | Average  | 10          | Pass    |
| NVNT      | a    | 5745            | Ant1    | 5720            | -40.54      | 3.47       | -                | -37.07           | Peak     | 15.6        | Pass    |
| NVNT      | a    | 5745            | Ant1    | 5720            | -55.81      | 3.47       | 0.24             | -52.10           | Average  | 15.6        | Pass    |
| NVNT      | a    | 5745            | Ant1    | 5725            | -40.68      | 3.47       | -                | -37.21           | Peak     | 27          | Pass    |
| NVNT      | a    | 5745            | Ant1    | 5725            | -51.53      | 3.47       | 0.24             | -47.82           | Average  | 27          | Pass    |
| NVNT      | a    | 5825            | Ant1    | 5850            | -45.37      | 3.47       | -                | -41.90           | Peak     | 27          | Pass    |
| NVNT      | a    | 5825            | Ant1    | 5850            | -56.48      | 3.47       | 0.24             | -52.77           | Average  | 27          | Pass    |
| NVNT      | a    | 5825            | Ant1    | 5855            | -47.98      | 3.47       | -                | -44.51           | Peak     | 15.6        | Pass    |
| NVNT      | a    | 5825            | Ant1    | 5855            | -57.69      | 3.47       | 0.24             | -53.98           | Average  | 15.6        | Pass    |
| NVNT      | a    | 5825            | Ant1    | 5875            | -50.86      | 3.47       | -                | -47.39           | Peak     | 10          | Pass    |
| NVNT      | a    | 5825            | Ant1    | 5875            | -58.24      | 3.47       | 0.24             | -54.53           | Average  | 10          | Pass    |
| NVNT      | a    | 5825            | Ant1    | 5925            | -48.84      | 3.47       | -                | -45.37           | Peak     | -27         | Pass    |
| NVNT      | a    | 5825            | Ant1    | 5925            | -57.52      | 3.47       | 0.24             | -53.81           | Average  | -27         | Pass    |
| NVNT      | n20  | 5745            | Ant1    | 5650            | -49.34      | 3.47       | -                | -45.87           | Peak     | -27         | Pass    |
| NVNT      | n20  | 5745            | Ant1    | 5650            | -57.6       | 3.47       | 0.28             | -53.85           | Average  | -27         | Pass    |
| NVNT      | n20  | 5745            | Ant1    | 5700            | -51.16      | 3.47       | -                | -47.69           | Peak     | 10          | Pass    |
| NVNT      | n20  | 5745            | Ant1    | 5700            | -57.51      | 3.47       | 0.28             | -53.76           | Average  | 10          | Pass    |
| NVNT      | n20  | 5745            | Ant1    | 5720            | -42.14      | 3.47       | -                | -38.67           | Peak     | 15.6        | Pass    |
| NVNT      | n20  | 5745            | Ant1    | 5720            | -55.1       | 3.47       | 0.28             | -51.35           | Average  | 15.6        | Pass    |
| NVNT      | n20  | 5745            | Ant1    | 5725            | -35.49      | 3.47       | -                | -32.02           | Peak     | 27          | Pass    |
| NVNT      | n20  | 5745            | Ant1    | 5725            | -51.11      | 3.47       | 0.28             | -47.36           | Average  | 27          | Pass    |
| NVNT      | n20  | 5825            | Ant1    | 5850            | -40.13      | 3.47       | -                | -36.66           | Peak     | 27          | Pass    |
| NVNT      | n20  | 5825            | Ant1    | 5850            | -55.73      | 3.47       | 0.28             | -51.98           | Average  | 27          | Pass    |
| NVNT      | n20  | 5825            | Ant1    | 5855            | -48.05      | 3.47       | -                | -44.58           | Peak     | 15.6        | Pass    |
| NVNT      | n20  | 5825            | Ant1    | 5855            | -57.4       | 3.47       | 0.28             | -53.65           | Average  | 15.6        | Pass    |
| NVNT      | n20  | 5825            | Ant1    | 5875            | -48.79      | 3.47       | -                | -45.32           | Peak     | 10          | Pass    |
| NVNT      | n20  | 5825            | Ant1    | 5875            | -58.14      | 3.47       | 0.28             | -54.39           | Average  | 10          | Pass    |
| NVNT      | n20  | 5825            | Ant1    | 5925            | -50.6       | 3.47       | -                | -47.13           | Peak     | -27         | Pass    |
| NVNT      | n20  | 5825            | Ant1    | 5925            | -57.33      | 3.47       | 0.28             | -53.58           | Average  | -27         | Pass    |
| NVNT      | n40  | 5755            | Ant1    | 5650            | -49.61      | 3.47       | -                | -46.14           | Peak     | -27         | Pass    |
| NVNT      | n40  | 5755            | Ant1    | 5650            | -57.64      | 3.47       | 0.12             | -54.05           | Average  | -27         | Pass    |
| NVNT      | n40  | 5755            | Ant1    | 5700            | -51.39      | 3.47       | -                | -47.92           | Peak     | 10          | Pass    |
| NVNT      | n40  | 5755            | Ant1    | 5700            | -57.72      | 3.47       | 0.12             | -54.13           | Average  | 10          | Pass    |
| NVNT      | n40  | 5755            | Ant1    | 5720            | -39.88      | 3.47       | -                | -36.41           | Peak     | 15.6        | Pass    |
| NVNT      | n40  | 5755            | Ant1    | 5720            | -54.73      | 3.47       | 0.12             | -51.14           | Average  | 15.6        | Pass    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|      |      |      |      |      |        |      |      |        |         |      |      |
|------|------|------|------|------|--------|------|------|--------|---------|------|------|
| NVNT | n40  | 5755 | Ant1 | 5725 | -37.67 | 3.47 | -    | -34.20 | Peak    | 27   | Pass |
| NVNT | n40  | 5755 | Ant1 | 5725 | -52.66 | 3.47 | 0.12 | -49.07 | Average | 27   | Pass |
| NVNT | n40  | 5795 | Ant1 | 5850 | -47.79 | 3.47 | -    | -44.32 | Peak    | 27   | Pass |
| NVNT | n40  | 5795 | Ant1 | 5850 | -59.05 | 3.47 | 0.12 | -55.46 | Average | 27   | Pass |
| NVNT | n40  | 5795 | Ant1 | 5855 | -50.59 | 3.47 | -    | -47.12 | Peak    | 15.6 | Pass |
| NVNT | n40  | 5795 | Ant1 | 5855 | -58.83 | 3.47 | 0.12 | -55.24 | Average | 15.6 | Pass |
| NVNT | n40  | 5795 | Ant1 | 5875 | -49.53 | 3.47 | -    | -46.06 | Peak    | 10   | Pass |
| NVNT | n40  | 5795 | Ant1 | 5875 | -57.73 | 3.47 | 0.12 | -54.14 | Average | 10   | Pass |
| NVNT | n40  | 5795 | Ant1 | 5925 | -49    | 3.47 | -    | -45.53 | Peak    | -27  | Pass |
| NVNT | n40  | 5795 | Ant1 | 5925 | -58.2  | 3.47 | 0.12 | -54.61 | Average | -27  | Pass |
| NVNT | ac20 | 5745 | Ant1 | 5650 | -50.36 | 3.47 | -    | -46.89 | Peak    | -27  | Pass |
| NVNT | ac20 | 5745 | Ant1 | 5650 | -58.1  | 3.47 | 0.28 | -54.35 | Average | -27  | Pass |
| NVNT | ac20 | 5745 | Ant1 | 5700 | -50.36 | 3.47 | -    | -46.89 | Peak    | 10   | Pass |
| NVNT | ac20 | 5745 | Ant1 | 5700 | -57.74 | 3.47 | 0.28 | -53.99 | Average | 10   | Pass |
| NVNT | ac20 | 5745 | Ant1 | 5720 | -42.81 | 3.47 | -    | -39.34 | Peak    | 15.6 | Pass |
| NVNT | ac20 | 5745 | Ant1 | 5720 | -54.58 | 3.47 | 0.28 | -50.83 | Average | 15.6 | Pass |
| NVNT | ac20 | 5745 | Ant1 | 5725 | -35.31 | 3.47 | -    | -31.84 | Peak    | 27   | Pass |
| NVNT | ac20 | 5745 | Ant1 | 5725 | -49.11 | 3.47 | 0.28 | -45.36 | Average | 27   | Pass |
| NVNT | ac20 | 5825 | Ant1 | 5850 | -37.35 | 3.47 | -    | -33.88 | Peak    | 27   | Pass |
| NVNT | ac20 | 5825 | Ant1 | 5850 | -56.26 | 3.47 | 0.28 | -52.51 | Average | 27   | Pass |
| NVNT | ac20 | 5825 | Ant1 | 5855 | -47.93 | 3.47 | -    | -44.46 | Peak    | 15.6 | Pass |
| NVNT | ac20 | 5825 | Ant1 | 5855 | -57.5  | 3.47 | 0.28 | -53.75 | Average | 15.6 | Pass |
| NVNT | ac20 | 5825 | Ant1 | 5875 | -49.36 | 3.47 | -    | -45.89 | Peak    | 10   | Pass |
| NVNT | ac20 | 5825 | Ant1 | 5875 | -58.57 | 3.47 | 0.28 | -54.82 | Average | 10   | Pass |
| NVNT | ac20 | 5825 | Ant1 | 5925 | -49.87 | 3.47 | -    | -46.40 | Peak    | -27  | Pass |
| NVNT | ac20 | 5825 | Ant1 | 5925 | -57.67 | 3.47 | 0.28 | -53.92 | Average | -27  | Pass |
| NVNT | ac40 | 5755 | Ant1 | 5650 | -49.65 | 3.47 | -    | -46.18 | Peak    | -27  | Pass |
| NVNT | ac40 | 5755 | Ant1 | 5650 | -57.64 | 3.47 | 0.12 | -54.05 | Average | -27  | Pass |
| NVNT | ac40 | 5755 | Ant1 | 5700 | -49.69 | 3.47 | -    | -46.22 | Peak    | 10   | Pass |
| NVNT | ac40 | 5755 | Ant1 | 5700 | -57.69 | 3.47 | 0.12 | -54.10 | Average | 10   | Pass |
| NVNT | ac40 | 5755 | Ant1 | 5720 | -42.59 | 3.47 | -    | -39.12 | Peak    | 15.6 | Pass |
| NVNT | ac40 | 5755 | Ant1 | 5720 | -53.78 | 3.47 | 0.12 | -50.19 | Average | 15.6 | Pass |
| NVNT | ac40 | 5755 | Ant1 | 5725 | -37.96 | 3.47 | -    | -34.49 | Peak    | 27   | Pass |
| NVNT | ac40 | 5755 | Ant1 | 5725 | -53.67 | 3.47 | 0.12 | -50.08 | Average | 27   | Pass |
| NVNT | ac40 | 5795 | Ant1 | 5850 | -48.24 | 3.47 | -    | -44.77 | Peak    | 27   | Pass |
| NVNT | ac40 | 5795 | Ant1 | 5850 | -56.2  | 3.47 | 0.12 | -52.61 | Average | 27   | Pass |
| NVNT | ac40 | 5795 | Ant1 | 5855 | -47.62 | 3.47 | -    | -44.15 | Peak    | 15.6 | Pass |
| NVNT | ac40 | 5795 | Ant1 | 5855 | -56.91 | 3.47 | 0.12 | -53.32 | Average | 15.6 | Pass |
| NVNT | ac40 | 5795 | Ant1 | 5875 | -50.09 | 3.47 | -    | -46.62 | Peak    | 10   | Pass |
| NVNT | ac40 | 5795 | Ant1 | 5875 | -57.77 | 3.47 | 0.12 | -54.18 | Average | 10   | Pass |
| NVNT | ac40 | 5795 | Ant1 | 5925 | -49.1  | 3.47 | -    | -45.63 | Peak    | -27  | Pass |
| NVNT | ac40 | 5795 | Ant1 | 5925 | -57.64 | 3.47 | 0.12 | -54.05 | Average | -27  | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|      |      |      |      |      |        |      |      |        |         |      |      |
|------|------|------|------|------|--------|------|------|--------|---------|------|------|
| NVNT | ac80 | 5775 | Ant1 | 5850 | -50.41 | 3.47 | -    | -46.94 | Peak    | 27   | Pass |
| NVNT | ac80 | 5775 | Ant1 | 5850 | -58.08 | 3.47 | 0.25 | -54.36 | Average | 27   | Pass |
| NVNT | ac80 | 5775 | Ant1 | 5855 | -49.82 | 3.47 | -    | -46.35 | Peak    | 15.6 | Pass |
| NVNT | ac80 | 5775 | Ant1 | 5855 | -58.08 | 3.47 | 0.25 | -54.36 | Average | 15.6 | Pass |
| NVNT | ac80 | 5775 | Ant1 | 5875 | -50.24 | 3.47 | -    | -46.77 | Peak    | 10   | Pass |
| NVNT | ac80 | 5775 | Ant1 | 5875 | -58    | 3.47 | 0.25 | -54.28 | Average | 10   | Pass |
| NVNT | ac80 | 5775 | Ant1 | 5925 | -50.41 | 3.47 | -    | -46.94 | Peak    | -27  | Pass |
| NVNT | ac80 | 5775 | Ant1 | 5925 | -58.21 | 3.47 | 0.25 | -54.49 | Average | -27  | Pass |
| NVNT | ac80 | 5775 | Ant1 | 5650 | -50.81 | 3.47 | -    | -47.34 | Peak    | -27  | Pass |
| NVNT | ac80 | 5775 | Ant1 | 5650 | -58.39 | 3.47 | 0.25 | -54.67 | Average | -27  | Pass |
| NVNT | ac80 | 5775 | Ant1 | 5700 | -50.67 | 3.47 | -    | -47.20 | Peak    | 10   | Pass |
| NVNT | ac80 | 5775 | Ant1 | 5700 | -58.07 | 3.47 | 0.25 | -54.35 | Average | 10   | Pass |
| NVNT | ac80 | 5775 | Ant1 | 5720 | -41.1  | 3.47 | -    | -37.63 | Peak    | 15.6 | Pass |
| NVNT | ac80 | 5775 | Ant1 | 5720 | -55.14 | 3.47 | 0.25 | -51.42 | Average | 15.6 | Pass |
| NVNT | ac80 | 5775 | Ant1 | 5725 | -41.32 | 3.47 | -    | -37.85 | Peak    | 27   | Pass |
| NVNT | ac80 | 5775 | Ant1 | 5725 | -54.08 | 3.47 | 0.25 | -50.36 | Average | 27   | Pass |
| NVNT | ax20 | 5745 | Ant1 | 5650 | -48.92 | 3.47 | -    | -45.45 | Peak    | -27  | Pass |
| NVNT | ax20 | 5745 | Ant1 | 5650 | -57.81 | 3.47 | 0.28 | -54.06 | Average | -27  | Pass |
| NVNT | ax20 | 5745 | Ant1 | 5700 | -48.58 | 3.47 | -    | -45.11 | Peak    | 10   | Pass |
| NVNT | ax20 | 5745 | Ant1 | 5700 | -58.06 | 3.47 | 0.28 | -54.31 | Average | 10   | Pass |
| NVNT | ax20 | 5745 | Ant1 | 5720 | -41.6  | 3.47 | -    | -38.13 | Peak    | 15.6 | Pass |
| NVNT | ax20 | 5745 | Ant1 | 5720 | -55.05 | 3.47 | 0.28 | -51.30 | Average | 15.6 | Pass |
| NVNT | ax20 | 5745 | Ant1 | 5725 | -36.95 | 3.47 | -    | -33.48 | Peak    | 27   | Pass |
| NVNT | ax20 | 5745 | Ant1 | 5725 | -50.84 | 3.47 | 0.28 | -47.09 | Average | 27   | Pass |
| NVNT | ax20 | 5825 | Ant1 | 5850 | -41.23 | 3.47 | -    | -37.76 | Peak    | 27   | Pass |
| NVNT | ax20 | 5825 | Ant1 | 5850 | -54.45 | 3.47 | 0.28 | -50.70 | Average | 27   | Pass |
| NVNT | ax20 | 5825 | Ant1 | 5855 | -46.68 | 3.47 | -    | -43.21 | Peak    | 15.6 | Pass |
| NVNT | ax20 | 5825 | Ant1 | 5855 | -57.77 | 3.47 | 0.28 | -54.02 | Average | 15.6 | Pass |
| NVNT | ax20 | 5825 | Ant1 | 5875 | -50.42 | 3.47 | -    | -46.95 | Peak    | 10   | Pass |
| NVNT | ax20 | 5825 | Ant1 | 5875 | -57.95 | 3.47 | 0.28 | -54.20 | Average | 10   | Pass |
| NVNT | ax20 | 5825 | Ant1 | 5925 | -48.27 | 3.47 | -    | -44.80 | Peak    | -27  | Pass |
| NVNT | ax20 | 5825 | Ant1 | 5925 | -58.1  | 3.47 | 0.28 | -54.35 | Average | -27  | Pass |
| NVNT | ax40 | 5755 | Ant1 | 5650 | -50.83 | 3.47 | -    | -47.36 | Peak    | -27  | Pass |
| NVNT | ax40 | 5755 | Ant1 | 5650 | -57.89 | 3.47 | 0.12 | -54.30 | Average | -27  | Pass |
| NVNT | ax40 | 5755 | Ant1 | 5700 | -49.58 | 3.47 | -    | -46.11 | Peak    | 10   | Pass |
| NVNT | ax40 | 5755 | Ant1 | 5700 | -58.13 | 3.47 | 0.12 | -54.54 | Average | 10   | Pass |
| NVNT | ax40 | 5755 | Ant1 | 5720 | -41.06 | 3.47 | -    | -37.59 | Peak    | 15.6 | Pass |
| NVNT | ax40 | 5755 | Ant1 | 5720 | -55.26 | 3.47 | 0.12 | -51.67 | Average | 15.6 | Pass |
| NVNT | ax40 | 5755 | Ant1 | 5725 | -35.55 | 3.47 | -    | -32.08 | Peak    | 27   | Pass |
| NVNT | ax40 | 5755 | Ant1 | 5725 | -52.45 | 3.47 | 0.12 | -48.86 | Average | 27   | Pass |
| NVNT | ax40 | 5795 | Ant1 | 5850 | -50.69 | 3.47 | -    | -47.22 | Peak    | 27   | Pass |
| NVNT | ax40 | 5795 | Ant1 | 5850 | -58.35 | 3.47 | 0.12 | -54.76 | Average | 27   | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|      |      |      |      |      |        |      |      |        |         |      |      |
|------|------|------|------|------|--------|------|------|--------|---------|------|------|
| NVNT | ax40 | 5795 | Ant1 | 5855 | -50.31 | 3.47 | -    | -46.84 | Peak    | 15.6 | Pass |
| NVNT | ax40 | 5795 | Ant1 | 5855 | -58.74 | 3.47 | 0.12 | -55.15 | Average | 15.6 | Pass |
| NVNT | ax40 | 5795 | Ant1 | 5875 | -50.44 | 3.47 | -    | -46.97 | Peak    | 10   | Pass |
| NVNT | ax40 | 5795 | Ant1 | 5875 | -58.4  | 3.47 | 0.12 | -54.81 | Average | 10   | Pass |
| NVNT | ax40 | 5795 | Ant1 | 5925 | -50.66 | 3.47 | -    | -47.19 | Peak    | -27  | Pass |
| NVNT | ax40 | 5795 | Ant1 | 5925 | -58.11 | 3.47 | 0.12 | -54.52 | Average | -27  | Pass |
| NVNT | ax80 | 5775 | Ant1 | 5850 | -50.73 | 3.47 | -    | -47.26 | Peak    | 27   | Pass |
| NVNT | ax80 | 5775 | Ant1 | 5850 | -58.26 | 3.47 | 0.25 | -54.54 | Average | 27   | Pass |
| NVNT | ax80 | 5775 | Ant1 | 5855 | -51.94 | 3.47 | -    | -48.47 | Peak    | 15.6 | Pass |
| NVNT | ax80 | 5775 | Ant1 | 5855 | -58.47 | 3.47 | 0.25 | -54.75 | Average | 15.6 | Pass |
| NVNT | ax80 | 5775 | Ant1 | 5875 | -49.64 | 3.47 | -    | -46.17 | Peak    | 10   | Pass |
| NVNT | ax80 | 5775 | Ant1 | 5875 | -57.62 | 3.47 | 0.25 | -53.90 | Average | 10   | Pass |
| NVNT | ax80 | 5775 | Ant1 | 5925 | -49.69 | 3.47 | -    | -46.22 | Peak    | -27  | Pass |
| NVNT | ax80 | 5775 | Ant1 | 5925 | -57.27 | 3.47 | 0.25 | -53.55 | Average | -27  | Pass |
| NVNT | ax80 | 5775 | Ant1 | 5650 | -50.59 | 3.47 | -    | -47.12 | Peak    | -27  | Pass |
| NVNT | ax80 | 5775 | Ant1 | 5650 | -58.26 | 3.47 | 0.25 | -54.54 | Average | -27  | Pass |
| NVNT | ax80 | 5775 | Ant1 | 5700 | -50.14 | 3.47 | -    | -46.67 | Peak    | 10   | Pass |
| NVNT | ax80 | 5775 | Ant1 | 5700 | -57.59 | 3.47 | 0.25 | -53.87 | Average | 10   | Pass |
| NVNT | ax80 | 5775 | Ant1 | 5720 | -42.18 | 3.47 | -    | -38.71 | Peak    | 15.6 | Pass |
| NVNT | ax80 | 5775 | Ant1 | 5720 | -54.58 | 3.47 | 0.25 | -50.86 | Average | 15.6 | Pass |
| NVNT | ax80 | 5775 | Ant1 | 5725 | -38.08 | 3.47 | -    | -34.61 | Peak    | 27   | Pass |
| NVNT | ax80 | 5775 | Ant1 | 5725 | -53.85 | 3.47 | 0.25 | -50.13 | Average | 27   | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




## Test Graphs

## Restrict Band NVNT a 5745MHz Ant1 Peak

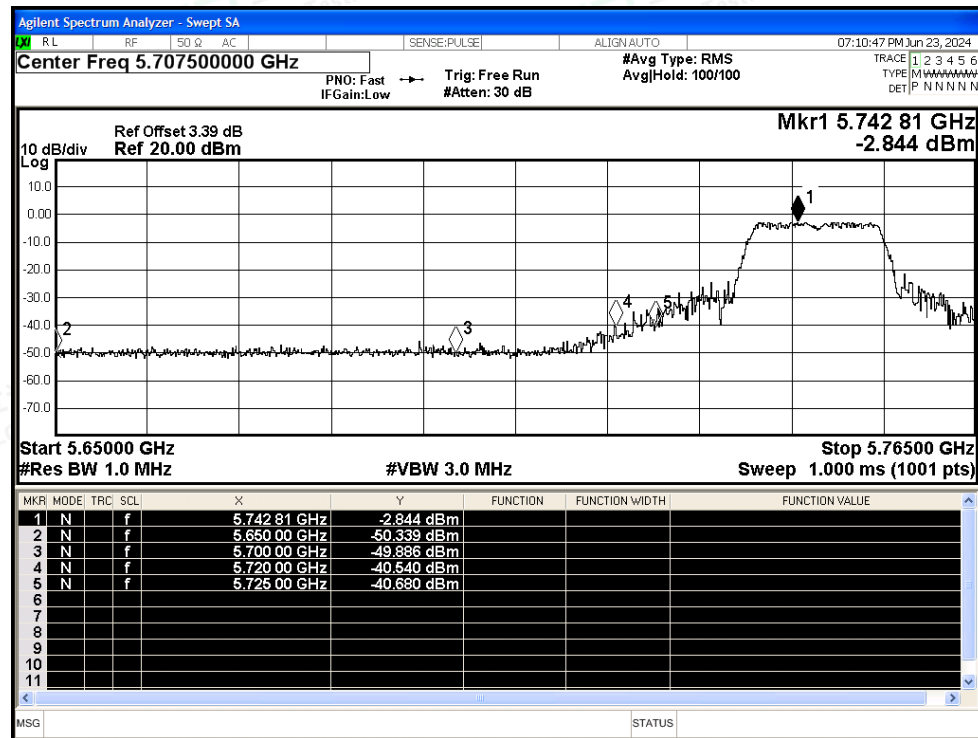

## Restrict Band NVNT a 5745MHz Ant1 Average

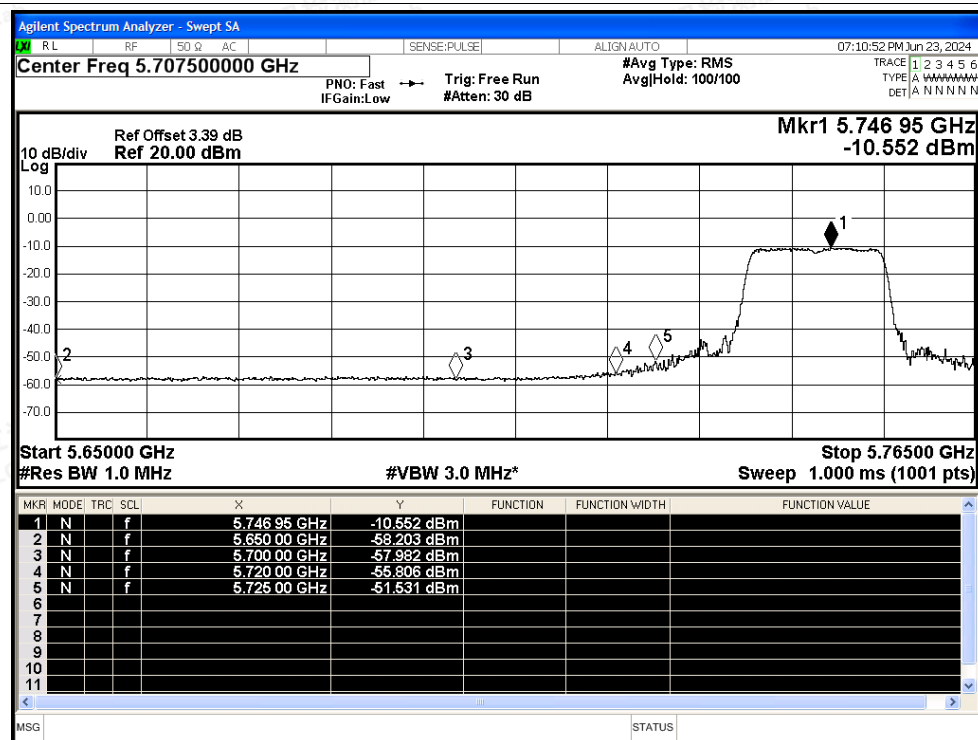

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT a 5825MHz Ant1 Peak

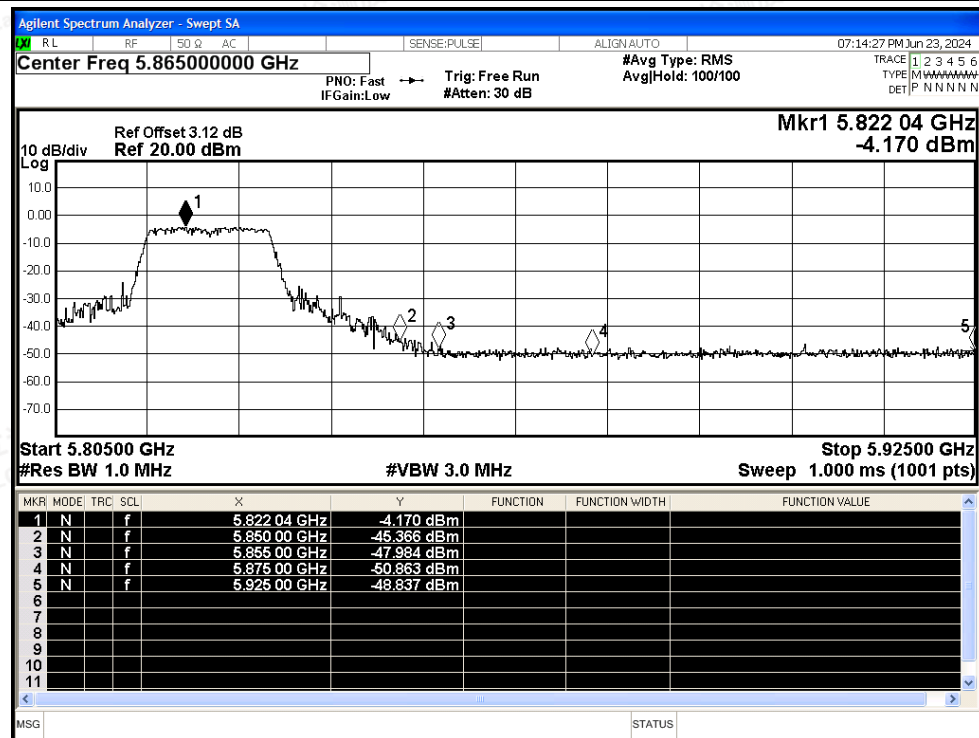

## Restrict Band NVNT a 5825MHz Ant1 Average

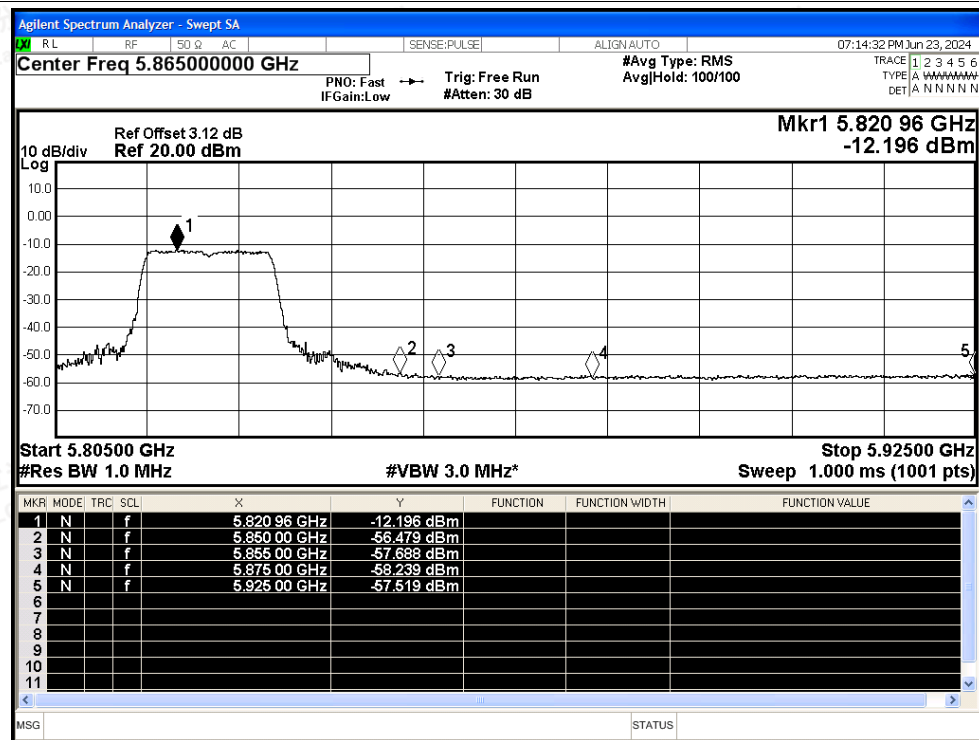

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT n20 5745MHz Ant1 Peak

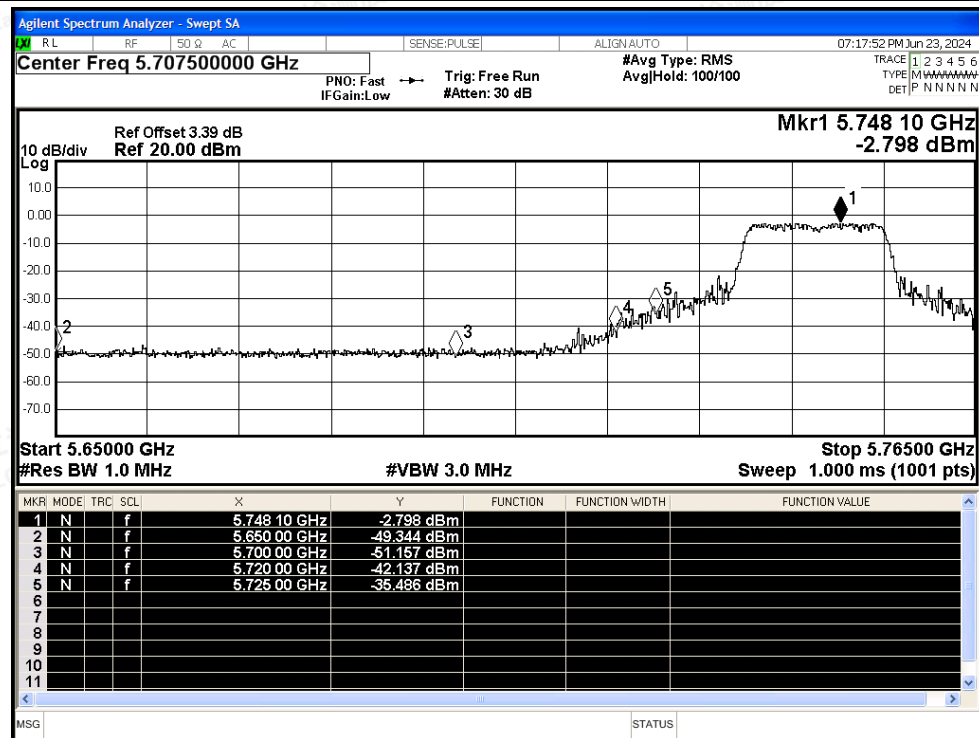

## Restrict Band NVNT n20 5745MHz Ant1 Average

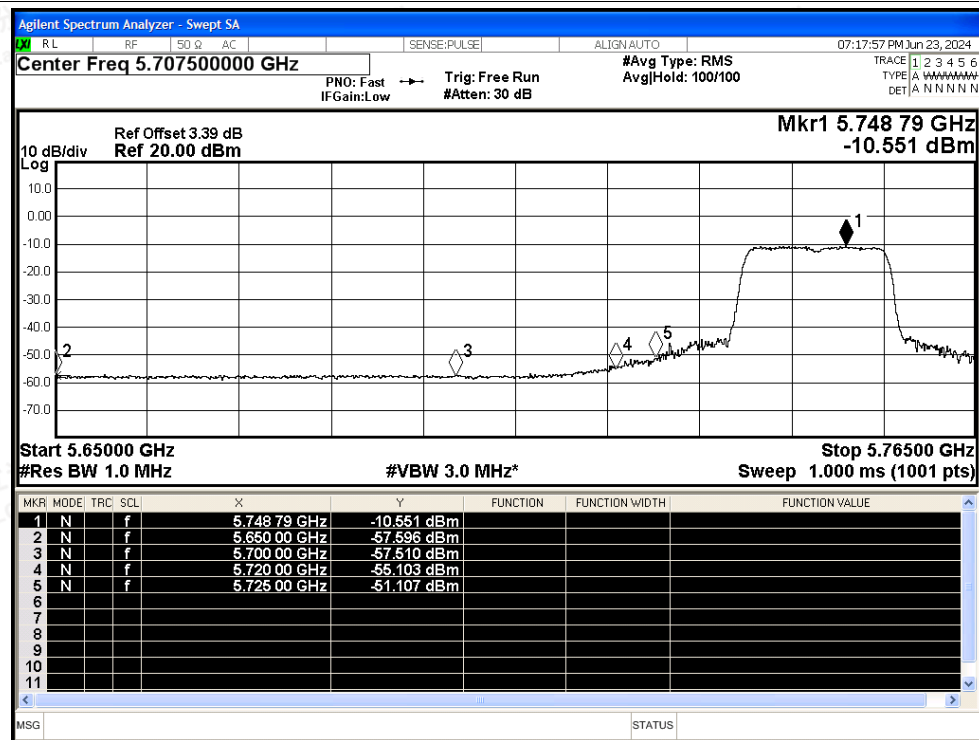

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT n20 5825MHz Ant1 Peak

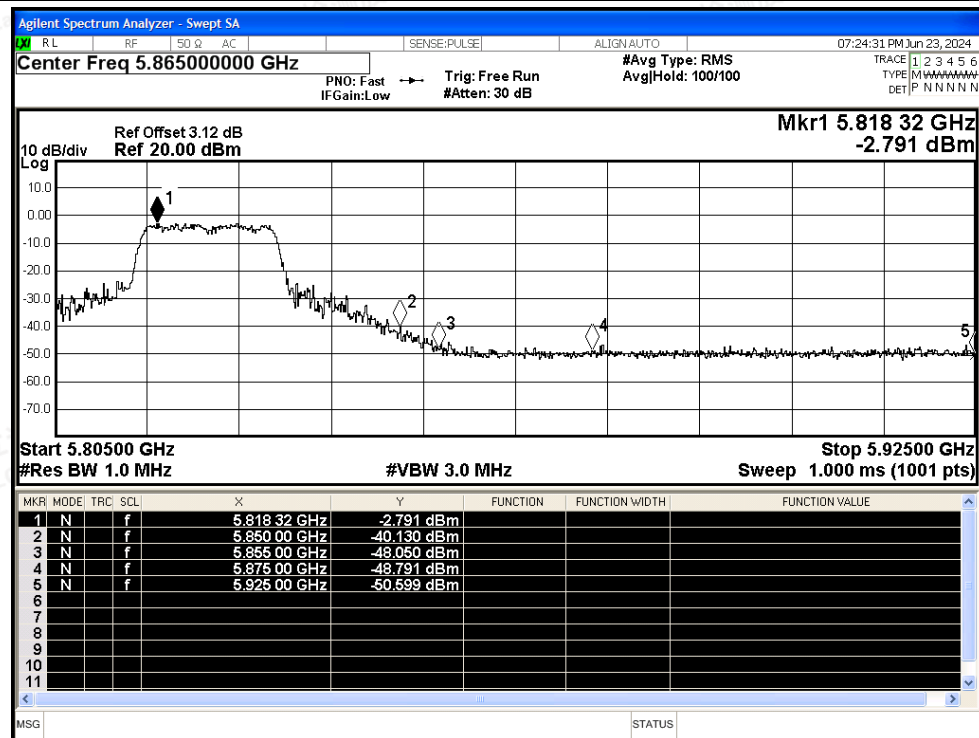

## Restrict Band NVNT n20 5825MHz Ant1 Average

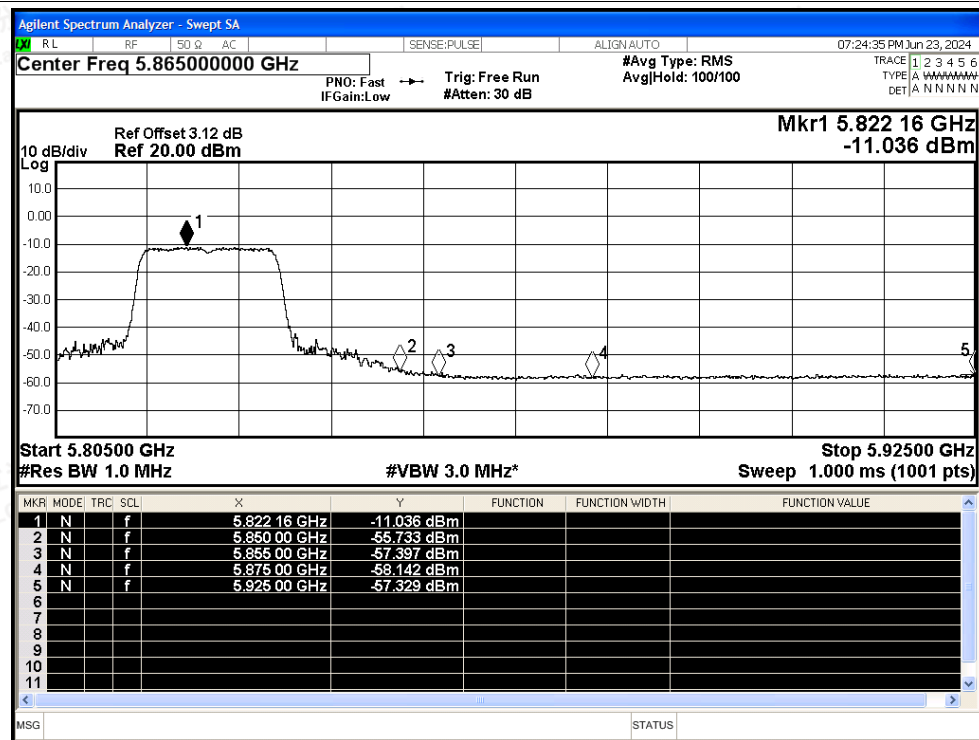

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT n40 5755MHz Ant1 Peak

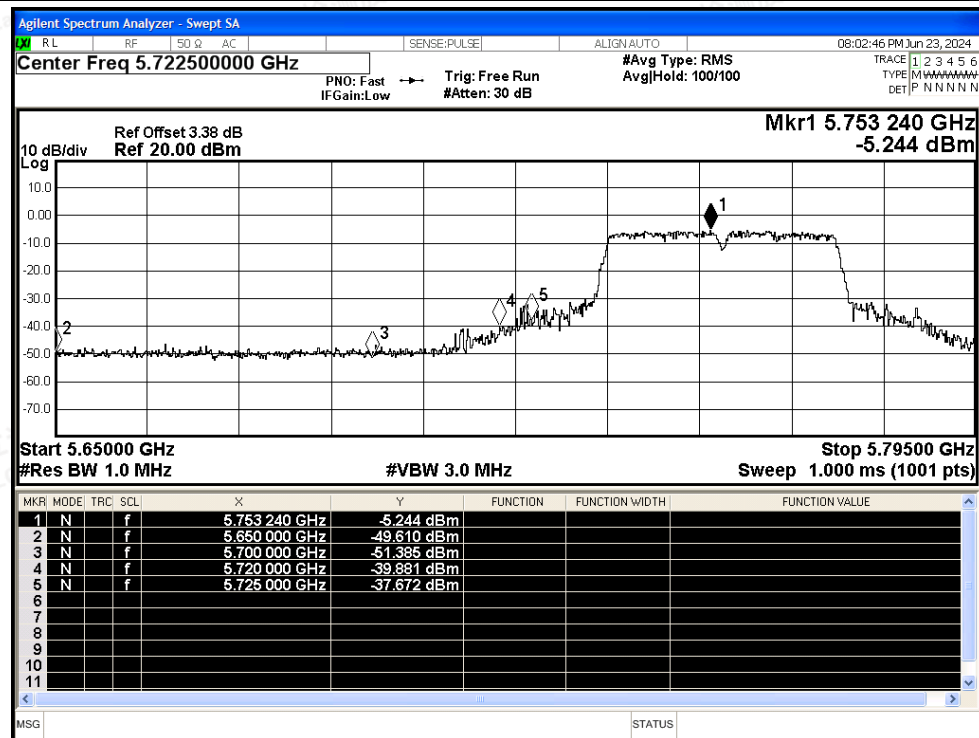

## Restrict Band NVNT n40 5755MHz Ant1 Average

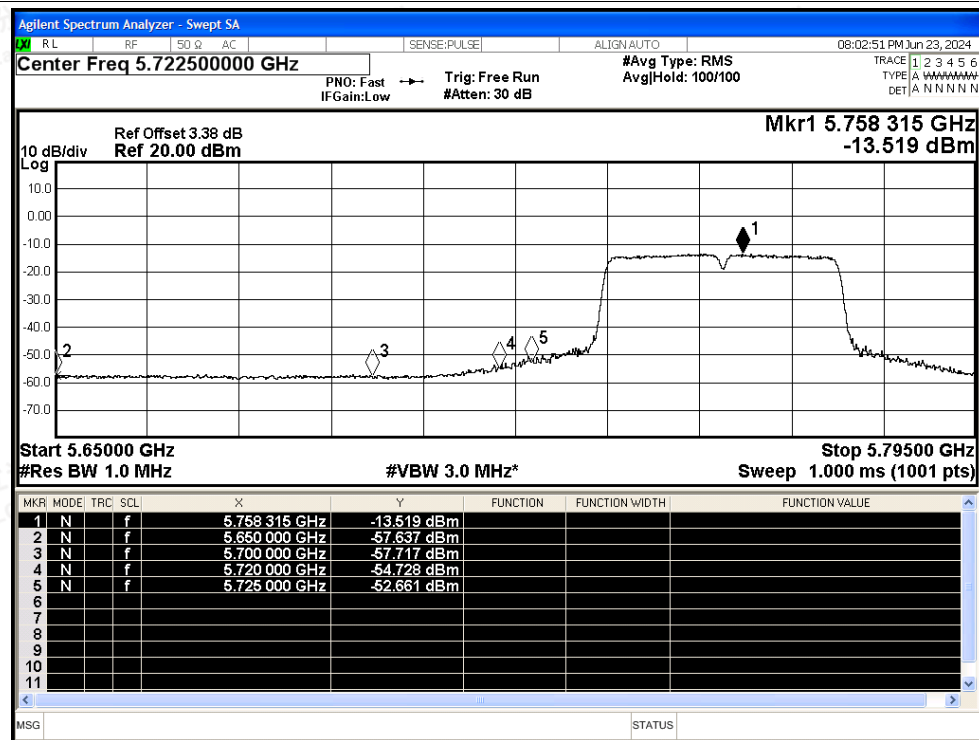

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT n40 5795MHz Ant1 Peak

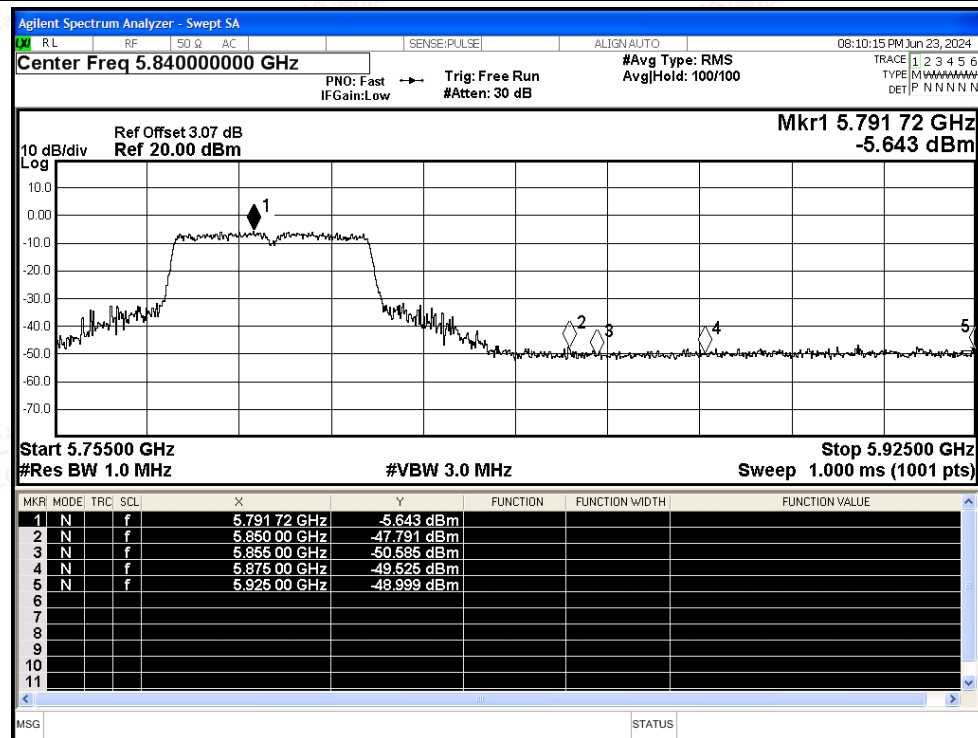

## Restrict Band NVNT n40 5795MHz Ant1 Average

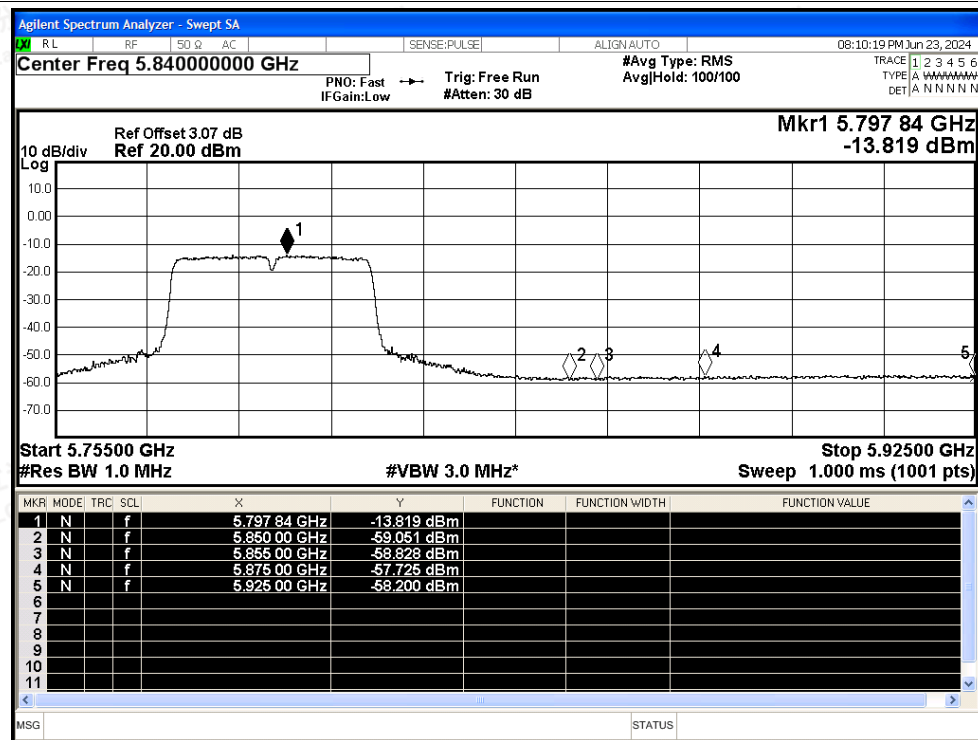

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac20 5745MHz Ant1 Peak

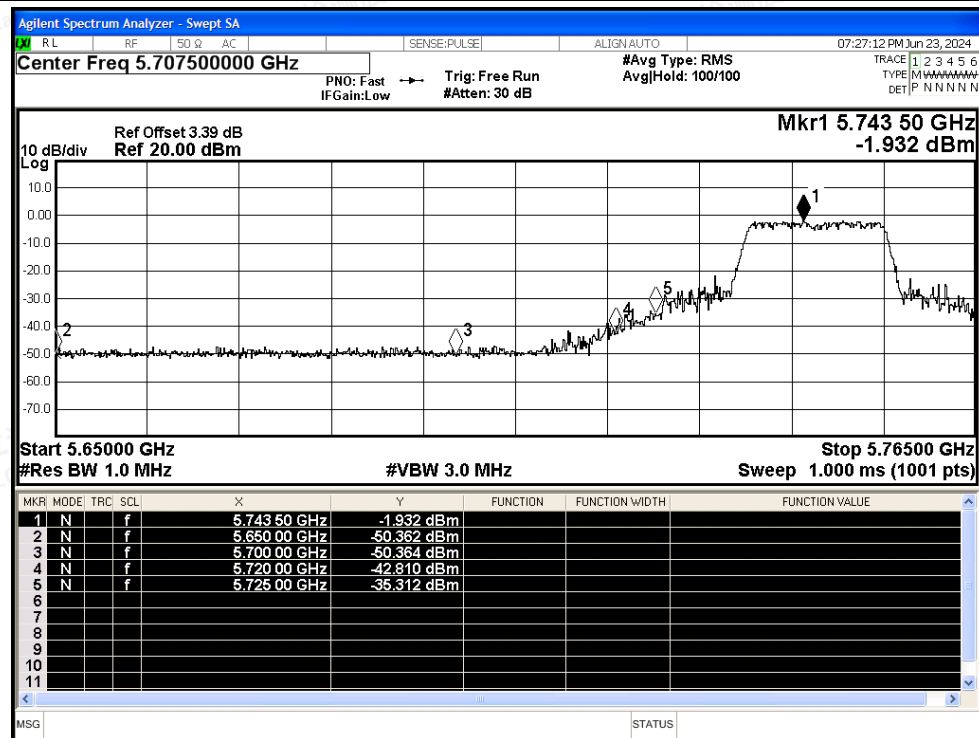

## Restrict Band NVNT ac20 5745MHz Ant1 Average

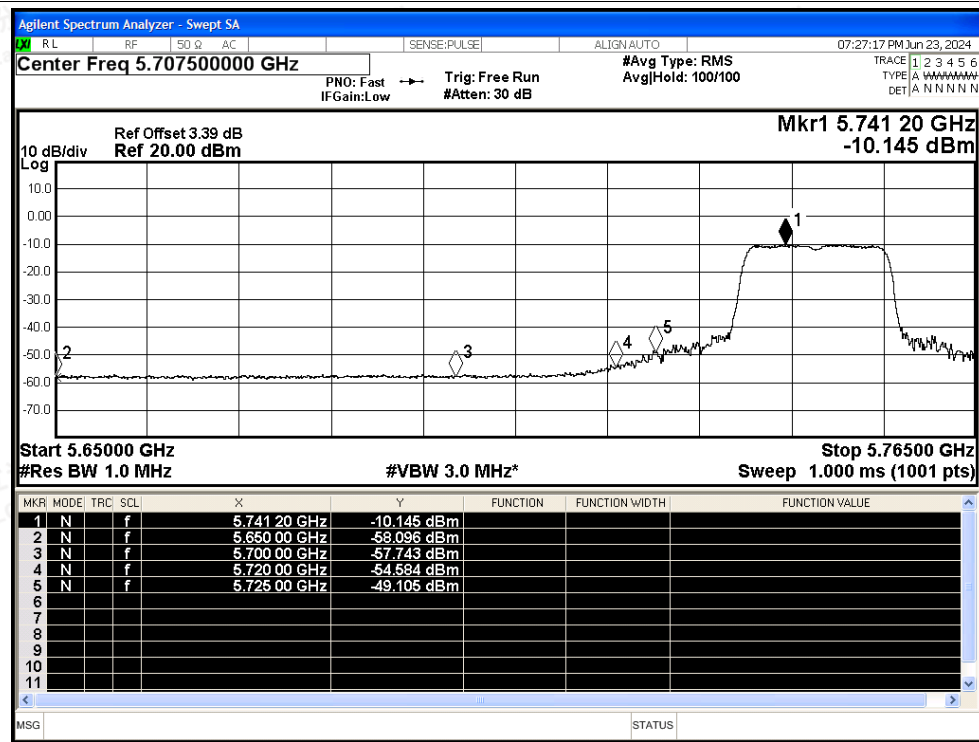

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac20 5825MHz Ant1 Peak

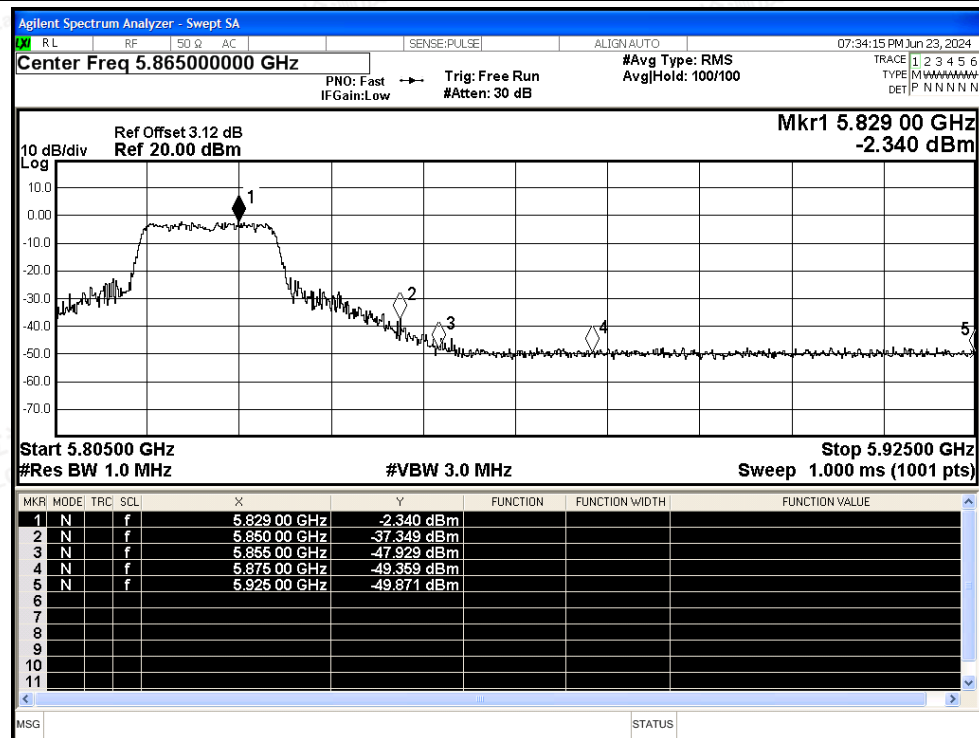

## Restrict Band NVNT ac20 5825MHz Ant1 Average

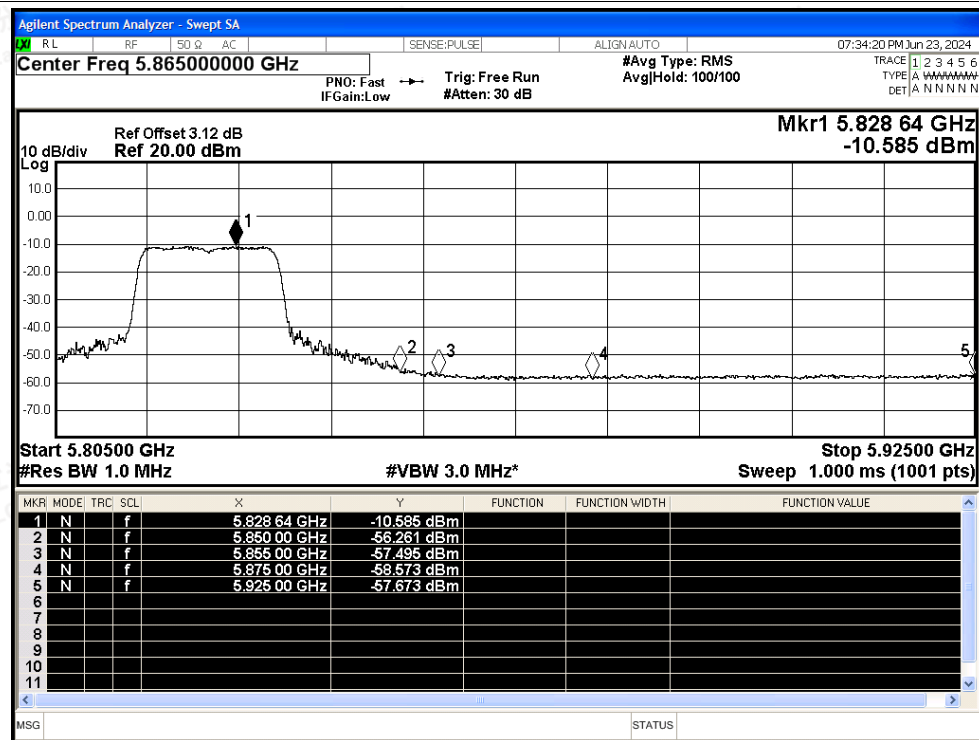

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac40 5755MHz Ant1 Peak

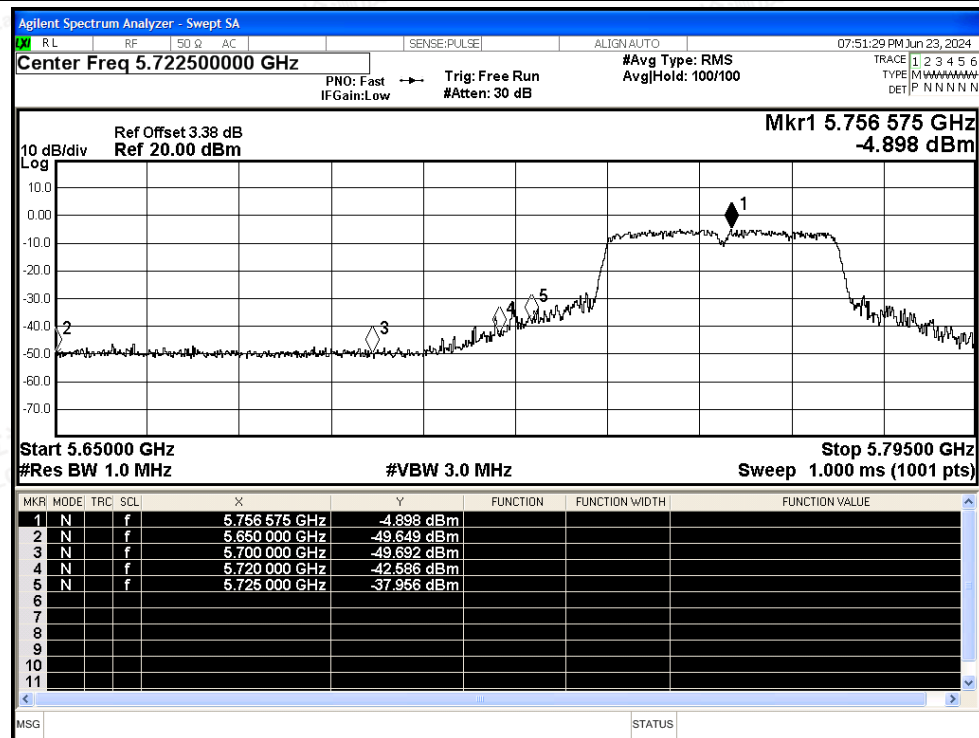

## Restrict Band NVNT ac40 5755MHz Ant1 Average

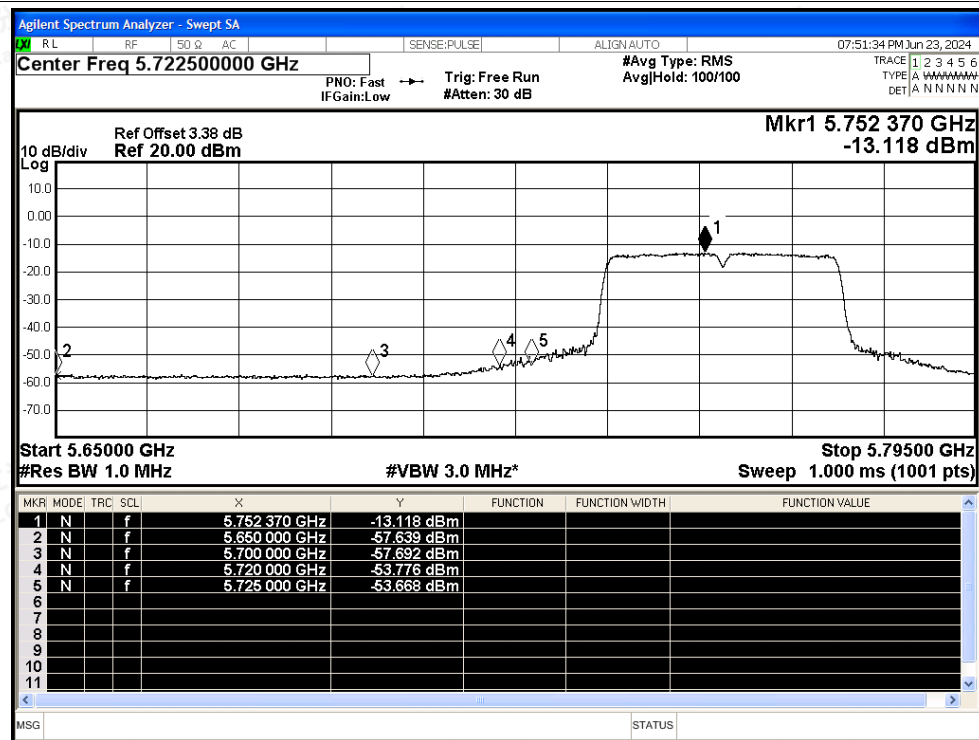

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac40 5795MHz Ant1 Peak

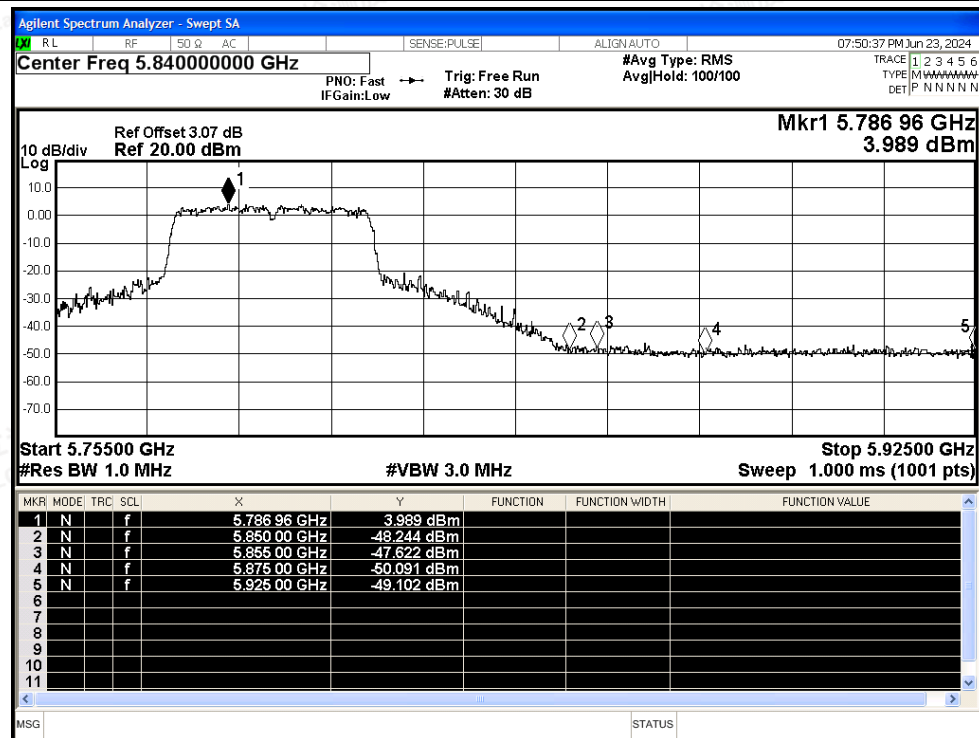

## Restrict Band NVNT ac40 5795MHz Ant1 Average

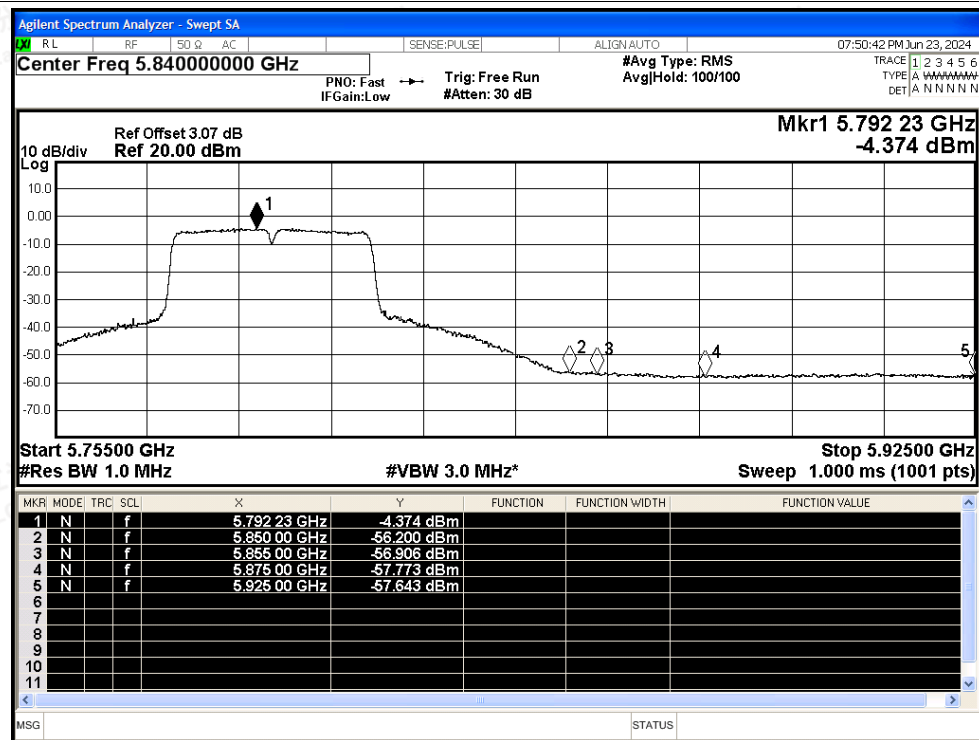

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac80 5775MHz Ant1 Peak

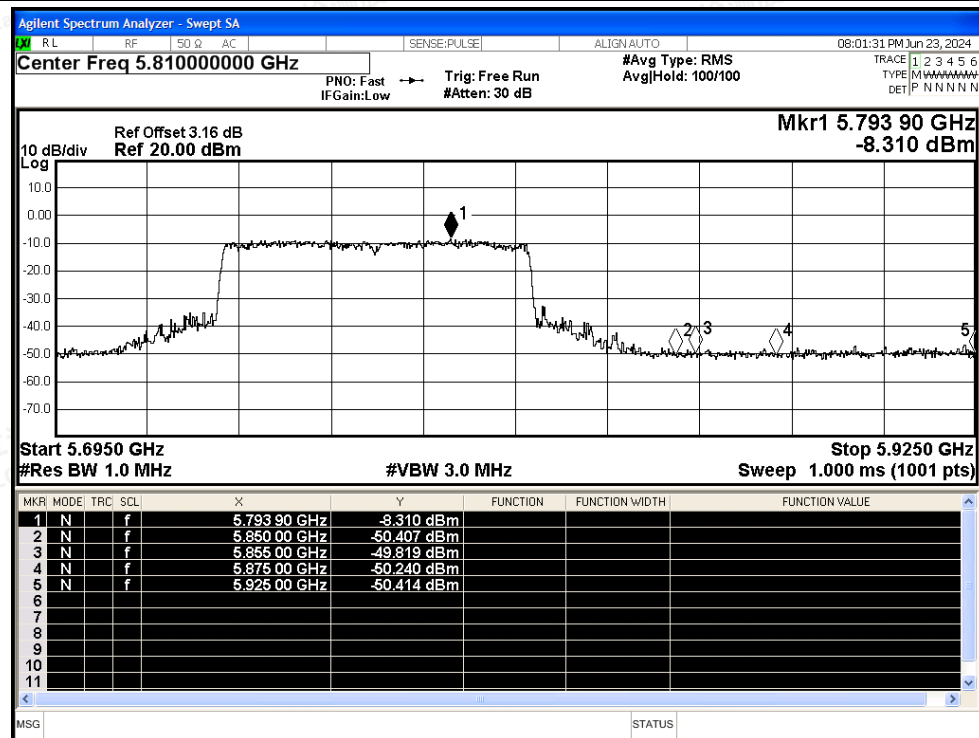

## Restrict Band NVNT ac80 5775MHz Ant1 Average

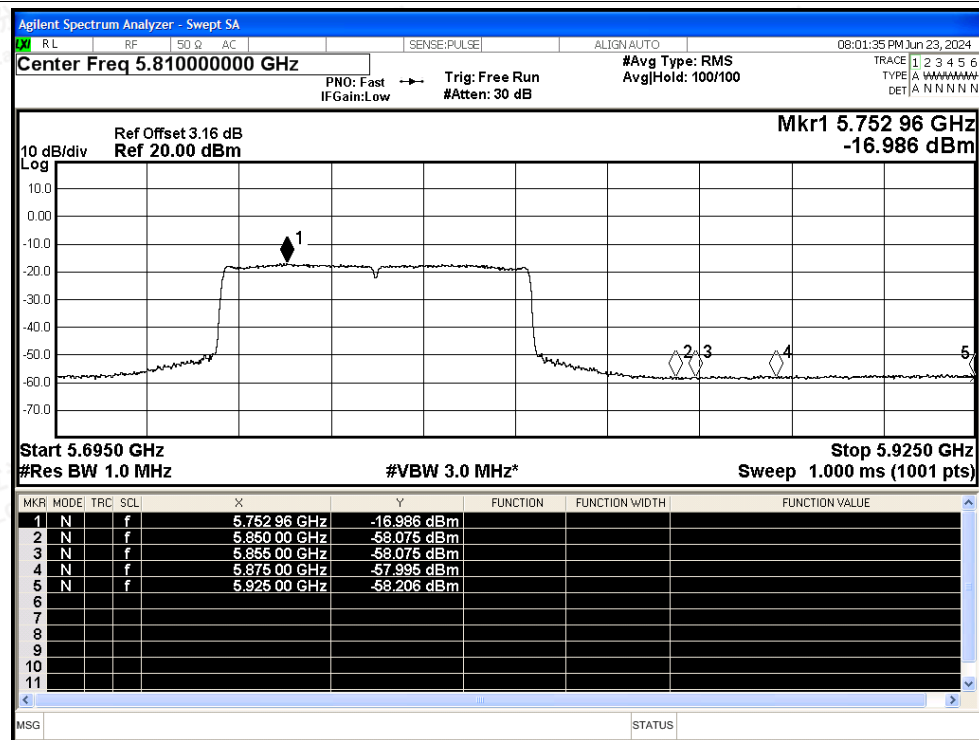

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac80 5775MHz Ant1 Peak

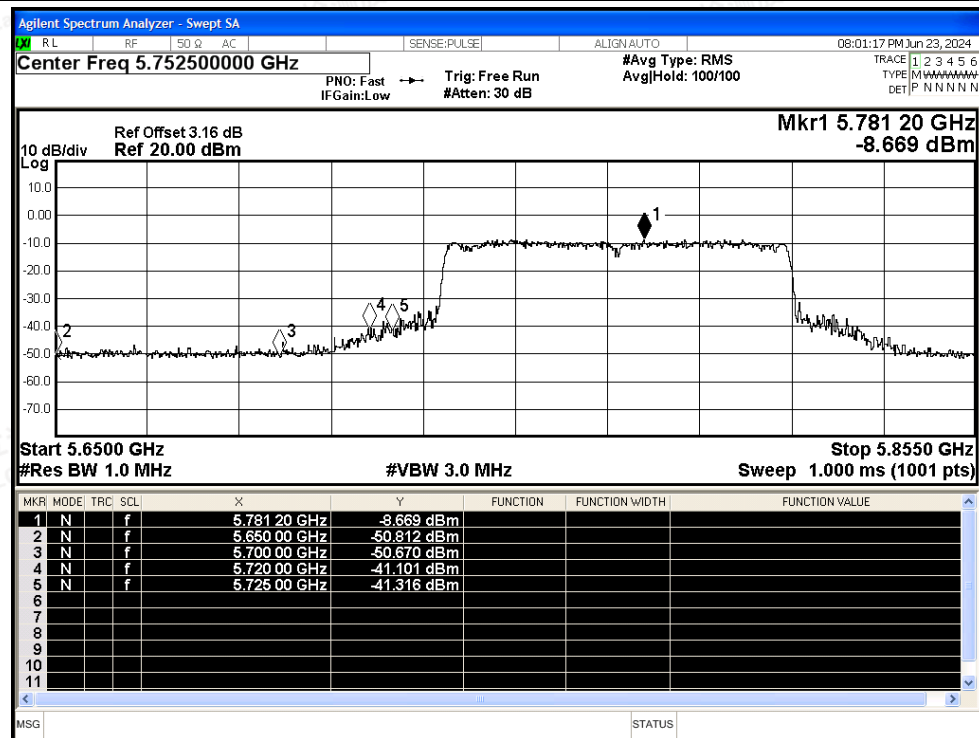

## Restrict Band NVNT ac80 5775MHz Ant1 Average

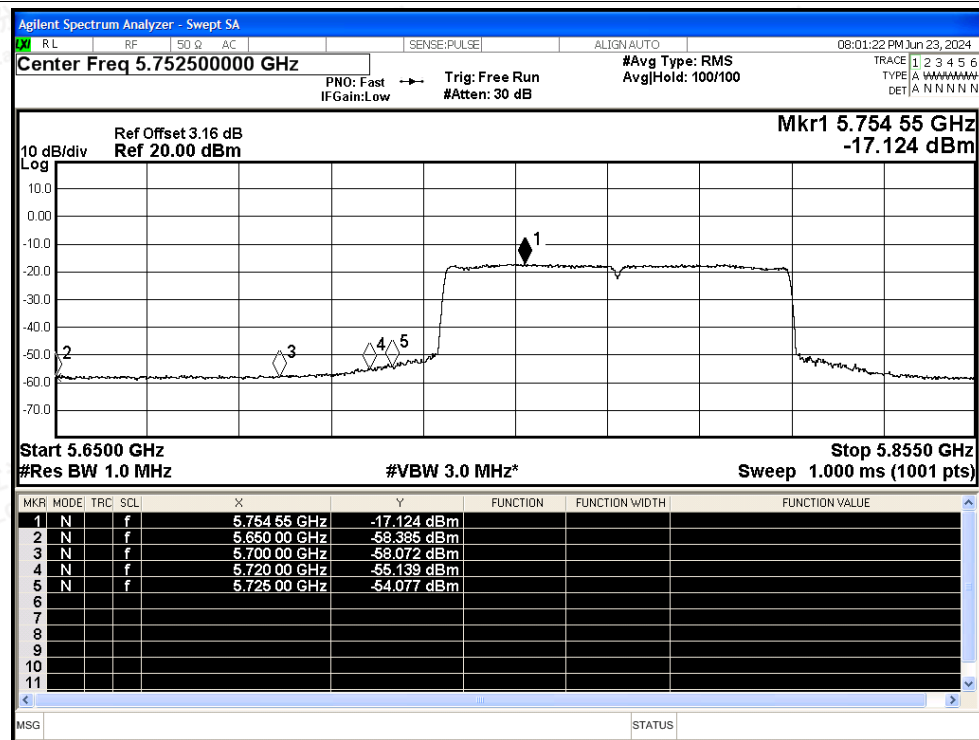

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax20 5745MHz Ant1 Peak

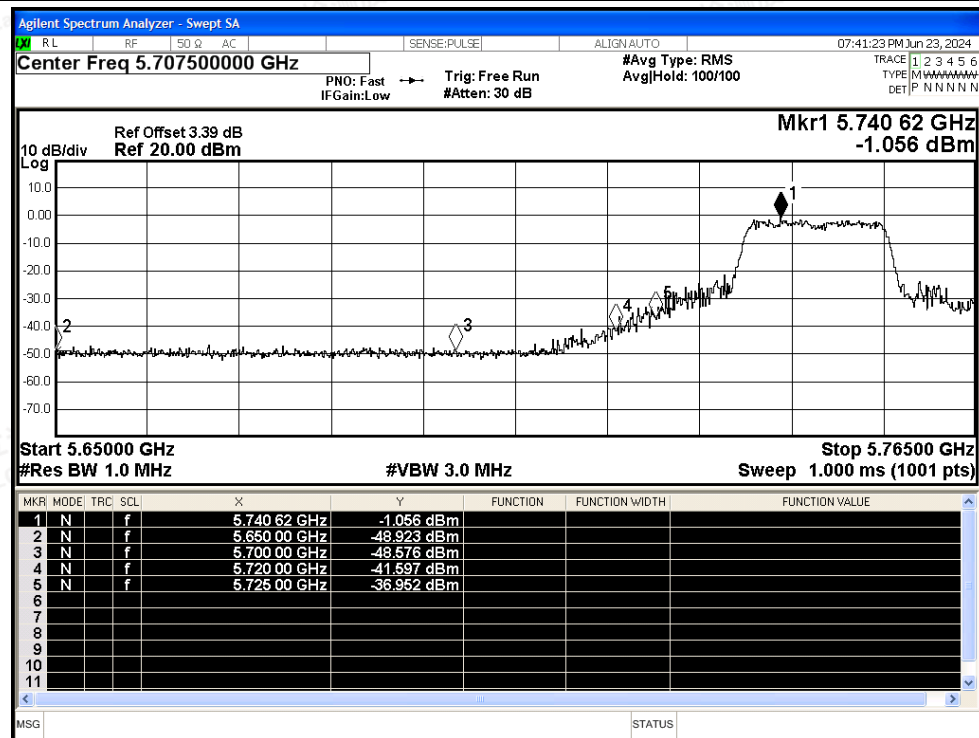

## Restrict Band NVNT ax20 5745MHz Ant1 Average

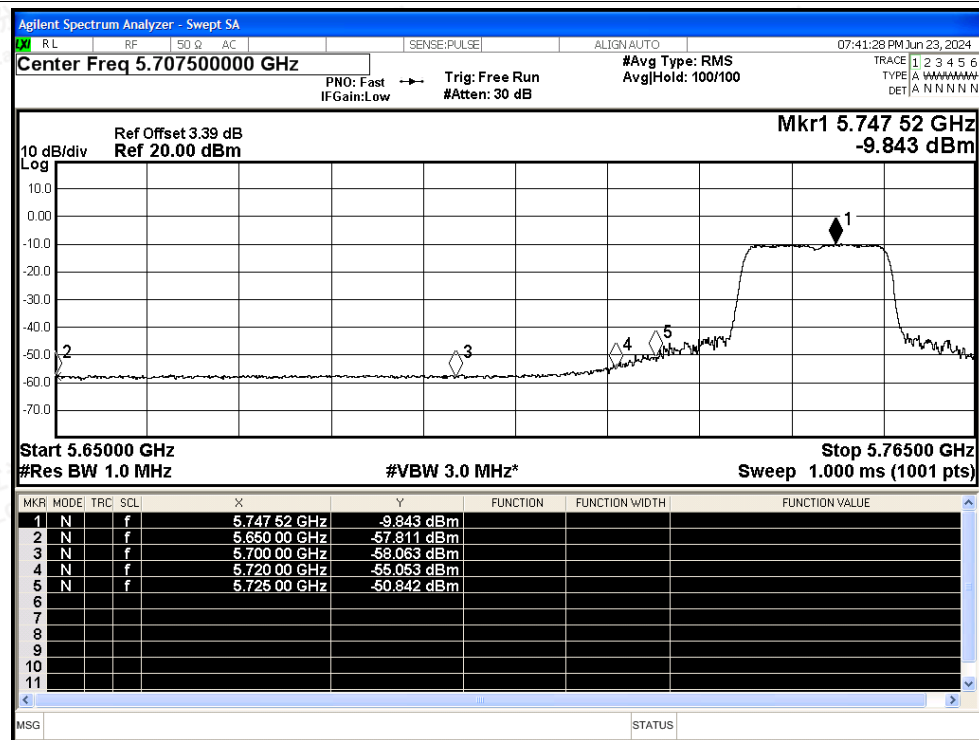

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax20 5825MHz Ant1 Peak

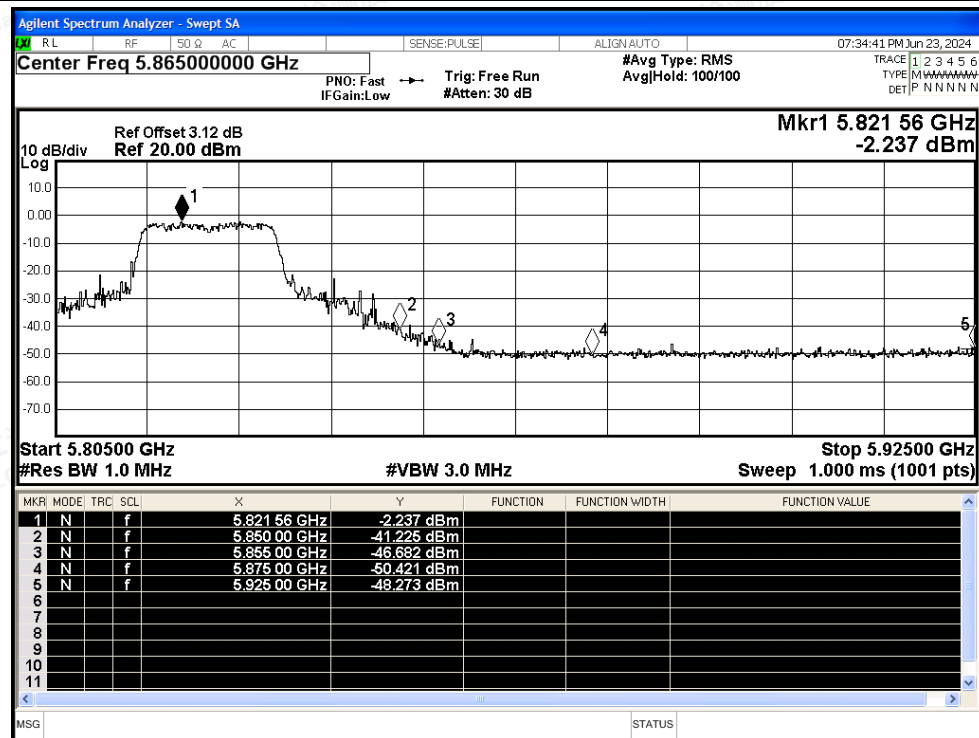

## Restrict Band NVNT ax20 5825MHz Ant1 Average

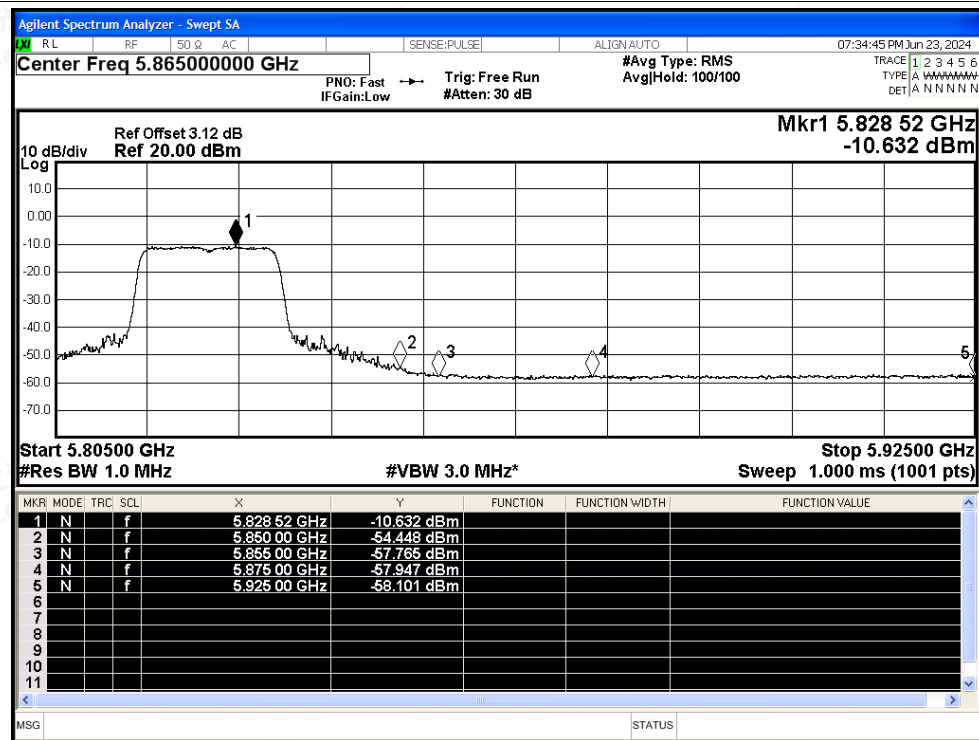

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax40 5755MHz Ant1 Peak

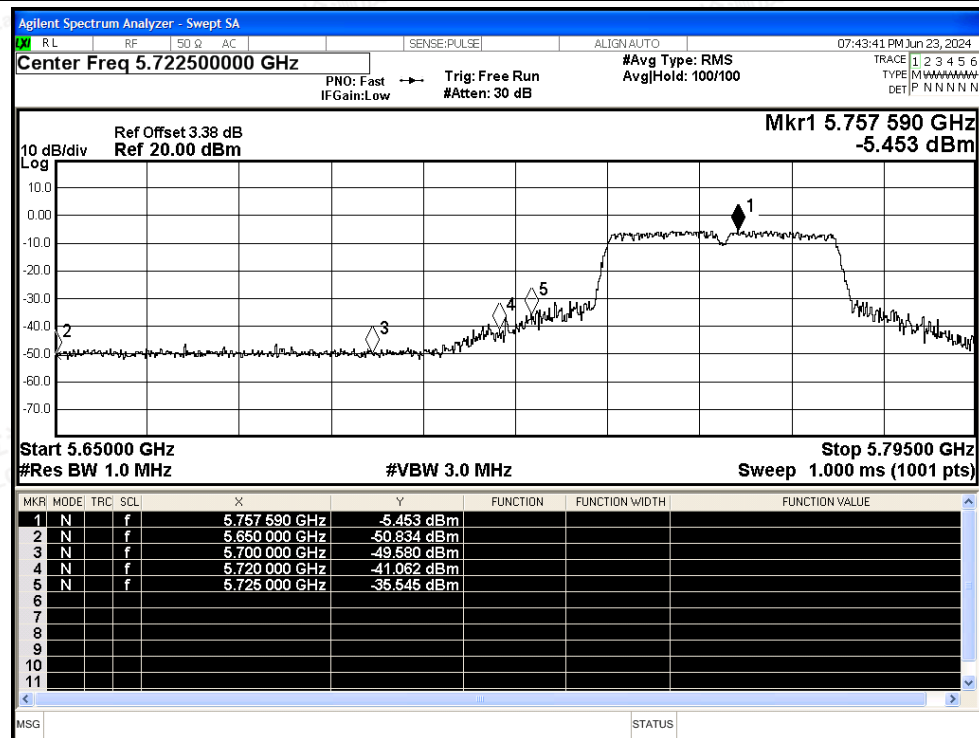

## Restrict Band NVNT ax40 5755MHz Ant1 Average

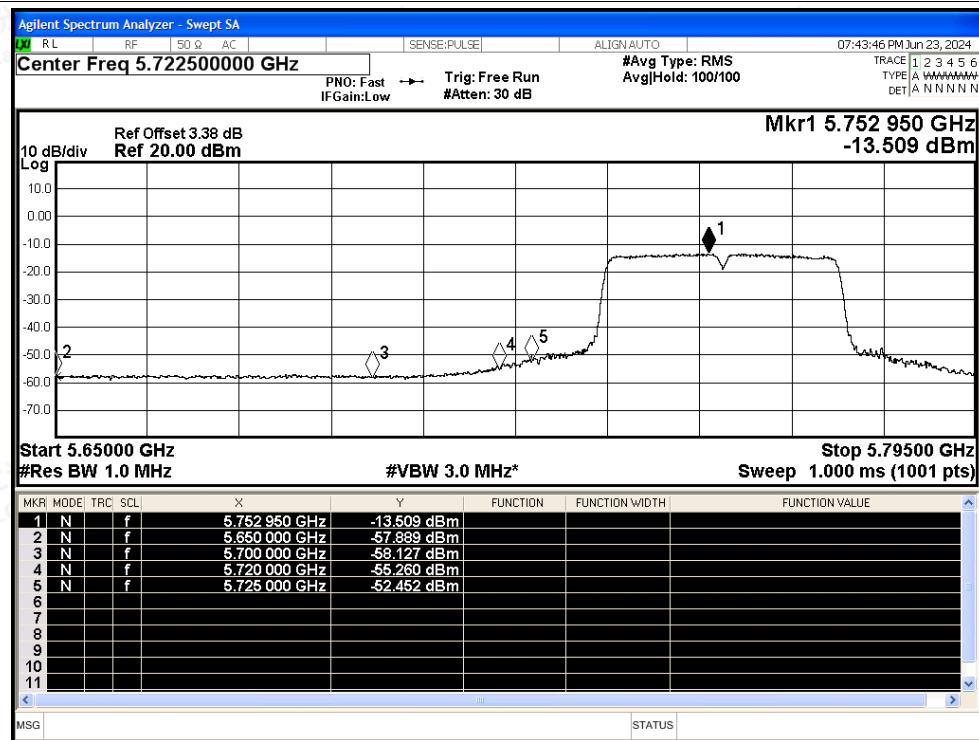

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax40 5795MHz Ant1 Peak

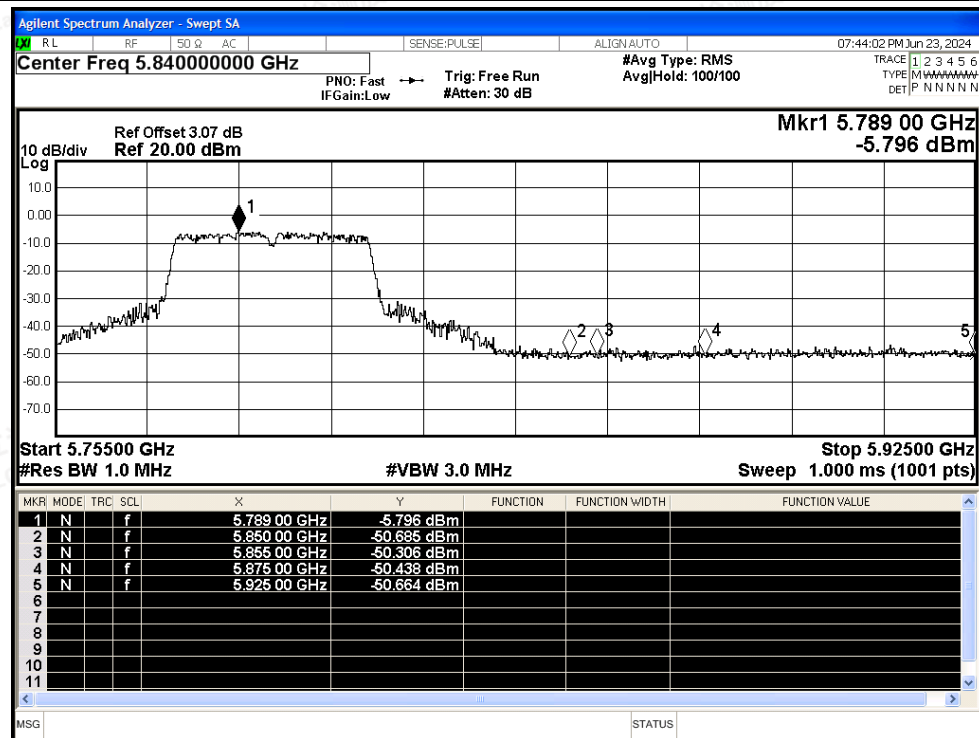

## Restrict Band NVNT ax40 5795MHz Ant1 Average

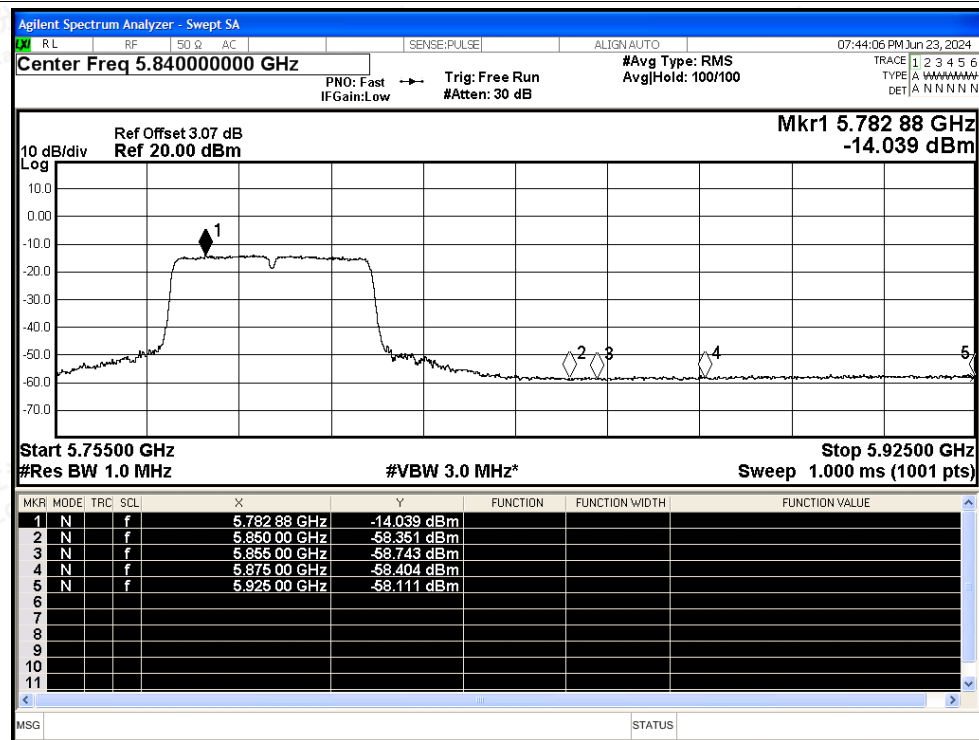

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax80 5775MHz Ant1 Peak

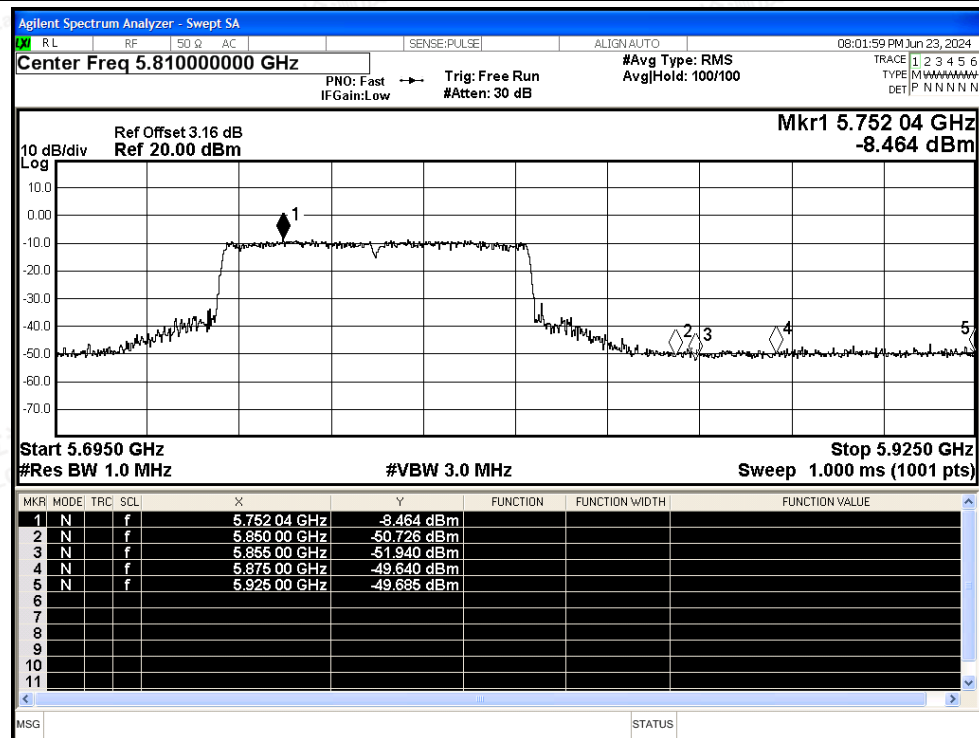

## Restrict Band NVNT ax80 5775MHz Ant1 Average

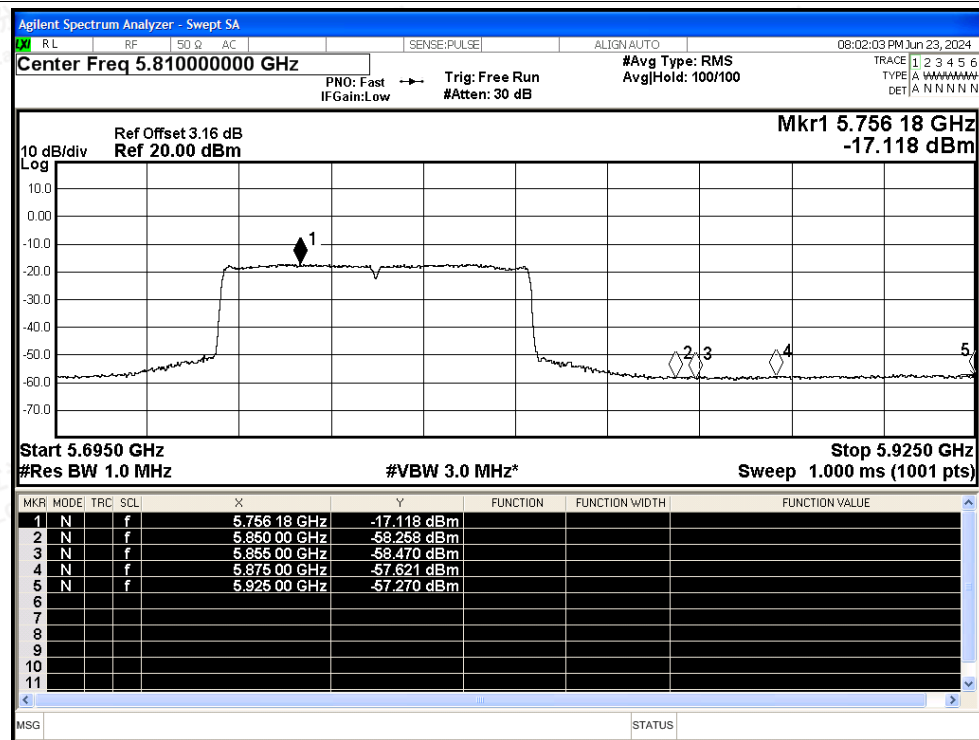

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax80 5775MHz Ant1 Peak

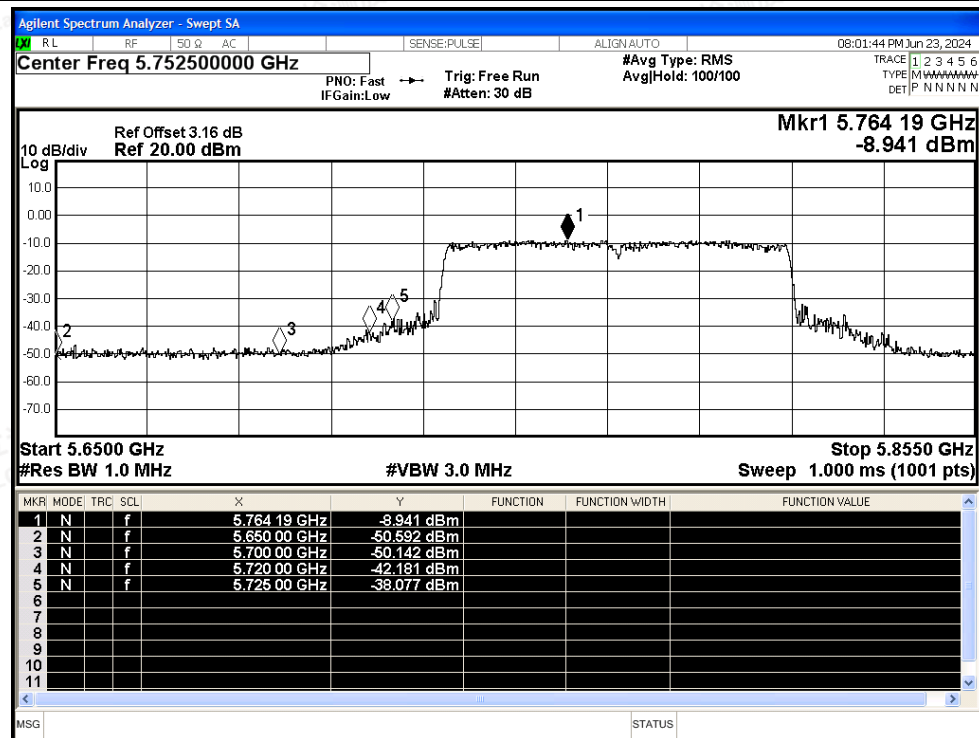

## Restrict Band NVNT ax80 5775MHz Ant1 Average

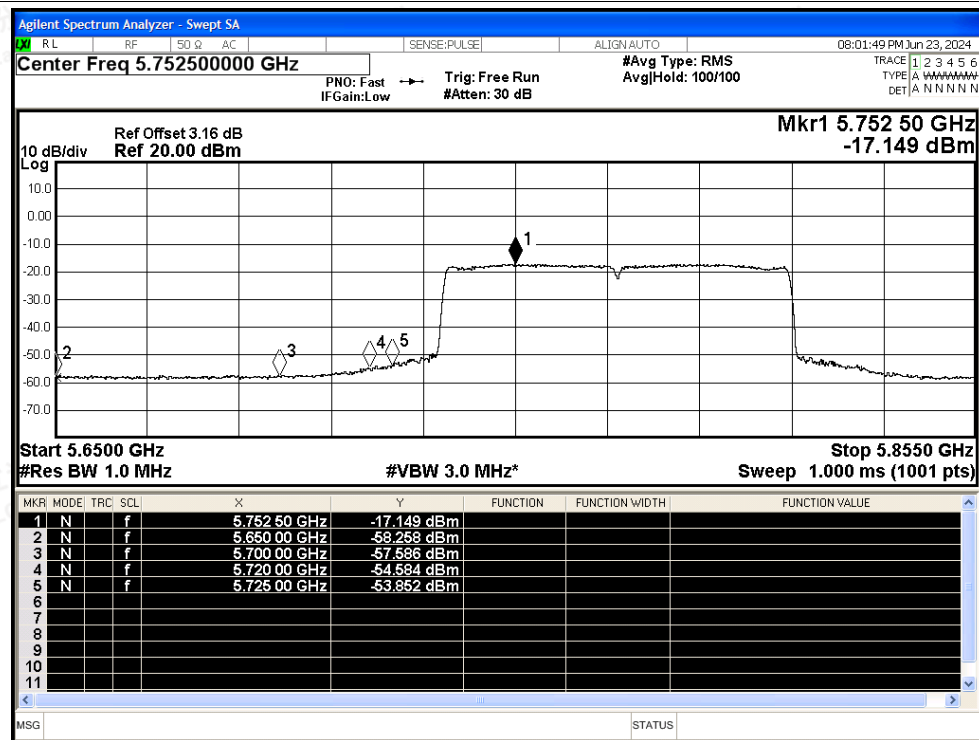

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



## MIMO

| Condition | Mode | Frequency<br>(MHz) | Spur<br>Freq<br>(MHz) | ANT0<br>Power<br>(dBm) | ANT1<br>Power<br>(dBm) | Gain<br>(dBi) | EIRP<br>Power<br>(dBm) | Detector | Limit<br>(dBm) | Verdict |
|-----------|------|--------------------|-----------------------|------------------------|------------------------|---------------|------------------------|----------|----------------|---------|
| NVNT      | n20  | 5745               | 5650                  | -49.15                 | -49.34                 | 6.48          | -39.75                 | Peak     | -27            | Pass    |
| NVNT      | n20  | 5745               | 5650                  | -57.59                 | -57.6                  | 6.48          | -48.10                 | Average  | -27            | Pass    |
| NVNT      | n20  | 5745               | 5700                  | -51.13                 | -51.16                 | 6.48          | -41.65                 | Peak     | 10             | Pass    |
| NVNT      | n20  | 5745               | 5700                  | -57.83                 | -57.51                 | 6.48          | -48.18                 | Average  | 10             | Pass    |
| NVNT      | n20  | 5745               | 5720                  | -41.26                 | -42.14                 | 6.48          | -32.19                 | Peak     | 15.6           | Pass    |
| NVNT      | n20  | 5745               | 5720                  | -53.48                 | -55.1                  | 6.48          | -44.72                 | Average  | 15.6           | Pass    |
| NVNT      | n20  | 5745               | 5725                  | -36.84                 | -35.49                 | 6.48          | -26.62                 | Peak     | 27             | Pass    |
| NVNT      | n20  | 5745               | 5725                  | -50.07                 | -51.11                 | 6.48          | -41.07                 | Average  | 27             | Pass    |
| NVNT      | n20  | 5825               | 5850                  | -45.37                 | -40.13                 | 6.48          | -32.51                 | Peak     | 27             | Pass    |
| NVNT      | n20  | 5825               | 5850                  | -54.91                 | -55.73                 | 6.48          | -45.81                 | Average  | 27             | Pass    |
| NVNT      | n20  | 5825               | 5855                  | -46.81                 | -48.05                 | 6.48          | -37.90                 | Peak     | 15.6           | Pass    |
| NVNT      | n20  | 5825               | 5855                  | -57.69                 | -57.4                  | 6.48          | -48.05                 | Average  | 15.6           | Pass    |
| NVNT      | n20  | 5825               | 5875                  | -48.97                 | -48.79                 | 6.48          | -39.39                 | Peak     | 10             | Pass    |
| NVNT      | n20  | 5825               | 5875                  | -58.18                 | -58.14                 | 6.48          | -48.67                 | Average  | 10             | Pass    |
| NVNT      | n20  | 5825               | 5925                  | -49.03                 | -50.6                  | 6.48          | -40.25                 | Peak     | -27            | Pass    |
| NVNT      | n20  | 5825               | 5925                  | -58.1                  | -57.33                 | 6.48          | -48.21                 | Average  | -27            | Pass    |
| NVNT      | n40  | 5755               | 5650                  | -50.2                  | -49.61                 | 6.48          | -40.40                 | Peak     | -27            | Pass    |
| NVNT      | n40  | 5755               | 5650                  | -57.93                 | -57.64                 | 6.48          | -48.29                 | Average  | -27            | Pass    |
| NVNT      | n40  | 5755               | 5700                  | -50.44                 | -51.39                 | 6.48          | -41.40                 | Peak     | 10             | Pass    |
| NVNT      | n40  | 5755               | 5700                  | -57.59                 | -57.72                 | 6.48          | -48.16                 | Average  | 10             | Pass    |
| NVNT      | n40  | 5755               | 5720                  | -37.18                 | -39.88                 | 6.48          | -28.83                 | Peak     | 15.6           | Pass    |
| NVNT      | n40  | 5755               | 5720                  | -54.99                 | -54.73                 | 6.48          | -45.37                 | Average  | 15.6           | Pass    |
| NVNT      | n40  | 5755               | 5725                  | -40.22                 | -37.67                 | 6.48          | -29.27                 | Peak     | 27             | Pass    |
| NVNT      | n40  | 5755               | 5725                  | -54.36                 | -52.66                 | 6.48          | -43.94                 | Average  | 27             | Pass    |
| NVNT      | n40  | 5795               | 5850                  | -50.68                 | -47.79                 | 6.48          | -39.51                 | Peak     | 27             | Pass    |
| NVNT      | n40  | 5795               | 5850                  | -59.09                 | -59.05                 | 6.48          | -49.58                 | Average  | 27             | Pass    |
| NVNT      | n40  | 5795               | 5855                  | -50.3                  | -50.59                 | 6.48          | -40.95                 | Peak     | 15.6           | Pass    |
| NVNT      | n40  | 5795               | 5855                  | -58.54                 | -58.83                 | 6.48          | -49.19                 | Average  | 15.6           | Pass    |
| NVNT      | n40  | 5795               | 5875                  | -51.03                 | -49.53                 | 6.48          | -40.73                 | Peak     | 10             | Pass    |
| NVNT      | n40  | 5795               | 5875                  | -58.65                 | -57.73                 | 6.48          | -48.68                 | Average  | 10             | Pass    |
| NVNT      | n40  | 5795               | 5925                  | -50.67                 | -49                    | 6.48          | -40.26                 | Peak     | -27            | Pass    |
| NVNT      | n40  | 5795               | 5925                  | -58.01                 | -58.2                  | 6.48          | -48.61                 | Average  | -27            | Pass    |
| NVNT      | ac20 | 5745               | 5650                  | -50.37                 | -50.36                 | 6.48          | -40.87                 | Peak     | -27            | Pass    |
| NVNT      | ac20 | 5745               | 5650                  | -58.06                 | -58.1                  | 6.48          | -48.59                 | Average  | -27            | Pass    |
| NVNT      | ac20 | 5745               | 5700                  | -50.52                 | -50.36                 | 6.48          | -40.95                 | Peak     | 10             | Pass    |
| NVNT      | ac20 | 5745               | 5700                  | -57.9                  | -57.74                 | 6.48          | -48.33                 | Average  | 10             | Pass    |
| NVNT      | ac20 | 5745               | 5720                  | -39.02                 | -42.81                 | 6.48          | -31.02                 | Peak     | 15.6           | Pass    |
| NVNT      | ac20 | 5745               | 5720                  | -55.18                 | -54.58                 | 6.48          | -45.38                 | Average  | 15.6           | Pass    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|      |      |      |      |        |        |      |        |         |      |      |
|------|------|------|------|--------|--------|------|--------|---------|------|------|
| NVNT | ac20 | 5745 | 5725 | -37.05 | -35.31 | 6.48 | -26.60 | Peak    | 27   | Pass |
| NVNT | ac20 | 5745 | 5725 | -51.91 | -49.11 | 6.48 | -40.80 | Average | 27   | Pass |
| NVNT | ac20 | 5825 | 5850 | -42.99 | -37.35 | 6.48 | -29.82 | Peak    | 27   | Pass |
| NVNT | ac20 | 5825 | 5850 | -55.62 | -56.26 | 6.48 | -46.44 | Average | 27   | Pass |
| NVNT | ac20 | 5825 | 5855 | -49.71 | -47.93 | 6.48 | -39.24 | Peak    | 15.6 | Pass |
| NVNT | ac20 | 5825 | 5855 | -57.49 | -57.5  | 6.48 | -48.00 | Average | 15.6 | Pass |
| NVNT | ac20 | 5825 | 5875 | -49.18 | -49.36 | 6.48 | -39.78 | Peak    | 10   | Pass |
| NVNT | ac20 | 5825 | 5875 | -57.83 | -58.57 | 6.48 | -48.69 | Average | 10   | Pass |
| NVNT | ac20 | 5825 | 5925 | -48.88 | -49.87 | 6.48 | -39.86 | Peak    | -27  | Pass |
| NVNT | ac20 | 5825 | 5925 | -57.71 | -57.67 | 6.48 | -48.20 | Average | -27  | Pass |
| NVNT | ac40 | 5755 | 5650 | -50.05 | -49.65 | 6.48 | -40.36 | Peak    | -27  | Pass |
| NVNT | ac40 | 5755 | 5650 | -58    | -57.64 | 6.48 | -48.33 | Average | -27  | Pass |
| NVNT | ac40 | 5755 | 5700 | -50.25 | -49.69 | 6.48 | -40.47 | Peak    | 10   | Pass |
| NVNT | ac40 | 5755 | 5700 | -57.73 | -57.69 | 6.48 | -48.22 | Average | 10   | Pass |
| NVNT | ac40 | 5755 | 5720 | -37.26 | -42.59 | 6.48 | -29.66 | Peak    | 15.6 | Pass |
| NVNT | ac40 | 5755 | 5720 | -54.95 | -53.78 | 6.48 | -44.84 | Average | 15.6 | Pass |
| NVNT | ac40 | 5755 | 5725 | -38.77 | -37.96 | 6.48 | -28.86 | Peak    | 27   | Pass |
| NVNT | ac40 | 5755 | 5725 | -52.82 | -53.67 | 6.48 | -43.73 | Average | 27   | Pass |
| NVNT | ac40 | 5795 | 5850 | -49.74 | -48.24 | 6.48 | -39.44 | Peak    | 27   | Pass |
| NVNT | ac40 | 5795 | 5850 | -58.9  | -56.2  | 6.48 | -47.85 | Average | 27   | Pass |
| NVNT | ac40 | 5795 | 5855 | -50.63 | -47.62 | 6.48 | -39.38 | Peak    | 15.6 | Pass |
| NVNT | ac40 | 5795 | 5855 | -58.36 | -56.91 | 6.48 | -48.08 | Average | 15.6 | Pass |
| NVNT | ac40 | 5795 | 5875 | -49.22 | -50.09 | 6.48 | -40.14 | Peak    | 10   | Pass |
| NVNT | ac40 | 5795 | 5875 | -58.93 | -57.77 | 6.48 | -48.82 | Average | 10   | Pass |
| NVNT | ac40 | 5795 | 5925 | -50.57 | -49.1  | 6.48 | -40.28 | Peak    | -27  | Pass |
| NVNT | ac40 | 5795 | 5925 | -57.3  | -57.64 | 6.48 | -47.98 | Average | -27  | Pass |
| NVNT | ac80 | 5775 | 5850 | -50.34 | -50.41 | 6.48 | -40.88 | Peak    | 27   | Pass |
| NVNT | ac80 | 5775 | 5850 | -58.75 | -58.08 | 6.48 | -48.91 | Average | 27   | Pass |
| NVNT | ac80 | 5775 | 5855 | -47.82 | -49.82 | 6.48 | -39.22 | Peak    | 15.6 | Pass |
| NVNT | ac80 | 5775 | 5855 | -58.64 | -58.08 | 6.48 | -48.86 | Average | 15.6 | Pass |
| NVNT | ac80 | 5775 | 5875 | -48.66 | -50.24 | 6.48 | -39.89 | Peak    | 10   | Pass |
| NVNT | ac80 | 5775 | 5875 | -58.19 | -58    | 6.48 | -48.60 | Average | 10   | Pass |
| NVNT | ac80 | 5775 | 5925 | -50.12 | -50.41 | 6.48 | -40.77 | Peak    | -27  | Pass |
| NVNT | ac80 | 5775 | 5925 | -57.75 | -58.21 | 6.48 | -48.48 | Average | -27  | Pass |
| NVNT | ac80 | 5775 | 5650 | -49.72 | -50.81 | 6.48 | -40.74 | Peak    | -27  | Pass |
| NVNT | ac80 | 5775 | 5650 | -58.13 | -58.39 | 6.48 | -48.77 | Average | -27  | Pass |
| NVNT | ac80 | 5775 | 5700 | -50.58 | -50.67 | 6.48 | -41.13 | Peak    | 10   | Pass |
| NVNT | ac80 | 5775 | 5700 | -57.92 | -58.07 | 6.48 | -48.50 | Average | 10   | Pass |
| NVNT | ac80 | 5775 | 5720 | -43.33 | -41.1  | 6.48 | -32.58 | Peak    | 15.6 | Pass |
| NVNT | ac80 | 5775 | 5720 | -54.9  | -55.14 | 6.48 | -45.53 | Average | 15.6 | Pass |
| NVNT | ac80 | 5775 | 5725 | -42    | -41.32 | 6.48 | -32.16 | Peak    | 27   | Pass |
| NVNT | ac80 | 5775 | 5725 | -53.34 | -54.08 | 6.48 | -44.20 | Average | 27   | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|      |      |      |      |        |        |      |        |         |      |      |
|------|------|------|------|--------|--------|------|--------|---------|------|------|
| NVNT | ax20 | 5745 | 5650 | -50.42 | -48.92 | 6.48 | -40.12 | Peak    | -27  | Pass |
| NVNT | ax20 | 5745 | 5650 | -57.86 | -57.81 | 6.48 | -48.34 | Average | -27  | Pass |
| NVNT | ax20 | 5745 | 5700 | -50.39 | -48.58 | 6.48 | -39.90 | Peak    | 10   | Pass |
| NVNT | ax20 | 5745 | 5700 | -57.52 | -58.06 | 6.48 | -48.29 | Average | 10   | Pass |
| NVNT | ax20 | 5745 | 5720 | -41.25 | -41.6  | 6.48 | -31.93 | Peak    | 15.6 | Pass |
| NVNT | ax20 | 5745 | 5720 | -54.73 | -55.05 | 6.48 | -45.40 | Average | 15.6 | Pass |
| NVNT | ax20 | 5745 | 5725 | -36.26 | -36.95 | 6.48 | -27.10 | Peak    | 27   | Pass |
| NVNT | ax20 | 5745 | 5725 | -52.42 | -50.84 | 6.48 | -42.07 | Average | 27   | Pass |
| NVNT | ax20 | 5825 | 5850 | -39.25 | -41.23 | 6.48 | -30.64 | Peak    | 27   | Pass |
| NVNT | ax20 | 5825 | 5850 | -56.25 | -54.45 | 6.48 | -45.77 | Average | 27   | Pass |
| NVNT | ax20 | 5825 | 5855 | -48.41 | -46.68 | 6.48 | -37.97 | Peak    | 15.6 | Pass |
| NVNT | ax20 | 5825 | 5855 | -57.6  | -57.77 | 6.48 | -48.19 | Average | 15.6 | Pass |
| NVNT | ax20 | 5825 | 5875 | -50.93 | -50.42 | 6.48 | -41.18 | Peak    | 10   | Pass |
| NVNT | ax20 | 5825 | 5875 | -58.04 | -57.95 | 6.48 | -48.50 | Average | 10   | Pass |
| NVNT | ax20 | 5825 | 5925 | -50.96 | -48.27 | 6.48 | -39.92 | Peak    | -27  | Pass |
| NVNT | ax20 | 5825 | 5925 | -57.85 | -58.1  | 6.48 | -48.48 | Average | -27  | Pass |
| NVNT | ax40 | 5755 | 5650 | -50.44 | -50.83 | 6.48 | -41.14 | Peak    | -27  | Pass |
| NVNT | ax40 | 5755 | 5650 | -58.09 | -57.89 | 6.48 | -48.50 | Average | -27  | Pass |
| NVNT | ax40 | 5755 | 5700 | -49.82 | -49.58 | 6.48 | -40.21 | Peak    | 10   | Pass |
| NVNT | ax40 | 5755 | 5700 | -58.02 | -58.13 | 6.48 | -48.58 | Average | 10   | Pass |
| NVNT | ax40 | 5755 | 5720 | -39.44 | -41.06 | 6.48 | -30.68 | Peak    | 15.6 | Pass |
| NVNT | ax40 | 5755 | 5720 | -54.7  | -55.26 | 6.48 | -45.48 | Average | 15.6 | Pass |
| NVNT | ax40 | 5755 | 5725 | -37.04 | -35.55 | 6.48 | -26.74 | Peak    | 27   | Pass |
| NVNT | ax40 | 5755 | 5725 | -51.25 | -52.45 | 6.48 | -42.32 | Average | 27   | Pass |
| NVNT | ax40 | 5795 | 5850 | -50.15 | -50.69 | 6.48 | -40.92 | Peak    | 27   | Pass |
| NVNT | ax40 | 5795 | 5850 | -58.99 | -58.35 | 6.48 | -49.17 | Average | 27   | Pass |
| NVNT | ax40 | 5795 | 5855 | -49.86 | -50.31 | 6.48 | -40.59 | Peak    | 15.6 | Pass |
| NVNT | ax40 | 5795 | 5855 | -58.9  | -58.74 | 6.48 | -49.33 | Average | 15.6 | Pass |
| NVNT | ax40 | 5795 | 5875 | -50.68 | -50.44 | 6.48 | -41.07 | Peak    | 10   | Pass |
| NVNT | ax40 | 5795 | 5875 | -58.02 | -58.4  | 6.48 | -48.72 | Average | 10   | Pass |
| NVNT | ax40 | 5795 | 5925 | -50.17 | -50.66 | 6.48 | -40.92 | Peak    | -27  | Pass |
| NVNT | ax40 | 5795 | 5925 | -57.97 | -58.11 | 6.48 | -48.55 | Average | -27  | Pass |
| NVNT | ax80 | 5775 | 5850 | -50.53 | -50.73 | 6.48 | -41.14 | Peak    | 27   | Pass |
| NVNT | ax80 | 5775 | 5850 | -58.74 | -58.26 | 6.48 | -49.00 | Average | 27   | Pass |
| NVNT | ax80 | 5775 | 5855 | -50.66 | -51.94 | 6.48 | -41.76 | Peak    | 15.6 | Pass |
| NVNT | ax80 | 5775 | 5855 | -57.82 | -58.47 | 6.48 | -48.64 | Average | 15.6 | Pass |
| NVNT | ax80 | 5775 | 5875 | -51.02 | -49.64 | 6.48 | -40.79 | Peak    | 10   | Pass |
| NVNT | ax80 | 5775 | 5875 | -58.33 | -57.62 | 6.48 | -48.47 | Average | 10   | Pass |
| NVNT | ax80 | 5775 | 5925 | -49.59 | -49.69 | 6.48 | -40.15 | Peak    | -27  | Pass |
| NVNT | ax80 | 5775 | 5925 | -57.9  | -57.27 | 6.48 | -48.08 | Average | -27  | Pass |
| NVNT | ax80 | 5775 | 5650 | -50.24 | -50.59 | 6.48 | -40.92 | Peak    | -27  | Pass |
| NVNT | ax80 | 5775 | 5650 | -58.4  | -58.26 | 6.48 | -48.84 | Average | -27  | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|      |      |      |      |        |        |      |        |         |      |      |
|------|------|------|------|--------|--------|------|--------|---------|------|------|
| NVNT | ax80 | 5775 | 5700 | -49.94 | -50.14 | 6.48 | -40.55 | Peak    | 10   | Pass |
| NVNT | ax80 | 5775 | 5700 | -58.24 | -57.59 | 6.48 | -48.41 | Average | 10   | Pass |
| NVNT | ax80 | 5775 | 5720 | -41.93 | -42.18 | 6.48 | -32.56 | Peak    | 15.6 | Pass |
| NVNT | ax80 | 5775 | 5720 | -55.38 | -54.58 | 6.48 | -45.47 | Average | 15.6 | Pass |
| NVNT | ax80 | 5775 | 5725 | -41.66 | -38.08 | 6.48 | -30.02 | Peak    | 27   | Pass |
| NVNT | ax80 | 5775 | 5725 | -53.92 | -53.85 | 6.48 | -44.39 | Average | 27   | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



## G.5 Frequency Stability

| Condition | Mode | Frequency<br>(MHz) | Antenna | Measured Frequency<br>(MHz) | Frequency Error<br>(Hz) | Deviation<br>(ppm) | Limit<br>(ppm) | Verdict |
|-----------|------|--------------------|---------|-----------------------------|-------------------------|--------------------|----------------|---------|
| NVNT      | n40  | 5755               | Ant0    | 5755                        | 0                       | 0                  | 25             | Pass    |
| NVNT      | n40  | 5795               | Ant0    | 5794.96                     | -40000                  | -6.9               | 25             | Pass    |
| NVNT      | ac20 | 5745               | Ant0    | 5744.98                     | -20000                  | -3.48              | 25             | Pass    |
| NVNT      | ac20 | 5785               | Ant0    | 5784.98                     | -20000                  | -3.46              | 25             | Pass    |
| NVNT      | ac20 | 5825               | Ant0    | 5824.98                     | -20000                  | -3.43              | 25             | Pass    |
| NVNT      | ac40 | 5755               | Ant0    | 5755                        | 0                       | 0                  | 25             | Pass    |
| NVNT      | ac40 | 5795               | Ant0    | 5795                        | 0                       | 0                  | 25             | Pass    |
| NVNT      | ac80 | 5775               | Ant0    | 5775                        | 0                       | 0                  | 25             | Pass    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




## Test Graphs

## Freq. Stability NVNT n40 5755MHz Ant0

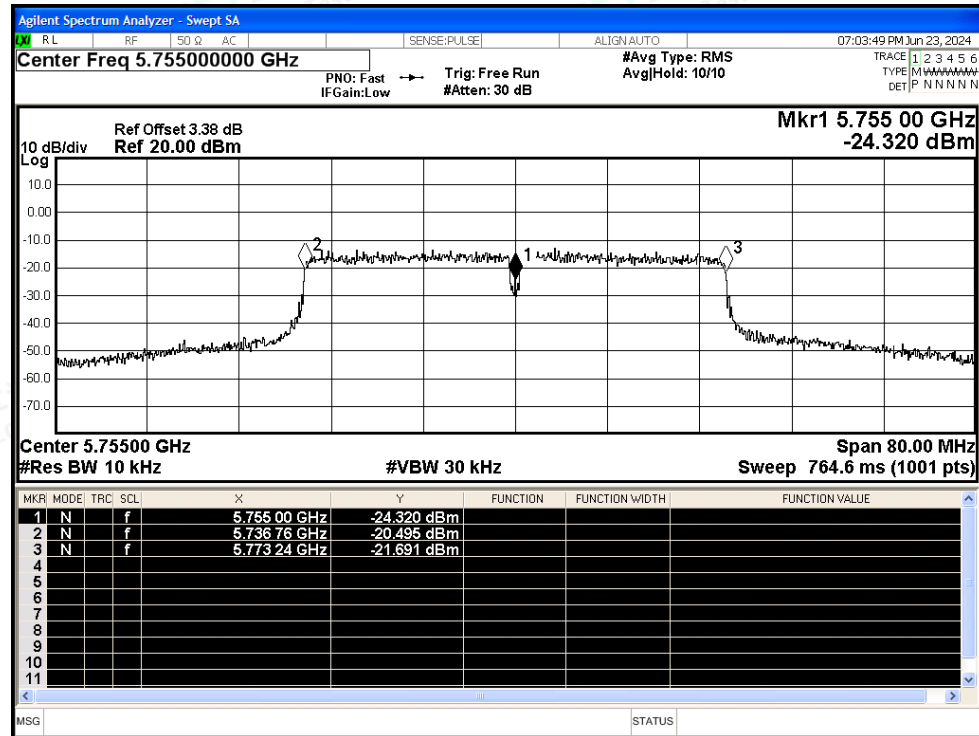

## Freq. Stability NVNT n40 5795MHz Ant0


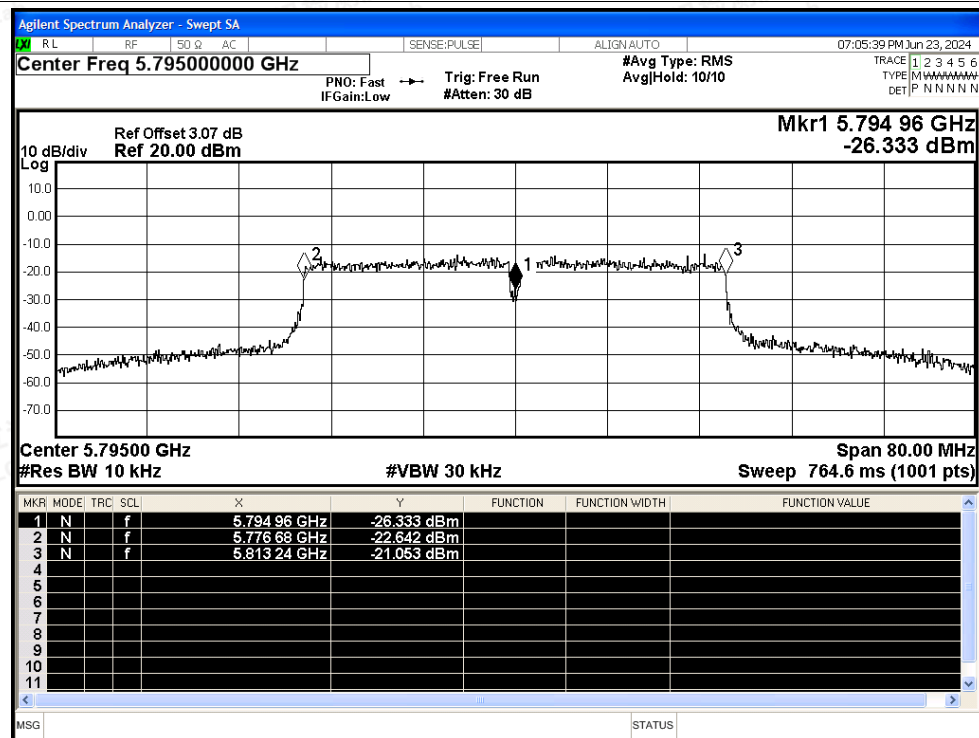


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

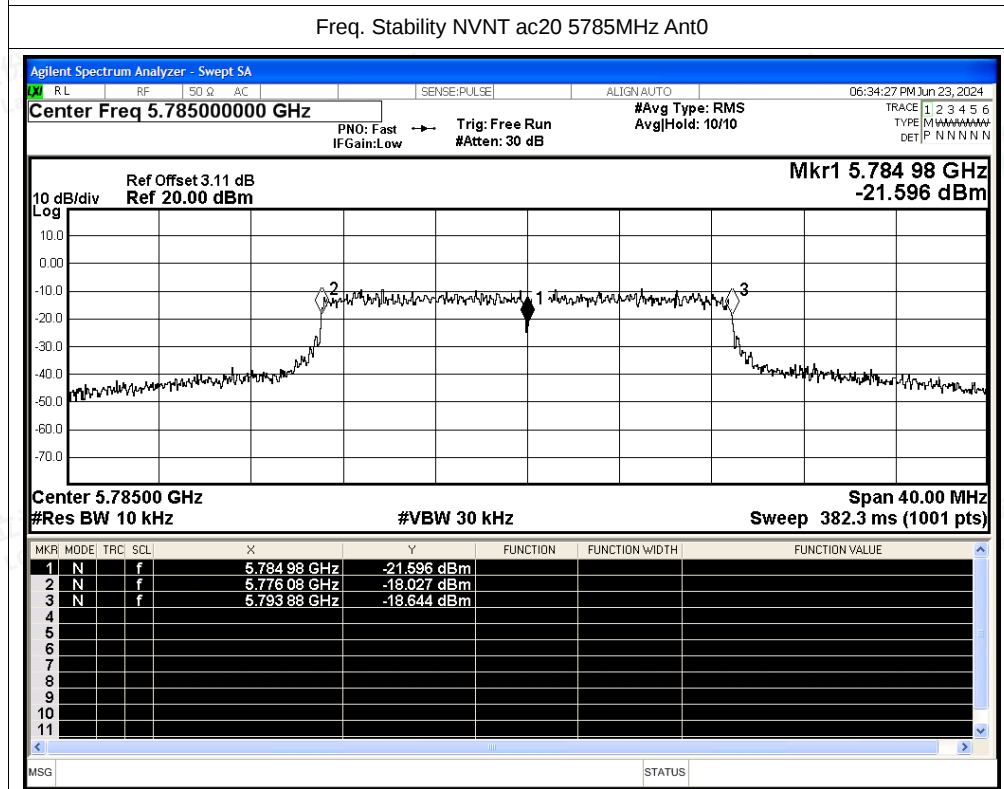
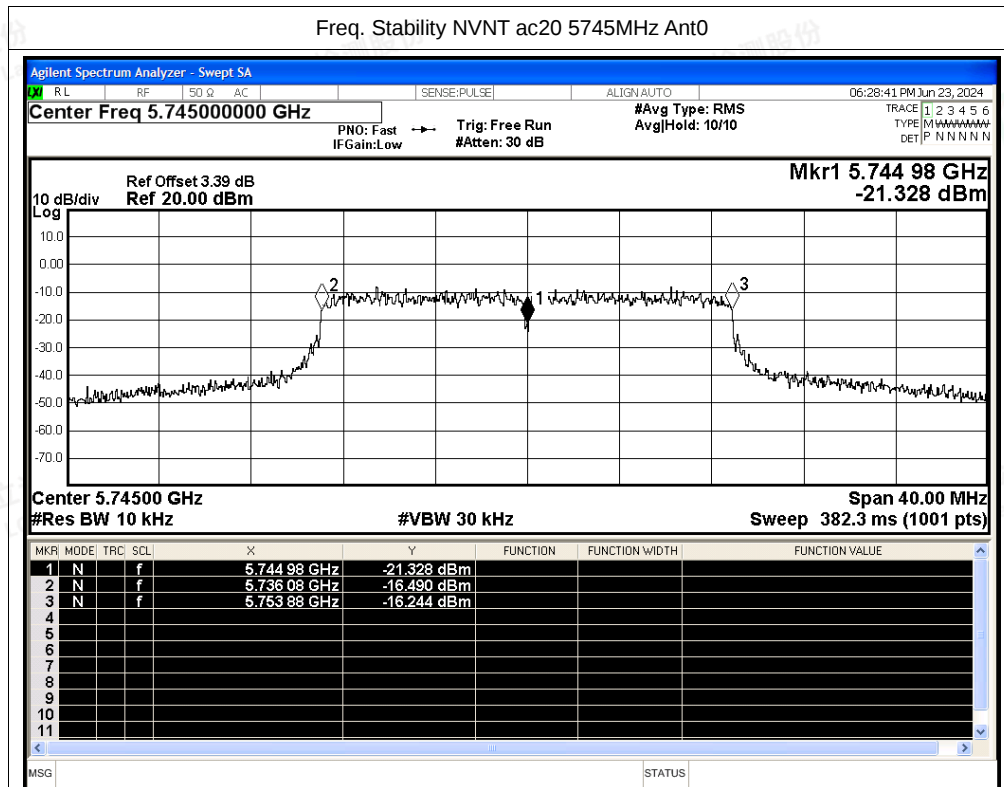


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

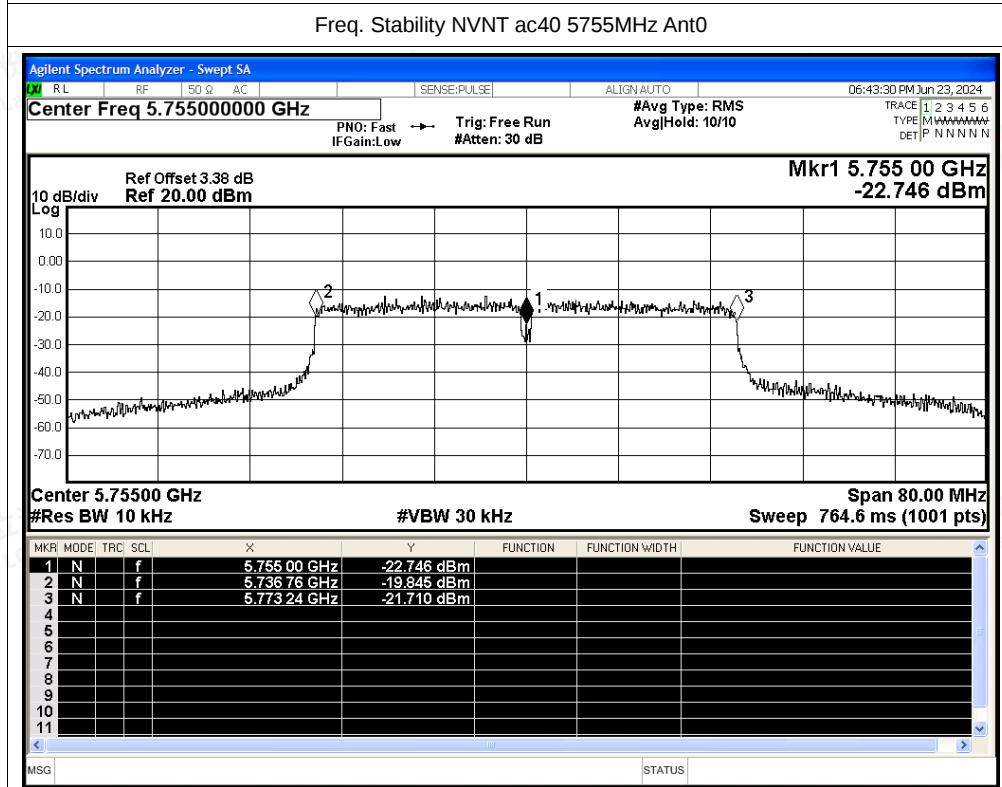
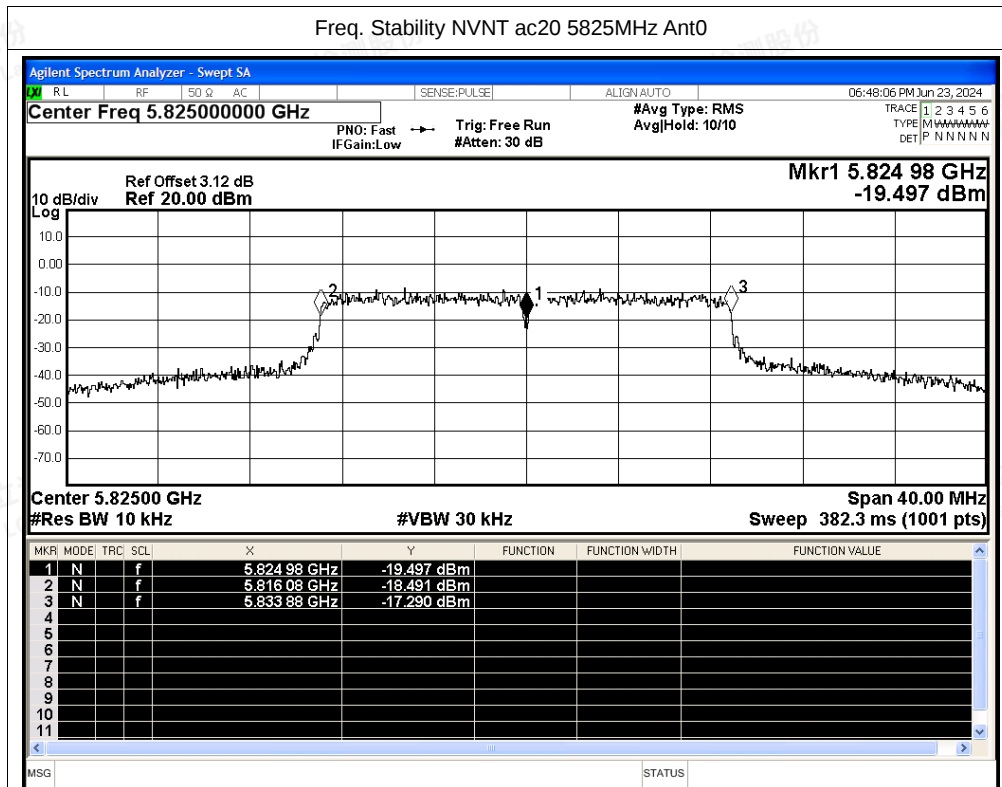


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

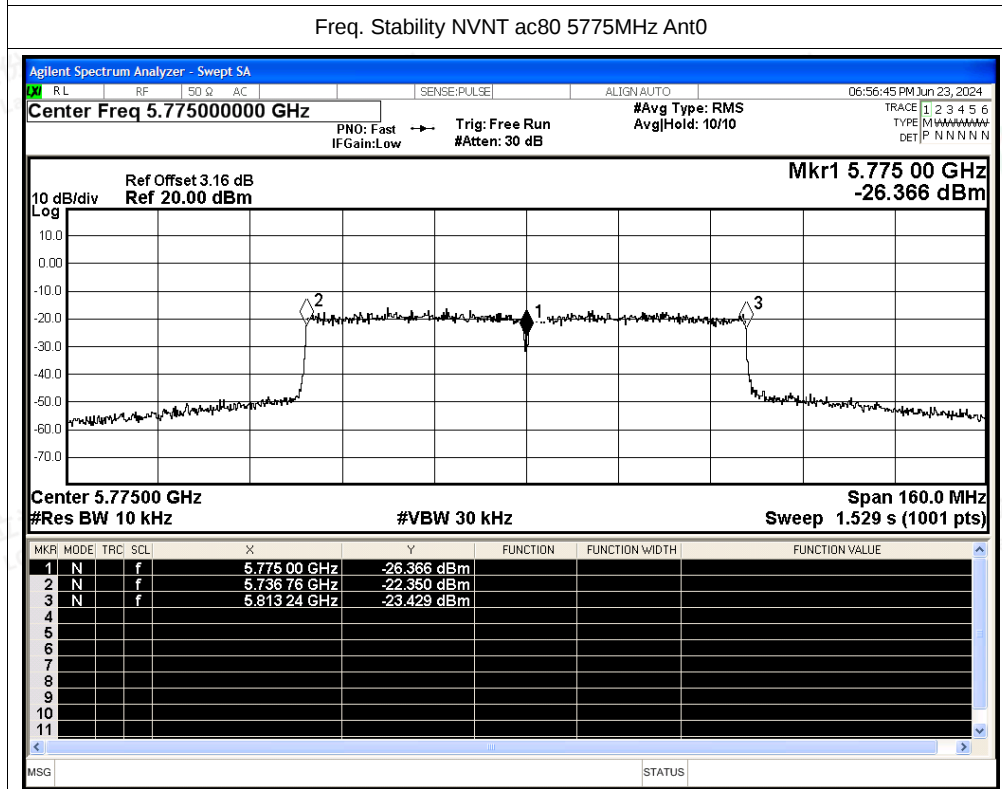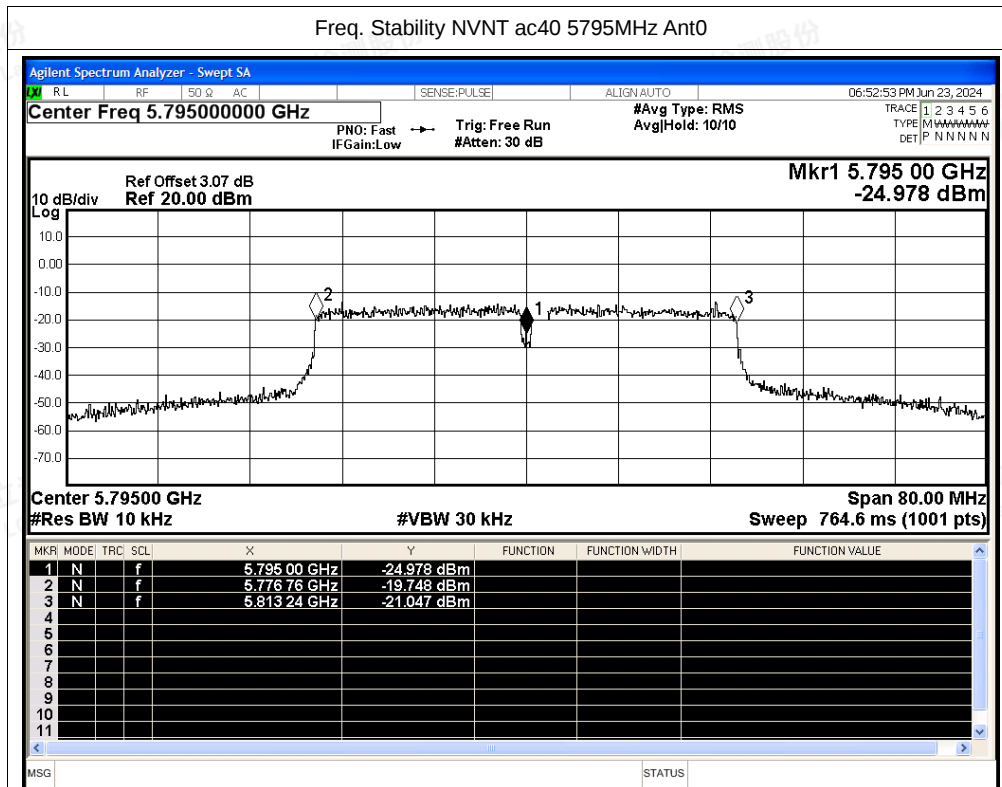

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



| Condition | Mode | Frequency (MHz) | Antenna | Measured Frequency (MHz) | Frequency Error (Hz) | Deviation (ppm) | Limit (ppm) | Verdict |
|-----------|------|-----------------|---------|--------------------------|----------------------|-----------------|-------------|---------|
| NVNT      | n40  | 5755            | Ant1    | 5755                     | 0                    | 0               | 25          | Pass    |
| NVNT      | n40  | 5795            | Ant1    | 5795                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac20 | 5745            | Ant1    | 5744.98                  | -20000               | -3.48           | 25          | Pass    |
| NVNT      | ac20 | 5785            | Ant1    | 5784.98                  | -20000               | -3.46           | 25          | Pass    |
| NVNT      | ac20 | 5825            | Ant1    | 5825                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac40 | 5755            | Ant1    | 5755                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac40 | 5795            | Ant1    | 5795                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac80 | 5775            | Ant1    | 5775                     | 0                    | 0               | 25          | Pass    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




## Test Graphs

## Freq. Stability NVNT n40 5755MHz Ant1

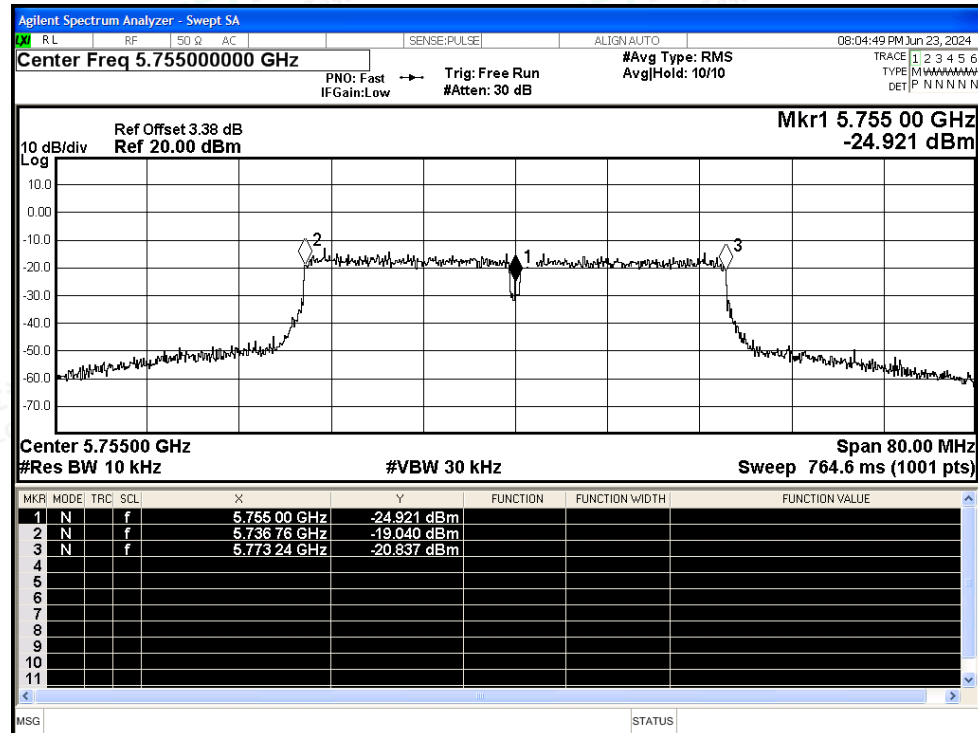

## Freq. Stability NVNT n40 5795MHz Ant1

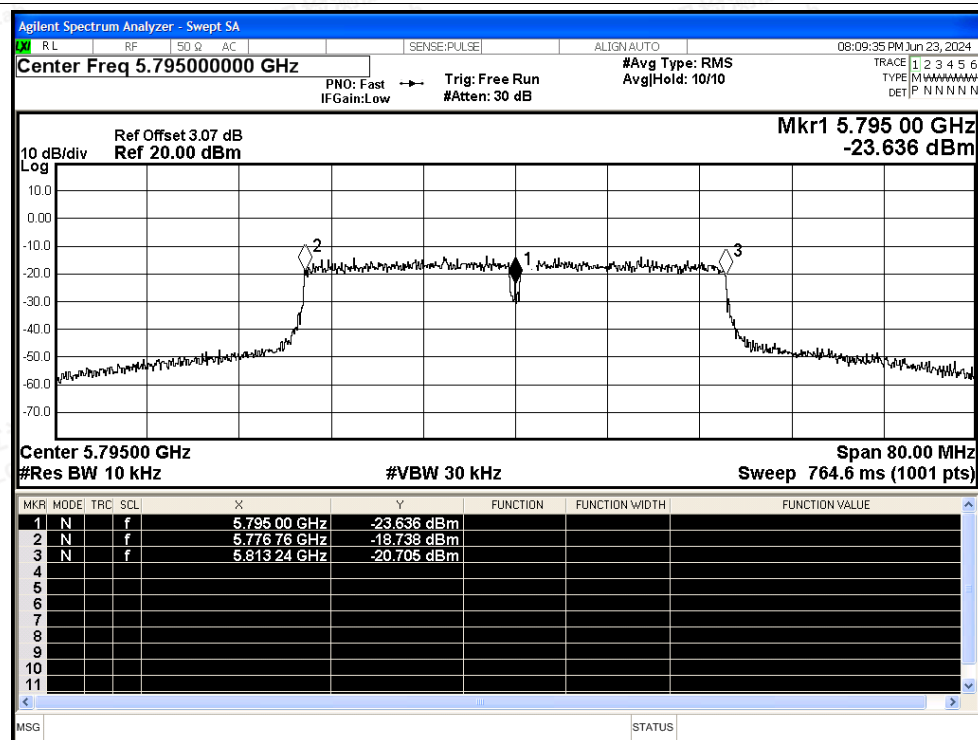

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ac20 5745MHz Ant1

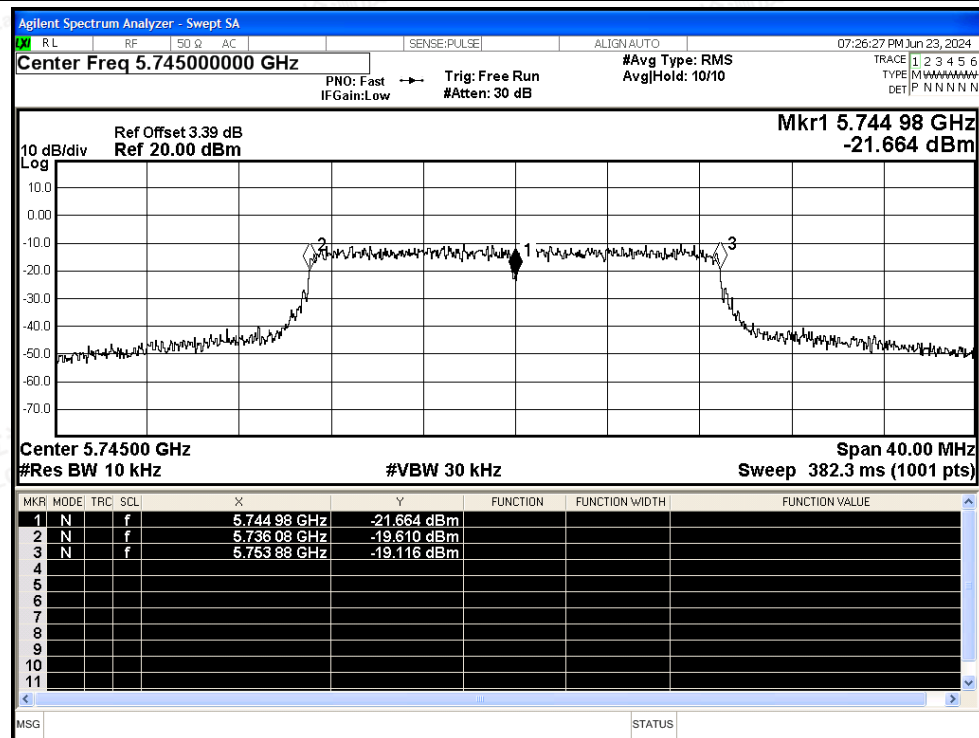

## Freq. Stability NVNT ac20 5785MHz Ant1


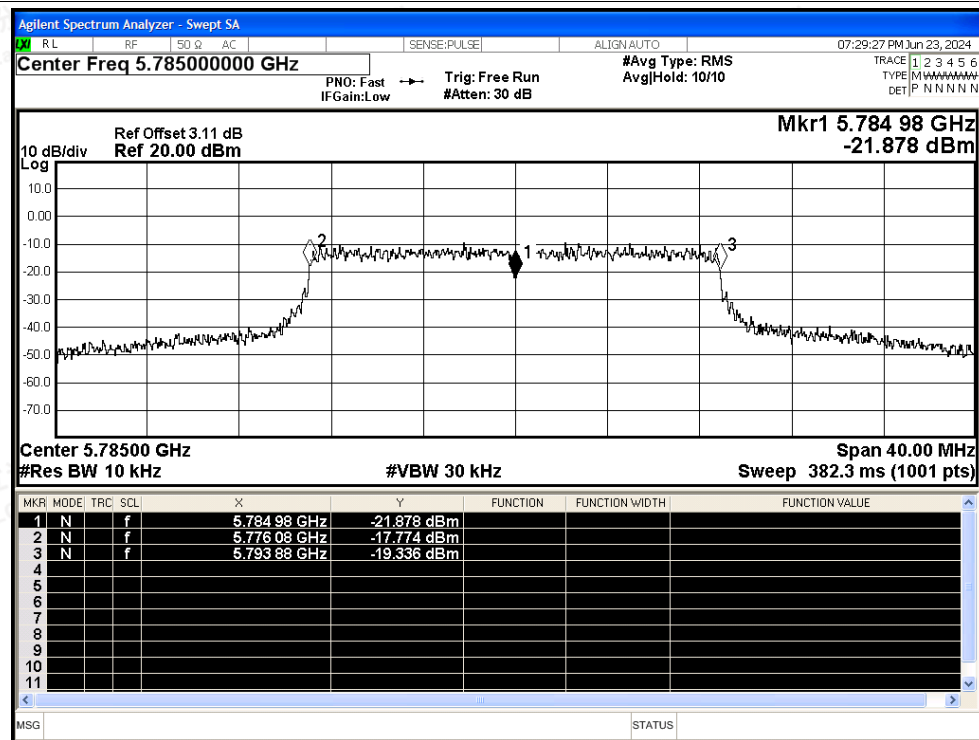


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

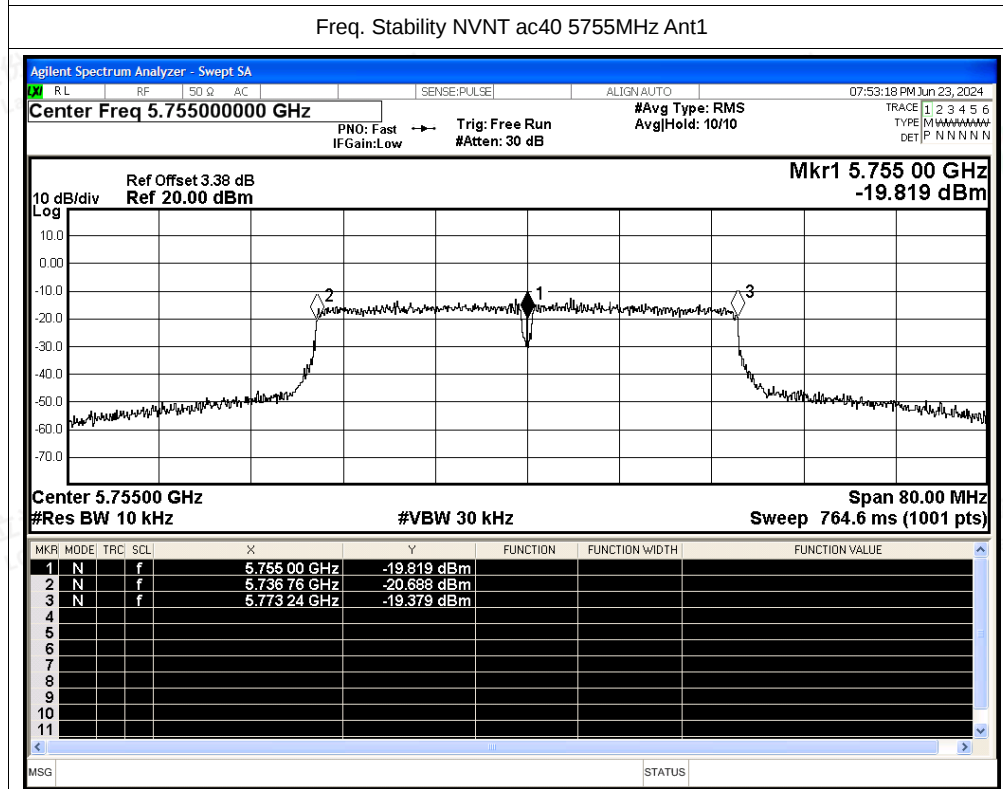
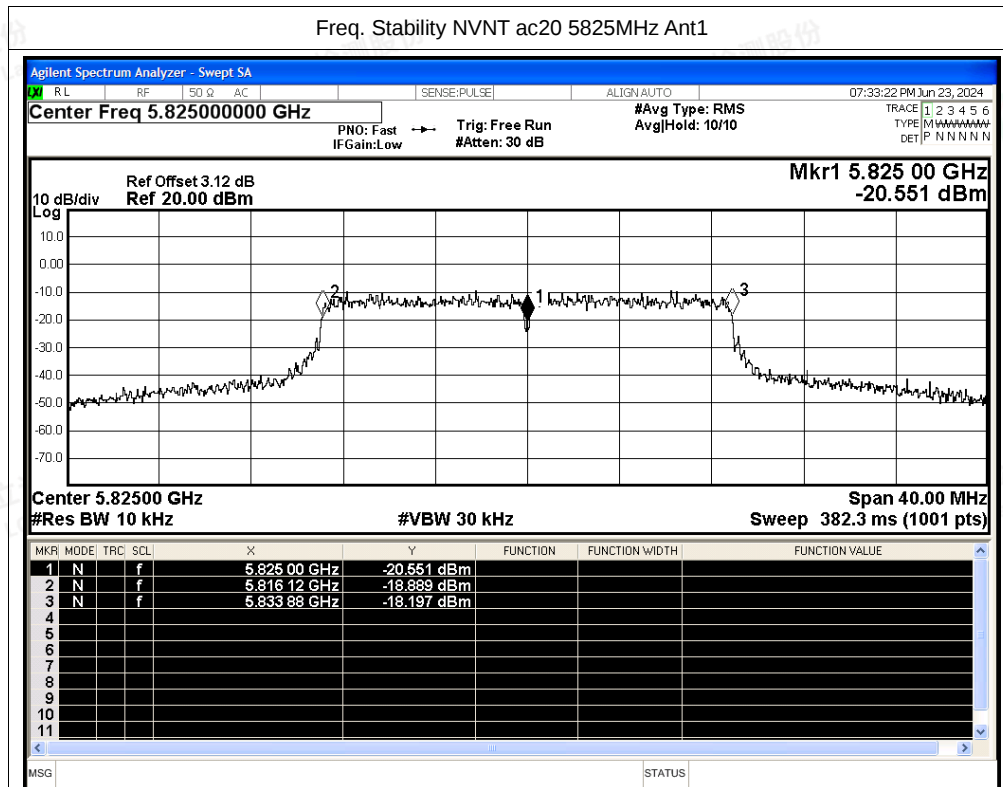


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

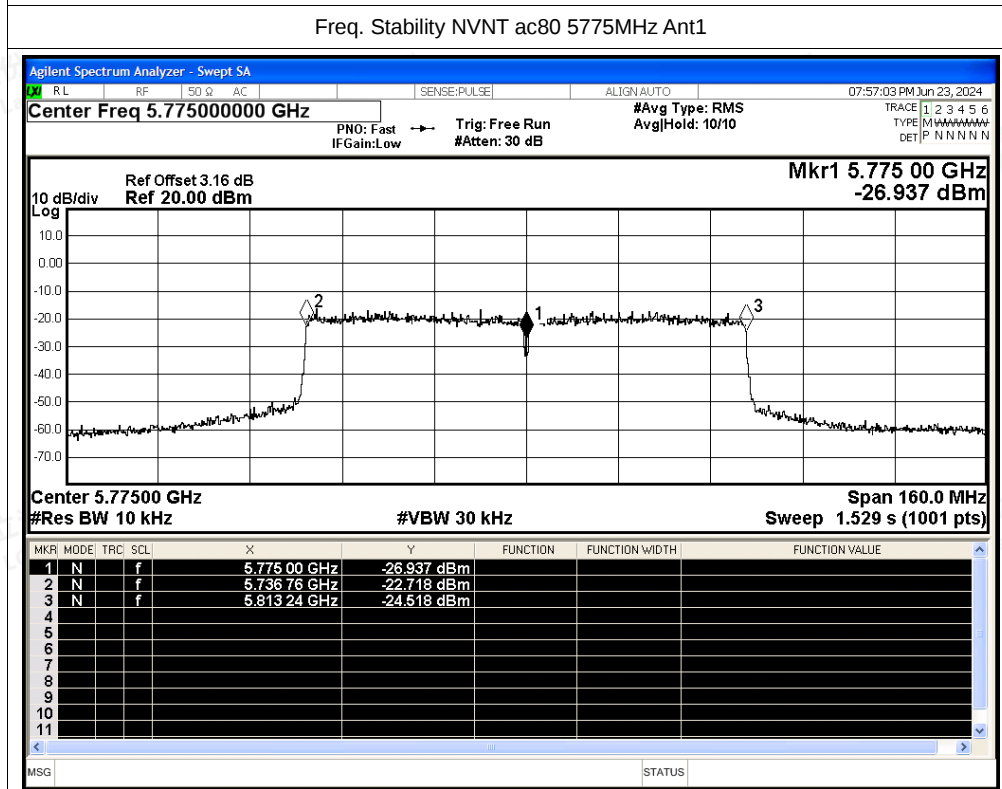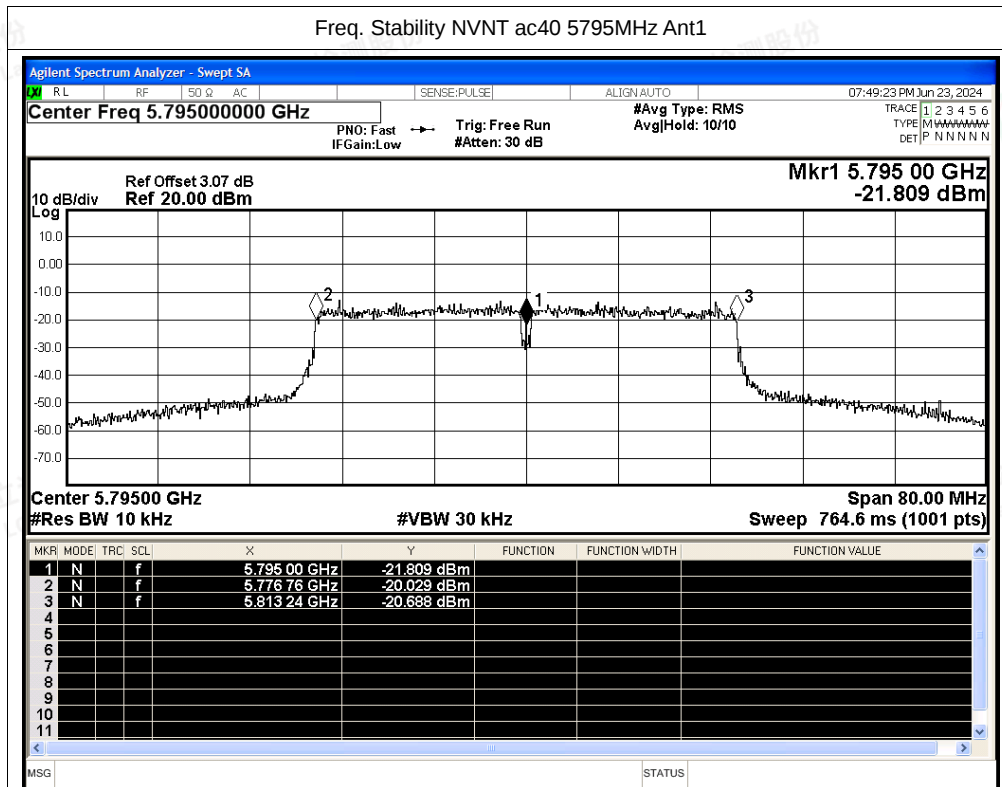

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



## G.6 Duty Cycle

| Condition | Mode | Frequency (MHz) | Antenna | Duty Cycle (%) | Correction Factor (dB) | 1/T (kHz) |
|-----------|------|-----------------|---------|----------------|------------------------|-----------|
| NVNT      | a    | 5745            | Ant0    | 94.65          | 0.24                   | 0.91      |
| NVNT      | a    | 5785            | Ant0    | 94.56          | 0.24                   | 0.91      |
| NVNT      | a    | 5825            | Ant0    | 94.65          | 0.24                   | 0.91      |
| NVNT      | n20  | 5745            | Ant0    | 93.67          | 0.28                   | 1.07      |
| NVNT      | n20  | 5785            | Ant0    | 93.77          | 0.28                   | 1.07      |
| NVNT      | n20  | 5825            | Ant0    | 93.77          | 0.28                   | 1.07      |
| NVNT      | n40  | 5755            | Ant0    | 97.23          | 0.12                   | 0.46      |
| NVNT      | n40  | 5795            | Ant0    | 97.23          | 0.12                   | 0.46      |
| NVNT      | ac20 | 5745            | Ant0    | 93.82          | 0.28                   | 1.06      |
| NVNT      | ac20 | 5785            | Ant0    | 93.72          | 0.28                   | 1.06      |
| NVNT      | ac20 | 5825            | Ant0    | 93.82          | 0.28                   | 1.06      |
| NVNT      | ac40 | 5755            | Ant0    | 97.24          | 0.12                   | 0.46      |
| NVNT      | ac40 | 5795            | Ant0    | 97.2           | 0.12                   | 0.46      |
| NVNT      | ac80 | 5775            | Ant0    | 94.41          | 0.25                   | 0.97      |
| NVNT      | ax20 | 5745            | Ant0    | 93.72          | 0.28                   | 1.06      |
| NVNT      | ax20 | 5785            | Ant0    | 93.72          | 0.28                   | 1.06      |
| NVNT      | ax20 | 5825            | Ant0    | 93.82          | 0.28                   | 1.06      |
| NVNT      | ax40 | 5755            | Ant0    | 97.19          | 0.12                   | 0.46      |
| NVNT      | ax40 | 5795            | Ant0    | 97.19          | 0.12                   | 0.46      |
| NVNT      | ax80 | 5775            | Ant0    | 94.41          | 0.25                   | 0.97      |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




## Test Graphs

## Duty Cycle NVNT a 5745MHz Ant0

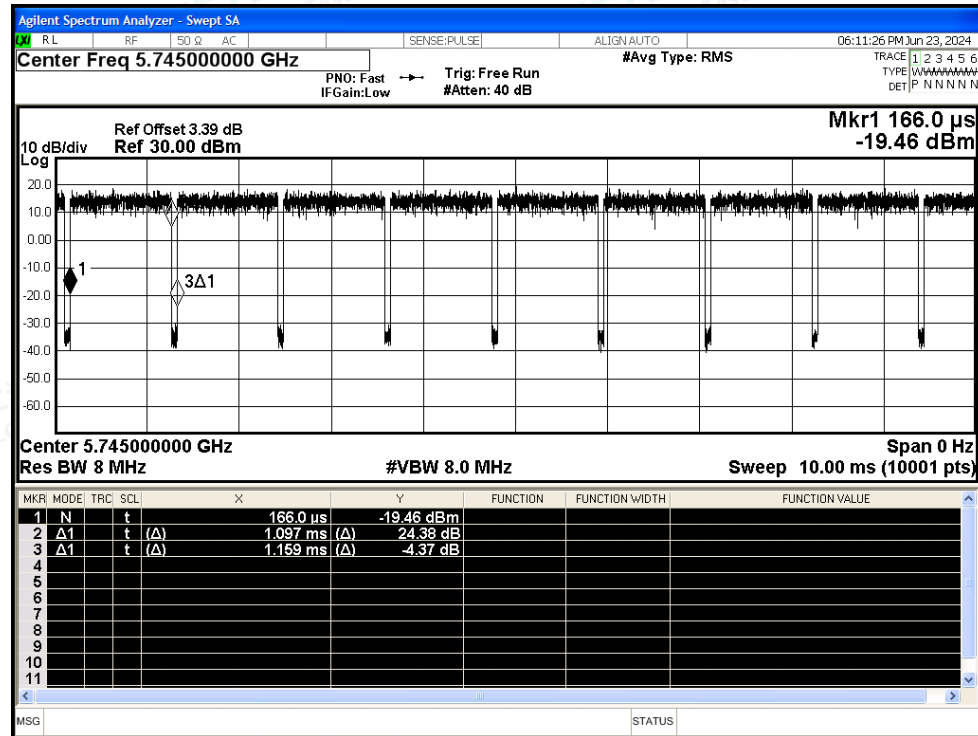

## Duty Cycle NVNT a 5785MHz Ant0

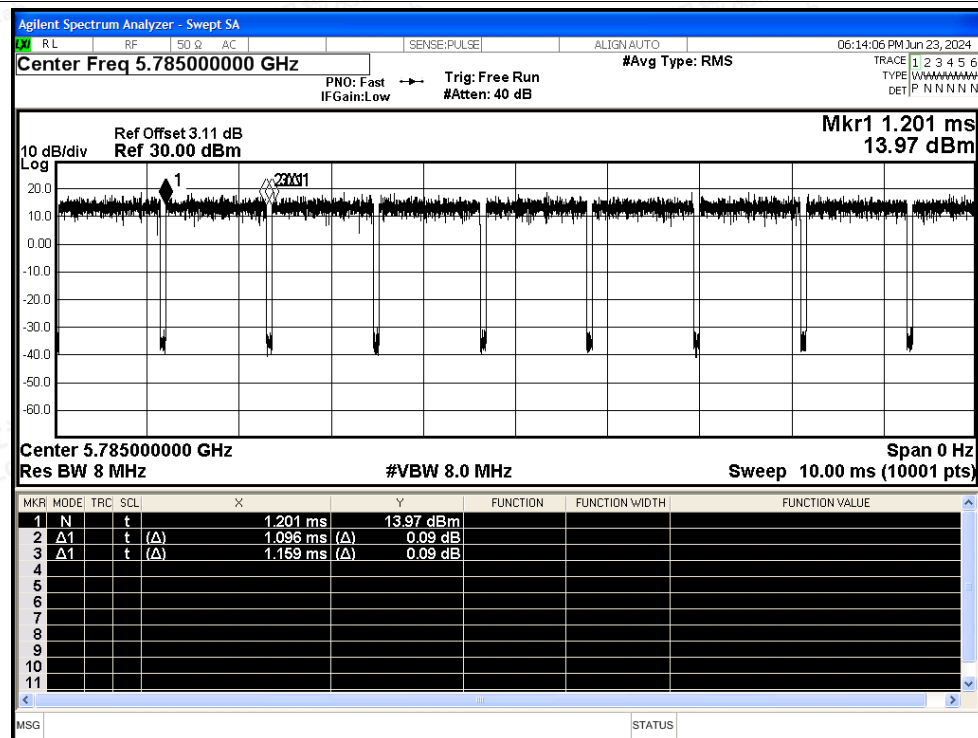

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT a 5825MHz Ant0

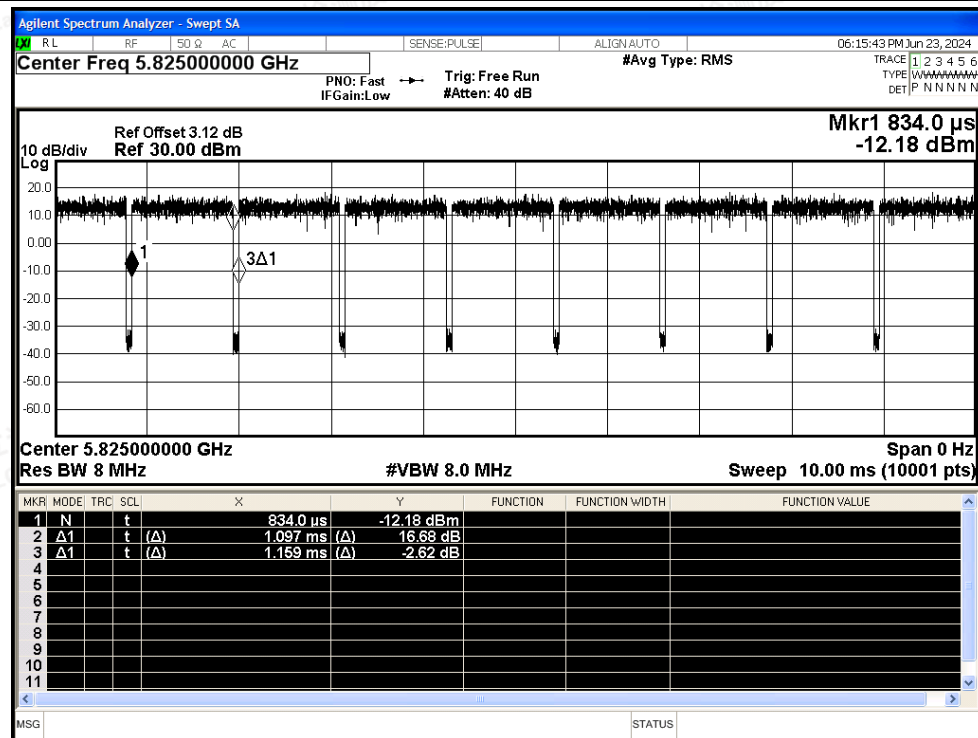

## Duty Cycle NVNT n20 5745MHz Ant0


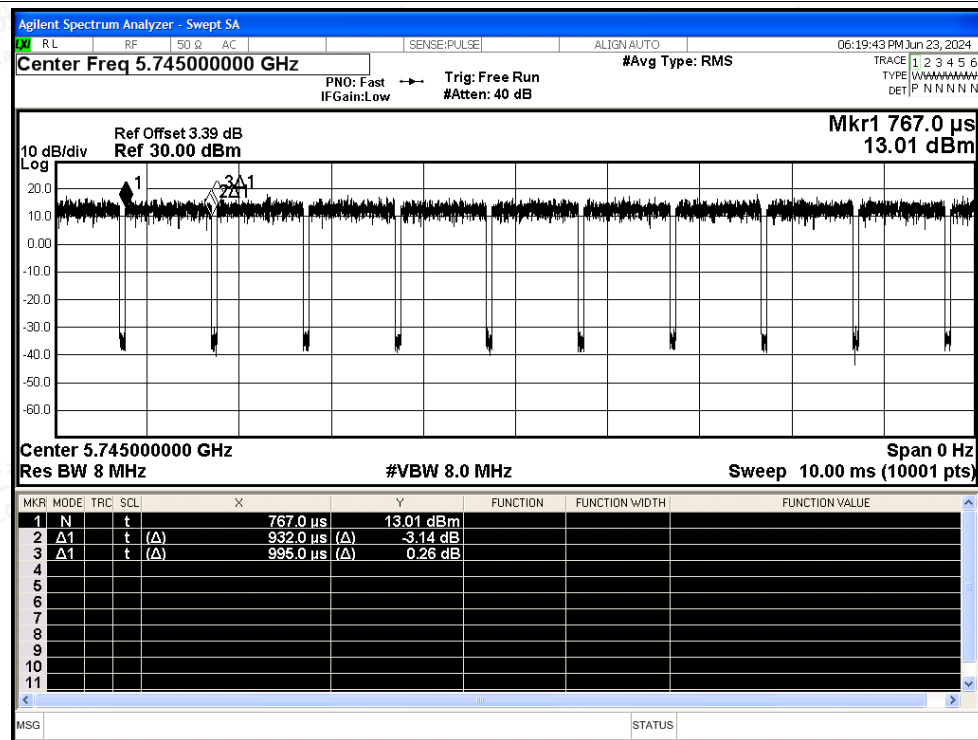


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

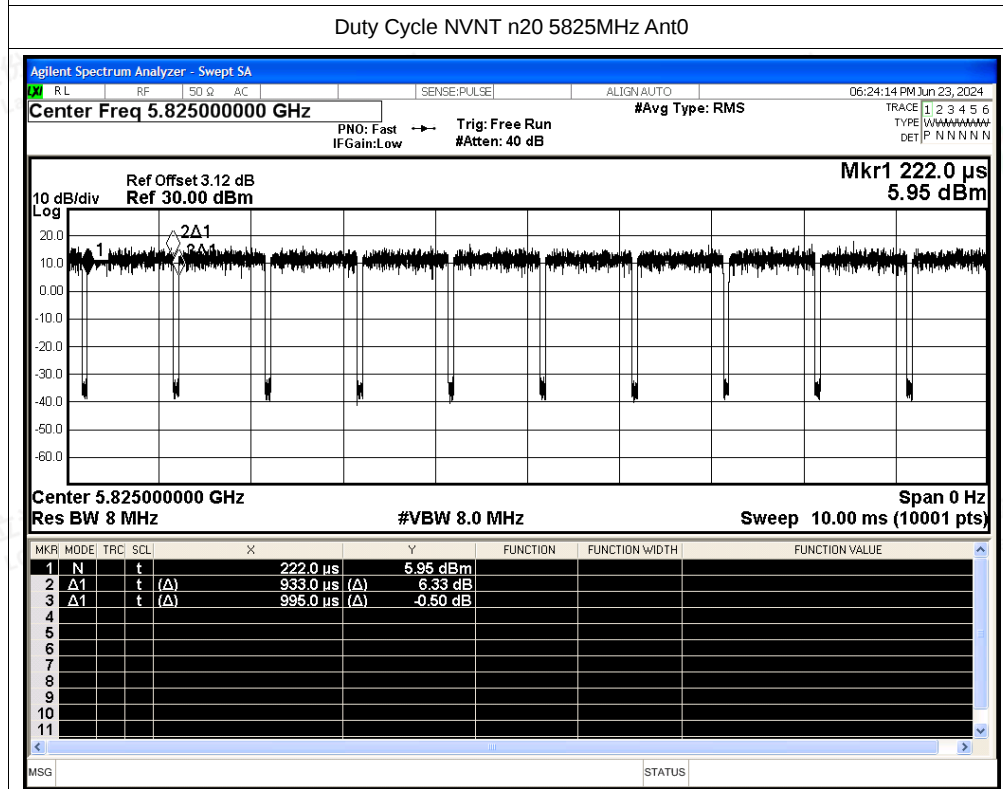
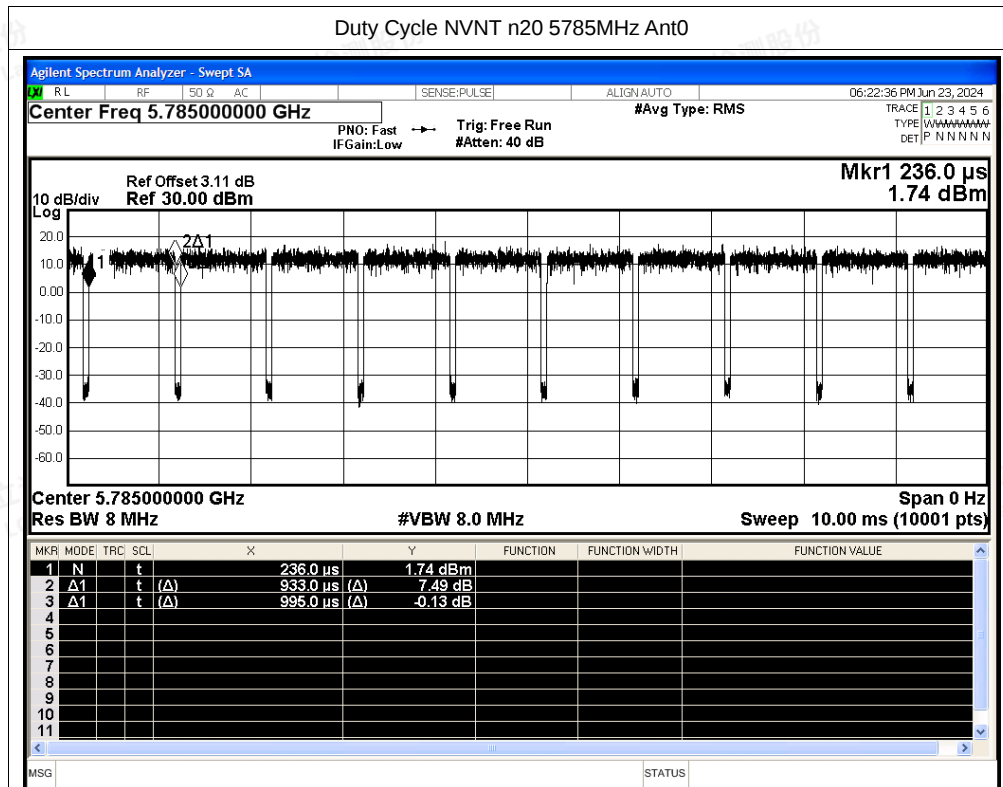


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

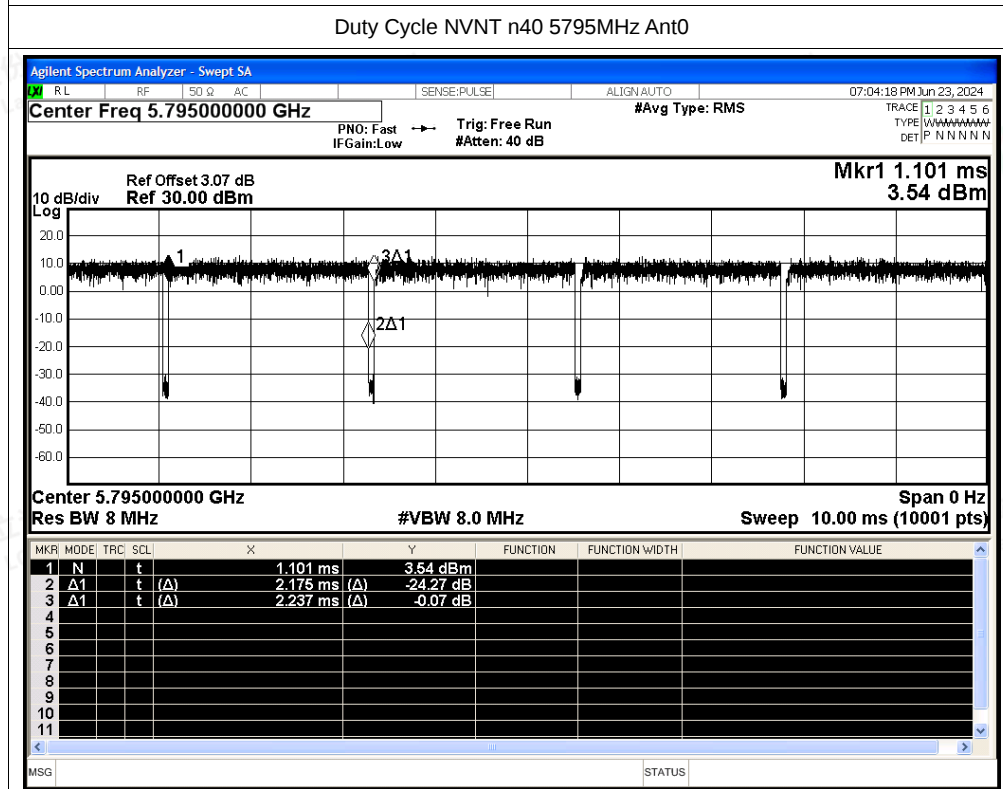
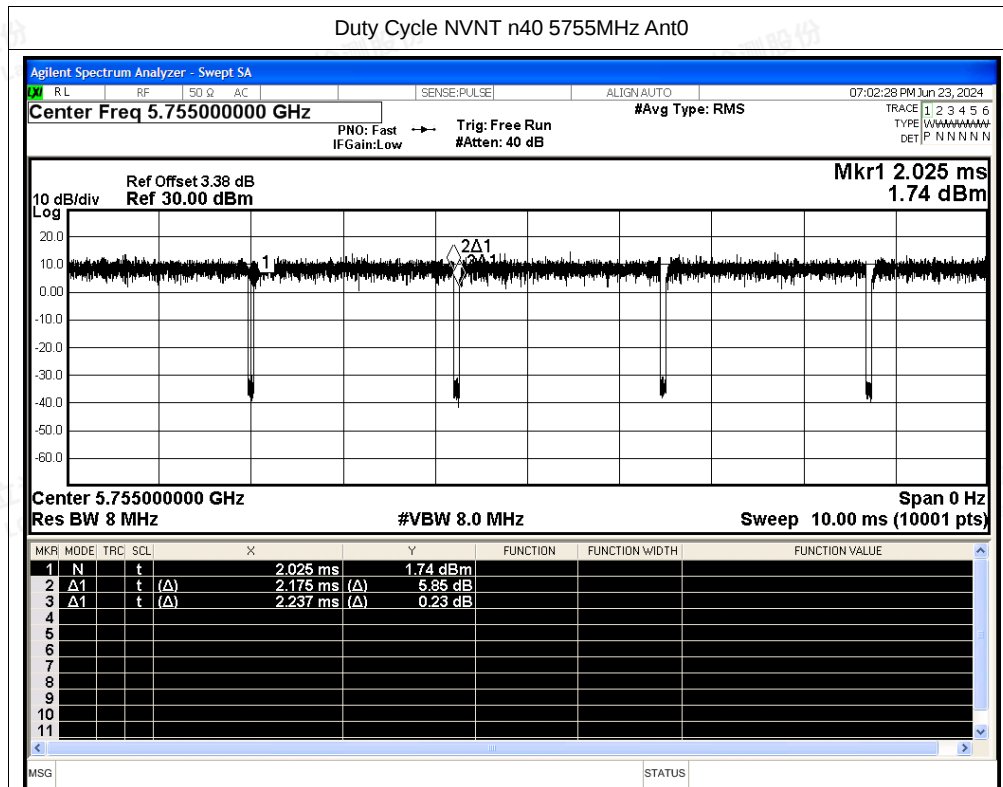


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

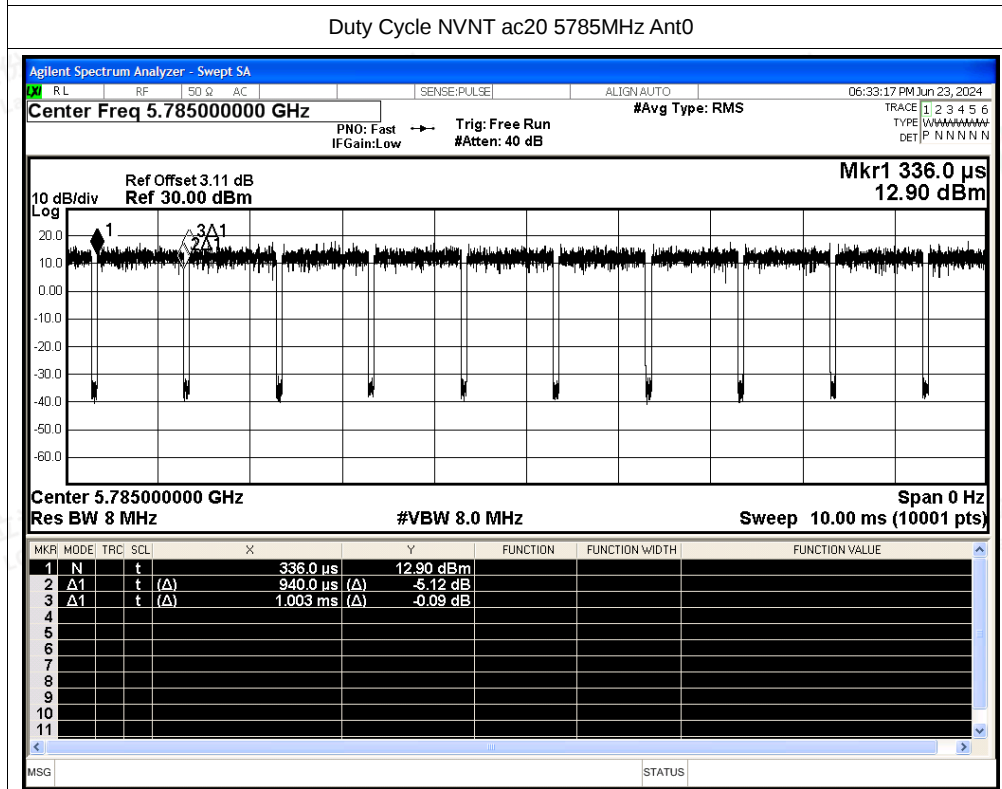
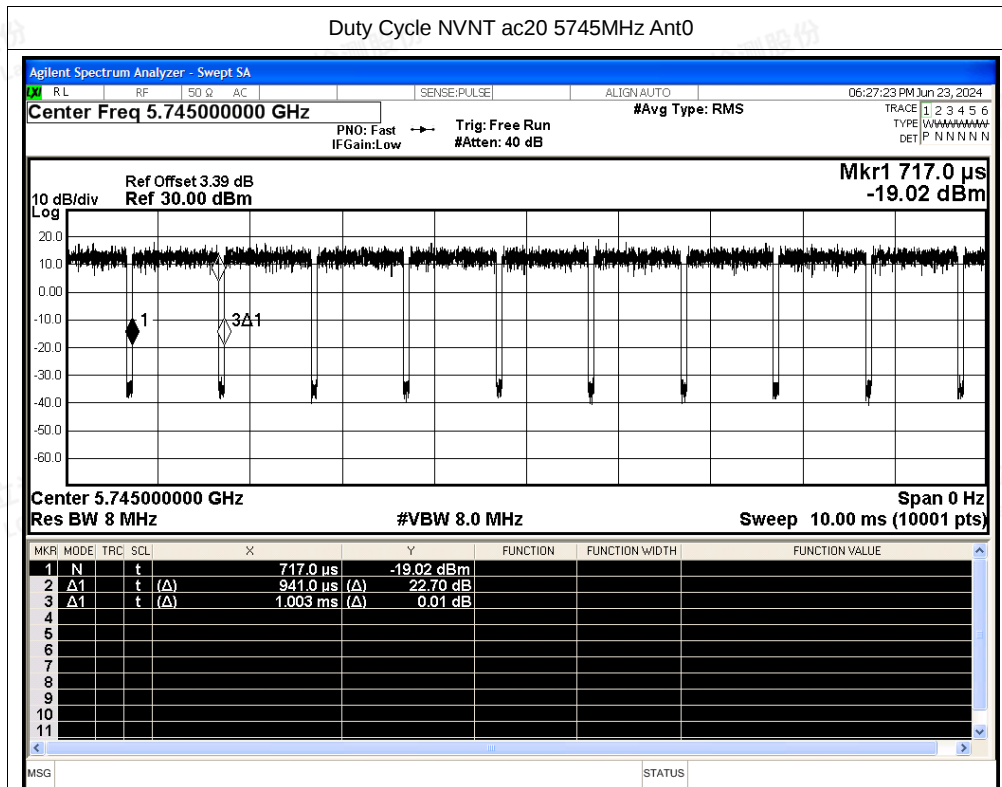


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

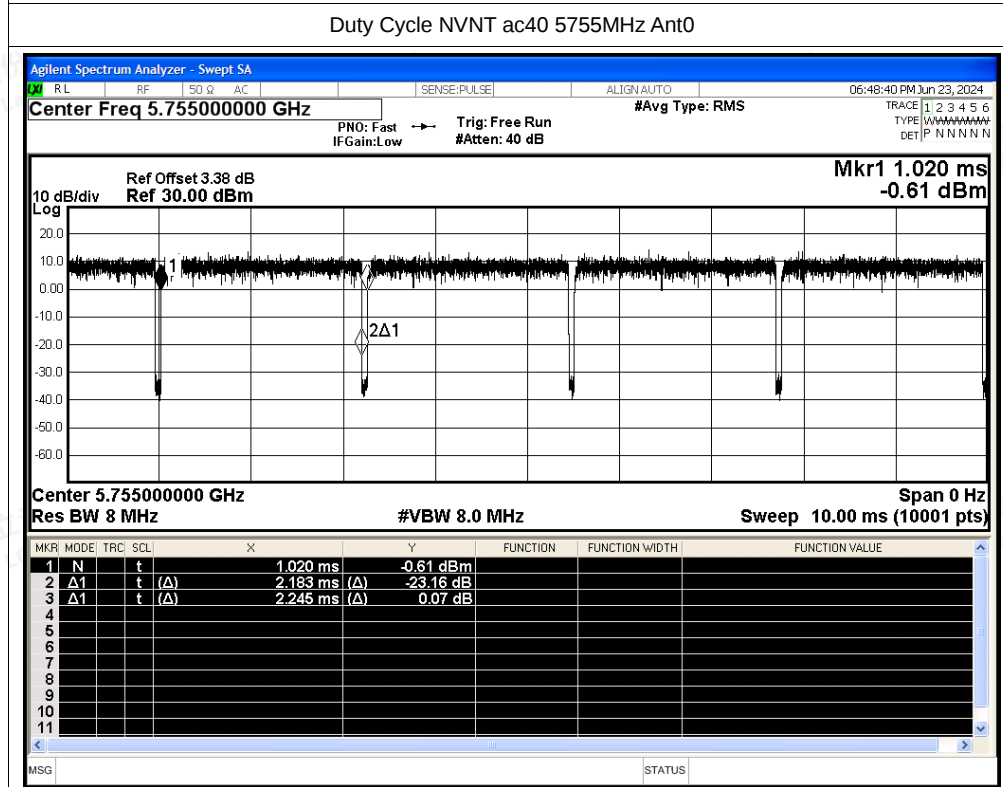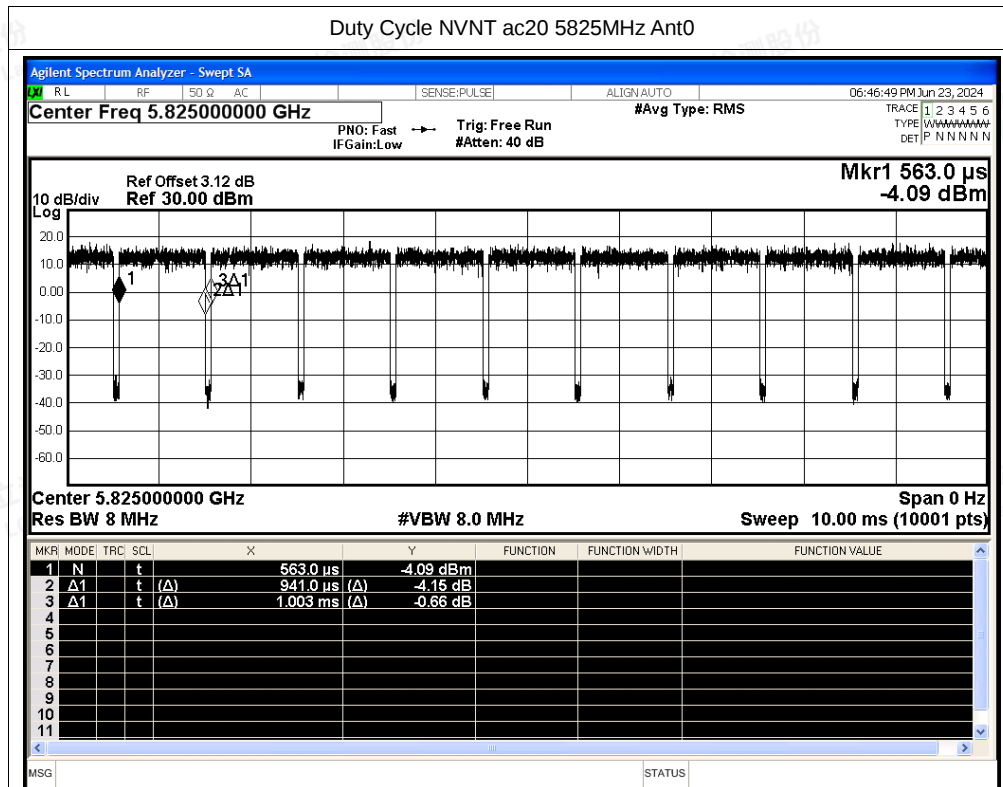

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ac40 5795MHz Ant0

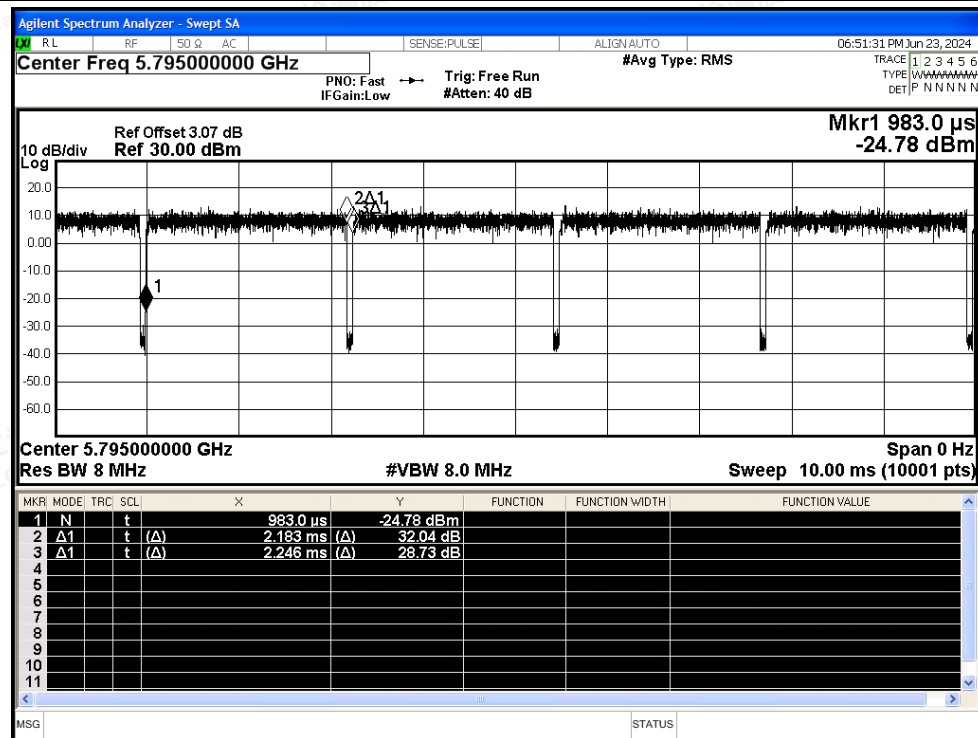

## Duty Cycle NVNT ac80 5775MHz Ant0

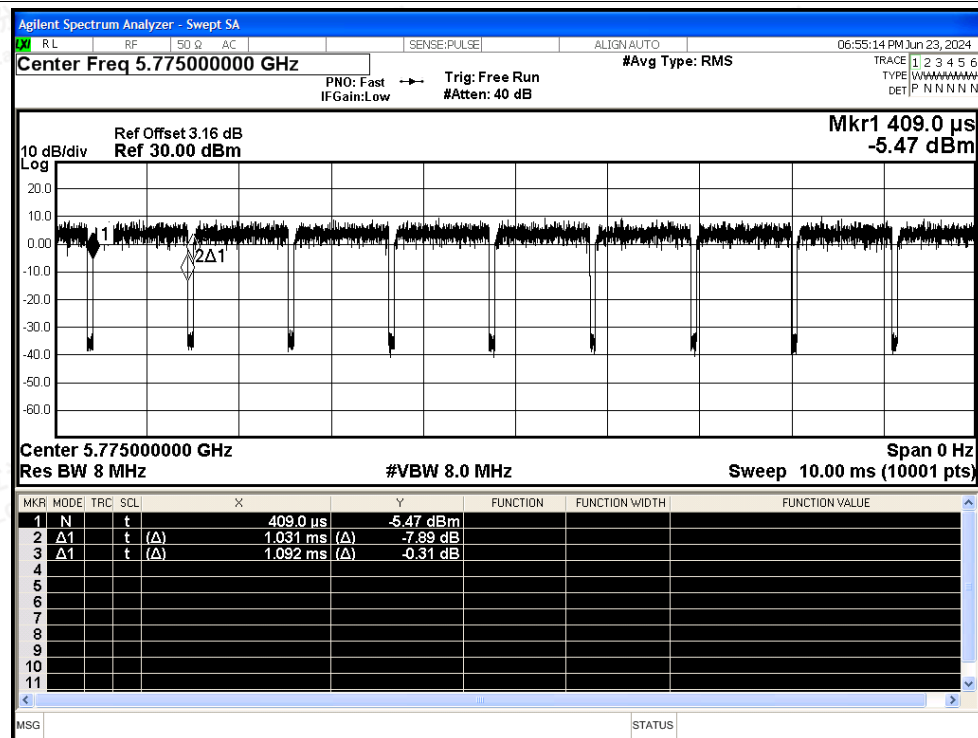

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ax20 5745MHz Ant0

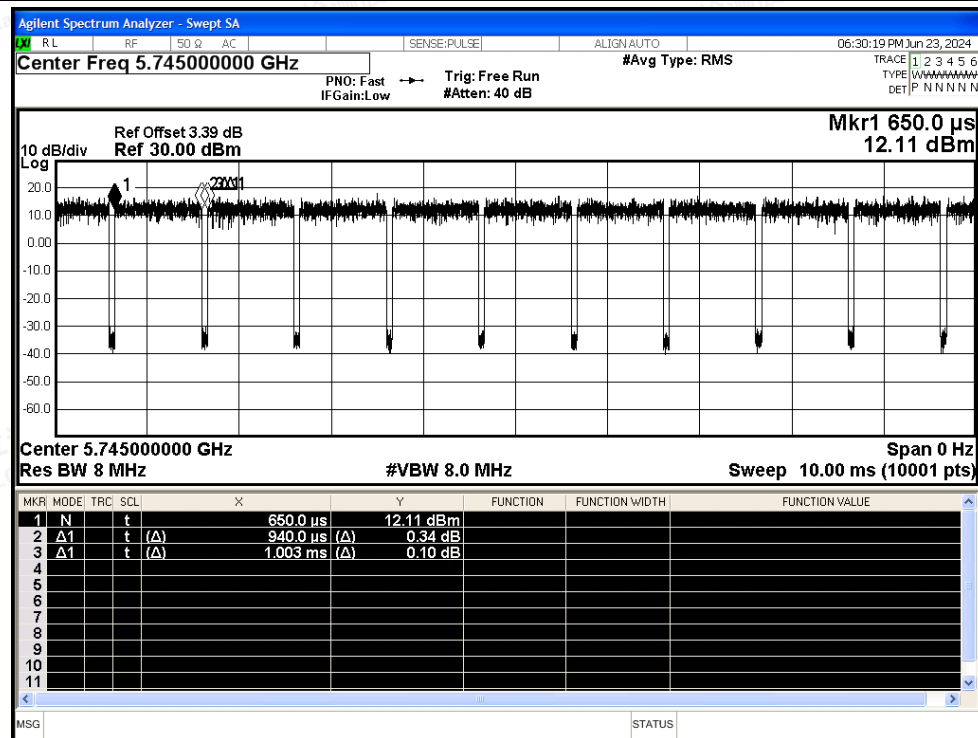

## Duty Cycle NVNT ax20 5785MHz Ant0

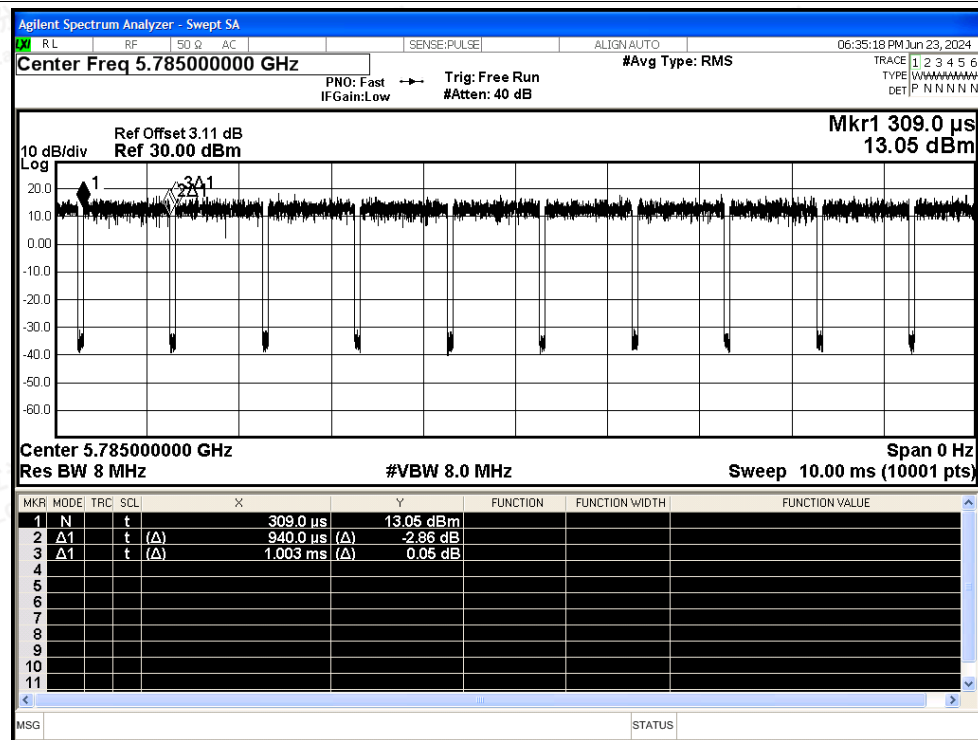

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ax20 5825MHz Ant0

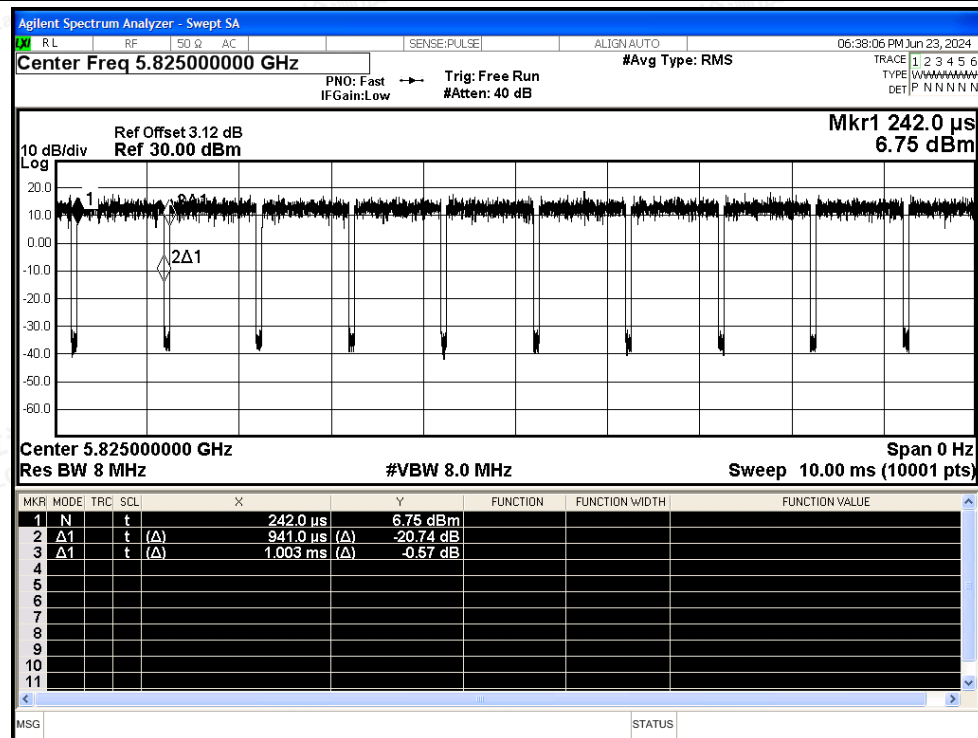

## Duty Cycle NVNT ax40 5755MHz Ant0


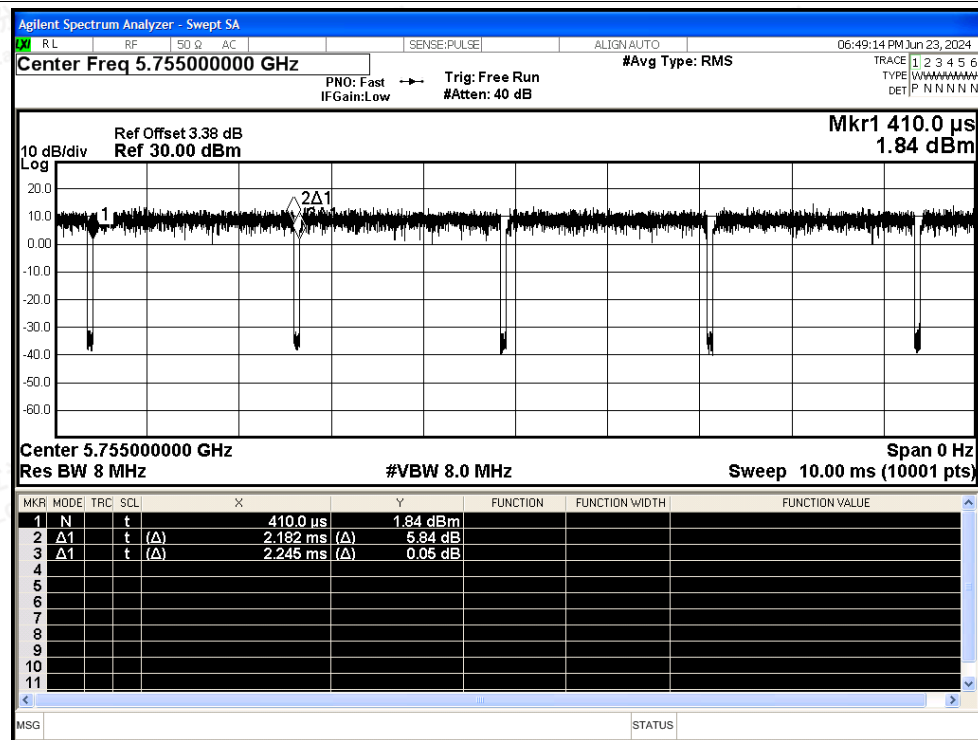


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

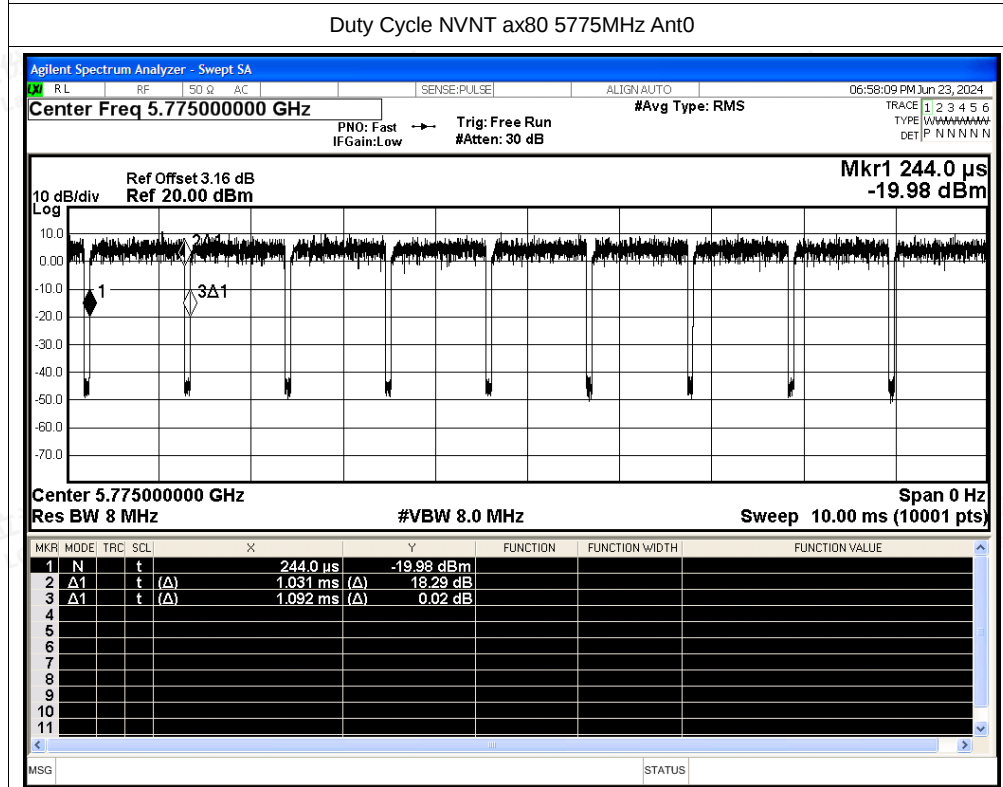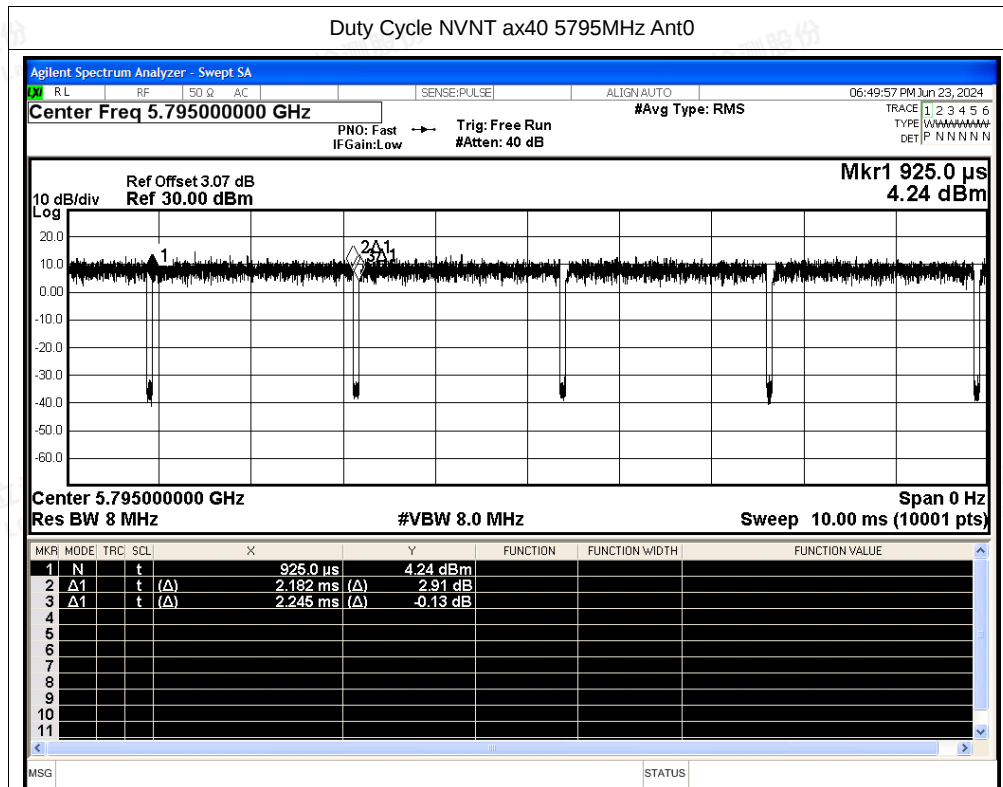

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



| Condition | Mode | Frequency (MHz) | Antenna | Duty Cycle (%) | Correction Factor (dB) | 1/T (kHz) |
|-----------|------|-----------------|---------|----------------|------------------------|-----------|
| NVNT      | a    | 5745            | Ant1    | 94.56          | 0.24                   | 0.91      |
| NVNT      | a    | 5785            | Ant1    | 94.56          | 0.24                   | 0.91      |
| NVNT      | a    | 5825            | Ant1    | 94.56          | 0.24                   | 0.91      |
| NVNT      | n20  | 5745            | Ant1    | 93.77          | 0.28                   | 1.07      |
| NVNT      | n20  | 5785            | Ant1    | 93.77          | 0.28                   | 1.07      |
| NVNT      | n20  | 5825            | Ant1    | 93.77          | 0.28                   | 1.07      |
| NVNT      | n40  | 5755            | Ant1    | 97.18          | 0.12                   | 0.46      |
| NVNT      | n40  | 5795            | Ant1    | 97.23          | 0.12                   | 0.46      |
| NVNT      | ac20 | 5745            | Ant1    | 93.72          | 0.28                   | 1.06      |
| NVNT      | ac20 | 5785            | Ant1    | 93.82          | 0.28                   | 1.06      |
| NVNT      | ac20 | 5825            | Ant1    | 93.72          | 0.28                   | 1.06      |
| NVNT      | ac40 | 5755            | Ant1    | 97.19          | 0.12                   | 0.46      |
| NVNT      | ac40 | 5795            | Ant1    | 97.24          | 0.12                   | 0.46      |
| NVNT      | ac80 | 5775            | Ant1    | 94.41          | 0.25                   | 0.97      |
| NVNT      | ax20 | 5745            | Ant1    | 93.72          | 0.28                   | 1.06      |
| NVNT      | ax20 | 5785            | Ant1    | 93.82          | 0.28                   | 1.06      |
| NVNT      | ax20 | 5825            | Ant1    | 93.72          | 0.28                   | 1.06      |
| NVNT      | ax40 | 5755            | Ant1    | 97.19          | 0.12                   | 0.46      |
| NVNT      | ax40 | 5795            | Ant1    | 97.19          | 0.12                   | 0.46      |
| NVNT      | ax80 | 5775            | Ant1    | 94.32          | 0.25                   | 0.97      |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




## Test Graphs

## Duty Cycle NVNT a 5745MHz Ant1

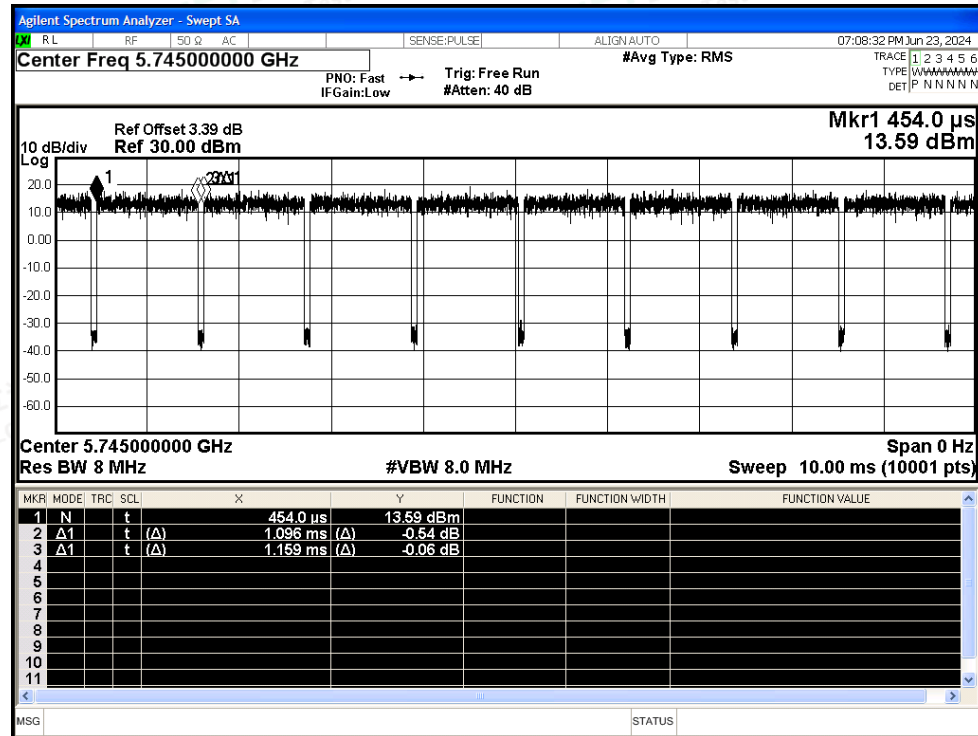

## Duty Cycle NVNT a 5785MHz Ant1

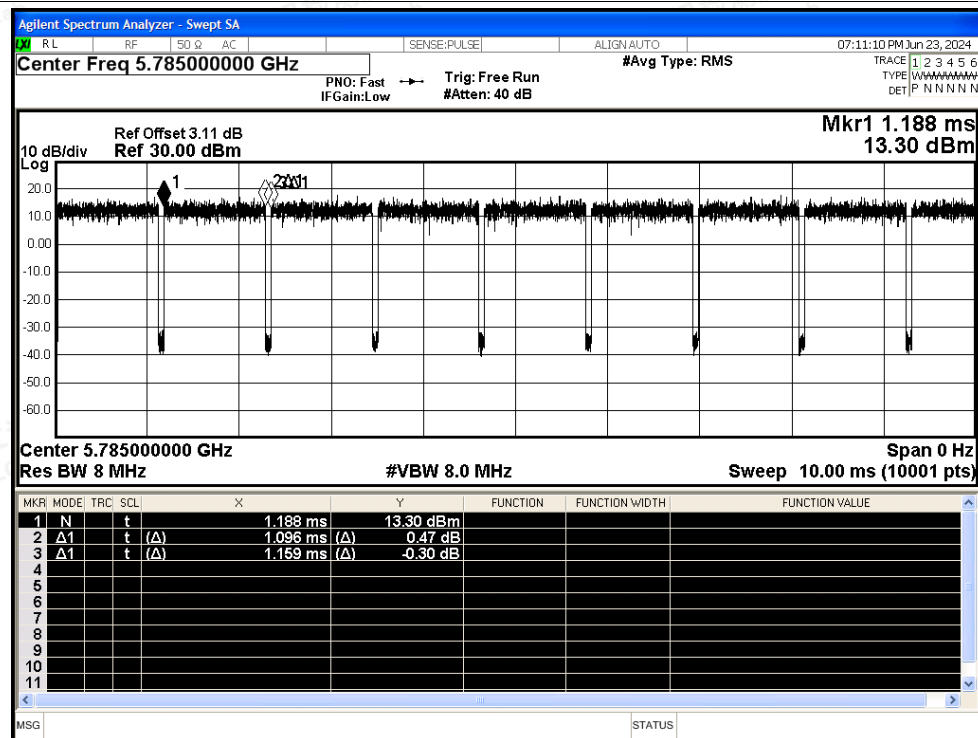

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity