



Band Edge NVNT ac40 5190MHz Low Ant1



Band Edge NVNT ac40 5230MHz High Ant1



Band Edge NVNT ac40 5270MHz Low Ant1





Band Edge NVNT ac40 5310MHz High Ant1



Band Edge NVNT ac40 5510MHz Low Ant1



Band Edge NVNT ac40 5670MHz High Ant1





Band Edge NVNT ac40 5190MHz Low Ant2



Band Edge NVNT ac40 5230MHz High Ant2



Band Edge NVNT ac40 5270MHz Low Ant2





Band Edge NVNT ac40 5310MHz High Ant2



Band Edge NVNT ac40 5510MHz Low Ant2



Band Edge NVNT ac40 5670MHz High Ant2





Band Edge NVNT ac80 5210MHz Low Ant1



Band Edge NVNT ac80 5290MHz High Ant1




Band Edge NVNT ac80 5530MHz Low Ant1





Band Edge NVNT ac80 5610MHz High Ant1

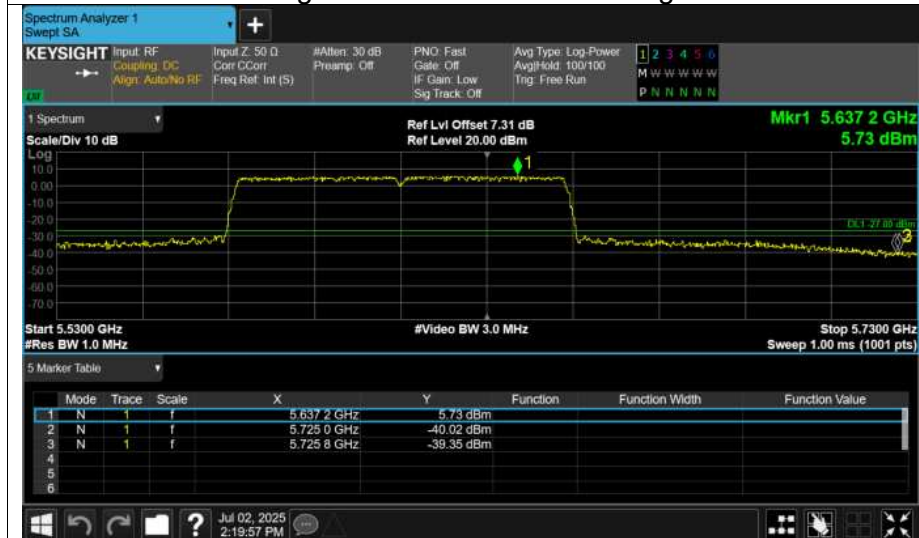

Band Edge NVNT ac80 5210MHz Low Ant2



Band Edge NVNT ac80 5290MHz High Ant2





Band Edge NVNT ac80 5530MHz Low Ant2



Band Edge NVNT ac80 5610MHz High Ant2



Band Edge NVNT ax20 5180MHz Low Ant1





Band Edge NVNT ax20 5240MHz High Ant1



Band Edge NVNT ax20 5260MHz Low Ant1



Band Edge NVNT ax20 5320MHz High Ant1





Band Edge NVNT ax20 5500MHz Low Ant1



Band Edge NVNT ax20 5700MHz High Ant1



Band Edge NVNT ax20 5180MHz Low Ant2





Band Edge NVNT ax20 5240MHz High Ant2



Band Edge NVNT ax20 5260MHz Low Ant2



Band Edge NVNT ax20 5320MHz High Ant2





Band Edge NVNT ax20 5500MHz Low Ant2



Band Edge NVNT ax20 5700MHz High Ant2



Band Edge NVNT ax40 5190MHz Low Ant1





Band Edge NVNT ax40 5230MHz High Ant1



Band Edge NVNT ax40 5270MHz Low Ant1




Band Edge NVNT ax40 5310MHz High Ant1





Band Edge NVNT ax40 5510MHz Low Ant1

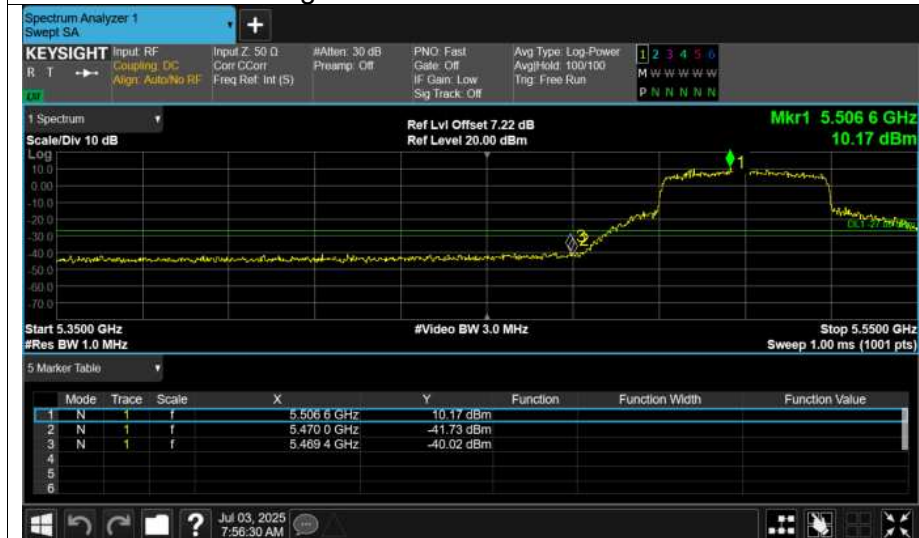

Band Edge NVNT ax40 5670MHz High Ant1



Band Edge NVNT ax40 5190MHz Low Ant2





Band Edge NVNT ax40 5230MHz High Ant2



Band Edge NVNT ax40 5270MHz Low Ant2



Band Edge NVNT ax40 5310MHz High Ant2





Band Edge NVNT ax40 5510MHz Low Ant2



Band Edge NVNT ax40 5670MHz High Ant2



Band Edge NVNT ax80 5210MHz Low Ant1





Band Edge NVNT ax80 5290MHz High Ant1



Band Edge NVNT ax80 5530MHz Low Ant1



Band Edge NVNT ax80 5610MHz High Ant1





Band Edge NVNT ax80 5210MHz Low Ant2



Band Edge NVNT ax80 5290MHz High Ant2



Band Edge NVNT ax80 5530MHz Low Ant2





Band Edge NVNT ax80 5610MHz High Ant2



Band Edge NVNT a 5745MHz Low Ant1



Band Edge NVNT a 5825MHz High Ant1





Band Edge NVNT n20 5745MHz Low Ant1



Band Edge NVNT n20 5825MHz High Ant1



Band Edge NVNT n40 5755MHz Low Ant1





Band Edge NVNT n40 5795MHz High Ant1



Band Edge NVNT n40 5755MHz Low Ant2



Band Edge NVNT n40 5795MHz High Ant2





Band Edge NVNT ac20 5745MHz Low Ant1



Band Edge NVNT ac20 5825MHz High Ant1



Band Edge NVNT ac40 5755MHz Low Ant1





Band Edge NVNT ac40 5795MHz High Ant1



Band Edge NVNT ac40 5755MHz Low Ant2



Band Edge NVNT ac40 5795MHz High Ant2






Band Edge NVNT ac80 5775MHz Low Ant1



Band Edge NVNT ac80 5775MHz Low Ant2



Band Edge NVNT ax20 5745MHz Low Ant1

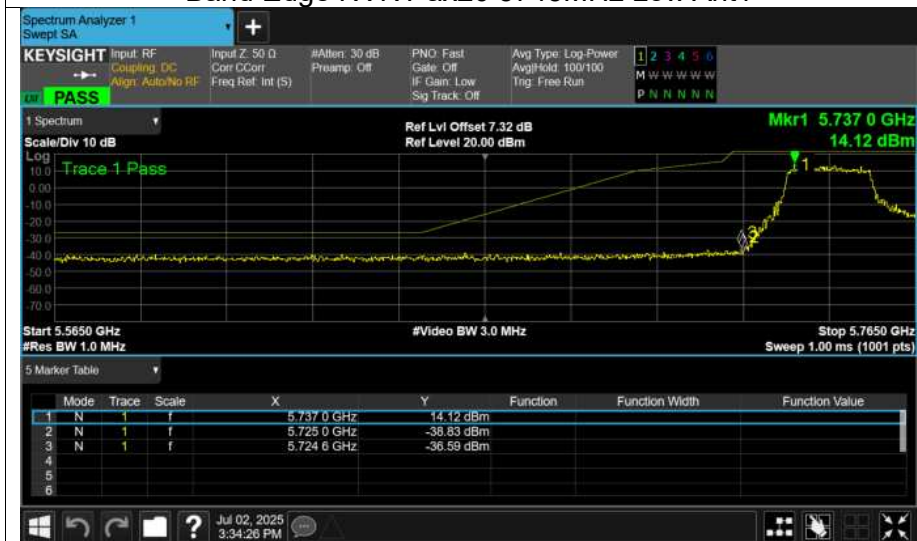



Band Edge NVNT ax20 5825MHz High Ant1



Band Edge NVNT ax40 5755MHz Low Ant1



Band Edge NVNT ax40 5795MHz High Ant1





Band Edge NVNT ax40 5755MHz Low Ant2




Band Edge NVNT ax40 5795MHz High Ant2



Band Edge NVNT ax80 5775MHz Low Ant1



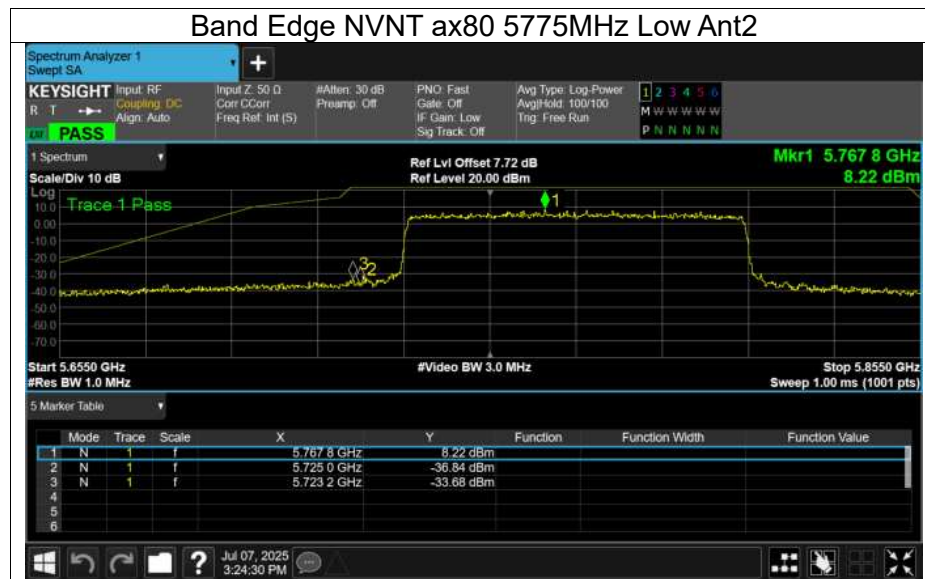



Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	E (dBUV/m)	Detector	Limit (dBUV/m)	Verdict
NVNT	a	5180	Ant1	4500	-43.08	2.62	54.77	Peak	68.2	Pass
NVNT	a	5180	Ant1	4500	-53.74	2.62	44.11	Average	54	Pass
NVNT	a	5180	Ant1	5144	-38.37	2.62	59.48	Peak	68.2	Pass
NVNT	a	5180	Ant1	5149.6	-49.96	2.62	47.89	Average	54	Pass
NVNT	a	5180	Ant1	5150	-40.31	2.62	57.54	Peak	68.2	Pass
NVNT	a	5180	Ant1	5150	-49.85	2.62	48	Average	54	Pass
NVNT	a	5240	Ant1	5350	-42.67	2.62	55.18	Peak	68.2	Pass
NVNT	a	5240	Ant1	5350	-53.71	2.62	44.14	Average	54	Pass
NVNT	a	5240	Ant1	5390.16	-40.55	2.62	57.3	Peak	68.2	Pass
NVNT	a	5240	Ant1	5351.76	-53.7	2.62	44.15	Average	54	Pass
NVNT	a	5240	Ant1	5460	-44.52	2.62	53.33	Peak	68.2	Pass
NVNT	a	5240	Ant1	5460	-53.87	2.62	43.98	Average	54	Pass
NVNT	a	5260	Ant1	4500	-43.27	2.62	54.58	Peak	68.2	Pass
NVNT	a	5260	Ant1	4500	-53.72	2.62	44.13	Average	54	Pass
NVNT	a	5260	Ant1	5044.44	-39.3	2.62	58.55	Peak	68.2	Pass
NVNT	a	5260	Ant1	5116.2	-51.83	2.62	46.02	Average	54	Pass
NVNT	a	5260	Ant1	5150	-40.8	2.62	57.05	Peak	68.2	Pass
NVNT	a	5260	Ant1	5150	-51.96	2.62	45.89	Average	54	Pass
NVNT	a	5320	Ant1	5350	-42.61	2.62	55.24	Peak	68.2	Pass
NVNT	a	5320	Ant1	5350	-52.98	2.62	44.87	Average	54	Pass
NVNT	a	5320	Ant1	5354.6	-40.03	2.62	57.82	Peak	68.2	Pass
NVNT	a	5320	Ant1	5350.4	-52.95	2.62	44.9	Average	54	Pass
NVNT	a	5320	Ant1	5460	-42.68	2.62	55.17	Peak	68.2	Pass
NVNT	a	5320	Ant1	5460	-53.62	2.62	44.23	Average	54	Pass
NVNT	a	5500	Ant1	5460	-43.49	2.62	54.36	Peak	68.2	Pass
NVNT	a	5500	Ant1	5460	-52.78	2.62	45.07	Average	54	Pass
NVNT	a	5500	Ant1	5467.2	-40.78	2.62	57.07	Peak	68.2	Pass
NVNT	a	5500	Ant1	5469.8	-52.31	2.62	45.54	Average	54	Pass
NVNT	a	5500	Ant1	5470	-43.2	2.62	54.65	Peak	68.2	Pass
NVNT	a	5500	Ant1	5470	-52.31	2.62	45.54	Average	54	Pass
NVNT	a	5700	Ant1	5725	-39.82	2.62	58.03	Peak	68.2	Pass
NVNT	a	5700	Ant1	5725	-51.19	2.62	46.66	Average	54	Pass
NVNT	a	5700	Ant1	5735	-40.87	2.62	56.98	Peak	68.2	Pass
NVNT	a	5700	Ant1	5735	-52.09	2.62	45.76	Average	54	Pass
NVNT	a	5745	Ant1	5650	-43.27	2.62	-40.65	Peak	-27	Pass
NVNT	a	5745	Ant1	5650	-52.54	2.62	-49.92	Average	-27	Pass
NVNT	a	5745	Ant1	5700	-40.55	2.62	-37.93	Peak	10	Pass
NVNT	a	5745	Ant1	5700	-51.47	2.62	-48.85	Average	10	Pass
NVNT	a	5745	Ant1	5720	-40.04	2.62	-37.42	Peak	15.6	Pass
NVNT	a	5745	Ant1	5720	-50	2.62	-47.38	Average	15.6	Pass
NVNT	a	5745	Ant1	5725	-38.48	2.62	-35.86	Peak	27	Pass
NVNT	a	5745	Ant1	5725	-48.94	2.62	-46.32	Average	27	Pass
NVNT	a	5825	Ant1	5850	-38.31	2.62	-35.69	Peak	27	Pass
NVNT	a	5825	Ant1	5850	-50.43	2.62	-47.81	Average	27	Pass
NVNT	a	5825	Ant1	5855	-40.62	2.62	-38	Peak	15.6	Pass
NVNT	a	5825	Ant1	5855	-50.96	2.62	-48.34	Average	15.6	Pass
NVNT	a	5825	Ant1	5875	-41.8	2.62	-39.18	Peak	10	Pass
NVNT	a	5825	Ant1	5875	-51.85	2.62	-49.23	Average	10	Pass
NVNT	a	5825	Ant1	5925	-40.8	2.62	-38.18	Peak	-27	Pass
NVNT	a	5825	Ant1	5925	-52.35	2.62	-49.73	Average	-27	Pass
NVNT	a	5180	Ant2	4500	-43.41	2.62	54.44	Peak	68.2	Pass



NVNT	a	5180	Ant2	4500	-53.35	2.62	44.5	Average	54	Pass
NVNT	a	5180	Ant2	5117.4	-38.42	2.62	59.43	Peak	68.2	Pass
NVNT	a	5180	Ant2	5149.6	-51.07	2.62	46.78	Average	54	Pass
NVNT	a	5180	Ant2	5150	-42.49	2.62	55.36	Peak	68.2	Pass
NVNT	a	5180	Ant2	5150	-51.06	2.62	46.79	Average	54	Pass
NVNT	a	5240	Ant2	5350	-41.25	2.62	56.6	Peak	68.2	Pass
NVNT	a	5240	Ant2	5350	-53.48	2.62	44.37	Average	54	Pass
NVNT	a	5240	Ant2	5402.16	-40.69	2.62	57.16	Peak	68.2	Pass
NVNT	a	5240	Ant2	5350.08	-53.48	2.62	44.37	Average	54	Pass
NVNT	a	5240	Ant2	5460	-43.35	2.62	54.5	Peak	68.2	Pass
NVNT	a	5240	Ant2	5460	-53.5	2.62	44.35	Average	54	Pass
NVNT	a	5260	Ant2	4500	-41.02	2.62	56.83	Peak	68.2	Pass
NVNT	a	5260	Ant2	4500	-53.32	2.62	44.53	Average	54	Pass
NVNT	a	5260	Ant2	4627.92	-38.62	2.62	59.23	Peak	68.2	Pass
NVNT	a	5260	Ant2	4690.32	-51.54	2.62	46.31	Average	54	Pass
NVNT	a	5260	Ant2	5150	-41.08	2.62	56.77	Peak	68.2	Pass
NVNT	a	5260	Ant2	5150	-51.7	2.62	46.15	Average	54	Pass
NVNT	a	5500	Ant2	5460	-43.14	2.62	54.71	Peak	68.2	Pass
NVNT	a	5500	Ant2	5460	-52.37	2.62	45.48	Average	54	Pass
NVNT	a	5500	Ant2	5469.2	-40.01	2.62	57.84	Peak	68.2	Pass
NVNT	a	5500	Ant2	5469.6	-51.91	2.62	45.94	Average	54	Pass
NVNT	a	5500	Ant2	5470	-43.52	2.62	54.33	Peak	68.2	Pass
NVNT	a	5500	Ant2	5470	-51.91	2.62	45.94	Average	54	Pass
NVNT	a	5700	Ant2	5725	-42.79	2.62	55.06	Peak	68.2	Pass
NVNT	a	5700	Ant2	5725	-51.81	2.62	46.04	Average	54	Pass
NVNT	a	5700	Ant2	5733.8	-39.88	2.62	57.97	Peak	68.2	Pass
NVNT	a	5700	Ant2	5725.2	-51.78	2.62	46.07	Average	54	Pass
NVNT	a	5700	Ant2	5735	-41.71	2.62	56.14	Peak	68.2	Pass
NVNT	a	5700	Ant2	5735	-52.12	2.62	45.73	Average	54	Pass
NVNT	a	5745	Ant2	5650	-41.79	2.62	-39.17	Peak	-27	Pass
NVNT	a	5745	Ant2	5650	-52.4	2.62	-49.78	Average	-27	Pass
NVNT	a	5745	Ant2	5700	-42.3	2.62	-39.68	Peak	10	Pass
NVNT	a	5745	Ant2	5700	-51.95	2.62	-49.33	Average	10	Pass
NVNT	a	5745	Ant2	5720	-42.84	2.62	-40.22	Peak	15.6	Pass
NVNT	a	5745	Ant2	5720	-51.43	2.62	-48.81	Average	15.6	Pass
NVNT	a	5745	Ant2	5725	-41.56	2.62	-38.94	Peak	27	Pass
NVNT	a	5745	Ant2	5725	-50.85	2.62	-48.23	Average	27	Pass
NVNT	a	5825	Ant2	5850	-40.89	2.62	-38.27	Peak	27	Pass
NVNT	a	5825	Ant2	5850	-51.6	2.62	-48.98	Average	27	Pass
NVNT	a	5825	Ant2	5855	-42.72	2.62	-40.1	Peak	15.6	Pass
NVNT	a	5825	Ant2	5855	-51.83	2.62	-49.21	Average	15.6	Pass
NVNT	a	5825	Ant2	5875	-41.93	2.62	-39.31	Peak	10	Pass
NVNT	a	5825	Ant2	5875	-52.36	2.62	-49.74	Average	10	Pass
NVNT	a	5825	Ant2	5925	-43.22	2.62	-40.6	Peak	-27	Pass
NVNT	a	5825	Ant2	5925	-52.5	2.62	-49.88	Average	-27	Pass
NVNT	n20	5180	Ant1	4500	-44.44	2.62	53.41	Peak	68.2	Pass
NVNT	n20	5180	Ant1	4500	-53.76	2.62	44.09	Average	54	Pass
NVNT	n20	5180	Ant1	5132.1	-38.96	2.62	58.89	Peak	68.2	Pass
NVNT	n20	5180	Ant1	5149.6	-50.47	2.62	47.38	Average	54	Pass
NVNT	n20	5180	Ant1	5150	-40.15	2.62	57.7	Peak	68.2	Pass
NVNT	n20	5180	Ant1	5150	-50.42	2.62	47.43	Average	54	Pass
NVNT	n20	5240	Ant1	5350	-45.36	2.62	52.49	Peak	68.2	Pass
NVNT	n20	5240	Ant1	5350	-53.93	2.62	43.92	Average	54	Pass
NVNT	n20	5240	Ant1	5367.36	-41.49	2.62	56.36	Peak	68.2	Pass
NVNT	n20	5240	Ant1	5350.08	-53.93	2.62	43.92	Average	54	Pass
NVNT	n20	5240	Ant1	5460	-43.18	2.62	54.67	Peak	68.2	Pass



NVNT	n20	5240	Ant1	5460	-53.94	2.62	43.91	Average	54	Pass
NVNT	n20	5260	Ant1	4500	-44	2.62	53.85	Peak	68.2	Pass
NVNT	n20	5260	Ant1	4500	-53.75	2.62	44.1	Average	54	Pass
NVNT	n20	5260	Ant1	5053.02	-38.73	2.62	59.12	Peak	68.2	Pass
NVNT	n20	5260	Ant1	4695.78	-51.96	2.62	45.89	Average	54	Pass
NVNT	n20	5260	Ant1	5150	-41.2	2.62	56.65	Peak	68.2	Pass
NVNT	n20	5260	Ant1	5150	-52.16	2.62	45.69	Average	54	Pass
NVNT	n20	5500	Ant1	5460	-42.1	2.62	55.75	Peak	68.2	Pass
NVNT	n20	5500	Ant1	5460	-51.82	2.62	46.03	Average	54	Pass
NVNT	n20	5500	Ant1	5465.4	-39.8	2.62	58.05	Peak	68.2	Pass
NVNT	n20	5500	Ant1	5469.6	-51.09	2.62	46.76	Average	54	Pass
NVNT	n20	5500	Ant1	5470	-42.5	2.62	55.35	Peak	68.2	Pass
NVNT	n20	5500	Ant1	5470	-51.1	2.62	46.75	Average	54	Pass
NVNT	n20	5745	Ant1	5650	-44.1	2.62	-41.48	Peak	-27	Pass
NVNT	n20	5745	Ant1	5650	-52.77	2.62	-50.15	Average	-27	Pass
NVNT	n20	5745	Ant1	5700	-41.29	2.62	-38.67	Peak	10	Pass
NVNT	n20	5745	Ant1	5700	-52	2.62	-49.38	Average	10	Pass
NVNT	n20	5745	Ant1	5720	-41.09	2.62	-38.47	Peak	15.6	Pass
NVNT	n20	5745	Ant1	5720	-51	2.62	-48.38	Average	15.6	Pass
NVNT	n20	5745	Ant1	5725	-39.61	2.62	-36.99	Peak	27	Pass
NVNT	n20	5745	Ant1	5725	-50.08	2.62	-47.46	Average	27	Pass
NVNT	n20	5825	Ant1	5850	-40.35	2.62	-37.73	Peak	27	Pass
NVNT	n20	5825	Ant1	5850	-50.95	2.62	-48.33	Average	27	Pass
NVNT	n20	5825	Ant1	5855	-42.34	2.62	-39.72	Peak	15.6	Pass
NVNT	n20	5825	Ant1	5855	-51.43	2.62	-48.81	Average	15.6	Pass
NVNT	n20	5825	Ant1	5875	-41.39	2.62	-38.77	Peak	10	Pass
NVNT	n20	5825	Ant1	5875	-52.1	2.62	-49.48	Average	10	Pass
NVNT	n20	5825	Ant1	5925	-42.4	2.62	-39.78	Peak	-27	Pass
NVNT	n20	5825	Ant1	5925	-52.44	2.62	-49.82	Average	-27	Pass
NVNT	n20	5180	Ant2	4500	-42.98	2.62	54.87	Peak	68.2	Pass
NVNT	n20	5180	Ant2	4500	-53.43	2.62	44.42	Average	54	Pass
NVNT	n20	5180	Ant2	4667.3	-39.23	2.62	58.62	Peak	68.2	Pass
NVNT	n20	5180	Ant2	5149.6	-50.89	2.62	46.96	Average	54	Pass
NVNT	n20	5180	Ant2	5150	-39.93	2.62	57.92	Peak	68.2	Pass
NVNT	n20	5180	Ant2	5150	-50.87	2.62	46.98	Average	54	Pass
NVNT	n20	5240	Ant2	5350	-43.89	2.62	53.96	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5350	-53.52	2.62	44.33	Average	54	Pass
NVNT	n20	5240	Ant2	5383.92	-40.39	2.62	57.46	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5458.8	-53.49	2.62	44.36	Average	54	Pass
NVNT	n20	5240	Ant2	5460	-42.33	2.62	55.52	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5460	-53.53	2.62	44.32	Average	54	Pass
NVNT	n20	5260	Ant2	4500	-42.73	2.62	55.12	Peak	68.2	Pass
NVNT	n20	5260	Ant2	4500	-53.33	2.62	44.52	Average	54	Pass
NVNT	n20	5260	Ant2	5088.9	-39.19	2.62	58.66	Peak	68.2	Pass
NVNT	n20	5260	Ant2	4694.22	-51.52	2.62	46.33	Average	54	Pass
NVNT	n20	5260	Ant2	5150	-40.86	2.62	56.99	Peak	68.2	Pass
NVNT	n20	5260	Ant2	5150	-51.71	2.62	46.14	Average	54	Pass
NVNT	n20	5745	Ant2	5650	-42.54	2.62	-39.92	Peak	-27	Pass
NVNT	n20	5745	Ant2	5650	-52.39	2.62	-49.77	Average	-27	Pass
NVNT	n20	5745	Ant2	5700	-41.99	2.62	-39.37	Peak	10	Pass
NVNT	n20	5745	Ant2	5700	-51.96	2.62	-49.34	Average	10	Pass
NVNT	n20	5745	Ant2	5720	-41.6	2.62	-38.98	Peak	15.6	Pass
NVNT	n20	5745	Ant2	5720	-51.4	2.62	-48.78	Average	15.6	Pass
NVNT	n20	5745	Ant2	5725	-42.13	2.62	-39.51	Peak	27	Pass
NVNT	n20	5745	Ant2	5725	-51.04	2.62	-48.42	Average	27	Pass
NVNT	n20	5825	Ant2	5850	-41.6	2.62	-38.98	Peak	27	Pass



NVNT	n20	5825	Ant2	5850	-52.09	2.62	-49.47	Average	27	Pass
NVNT	n20	5825	Ant2	5855	-41	2.62	-38.38	Peak	15.6	Pass
NVNT	n20	5825	Ant2	5855	-52.29	2.62	-49.67	Average	15.6	Pass
NVNT	n20	5825	Ant2	5875	-42.75	2.62	-40.13	Peak	10	Pass
NVNT	n20	5825	Ant2	5875	-52.58	2.62	-49.96	Average	10	Pass
NVNT	n20	5825	Ant2	5925	-43.22	2.62	-40.6	Peak	-27	Pass
NVNT	n20	5825	Ant2	5925	-52.57	2.62	-49.95	Average	-27	Pass
NVNT	n40	5190	Ant1	4500	-43.63	2.62	54.22	Peak	68.2	Pass
NVNT	n40	5190	Ant1	4500	-53.94	2.62	43.91	Average	54	Pass
NVNT	n40	5190	Ant1	5053.34	-38.75	2.62	59.1	Peak	68.2	Pass
NVNT	n40	5190	Ant1	5149.7	-50.09	2.62	47.76	Average	54	Pass
NVNT	n40	5190	Ant1	5150	-39.02	2.62	58.83	Peak	68.2	Pass
NVNT	n40	5190	Ant1	5150	-50.01	2.62	47.84	Average	54	Pass
NVNT	n40	5230	Ant1	5350	-43.14	2.62	54.71	Peak	68.2	Pass
NVNT	n40	5230	Ant1	5350	-53.97	2.62	43.88	Average	54	Pass
NVNT	n40	5230	Ant1	5446.77	-41.6	2.62	56.25	Peak	68.2	Pass
NVNT	n40	5230	Ant1	5458.11	-53.9	2.62	43.95	Average	54	Pass
NVNT	n40	5230	Ant1	5460	-43.41	2.62	54.44	Peak	68.2	Pass
NVNT	n40	5230	Ant1	5460	-53.92	2.62	43.93	Average	54	Pass
NVNT	n40	5270	Ant1	4500	-42.88	2.62	54.97	Peak	68.2	Pass
NVNT	n40	5270	Ant1	4500	-53.69	2.62	44.16	Average	54	Pass
NVNT	n40	5270	Ant1	5068.62	-39.12	2.62	58.73	Peak	68.2	Pass
NVNT	n40	5270	Ant1	5114.79	-51.84	2.62	46.01	Average	54	Pass
NVNT	n40	5270	Ant1	5150	-41.87	2.62	55.98	Peak	68.2	Pass
NVNT	n40	5270	Ant1	5150	-51.96	2.62	45.89	Average	54	Pass
NVNT	n40	5310	Ant1	5350	-42.47	2.62	55.38	Peak	68.2	Pass
NVNT	n40	5310	Ant1	5350	-51.91	2.62	45.94	Average	54	Pass
NVNT	n40	5310	Ant1	5356.8	-40.11	2.62	57.74	Peak	68.2	Pass
NVNT	n40	5310	Ant1	5350.6	-51.73	2.62	46.12	Average	54	Pass
NVNT	n40	5310	Ant1	5460	-44.28	2.62	53.57	Peak	68.2	Pass
NVNT	n40	5310	Ant1	5460	-53.54	2.62	44.31	Average	54	Pass
NVNT	n40	5510	Ant1	5460	-41.83	2.62	56.02	Peak	68.2	Pass
NVNT	n40	5510	Ant1	5460	-51.67	2.62	46.18	Average	54	Pass
NVNT	n40	5510	Ant1	5465.2	-39.5	2.62	58.35	Peak	68.2	Pass
NVNT	n40	5510	Ant1	5469.4	-50.5	2.62	47.35	Average	54	Pass
NVNT	n40	5510	Ant1	5470	-40.27	2.62	57.58	Peak	68.2	Pass
NVNT	n40	5510	Ant1	5470	-50.55	2.62	47.3	Average	54	Pass
NVNT	n40	5670	Ant1	5725	-42.27	2.62	55.58	Peak	68.2	Pass
NVNT	n40	5670	Ant1	5725	-52.62	2.62	45.23	Average	54	Pass
NVNT	n40	5670	Ant1	5730.4	-40.86	2.62	56.99	Peak	68.2	Pass
NVNT	n40	5670	Ant1	5725.4	-52.6	2.62	45.25	Average	54	Pass
NVNT	n40	5670	Ant1	5735	-42.48	2.62	55.37	Peak	68.2	Pass
NVNT	n40	5670	Ant1	5735	-52.8	2.62	45.05	Average	54	Pass
NVNT	n40	5755	Ant1	5650	-42.25	2.62	-39.63	Peak	-27	Pass
NVNT	n40	5755	Ant1	5650	-52.58	2.62	-49.96	Average	-27	Pass
NVNT	n40	5755	Ant1	5700	-41.21	2.62	-38.59	Peak	10	Pass
NVNT	n40	5755	Ant1	5700	-51.45	2.62	-48.83	Average	10	Pass
NVNT	n40	5755	Ant1	5720	-39.02	2.62	-36.4	Peak	15.6	Pass
NVNT	n40	5755	Ant1	5720	-49.65	2.62	-47.03	Average	15.6	Pass
NVNT	n40	5755	Ant1	5725	-36.48	2.62	-33.86	Peak	27	Pass
NVNT	n40	5755	Ant1	5725	-46.83	2.62	-44.21	Average	27	Pass
NVNT	n40	5795	Ant1	5850	-40.52	2.62	-37.9	Peak	27	Pass
NVNT	n40	5795	Ant1	5850	-50.78	2.62	-48.16	Average	27	Pass
NVNT	n40	5795	Ant1	5855	-41.07	2.62	-38.45	Peak	15.6	Pass
NVNT	n40	5795	Ant1	5855	-51.45	2.62	-48.83	Average	15.6	Pass
NVNT	n40	5795	Ant1	5875	-41.87	2.62	-39.25	Peak	10	Pass



NVNT	n40	5795	Ant1	5875	-52.43	2.62	-49.81	Average	10	Pass
NVNT	n40	5795	Ant1	5925	-43.09	2.62	-40.47	Peak	-27	Pass
NVNT	n40	5795	Ant1	5925	-52.73	2.62	-50.11	Average	-27	Pass
NVNT	n40	5190	Ant2	4500	-43.5	2.62	54.35	Peak	68.2	Pass
NVNT	n40	5190	Ant2	4500	-53.57	2.62	44.28	Average	54	Pass
NVNT	n40	5190	Ant2	5123.42	-38.16	2.62	59.69	Peak	68.2	Pass
NVNT	n40	5190	Ant2	5148.97	-50.7	2.62	47.15	Average	54	Pass
NVNT	n40	5190	Ant2	5150	-40.29	2.62	57.56	Peak	68.2	Pass
NVNT	n40	5190	Ant2	5150	-50.8	2.62	47.05	Average	54	Pass
NVNT	n40	5230	Ant2	5350	-43.84	2.62	54.01	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5350	-53.6	2.62	44.25	Average	54	Pass
NVNT	n40	5230	Ant2	5353.89	-40.75	2.62	57.1	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5458.65	-53.54	2.62	44.31	Average	54	Pass
NVNT	n40	5230	Ant2	5460	-44.03	2.62	53.82	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5460	-53.54	2.62	44.31	Average	54	Pass
NVNT	n40	5270	Ant2	4500	-43	2.62	54.85	Peak	68.2	Pass
NVNT	n40	5270	Ant2	4500	-53.2	2.62	44.65	Average	54	Pass
NVNT	n40	5270	Ant2	5060.52	-38.78	2.62	59.07	Peak	68.2	Pass
NVNT	n40	5270	Ant2	4687.11	-51.4	2.62	46.45	Average	54	Pass
NVNT	n40	5270	Ant2	5150	-41.9	2.62	55.95	Peak	68.2	Pass
NVNT	n40	5270	Ant2	5150	-51.58	2.62	46.27	Average	54	Pass
NVNT	n40	5310	Ant2	5350	-42.37	2.62	55.48	Peak	68.2	Pass
NVNT	n40	5310	Ant2	5350	-52.3	2.62	45.55	Average	54	Pass
NVNT	n40	5310	Ant2	5403.6	-40.51	2.62	57.34	Peak	68.2	Pass
NVNT	n40	5310	Ant2	5350.6	-52.26	2.62	45.59	Average	54	Pass
NVNT	n40	5310	Ant2	5460	-42.22	2.62	55.63	Peak	68.2	Pass
NVNT	n40	5310	Ant2	5460	-53.16	2.62	44.69	Average	54	Pass
NVNT	n40	5510	Ant2	5460	-42.85	2.62	55	Peak	68.2	Pass
NVNT	n40	5510	Ant2	5460	-52.02	2.62	45.83	Average	54	Pass
NVNT	n40	5510	Ant2	5463.4	-39.82	2.62	58.03	Peak	68.2	Pass
NVNT	n40	5510	Ant2	5469.4	-51.47	2.62	46.38	Average	54	Pass
NVNT	n40	5510	Ant2	5470	-41.79	2.62	56.06	Peak	68.2	Pass
NVNT	n40	5510	Ant2	5470	-51.53	2.62	46.32	Average	54	Pass
NVNT	n40	5670	Ant2	5725	-42.59	2.62	55.26	Peak	68.2	Pass
NVNT	n40	5670	Ant2	5725	-52.4	2.62	45.45	Average	54	Pass
NVNT	n40	5670	Ant2	5728.8	-38.82	2.62	59.03	Peak	68.2	Pass
NVNT	n40	5670	Ant2	5726	-52.37	2.62	45.48	Average	54	Pass
NVNT	n40	5670	Ant2	5735	-42.26	2.62	55.59	Peak	68.2	Pass
NVNT	n40	5670	Ant2	5735	-52.58	2.62	45.27	Average	54	Pass
NVNT	n40	5755	Ant2	5650	-41.59	2.62	-38.97	Peak	-27	Pass
NVNT	n40	5755	Ant2	5650	-52.48	2.62	-49.86	Average	-27	Pass
NVNT	n40	5755	Ant2	5700	-42.57	2.62	-39.95	Peak	10	Pass
NVNT	n40	5755	Ant2	5700	-51.94	2.62	-49.32	Average	10	Pass
NVNT	n40	5755	Ant2	5720	-40.76	2.62	-38.14	Peak	15.6	Pass
NVNT	n40	5755	Ant2	5720	-50.61	2.62	-47.99	Average	15.6	Pass
NVNT	n40	5755	Ant2	5725	-39.05	2.62	-36.43	Peak	27	Pass
NVNT	n40	5755	Ant2	5725	-48.26	2.62	-45.64	Average	27	Pass
NVNT	n40	5795	Ant2	5850	-41.09	2.62	-38.47	Peak	27	Pass
NVNT	n40	5795	Ant2	5850	-51.23	2.62	-48.61	Average	27	Pass
NVNT	n40	5795	Ant2	5855	-41.87	2.62	-39.25	Peak	15.6	Pass
NVNT	n40	5795	Ant2	5855	-51.63	2.62	-49.01	Average	15.6	Pass
NVNT	n40	5795	Ant2	5875	-43	2.62	-40.38	Peak	10	Pass
NVNT	n40	5795	Ant2	5875	-52.41	2.62	-49.79	Average	10	Pass
NVNT	n40	5795	Ant2	5925	-42.91	2.62	-40.29	Peak	-27	Pass
NVNT	n40	5795	Ant2	5925	-52.63	2.62	-50.01	Average	-27	Pass
NVNT	ac20	5180	Ant1	4500	-43.78	2.62	54.07	Peak	68.2	Pass



NVNT	ac20	5180	Ant1	4500	-53.92	2.62	43.93	Average	54	Pass
NVNT	ac20	5180	Ant1	4689	-38.63	2.62	59.22	Peak	68.2	Pass
NVNT	ac20	5180	Ant1	5149.6	-51.09	2.62	46.76	Average	54	Pass
NVNT	ac20	5180	Ant1	5150	-40.84	2.62	57.01	Peak	68.2	Pass
NVNT	ac20	5180	Ant1	5150	-51.06	2.62	46.79	Average	54	Pass
NVNT	ac20	5240	Ant1	5350	-42.17	2.62	55.68	Peak	68.2	Pass
NVNT	ac20	5240	Ant1	5350	-53.72	2.62	44.13	Average	54	Pass
NVNT	ac20	5240	Ant1	5424.72	-40.82	2.62	57.03	Peak	68.2	Pass
NVNT	ac20	5240	Ant1	5350.32	-53.7	2.62	44.15	Average	54	Pass
NVNT	ac20	5240	Ant1	5460	-43.19	2.62	54.66	Peak	68.2	Pass
NVNT	ac20	5240	Ant1	5460	-53.86	2.62	43.99	Average	54	Pass
NVNT	ac20	5260	Ant1	4500	-43.69	2.62	54.16	Peak	68.2	Pass
NVNT	ac20	5260	Ant1	4500	-53.89	2.62	43.96	Average	54	Pass
NVNT	ac20	5260	Ant1	5127.12	-38.77	2.62	59.08	Peak	68.2	Pass
NVNT	ac20	5260	Ant1	4687.98	-52.06	2.62	45.79	Average	54	Pass
NVNT	ac20	5260	Ant1	5150	-43.2	2.62	54.65	Peak	68.2	Pass
NVNT	ac20	5260	Ant1	5150	-52.24	2.62	45.61	Average	54	Pass
NVNT	ac20	5745	Ant1	5650	-43.39	2.62	-40.77	Peak	-27	Pass
NVNT	ac20	5745	Ant1	5650	-52.71	2.62	-50.09	Average	-27	Pass
NVNT	ac20	5745	Ant1	5700	-42.02	2.62	-39.4	Peak	10	Pass
NVNT	ac20	5745	Ant1	5700	-51.87	2.62	-49.25	Average	10	Pass
NVNT	ac20	5745	Ant1	5720	-39.46	2.62	-36.84	Peak	15.6	Pass
NVNT	ac20	5745	Ant1	5720	-50.81	2.62	-48.19	Average	15.6	Pass
NVNT	ac20	5745	Ant1	5725	-40.35	2.62	-37.73	Peak	27	Pass
NVNT	ac20	5745	Ant1	5725	-49.98	2.62	-47.36	Average	27	Pass
NVNT	ac20	5825	Ant1	5850	-41.31	2.62	-38.69	Peak	27	Pass
NVNT	ac20	5825	Ant1	5850	-50.84	2.62	-48.22	Average	27	Pass
NVNT	ac20	5825	Ant1	5855	-41.03	2.62	-38.41	Peak	15.6	Pass
NVNT	ac20	5825	Ant1	5855	-51.34	2.62	-48.72	Average	15.6	Pass
NVNT	ac20	5825	Ant1	5875	-43.19	2.62	-40.57	Peak	10	Pass
NVNT	ac20	5825	Ant1	5875	-52.07	2.62	-49.45	Average	10	Pass
NVNT	ac20	5825	Ant1	5925	-42.41	2.62	-39.79	Peak	-27	Pass
NVNT	ac20	5825	Ant1	5925	-52.43	2.62	-49.81	Average	-27	Pass
NVNT	ac20	5180	Ant2	4500	-41.65	2.62	56.2	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	4500	-53.57	2.62	44.28	Average	54	Pass
NVNT	ac20	5180	Ant2	5084.5	-38.97	2.62	58.88	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	5149.6	-50.87	2.62	46.98	Average	54	Pass
NVNT	ac20	5180	Ant2	5150	-40.54	2.62	57.31	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	5150	-50.82	2.62	47.03	Average	54	Pass
NVNT	ac20	5240	Ant2	5350	-43.11	2.62	54.74	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5350	-53.5	2.62	44.35	Average	54	Pass
NVNT	ac20	5240	Ant2	5396.4	-40.86	2.62	56.99	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5350.08	-53.5	2.62	44.35	Average	54	Pass
NVNT	ac20	5240	Ant2	5460	-43.5	2.62	54.35	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5460	-53.54	2.62	44.31	Average	54	Pass
NVNT	ac20	5260	Ant2	4500	-41.94	2.62	55.91	Peak	68.2	Pass
NVNT	ac20	5260	Ant2	4500	-53.32	2.62	44.53	Average	54	Pass
NVNT	ac20	5260	Ant2	5105.28	-39.25	2.62	58.6	Peak	68.2	Pass
NVNT	ac20	5260	Ant2	4687.2	-51.53	2.62	46.32	Average	54	Pass
NVNT	ac20	5260	Ant2	5150	-42.08	2.62	55.77	Peak	68.2	Pass
NVNT	ac20	5260	Ant2	5150	-51.72	2.62	46.13	Average	54	Pass
NVNT	ac20	5745	Ant2	5650	-41.69	2.62	-39.07	Peak	-27	Pass
NVNT	ac20	5745	Ant2	5650	-52.36	2.62	-49.74	Average	-27	Pass
NVNT	ac20	5745	Ant2	5700	-43.34	2.62	-40.72	Peak	10	Pass
NVNT	ac20	5745	Ant2	5700	-51.9	2.62	-49.28	Average	10	Pass
NVNT	ac20	5745	Ant2	5720	-41.93	2.62	-39.31	Peak	15.6	Pass



NVNT	ac20	5745	Ant2	5720	-51.33	2.62	-48.71	Average	15.6	Pass
NVNT	ac20	5745	Ant2	5725	-40.87	2.62	-38.25	Peak	27	Pass
NVNT	ac20	5745	Ant2	5725	-50.65	2.62	-48.03	Average	27	Pass
NVNT	ac20	5825	Ant2	5850	-41.21	2.62	-38.59	Peak	27	Pass
NVNT	ac20	5825	Ant2	5850	-52.09	2.62	-49.47	Average	27	Pass
NVNT	ac20	5825	Ant2	5855	-42.68	2.62	-40.06	Peak	15.6	Pass
NVNT	ac20	5825	Ant2	5855	-52.27	2.62	-49.65	Average	15.6	Pass
NVNT	ac20	5825	Ant2	5875	-42.91	2.62	-40.29	Peak	10	Pass
NVNT	ac20	5825	Ant2	5875	-52.54	2.62	-49.92	Average	10	Pass
NVNT	ac20	5825	Ant2	5925	-43.85	2.62	-41.23	Peak	-27	Pass
NVNT	ac20	5825	Ant2	5925	-52.56	2.62	-49.94	Average	-27	Pass
NVNT	ac40	5190	Ant1	4500	-42.86	2.62	54.99	Peak	68.2	Pass
NVNT	ac40	5190	Ant1	4500	-53.89	2.62	43.96	Average	54	Pass
NVNT	ac40	5190	Ant1	5144.59	-37.96	2.62	59.89	Peak	68.2	Pass
NVNT	ac40	5190	Ant1	5149.7	-50.15	2.62	47.7	Average	54	Pass
NVNT	ac40	5190	Ant1	5150	-39.31	2.62	58.54	Peak	68.2	Pass
NVNT	ac40	5190	Ant1	5150	-50.09	2.62	47.76	Average	54	Pass
NVNT	ac40	5230	Ant1	5350	-43.2	2.62	54.65	Peak	68.2	Pass
NVNT	ac40	5230	Ant1	5350	-53.89	2.62	43.96	Average	54	Pass
NVNT	ac40	5230	Ant1	5459.46	-40.33	2.62	57.52	Peak	68.2	Pass
NVNT	ac40	5230	Ant1	5350.38	-53.87	2.62	43.98	Average	54	Pass
NVNT	ac40	5230	Ant1	5460	-42.83	2.62	55.02	Peak	68.2	Pass
NVNT	ac40	5230	Ant1	5460	-53.98	2.62	43.87	Average	54	Pass
NVNT	ac40	5270	Ant1	4500	-43.95	2.62	53.9	Peak	68.2	Pass
NVNT	ac40	5270	Ant1	4500	-53.81	2.62	44.04	Average	54	Pass
NVNT	ac40	5270	Ant1	4968.99	-39.42	2.62	58.43	Peak	68.2	Pass
NVNT	ac40	5270	Ant1	5115.6	-51.97	2.62	45.88	Average	54	Pass
NVNT	ac40	5270	Ant1	5150	-40.68	2.62	57.17	Peak	68.2	Pass
NVNT	ac40	5270	Ant1	5150	-52.06	2.62	45.79	Average	54	Pass
NVNT	ac40	5310	Ant1	5350	-42.5	2.62	55.35	Peak	68.2	Pass
NVNT	ac40	5310	Ant1	5350	-51.81	2.62	46.04	Average	54	Pass
NVNT	ac40	5310	Ant1	5360.8	-40.17	2.62	57.68	Peak	68.2	Pass
NVNT	ac40	5310	Ant1	5350.6	-51.67	2.62	46.18	Average	54	Pass
NVNT	ac40	5310	Ant1	5460	-43.97	2.62	53.88	Peak	68.2	Pass
NVNT	ac40	5310	Ant1	5460	-53.64	2.62	44.21	Average	54	Pass
NVNT	ac40	5510	Ant1	5460	-40.42	2.62	57.43	Peak	68.2	Pass
NVNT	ac40	5510	Ant1	5460	-50.97	2.62	46.88	Average	54	Pass
NVNT	ac40	5510	Ant1	5465	-38.29	2.62	59.56	Peak	68.2	Pass
NVNT	ac40	5510	Ant1	5469.4	-49.72	2.62	48.13	Average	54	Pass
NVNT	ac40	5510	Ant1	5470	-38.86	2.62	58.99	Peak	68.2	Pass
NVNT	ac40	5510	Ant1	5470	-49.77	2.62	48.08	Average	54	Pass
NVNT	ac40	5670	Ant1	5725	-42.64	2.62	55.21	Peak	68.2	Pass
NVNT	ac40	5670	Ant1	5725	-52.61	2.62	45.24	Average	54	Pass
NVNT	ac40	5670	Ant1	5727	-38.12	2.62	59.73	Peak	68.2	Pass
NVNT	ac40	5670	Ant1	5725.4	-52.59	2.62	45.26	Average	54	Pass
NVNT	ac40	5670	Ant1	5735	-43.51	2.62	54.34	Peak	68.2	Pass
NVNT	ac40	5670	Ant1	5735	-52.81	2.62	45.04	Average	54	Pass
NVNT	ac40	5755	Ant1	5650	-42.01	2.62	-39.39	Peak	-27	Pass
NVNT	ac40	5755	Ant1	5650	-52.68	2.62	-50.06	Average	-27	Pass
NVNT	ac40	5755	Ant1	5700	-40.92	2.62	-38.3	Peak	10	Pass
NVNT	ac40	5755	Ant1	5700	-51.6	2.62	-48.98	Average	10	Pass
NVNT	ac40	5755	Ant1	5720	-40.13	2.62	-37.51	Peak	15.6	Pass
NVNT	ac40	5755	Ant1	5720	-49.87	2.62	-47.25	Average	15.6	Pass
NVNT	ac40	5755	Ant1	5725	-37	2.62	-34.38	Peak	27	Pass
NVNT	ac40	5755	Ant1	5725	-46.97	2.62	-44.35	Average	27	Pass
NVNT	ac40	5795	Ant1	5850	-38.58	2.62	-35.96	Peak	27	Pass



NVNT	ac40	5795	Ant1	5850	-50.67	2.62	-48.05	Average	27	Pass
NVNT	ac40	5795	Ant1	5855	-40.97	2.62	-38.35	Peak	15.6	Pass
NVNT	ac40	5795	Ant1	5855	-51.33	2.62	-48.71	Average	15.6	Pass
NVNT	ac40	5795	Ant1	5875	-42.08	2.62	-39.46	Peak	10	Pass
NVNT	ac40	5795	Ant1	5875	-52.49	2.62	-49.87	Average	10	Pass
NVNT	ac40	5795	Ant1	5925	-41.19	2.62	-38.57	Peak	-27	Pass
NVNT	ac40	5795	Ant1	5925	-52.85	2.62	-50.23	Average	-27	Pass
NVNT	ac40	5190	Ant2	4500	-42.78	2.62	55.07	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	4500	-53.6	2.62	44.25	Average	54	Pass
NVNT	ac40	5190	Ant2	5138.02	-38.37	2.62	59.48	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	5148.97	-50.71	2.62	47.14	Average	54	Pass
NVNT	ac40	5190	Ant2	5150	-41.66	2.62	56.19	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	5150	-50.78	2.62	47.07	Average	54	Pass
NVNT	ac40	5230	Ant2	5350	-44	2.62	53.85	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5350	-53.59	2.62	44.26	Average	54	Pass
NVNT	ac40	5230	Ant2	5380.08	-40.7	2.62	57.15	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5455.41	-53.52	2.62	44.33	Average	54	Pass
NVNT	ac40	5230	Ant2	5460	-42.07	2.62	55.78	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5460	-53.53	2.62	44.32	Average	54	Pass
NVNT	ac40	5270	Ant2	4500	-42.96	2.62	54.89	Peak	68.2	Pass
NVNT	ac40	5270	Ant2	4500	-53.21	2.62	44.64	Average	54	Pass
NVNT	ac40	5270	Ant2	5011.92	-38.56	2.62	59.29	Peak	68.2	Pass
NVNT	ac40	5270	Ant2	4689.54	-51.38	2.62	46.47	Average	54	Pass
NVNT	ac40	5270	Ant2	5150	-41.95	2.62	55.9	Peak	68.2	Pass
NVNT	ac40	5270	Ant2	5150	-51.62	2.62	46.23	Average	54	Pass
NVNT	ac40	5310	Ant2	5350	-43.09	2.62	54.76	Peak	68.2	Pass
NVNT	ac40	5310	Ant2	5350	-52.32	2.62	45.53	Average	54	Pass
NVNT	ac40	5310	Ant2	5379.6	-40.48	2.62	57.37	Peak	68.2	Pass
NVNT	ac40	5310	Ant2	5350.4	-52.28	2.62	45.57	Average	54	Pass
NVNT	ac40	5310	Ant2	5460	-43.25	2.62	54.6	Peak	68.2	Pass
NVNT	ac40	5310	Ant2	5460	-53.17	2.62	44.68	Average	54	Pass
NVNT	ac40	5510	Ant2	5460	-42.51	2.62	55.34	Peak	68.2	Pass
NVNT	ac40	5510	Ant2	5460	-51.95	2.62	45.9	Average	54	Pass
NVNT	ac40	5510	Ant2	5465.6	-40.01	2.62	57.84	Peak	68.2	Pass
NVNT	ac40	5510	Ant2	5469.4	-51.44	2.62	46.41	Average	54	Pass
NVNT	ac40	5510	Ant2	5470	-41.75	2.62	56.1	Peak	68.2	Pass
NVNT	ac40	5510	Ant2	5470	-51.55	2.62	46.3	Average	54	Pass
NVNT	ac40	5670	Ant2	5725	-39.73	2.62	58.12	Peak	68.2	Pass
NVNT	ac40	5670	Ant2	5725	-52.16	2.62	45.69	Average	54	Pass
NVNT	ac40	5670	Ant2	5735	-41.06	2.62	56.79	Peak	68.2	Pass
NVNT	ac40	5670	Ant2	5725.2	-52.14	2.62	45.71	Average	54	Pass
NVNT	ac40	5755	Ant2	5650	-43.18	2.62	-40.56	Peak	-27	Pass
NVNT	ac40	5755	Ant2	5650	-52.25	2.62	-49.63	Average	-27	Pass
NVNT	ac40	5755	Ant2	5700	-41.44	2.62	-38.82	Peak	10	Pass
NVNT	ac40	5755	Ant2	5700	-51.54	2.62	-48.92	Average	10	Pass
NVNT	ac40	5755	Ant2	5720	-40.45	2.62	-37.83	Peak	15.6	Pass
NVNT	ac40	5755	Ant2	5720	-50.33	2.62	-47.71	Average	15.6	Pass
NVNT	ac40	5755	Ant2	5725	-38.97	2.62	-36.35	Peak	27	Pass
NVNT	ac40	5755	Ant2	5725	-47.98	2.62	-45.36	Average	27	Pass
NVNT	ac40	5795	Ant2	5850	-41.25	2.62	-38.63	Peak	27	Pass
NVNT	ac40	5795	Ant2	5850	-51.03	2.62	-48.41	Average	27	Pass
NVNT	ac40	5795	Ant2	5855	-39.86	2.62	-37.24	Peak	15.6	Pass
NVNT	ac40	5795	Ant2	5855	-51.51	2.62	-48.89	Average	15.6	Pass
NVNT	ac40	5795	Ant2	5875	-42.77	2.62	-40.15	Peak	10	Pass
NVNT	ac40	5795	Ant2	5875	-52.37	2.62	-49.75	Average	10	Pass
NVNT	ac40	5795	Ant2	5925	-42.02	2.62	-39.4	Peak	-27	Pass



NVNT	ac40	5795	Ant2	5925	-52.58	2.62	-49.96	Average	-27	Pass
NVNT	ac80	5210	Ant1	4500	-44.72	2.62	53.13	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	4500	-53.82	2.62	44.03	Average	54	Pass
NVNT	ac80	5210	Ant1	5149.38	-36.24	2.62	61.61	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5149.38	-46.47	2.62	51.38	Average	54	Pass
NVNT	ac80	5210	Ant1	5150	-35.23	2.62	62.62	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5150	-46.46	2.62	51.39	Average	54	Pass
NVNT	ac80	5290	Ant1	4500	-40.62	2.62	57.23	Peak	68.2	Pass
NVNT	ac80	5290	Ant1	4500	-53.67	2.62	44.18	Average	54	Pass
NVNT	ac80	5290	Ant1	4685.31	-38.71	2.62	59.14	Peak	68.2	Pass
NVNT	ac80	5290	Ant1	4693.14	-51.85	2.62	46	Average	54	Pass
NVNT	ac80	5290	Ant1	5150	-40.3	2.62	57.55	Peak	68.2	Pass
NVNT	ac80	5290	Ant1	5150	-51.87	2.62	45.98	Average	54	Pass
NVNT	ac80	5530	Ant1	5460	-38.58	2.62	59.27	Peak	68.2	Pass
NVNT	ac80	5530	Ant1	5460	-48.93	2.62	48.92	Average	54	Pass
NVNT	ac80	5530	Ant1	5469.6	-36.61	2.62	61.24	Peak	68.2	Pass
NVNT	ac80	5530	Ant1	5469.8	-46.07	2.62	51.78	Average	54	Pass
NVNT	ac80	5530	Ant1	5470	-37.07	2.62	60.78	Peak	68.2	Pass
NVNT	ac80	5530	Ant1	5470	-46.1	2.62	51.75	Average	54	Pass
NVNT	ac80	5610	Ant1	5725	-38.88	2.62	58.97	Peak	68.2	Pass
NVNT	ac80	5610	Ant1	5725	-51.22	2.62	46.63	Average	54	Pass
NVNT	ac80	5610	Ant1	5725.16	-38.88	2.62	58.97	Peak	68.2	Pass
NVNT	ac80	5610	Ant1	5725.16	-51.22	2.62	46.63	Average	54	Pass
NVNT	ac80	5610	Ant1	5735	-42.27	2.62	55.58	Peak	68.2	Pass
NVNT	ac80	5610	Ant1	5735	-51.92	2.62	45.93	Average	54	Pass
NVNT	ac80	5775	Ant1	5650	-40.77	2.62	-38.15	Peak	-27	Pass
NVNT	ac80	5775	Ant1	5650	-51.6	2.62	-48.98	Average	-27	Pass
NVNT	ac80	5775	Ant1	5700	-34.41	2.62	-31.79	Peak	10	Pass
NVNT	ac80	5775	Ant1	5700	-45	2.62	-42.38	Average	10	Pass
NVNT	ac80	5775	Ant1	5720	-34.92	2.62	-32.3	Peak	15.6	Pass
NVNT	ac80	5775	Ant1	5720	-44.7	2.62	-42.08	Average	15.6	Pass
NVNT	ac80	5775	Ant1	5725	-34.93	2.62	-32.31	Peak	27	Pass
NVNT	ac80	5775	Ant1	5725	-43.66	2.62	-41.04	Average	27	Pass
NVNT	ac80	5210	Ant2	4500	-43.74	2.62	54.11	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	4500	-53.17	2.62	44.68	Average	54	Pass
NVNT	ac80	5210	Ant2	5145.43	-32.88	2.62	64.97	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5149.38	-44.07	2.62	53.78	Average	54	Pass
NVNT	ac80	5210	Ant2	5150	-33.68	2.62	64.17	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5150	-44.06	2.62	53.79	Average	54	Pass
NVNT	ac80	5290	Ant2	4500	-43.49	2.62	54.36	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	4500	-53.16	2.62	44.69	Average	54	Pass
NVNT	ac80	5290	Ant2	4732.29	-38.45	2.62	59.4	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	4687.05	-51.35	2.62	46.5	Average	54	Pass
NVNT	ac80	5290	Ant2	5150	-42.69	2.62	55.16	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5150	-51.46	2.62	46.39	Average	54	Pass
NVNT	ac80	5530	Ant2	5460	-41.48	2.62	56.37	Peak	68.2	Pass
NVNT	ac80	5530	Ant2	5460	-51.62	2.62	46.23	Average	54	Pass
NVNT	ac80	5530	Ant2	5469.2	-37.69	2.62	60.16	Peak	68.2	Pass
NVNT	ac80	5530	Ant2	5469.8	-48.17	2.62	49.68	Average	54	Pass
NVNT	ac80	5530	Ant2	5470	-39.29	2.62	58.56	Peak	68.2	Pass
NVNT	ac80	5530	Ant2	5470	-48.17	2.62	49.68	Average	54	Pass
NVNT	ac80	5610	Ant2	5725	-41.95	2.62	55.9	Peak	68.2	Pass
NVNT	ac80	5610	Ant2	5725	-52.42	2.62	45.43	Average	54	Pass
NVNT	ac80	5610	Ant2	5729.87 5	-39.41	2.62	58.44	Peak	68.2	Pass
NVNT	ac80	5610	Ant2	5726.18	-52.4	2.62	45.45	Average	54	Pass



				5						
NVNT	ac80	5610	Ant2	5735	-43.76	2.62	54.09	Peak	68.2	Pass
NVNT	ac80	5610	Ant2	5735	-52.65	2.62	45.2	Average	54	Pass
NVNT	ac80	5775	Ant2	5650	-41.95	2.62	-39.33	Peak	-27	Pass
NVNT	ac80	5775	Ant2	5650	-51.63	2.62	-49.01	Average	-27	Pass
NVNT	ac80	5775	Ant2	5700	-36.96	2.62	-34.34	Peak	10	Pass
NVNT	ac80	5775	Ant2	5700	-47.27	2.62	-44.65	Average	10	Pass
NVNT	ac80	5775	Ant2	5720	-36.49	2.62	-33.87	Peak	15.6	Pass
NVNT	ac80	5775	Ant2	5720	-46.85	2.62	-44.23	Average	15.6	Pass
NVNT	ac80	5775	Ant2	5725	-36.4	2.62	-33.78	Peak	27	Pass
NVNT	ac80	5775	Ant2	5725	-45.84	2.62	-43.22	Average	27	Pass
NVNT	ax20	5180	Ant1	4500	-43.41	2.62	54.44	Peak	68.2	Pass
NVNT	ax20	5180	Ant1	4500	-53.97	2.62	43.88	Average	54	Pass
NVNT	ax20	5180	Ant1	5144	-38.52	2.62	59.33	Peak	68.2	Pass
NVNT	ax20	5180	Ant1	5149.6	-50.54	2.62	47.31	Average	54	Pass
NVNT	ax20	5180	Ant1	5150	-38.85	2.62	59	Peak	68.2	Pass
NVNT	ax20	5180	Ant1	5150	-50.49	2.62	47.36	Average	54	Pass
NVNT	ax20	5240	Ant1	5350	-42.22	2.62	55.63	Peak	68.2	Pass
NVNT	ax20	5240	Ant1	5350	-53.79	2.62	44.06	Average	54	Pass
NVNT	ax20	5240	Ant1	5456.64	-39.37	2.62	58.48	Peak	68.2	Pass
NVNT	ax20	5240	Ant1	5350.8	-53.77	2.62	44.08	Average	54	Pass
NVNT	ax20	5240	Ant1	5460	-43.82	2.62	54.03	Peak	68.2	Pass
NVNT	ax20	5240	Ant1	5460	-53.87	2.62	43.98	Average	54	Pass
NVNT	ax20	5260	Ant1	4500	-43.37	2.62	54.48	Peak	68.2	Pass
NVNT	ax20	5260	Ant1	4500	-53.9	2.62	43.95	Average	54	Pass
NVNT	ax20	5260	Ant1	5035.86	-37.9	2.62	59.95	Peak	68.2	Pass
NVNT	ax20	5260	Ant1	5113.08	-52	2.62	45.85	Average	54	Pass
NVNT	ax20	5260	Ant1	5150	-42.37	2.62	55.48	Peak	68.2	Pass
NVNT	ax20	5260	Ant1	5150	-52.12	2.62	45.73	Average	54	Pass
NVNT	ax20	5745	Ant1	5650	-42.02	2.62	-39.4	Peak	-27	Pass
NVNT	ax20	5745	Ant1	5650	-52.51	2.62	-49.89	Average	-27	Pass
NVNT	ax20	5745	Ant1	5700	-40.38	2.62	-37.76	Peak	10	Pass
NVNT	ax20	5745	Ant1	5700	-51.43	2.62	-48.81	Average	10	Pass
NVNT	ax20	5745	Ant1	5720	-37.51	2.62	-34.89	Peak	15.6	Pass
NVNT	ax20	5745	Ant1	5720	-49.86	2.62	-47.24	Average	15.6	Pass
NVNT	ax20	5745	Ant1	5725	-38.86	2.62	-36.24	Peak	27	Pass
NVNT	ax20	5745	Ant1	5725	-49.05	2.62	-46.43	Average	27	Pass
NVNT	ax20	5825	Ant1	5850	-40.18	2.62	-37.56	Peak	27	Pass
NVNT	ax20	5825	Ant1	5850	-50.73	2.62	-48.11	Average	27	Pass
NVNT	ax20	5825	Ant1	5855	-41.66	2.62	-39.04	Peak	15.6	Pass
NVNT	ax20	5825	Ant1	5855	-51.31	2.62	-48.69	Average	15.6	Pass
NVNT	ax20	5825	Ant1	5875	-40.88	2.62	-38.26	Peak	10	Pass
NVNT	ax20	5825	Ant1	5875	-52.06	2.62	-49.44	Average	10	Pass
NVNT	ax20	5825	Ant1	5925	-42	2.62	-39.38	Peak	-27	Pass
NVNT	ax20	5825	Ant1	5925	-52.45	2.62	-49.83	Average	-27	Pass
NVNT	ax20	5180	Ant2	4500	-42.73	2.62	55.12	Peak	68.2	Pass
NVNT	ax20	5180	Ant2	4500	-53.39	2.62	44.46	Average	54	Pass
NVNT	ax20	5180	Ant2	5100.6	-39.03	2.62	58.82	Peak	68.2	Pass
NVNT	ax20	5180	Ant2	5149.6	-51.24	2.62	46.61	Average	54	Pass
NVNT	ax20	5180	Ant2	5150	-40.19	2.62	57.66	Peak	68.2	Pass
NVNT	ax20	5180	Ant2	5150	-51.23	2.62	46.62	Average	54	Pass
NVNT	ax20	5240	Ant2	5350	-44.63	2.62	53.22	Peak	68.2	Pass
NVNT	ax20	5240	Ant2	5350	-53.58	2.62	44.27	Average	54	Pass
NVNT	ax20	5240	Ant2	5359.68	-41.23	2.62	56.62	Peak	68.2	Pass
NVNT	ax20	5240	Ant2	5350.8	-53.55	2.62	44.3	Average	54	Pass
NVNT	ax20	5240	Ant2	5460	-44.45	2.62	53.4	Peak	68.2	Pass



NVNT	ax20	5240	Ant2	5460	-53.6	2.62	44.25	Average	54	Pass
NVNT	ax20	5260	Ant2	4500	-44.57	2.62	53.28	Peak	68.2	Pass
NVNT	ax20	5260	Ant2	4500	-53.45	2.62	44.4	Average	54	Pass
NVNT	ax20	5260	Ant2	5045.22	-38.1	2.62	59.75	Peak	68.2	Pass
NVNT	ax20	5260	Ant2	4698.9	-51.61	2.62	46.24	Average	54	Pass
NVNT	ax20	5260	Ant2	5150	-41.6	2.62	56.25	Peak	68.2	Pass
NVNT	ax20	5260	Ant2	5150	-51.77	2.62	46.08	Average	54	Pass
NVNT	ax20	5745	Ant2	5650	-43.2	2.62	-40.58	Peak	-27	Pass
NVNT	ax20	5745	Ant2	5650	-52.39	2.62	-49.77	Average	-27	Pass
NVNT	ax20	5745	Ant2	5700	-42.2	2.62	-39.58	Peak	10	Pass
NVNT	ax20	5745	Ant2	5700	-51.93	2.62	-49.31	Average	10	Pass
NVNT	ax20	5745	Ant2	5720	-40.39	2.62	-37.77	Peak	15.6	Pass
NVNT	ax20	5745	Ant2	5720	-51.24	2.62	-48.62	Average	15.6	Pass
NVNT	ax20	5745	Ant2	5725	-42.11	2.62	-39.49	Peak	27	Pass
NVNT	ax20	5745	Ant2	5725	-50.86	2.62	-48.24	Average	27	Pass
NVNT	ax20	5825	Ant2	5850	-40.85	2.62	-38.23	Peak	27	Pass
NVNT	ax20	5825	Ant2	5850	-51.94	2.62	-49.32	Average	27	Pass
NVNT	ax20	5825	Ant2	5855	-42.25	2.62	-39.63	Peak	15.6	Pass
NVNT	ax20	5825	Ant2	5855	-52.19	2.62	-49.57	Average	15.6	Pass
NVNT	ax20	5825	Ant2	5875	-42.01	2.62	-39.39	Peak	10	Pass
NVNT	ax20	5825	Ant2	5875	-52.4	2.62	-49.78	Average	10	Pass
NVNT	ax20	5825	Ant2	5925	-42.97	2.62	-40.35	Peak	-27	Pass
NVNT	ax20	5825	Ant2	5925	-52.5	2.62	-49.88	Average	-27	Pass
NVNT	ax40	5190	Ant1	4500	-44.86	2.62	52.99	Peak	68.2	Pass
NVNT	ax40	5190	Ant1	4500	-53.94	2.62	43.91	Average	54	Pass
NVNT	ax40	5190	Ant1	5084	-38.25	2.62	59.6	Peak	68.2	Pass
NVNT	ax40	5190	Ant1	5149.7	-49.64	2.62	48.21	Average	54	Pass
NVNT	ax40	5190	Ant1	5150	-38.56	2.62	59.29	Peak	68.2	Pass
NVNT	ax40	5190	Ant1	5150	-49.59	2.62	48.26	Average	54	Pass
NVNT	ax40	5230	Ant1	5350	-44.95	2.62	52.9	Peak	68.2	Pass
NVNT	ax40	5230	Ant1	5350	-53.81	2.62	44.04	Average	54	Pass
NVNT	ax40	5230	Ant1	5352.54	-41.15	2.62	56.7	Peak	68.2	Pass
NVNT	ax40	5230	Ant1	5350.11	-53.81	2.62	44.04	Average	54	Pass
NVNT	ax40	5230	Ant1	5460	-42.79	2.62	55.06	Peak	68.2	Pass
NVNT	ax40	5230	Ant1	5460	-53.88	2.62	43.97	Average	54	Pass
NVNT	ax40	5270	Ant1	4500	-41.42	2.62	56.43	Peak	68.2	Pass
NVNT	ax40	5270	Ant1	4500	-53.69	2.62	44.16	Average	54	Pass
NVNT	ax40	5270	Ant1	4665.24	-39.32	2.62	58.53	Peak	68.2	Pass
NVNT	ax40	5270	Ant1	5112.36	-51.88	2.62	45.97	Average	54	Pass
NVNT	ax40	5270	Ant1	5150	-41.43	2.62	56.42	Peak	68.2	Pass
NVNT	ax40	5270	Ant1	5150	-51.99	2.62	45.86	Average	54	Pass
NVNT	ax40	5310	Ant1	5350	-40.39	2.62	57.46	Peak	68.2	Pass
NVNT	ax40	5310	Ant1	5350	-51.28	2.62	46.57	Average	54	Pass
NVNT	ax40	5310	Ant1	5350.4	-39.51	2.62	58.34	Peak	68.2	Pass
NVNT	ax40	5310	Ant1	5350.6	-51.14	2.62	46.71	Average	54	Pass
NVNT	ax40	5310	Ant1	5460	-43.95	2.62	53.9	Peak	68.2	Pass
NVNT	ax40	5310	Ant1	5460	-53.86	2.62	43.99	Average	54	Pass
NVNT	ax40	5510	Ant1	5460	-42.64	2.62	55.21	Peak	68.2	Pass
NVNT	ax40	5510	Ant1	5460	-52.09	2.62	45.76	Average	54	Pass
NVNT	ax40	5510	Ant1	5467	-40	2.62	57.85	Peak	68.2	Pass
NVNT	ax40	5510	Ant1	5469.4	-50.9	2.62	46.95	Average	54	Pass
NVNT	ax40	5510	Ant1	5470	-40.99	2.62	56.86	Peak	68.2	Pass
NVNT	ax40	5510	Ant1	5470	-50.97	2.62	46.88	Average	54	Pass
NVNT	ax40	5670	Ant1	5725	-42.19	2.62	55.66	Peak	68.2	Pass
NVNT	ax40	5670	Ant1	5725	-51.9	2.62	45.95	Average	54	Pass
NVNT	ax40	5670	Ant1	5728.2	-40.11	2.62	57.74	Peak	68.2	Pass



NVNT	ax40	5670	Ant1	5725.4	-51.88	2.62	45.97	Average	54	Pass
NVNT	ax40	5670	Ant1	5735	-42.33	2.62	55.52	Peak	68.2	Pass
NVNT	ax40	5670	Ant1	5735	-52.2	2.62	45.65	Average	54	Pass
NVNT	ax40	5755	Ant1	5650	-42.1	2.62	-39.48	Peak	-27	Pass
NVNT	ax40	5755	Ant1	5650	-52.73	2.62	-50.11	Average	-27	Pass
NVNT	ax40	5755	Ant1	5700	-39.95	2.62	-37.33	Peak	10	Pass
NVNT	ax40	5755	Ant1	5700	-51.5	2.62	-48.88	Average	10	Pass
NVNT	ax40	5755	Ant1	5720	-39.71	2.62	-37.09	Peak	15.6	Pass
NVNT	ax40	5755	Ant1	5720	-49.84	2.62	-47.22	Average	15.6	Pass
NVNT	ax40	5755	Ant1	5725	-37.75	2.62	-35.13	Peak	27	Pass
NVNT	ax40	5755	Ant1	5725	-47.41	2.62	-44.79	Average	27	Pass
NVNT	ax40	5795	Ant1	5850	-40.08	2.62	-37.46	Peak	27	Pass
NVNT	ax40	5795	Ant1	5850	-51.05	2.62	-48.43	Average	27	Pass
NVNT	ax40	5795	Ant1	5855	-41.34	2.62	-38.72	Peak	15.6	Pass
NVNT	ax40	5795	Ant1	5855	-51.42	2.62	-48.8	Average	15.6	Pass
NVNT	ax40	5795	Ant1	5875	-42.48	2.62	-39.86	Peak	10	Pass
NVNT	ax40	5795	Ant1	5875	-52.08	2.62	-49.46	Average	10	Pass
NVNT	ax40	5795	Ant1	5925	-42.86	2.62	-40.24	Peak	-27	Pass
NVNT	ax40	5795	Ant1	5925	-52.54	2.62	-49.92	Average	-27	Pass
NVNT	ax40	5190	Ant2	4500	-43.76	2.62	54.09	Peak	68.2	Pass
NVNT	ax40	5190	Ant2	4500	-53.44	2.62	44.41	Average	54	Pass
NVNT	ax40	5190	Ant2	5110.28	-39.29	2.62	58.56	Peak	68.2	Pass
NVNT	ax40	5190	Ant2	5149.7	-50.59	2.62	47.26	Average	54	Pass
NVNT	ax40	5190	Ant2	5150	-39.43	2.62	58.42	Peak	68.2	Pass
NVNT	ax40	5190	Ant2	5150	-50.75	2.62	47.1	Average	54	Pass
NVNT	ax40	5230	Ant2	5350	-42.17	2.62	55.68	Peak	68.2	Pass
NVNT	ax40	5230	Ant2	5350	-53.62	2.62	44.23	Average	54	Pass
NVNT	ax40	5230	Ant2	5411.4	-40.86	2.62	56.99	Peak	68.2	Pass
NVNT	ax40	5230	Ant2	5459.73	-53.54	2.62	44.31	Average	54	Pass
NVNT	ax40	5230	Ant2	5460	-42.59	2.62	55.26	Peak	68.2	Pass
NVNT	ax40	5230	Ant2	5460	-53.57	2.62	44.28	Average	54	Pass
NVNT	ax40	5270	Ant2	4500	-42.18	2.62	55.67	Peak	68.2	Pass
NVNT	ax40	5270	Ant2	4500	-53.23	2.62	44.62	Average	54	Pass
NVNT	ax40	5270	Ant2	4994.91	-38.55	2.62	59.3	Peak	68.2	Pass
NVNT	ax40	5270	Ant2	4687.92	-51.39	2.62	46.46	Average	54	Pass
NVNT	ax40	5270	Ant2	5150	-40.84	2.62	57.01	Peak	68.2	Pass
NVNT	ax40	5270	Ant2	5150	-51.49	2.62	46.36	Average	54	Pass
NVNT	ax40	5310	Ant2	5350	-41.69	2.62	56.16	Peak	68.2	Pass
NVNT	ax40	5310	Ant2	5350	-52.34	2.62	45.51	Average	54	Pass
NVNT	ax40	5310	Ant2	5382.4	-39.53	2.62	58.32	Peak	68.2	Pass
NVNT	ax40	5310	Ant2	5350.2	-52.3	2.62	45.55	Average	54	Pass
NVNT	ax40	5310	Ant2	5460	-43.21	2.62	54.64	Peak	68.2	Pass
NVNT	ax40	5310	Ant2	5460	-53.15	2.62	44.7	Average	54	Pass
NVNT	ax40	5510	Ant2	5460	-41.06	2.62	56.79	Peak	68.2	Pass
NVNT	ax40	5510	Ant2	5460	-51.99	2.62	45.86	Average	54	Pass
NVNT	ax40	5510	Ant2	5465	-39.86	2.62	57.99	Peak	68.2	Pass
NVNT	ax40	5510	Ant2	5469.6	-51.36	2.62	46.49	Average	54	Pass
NVNT	ax40	5510	Ant2	5470	-41.28	2.62	56.57	Peak	68.2	Pass
NVNT	ax40	5510	Ant2	5470	-51.4	2.62	46.45	Average	54	Pass
NVNT	ax40	5670	Ant2	5725	-41.37	2.62	56.48	Peak	68.2	Pass
NVNT	ax40	5670	Ant2	5725	-52.12	2.62	45.73	Average	54	Pass
NVNT	ax40	5670	Ant2	5733.8	-40.12	2.62	57.73	Peak	68.2	Pass
NVNT	ax40	5670	Ant2	5725.2	-52.11	2.62	45.74	Average	54	Pass
NVNT	ax40	5670	Ant2	5735	-41.17	2.62	56.68	Peak	68.2	Pass
NVNT	ax40	5670	Ant2	5735	-52.33	2.62	45.52	Average	54	Pass
NVNT	ax40	5755	Ant2	5650	-42.19	2.62	-39.57	Peak	-27	Pass



NVNT	ax40	5755	Ant2	5650	-52.42	2.62	-49.8	Average	-27	Pass
NVNT	ax40	5755	Ant2	5700	-42.46	2.62	-39.84	Peak	10	Pass
NVNT	ax40	5755	Ant2	5700	-51.81	2.62	-49.19	Average	10	Pass
NVNT	ax40	5755	Ant2	5720	-40.76	2.62	-38.14	Peak	15.6	Pass
NVNT	ax40	5755	Ant2	5720	-50.67	2.62	-48.05	Average	15.6	Pass
NVNT	ax40	5755	Ant2	5725	-38.38	2.62	-35.76	Peak	27	Pass
NVNT	ax40	5755	Ant2	5725	-48.63	2.62	-46.01	Average	27	Pass
NVNT	ax40	5795	Ant2	5850	-40.93	2.62	-38.31	Peak	27	Pass
NVNT	ax40	5795	Ant2	5850	-51.51	2.62	-48.89	Average	27	Pass
NVNT	ax40	5795	Ant2	5855	-42.29	2.62	-39.67	Peak	15.6	Pass
NVNT	ax40	5795	Ant2	5855	-51.83	2.62	-49.21	Average	15.6	Pass
NVNT	ax40	5795	Ant2	5875	-40.99	2.62	-38.37	Peak	10	Pass
NVNT	ax40	5795	Ant2	5875	-52.41	2.62	-49.79	Average	10	Pass
NVNT	ax40	5795	Ant2	5925	-43.83	2.62	-41.21	Peak	-27	Pass
NVNT	ax40	5795	Ant2	5925	-52.6	2.62	-49.98	Average	-27	Pass
NVNT	ax80	5210	Ant1	4500	-43.96	2.62	53.89	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	4500	-53.79	2.62	44.06	Average	54	Pass
NVNT	ax80	5210	Ant1	5131.21	-35.8	2.62	62.05	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	5149.38	-46.64	2.62	51.21	Average	54	Pass
NVNT	ax80	5210	Ant1	5150	-35.09	2.62	62.76	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	5150	-46.63	2.62	51.22	Average	54	Pass
NVNT	ax80	5290	Ant1	4500	-44.12	2.62	53.73	Peak	68.2	Pass
NVNT	ax80	5290	Ant1	4500	-53.69	2.62	44.16	Average	54	Pass
NVNT	ax80	5290	Ant1	5139.45	-38.88	2.62	58.97	Peak	68.2	Pass
NVNT	ax80	5290	Ant1	4688.79	-51.89	2.62	45.96	Average	54	Pass
NVNT	ax80	5290	Ant1	5150	-42.73	2.62	55.12	Peak	68.2	Pass
NVNT	ax80	5290	Ant1	5150	-51.91	2.62	45.94	Average	54	Pass
NVNT	ax80	5530	Ant1	5460	-37.38	2.62	60.47	Peak	68.2	Pass
NVNT	ax80	5530	Ant1	5460	-48.68	2.62	49.17	Average	54	Pass
NVNT	ax80	5530	Ant1	5467	-36.6	2.62	61.25	Peak	68.2	Pass
NVNT	ax80	5530	Ant1	5469.8	-46.22	2.62	51.63	Average	54	Pass
NVNT	ax80	5530	Ant1	5470	-36.82	2.62	61.03	Peak	68.2	Pass
NVNT	ax80	5530	Ant1	5470	-46.24	2.62	51.61	Average	54	Pass
NVNT	ax80	5610	Ant1	5725	-42.97	2.62	54.88	Peak	68.2	Pass
NVNT	ax80	5610	Ant1	5725	-52.49	2.62	45.36	Average	54	Pass
NVNT	ax80	5610	Ant1	5728.23 5	-40.72	2.62	57.13	Peak	68.2	Pass
NVNT	ax80	5610	Ant1	5725.77 5	-52.48	2.62	45.37	Average	54	Pass
NVNT	ax80	5610	Ant1	5735	-43.3	2.62	54.55	Peak	68.2	Pass
NVNT	ax80	5610	Ant1	5735	-52.75	2.62	45.1	Average	54	Pass
NVNT	ax80	5775	Ant1	5650	-42	2.62	-39.38	Peak	-27	Pass
NVNT	ax80	5775	Ant1	5650	-52.26	2.62	-49.64	Average	-27	Pass
NVNT	ax80	5775	Ant1	5700	-37.39	2.62	-34.77	Peak	10	Pass
NVNT	ax80	5775	Ant1	5700	-47.74	2.62	-45.12	Average	10	Pass
NVNT	ax80	5775	Ant1	5720	-36.42	2.62	-33.8	Peak	15.6	Pass
NVNT	ax80	5775	Ant1	5720	-47.53	2.62	-44.91	Average	15.6	Pass
NVNT	ax80	5775	Ant1	5725	-35.16	2.62	-32.54	Peak	27	Pass
NVNT	ax80	5775	Ant1	5725	-45.87	2.62	-43.25	Average	27	Pass
NVNT	ax80	5210	Ant2	4500	-42.96	2.62	54.89	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	4500	-53.37	2.62	44.48	Average	54	Pass
NVNT	ax80	5210	Ant2	5146.22	-36.43	2.62	61.42	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5149.38	-48.12	2.62	49.73	Average	54	Pass
NVNT	ax80	5210	Ant2	5150	-37.52	2.62	60.33	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5150	-48.1	2.62	49.75	Average	54	Pass
NVNT	ax80	5290	Ant2	4500	-44.47	2.62	53.38	Peak	68.2	Pass




NVNT	ax80	5290	Ant2	4500	-53.3	2.62	44.55	Average	54	Pass
NVNT	ax80	5290	Ant2	4814.94	-38.58	2.62	59.27	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	4687.05	-51.52	2.62	46.33	Average	54	Pass
NVNT	ax80	5290	Ant2	5150	-41.56	2.62	56.29	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5150	-51.73	2.62	46.12	Average	54	Pass
NVNT	ax80	5530	Ant2	5460	-38.6	2.62	59.25	Peak	68.2	Pass
NVNT	ax80	5530	Ant2	5460	-48.1	2.62	49.75	Average	54	Pass
NVNT	ax80	5530	Ant2	5465	-34.78	2.62	63.07	Peak	68.2	Pass
NVNT	ax80	5530	Ant2	5469.8	-45.67	2.62	52.18	Average	54	Pass
NVNT	ax80	5530	Ant2	5470	-35.59	2.62	62.26	Peak	68.2	Pass
NVNT	ax80	5530	Ant2	5470	-45.68	2.62	52.17	Average	54	Pass
NVNT	ax80	5610	Ant2	5725	-42.17	2.62	55.68	Peak	68.2	Pass
NVNT	ax80	5610	Ant2	5725	-52.46	2.62	45.39	Average	54	Pass
NVNT	ax80	5610	Ant2	5726.59 5	-40.66	2.62	57.19	Peak	68.2	Pass
NVNT	ax80	5610	Ant2	5725.16	-52.46	2.62	45.39	Average	54	Pass
NVNT	ax80	5610	Ant2	5735	-42.54	2.62	55.31	Peak	68.2	Pass
NVNT	ax80	5610	Ant2	5735	-52.62	2.62	45.23	Average	54	Pass
NVNT	ax80	5775	Ant2	5650	-42.13	2.62	-39.51	Peak	-27	Pass
NVNT	ax80	5775	Ant2	5650	-52.15	2.62	-49.53	Average	-27	Pass
NVNT	ax80	5775	Ant2	5700	-38.29	2.62	-35.67	Peak	10	Pass
NVNT	ax80	5775	Ant2	5700	-48.5	2.62	-45.88	Average	10	Pass
NVNT	ax80	5775	Ant2	5720	-36.43	2.62	-33.81	Peak	15.6	Pass
NVNT	ax80	5775	Ant2	5720	-47.96	2.62	-45.34	Average	15.6	Pass
NVNT	ax80	5775	Ant2	5725	-36.84	2.62	-34.22	Peak	27	Pass
NVNT	ax80	5775	Ant2	5725	-46.55	2.62	-43.93	Average	27	Pass



Test Graphs

Restrict Band NVNT a 5180MHz Ant1 Peak

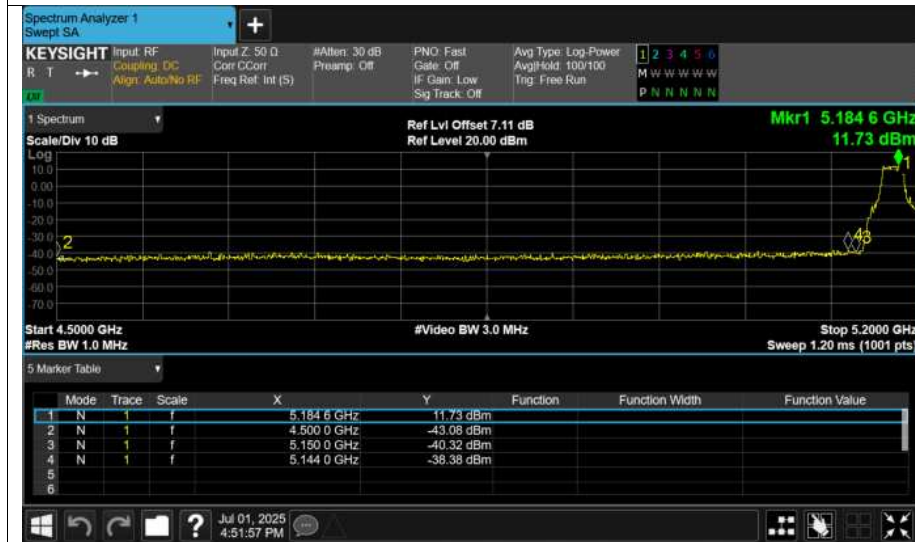

Restrict Band NVNT a 5180MHz Ant1 Average



Restrict Band NVNT a 5240MHz Ant1 Peak






Restrict Band NVNT a 5240MHz Ant1 Average



Restrict Band NVNT a 5260MHz Ant1 Peak

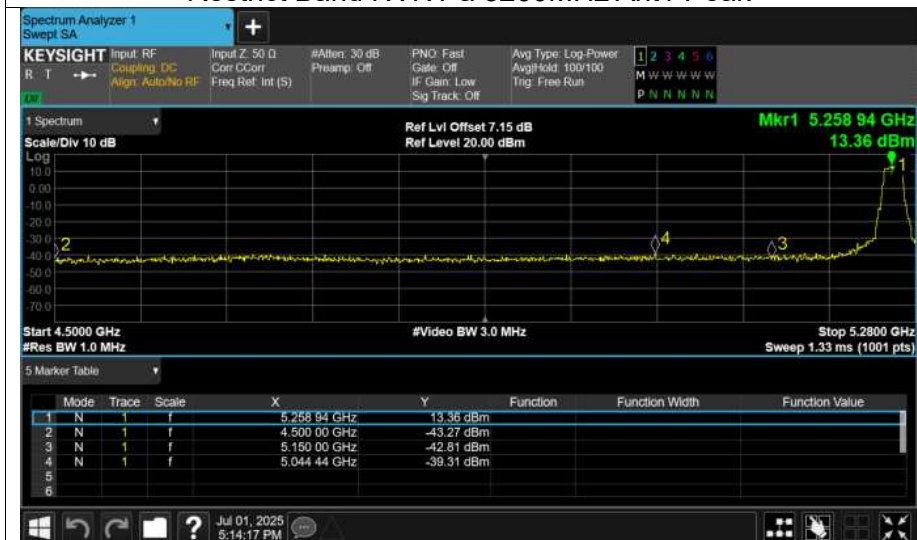

Restrict Band NVNT a 5260MHz Ant1 Average

