





Band71-20MHz-16QAM-133222-1RB#0-Range1:30~1000MHz

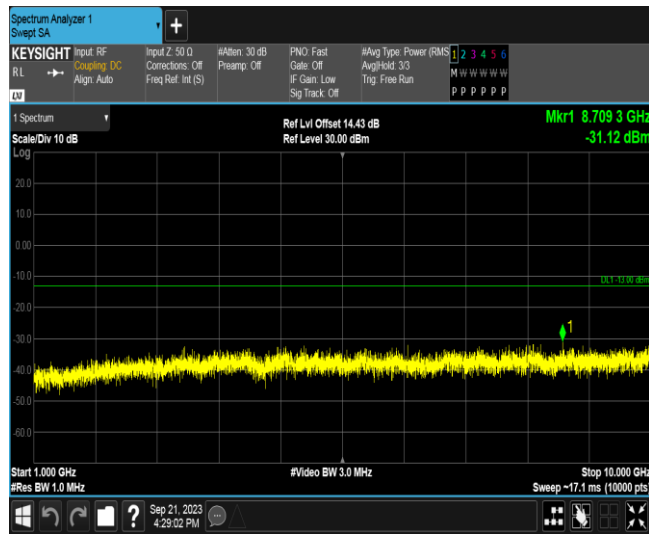


Band71-20MHz-16QAM-133222-1RB#0-Range2:1000~10000MHz

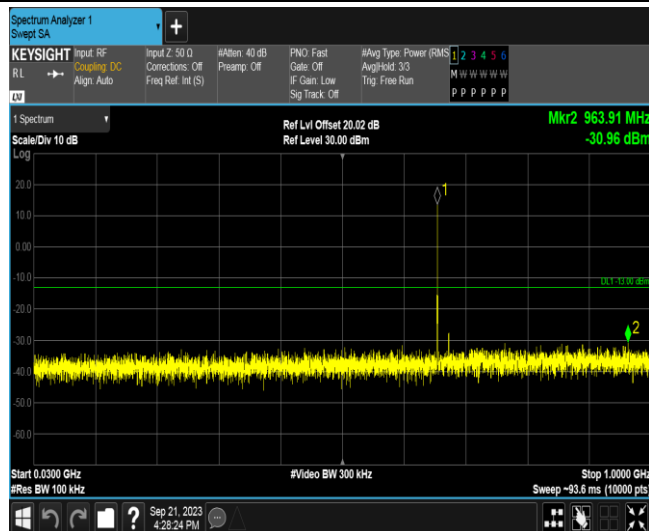


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band71-20MHz-16QAM-133322-1RB#0-Range1:30~1000MHz

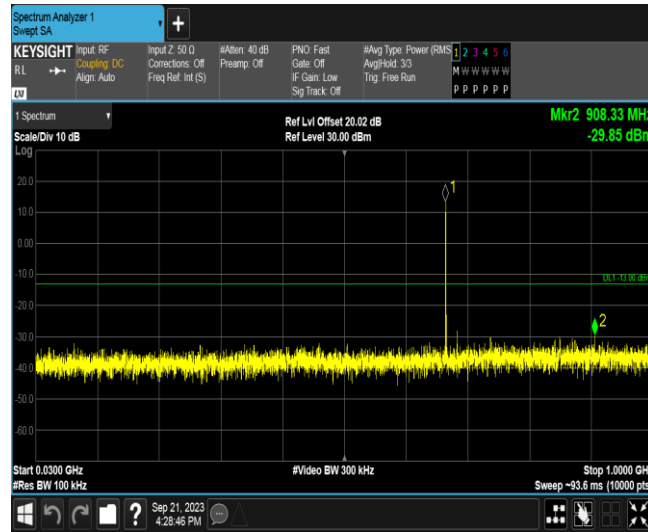


Band71-20MHz-16QAM-133322-1RB#0-Range2:1000~10000MHz

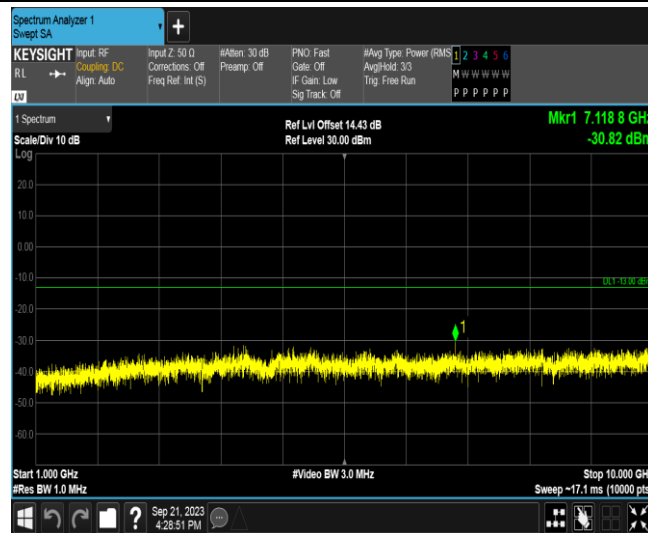


Band71-20MHz-16QAM-133372-1RB#0-Range1:30~1000MHz

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd
Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd
Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>

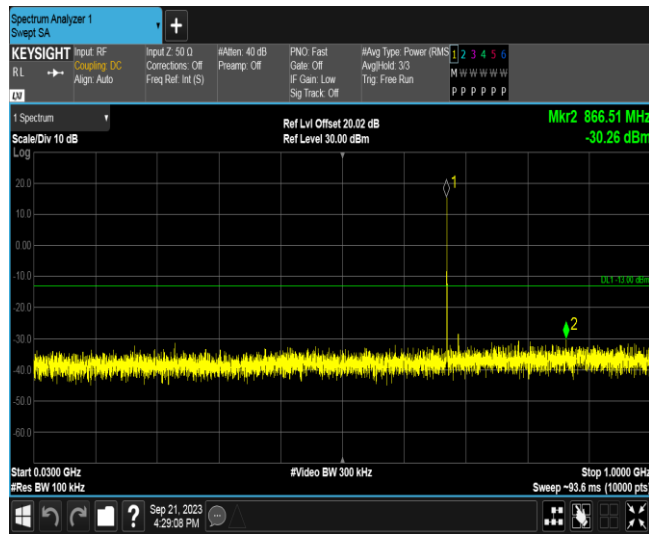

Band71-20MHz-16QAM-133372-1RB#0-Range2:1000~10000MHz

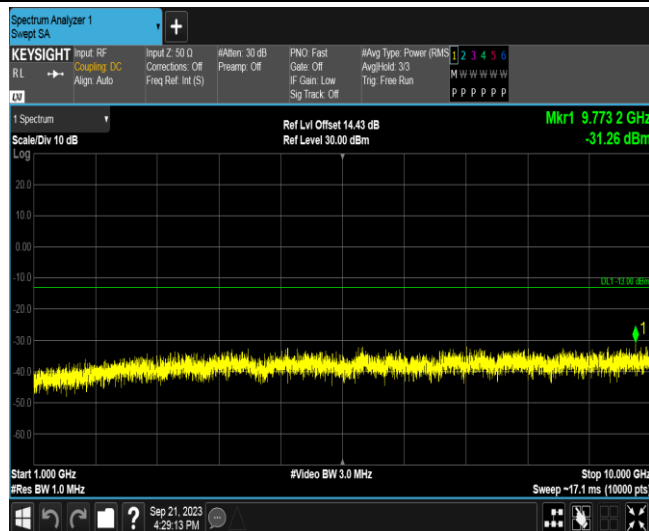

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd
Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd
Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>

Appendix F: Frequency Stability

Test Result

Voltage										
Band	Bandwidth	Modulation	Channel	RB Configure	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band71	5MHz	QPSK	133147	25RB#0	VL	NT	-3.10	-0.004658	±2.5	PASS
Band71	5MHz	QPSK	133147	25RB#0	VN	NT	-3.43	-0.005154	±2.5	PASS
Band71	5MHz	QPSK	133147	25RB#0	VH	NT	-3.63	-0.005455	±2.5	PASS
Band71	5MHz	QPSK	133297	25RB#0	VL	NT	-2.96	-0.004350	±2.5	PASS
Band71	5MHz	QPSK	133297	25RB#0	VN	NT	-2.79	-0.004100	±2.5	PASS
Band71	5MHz	QPSK	133297	25RB#0	VH	NT	-3.19	-0.004688	±2.5	PASS
Band71	5MHz	QPSK	133447	25RB#0	VL	NT	-4.76	-0.006844	±2.5	PASS
Band71	5MHz	QPSK	133447	25RB#0	VN	NT	-3.49	-0.005018	±2.5	PASS
Band71	5MHz	QPSK	133447	25RB#0	VH	NT	-4.22	-0.006068	±2.5	PASS
Band71	5MHz	16QAM	133147	25RB#0	VL	NT	-3.28	-0.004929	±2.5	PASS
Band71	5MHz	16QAM	133147	25RB#0	VN	NT	-3.92	-0.005890	±2.5	PASS
Band71	5MHz	16QAM	133147	25RB#0	VH	NT	-4.13	-0.006206	±2.5	PASS
Band71	5MHz	16QAM	133297	25RB#0	VL	NT	-3.33	-0.004893	±2.5	PASS
Band71	5MHz	16QAM	133297	25RB#0	VN	NT	-1.40	-0.002057	±2.5	PASS
Band71	5MHz	16QAM	133297	25RB#0	VH	NT	-4.81	-0.007068	±2.5	PASS
Band71	5MHz	16QAM	133447	25RB#0	VL	NT	-3.78	-0.005435	±2.5	PASS
Band71	5MHz	16QAM	133447	25RB#0	VN	NT	-1.95	-0.002804	±2.5	PASS
Band71	5MHz	16QAM	133447	25RB#0	VH	NT	-3.95	-0.005679	±2.5	PASS
Band71	10MHz	QPSK	133172	50RB#0	VL	NT	1.23	0.001841	±2.5	PASS
Band71	10MHz	QPSK	133172	50RB#0	VN	NT	-2.23	-0.003338	±2.5	PASS
Band71	10MHz	QPSK	133172	50RB#0	VH	NT	1.14	0.001707	±2.5	PASS
Band71	10MHz	QPSK	133297	50RB#0	VL	NT	-3.30	-0.004849	±2.5	PASS
Band71	10MHz	QPSK	133297	50RB#0	VN	NT	-2.65	-0.003894	±2.5	PASS
Band71	10MHz	QPSK	133297	50RB#0	VH	NT	-3.72	-0.005467	±2.5	PASS
Band71	10MHz	QPSK	133422	50RB#0	VL	NT	-2.82	-0.004069	±2.5	PASS
Band71	10MHz	QPSK	133422	50RB#0	VN	NT	2.69	0.003882	±2.5	PASS
Band71	10MHz	QPSK	133422	50RB#0	VH	NT	-1.66	-0.002395	±2.5	PASS
Band71	10MHz	16QAM	133172	50RB#0	VL	NT	-2.60	-0.003892	±2.5	PASS
Band71	10MHz	16QAM	133172	50RB#0	VN	NT	-1.52	-0.002275	±2.5	PASS
Band71	10MHz	16QAM	133172	50RB#0	VH	NT	-1.36	-0.002036	±2.5	PASS
Band71	10MHz	16QAM	133297	50RB#0	VL	NT	-1.53	-0.002248	±2.5	PASS
Band71	10MHz	16QAM	133297	50RB#0	VN	NT	-3.19	-0.004688	±2.5	PASS
Band71	10MHz	16QAM	133297	50RB#0	VH	NT	-3.19	-0.004688	±2.5	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band71	10MHz	16QAM	133422	50RB#0	VL	NT	1.39	0.002006	±2.5	PASS
Band71	10MHz	16QAM	133422	50RB#0	VN	NT	-1.30	-0.001876	±2.5	PASS
Band71	10MHz	16QAM	133422	50RB#0	VH	NT	1.62	0.002338	±2.5	PASS
Band71	15MHz	QPSK	133197	75RB#0	VL	NT	3.32	0.004952	±2.5	PASS
Band71	15MHz	QPSK	133197	75RB#0	VN	NT	-4.01	-0.005981	±2.5	PASS
Band71	15MHz	QPSK	133197	75RB#0	VH	NT	2.00	0.002983	±2.5	PASS
Band71	15MHz	QPSK	133297	75RB#0	VL	NT	-2.00	-0.002939	±2.5	PASS
Band71	15MHz	QPSK	133297	75RB#0	VN	NT	-2.49	-0.003659	±2.5	PASS
Band71	15MHz	QPSK	133297	75RB#0	VH	NT	-4.25	-0.006245	±2.5	PASS
Band71	15MHz	QPSK	133397	75RB#0	VL	NT	1.97	0.002853	±2.5	PASS
Band71	15MHz	QPSK	133397	75RB#0	VN	NT	3.36	0.004866	±2.5	PASS
Band71	15MHz	QPSK	133397	75RB#0	VH	NT	-2.96	-0.004287	±2.5	PASS
Band71	15MHz	16QAM	133197	75RB#0	VL	NT	1.19	0.001775	±2.5	PASS
Band71	15MHz	16QAM	133197	75RB#0	VN	NT	-1.79	-0.002670	±2.5	PASS
Band71	15MHz	16QAM	133197	75RB#0	VH	NT	-2.52	-0.003758	±2.5	PASS
Band71	15MHz	16QAM	133297	75RB#0	VL	NT	-2.88	-0.004232	±2.5	PASS
Band71	15MHz	16QAM	133297	75RB#0	VN	NT	-2.05	-0.003012	±2.5	PASS
Band71	15MHz	16QAM	133297	75RB#0	VH	NT	-4.29	-0.006304	±2.5	PASS
Band71	15MHz	16QAM	133397	75RB#0	VL	NT	-1.77	-0.002563	±2.5	PASS
Band71	15MHz	16QAM	133397	75RB#0	VN	NT	2.36	0.003418	±2.5	PASS
Band71	15MHz	16QAM	133397	75RB#0	VH	NT	2.69	0.003896	±2.5	PASS
Band71	20MHz	QPSK	133222	100RB#0	VL	NT	-2.90	-0.004309	±2.5	PASS
Band71	20MHz	QPSK	133222	100RB#0	VN	NT	-3.91	-0.005810	±2.5	PASS
Band71	20MHz	QPSK	133222	100RB#0	VH	NT	-4.62	-0.006865	±2.5	PASS
Band71	20MHz	QPSK	133322	100RB#0	VL	NT	4.89	0.007160	±2.5	PASS
Band71	20MHz	QPSK	133322	100RB#0	VN	NT	2.96	0.004334	±2.5	PASS
Band71	20MHz	QPSK	133322	100RB#0	VH	NT	2.80	0.004100	±2.5	PASS
Band71	20MHz	QPSK	133372	100RB#0	VL	NT	-3.28	-0.004767	±2.5	PASS
Band71	20MHz	QPSK	133372	100RB#0	VN	NT	-3.19	-0.004637	±2.5	PASS
Band71	20MHz	QPSK	133372	100RB#0	VH	NT	-3.45	-0.005015	±2.5	PASS
Band71	20MHz	16QAM	133222	100RB#0	VL	NT	-4.81	-0.007147	±2.5	PASS
Band71	20MHz	16QAM	133222	100RB#0	VN	NT	-3.00	-0.004458	±2.5	PASS
Band71	20MHz	16QAM	133222	100RB#0	VH	NT	-2.53	-0.003759	±2.5	PASS
Band71	20MHz	16QAM	133322	100RB#0	VL	NT	3.05	0.004466	±2.5	PASS
Band71	20MHz	16QAM	133322	100RB#0	VN	NT	2.26	0.003309	±2.5	PASS
Band71	20MHz	16QAM	133322	100RB#0	VH	NT	4.45	0.006515	±2.5	PASS
Band71	20MHz	16QAM	133372	100RB#0	VL	NT	-2.83	-0.004113	±2.5	PASS
Band71	20MHz	16QAM	133372	100RB#0	VN	NT	-3.00	-0.004360	±2.5	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band71	20MHz	16QAM	133372	100RB#0	VH	NT	-2.29	-0.003328	±2.5	PASS
--------	-------	-------	--------	---------	----	----	-------	-----------	------	------

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configure	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band71	5MHz	QPSK	133147	25RB#0	NV	-30	-2.39	-0.003591	±2.5	PASS
Band71	5MHz	QPSK	133147	25RB#0	NV	-20	-2.32	-0.003486	±2.5	PASS
Band71	5MHz	QPSK	133147	25RB#0	NV	0	-2.79	-0.004192	±2.5	PASS
Band71	5MHz	QPSK	133147	25RB#0	NV	10	-2.33	-0.003501	±2.5	PASS
Band71	5MHz	QPSK	133147	25RB#0	NV	20	-3.22	-0.004838	±2.5	PASS
Band71	5MHz	QPSK	133297	25RB#0	NV	-30	-4.12	-0.006054	±2.5	PASS
Band71	5MHz	QPSK	133297	25RB#0	NV	-20	-4.31	-0.006334	±2.5	PASS
Band71	5MHz	QPSK	133297	25RB#0	NV	0	-3.93	-0.005775	±2.5	PASS
Band71	5MHz	QPSK	133297	25RB#0	NV	10	-3.36	-0.004938	±2.5	PASS
Band71	5MHz	QPSK	133297	25RB#0	NV	20	-6.61	-0.009713	±2.5	PASS
Band71	5MHz	QPSK	133447	25RB#0	NV	-30	-1.02	-0.001467	±2.5	PASS
Band71	5MHz	QPSK	133447	25RB#0	NV	-20	-4.01	-0.005766	±2.5	PASS
Band71	5MHz	QPSK	133447	25RB#0	NV	0	-3.69	-0.005306	±2.5	PASS
Band71	5MHz	QPSK	133447	25RB#0	NV	10	-4.78	-0.006873	±2.5	PASS
Band71	5MHz	QPSK	133447	25RB#0	NV	20	-3.63	-0.005219	±2.5	PASS
Band71	5MHz	16QAM	133147	25RB#0	NV	-30	-3.42	-0.005139	±2.5	PASS
Band71	5MHz	16QAM	133147	25RB#0	NV	-20	-4.32	-0.006491	±2.5	PASS
Band71	5MHz	16QAM	133147	25RB#0	NV	0	-2.56	-0.003847	±2.5	PASS
Band71	5MHz	16QAM	133147	25RB#0	NV	10	-4.09	-0.006146	±2.5	PASS
Band71	5MHz	16QAM	133147	25RB#0	NV	20	-2.29	-0.003441	±2.5	PASS
Band71	5MHz	16QAM	133297	25RB#0	NV	-30	-2.42	-0.003556	±2.5	PASS
Band71	5MHz	16QAM	133297	25RB#0	NV	-20	-3.13	-0.004600	±2.5	PASS
Band71	5MHz	16QAM	133297	25RB#0	NV	0	-2.13	-0.003130	±2.5	PASS
Band71	5MHz	16QAM	133297	25RB#0	NV	10	-4.35	-0.006392	±2.5	PASS
Band71	5MHz	16QAM	133297	25RB#0	NV	20	-4.25	-0.006245	±2.5	PASS
Band71	5MHz	16QAM	133447	25RB#0	NV	-30	-2.43	-0.003494	±2.5	PASS
Band71	5MHz	16QAM	133447	25RB#0	NV	-20	0.99	0.001423	±2.5	PASS
Band71	5MHz	16QAM	133447	25RB#0	NV	0	-2.16	-0.003106	±2.5	PASS
Band71	5MHz	16QAM	133447	25RB#0	NV	10	-4.11	-0.005909	±2.5	PASS
Band71	5MHz	16QAM	133447	25RB#0	NV	20	-2.73	-0.003925	±2.5	PASS
Band71	10MHz	QPSK	133172	50RB#0	NV	-30	1.04	0.001557	±2.5	PASS
Band71	10MHz	QPSK	133172	50RB#0	NV	-20	-1.20	-0.001796	±2.5	PASS
Band71	10MHz	QPSK	133172	50RB#0	NV	0	-1.49	-0.002231	±2.5	PASS
Band71	10MHz	QPSK	133172	50RB#0	NV	10	2.27	0.003398	±2.5	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band71	10MHz	QPSK	133172	50RB#0	NV	20	2.35	0.003518	±2.5	PASS
Band71	10MHz	QPSK	133297	50RB#0	NV	-30	-3.50	-0.005143	±2.5	PASS
Band71	10MHz	QPSK	133297	50RB#0	NV	-20	-3.03	-0.004453	±2.5	PASS
Band71	10MHz	QPSK	133297	50RB#0	NV	0	-4.22	-0.006201	±2.5	PASS
Band71	10MHz	QPSK	133297	50RB#0	NV	10	-3.15	-0.004629	±2.5	PASS
Band71	10MHz	QPSK	133297	50RB#0	NV	20	-2.93	-0.004306	±2.5	PASS
Band71	10MHz	QPSK	133422	50RB#0	NV	-30	1.92	0.002771	±2.5	PASS
Band71	10MHz	QPSK	133422	50RB#0	NV	-20	1.77	0.002554	±2.5	PASS
Band71	10MHz	QPSK	133422	50RB#0	NV	0	1.63	0.002352	±2.5	PASS
Band71	10MHz	QPSK	133422	50RB#0	NV	10	-1.32	-0.001905	±2.5	PASS
Band71	10MHz	QPSK	133422	50RB#0	NV	20	-3.09	-0.004459	±2.5	PASS
Band71	10MHz	16QAM	133172	50RB#0	NV	-30	-1.23	-0.001841	±2.5	PASS
Band71	10MHz	16QAM	133172	50RB#0	NV	-20	-1.70	-0.002545	±2.5	PASS
Band71	10MHz	16QAM	133172	50RB#0	NV	0	1.53	0.002290	±2.5	PASS
Band71	10MHz	16QAM	133172	50RB#0	NV	10	1.32	0.001976	±2.5	PASS
Band71	10MHz	16QAM	133172	50RB#0	NV	20	3.42	0.005120	±2.5	PASS
Band71	10MHz	16QAM	133297	50RB#0	NV	-30	-2.98	-0.004379	±2.5	PASS
Band71	10MHz	16QAM	133297	50RB#0	NV	-20	-3.33	-0.004893	±2.5	PASS
Band71	10MHz	16QAM	133297	50RB#0	NV	0	-6.65	-0.009772	±2.5	PASS
Band71	10MHz	16QAM	133297	50RB#0	NV	10	-3.23	-0.004747	±2.5	PASS
Band71	10MHz	16QAM	133297	50RB#0	NV	20	-2.33	-0.003424	±2.5	PASS
Band71	10MHz	16QAM	133422	50RB#0	NV	-30	1.86	0.002684	±2.5	PASS
Band71	10MHz	16QAM	133422	50RB#0	NV	-20	0.90	0.001299	±2.5	PASS
Band71	10MHz	16QAM	133422	50RB#0	NV	0	1.34	0.001934	±2.5	PASS
Band71	10MHz	16QAM	133422	50RB#0	NV	10	-2.62	-0.003781	±2.5	PASS
Band71	10MHz	16QAM	133422	50RB#0	NV	20	-2.17	-0.003131	±2.5	PASS
Band71	15MHz	QPSK	133197	75RB#0	NV	-30	1.89	0.002819	±2.5	PASS
Band71	15MHz	QPSK	133197	75RB#0	NV	-20	-2.27	-0.003386	±2.5	PASS
Band71	15MHz	QPSK	133197	75RB#0	NV	0	-2.53	-0.003773	±2.5	PASS
Band71	15MHz	QPSK	133197	75RB#0	NV	10	-1.80	-0.002685	±2.5	PASS
Band71	15MHz	QPSK	133197	75RB#0	NV	20	-1.65	-0.002461	±2.5	PASS
Band71	15MHz	QPSK	133297	75RB#0	NV	-30	-3.69	-0.005422	±2.5	PASS
Band71	15MHz	QPSK	133297	75RB#0	NV	-20	-4.98	-0.007318	±2.5	PASS
Band71	15MHz	QPSK	133297	75RB#0	NV	0	-3.22	-0.004732	±2.5	PASS
Band71	15MHz	QPSK	133297	75RB#0	NV	10	-4.61	-0.006774	±2.5	PASS
Band71	15MHz	QPSK	133297	75RB#0	NV	20	-4.12	-0.006054	±2.5	PASS
Band71	15MHz	QPSK	133397	75RB#0	NV	-30	-1.40	-0.002028	±2.5	PASS
Band71	15MHz	QPSK	133397	75RB#0	NV	-20	1.63	0.002361	±2.5	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band71	15MHz	QPSK	133397	75RB#0	NV	0	-1.59	-0.002303	±2.5	PASS
Band71	15MHz	QPSK	133397	75RB#0	NV	10	1.43	0.002071	±2.5	PASS
Band71	15MHz	QPSK	133397	75RB#0	NV	20	1.19	0.001723	±2.5	PASS
Band71	15MHz	16QAM	133197	75RB#0	NV	-30	-2.66	-0.003967	±2.5	PASS
Band71	15MHz	16QAM	133197	75RB#0	NV	-20	-3.93	-0.005861	±2.5	PASS
Band71	15MHz	16QAM	133197	75RB#0	NV	0	-2.36	-0.003520	±2.5	PASS
Band71	15MHz	16QAM	133197	75RB#0	NV	10	-1.80	-0.002685	±2.5	PASS
Band71	15MHz	16QAM	133197	75RB#0	NV	20	-2.75	-0.004101	±2.5	PASS
Band71	15MHz	16QAM	133297	75RB#0	NV	-30	-4.08	-0.005996	±2.5	PASS
Band71	15MHz	16QAM	133297	75RB#0	NV	-20	-1.85	-0.002719	±2.5	PASS
Band71	15MHz	16QAM	133297	75RB#0	NV	0	-3.92	-0.005760	±2.5	PASS
Band71	15MHz	16QAM	133297	75RB#0	NV	10	-4.15	-0.006098	±2.5	PASS
Band71	15MHz	16QAM	133297	75RB#0	NV	20	-4.69	-0.006892	±2.5	PASS
Band71	15MHz	16QAM	133397	75RB#0	NV	-30	-1.34	-0.001941	±2.5	PASS
Band71	15MHz	16QAM	133397	75RB#0	NV	-20	0.84	0.001217	±2.5	PASS
Band71	15MHz	16QAM	133397	75RB#0	NV	0	2.75	0.003983	±2.5	PASS
Band71	15MHz	16QAM	133397	75RB#0	NV	10	-1.57	-0.002274	±2.5	PASS
Band71	15MHz	16QAM	133397	75RB#0	NV	20	2.59	0.003751	±2.5	PASS
Band71	20MHz	QPSK	133222	100RB#0	NV	-30	-3.40	-0.005052	±2.5	PASS
Band71	20MHz	QPSK	133222	100RB#0	NV	-20	-3.59	-0.005334	±2.5	PASS
Band71	20MHz	QPSK	133222	100RB#0	NV	0	-3.43	-0.005097	±2.5	PASS
Band71	20MHz	QPSK	133222	100RB#0	NV	10	-5.05	-0.007504	±2.5	PASS
Band71	20MHz	QPSK	133222	100RB#0	NV	20	-4.41	-0.006553	±2.5	PASS
Band71	20MHz	QPSK	133322	100RB#0	NV	-30	1.87	0.002738	±2.5	PASS
Band71	20MHz	QPSK	133322	100RB#0	NV	-20	1.62	0.002372	±2.5	PASS
Band71	20MHz	QPSK	133322	100RB#0	NV	0	1.29	0.001889	±2.5	PASS
Band71	20MHz	QPSK	133322	100RB#0	NV	10	-1.42	-0.002079	±2.5	PASS
Band71	20MHz	QPSK	133322	100RB#0	NV	20	1.57	0.002299	±2.5	PASS
Band71	20MHz	QPSK	133372	100RB#0	NV	-30	-3.23	-0.004695	±2.5	PASS
Band71	20MHz	QPSK	133372	100RB#0	NV	-20	-4.22	-0.006134	±2.5	PASS
Band71	20MHz	QPSK	133372	100RB#0	NV	0	-2.12	-0.003081	±2.5	PASS
Band71	20MHz	QPSK	133372	100RB#0	NV	10	-4.03	-0.005858	±2.5	PASS
Band71	20MHz	QPSK	133372	100RB#0	NV	20	-5.19	-0.007544	±2.5	PASS
Band71	20MHz	16QAM	133222	100RB#0	NV	-30	-4.99	-0.007415	±2.5	PASS
Band71	20MHz	16QAM	133222	100RB#0	NV	-20	-3.95	-0.005869	±2.5	PASS
Band71	20MHz	16QAM	133222	100RB#0	NV	0	-4.09	-0.006077	±2.5	PASS
Band71	20MHz	16QAM	133222	100RB#0	NV	10	-4.15	-0.006166	±2.5	PASS
Band71	20MHz	16QAM	133222	100RB#0	NV	20	-4.66	-0.006924	±2.5	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band71	20MHz	16QAM	133322	100RB#0	NV	-30	1.83	0.002679	±2.5	PASS
Band71	20MHz	16QAM	133322	100RB#0	NV	-20	1.52	0.002225	±2.5	PASS
Band71	20MHz	16QAM	133322	100RB#0	NV	0	1.72	0.002518	±2.5	PASS
Band71	20MHz	16QAM	133322	100RB#0	NV	10	1.23	0.001801	±2.5	PASS
Band71	20MHz	16QAM	133322	100RB#0	NV	20	1.43	0.002094	±2.5	PASS
Band71	20MHz	16QAM	133372	100RB#0	NV	-30	-3.18	-0.004622	±2.5	PASS
Band71	20MHz	16QAM	133372	100RB#0	NV	-20	-2.65	-0.003852	±2.5	PASS
Band71	20MHz	16QAM	133372	100RB#0	NV	0	-3.65	-0.005305	±2.5	PASS
Band71	20MHz	16QAM	133372	100RB#0	NV	10	-4.75	-0.006904	±2.5	PASS
Band71	20MHz	16QAM	133372	100RB#0	NV	20	-3.75	-0.005451	±2.5	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd
Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd
Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>