




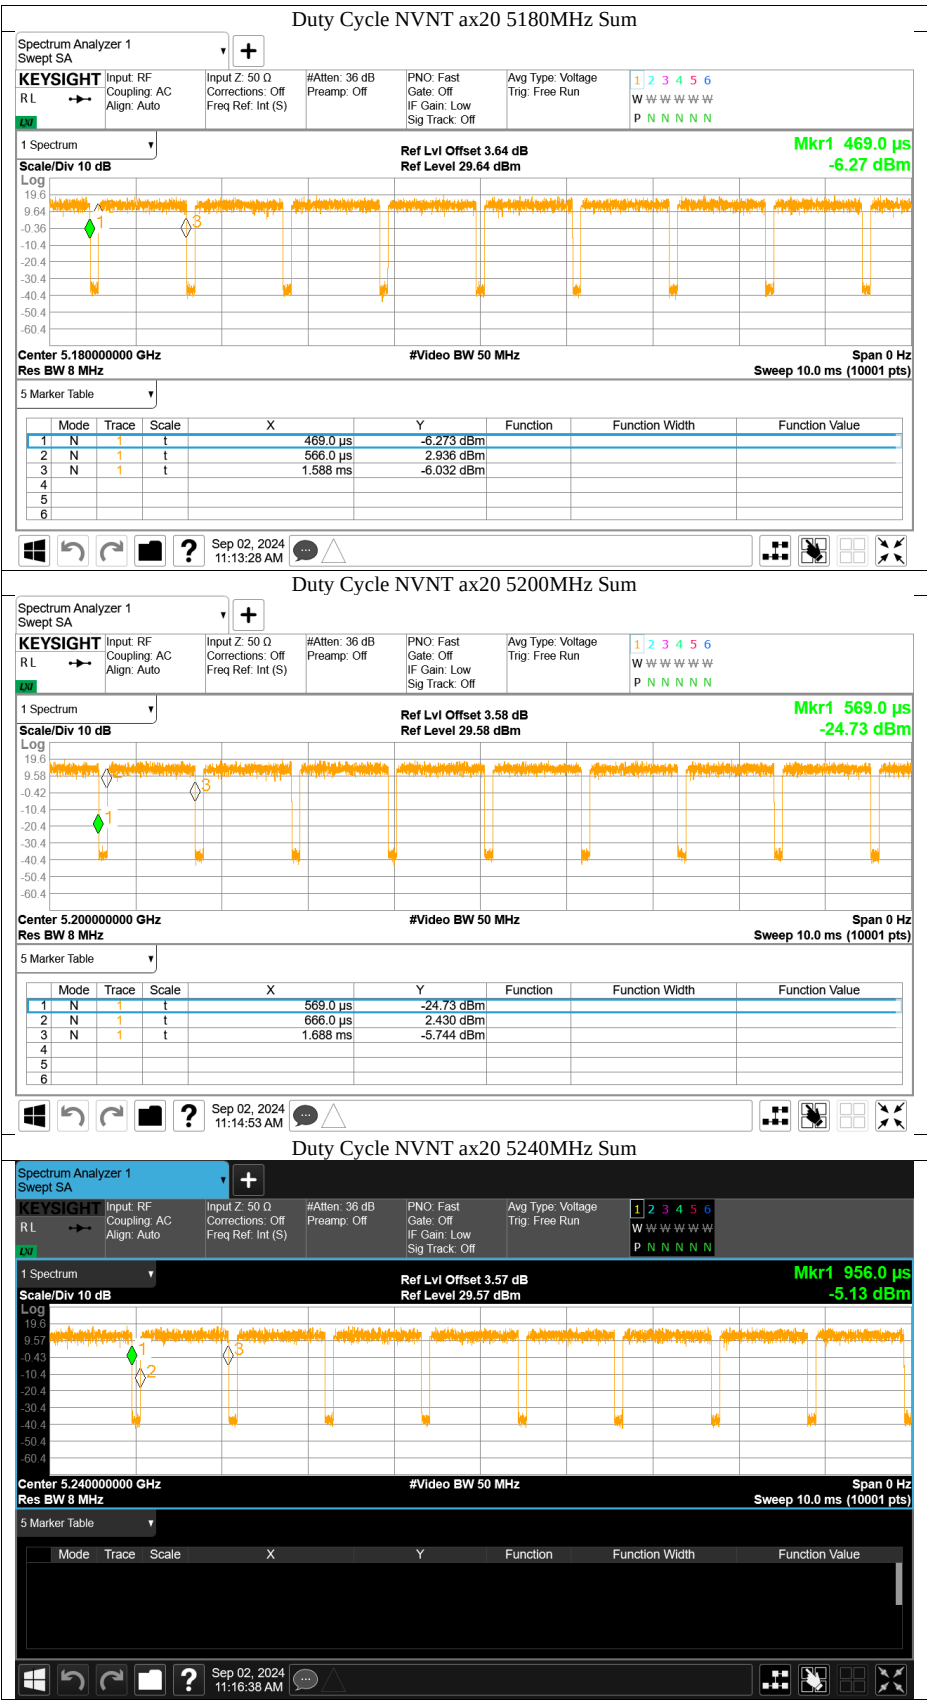
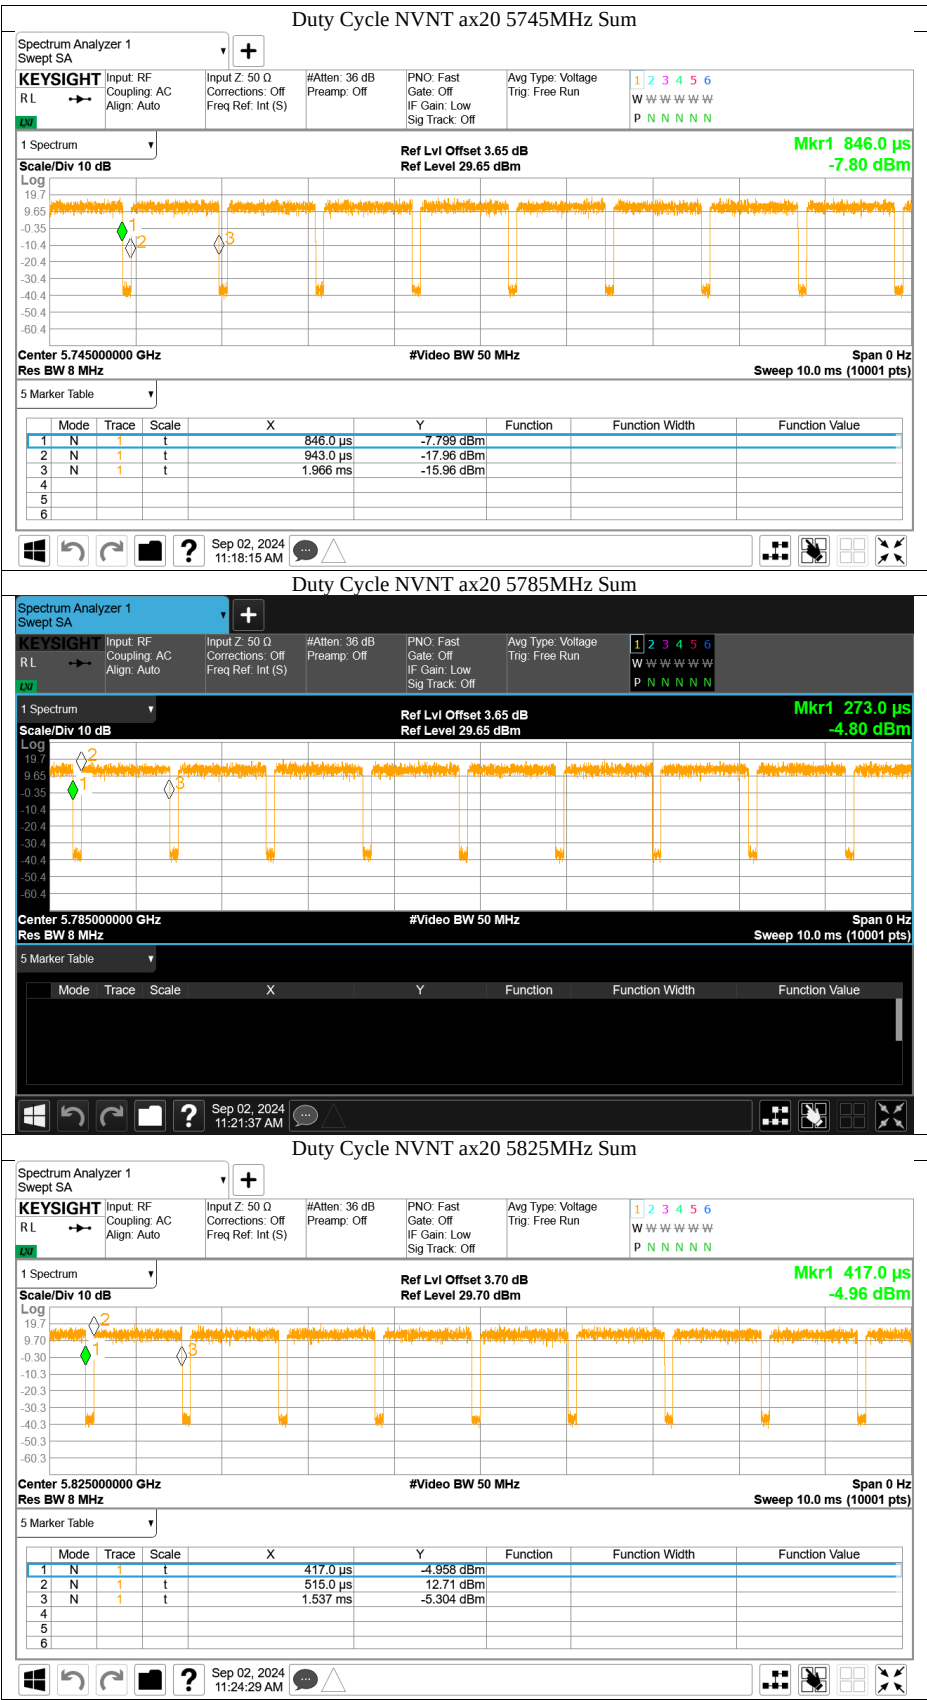


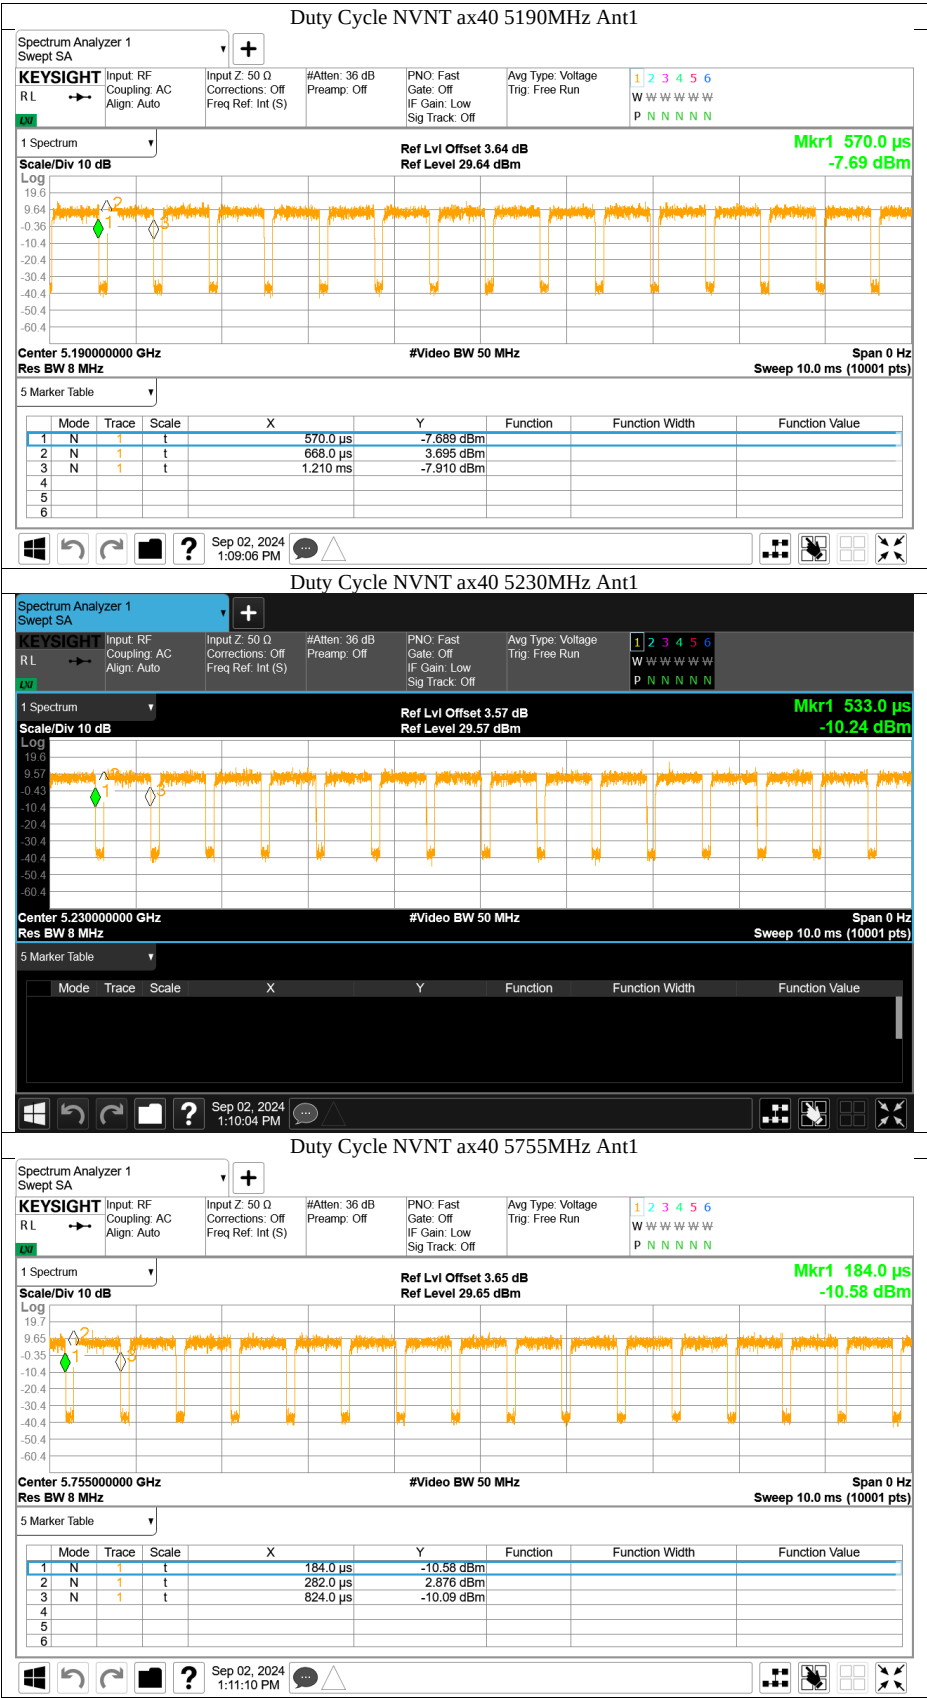




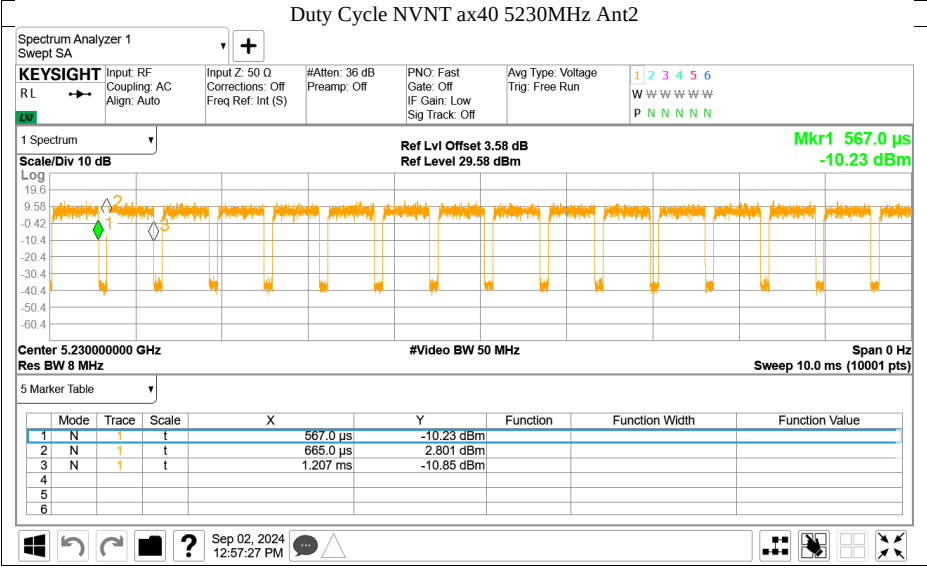


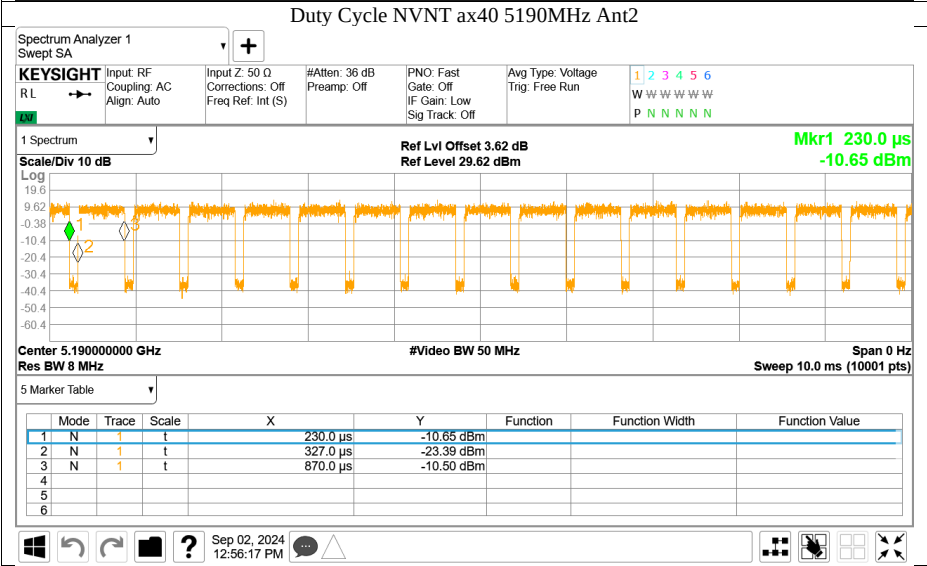


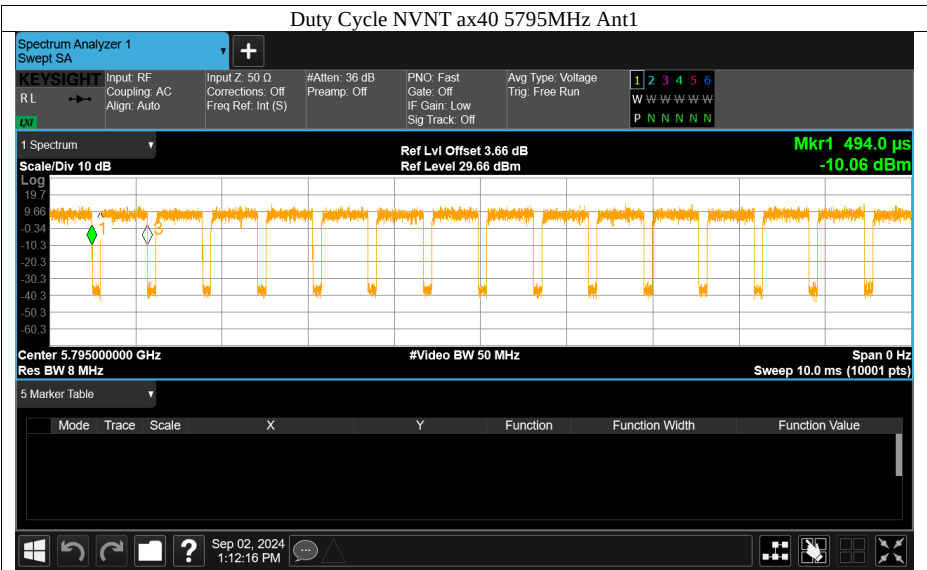

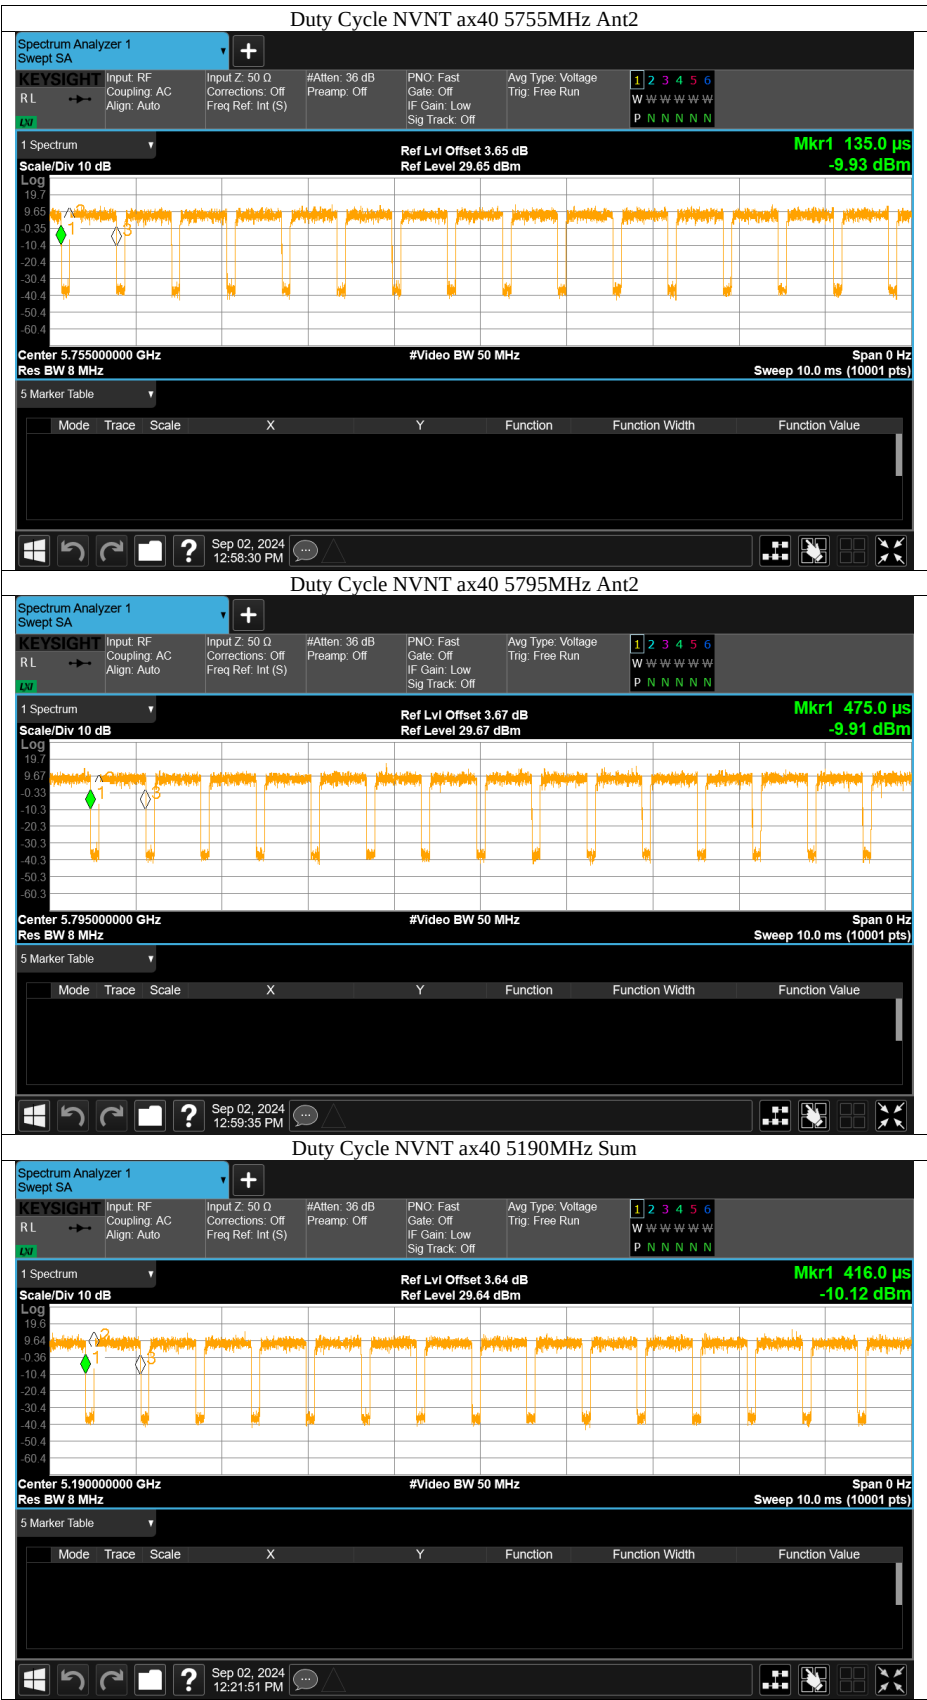

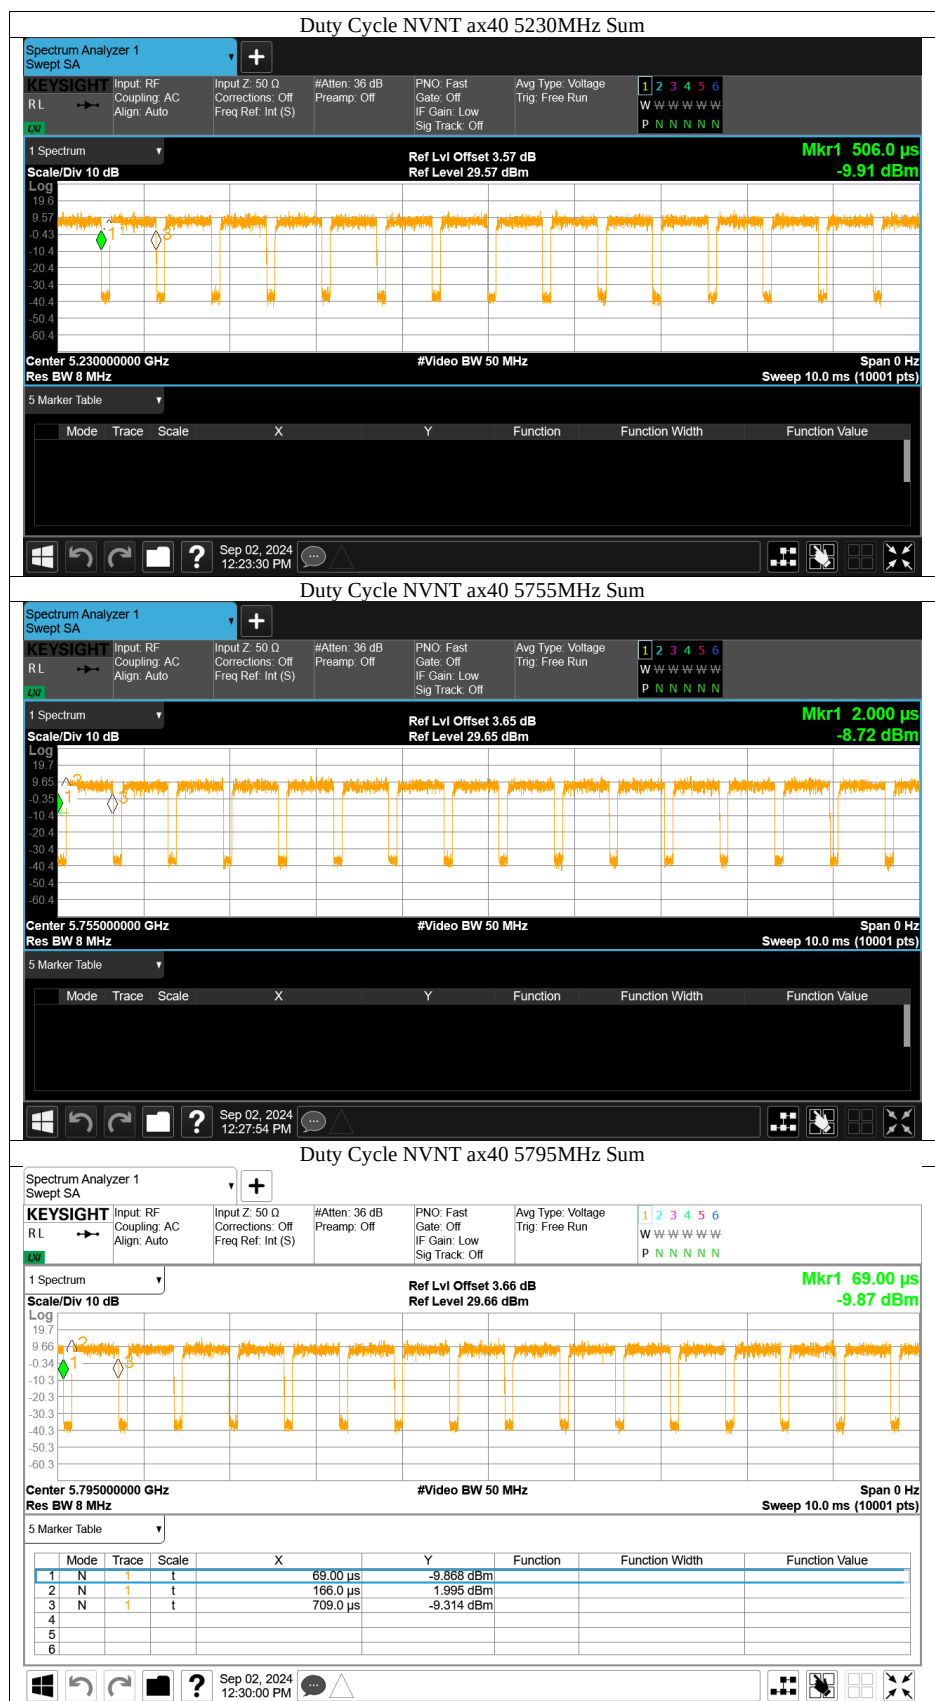

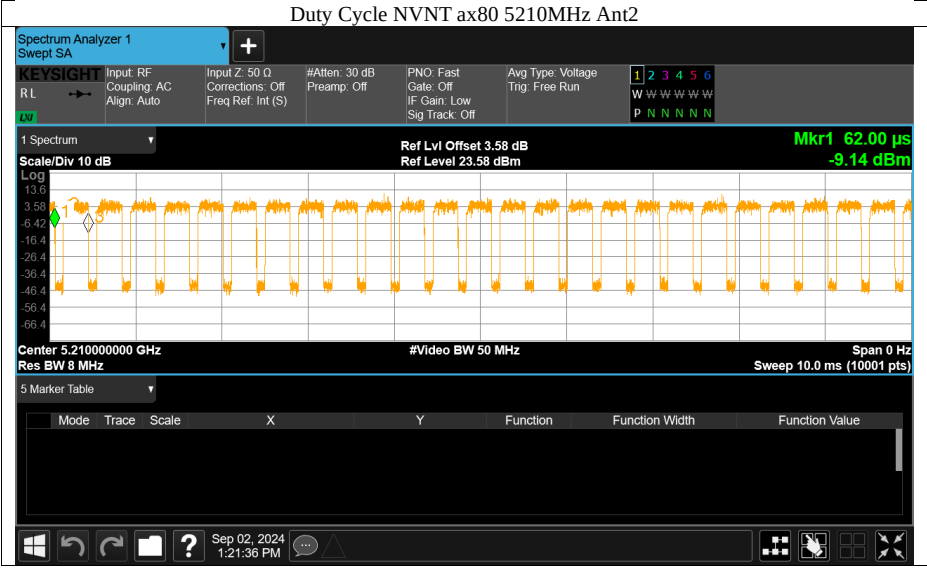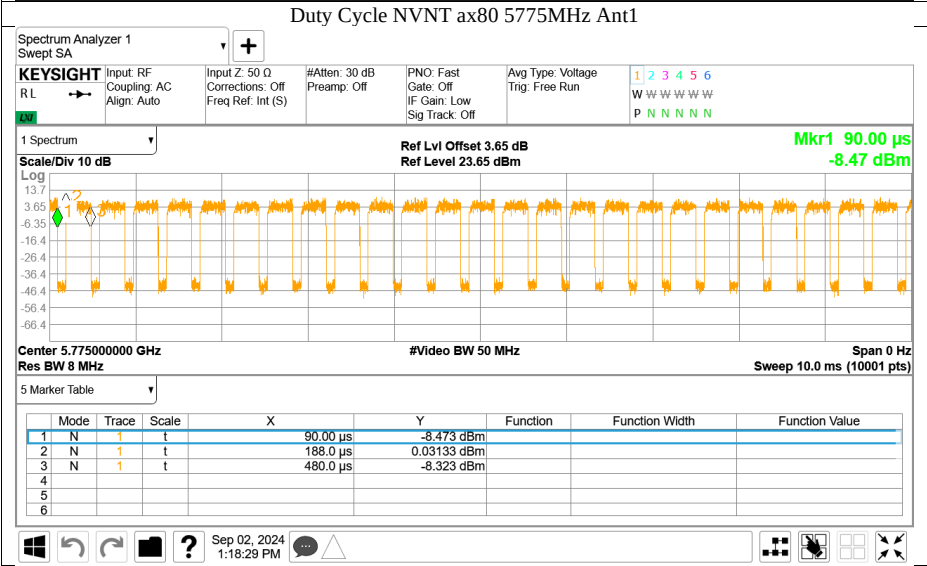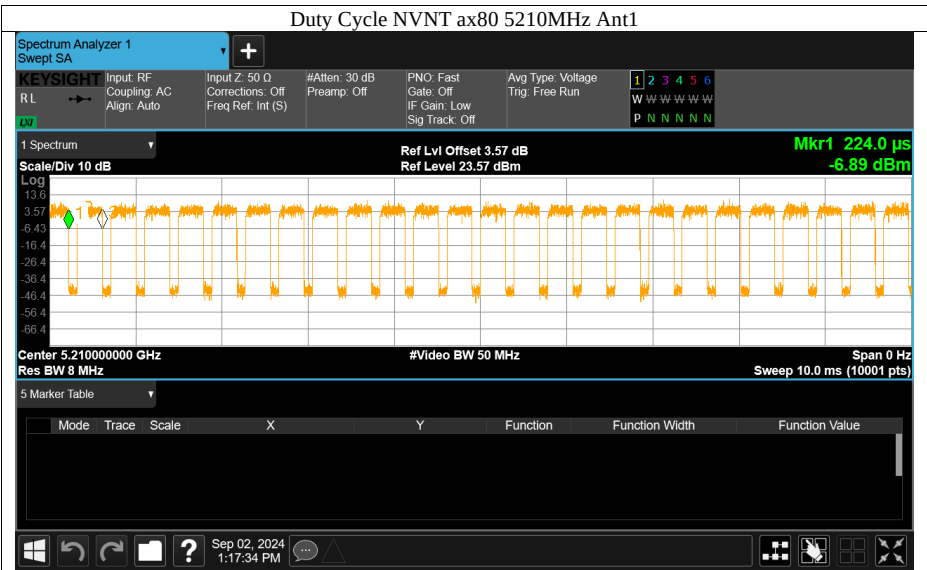

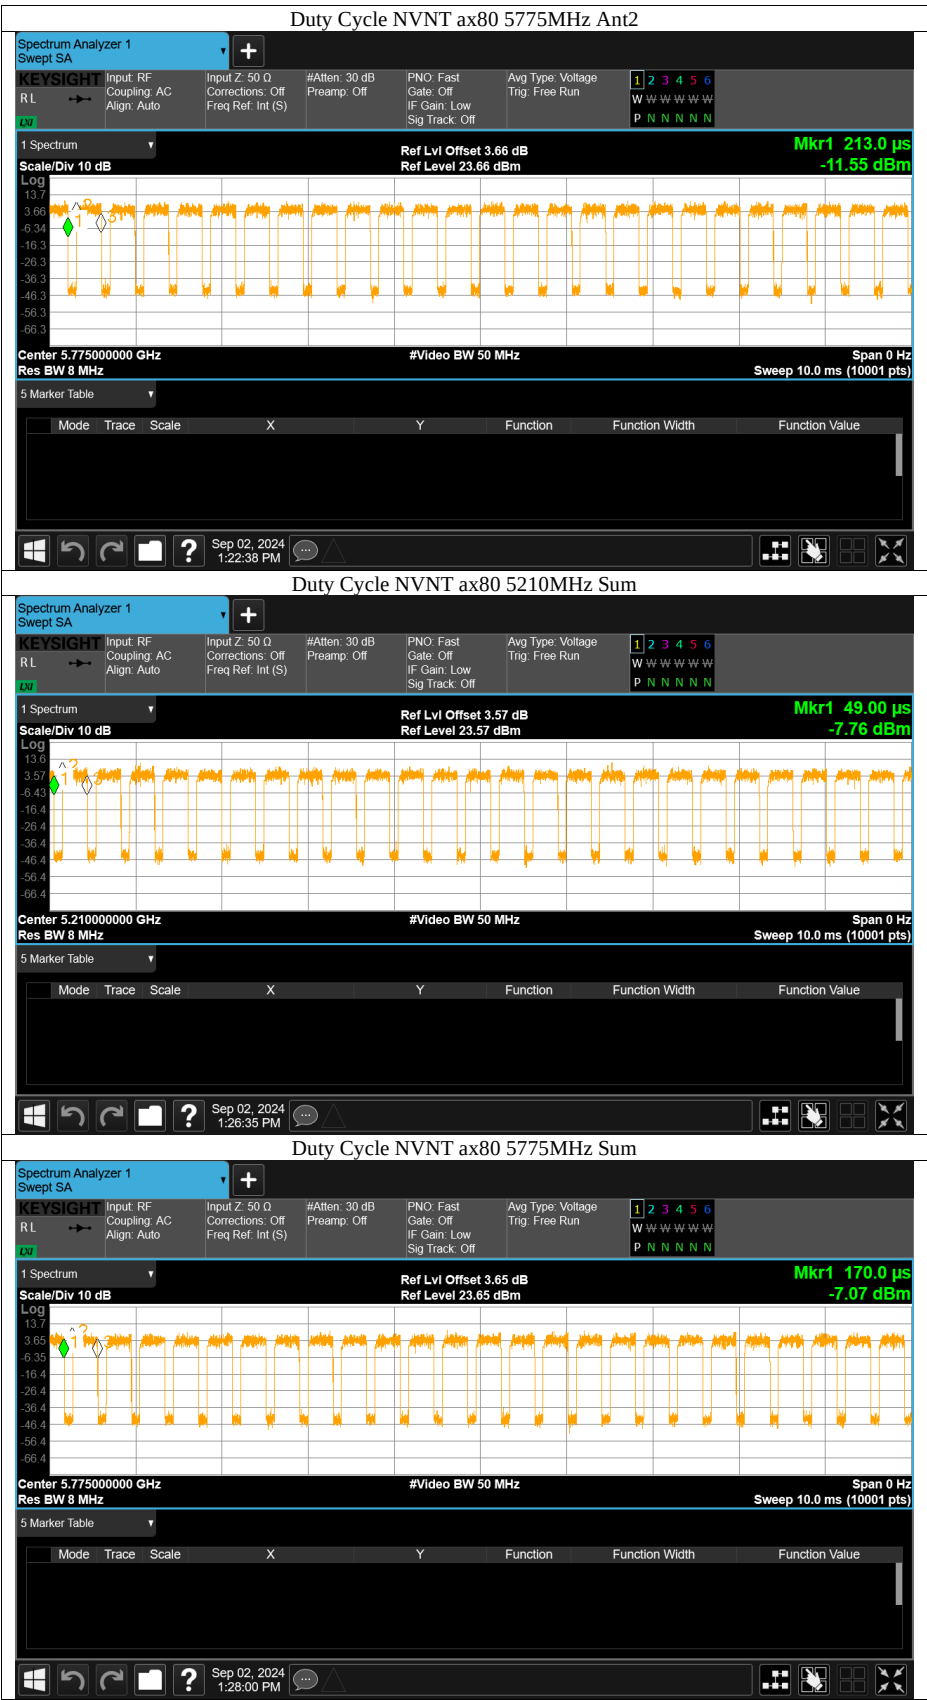



2 Maximum Conducted Output Power

Condition	Mode	Frequency (MHz)	Ant	Conducted Power (dBm)	Duty Factor (dB)	Total Power (dBm)	Gain	E.I.R.P	FCC Limit (dBm)	IC power Limit (dBm)	IC E.I.R.P Limit (dBm)	Verdict
NVNT	a	5180	Ant1	11.15	0.29	11.44	4.26	15.7	24	--	22.2	Pass
NVNT	a	5200	Ant1	11.21	0.29	11.5	4.26	15.76	24	--	22.2	Pass
NVNT	a	5240	Ant1	10.19	0.29	10.48	4.26	14.74	24	--	22.2	Pass
NVNT	a	5745	Ant1	10.09	0.29	10.38	4.26	14.64	30	30	--	Pass
NVNT	a	5785	Ant1	11	0.29	11.29	4.26	15.55	30	30	--	Pass
NVNT	a	5825	Ant1	10.87	0.29	11.16	4.26	15.42	30	30	--	Pass
NVNT	a	5180	Ant2	10.89	0.29	11.18	3.09	14.27	24	--	22.2	Pass
NVNT	a	5200	Ant2	10.67	0.29	10.96	3.09	14.05	24	--	22.2	Pass
NVNT	a	5240	Ant2	10.29	0.29	10.58	3.09	13.67	24	--	22.2	Pass
NVNT	a	5745	Ant2	10.13	0.29	10.42	3.09	13.51	30	30	--	Pass
NVNT	a	5785	Ant2	11.3	0.29	11.59	3.09	14.68	30	30	--	Pass
NVNT	a	5825	Ant2	11.19	0.29	11.48	3.09	14.57	30	30	--	Pass
NVNT	a	5180	Ant1	7.7	0.29	7.99	4.26	12.25	24	--	22.2	Pass
NVNT	a	5180	Ant2	7.93	0.29	8.22	3.09	11.31	24	--	22.2	Pass
NVNT	a	5180	Sum	10.83	0.29	11.12	6.71	17.83	23.29	--	22.2	Pass
NVNT	a	5200	Ant1	7.81	0.29	8.1	4.26	12.36	24	--	22.2	Pass
NVNT	a	5200	Ant2	7.43	0.29	7.72	3.09	10.81	24	--	22.2	Pass
NVNT	a	5200	Sum	10.63	0.29	10.92	6.71	17.63	23.29	--	22.2	Pass
NVNT	a	5240	Ant1	6.79	0.29	7.08	4.26	11.34	24	--	22.2	Pass
NVNT	a	5240	Ant2	7.17	0.29	7.46	3.09	10.55	24	--	22.2	Pass
NVNT	a	5240	Sum	9.99	0.29	10.28	6.71	16.99	23.29	--	22.2	Pass
NVNT	a	5745	Ant1	6.65	0.29	6.94	4.26	11.2	30	30	--	Pass
NVNT	a	5745	Ant2	7.2	0.29	7.49	3.09	10.58	30	30	--	Pass
NVNT	a	5745	Sum	9.94	0.29	10.23	6.71	16.94	30	29.29	--	Pass
NVNT	a	5785	Ant1	7.38	0.29	7.67	4.26	11.93	30	30	--	Pass
NVNT	a	5785	Ant2	7.99	0.29	8.28	3.09	11.37	30	30	--	Pass
NVNT	a	5785	Sum	10.71	0.29	11	6.71	17.71	30	29.29	--	Pass
NVNT	a	5825	Ant1	7.28	0.29	7.57	4.26	11.83	30	30	--	Pass
NVNT	a	5825	Ant2	7.88	0.29	8.17	3.09	11.26	30	30	--	Pass
NVNT	a	5825	Sum	10.6	0.29	10.89	6.71	17.6	30	29.29	--	Pass
NVNT	n20	5180	Ant1	11.23	0.31	11.54	4.26	15.8	24	--	22.2	Pass
NVNT	n20	5200	Ant1	11.05	0.31	11.36	4.26	15.62	24	--	22.2	Pass
NVNT	n20	5240	Ant1	10.19	0.31	10.5	4.26	14.76	24	--	22.2	Pass
NVNT	n20	5745	Ant1	9.89	0.31	10.2	4.26	14.46	30	30	--	Pass
NVNT	n20	5785	Ant1	10.81	0.31	11.12	4.26	15.38	30	30	--	Pass
NVNT	n20	5825	Ant1	10.68	0.31	10.99	4.26	15.25	30	30	--	Pass
NVNT	n20	5180	Ant2	11.05	0.31	11.36	3.09	14.45	24	--	22.2	Pass
NVNT	n20	5200	Ant2	10.68	0.31	10.99	3.09	14.08	24	--	22.2	Pass
NVNT	n20	5240	Ant2	10.12	0.31	10.43	3.09	13.52	24	--	22.2	Pass
NVNT	n20	5745	Ant2	10.23	0.31	10.54	3.09	13.63	30	30	--	Pass
NVNT	n20	5785	Ant2	11.36	0.31	11.67	3.09	14.76	30	30	--	Pass
NVNT	n20	5825	Ant2	11.05	0.31	11.36	3.09	14.45	30	30	--	Pass
NVNT	n20	5180	Ant1	7.72	0.31	8.03	4.26	12.29	24	--	22.2	Pass
NVNT	n20	5180	Ant2	7.78	0.31	8.09	3.09	11.18	24	--	22.2	Pass
NVNT	n20	5180	Sum	10.76	0.31	11.07	6.71	17.78	23.29	--	22.2	Pass
NVNT	n20	5200	Ant1	7.76	0.31	8.07	4.26	12.33	24	--	22.2	Pass
NVNT	n20	5200	Ant2	7.31	0.31	7.62	3.09	10.71	24	--	22.2	Pass
NVNT	n20	5200	Sum	10.55	0.31	10.86	6.71	17.57	23.29	--	22.2	Pass
NVNT	n20	5240	Ant1	6.74	0.31	7.05	4.26	11.31	24	--	22.2	Pass
NVNT	n20	5240	Ant2	7.03	0.31	7.34	3.09	10.43	24	--	22.2	Pass
NVNT	n20	5240	Sum	9.9	0.31	10.21	6.71	16.92	23.29	--	22.2	Pass
NVNT	n20	5745	Ant1	6.52	0.31	6.83	4.26	11.09	30	30	--	Pass
NVNT	n20	5745	Ant2	7.09	0.31	7.4	3.09	10.49	30	30	--	Pass
NVNT	n20	5745	Sum	9.82	0.31	10.13	6.71	16.84	30	29.29	--	Pass
NVNT	n20	5785	Ant1	7.33	0.31	7.64	4.26	11.9	30	30	--	Pass
NVNT	n20	5785	Ant2	7.86	0.31	8.17	3.09	11.26	30	30	--	Pass
NVNT	n20	5785	Sum	10.61	0.31	10.92	6.71	17.63	30	29.29	--	Pass
NVNT	n20	5825	Ant1	7.24	0.31	7.55	4.26	11.81	30	30	--	Pass
NVNT	n20	5825	Ant2	7.88	0.31	8.19	3.09	11.28	30	30	--	Pass
NVNT	n20	5825	Sum	10.58	0.31	10.89	6.71	17.6	30	29.29	--	Pass
NVNT	n40	5190	Ant1	9.28	0.6	9.88	4.26	14.14	24	--	23	Pass
NVNT	n40	5230	Ant1	8.44	0.61	9.05	4.26	13.31	24	--	23	Pass
NVNT	n40	5755	Ant1	8.37	0.61	8.98	4.26	13.24	30	30	--	Pass
NVNT	n40	5795	Ant1	8.75	0.6	9.35	4.26	13.61	30	30	--	Pass



NVNT	n40	5190	Ant2	8.84	0.6	9.44	3.09	12.53	24	--	23	Pass
NVNT	n40	5230	Ant2	8.16	0.61	8.77	3.09	11.86	24	--	23	Pass
NVNT	n40	5755	Ant2	9.01	0.61	9.62	3.09	12.71	30	30	--	Pass
NVNT	n40	5795	Ant2	9.3	0	9.3	3.09	12.39	30	30	--	Pass
NVNT	n40	5190	Ant1	9.26	0.61	9.87	4.26	14.13	24	--	23	Pass
NVNT	n40	5190	Ant2	8.51	0.61	9.12	3.09	12.21	24	--	23	Pass
NVNT	n40	5190	Sum	11.91	0.61	12.52	6.71	19.23	23.29	--	23	Pass
NVNT	n40	5230	Ant1	8.33	0.61	8.94	4.26	13.2	24	--	23	Pass
NVNT	n40	5230	Ant2	7.98	0.61	8.59	3.09	11.68	24	--	23	Pass
NVNT	n40	5230	Sum	11.17	0.61	11.78	6.71	18.49	23.29	--	23	Pass
NVNT	n40	5755	Ant1	8.48	0.61	9.09	4.26	13.35	30	30	--	Pass
NVNT	n40	5755	Ant2	8.8	0.61	9.41	3.09	12.5	30	30	--	Pass
NVNT	n40	5755	Sum	11.65	0.61	12.26	6.71	18.97	30	29.29	--	Pass
NVNT	n40	5795	Ant1	8.73	0.6	9.33	4.26	13.59	30	30	--	Pass
NVNT	n40	5795	Ant2	9.06	0.6	9.66	3.09	12.75	30	30	--	Pass
NVNT	n40	5795	Sum	11.91	0.6	12.51	6.71	19.22	30	29.29	--	Pass
NVNT	ac20	5180	Ant1	11.4	0	11.4	4.26	15.66	24	--	22.2	Pass
NVNT	ac20	5200	Ant1	11.48	0	11.48	4.26	15.74	24	--	22.2	Pass
NVNT	ac20	5240	Ant1	10.44	0	10.44	4.26	14.7	24	--	22.2	Pass
NVNT	ac20	5745	Ant1	10.25	0	10.25	4.26	14.51	30	30	--	Pass
NVNT	ac20	5785	Ant1	11.1	0	11.1	4.26	15.36	30	30	--	Pass
NVNT	ac20	5825	Ant1	10.92	0	10.92	4.26	15.18	30	30	--	Pass
NVNT	ac20	5180	Ant2	11.32	0	11.32	3.09	14.41	24	--	22.2	Pass
NVNT	ac20	5200	Ant2	10.91	0	10.91	3.09	14	24	--	22.2	Pass
NVNT	ac20	5240	Ant2	10.57	0	10.57	3.09	13.66	24	--	22.2	Pass
NVNT	ac20	5745	Ant2	10.4	0	10.4	3.09	13.49	30	30	--	Pass
NVNT	ac20	5785	Ant2	11.49	0	11.49	3.09	14.58	30	30	--	Pass
NVNT	ac20	5825	Ant2	11.36	0	11.36	3.09	14.45	30	30	--	Pass
NVNT	ac20	5180	Ant1	7.93	0	7.93	4.26	12.19	24	--	22.2	Pass
NVNT	ac20	5180	Ant2	8.05	0	8.05	3.09	11.14	24	--	22.2	Pass
NVNT	ac20	5180	Sum	11	0	11	6.71	17.71	23.29	--	22.2	Pass
NVNT	ac20	5200	Ant1	7.88	0	7.88	4.26	12.14	24	--	22.2	Pass
NVNT	ac20	5200	Ant2	7.75	0	7.75	3.09	10.84	24	--	22.2	Pass
NVNT	ac20	5200	Sum	10.83	0	10.83	6.71	17.54	23.29	--	22.2	Pass
NVNT	ac20	5240	Ant1	7.06	0	7.06	4.26	11.32	24	--	22.2	Pass
NVNT	ac20	5240	Ant2	7.33	0	7.33	3.09	10.42	24	--	22.2	Pass
NVNT	ac20	5240	Sum	10.21	0	10.21	6.71	16.92	23.29	--	22.2	Pass
NVNT	ac20	5745	Ant1	6.65	0	6.65	4.26	10.91	30	30	--	Pass
NVNT	ac20	5745	Ant2	7.41	0	7.41	3.09	10.5	30	30	--	Pass
NVNT	ac20	5745	Sum	10.06	0	10.06	6.71	16.77	30	29.29	--	Pass
NVNT	ac20	5785	Ant1	7.59	0	7.59	4.26	11.85	30	30	--	Pass
NVNT	ac20	5785	Ant2	8.11	0	8.11	3.09	11.2	30	30	--	Pass
NVNT	ac20	5785	Sum	10.87	0	10.87	6.71	17.58	30	29.29	--	Pass
NVNT	ac20	5825	Ant1	7.31	0	7.31	4.26	11.57	30	30	--	Pass
NVNT	ac20	5825	Ant2	7.99	0	7.99	3.09	11.08	30	30	--	Pass
NVNT	ac20	5825	Sum	10.67	0	10.67	6.71	17.38	30	29.29	--	Pass
NVNT	ac40	5190	Ant1	9.9	0	9.9	4.26	14.16	24	--	23	Pass
NVNT	ac40	5230	Ant1	9.14	0	9.14	4.26	13.4	24	--	23	Pass
NVNT	ac40	5755	Ant1	9.07	0	9.07	4.26	13.33	30	30	--	Pass
NVNT	ac40	5795	Ant1	9.34	0	9.34	4.26	13.6	30	30	--	Pass
NVNT	ac40	5190	Ant2	9.31	0	9.31	3.09	12.4	24	--	23	Pass
NVNT	ac40	5230	Ant2	8.8	0	8.8	3.09	11.89	24	--	23	Pass
NVNT	ac40	5755	Ant2	9.53	0	9.53	3.09	12.62	30	30	--	Pass
NVNT	ac40	5795	Ant2	9.68	0	9.68	3.09	12.77	30	30	--	Pass
NVNT	ac40	5190	Ant1	9.7	0	9.7	4.26	13.96	24	--	23	Pass
NVNT	ac40	5190	Ant2	9.01	0	9.01	3.09	12.1	24	--	23	Pass
NVNT	ac40	5190	Sum	12.38	0	12.38	6.71	19.09	23.29	--	23	Pass
NVNT	ac40	5230	Ant1	8.98	0	8.98	4.26	13.24	24	--	23	Pass
NVNT	ac40	5230	Ant2	8.51	0	8.51	3.09	11.6	24	--	23	Pass
NVNT	ac40	5230	Sum	11.76	0	11.76	6.71	18.47	23.29	--	23	Pass
NVNT	ac40	5755	Ant1	8.88	0	8.88	4.26	13.14	30	30	--	Pass
NVNT	ac40	5755	Ant2	9.23	0	9.23	3.09	12.32	30	30	--	Pass
NVNT	ac40	5755	Sum	12.07	0	12.07	6.71	18.78	30	29.29	--	Pass
NVNT	ac40	5795	Ant1	9.07	0	9.07	4.26	13.33	30	30	--	Pass
NVNT	ac40	5795	Ant2	9.65	0	9.65	3.09	12.74	30	30	--	Pass
NVNT	ac40	5795	Sum	12.38	0	12.38	6.71	19.09	30	29.29	--	Pass
NVNT	ac80	5210	Ant1	8.55	0	8.55	4.26	12.81	24	--	23	Pass
NVNT	ac80	5775	Ant1	8.61	0.65	9.26	4.26	13.52	30	--	23	Pass
NVNT	ac80	5210	Ant2	8.16	0.66	8.82	3.09	11.91	24	30	--	Pass



NVNT	ac80	5775	Ant2	9.52	0.65	10.17	3.09	13.26	30	30	--	Pass
NVNT	ac80	5210	Ant1	8.62	0.66	9.28	4.26	13.54	24	--	23	Pass
NVNT	ac80	5210	Ant2	8.34	0.66	9	3.09	12.09	24	--	23	Pass
NVNT	ac80	5210	Sum	11.49	0.66	12.15	6.71	18.86	23.29	--	23	Pass
NVNT	ac80	5775	Ant1	8.37	0.66	9.03	4.26	13.29	30	30	--	Pass
NVNT	ac80	5775	Ant2	9.64	0.66	10.3	3.09	13.39	30	30	--	Pass
NVNT	ac80	5775	Sum	12.06	0.66	12.72	6.71	19.43	30	29.29	--	Pass
NVNT	ax20	5180	Ant1	11.22	0.4	11.62	4.26	15.88	24	--	22.2	Pass
NVNT	ax20	5200	Ant1	11.2	0.39	11.59	4.26	15.85	24	--	22.2	Pass
NVNT	ax20	5240	Ant1	10.17	0.39	10.56	4.26	14.82	24	--	22.2	Pass
NVNT	ax20	5745	Ant1	10.14	0.39	10.53	4.26	14.79	30	30	--	Pass
NVNT	ax20	5785	Ant1	11.08	0.4	11.48	4.26	15.74	30	30	--	Pass
NVNT	ax20	5825	Ant1	10.75	0.39	11.14	4.26	15.4	30	30	--	Pass
NVNT	ax20	5180	Ant2	11.2	0.39	11.59	3.09	14.68	24	--	22.2	Pass
NVNT	ax20	5200	Ant2	10.88	0.39	11.27	3.09	14.36	24	--	22.2	Pass
NVNT	ax20	5240	Ant2	10.42	0.41	10.83	3.09	13.92	24	--	22.2	Pass
NVNT	ax20	5745	Ant2	10.22	0.39	10.61	3.09	13.7	30	30	--	Pass
NVNT	ax20	5785	Ant2	11.46	0.4	11.86	3.09	14.95	30	30	--	Pass
NVNT	ax20	5825	Ant2	11.11	0.39	11.5	3.09	14.59	30	30	--	Pass
NVNT	ax20	5180	Ant1	8.12	0	8.12	4.26	12.38	24	--	22.2	Pass
NVNT	ax20	5180	Ant2	8.12	0	8.12	3.09	11.21	24	--	22.2	Pass
NVNT	ax20	5180	Sum	11.13	0	11.13	6.71	17.84	23.29	--	22.2	Pass
NVNT	ax20	5200	Ant1	7.95	0	7.95	4.26	12.21	24	--	22.2	Pass
NVNT	ax20	5200	Ant2	7.82	0	7.82	3.09	10.91	24	--	22.2	Pass
NVNT	ax20	5200	Sum	10.9	0	10.9	6.71	17.61	23.29	--	22.2	Pass
NVNT	ax20	5240	Ant1	7.15	0	7.15	4.26	11.41	24	--	22.2	Pass
NVNT	ax20	5240	Ant2	7.88	0	7.88	3.09	10.97	24	--	22.2	Pass
NVNT	ax20	5240	Sum	10.54	0	10.54	6.71	17.25	23.29	--	22.2	Pass
NVNT	ax20	5745	Ant1	6.92	0	6.92	4.26	11.18	30	30	--	Pass
NVNT	ax20	5745	Ant2	7.57	0	7.57	3.09	10.66	30	30	--	Pass
NVNT	ax20	5745	Sum	10.27	0	10.27	6.71	16.98	30	29.29	--	Pass
NVNT	ax20	5785	Ant1	7.62	0	7.62	4.26	11.88	30	30	--	Pass
NVNT	ax20	5785	Ant2	8.35	0	8.35	3.09	11.44	30	30	--	Pass
NVNT	ax20	5785	Sum	11.01	0	11.01	6.71	17.72	30	29.29	--	Pass
NVNT	ax20	5825	Ant1	7.62	0	7.62	4.26	11.88	30	30	--	Pass
NVNT	ax20	5825	Ant2	8.15	0	8.15	3.09	11.24	30	30	--	Pass
NVNT	ax20	5825	Sum	10.9	0	10.9	6.71	17.61	30	29.29	--	Pass
NVNT	ax40	5190	Ant1	9.45	0.72	10.17	4.26	14.43	24	--	23	Pass
NVNT	ax40	5230	Ant1	8.79	0.71	9.5	4.26	13.76	24	--	23	Pass
NVNT	ax40	5755	Ant1	8.61	0.72	9.33	4.26	13.59	30	30	--	Pass
NVNT	ax40	5795	Ant1	8.83	0.71	9.54	4.26	13.8	30	30	--	Pass
NVNT	ax40	5190	Ant2	9.06	0.71	9.77	3.09	12.86	24	--	23	Pass
NVNT	ax40	5230	Ant2	8.43	0.72	9.15	3.09	12.24	24	--	23	Pass
NVNT	ax40	5755	Ant2	9.02	0.71	9.73	3.09	12.82	30	30	--	Pass
NVNT	ax40	5795	Ant2	9.11	0.71	9.82	3.09	12.91	30	30	--	Pass
NVNT	ax40	5190	Ant1	9.42	0.72	10.14	4.26	14.4	24	--	23	Pass
NVNT	ax40	5190	Ant2	8.66	0.72	9.38	3.09	12.47	24	--	23	Pass
NVNT	ax40	5190	Sum	12.07	0.72	12.79	6.71	19.5	23.29	--	23	Pass
NVNT	ax40	5230	Ant1	8.75	0.71	9.46	4.26	13.72	24	--	23	Pass
NVNT	ax40	5230	Ant2	8.21	0.71	8.92	3.09	12.01	24	--	23	Pass
NVNT	ax40	5230	Sum	11.5	0.71	12.21	6.71	18.92	23.29	--	23	Pass
NVNT	ax40	5755	Ant1	8.63	0.71	9.34	4.26	13.6	30	30	--	Pass
NVNT	ax40	5755	Ant2	8.96	0.71	9.67	3.09	12.76	30	30	--	Pass
NVNT	ax40	5755	Sum	11.81	0.71	12.52	6.71	19.23	30	29.29	--	Pass
NVNT	ax40	5795	Ant1	8.87	0.71	9.58	4.26	13.84	30	30	--	Pass
NVNT	ax40	5795	Ant2	9.27	0.71	9.98	3.09	13.07	30	30	--	Pass
NVNT	ax40	5795	Sum	12.08	0.71	12.79	6.71	19.5	30	29.29	--	Pass
NVNT	ax80	5210	Ant1	8.36	1.24	9.6	4.26	13.86	24	--	23	Pass
NVNT	ax80	5775	Ant1	8.21	1.26	9.47	4.26	13.73	30	--	23	Pass
NVNT	ax80	5210	Ant2	8.02	1.24	9.26	3.09	12.35	24	30	--	Pass
NVNT	ax80	5775	Ant2	9.07	1.25	10.32	3.09	13.41	30	30	--	Pass
NVNT	ax80	5210	Ant1	8.1	1.26	9.36	4.26	13.62	24	--	23	Pass
NVNT	ax80	5210	Ant2	8.09	1.26	9.35	3.09	12.44	24	--	23	Pass
NVNT	ax80	5210	Sum	11.11	1.26	12.37	6.71	19.08	23.29	--	23	Pass
NVNT	ax80	5775	Ant1	8.13	1.26	9.39	4.26	13.65	30	30	--	Pass
NVNT	ax80	5775	Ant2	9.2	1.26	10.46	3.09	13.55	30	30	--	Pass
NVNT	ax80	5775	Sum	11.71	1.26	12.97	6.71	19.68	30	29.29	--	Pass

