






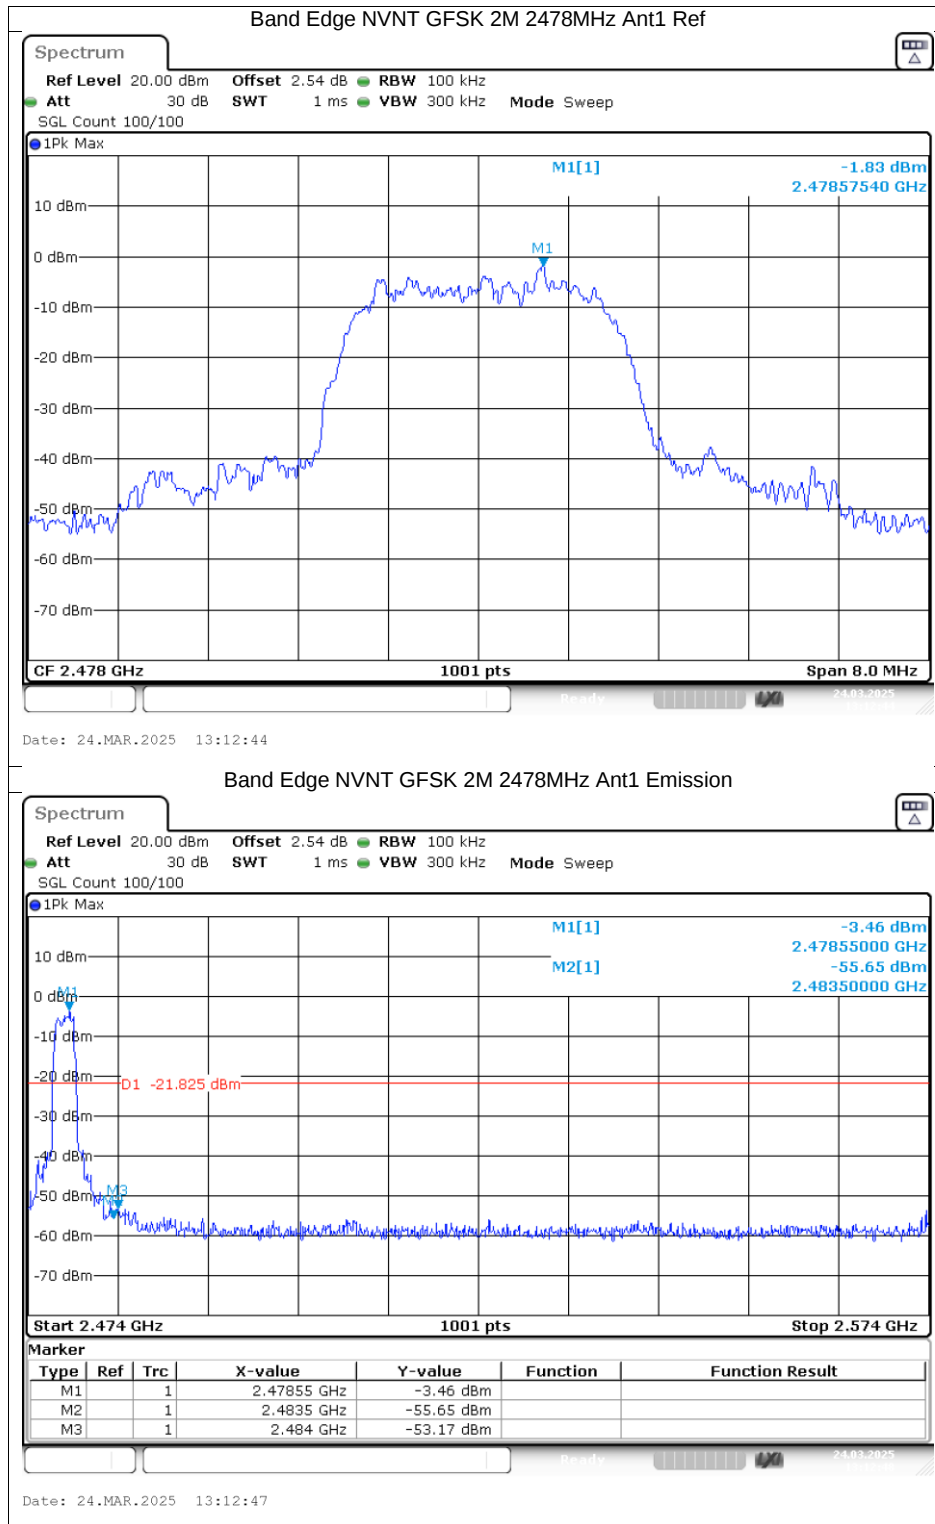


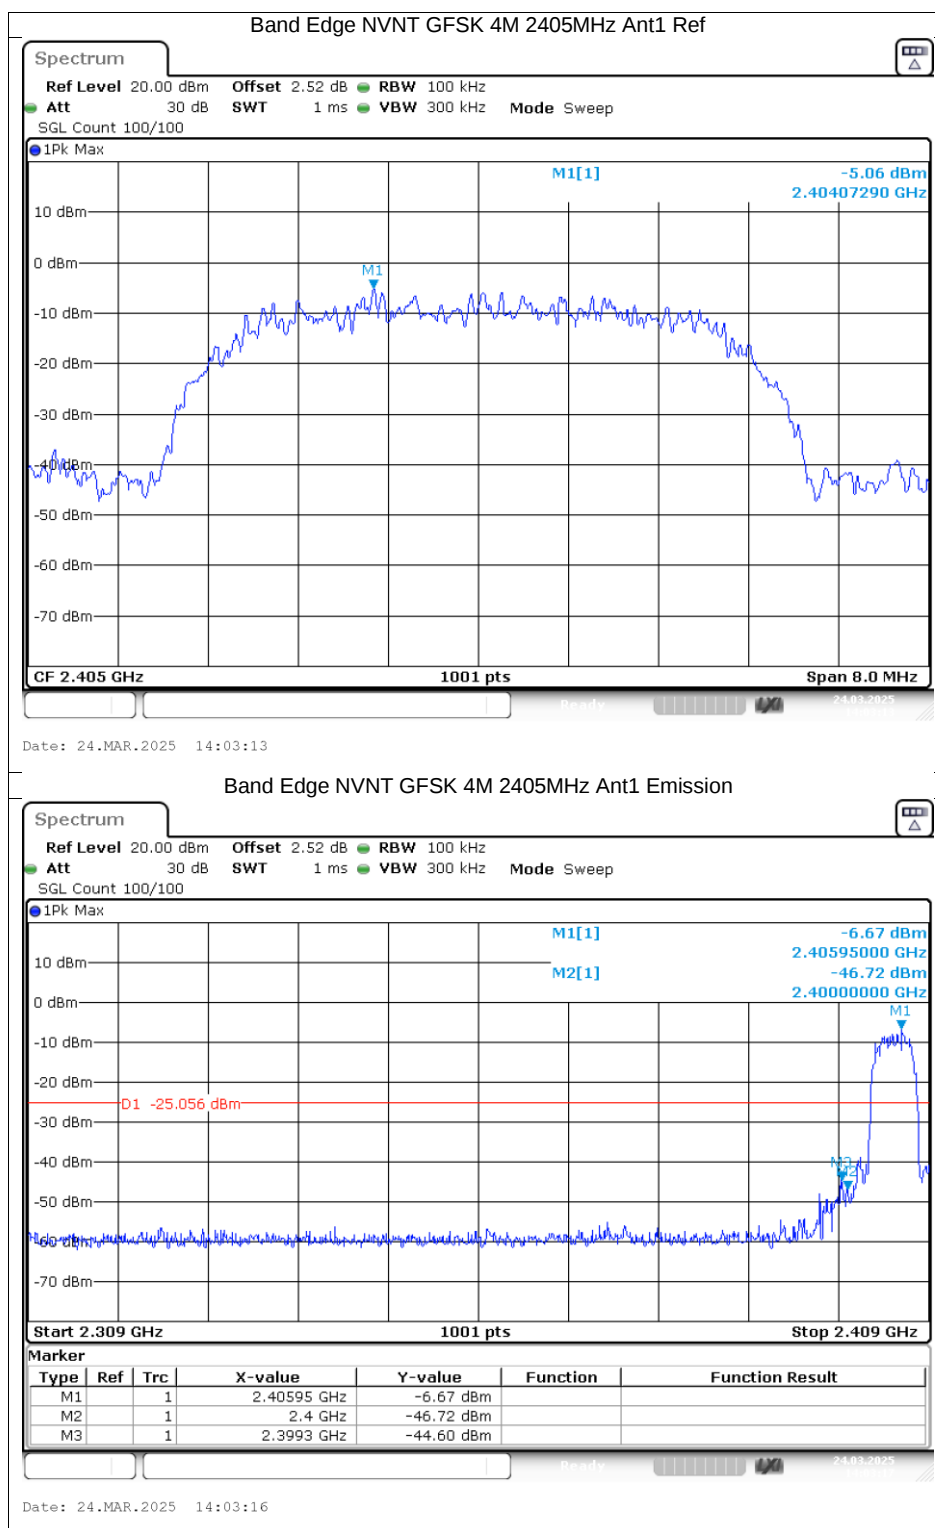


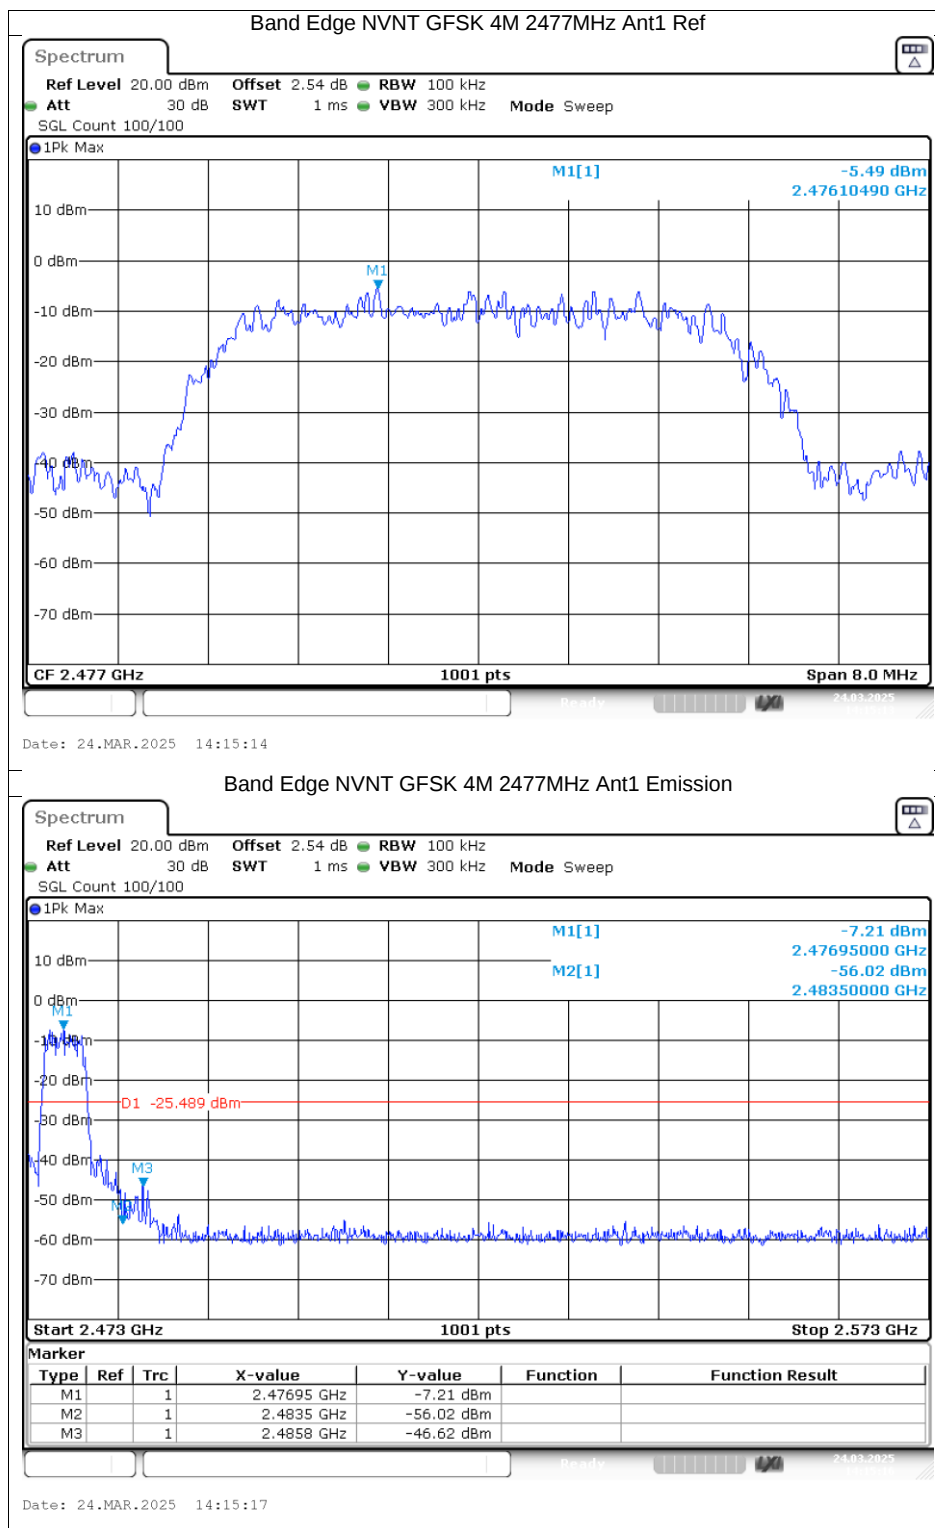


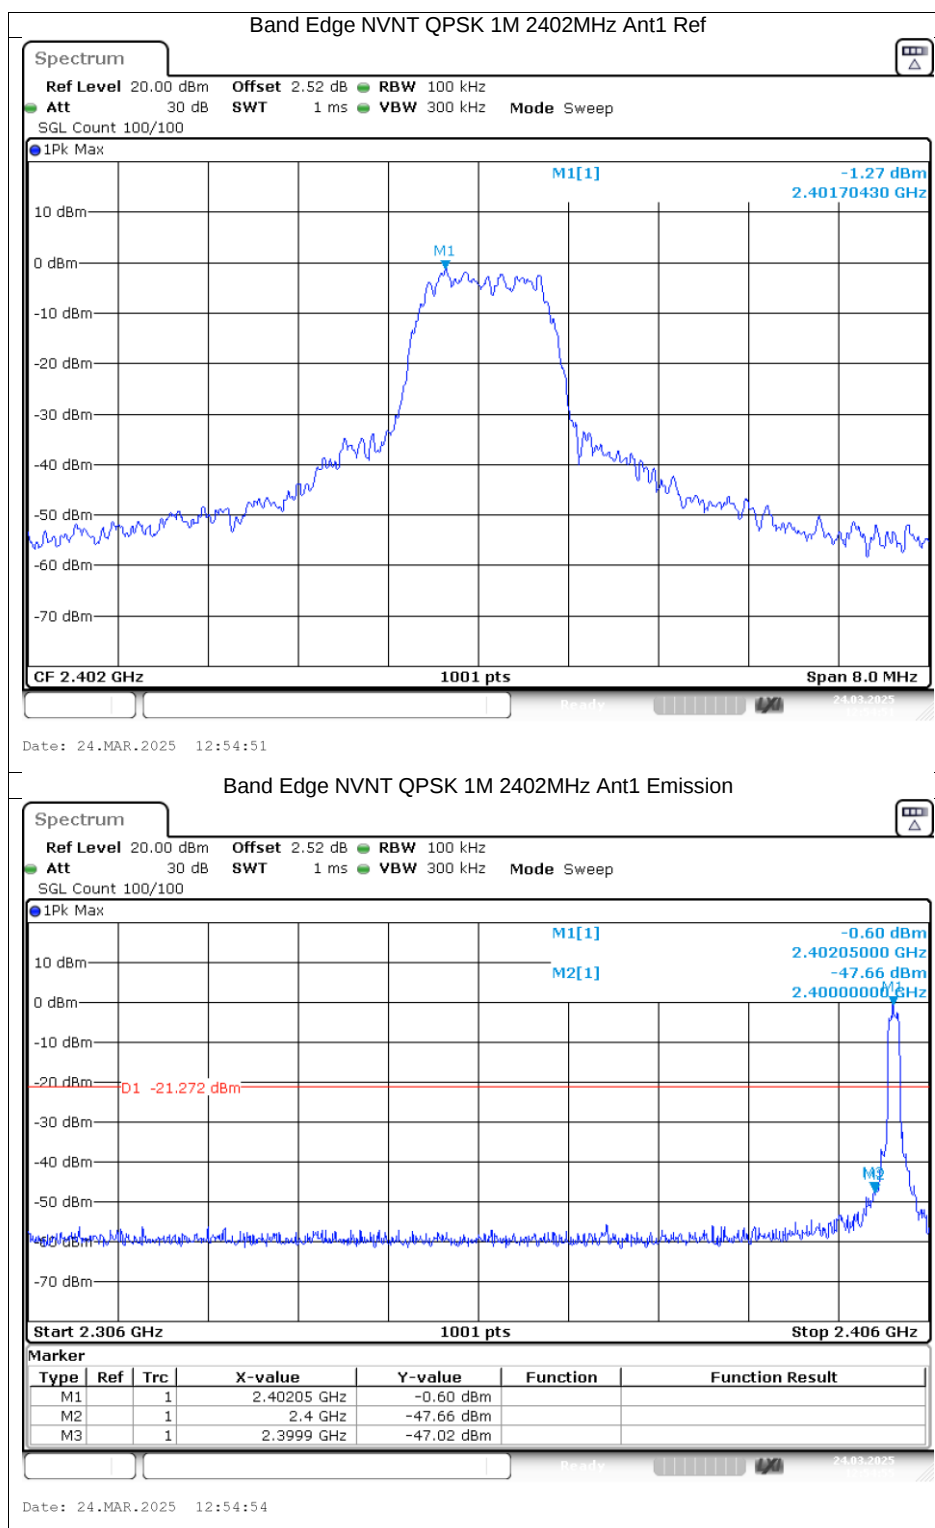


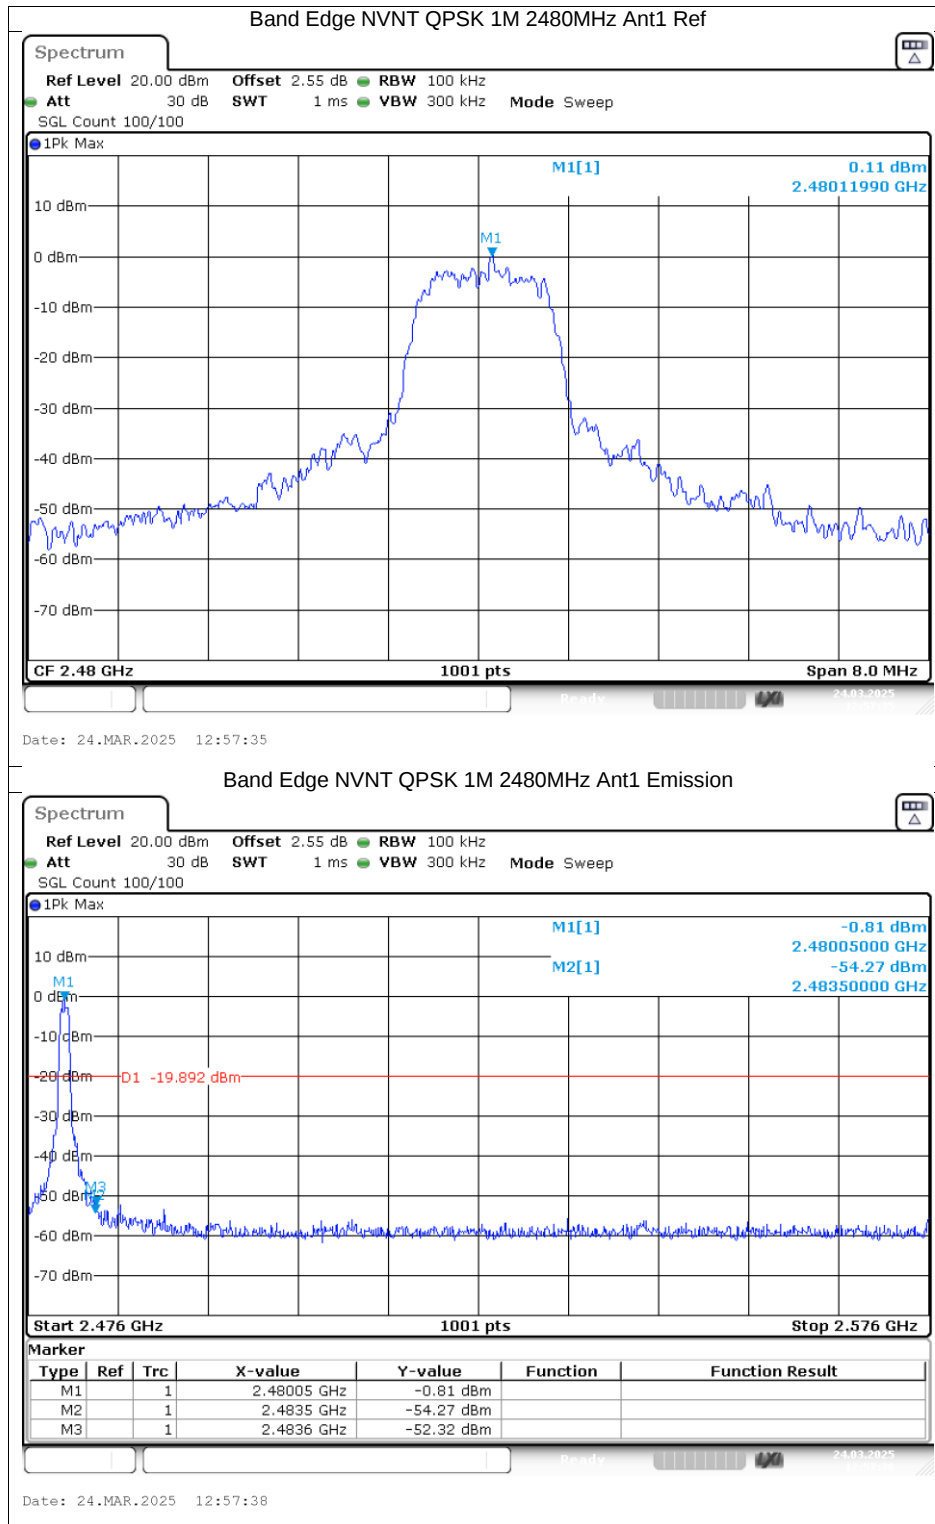

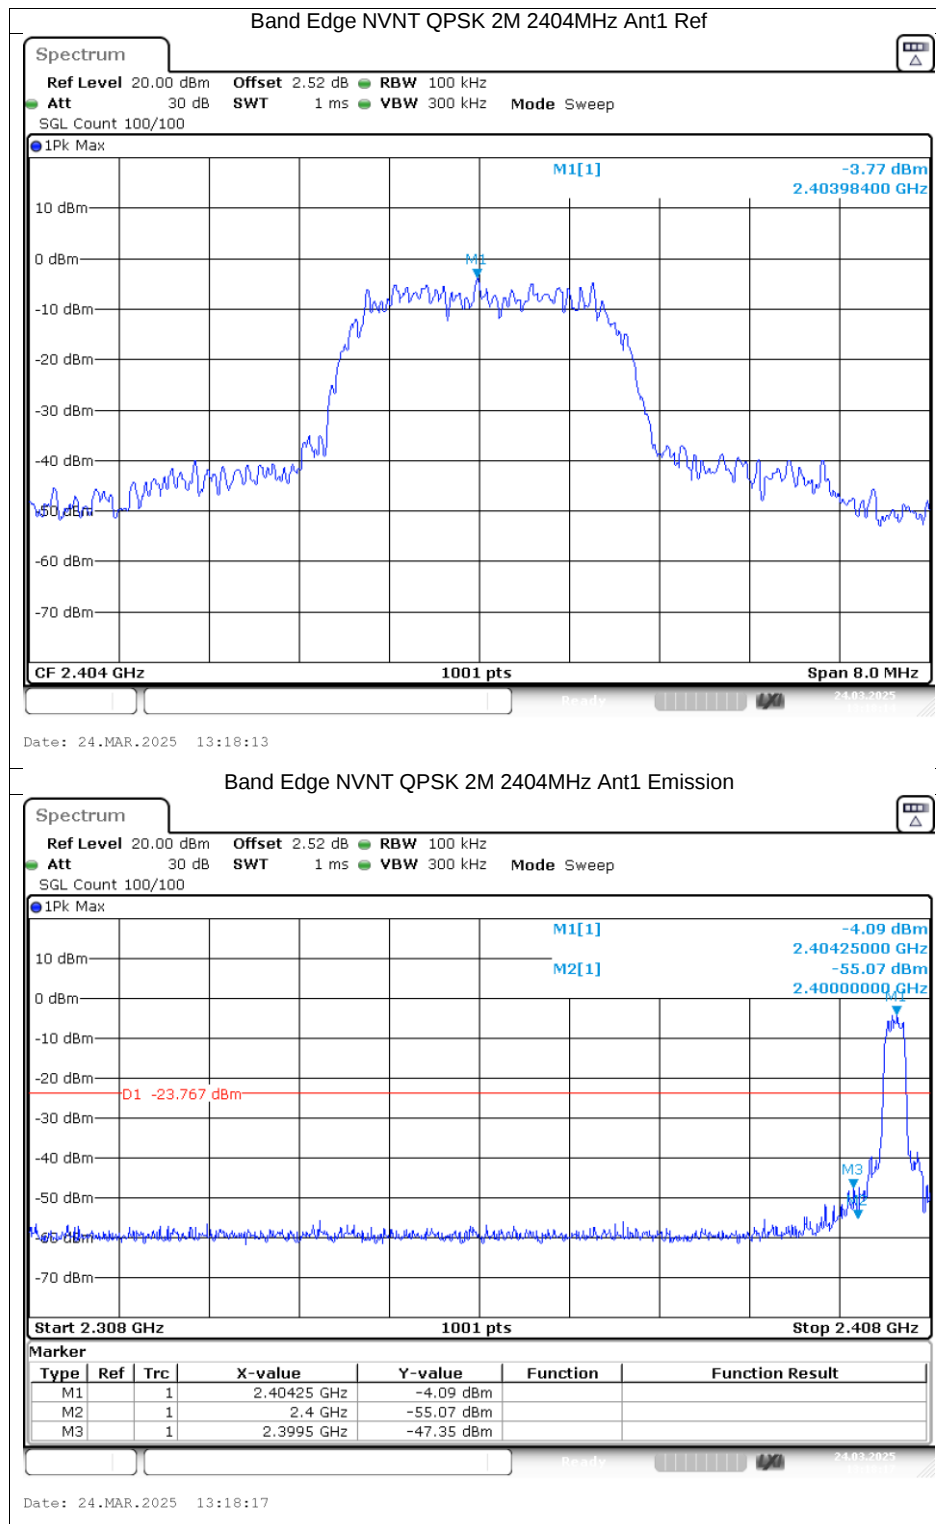

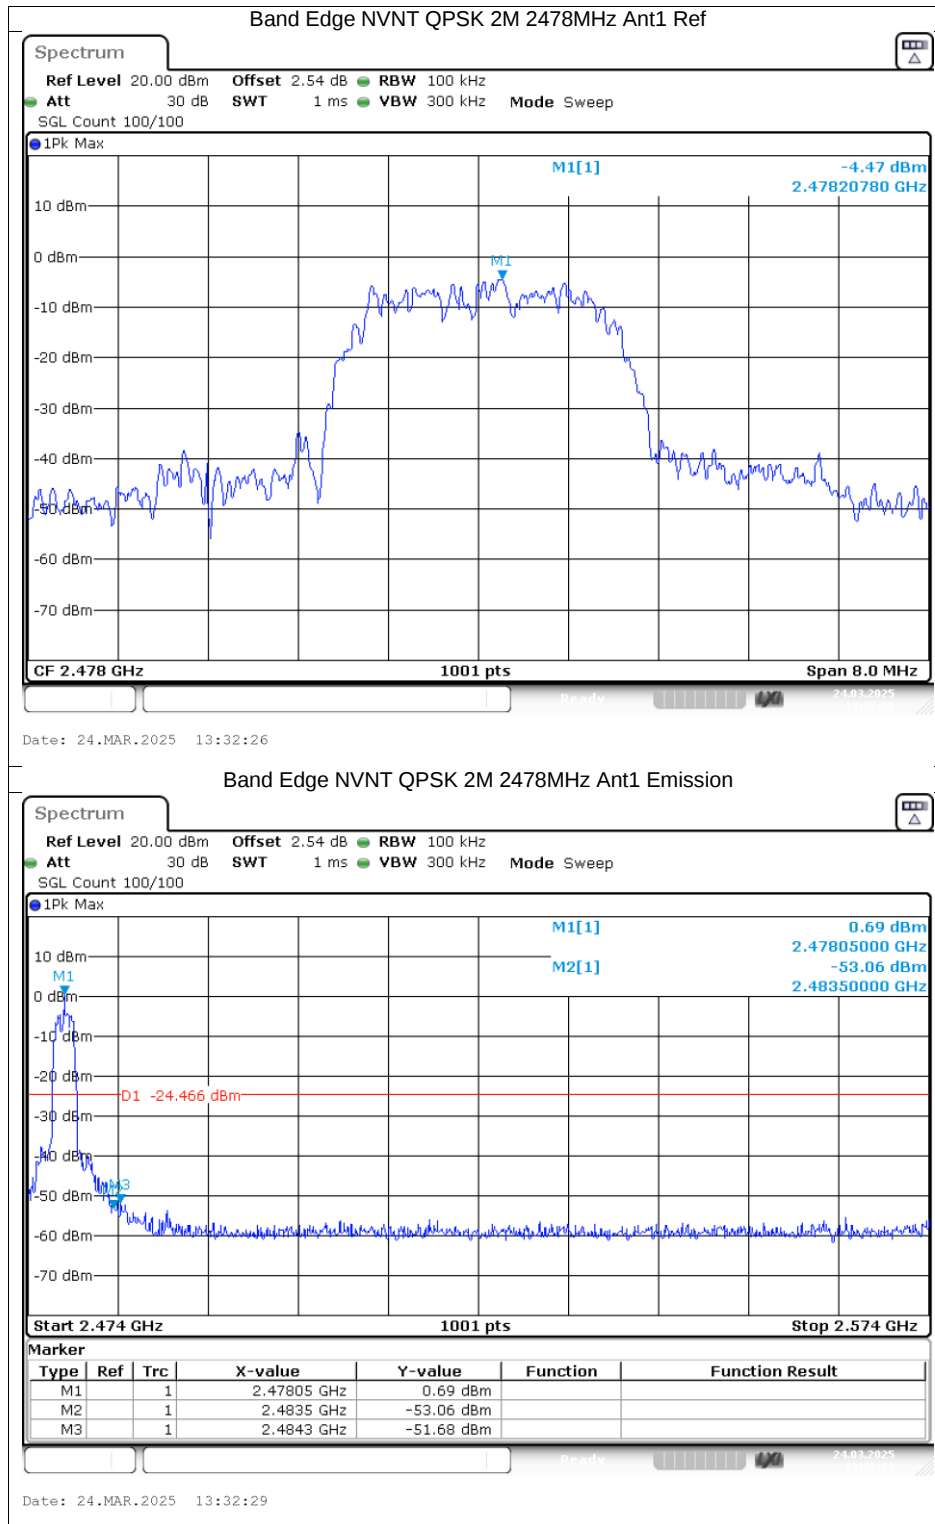


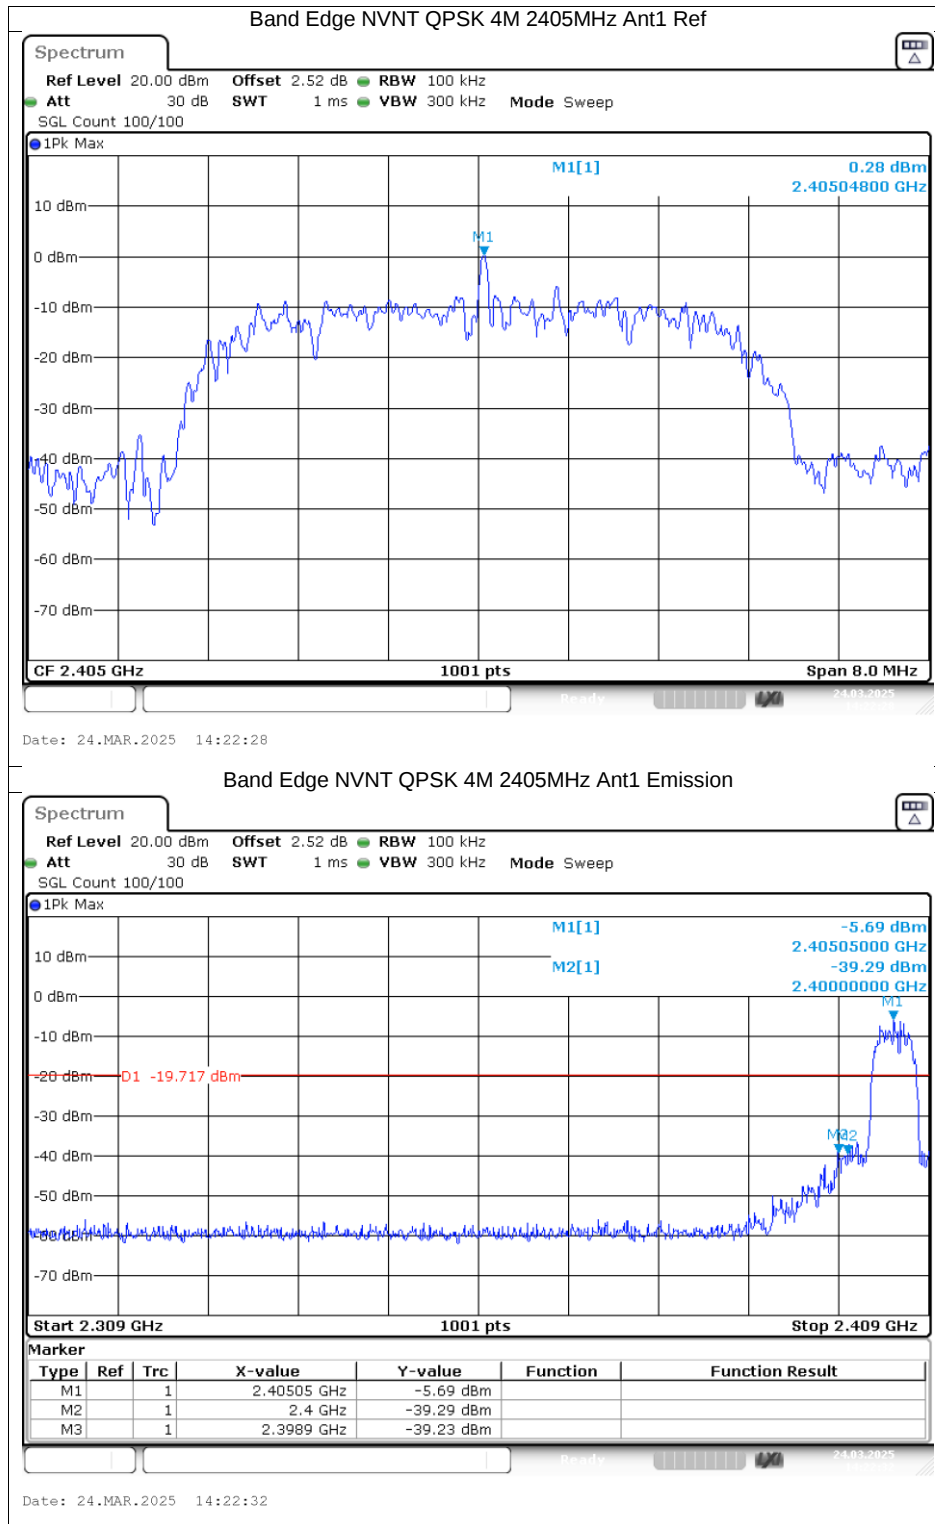


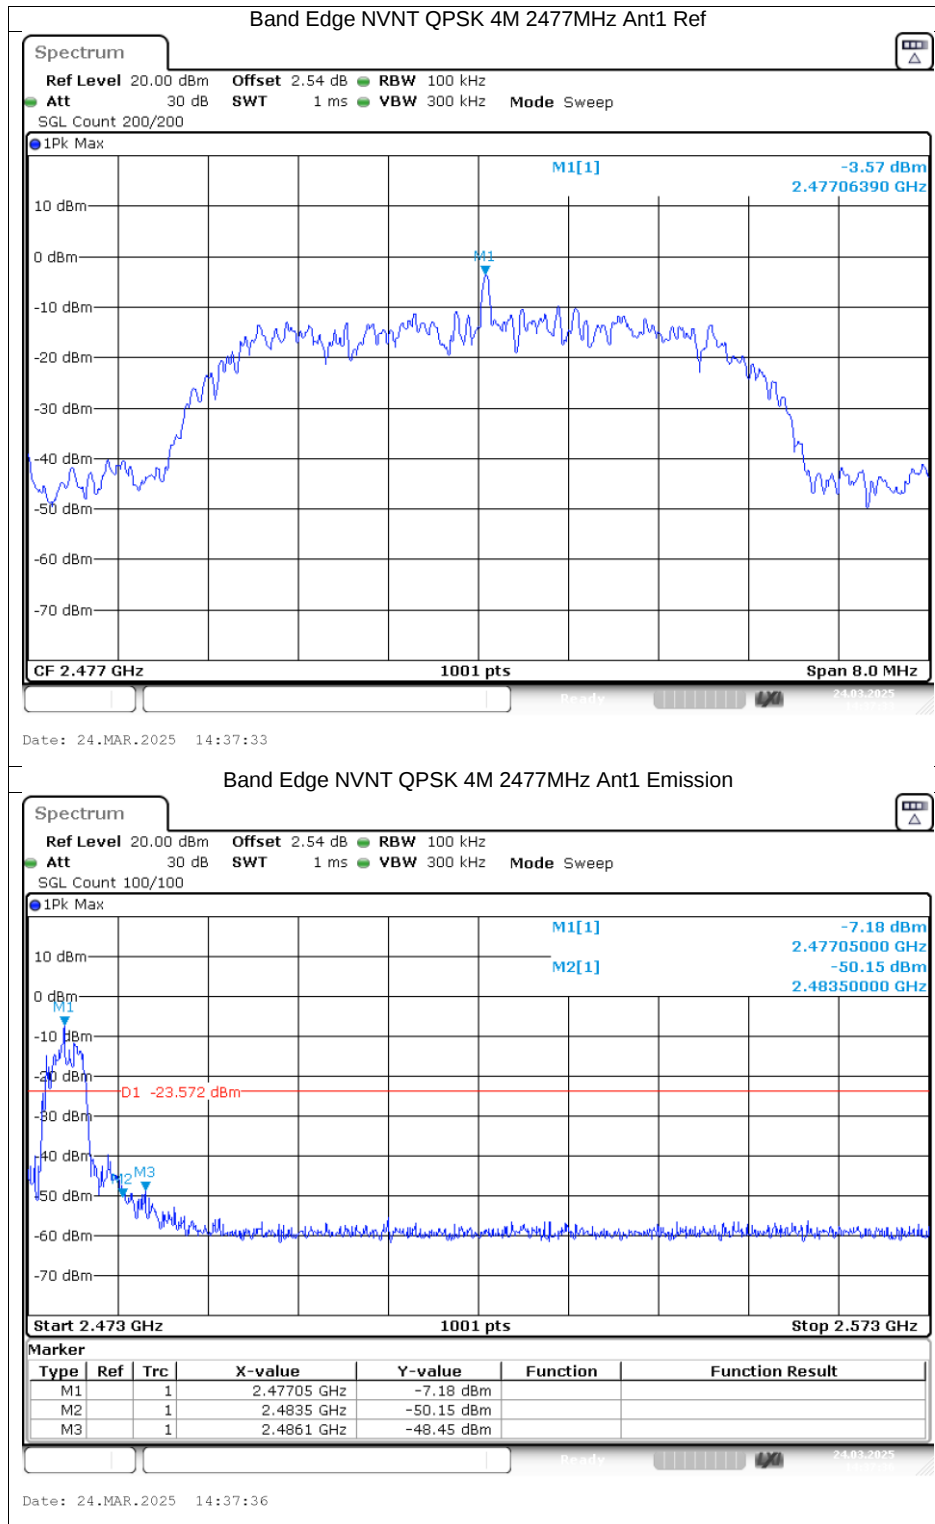



Conducted RF Spurious Emission


Condition	Mode	Frequency (MHz)	Antenna	Max Value (dBc)	Limit (dBc)	Verdict
NVNT	8PSK 1M	2402	Ant1	-46.82	-20	Pass
NVNT	8PSK 1M	2441	Ant1	-49.21	-20	Pass
NVNT	8PSK 1M	2480	Ant1	-48.01	-20	Pass
NVNT	8PSK 2M	2404	Ant1	-46.16	-20	Pass
NVNT	8PSK 2M	2440	Ant1	-50.67	-20	Pass
NVNT	8PSK 2M	2478	Ant1	-44.94	-20	Pass
NVNT	8PSK 4M	2405	Ant1	-43.02	-20	Pass
NVNT	8PSK 4M	2441	Ant1	-46.46	-20	Pass
NVNT	8PSK 4M	2477	Ant1	-42.93	-20	Pass
NVNT	GFSK 1M	2402	Ant1	-46.58	-20	Pass
NVNT	GFSK 1M	2441	Ant1	-46.02	-20	Pass
NVNT	GFSK 1M	2480	Ant1	-45.79	-20	Pass
NVNT	GFSK 2M	2404	Ant1	-44.67	-20	Pass
NVNT	GFSK 2M	2440	Ant1	-45.6	-20	Pass
NVNT	GFSK 2M	2478	Ant1	-46.06	-20	Pass
NVNT	GFSK 4M	2405	Ant1	-39.68	-20	Pass
NVNT	GFSK 4M	2441	Ant1	-47.52	-20	Pass
NVNT	GFSK 4M	2477	Ant1	-43.06	-20	Pass
NVNT	QPSK 1M	2402	Ant1	-47.52	-20	Pass
NVNT	QPSK 1M	2441	Ant1	-51.02	-20	Pass
NVNT	QPSK 1M	2480	Ant1	-48.7	-20	Pass
NVNT	QPSK 2M	2404	Ant1	-50.21	-20	Pass
NVNT	QPSK 2M	2440	Ant1	-48.4	-20	Pass
NVNT	QPSK 2M	2478	Ant1	-50.4	-20	Pass
NVNT	QPSK 4M	2405	Ant1	-44.88	-20	Pass
NVNT	QPSK 4M	2441	Ant1	-50.49	-20	Pass
NVNT	QPSK 4M	2477	Ant1	-41.2	-20	Pass

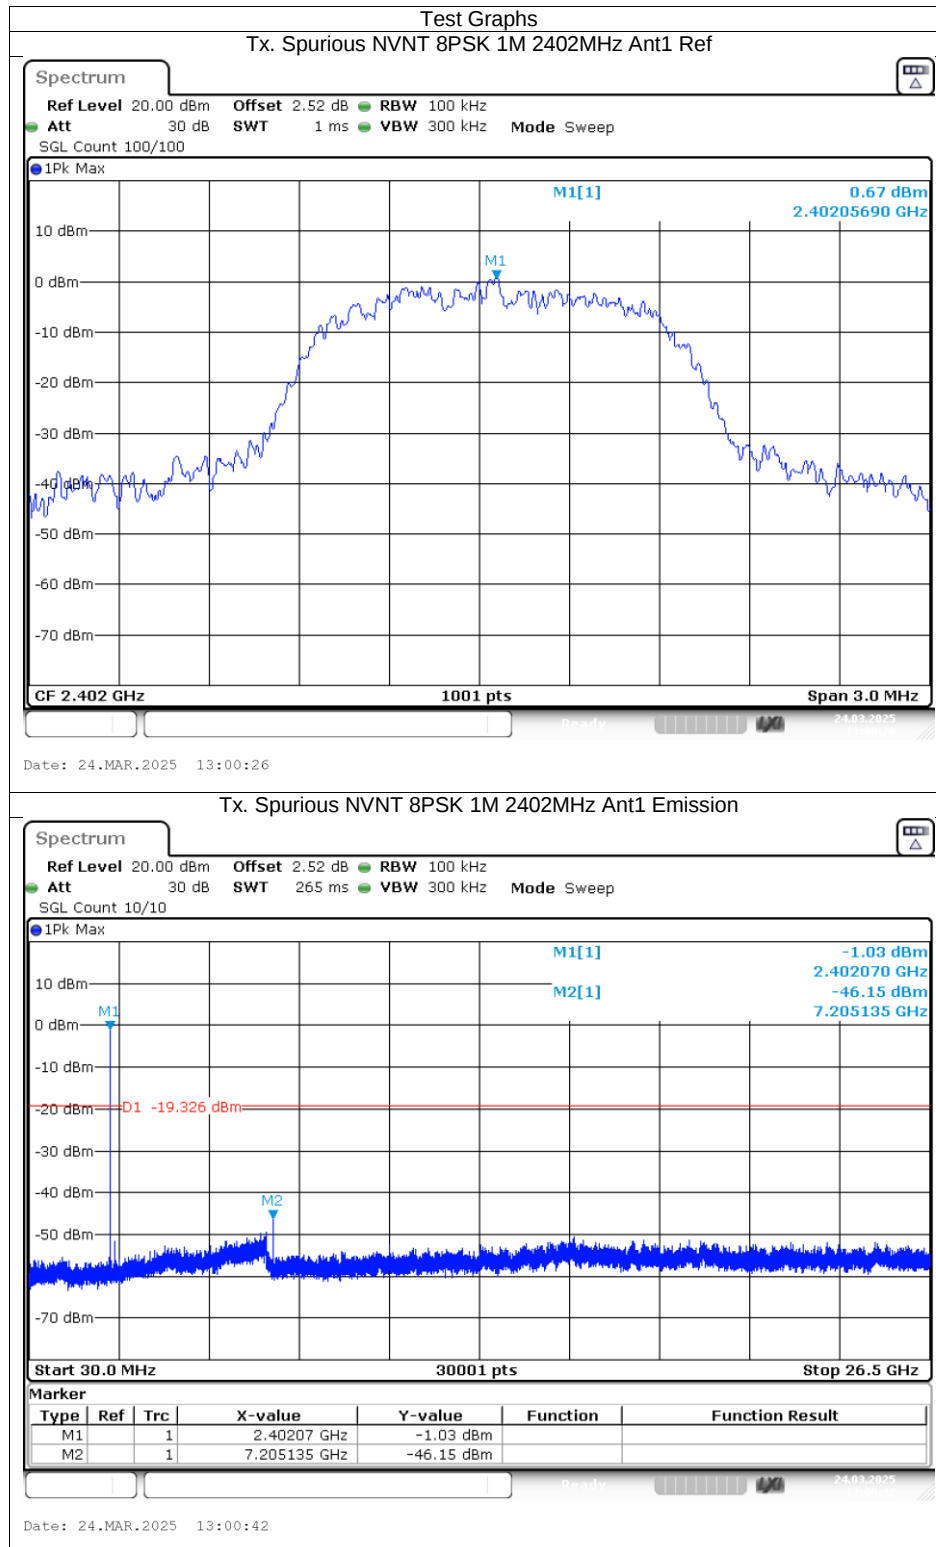


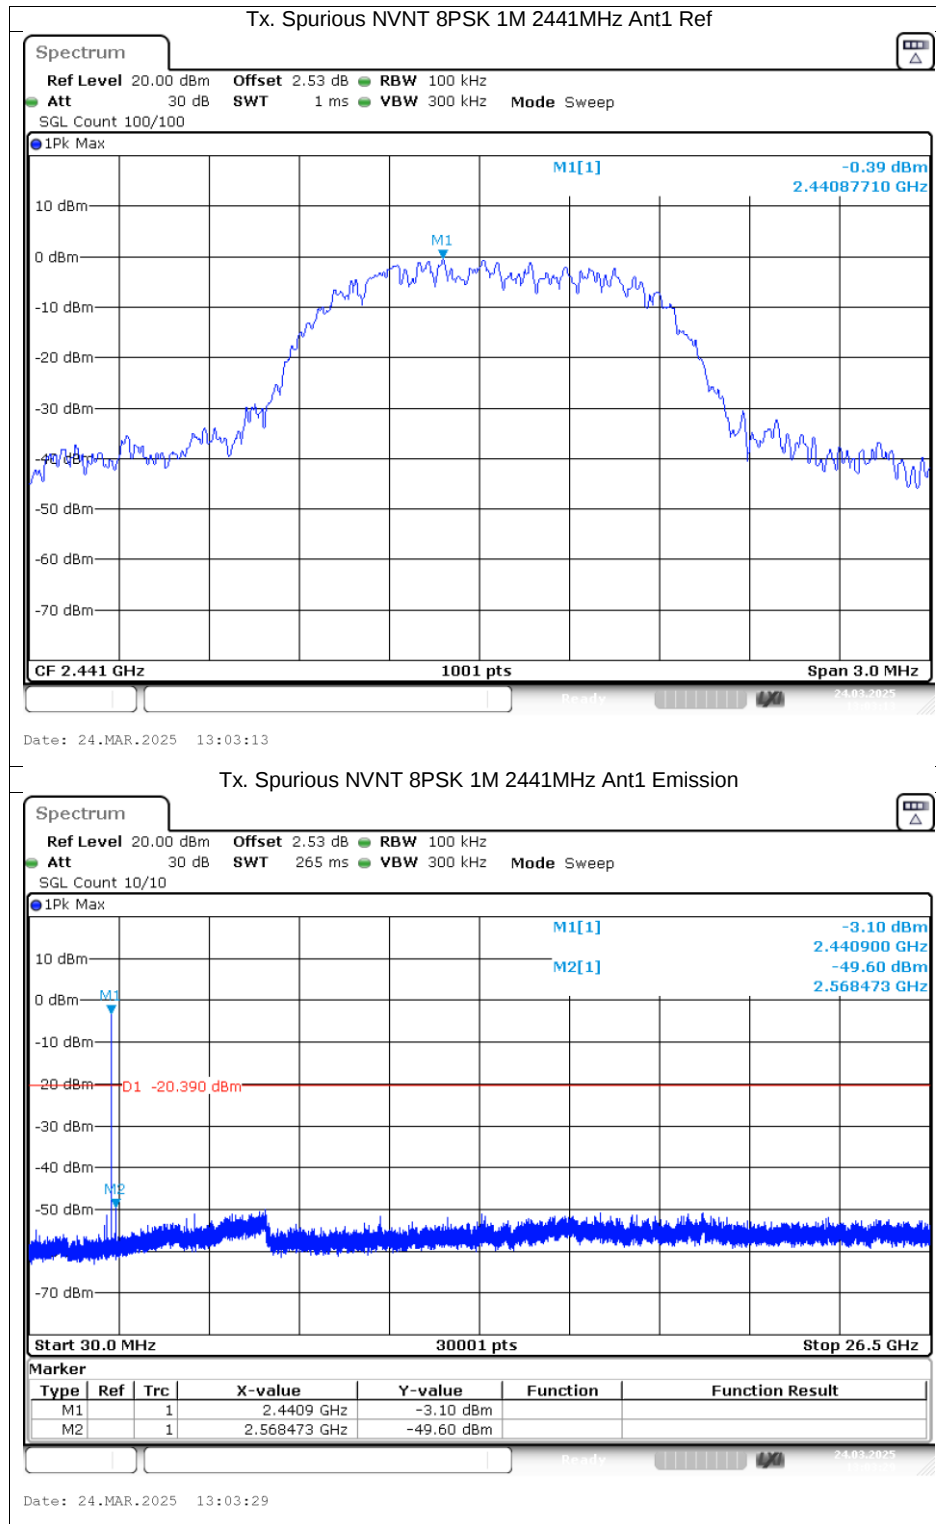


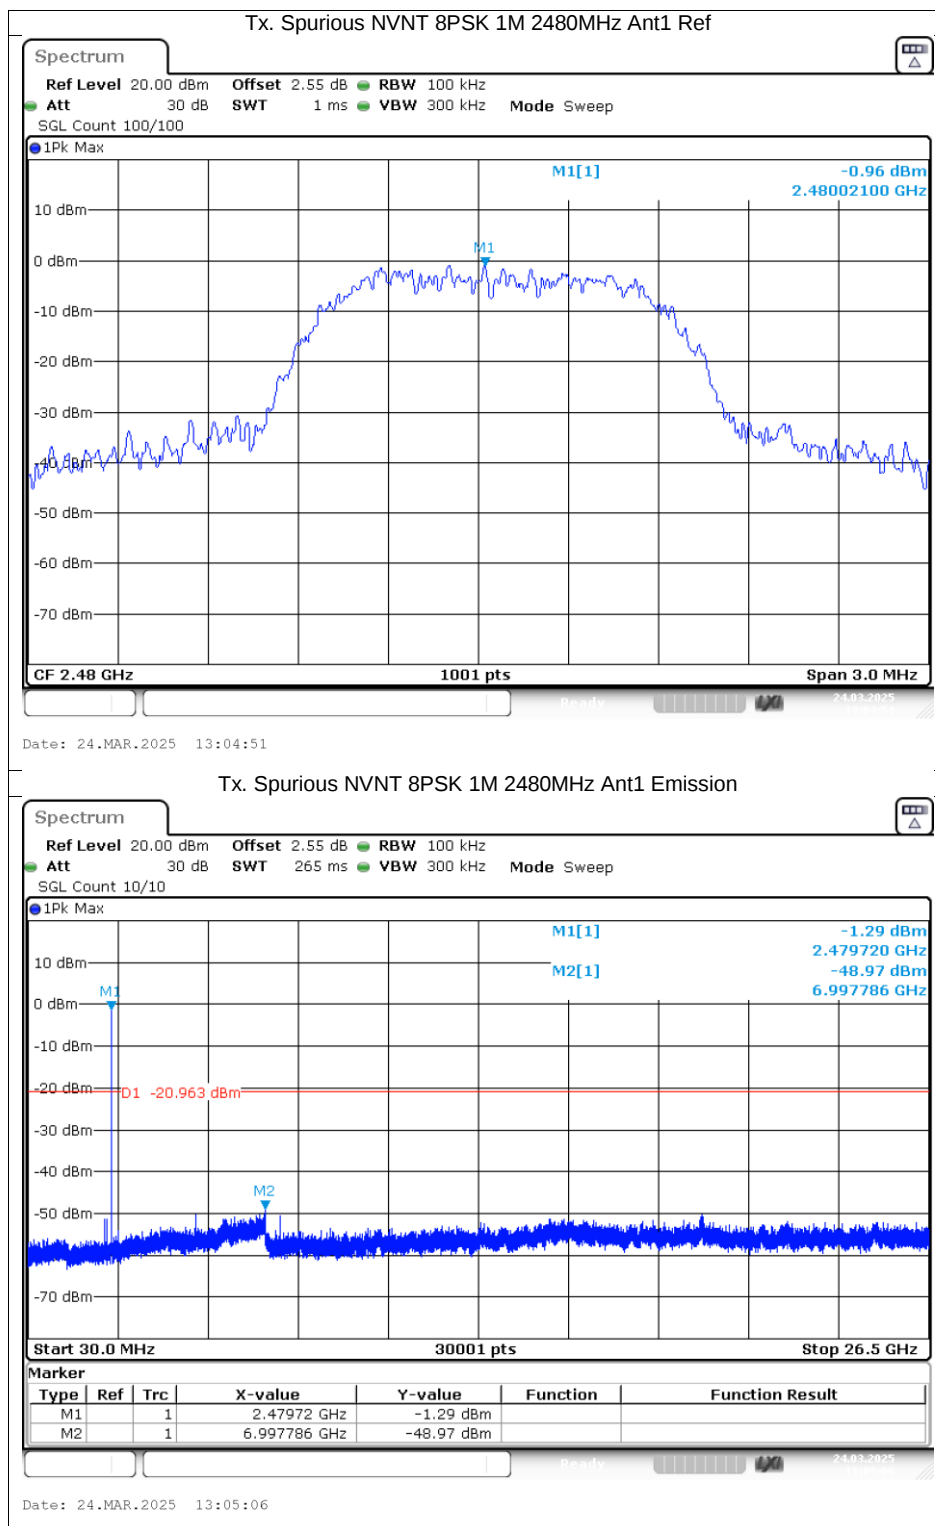


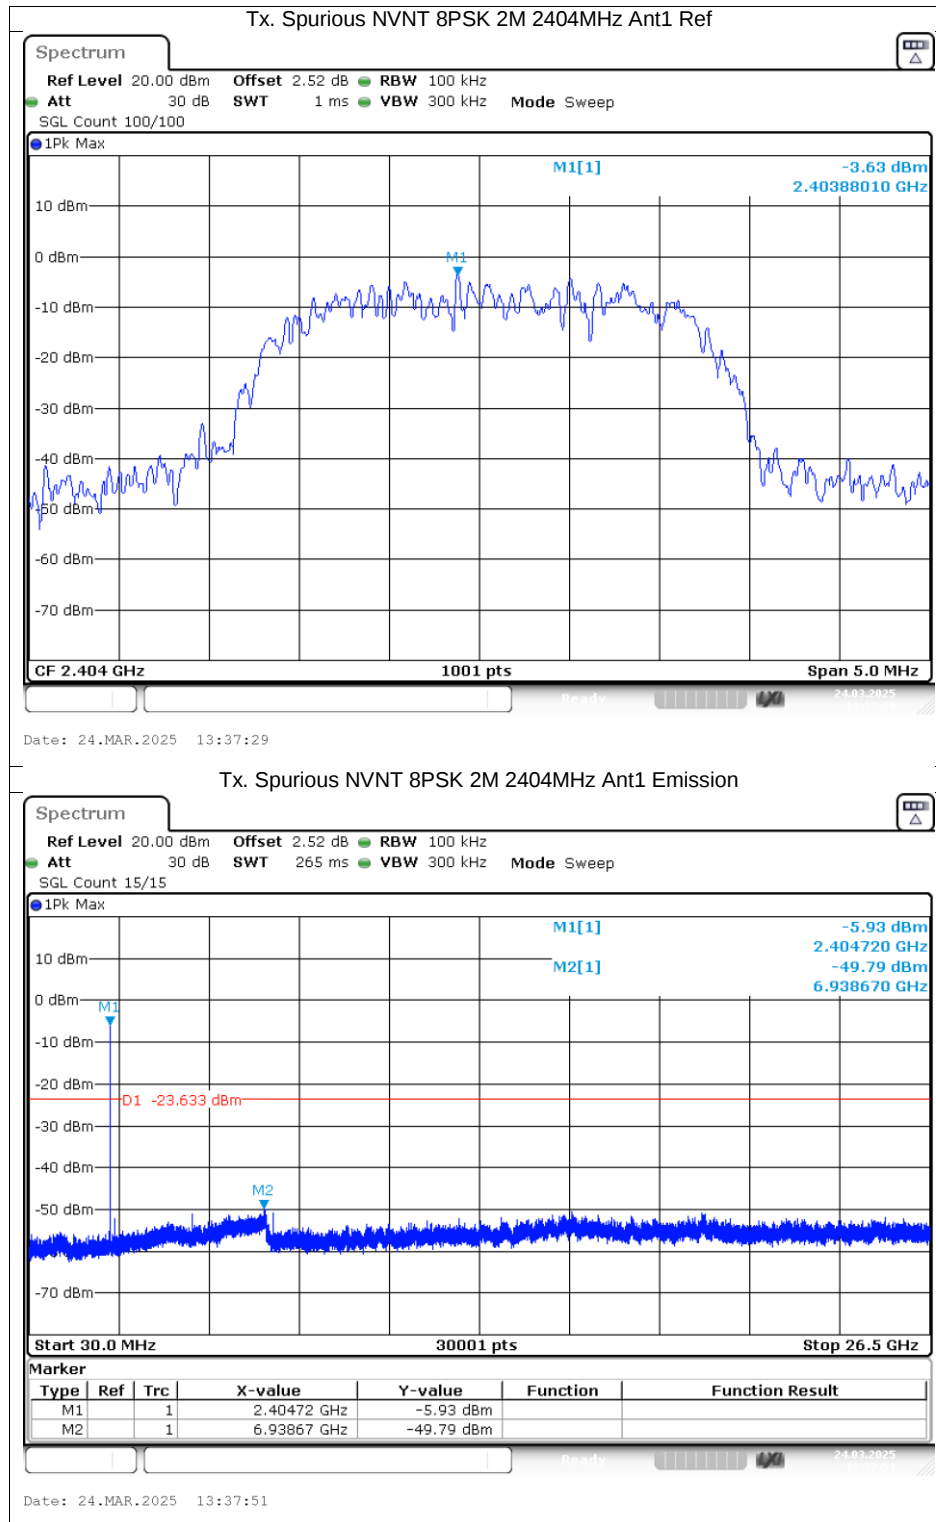


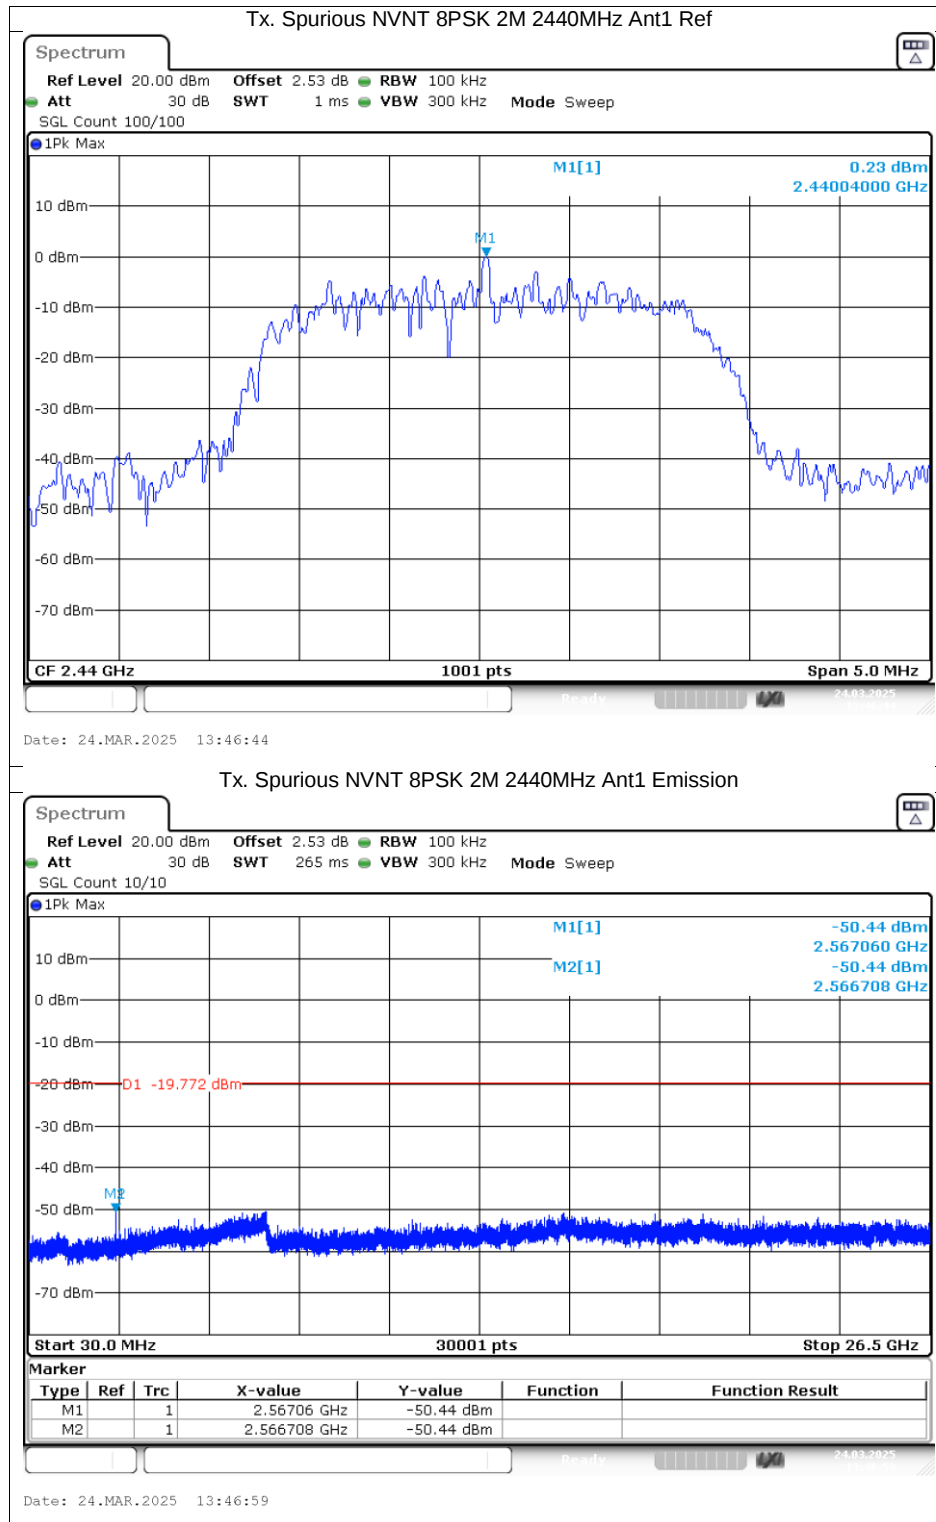


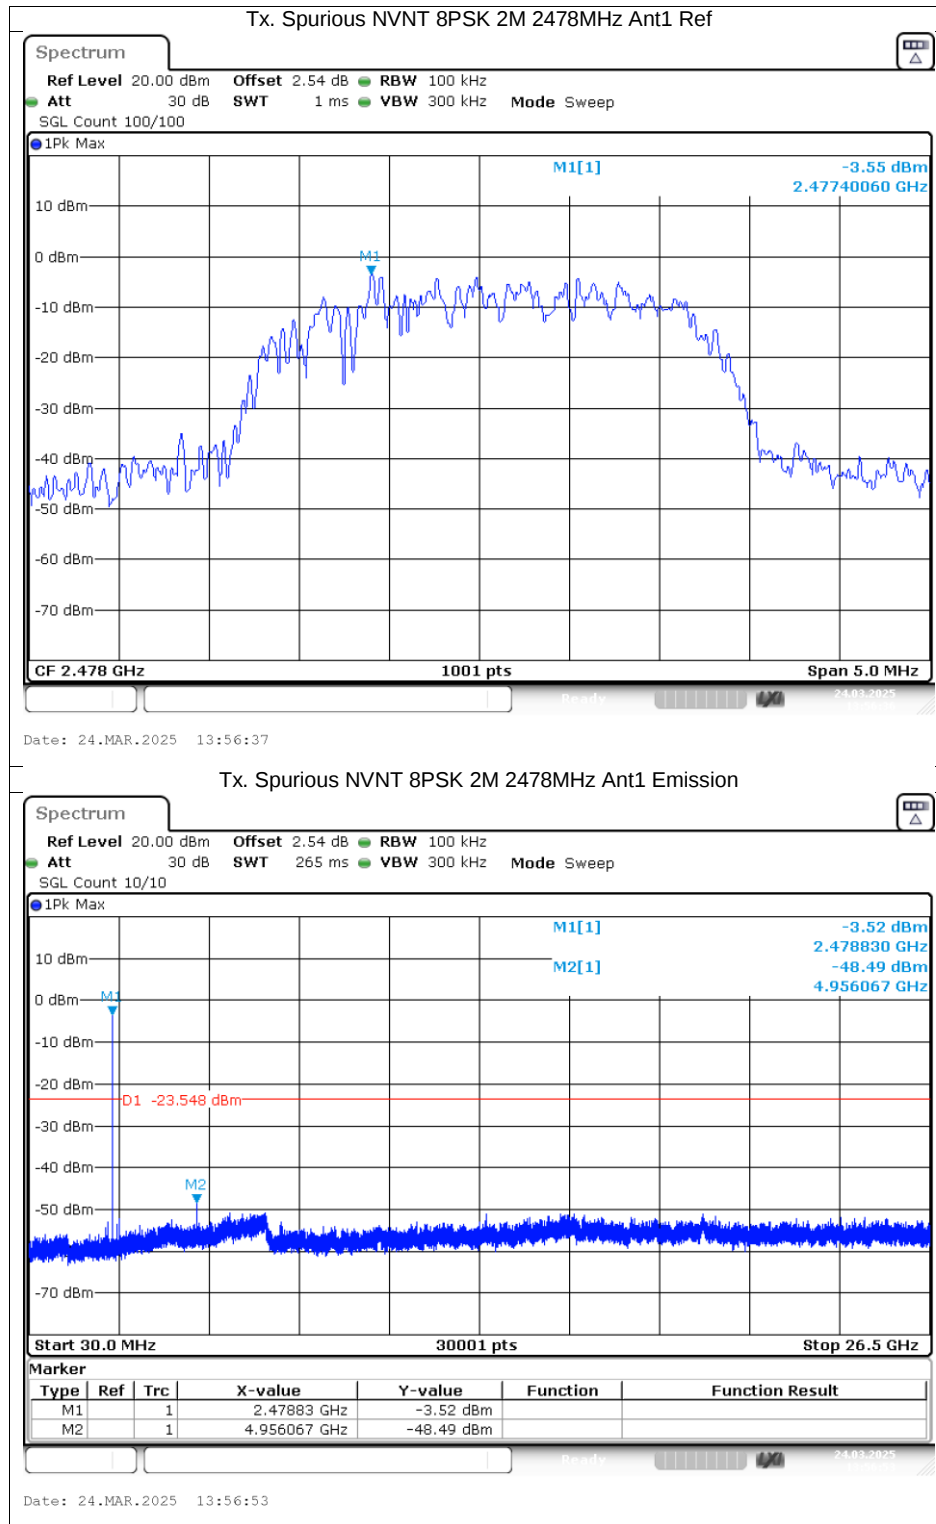


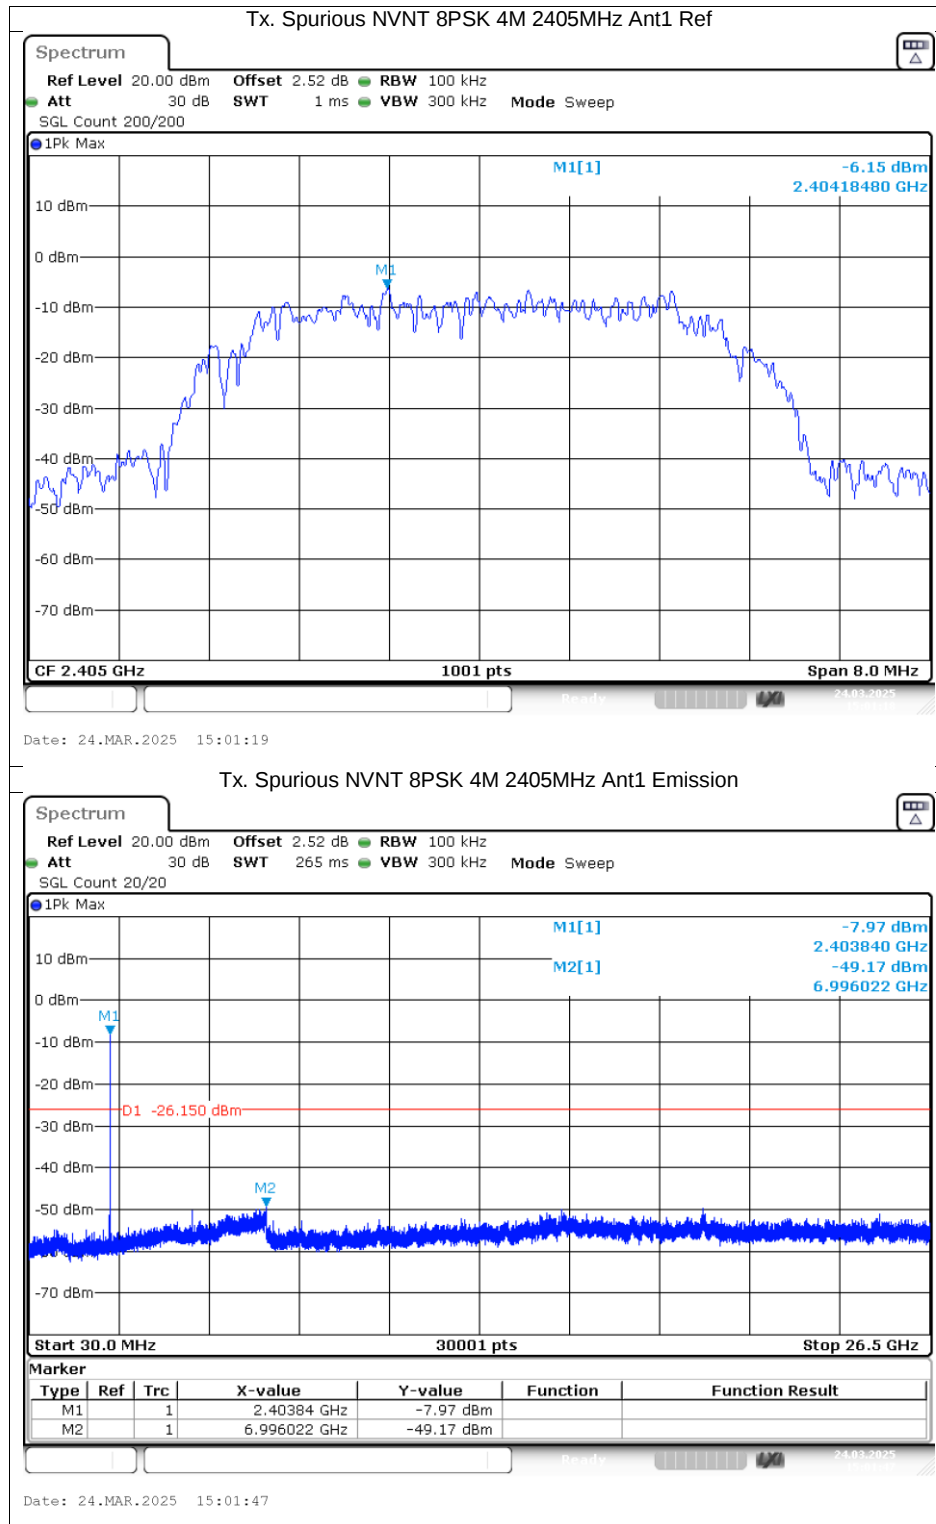


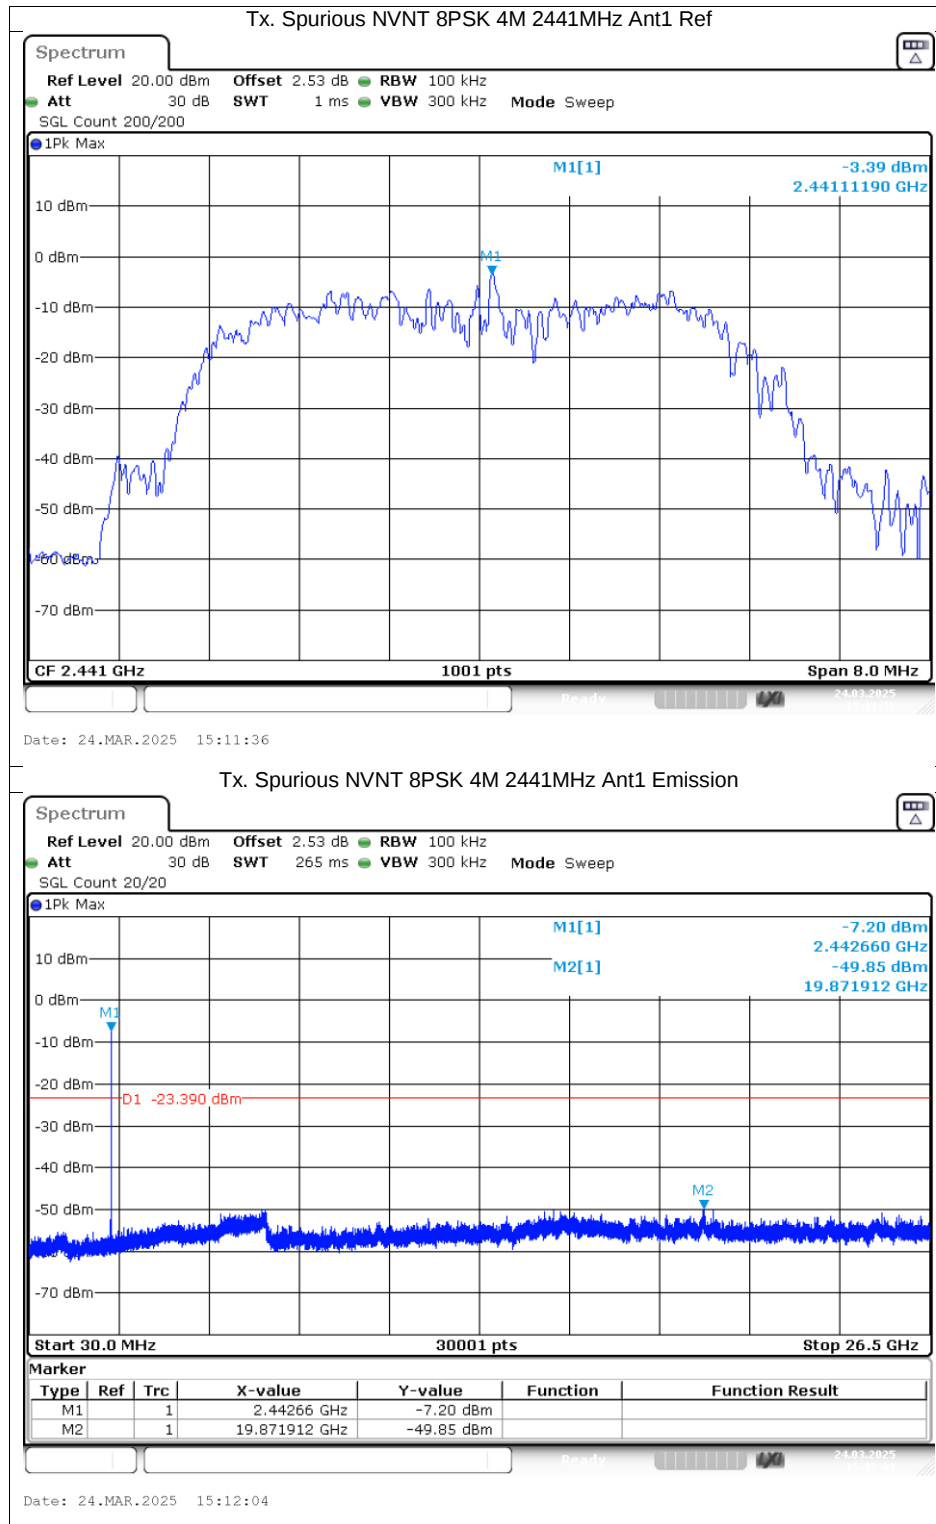


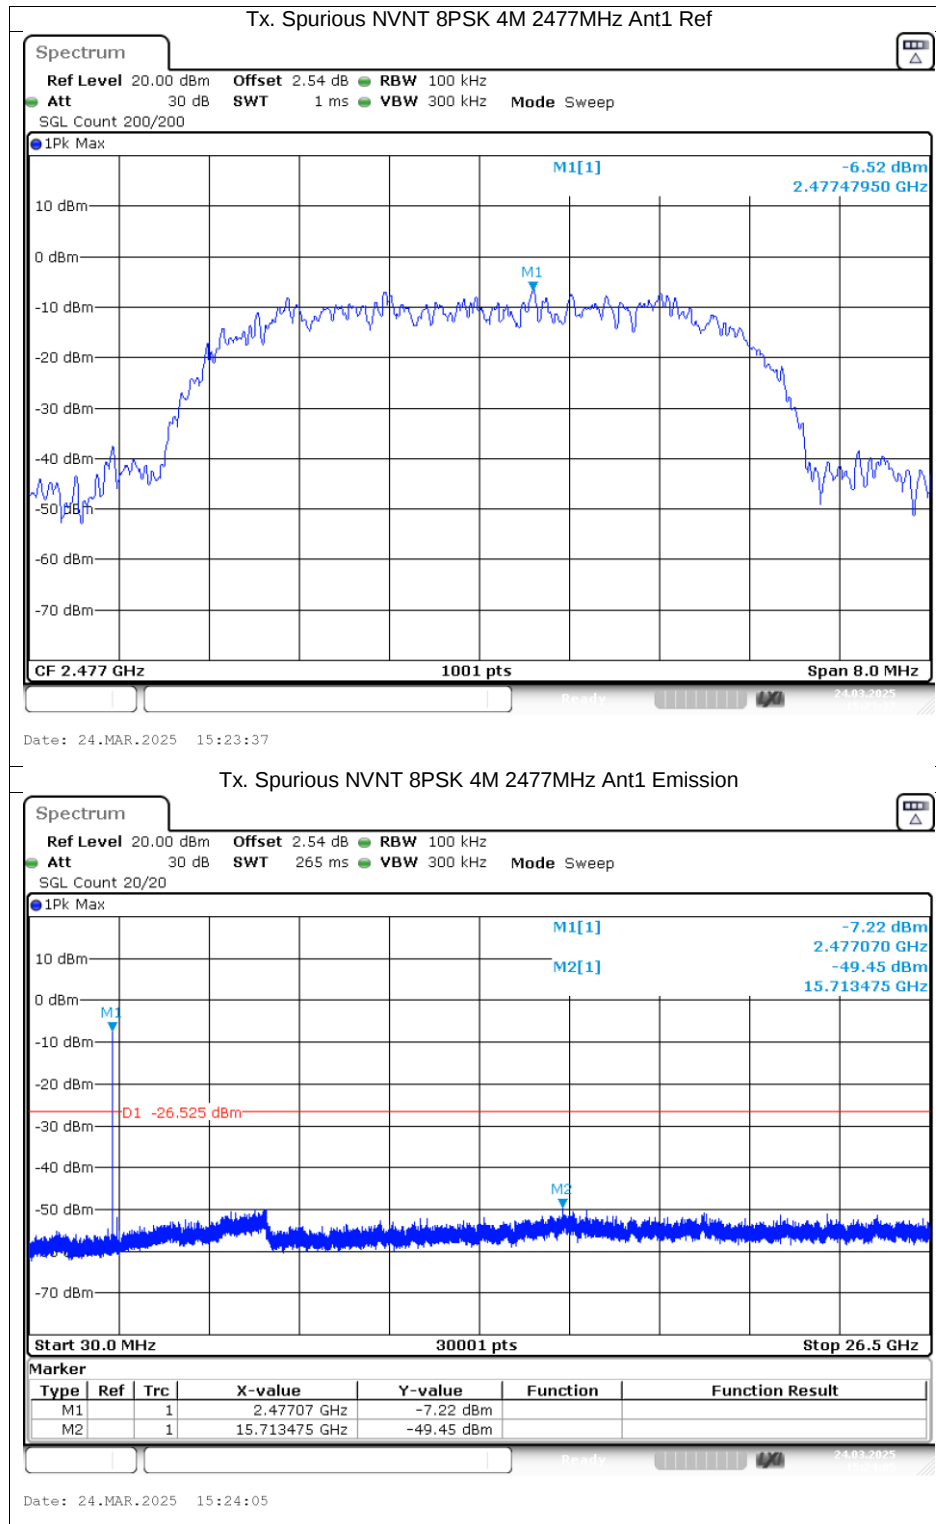


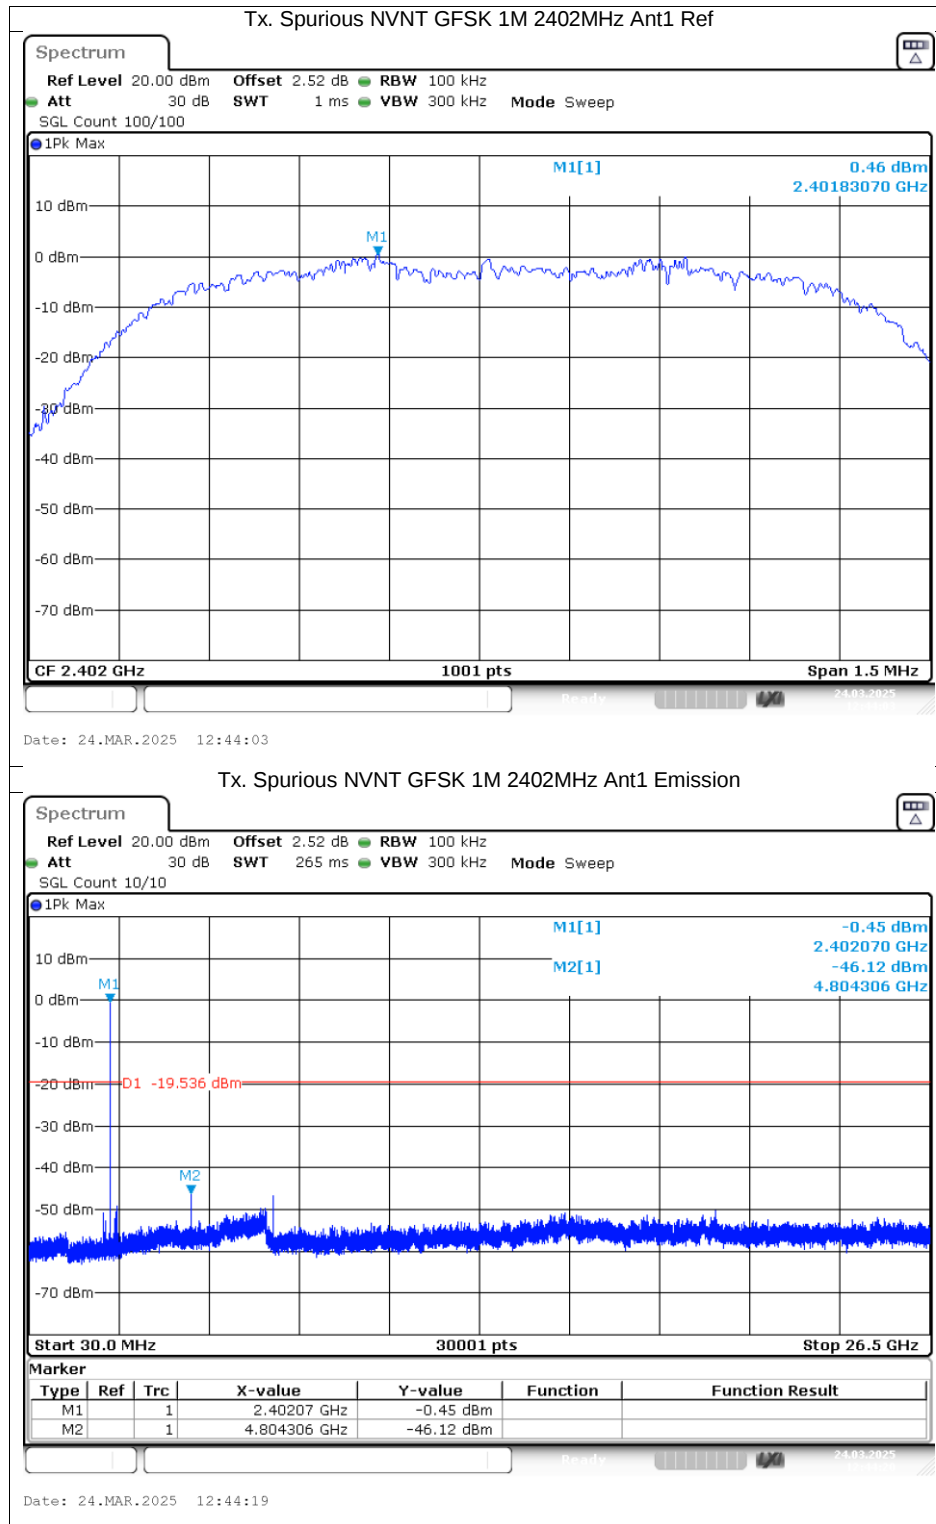


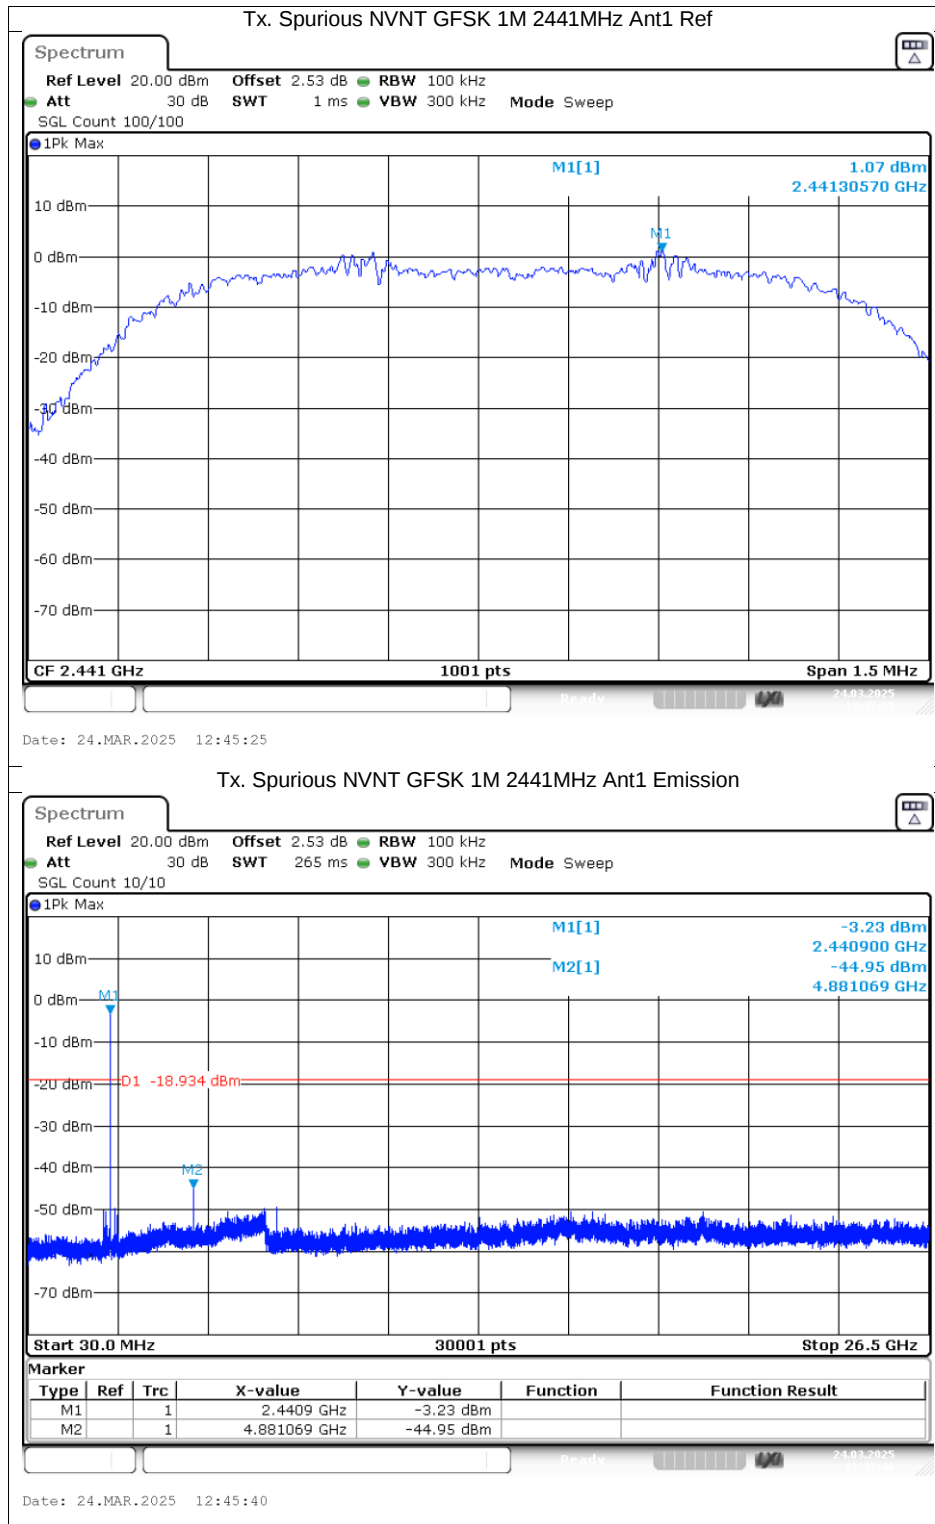


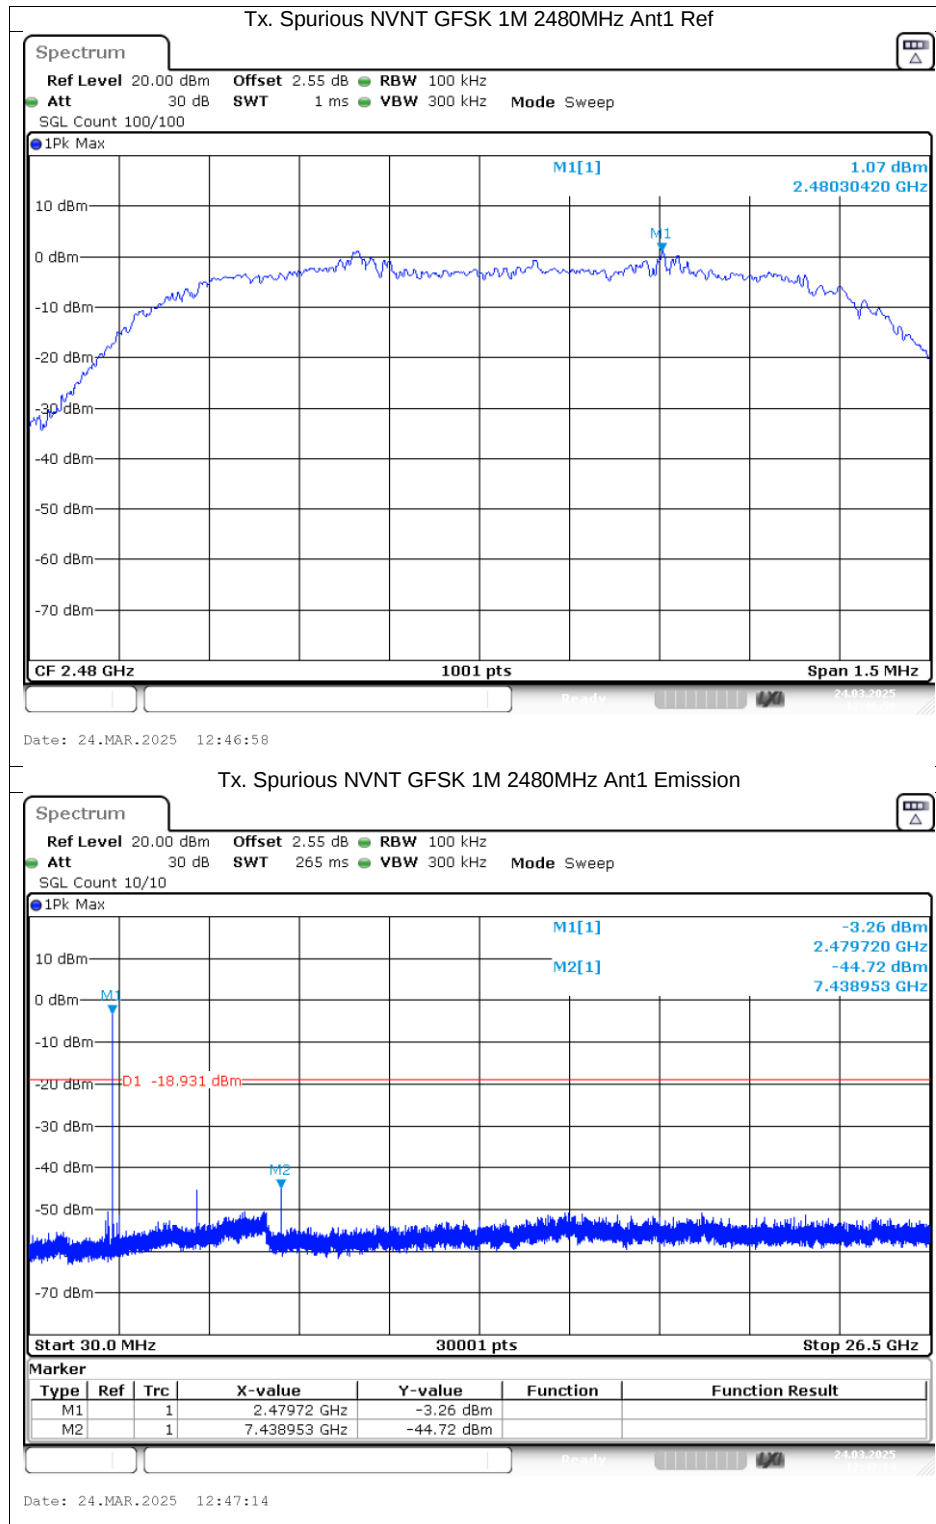


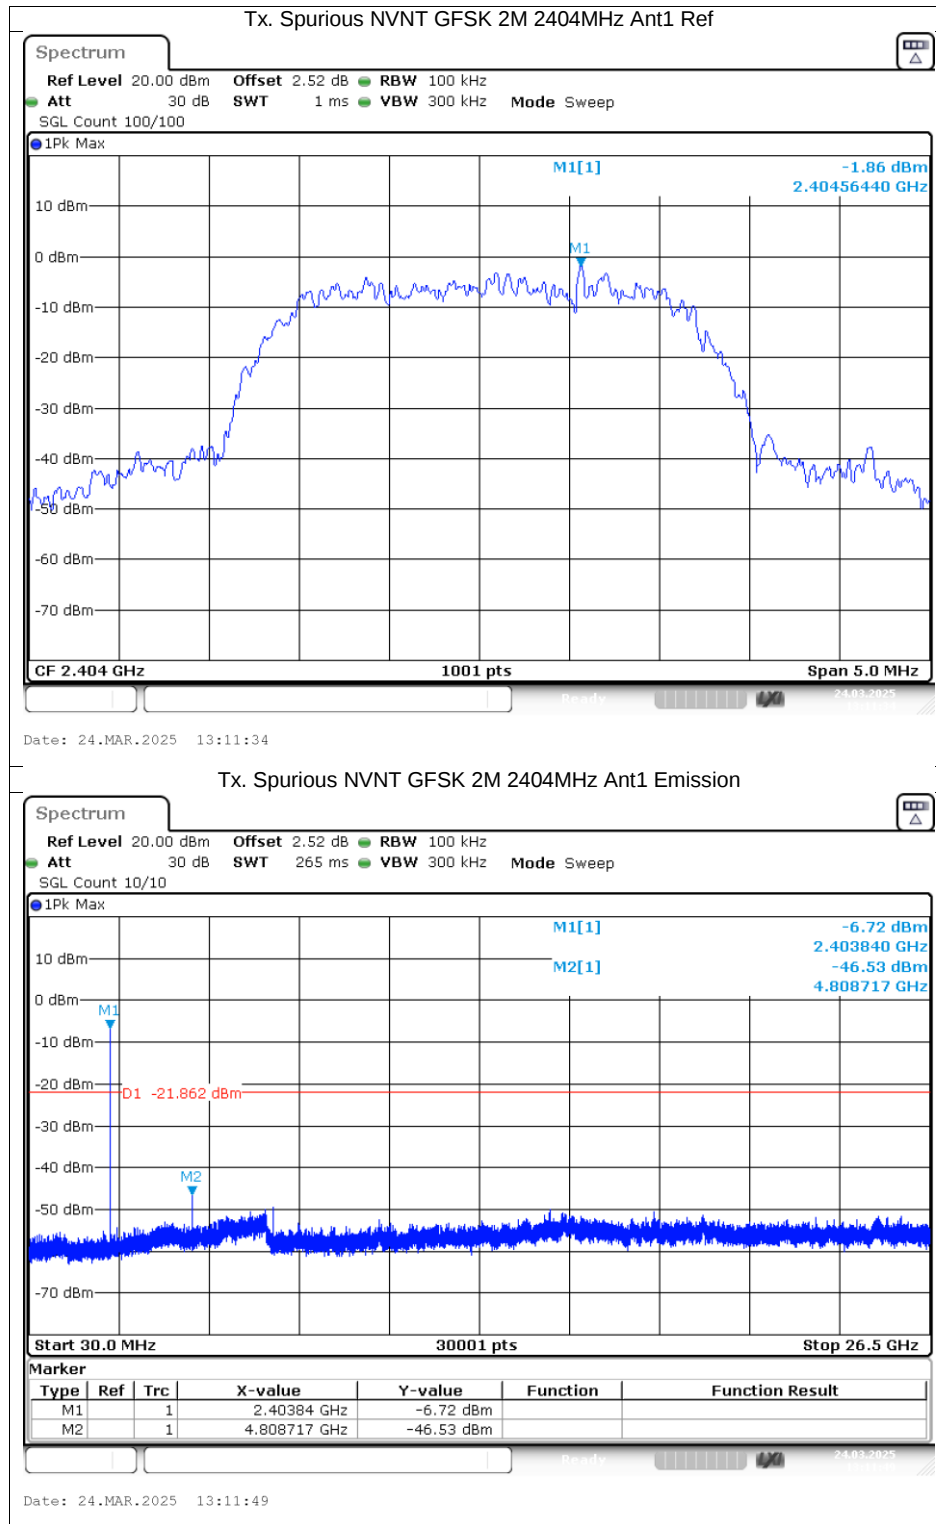


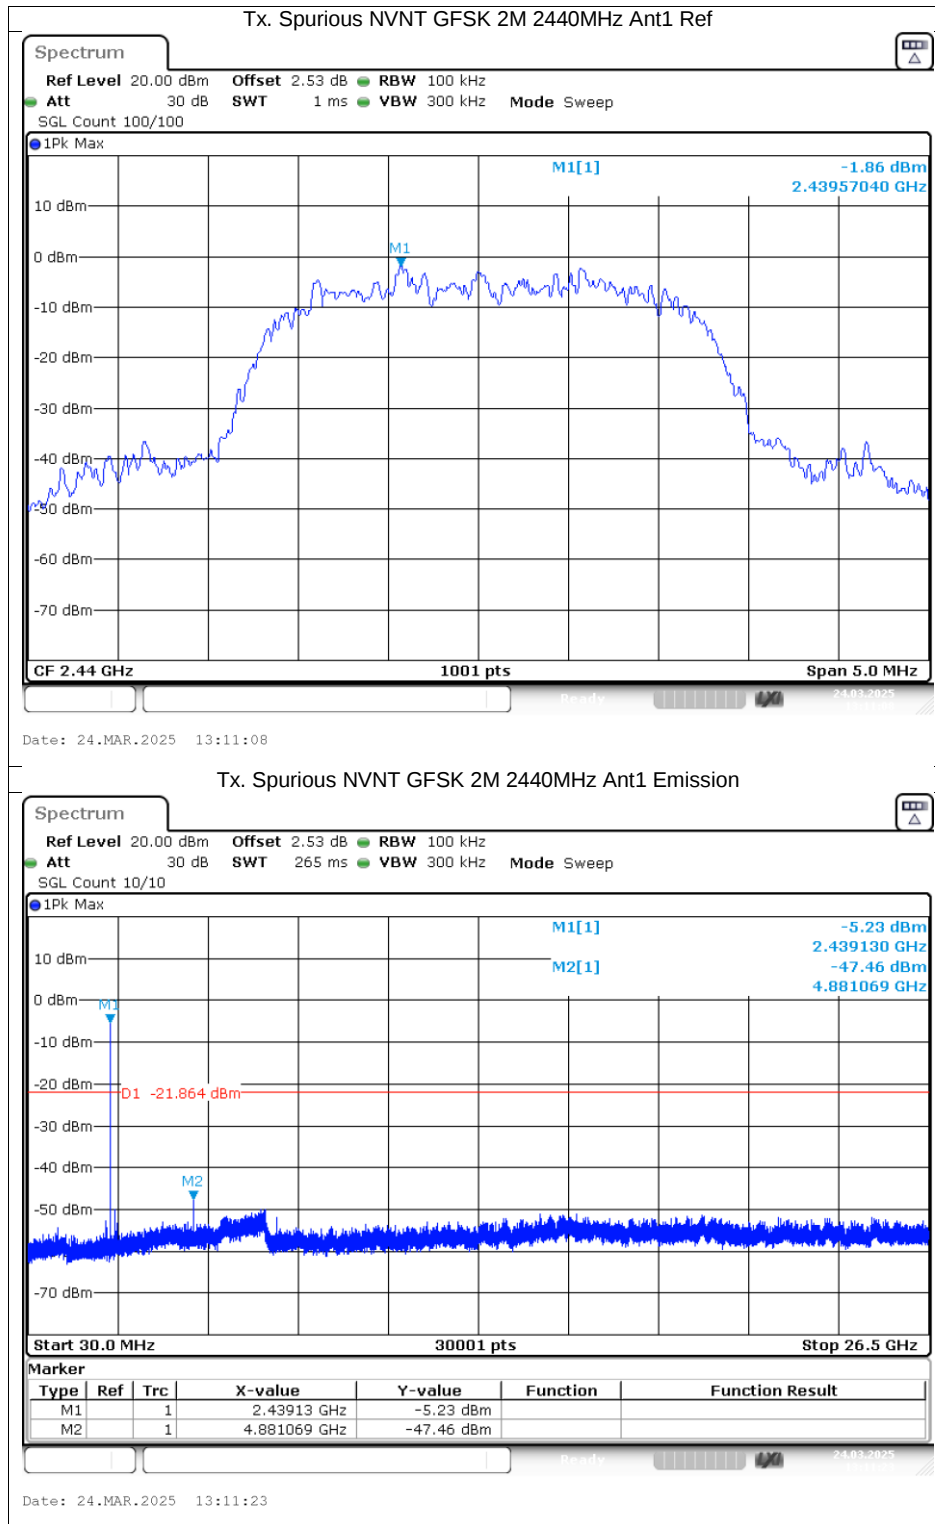


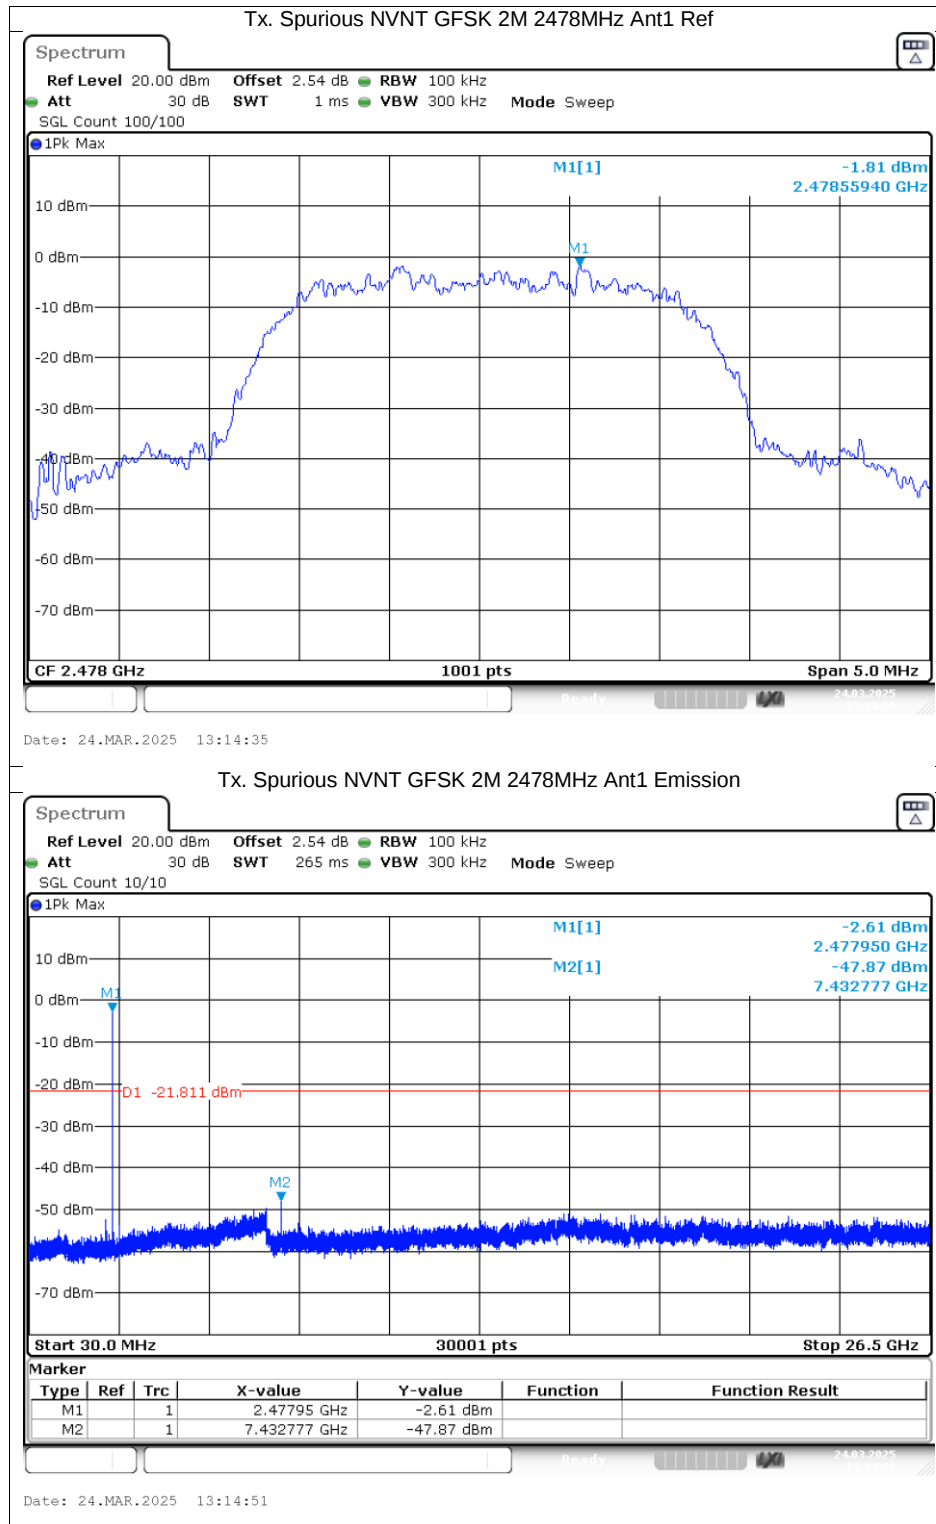


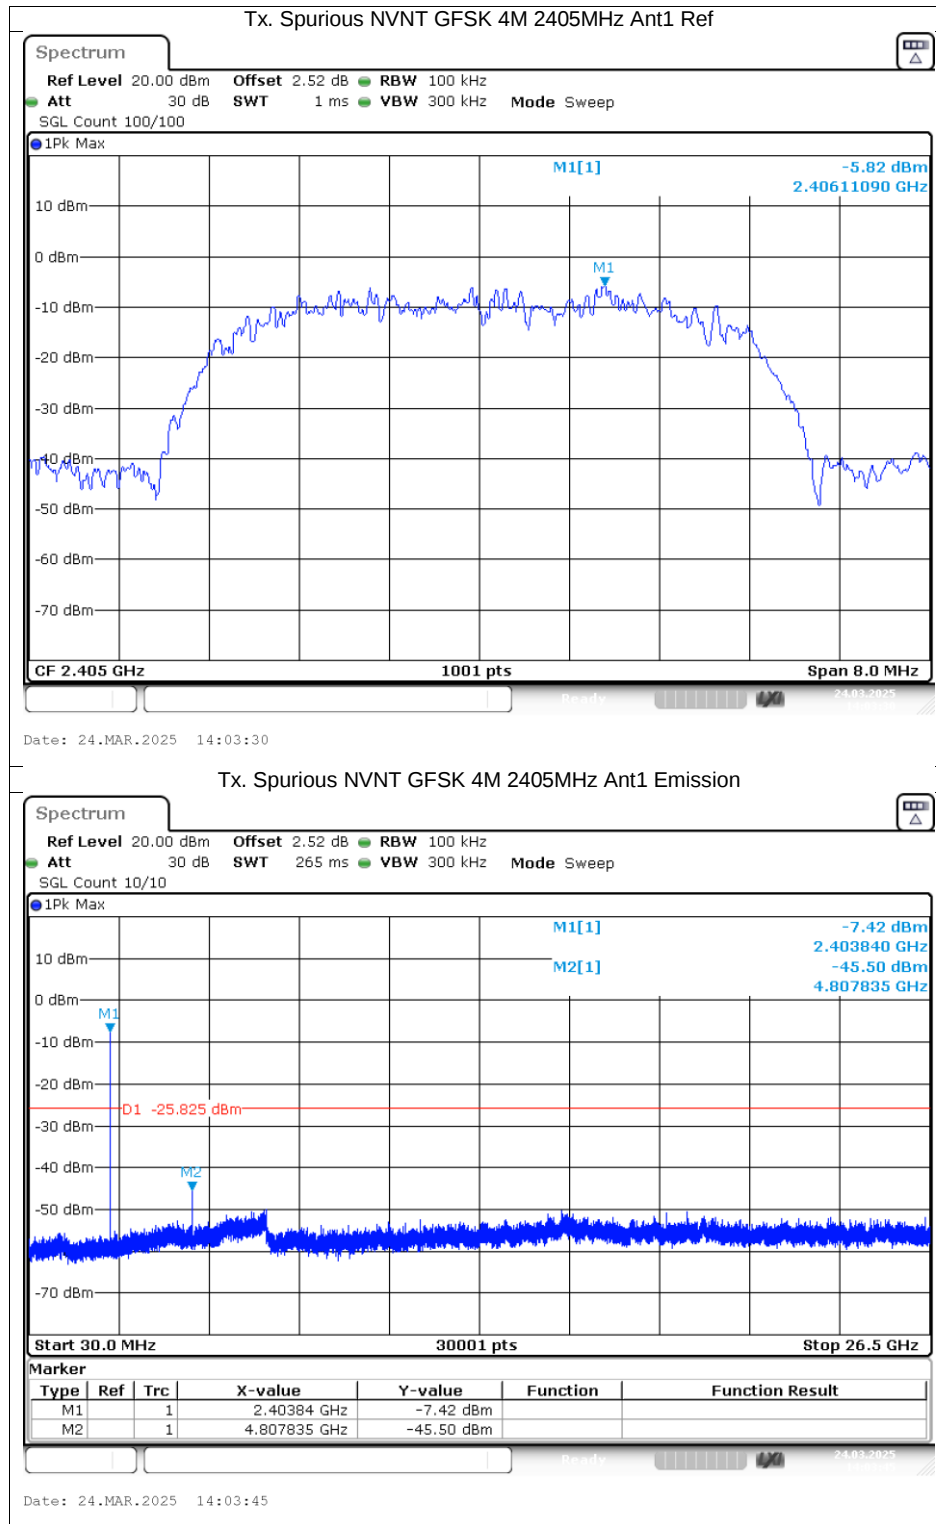


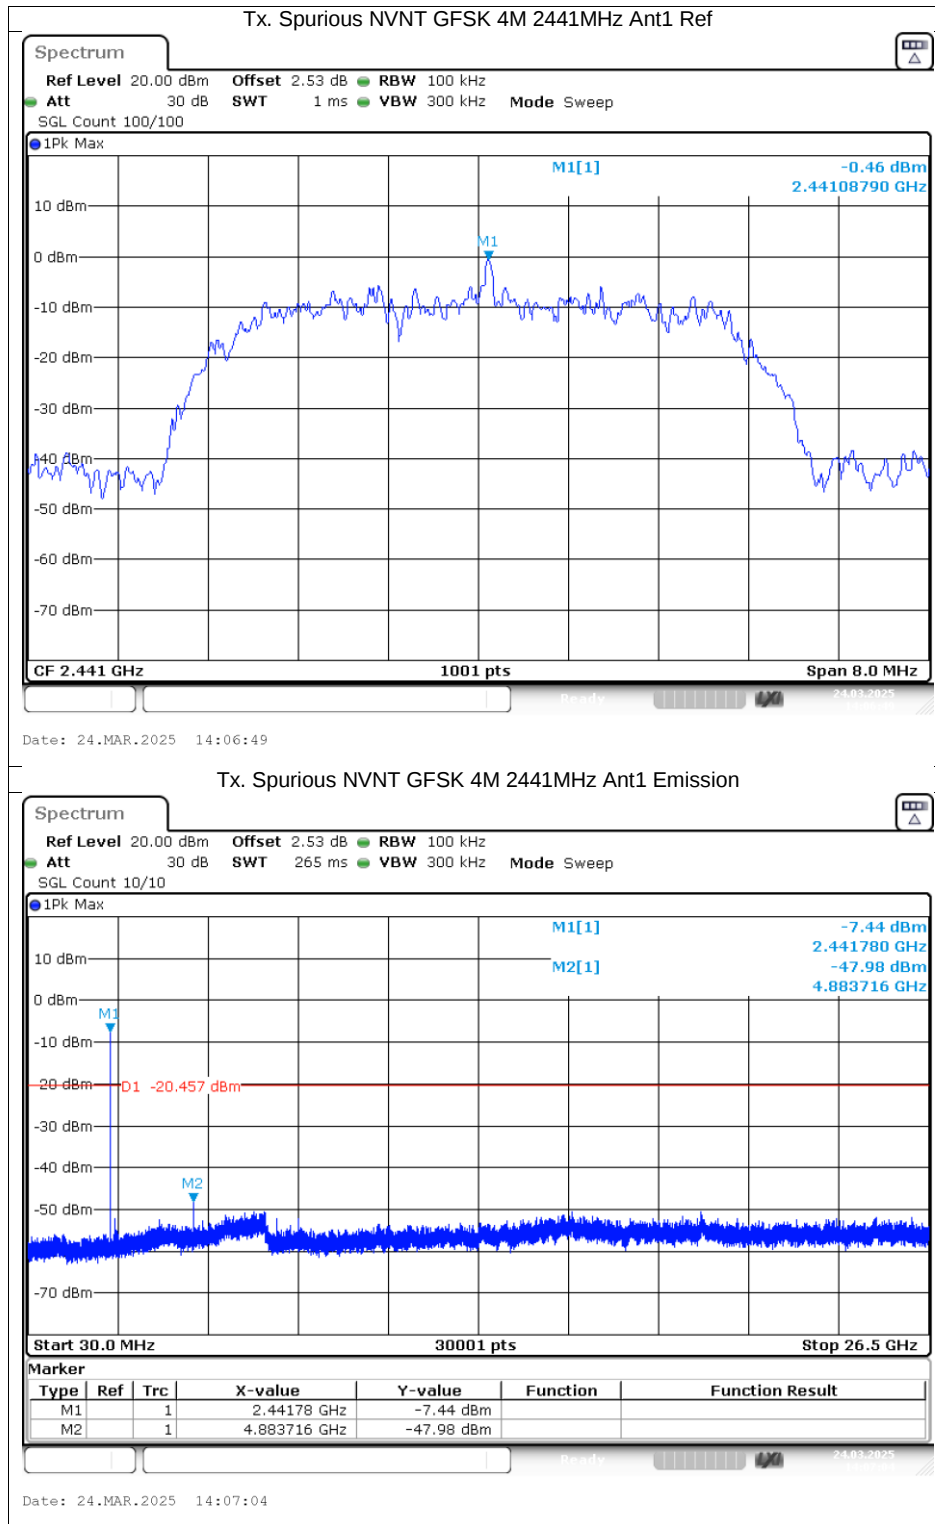


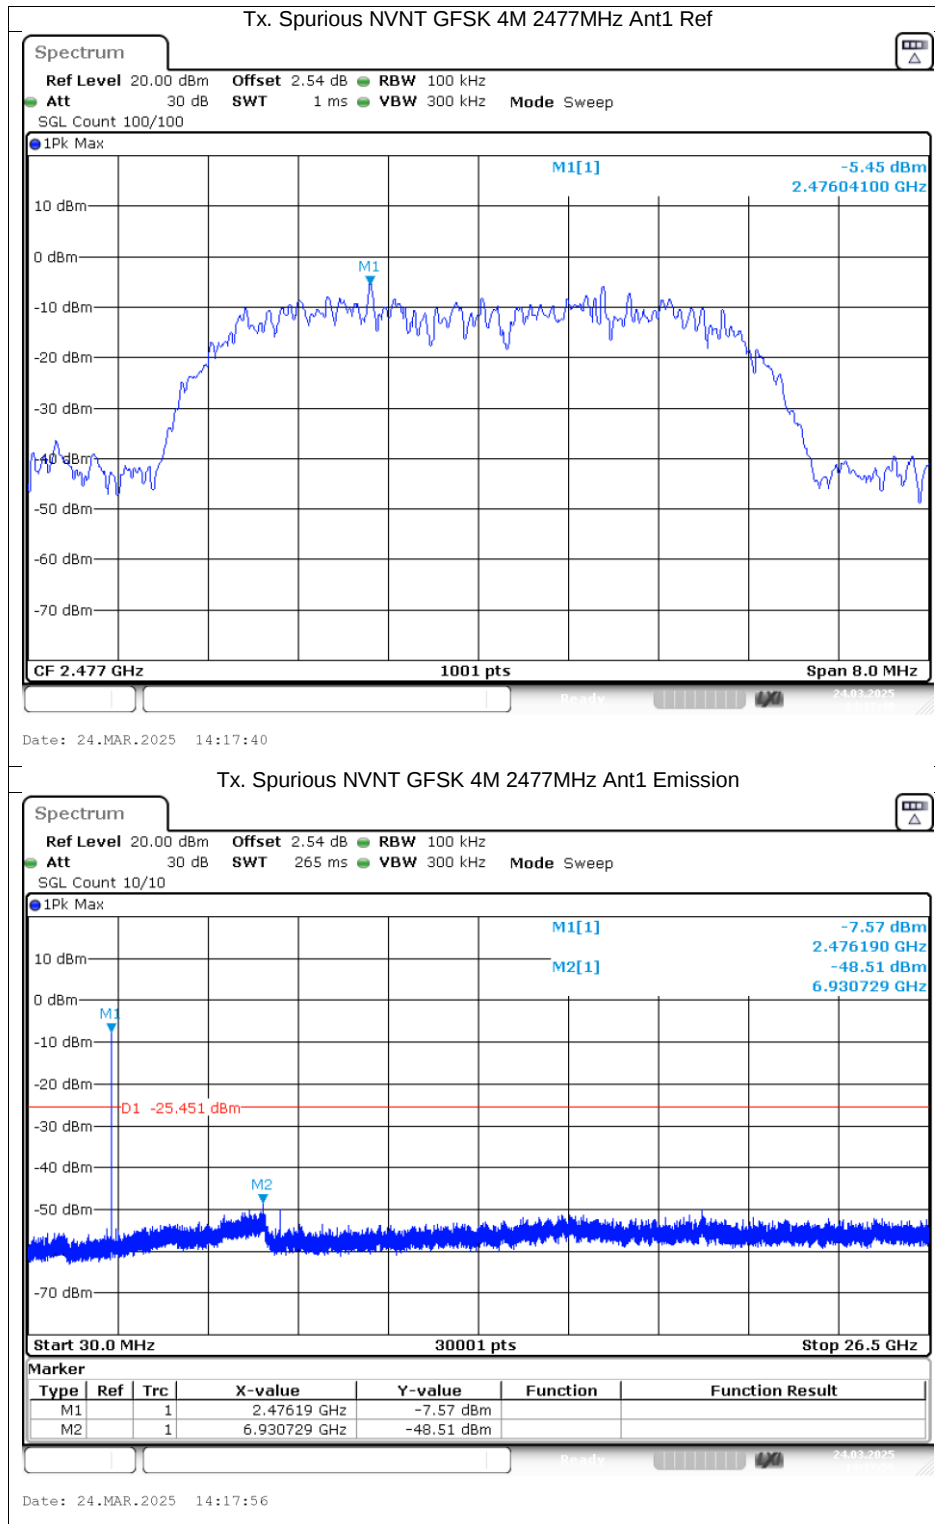


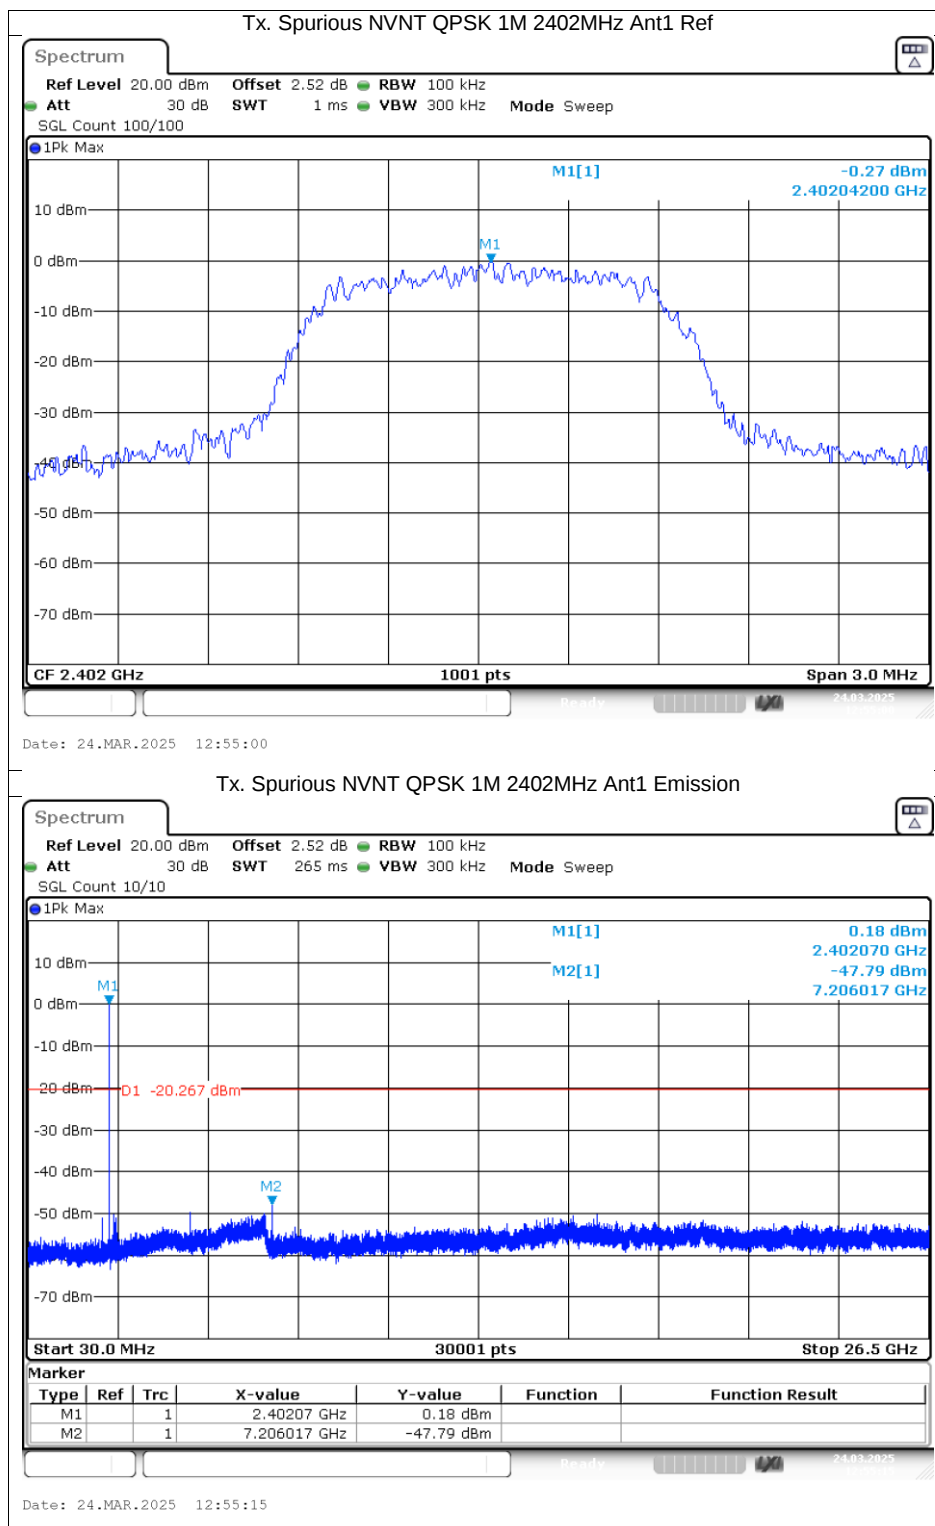


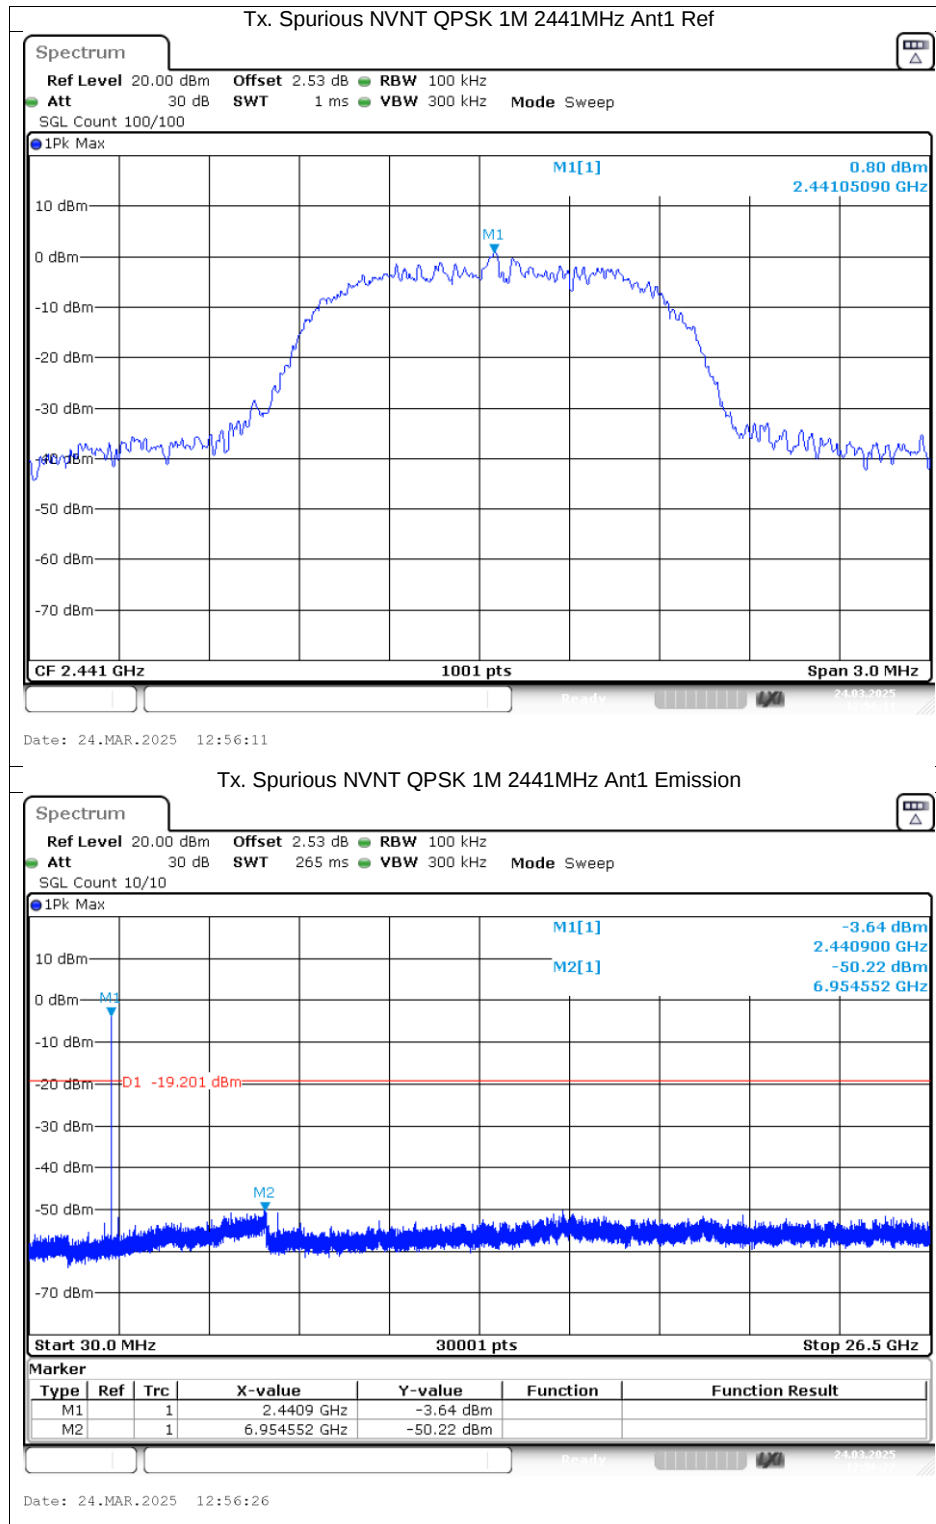


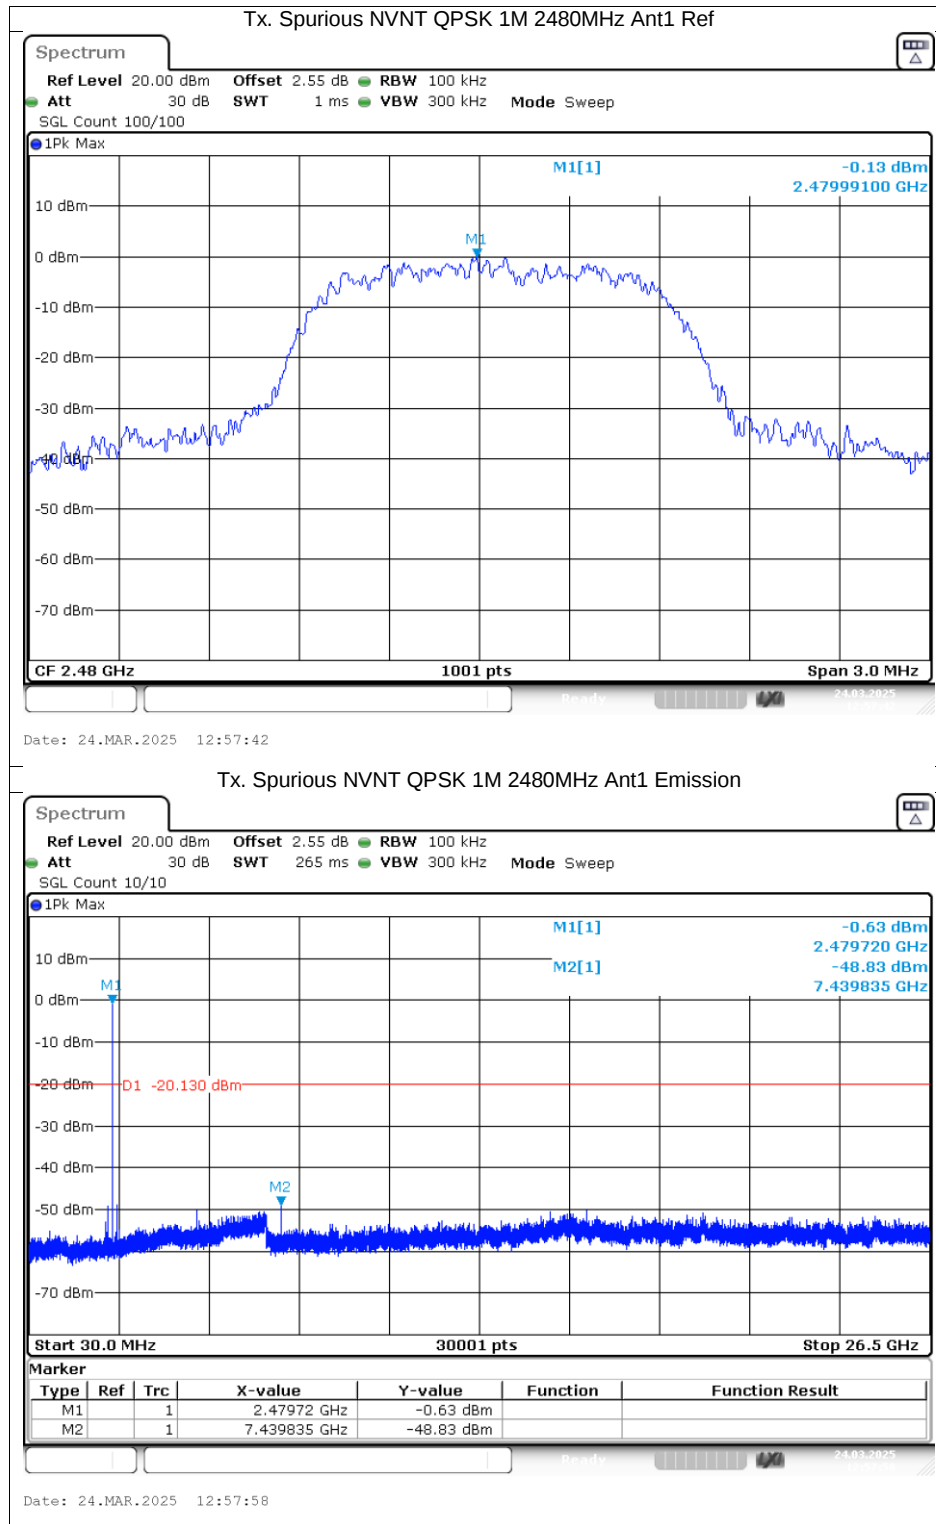


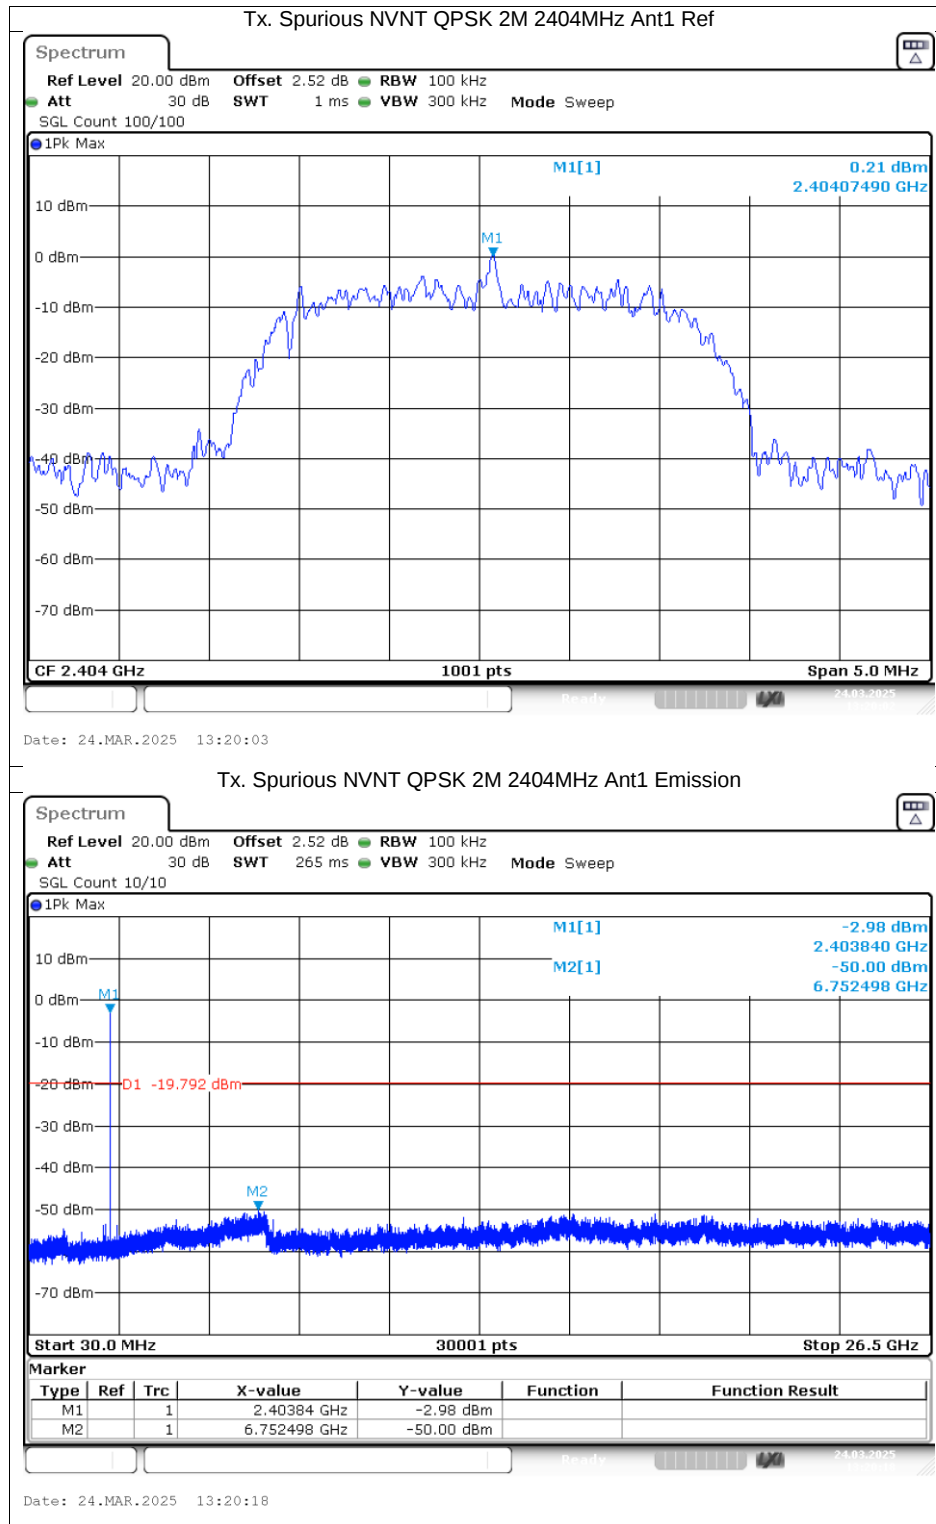


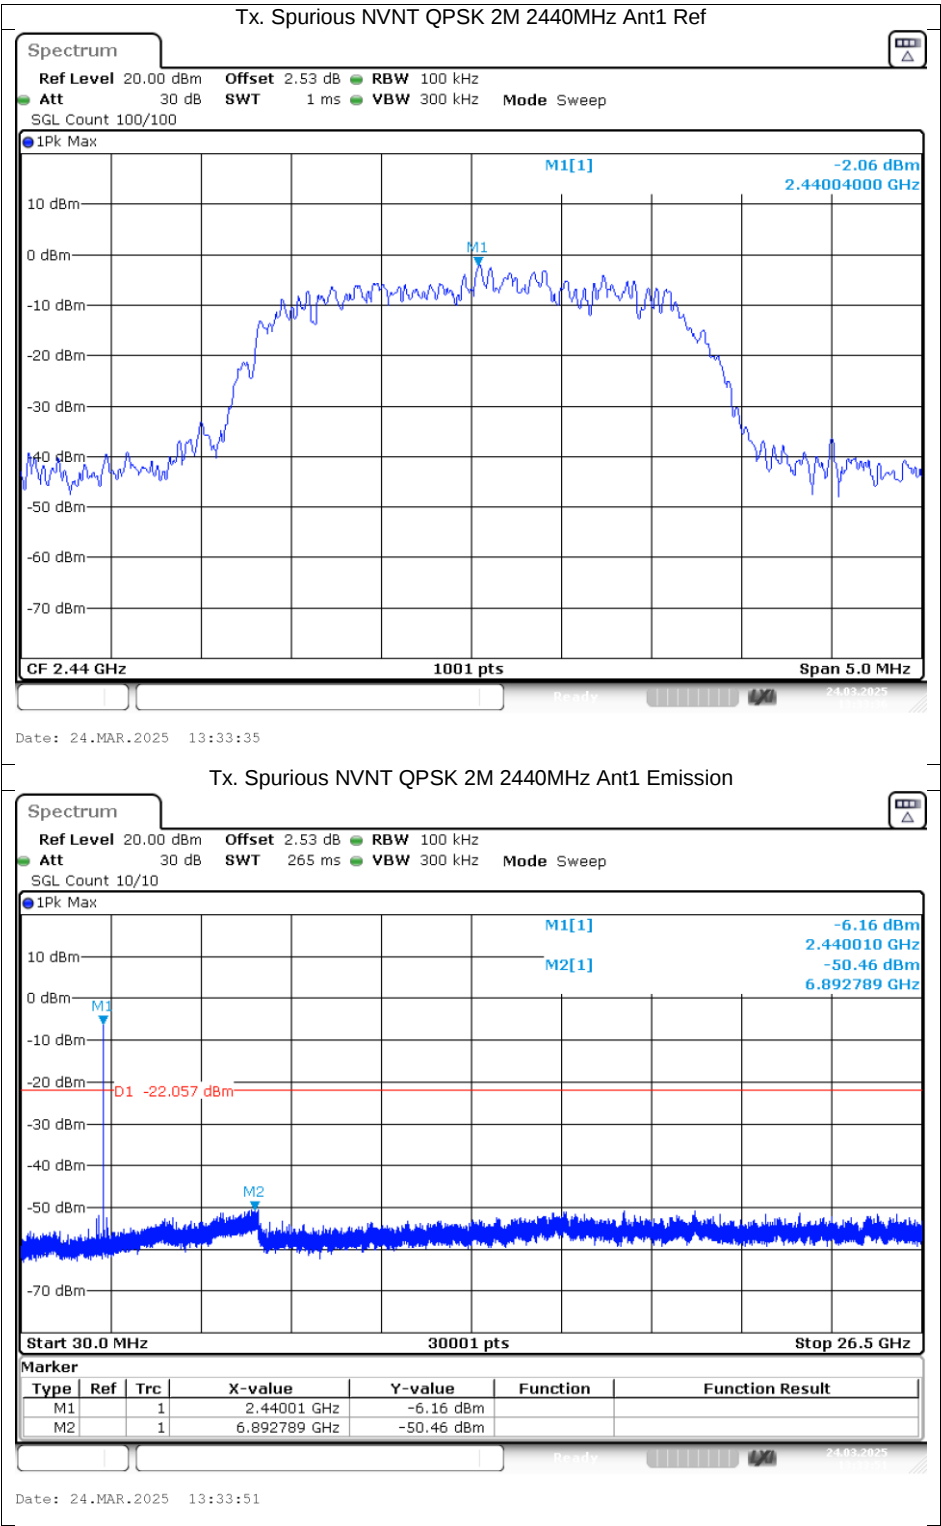

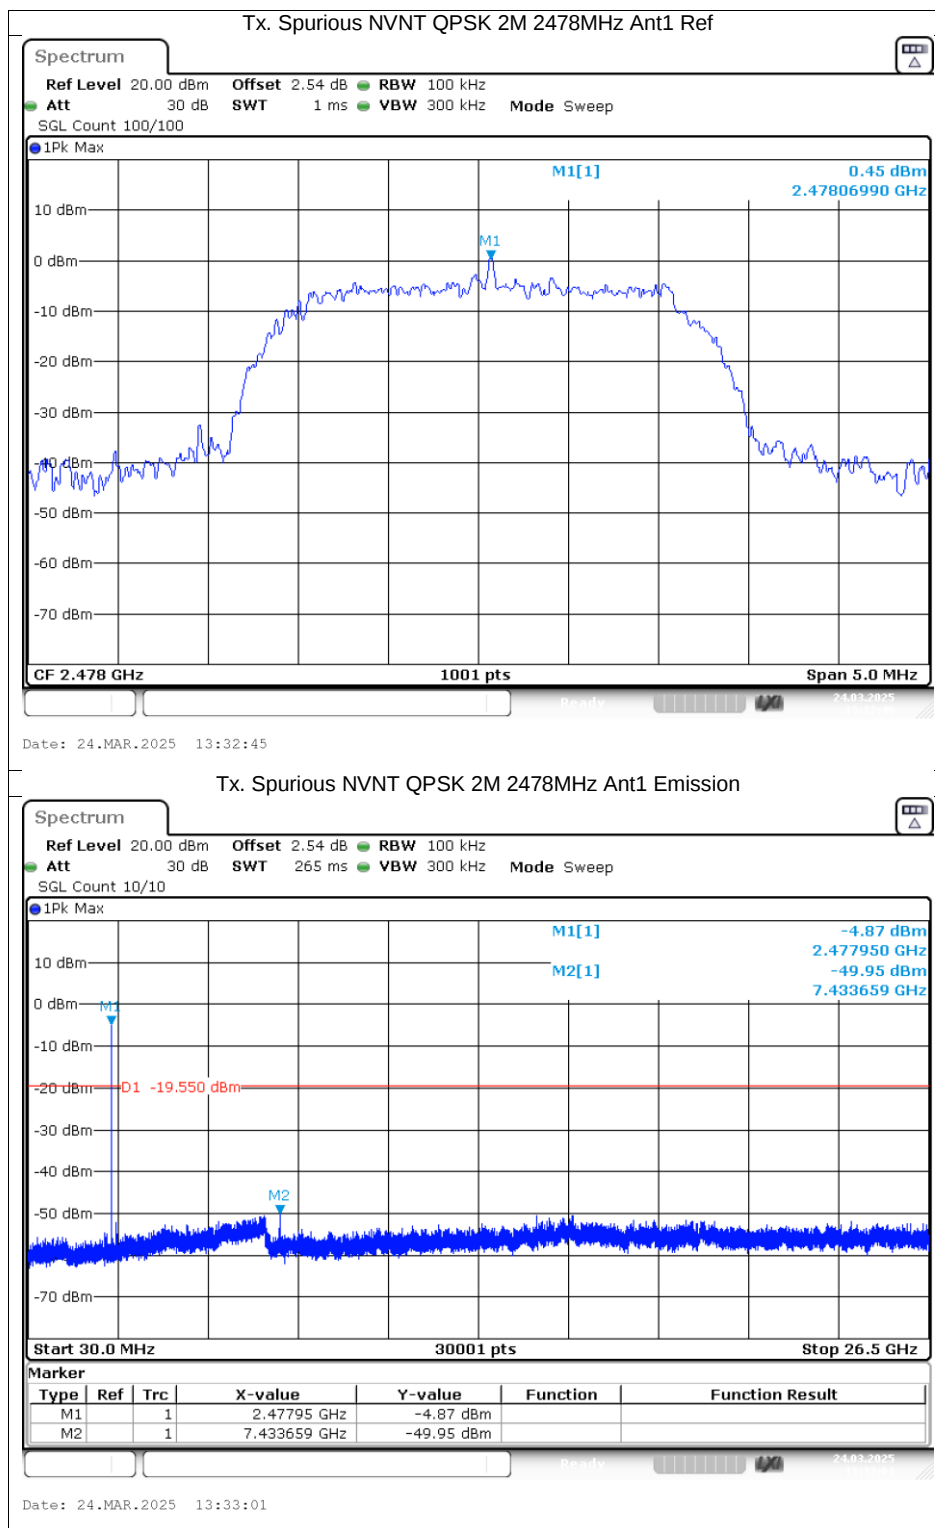

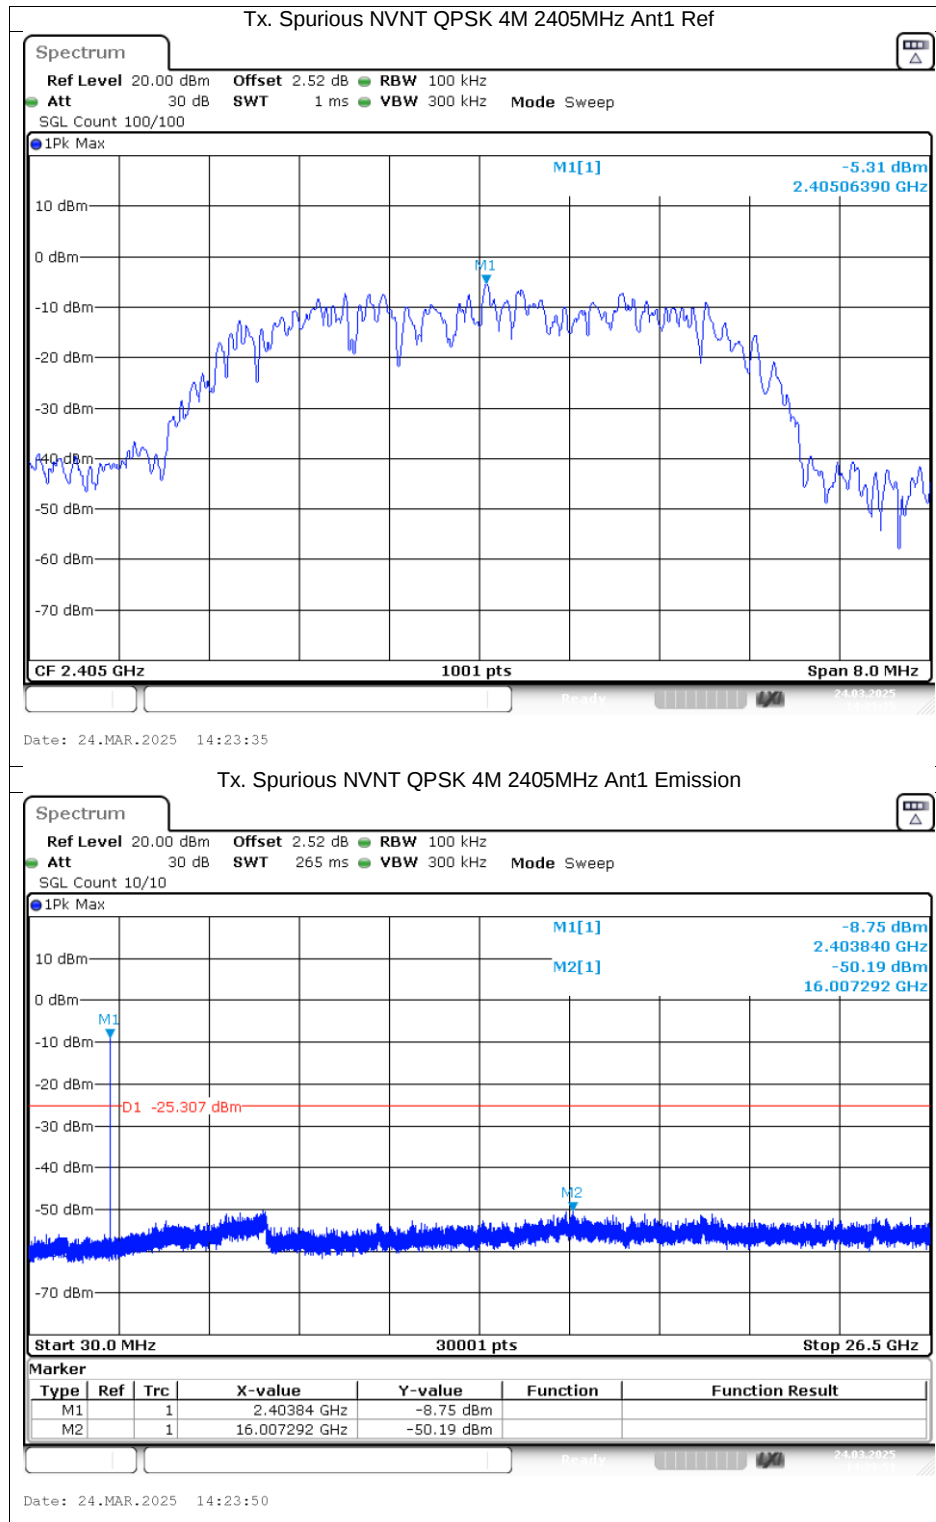

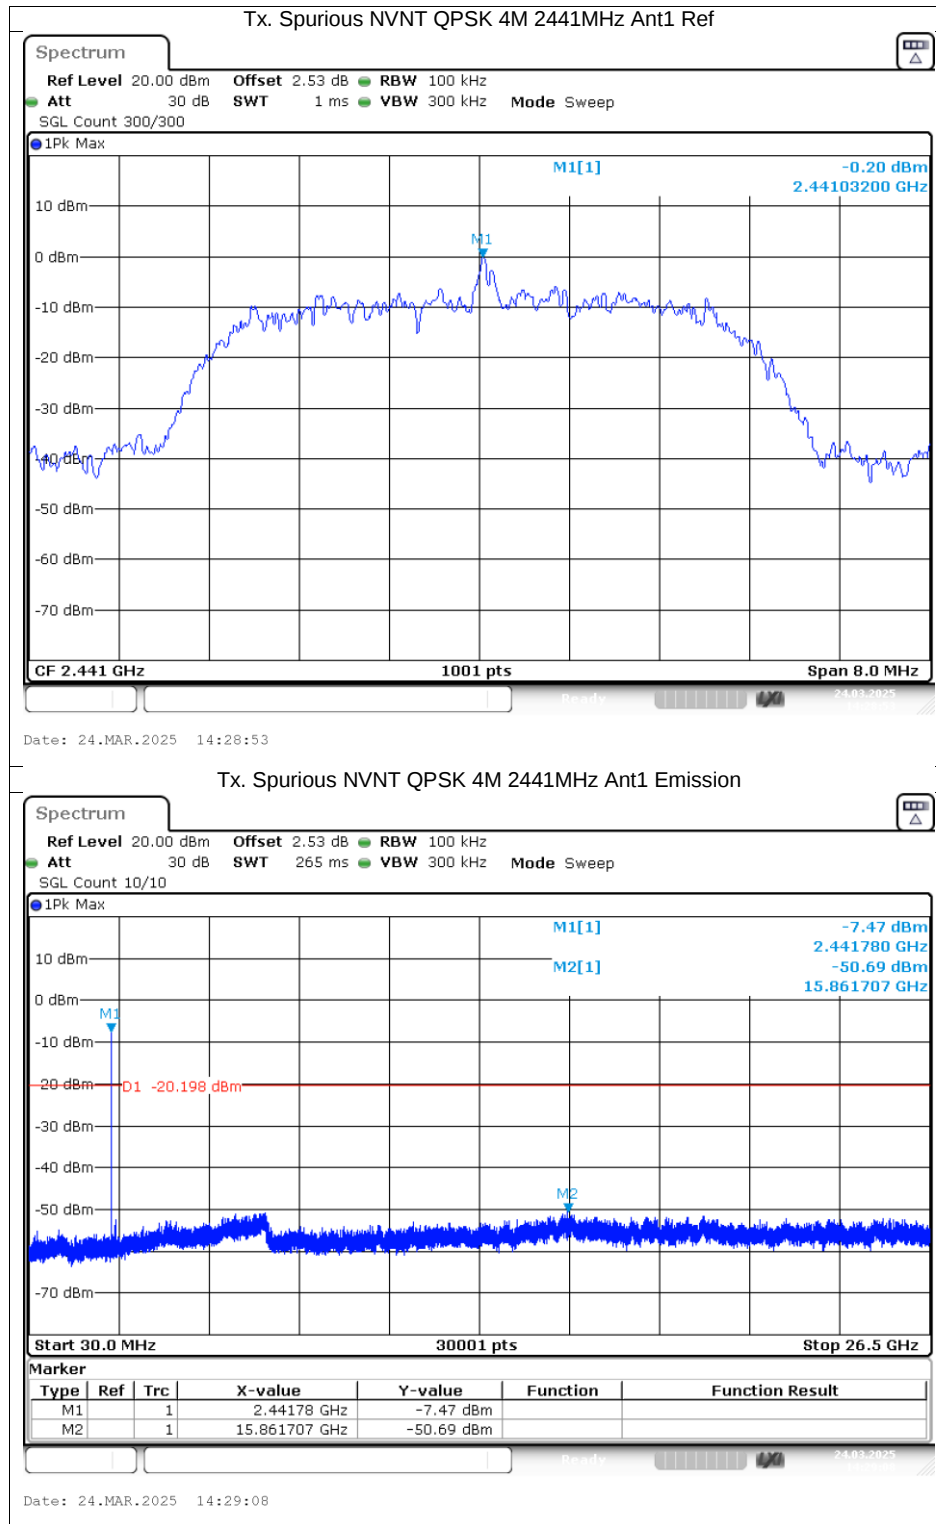

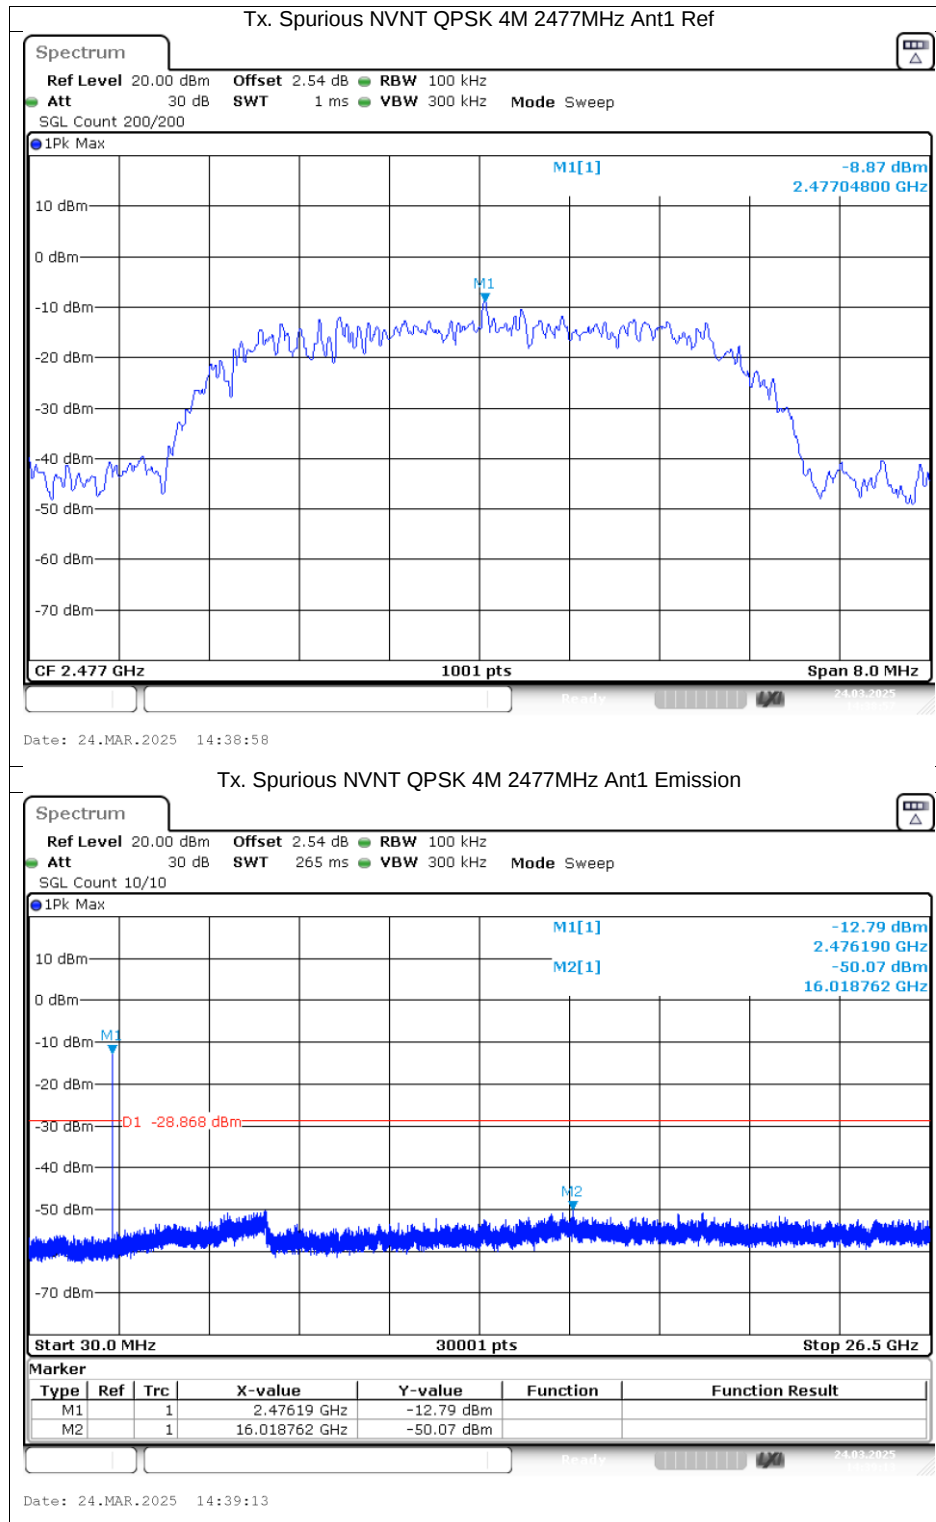

END OF REPORT