

Hotline: 400-003-0500 web: www.anbotech.com E-mail: service@anbotech.com

Appendix F: Bandedge

Condition	Antenna	Modulation	TX Mode	Ref_level(dBm)	Bandedge MAX.Value	Limit	Result
NVNT	ANT1	1-DH5	2402.00	0.792	-49.988	-19.208	Pass
NVNT	ANT1	1-DH5	Hopping_LCH	0.570	-58.393	-19.430	Pass
NVNT	ANT1	1-DH5	2480.00	-0.868	-62.596	-20.868	Pass
NVNT	ANT1	1-DH5	Hopping_HCH	0.169	-58.003	-19.831	Pass
NVNT	ANT1	2-DH5	2402.00	0.753	-48.962	-19.247	Pass
NVNT	ANT1	2-DH5	Hopping_LCH	0.826	-56.610	-19.174	Pass
NVNT	ANT1	2-DH5	2480.00	-0.821	-62.184	-20.821	Pass
NVNT	ANT1	2-DH5	Hopping_HCH	-0.048	-59.172	-20.048	Pass
NVNT	ANT1	3-DH5	2402.00	0.748	-49.743	-19.252	Pass
NVNT	ANT1	3-DH5	Hopping_LCH	0.392	-58.287	-19.608	Pass
NVNT	ANT1	3-DH5	2480.00	-0.845	-62.147	-20.845	Pass
NVNT	ANT1	3-DH5	Hopping_HCH	0.280	-58.048	-19.720	Pass

Remark:1. Regarding the spurious emissions from 30MHz to 26.5GHz, the cable lose have been set in the 'offset' of the Spectrum Analyzer during the test.

1_Reference_Level_NVNT_ANT1_1-DH5_2402_00




2_Bandedge_NVNT_ANT1_1-DH5_2402_00


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

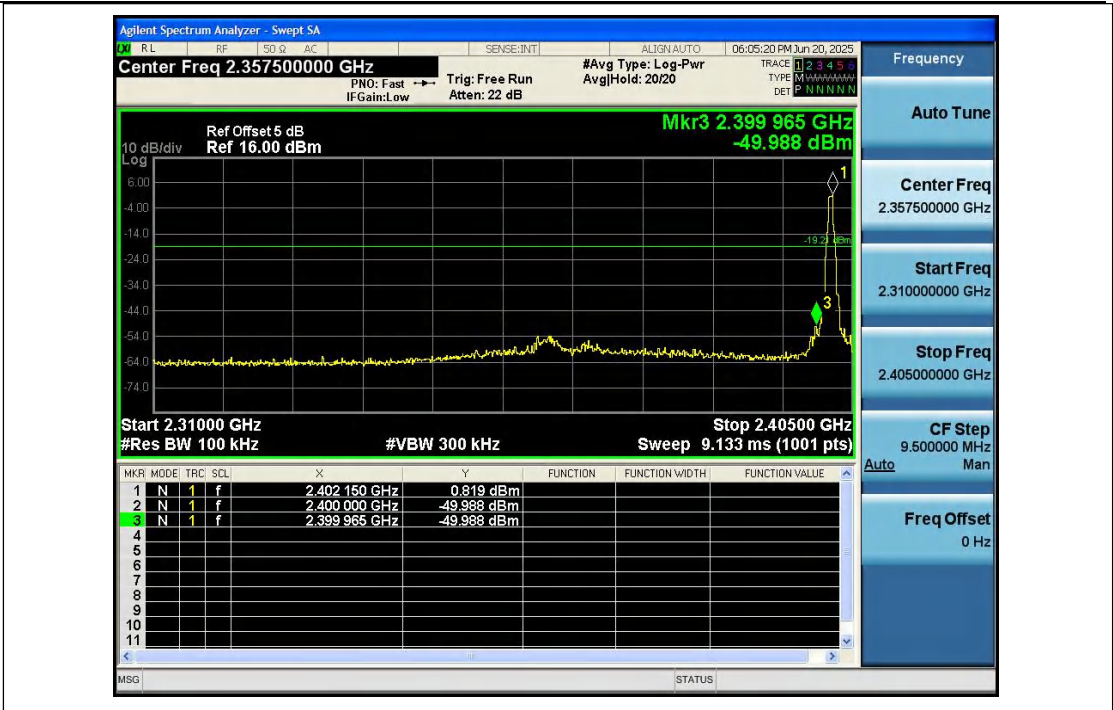


1_Reference_Level_Hopping_NVNT_ANT1_1-DH5_Hopping

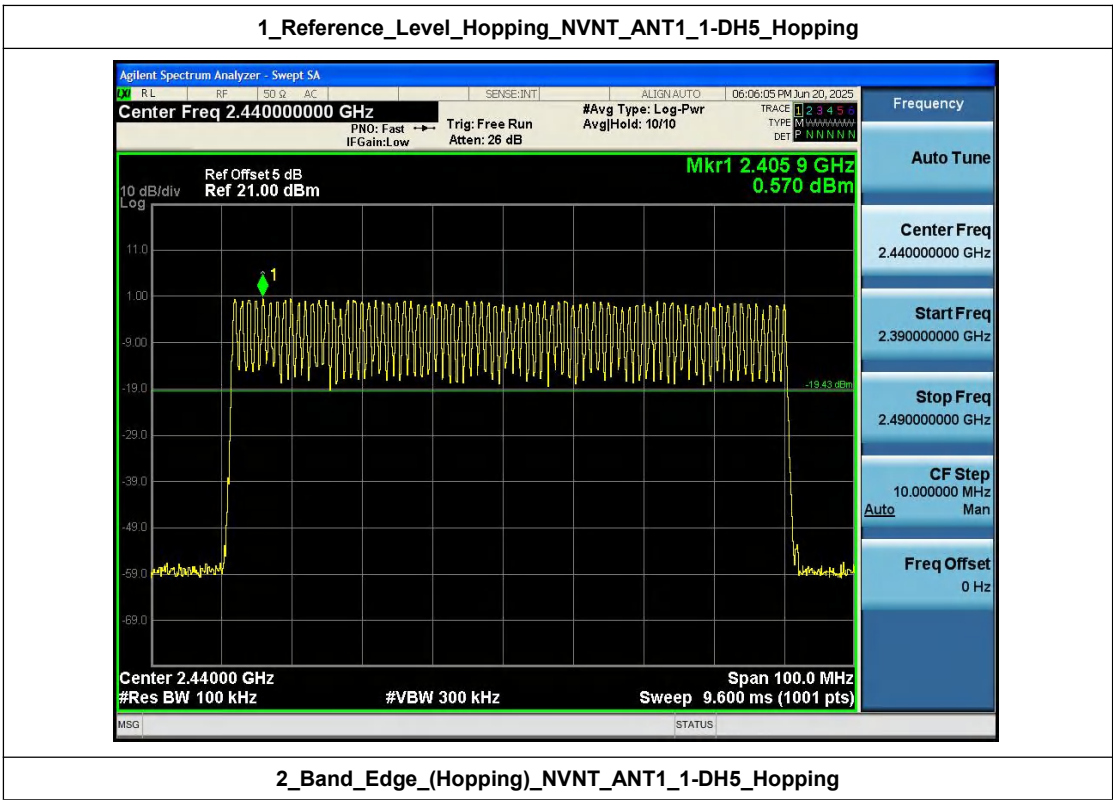


2_Band_Edge_(Hopping)_NVNT_ANT1_1-DH5_Hopping

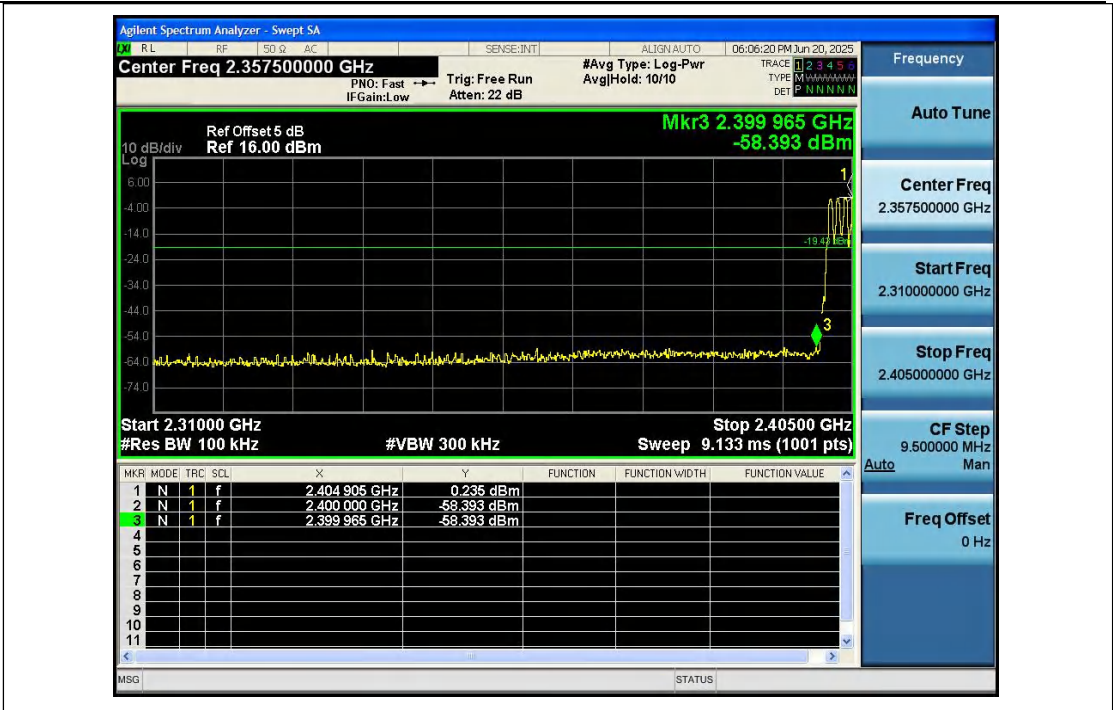


1_Reference_Level_NVNT_ANT1_1-DH5_2480_00

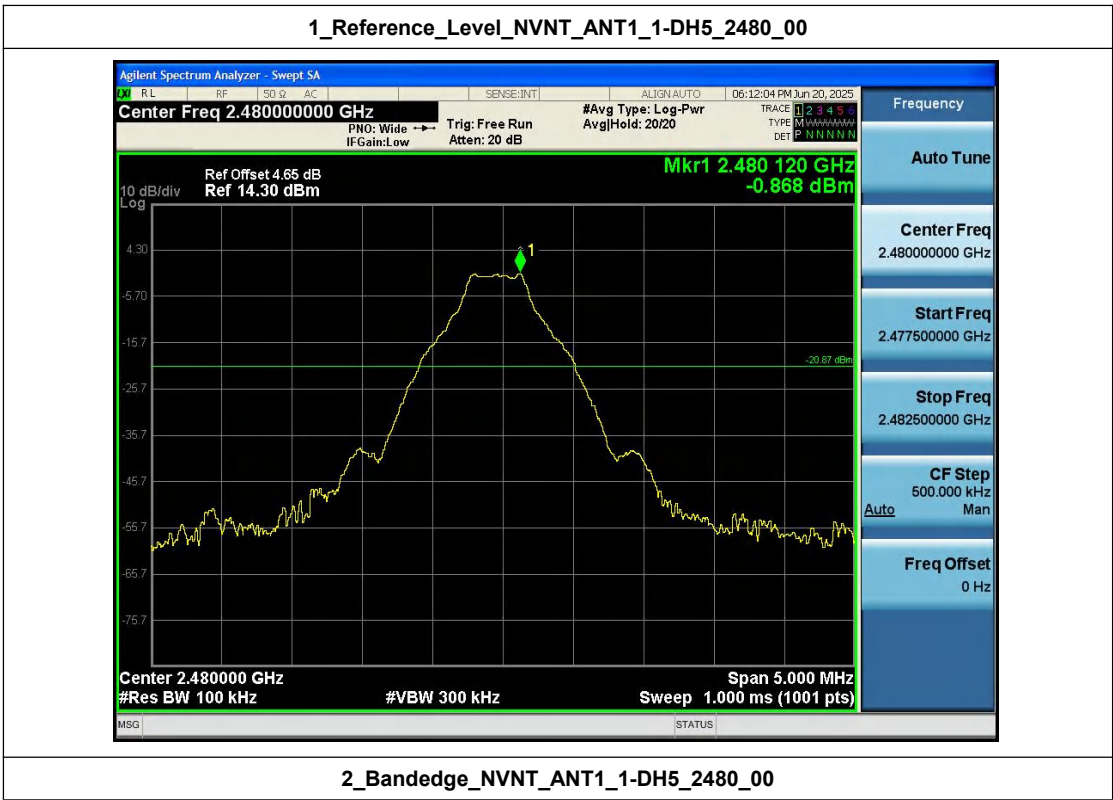


2_Bandedge_NVNT_ANT1_1-DH5_2480_00

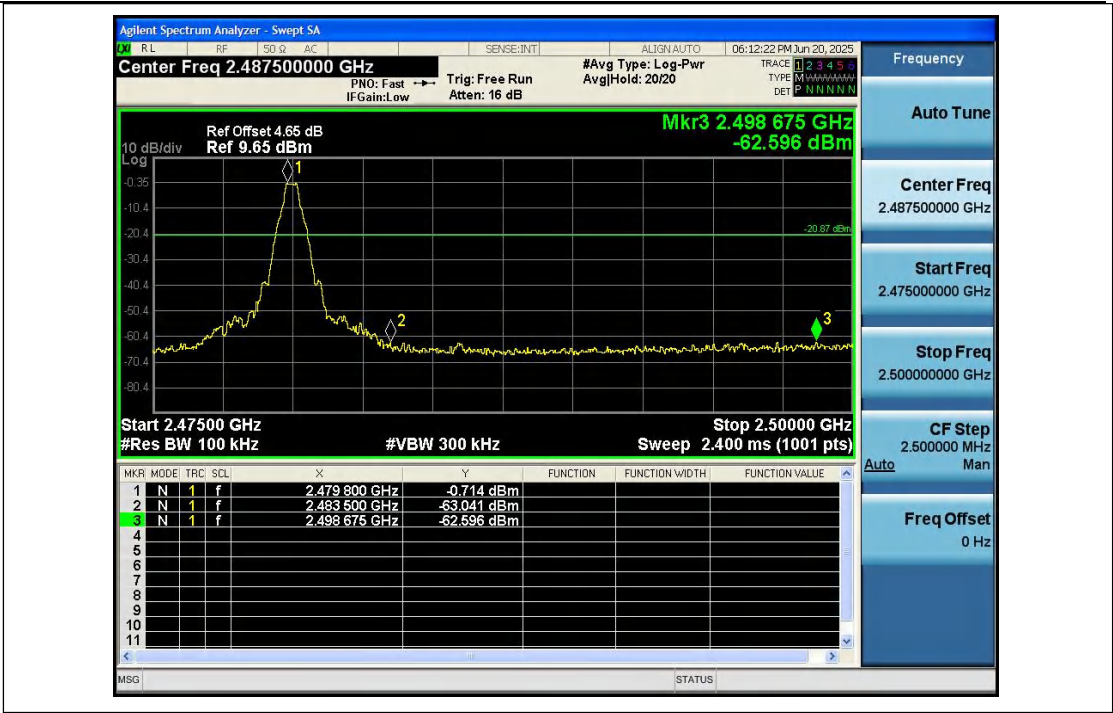


1_Reference_Level_Hopping_NVNT_ANT1_1-DH5_Hopping

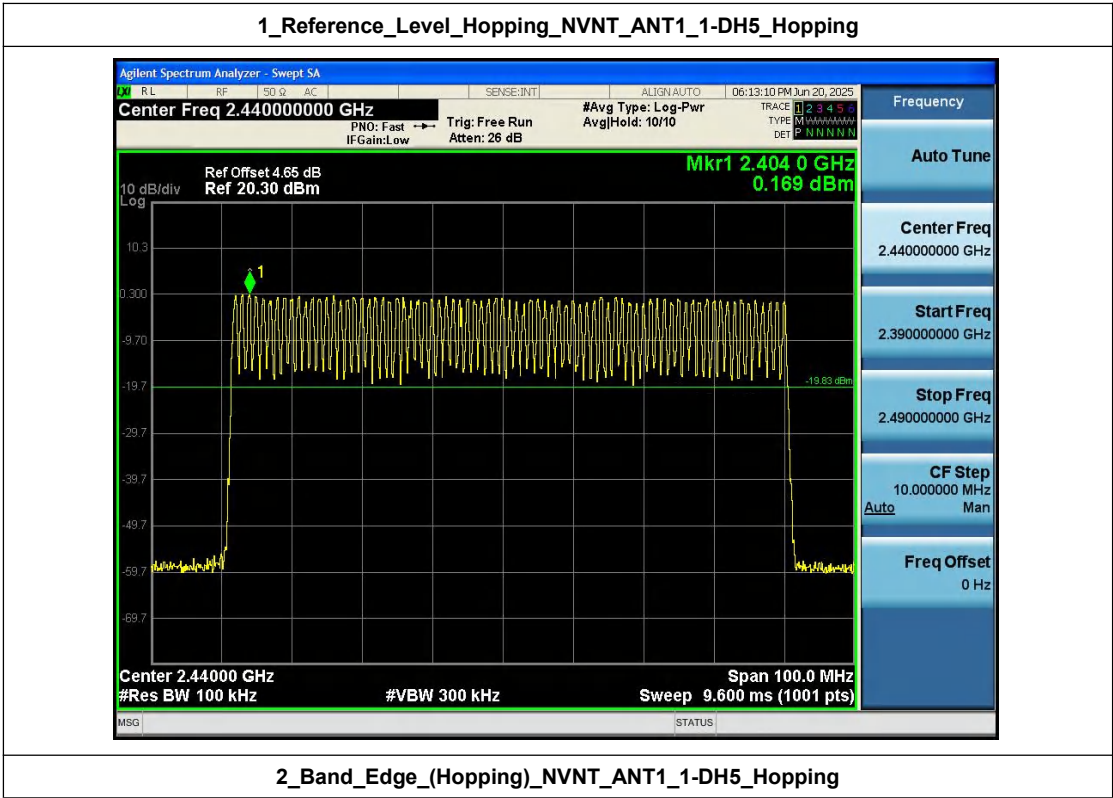


2_Band_Edge_(Hopping)_NVNT_ANT1_1-DH5_Hopping

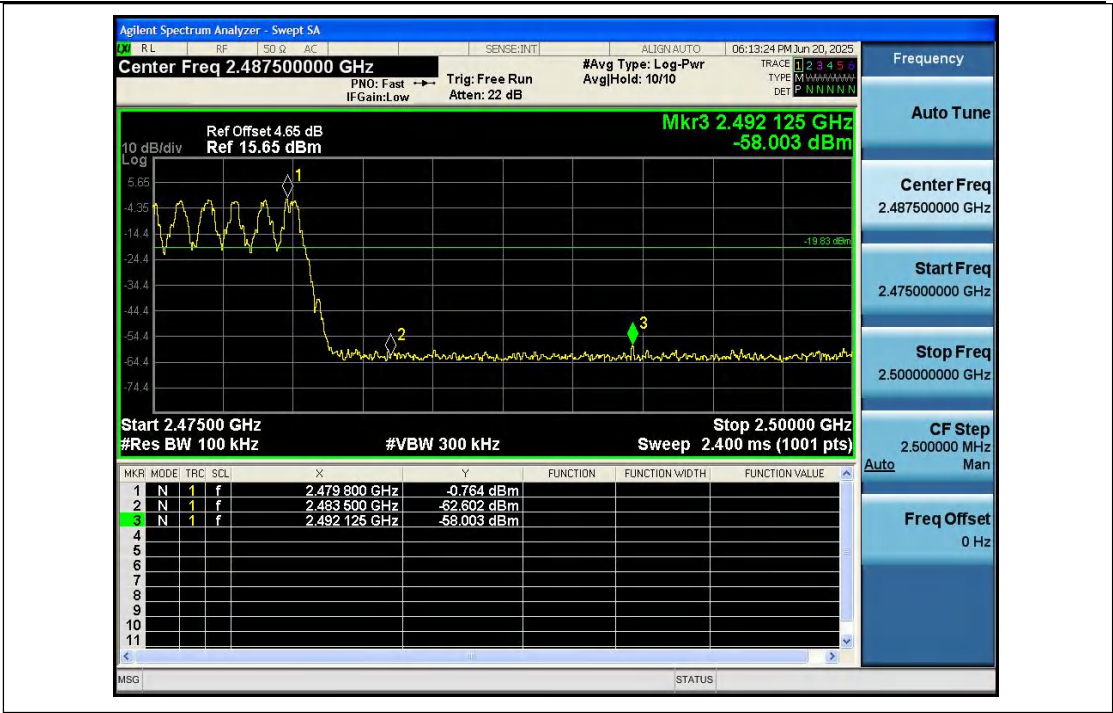


1_Reference_Level_NVNT_ANT1_2-DH5_2402_00

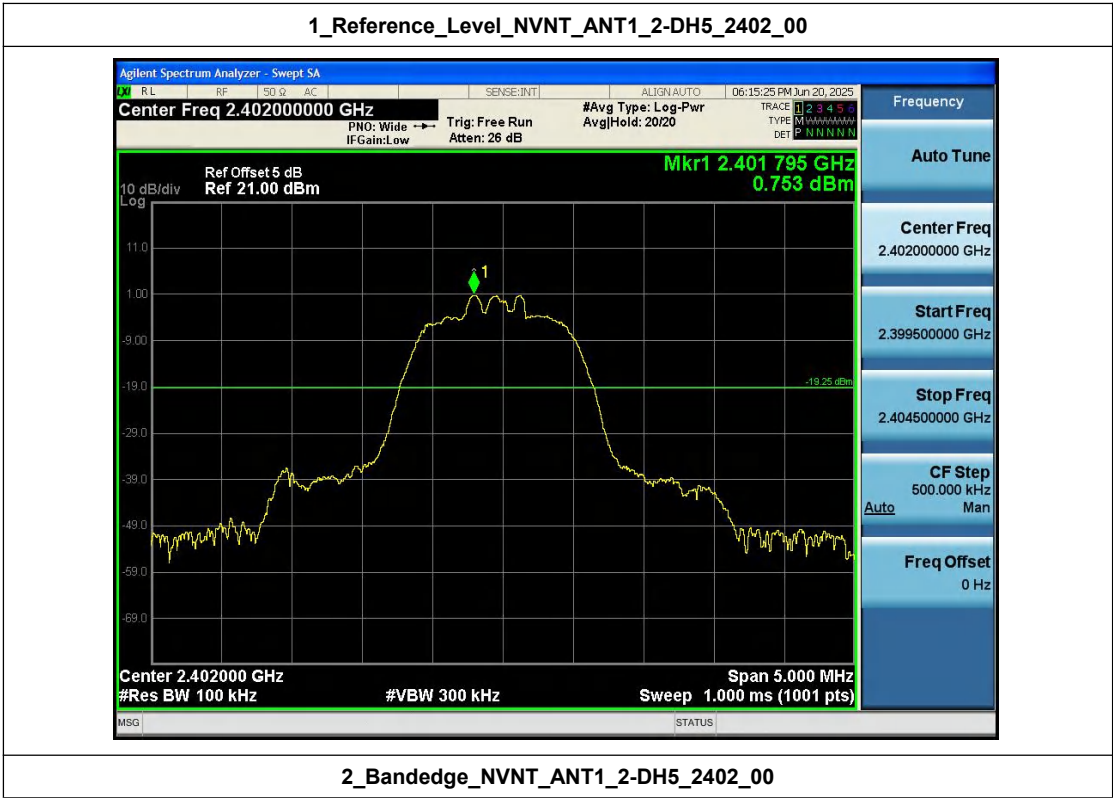


2_Bandedge_NVNT_ANT1_2-DH5_2402_00

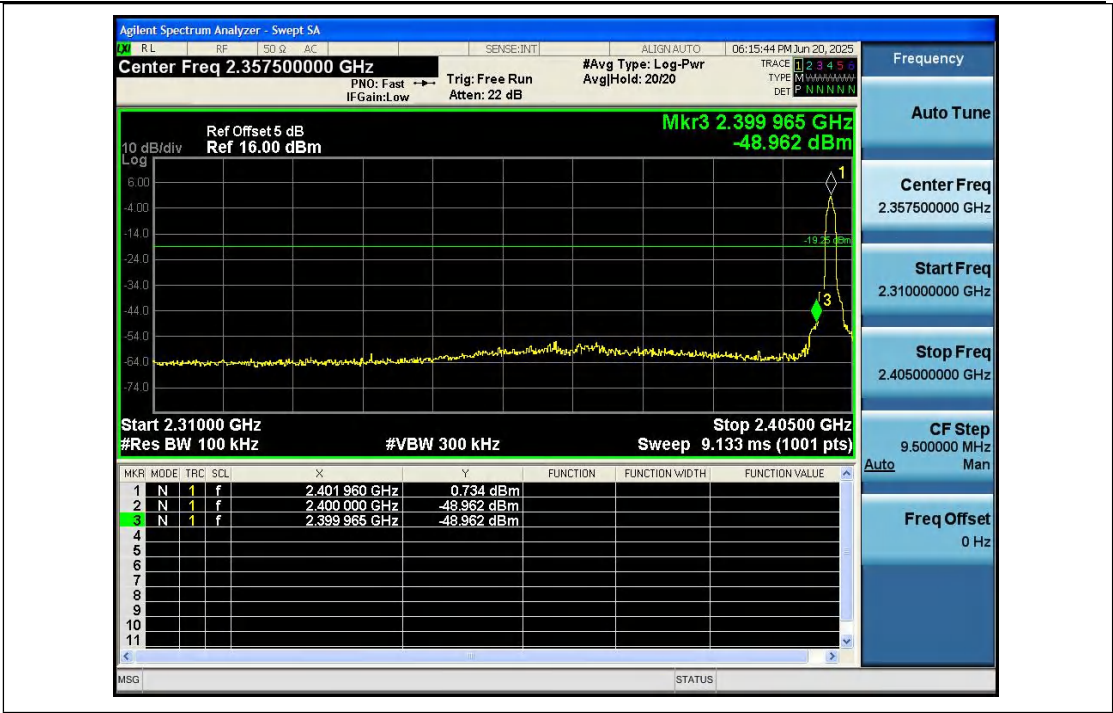


1_Reference_Level_Hopping_NVNT_ANT1_2-DH5_Hopping

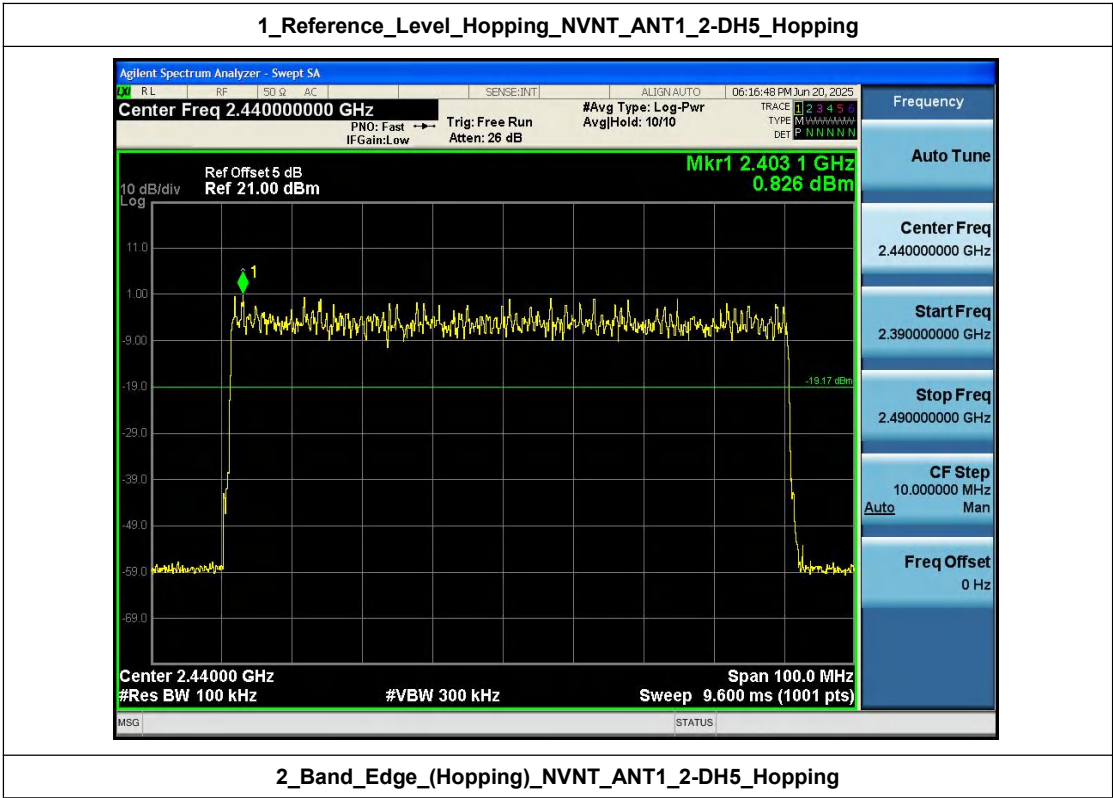


2_Band_Edge_(Hopping)_NVNT_ANT1_2-DH5_Hopping

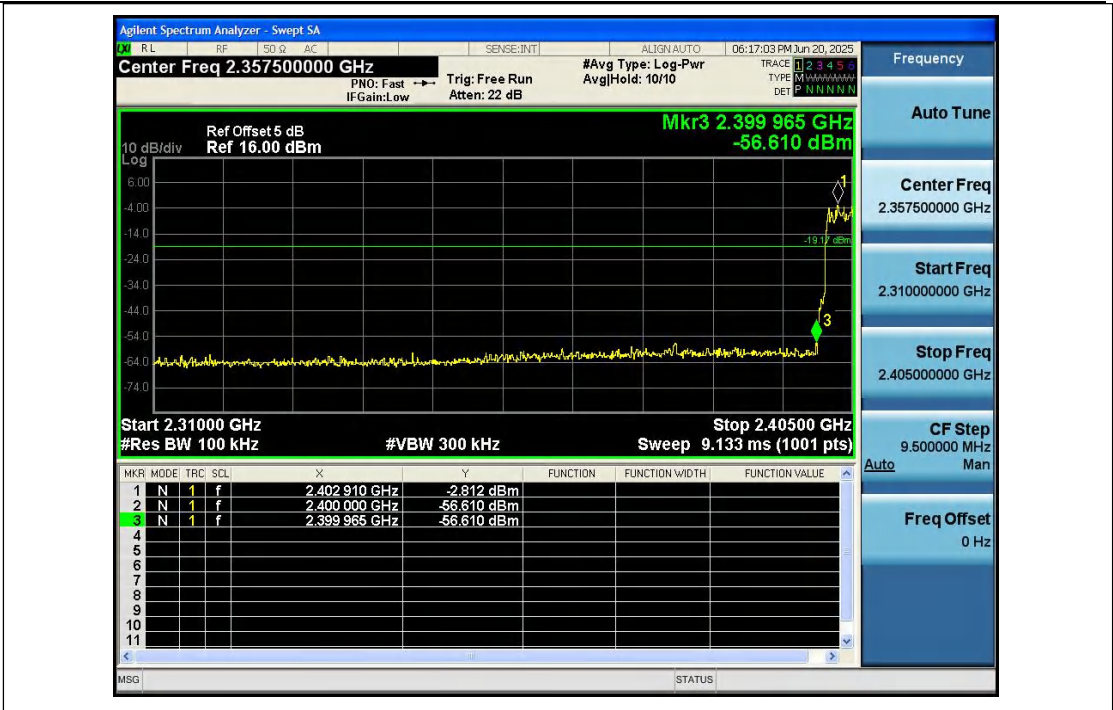


1_Reference_Level_NVNT_ANT1_2-DH5_2480_00

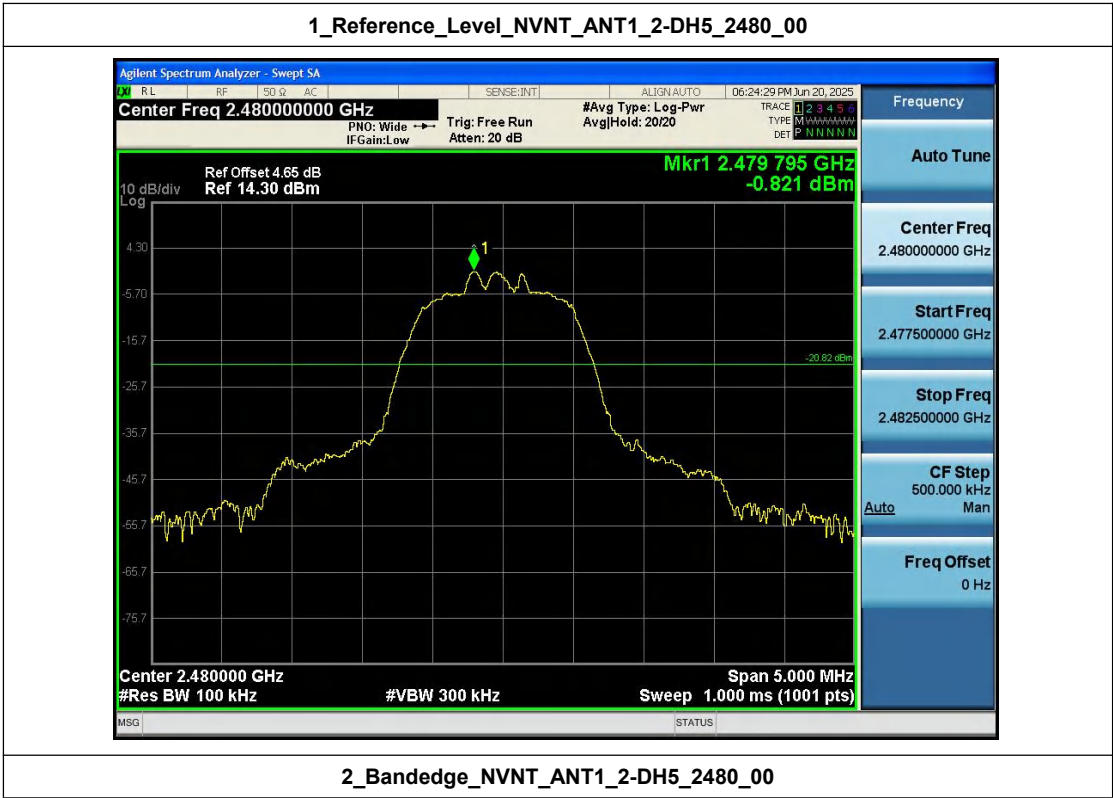


2_Bandedge_NVNT_ANT1_2-DH5_2480_00

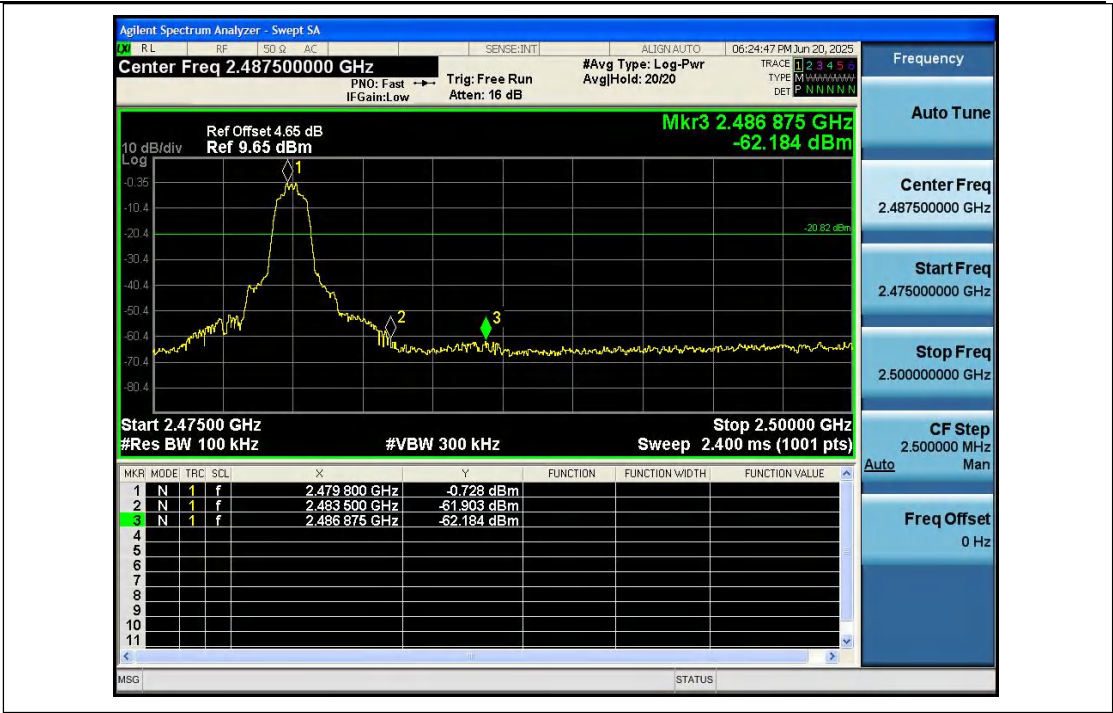


1_Reference_Level_Hopping_NVNT_ANT1_2-DH5_Hopping

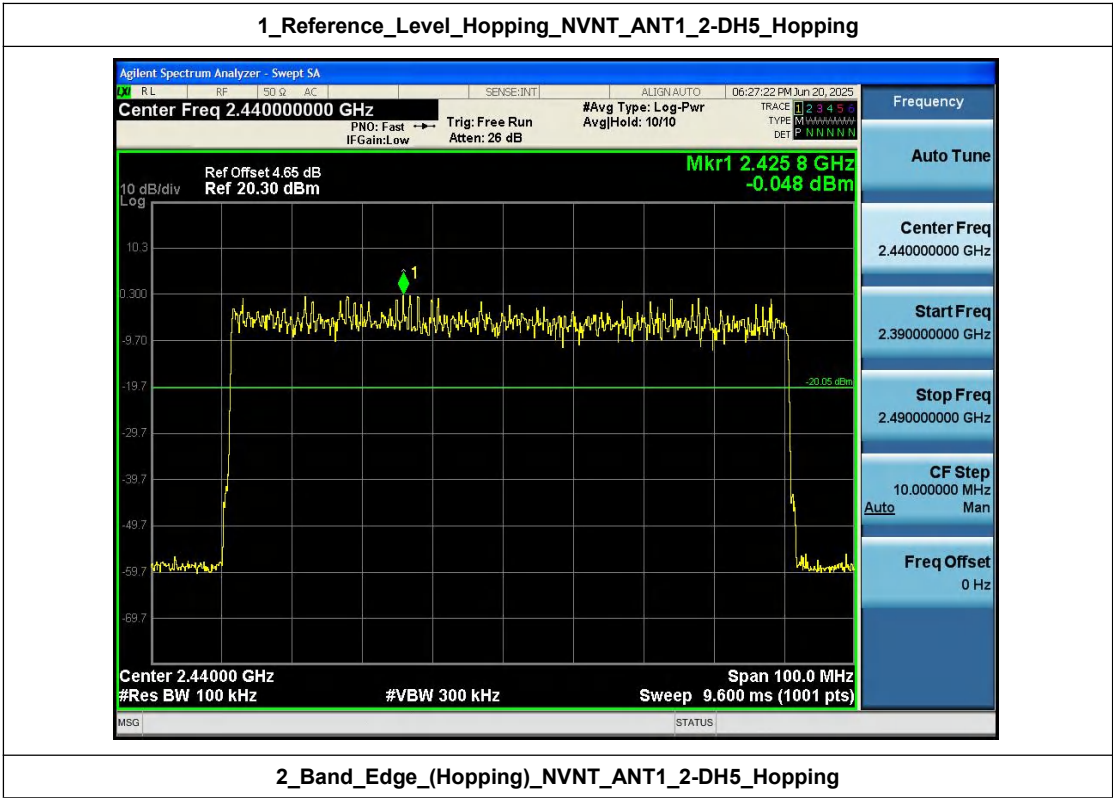


2_Band_Edge_(Hopping)_NVNT_ANT1_2-DH5_Hopping

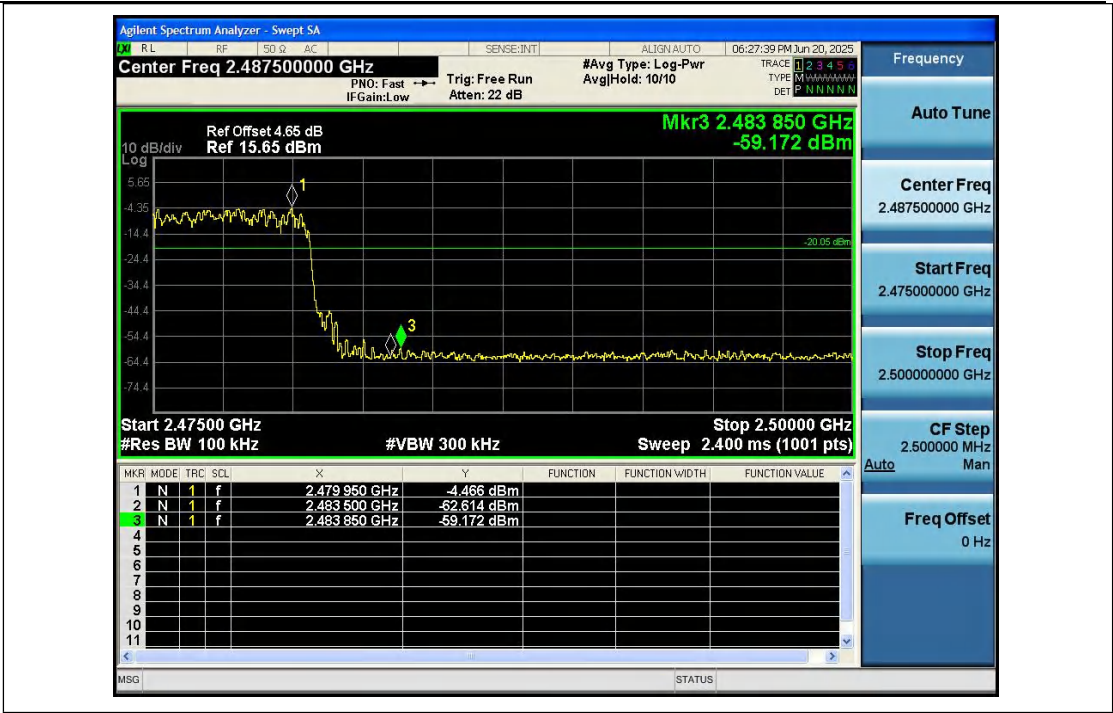


1_Reference_Level_NVNT_ANT1_3-DH5_2402_00

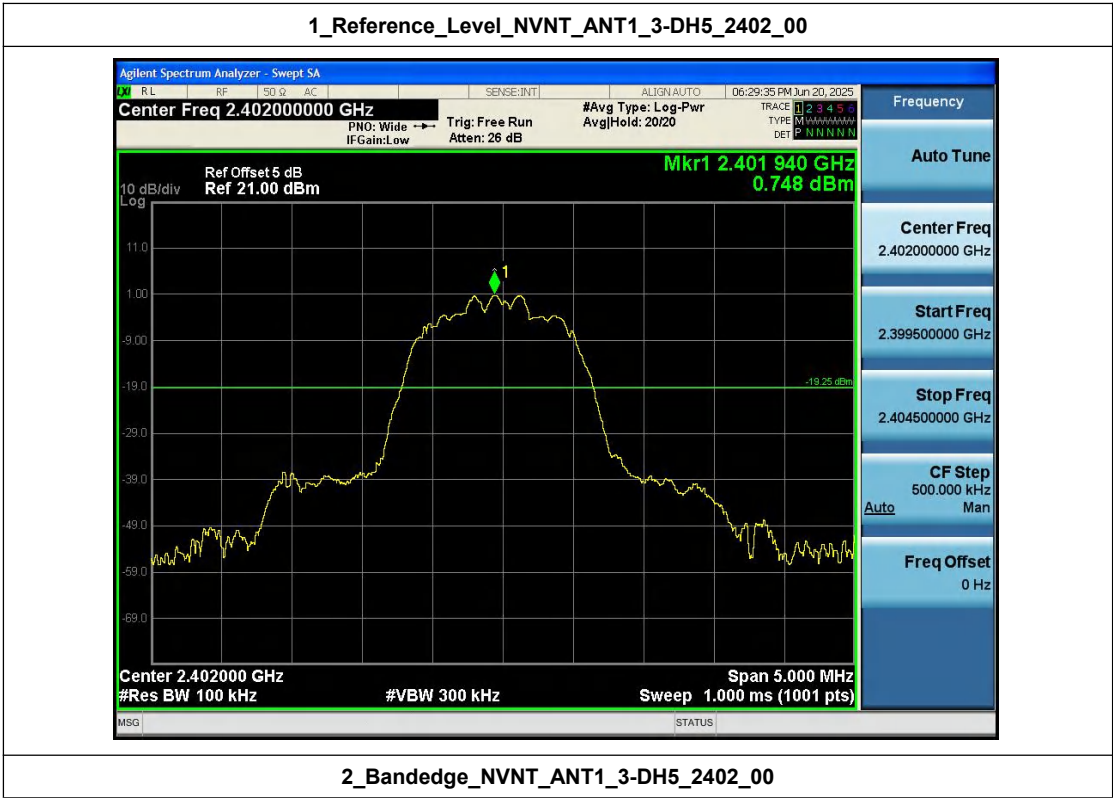


2_Bandedge_NVNT_ANT1_3-DH5_2402_00

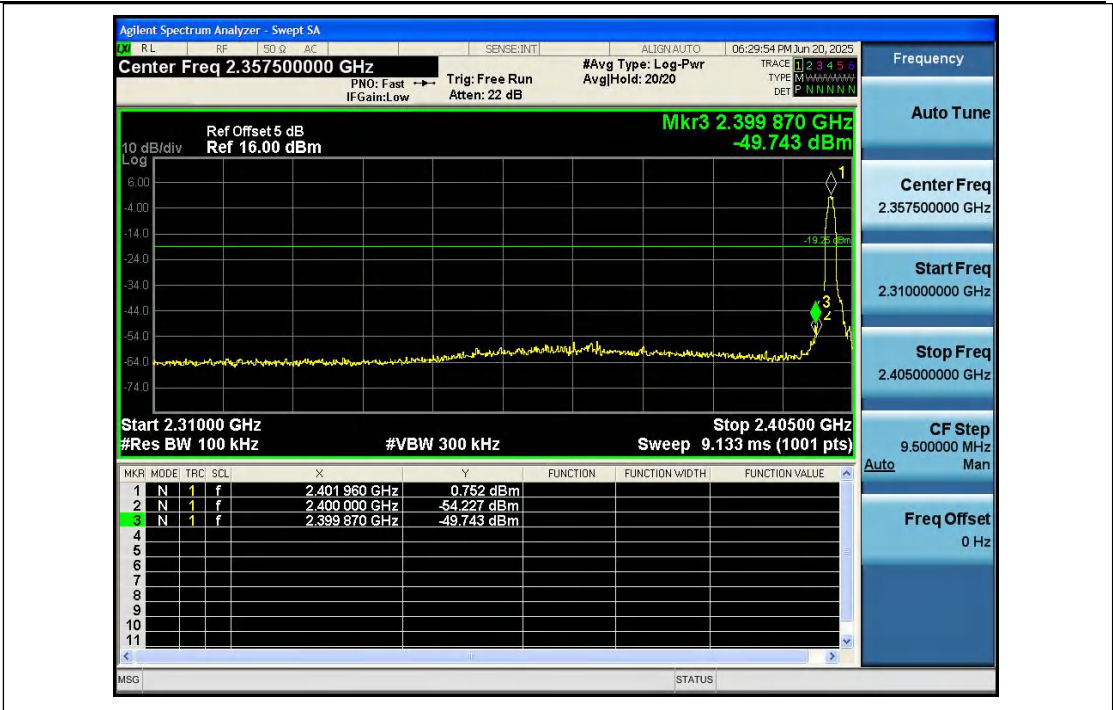


1_Reference_Level_Hopping_NVNT_ANT1_3-DH5_Hopping

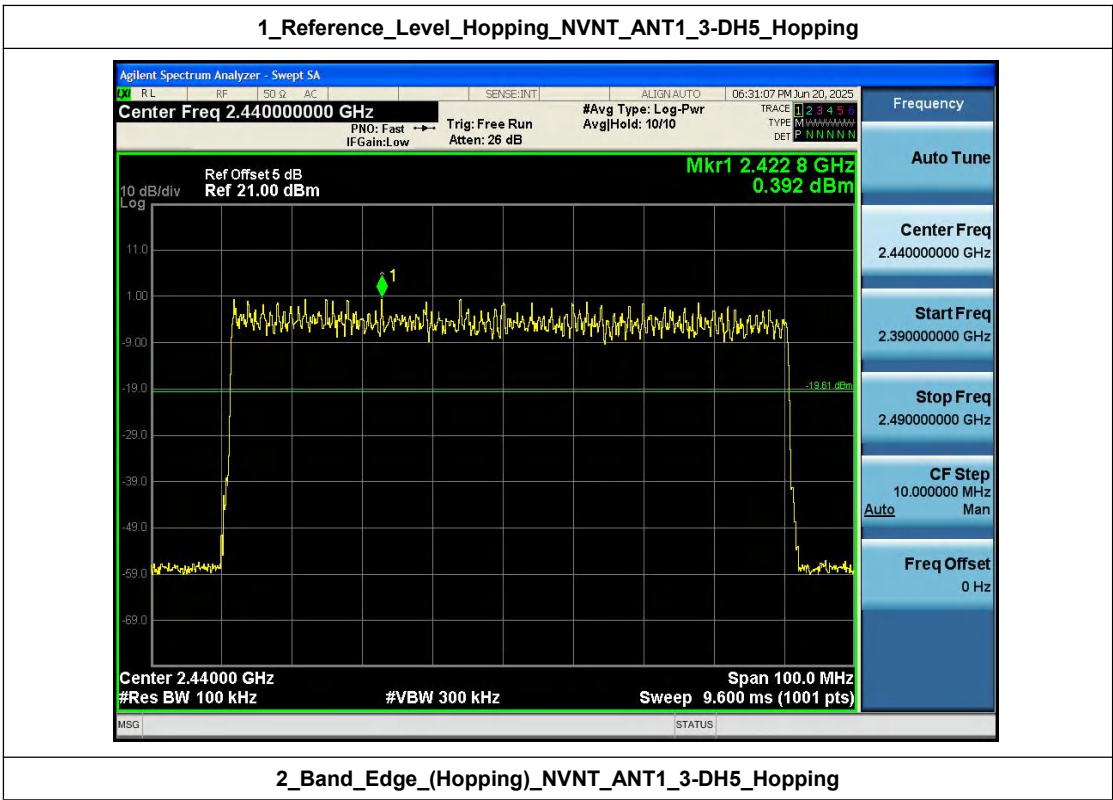

2_Band_Edge_(Hopping)_NVNT_ANT1_3-DH5_Hopping

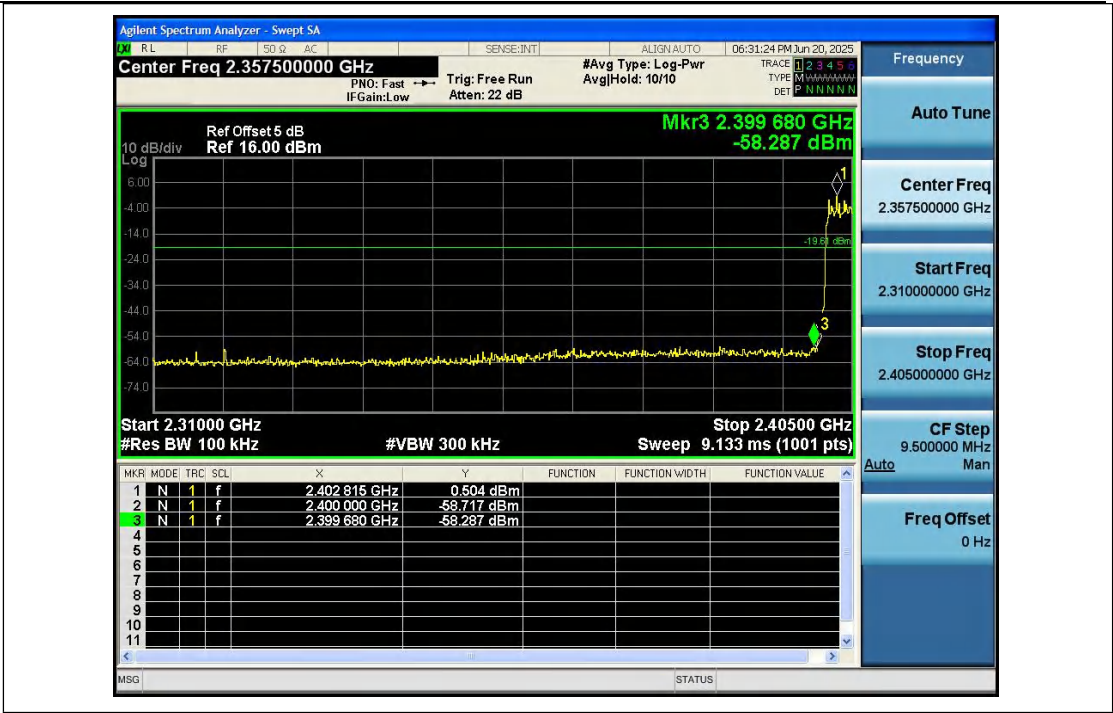

1_Reference_Level_NVNT_ANT1_3-DH5_2480_00

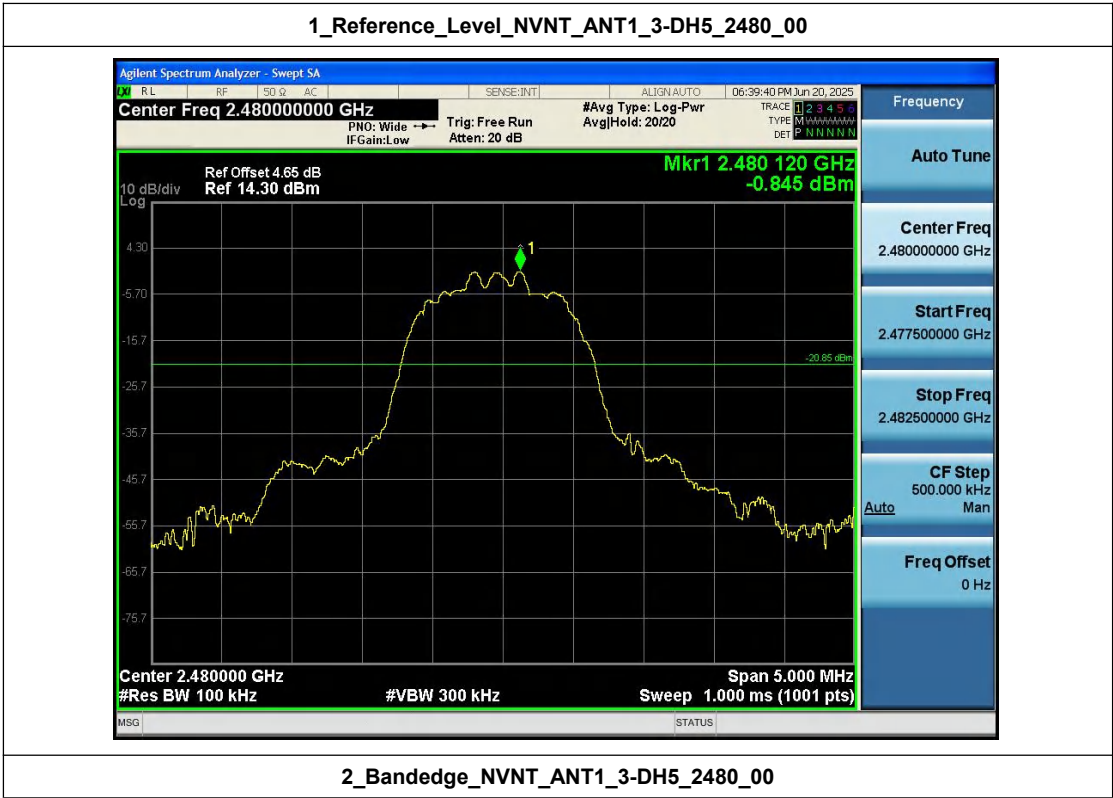


2_Bandedge_NVNT_ANT1_3-DH5_2480_00


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

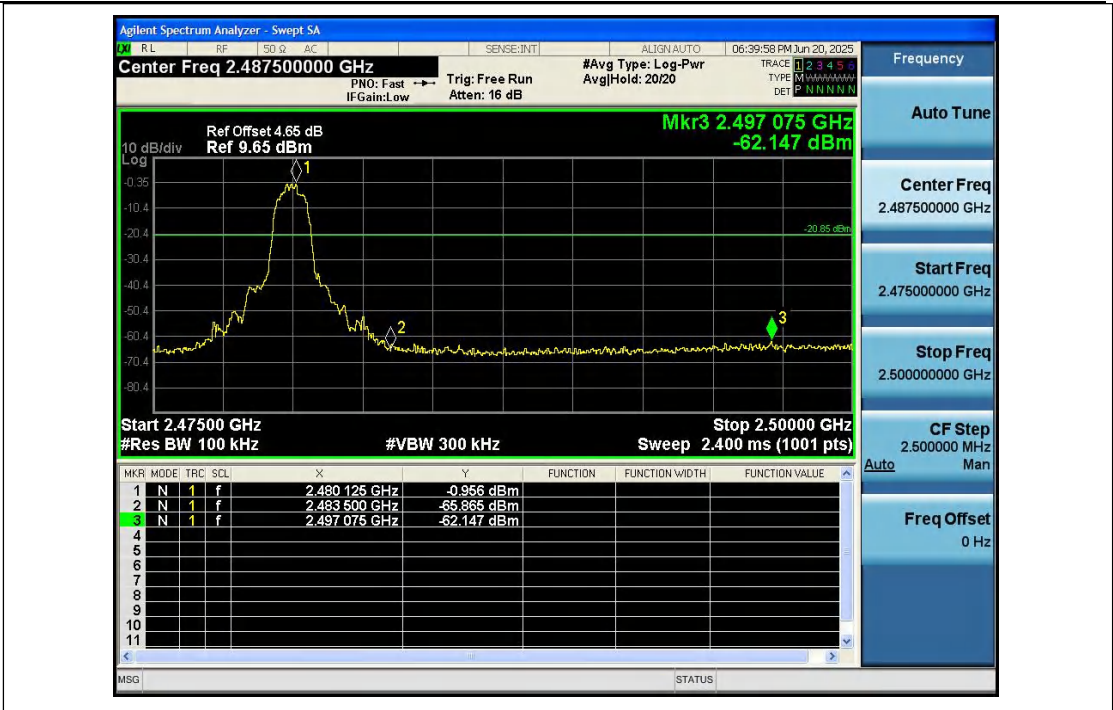

1_Reference_Level_Hopping_NVNT_ANT1_3-DH5_Hopping

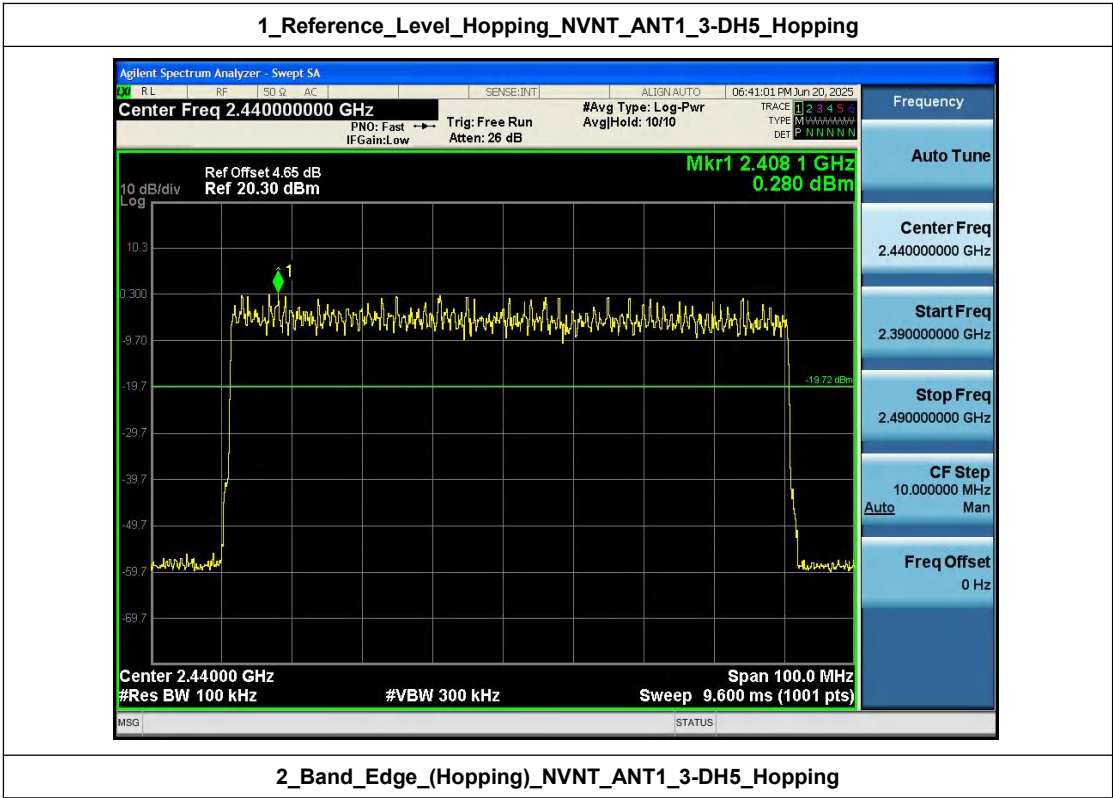

2_Band_Edge_(Hopping)_NVNT_ANT1_3-DH5_Hopping

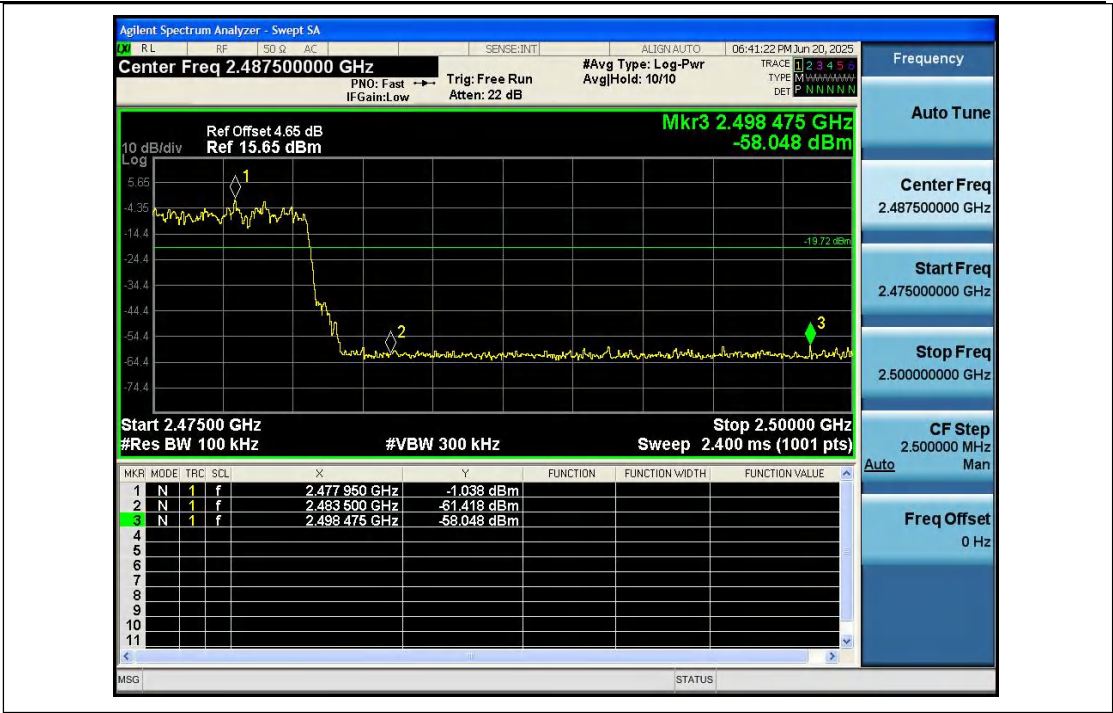

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix G: Carrier Frequencies Separation (Hopping)

Condition	Antenna	Modulation	Frequency(MHz)	Hopping NO.0 (MHz)	Hopping NO.1 (MHz)	Carrier Frequencies Separation(MHz)	Limit(MHz)	Result
NVNT	ANT1	1-DH5	2441.00	2440.789	2441.821	1.03	0.685	Pass
NVNT	ANT1	2-DH5	2441.00	2440.807	2441.773	0.97	0.873	Pass
NVNT	ANT1	3-DH5	2441.00	2440.834	2441.830	1.00	0.867	Pass


Carrier_Frequencies_Separation_(Hopping)_NVNT_ANT1_1-DH5_Hopping



Carrier_Frequencies_Separation_(Hopping)_NVNT_ANT1_2-DH5_Hopping




Carrier_Frequencies_Separation_(Hopping)_NVNT_ANT1_3-DH5_Hopping

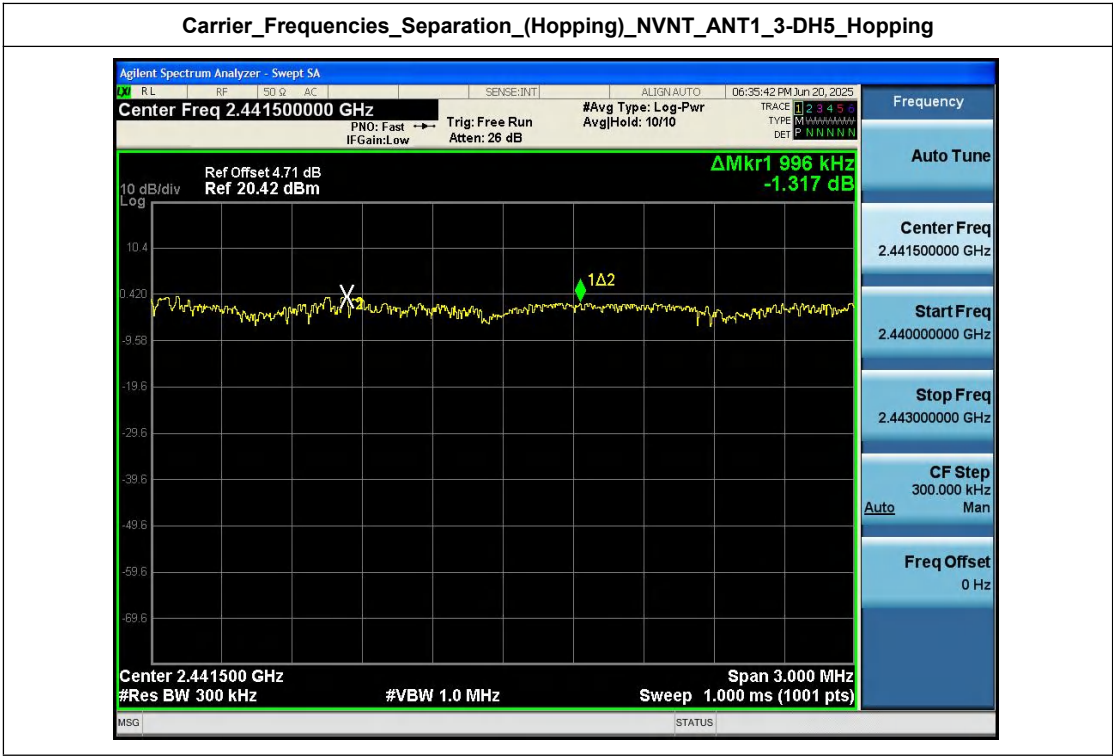


Appendix H: Number of Hopping Channel (Hopping)

Condition	Antenna	Modulation	Hopping Num	Limit	Result
NVNT	ANT1	1-DH5	79	15	Pass
NVNT	ANT1	2-DH5	79	15	Pass
NVNT	ANT1	3-DH5	79	15	Pass

Number_of_Hopping_Channel_(Hopping)_NVNT_ANT1_1-DH5_Hopping

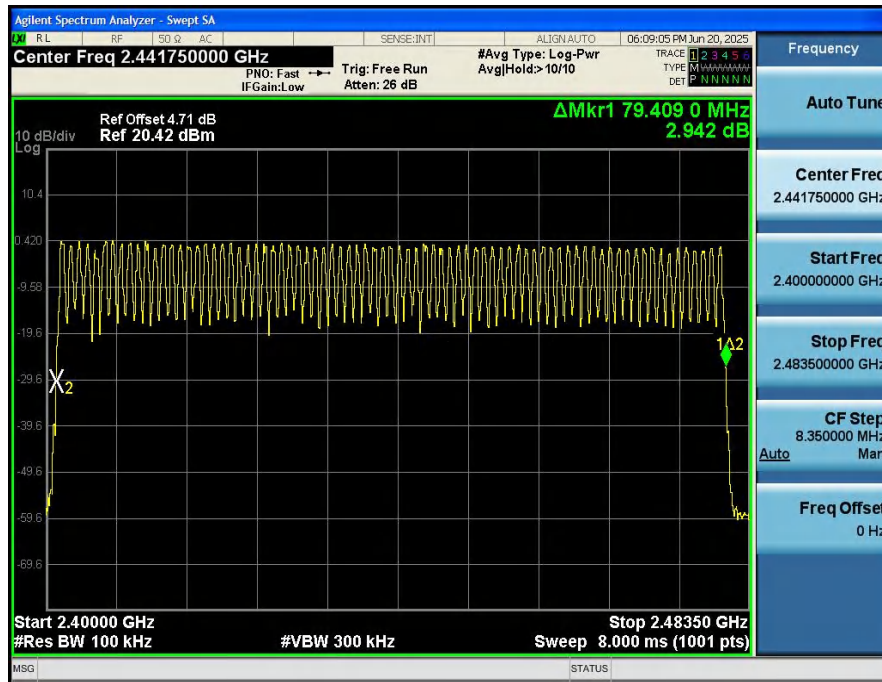


Number_of_Hopping_Channel_(Hopping)_NVNT_ANT1_2-DH5_Hopping

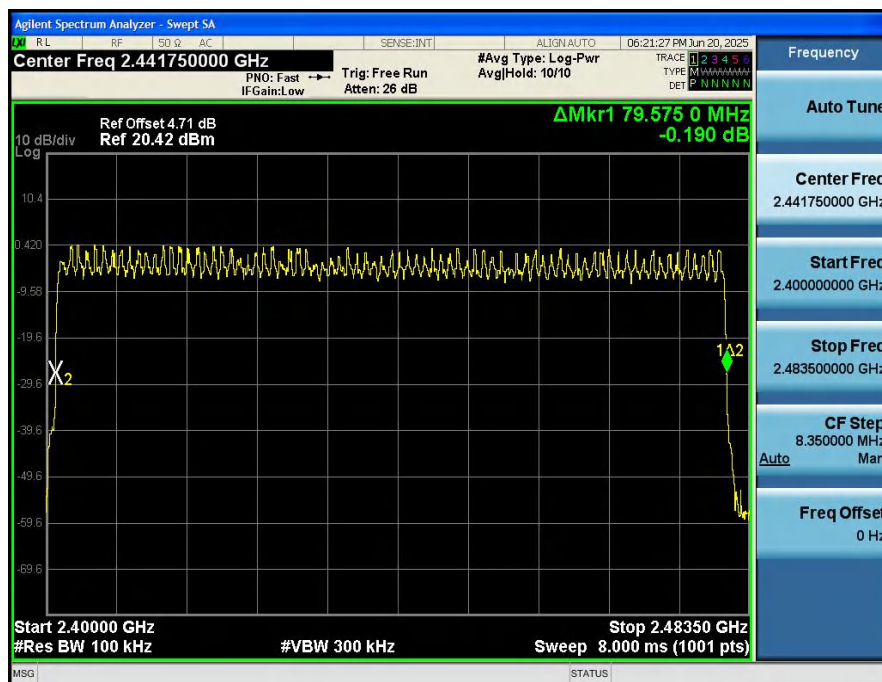

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

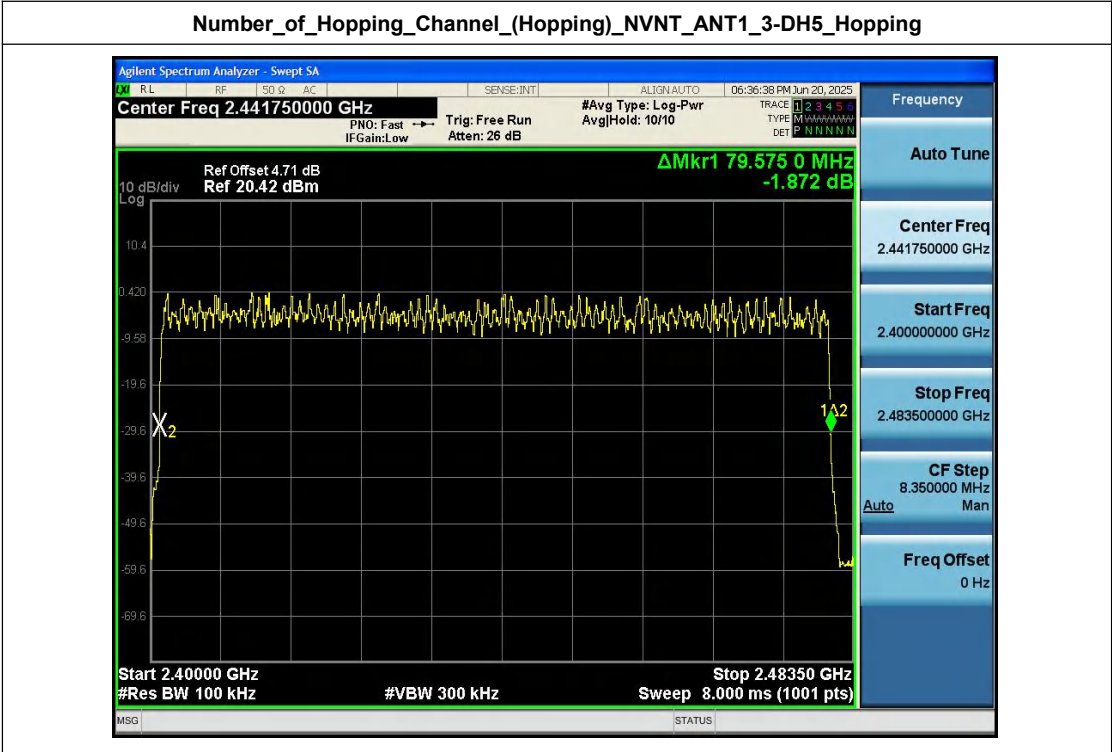

Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix I: Dwell Time (Hopping)

Condition	Antenna	Packet Type	Pulse Time(ms)	Hops	Dwell Time(ms)	Limit(s)	Result
NVNT	ANT1	1-DH5	2.890	95.00	274.550	0.40	Pass
NVNT	ANT1	2-DH5	2.900	91.00	263.900	0.40	Pass
NVNT	ANT1	3-DH5	2.910	110.00	320.100	0.40	Pass
NVNT	ANT1	1-DH1	0.390	320.00	124.800	0.40	Pass
NVNT	ANT1	1-DH3	1.650	159.00	262.350	0.40	Pass
NVNT	ANT1	2-DH1	0.400	319.00	127.600	0.40	Pass
NVNT	ANT1	2-DH3	1.660	167.00	277.220	0.40	Pass
NVNT	ANT1	3-DH1	0.410	320.00	131.200	0.40	Pass
NVNT	ANT1	3-DH3	1.660	162.00	268.920	0.40	Pass


Dwell_Time_(Hopping)_NVNT_ANT1_1-DH5_2441_00_One_Burst_Time

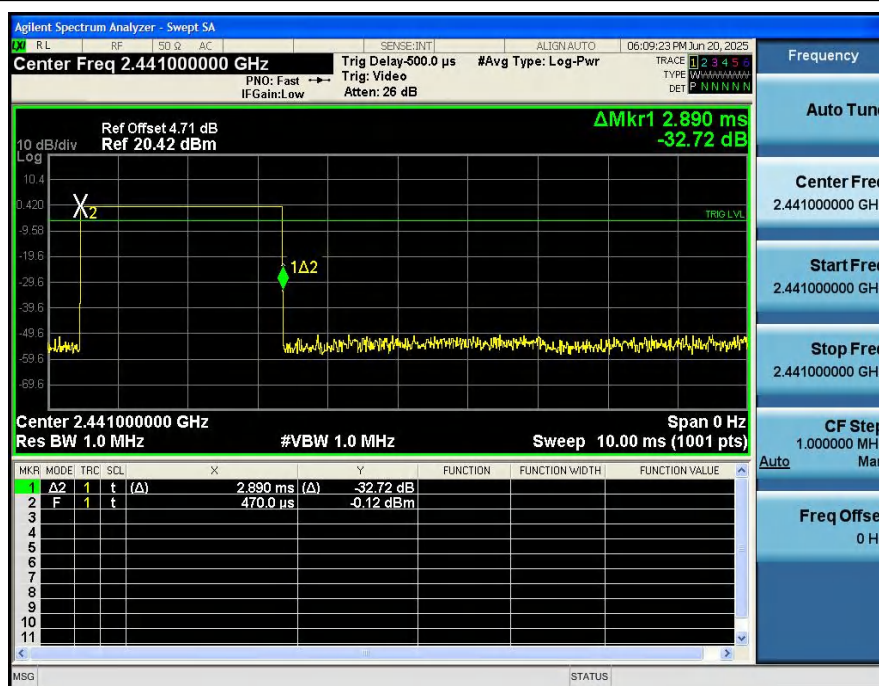


Dwell_Time_(Hopping)_NVNT_ANT1_1-DH5_2441_00_Accumulated

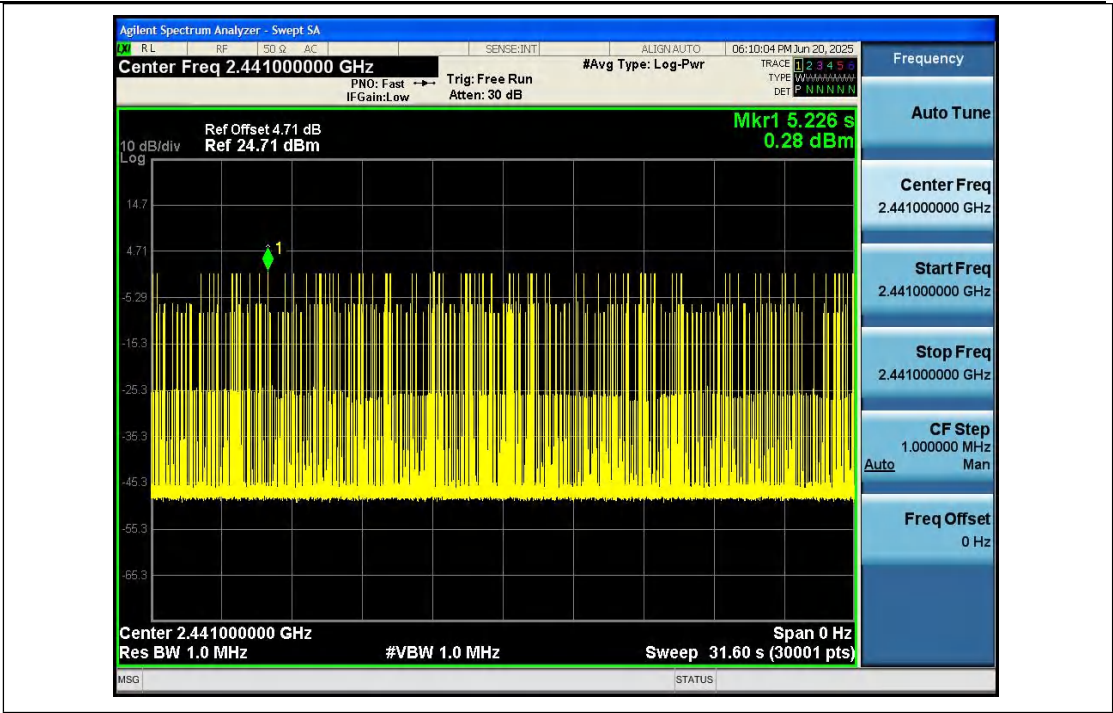


Dwell_Time_(Hopping)_NVNT_ANT1_2-DH5_2441_00_One_Burst_Time

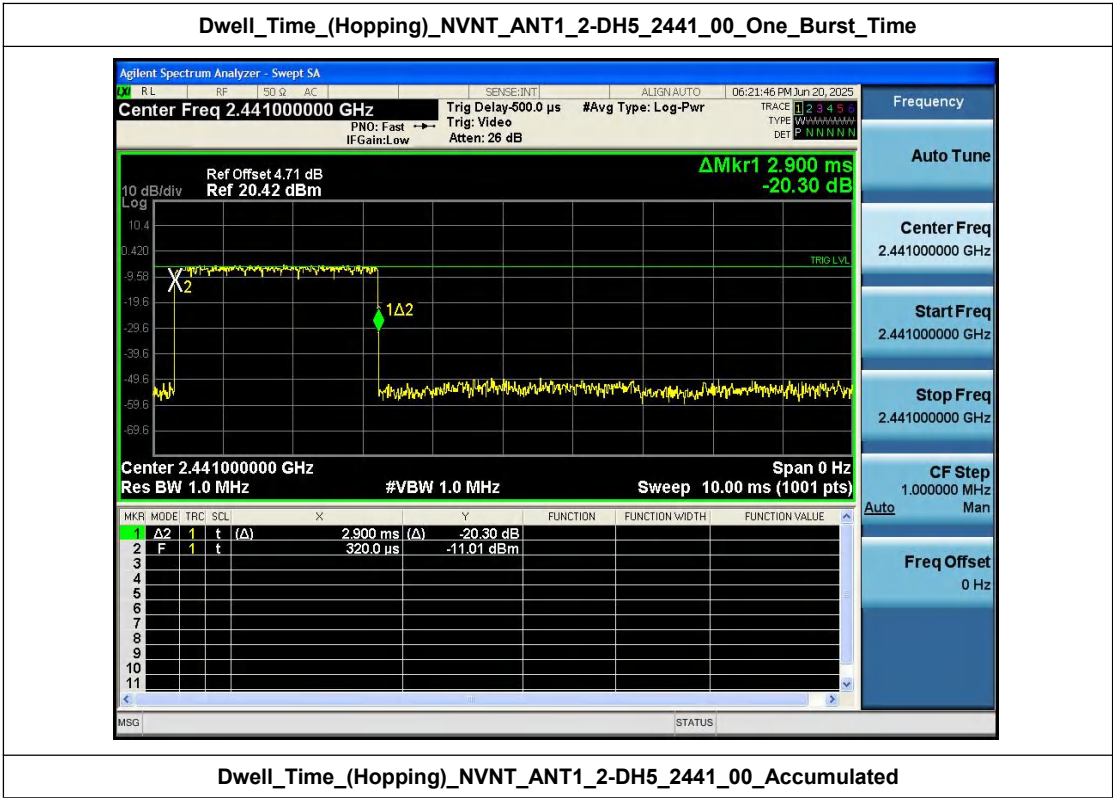

Dwell_Time_(Hopping)_NVNT_ANT1_2-DH5_2441_00_Accumulated

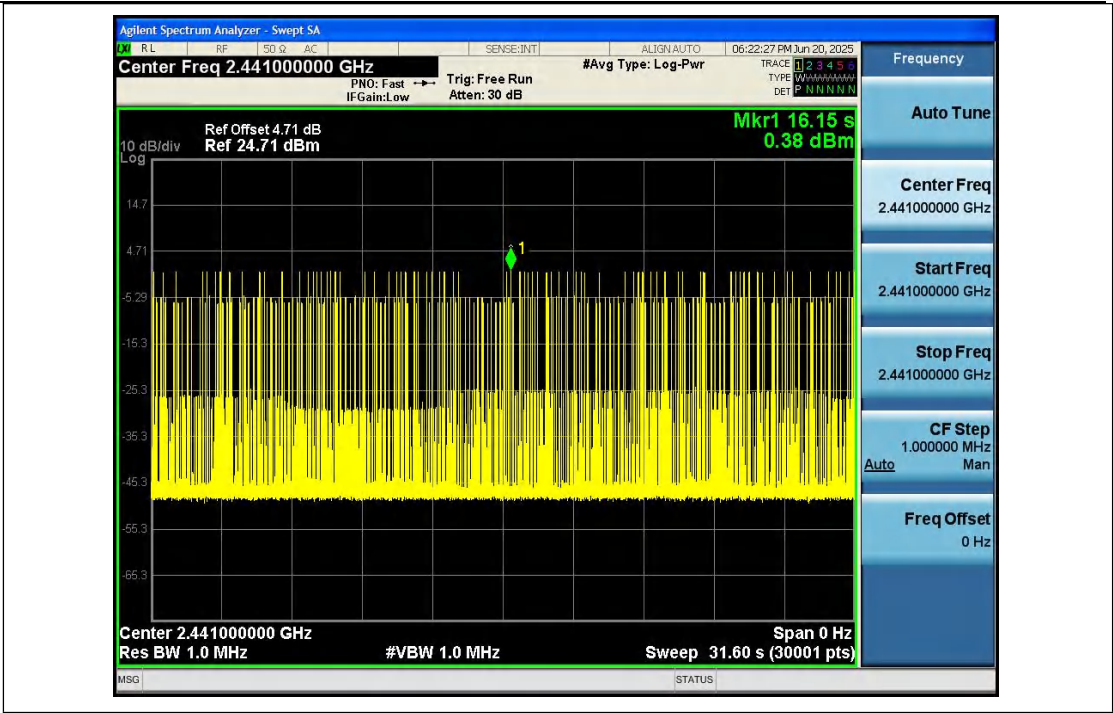

Dwell_Time_(Hopping)_NVNT_ANT1_3-DH5_2441_00_One_Burst_Time

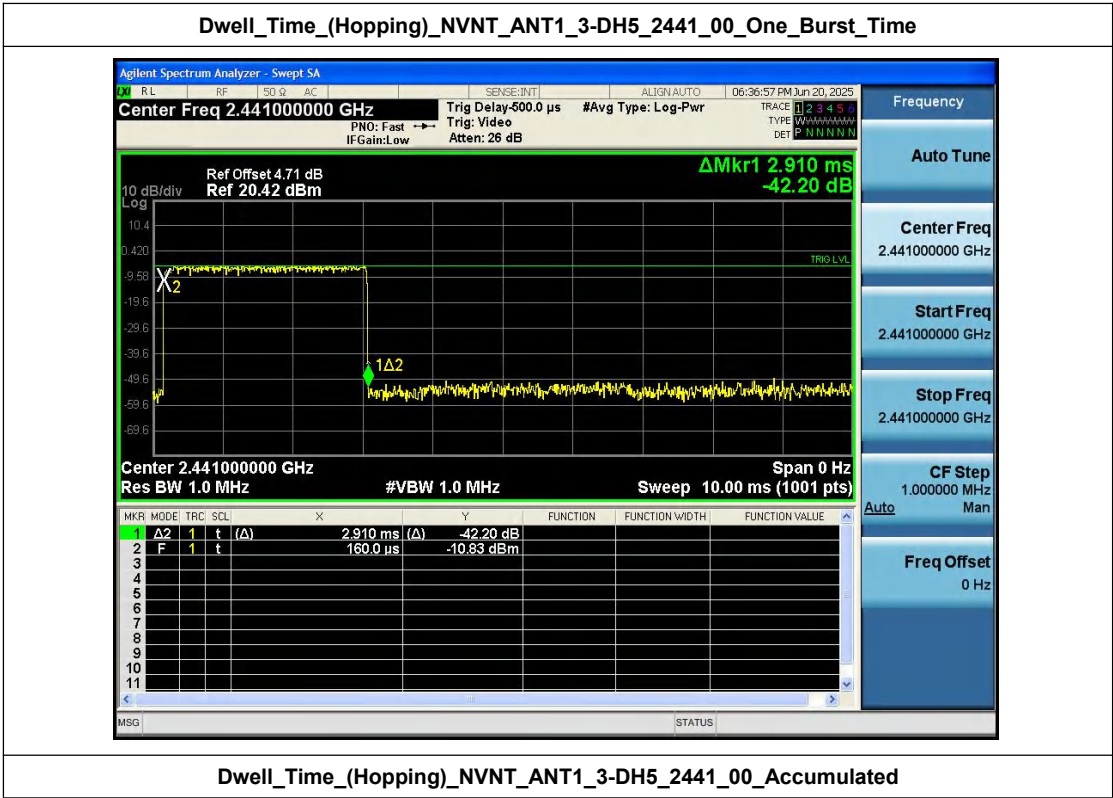


Dwell_Time_(Hopping)_NVNT_ANT1_3-DH5_2441_00_Accumulated


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

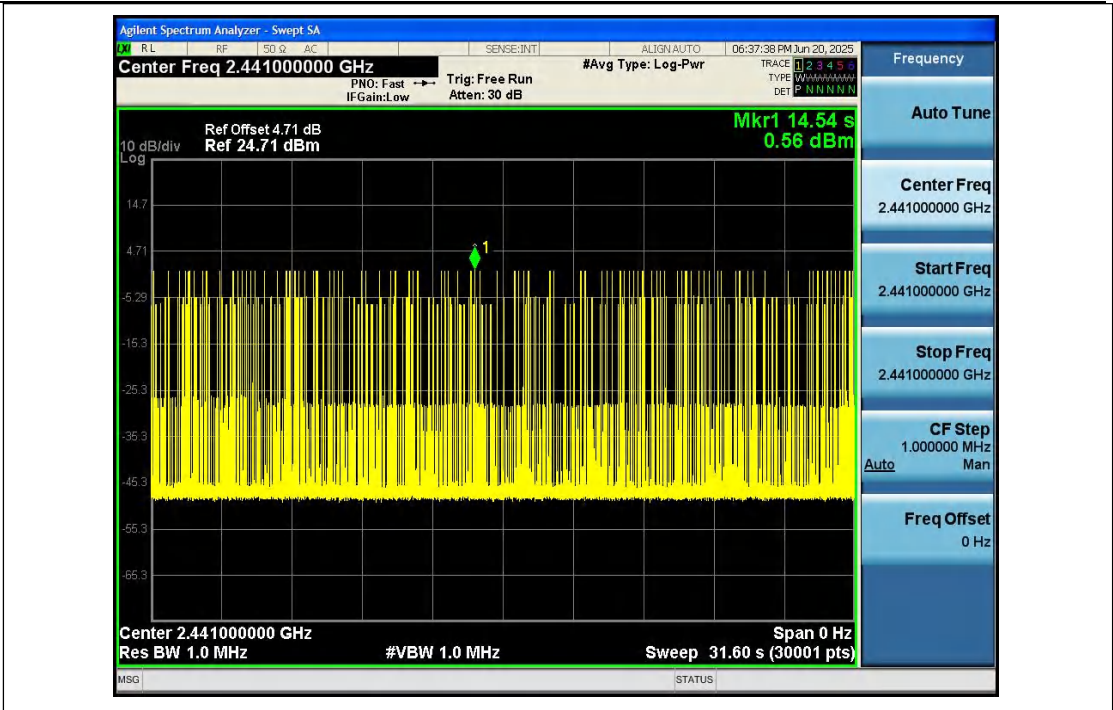


Dwell_Time_(Hopping)_NVNT_ANT1_1-DH1_2441_00_One_Burst_Time

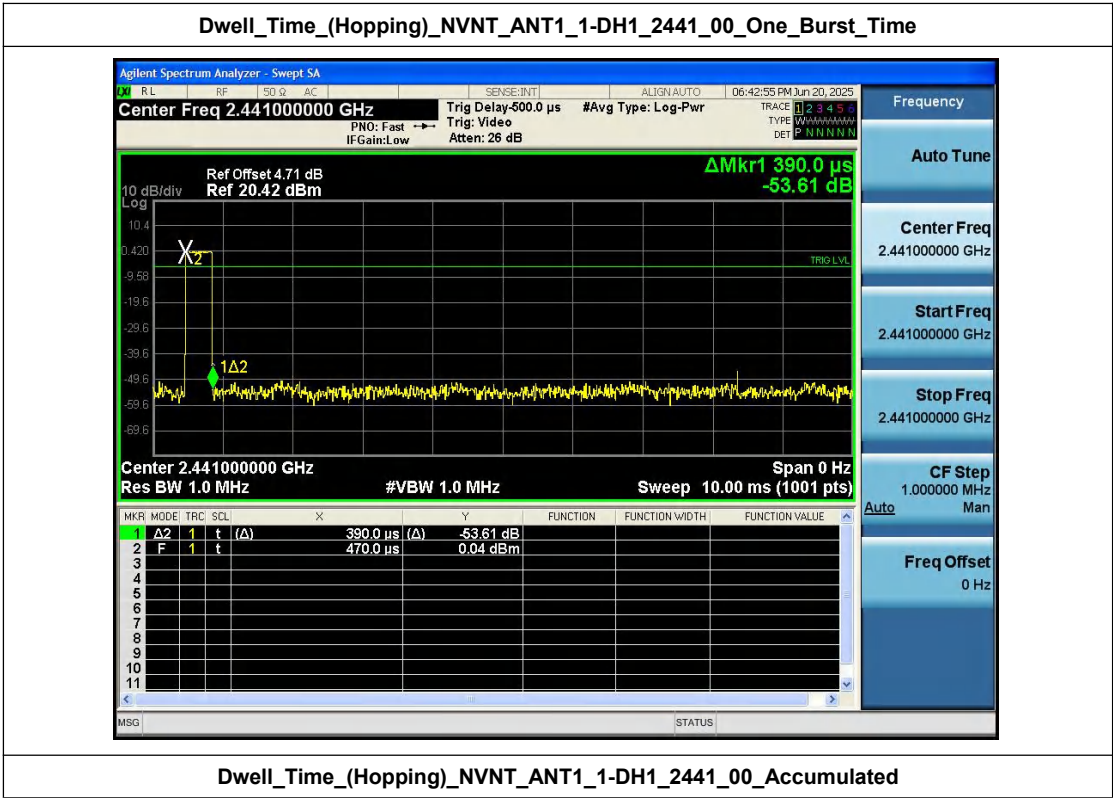


Dwell_Time_(Hopping)_NVNT_ANT1_1-DH1_2441_00_Accumulated

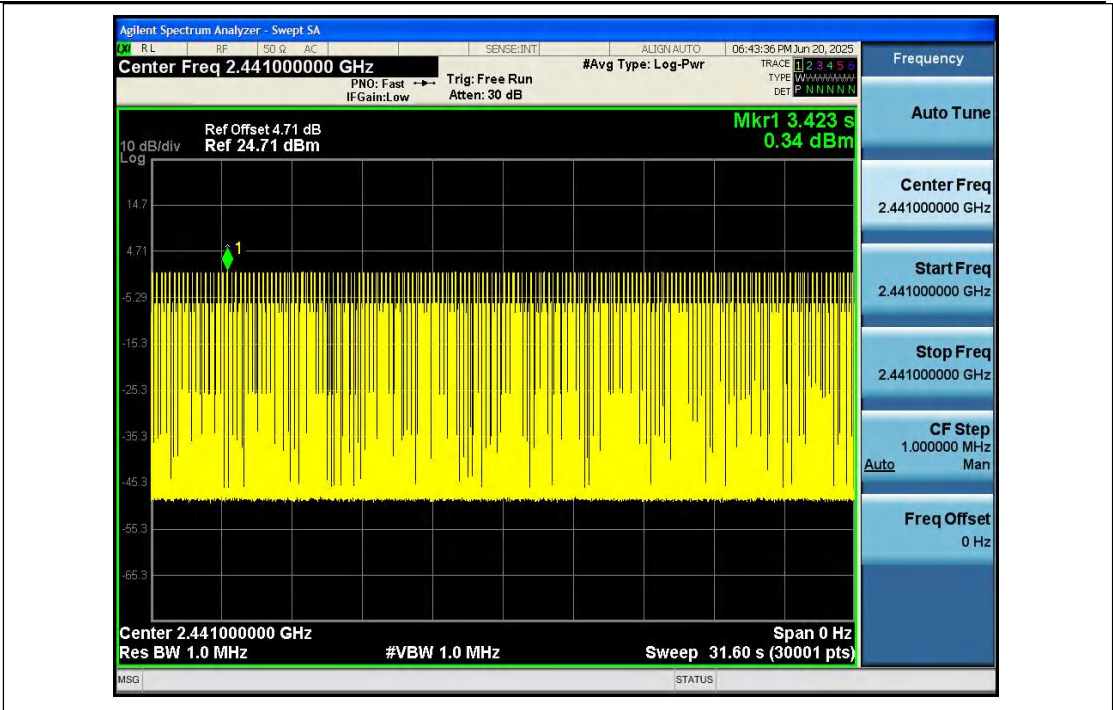


Dwell_Time_(Hopping)_NVNT_ANT1_1-DH3_2441_00_One_Burst_Time

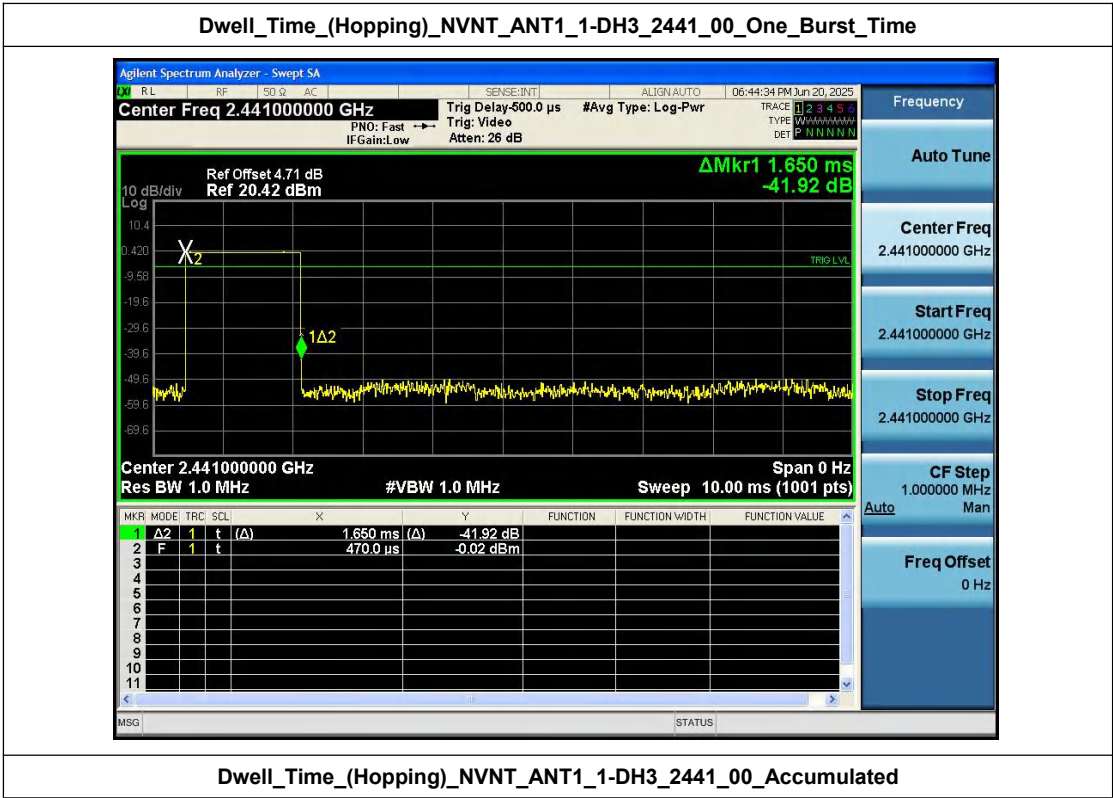


Dwell_Time_(Hopping)_NVNT_ANT1_1-DH3_2441_00_Accumulated

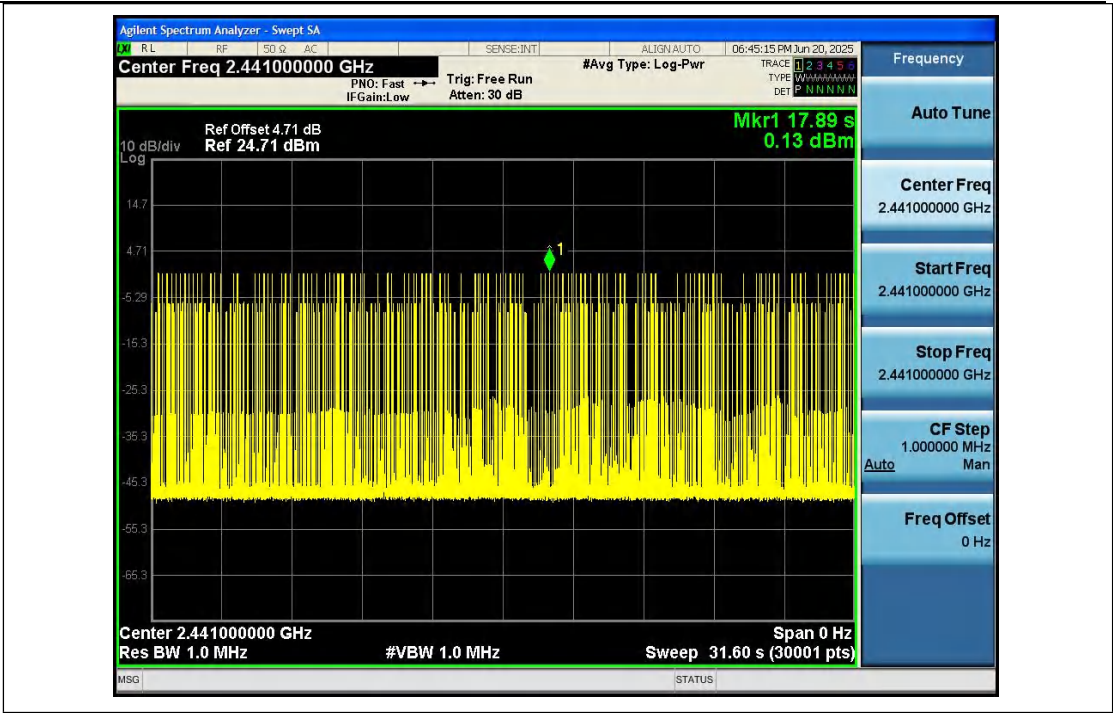


Dwell_Time_(Hopping)_NVNT_ANT1_2-DH1_2441_00_One_Burst_Time

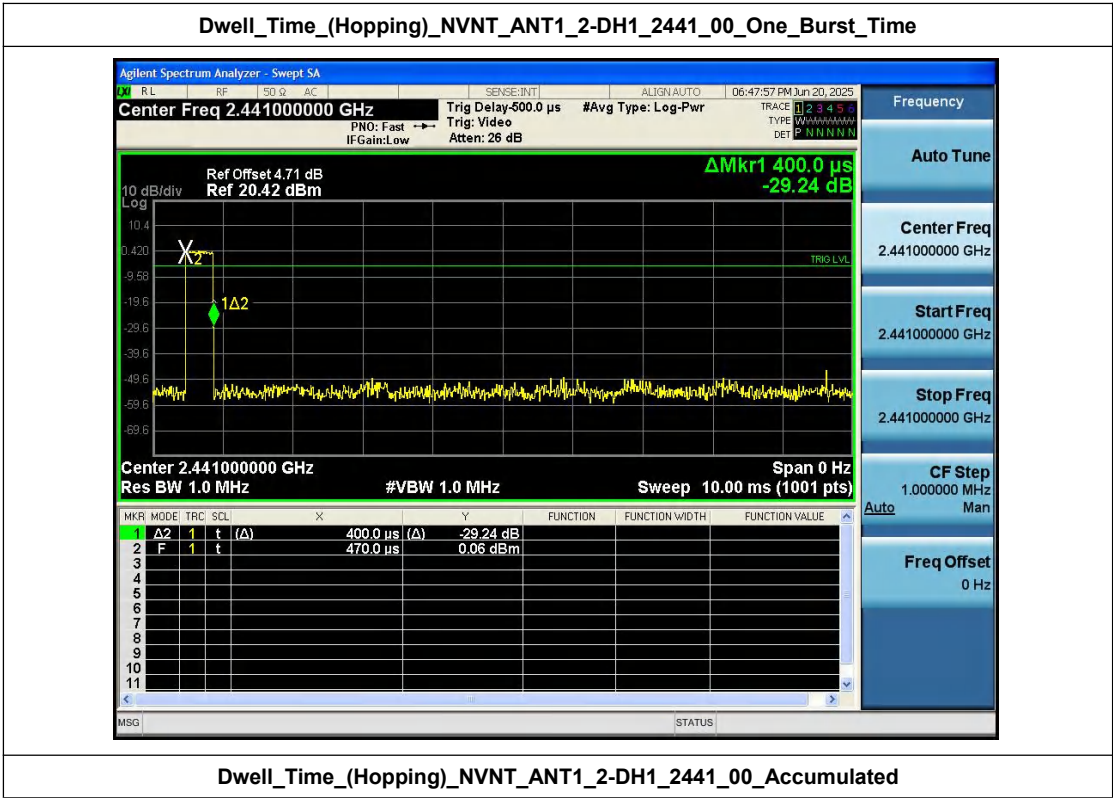


Dwell_Time_(Hopping)_NVNT_ANT1_2-DH1_2441_00_Accumulated

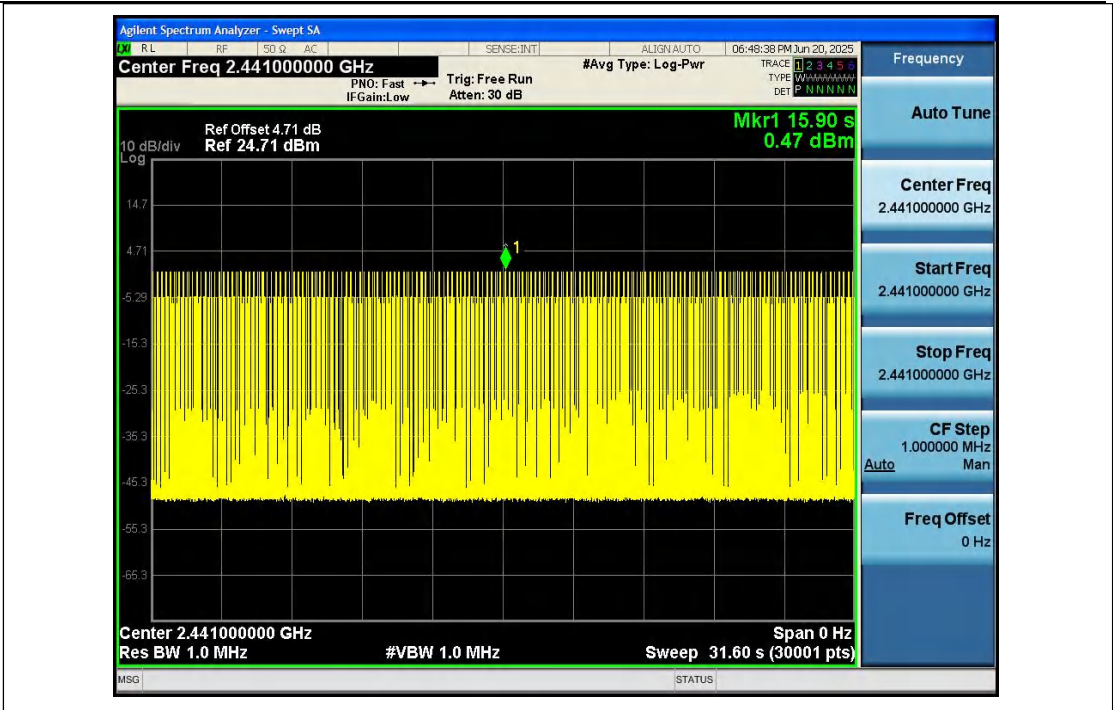


Dwell_Time_(Hopping)_NVNT_ANT1_2-DH3_2441_00_One_Burst_Time

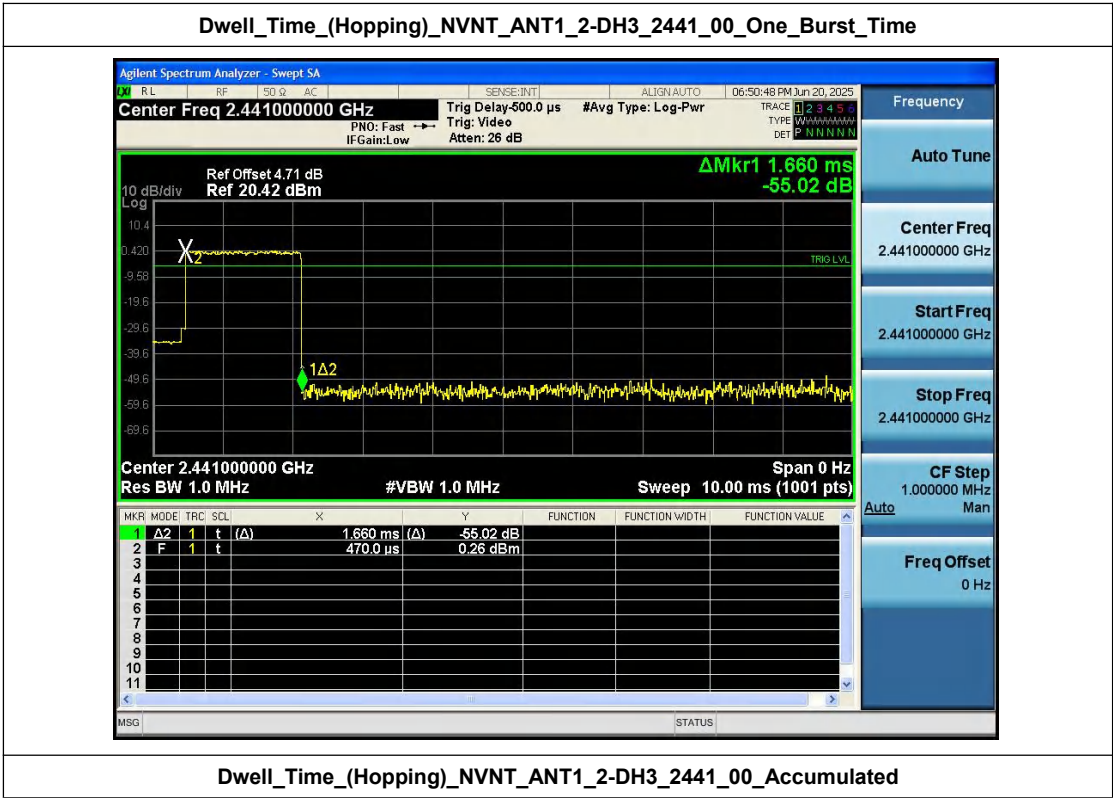


Dwell_Time_(Hopping)_NVNT_ANT1_2-DH3_2441_00_Accumulated

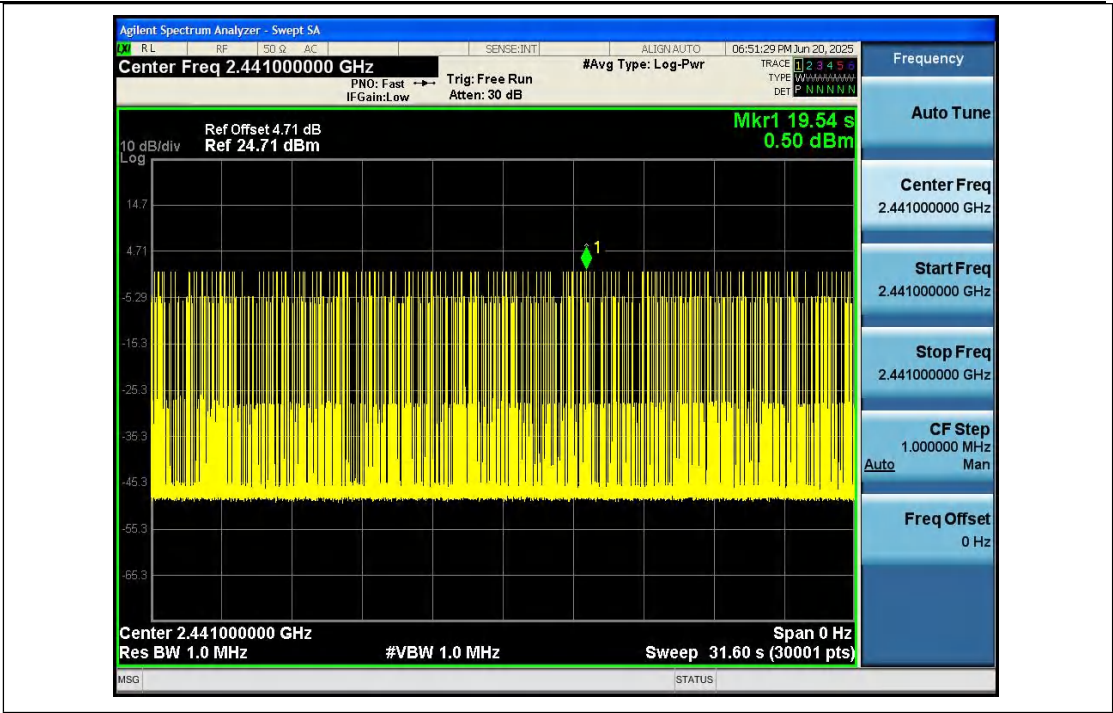


Dwell_Time_(Hopping)_NVNT_ANT1_3-DH1_2441_00_One_Burst_Time

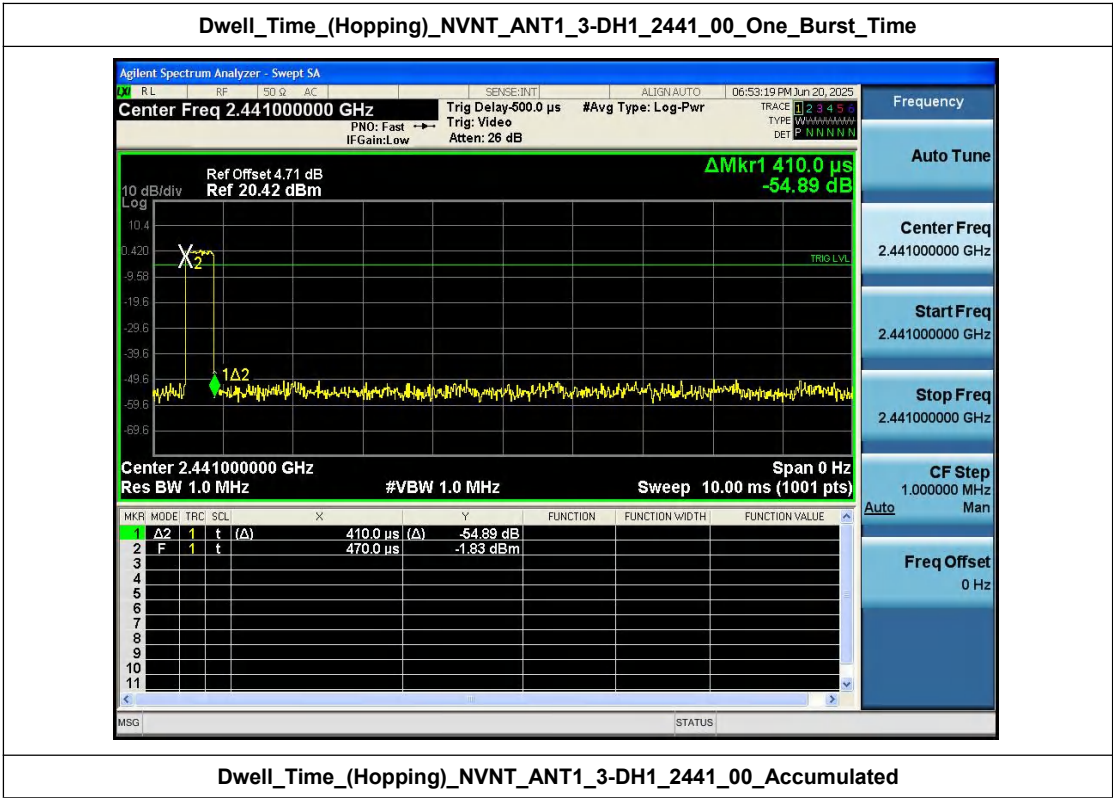


Dwell_Time_(Hopping)_NVNT_ANT1_3-DH1_2441_00_Accumulated

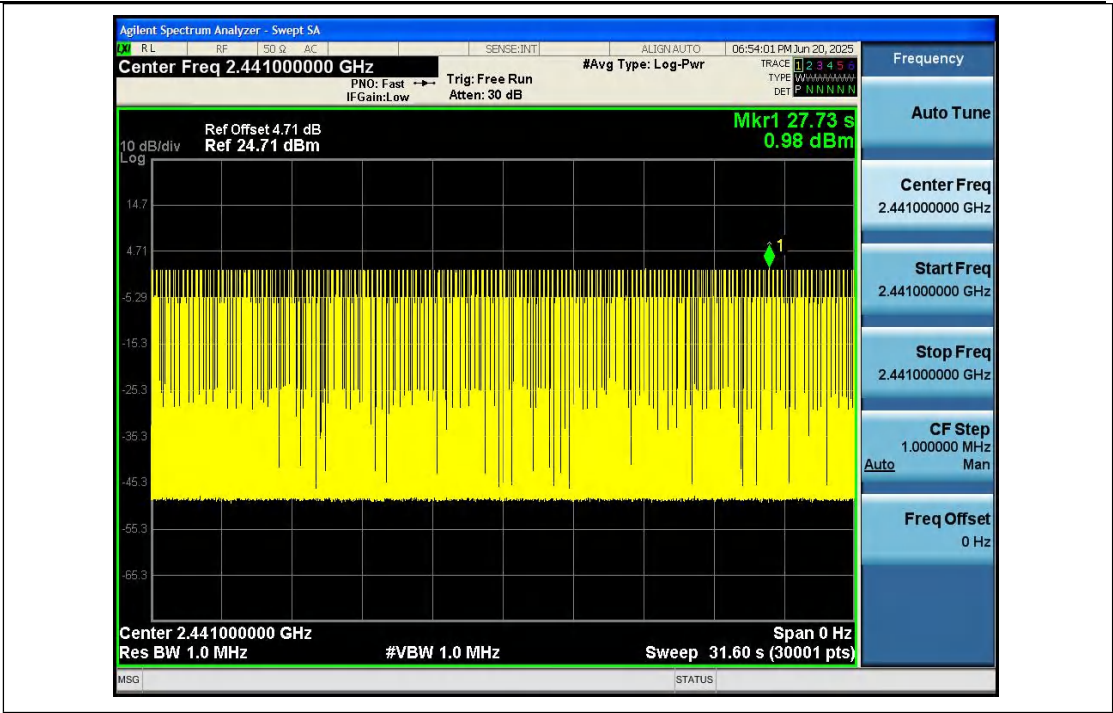

Dwell_Time_(Hopping)_NVNT_ANT1_3-DH3_2441_00_One_Burst_Time

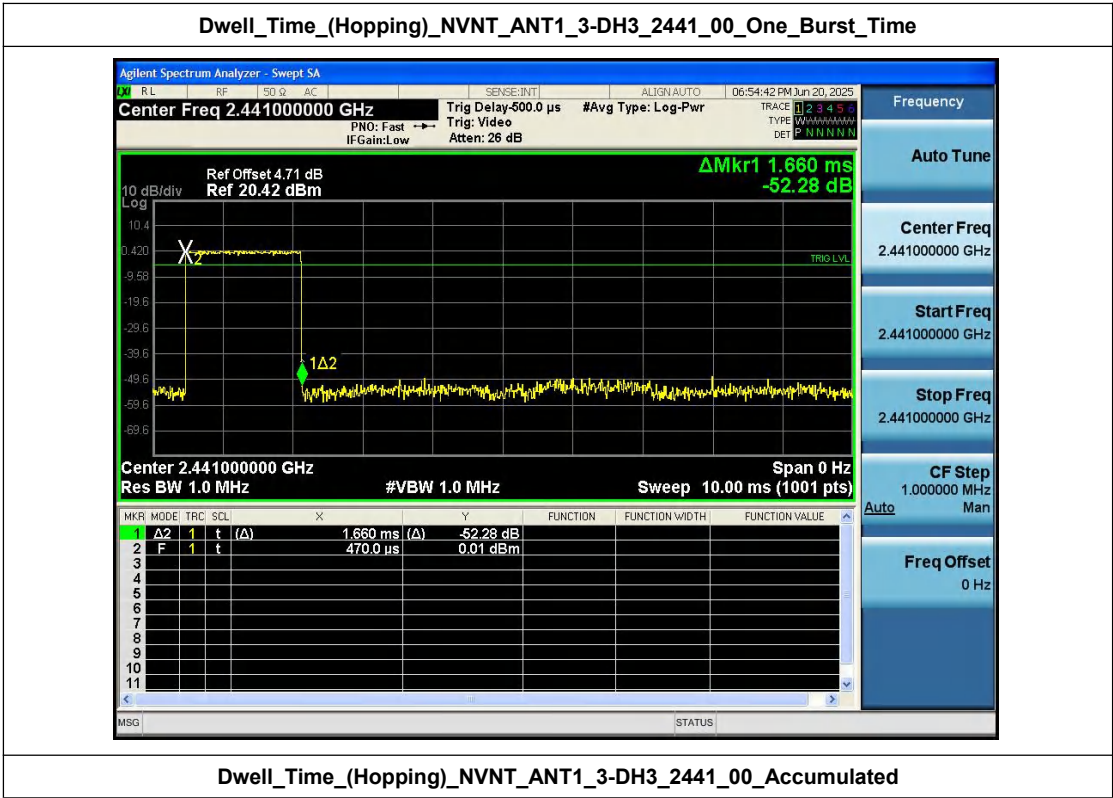

Dwell_Time_(Hopping)_NVNT_ANT1_3-DH3_2441_00_Accumulated

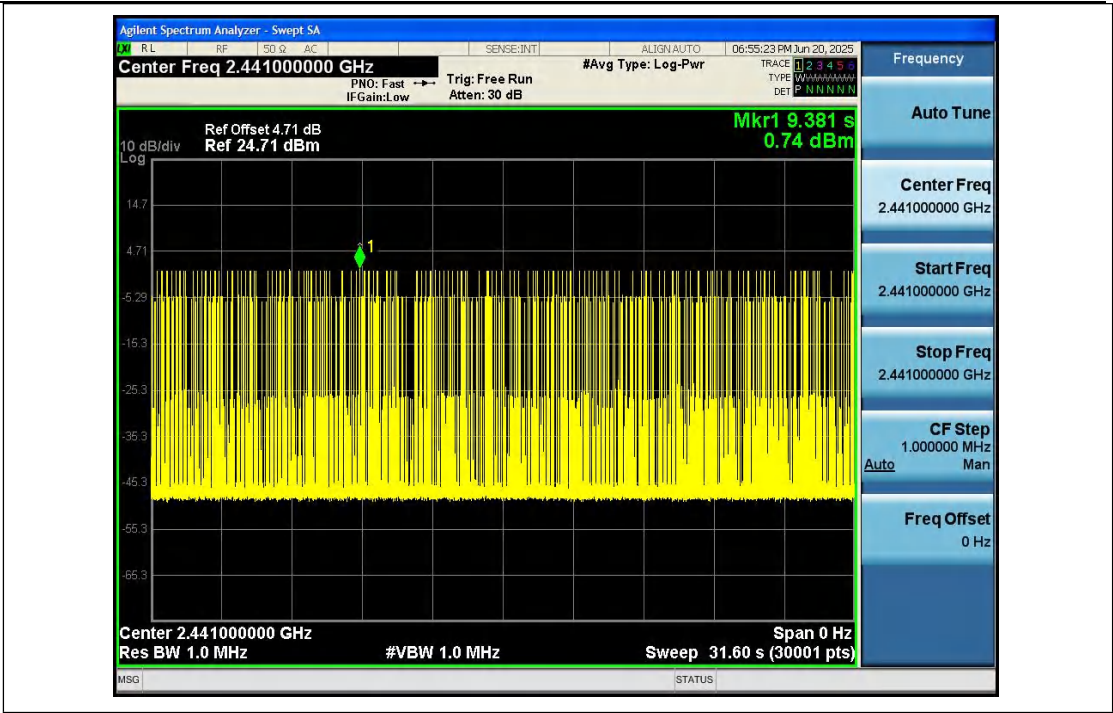

---END---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com