



Appendix D

RF Test Data for 5.2GWIFI (Conducted Measurement)

Product Name: SEI900B4TV

Test Model: IPA2312HDW

Environmental Conditions

Temperature:	23.7° C
Relative Humidity:	53.6%
ATM Pressure:	100.0 kPa
Test Engineer:	Paddi Chen
Supervised by:	Nick Peng





D.1 -26dB Bandwidth


Condition	Mode	Frequency (MHz)	Antenna	-26 dB Bandwidth (MHz)	Limit -26 dB Bandwidth (MHz)	Verdict
NVNT	a	5180	Ant1	25.731	----	Pass
NVNT	a	5200	Ant1	28.572	----	Pass
NVNT	a	5240	Ant1	24.58	----	Pass
NVNT	n20	5180	Ant1	28.564	----	Pass
NVNT	n20	5200	Ant1	25.601	----	Pass
NVNT	n20	5240	Ant1	28.565	----	Pass
NVNT	n40	5190	Ant1	46.607	----	Pass
NVNT	n40	5230	Ant1	51.374	----	Pass
NVNT	ac20	5180	Ant1	27.846	----	Pass
NVNT	ac20	5200	Ant1	27.11	----	Pass
NVNT	ac20	5240	Ant1	27.861	----	Pass
NVNT	ac40	5190	Ant1	50.959	----	Pass
NVNT	ac40	5230	Ant1	45.868	----	Pass
NVNT	ac80	5210	Ant1	86.941	----	Pass
NVNT	ax20	5180	Ant1	26.725	----	Pass
NVNT	ax20	5200	Ant1	26.732	----	Pass
NVNT	ax20	5240	Ant1	27.048	----	Pass
NVNT	ax40	5190	Ant1	48.326	----	Pass
NVNT	ax40	5230	Ant1	44.337	----	Pass
NVNT	ax80	5210	Ant1	83.488	----	Pass






Test Graphs

-26dB Bandwidth NVNT a 5180MHz Ant1

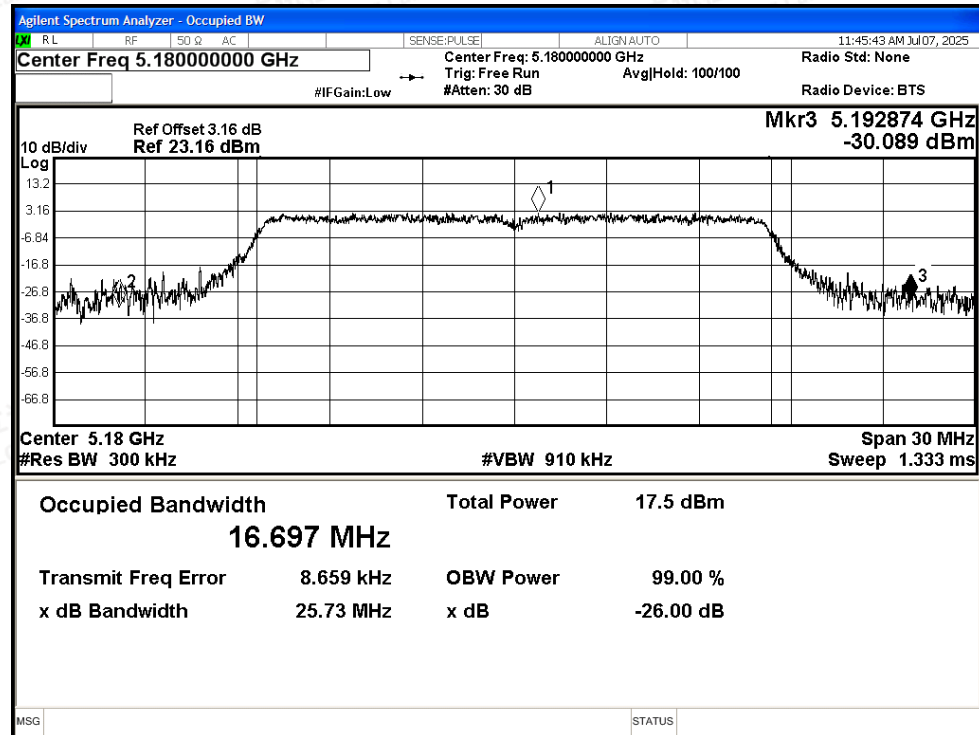

-26dB Bandwidth NVNT a 5200MHz Ant1

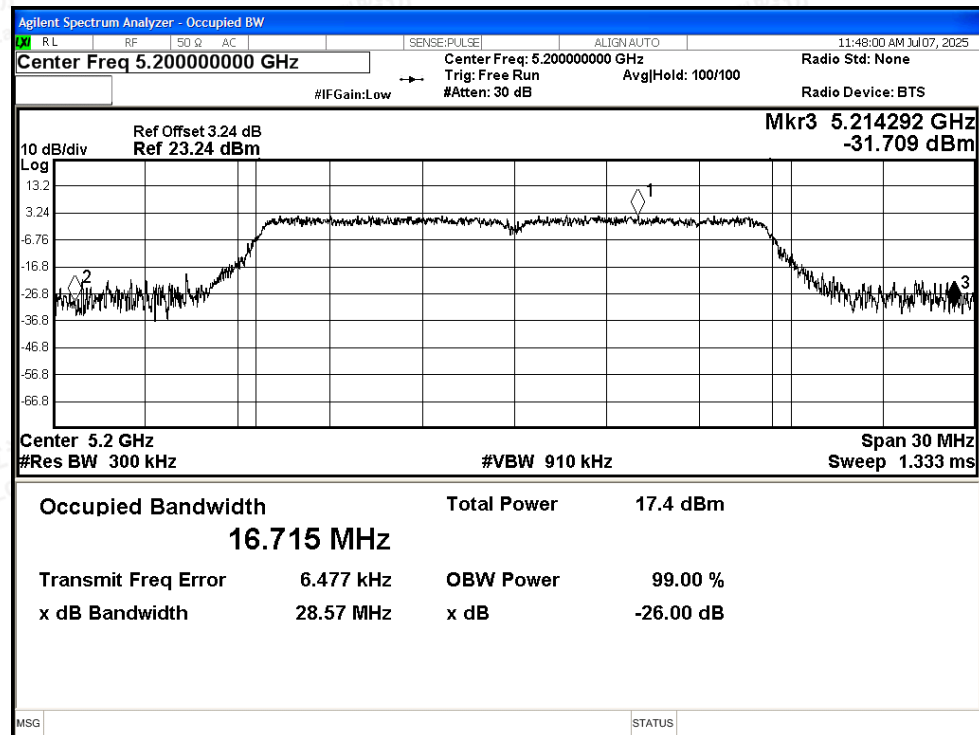

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT a 5240MHz Ant1

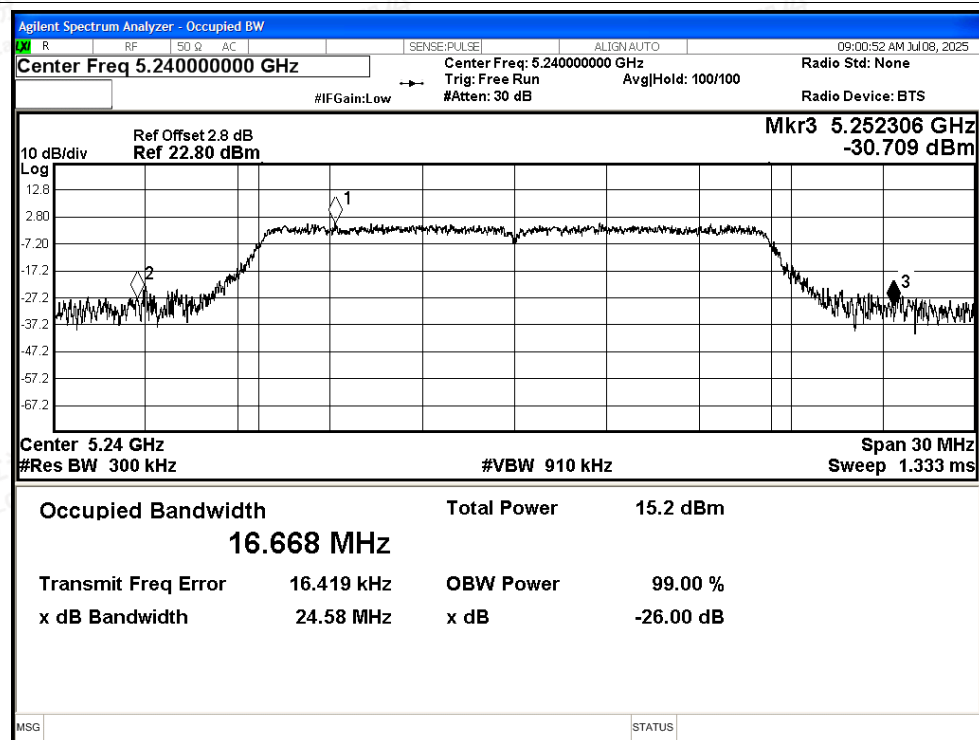

-26dB Bandwidth NVNT n20 5180MHz Ant1

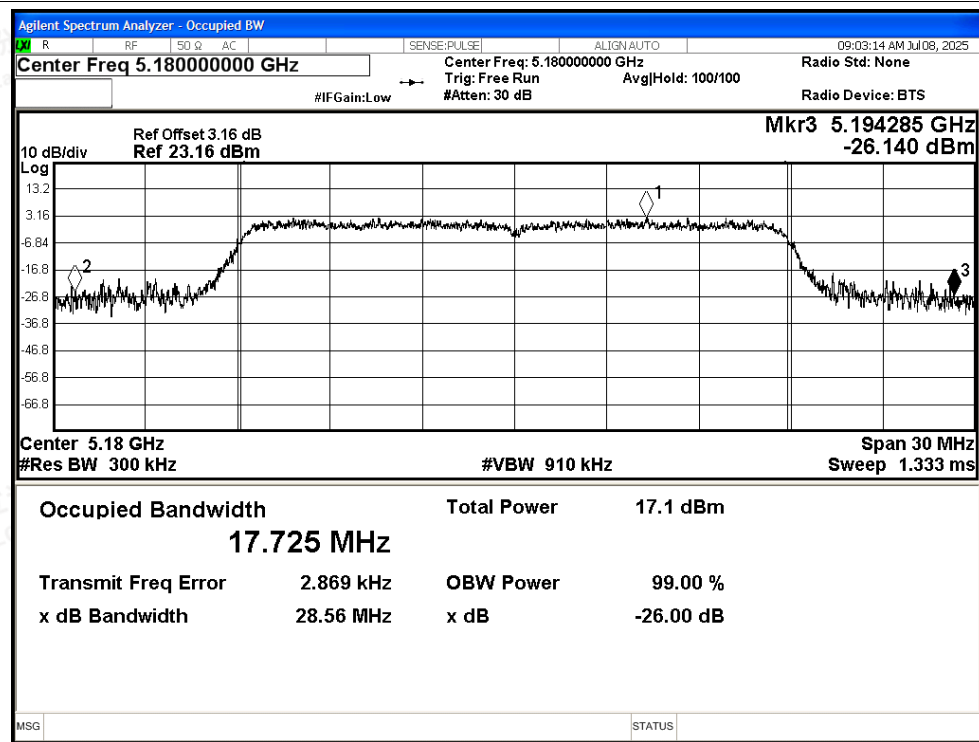

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT n20 5200MHz Ant1

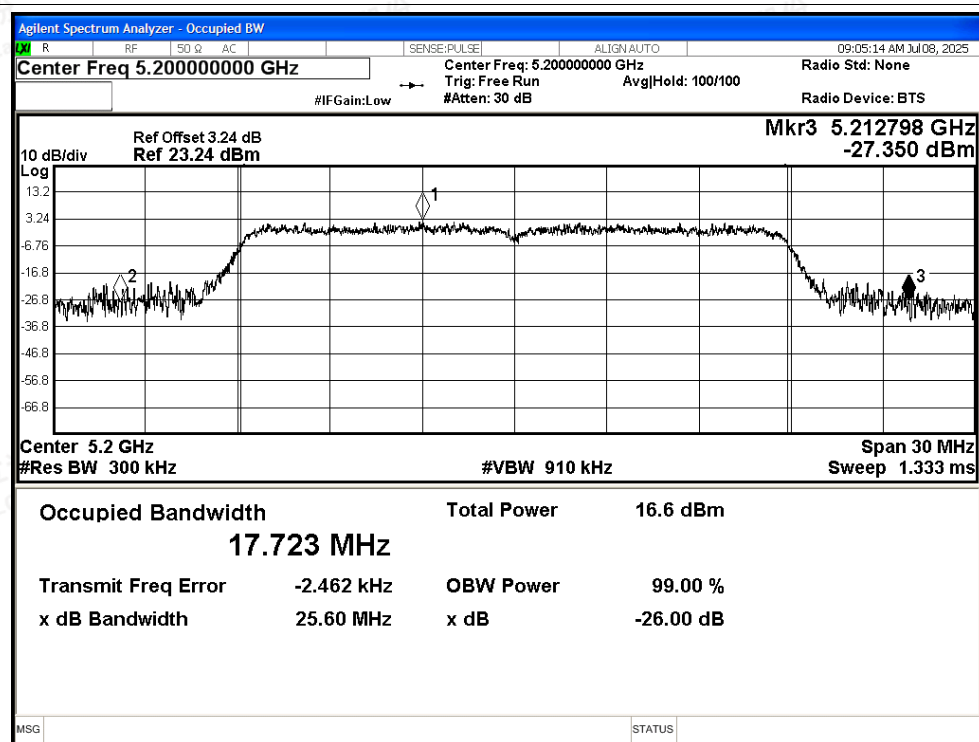

-26dB Bandwidth NVNT n20 5240MHz Ant1

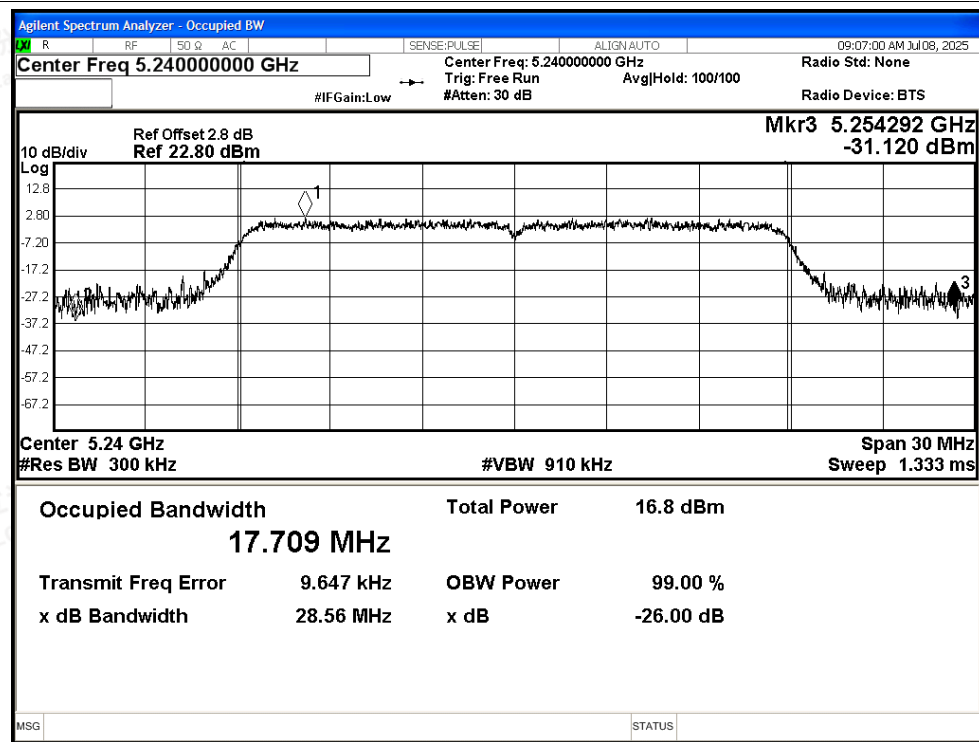

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT n40 5190MHz Ant1

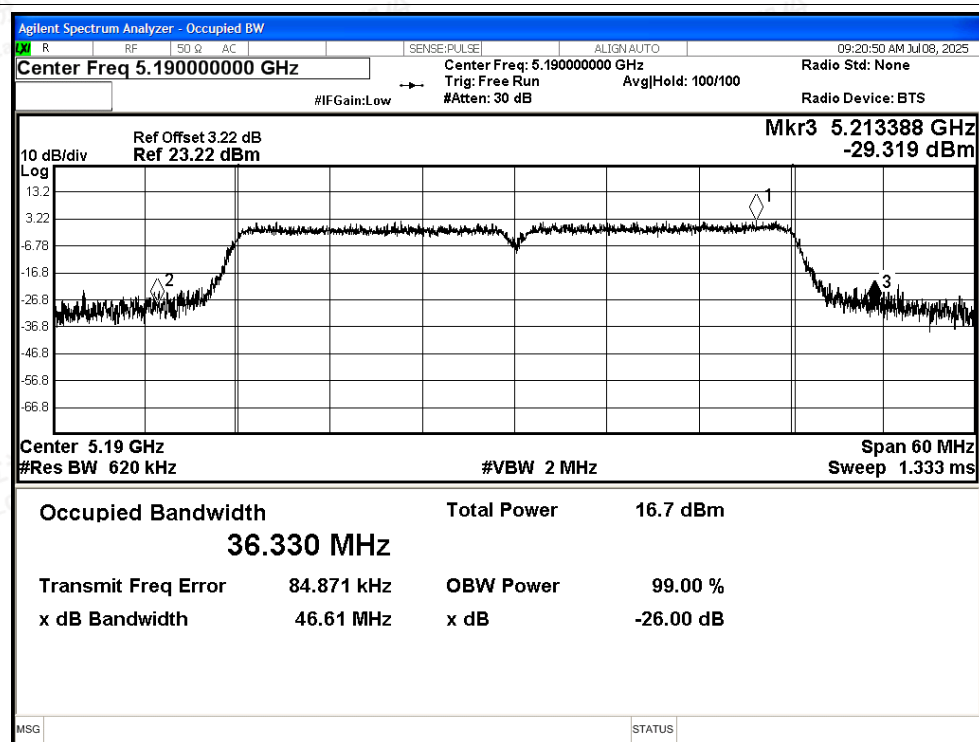

-26dB Bandwidth NVNT n40 5230MHz Ant1

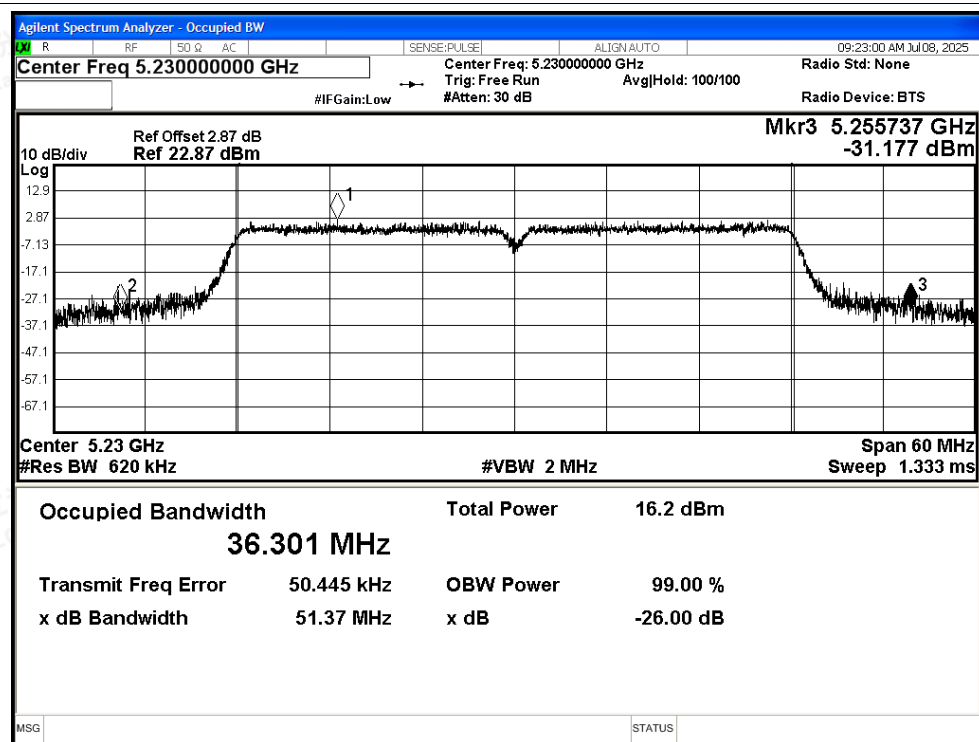

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT ac20 5180MHz Ant1

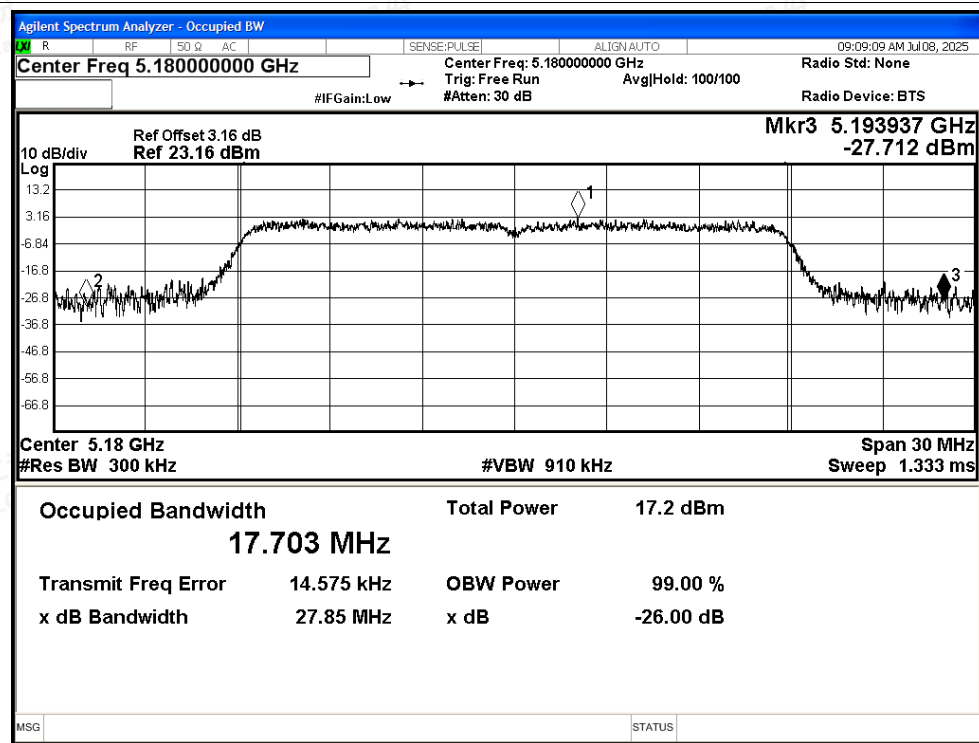

-26dB Bandwidth NVNT ac20 5200MHz Ant1

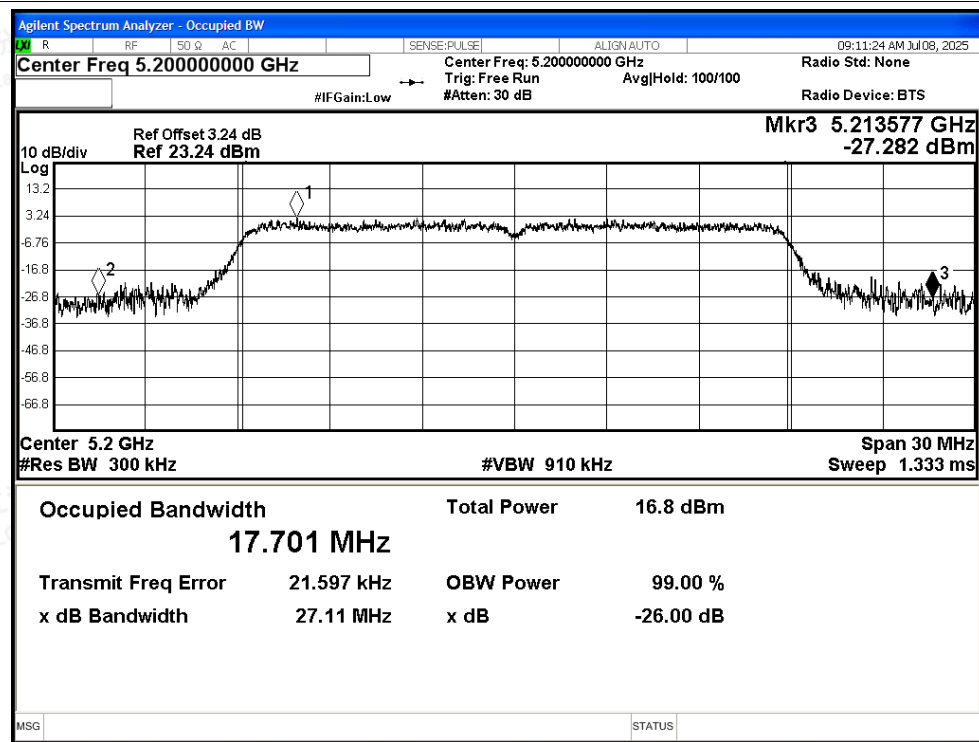

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT ac20 5240MHz Ant1

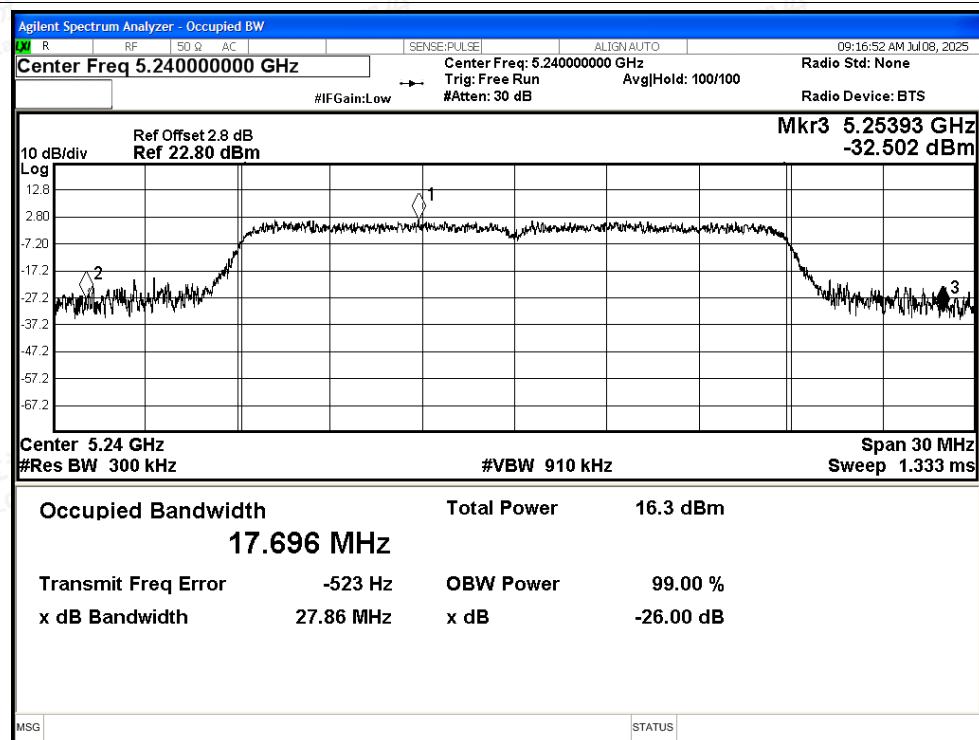

-26dB Bandwidth NVNT ac40 5190MHz Ant1

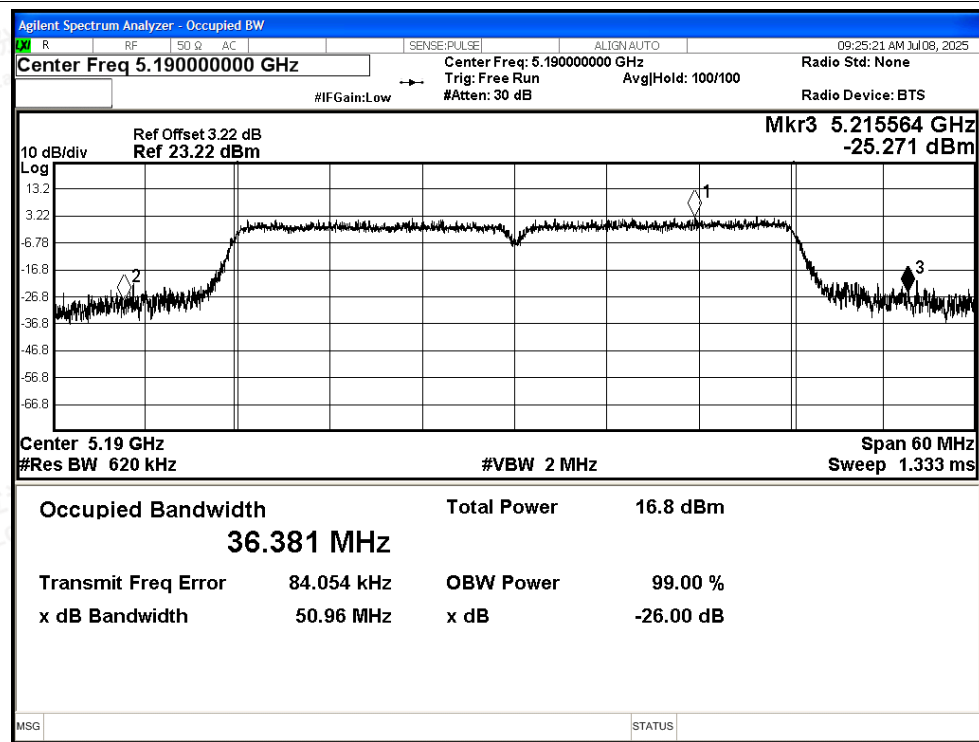

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT ac40 5230MHz Ant1

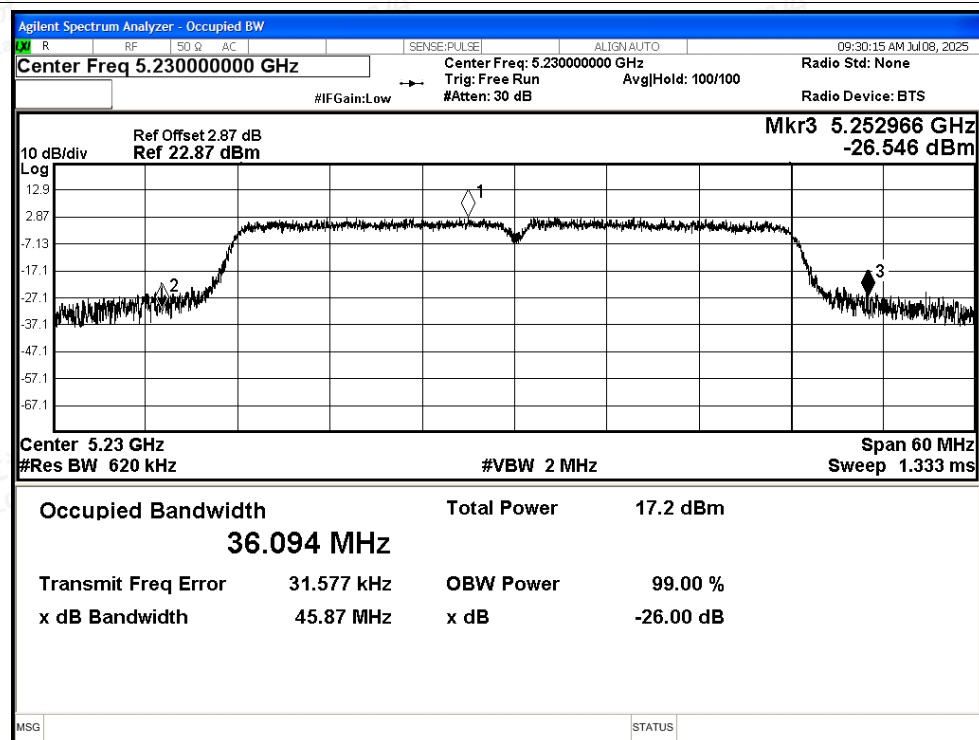

-26dB Bandwidth NVNT ac80 5210MHz Ant1

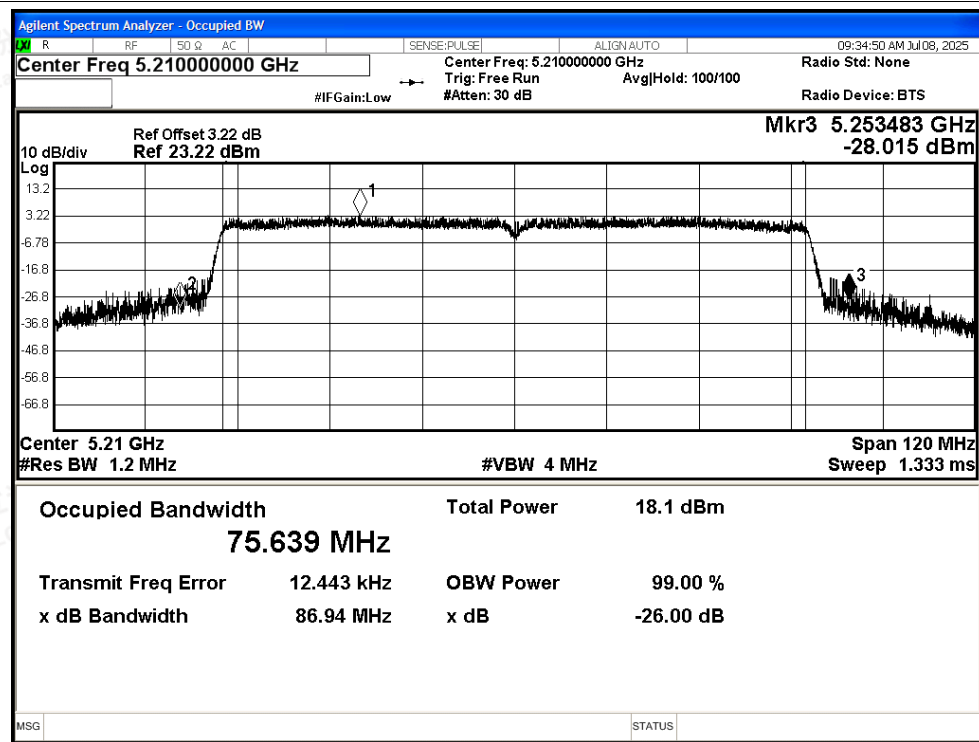

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT ax20 5180MHz Ant1

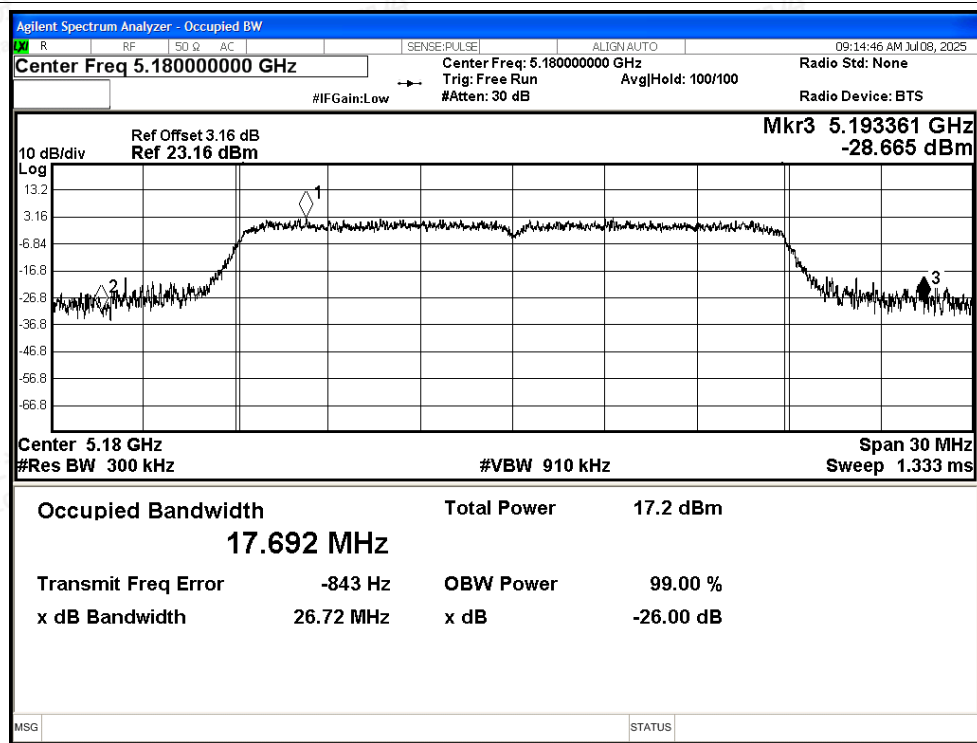

-26dB Bandwidth NVNT ax20 5200MHz Ant1

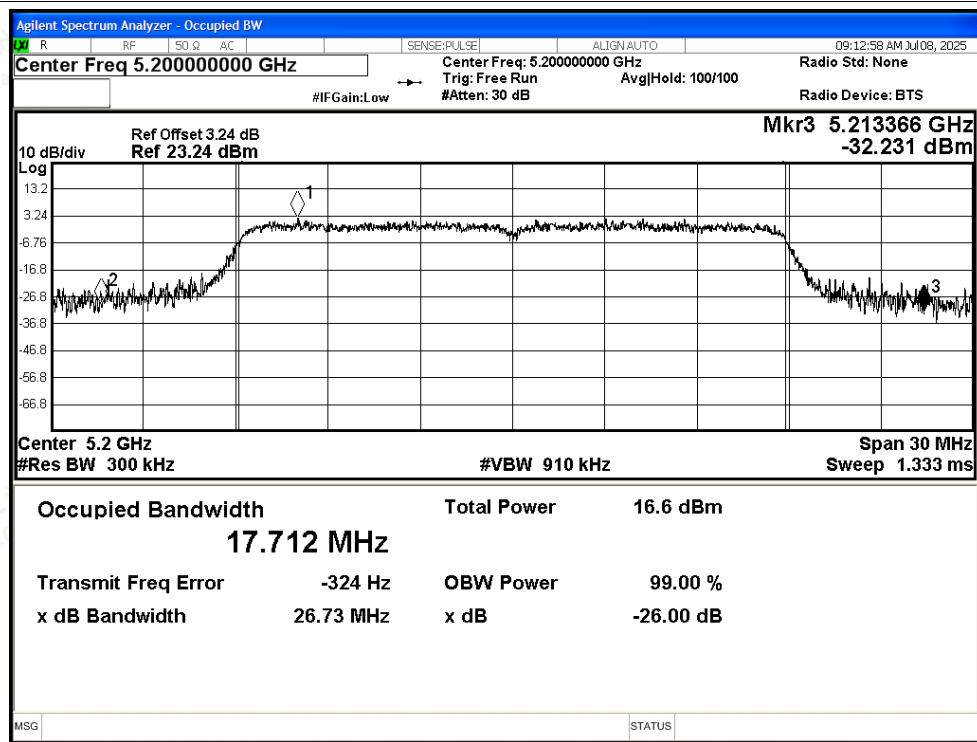

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT ax20 5240MHz Ant1

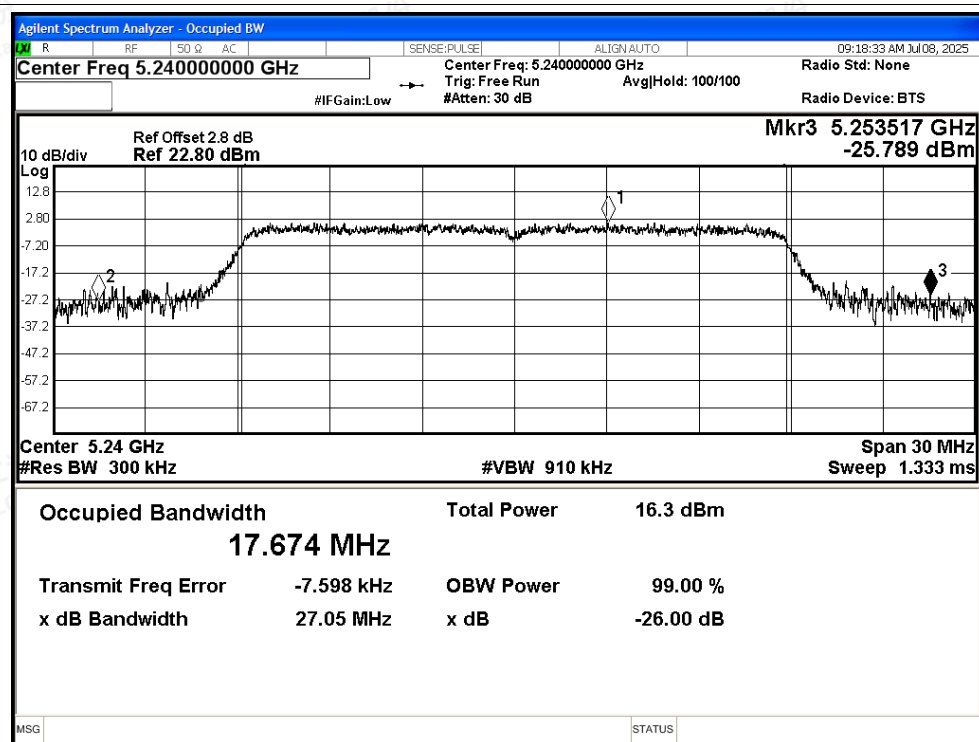

-26dB Bandwidth NVNT ax40 5190MHz Ant1

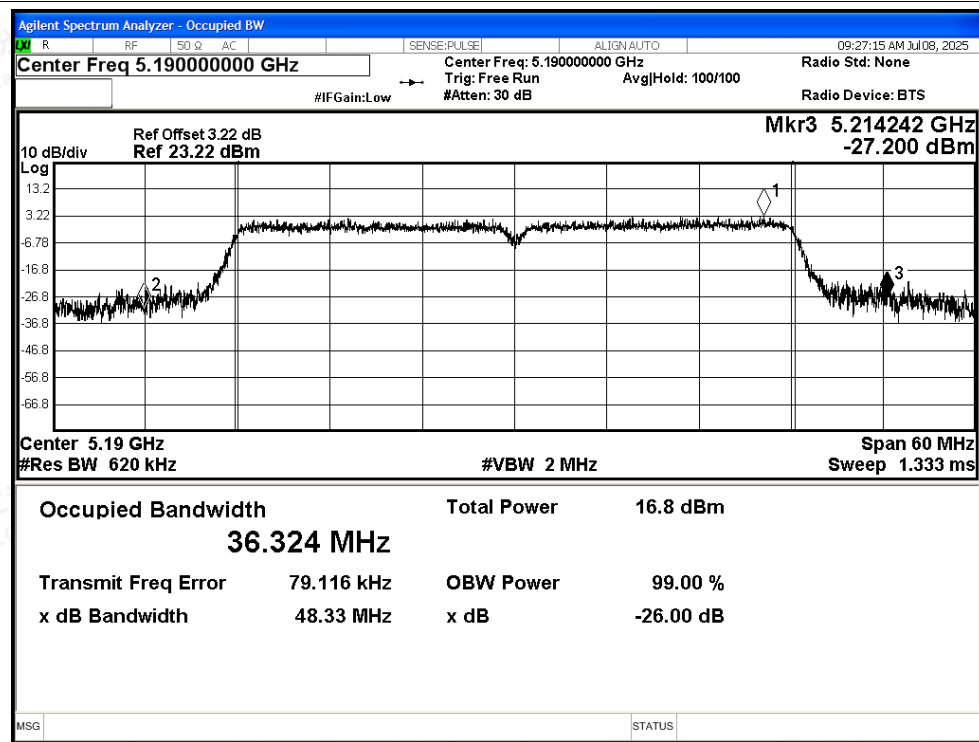

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT ax40 5230MHz Ant1

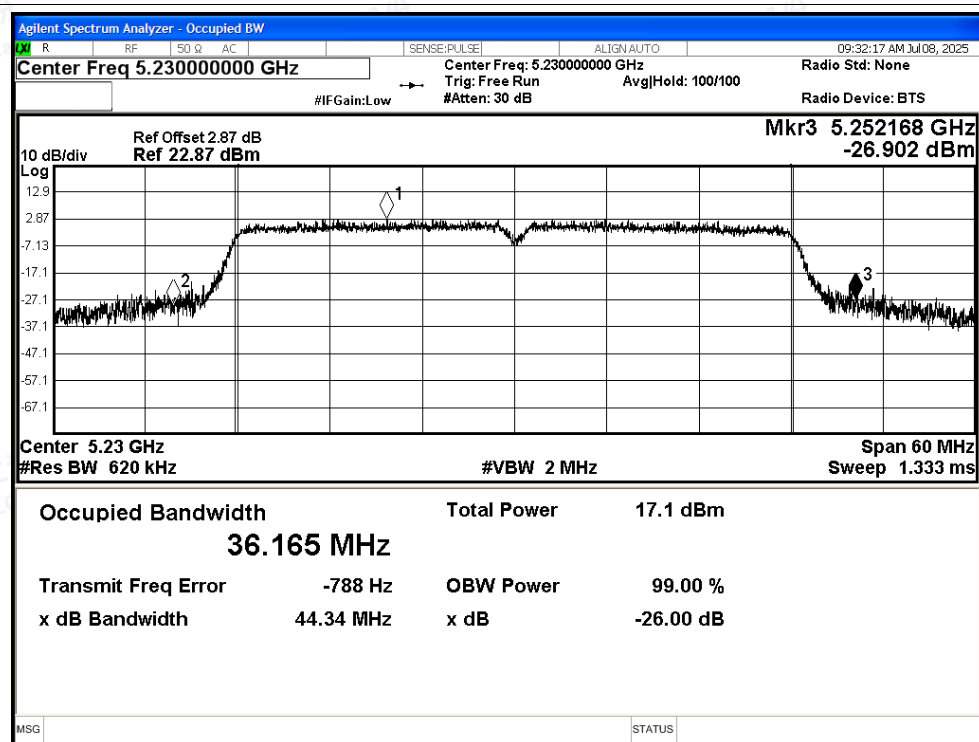

-26dB Bandwidth NVNT ax80 5210MHz Ant1

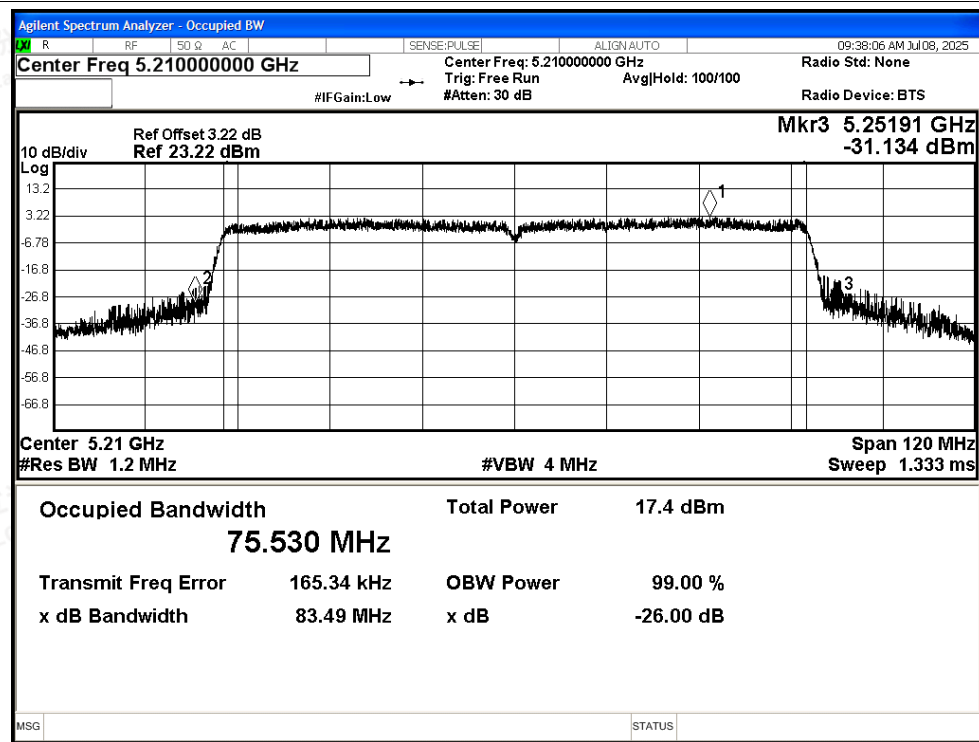

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Condition	Mode	Frequency (MHz)	Antenna	-26 dB Bandwidth (MHz)	Limit -26 dB Bandwidth (MHz)	Verdict
NVNT	a	5180	Ant2	23.78	----	Pass
NVNT	a	5200	Ant2	26.256	----	Pass
NVNT	a	5240	Ant2	26.249	----	Pass
NVNT	n20	5180	Ant2	28.853	----	Pass
NVNT	n20	5200	Ant2	27.473	----	Pass
NVNT	n20	5240	Ant2	29.15	----	Pass
NVNT	n40	5190	Ant2	44.947	----	Pass
NVNT	n40	5230	Ant2	48.648	----	Pass
NVNT	ac20	5180	Ant2	27.264	----	Pass
NVNT	ac20	5200	Ant2	29.274	----	Pass
NVNT	ac20	5240	Ant2	29.098	----	Pass
NVNT	ac40	5190	Ant2	51.738	----	Pass
NVNT	ac40	5230	Ant2	45.772	----	Pass
NVNT	ac80	5210	Ant2	89.646	----	Pass
NVNT	ax20	5180	Ant2	27.126	----	Pass
NVNT	ax20	5200	Ant2	27.696	----	Pass
NVNT	ax20	5240	Ant2	28.165	----	Pass
NVNT	ax40	5190	Ant2	45.687	----	Pass
NVNT	ax40	5230	Ant2	49.001	----	Pass
NVNT	ax80	5210	Ant2	86.434	----	Pass






Test Graphs

-26dB Bandwidth NVNT a 5180MHz Ant2

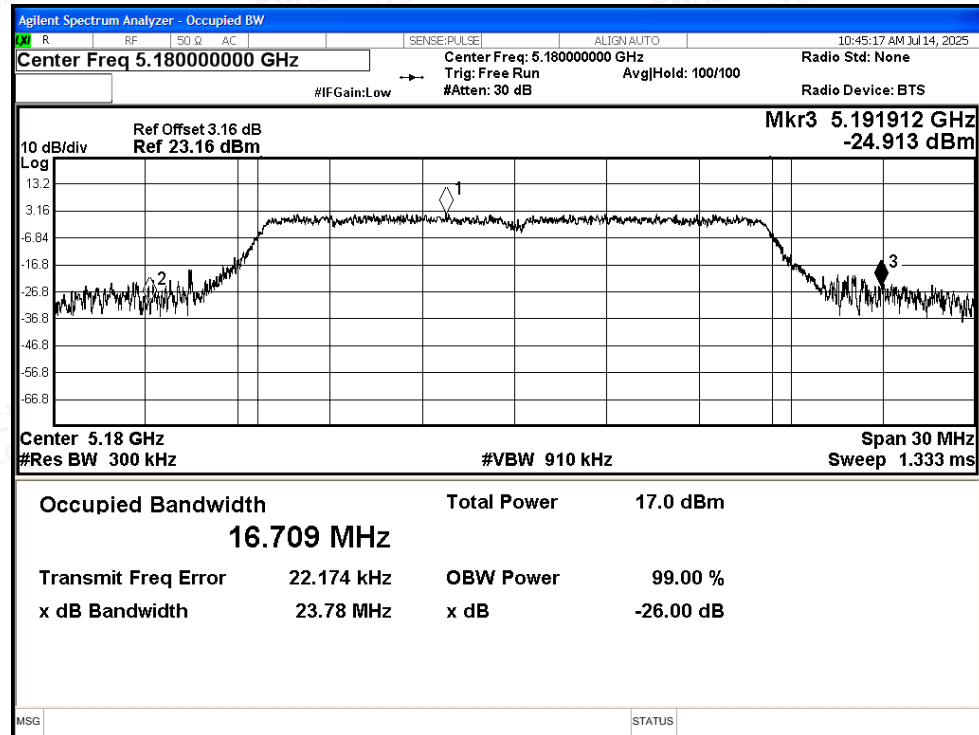

-26dB Bandwidth NVNT a 5200MHz Ant2


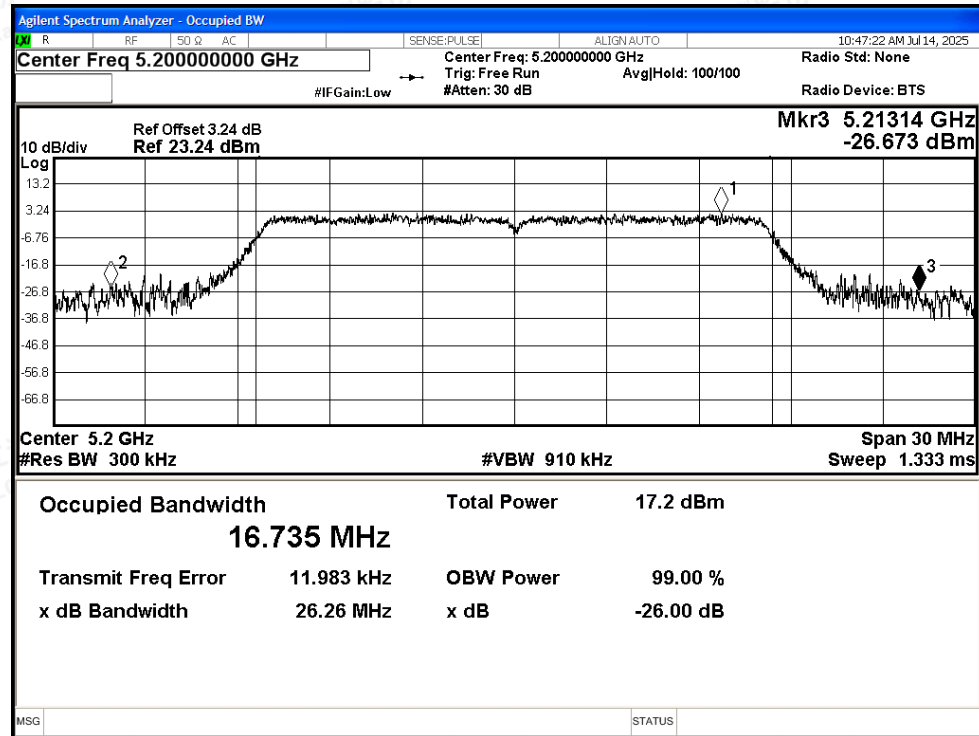


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

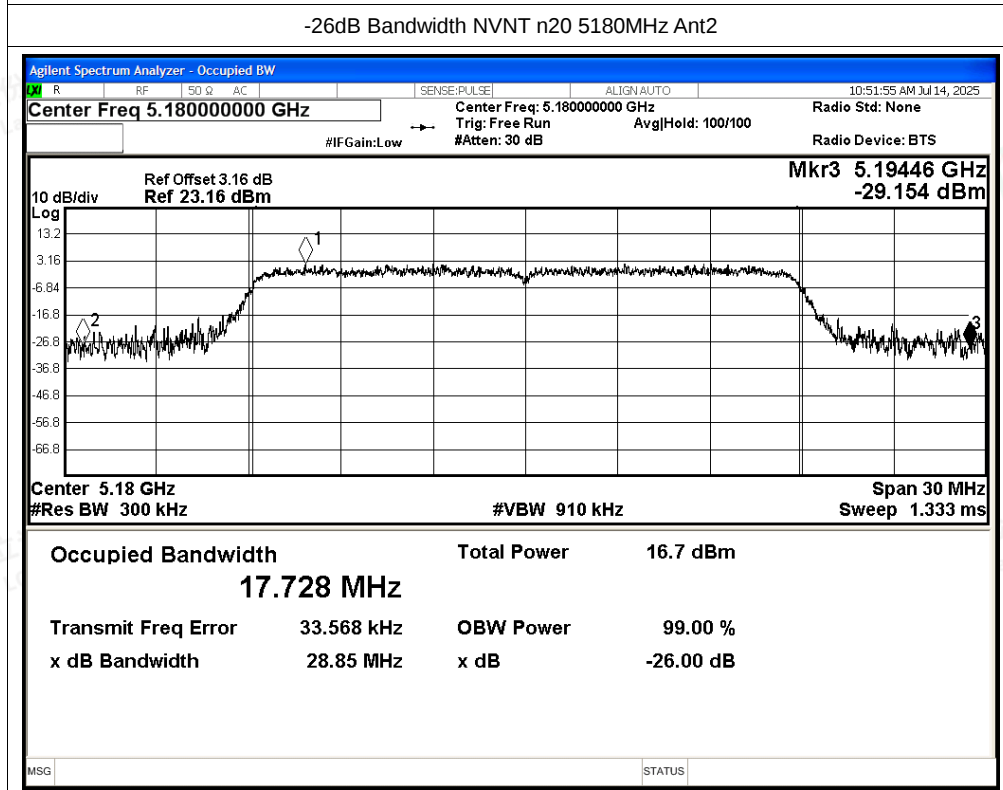
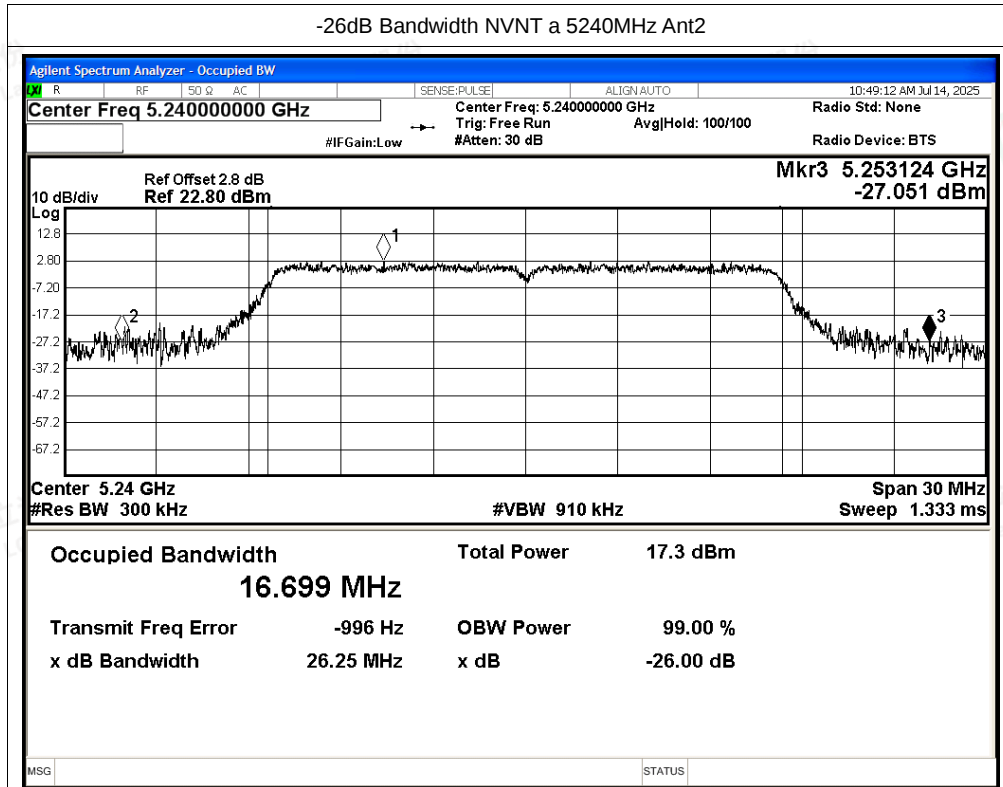


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

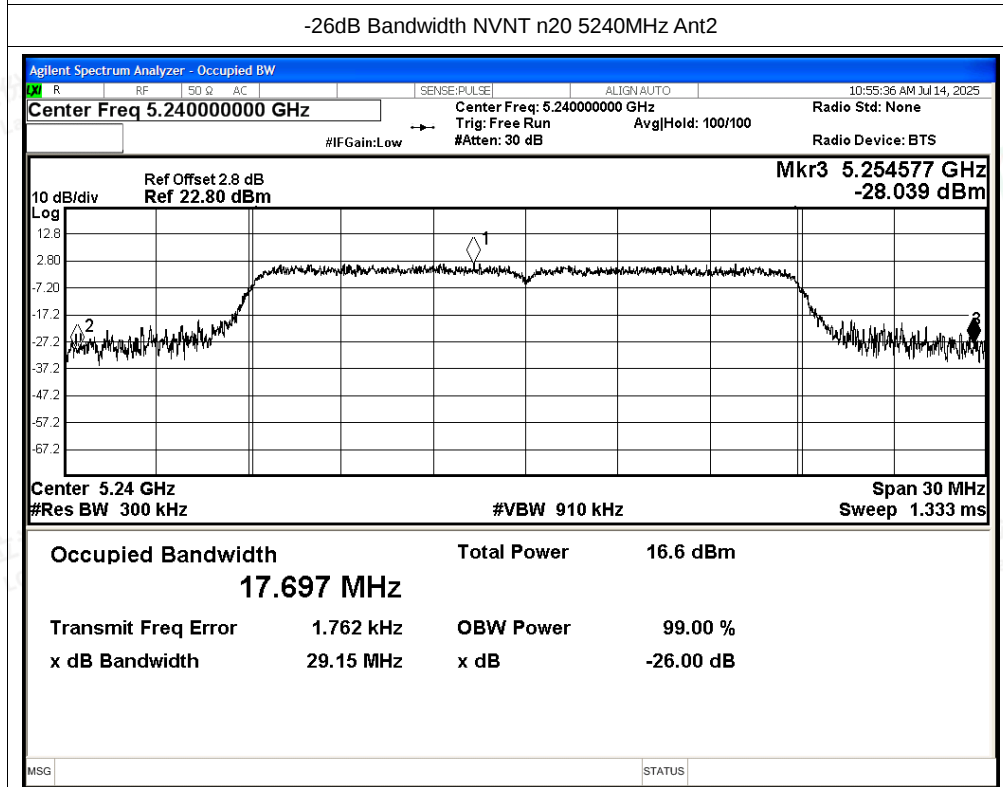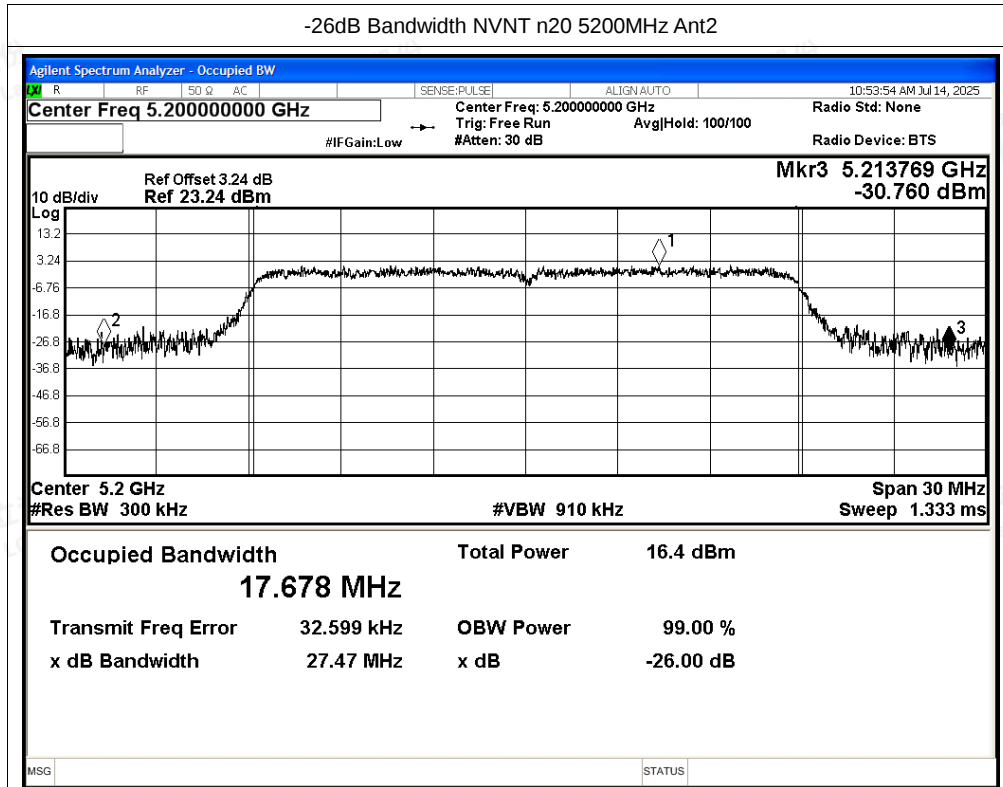




-26dB Bandwidth NVNT n40 5190MHz Ant2

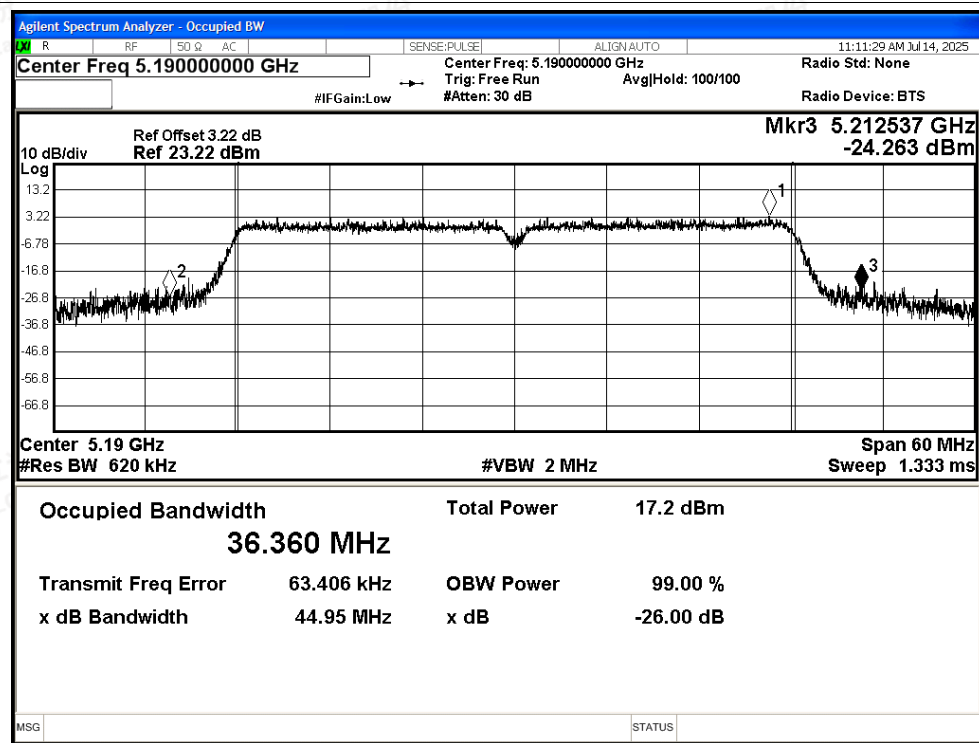

-26dB Bandwidth NVNT n40 5230MHz Ant2

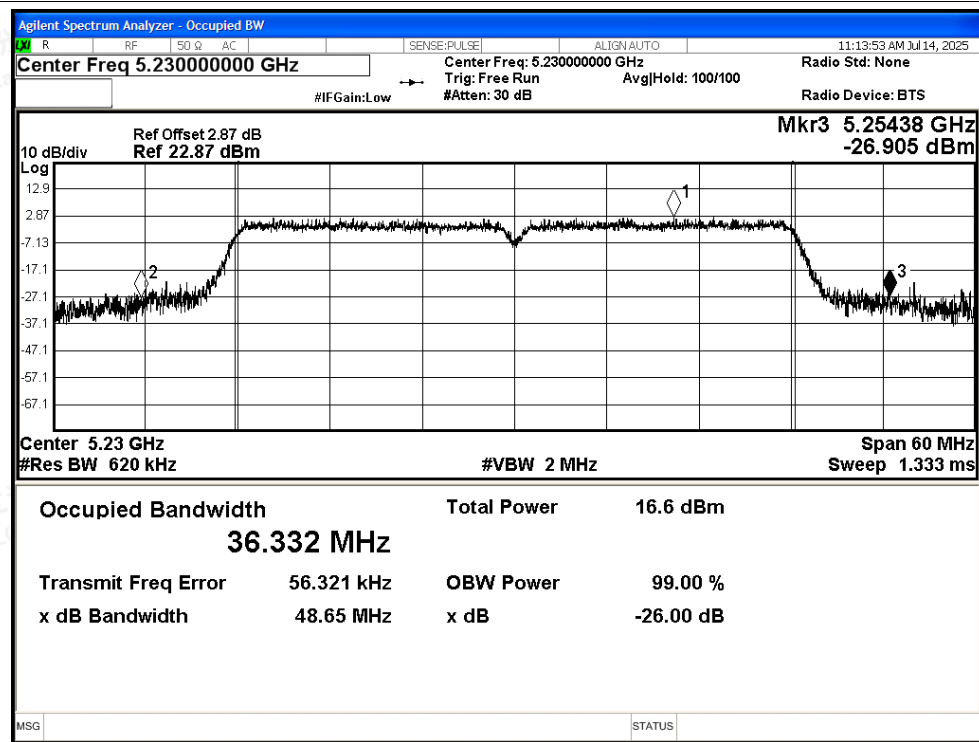

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT ac20 5180MHz Ant2

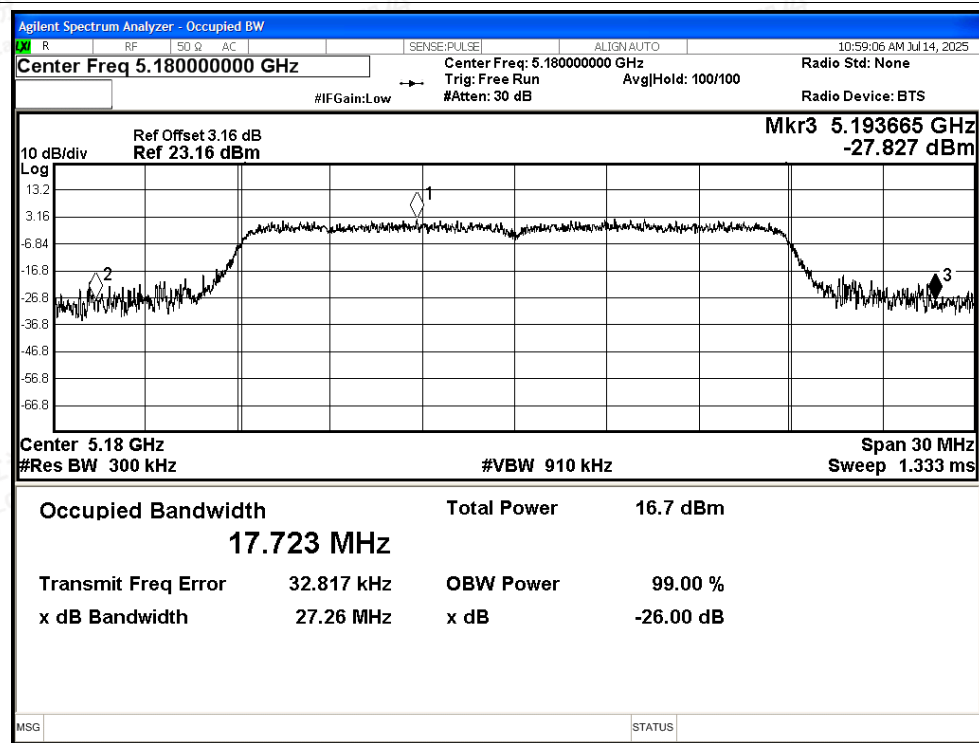

-26dB Bandwidth NVNT ac20 5200MHz Ant2

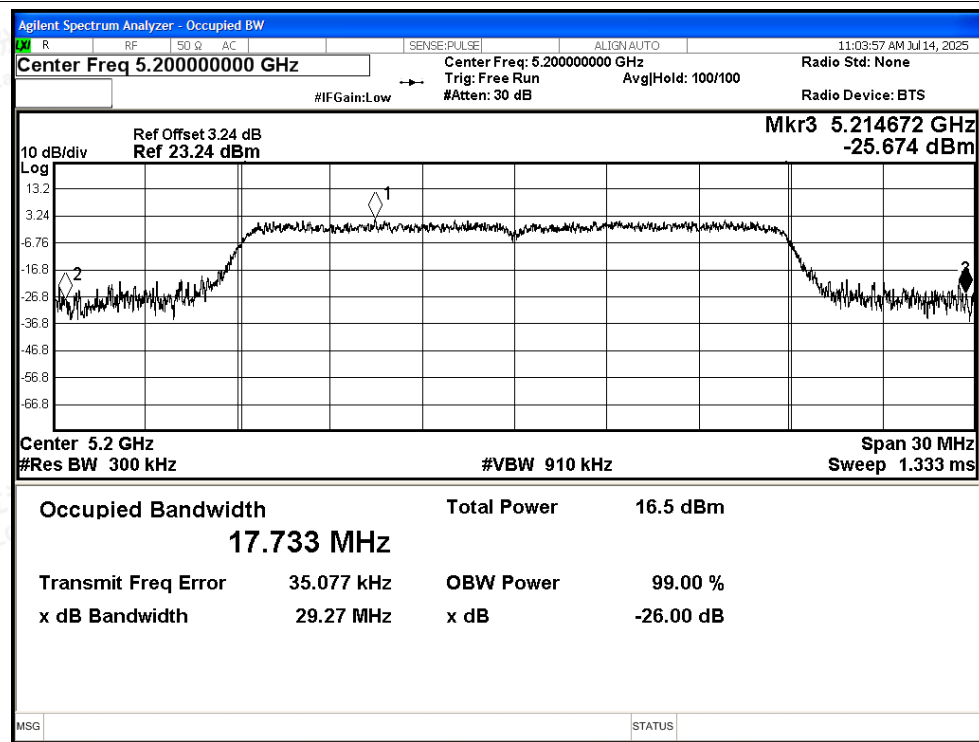

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT ac20 5240MHz Ant2

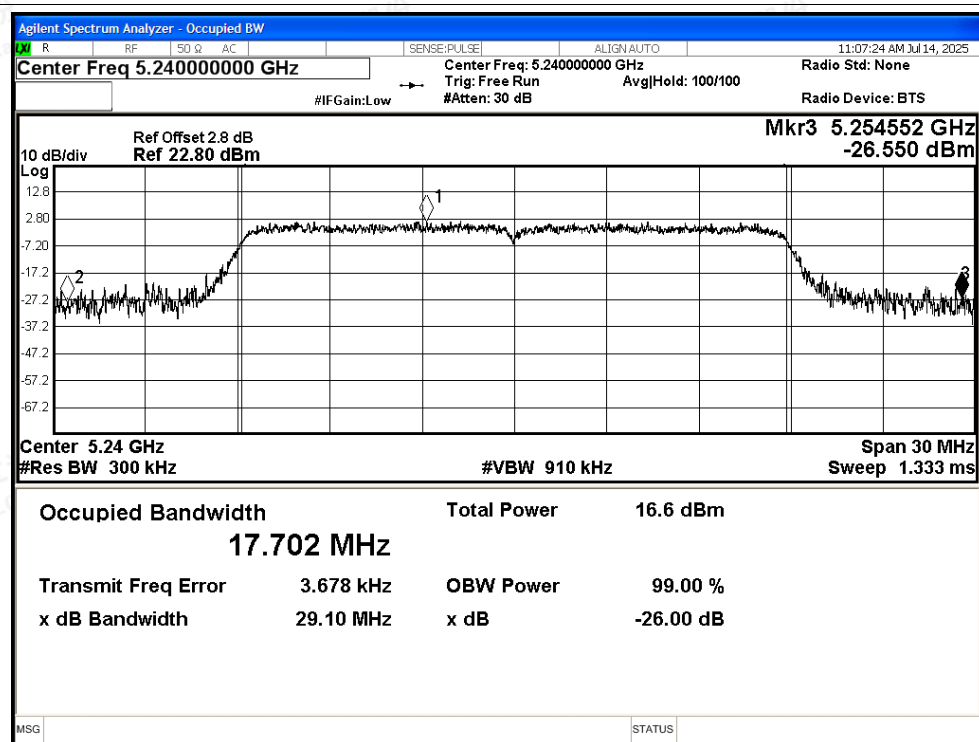

-26dB Bandwidth NVNT ac40 5190MHz Ant2

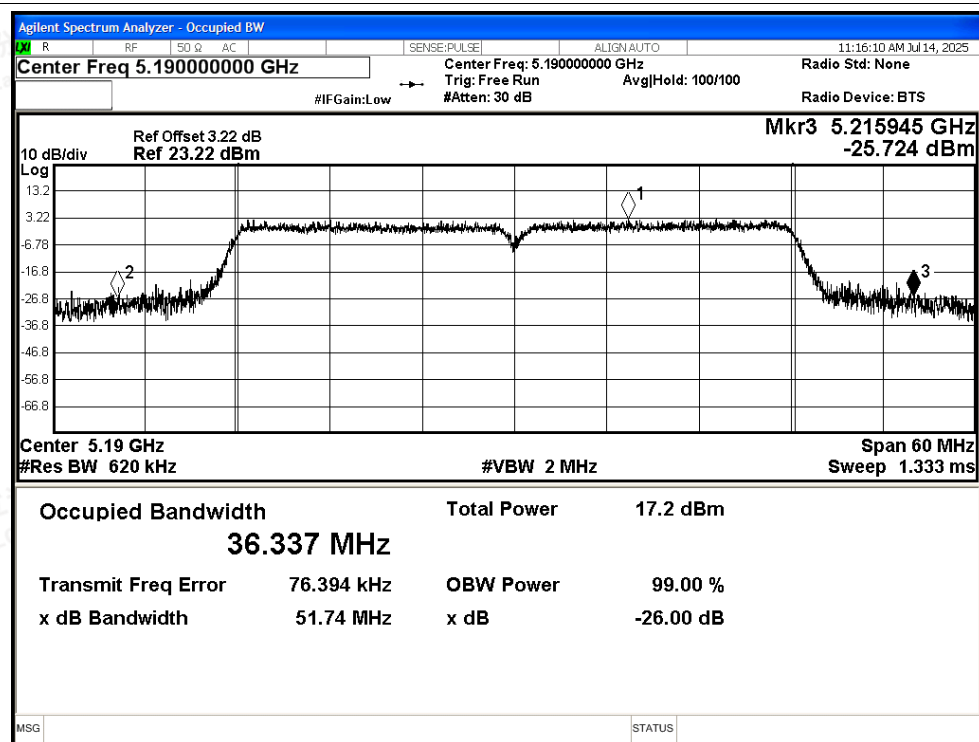

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT ac40 5230MHz Ant2

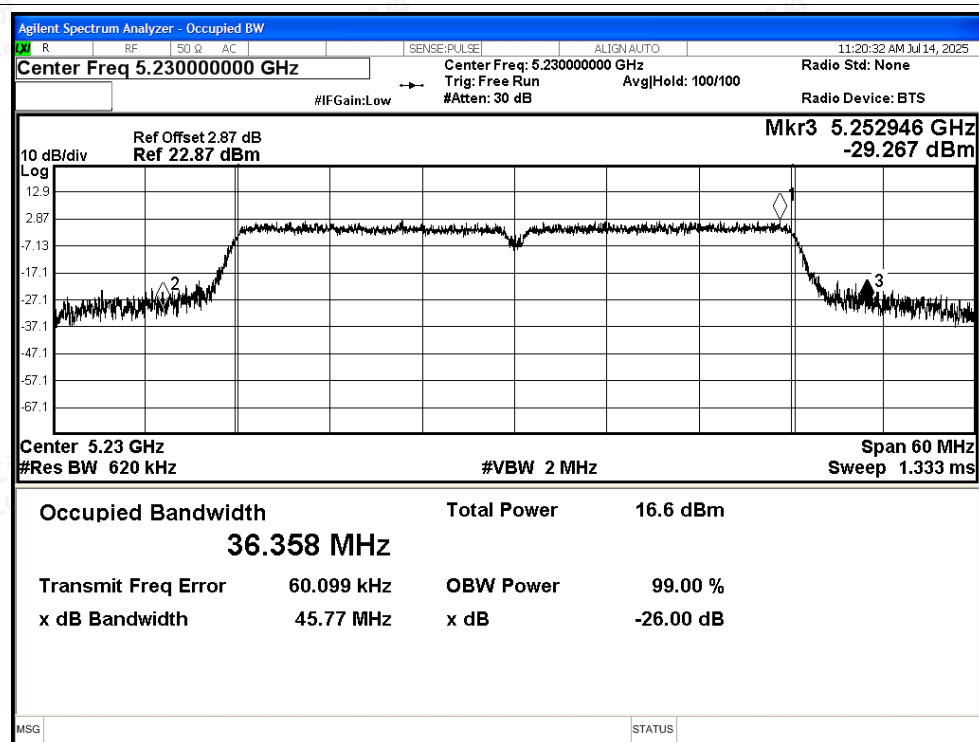

-26dB Bandwidth NVNT ac80 5210MHz Ant2

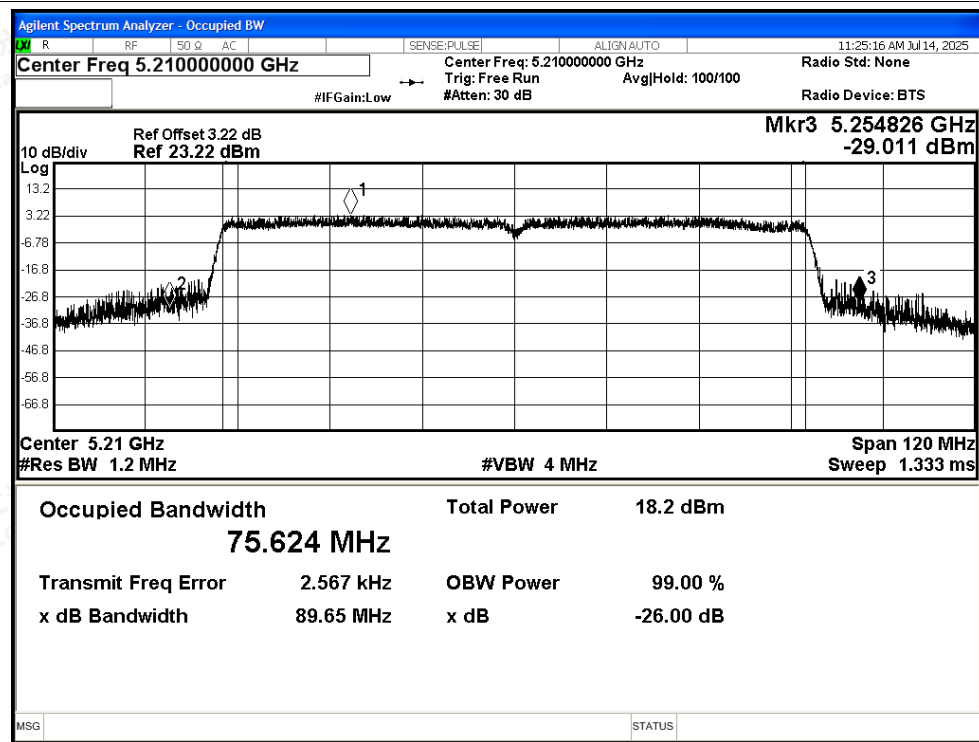

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT ax20 5180MHz Ant2

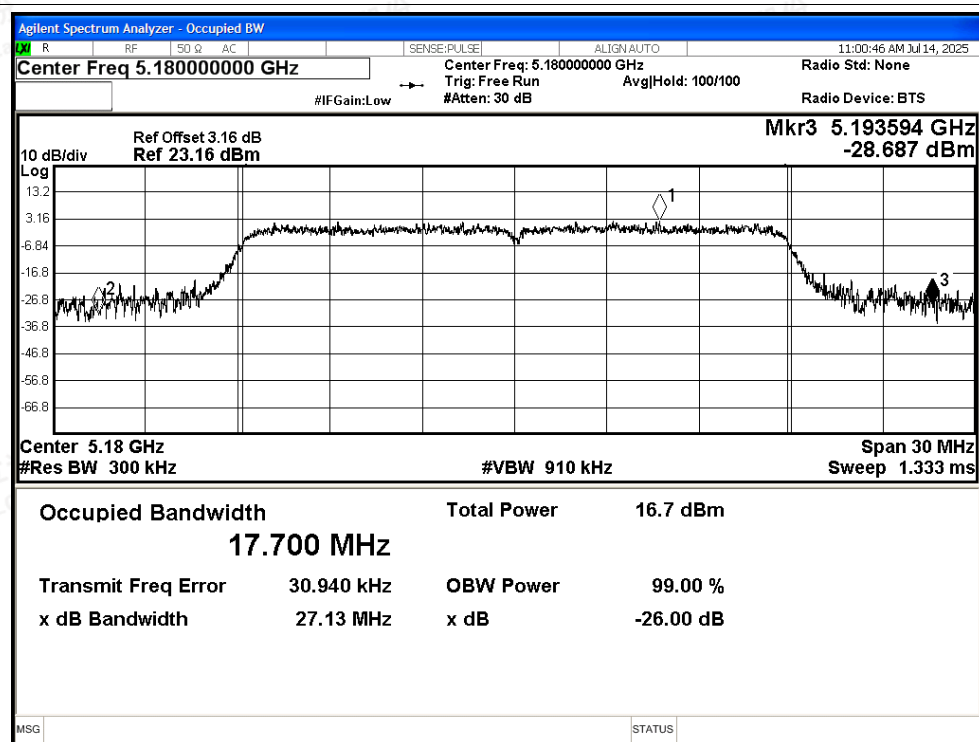

-26dB Bandwidth NVNT ax20 5200MHz Ant2

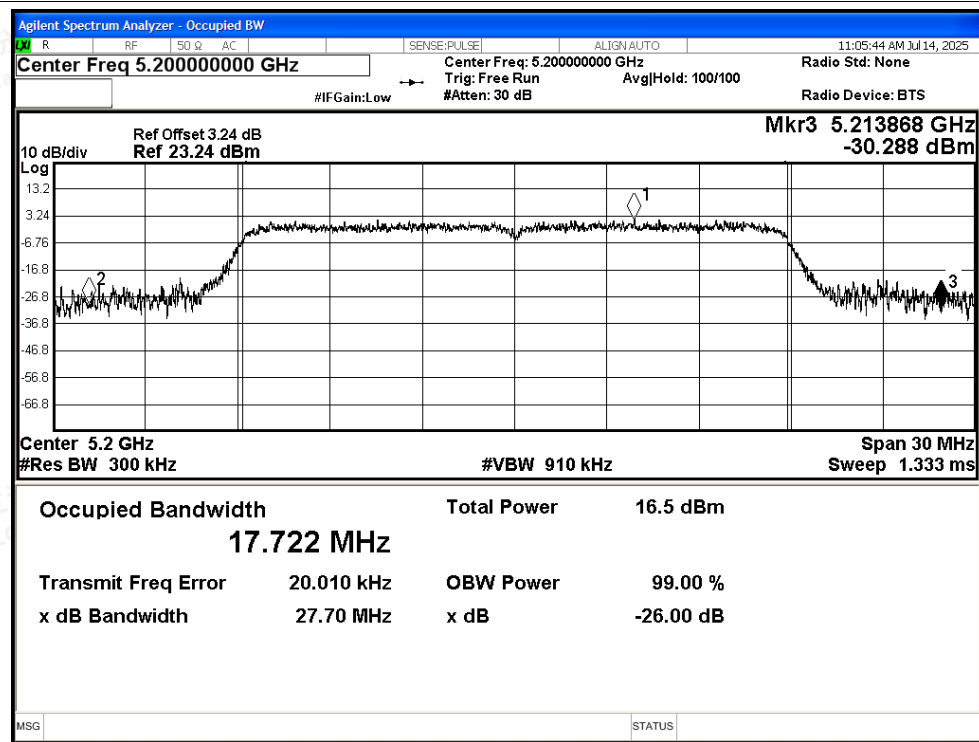

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT ax20 5240MHz Ant2

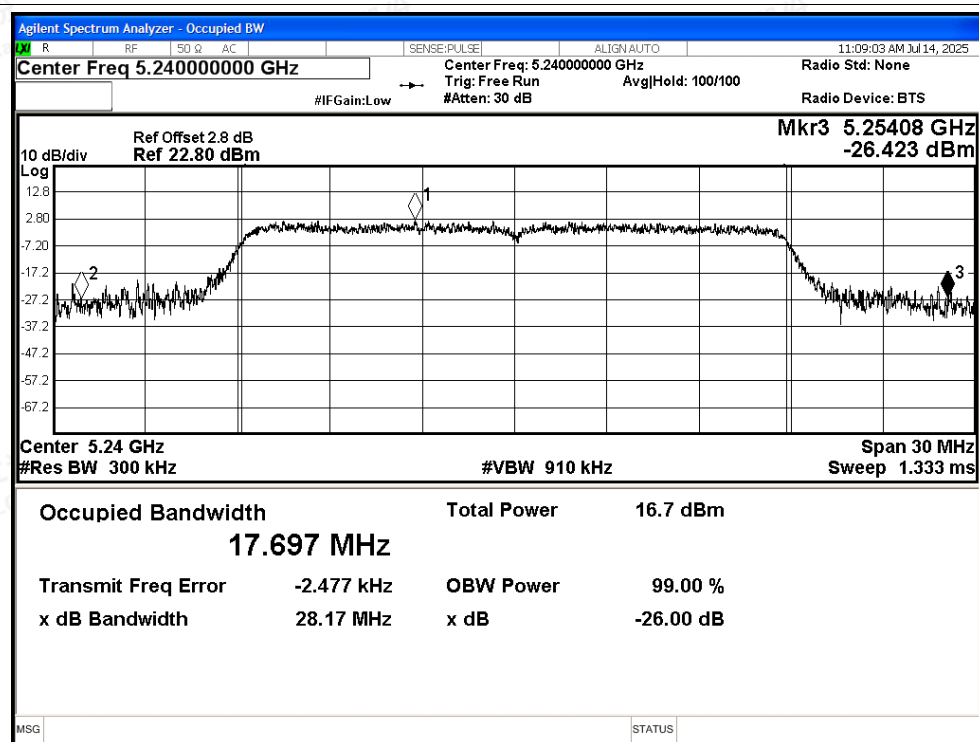

-26dB Bandwidth NVNT ax40 5190MHz Ant2

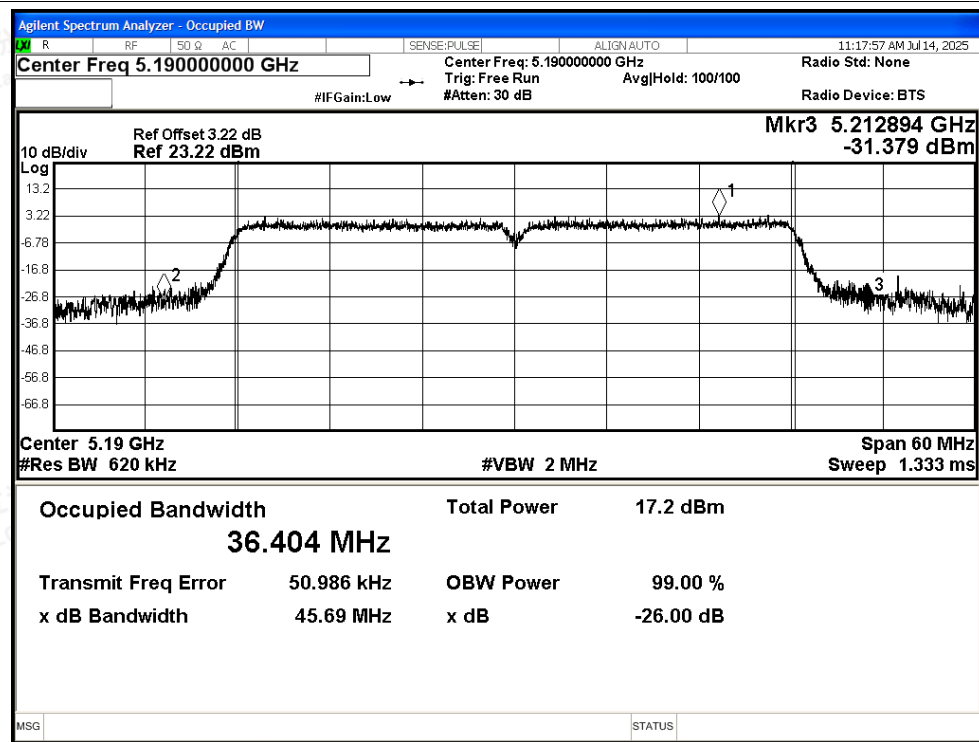

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT ax40 5230MHz Ant2

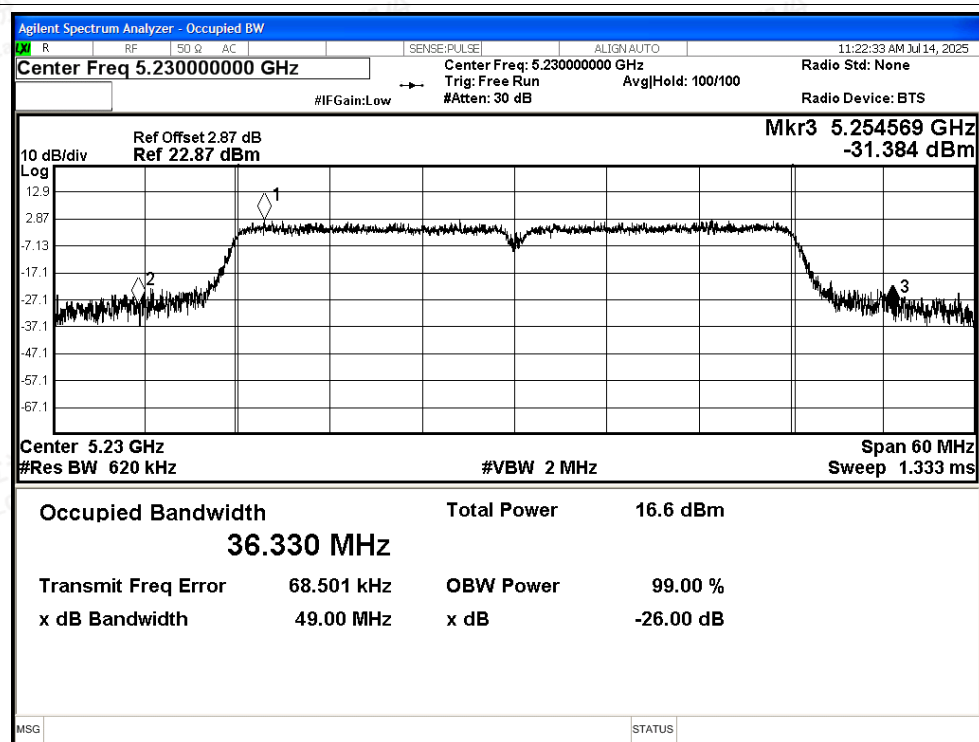

-26dB Bandwidth NVNT ax80 5210MHz Ant2

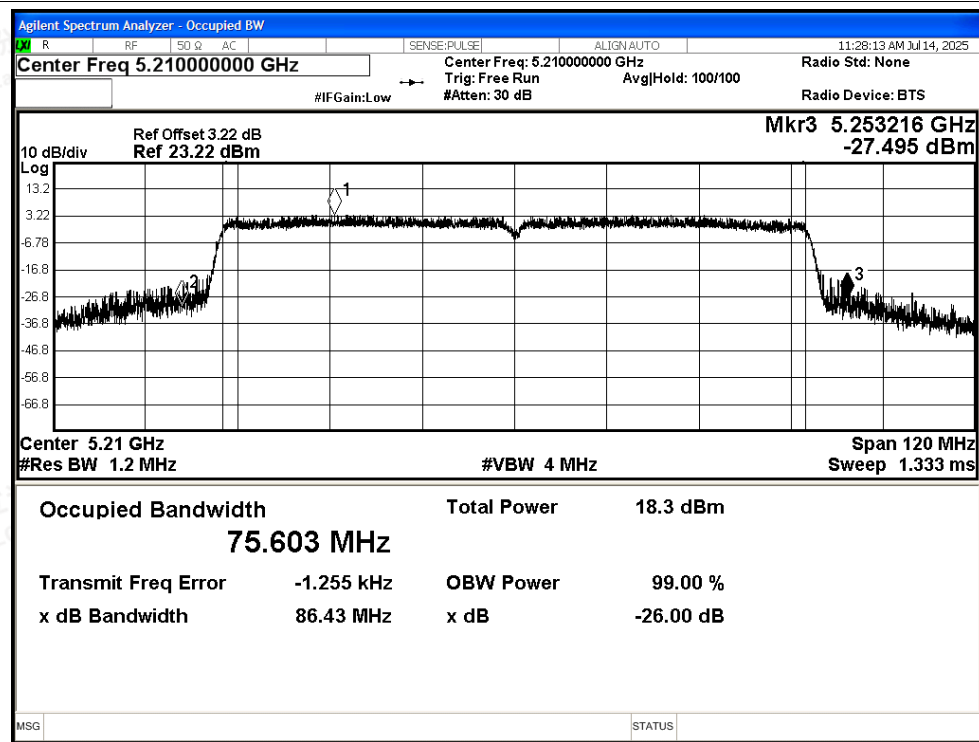

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



D.2 Maximum Conducted Output Power

Condition	Mode	Frequency (MHz)	Antenna	Conducted Power (dBm)	Duty Factor (dB)	Total Power (dBm)	Limit (dBm)	Verdict
NVNT	a	5180	Ant1	11.83	0.24	12.07	24	Pass
NVNT	a	5200	Ant1	11.71	0.24	11.95	24	Pass
NVNT	a	5240	Ant1	11.74	0.24	11.98	24	Pass
NVNT	n20	5180	Ant1	11.75	0.12	11.87	24	Pass
NVNT	n20	5200	Ant1	11.01	0.12	11.13	24	Pass
NVNT	n20	5240	Ant1	11.29	0.12	11.41	24	Pass
NVNT	n40	5190	Ant1	10.43	0.24	10.67	24	Pass
NVNT	n40	5230	Ant1	10.73	0.24	10.97	24	Pass
NVNT	ac20	5180	Ant1	11.57	0.12	11.69	24	Pass
NVNT	ac20	5200	Ant1	11.21	0.12	11.33	24	Pass
NVNT	ac20	5240	Ant1	10.79	0.12	10.91	24	Pass
NVNT	ac40	5190	Ant1	10.47	0.24	10.71	24	Pass
NVNT	ac40	5230	Ant1	10.77	0.24	11.01	24	Pass
NVNT	ac80	5210	Ant1	10.69	0.47	11.16	24	Pass
NVNT	ax20	5180	Ant1	11.64	0.12	11.76	24	Pass
NVNT	ax20	5200	Ant1	11.15	0.12	11.27	24	Pass
NVNT	ax20	5240	Ant1	10.73	0.12	10.85	24	Pass
NVNT	ax40	5190	Ant1	10.57	0.24	10.81	24	Pass
NVNT	ax40	5230	Ant1	10.67	0.23	10.9	24	Pass
NVNT	ax80	5210	Ant1	9.93	0.47	10.4	24	Pass

Condition	Mode	Frequency (MHz)	Antenna	Conducted Power (dBm)	Duty Factor (dB)	Total Power (dBm)	Limit (dBm)	Verdict
NVNT	a	5180	Ant2	11.31	0.24	11.55	24	Pass
NVNT	a	5200	Ant2	11.49	0.24	11.73	24	Pass
NVNT	a	5240	Ant2	11.53	0.24	11.77	24	Pass
NVNT	n20	5180	Ant2	11.23	0.12	11.35	24	Pass
NVNT	n20	5200	Ant2	10.96	0.12	11.08	24	Pass
NVNT	n20	5240	Ant2	11.03	0.12	11.15	24	Pass
NVNT	n40	5190	Ant2	10.82	0.24	11.06	24	Pass
NVNT	n40	5230	Ant2	10.07	0.24	10.31	24	Pass
NVNT	ac20	5180	Ant2	11.21	0.12	11.33	24	Pass
NVNT	ac20	5200	Ant2	11.03	0.12	11.15	24	Pass
NVNT	ac20	5240	Ant2	11.12	0.12	11.24	24	Pass
NVNT	ac40	5190	Ant2	10.86	0.24	11.1	24	Pass
NVNT	ac40	5230	Ant2	10.07	0.24	10.31	24	Pass
NVNT	ac80	5210	Ant2	11.06	0.47	11.53	24	Pass
NVNT	ax20	5180	Ant2	11.18	0.12	11.3	24	Pass
NVNT	ax20	5200	Ant2	10.98	0.12	11.1	24	Pass
NVNT	ax20	5240	Ant2	11.07	0.12	11.19	24	Pass
NVNT	ax40	5190	Ant2	10.87	0.24	11.11	24	Pass
NVNT	ax40	5230	Ant2	10.11	0.24	10.35	24	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax80	5210	Ant2	11.03	0.47	11.5	24	Pass
------	------	------	------	-------	------	------	----	------

MIMO

Condition	Mode	Frequency (MHz)	Antenna		Total Power (dBm)	Limit (dBm)	Verdict
			Ant1	Ant2			
NVNT	n20	5180	11.87	11.35	14.63	30	Pass
NVNT	n20	5200	11.13	11.08	14.12	30	Pass
NVNT	n20	5240	11.41	11.15	14.29	30	Pass
NVNT	n40	5190	10.67	11.06	13.88	30	Pass
NVNT	n40	5230	10.97	10.31	13.66	30	Pass
NVNT	ac20	5180	11.69	11.33	14.52	30	Pass
NVNT	ac20	5200	11.33	11.15	14.25	30	Pass
NVNT	ac20	5240	10.91	11.24	14.09	30	Pass
NVNT	ac40	5190	10.71	11.1	13.92	30	Pass
NVNT	ac40	5230	11.01	10.31	13.68	30	Pass
NVNT	ac80	5210	11.16	11.53	14.36	30	Pass
NVNT	ax20	5180	11.76	11.3	14.55	30	Pass
NVNT	ax20	5200	11.27	11.1	14.20	30	Pass
NVNT	ax20	5240	10.85	11.19	14.03	30	Pass
NVNT	ax40	5190	10.81	11.11	13.97	30	Pass
NVNT	ax40	5230	10.9	10.35	13.64	30	Pass
NVNT	ax80	5210	10.4	11.5	14.00	30	Pass





D.3 Maximum Power Spectral Density Level

Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm/MHz)	Duty Factor (dB)	Total PSD (dBm/MHz)	Limit (dBm/MHz)	Verdict
NVNT	a	5180	Ant1	1.07	0.24	1.31	11	Pass
NVNT	a	5200	Ant1	1.03	0.24	1.27	11	Pass
NVNT	a	5240	Ant1	-0.7	0.24	-0.46	11	Pass
NVNT	n20	5180	Ant1	0.97	0.12	1.09	11	Pass
NVNT	n20	5200	Ant1	0.17	0.12	0.29	11	Pass
NVNT	n20	5240	Ant1	0.34	0.12	0.46	11	Pass
NVNT	n40	5190	Ant1	-2.83	0.24	-2.59	11	Pass
NVNT	n40	5230	Ant1	-3.59	0.24	-3.35	11	Pass
NVNT	ac20	5180	Ant1	0.63	0.12	0.75	11	Pass
NVNT	ac20	5200	Ant1	0.43	0.12	0.55	11	Pass
NVNT	ac20	5240	Ant1	0.11	0.12	0.23	11	Pass
NVNT	ac40	5190	Ant1	-3.09	0.24	-2.85	11	Pass
NVNT	ac40	5230	Ant1	-2.85	0.24	-2.61	11	Pass
NVNT	ac80	5210	Ant1	-5.67	0.47	-5.2	11	Pass
NVNT	ax20	5180	Ant1	1.1	0.12	1.22	11	Pass
NVNT	ax20	5200	Ant1	0.38	0.12	0.5	11	Pass
NVNT	ax20	5240	Ant1	-0.18	0.12	-0.06	11	Pass
NVNT	ax40	5190	Ant1	-2.38	0.24	-2.14	11	Pass
NVNT	ax40	5230	Ant1	-3	0.23	-2.77	11	Pass
NVNT	ax80	5210	Ant1	-6.23	0.47	-5.76	11	Pass

Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm/MHz)	Duty Factor (dB)	Total PSD (dBm/MHz)	Limit (dBm/MHz)	Verdict
NVNT	a	5180	Ant2	0.74	0.24	0.98	11	Pass
NVNT	a	5200	Ant2	0.85	0.24	1.09	11	Pass
NVNT	a	5240	Ant2	1.01	0.24	1.25	11	Pass
NVNT	n20	5180	Ant2	0.38	0.12	0.5	11	Pass
NVNT	n20	5200	Ant2	0	0.12	0.12	11	Pass
NVNT	n20	5240	Ant2	0.35	0.12	0.47	11	Pass
NVNT	n40	5190	Ant2	-2.57	0.24	-2.33	11	Pass
NVNT	n40	5230	Ant2	-3.29	0.24	-3.05	11	Pass
NVNT	ac20	5180	Ant2	0.45	0.12	0.57	11	Pass
NVNT	ac20	5200	Ant2	0.28	0.12	0.4	11	Pass
NVNT	ac20	5240	Ant2	0.38	0.12	0.5	11	Pass
NVNT	ac40	5190	Ant2	-2.73	0.24	-2.49	11	Pass
NVNT	ac40	5230	Ant2	-3.47	0.24	-3.23	11	Pass
NVNT	ac80	5210	Ant2	-5.82	0.47	-5.35	11	Pass
NVNT	ax20	5180	Ant2	0.36	0.12	0.48	11	Pass
NVNT	ax20	5200	Ant2	0.19	0.12	0.31	11	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5240	Ant2	0.36	0.12	0.48	11	Pass
NVNT	ax40	5190	Ant2	-2.77	0.24	-2.53	11	Pass
NVNT	ax40	5230	Ant2	-3.2	0.24	-2.96	11	Pass
NVNT	ax80	5210	Ant2	-5.75	0.47	-5.28	11	Pass

MIMO


Condition	Mode	Frequency (MHz)	Conducted PSD (dBm/MHz)		Total PSD (dBm/MHz)	Limit (dBm/MHz)	Verdict
			Duty Factor (dB)				
			Ant1	Ant2			
NVNT	n20	5180	1.09	0.5	3.82	8.12	Pass
NVNT	n20	5200	0.29	0.12	3.22	8.12	Pass
NVNT	n20	5240	0.46	0.47	3.48	8.12	Pass
NVNT	n40	5190	-2.59	-2.33	0.55	8.12	Pass
NVNT	n40	5230	-3.35	-3.05	-0.19	8.12	Pass
NVNT	ac20	5180	0.75	0.57	3.67	8.12	Pass
NVNT	ac20	5200	0.55	0.4	3.49	8.12	Pass
NVNT	ac20	5240	0.23	0.5	3.38	8.12	Pass
NVNT	ac40	5190	-2.85	-2.49	0.34	8.12	Pass
NVNT	ac40	5230	-2.61	-3.23	0.10	8.12	Pass
NVNT	ac80	5210	-5.2	-5.35	-2.26	8.12	Pass
NVNT	ax20	5180	1.22	0.48	3.88	8.12	Pass
NVNT	ax20	5200	0.5	0.31	3.42	8.12	Pass
NVNT	ax20	5240	-0.06	0.48	3.23	8.12	Pass
NVNT	ax40	5190	-2.14	-2.53	0.68	8.12	Pass
NVNT	ax40	5230	-2.77	-2.96	0.15	8.12	Pass
NVNT	ax80	5210	-5.76	-5.28	-2.50	8.12	Pass






Test Graphs

PSD NVNT a 5180MHz Ant1

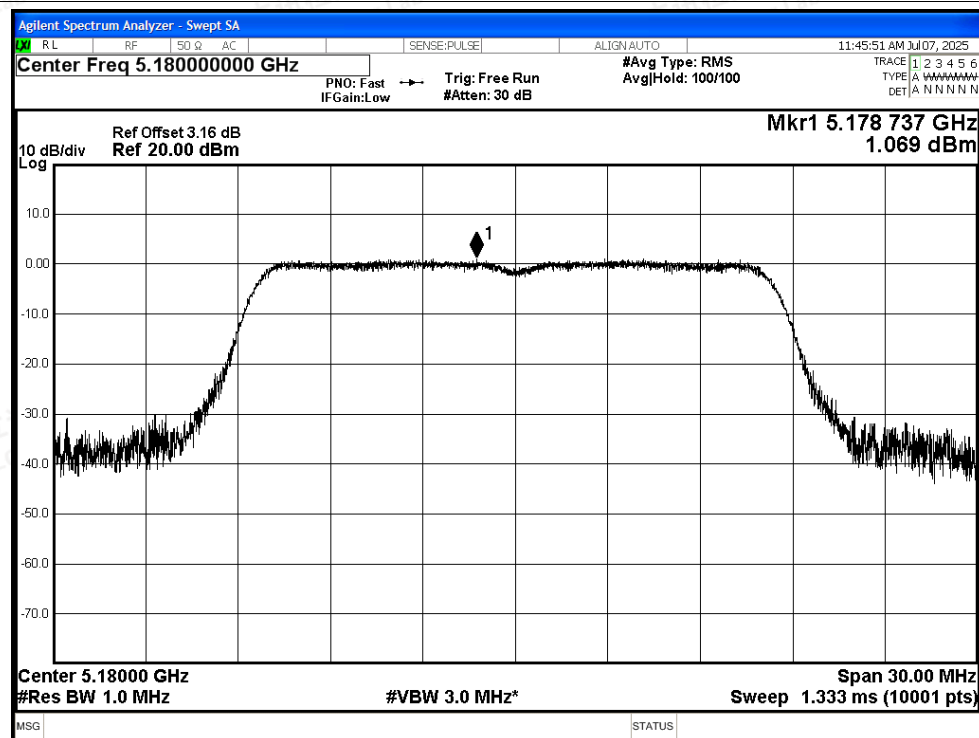

PSD NVNT a 5200MHz Ant1


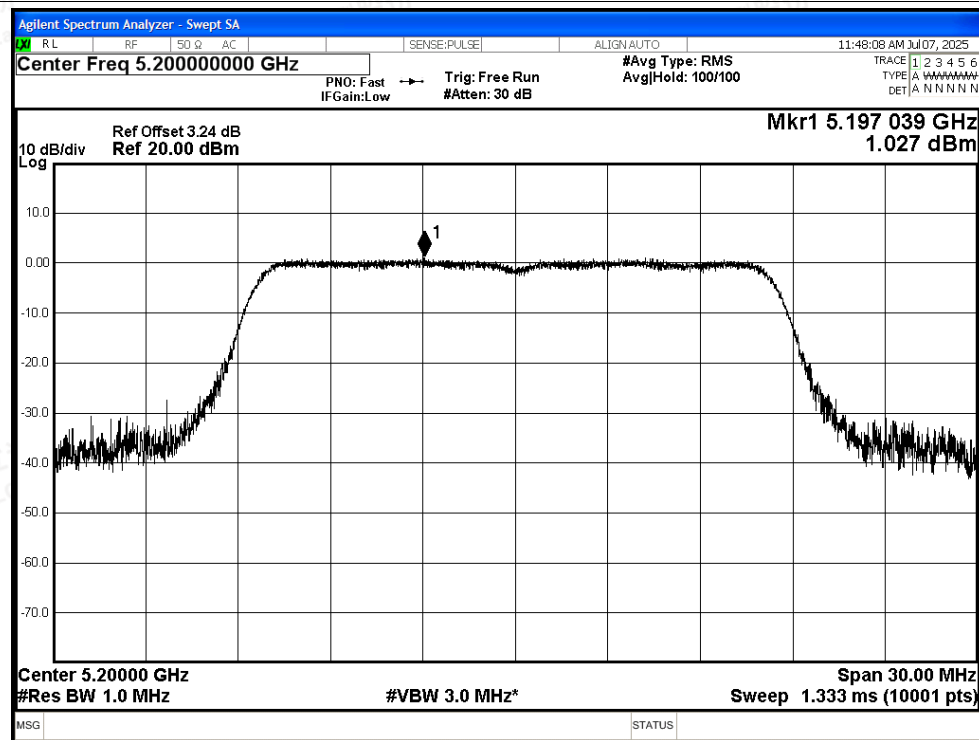


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

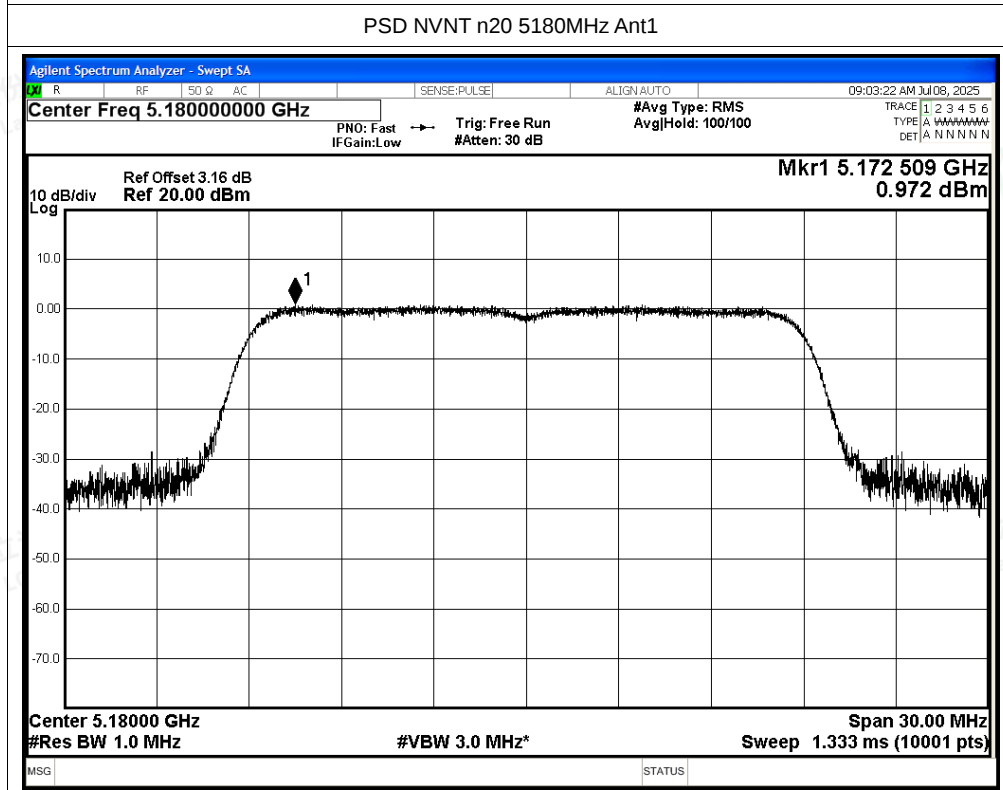
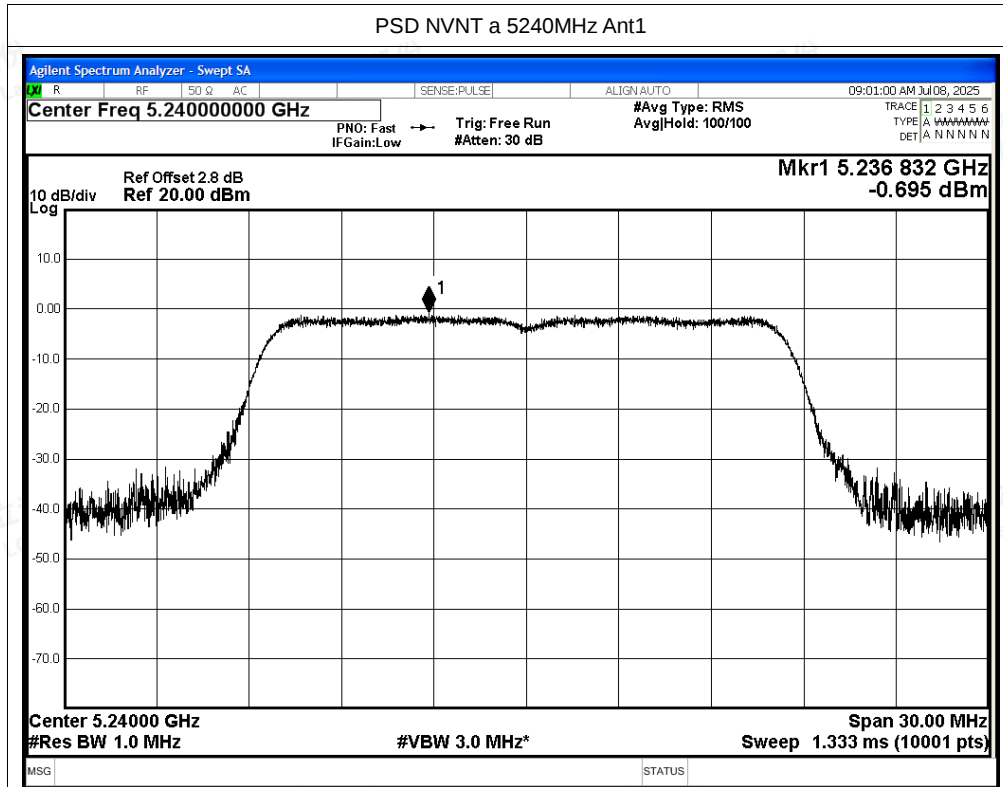


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

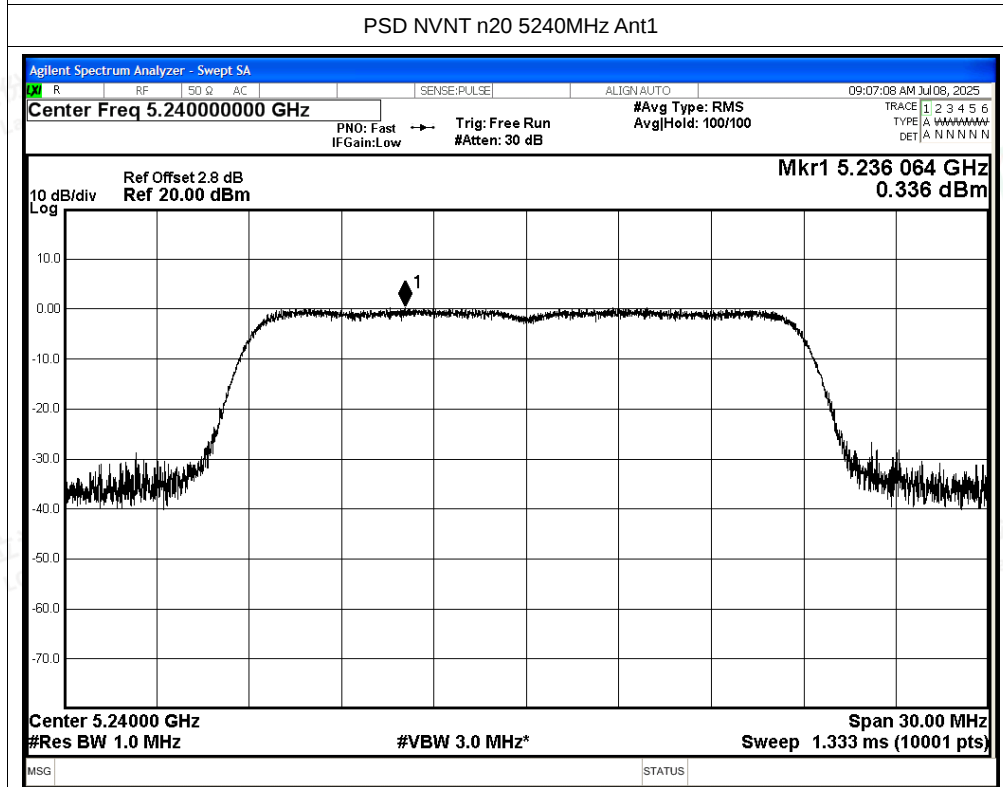
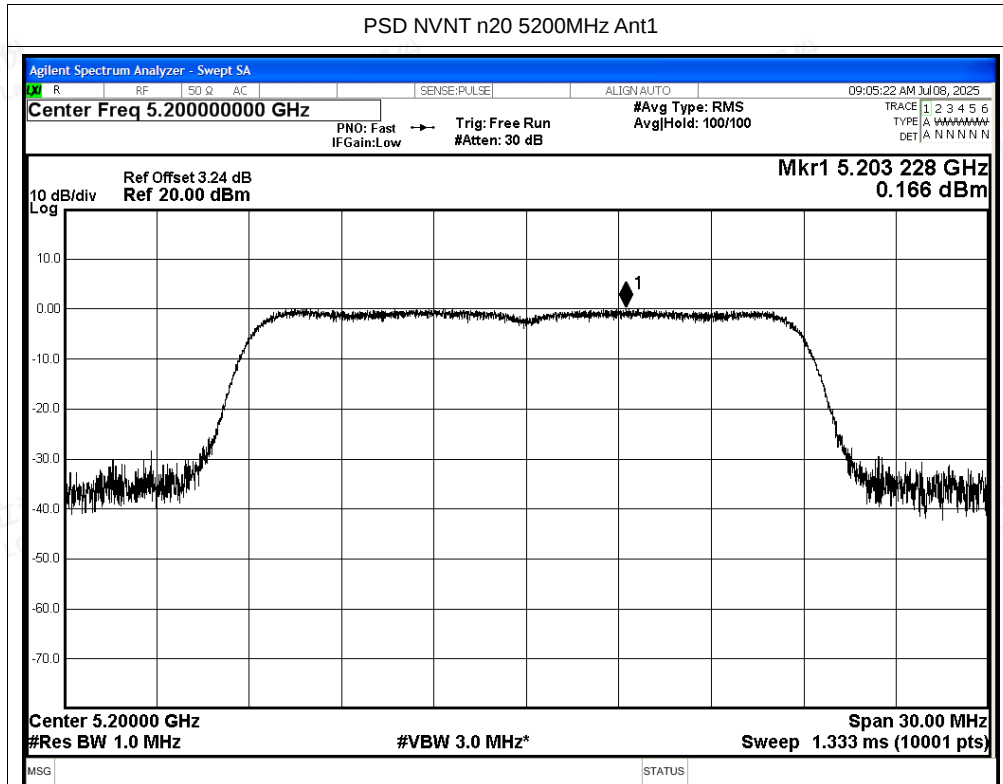


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

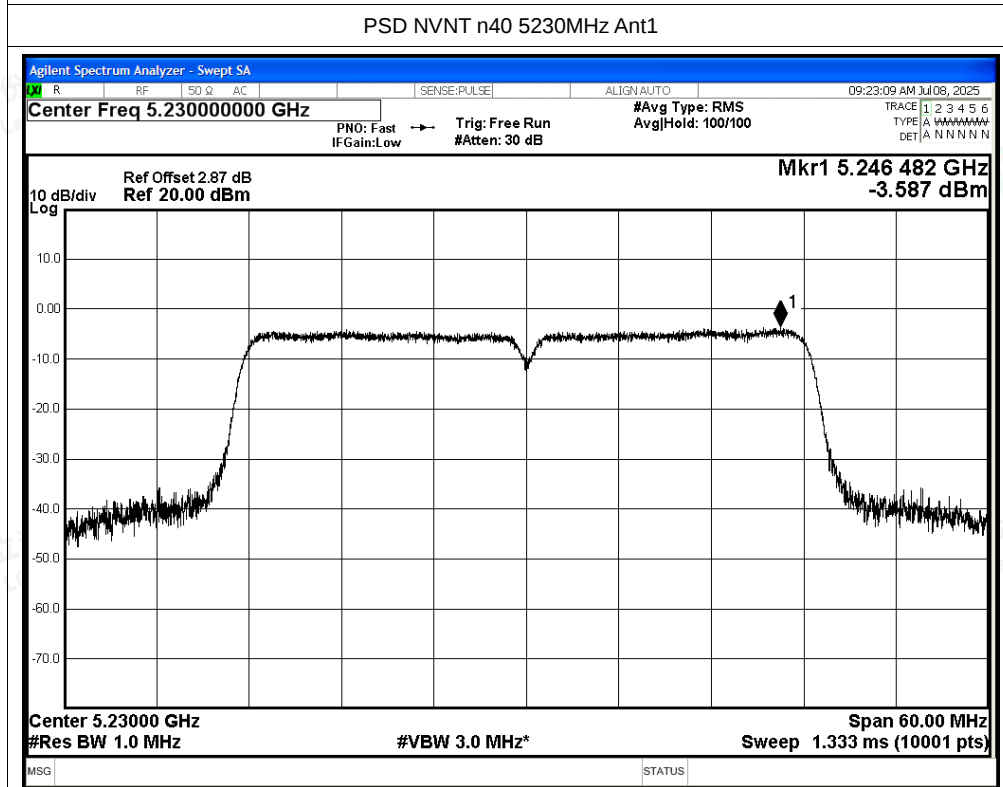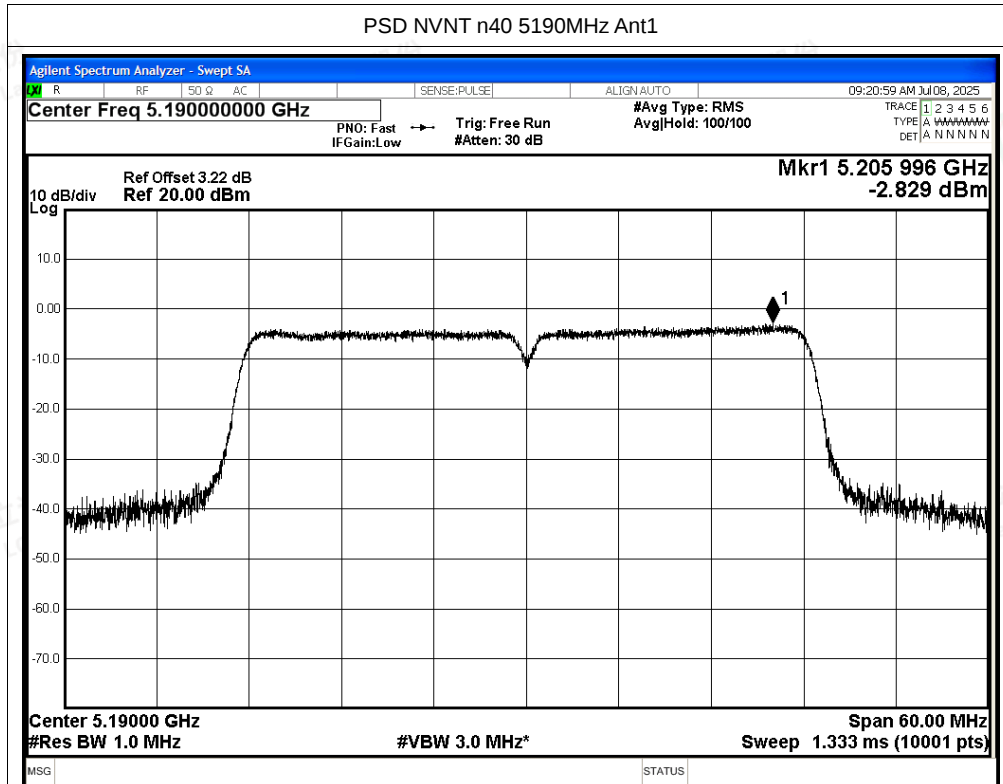

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac20 5180MHz Ant1

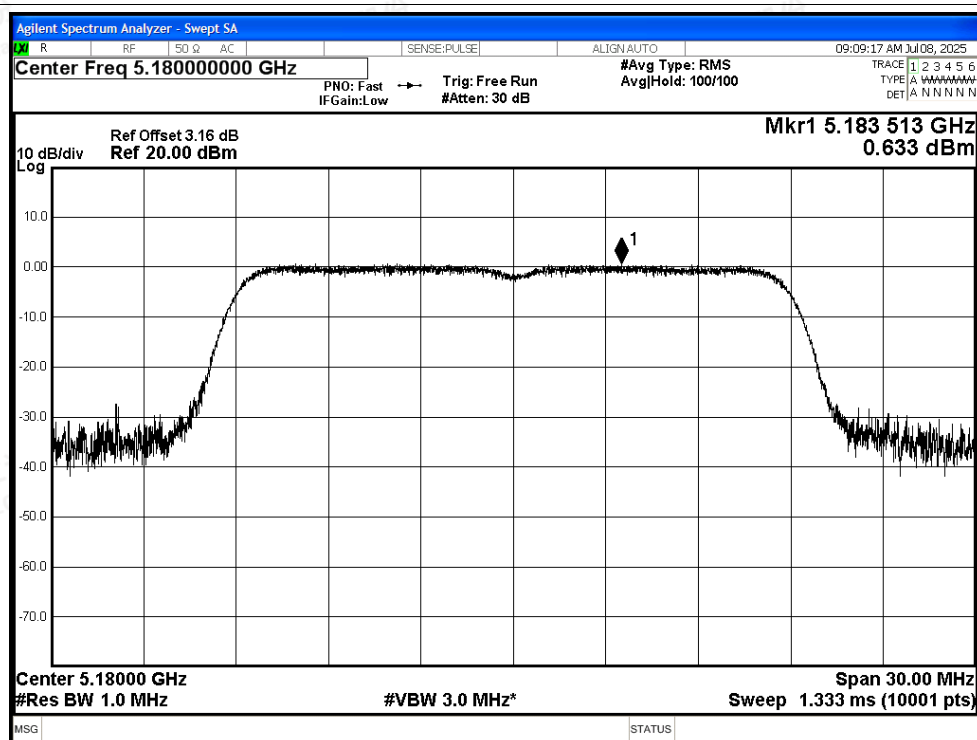

PSD NVNT ac20 5200MHz Ant1

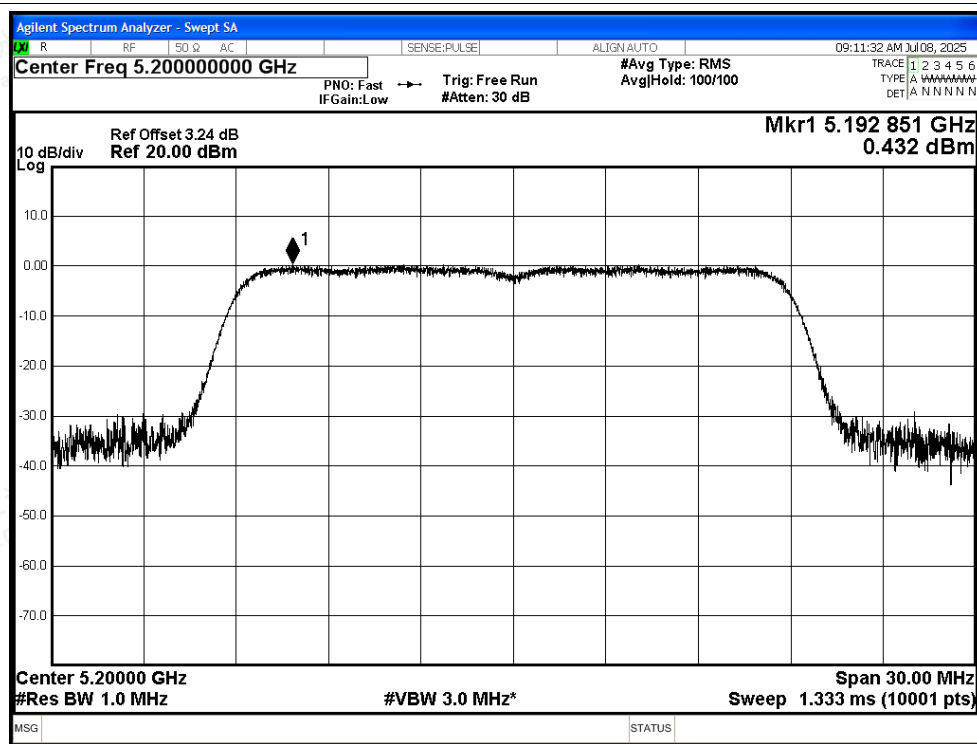

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac20 5240MHz Ant1

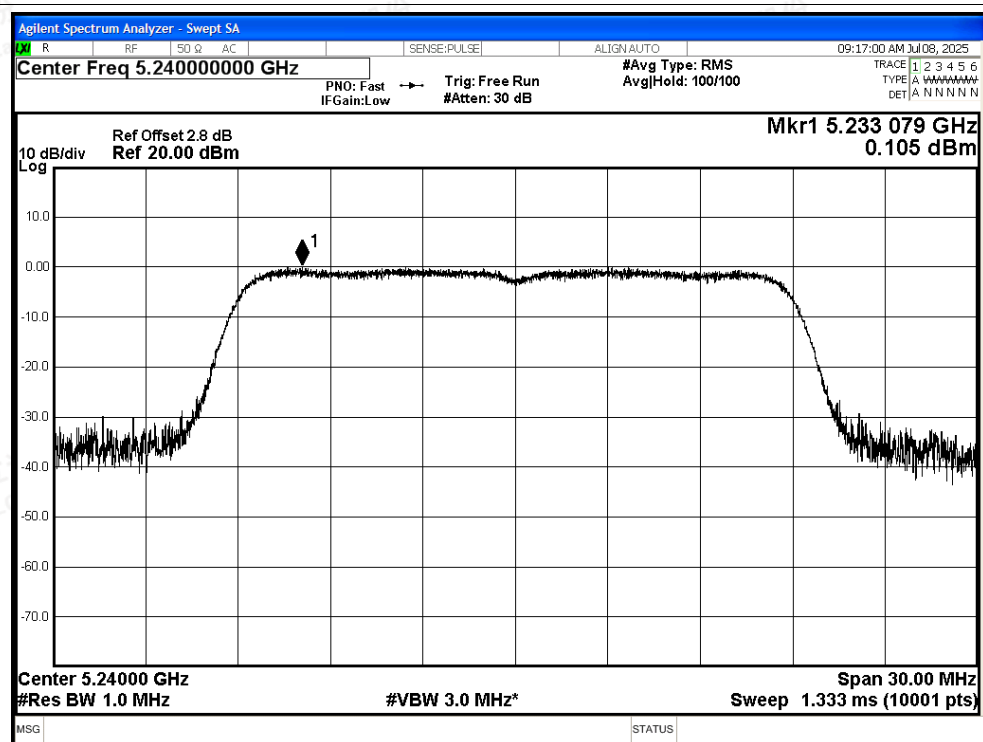

PSD NVNT ac40 5190MHz Ant1

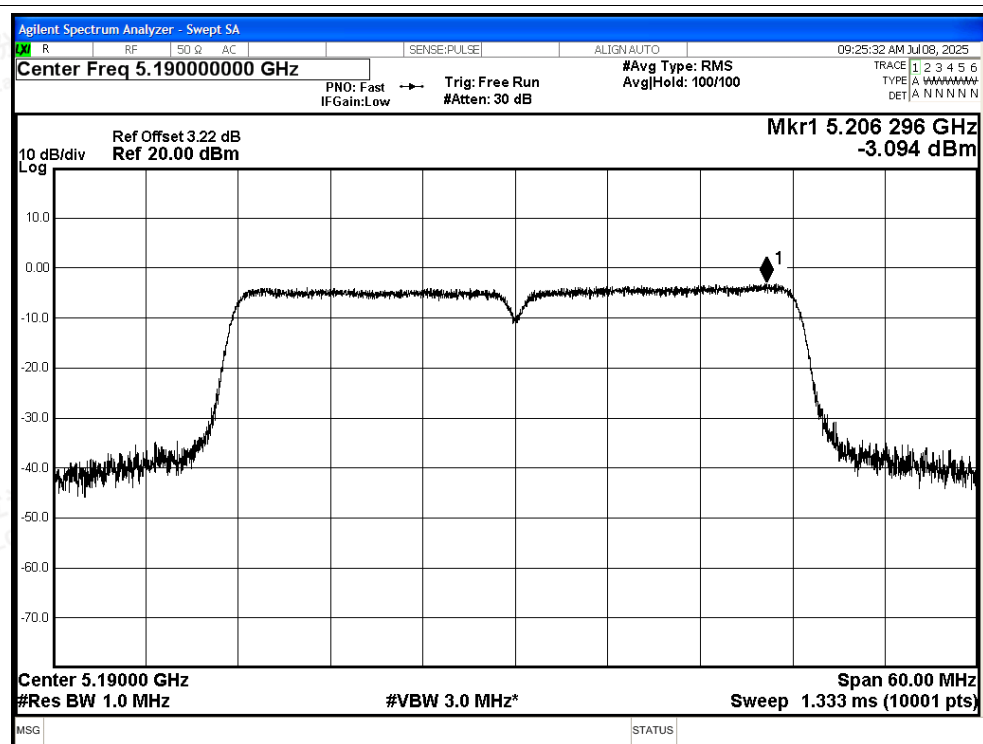

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac40 5230MHz Ant1

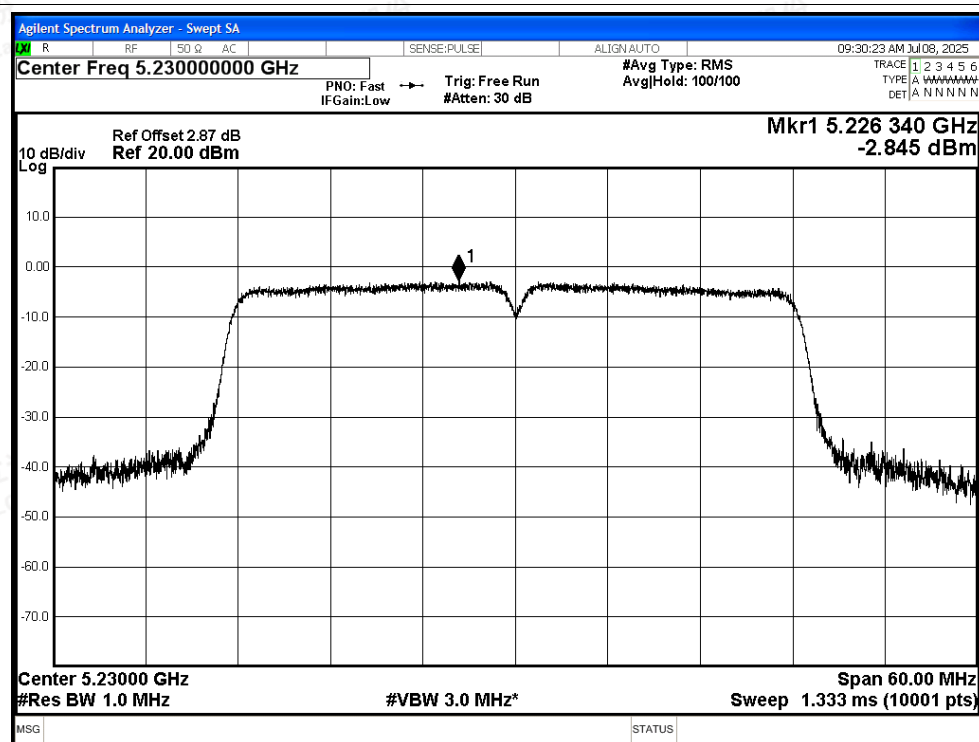

PSD NVNT ac80 5210MHz Ant1

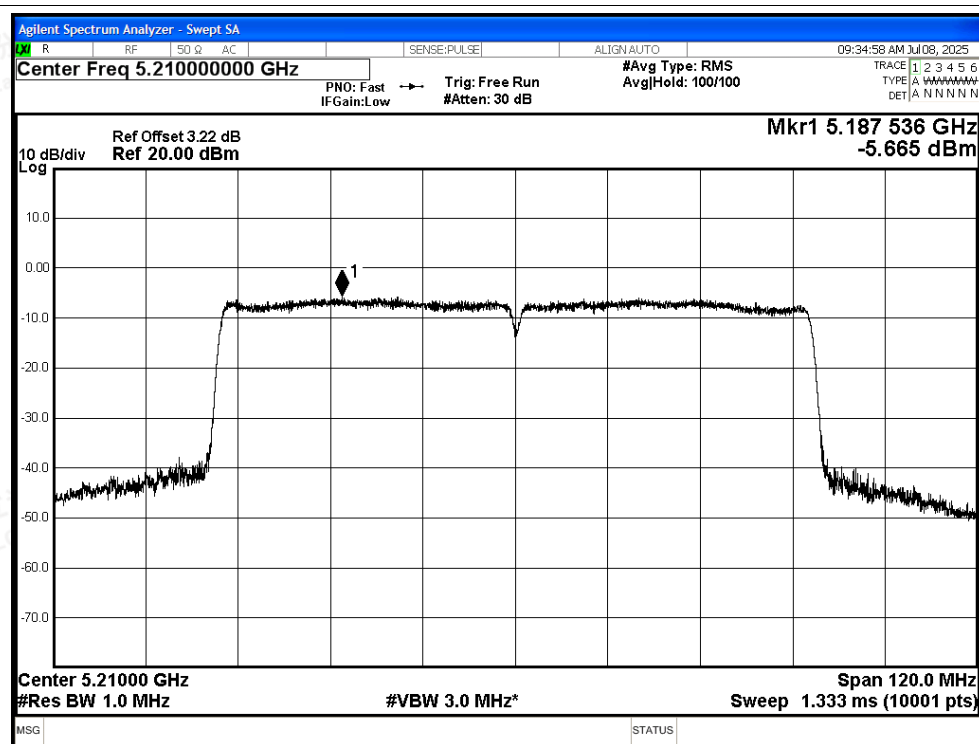

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax20 5180MHz Ant1

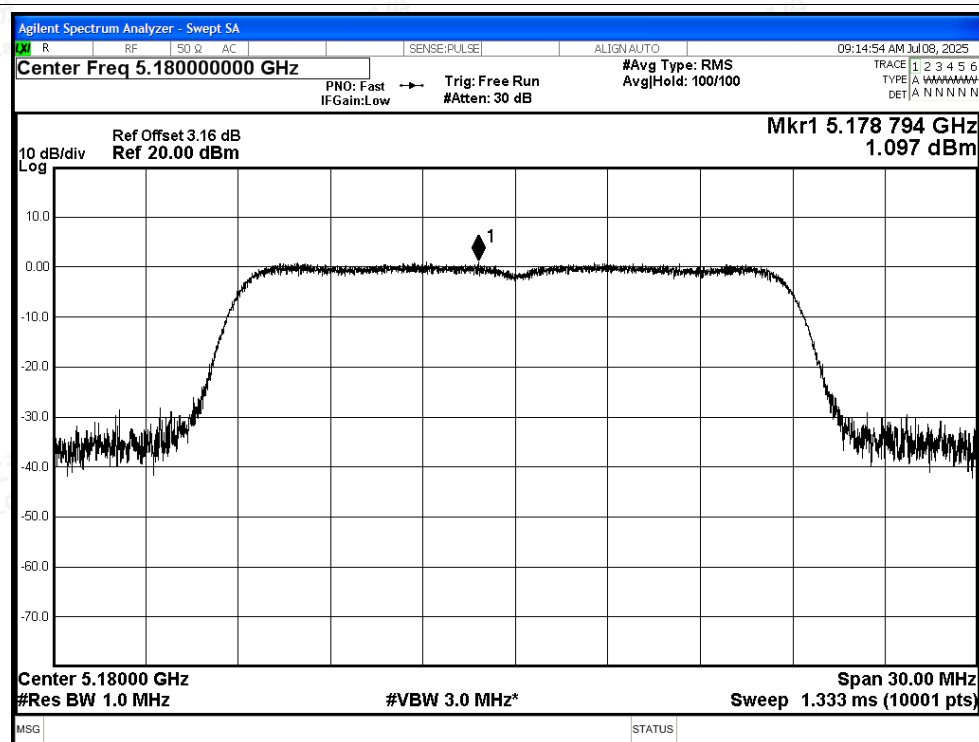

PSD NVNT ax20 5200MHz Ant1

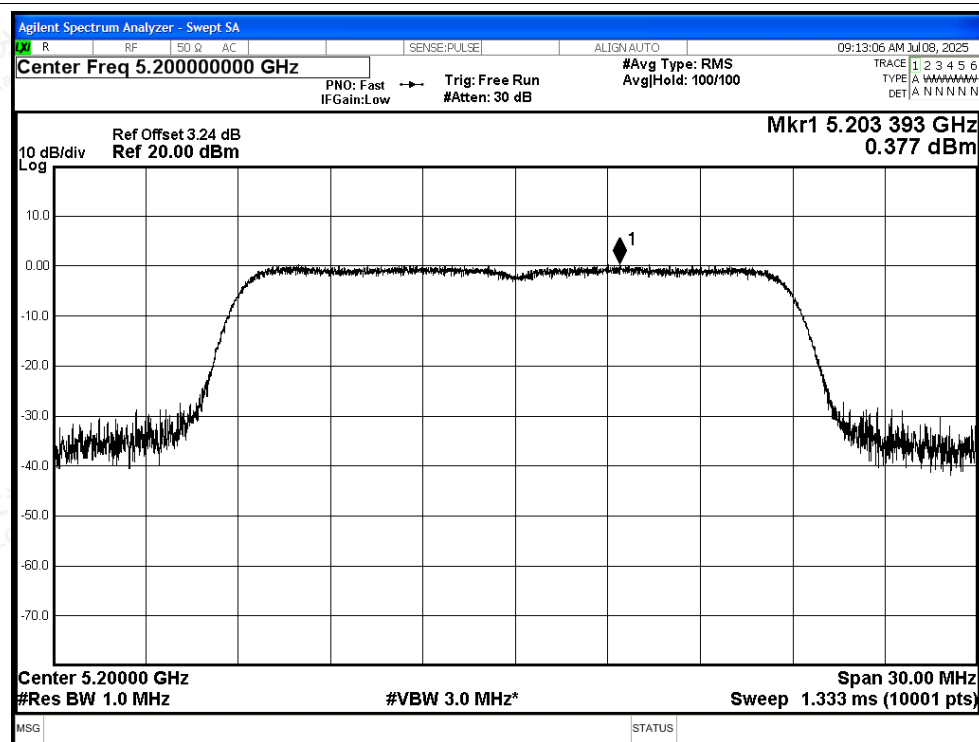

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax20 5240MHz Ant1

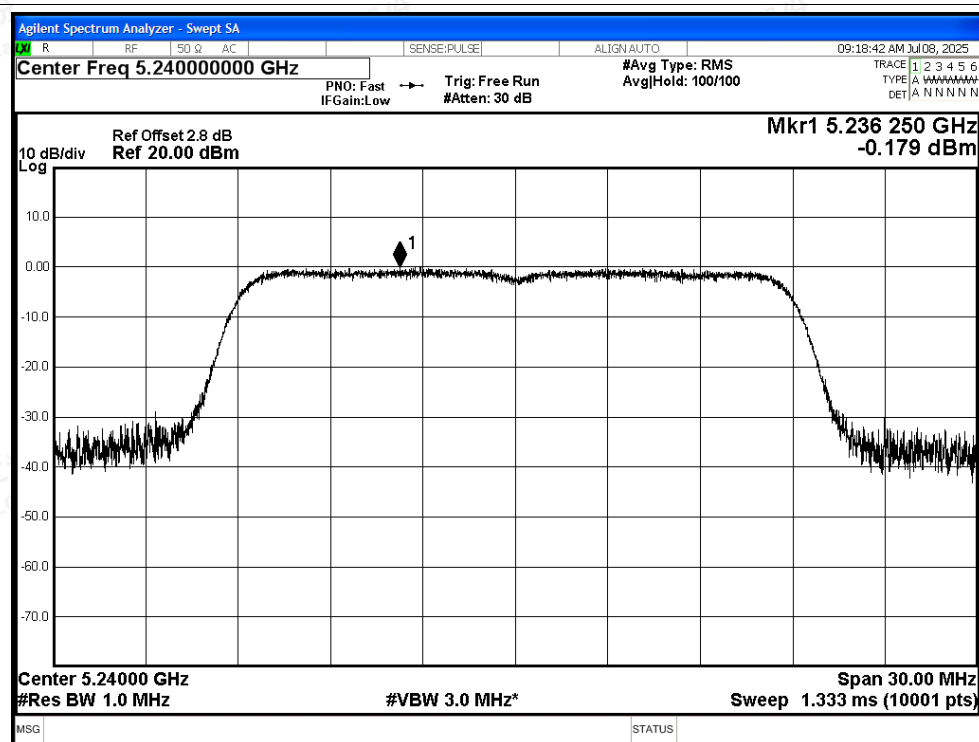

PSD NVNT ax40 5190MHz Ant1

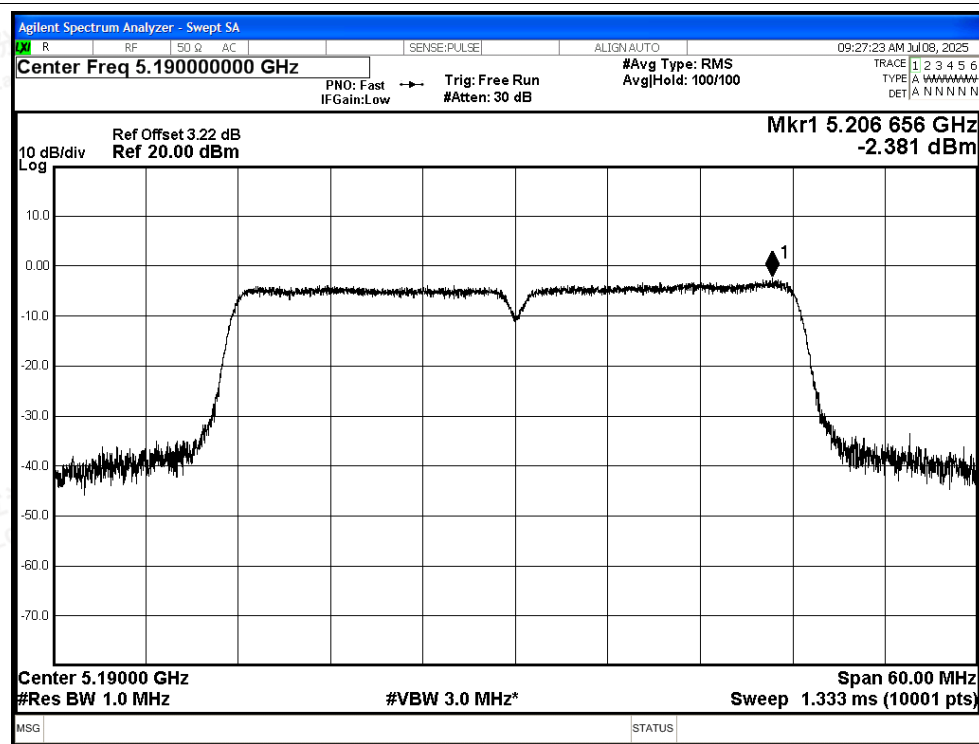

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax40 5230MHz Ant1

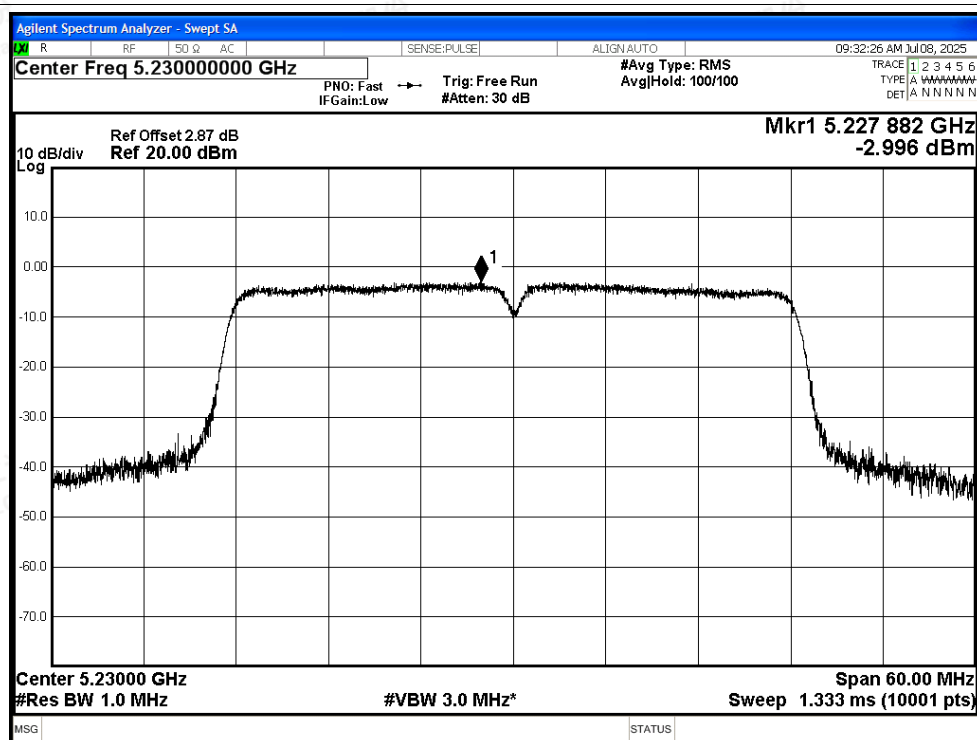

PSD NVNT ax80 5210MHz Ant1


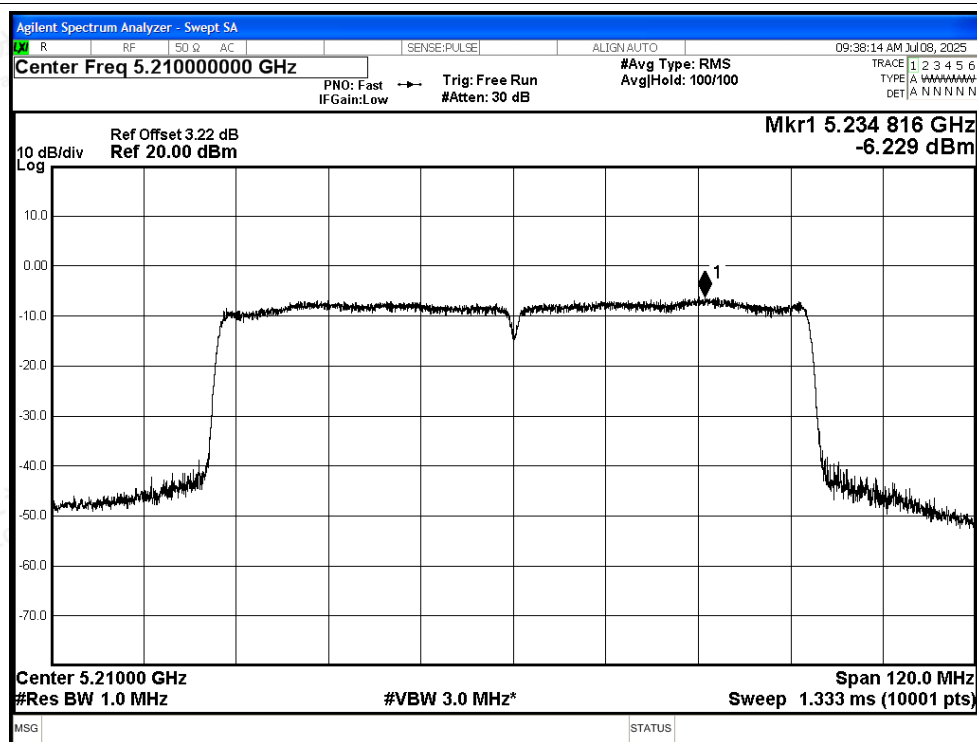


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

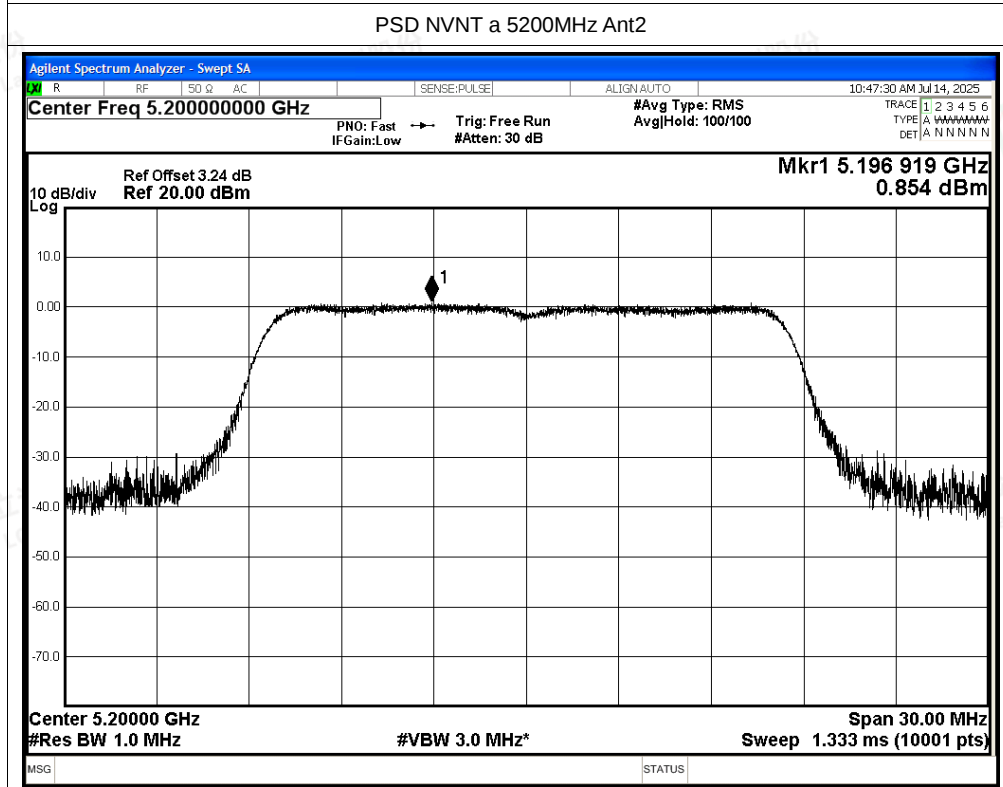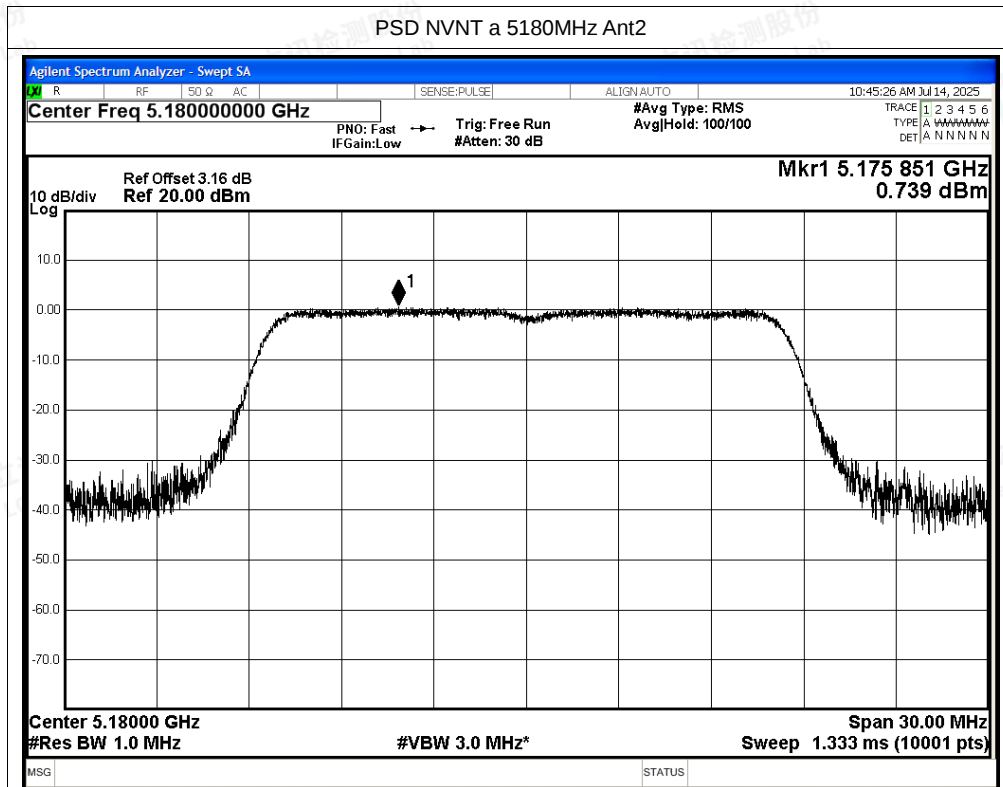

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT a 5240MHz Ant2

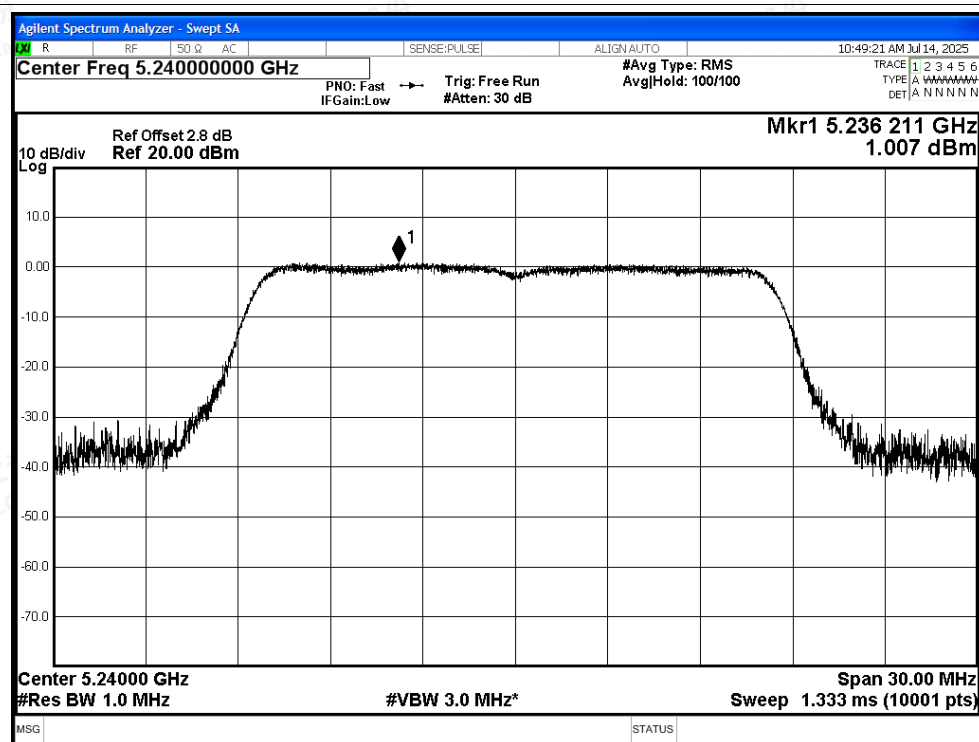

PSD NVNT n20 5180MHz Ant2


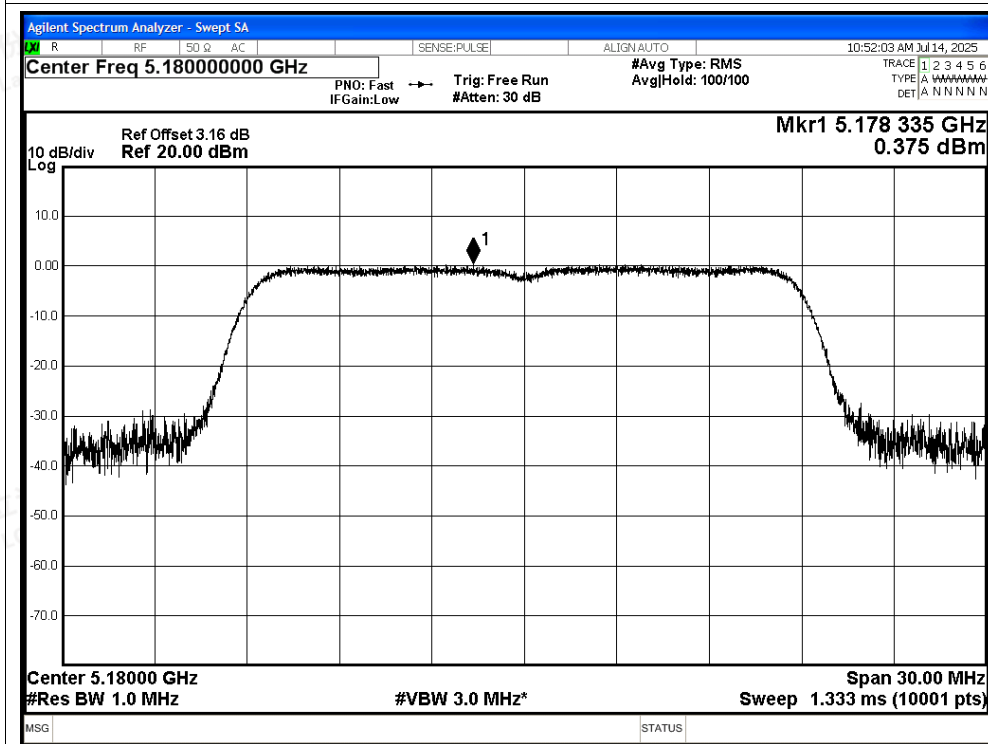




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

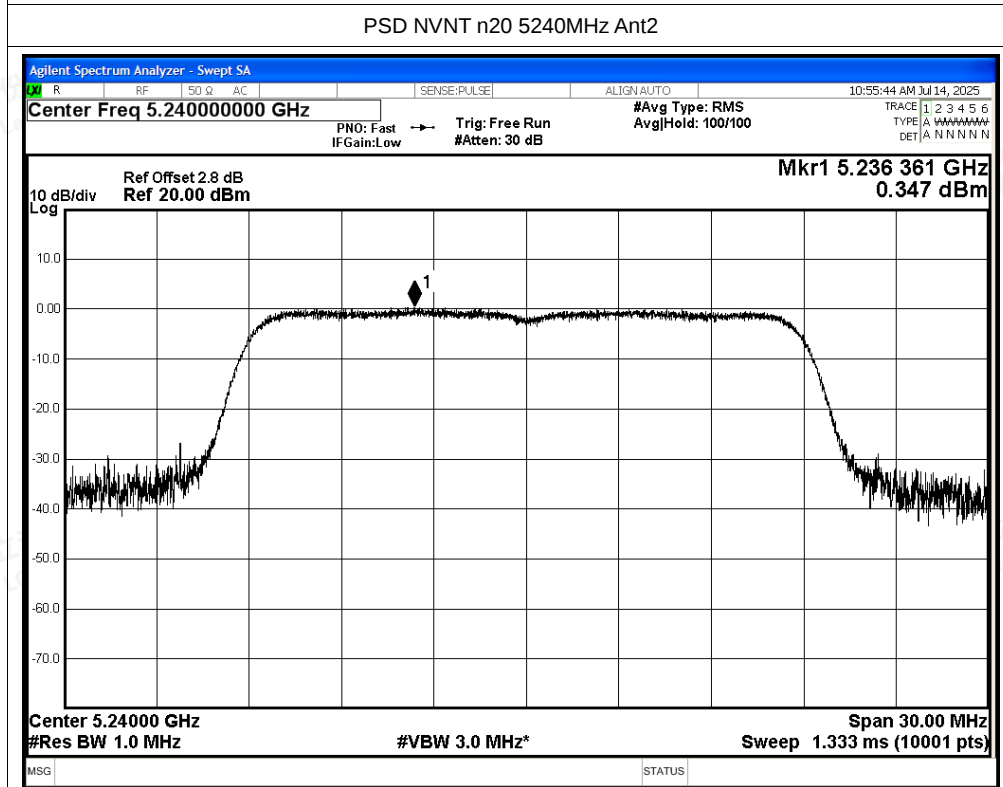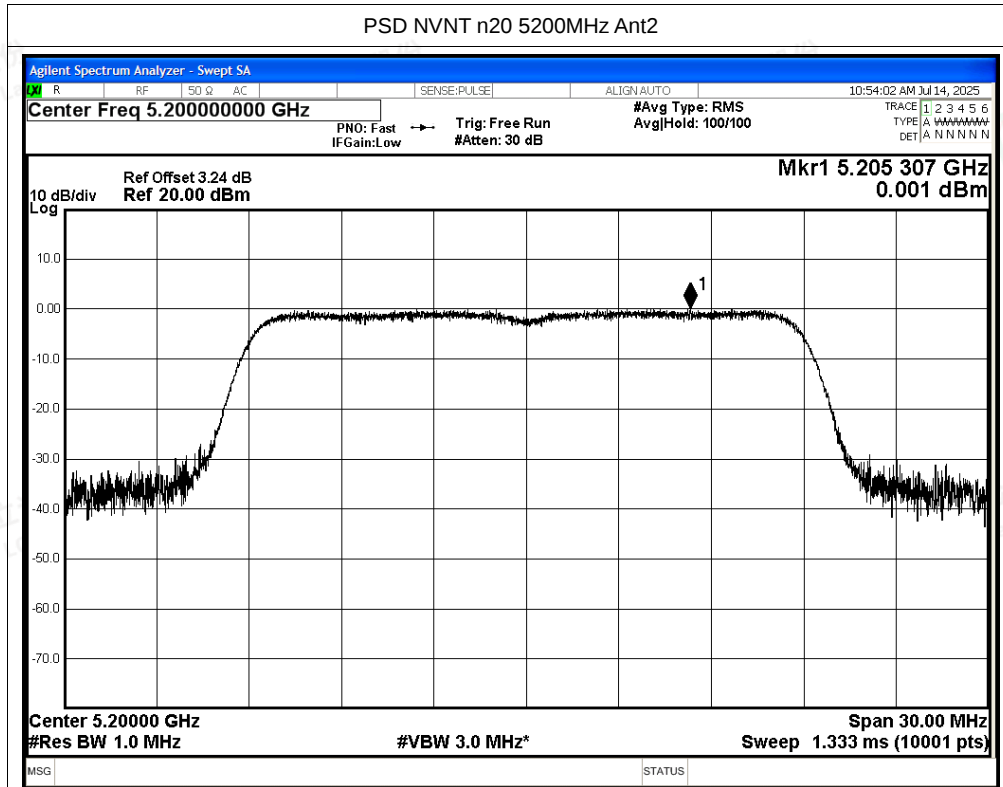

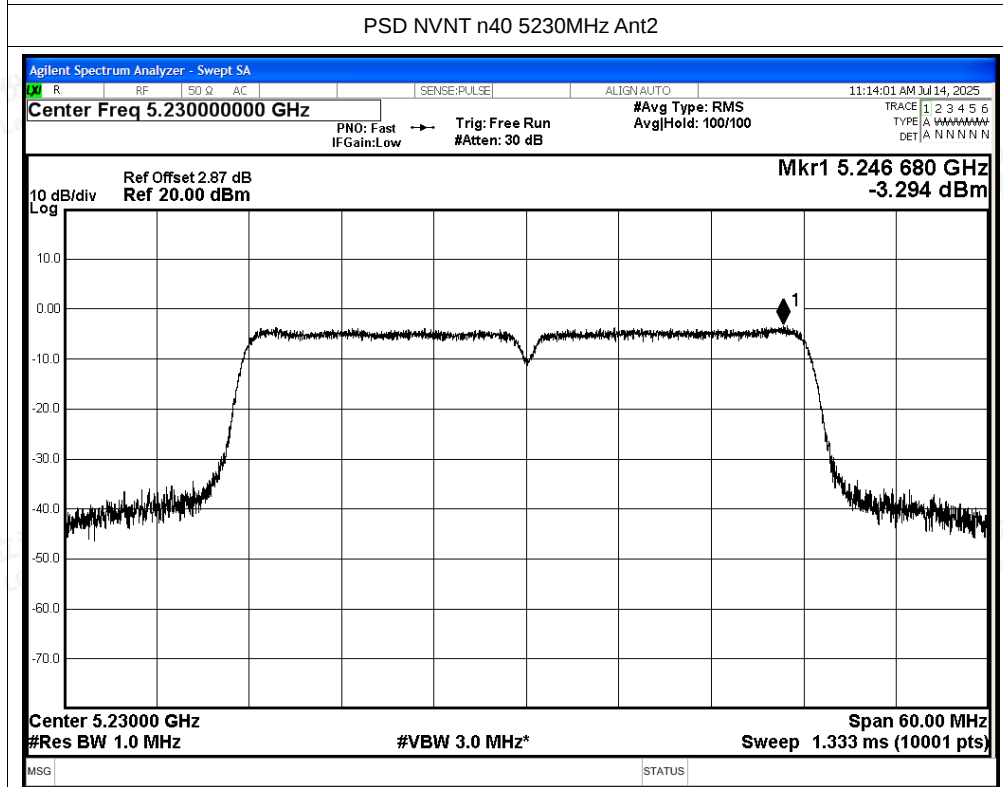
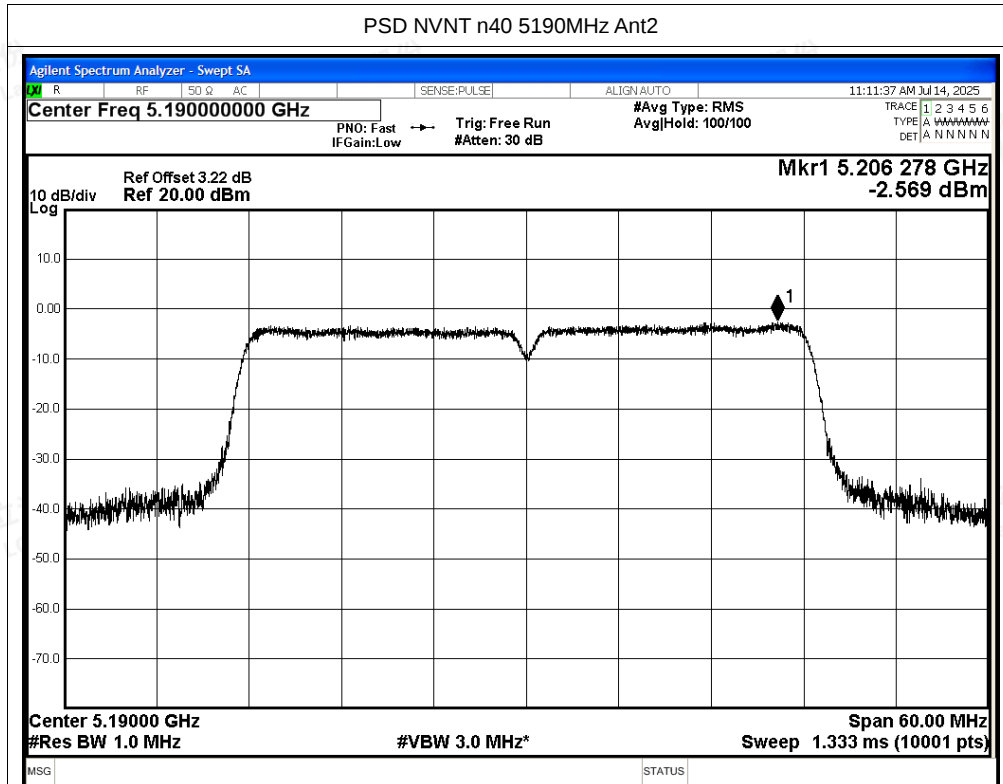


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

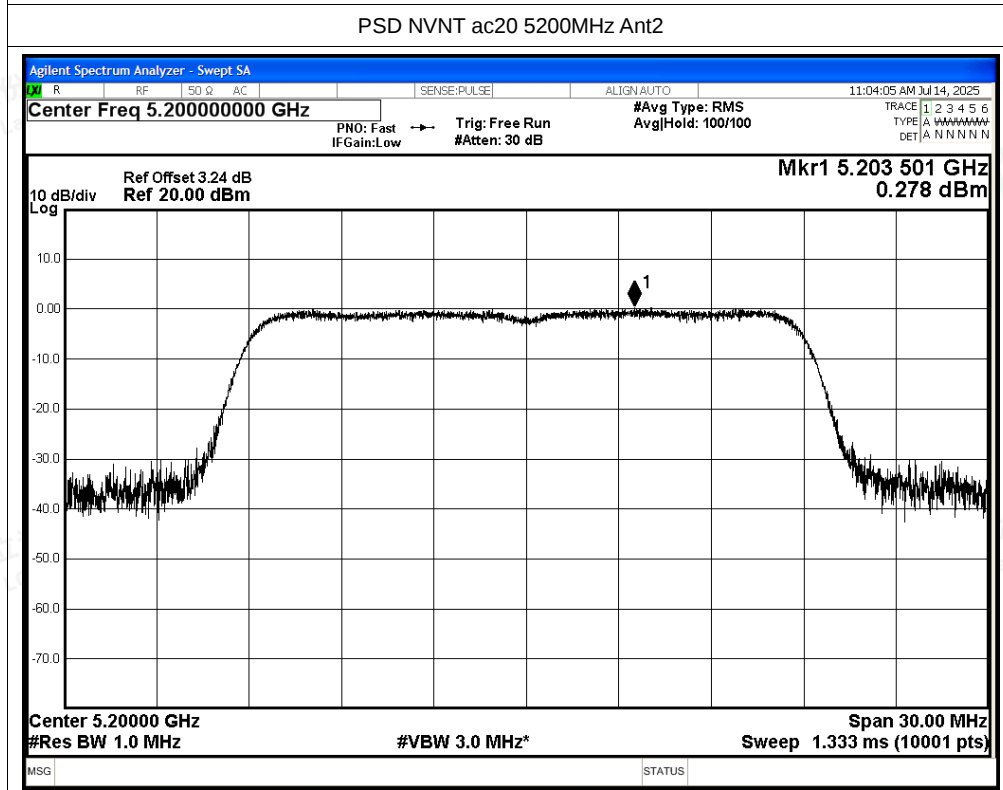
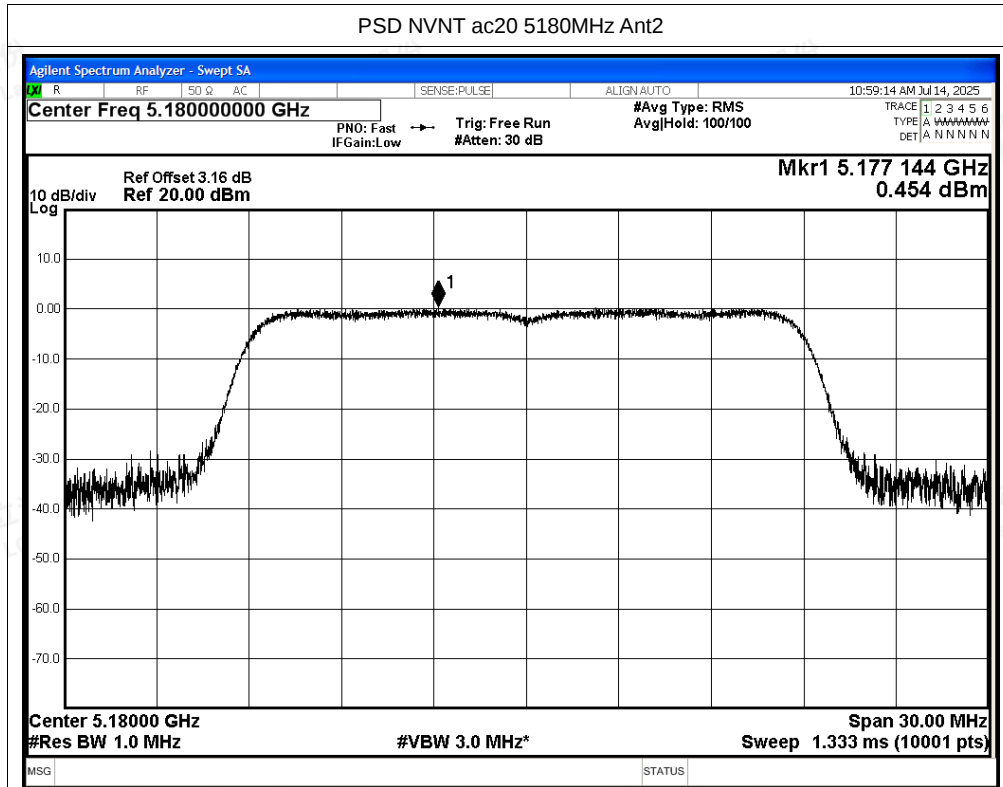


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

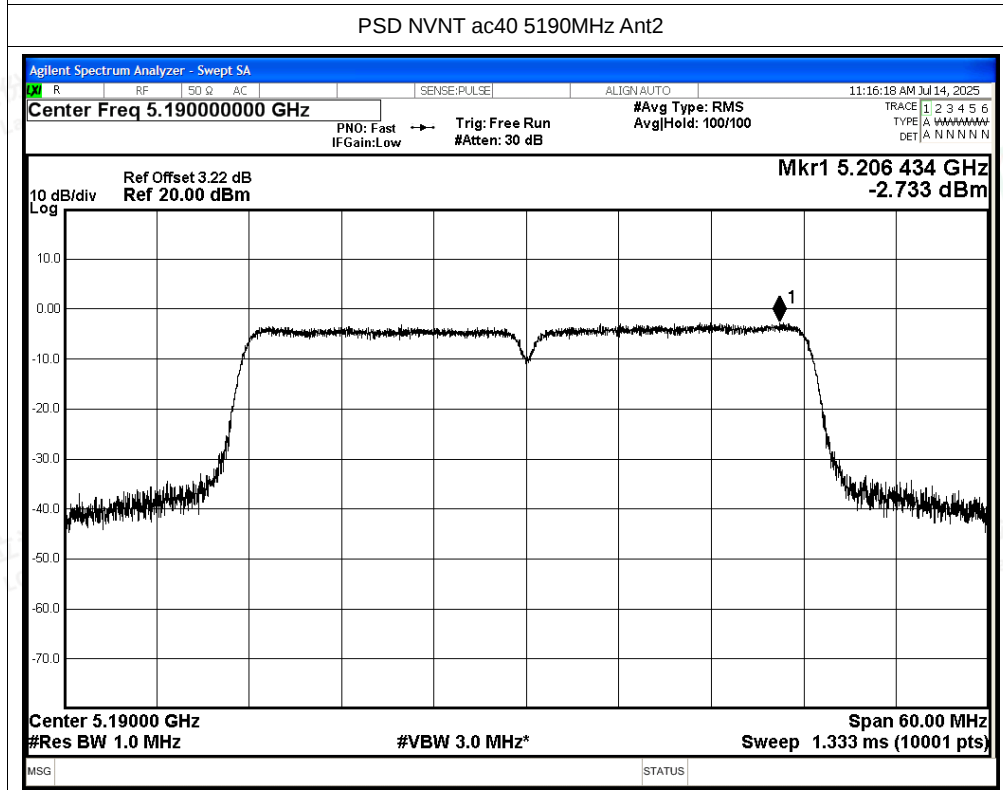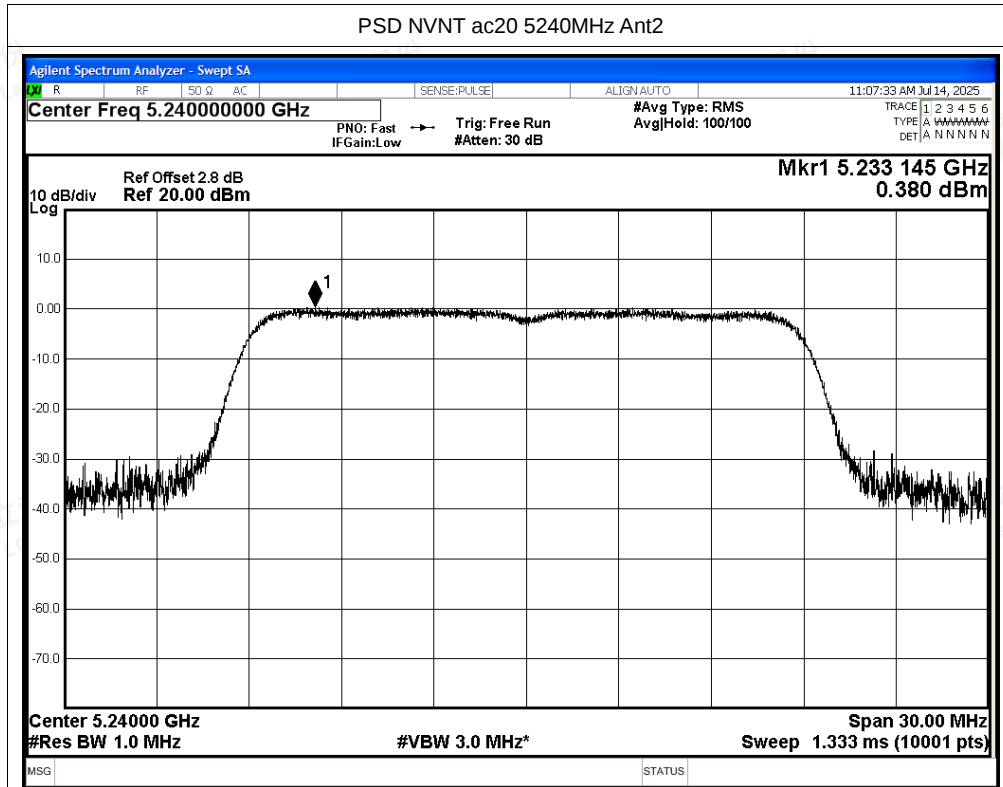

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac40 5230MHz Ant2

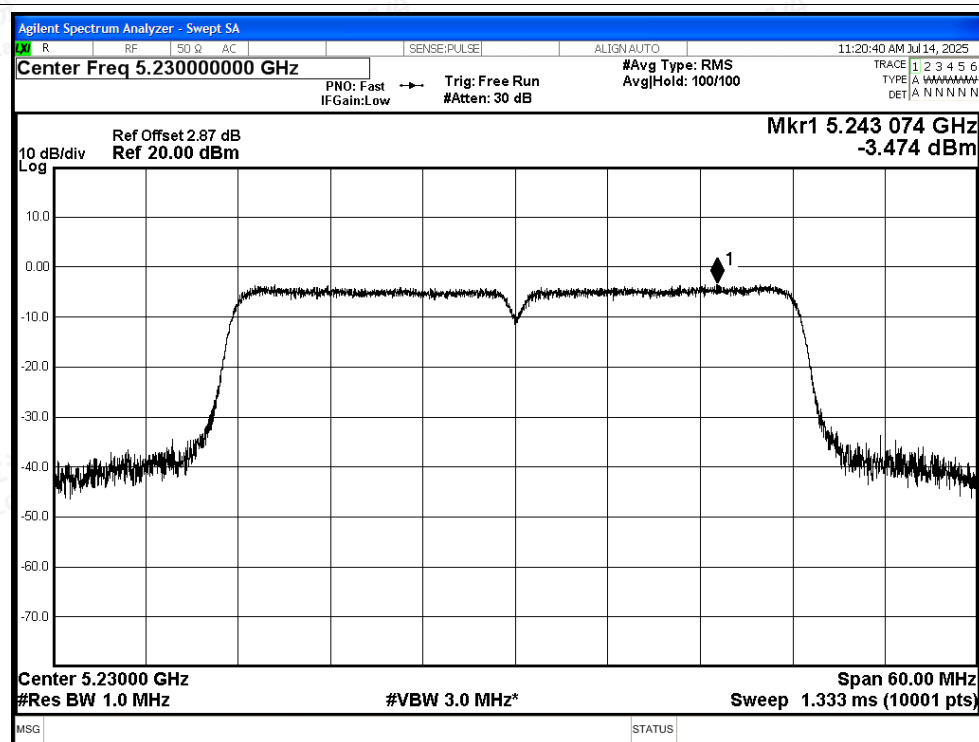

PSD NVNT ac80 5210MHz Ant2

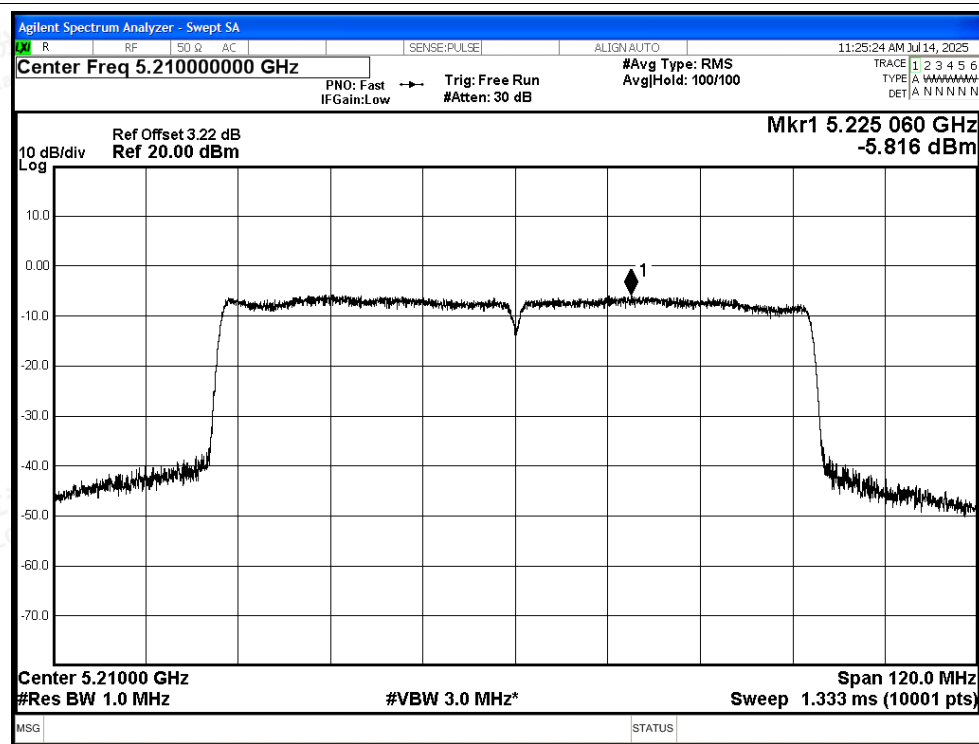

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax20 5180MHz Ant2

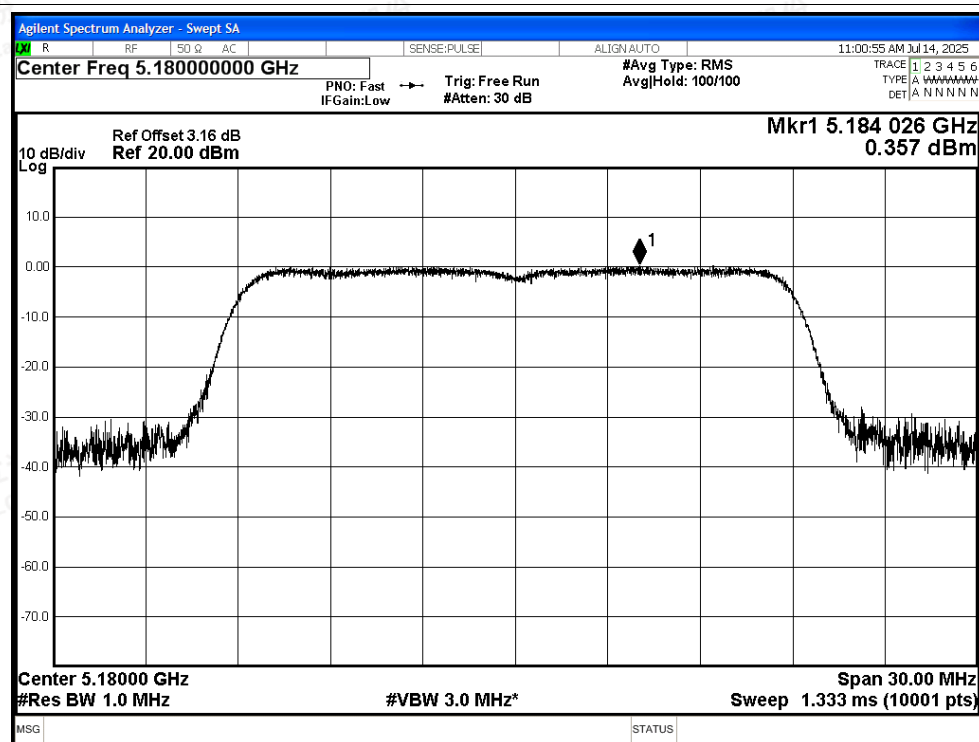

PSD NVNT ax20 5200MHz Ant2

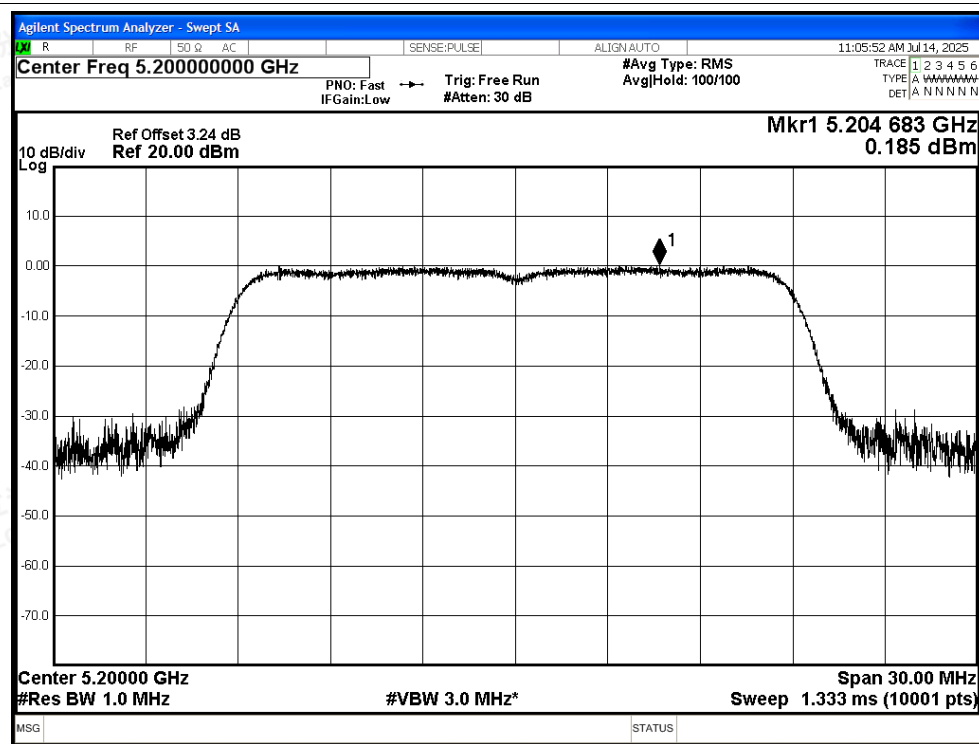

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax20 5240MHz Ant2

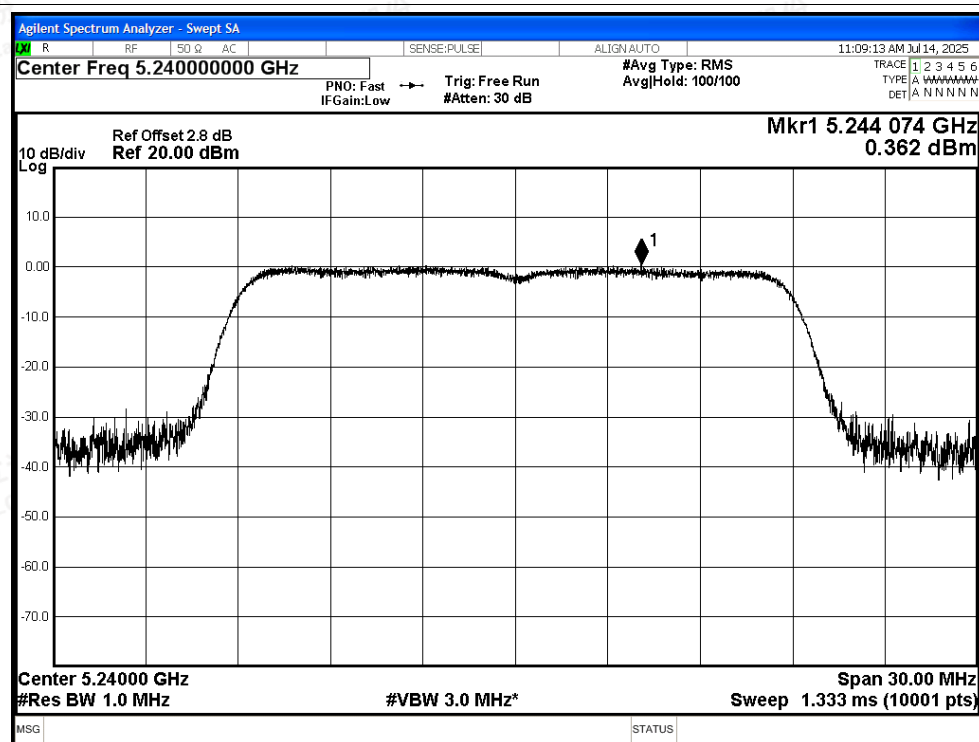

PSD NVNT ax40 5190MHz Ant2

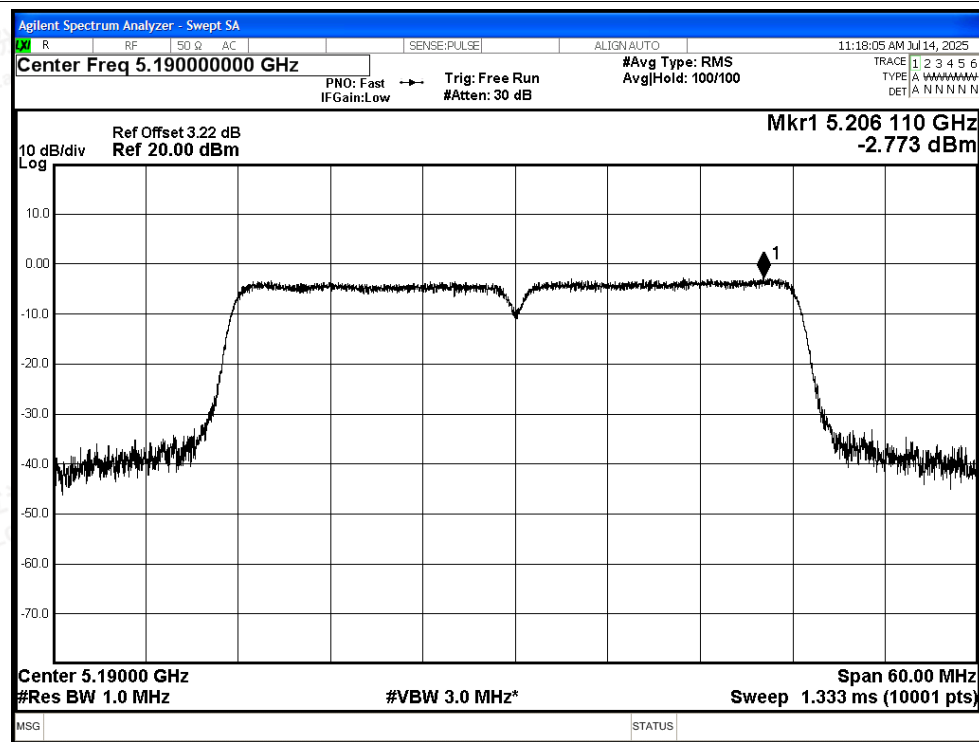

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax40 5230MHz Ant2

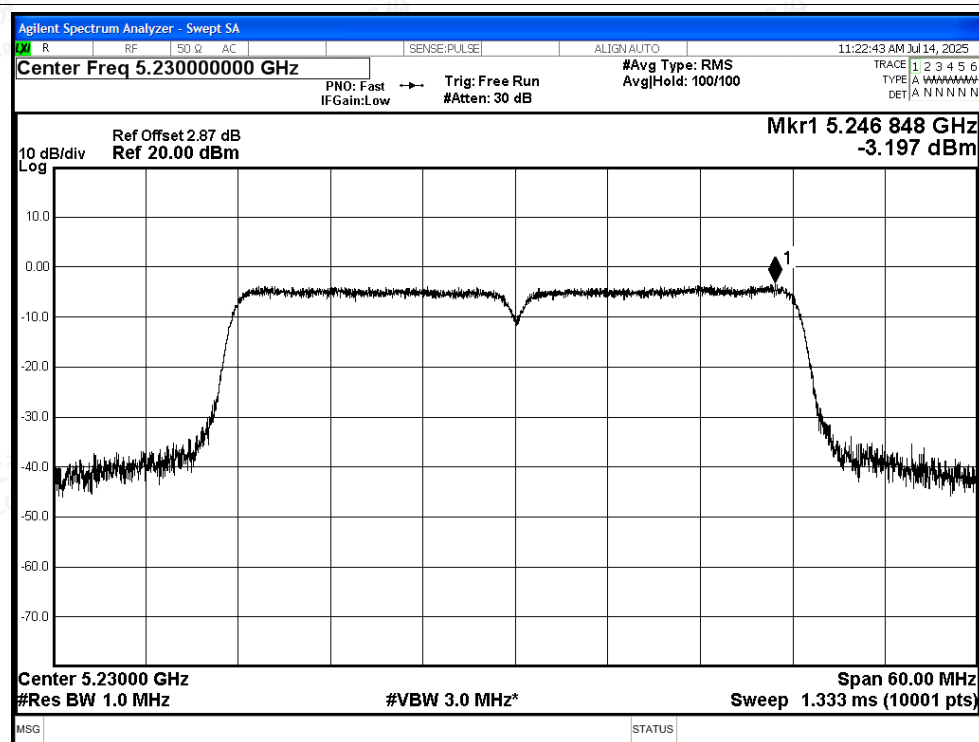

PSD NVNT ax80 5210MHz Ant2

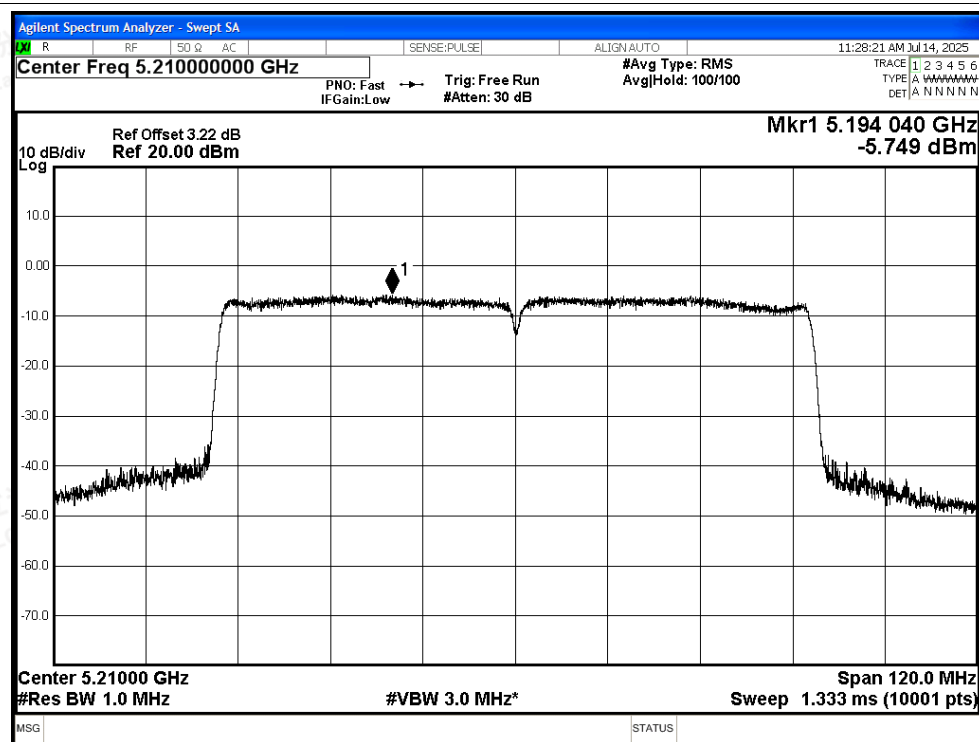

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



D.4 Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5180	Ant1	4500	-50.62	5.37	-	50.01	Peak	68.2	Pass
NVNT	a	5180	Ant1	4500	-58.45	5.37	0.24	42.42	Average	54	Pass
NVNT	a	5180	Ant1	5136.3	-46.05	5.37	-	54.58	Peak	68.2	Pass
NVNT	a	5180	Ant1	5123	-56.25	5.37	0.24	44.62	Average	54	Pass
NVNT	a	5180	Ant1	5150	-48.83	5.37	-	51.80	Peak	68.2	Pass
NVNT	a	5180	Ant1	5150	-56.61	5.37	0.24	44.26	Average	54	Pass
NVNT	a	5240	Ant1	5350	-51.21	5.37	-	49.42	Peak	68.2	Pass
NVNT	a	5240	Ant1	5350	-58.53	5.37	0.24	42.34	Average	54	Pass
NVNT	a	5240	Ant1	5355.12	-46.7	5.37	-	53.93	Peak	68.2	Pass
NVNT	a	5240	Ant1	5376.48	-57.5	5.37	0.24	43.37	Average	54	Pass
NVNT	a	5240	Ant1	5460	-51.07	5.37	-	49.56	Peak	68.2	Pass
NVNT	a	5240	Ant1	5460	-58.63	5.37	0.24	42.24	Average	54	Pass
NVNT	n20	5180	Ant1	4500	-49.78	5.37	-	50.85	Peak	68.2	Pass
NVNT	n20	5180	Ant1	4500	-59.09	5.37	0.12	41.66	Average	54	Pass
NVNT	n20	5180	Ant1	5145.4	-45.35	5.37	-	55.28	Peak	68.2	Pass
NVNT	n20	5180	Ant1	5148.9	-56.27	5.37	0.12	44.48	Average	54	Pass
NVNT	n20	5180	Ant1	5150	-46.02	5.37	-	54.61	Peak	68.2	Pass
NVNT	n20	5180	Ant1	5150	-55.77	5.37	0.12	44.98	Average	54	Pass
NVNT	n20	5240	Ant1	5350	-50.23	5.37	-	50.40	Peak	68.2	Pass
NVNT	n20	5240	Ant1	5350	-57.94	5.37	0.12	42.81	Average	54	Pass
NVNT	n20	5240	Ant1	5350.8	-47.66	5.37	-	52.97	Peak	68.2	Pass
NVNT	n20	5240	Ant1	5402.88	-57.52	5.37	0.12	43.23	Average	54	Pass
NVNT	n20	5240	Ant1	5460	-49.42	5.37	-	51.21	Peak	68.2	Pass
NVNT	n20	5240	Ant1	5460	-58.08	5.37	0.12	42.67	Average	54	Pass
NVNT	n40	5190	Ant1	4500	-49.63	5.37	-	51.00	Peak	68.2	Pass
NVNT	n40	5190	Ant1	4500	-58.6	5.37	0.24	42.27	Average	54	Pass
NVNT	n40	5190	Ant1	5148.97	-42.16	5.37	-	58.47	Peak	68.2	Pass
NVNT	n40	5190	Ant1	5148.97	-55.45	5.37	0.24	45.42	Average	54	Pass
NVNT	n40	5190	Ant1	5150	-45.83	5.37	-	54.80	Peak	68.2	Pass
NVNT	n40	5190	Ant1	5150	-55.49	5.37	0.24	45.38	Average	54	Pass
NVNT	n40	5230	Ant1	5350	-49.55	5.37	-	51.08	Peak	68.2	Pass
NVNT	n40	5230	Ant1	5350	-58.61	5.37	0.24	42.26	Average	54	Pass
NVNT	n40	5230	Ant1	5428.41	-47.14	5.37	-	53.49	Peak	68.2	Pass
NVNT	n40	5230	Ant1	5428.68	-57.29	5.37	0.24	43.58	Average	54	Pass
NVNT	n40	5230	Ant1	5460	-49.9	5.37	-	50.73	Peak	68.2	Pass
NVNT	n40	5230	Ant1	5460	-58.53	5.37	0.24	42.34	Average	54	Pass
NVNT	ac20	5180	Ant1	4500	-49.17	5.37	-	51.46	Peak	68.2	Pass
NVNT	ac20	5180	Ant1	4500	-58.61	5.37	0.12	42.14	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5180	Ant1	5149.6	-45.48	5.37	-	55.15	Peak	68.2	Pass
NVNT	ac20	5180	Ant1	5148.9	-55.97	5.37	0.12	44.78	Average	54	Pass
NVNT	ac20	5180	Ant1	5150	-47.23	5.37	-	53.40	Peak	68.2	Pass
NVNT	ac20	5180	Ant1	5150	-56.17	5.37	0.12	44.58	Average	54	Pass
NVNT	ac20	5240	Ant1	4500	-49.17	5.37	-	51.46	Peak	68.2	Pass
NVNT	ac20	5240	Ant1	4500	-58.61	5.37	0.12	42.14	Average	54	Pass
NVNT	ac20	5240	Ant1	5149.6	-45.48	5.37	-	55.15	Peak	68.2	Pass
NVNT	ac20	5240	Ant1	5148.9	-55.97	5.37	0.12	44.78	Average	54	Pass
NVNT	ac20	5240	Ant1	5150	-47.23	5.37	-	53.40	Peak	68.2	Pass
NVNT	ac20	5240	Ant1	5150	-56.17	5.37	0.12	44.58	Average	54	Pass
NVNT	ac40	5190	Ant1	4500	-51.45	5.37	-	49.18	Peak	68.2	Pass
NVNT	ac40	5190	Ant1	4500	-58.62	5.37	0.24	42.25	Average	54	Pass
NVNT	ac40	5190	Ant1	5148.97	-44.39	5.37	-	56.24	Peak	68.2	Pass
NVNT	ac40	5190	Ant1	5149.7	-55.83	5.37	0.24	45.04	Average	54	Pass
NVNT	ac40	5190	Ant1	5150	-46.51	5.37	-	54.12	Peak	68.2	Pass
NVNT	ac40	5190	Ant1	5150	-55.83	5.37	0.24	45.04	Average	54	Pass
NVNT	ac40	5230	Ant1	5350	-50.37	5.37	-	50.26	Peak	68.2	Pass
NVNT	ac40	5230	Ant1	5350	-58.18	5.37	0.24	42.69	Average	54	Pass
NVNT	ac40	5230	Ant1	5380.35	-47.38	5.37	-	53.25	Peak	68.2	Pass
NVNT	ac40	5230	Ant1	5373.33	-57.4	5.37	0.24	43.47	Average	54	Pass
NVNT	ac40	5230	Ant1	5460	-48.26	5.37	-	52.37	Peak	68.2	Pass
NVNT	ac40	5230	Ant1	5460	-58.05	5.37	0.24	42.82	Average	54	Pass
NVNT	ac80	5210	Ant1	5350	-46.85	5.37	-	53.78	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5350	-56.8	5.37	0.47	44.30	Average	54	Pass
NVNT	ac80	5210	Ant1	5361.99	-46.66	5.37	-	53.97	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5350.44	-56.21	5.37	0.47	44.89	Average	54	Pass
NVNT	ac80	5210	Ant1	5460	-49.19	5.37	-	51.44	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5460	-57.99	5.37	0.47	43.11	Average	54	Pass
NVNT	ac80	5210	Ant1	4500	-49.89	5.37	-	50.74	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	4500	-58.99	5.37	0.47	42.11	Average	54	Pass
NVNT	ac80	5210	Ant1	5149.38	-42.38	5.37	-	58.25	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5147.01	-55.46	5.37	0.47	45.64	Average	54	Pass
NVNT	ac80	5210	Ant1	5150	-42.53	5.37	-	58.10	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5150	-55.15	5.37	0.47	45.95	Average	54	Pass
NVNT	ax20	5180	Ant1	4500	-49.67	5.37	-	50.96	Peak	68.2	Pass
NVNT	ax20	5180	Ant1	4500	-58.74	5.37	0.12	42.01	Average	54	Pass
NVNT	ax20	5180	Ant1	5149.6	-36.53	5.37	-	64.10	Peak	68.2	Pass
NVNT	ax20	5180	Ant1	5149.6	-49.1	5.37	0.12	51.65	Average	54	Pass
NVNT	ax20	5180	Ant1	5150	-37.73	5.37	-	62.90	Peak	68.2	Pass
NVNT	ax20	5180	Ant1	5150	-48.71	5.37	0.12	52.04	Average	54	Pass
NVNT	ax20	5240	Ant1	5350	-49.11	5.37	-	51.52	Peak	68.2	Pass
NVNT	ax20	5240	Ant1	5350	-57.85	5.37	0.12	42.90	Average	54	Pass
NVNT	ax20	5240	Ant1	5363.28	-48.05	5.37	-	52.58	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




NVNT	ax20	5240	Ant1	5368.56	-57.37	5.37	0.12	43.38	Average	54	Pass
NVNT	ax20	5240	Ant1	5460	-49.73	5.37	-	50.90	Peak	68.2	Pass
NVNT	ax20	5240	Ant1	5460	-58.1	5.37	0.12	42.65	Average	54	Pass
NVNT	ax40	5190	Ant1	4500	-49.77	5.37	-	50.86	Peak	68.2	Pass
NVNT	ax40	5190	Ant1	4500	-58.95	5.37	0.24	41.92	Average	54	Pass
NVNT	ax40	5190	Ant1	5148.24	-46.55	5.37	-	54.08	Peak	68.2	Pass
NVNT	ax40	5190	Ant1	5149.7	-55.19	5.37	0.24	45.68	Average	54	Pass
NVNT	ax40	5190	Ant1	5150	-47.46	5.37	-	53.17	Peak	68.2	Pass
NVNT	ax40	5190	Ant1	5150	-55.19	5.37	0.24	45.68	Average	54	Pass
NVNT	ax40	5230	Ant1	5350	-51.53	5.37	-	49.10	Peak	68.2	Pass
NVNT	ax40	5230	Ant1	5350	-58.11	5.37	0.23	42.75	Average	54	Pass
NVNT	ax40	5230	Ant1	5430.84	-46.71	5.37	-	53.92	Peak	68.2	Pass
NVNT	ax40	5230	Ant1	5360.37	-57.21	5.37	0.23	43.65	Average	54	Pass
NVNT	ax40	5230	Ant1	5460	-50.91	5.37	-	49.72	Peak	68.2	Pass
NVNT	ax40	5230	Ant1	5460	-58.75	5.37	0.23	42.11	Average	54	Pass
NVNT	ax80	5210	Ant1	5350	-47.71	5.37	-	52.92	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	5350	-57.06	5.37	0.47	44.04	Average	54	Pass
NVNT	ax80	5210	Ant1	5351.1	-46.9	5.37	-	53.73	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	5352.75	-56.2	5.37	0.47	44.90	Average	54	Pass
NVNT	ax80	5210	Ant1	5460	-49.52	5.37	-	51.11	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	5460	-57.5	5.37	0.47	43.60	Average	54	Pass
NVNT	ax80	5210	Ant1	4500	-49.77	5.37	-	50.86	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	4500	-59.02	5.37	0.47	42.08	Average	54	Pass
NVNT	ax80	5210	Ant1	5147.01	-43.47	5.37	-	57.16	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	5148.59	-54.89	5.37	0.47	46.21	Average	54	Pass
NVNT	ax80	5210	Ant1	5150	-44.99	5.37	-	55.64	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	5150	-55.57	5.37	0.47	45.53	Average	54	Pass






Test Graphs

Restrict Band NVNT a 5180MHz Ant1 Peak

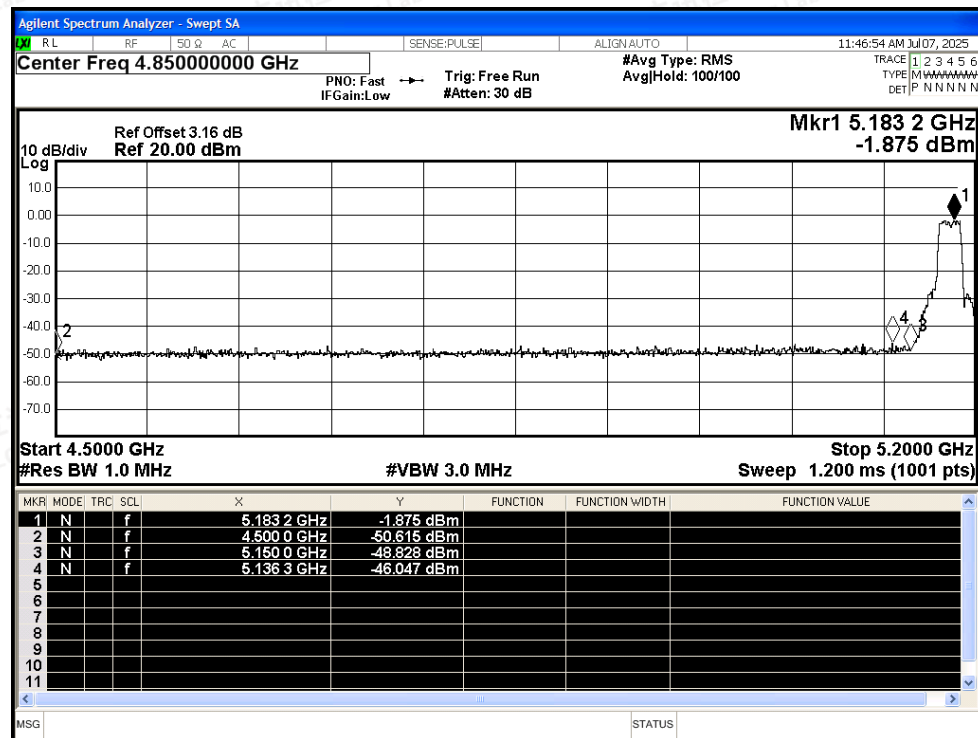

Restrict Band NVNT a 5180MHz Ant1 Average

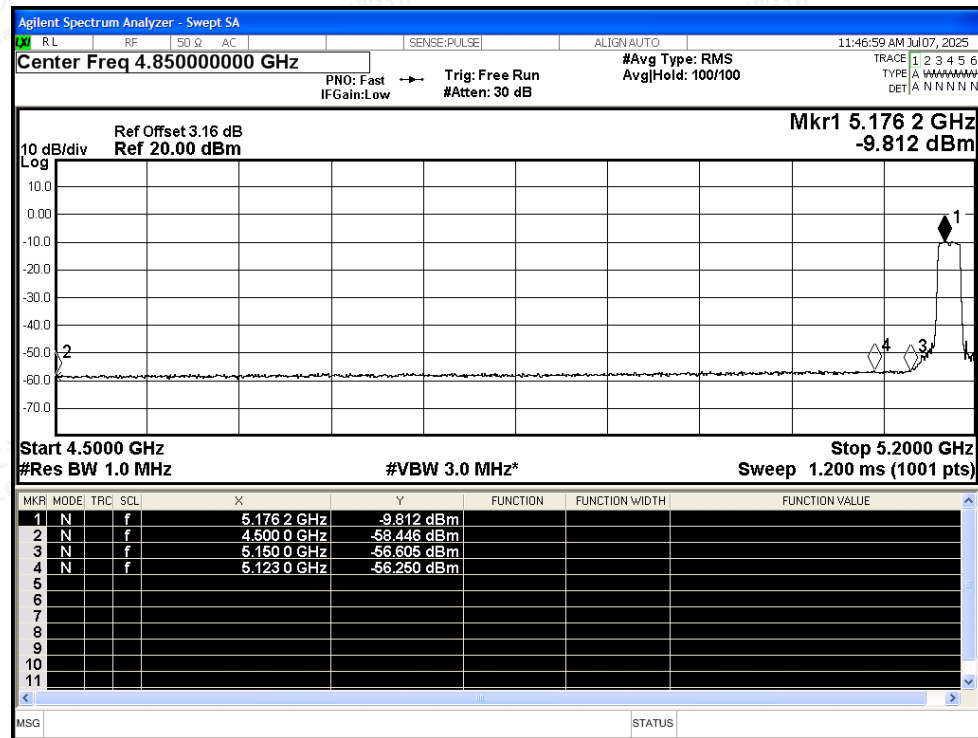

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5240MHz Ant1 Peak

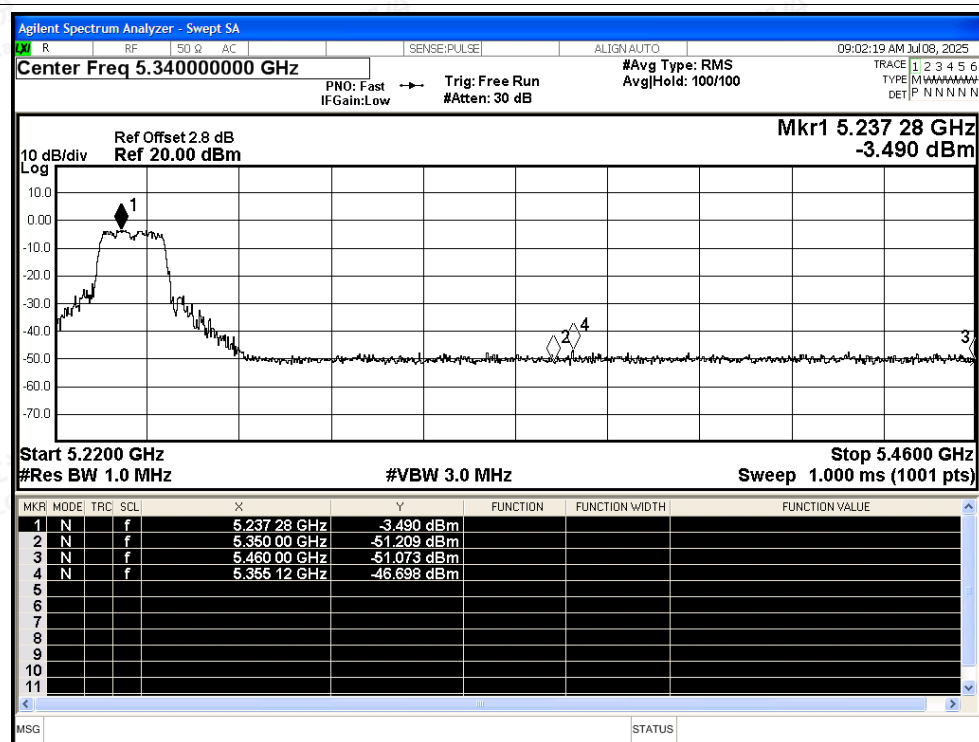

Restrict Band NVNT a 5240MHz Ant1 Average

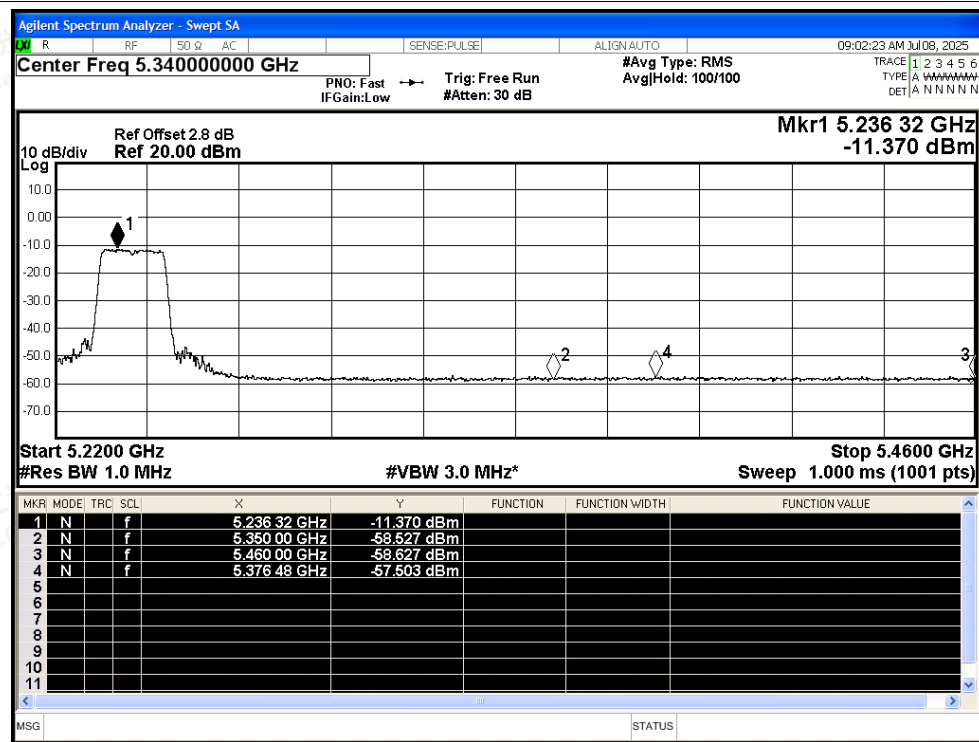

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5180MHz Ant1 Peak

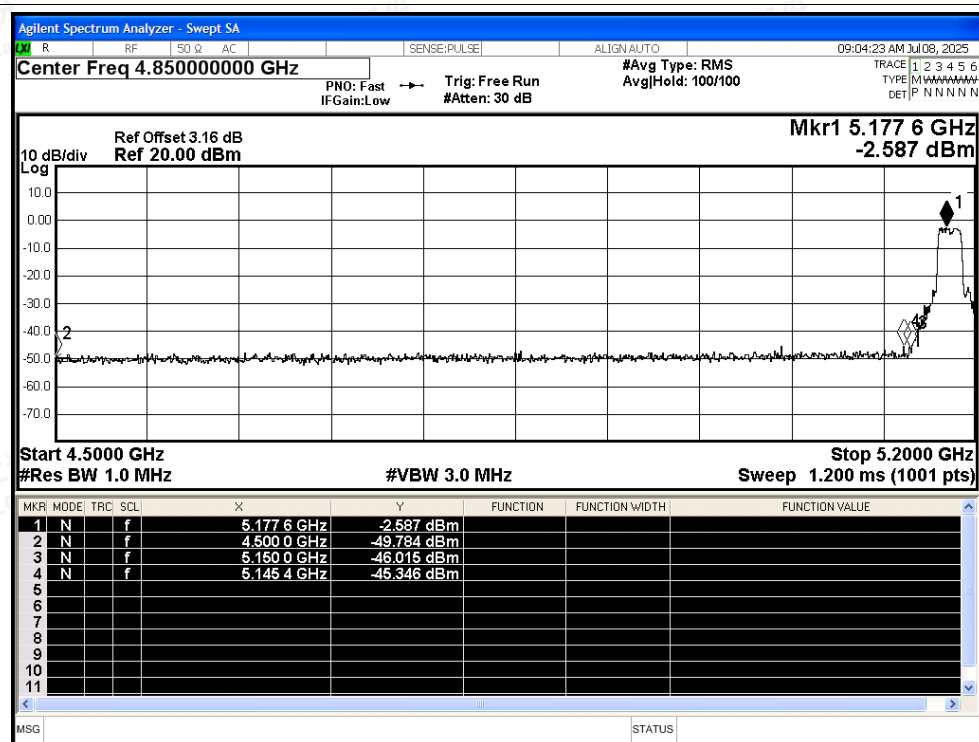

Restrict Band NVNT n20 5180MHz Ant1 Average

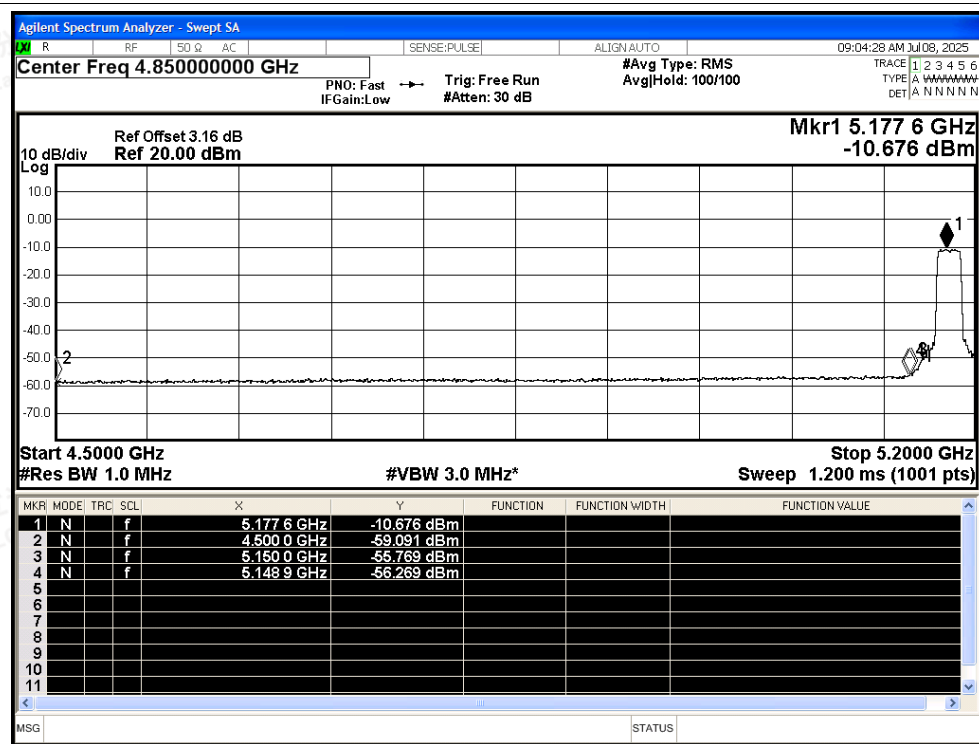

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5240MHz Ant1 Peak

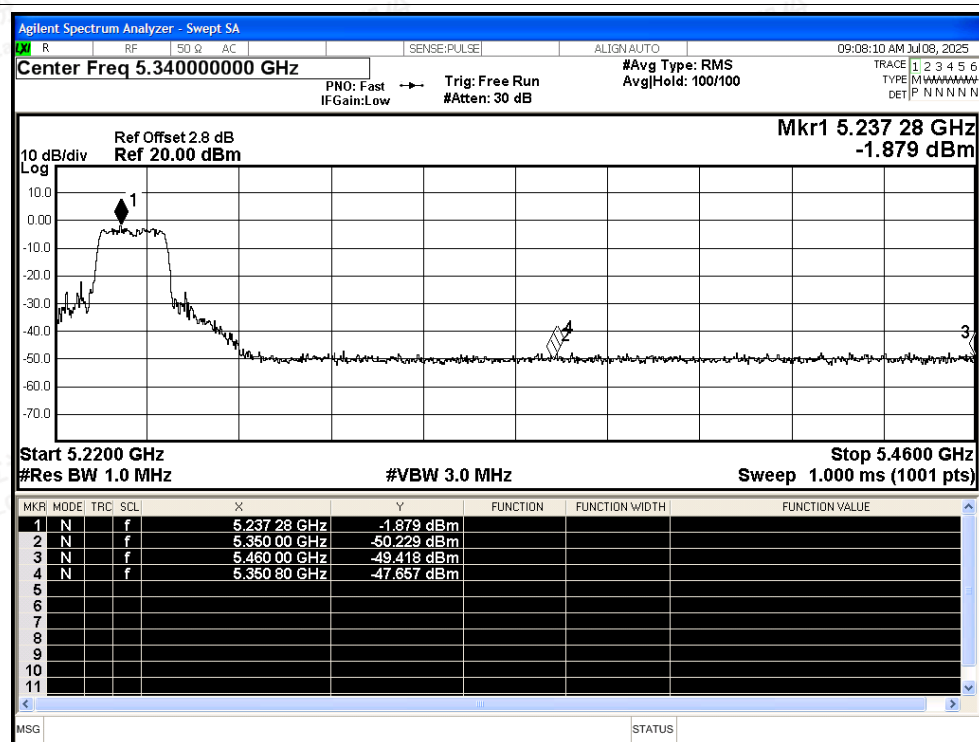

Restrict Band NVNT n20 5240MHz Ant1 Average

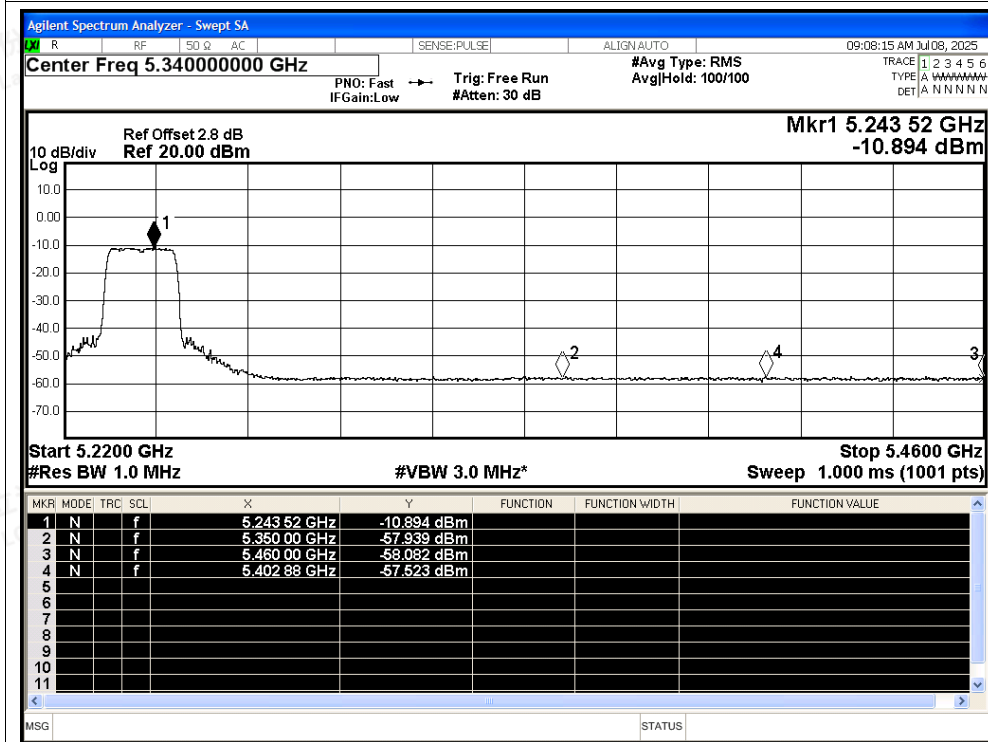

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5190MHz Ant1 Peak

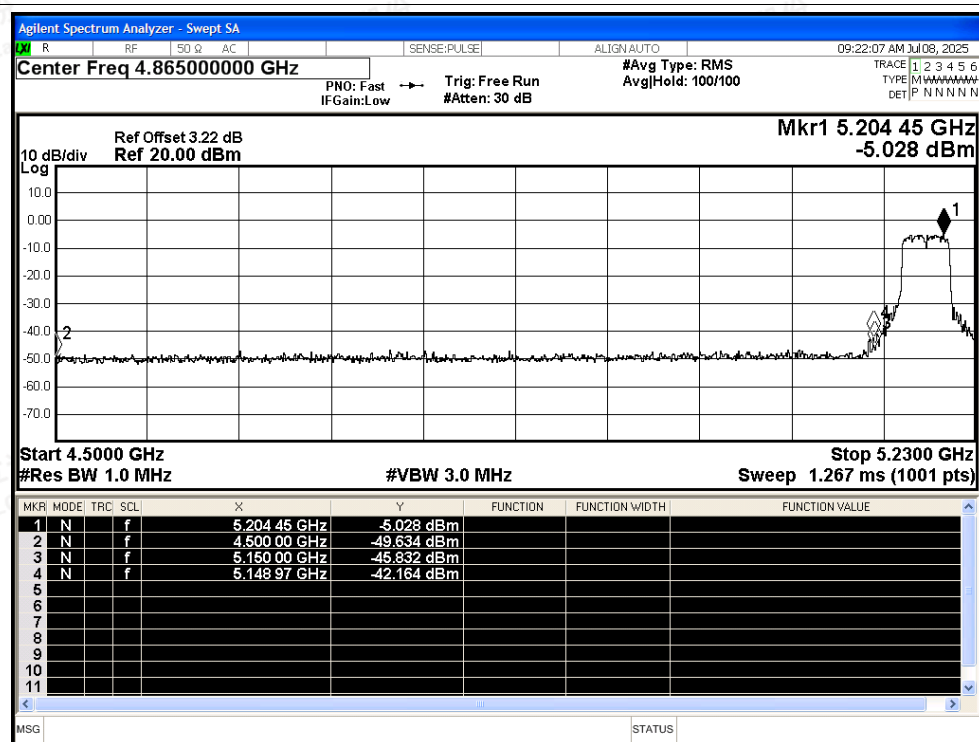

Restrict Band NVNT n40 5190MHz Ant1 Average

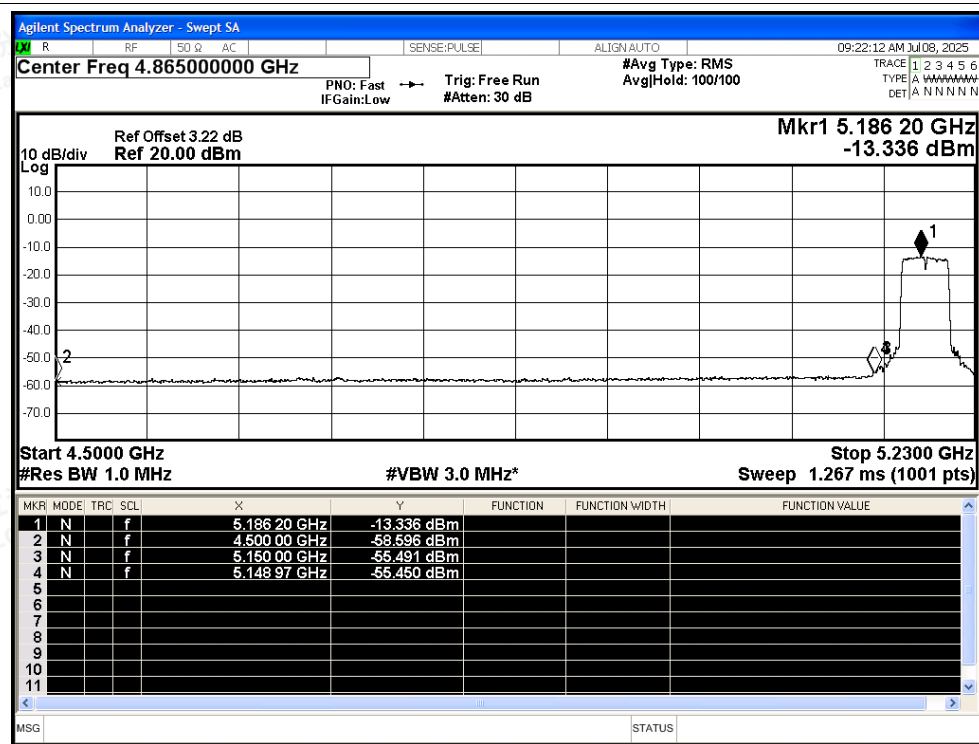

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5230MHz Ant1 Peak

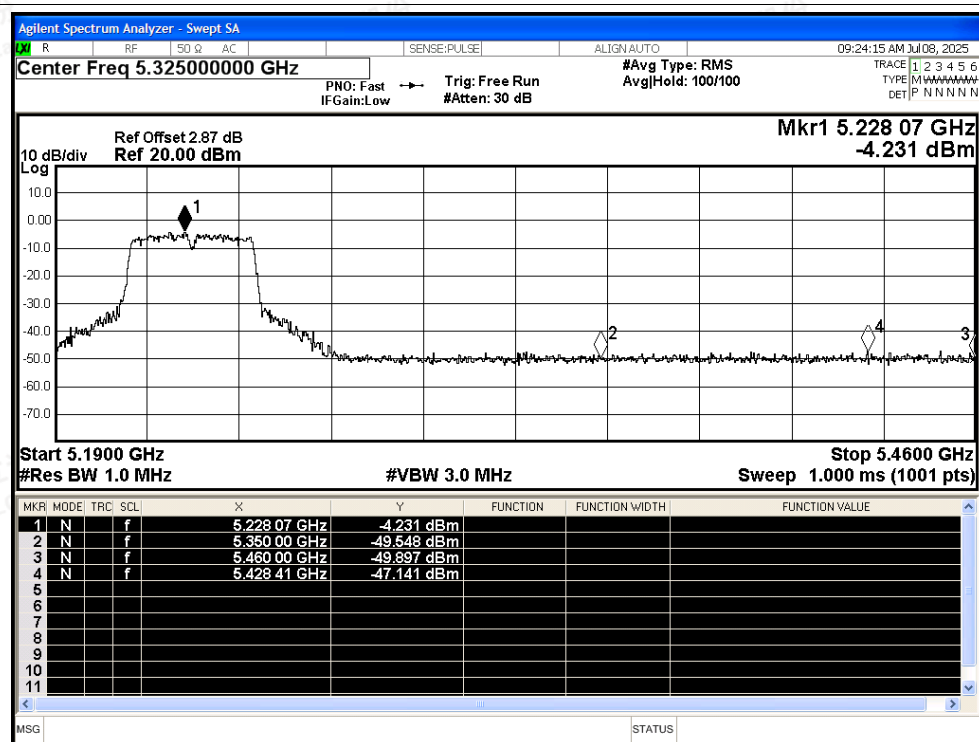

Restrict Band NVNT n40 5230MHz Ant1 Average

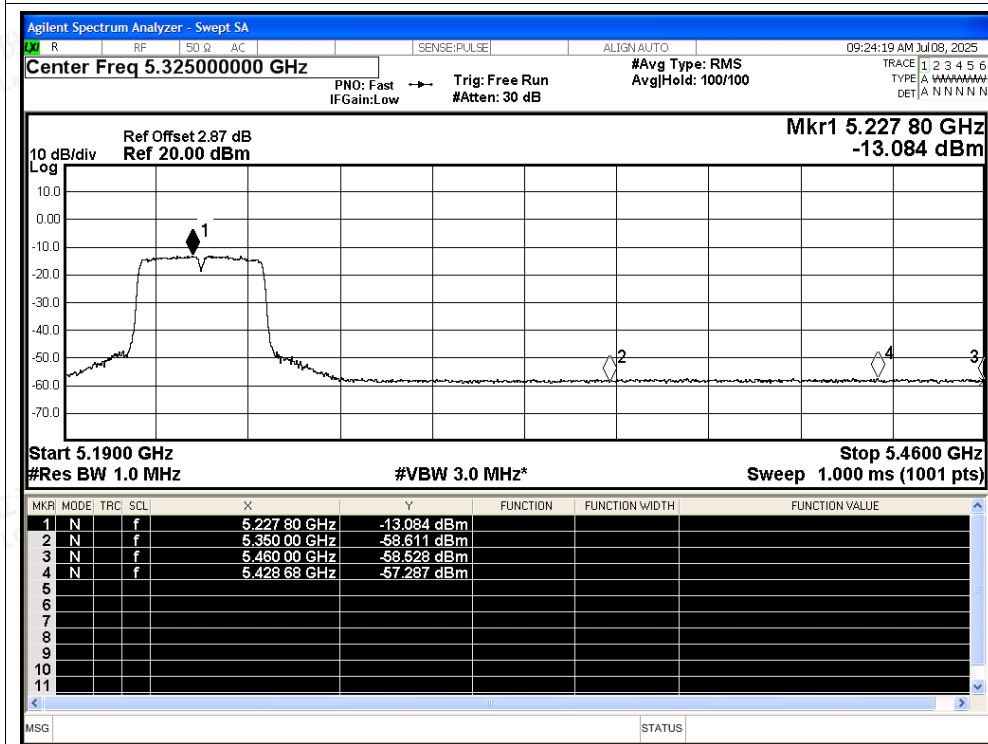

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5180MHz Ant1 Peak

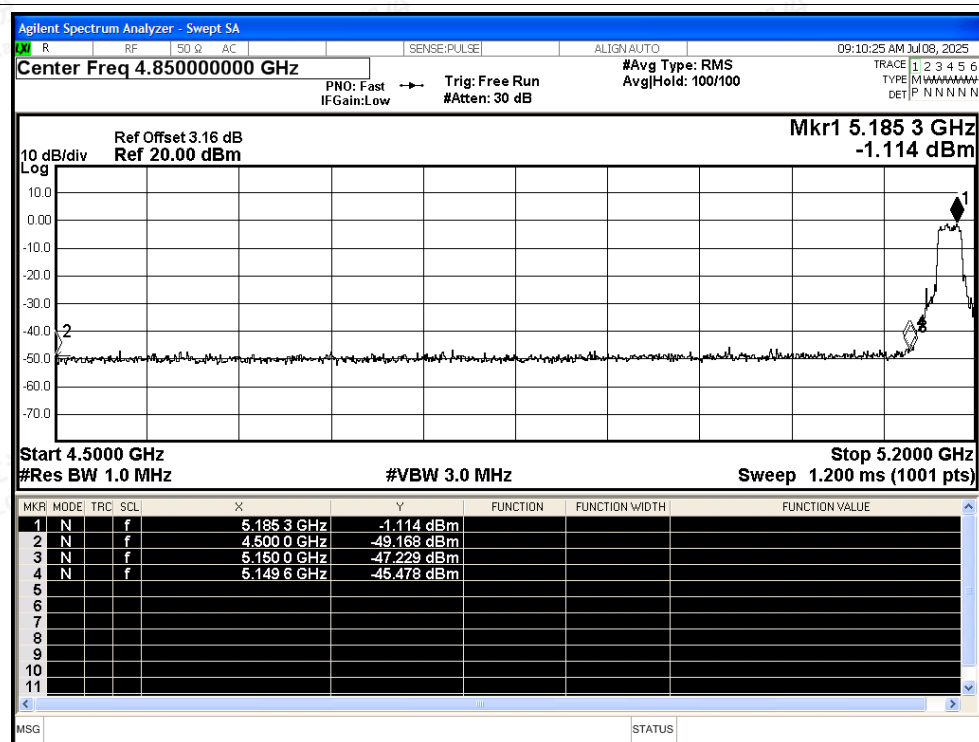

Restrict Band NVNT ac20 5180MHz Ant1 Average

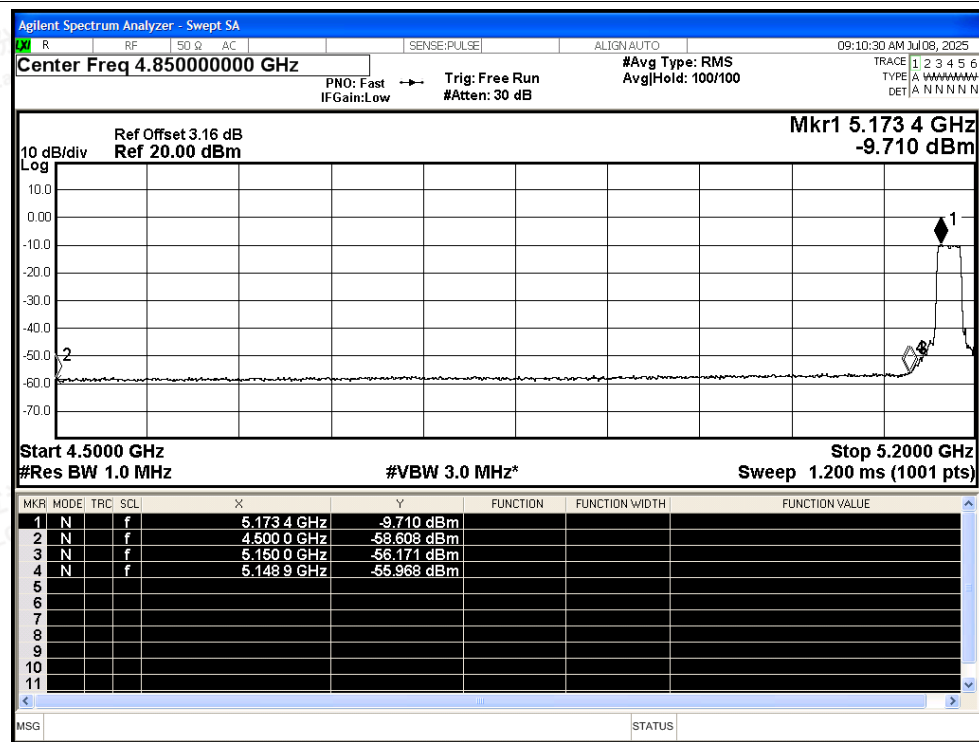

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5190MHz Ant1 Peak

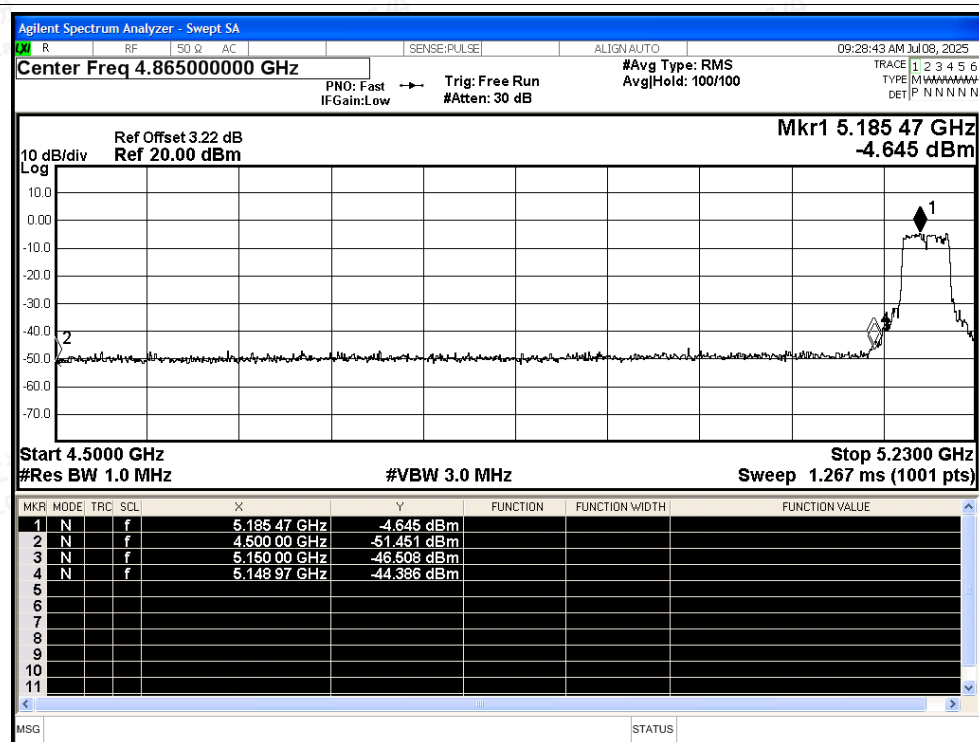

Restrict Band NVNT ac40 5190MHz Ant1 Average

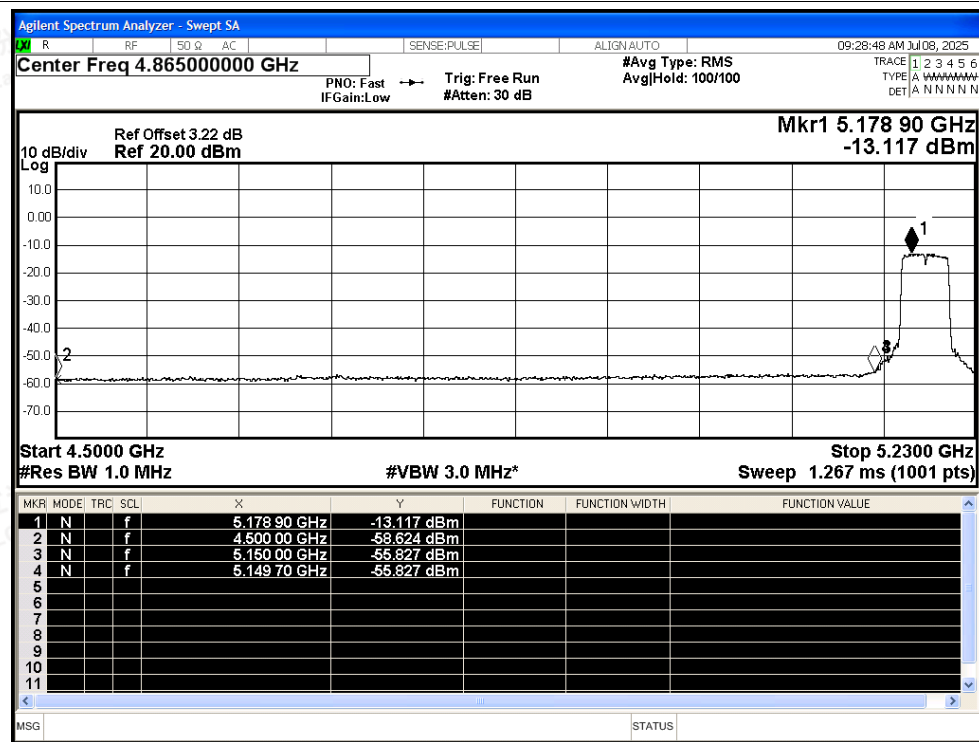

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5230MHz Ant1 Peak

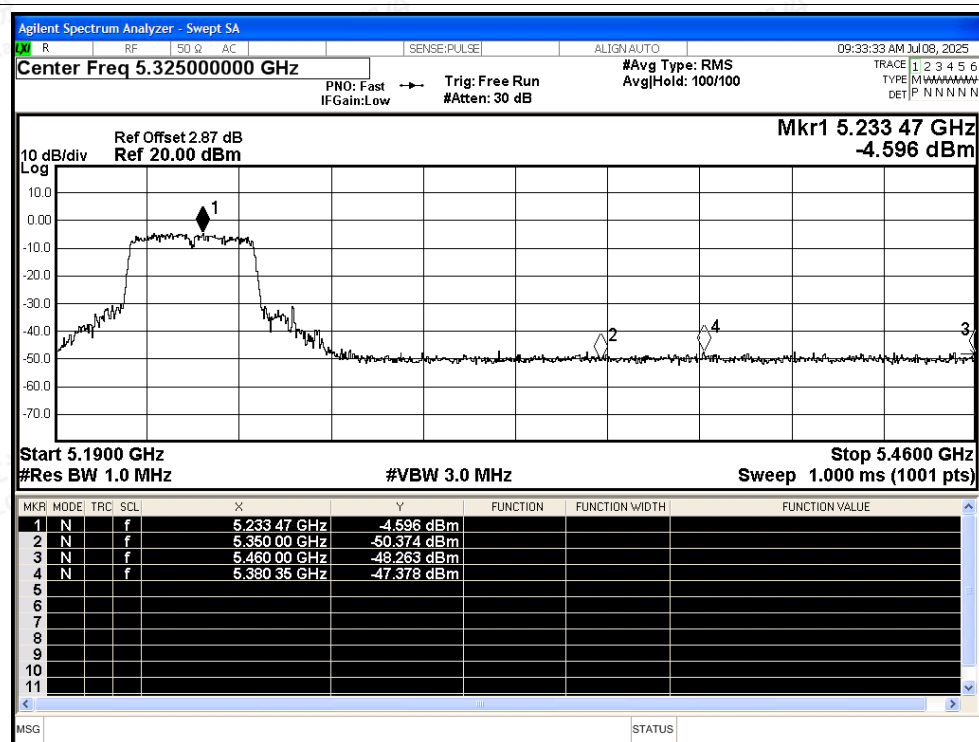

Restrict Band NVNT ac40 5230MHz Ant1 Average

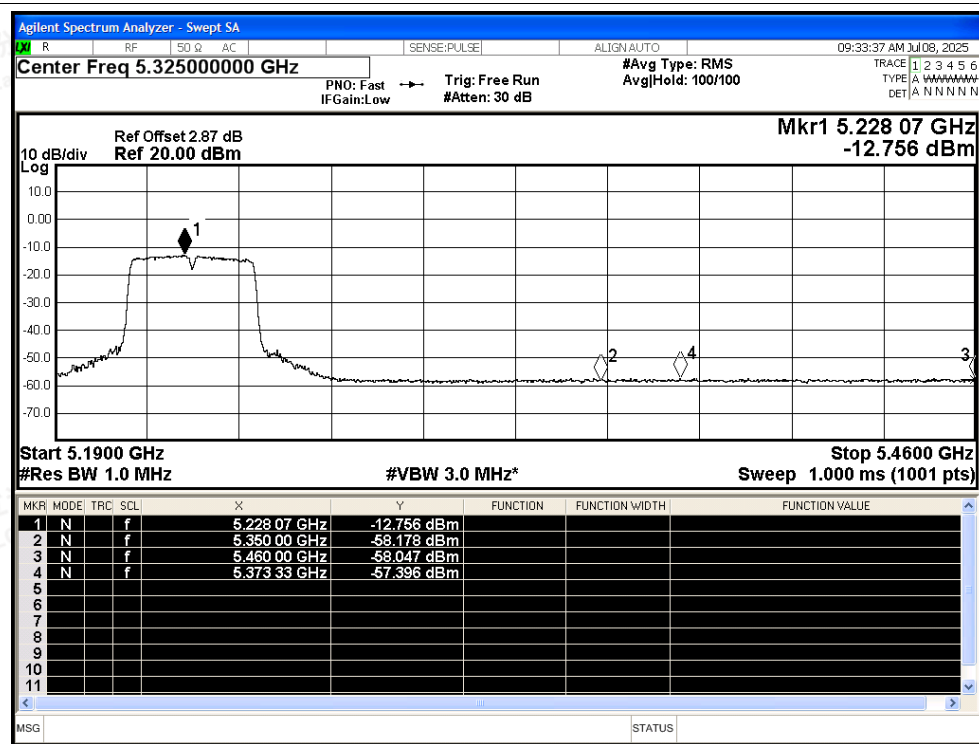

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant1 Peak

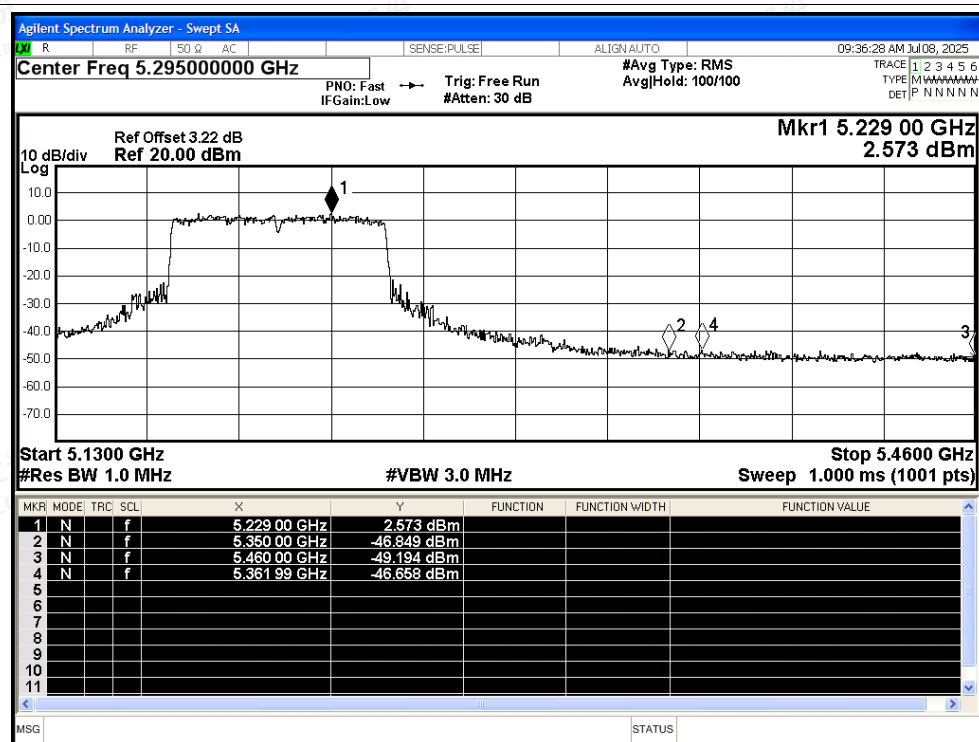

Restrict Band NVNT ac80 5210MHz Ant1 Average

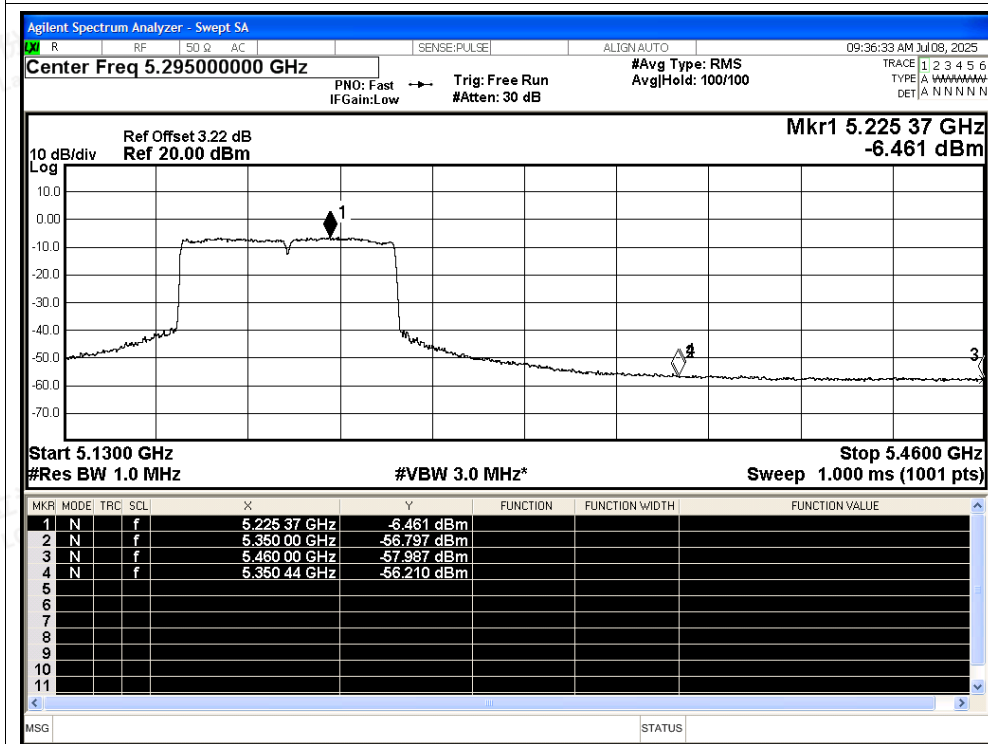

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant1 Peak

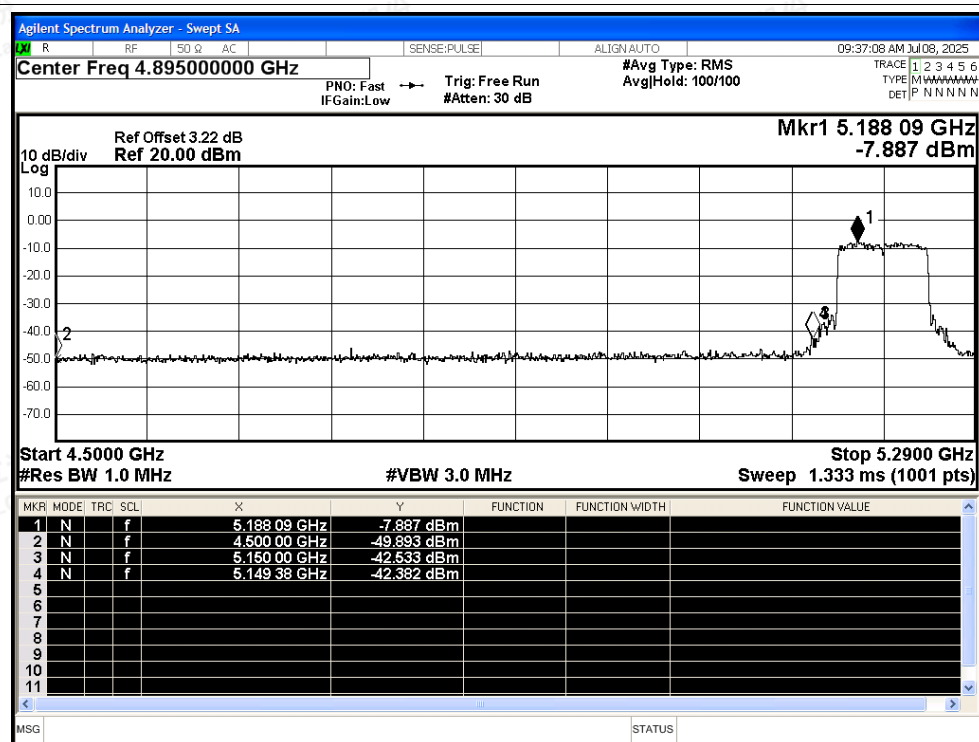

Restrict Band NVNT ac80 5210MHz Ant1 Average

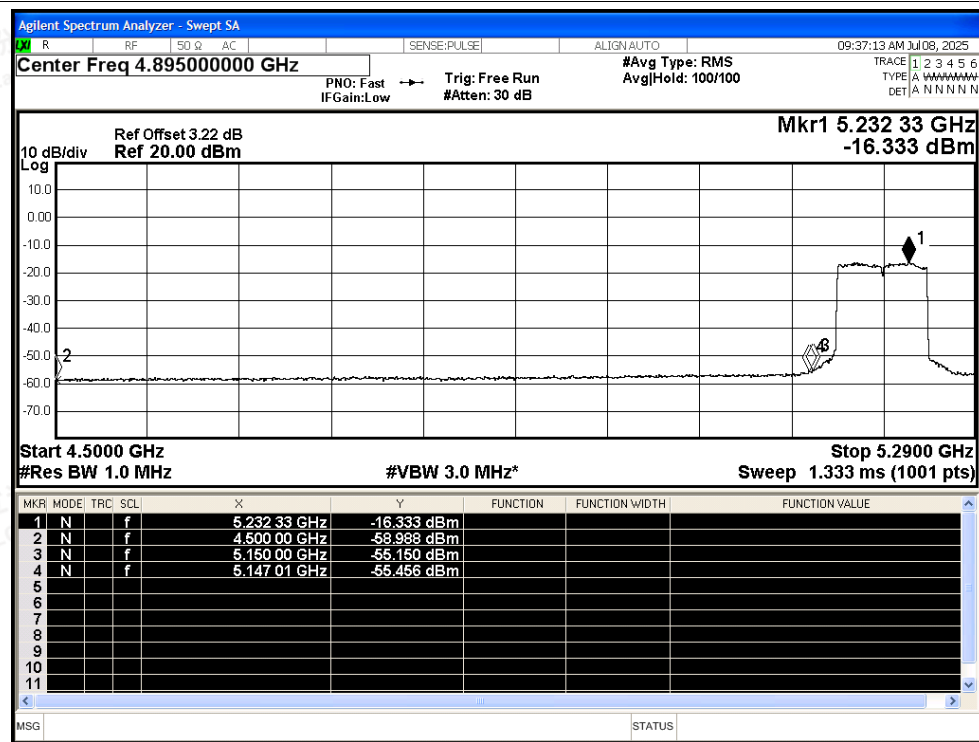

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5180MHz Ant1 Peak

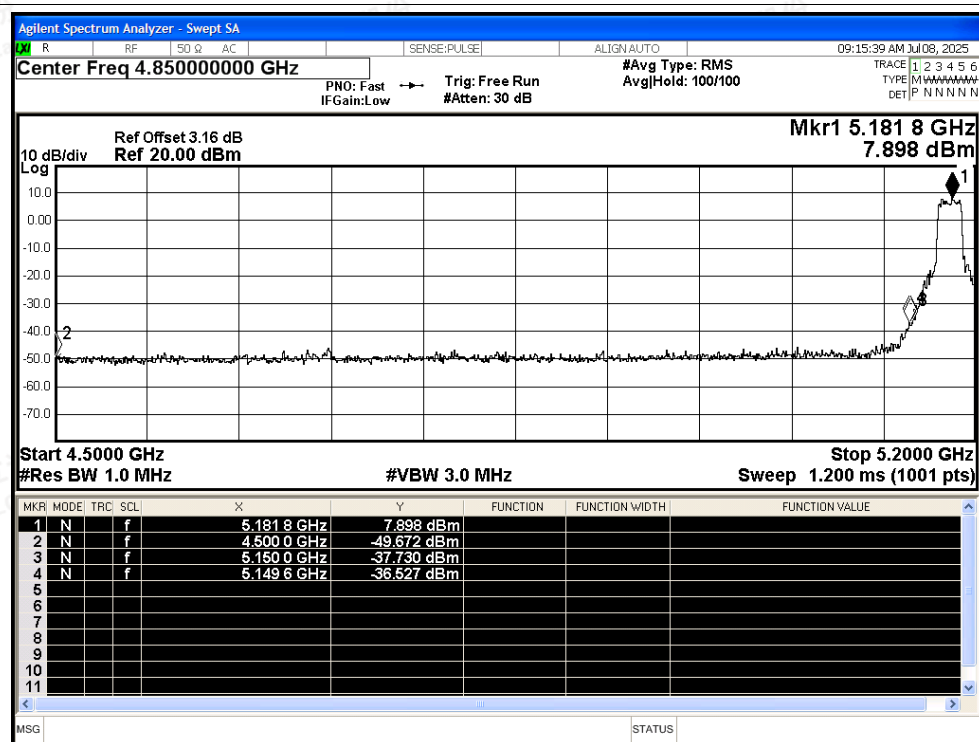

Restrict Band NVNT ax20 5180MHz Ant1 Average

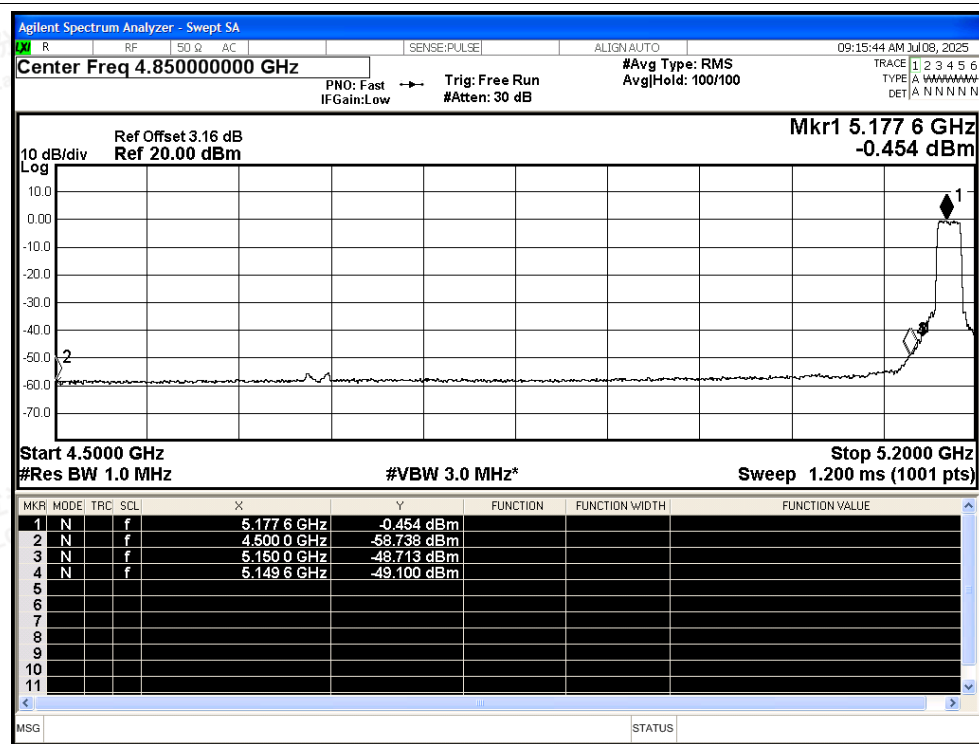

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5240MHz Ant1 Peak

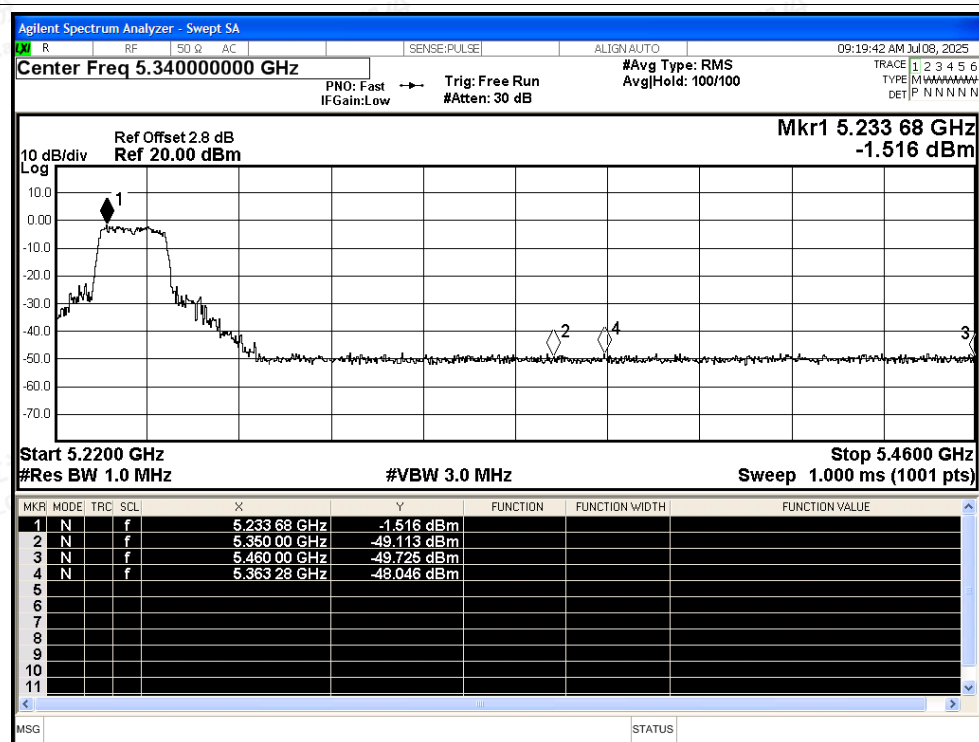

Restrict Band NVNT ax20 5240MHz Ant1 Average

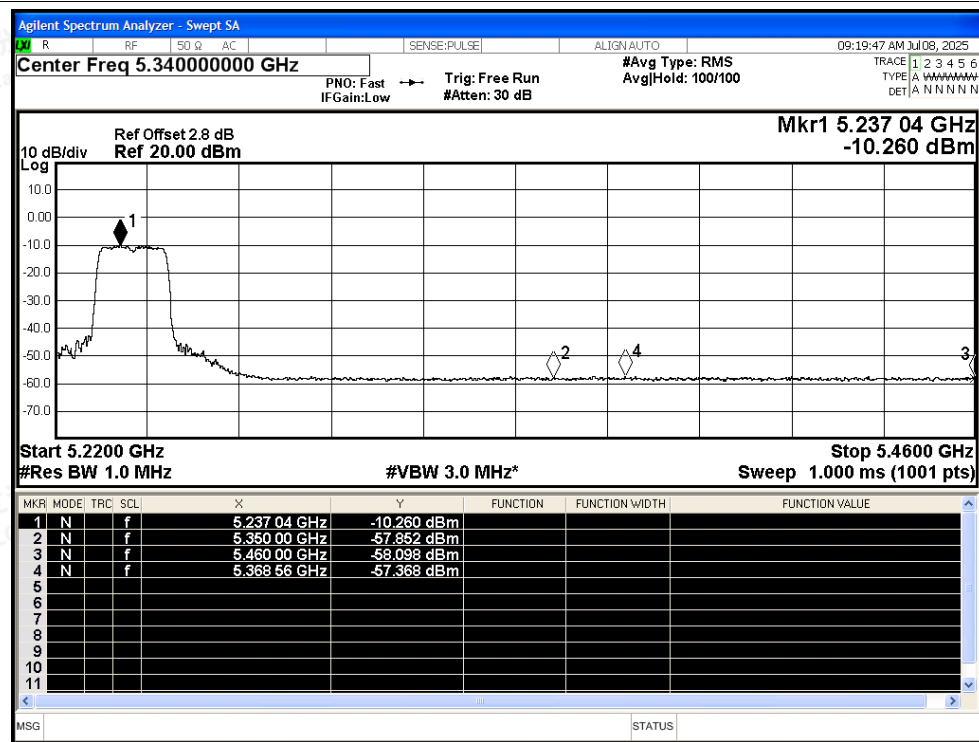

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5190MHz Ant1 Peak

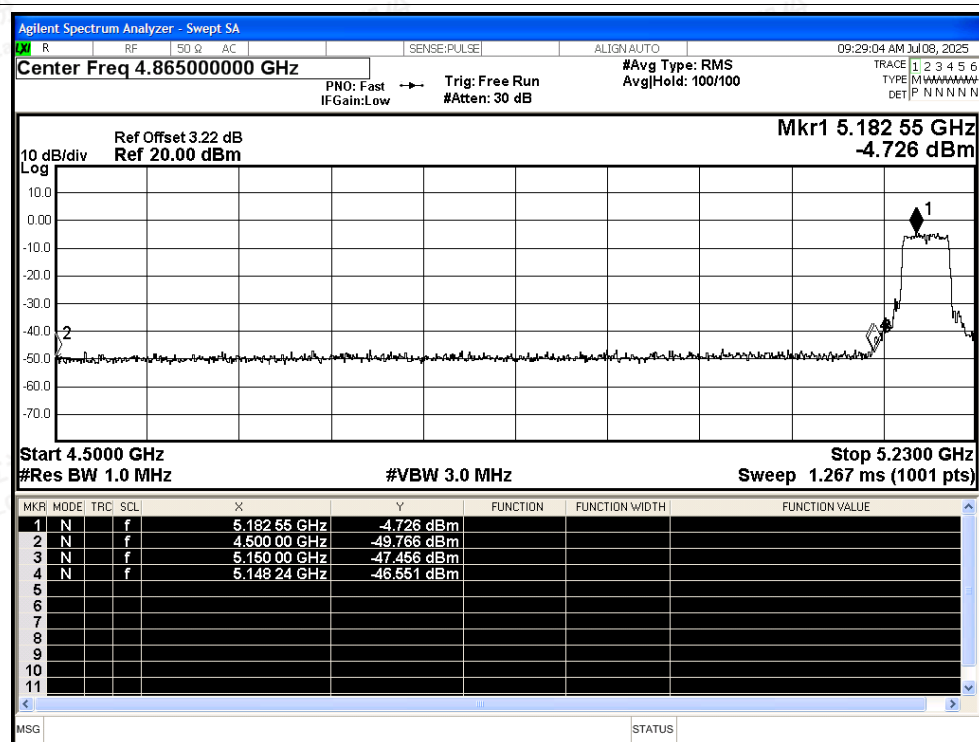

Restrict Band NVNT ax40 5190MHz Ant1 Average

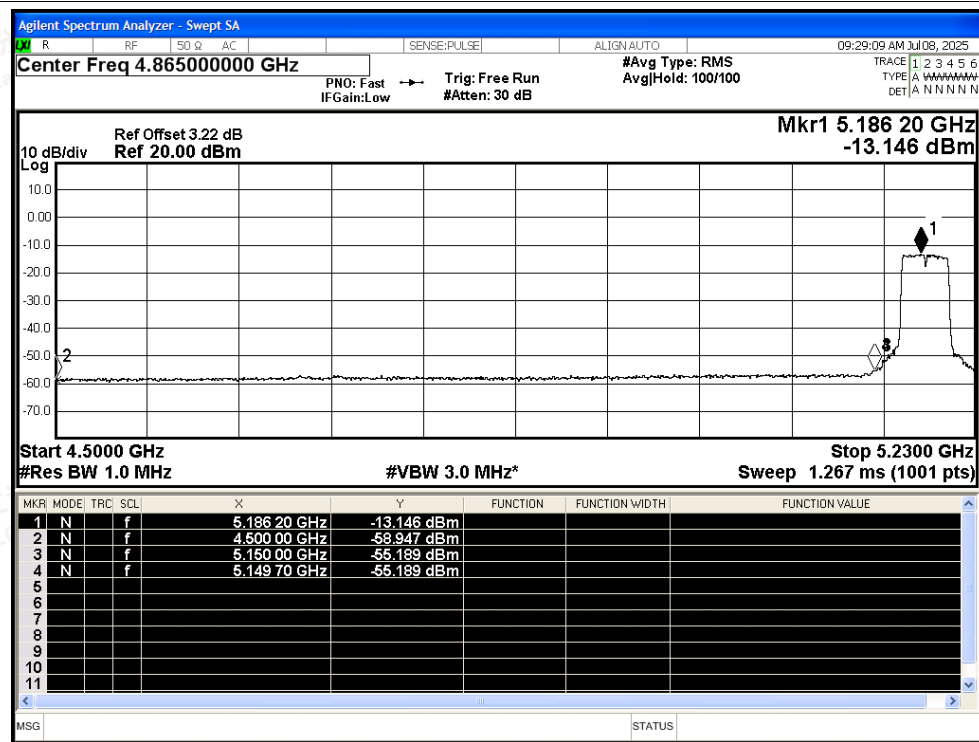

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5230MHz Ant1 Peak

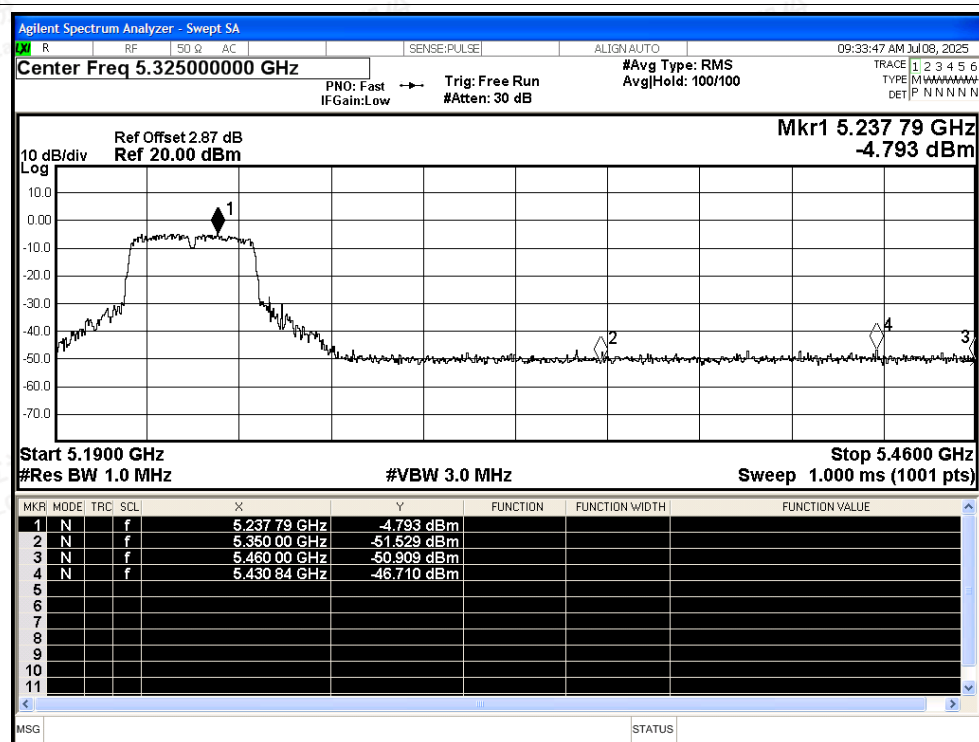

Restrict Band NVNT ax40 5230MHz Ant1 Average

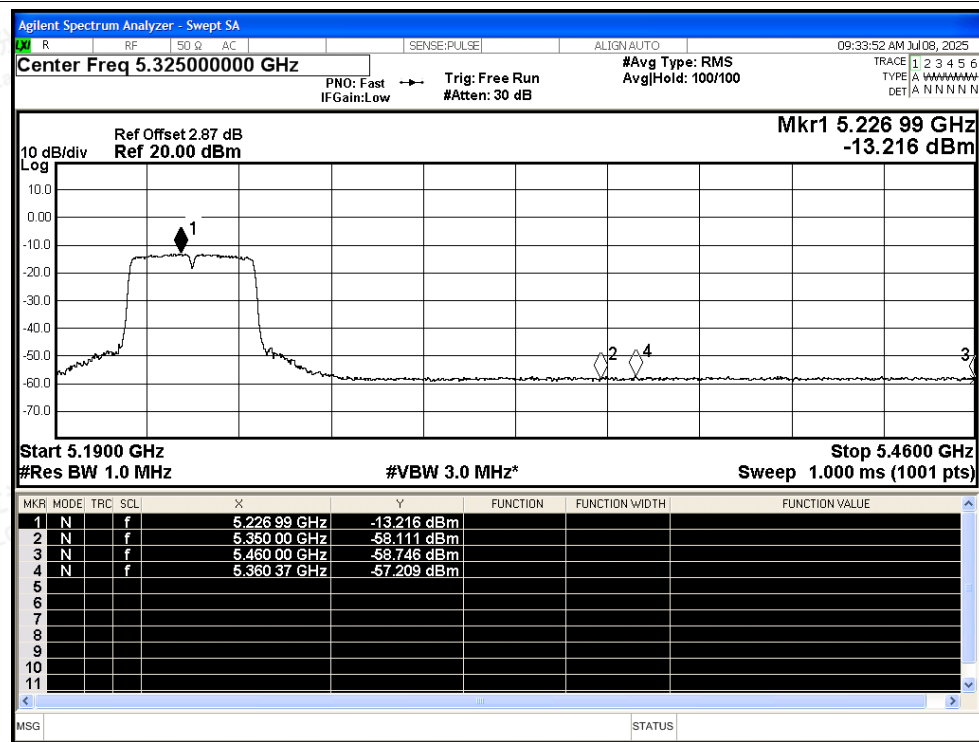

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant1 Peak

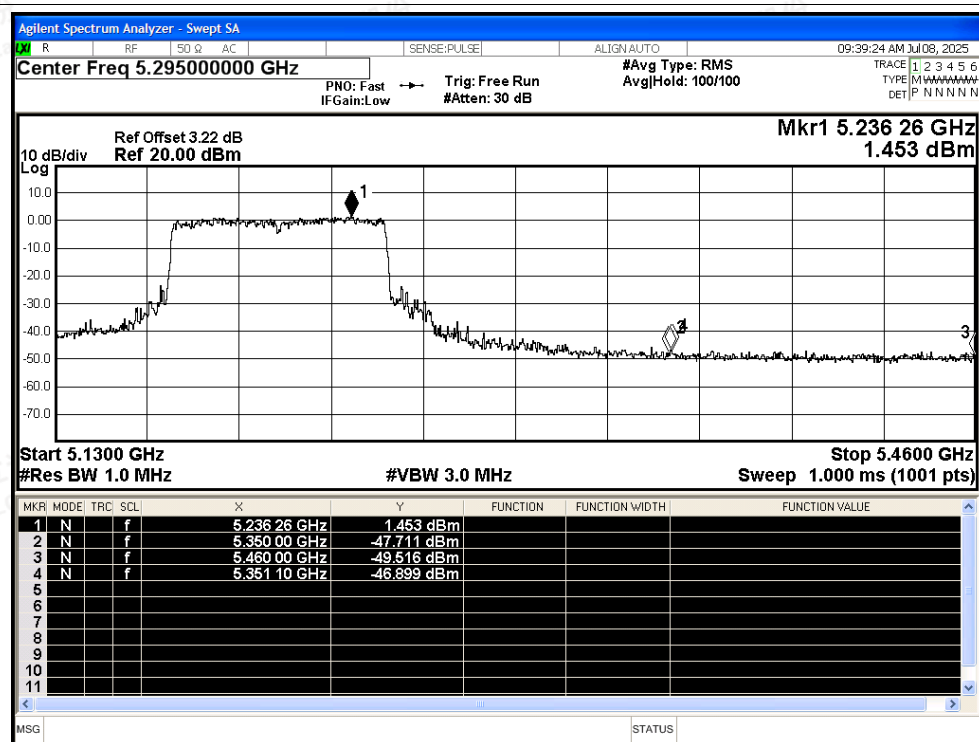

Restrict Band NVNT ax80 5210MHz Ant1 Average

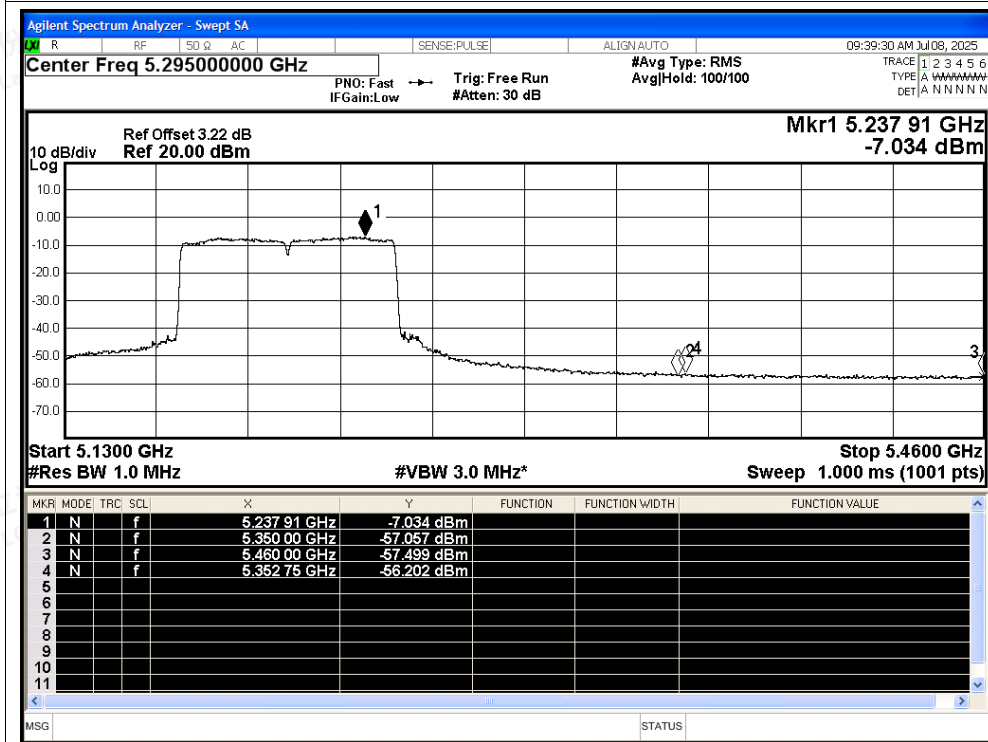

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant1 Peak

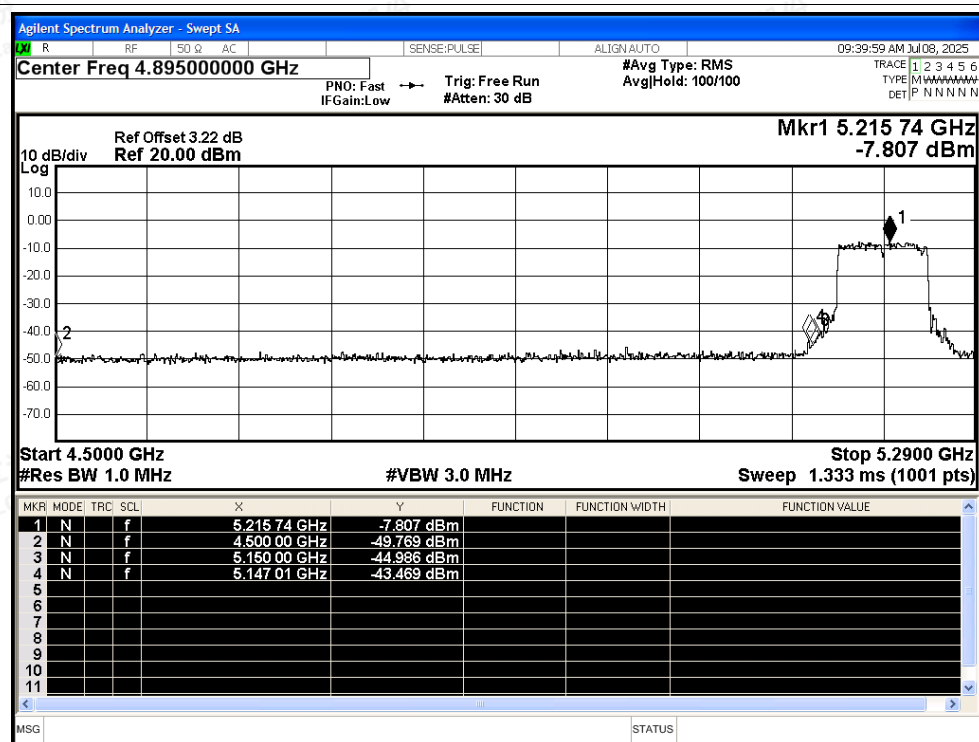

Restrict Band NVNT ax80 5210MHz Ant1 Average

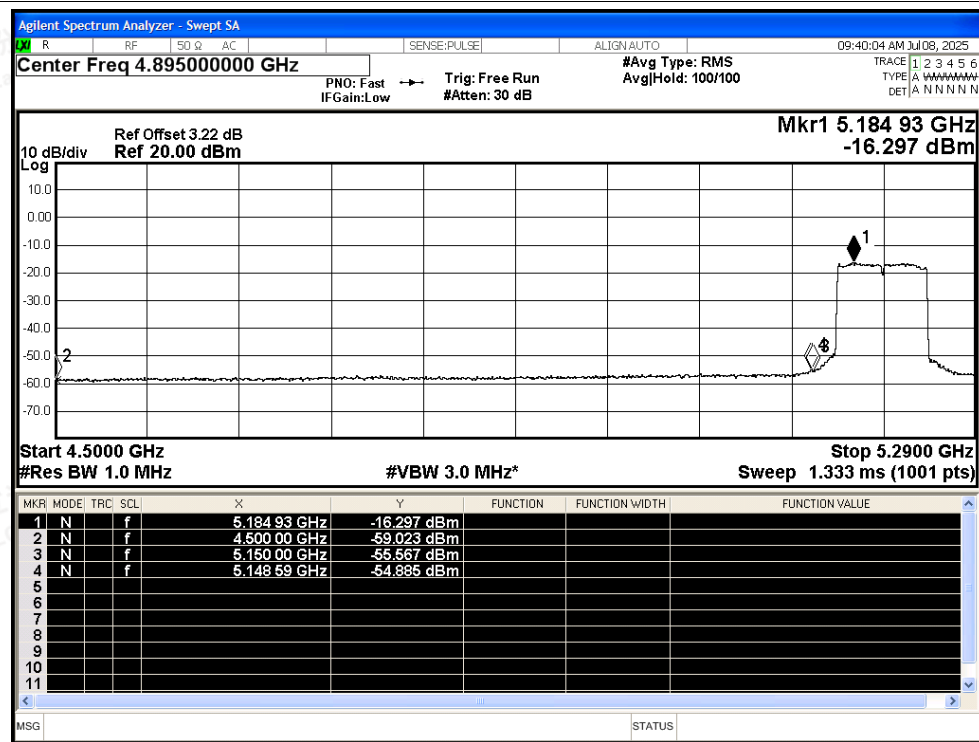

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5180	Ant2	4500	-50.86	5.87	-	50.27	Peak	68.2	Pass
NVNT	a	5180	Ant2	4500	-58.95	5.87	0.24	42.42	Average	54	Pass
NVNT	a	5180	Ant2	5021.5	-46.4	5.87	-	54.73	Peak	68.2	Pass
NVNT	a	5180	Ant2	5145.4	-56.29	5.87	0.24	45.08	Average	54	Pass
NVNT	a	5180	Ant2	5150	-48.2	5.87	-	52.93	Peak	68.2	Pass
NVNT	a	5180	Ant2	5150	-56.6	5.87	0.24	44.77	Average	54	Pass
NVNT	a	5240	Ant2	5350	-50.67	5.87	-	50.46	Peak	68.2	Pass
NVNT	a	5240	Ant2	5350	-58.67	5.87	0.24	42.70	Average	54	Pass
NVNT	a	5240	Ant2	5370.96	-47.35	5.87	-	53.78	Peak	68.2	Pass
NVNT	a	5240	Ant2	5381.28	-57.25	5.87	0.24	44.12	Average	54	Pass
NVNT	a	5240	Ant2	5460	-49.83	5.87	-	51.30	Peak	68.2	Pass
NVNT	a	5240	Ant2	5460	-58.56	5.87	0.24	42.81	Average	54	Pass
NVNT	n20	5180	Ant2	4500	-50.93	5.87	-	50.20	Peak	68.2	Pass
NVNT	n20	5180	Ant2	4500	-58.56	5.87	0.12	42.69	Average	54	Pass
NVNT	n20	5180	Ant2	5146.8	-45.45	5.87	-	55.68	Peak	68.2	Pass
NVNT	n20	5180	Ant2	5149.6	-56.16	5.87	0.12	45.09	Average	54	Pass
NVNT	n20	5180	Ant2	5150	-46.04	5.87	-	55.09	Peak	68.2	Pass
NVNT	n20	5180	Ant2	5150	-55.13	5.87	0.12	46.12	Average	54	Pass
NVNT	n20	5240	Ant2	5350	-50.29	5.87	-	50.84	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5350	-57.93	5.87	0.12	43.32	Average	54	Pass
NVNT	n20	5240	Ant2	5387.04	-47.49	5.87	-	53.64	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5427.12	-57.54	5.87	0.12	43.71	Average	54	Pass
NVNT	n20	5240	Ant2	5460	-49.81	5.87	-	51.32	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5460	-58.43	5.87	0.12	42.82	Average	54	Pass
NVNT	n40	5190	Ant2	4500	-50.31	5.87	-	50.82	Peak	68.2	Pass
NVNT	n40	5190	Ant2	4500	-59.21	5.87	0.24	42.16	Average	54	Pass
NVNT	n40	5190	Ant2	5149.7	-45	5.87	-	56.13	Peak	68.2	Pass
NVNT	n40	5190	Ant2	5148.97	-55.69	5.87	0.24	45.68	Average	54	Pass
NVNT	n40	5190	Ant2	5150	-45	5.87	-	56.13	Peak	68.2	Pass
NVNT	n40	5190	Ant2	5150	-56.14	5.87	0.24	45.23	Average	54	Pass
NVNT	n40	5230	Ant2	5350	-49.81	5.87	-	51.32	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5350	-58.32	5.87	0.24	43.05	Average	54	Pass
NVNT	n40	5230	Ant2	5426.25	-47.69	5.87	-	53.44	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5434.62	-57.45	5.87	0.24	43.92	Average	54	Pass
NVNT	n40	5230	Ant2	5460	-51.03	5.87	-	50.10	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5460	-58.1	5.87	0.24	43.27	Average	54	Pass
NVNT	ac20	5180	Ant2	4500	-51.29	5.87	-	49.84	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5180	Ant2	4500	-59.41	5.87	0.12	41.84	Average	54	Pass
NVNT	ac20	5180	Ant2	5149.6	-42.05	5.87	-	59.08	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	5148.9	-55.63	5.87	0.12	45.62	Average	54	Pass
NVNT	ac20	5180	Ant2	5150	-42.66	5.87	-	58.47	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	5150	-56.28	5.87	0.12	44.97	Average	54	Pass
NVNT	ac20	5240	Ant2	5350	-51.08	5.87	-	50.05	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5350	-58.38	5.87	0.12	42.87	Average	54	Pass
NVNT	ac20	5240	Ant2	5401.2	-47.61	5.87	-	53.52	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5357.28	-57.33	5.87	0.12	43.92	Average	54	Pass
NVNT	ac20	5240	Ant2	5460	-51.26	5.87	-	49.87	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5460	-58.24	5.87	0.12	43.01	Average	54	Pass
NVNT	ac40	5190	Ant2	4500	-50.1	5.87	-	51.03	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	4500	-59.01	5.87	0.24	42.36	Average	54	Pass
NVNT	ac40	5190	Ant2	5148.24	-42.56	5.87	-	58.57	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	5148.97	-56.1	5.87	0.24	45.27	Average	54	Pass
NVNT	ac40	5190	Ant2	5150	-45.26	5.87	-	55.87	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	5150	-56.2	5.87	0.24	45.17	Average	54	Pass
NVNT	ac40	5230	Ant2	5350	-49.51	5.87	-	51.62	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5350	-58.65	5.87	0.24	42.72	Average	54	Pass
NVNT	ac40	5230	Ant2	5369.01	-46.88	5.87	-	54.25	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5367.93	-57.37	5.87	0.24	44.00	Average	54	Pass
NVNT	ac40	5230	Ant2	5460	-49.89	5.87	-	51.24	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5460	-58.41	5.87	0.24	42.96	Average	54	Pass
NVNT	ac80	5210	Ant2	5350	-47.95	5.87	-	53.18	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5350	-56.38	5.87	0.47	45.22	Average	54	Pass
NVNT	ac80	5210	Ant2	5352.09	-46.53	5.87	-	54.60	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5352.09	-56.03	5.87	0.47	45.57	Average	54	Pass
NVNT	ac80	5210	Ant2	5460	-50.58	5.87	-	50.55	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5460	-57.75	5.87	0.47	43.85	Average	54	Pass
NVNT	ac80	5210	Ant2	4500	-49.82	5.87	-	51.31	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	4500	-59.16	5.87	0.47	42.44	Average	54	Pass
NVNT	ac80	5210	Ant2	5143.85	-35.51	5.87	-	65.62	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5148.59	-49.15	5.87	0.47	52.45	Average	54	Pass
NVNT	ac80	5210	Ant2	5150	-37.61	5.87	-	63.52	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5150	-49.66	5.87	0.47	51.94	Average	54	Pass
NVNT	ax20	5180	Ant2	4500	-49.53	5.87	-	51.60	Peak	68.2	Pass
NVNT	ax20	5180	Ant2	4500	-58.86	5.87	0.12	42.39	Average	54	Pass
NVNT	ax20	5180	Ant2	5145.4	-44.62	5.87	-	56.51	Peak	68.2	Pass
NVNT	ax20	5180	Ant2	5146.1	-56.37	5.87	0.12	44.88	Average	54	Pass
NVNT	ax20	5180	Ant2	5150	-44.93	5.87	-	56.20	Peak	68.2	Pass
NVNT	ax20	5180	Ant2	5150	-56.14	5.87	0.12	45.11	Average	54	Pass
NVNT	ax20	5240	Ant2	5350	-49.39	5.87	-	51.74	Peak	68.2	Pass
NVNT	ax20	5240	Ant2	5350	-58.6	5.87	0.12	42.65	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




NVNT	ax20	5240	Ant2	5451.6	-47.16	5.87	-	53.97	Peak	68.2	Pass
NVNT	ax20	5240	Ant2	5386.08	-57.65	5.87	0.12	43.60	Average	54	Pass
NVNT	ax20	5240	Ant2	5460	-49.93	5.87	-	51.20	Peak	68.2	Pass
NVNT	ax20	5240	Ant2	5460	-58.31	5.87	0.12	42.94	Average	54	Pass
NVNT	ax40	5190	Ant2	4500	-51.74	5.87	-	49.39	Peak	68.2	Pass
NVNT	ax40	5190	Ant2	4500	-58.71	5.87	0.24	42.66	Average	54	Pass
NVNT	ax40	5190	Ant2	5148.24	-44.9	5.87	-	56.23	Peak	68.2	Pass
NVNT	ax40	5190	Ant2	5148.97	-55.4	5.87	0.24	45.97	Average	54	Pass
NVNT	ax40	5190	Ant2	5150	-47.65	5.87	-	53.48	Peak	68.2	Pass
NVNT	ax40	5190	Ant2	5150	-55.71	5.87	0.24	45.66	Average	54	Pass
NVNT	ax40	5230	Ant2	5350	-48.9	5.87	-	52.23	Peak	68.2	Pass
NVNT	ax40	5230	Ant2	5350	-58.37	5.87	0.24	43.00	Average	54	Pass
NVNT	ax40	5230	Ant2	5429.76	-47.29	5.87	-	53.84	Peak	68.2	Pass
NVNT	ax40	5230	Ant2	5396.55	-57.38	5.87	0.24	43.99	Average	54	Pass
NVNT	ax40	5230	Ant2	5460	-51.15	5.87	-	49.98	Peak	68.2	Pass
NVNT	ax40	5230	Ant2	5460	-58.09	5.87	0.24	43.28	Average	54	Pass
NVNT	ax80	5210	Ant2	5350	-48.36	5.87	-	52.77	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5350	-56.43	5.87	0.47	45.17	Average	54	Pass
NVNT	ax80	5210	Ant2	5350.77	-46.43	5.87	-	54.70	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5351.43	-56.03	5.87	0.47	45.57	Average	54	Pass
NVNT	ax80	5210	Ant2	5460	-50.58	5.87	-	50.55	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5460	-58.33	5.87	0.47	43.27	Average	54	Pass
NVNT	ax80	5210	Ant2	4500	-50.81	5.87	-	50.32	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	4500	-58.33	5.87	0.47	43.27	Average	54	Pass
NVNT	ax80	5210	Ant2	5145.43	-44.37	5.87	-	56.76	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5149.38	-55.74	5.87	0.47	45.86	Average	54	Pass
NVNT	ax80	5210	Ant2	5150	-45.13	5.87	-	56.00	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5150	-55.85	5.87	0.47	45.75	Average	54	Pass






Test Graphs

Restrict Band NVNT a 5180MHz Ant2 Peak

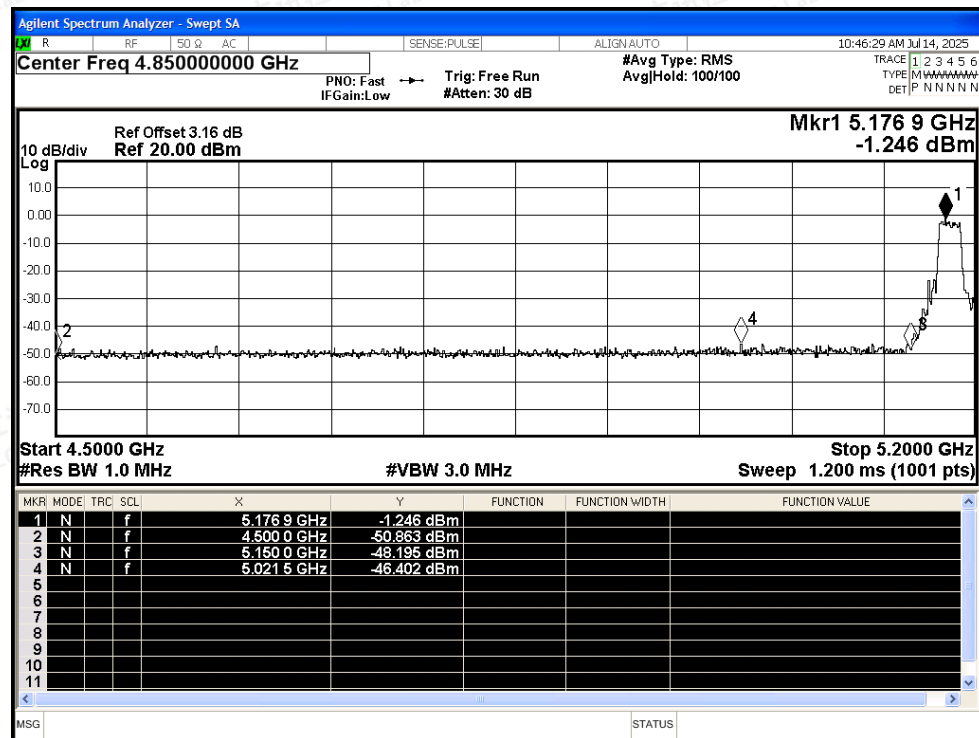

Restrict Band NVNT a 5180MHz Ant2 Average

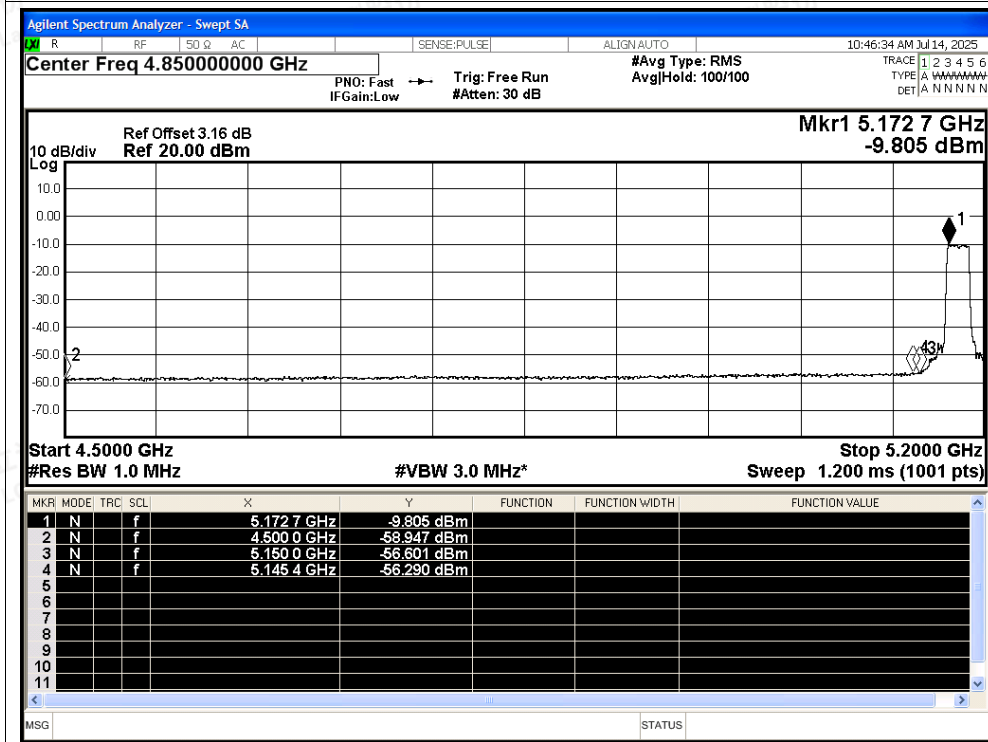

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5240MHz Ant2 Peak

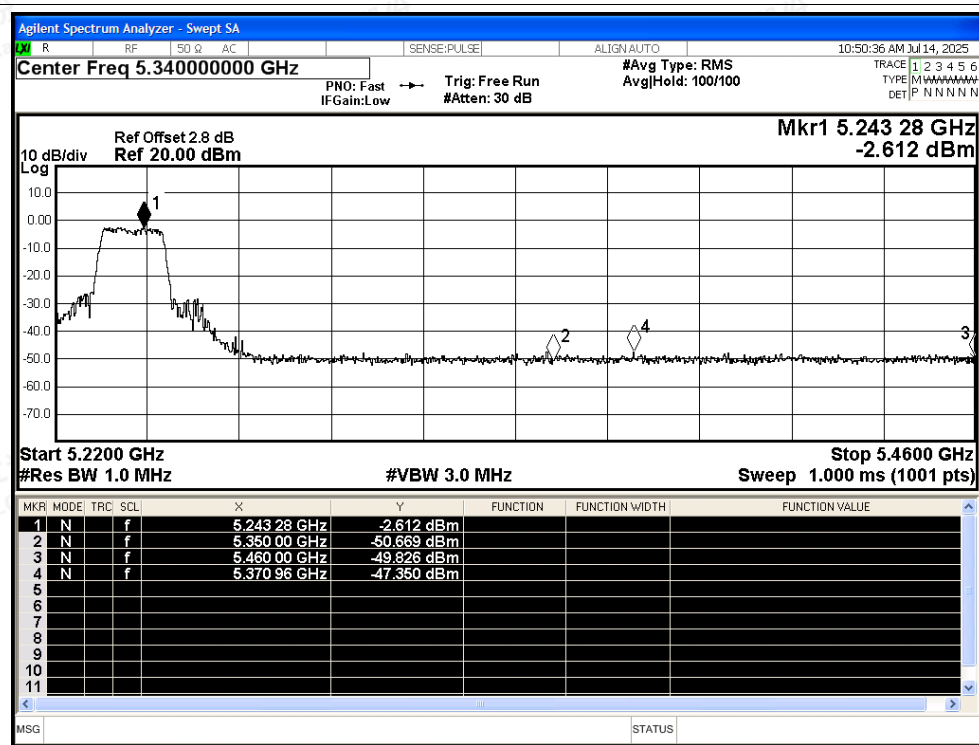

Restrict Band NVNT a 5240MHz Ant2 Average

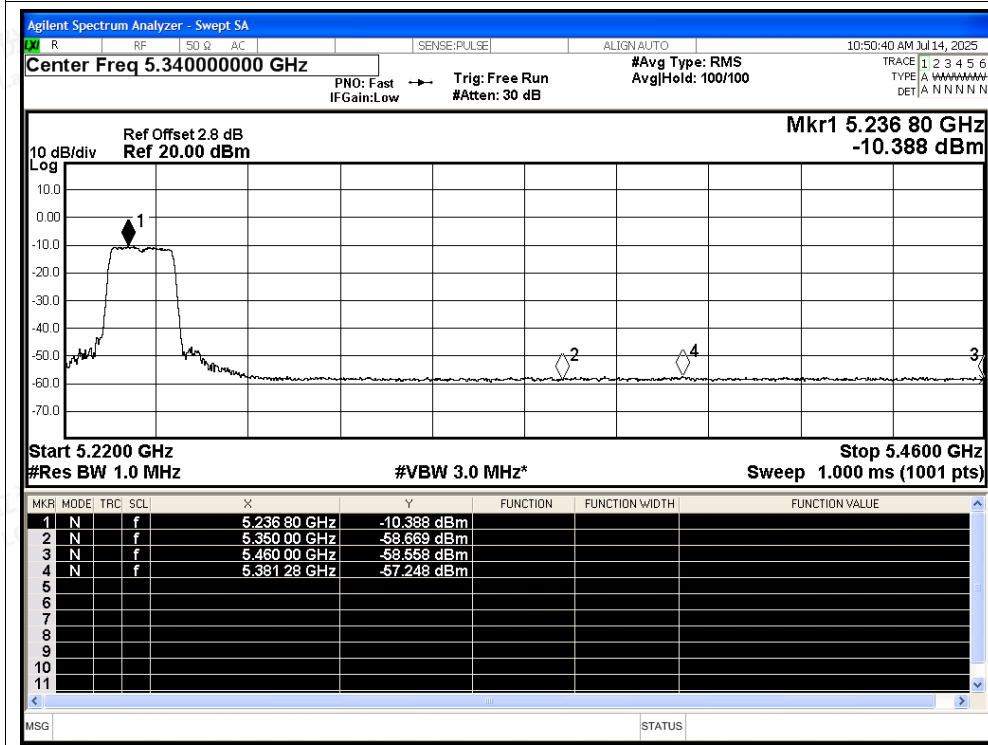

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5180MHz Ant2 Peak

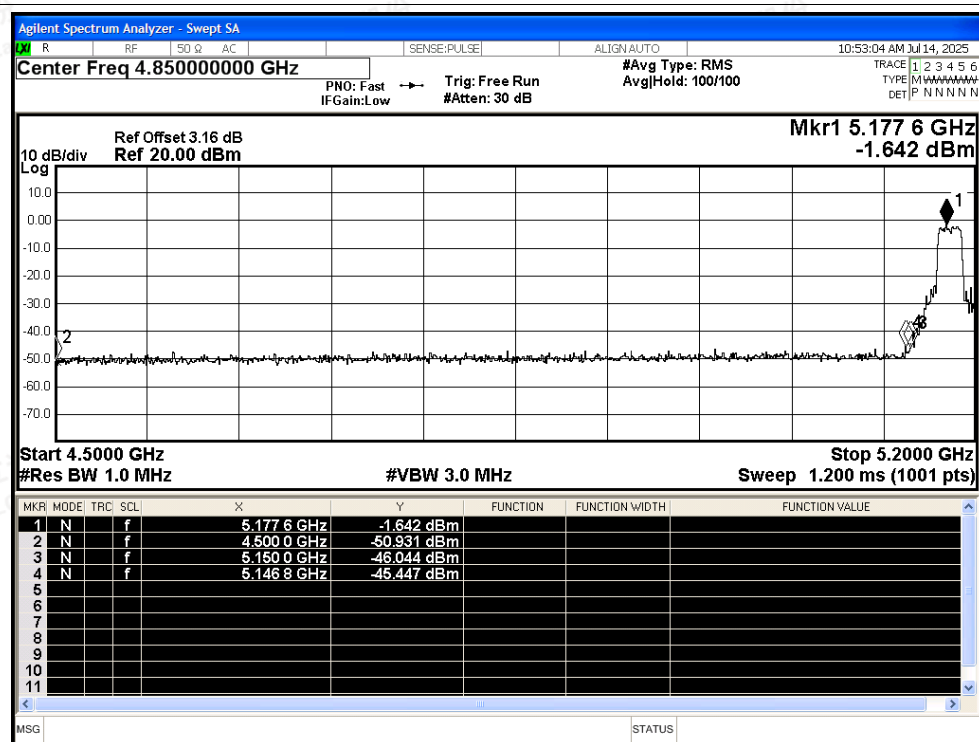

Restrict Band NVNT n20 5180MHz Ant2 Average

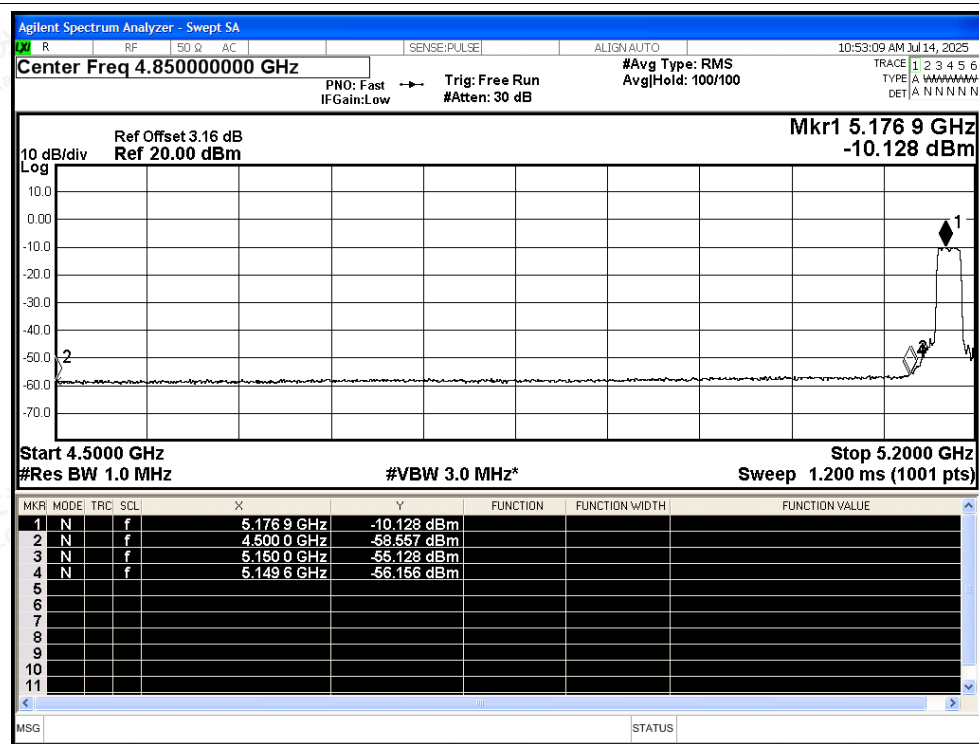

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5240MHz Ant2 Peak

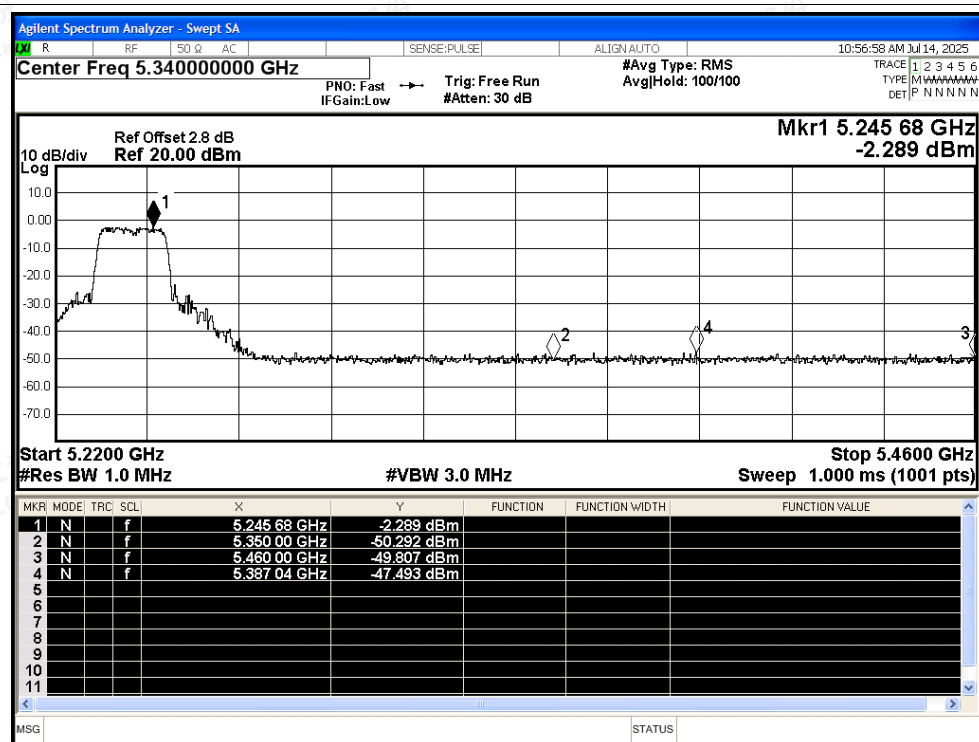

Restrict Band NVNT n20 5240MHz Ant2 Average

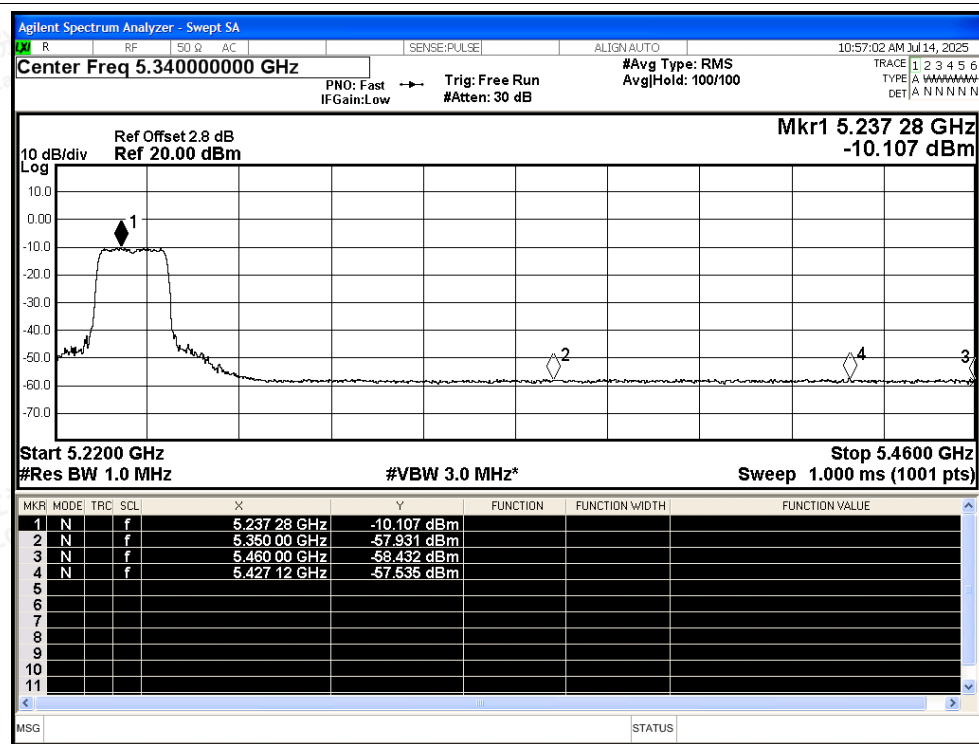

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5190MHz Ant2 Peak

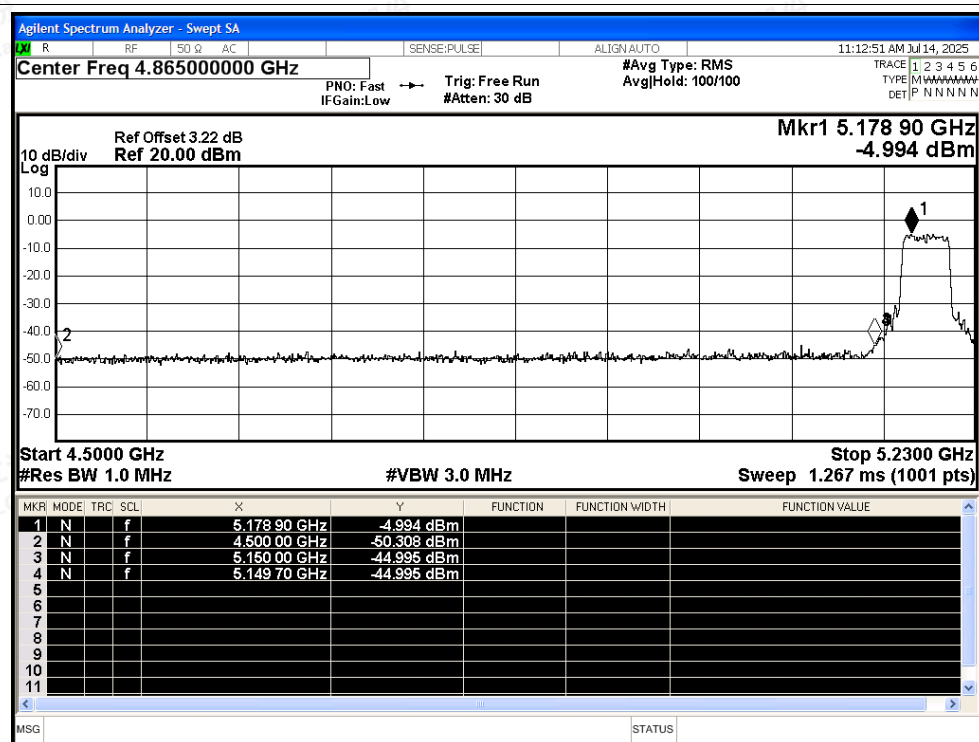

Restrict Band NVNT n40 5190MHz Ant2 Average

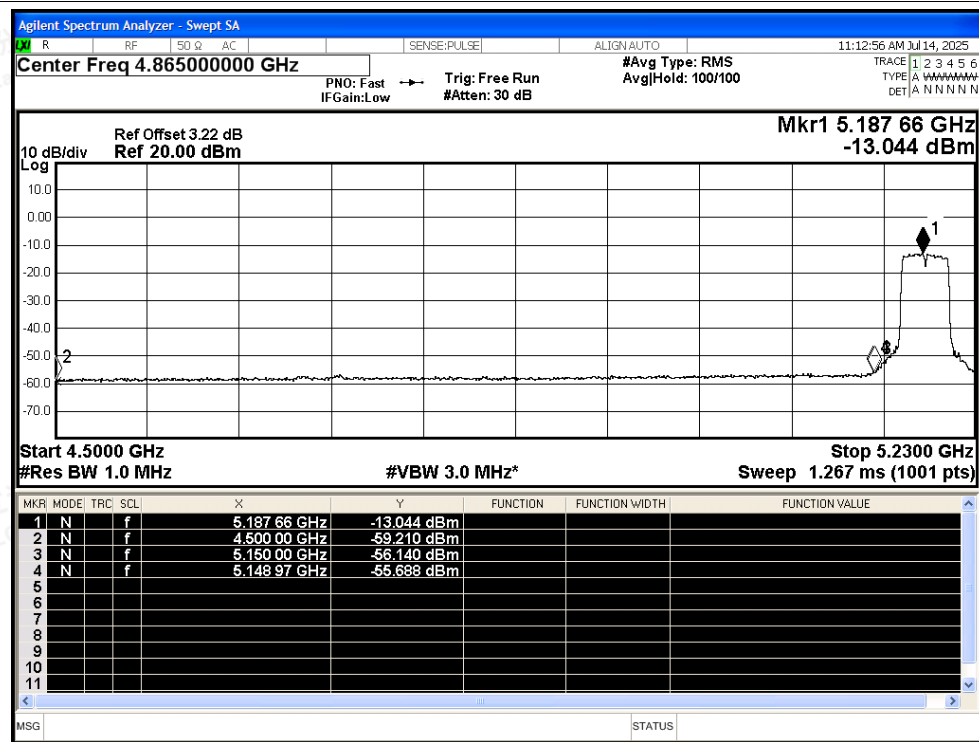

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5230MHz Ant2 Peak

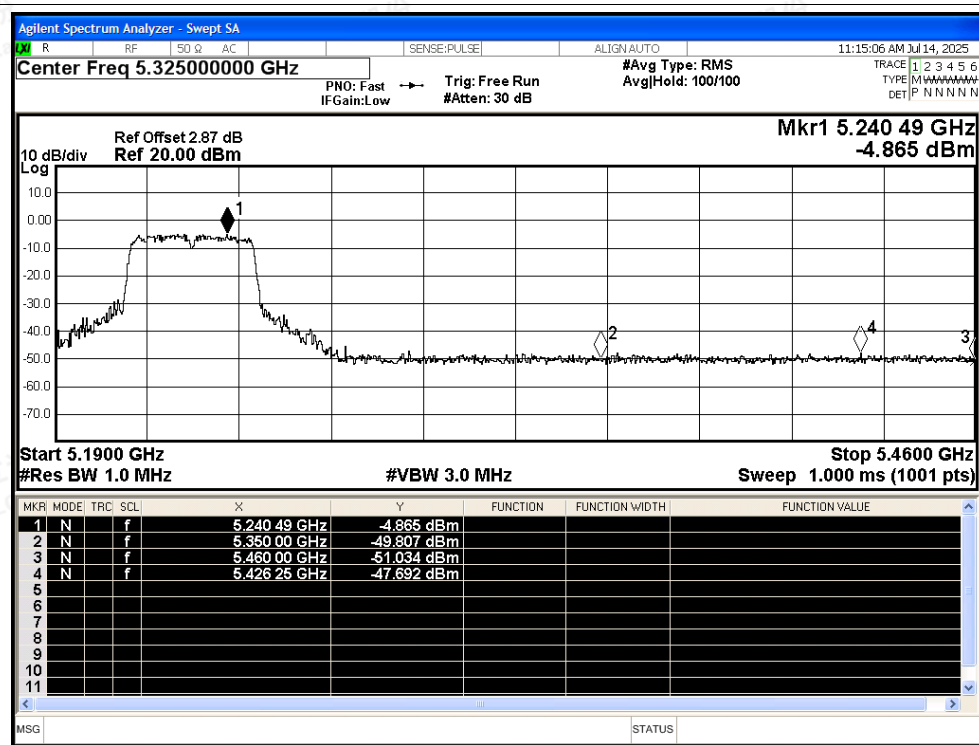

Restrict Band NVNT n40 5230MHz Ant2 Average

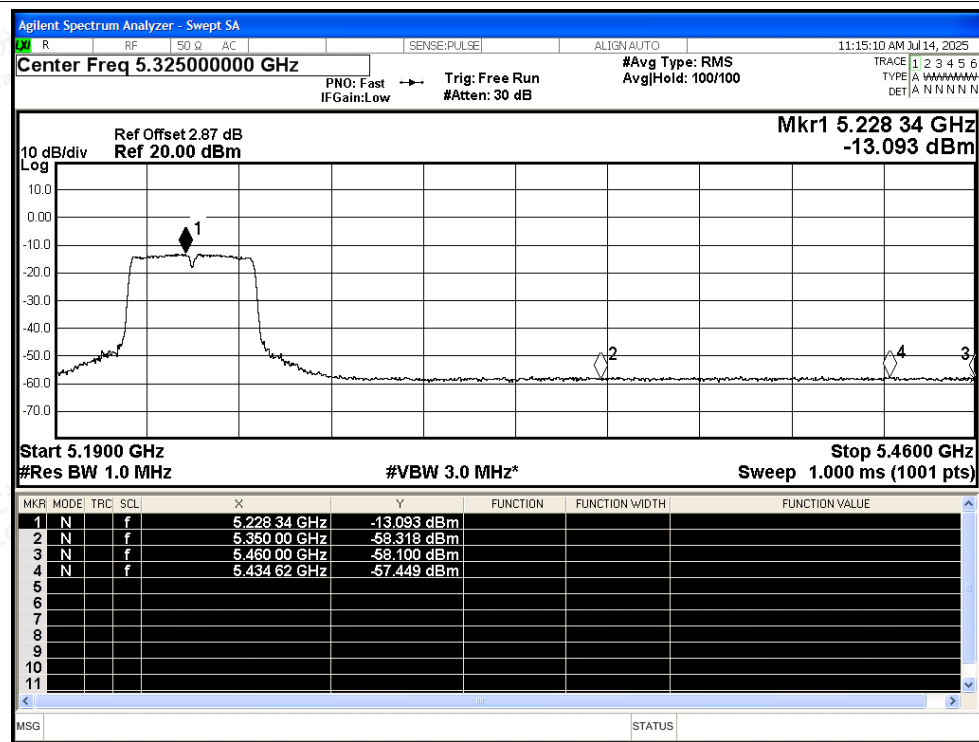

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5180MHz Ant2 Peak

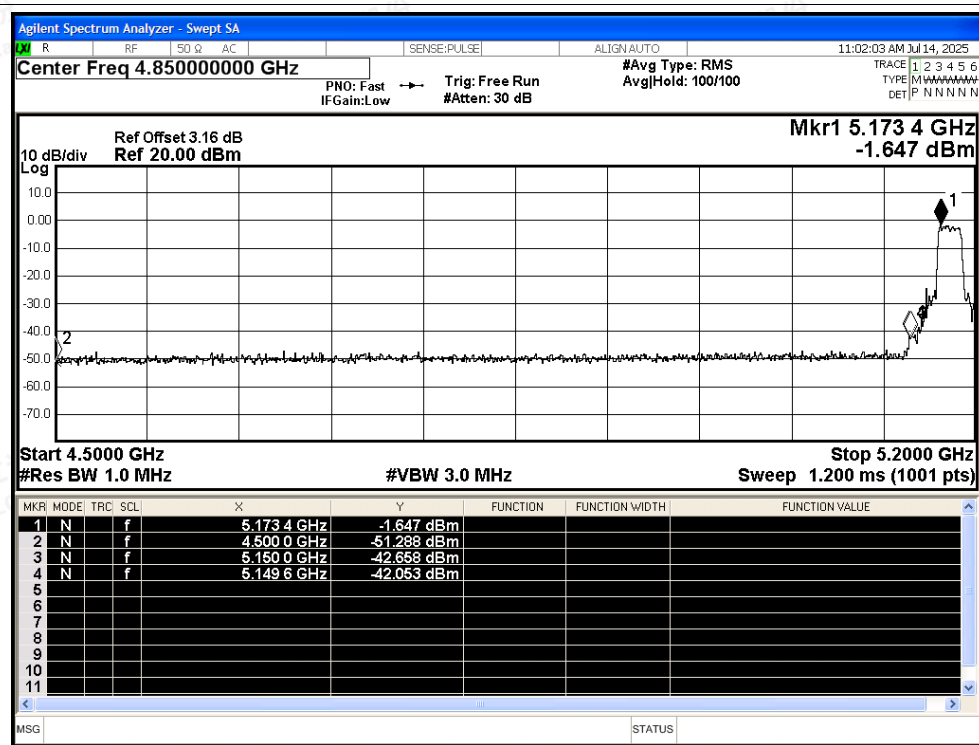

Restrict Band NVNT ac20 5180MHz Ant2 Average

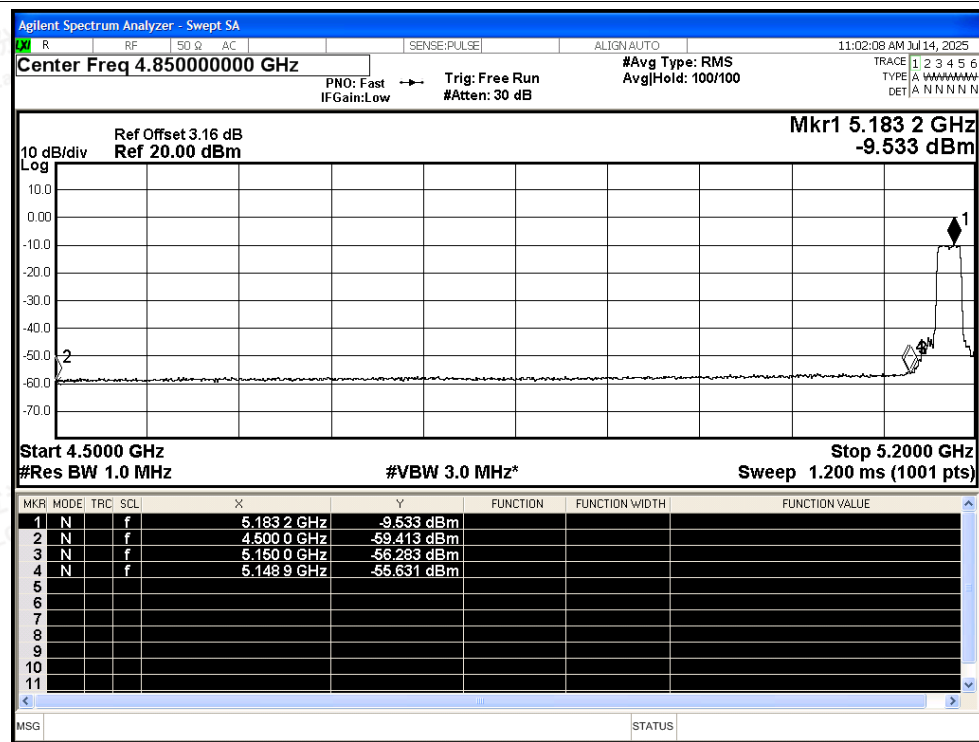

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5240MHz Ant2 Peak

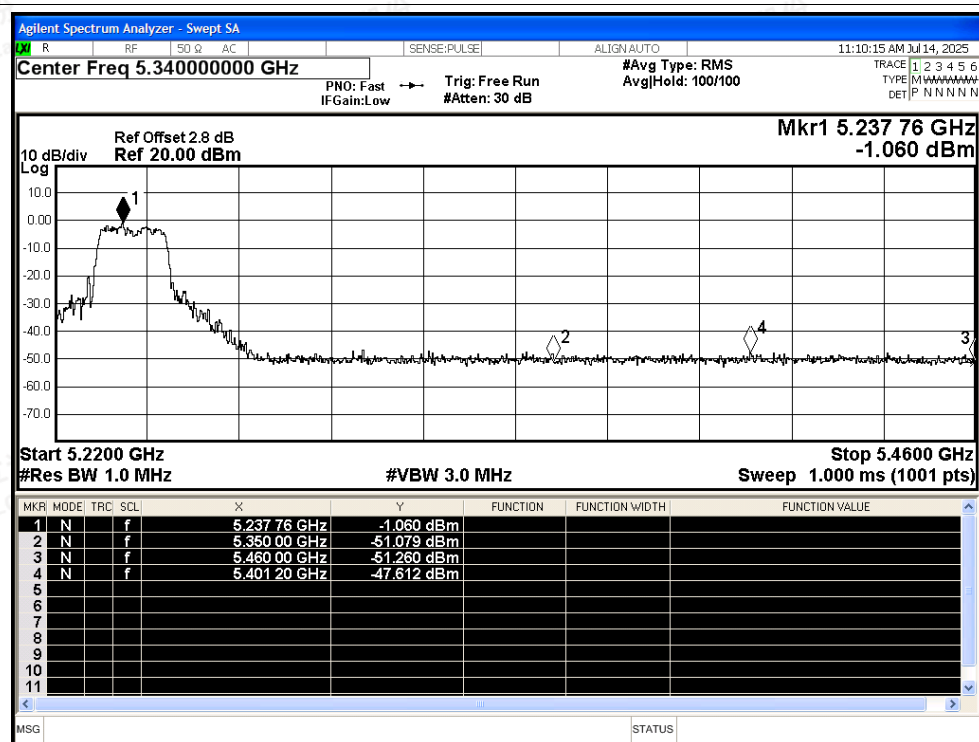

Restrict Band NVNT ac20 5240MHz Ant2 Average

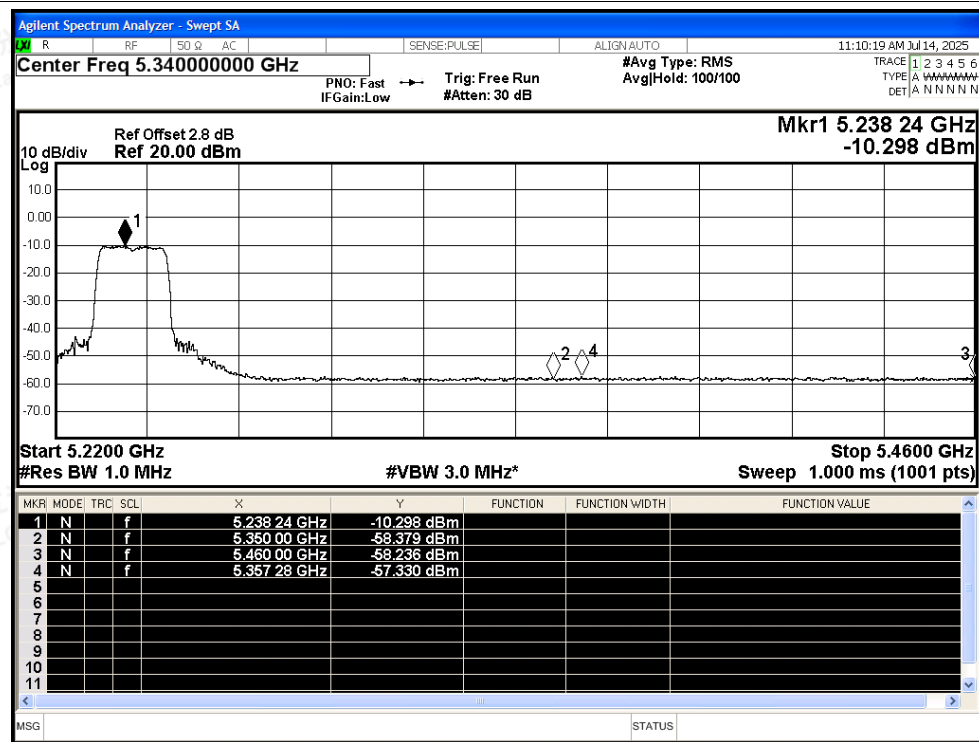

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5190MHz Ant2 Peak

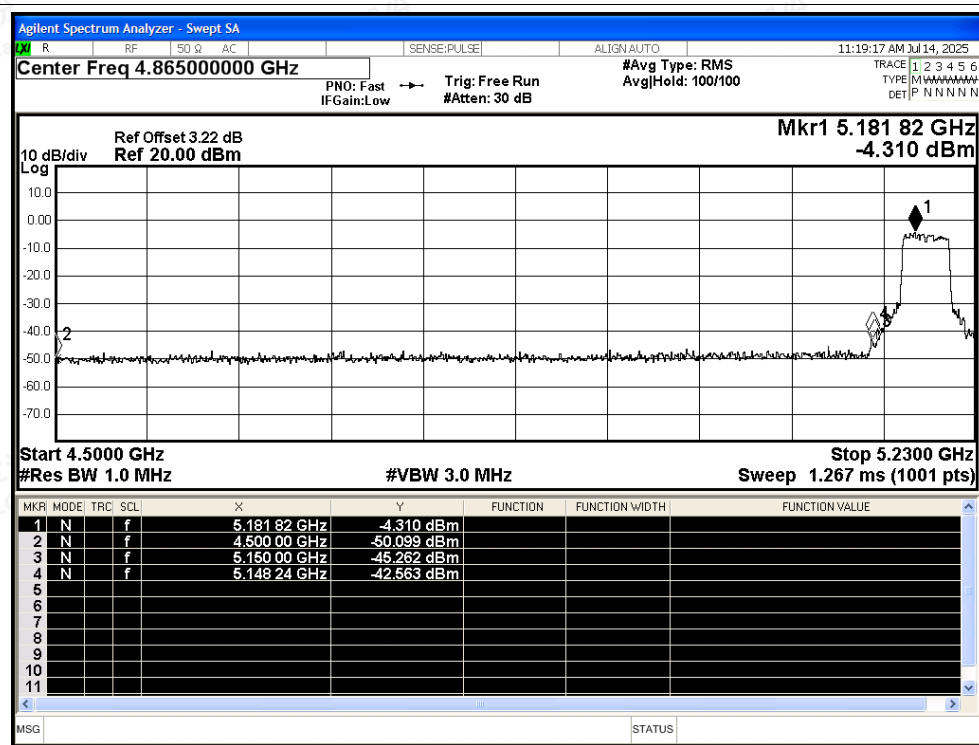

Restrict Band NVNT ac40 5190MHz Ant2 Average

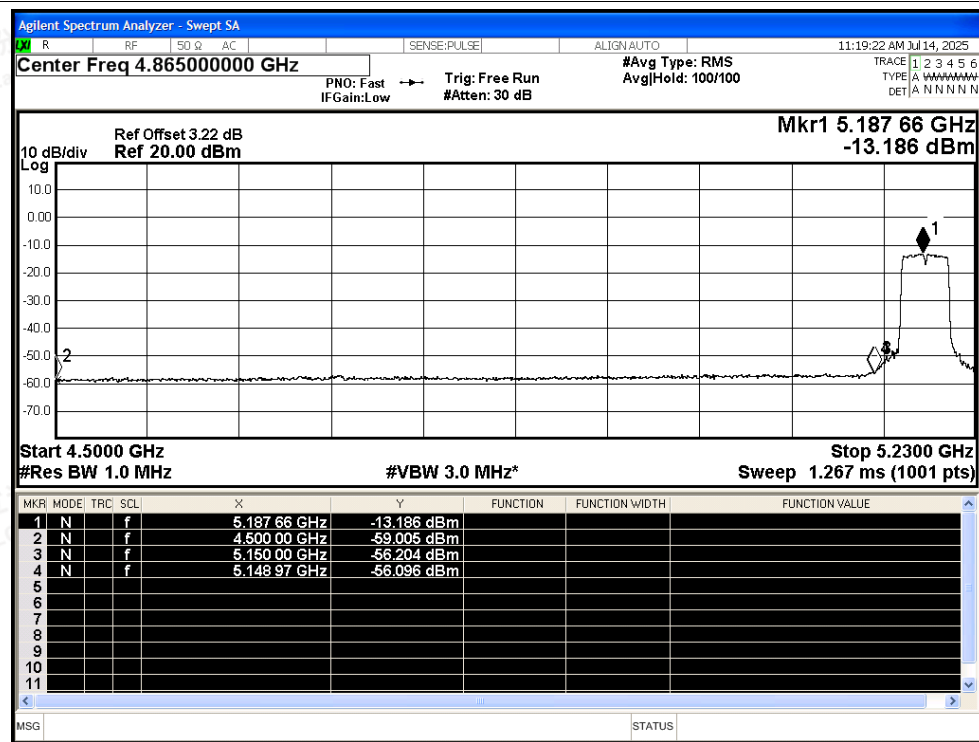

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5230MHz Ant2 Peak

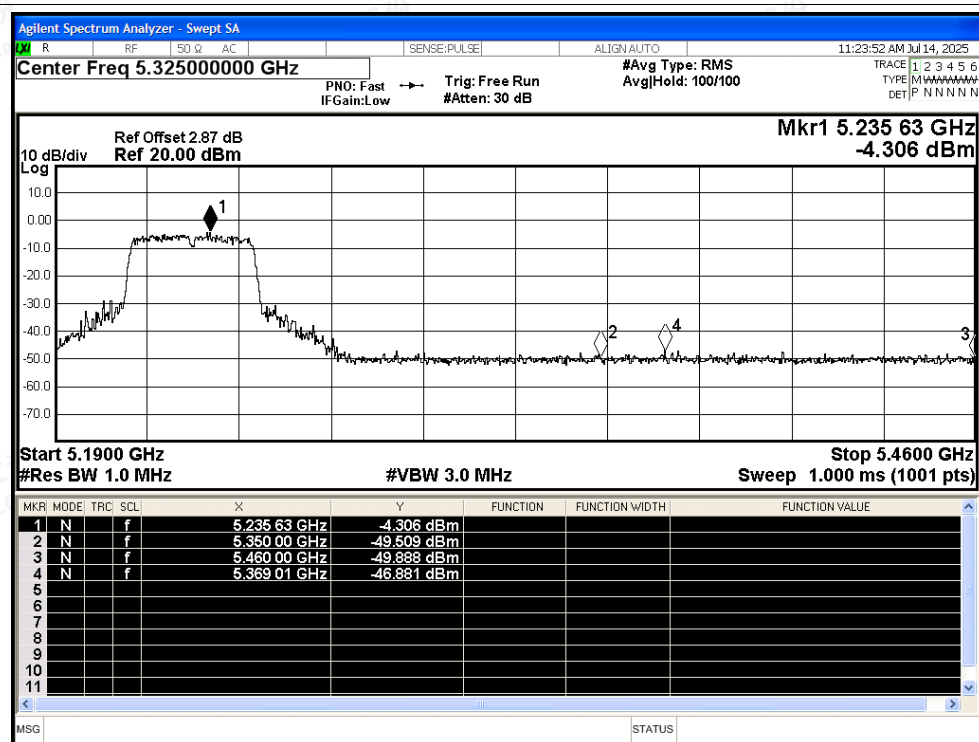

Restrict Band NVNT ac40 5230MHz Ant2 Average

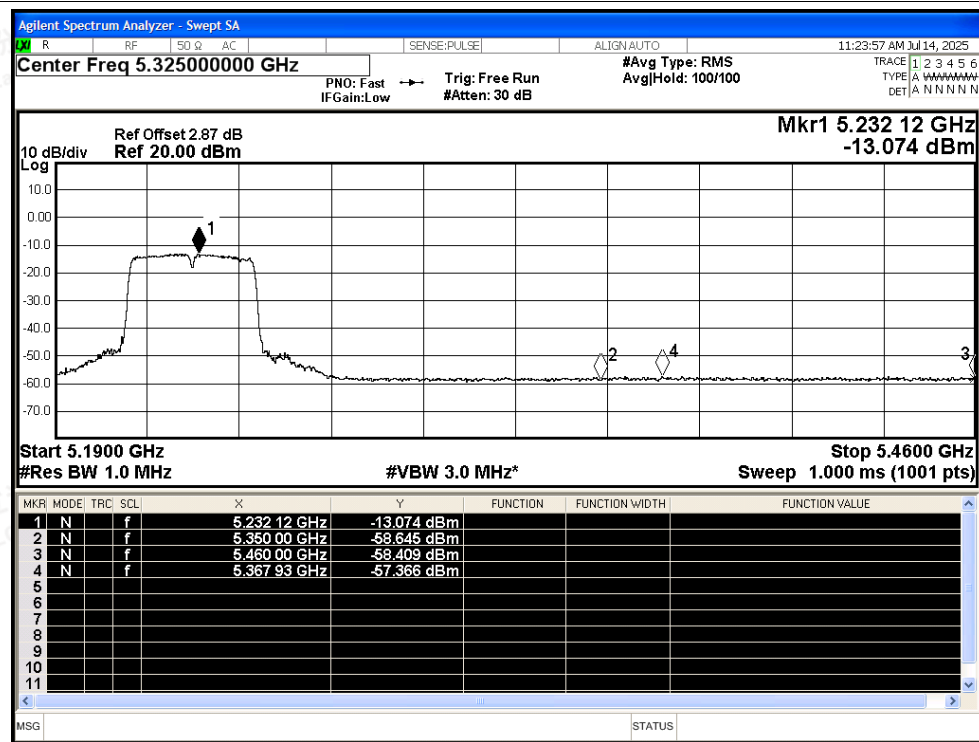

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant2 Peak

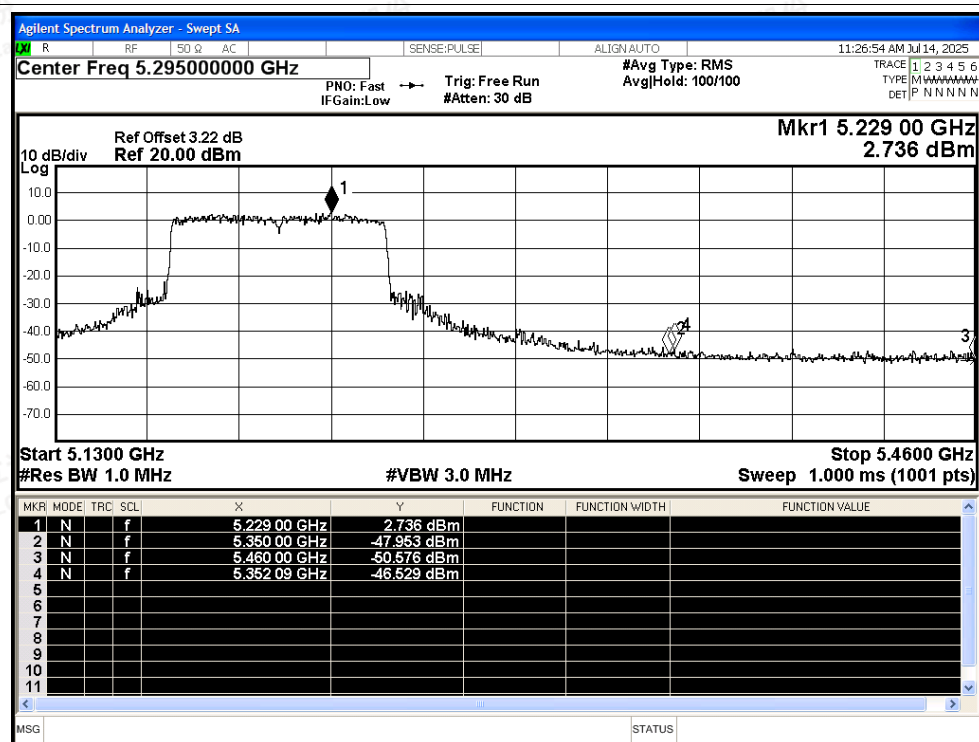

Restrict Band NVNT ac80 5210MHz Ant2 Average

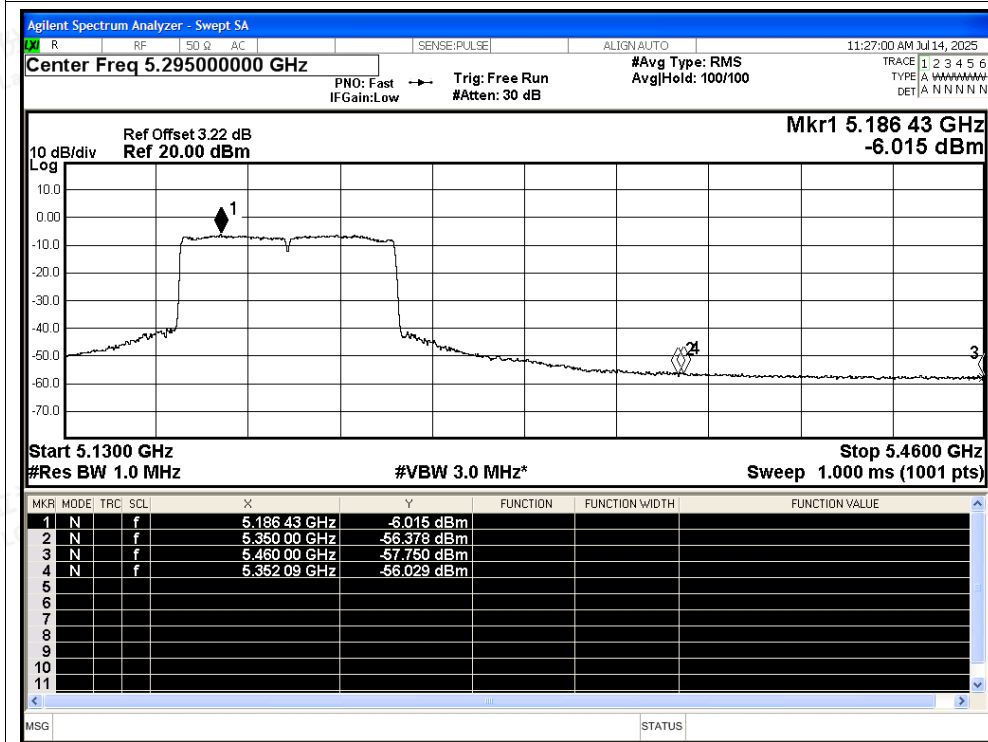

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant2 Peak

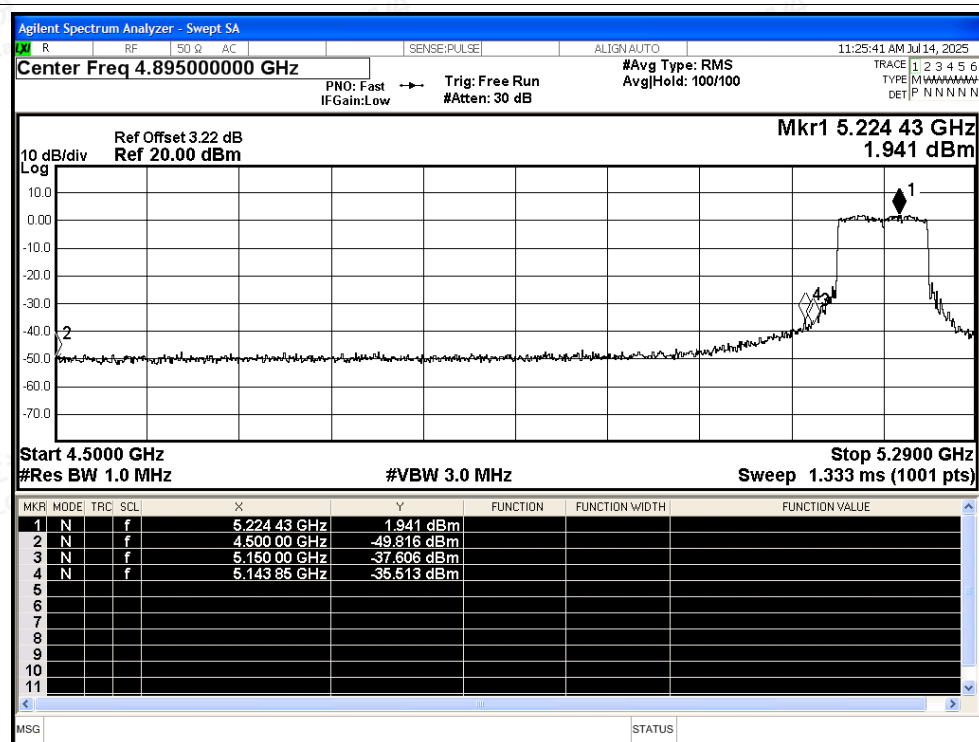

Restrict Band NVNT ac80 5210MHz Ant2 Average

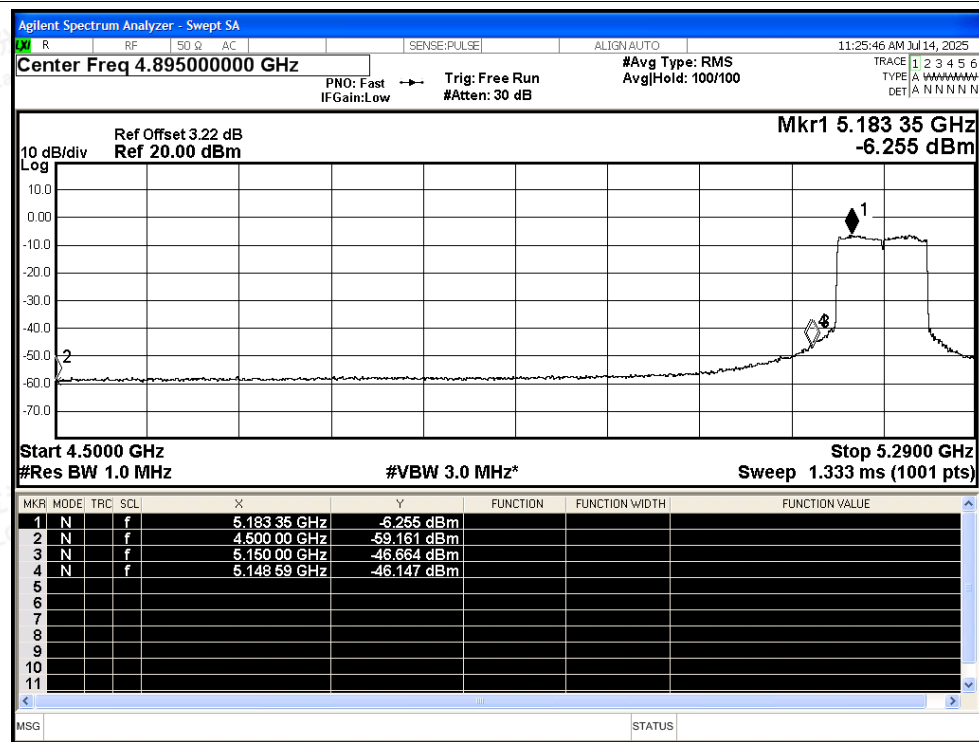

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5180MHz Ant2 Peak

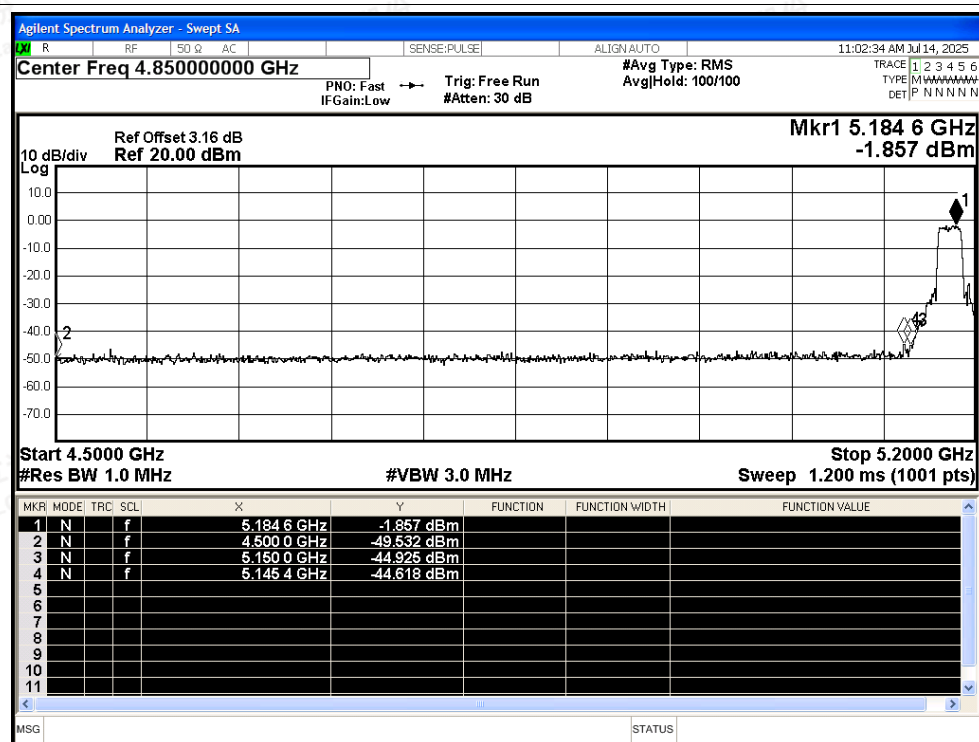

Restrict Band NVNT ax20 5180MHz Ant2 Average

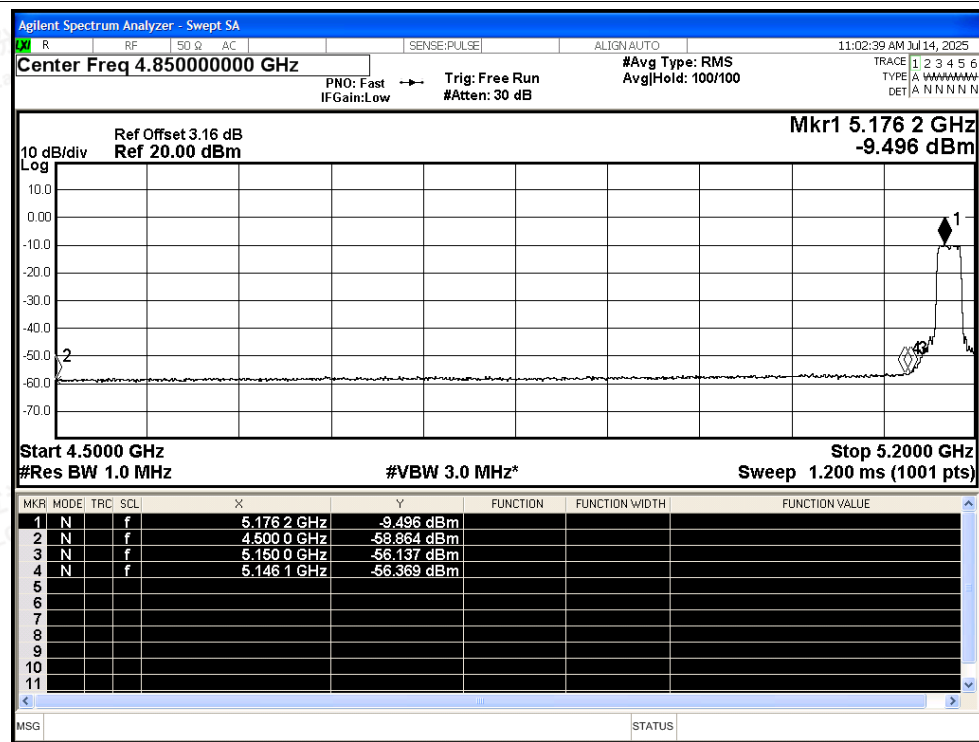

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5240MHz Ant2 Peak

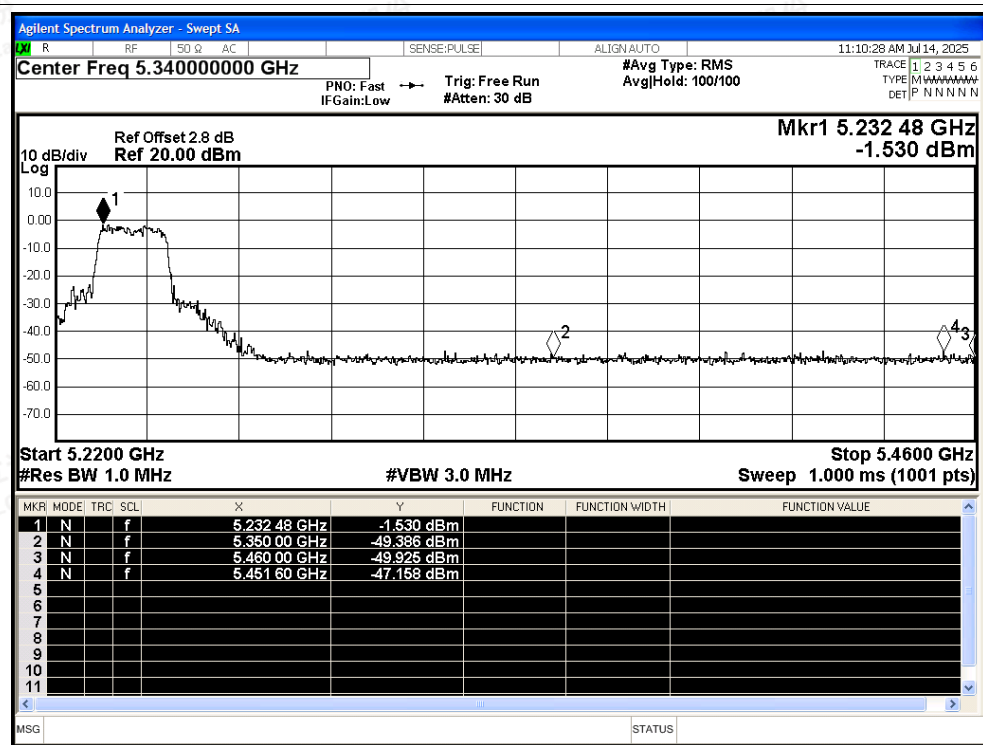

Restrict Band NVNT ax20 5240MHz Ant2 Average

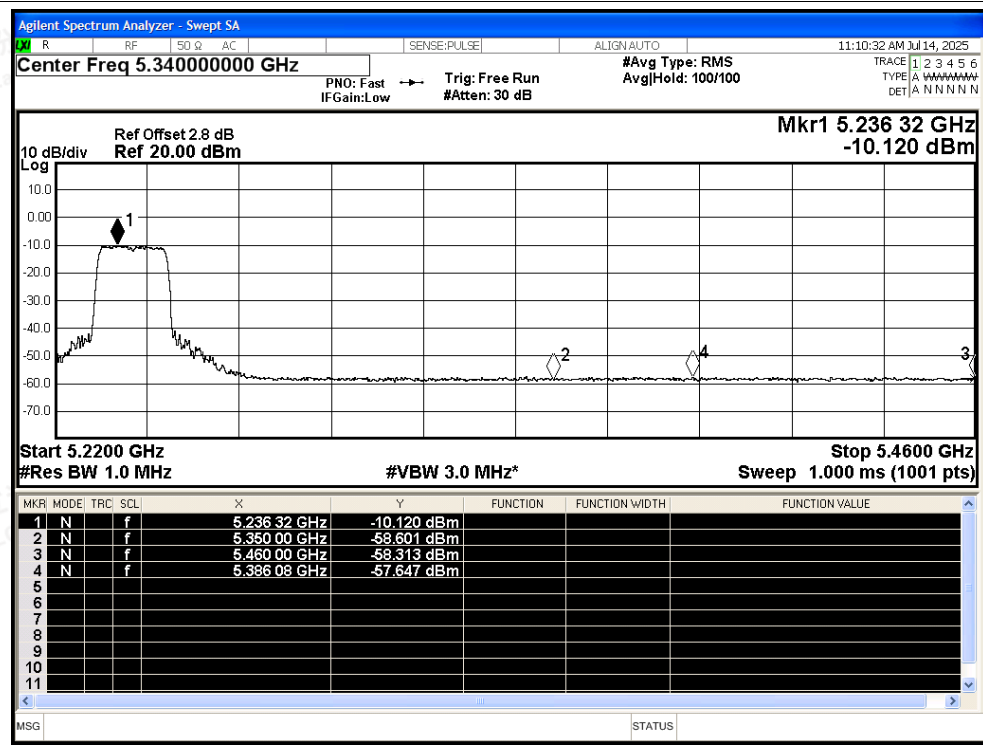

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity